









- Collaboration Spaces
- Exterior Upgrades
- Mechanical, Electrical, Plumbing Systems Upgrades
- New Marquees at Multiple Elementary Schools
- -Landscape Improvements



- Access Control
- Video Intercom
- New Camera System with Upgrade Interior & Exterior Devices
- Classroom Door Hardware
- Intrusion
- Fire Sprinkler System Upgrades



Technology

- Cabling
- Public Announcement System
- Bells
- Clocks

FREEMAN ELEMENTARY SCHOOL

cfbbond.com



- **Collaboration Spaces**
 - **Collaboration Spaces**
 - **New Maker Space**
- **Exterior Upgrades**
 - **Roof Repairs**
- Mechanical, Electrical, Plumbing, Systems **Upgrades**
 - **New HVAC and Controls**
 - **New LED Lighting in Gym**
 - **New LED Lighting in Parking Lots**
 - **Replaced Damaged Drinking Fountains**
- **New Marquees**
 - To be done over the oncoming months as part of this renovation package
- **Landscape Improvements**
 - **Replaced Playground Fall Protection New Site Furnishings**
 - **Restriped Parking Lot**

PROMISES MADE PROMISES KEPT





- **Collaboration Spaces**
 - **Collaboration Spaces**
 - **New Maker Space**
- **Exterior Upgrades**
 - **Roof Repairs**
- Mechanical, Electrical, Plumbing, Systems **Upgrades**
 - **New HVAC and Controls**
 - **New LED Lighting in Gym**
 - **New LED Lighting in Parking Lots**
 - **Replaced Damaged Drinking Fountains**
- **New Marquees**
 - To be done over the oncoming months as part of this renovation package
- **Landscape Improvements**
 - **Replaced Playground Fall Protection New Site Furnishings**
 - **Restriped Parking Lot**

PROMISES MADE PROMISES KEPT









- Collaboration Spaces
 - Collaboration Spaces
 - New Maker Space
- Exterior Upgrades
 - Roof Repairs
- Mechanical, Electrical, Plumbing, Systems
 Upgrades
 - New HVAC and Controls
 - O New LED Lighting in Gym
 - New LED Lighting in Parking Lots
 - Replaced Damaged Drinking Fountains
- New Marquees
 - O To be done over the oncoming months as part of this renovation package
- Landscape Improvements
 - Replaced Playground Fall Protection
 New Site Furnishings
 - Restriped Parking Lot

PROMISES MADE PROMISES KEPT















- Collaboration Spaces
 - Collaboration Spaces
 - O New Maker Space
- Exterior Upgrades
 - Roof Repairs
- Mechanical, Electrical, Plumbing, Systems
 Upgrades
 - New HVAC and Controls
 - O New LED Lighting in Gym
 - New LED Lighting in Parking Lots
 - O Replaced Damaged Drinking Fountains
- New Marquees
 - O To be done over the oncoming months as part of this renovation package
- Landscape Improvements
 - Replaced Playground Fall Protection
 New Site Furnishings Pending
 Completion of Drainage Work
 - Restriped Parking Lot

PROMISES MADE PROMISES KEPT



Site Furnishings –Winter 2022

Restriped Parking Lot



- Access Control
 - Video Intercom
 - **Card Readers**
 - o New Camera System
 - Classroom Door Locks
 - Intrusion Alarm
- Fire Sprinkler System Upgrades
- Bollards Pending Completion of Drainage Work









BONDUPDATES










Technology

- Cabling
- Public Announcement System
- o Bells
- o Clocks

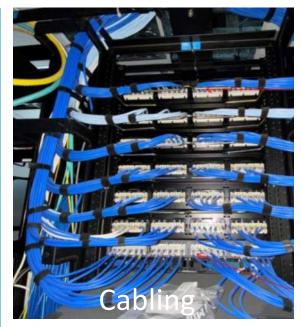





PROMISES MADE PROMISES KEPT



Freeman ES Assessment

Site: 82 Exterior: 89 Interior: 82 MEP: 90 Technology: 85

Score: 86

PROMISES MADE PROMISES KEPT



CFAC RECOMMENDATIONS



PROMISES MADE

ALL CFBISD SCHOOLS \$189.7m

Bring all CFBISD facilities to a minimum assessment score of 85*
Mechanical, electrical and plumbing (MEP)
Collaboration
Roofs, Exteriors and Finishes etc.



- **FCI Improvements**
 - **Finish Upgrades**
 - **New Resilient Flooring in Dining and Main Corridor**
 - **New Carpet in Select** Areas
 - **Plastic Laminate Wainscot**
 - **New Paint and Wayfinding Graphics**







| Building Element | Type/Material | Prior Condition | Current Condition | Description | Prior Comments | 2021 Reno Comments |
|---|------------------|-----------------|-------------------|--|--|--|
| On-Site Utilities & Drainage | | | | | | |
| Site Drainage / Erosion Control | | Poor | Good | Negative slope or drainage toward the building, severe erosion & visible ponding. | south has neg slope at building and erosion at parking lot | Work includes regrading, new concrete pours, and revised drainage plans to mitiage ponding |
| Site Lighting - Parking Lots | | Fair | Good | | , , , , , , , , , , , , , , , , , , , | Replaced lights in parking lot power poles |
| Exterior Concrete Pads & Pavement-Around building, me | chanical yards | Good | Good | | | |
| Fire Hydrants / Utility Vaults / Misc. | | Good | Good | | | |
| Grease Trap | | Fair | Fair | Insert assessment data from MEP Engineer | | |
| Site Parking & Drives | | | | | | |
| Pavement - Roads / Drives / Parking Areas | | Fair | Fair | Minor to Moderate cracking visible, joint sealer showing minor signs of wear. Little to no heaving. | | |
| Fire Lanes | | Fair | Fair | Minor to Moderate cracking visible, joint sealer showing minor signs of wear. Little to no heaving. Striping in fair condition. | | |
| Striping - Parking lot and fire lane | | Fair | Good | Minor to moderate signs of age and deterioration but still visible. Handicapped spaces incorrectly marked or striped. | | Repainted |
| Curbs | | Fair | Fair | Minor to moderate signs of age and deterioration, no major damage. | | |
| Site Lighting | | | | | - | · |
| | | Fair | Good | Very few fixtures have minor damage or are not working. Lighting | | |
| Site Lighting | | Tan | | is adequate for security. | lights are in good condition but more are needed on west facade | Replaced existing parking lot light fixtures |
| Site Security | | Control Control | Good | | Lance and the state of the stat | |
| Security Cameras | | Fair Good | Good | No decree to control and only only only on the control of | more cameras needed by playgorund and west end | |
| Chain Link Fencing / Gates Misc. Stuctures | | Good | Good | No damage to material and poles, gates are working properly. | | |
| Site Walls - Retaining / Screen | | N/A | N/A | | | |
| Oite Walls - Netalling / Octobri | | 14/71 | 14/7 | Moderate to Minor signs of damage to dumpster walls, may need a | | |
| | | Fair | | refresh of finish paint if applicable and additional bollards. Gates | | |
| Dumpster Service Area | | | | function as required. | screen wall needs to be repainted | |
| | | N/A | Good | | | |
| Bollards Material: | Concrete | | | | | Installation of new bollards at entry vestibule |
| Site Signage - Directional / Handicapped | Concrete | Good | Good | | | ilistaliation of new bollarus at entry vestibule |
| Misc. Site work / Site Structures | | Good | Good | | playground | |
| Circulation | | | | | p. 1. 3 2 2 2 2 2 2 2. | |
| Sidewalks | | Good | Good | Clean and clear of cracks or heaving. Joint Sealer is properly in place. | | |
| Stairs | | Good | Good | Clean and clear of cracks or heaving. Joint Sealer is properly in place. Rise and Run is compliant. Handrails (if present) are compliant & finish is in good standing. | | |
| SidiiS | | Good | Good | Clean and clear of cracks or heaving. Joint Sealer is properly in place. Slope is compliant. Handrails (if present) are compliant & | | |
| Ramps | | Good | Good | finish is in good condition. | | |
| ADA Compliance / Accessibility | | | | | | , |
| Compliant Sidewalks/Curbs | | Good | Good | | | |
| Compliant Ramps & Handrails | | Good | Good | | | |
| | Scored Categorie | es 20 | 21 | *Original site assessment did not asses draininage issues site wide | e. Changed from N/A to Poor resulting in a change from 86 to 82 | |
| | Goo | id 10 | 16 | | | |
| | Fa | ir 9 | 5 | | | |
| | Poo | or 1 | 0 | Assessment Score: | : 82 | |
| | N/ | A 2 | 1 | Score After Bond Improvements: | 92 | |
| | | | | | | |





| Building Element | Type/Material | Prior Condition | Current Condition | Description | Prior Comments | 2021 Reno Comments |
|---|---------------------------------|-----------------|-------------------|--|--|---|
| building Element | i ype/iviateriai | i noi Condition | Current Condition | Description | Thoi Comments | 2021 Nello Comments |
| Building Structure/Foundation | | | | | | |
| Foundation | Type: Crawlspace | Good | Good | No signs of cracking or heaving. | | |
| Substructure - Slab - on - Grade | | | | | | |
| Basement / Below Grade Exterior Walls | | N/A | N/A | | | |
| Miscellanous | | N/A | N/A | | | |
| Superstructure | | | | | | |
| Fireproofing | | N/A | N/A | | | |
| Pre-Engineered Metal building | | N/A | N/A | | | |
| Building Exterior Shell | | | | | | |
| Roofing | built up roof | | | | | |
| • | | | | Roof is nearing the end of it's expected useful life. Some leaks are reported with | 1 | |
| | | Fair | | areas of ponding. Some sealants and flashings are in need of repair or | | Minor roofing repairs completed to extend |
| General Roof Condition (Visual Inspection | on) | | | replacement. | | useful life |
| Roof Warranty Status | , | | | N/A | | |
| Roofing Manufacturer / Warranty | | | | | | |
| Issuer | | | | Johns Manville | | |
| Years Remaining in Warranty Perio | od | | | out of warranty 3 years | | |
| Skylights | | N/A | N/A | | | |
| | | Fair | Good | | | |
| Roof Curbs / Openings / Misc. | | 1 411 | | | | Replacement of damaged curbs as neede |
| Exterior Walls | | | | | | |
| Exterior Wall Material | Material: Brick | Good | Good | Veneer is free of cracks, signs of settling, rotation or damage. | | |
| | | Fair | Good | | | Exterior building sealant replaced as |
| Building Caulking/Sealant | | | | May show minor signs of aging, minor fading or stains. | | needed |
| Exterior Painting | | N/A | N/A | | | |
| Windows/Glazed Walls | | | | | | |
| Windows | | | | | | |
| | Glazing Type: Insulated | Good | Good | | | |
| | Frame Type: Aluminum | 0000 | | No visible damage, proper weatherproofing apparent. | | |
| Exterior Doors Systems | | | | | | |
| Exterior Doors | | | | | | |
| | Frame Type: Aluminum Storefront | Good | Good | No visible damage, proper weatherproofing/threshold apparent, door hardware | | |
| | Panel Type: | Good | | compliant and functioning properly. | | |
| Exterior Overhead Doors | Type: | | | | | |
| Card Access Reader | Yes | | | | | |
| Door Bell | Yes | | | | | |
| Peep Hole | No | | | | | |
| Canopies | _ | | | | | |
| | | Good | Good | No visible damage, proper weather coverage, finishes are almost new in | | |
| Canopy | Type: Attached to Building | G000 | Good | appearance. No signs of settling or movement. | insufficient drainage leaving residue on east wall | |
| Loading Area | | | | • | | |
| Raised Loading Dock | | N/A | N/A | | 0 | |
| Independent Loading Area | | N/A | N/A | | 0 | |
| Misc. Exterior | | | | | | |
| Exterior Soffit - Material | Material: Plaster | Good | Good | Almost new in appearance, no visible fading or stains. | | |
| Exterior Louvers / Sunscreens | • | | | • | | |
| | | · | | - | • | • |
| | Scored Categories | 9 | 9 | | | |
| | | | | *Original assessment evaluated skylights, which do not exist on the campus. O | riginal exterior assessment score was 86 | |
| | Good | 6 | 8 | | • | |
| | | | 1 | 4 | | |
| | Fair | 3 | 1 | | | |

Exterior

Good 6 8
Fair 3 1
Poor 0 0
N/A 8 8

Assessment Score: 89
Score After Bond Improvements: 96



| Building Element | Type/Material | Prior Condition | Current Condition | Description | Prior Comments | 2021 Reno Comments |
|---|--------------------|-----------------|-------------------|---|-----------------------------------|---|
| Interior Finishes | | | | | | |
| Interior Ceiling Finishes | | | | | | |
| · | Scrubbable | Good | Good | | | |
| Acoustical Ceilings - 2x2 Tiles | Finish Yes | Good | Good | Almost new in appearance, no signs of sagging, damage, leaks, or stains. | scrubbable in kitchen | |
| | Scrubbable | N/A | N/A | | | |
| Acoustical Ceilings - 2x4 Tiles | Finish | - | | | | |
| Plaster Ceilings | | N/A | N/A | | | |
| Painted Gypsum Ceiling | | N/A | N/A | | | |
| Metal Ceilings | | N/A | N/A | | | |
| Exposed / Painted Ceilings | | Good | Good | Almost new in appearance, no signs of sagging, damage, leaks, or stains. | | |
| Soffit / Bulkhead Walls | | N/A | N/A | | | |
| Special/Misc. | | N/A | N/A | | | |
| Interior Floor Finishes | | | | | • | |
| Resilient Flooring - Classroom Cooridors/Classrooms | | Good | Good | Almost new in appearance, no signs of damage or stains, properly sealed and finished. | | |
| Resilient Flooring - Main Cooridor, Cafeteria, Admin Spaces | | Fair | Good | Minor signs of aging with minimal apparent stains or damage, may need to be resealed. | | VCT Flooring replacement in main hallway and partial cooridors. Replacement flooring in Cafeteria |
| Quarry Tile | | Good | Good | Almost new in appearance, no signs of damage or stains, properly sealed and finished. | | |
| Ceramic Tile | | Good | Good | Almost new in appearance, no signs of damage or stains, properly sealed and finished. | kitchen | |
| Terrazzo | | N/A | N/A | and minores. | | |
| · · · · · · · · · · · · · · · · · · · | | | · | Almost new in appearance, no signs of damage or stains, properly sealed | | |
| Poured Resinous Epoxy | | Good | Good | and finished. | one bubble in gym | |
| Finish Concrete - (sealed) | | N/A | N/A | | | |
| | | Good | Good | Almost new in appearance, no signs of damage or stains, properly sealed | | |
| Carpet - Classrooms | | Good | | and finished. | has minimal snags | |
| Carpet - Library/Makerspace/Admin Suite | | Fair | Good | | | Replacement of carpet tiles in Library and Makerspaces |
| Natural Stone | | N/A | N/A | | | |
| Wood | | N/A | N/A | | | |
| Special/Misc. | | N/A | N/A | | | |
| Interior Wall Finishes | | | | | | |
| Painted Gypsum Board - Full Height | | Good | Good | Almost new in appearance, no signs of damage, stains or cracking. | | |
| Painted CMU - Full Height | | Good | Good | Almost new in appearance, no signs of damage, stains or cracking. | | |
| Painted Gypsum Board + Tile Wainscot | | Fair | Good | Minor signs of aging with minimal apparent stains, cracking or damage, may need minor touch up on finishes. | south wing has some cracks in gyp | Replacement of cracking wainscoating and repainting of gypsum board |
| Full Height Tile | | N/A | N/A | | 3,1 | |
| PLAM | | N/A | Good | | | Addition of laminate for coordior entry ways |
| FRP | | N/A | N/A | | | , , |
| Wood Panels | | N/A | N/A | | | |
| Interior Wall Base & Trim | | | | | | |
| Rubber Base - Library/Maker Space, Admin Suite, Corridor | | Fair | Good | Minor signs of aging with minimal damage and properly installed. | gym has minor tear in rubber base | Replacement of rubber bases a main cooridor, library, maker space, and admir suite |
| Rubber Base - Classrooms, Classroom Cooridors | | Fair | Fair | | | |
| Quarry Tile | | N/A | N/A | | | |
| Ceramic Tile | | Good | Good | Almost new in appearance, no signs of damage and properly installed. | | |
| Terrazzo | | N/A | N/A | | | |
| Poured Resinous Epoxy | | N/A N/A | N/A N/A | | | |
| Wood Base Misc. Interior | | IN/A | IN/A | | | |
| Interior Door Systems | | | | | | |
| Frame Type: | Hollow Metal | | | Minor scratches or signs of wear, may need a refresh of finish, door | | Repainting interior door frames and door replacements as |
| | I IUIIUW IVICIAI | Fair | Good | | | |
| | Hollow Metal | | | hardware is compliant and functioning properly | | heeded on classroom doors |
| Panel Type: Panel Type: Interior Overhead Door/Grille | Hollow Metal Type: | N/A | N/A | hardware is compliant and functioning properly. | | needed on classroom doors |

Interior



| | | | | 1 | | | |
|---|------------------|-------------------|-------|-------|--|----------------------|---|
| Millwork Cabinets | | | Fair | Good | | | Replacement of millwork in library, makerspace, and STEM classrooms |
| Corner Guards | Type: | | N/A | N/A | | | |
| Interior Signage - Classro | ooms | | Good | Good | some | missing exit signage | |
| Interior Signage - Classro Cooridors | | | Fair | Good | | | New signage for classroom coordiors |
| Digital Clocks | | | Fair | Good | | | Replacement of digital clocks |
| Operable Partitions | | | N/A | Good | | | Addition of operable wall in STEM classrooms |
| Markerboards and Tack E and Classroom Hallways | | | Fair | Fair | Some cracking or warping present. | | · |
| Markerboard and Tack Bo - Main Cooridor | oards | | Fair | Good | | | Replacement of takcboards and markerboards in ma cooridor |
| Projection Screens | | | Good | Good | | | |
| A/V Equipment | | | N/A | N/A | | | |
| Lockers Railings | | N/A | N/A | N/A | | | |
| Elevator Cab Finishes | | | N/A | N/A | | | |
| Wireless Access | | | Fair | Good | | | New cabling for wireless system |
| Toilet Partitions | Material Type: | Plastic | Good | Good | | | , |
| Toilet Accessories | ivialeriai Type. | i iastic | Good | Good | Almost new condition, proper installation. | | |
| Interior Window Blinds/Shades | Type of Blinds: | | | 3000 | Almost new condition, proper installation. | | |
| | Type of Shades: | | | | | | |
| Food Service Area | Operation: | | | | | | |
| | | | Fair | Good | | | Kitchen equipment repaired and replaced as needed |
| Equipment Condition | | | N/A | N/A | | | Kitchen equipment repaired and replaced as needed |
| Digital Menu Boards | 0 | | No No | No No | | | |
| Restrooms open to Kitche Drinking Fountains in Cafeteria? | en? | | No | No | | | |
| | | | | | | | |
| Accessibility | | | | | | | |
| Restrooms | | | Good | Good | Compliant | | |
| Drinking Fountains | | | Good | Good | Compliant | | |
| Ramps | | | Good | Good | Compliant | | |
| Signage | | | Good | Good | Compliant | | |
| Doors | | | Good | Good | | nobs in special ed | |
| Millwork | | | Good | Good | Compliant | | |
| | | | | | | | |
| | | Scored Categories | 35 | 37 | | | |

| Categories | 35 | 31 |
|------------|----|----|
| Good | 20 | 33 |
| Fair | 13 | 2 |
| Poor | 0 | 0 |
| N/A | 27 | 25 |

| Assessment Score: | 82 |
|-------------------------------|----|
| Scor After Bond Improvements: | 93 |

Interior



FREEMAN ELEMENTARY SCHOOL OPERATIONAL, SYSTEMS & CODE DEFICIENCIES

| | | | MEP Faci | lity Grade |
|------------------------|--|---|----------|------------|
| | Assessed Scope | Performed Scope | PRIOR | CURRENT |
| HVAC | Task: Replace Trane DX packaged units installed in 2003. | Task: Replaced Trane DX packaged units installed in 2003. | 85 | 98 |
| EMCS | Task: Replace Alerton controls installed with 2003 system; price included in HVAC replacement. | Task: Replaced Alerton controls installed with 2003 system. | | |
| PLUMBING | Task: Replace Lochinvar 200-gallon domestic boiler and tank installed in 2004. | Task: Scope completed before this summer | | |
| | Task: Provide new EWCs With bottle fillers in select locations. | Task: Provided new EWCs With bottle fillers in select locations. | 95 | 97 |
| | Task: Add redundant sump pumps under new addition. | Task: Item removed from project scope | | |
| ELECTRICAL SYSTEM | Task: | Task: | 95 | 95 |
| INTERIOR LIGHTING | Task: Provide tunable lighting for special education classrooms. Task: Item removed from project scope. | | 00 | 04 |
| | Task: Replace metal halide fixtures in gym with LED fixtures. | Task: Replaced metal halide fixtures in gym with LED fixtures. | 90 94 ED | |
| EXTERIOR LIGHTING | Task: Replace all existing exterior non-LED wall packs with LED fixtures. | Task: Replaced all existing exterior non-LED wall packs with LED fixtures. | 87 | 98 |
| | Task: Renovate all exterior parking lot lighting to LED. | Task: Renovated all exterior parking lot lighting to LED. | 67 98 | |
| FIRE ALARM SYSTEMS | Task: Replace Fire Alarm System. | Task: Replaced Fire Alarm System. | 75 | 100 |
| FIRE PROTECTION SYSTEM | Task: | Task: | 100 | 100 |
| | | | 90 | 97 |







Freeman ES Technology and Security Status

| System | Possible Score | Corgan Score (2018) | TNCG Score (2020) | Notes |
|--------------------------------|-------------------|------------------------|----------------------|---|
| Cabling Infrastructure | 10 | 8 | 8 | Upgrades done for wireless and major systems. |
| Local Area Network | 15 | 12 | 14 | |
| Wireless LAN | 15 | 12 | 14 | |
| Unified Comm (Phone) System | 10 | 9 | 10 | New phones installed and active |
| Video Management System | 10 | 7 | 10 | New high resolution cameras installed |
| Public Address | 10 | 8 | 10 | New Informacast PA System. Great Condition |
| Premise Access Control | 10 | 8 | 10 | Access controls at primary entrances and front office |
| Intercom System | 5 | 5 | 5 | New video intercom integrated to phone system |
| Special Space AV | 5 | 5 | 5 | |
| Instruction Space Presentation | 10 | 10 | 10 | New interactive displays matching district standard. |
| Total Score | 100 | 85 | 96 | |

Technology



Freeman ES Assessment

Site: 82 Exterior: 89 Interior: 82 MEP: 90 Technology: 85

Score: 86

PROMISES MADE PROMISES KEPT



After Bond Improvements

Site: 92 Exterior: 96 Interior: 93 MEP: 97 Technology: 96

Score: 95

ALL CFBISD SCHOOLS \$189.7m



Bring all CFBISD facilities to a minimum assessment score of 85*

Mechanical, electrical and plumbing (MEP)
Collaboration
Roofs, Exteriors and Finishes etc.