



Revised October 2, 2019 Loma Vista Environmental Sciences Academy 146 Rainer Street


School Data

| Date School Opened: | 1942 |
|--|--------|
| 2019 - 2020 Projected School Year Enrollment: | 452 |
| Standard Classrooms: | 17 |
| Portable Classrooms: | 8 |
| Classrooms Used for Other Programs: | 7 |
| Permanent Building Area: | 33,459 |
| Facility Capacity: | 477 |

Loma Vista Academy - Background information

Loma Vista Environmental Academy is a Kindergarten through 8th grade Magnet School dedicated to Environmental Sciences. It serves students from across Vallejo. The school is currently spread across two adjacent former elementary school campuses with a private street separating the two. It is also adjacent to a number of other District sites including the Solano K-8 School.

Loma Vista is a school where children grow, learn, and make and learn from mistakes on the road to reaching each student's highest potential. Loma Vista is also home to one of only two working farms in the county: the Loma Vista Farm is an outdoor classroom that provides children with standards based hands-on learning opportunities to bolster their academic skills in reading, writing, math, social science, language arts and science.

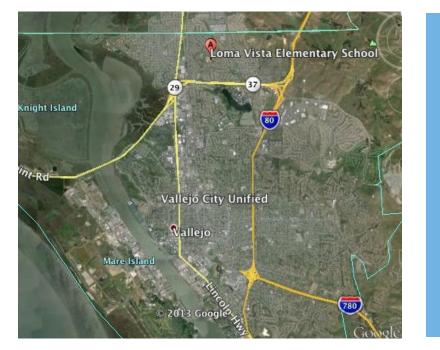



Loma Vista Environmental Sciences Academy - Existing Conditions Summary

Facilities Assessment Needs

- Code compliant identification signage is mostly missing throughout campus
- Accessibility issues include paths of travel to and throughout both campuses, restrooms, noncompliant door thresholds, signage, and sinks/sink cabinets at classrooms and administration
- Modular classroom buildings at South Campus are deteriorating in many areas and do not meet goals for learning environments. Recommend modernization or replacement
- Lighting and lighting controls are poor
- Foundation vent screens are damaged or missing
- Areas of campus are not connected: street runs through the middle
- Repair rusted areas and paint exterior finishes throughout.

Educational Program Needs

- STEM Lab space
- Small Group Instruction areas
- Security Fencing
- Create Library in central location

Unique Opportunities

- Exterior areas can be developed to create cohesive campus and learning areas
- Develop better connection to the adjacent farm







Loma Vista Environmental Sciences Academy - Master Plan Summary

Master Plan Features

- Construct addition to existing Multipurpose room to accommodate library, kitchen and Multipurpose functions.
- Construct new 8 classrooms wing with support spaces
- Develop outdoor learning areas: include seating and table areas
- Provide state of art barn at farm: learning areas and breeding/animal's life cycle

Selected Improvements by Theme

| | FACILITIES NEED THEME | IMPROVEMENT |
|----|--|---|
| | Campus Safety | Complete perimeter fencing with limited access points and upgrade remaining classroom locks. Extend clock/bell system to Farm. Provide new window blinds. |
| Ċ, | Accessibility | Upgrade ramps, drinking fountains, doors and other features to meet accessibility code requirements. Create an accessible path of travel to all classrooms and to farm. |
| - | Technology | Provide A/V system in classrooms, auditorium, MPR, and gym. Add wireless internet throughout the campus. Upgrade electrical, data, and security infrastructure as required. |
| 囚 | Science, Technology, Engineering, Mathematics (STEM) | Repurpose 2 general use classrooms to accommodate STEM Lab with outdoor work area. |
| Ē | Community Schools | Create additional meeting rooms on campus. Support community use of Library/Multipurpose building. New exterior painting, playground equipment and paving. New classroom furniture. |
| | Infrastructure | Replace mechanical units with energy efficient models throughout campus. Replace and upgrade roofing. Replace or repair utilities where needed. Modernize restrooms. |


Loma Vista Environmental Academy - Educational Program Needs:

STEM Lab

- Flexible room designed to be used by the entire campus community for science labs, project-based learning and other activities
- Amenities include storage cabinets, perimeter cabinetry with sinks and a connected outdoor work area
- Durable surfaces throughout
- Durable, moveable furniture to easily accommodate a variety of uses
- Wired and wireless internet access and two A/V systems for presentations
- Secure storage room with sink, shelving, computer storage and ice maker

Additional Educational Program Needs

- Outdoor learning areas throughout campus
- Small Group Instruction and collaborative workspaces incorporated into classrooms
- Display areas for student work at corridors, library, and Multipurpose
- Improve access to Farm
- Connect Olympic Ave and Rainier Ave sides of campus
- Centrally located Multi-purpose room with performance capacity
- Centralized Library

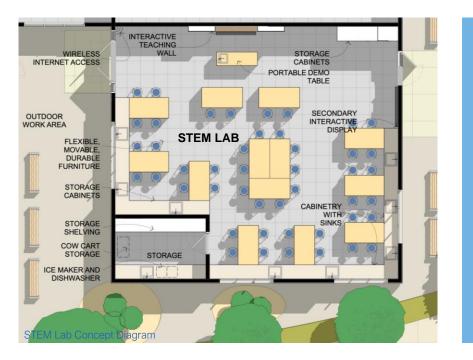

Learning Environment Improvements

- Replace interior finishes
- Upgrade existing lighting and controls
- Replace heating and cooling equipment, upgrade insulation
- Replace existing portable classrooms with new building
- Upgrade Classroom technology infrastructure
- Address Accessibility issues

Loma Vista Environmental Sciences Academy- Committee Facilities Improvement

The Master Plan Committee provided their recommendation on the priority of improvements with in the three categories for use in future decision making. These recommendations will be considered along with other factors when scheduling projects as funding becomes available.

Current Facilities Needs (CFN)

- Accessibility throughout needs to be brought up to current codes: doors, drinking fountains, toilet rooms, exterior path of travel-including farm, paths of travel to all rooms, identification and way finding signage
- Wheelchair accessibility at Farm is limited to kitchen
- Sidewalks at farm: not navigable, tripping hazard
- Perimeter fencing needs to be repaired and completed to include farm, with access gate. Fence at East road needs to be much higher
- Campus very open: need to create one point of entry during the day, community access in the evenings and weekends
- Eliminate access by Solano Students cutting through campus
- Need blackout curtains window coverings
- Connect farm to rest of campus alarm system(security)
- Clock/bells and PA system needs to be upgraded

Educational Program Needs (EPN)


- Paint needed throughout at both interior and exterior areas
- Replace interior finishes
- Protect HVAC thermostats (and all controls) from student access
- Farm has no technology, data port connectivity
- Restrooms inadequate, need restrooms w/access to outside play area
- More restrooms are needed at farm
- Need covered walkway to cafeteria
- Technology-need Smart Boards as well as white boards

Vallejo City Unified School District Facilities Master Plan

- Ceiling mounted projectors
- Drainage issue at farm: irrigation required at orchard; leaking pipes leading to orchard; city water.
- Pond seepage at Farm needs to be dredged and upgraded, needs CEQA determination

Future Facilities Needs (FFN)

- Create central Library/Multipurpose to accommodate full student body
- Need Performance venue
- Develop outdoor learning areas, include seating and table areas
- Amphitheater desired for outdoor gathering
- State of art barn at farm: learning area and breeding/animal's life cycle
- Kitchen in school
- Meeting spaces needed
- Shop facilities i.e. wood shop, metal shop, etc.
- Gym and locker rooms maybe at Eucalyptus grove
- Parent resource room location is too remote from office- sign in is required

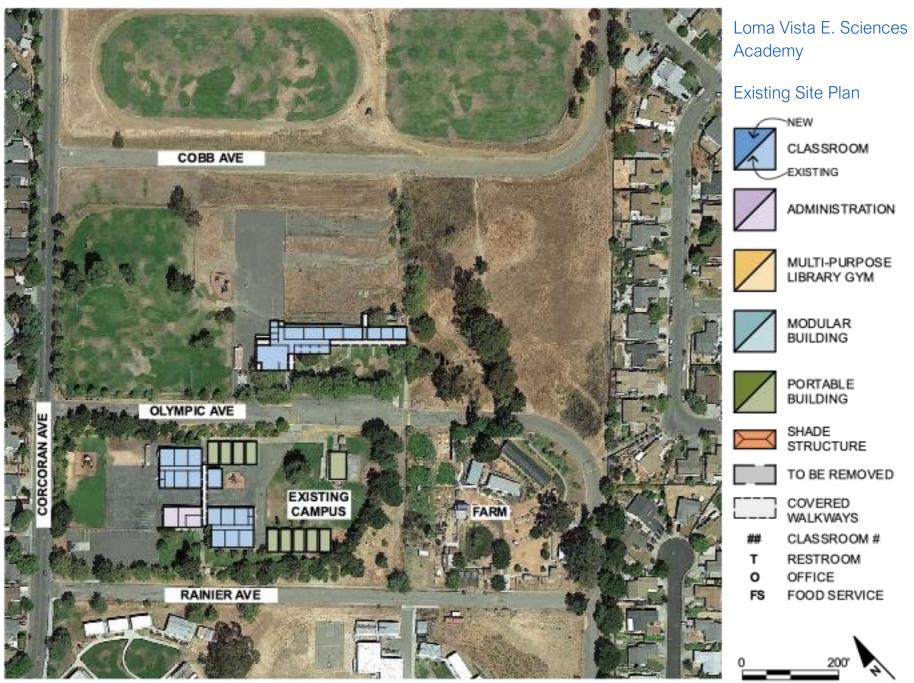



Loma Vista E. Sciences Academy

Existing Building Plan



CLASSROOM



ADMINISTRATION



MULTI-PURPOSE LIBRARY GYM



MODULAR BUILDING



PORTABLE BUILDING



STRUCTURE


TO BE REMOVED




CLASSROOM

- T RESTROOM
- O OFFICE

FS FOOD SERVICE

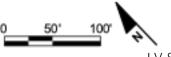

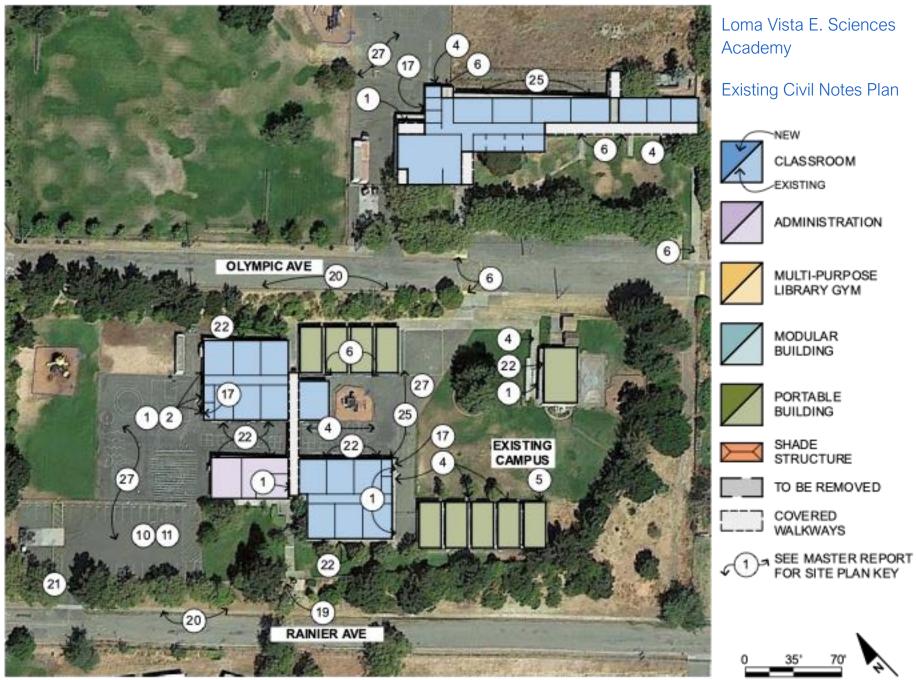



Loma Vista E. Sciences

Academy

Loma Vista Environmental Sciences Academy Preliminary Cost Estimate

146 Rainer Street, Vallejo, CA 94589 707/556-8550

| | | | # Classrooms: | 17 | |
|---|--------------------|---------------------|--------------------|----|---------------|
| | | | # Portables: | 8 | |
| | CFN | EPN | FFN | | Grand Total |
| Construction Costs | \$ 4,306,592.03 | \$ 19,955,540.90 | \$ 1,873,500.00 | \$ | 26,135,632.93 |
| | | | | | |
| Sub-Total | \$ 4,306,592.03 | \$ 19,955,540.90 | \$ 1,873,500.00 | \$ | 26,135,632.93 |
| Design Contingency (0%) | \$ - | \$ - | \$ - | \$ | - |
| | | | | | |
| Sub-Total | \$ 4,306,592.03 | \$ 19,955,540.90 | \$ 1,873,500.00 | \$ | 26,135,632.93 |
| General Contractor OHP (12%) | \$ 516,791.04 | \$ 2,394,664.91 | \$ 224,820.00 | \$ | 3,136,275.95 |
| General Contractor Insurance (2%) | \$ 86,131.84 | \$ 399,110.82 | \$ 37,470.00 | \$ | 522,712.66 |
| | | | | | |
| Sub-Total | \$ 4,909,514.91 | \$ 22,749,316.63 | \$ 2,135,790.00 | \$ | 29,794,621.54 |
| Soft Costs: Change Order Contingency, A/E Fees, | | | | | |
| Inspection, Management Fees, etc. (35%) | \$ 1,718,330.22 | \$ 7,962,260.82 | \$ 747,526.50 | \$ | 10,428,117.54 |
| | | | | | |
| Sub-Total | \$ 6,627,845.13 | \$ 30,711,577.45 | \$ 2,883,316.50 | \$ | 40,222,739.08 |
| Escalation (18%) | \$ 1,193,012.12 | \$ 5,528,083.94 | \$ 518,996.97 | \$ | 7,240,093.03 |
| | | | | | |
| Grand Total | \$ 7,820,857.26 | \$ 36,239,661.39 | \$ 3,402,313.47 | \$ | 47,462,832.11 |

Square Footage (Bldg. only): 40,111 # Classrooms: 17

| CODE | DISCIPLINE | LOCATION | | DESCRIPTION | SITE PLAN KEY | РНОТО | ESTIM/ TAKE | OFF | CO | COST/ UNIT | | OTAL COST |
|------|------------------------|----------|------------|---|---------------|-------|----------------|------|-----|------------|----|------------|
| | | | | SITE ISSUES | N N | | Qty. | Unit | | | | |
| | | | Deficiency | Site utilities are nearing the end of their useful life | | | | | | | | |
| CFN | Site Utilities | Site | Remedy | Replace underground utility lines | | | 1 | ls | \$9 | 950,000.00 | \$ | 950,000.00 |
| | | | Deficiency | Landing at Door/Ramp exceeds 2% Slope at 6 locations throughout site. | | | | | | | | |
| CFN | Accessibility Issue | Site | Remedy | Saw cut, remove and replace Landings. Estimated 50 sf ea. landing | 1 | 12 | 250 | sf | \$ | 40.00 | \$ | 10,000.00 |
| | | | Deficiency | Non-compliant Door threshold at 1 location throughout site. | | | | | | | | |
| CFN | Accessibility Issue | Site | Remedy | Remove and replace with compliant threshold. | 2 | | 1 | ea | \$ | 1,500.00 | \$ | 1,500.00 |
| | | | Deficiency | Cross slope on path of travel exceeds 2% at 7 locations throughout site. | | | | | | | | |
| CFN | Accessibility Issue | Site | Remedy | Remove and replace section of walkway that is non- compliant. Estimate of 250 sf ea. occurrence. | 4 | | 1750 | sf | \$ | 40.00 | \$ | 70,000.00 |
| | | | Deficiency | Slopes on path of travel > 5% without handrails at 1 location. | | | | | | | | |
| CFN | Accessibility Issue | Site | Remedy | Remove and replace ramp with slopes < 5% or provide handrails for ramp as required path of travel. | 5 | | 100 | sf | \$ | 40.00 | \$ | 4,000.00 |
| | | | Deficiency | Slopes on path of travel > 8.33% at 8 locations. | | | | | | | | |
| CFN | Accessibility Issue | Site | Remedy | Remove ramp and construct code compliant ramp | 6 | 15 | 800 | ea | \$ | 40.00 | \$ | 32,000.00 |
| | | | Deficiency | Non-compliant accessible Parking signage. | | | | 1 | | | | |
| CFN | Accessibility Issue | Site | Remedy | Provide code compliant signage. | 10 | | 1 | ea | \$ | 100.00 | \$ | 100.00 |

| CODE | DISCIPLINE | LOCATION | | DESCRIPTION | SITE PLAN KEY | РНОТО | ESTIM/ TAKE | | COS. | COST/ UNIT | | COST/ UNIT | | OTAL COST |
|------|------------------------|----------|----------------------|---|---------------|----------|-------------------|---------|-------------|------------|----|------------|--|-----------|
| CFN | Accessibility Issue | Site | Deficiency Remedy | Slopes exceed 2% in any direction on accessible parking stall or loading area. Repave accessible parking area to provide maximum of 2% cross slope or relocate accessible parking. | ග 11 | | Qty. 100 | ea | \$ | 30.00 | \$ | 3,000.00 | | |
| CFN | Accessibility Issue | Site | Deficiency Remedy | Accessible drinking fountain not provided. Provide code compliant approved drinking fountain. | 17 | | 40111 | sf | \$ | 0.30 | \$ | 12,033.30 | | |
| CFN | Accessibility Issue | Site | Deficiency Remedy | No Accessible route to public right of way. Provide code compliant accessible route to public right of way | 19 | | 1 | ea | \$ 2 | 2,500.00 | \$ | 2,500.00 | | |
| CFN | Accessibility Issue | Site | Deficiency Remedy | No Accessible drop off area provided Provide accessible drop off area | 20 | | 1 | ea | \$ 7 | 5,000.00 | \$ | 75,000.00 | | |
| CFN | Accessibility Issue | Site | Deficiency Remedy | Non-compliant/missing accessible signage at parking lot entry Provide code compliant signage | 21 | | 1 | ea | \$ | 100.00 | \$ | 100.00 | | |
| CFN | Fire & Life Safety | Site | Deficiency Remedy | Inadequate fire protection. Provide additional fire hydrants on site. | 25 | | Cost i | ncluded | l in Site L | Itilities | \$ | - | | |
| CFN | Accessibility Issue | Site | Deficiency Remedy | Non-accessible Door landing at 11 locations for secondary access points. Remove and replace with compliant access if required. | 3 | 13 14 | 11 ea \$ 1,500.00 | | | | \$ | 16,500.00 | | |
| EPN | Electrical | Site | Deficiency Remedy | Repairs and Upgrades to electrical and Security Systems | | | 1 | ls | \$ 46 | 1,276.50 | \$ | 461,276.50 | | |

| CODE | DISCIPLINE | LOCATION | 다. 이 전 10 10 10 10 10 10 10 10 10 10 10 10 10 | | TAKE OFF | | TAKE OFF | | TAKE OFF | | TAKE OFF | | TAKE OFF COST/ UNIT | | | OTAL COST |
|------|----------------------|---|---|---|-----------|------------|-------------|----------|----------|-------------|----------|--------------|---------------------|--|--|-----------|
| EPN | Paving & Grading | Site | Deficiency Remedy | Pavement broken or failing. Remove existing paving and base and replace full paving section. | 26 | | Cost inc | luded in | Parkir | ng Lot cost | \$ | - | | | | |
| EPN | Paving & Grading | Site | Deficiency Remedy | Pavement worn or cracked. Fill cracks, slurry seal surface and repaint as necessary | 27 | | Cost inc | luded in | Parkir | ng Lot cost | \$ | - | | | | |
| EPN | Plumbing | Site | Deficiency Remedy | Drainage blocked with debris | 28 | | Routi | ne Main | tenanc | e Issue | \$ | - | | | | |
| FFN | Site | Olympic Avenue | Need | Develop upper "Quad" area with amphitheater seating, gathering areas, grading | | | 3200 | sf | \$ | 50.00 | \$ | 160,000.00 | | | | |
| | | | | GENERAL & CAMPUS-WIDE ISSUES | | | | | | | | | | | | |
| | Asses | sment is for area | - | ot part of the Summer 2013 project which was under con | struction | n at the t | ime of this | s asses | sment | (Classroon | n 4-7) | | | | | |
| CFN | Accessibility | Campus-wide | Deficiency Remedy | Identification and way finding signage lacking Campus-wide signage program | | 07 | 40111 | sf | \$ | 0.50 | \$ | 20,055.50 | | | | |
| CFN | Roofing | Campus Buildings | Deficiency Remedy | Roofing in need of replacement Replace Asphalt BUR/Metal roof | | | 1 | ls | \$ 1,0 | 027,152.00 | \$ | 1,027,152.00 | | | | |
| CFN | Exterior Envelope | Office/Admin, Wings 32-40, 10-22, CR35 | Deficiency Remedy | Metal tube framing with painted plywood or transite infill panels providing exterior and interior wall: no insulation Provide exterior insulating infill panels with thermal break at tube framing, or other means of insulation | | | 40111 | sf | \$ | 4.00 | \$ | 160,444.00 | | | | |
| CFN | Doors | Office/Admin, Wings 32-40, 10-22: | Deficiency Remedy | Weather stripping damaged or missing on exterior doors Provide new weather-stripping and door sweeps throughout | | | 30 | ea | \$ | 125.00 | \$ | 3,750.00 | | | | |
| CFN | Doors | Office/Admin, Wings 32-40, 10-22: | Deficiency Remedy | Doors damaged, worn, some lites have plywood panels Provide new extra heavy-duty doors with high security glazing | | | 3 | pr | \$ | 1,300.00 | \$ | 3,900.00 | | | | |

| CODE | DISCIPLINE | LOCATION | | DESCRIPTION | SITE PLAN KEY | РНОТО | ESTIM/ TAKE Qty. | | COST/ UNIT | T | DTAL COST |
|------|----------------------|---|----------------------|--|---------------|-------|------------------------|----|---------------|----|------------|
| CFN | Exterior Envelope | Office/Admin, Wings 32-40, 10-22: | Deficiency Remedy | Foundation vents missing, mismatched or damaged screens Replace all | | 01 | 40111 | sf | \$ 0.25 | \$ | 10,027.75 |
| CFN | Accessibility | Office/Admin | Deficiency Remedy | Accessibility issues within building include access to restrooms and staff room Reconfigure to provide access to restroom and to staff room | | | 6 | ea | \$ 2,500.00 | \$ | 15,000.00 |
| CFN | Site Security | Campus-wide | Deficiency Remedy | Secure perimeter fencing is needed Perimeter fencing needs to be repaired and completed to include farm a. Include gate access periodically b. Fence height at east road needs to be higher – possibly up to 10 ft. | | | 1 | ls | \$ 45,000.00 | \$ | 45,000.00 |
| CFN | Mechanical | Campus-wide | Deficiency Remedy | Mechanical Upgrade needed Protect HVAC thermostats (and all controls) from student access District wide mechanical replacement, including Farm | | | 1 | ls | \$ 553,531.80 | \$ | 553,531.80 |
| EPN | Site | Olympic Ave | Deficiency Remedy | Restrooms inadequate, need restrooms w/access to outside play area at upper campus Additional Restrooms provided in master planning section | | | na | na | \$- | \$ | - |
| EPN | Windows | Office/Admin Wing 32-40, 10-22 | Deficiency Remedy | Windows single pane aluminum, operable but in poor condition: not thermally broken Replace with dual pane aluminum, operable, thermally broken | | | 40111 | sf | \$ 12.00 | \$ | 481,332.00 |

| CODE | DISCIPLINE | LOCATION | | DESCRIPTION | SITE PLAN KEY | РНОТО | ESTIMATED TAKE OFF Qtv. Unit | | | | тс | TAL COST | | |
|--------------------------|-----------------------------------|--------------------------------------|----------------------|--|---------------|-------|---|------|---------------------------|----------------------------------|----|------------|----|---|
| EPN | Electrical | Site Lighting | Deficiency Remedy | Rice Paddy Hat' site light fixtures tops appear dented or warped Repair or replace fixture and housing at existing pole standards with energy efficient fixtures | SIT | | Qty. 1 | Unit | \$ 25,0 | 00.00 | \$ | 25,000.00 | | |
| EPN | Electrical | Office/Admin | Deficiency Remedy | Some exterior lights on during the day Provide daylight sensing controls | | 06 | Cost included in Electrical cost | | | Cost included in Electrical cost | | | \$ | - |
| EPN | Exterior Envelope | Office/Admin | Deficiency Remedy | Paint needed throughout at exterior Paint entire campus | | | 40111 | sf | \$ | 1.00 | \$ | 40,111.00 | | |
| EPN | Walls and Finishes Flooring | Office/Admin Wing 32-40, 10-22 | Deficiency Remedy | Interior finishes are worn, damaged, dirty Replace all interior finishes: walls, flooring, ceilings | | | 40111 | sf | \$ | 1.00 | \$ | 40,111.00 | | |
| EPN | Walls and Finishes | Olympic Ave | Deficiency Remedy | Interior finishes are worn, damaged, dirty Patch, repair, paint interior finishes: maintain wood paneled walls | | 08 | Cost included in Interior Finishes cost | | | ishes | \$ | - | | |
| EPN | Siding | Wing 32-40 Plus CR35 | Deficiency Remedy | Siding: Metal tube framing with painted metal or plywood faced insulated panels providing exterior and interior wall. Metal battens are coming loose Repair or replace all damaged areas | | 02 | Cos | | ed in Exterio ope cost | r | \$ | - | | |
| EPN | Technology | Campus-wide | Deficiency Remedy | Need Smart Boards or equivalent but keep white Boards, Ceiling mounted projectors or equivalent Farm has no technology, data port connectivity District wide technology upgrade, including Farm | | | 40111 | sf | \$ | 3.00 | \$ | 120,333.00 | | |
| RAINER AVENUE CLASSROOMS | | | | | | | | | | | | | | |

| CODE | DISCIPLINE | LOCATION | | DESCRIPTION | SITE PLAN KEY | РНОТО | - | | | | | TAKE OFF COST/ UNIT | | ST/ UNIT | то | TAL COST |
|------|------------------------------|-------------------------|----------------------|---|---------------|-------|--|----------------------------------|-------------------|----------------------|----|---------------------|--|----------|----|----------|
| CFN | Siding | Wing 32-40 Plus CR35 | Deficiency Remedy | Plywood faced siding panels severely damaged at southeast corner Replace panels | | 03 | Cos | t includ envelo | ed in E pe cos | | \$ | - | | | | |
| CFN | Exterior Envelope | Wing 32-40 Plus CR35 | Deficiency Remedy | Rust at utility box at north corner of building has spread into adjacent building panels and foundation, rust apparent at other exterior surface mounted utility boxes | | | | | | xterior echanical | \$ | - | | | | |
| CFN | Soffit | Wing 32-40 Plus CR35 | Deficiency Remedy | Metal frame rusted and plywood soffit shows water damage Locate leak and repair, remove rust, repair and repaint soffit panels | | 04 | Cost included in Exterior Door cost | | | | | | | | | |
| CFN | Exterior Envelope | Wing 32-40 Plus CR35 | Deficiency Remedy | Metal underside of covered walkways between Wing 32 and Clsrm 35 has peeling paint Repair and refinish | | | 10000 | 10000 sf \$ 4.25 | | | | 42,500.00 | | | | |
| CFN | Accessibility | Wing 32-40 Plus CR35 | Deficiency Remedy | CR 35 entry door stoop is 4' x 4' with 7 1/2" step up and site utility boxes very close to edge of stoop. signage is at the non-accessible entry door Master Plan goals remove this classroom. | | | 1 | ea | \$ | 1,500.00 | \$ | 1,500.00 | | | | |
| CFN | Electrical, Accessibility | Wing 32-40 Plus CR35 | Deficiency Remedy | CR 35 Lighting controls are only at the opposite, accessible door, Lighting: Typical CR: 2X4 fixtures in suspended acoustical ceiling. Switched in rows at accessible entry: rows run perpendicular to the windows | | | Cost in | Cost included in Electrical cost | | \$ | - | | | | | |
| CFN | Accessibility | Wing 32-40 Plus CR35 | Deficiency Remedy | 4 utility access boxes within 2' of the stoops (3 are within 6"). Until building is removed, locate signage at the accessible door, provide directional signage to that door (cost for signage only) | | | 2 ea \$ 100.00 | | | | \$ | 200.00 | | | | |

| CODE | DISCIPLINE | LOCATION | | DESCRIPTION | SITE PLAN KEY | РНОТО | - | ESTIMATED TAKE OFF COST/ UNIT | | | то | TAL COST |
|------|---------------------|-------------|----------------------|--|---------------|-------|--|----------------------------------|------------------|------|----|-----------|
| | | _ | | | L S | | Qty. | Unit | | | | |
| CFN | Accessibility | Wing 32-40 | Deficiency | Exit door (with Exit signage) at end of corridor in enclosed wing leads to 4'X4' stoop at + / -9" above adjacent grade Provide accessible landing and path of travel to play area | | | 1 | ea | \$ 1,500 | 0.00 | \$ | 1,500.00 |
| | | | , | | | | | | | | | |
| | | Wing 32-40 | Deficiency | Door frames direct to exterior have been retrofitted to accommodate closer (rms 35) | | | Cost ir | cluded | in Exterior Do | or | | |
| EPN | Doors | Plus CR35 | Remedy | Provide new doors and closers | | | Cost included in Exterior Door cost | | | | \$ | - |
| | | | | OLYMPIC AVENUE CAMPUS | | 1 | | | | | | |
| CFN | Doors | Olympic Ave | Deficiency Remedy | Some interior doors damaged: girl's toilet room, Room 1 & 2 - wood frame in very poor condition. Door ratings inconsistent Room1 has rated door in wood frame, PT office non-rated door Provide consistent, code compliant doors and frames | | | 8 ea \$ 1,300.00 | | | | \$ | 10,400.00 |
| CFN | Window coverings | Olympic Ave | Deficiency Remedy | Vertical blinds, many broken, need blackout curtains – Campus-wide window covering program | | 09 | 40111 | sf | \$ (| .88 | \$ | 35,297.68 |
| CFN | Electrical | Olympic Ave | Deficiency Remedy | MU - 2-tube fluorescent fixtures, no lenses, controls are scattered among exterior doors and are at 6'-0" and higher Provide lenses, relocate and repair controls | | | Cost ir | ncluded | in Electrical co | ost | \$ | - |
| CFN | Technology | Olympic Ave | Deficiency Remedy | PA system in Multi Use is ancient, farm is not connected to campus alarm system Campus-wide upgrade of clock/bell/speaker system | | | Cost ir | ncluded | in Electrical co | ost | \$ | - |
| CFN | Accessibility | Olympic Ave | Deficiency Remedy | 1" threshold at exit to play area from corridor and MU, 2" threshold at custodial room housing water heater Provide accessible landing and slope to adjacent areas | | | 1 ea \$ 2,500.00 | | | 0.00 | \$ | 2,500.00 |

| CODE | DISCIPLINE | LOCATION | | DESCRIPTION | SITE PLAN KEY | РНОТО | TAKE | ESTIMATED TAKE OFF COST/ UNIT | | | | DTAL COST |
|------|------------------------|-------------------------------------|----------------------|---|---------------|-------|---|----------------------------------|----|----------|----|------------|
| | | | | | ୍ଘ' | | Qty. | Unit | | | | |
| CFN | Plumbing | Campus-wide | Deficiency Remedy | Exterior DF non-compliant Replace with compliant DFs at same locations | | 02 | Cos | t include Fount | | | \$ | - |
| CFN | Accessibility | Room 26 Parent Resource: | Deficiency Remedy | 2" threshold at entry Buildings recommended to be removed in Master Plan: if kept provide access compliant ramp, landing and entry | | | 1 | 1 ea \$ 5,000.00 | | | | 5,000.00 |
| CFN | Accessibility | Modular Buildings Room 46, 17 | Deficiency Remedy | Existing prefab ramps are not compliant: reach 21" high in less than 12' Buildings recommended to be removed in Master Plan: if kept, replace with compliant ramp and landing at entry | | | 2 | ea | \$ | 5,000.00 | \$ | 10,000.00 |
| EPN | Windows | Olympic Ave | Deficiency Remedy | Primarily single pane aluminum windows, operable, in wood frames. Deep sills are nice. Install dual pane windows or provide low-e film | | | Cost included in Window cost | | | \$ | - | |
| EPN | Walls and finishes | Olympic Ave | Deficiency Remedy | Acoustical wall treatment needed at MU: existing walls are painted plywood. Some acoustical treatment does exist at ceiling Provide acoustical treatment at walls, paint plywood areas | | | Cost included in Acoustical Wall finish cost | | | \$ | - | |
| EPN | Walls and finishes | Olympic Ave | Deficiency Remedy | Classroom walls painted plywood with + / - 20'X4' tackable bulletin board, no acoustical treatment Provide acoustical wall treatment | | 10 | 40111 | sf | \$ | 3.40 | \$ | 136,377.40 |
| EPN | Flooring, wall base | Olympic Ave | Deficiency Remedy | VCT in good condition at classrooms except at perimeter. Poor condition at corridor. Wall base in poor condition. Replace all Wall base Replace VCT at corridors and at classrooms 1, 2, 3 | | | Cost included in Flooring cost | | | | \$ | - |

| CODE | DISCIPLINE | LOCATION | | DESCRIPTION | SITE PLAN KEY | РНОТО | ESTIMATED TAKE OFF Qty. Unit | CO | ST/ UNIT | тс | ITAL COST | | | |
|------|----------------------------|--------------------------------|----------------------|---|---------------|-------|------------------------------------|---|------------|----|------------|--|--|---|
| EPN | Electrical | Olympic Ave | Deficiency Remedy | Room 1 linear surface mounted fluorescent, many broken lenses. Controls unknown-only center switch of 3 is functional Provide new lenses, repair controls | | | Cost included | in Elect | rical cost | \$ | - | | | |
| EPN | General | Room 26 Parent Resource: | Deficiency Remedy | No acoustical separation from adjacent (Preschool?) room Buildings recommended to be removed in Master Plan | | | | Cost included in Master plan changes | | | | | | - |
| | 1 | | • | RESTROOMS | T | T | | - | | | | | | |
| | Restrooms | Campus wide | | Full upgrade to all campus restrooms | | | 1588 sf | \$ | 575.00 | \$ | 913,100.00 | | | |
| CFN | Accessibility, Plumbing | Wing 32-40 Plus CR35 | Deficiency Remedy | Boys/Men's adjacent to Room 32 has 3" threshold. Unable to access, possible that door is rusted shut. Repair | | | Cost included | in Restr | \$ | - | | | | |
| CFN | Accessibility, Plumbing | Wing 32-40 Plus CR35 | Deficiency Remedy | Girls adjacent to Room 32 has 2" threshold, non- accessible stall Reconfigure within same footprint: Probably could be made accessible via losing one stall | | 11 | Cost included | in Restr | oom Cost | \$ | - | | | |
| CFN | Accessibility, Plumbing | Wing 32-40 Plus CR35 | Deficiency Remedy | Toilet rooms inside corridor: Doors have 16" clearance at push side, entry alcove in direction of door swing is 4'-0" (needs to be 5'-0") Reconfigure door location: may need to eliminate alcove: may need to provide unisex toilet room | | | Cost included | in Restr | oom Cost | \$ | - | | | |
| CFN | Maintenance | Wing 10-22 | Deficiency Remedy | Girls toilet room adjacent to Room 22 smells bad Investigate source of smell, thoroughly clean all finishes | | | Routine Mai | ntenanc | e Issue | \$ | - | | | |
| CFN | Doors | Wing 10-22 | Deficiency Remedy | Girls toilet room adjacent to Room 22 door is in extremely poor condition with gaps at frame, rusted louver Replace doors/louvers | | | Cost included | in Restr | oom Cost | \$ | - | | | |

| CODE | DISCIPLINE | LOCATION | | DESCRIPTION | SITE PLAN KEY | РНОТО | ESTIMA TAKE Qty. | | со | ST/ UNIT | тс | DTAL COST |
|------|----------------------------|-------------|----------------------|---|---------------|-------|--------------------------------|----------|---------|----------|----|------------|
| CFN | Accessibility, Plumbing | Wing 10-22 | Deficiency Remedy | Girls toilet room adjacent to Room 22 entry passage non accessible at 3'-9" wide. Stall size ok | | | Cost included in Restroom Cost | | | | \$ | - |
| CFN | Accessibility, Plumbing | Olympic Ave | Deficiency Remedy | Girls toilet room entry passage non accessible at 3'-2" wide. Stall size ok but room size is not: 3'-10" from lav to front of toilet partition, 2 lavs at 1'8"aff., flush valve at wrong side Replace non-compliant fixtures. Relocate partition wall at entry to provide accessibility and reconfigure interior: may lose one stall: plumbing locations will be affected | | | Cost included in Restroom Cost | | | | \$ | - |
| CFN | Accessibility | Olympic Ave | Deficiency Remedy | Boys toilet room threshold ramps up about 1" Provide accessible slope and landing at room entry | | | Cost included in Restroom Cost | | | | \$ | - |
| CFN | Accessibility | Olympic Ave | Deficiency Remedy | Toilet room labeled "Staff" is actually for severely disabled - room is not lockable but has no privacy screening Room needs to have privacy capability for user: change door swing, replace signage with correct signage | | | Cost included in Restroom Cost | | | | \$ | - |
| CFN | Ceilings | Olympic Ave | Deficiency Remedy | Glue on acoustical tile in toilet rooms is not to health code requirements Replace ceiling finish with code compliant (gyp board) finish | | | Cost ind | cluded i | n Restr | \$ | - | |
| | | | г | EDUCATIONAL PROGRAM NEEDS | 1 | T | 1 | 1 | | | 1 | |
| EPN | Additional Need | General | Need | Meeting spaces needed | | | 200 | sf | \$ | 175.00 | \$ | 35,000.00 |
| EPN | Additional Need | General | Deficiency Remedy | Parent resource room location is too remote from office Relocate within view of Administration building | | | 200 | sf | \$ | 175.00 | \$ | 35,000.00 |
| EPN | Additional Need | General | Deficiency Remedy | Need covered walkway to cafeteria Provide covered walkway throughout campus | | | 1800 | sf | \$ | 350.00 | \$ | 630,000.00 |


| CODE | DISCIPLINE | LOCATION | | DESCRIPTION | E PLAN KEY | РНОТО | ESTIM, TAKE | | COST/ UNIT | ٦ | FOTAL COST |
|------|---------------------|----------|----------------------|--|------------|----------|----------------|------|-----------------|----|--------------|
| | | _ | | | SITE | | Qty. | Unit | | | |
| EPN | Additional Need | MPR | Need | Expand Multi-use: too small, eat in three shifts, need Performance venue, need Gym and locker rooms, need kitchen New Gym/Multipurpose/cafeteria building with kitchen and restrooms, and indoor/outdoor performance venue between the Rainier and Olympic campuses | | | 14,000 | sf | \$ 560.00 | \$ | 7,840,000.00 |
| EPN | Site | Site | Need | Upgrades to Playground | | | 1 | ls | \$ 20,000.00 | \$ | 20,000.00 |
| EPN | Site | Site | Need | Upgrades to Play Structures | | | 1 | ls | \$ 90,000.00 | \$ | 90,000.00 |
| EPN | Site | Site | Need | Upgrades to Playfields | | | 1 | ls | \$ 45,000.00 | \$ | 45,000.00 |
| EPN | Additional Need | Library | Need | Reconfigure Olympic Avenue Multi-Purpose to be central Library | | | 2000 | sf | \$ 125.00 | \$ | 250,000.00 |
| EPN | Additional Need | General | Deficiency Remedy | Inadequate number of classrooms for needs, including incoming 8th grade class Build 2 new classroom wings with 8 total classrooms, restrooms, support spaces: 1 meeting rooms | | | 10000 | sf | \$ 560.00 | \$ | 5,600,000.00 |
| EPN | Additional Need | General | Need | Develop outdoor learning areas, include seating and table areas | | 05 06 | 1500 | sf | \$ 50.00 | \$ | 75,000.00 |
| EPN | Paving & Grading | General | Need | Reconfigure campus to delete through street: provide access via Rainier around farm, with bus turnaround and drop off area at intersection of Farm and Loma Vista campus on Olympic Provide Parent drop off, waiting, and through lanes along Rainier Provide Staff access and parking along Olympic, entered from Mini Drive; Provide drop off at front of new MPR | | | 1 | ls | \$ 1,450,000.00 | \$ | 1,450,000.00 |
| EPN | Additional Need | Admin | Need | Construct new Administration Building central to campus | | | 3200 | sf | \$ 560.00 | \$ | 1,792,000.00 |
| EPN | Additional Need | Admin | Need | Reconfigure (E) Administration Building to provide support function areas: Staff workroom, parent resource, etc. | | | 3200 | sf | \$ 125.00 | \$ | 400,000.00 |

| FFN | Additional Need | Kitchen | Need | Upgrades to Kitchen/Food Services | | 1 | ls | \$ | 58,500.00 | \$ 58,500.00 |
|-----|---------------------|-------------|----------------------|---|--|---------------------------------|----|------------------|----------------|------------------|
| FFN | Additional Need | General | Need | Shop facilities – i.e. woodshop, metal shop, etc. | | 1600 | sf | \$ | 425.00 | \$ 680,000.00 |
| | | | | | | | | | | |
| | | | Deficiency | Sidewalks at farm: not navigable, tripping hazard, Farm wheelchair accessibility is limited to kitchen | | | | | | |
| CFN | Paving & Grading | Farm | Remedy | Replace paving to and within farm, provide accessible paths of travel to main educational spaces | | 1 | ls | \$ | 45,000.00 | \$ 45,000.00 |
| | | | Deficiency | More restrooms are needed at farm | | | | | | |
| CFN | General | Farm | Remedy | Provide girls and boys restrooms: 3 fixtures each | | 350 | sf | \$ | 640.00 | \$ 224,000.00 |
| EPN | Site Utilities | Farm | Deficiency Remedy | Existing Drainage issue at farm: irrigation required at orchard a. City water b. Leaking at pipes leading to orchard | | Cost included in Site utilities | | | | \$ - |
| | | | | Develop Overall campus drainage analysis and plan | | | | | | |
| | | | Deficiency | Pond seepage at Farm | | | | | | |
| EPN | Site | Farm | Remedy | Needs to be dredged & upgraded, needs CEQA determination | | 1 | ls | \$ | 125,000.00 | \$ 125,000.00 |
| | Technology | Campus-wide | Deficiency | Wireless throughout campus | | | | | | |
| EPN | | | Remedy | Provide/upgrade wiring to 1gig fiber connection | | Per | | eting, pleteo | , already J | \$ - |
| FFN | Additional Need | Farm | Need | State of art barn at farm: learning area and breeding/animal's life cycle | | 1 | ls | \$ | 975,000.00 | \$ 975,000.00 |

| | CFN Total | \$ 4,306,592.03 |
|-----------------------|-------------------|------------------|
| | EPN Total | \$ 19,691,540.90 |
| | FFN Total | \$ 1,873,500.00 |
| TOTAL COSTS (not incl | uding escalation) | \$ 25,871,632.93 |



Loma Vista Environmental Sciences Academy - Photographs

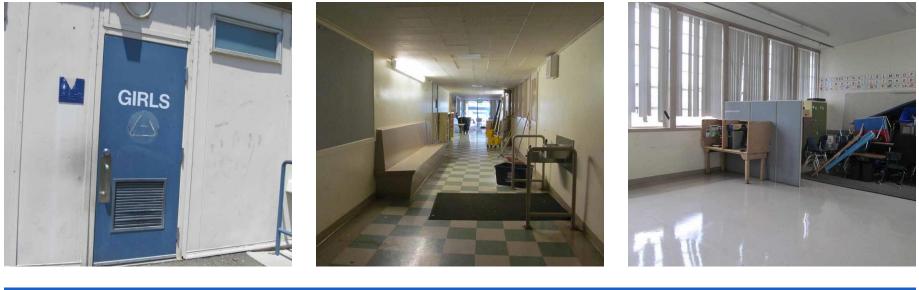





Loma Vista Environmental Sciences Academy - Photographs



15

14

13