



Revised October 2, 2019 Mare Island Health and Fitness Academy 400 Rickover Street

School Data

Date School Opened:	1976/1990
2019 – 2020 Projected School Ye Enrollment:	ear 379
Standard Classrooms:	19
Portable Classrooms:	0
Classrooms Used for Other Progr	ams: 4
Permanent Building Area:	39,700
Facility Capacity:	398

Mare Island Fitness Academy - Background information

Mare Island is a Health & Fitness Magnet school that serves students in Kindergarten through 8th grade from across Vallejo. The campus is the District's only school on Mare Island. It was originally constructed in two phases as a Navy School. The school is now adjacent to areas of recently built new homes.

The Mare Island Academy's mission is "to inspire students, staff and families to achieve excellence in intellectual, physical and emotional fitness". Students and teachers take advantage of educational opportunities in the surrounding community as well as on campus. For example, via a grant-financed partnership with Touro University, volunteers from Touro come twice a week to teach after-school students about healthy eating and to develop life-long exercise habits.





Mare Island Fitness Academy - Existing Conditions Summary

Facilities Assessment Needs

- Exterior doors have extensive damage
- Inadequate signage
- Accessibility issues at door thresholds, student toilet rooms and classroom sinks, Multi-purpose Room platform
- Flooring is at the end of its useful life
- Wind driven rain has caused damage at Administration building
- Acoustical treatments are lacking in atrium corridors and classrooms

Educational Program Needs

- Improvements to the PE facilities to support the Health and Fitness focus of this school
- Provide fenced and secure perimeter
- Improved sense of entry to the school
- Performance space needed
- Library is too crowded and cramped to provide flexible space.

Unique Opportunities

- Existing Multi-purpose Room is a great space with flexible use potential
- Atrium spaces could provide vibrant learning environments, including small group areas
- Opportunity for natural light and ventilation via high and low window openings in classrooms and corridors







Mare Island Fitness Academy - Master Plan Summary

Master Plan Features

- Re-orient main campus entry to north side of campus where existing parking and drop off areas are located
- Construct new gym with locker rooms and toilet rooms
- Construct new building with library, STEM lab space, and additional classrooms

Selected Improvements by Theme

- Develop outdoor learning areas, covered eating, and garden spaces
- Provide flexible layout at classrooms and sun control at south facing windows
- Construct addition to Administration building: parent meeting and teacher prep

	FACILITIES NEED THEME	IMPROVEMENT
	Campus Safety	Provide secure fenced perimeter with controlled access points to campus. Upgrade remaining classroom locks. Provide new window blinds.
Ġ.	Accessibility	Replace paving and provide other upgrades to create an accessible path of travel to classrooms and student restrooms. Upgrade drinking fountains, restrooms, doors and other features to meet accessibility code requirements.
	Technology	Provide A/V system in classrooms, auditorium, MPR, and gym. Add wireless internet throughout the campus. Upgrade electrical, data, and security infrastructure as required.
四	Science, Technology, Engineering, Mathematics (STEM)	Construct STEM Labs with outdoor work area.
Ê	Community Schools	Construct meeting room in an addition to Administration area. New exterior painting, playground equipment and paving. New classroom furniture.
	Infrastructure	Replace mechanical units with energy efficient models. Replace and repair roofing. Replace or repair site utilities where needed. Restroom modernization.


Mare Island Health and Fitness Academy - Educational Program Needs:

STEM Lab

- Flexible room designed to be used by the entire campus community for science labs, project-based learning and other activities
- Amenities include storage cabinets, perimeter cabinetry with sinks and a connected outdoor work area
- Durable surfaces throughout
- Durable, moveable furniture to easily accommodate a variety of uses
- Wired and wireless internet access and two A/V systems for presentations
- Secure storage room with sink, shelving, computer storage and ice maker

Additional Educational Program Needs

- Outdoor learning areas throughout Campus
- Physical Education Facilities to support the school's Health and Fitness focus
- Permanent performance platform in Multi-purpose room
- Flexible library space sized for school enrollment
- Small group and collaborative workspaces
- Safe and secure campus with connections to the surrounding community

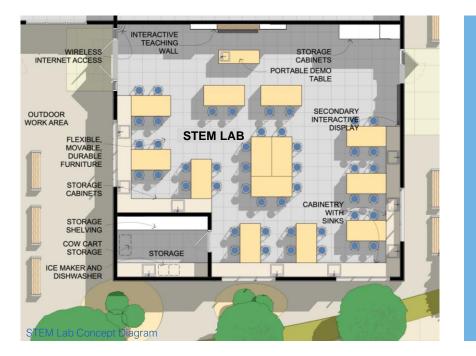

Learning Environment Improvements

- Repair or replace damaged doors and windows
- Upgrade Classroom technology infrastructure
- Replace flooring and wall finishes
- Address accessibility issues at classrooms and restrooms
- Provide acoustical treatments in atrium corridors and classrooms

Mare Island Fitness Academy - Committee Facilities Improvement Priorities

The Master Plan Committee provided their recommendation on the priority of improvements with in the three categories for use in future decision making. These recommendations will be considered along with other factors when scheduling projects as funding becomes available.

Current Facilities Needs (CFN)

- Exterior Doors have extensive damage and need to be replaced.
- Wind driven rain has caused damage at Admin building storefront system, walls, and flooring.
- Provide secure fenced perimeter while maintaining critical connections to community and surroundings
- Accessibility Issues include non-compliant thresholds at many exterior classroom doors, non-compliant classroom sinks and sink cabinets, and non-accessible toilet rooms at main classroom building.
- Locate source and repair leak at Multi-use room
- Provide enclosure at Kindergarten play area
- Security pulls and alarms
- Pipe columns at covered walkway can be hazardous

Educational Program Needs (EPN)

- New Doors and hardware throughout –interior and exterior
- Campus environment encompasses all of Mare Island: partnerships with community and connection of the school to community and environment are extremely important in project-based learning program.
- Library is too dark and crowded to provide flexible space.
- Flooring throughout the school is damaged and/or at the end of its useful life
- Improve all aspects of Health and Fitness components of the campus
- PE facilities are needed: gym functions are currently set up in old Kindergarten room


- Develop grade level appropriate outdoor play areas, outdoor learning, outdoor eating space
- Develop the atrium spaces to provide learning environments, including small group areas
- Interior activities spaces in addition to gym are needed
- Performance space needed. Existing Multi-purpose needs acoustical improvements, technology, sound system, permanent stage
- Acoustical treatments are lacking in the atrium corridors and classrooms
- Sun control is needed at south facing window
- Additional power outlets, reliable wireless, better projection area and assistive listening needed
- Students need storage space locations
- Teachers need, confidential meeting space, room for work, resource space separate from workroom and storage

Future Facilities Needs (FFN)

- Keep and develop existing garden
- Kitchen for fresh food prep, and cooking classes
- Develop connections between all areas of the campus
- Improve sense of entry, curb appeal!
- Multi-purpose Room great space, needs inviting lobby
- Opportunity for natural light and ventilation
- Commercial building at corner-may be feasible to use
- Meditation room for teachers
- Build new library and gym library location –STEM lab




Mare Island Fitness Academy

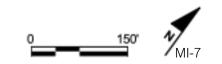




MI-8

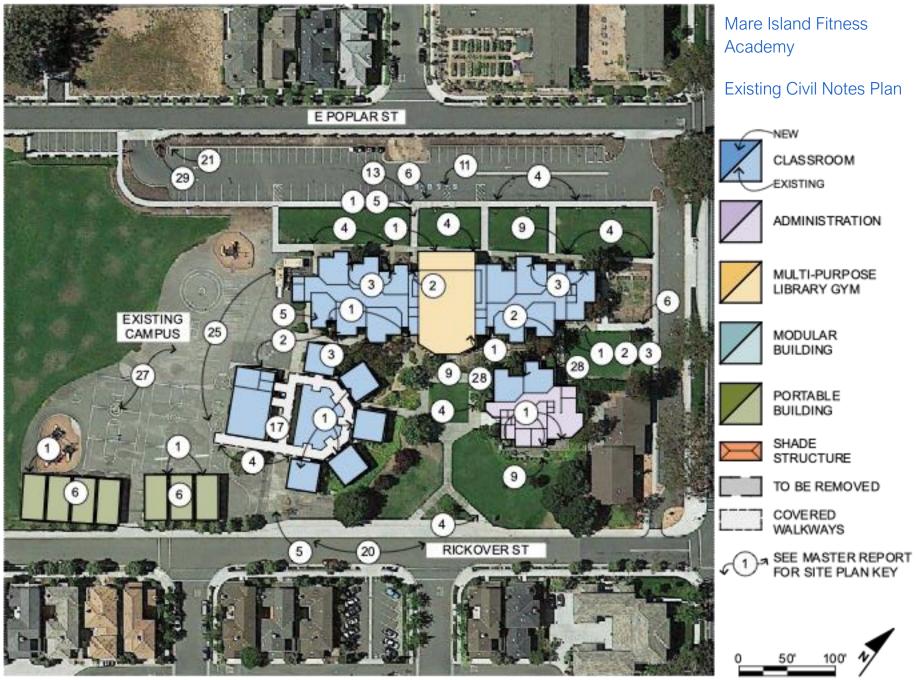



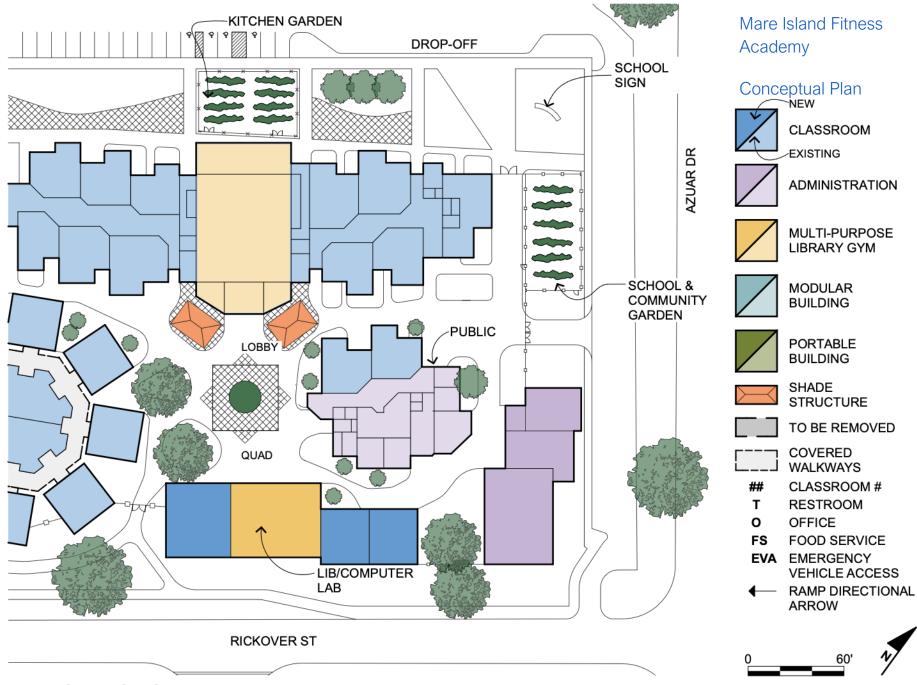

Mare Island Health & Fitness Academy Preliminary Cost Estimate

400 Rickover Street, Vallejo, California 94592 707/556-8560

						# Classrooms:	19	
						# Portables:	0	
		CFN		EPN		FFN		Grand Total
Construction Costs	\$	4,306,871.80	\$	10,706,932.00	\$	192,440.00	\$	15,206,243.80
Sub-Total	\$	4,306,871.80	\$	10,706,932.00	\$	192,440.00	\$	15,206,243.80
Design Contingency (0%)	\$	-	\$	-	\$	-	\$	-
Sub-Total	\$	4,306,871.80	\$	10,706,932.00	\$	192,440.00	\$	15,206,243.80
General Contractor OHP (12%)	\$	516,824.62	\$	1,284,831.84	\$	23,092.80	\$	1,824,749.26
General Contractor Insurance (2%)	\$	86,137.44	\$	214,138.64	\$	3,848.80	\$	304,124.88
Sub-Total	\$	4,909,833.85	\$	12,205,902.48	¢	219,381.60	¢	17,335,117.93
Soft Costs: Change Order Contingency, A/E Fees,	Ψ	4,303,000.00	Ψ	12,200,302.40	Ψ	213,301.00	Ψ	17,000,117.00
Inspection, Management Fees, etc. (35%)	\$	1,718,441.85	\$	4,272,065.87	\$	76,783.56	\$	6,067,291.28
Sub-Total	\$	6,628,275.70	\$	16 477 069 25	¢	206 165 16	¢	22 402 400 21
	,			16,477,968.35		296,165.16		23,402,409.21
Escalation (18%)	\$	1,193,089.63	\$	2,966,034.30	\$	53,309.73	\$	4,212,433.66
Grand Total	\$	7,821,365.33	\$	19,444,002.65	\$	349,474.89	\$	27,614,842.87

Square Footage (Bldg. only): 42,440

CODE	DISCIPLINE	LOCATION			KEY	PHOT -	STIMAT ГАКЕ O Qty. (COST	/ UNIT	тс	OTAL COST
				SITE ISSUES								
			Deficiency	Site utilities are nearing the end of their useful life		1						
CFN	Site Utilities	Site					1	ls	\$ 95	0,000.00	\$	950,000.00
			Remedy	Replace underground utility lines								
		0.1	Deficiency	Landing at Door/Ramp exceeds 2% Slope at 24 locations throughout site		10				40.00		
CEN	Accessibility Issue	Site	Remedy	Saw cut, remove and replace Landings. Estimated 25 sf ea landing	1	19	600	sf	\$	40.00	\$	24,000.00
CFN	Accessibility Issue	Site	Deficiency	Non-compliant Door threshold at 7 locations throughout site	2		7	ea	\$	1,500.00	\$	10,500.00
_	,		Remedy	Remove and replace with compliant threshold.					·	,	·	-,
CFN	Accessibility Issue	Site	Deficiency	18" clearance not provided on pull side of door	3		8	ea	\$	1,500.00	\$	12,000.00
			Remedy	Widen walkway to provide 18" minimum beyond door.								
CFN	Accessibility Issue	Site	Deficiency	Cross slope on path of travel exceeds 2% at 11 locations throughout site	4	20	1100	sf	\$	40.00	\$	44,000.00
			Remedy	Remove and replace section of walkway that is non compliant. Estimate of 100 sf ea occurrence.								
CFN	Accessibility Issue	Site	Deficiency Remedy	Slopes on path of travel > 5% without handrails at 3 locations Remove and replace ramp with slopes < 5% or provide handrails	5		300	sf	\$	40.00	\$	12,000.00
				for ramp as required path of travel.								
CFN	Accessibility Issue	Site	Deficiency Remedy	Slopes on path of travel > 8.33% at 5 locations Remove ramp and construct code compliant ramp	6		500	sf	\$	40.00	\$	20,000.00
CFN	Accessibility Issue	Site	Deficiency	Broken or raised pavement at 5 locations	9	· 22	125	sf	\$	20.00	\$	2,500.00
	-		Remedy	Remove and replace pavement. Estimate 25 sf ea occurrence								
CFN	Accessibility Issue	Site	Deficiency	Slopes exceed 2% in any direction on accessible parking stall or loading area	11	21	100	sf	\$	30.00	\$	3,000.00
	,		Remedy	Repave accessible parking area to provide maximum of 2% cross slope or relocate accessible parking.								,
CFN	Accessibility Issue	Site	Deficiency	Non-compliant ramp at accessible parking- inadequate clearance behind ramp	13		1	ea	\$	5,000.00	\$	5,000.00
			Remedy	Modify ramp as required.								
CFN	Accessibility Issue	Site	Deficiency Remedy	Non compliant/missing accessible signage at parking lot entry Provide code compliant signage with "tow to" information	21		1	ea	\$	100.00	\$	100.00

CODE	DISCIPLINE	LOCATION		DESCRIPTION	SITE PLAN KFY		ТОНА	STIMAT AKE OF Qty. L		CO	ST/ UNIT	тс	DTAL COST
CFN	Fire & Life Safety	Site	Deficiency Remedy	Inadequate fire protection. Provide additional fire hydrants on site.	2	25		Cost ir		ed in cost	Site Utilities t	\$	-
CFN	Paving & Grading	Site	Deficiency Remedy	Pavement maintenance Remove and replace	2	27		40000	sf	\$	20.00	\$	800,000.00
EPN	Plumbing	Site	Deficiency Remedy	Inadequate drainage, reports of standing water during storms Provide storm drain system to provide drainage.	2	29		2	ea	\$	2,500.00	\$	5,000.00
EPN	Plumbing	Site	Deficiency Remedy	Drainage blocked with debris Provide regular maintenance on storm drain system.	2	29		Routir	ne Ma	ainter	nance Issue	\$	-
				GENERAL & CAMPUS-WIDE ISSUES									
	Restrooms	Campuswide		Full upgrade to all campus restrooms				1720	sf	\$	575.00	\$	989,000.00
CFN	Mechanical	Campus-wide	Deficiency Remedy	Mechanical units at end of useful life. Replace mechanical units				1	ls	\$	585,672.00	\$	585,672.00
EPN	Electrical	Site	Remedy	Repairs and Upgrades to electrical and Security Systems				1	ls	\$	488,060.00	\$	488,060.00
CFN	Signage	Campus-wide	Deficiency Remedy	Building, room identification and directional signage is lacking throughout Implement campus-wide signage program			02 04	42440	sf	\$	0.50	\$	21,220.00
CFN	Doors	Campus-wide	Deficiency Remedy	Exterior doors severely damaged, dry rot Replace all exterior doors with heavy-duty, climate-specific doors and hardware			03	10	pr	\$	1,300.00	\$	13,000.00
CFN	Window coverings	Campus-wide	Deficiency Remedy	Window coverings are in poor condition, or are homemade Provide new window coverings and appropriate controls			15	42440	sf	\$	0.88	\$	37,347.20
CFN	Roofing	Campus Buildings	Deficiency Remedy	Roofing in need of replacement				1	ls	\$	293,700.00	\$	293,700.00
CFN	Security	Campus-wide	Deficiency Remedy	Secure fenced perimeter with controlled access points to campus					Comp	oleteo	d 2018	\$	-
CFN	Doors	CR 15-19	Deficiency Remedy	Thresholds > 1/2" Provide new concrete or concrete overlay.				88	ea	\$	1,500.00	\$	132,000.00

CODE	DISCIPLINE	LOCATION	,	DESCRIPTION	SITE PLAN	КЕҮ	PHOT	STIMAT TAKE OF Qty. L		CO	ST/ UNIT	тс	TAL COST
CFN	Doors	CR Wing 3-7/8-13	Deficiency Remedy	Threshold from exterior > 1" at several locations. Provide new concrete or concrete overlay.				11	ea	\$	1,500.00	\$	16,500.00
CFN	Accessibility Issue	CR Wing 3-7/8-13	Deficiency Remedy	Paths to many exterior CR doors only 4' 0" wide. Add or replace concrete walk as required to provide landing wi compliant clearances.	ith		02	10	ea	\$	2,500.00	\$	25,000.00
CFN	Doors	Library	Deficiency Remedy	Thresholds > 1/2" Provide new concrete or concrete overlay.				Cost	inclue	ded ir	n Door cost	\$	-
CFN	Accessibility Issue	Library	Deficiency Remedy	Exterior drinking fountain non compliant Replace with code compliant fountain			10	42440	sf	\$	0.30	\$	12,732.00
EPN	Finishes/Flooring	Campus-wide	Deficiency Remedy	VCT and Carpet: Flooring is mismatched, poorly adhered, damaged worn and/or deteriorated throughout the campus Campus-wide flooring replacement program provide walk-off an at each exterior door.	ea		04 05	42440	sf	\$	6.25	\$	265,250.00
EPN		Campus-wide	Deficiency Remedy	Soffit vent screens are damaged or painted over Clean off and secure screens or replace.				1	ls	\$	8,000.00	\$	8,000.00
EPN	Technology	Campus-wide	Need	Campus-wide technology upgrade per district ed specs				42440	sf	\$	3.00	\$	127,320.00
FFN	Exterior Envelope		Deficiency Remedy	Exterior walls dirty and marred. Clean and Paint				42440	sf	\$	1.00	\$	42,440.00
			rtomody	CLASSROOMS			1						
CFN	Accessibility	CR Wing 3-7/8-13	Deficiency Remedy	Sinks/cabinets not code compliant. Replace with compliant sinks/cabinets			09	1	ls	\$	15,000.00	\$	15,000.00
CFN	Signage	CR Wing 3-7/8-13	Deficiency Remedy	Signage not compliant (except at toilet rooms) Provide accessible signage throughout campus			02	Cost	inclu	ided cost	in Signage	\$	-
CFN	Plumbing	CR Wing 3-7/8-13 Toilets/Misc.	Deficiency Remedy	Toilet rooms at CR 3 are taped shut, appear abandoned. Address plumbing issues				Cost	inclu	ded ir cost	n Restroom	\$	-
CFN	Accessibility Issue	CR Wing 3-7/8-13 Toilets/Misc.	Deficiency Remedy	Access to Girl's toilet room not compliant - only 3'-6" wide pat of travel, but stall inside is > 5'-0" wide. Entry can be made accessible by moving 1 wall and toilet partitions/fixtures w/o losing any fixtures.	h			Cost	incluo	ded ir cost	n Restroom	\$	-

CODE	DISCIPLINE	LOCATION		DESCRIPTION	SHE PLAN KEY	РНОТО	ESTIMAT TAKE OF Qty. L		CO	ST/ UNIT	тс	DTAL COST
CFN	Accessibility Issue	CR 15-19	Deficiency Remedy	CR sinks/cabinets not accessible Replace sinks and cabinets.			40	lf	\$	275.00	\$	11,000.00
CFN	Mechanical	CR 15-19	Deficiency	Mechanical closets in corners, condensing units-carrier-exterior pads adjacent to building SEE CAMPUS-WIDE			Cost ir	nclud	ed in cost	Mechanical	\$	-
EPN	Walls & Finishes	CR Wing 3-7/8-13 Atrium/Corridor	Deficiency	Damage at gypboard wall corners. Repair Damage, Provide corner guards			42440	sf	\$	4.00	\$	169,760.00
EPN	Walls & Finishes	CR Wing 3-7/8-13	Deficiency	No acoustical treatment at walls.		07 08	42440	sf	\$	3.40	\$	144,296.00
EPN	Flooring	CR Wing 3-7/8-13	Deficiency	New Flooring needed Provide new flooring, provide walk off area at ea. exterior door			Cost in	clude	ed in	Flooring cost	\$	-
EPN	Electrical	CR Wing 3-7/8-13	Deficiency Remedy	No occupancy sensors seen Provide occupancy sensors			Cost	inclu	ded i cost	n Electrical	\$	-
EPN	Electrical	CR Wing 3-7/8-13	Deficiency Remedy	Switching is alternate fixtures (fluorescent surface mounted) Modify lighting controls to be daylight based			Cost	inclu	ded i cost	n Electrical	\$	-
EPN	Electrical	CR Wing 3-7/8-13	Deficiency Remedy	Inadequate Power Provide additional power at each classroom			Cost	inclu	ded i cost	n Electrical	\$	-
EPN	Mechanical	CR Wing 3-7/8-13	Deficiency Remedy	Some exterior windows blocked by cages for cond. Units or transformers.			Cost ir	nclud	ed in cost	Mechanical	\$	-
EPN	Siding	CR 15-19	Deficiency Remedy	Board and Batten Siding damaged at corner and window trim. Replace damaged sections.		11	1	ls	\$	45,000.00	\$	45,000.00
EPN	Doors	CR 15-19	Deficiency Remedy	Wood door frames deteriorated at rated door assembly. Repair if able to maintain fire rating; or replace			Cost	inclu	ded i	n Door cost	\$	-
EPN	Windows	CR 15-19	Deficiency Remedy	Window casings and sills damaged and deteriorated. Repair, refinish and replace.		11	42440	sf	\$	12.00	\$	509,280.00

CODE	DISCIPLINE	LOCATION	2	DESCRIPTION	SITE PLAN	KEY		STIMATE AKE OF Qty. U		COS	ST/ UNIT	T	OTAL COST
CFN	Doors	Admin Classrooms 1-2 (CR 2 staffroom)	Deficiency Remedy	Doors to rated corridor not labeled. Verify/replace all non-rated doors & frames with appropriately rated doors/frames :20 min., 90 min.				1	ls	\$	5,000.00	\$	5,000.00
CFN	Exterior Envelope	Admin Corridors/ Toilet rooms	Deficiency Remedy	Wind driven water at wood/aluminum storefront a big issue: water penetration into & through system- and into walls and ceilings Provide concrete curb, replace storefront system w/climate appropriate system.			06	1	ls	\$	18,000.00) \$	18,000.00
CFN	Doors	Admin Corridors/ Toilet rooms	Deficiency Remedy	Rated corridor, but some interior doors not labeled. Replace non rated doors and frames with 20 min. rated.				Cost ir		ed in cost	Door Rating	\$	-
CFN	Accessibility Issue	Admin Corridors/ Toilet rooms	Deficiency Remedy	Women's toilet room lacks code clearance lav to WC. Move Lavatory				Cost		led ir cost	n Restroom	\$	-
CFN	Accessibility Issue	Admin Corridors/ Toilet rooms	Deficiency Remedy	Girl's and boy's access stall not compliant (<5'-0" wide). New Partitions.				Cost		led ir cost	n Restroom	\$	-
EPN	Electrical	Admin Office Suite and Corridor	Deficiency Remedy	Lots of unpainted exposed conduit. Paint to match adjacent surface				42440	sf	\$	1.00) \$	42,440.00
EPN	Walls & Finishes	Admin Office Suite	Deficiency Remedy	No tackable or acoustical treatment at walls Provide acoustical and/or tackable wall treatment				42440	sf	\$	2.50	\$	106,100.00
EPN	Walls & Finishes	Admin Office Suite	Deficiency Remedy	No acoustical treatment at ceiling Provide acoustical wall treatment				42440	sf	\$	3.40) \$	144,296.00
EPN	Flooring	Admin Office Suite	Deficiency Remedy	Carpeting and VCT Flooring are worn, at end of useful life. Replace Flooring				Cost in	clude	d in l	Flooring cos	t\$	-
EPN	Electrical	Admin Office Suite	Deficiency Remedy	Surface mounted fluorescent lighting throughout - T-12 assumed. Replace with energy efficient fixtures.				Cost	inclu	ded ir cost	n Electrical	\$	-
EPN	Electrical	Admin Office Suite	Deficiency Remedy	Lots of surface mounted power: Haphazard, Ad hoc location: Coordinate/condense runs: Provide raceway	s.			Cost	inclu	ded ir cost	n Electrical	\$	-

CODE	DISCIPLINE	LOCATION	-	DESCRIPTION	SITE PLAN KFY	PHOTO		STIMAT AKE OI Qty. L		COS	ST/ UNIT	тс	OTAL COST
EPN	Doors	Admin Classrooms 1-2 (CR 2 staffroom)	Deficiency Remedy	Exterior wall mounted doors stop is crushed. Remove, stop. Repair wall, install ground mounted stop or wall				1	ls	\$	450.00	\$	450.00
EPN	Walls & Finishes	Admin Classrooms 1-2 (CR 2 staffroom)	Deficiency Remedy	mounted with blocking behind. Damage at gypboard wall corners. Repair walls. Provide corner guards at outside corners				Cost ir		ed in (mer co	Gyp. Board ost	\$	-
EPN	Walls & Finishes	Admin Corridors/ Toilet rooms	Deficiency Remedy	Ceramic tile base at toilet rooms - some damaged tiles. Replace floor tile and first row of wall tile				Cost		ded in cost	Restroom	\$	-
				LIBRARY									
CFN	Doors	Library	Deficiency Remedy	Wood door frames deteriorated at rated door assembly Repair if able to maintain fire rating or replace.				Cost	inclu	ded in	door cost	\$	-
CFN	Accessibility Issue	Library	Deficiency Remedy	Room has perimeter casework with non-accessible sinks Replace one sink/cabinet with accessible				15	lf	\$	275.00	\$	4,125.00
EPN	Siding	Library	Deficiency Remedy	Board and Batten Siding damaged at corner and window trim Replace siding and trim sections.				Cost i	nclud	ed in S	Siding cost	\$	-
EPN	Windows	Library	Deficiency Remedy	Window casings and sills damaged and deteriorated Repair and refinish or replace.							n Window t cost	\$	-
EPN	Windows	Library	Deficiency Remedy	Window operable, but many painted shut; operators removed a 50%- 80 % Repair function; replace operators	t						n Window t cost	\$	-
EPN	Windows	Library	Deficiency Remedy	Damaged wood frames and sills							n Window t cost	\$	-
				ART/MUSIC/GYM BUILDING		-						-	
CFN	Doors	Art/Music/Gym CR 14 Toilet rooms	Deficiency Remedy	Thresholds > 1/2" Install compliant height and size concrete overlay at exterior landing.				Cost	incluc	led in	Door cost	\$	-
CFN	Doors	Art/Music/Gym CR 14 Toilet rooms	Deficiency Remedy	Wood door frames deteriorated and need to be fire rated to match door rating				Cost	incluc	ded in	Door cost	\$	-
CFN	Windows	Art/Music/Gym CR 14, 15-19	Deficiency Remedy	Homemade curtains and/or window curtains w/pulleys- washer on a string, window blind operators out of reach, function unknown Provide new window coverings with appropriate controls			15	42440	sf	\$	0.88	\$	37,347.20

CODE	DISCIPLINE	LOCATION		DESCRIPTION	SITE PLAN KEY	PHOTO	ESTIMA ⁻ TAKE C Qty.		cos	T/ UNIT	TO	TAL COST
CFN	Doors	Art/Music/Gym CR 14 Toilet rooms	Deficiency Remedy	Door to mechanical has no closer, swings free Provide closer or self closing hinges.			Cost	inclue	ded in	Door cost	\$	-
CFN	Accessibility Issue	Art/Music/Gym CR 14 Toilet rooms	Deficiency Remedy	Perimeter casework all around, including sinks - none accessible Replace 1 sink/cabinet with accessible			24	lf	\$	275.00	\$	6,600.00
CFN	Accessibility Issue	Art/Music/Gym CR 14 Toilet rooms	Deficiency Remedy	Inside Building: two toilets in tiny cubicles - not accessible Combine to make single unisex toilet room.			400	sf	\$	400.00	\$	160,000.00
CFN	Accessibility Issue	Art/Music/Gym CR 14 Toilet rooms	Deficiency Remedy	Girl's & Boy's from outside: Not compliant as-is, but could be reconfigured Reconfigure interior to provide accessible stall. May lose one fixture.		1	3 Cost	inclu	ded in cost	Restroom	\$	-
CFN	Mechanical	Art/Music/Gym CR 14 Toilet rooms	Deficiency Remedy	In floor radiator grills; are they functioning? SEE CAMPUS-WIDE			Cost	includ	ed in N cost	Mechanical	\$	-
EPN	Siding	Art/Music/Gym CR 14 Toilet rooms		Board and Batten Siding damaged at corner and window trim Replace siding and trim sections.			Cost	includ	ed in S	Siding cost	\$	-
EPN	Windows	Art/Music/Gym CR 14 Toilet rooms	Deficiency Remedy	Window frames and sills damaged and deteriorated Identify type and extent of damage. Repair or replace damage sections.	d		-			n Window t cost	\$	-
EPN	Windows	Art/Music/Gym CR 14, 15-19	Deficiency Remedy	Window operable, but many painted shut, operators removed a 50% - 80%	at		-			n Window t cost	\$	-
EPN	Doors	Art/Music/Gym CR 14 Toilet rooms	Deficiency Remedy	Expanded metal ventilation louver on door is an attractive nuisance, filled with debris Replace with vandal resistant louvers			Cost	inclu	ded in	Door cost	\$	-
EPN	Flooring	Art/Music/Gym CR 14 Toilet rooms	Deficiency Remedy	Replace VCT flooring Replace VCT flooring with gym appropriate flooring			Cost i	nclude	ed in F	looring cost	\$	-
EPN	Electrical	Art/Music/Gym CR 14 Toilet rooms	Deficiency Remedy	"Stuff" thrown on top of rectangular strip suspended light fixtures Replace light fixtures w/curved or sloped top			Cost	inclu	ded in cost	\$	-	
				MULTI-PURPOSE (MPR)								
CFN	Accessibility Issue	MPR	Deficiency Remedy	Exterior door has kickstand hold-opens - not compliant Provide code compliant hardware			42440	sf	\$	0.36	\$	15,278.40

CODE	DISCIPLINE	LOCATION		DESCRIPTION	SITE PLAN KEY	РНОТО	ESTIMA TAKE (Qty.		CO	ST/ UNIT	TO	TAL COST
CFN	Doors	MPR	Deficiency Remedy	Gaps, weather-stripping missing from exterior doors Replace all weather-strip			Cos	t inclu	ded ir	n Door cost	\$	-
CFN	Exterior Envelope	MPR	Deficiency Remedy	Leaks in walls are evident Locate and repair leak, damage to finish			1	ls	\$	20,000.00	\$	20,000.00
CFN	Flooring	MPR	Deficiency	Flooring and wall base at kitchen not code compliant Provide epoxy or resilient sheet flooring w/integral base.			Cost	nclud	ed in	Flooring cost	\$	-
CFN	Accessibility Issue	MPR	Deficiency Remedy	Drinking fountain not accessible Install high/low fountain in (E) alcove; install waterproof finishe at alcove	s		Co		uded Intain	in Drinking cost	\$	-
CFN	Electrical/ Mechanical	MPR	Deficiency Remedy	Electrical room in this building packed with equipment Upgrade mechanical system to accommodate			Cos	t inclu	ided i cost	n Electrical	\$	-
CFN	Mechanical	MPR	Deficiency	HVAC recessed in-wall at office - is damages, appears outdate and ad hoc.	ed		Cost	Cost included in Mechanical cost				-
EPN	Accessibility Issue	MPR	Remedy Deficiency Remedy	SEE CAMPUS-WIDE Portable platform is not accessible; rickety, inadequate for performance. Remove platform, provide permanent stage/platform, sound system, A/V technology		12	2 1000	sf	\$	95.00	\$	95,000.00
EPN	Walls & Finishes	MPR	Deficiency	Gypboard walls at kitchen and offices very damaged, needs to be impact resistant Provide new finishes			1	ls	\$	12,000.00	\$	12,000.00
EPN	Walls & Finishes	MPR	Deficiency Remedy	In-wall table storage beautiful: wood: plywood panels, slats @ M.U., but lack acoustical properties. Provide acoustical wall/ceiling treatment complimentary to (E) finishes.		16	, C	ost in Fini	clude	\$	-	
EPN	Flooring	MPR	Deficiency Remedy	Flooring in fair condition, but should be replaced Provide new resilient flooring applicable for MU functions.			Cost	nclud	ed in	Flooring cost	\$	-
EPN	Doors	MPR	Deficiency	Damage at bottom of 90 min. hollow metal interior doors, need kickplates Repair damage, provide 10" high kickplates both sides			Cost included in Door cost				\$	-


CODE	DISCIPLINE	LOCATION		DESCRIPTION	SITE PLAN KEY		STIMAT TAKE O Qty. L		CO	ST/ UNIT	тс	OTAL COST
				EDUCATIONAL PROGRAM NEEDS				-	_			
EPN	Additional Need	Gym	Deficiency Remedy	No Gym on site Build gym building with offices, locker rooms and toilet rooms			7000	sf	\$	560.00	\$	3,920,000.00
EPN	Educational Needs	Campus Wide	Needs	Replace Classroom Furniture			31	CR	\$	12,000.00	\$	372,000.00
EPN	Windows/Electrical	Campus-wide	Deficiency	Classrooms lack, Sun control at south facing windows; flexible layout, inadequate power			-			in Window ectrical cost	\$	-
EPN	General	Admin	Deficiency Remedy	Inadequate teacher support space: Confidential meeting areas, workspace Build addition to Admin. With parent meeting room, workroom, and teacher prep room			1000	sf	\$	560.00	\$	560,000.00
EPN	General	Library	Deficiency Remedy	Library is dark, cramped Build new building with library, STEM lab space, convert existing library into two classrooms		18	5000	sf	\$	560.00	\$	2,800,000.00
EPN	Site	Site	Need	Playground Repairs and Upgrades			1	ls	\$	25,000.00	\$	25,000.00
EPN	Site	Site	Need	Play Structure Repairs and Upgrades			1	ls	\$	90,000.00	\$	90,000.00
EPN	Security	Entry	Deficiency Remedy	Clear and safe entry to campus is needed Re-orient main campus entry to north side of campus where existing parking and drop off areas are currently located, develop outdoor learning areas		01	1	ls	\$	750,000.00	\$	750,000.00
EPN	Technology	Campus-wide	Deficiency Remedy	Wireless throughout campus Provide/upgrade wiring to 1gig fiber connection			Per 6		neetir mple	ng, already ted	\$	-
FFN	General	MPR	Need	Modernize lobby at Multipurpose to include office and storage areas		17	2500	sf	\$	60.00	\$	150,000.00

CFN Total	\$ 4,306,871.80

EPN Total \$ 10,706,932.00

FFN Total \$ 192,440.00

TOTAL COSTS (not including escalation) \$15,206,243.80

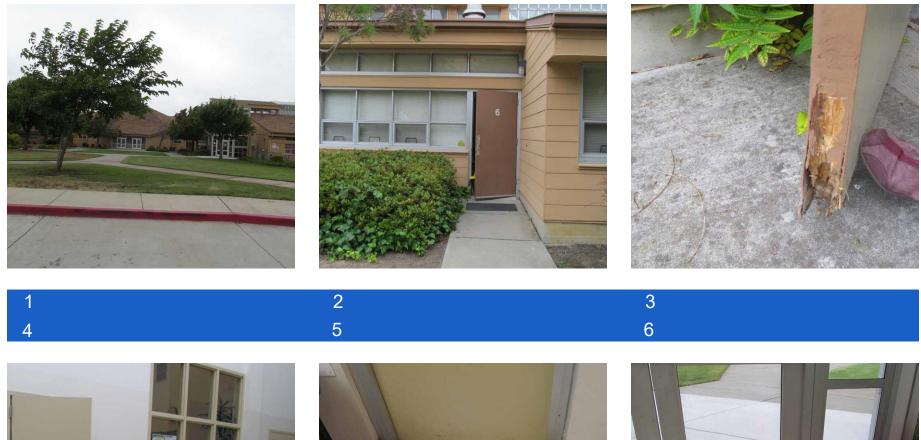















 13
 14
 15

 16
 17
 18



Vallejo City Unified School District Facilities Master Plan





21

19 22 20

