

INDOOR AIR QUALITY WATER DAMAGE ASSESSMENT

**Barnstable United Elementary School
730 Osterville W. Barnstable Road
Marstons Mills, MA**



Prepared by:
Massachusetts Department of Public Health
Bureau of Climate and Environmental Health
Indoor Air Quality Program
September 2024

BACKGROUND

Building:	Barnstable United Elementary School (BUES)
Address:	730 Osterville W. Barnstable Road Marstons Mills, Massachusetts
Assessment Requested by:	Barnstable Public Schools (BPS)
Reason for Request:	Mold concerns
Date of Assessment:	August 28, 2024
Massachusetts Department of Public Health/Bureau of Environmental Health (MDPH/BEH) Staff Conducting Assessment:	Mike Feeney, Director, Indoor Air Quality (IAQ) Program
Building Description:	The BUES is a two-story brick building completed in 1994 and formerly served as the Horace Mann Charter School (HMCS). The building contains a centralized courtyard, general classrooms, science classrooms, art rooms, music rooms, kitchen, cafeteria, gymnasium, faculty workrooms and office space.
Windows:	Openable

EXECUTIVE SUMMARY

The MDPH IAQ Program was asked to examine BUES for the presence of water damage/mold growth resulting from high relative humidity weather conditions that occurred during August 2024. The BUES experienced water damage in the building due to a number of factors, including:

- extended periods of weather with high relative humidity,
- the design of the building and,
- operating the heating, ventilation, and air conditioning (HVAC) system in cooling mode during the summer when the building has reduced occupancy during school summer vacation.

It is important to note that the BUES has been previously assessed by the IAQ Program, The reports (both as the BUES and HMCS) can be viewed at this webpage:

<https://www.mass.gov/info-details/indoor-air-quality-reports-cities-and-towns-b#barnstable->

The IAQ program visually examined the building and conducted measurements to determine whether building materials were moistened to support mold growth. Areas under water damage remediation were examined with a focus on materials that were damaged by condensation i.e., ceilings, carpeting, and classroom items. IAQ staff visited the BUES while water damage remediation efforts were being completed. Contractors used the US EPA guidelines “Mold Remediation in Schools and Commercial Buildings” to conduct water damage remediation, which include:

- Identifying the source of moisture cause water damage,
- Removing water-damaged porous materials capable of supporting mold growth (ceiling tiles, carpeting and various stored materials),
- Cleaning of non-porous surfaces areas (e.g., painted cement walls, laminated counters, floor tile).

IAQ staff examined hallways and classrooms of the BUES where the water damage occurred. Based on observations, the source of water vapor causing the damage was a combination of high relative humidity weather that occurred in August 2024 and water vapor migration from classroom sink drains with dry drain traps. Heavy rain entering the Barnstable storm/sewer system forced water vapor and air to back up the sink drain system, which then caused condensation on stored materials and building components. In addition, conditions regarding HVAC system operations and building designed are detailed in the previous IAQ assessment in 2019 <https://www.mass.gov/doc/barnstable-united-elementary-school-october-2019/download>

MDPH IAQ staff made the following recommendations on-site:

- Deactivate the AC system to eliminate source of condensation. Do not use the HVAC system in chilling mode.
- If outdoor relative humidity is below 70%, open windows and doors to create cross ventilation in order to reduce any odor from newly-installed ceiling tiles. Place fans in

open courtyard exterior doors to eject odors into the courtyard. If outdoor relative humidity exceeds 70%, close all doors and windows.

- Operate exhaust vents in classrooms to eject ceiling tile odors and water vapor from all occupied spaces.
- Continue to use vacuum cleaners equipped with high efficiency particle air (HEPA) filters which will remove residues of mold and mold spores from the environment.
- Use portable air filters equipped with HEPA filters in rooms to provide additional filtration of air in classrooms.
- Ensure that all sink drain traps are wetted regularly (once per week) to prevent water vapor backup into classrooms during hot, humid weather accompanied by rain that pressurizes the sewer system.
- Identify if materials in classrooms or storage have visible mold growth or mold odors. If the materials are porous and susceptible to mold growth, discard in a manner consistent with US EPA mold remediation guidelines.

METHODS

IAQ staff conducted a visual inspection of effected areas. Air temperature and relative humidity were measured in each room. Surface temperatures of floors and walls were also measured to determine if building components were at or below the dew point (temperature where condensation will gather on a cold surface). Please refer to the IAQ Manual for methods, equipment, sampling procedures, and interpretation of results (MDPH, 2015).

RESULTS AND DISCUSSION

The following is a summary of indoor air testing results (Table 1):

- ***Air Temperature*** was within the MDPH recommended range of 70°F to 78°F in areas tested during the assessment.
- ***Relative Humidity*** was within the MDPH recommended comfort range of 40 to 60% in all areas tested. Relative humidity outdoors was 53%. All indoor relative humidity measurements were below outdoor measurements. The US Environmental Protection Agency (US EPA) recommends keeping indoor relative humidity between 30 and 50% to

prevent mold growth, which presents a unique challenge in regions with high relative humidity in the outdoor environment (Center for Green Schools, 2024).

- **Dew Point** was within a range of 53°F to 57°F in areas tested during the assessment.

Based on these observations and the deactivation of the HVAC system chiller, conditions that could result in water vapor moistening building components or stored equipment/materials were not present at the time of this assessment. The conditions regarding the BUES HVAC system are detailed in the 2019 report, which is included as Appendix A and can also be viewed and downloaded at <https://www.mass.gov/doc/barnstable-united-elementary-school-october-2019/download>.

As mentioned, a water damage flooding restoration firm was present during this visit. Remediation activities included:

- Removal and replacement of water-damaged ceiling tiles.
- Cleaning of non-porous building materials that had mold on surfaces only (e.g., painted walls, laminated countertops, metal).
- Use of fans and dehumidifiers to accelerate drying of carpeting and classroom materials.
- Use of exhaust vents to vent water vapor outdoors.
- Cleaning of non-porous classroom materials.
- Moving cabinets, floor mats, and area rugs on the floor.

At the time of the MDPH IAQ visit, remediation activities (removal and drying of water-damaged building materials) were fully active and were being conducted in accordance with US EPA guidance (US EPA, 2008). Water-damaged materials had been removed and/or dried and rooms were being cleaned. Materials cleaned were in the basement hallway, which were found free of visible mold and odor. MDPH IAQ staff examined all accessible classrooms and other occupied spaces in the building and did not observe visible mold/associated odors during this visit except for a single location.

Mold odor was emanating from a custodial sink located in the music room (Picture 1). This location also had a removable carpet on the floor. While this carpet was free of visible mold

or staining, its location on the ground floor near the custodial sink with mold odors would make this carpet possibly cross-contaminated by mold (Picture 2).

One sign of high relative humidity in the BUES is the presence of bowed ceiling tiles (Picture 3). If a building experiences high relative humidity (+70%) indoors over an extended period of time, moisture exposure may cause ceiling tiles to bow. It is recommended that porous material be dried with fans and heating within 24 to 48 hours of becoming wet (US EPA, 2008). If relative humidity is experienced indoors above 70%, use of open windows and floor fans to create air movement will help reduce stagnant air and mold growth.

Bowed ceiling tiles without discoloration or stains are not mold-colonized but are a sign of water vapor exposure. Bowing ceiling tiles are typically found in classrooms and cafeterias with sink or floor drains where the trap has dried. A trap is a section of pipe below the drain opening that fills with water to form an airtight seal. The airtight seal prevents sewer gas, odors, and water vapor from the drain systems from backup up the drain to enter occupied space. Depending on various conditions, water evaporates from the trap if a plumbing device is not used for several days.

Wetting drain traps regularly to maintain the airtight water seal is particularly important when heavy rains occur. As large amounts of water enter storm/sewer pipes, air and other water vapor/odors/pollutants can be forced up drainpipes, which would be prevented from entering the occupied space by a wet drain trap.

Schools are particularly vulnerable to dry drain traps due to the extended summer vacation when the building is unoccupied, since water fountains as well as sinks in classrooms, the cafeteria and kitchens are not in use. School locations with bowed ceiling tiles are ones with multiple sinks that are not used during summer vacations, such as the cafeteria and science classrooms, as well as restrooms, when equipped with a suspended ceiling with cellulose ceiling tiles.

It is also important to note that the BUES HVAC system played a significant role regarding mold growth, as detailed in the previous IAQ assessment conducted in 2019 (Appendix A and <https://www.mass.gov/doc/barnstable-united-elementary-school-october-2019/download>). Until the HVAC system can be operated to prevent condensation, it is **strongly recommended not to operate this HVAC system in chilling mode**. If operating correctly and properly draining condensation, HVAC systems can reduce humidity during chiller operation.

Humidity reduction and production of condensation when this HVAC system is operating has been previously recognized and detailed in previous IAQ assessments of this building. Use of dehumidifiers during hot, humid weather on the ground floor may reduce humidity in place of the HVAC system operating in cooling mode.

A method to determine if areas in the BUES are prone to condensation would be to measure air and building material temperatures. If a wide temperature range exists between measurements, the building materials at the colder end of the range may be prone to becoming moistened with condensation in hot, humid weather. Floor temperatures can be measured using a laser thermometer. If constructed in a certain manner, soil temperature in contact with the floor slab may be transferred to the floor and lower walls. This condition is called a thermal bridge, leading to potential condensation which can moisten any materials on the floor. Checking ground floor temperature during the heating season is recommended (when conditions are more pronounced due to temperature extremes) to determine if floors are serving as thermal bridges.

Hot humid summers are becoming more frequent due to climate change. Massachusetts has experienced hot, humid, and rainy summers in 2018, 2021, and 2023. July of 2021 was the wettest ever recorded in Massachusetts, and the three-month period from June through August, known as the meteorological summer, was the fourth wettest on record, according to the National Oceanic and Atmospheric Administration's (NOAA) Centers for Environmental Information (NOAA, 2021). The summer of 2023 was also hot, and wet, being measured as the second rainiest on record (WBUR, 2023). The summer of 2024 has also had significant stretches of hot, humid weather. These conditions are challenging for buildings, particularly those without central air conditioning.

Under these weather conditions, public buildings experienced extended periods of water vapor exposure from high relative humidity. When exposed to these conditions, porous materials such as gypsum wallboard, cardboard, carpeting and other materials may become moistened and colonized with mold, particularly if located in areas that are prone to developing condensation, such as floors and walls in contact with the ground (e.g., below grade space).

The guideline "Preventing Mold Growth In Schools During Hot, Humid Weather" <https://www.mass.gov/info-details/preventing-mold-growth-in-massachusetts-schools-during-hot-humid-weather> should be used to minimize the impact of such weather on classroom

materials. This includes use of air conditioning and dehumidifiers, ensuring exhaust vents are on and operable, keeping windows closed, and ensuring air can circulate around porous materials.

CONCLUSIONS/RECOMMENDATIONS

Based on the observations made during the visit, it appears that most water-damaged materials were thoroughly dried and/or removed. Most of the following recommendations were made on-site at the time of assessment and are reiterated below:

1. Continue with restoration/reconstruction plans to replace all water-damaged building materials (ceilings, walls, floors, pipes, electrical, etc.).
2. Until condensation created by the HVAC system is controlled, do not operate the HVAC system in chilling mode.
3. If not already done so, implement recommendations in the 2019 IAQ assessment, <https://www.mass.gov/doc/barnstable-united-elementary-school-october-2019/download>
4. Use windows and floor fans to eject and reduce odors from newly-installed ceiling tiles. Open doors and windows if outdoor relative humidity is below 70%. To increase airflow to reduce ceiling tile odor, use portable fans to vent odor through courtyard doors. In addition, operate the general exhaust ventilation system to remove odors. If outdoor relative humidity is above 70%, close all windows and doors and use the general exhaust ventilation system to reduce new ceiling tile odors.
5. Continue remediation activities which includes cleaning all items and surfaces with a high efficiency particulate arrestance (HEPA) filter equipped vacuum cleaner combined with wet wiping.
6. Ensure that all sinks have water poured into drains to ensure traps are wet to prevent water vapor and associated drain odor from entering occupied space.
7. Consider discarding the carpet in Picture 2.
8. Use of HEPA filter equipped air cleaners is recommended in classrooms to capture any airborne dust and debris, including mold, mold spores and/or pollen.
9. Discard mold-colonized porous materials if found. If stored materials are found to be moldy, clean or discard per EPA mold guidelines. If mold odors are found from other items such as instrument cases, stored paper, cardboard, cloth/fabric, and other porous materials, discard and replace the affected materials.

10. For more information on mold refer to the US EPA's "Mold Remediation in Schools and Commercial Buildings," available at: <http://www.epa.gov/mold/mold-remediation-schools-and-commercial-buildings-guide>.
11. Measure temperatures on ground floors. If difference in temperature between air and floors is greater than 5°F, floors may be prone to condensation during hot, humid weather when HVAC system chiller is deactivated.
12. Refer to resource manuals and other related IAQ documents for further building-wide evaluations and advice on maintaining public buildings. Copies of these materials are located on the MDPH's website: <http://mass.gov/dph/iaq>.

REFERENCES

[Center for Green Schools](#). 2024. U.S. Green Building Council, Inc. [School mold prevention programs help keep schools healthy | U.S. Green Building Council \(usgbc.org\)](#). Lauren Bolton, Aug 22, 2024.

MDPH. 2015. Massachusetts Department of Public Health. Indoor Air Quality Manual: Chapters I-III. Available at: <https://www.mass.gov/lists/indoor-air-quality-manual-and-appendices#indoor-air-quality-manual->.

NOAA. 2021. Summer 2021 neck and neck with Dust Bowl summer for hottest on record. National Oceanic and Atmospheric Administration, 1401 Constitution Avenue NW, Room 5128, Washington, DC 20230 <https://www.noaa.gov/news/summer-2021-neck-and-neck-with-dust-bowl-summer-for-hottest-on-record>.

US EPA. 2008. “Mold Remediation in Schools and Commercial Buildings”. Office of Air and Radiation, Indoor Environments Division, Washington, DC. EPA 402-K-01-001. September 2008. Available at: <http://www.epa.gov/mold/mold-remediation-schools-and-commercial-buildings-guide>.

WBUR. 2023. “It's been a summer of rain and flooding misery in Mass.” WBUR local news. September 12, 2023. <https://www.wbur.org/news/2023/09/12/summer-flooding-rain-massachusetts>

Picture 1



Custodial sink with mold odor from dry drain trap

Picture 2



Carpet in music room

Picture 3



Bowed ceiling tiles

Location: Barnstable United Elementary School

**Address: 730 Osterville W. Barnstable Rd.,
Marstons Mills, Barnstable, MA**

Indoor Air Results

Date: 8/28/2024

Table 1

Location	Temp (°F)	Relative Humidity (%)	Dew Pt. (°F)	Remarks
Background (outside)	73	53	54	
100	74	52	54	
Art room	73	51	54	
Computer room	74	51	55	
101	75	49	55	
102 storage	75	47	57	
104	76	44	53	
106	74	51	55	
107	74	50	54	
108	76	47	54	
108 storage	75	46	53	
Hallway	75	47	53	

Comfort Guidelines

Temperature: 70 - 78 °F
Relative Humidity: 40 - 60%

Location: Barnstable United Elementary School

**Indoor Air
Results**

**Address: 730 Osterville W.
Barnstable Rd.,
Marstons Mills, Barnstable,
MA**

Table 1

Date: 8/28/2024

Location	Temp (°F)	Relative Humidity (%)	Dew Pt. (°F)	Remarks
109	74	51	55	
111	75	48	54	
113	74	51	54	
115	76	50	56	
116	75	50	53	
117	76	50	56	
118	75	50	55	
119	76	48	56	
120	75	49	55	
121	76	49	55	
123	76	49	55	

Comfort Guidelines

Temperature: 70 - 78 °F
Relative Humidity: 40 - 60%

INDOOR AIR QUALITY ASSESSMENT

**Barnstable United Elementary School
730 Osterville W. Barnstable Road
Marstons Mills, Massachusetts**



Prepared by:
Massachusetts Department of Public Health
Bureau of Environmental Health
Indoor Air Quality Program
October 2019

BACKGROUND

Building:	Barnstable United Elementary School (BUES) formally the Horace Mann Charter School
Address:	730 Osterville W. Barnstable Road Marstons Mills, Massachusetts
Assessment Requested by:	Barnstable Board of Health coordinated via Barnstable Public Schools (BPS)
Reason for Request:	Mold concerns prompted this recent request; however, over the past year the MDPH has been involved with a collaborative effort to perform general indoor air quality (IAQ) assessments throughout the Barnstable School District.
Date of Assessment:	September 12 and September 17, 2019
Massachusetts Department of Public Health/Bureau of Environmental Health (MDPH/BEH) Staff Conducting Assessment:	Mike Feeney, Director and Cory Holmes, Environmental Analyst, MDPH/IAQ Program
Building Description:	The BUES is a two-story brick building completed in 1994. The building contains a centralized courtyard, general classrooms, science classrooms, art rooms, music rooms, kitchen, cafeteria, gymnasium, faculty workrooms and office space.
Windows:	Openable

METHODS

Please refer to the IAQ Manual and appendices for methods, sampling procedures, and interpretation of results (MDPH, 2015). Note that this building has been visited by the MDPH IAQ Program in June 2012 at the request of the BPS. The report from that visit can be found at: <https://www.mass.gov/info-details/indoor-air-quality-reports-cities-and-towns-b> (listed as Horace Mann). It is also important to note that the BPS has reportedly created IAQ committees in their school buildings, each with an IAQ liaison/teacher representative that conducts regular walk-throughs to identify on-going and/or potential environmental issues.

RESULTS and DISCUSSION

The following is a summary of indoor air testing results (Tables 1 and 2).

Carbon dioxide levels on September 12 and 17 were above the MDPH recommended level of 800 parts per million (ppm) in about two-thirds of the areas surveyed, which indicates a lack of air exchange in many classrooms at the time of assessment. This is most likely due to deactivated mechanical ventilation components as well as limitations on outside air introduction, which is typical during operation of the air conditioning (AC) system. This is explained further in the Ventilation section of this report.

Temperature measurements on September 12 and 17 were within or close to the MDPH recommended range of 70°F to 78°F in occupied areas, with the exception of room 104 (63°F, Table 1) and the Library (64°F, Table 1), which is reported to be chronically cold. Temperature control issues/thermal comfort complaints were also reported in other areas.

Relative humidity measurements on September 12 were above the MDPH recommended range of 40 to 60% in all areas tested, which was reflective of outdoor conditions (humid/heavy rain) at the time of assessment. However, it is important to note that the building is reported to have chronic issues with water damage and humidity control, this is discussed further in the Microbial/Moisture Concerns portion of this assessment.

Relative humidity measurements on September 17 were within the MDPH comfort guideline of 40-60 percent.

Carbon monoxide levels were non-detectable (ND) in all areas tested on both days of assessment.

Particulate matter (PM_{2.5}) concentrations measured were below the National Ambient Air Quality (NAAQS) level of 35 µg/m³ in all areas tested on both days of assessment, with the exception of room 233, which had a measurement of 239 µg/m³ in close proximity to an electric fragrance diffuser operating at the time of testing. Exposure to particulate matter with a diameter of 2.5 micrometers (µm) or less (PM_{2.5}) can produce immediate, acute health effects upon exposure. A number of activities that occur indoors and/or mechanical devices can generate particulates during normal operations. Sources of indoor airborne particulates may include but are not limited to particles generated during the operation of fan belts in the HVAC system, use of stoves and/or microwave ovens in

kitchen areas; use of photocopiers, fax machines and computer printing devices; operation of an ordinary vacuum cleaner and heavy foot traffic indoors.

Ventilation

A heating, ventilating and air conditioning (HVAC) system has several functions. First it provides heating and, if equipped, cooling. Second, it is a source of fresh air. Finally, an HVAC system will dilute and remove normally-occurring indoor environmental pollutants by not only introducing fresh air, but by filtering the airstream and ejecting stale air to the outdoors via exhaust ventilation. Even if an HVAC system is operating as designed, point sources of respiratory irritation may exist and cause symptoms in sensitive individuals. Carbon dioxide is not a problem in and of itself. It is used as an indicator of the adequacy of the fresh air ventilation.

As carbon dioxide levels rise, it indicates that the ventilating system is malfunctioning or the design occupancy of the room is being exceeded. When this happens, a buildup of common indoor air pollutants can occur, leading to discomfort or health complaints. The Occupational Safety and Health Administration (OSHA) standard for carbon dioxide is 5,000 parts per million parts of air (ppm). Workers may be exposed to this level for 40 hours/week, based on a time-weighted average (OSHA, 1997).

Fresh air in classrooms is supplied by unit ventilators (univents, Picture 1). Univents draw air from the outdoors through a fresh air intake located on the exterior wall of the building (Picture 2) and return air through an air intake located at the base of the unit. Fresh and return air are mixed, filtered, heated or cooled and provided to rooms through an air diffuser located in the top of the unit ([Figure 1](#)). In room 205 the univent was reportedly inoperable; therefore no fresh air was being introduced at the time of testing. In addition, in some rooms the top and/or front of some univents were blocked by classroom items (Picture 3). In order for univents to provide fresh air as designed, intakes/returns must remain free of obstructions. Importantly, these units must remain on and be allowed to operate while rooms are occupied. It is also important to note that outside air is typically limited (by pneumatically adjusting intake louvers) during air conditioning (AC) season and cold/winter months to provide comfort and prevent the freezing of pipes.

Classroom exhaust vents are located in the ceilings (Picture 4) and are connected with ducts to exhaust fans on the roof. A number of these exhaust vents were not drawing air during the assessment. Note that in many classrooms, exhaust vents were located near classroom doors (Picture 5). This design works best with the doors to the hallway closed, otherwise the exhaust vents tend to draw air from the hallway rather than the room which reduces the effectiveness of air circulation. Without adequate supply and exhaust ventilation, excess heat/humidity and environmental pollutants can build up and lead to indoor air/comfort complaints.

Mechanical ventilation in common areas and interior rooms is provided by rooftop air handling units (AHUs). Air is drawn in through air intakes, filtered, heated/cooled, and distributed via ceiling or wall-mounted diffusers. Air is drawn back to AHUs via ceiling or wall-mounted return vents.

The HVAC equipment appears to be original equipment (early 1990s) over 25 years old. Efficient function of equipment of this age is difficult to maintain since compatible replacement parts are often unavailable. According to the American Society of Heating, Refrigeration, and Air-Conditioning Engineering (ASHRAE), the service life¹ of this type of unit is 15-20 years, assuming routine maintenance of the equipment (ASHRAE, 1991). It appears the optimal operational lifespan of this equipment has been exceeded. It was reported that the BPS was in the process of finding a Mechanical Engineering firm to conduct a full evaluation of the building's HVAC equipment.

To maximize air exchange, the IAQ program recommends that both supply and exhaust ventilation operate continuously during periods of occupancy. In order to have proper ventilation with a mechanical ventilation system, the systems must be balanced after installation to provide an adequate amount of fresh air to the interior of a room while removing stale air from the room. It is recommended that HVAC systems be re-balanced every five years to ensure adequate air systems function (SMACNA, 1994).

¹ The service life is the median time during which a particular system or component of ...[an HVAC]... system remains in its original service application and then is replaced. Replacement may occur for any reason, including, but not limited to, failure, general obsolescence, reduced reliability, excessive maintenance cost, and changed system requirements due to such influences as building characteristics or energy prices (ASHRAE, 1991).

Microbial/Moisture Concerns

In order for building materials to support mold growth, a source of water exposure is necessary. Identification and elimination of the source of water moistening building materials is necessary to control mold growth. In the case of the BUES, the main sources of moisture creating conditions conducive to mold growth are relative humidity and operation of the AC system. However other sources of water damage are typically present in most buildings such as roof/window leaks (Picture 6) as well as leaks/condensation from HVAC systems and plumbing.

It should be noted that maintaining relative humidity in school buildings over the summer months, particularly in the Cape Cod area is challenging. Compounding this condition is the use of an AC system in the summer in which a chiller creates cold water that is fed to univents and AHUs for cooling. When the HVAC system was designed, a thermal load (heat produced by occupants and activities) corresponding to the full capacity of the school, approximately 900-1,000 people, is used in design calculations. This thermal load determines the temperature at which the coolant is chilled to provide comfortable air. As is the case with most schools, that population is significantly lower during summer vacation. This discrepancy is likely leading to overcooling when the chiller is in use, which may lead to condensation on surfaces that are chilled below the dew point, which results in flat surfaces/floors becoming wet by condensation. This condition can be further exacerbated by classroom windows and/or exterior doors being left open to the outside or between sections for cleaning and maintenance activities. Therefore many factors should be taken into account over the summer months to make adjustments to the HVAC systems, including:

- Actual occupancy;
- Building design/materials (carpeting vs solid floors);
- Outdoor temperatures;
- Relative humidity conditions;
- Dew point and condensation issues;
- Opening/closing of windows and doors, particularly while the AC system is on (Picture 7);
- Fresh/outdoor air intake;
- Exhaust/return; as well as

- Activities in the building such as steam/carpet cleaning, etc.

It was reported to MDPH/IAQ Program staff that mold growth was observed and cleaned off a number of classroom items over the summer/prior to school opening. Typically solid/non-porous items can be cleaned whereas; porous items such as cardboard, books, ceiling tiles should be discarded as they are difficult to clean. At the time of the assessment water-damaged materials, some with likely/visible mold growth were observed (Tables 1 and 2), such as:

- Ceiling tiles (Pictures 8 and 9), which can indicate current/historic roof/plumbing leaks or other water infiltration. Active leaks were reported on the second floor in the hallway (near Room 217), where school staff reported ceiling tiles had been recently changed (Picture 10). Water-damaged ceiling tiles can provide a source of mold and should be replaced after a water leak is discovered and repaired;
- Instrument cases in the band room (Picture 11);
- Desk/chair unit in unoccupied Room 107 (Pictures 12a and 12b);
- Refrigerator gaskets in classrooms and the Teacher's Lounge (Pictures 13 and 14);
- Water-stained gypsum wallboard outside the library (Picture 15). Note, this material was tested for moisture content on September 17 and found dry;
- Insulation material in ceiling above art room closet (Picture 16); and
- Various classroom items (Pictures 17 through 19).

The US Environmental Protection Agency (US EPA) and the American Conference of Governmental Industrial Hygienists (ACGIH) recommend that porous materials (e.g., ceiling tiles, carpet) be dried with fans and heating within 24 to 48 hours of becoming wet (US EPA, 2008; ACGIH, 1989). If not dried within this time frame, mold growth may occur. Once mold has colonized porous materials, they are difficult to clean and should be removed. Corkboards are reported to be a chronic problem over the summer months. If not critical to the learning environment, consider removing these items from the building.

Plants were present in some classrooms and other areas. Plants, soil, and drip pans can serve as sources of mold/bacterial growth. Plants should be properly maintained, over-watering of plants should be avoided, and drip pans should be inspected periodically for mold growth. In addition, plants should not be placed on top of or in the airstream of HVAC equipment such as univents.

A perimeter inspection of the building was conducted to identify any breaches/potential pathways for water intrusion:

- Wooden fascia board was exposed near the roof (near front of building);
- Plants/shrubbery in close contact with exterior walls (Pictures 20 and 21);
- Clinging plants on masonry (Picture 21);
- A leaking plumbing fixture (Picture 22); and
- Lack of gutters and downspouts on parts of the roof that cause splash back against exterior walls (Pictures 23 through 25).

Over time, these conditions can undermine the integrity of the building envelope and provide a means of water entry into the building via capillary action through foundation concrete and masonry (Lstiburek & Brennan, 2001). The freezing and thawing action of water during the winter months can create cracks and fissures in the foundation. These breaches may provide a means for moisture and pests to enter the building.

During the exterior examination MDPH/IAQ Program staff also noted exterior wall drainage hindered by clogged/plugged weep holes (Pictures 26 and 27). In modern construction, brick exterior wall systems are usually designed to prevent moisture penetration into the building interior. An exterior wall system usually consists of an exterior brick curtain wall ([Figure 2](#)). Behind the curtain wall is an air space that allows for water to drain downward and for the exterior cladding system to dry. At the base of the curtain wall should be weep holes that allow for water drainage. Opposite the exterior wall and across the air space is a continuous, water-resistant material adhered to the backup wall that forms the drainage plane.

The purpose of the drainage plane is to prevent moisture that crosses the air space from penetrating into interior building systems. The plane also directs moisture downwards toward the weep holes. The drainage plane can consist of a number of water-resistant materials, such as tarpaper or, in newer buildings, plastic wraps, and should be continuous. Where breaks exist in the drainage plane (e.g., window systems, door systems and univent fresh air intakes), additional materials (e.g., flashing) are installed as transitional surfaces to direct water to weep holes. If the drainage plane is discontinuous, missing flashing, or lacking air space, rainwater may accumulate inside the wall cavity and lead to moisture penetration into the building.

In order to allow for water to drain from the exterior brick wall system, a series of weep holes is customarily installed at or near the foundation slab/exterior wall system junction ([Figure](#)

2). Weep holes allow for accumulated water to drain from a wall system (Dalzell, 1955). Failure to install weep holes in brickwork or clogging/burial of weep holes below grade will allow water to accumulate in the base of walls, resulting in seepage and possible moistening of building components ([Figure 3](#)).

Also noted on exterior walls was the presence of rust-colored scale/debris from AC condensation pipes (Picture 28). This may indicate that metal drip pans are corroded/at the end of their service life. It is important that drip pans be smooth/clean and drain properly to prevent debris from clogging drain holes, which can lead to standing water and bacterial/mold growth and associated odors within units.

Often times, classroom design can have a negative effect on air quality. A design issue that was noted was the configuration of ceiling-mounted univents in first floor classrooms and the installation of suspended lighting fixtures and sprinkler heads directly in the line of airflow. During operation of univents, these items will collect airborne dust/debris and or be cooled by the AC system, which can lead to condensation on cold surfaces and mold growth (Pictures 29 through 31). The condensation phenomenon would not occur if these structures were not in the air stream when the HVAC system is in chilled air mode or during the heating season. If a building is designed to have ceiling-mounted univents, locating metal protrusions from the suspended ceiling in the airstream is not recommended.

Relative Humidity

Of particular concern are weather patterns of high temperatures (heat waves) and elevated humidity conditions (> 70%) for extended periods of time (three/more consecutive days). If a building does not have either adequate exhaust ventilation and/or air chilling capacity to remove/reduce relative humidity from outside air, then hot, moist air can be introduced into a building and linger to increase occupant discomfort as well as possibly moisten materials that may lead to mold growth. The MDPH recommends a comfort range of 40 to 60 percent for indoor air relative humidity, which were exceeded throughout the building during the September 12th visit. Chronic issues with excess humidity were evident by the presence of “bowed” (i.e., non-flush) ceiling tiles throughout the building (Picture 32).

High relative humidity indoors can indicate that the HVAC system is insufficient to remove water vapor without the aid of air conditioning or dehumidification. It was observed that

several dehumidifiers were being used in conjunction with the AC system at the time of the assessment. Moisture removal is important since higher humidity at a given temperature reduces the ability of the body to cool itself by sweating. “Heat index” and “apparent temperature” are measurements that take into account the impact of a combination of heat and humidity on how individuals perceive heat. At a given indoor temperature, the addition of humid air increases occupant discomfort and may generate heat complaints. If moisture levels are decreased, the comfort of the individuals can increase. Relative humidity in excess of 70 percent for extended periods of time can provide an environment for mold and fungal growth (ASHRAE, 1989).

Compounding this condition is the use of an AC system in the summer in which a chiller creates cold water that is fed to univents and AHUs for cooling. When the HVAC system was designed, a thermal load (heat produced by occupants and activities) corresponding to the full capacity of the school, approximately 900-1000 people, was likely used in design calculations. This thermal load determines the temperature at which the coolant is chilled to provide comfortable air. With occupancy being considerably less during summer vacation, this is likely leading to overcooling when the chiller is in use, which may lead to condensation on surfaces that are chilled below the dew point. Without proper control/adjustment, the operation of the HVAC system in the chilling mode can result in the floor becoming wet by condensation during summer months. This condition can be further exacerbated by exterior doors or windows being left open to the outside while the AC system is in operation (Pictures 7 and 24).

Other Conditions

Other conditions that can affect indoor air quality were observed during the assessment. The MDPH recommends pleated filters with a Minimum Efficiency Reporting Value (MERV) of 8, which are adequate in filtering out pollen and mold spores (ASHRAE, 2012). Filters should also be changed two to four times a year, or per the manufacturer’s recommendations. To change univent filters, BUES maintenance staff must remove a panel on the front of the unit, open a filter access panel and remove a metal frame to access the filter medium (Picture 33). The type of filter medium used by the school comes in a bulk roll and must be cut to size. This method is extremely time intensive and the results are variable; if the filter medium is not properly fitted, gaps can allow unfiltered air into the room and/or reduce the useful life of the filter. It should be determined if disposable filters with an appropriate dust spot efficiency can be installed in these

univents. The dust spot efficiency is the ability of a filter to remove particulates of a certain diameter from air passing through the filter. Note that increased filtration can reduce airflow by increased resistance. Prior to any increase of filtration, each univent should be evaluated by a ventilation engineer as to whether it can maintain function with more efficient filters.

In some areas, exhaust vents, supply diffusers and the interior of univents had accumulated dust/debris (Table 1, Pictures 4, 34 and 35). This dust can be reaerosolized under certain conditions, and can also be a medium for mold growth. Univent cabinets can also accumulate dust and debris which should be cleaned when filters are changed (2-4 times/year).

Some areas had wall to wall carpeting, in some cases the carpet was wrinkled/worn and appeared to be past its useful life (Pictures 36 and 37). The service life of carpeting in schools is approximately 10-11 years (IICRC, 2002). Aging carpet can produce fibers that can be irritating to the respiratory system. In addition, tears or lifting carpet can create tripping hazards. Area rugs were also observed in many classrooms (Table 1). Carpets should be cleaned annually (or semi-annually in soiled/high traffic areas) in accordance with Institute of Inspection, Cleaning and Restoration Certification (IICRC) recommendations, (IICRC, 2012). Regular cleaning with a high efficiency particulate air (HEPA) filtered vacuum in combination with an annual cleaning will help to reduce accumulation and potential aerosolization of materials from carpeting. Area carpets too worn to be effectively cleaned should be replaced. Area rugs should be rolled up and stored in a clean, dry place when rooms are not occupied during the summer months to prevent moistening due to condensation.

In many classrooms, large numbers of items were on floors, windowsills, tabletops, counters, bookcases, and desks, which provide a source for dusts to accumulate. These items (e.g., papers, folders, boxes) make it difficult for custodial staff to clean. Items should be relocated and/or be cleaned periodically to avoid excessive dust build up. In addition, dust and debris can accumulate on flat surfaces (e.g., desktops, shelving, and carpets) in occupied areas and subsequently be re-aerosolized causing further irritation.

Aquariums were located in a few classrooms. Aquariums should be properly maintained to prevent bacterial/mold/algal growth and associated nuisance odors.

Exposure to low levels of total volatile organic compounds (TVOCs) may produce eye, nose, throat, and/or respiratory irritation in some sensitive individuals. BEH/IAQ staff examined rooms for products containing VOCs. BEH/IAQ staff noted hand sanitizers, scented products,

plug in air fresheners/diffusers (Picture 38), home cleaning products, and dry erase materials in use within the building. All of these products have the potential to be irritants to the eyes, nose, throat, and respiratory system of sensitive individuals. In addition, spray bottles/cleaning products should be *kept out of reach of children*.

Several areas contain photocopiers, which can give off waste heat and irritating odors. VOCs and ozone can be produced by photocopiers, particularly if the equipment is older and in frequent use. Ozone is a respiratory irritant (Schmidt Etkin, D., 1992). These units should be used in well-ventilated areas or in rooms with local exhaust ventilation.

Note that the Environmental Protection Agency (EPA) conducted a National School Radon Survey in which it discovered nearly one in five schools had "...at least one frequently occupied ground contact room with short-term radon levels above 4 [picocuries per liter] pCi/L" (US EPA 1993). The BEH/IAQ Program therefore recommends that every school be tested for radon, and that this testing be conducted during the heating season while school is in session in a manner consistent with USEPA radon testing guidelines. Radon measurement specialists and other information can be found at www.nrsb.org and <http://aarst-nrpp.com/wp>, with additional information at: <http://www.mass.gov/eohhs/gov/departments/dph/programs/environmental-health/exposure-topics/iaq/radon>.

Finally, musty odors were detected in interior room 108a. No visible mold growth and/or obvious signs of water damage were observed in this room, which had cinderblock walls and tile floors. Therefore, it is likely that either items or furniture located in this room is the source of the odors.

RECOMMENDATIONS

The conditions related to IAQ problems at the BUES raise a number of issues. The general building conditions/design, maintenance, work hygiene practices, and the condition of HVAC equipment, if considered individually, present conditions that could degrade IAQ. When combined, these conditions can serve to further degrade IAQ. Some of these conditions can be remedied by actions of building occupants. Other remediation efforts will require alteration to the building structure and equipment. For these reasons, a two-phase approach is recommended. The first consists of **short-term** measures to improve air quality and the second consists of **long-**

term measures that will require planning and resources to adequately address overall IAQ concerns.

Short-term measures:

1. Consider raising the set point for the HVAC system during periods of hot weather when building is mostly empty of occupants to limit condensation.
2. Continue to employ district-wide/building specific IAQ committees/liaisons with regular walk-troughs of the building to identify on-going and/or potential issues.
3. Operate the HVAC system (supply/exhaust) to provide for *continuous* fresh air ventilation during occupied hours.
4. Continue to make repairs to univent in room 205 (and any other areas).
5. Remove furniture and items blocking the front and top of univents.
6. Periodically assess whether exhaust vents (classrooms and restrooms) are drawing air and make repairs as needed.
7. Use openable windows to supplement fresh air during temperate weather. Ensure all windows are closed tightly at the end of each day. *Do not* use windows while AC system is operating to prevent condensation/mold growth.
8. Close classroom doors during occupancy to allow for more effective function of exhaust vents (once operating as designed).
9. Work with staff to troubleshoot temperature control problems.
10. Utilize a system to report and track maintenance issues (e.g., school dude) so that concerns can be reported by staff and maintenance staff can report when issues have been resolved.
11. Consider adopting a balancing schedule of every 5 years for all mechanical ventilation systems, as recommended by ventilation industrial standards (SMACNA, 1994).
12. Work with a roofing contractor/building engineer to investigate/repair building envelope leaks (e.g., 2nd floor hallway/windows in Room 215). Until this has been completed, avoid storing porous materials in areas of known leaks.
13. Once repairs are made, replace water-damaged ceiling tiles, and refinish areas of water damage. Inspect the area above the stained tiles for water damage or odors and remediate or clean as necessary.

14. Discard porous classroom items that have mold growth (e.g., books, cardboard, paper). Conduct a close examination of items in storage closets and the band room. Non-porous items can be cleaned with soap/water or an anti-microbial product.
15. Keep classroom/office plants in good condition, avoid overwatering, and keep them away from the airstream of ventilation equipment.
16. Ensure aquariums are clean and odor free.
17. Reduce or eliminate the use of air fresheners/diffusers, scented cleaners, hand sanitizers and dry erase materials to reduce irritation. In addition, spray bottles/cleaning products should be *kept out of reach of children*.
18. Use photocopiers in well-ventilated/open spaces or in areas with local exhaust ventilation.
19. Change filters in HVAC units 2-4 times a year with MERV 8 (or higher) filters. Clean HVAC and univent cabinets of debris and dust when filters are changed.
20. Consider using disposable, pleated cardboard filters instead of filter media that needs to be hand cut and installed in metal racks.
21. Clean supply/exhaust vents and personal fans regularly to remove accumulated dust/debris. Replace surrounding ceiling tiles that cannot be adequately cleaned.
22. Ensure all refrigerators are kept clean to prevent microbial growth and odors. Clean gaskets and other surfaces with a mild antimicrobial solution to remove debris and mold. If cannot be adequately cleaned-replace.
23. Ensure that condensation from AC equipment is draining properly. Check collector pans, piping and any associated pumps for clogs and leaks and clean periodically to prevent stagnant water build-up and remove debris that may provide a medium for microbial growth.
24. Trim back trees from overhanging the roof and ensure all plants/shrubs are located at least five feet away from exterior walls. Remove clinging plants.
25. Fix plumbing leak shown in Picture 22.
26. Continue to utilize portable dehumidifiers as needed during excessive relative humidity periods (>70%). Ensure dehumidifiers are cleaned/maintained as per the manufacturer's instructions to prevent mold/bacterial growth.

27. Repair/replace all water-damaged/mold-colonized porous building materials (e.g., ceiling tiles, gypsum wallboard) in classrooms, hallways, and common areas in a manner consistent with the U.S. Environmental Protection Agency's guidelines (US EPA, 2008).
28. If water damage/mold growth on corkboards continues to be a problem, consider removing from the building.
29. For buildings in New England, periods of low relative humidity during the winter are often unavoidable. Therefore, scrupulous cleaning practices should be adopted to minimize common indoor air contaminants whose irritant effects can be enhanced when the relative humidity is low. To control for dusts, a high efficiency particulate arrestance (HEPA) filter equipped vacuum cleaner in conjunction with wet wiping of all surfaces is recommended. Avoid the use of feather dusters. Drinking water during the day can help ease some symptoms associated with a dry environment (throat and sinus irritations).
30. Replace any missing or ajar ceiling tiles to avoid pathways to unconditioned areas.
31. Clean carpeting annually or semi-annually in soiled high traffic areas as per the recommendations of the Institute of Inspection, Cleaning and Restoration Certification (IICRC 2012). Area carpets too worn to be effectively cleaned should be replaced. Roll up and store area rugs in a clean, dry place during the summer.
32. Consider a long-term plan to replace all carpeting in the building as funds become available. Consider replacing carpeting with a non-porous surface such as vinyl tile particularly in below-grade areas.
33. Relocate or consider reducing the amount of materials stored in classrooms to allow for more thorough cleaning of classrooms. Clean items regularly with a wet cloth or sponge to prevent excessive dust build-up.
34. Remove all items from Room 108a to determine if odors dissipate. If odors persist have the AHU above the ceiling fully evaluated for function/proper drainage to rule out as a source of odor.
35. Continue to utilize the US EPA's (2000), "Tools for Schools", as an instrument for maintaining a good IAQ environment in the building available at:
<http://www.epa.gov/iaq/schools/index.html>.

36. The school should be tested for radon by a certified radon measurement specialist during the heating season when school is in session. Radon measurement specialists and other information can be found at: www.nrsb.org, and <http://aarst-nrpp.com/wp>.
37. For more information on mold refer to “Mold Remediation in Schools and Commercial Buildings” published by the US Environmental Protection Agency (US EPA, 2008). <http://www.epa.gov/mold/mold-remediation-schools-and-commercial-buildings-guide>.

Long-term Recommendations:

1. Continue with plans to contact an HVAC engineering firm for an assessment of the ventilation system’s components and control systems (e.g., controls, air intake louvers, thermostats). Based on the age, physical deterioration, and availability of parts for ventilation components, such an evaluation is necessary to determine the operability and feasibility of repairing/replacing the equipment.
2. Examine drip pans building-wide for corrosion/proper drainage and replace as necessary.
3. Remove blockages from affected weep holes to ensure proper operation of drainage plane.
4. Consider relocating all suspended lighting fixtures and sprinkler heads (if possible) from in direct line of airflow of univents/AC. Due to this design configuration, these structures will continue to accumulate dust/debris and be subject to cooling/condensation and likely mold growth in the future. In the interim, these items should be cleaned regularly to prevent such occurrence.
5. As discussed in the report there are many factors that must be taken into consideration to operate the building’s HVAC system efficiently over the summer months to provide comfort and prevent condensation/mold growth; consult with an HVAC engineering firm regarding best practices for operation.
6. Consider installing a full gutter/down spout system to draw/drain water away from the building.

REFERENCES

- ACGIH. 1989. Guidelines for the Assessment of Bioaerosols in the Indoor Environment. American Conference of Governmental Industrial Hygienists, Cincinnati, OH.
- ASHRAE. 1989. Ventilation for Acceptable Indoor Air Quality. American Society of Heating, Refrigeration and Air Conditioning Engineers. ANSI/ASHRAE 62-1989.
- ASHRAE. 1991. ASHRAE Applications Handbook, Chapter 33 “Owning and Operating Costs”. American Society of Heating, Refrigeration and Air Conditioning Engineers, Atlanta, GA.
- ASHRAE. 2012. American Society of Heating, Refrigeration and Air Conditioning Engineers (ASHRAE) Standard 52.2-2012 -- Method of Testing General Ventilation Air-Cleaning Devices for Removal Efficiency by Particle Size (ANSI Approved). 2012.
- Dalzell, J.R. 1955. Simplified Masonry Planning and Building. McGraw-Hill Book Company, Inc. New York, NY.
- IICRC. 2002. Institute of Inspection, Cleaning and Restoration Certification. A Life-Cycle Cost Analysis for Floor Coverings in School Facilities.
- IICRC. 2012. Institute of Inspection Cleaning and Restoration Certification. Institute of Inspection, Cleaning and Restoration Certification. Carpet Cleaning: FAQ.
- Lstiburek, J. & Brennan, T. 2001. Read This Before You Design, Build or Renovate. Building Science Corporation, Westford, MA. U.S. Department of Housing and Urban Development, Region I, Boston, MA.
- MDPH. 2015. Massachusetts Department of Public Health. Indoor Air Quality Manual: Chapters I-III. Available at: <http://www.mass.gov/eohhs/gov/departments/dph/programs/environmental-health/exposure-topics/iaq/iaq-manual/>.
- OSHA. 1997. Limits for Air Contaminants. Occupational Safety and Health Administration. Code of Federal Regulations. 29 C.F.R 1910.1000 Table Z-1-A.
- Schmidt Etkin, D. 1992. Office Furnishings/Equipment & IAQ Health Impacts, Prevention & Mitigation. Cutter Information Corporation, Indoor Air Quality Update, Arlington, MA.
- SMACNA. 1994. HVAC Systems Commissioning Manual. 1st ed. Sheet Metal and Air Conditioning Contractors' National Association, Inc., Chantilly, VA.
- US EPA. 1993. Radon Measurement in Schools, Revised Edition. Office of Air and Radiation, Office of Radiation and Indoor Air, Indoor Environments Division (6609J). EPA 402-R-92-014. <https://www.epa.gov/radon/radon-schools>
- US EPA. 2000. Tools for Schools. Office of Air and Radiation, Office of Radiation and Indoor Air, Indoor Environments Division (6609J). EPA 402-K-95-001, Second Edition. <http://www.epa.gov/iaq/schools/index.html>.

- US EPA. 2008. Mold Remediation in Schools and Commercial Buildings. US Environmental Protection Agency, Office of Air and Radiation, Indoor Environments Division, Washington, D.C. EPA 402-K-01-001. <http://www.epa.gov/mold/mold-remediation-schools-and-commercial-buildings-guide>.

Picture 1



Classroom univent

Picture 2



Univent fresh air intakes

Picture 3



Univent return vent (bottom front) obstructed by classroom furniture

Picture 4



Classroom exhaust vent, note accumulated dust/debris

Picture 5



Proximity of classroom exhaust vent (arrows) to open hallway door

Picture 6



Standing water from active leak on masonry/windowsill in classroom 215, note duct tape on left window

Picture 7



Classroom windows open while AC system in operation

Picture 8



Water-damage/mold growth on ceiling tiles room 219

Picture 9



Water damage/mold growth on ceiling tiles room 107

Picture 10



Water-damaged ceiling tiles in 2nd floor hallway near Room 217

Picture 11



Mold growth on instrument case in band storage room

Pictures 12a and 12b



Mold growth on chair/desk unit labeled "Please Take away"

Picture 13



Debris/mold growth on mini-fridge gasket in classroom

Picture 14




Debris/mold growth on mini-fridge gasket in Faculty Lounge

Picture 15




Water-stained gypsum wallboard outside Library

Picture 16

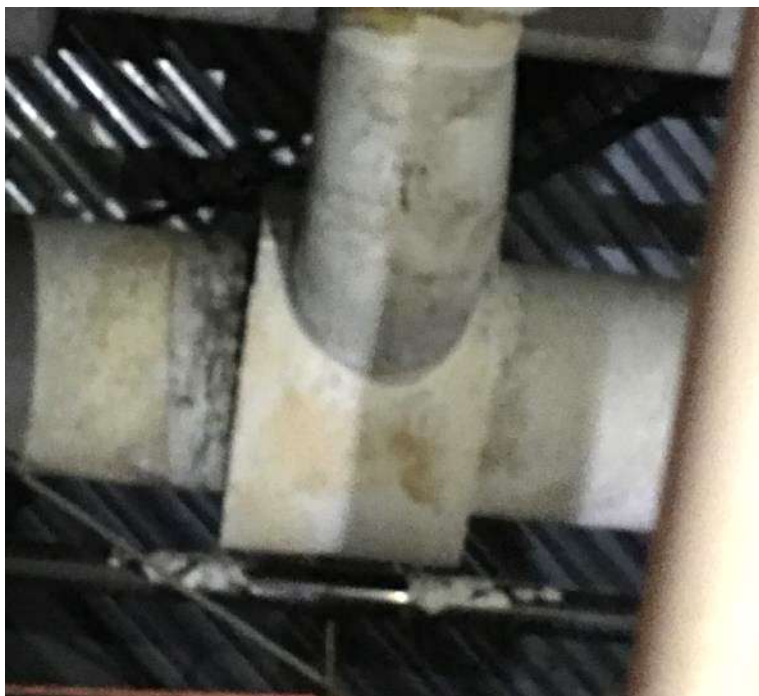

Insulation material in art room closet

Picture 17

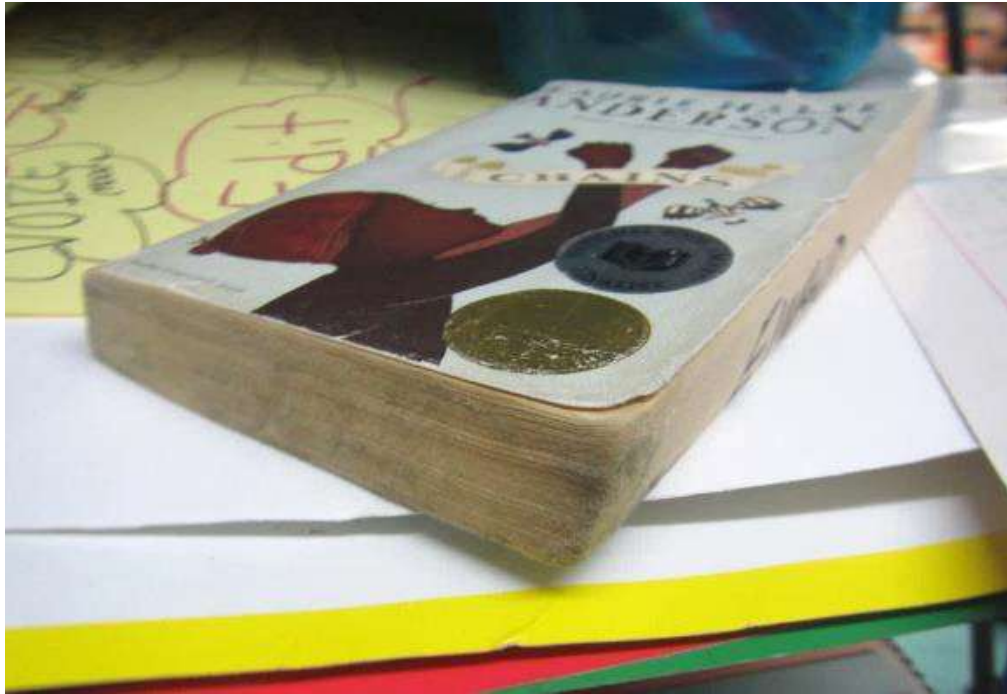

Mold growth on book in closet in Room 207

Picture 18



Staining from mold growth on fabric classroom item

Picture 19



Moldy/odorous bamboo in Art room closet

Picture 20



Trees/shrubbery in close contact with exterior walls

Picture 21



Trees/shrubbery in close contact with exterior walls, also note clinging plants

Picture 22



Leaking plumbing fixture

Picture 23



Moss growth from chronic water exposure on exterior walls

Picture 24



Trough along exterior of building due to roof runoff/lack of gutters, also note open classroom window while AC system operating

Picture 25



Heavy moss growth/discoloration of foundation due to chronic water exposure (i.e., splash back) from lack of drainage/gutters/downspouts

Picture 26



Clogged/plugged weep hole (arrow)

Picture 27



Clogged/plugged weep hole

Picture 28



Debris/scale from condensate pipe/drip pans

Picture 29



Dust/debris/staining on light fixture directly in front of univent, also note sprinkler head

Picture 30



Suspended lighting fixture and stained tile in front of univent

Picture 31



Water-damaged/moldy ceiling tiles and metal sprinkler head directly in front of univent

Picture 32



“Bowed” (non-flush) ceiling tiles in first floor classroom

Picture 33



Metal filter rack and media that needs to be “cut to size” and installed in univents

Picture 34



Accumulated dust/debris on supply diffuser and surrounding ceiling tile

Picture 35



Accumulated dust/debris on interior univent components

Picture 36



Original (20+ yr.)/wrinkled carpeting in Library

Picture 37



Original (20+ yr.)/wrinkled carpeting in Guidance Dept

Picture 38



Plug-in air freshener in classroom

Location: Barnstable United Elementary School

Address: 730 Osterville W. Barnstable Rd., Marstons Mills, MA Table 1

Indoor Air Results

Date: 9/12/2019

Location	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)	Temp (°F)	Relative Humidity (%)	PM2.5 (µg/m³)	Occupants in Room	Windows Openable	Ventilation		Remarks
								Supply	Exhaust	
Background (outside)	405	ND	63	100	2					Moderate to heavy rain/humid, winds: NNE 14 mph
Main Office	934	ND	69	61	4	2	Y	Y	Y	
1	999	ND	72	72	4	0	Y	N	Y	
2	1050	ND	70	70	4	0	Y	N	Y	WAC
3	1044	ND	76	74	7	0	Y	N	Y	WD CT, WAC
4	898	ND	72	69	4	0	Y	N	Y	
5 RR	1032	ND	76	69	1	0	Y	N	Y	
104	528	ND	63	63	2	0	Y	Y	Y	Dehumidifier, bowed CTs
108	725	ND	72	71	ND	0	Y	Y	Y	Bowed CTs, window fail
119	1000	ND	70	65	ND	23	Y	Y	Y	Bowed CTs, Sprinkler head in airflow 60 °F (dew point = 58°F)
127	548	ND	71	68	ND	1	Y	Y	Y	Bowed CTs
130	938	ND	74	68	ND	24	Y	Y	Y	Bowed CTs
131	955	ND	74	67	ND	23	Y	Y	Y	Bowed CTs

ppm = parts per million

AF = air freshener

DO = door open

CP = cleaning products

UV = univent

µg/m³ = micrograms per cubic meter

WD = water-damaged

HS = hand sanitizer

GW = gypsum wallboard

WAC = window air conditioner

ND = non detect

CT = ceiling tile

PC = photocopier

Comfort Guidelines

Carbon Dioxide: < 800 ppm = preferable
> 800 ppm = indicative of ventilation problems

Temperature: 70 - 78 °F
Relative Humidity: 40 - 60%

Location: Barnstable United Elementary School

**Indoor Air
Results**

Address: 730 Osterville W. Barnstable Rd., Marstons Mills, MA

Date: 9/12/2019

Location	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)	Temp (°F)	Relative Humidity (%)	PM2.5 (µg/m³)	Occupants in Room	Windows Openable	Ventilation		Remarks
								Supply	Exhaust	
135 Art Room	507	ND	69	73	ND	7	Y	Y	Y	Bowed CT
135 Closet	677	ND	72	69	ND					Closet mold, moldy bamboo
Library	896	ND	64	63	3	24	Y	Y	Y	Cold, wall to wall carpet-wrinkled, peeling paint/WD-rotunda
203 Network/Copy room	922	ND	72	68	4	0	N	Y	Y	Dust/debris-vents/CTs
205	1069	ND	74	68	5	2	Y	Y Off	Y Off	UV-on repair list, area rugs, plug in AF, HS, 25 occupants gone ~ 8 mins
Dean of Students	892	ND	73	67	2	0	Y	Y	Y	Wall to wall carpet
207	752	ND	72	71	4	22	Y	Y	Y Off	Area rug, moldy book-closet
208	563	ND	71	71	2	2	Y	Y	Y	Kids at specialist
209	500	ND	70	68	1	24	Y	Y	Y	
210	1188	ND	68	73	3	17	Y	Y	Y	Exhaust vent near hallway door, area rug, WD CT

ppm = parts per million

AF = air freshener

DO = door open

CP = cleaning products

UV = univent

µg/m³ = micrograms per cubic meter

WD = water-damaged

HS = hand sanitizer

GW = gypsum wallboard

WAC = window air conditioner

ND = non detect

CT = ceiling tile

PC = photocopier

Comfort Guidelines

Carbon Dioxide: < 800 ppm = preferable
> 800 ppm = indicative of ventilation problems

Temperature: 70 - 78 °F
Relative Humidity: 40 - 60%

Location: Barnstable United Elementary School

**Indoor Air
Results**

Address: 730 Osterville W. Barnstable Rd., Marstons Mills, MA

Date: 9/12/2019

Location	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)	Temp (°F)	Relative Humidity (%)	PM2.5 (µg/m³)	Occupants in Room	Windows Openable	Ventilation		Remarks
								Supply	Exhaust	
211	681	ND	69	71	2	1	Y	Y	Y	
212	922	ND	72	69	3	0	Y	Y	Y	
2 nd Floor Hallway outside Library										WD GW-stains, WD CTs
213	697	ND	71	71	2	3	Y	Y	Y	Dust/debris-vents
214	797	ND	71	72	3	0	Y	Y	Y	2 WD CTs
Custodial Closet							N	N	Y	WD CTs, missing light cover
2 nd Fl Hallway (near 217)										WD CTs (current leak?)
215	1015	ND	70	67	2	19	Y	Y	Y	Window leak/standing water observed on window sill (cement block), dust/debris-vents
217	850	ND	70	68	3	20	Y	Y	Y	UV-obstructed (front), window open
218	1243	ND	70	68	3	22	Y	Y	Y	

ppm = parts per million

AF = air freshener

DO = door open

CP = cleaning products

UV = univent

µg/m³ = micrograms per cubic meter

WD = water-damaged

HS = hand sanitizer

GW = gypsum wallboard

WAC = window air conditioner

ND = non detect

CT = ceiling tile

PC = photocopier

Comfort Guidelines

Carbon Dioxide: < 800 ppm = preferable
> 800 ppm = indicative of ventilation problems

Temperature: 70 - 78 °F
Relative Humidity: 40 - 60%

Location: Barnstable United Elementary School

**Indoor Air
Results**

Address: 730 Osterville W. Barnstable Rd., Marstons Mills, MA

Date: 9/12/2019

Location	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)	Temp (°F)	Relative Humidity (%)	PM2.5 (µg/m³)	Occupants in Room	Windows Openable	Ventilation		Remarks
								Supply	Exhaust	
219	698	ND	70	70	2	0	Y	Y	Y	WD CTs-mold growth, dust/debris-vents
220	1266	ND	70	71	2	21	Y	Y	Y	Exhaust vent near hallway door
221	1441	ND	70	68	2	23	Y	Y	Y	CPs-countertop
222	936	ND	68	69	2	0	Y	Y	Y	Dust/debris-vents
223	1357	ND	70	67	3	25	Y	Y	Y	Dust/debris-vents, leak ceiling reported (near UV/exterior wall/ceiling)
225	830	ND	69	67	2	0	Y	Y	Y	

ppm = parts per million

µg/m³ = micrograms per cubic meter

ND = non detect

AF = air freshener

WD = water-damaged

CT = ceiling tile

DO = door open

HS = hand sanitizer

PC = photocopier

CP = cleaning products

GW = gypsum wallboard

UV = univent

WAC = window air conditioner

Comfort Guidelines

Carbon Dioxide: < 800 ppm = preferable
> 800 ppm = indicative of ventilation problems

Temperature: 70 - 78 °F
Relative Humidity: 40 - 60%

Location: Barnstable United Elementary School

Address: 730 Osterville W. Barnstable Rd., Marstons Mills, MA

Table 2

Indoor Air Results

Date: 9/17/2019

Location	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)	Temp (°F)	Relative Humidity (%)	PM2.5 (µg/m³)	Occupants in Room	Windows Openable	Ventilation		Remarks
								Supply	Exhaust	
Background (outside)	418	ND	64	63	13					Clear and sunny, winds: N NW 9-12 mph
102	663	ND	74	53	5	7	Y	Y	Y	Area rug, DO
106 Teachers Lounge	699	ND	73	53	5	5	Y	Y	Y	Refrigerators-mold/gaskets, PC, 2 WD CT-changed recently
107 Storage (unoccupied) Interior Room							N	Y	Y	Dark stains/mold on CTs around vents, mold growth on chair/desk labelled "take away"
108A	889	ND	71	53	3	0	N	Y	Y	Musty odors-no obvious source of WD/mold growth-recommend removing all items (furniture, cork boards, stored items) to see if odor dissipates, dehumidifier
108B	974	ND	71	58	3	7	N	Y	Y	WD CT-possible mold growth
Cafeteria	970	ND	73	59	5	~100	Y	Y	Y	
113 Music	674	ND	73	54	3	2	Y	Y	Y	Storage room-mold/musty odors from instrument cases
Practice Room C	696	ND	73	56	3	0	N	Y	Y	Wall to wall carpet
115	533	ND	75	53	3	1	Y	Y	Y	Dust/debris/staining on light fixtures (airflow of UV)
126	793	ND	73	56	8	21	Y	Y	Y Off	

Location: Barnstable United Elementary School

**Indoor Air
Results**

Address: 730 Osterville W. Barnstable Rd., Marstons Mills, MA

Table 2 (continued)

Date: 9/17/2019

Location	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)	Temp (°F)	Relative Humidity (%)	PM2.5 (µg/m³)	Occupants in Room	Windows Openable	Ventilation		Remarks
								Supply	Exhaust	
Guidance	851	ND	72	56	3	1	N	Y	Y	Wall to wall carpet wrinkled, DO, dust/debris on vents, WD CT, PC
Delaney Office	1025	ND	72	52	3	1	Y	Y	Y Off	Wall to wall carpet
224	1373	ND	76	54	4	23	Y	Y	Y	Area rugs
227	1016	ND	75	54	4	20	Y	Y	Y	Area rugs
228	760	ND	74	54	4	0	Y	Y	Y	Dehumidifier
229	1183	ND	76	54	5	23	Y	Y	Y	DO
230	990	ND	76	52	5	18	Y Open	Y	Y	Area rug/pillows, DO, dehumidifier
231	939	ND	77	50	5	18	Y	Y	Y	Pencils/items in UV, DO, dehumidifier
232	743	ND	74	51	5	0	Y Open	Y	Y	
233	1124	ND	74	57	239*/17	19	Y	Y	Y	*Fragrance diffuser, DO
234	1090	ND	76	53	4	19	Y	Y	Y	DO

ppm = parts per million

µg/m³ = micrograms per cubic meter

HS = hand sanitizer

WD = water-damaged

DO = door open

CT = ceiling tile

PF = personal fan

PC = photocopier

UV = univent

DO = door open

ND = non detect

Comfort Guidelines

Carbon Dioxide: < 800 ppm = preferable
> 800 ppm = indicative of ventilation problems

Temperature: 70 - 78 °F
Relative Humidity: 40 - 60%

Location: Barnstable United Elementary School

**Indoor Air
Results**

Address: 730 Osterville W. Barnstable Rd., Marstons Mills, MA

Table 2 (continued)

Date: 9/17/2019

Location	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)	Temp (°F)	Relative Humidity (%)	PM2.5 (µg/m³)	Occupants in Room	Windows Openable	Ventilation		Remarks
								Supply	Exhaust	
235	991	ND	76	53	4	20	Y	Y	Y	Dust/debris on vents, area rug, DO
236	1231	ND	75	55	4	21	Y	Y	Y	UV-obstructed, area rug, DO
237	1167	ND	76	56	4	18	Y	Y	Y	
238	866	ND	74	53	5	2	Y	Y	Y	Wall to wall carpet-wrinkled, bowed CTs
239	1132	ND	76	54	5	19	Y	Y	Y Off	Area rug/pillows, DO
240	1060	ND	75	53	6	7	Y	Y	Y	UV-deactivated, DO
241	896	ND	76	53	5	22	Y Open	Y	Y	Area rug
242	1040	ND	76	53	9	3	Y	Y Passive	Y	PCs
243	771	ND	74	53	4	1	Y Open	Y	Y	DO, exhaust near hallway door

ppm = parts per million

µg/m³ = micrograms per cubic meter

HS = hand sanitizer

WD = water-damaged

DO = door open

CT = ceiling tile

PF = personal fan

PC = photocopier

UV = univent

DO = door open

ND = non detect

Comfort Guidelines

Carbon Dioxide: < 800 ppm = preferable
> 800 ppm = indicative of ventilation problems

Temperature: 70 - 78 °F
Relative Humidity: 40 - 60%

Location: Barnstable United Elementary School

**Indoor Air
Results**

Address: 730 Osterville W. Barnstable Rd., Marstons Mills, MA

Table 2 (continued)

Date: 9/17/2019

Location	Carbon Dioxide (ppm)	Carbon Monoxide (ppm)	Temp (°F)	Relative Humidity (%)	PM2.5 (µg/m³)	Occupants in Room	Windows Openable	Ventilation		Remarks
								Supply	Exhaust	
244	976	ND	75	53	4	1	Y	Y	Y	Area rug, 23 occupants gone ~ 20 mins
245	856	ND	74	53	5	3	Y	Y	Y	Plants, area rug, DO
246	1183	ND	75	54	5	20	Y	Y	Y Off	Area rug, HS, bowed CTs
247	1048	ND	75	53	3	1	Y	Y	Y Off	DO, WD CT, 22 occupants gone ~15 mins
248	1145	ND	75	55	4	0	Y Open	Y	Y	Class just left, aquarium, food/fruit in basket, dehumidifier
249	1136	ND	75	54	4	0	Y	Y	Y Off	UV-blocked, wasps nests (props), kids at specialist, DO, PF
250	635	ND	73	53	3	0	Y	Y	Y	DO
251	1080	ND	75	56	6	24	Y	Y	Y	DO

ppm = parts per million

µg/m³ = micrograms per cubic meter

HS = hand sanitizer

WD = water-damaged

DO = door open

CT = ceiling tile

PF = personal fan

PC = photocopier

UV = univent

DO = door open

ND = non detect

Comfort Guidelines

Carbon Dioxide: < 800 ppm = preferable
> 800 ppm = indicative of ventilation problems

Temperature: 70 - 78 °F
Relative Humidity: 40 - 60%

Location: Barnstable United Elementary School

**Indoor Air
Results**

Address: 730 Osterville W. Barnstable Rd., Marstons Mills, MA

Table 2 (continued)

Date: 9/17/2019

ppm = parts per million

HS = hand sanitizer

DO = door open

PF = personal fan

UV = univent

ND = non detect

µg/m³ = micrograms per cubic meter

WD = water-damaged

CT = ceiling tile

PC = photocopier

DO = door open

Comfort Guidelines

Carbon Dioxide: < 800 ppm = preferable
> 800 ppm = indicative of ventilation problems

Temperature: 70 - 78 °F
Relative Humidity: 40 - 60%