Prepared for:

Kyrene Elementary School District
8700 South Kyrene Road
Tempe, Arizona 85284

AHERA ASBESTOS MANAGEMENT PLAN

FOR

KYRENE MIDDLE SCHOOL
1050 EAST CARVER ROAD
TEMPE, ARIZONA 85284

Prepared by:



Dominion Environmental Consultants, Inc.
20045 North 19th Avenue, Building 7
Phoenix, Arizona 85027
(623) 516-1415

July 16, 2025

TABLE OF CONTENTS

GENERAL INVENTORY .....SECTION 1

INSPECTION REPORT .....SECTION 2

DESIGNATED PERSON IDENTIFICATION.....SECTION 3

AHERA TRAINING CERTIFICATIONS OF SCHOOL STAFF MEMBERS....SECTION 4

RESPONSE ACTIONS WITH DETAILS, REASONS, & SCHEDULES.....SECTION 5

ACCREDITATION STATEMENT .....SECTION 6

REMAINING ACBM .....SECTION 7

OPERATIONS & MAINTENANCE PLAN .....SECTION 8

EXAMPLE OF INITIAL & ANNUAL NOTIFICATION LETTER .....SECTION 9

COST ESTIMATION.....SECTION 10

MANAGEMENT PLANNER OPTIONAL COMPLIANCE STATEMENT.....SECTION 11

SIGNED STATEMENT BY DESIGNATED PERSON.....SECTION 12

SECTION 1

♦

GENERAL INVENTORY

Dominion Environmental Consultants, Inc.
General Inventory

Client: Kyrene Elementary School District	**Campus: Kyrene Middle School**
Date: July 16, 2025	**Address: 1050 East Carver Road, Tempe, Arizona 85284**

Building	Building Description	BSC or AL	Friable ACBM	Non-Friable ACBM	Assumed ACBM
Building E/L	Classrooms, Restrooms, Locker Rooms, Storage, Electrical, Gymnasium, Stage, Multi-Purpose Room, Kitchen, and Offices	BSC	No	No	Yes
Building F	Classrooms, Restrooms, Stairway, Mechanical, and Storage	BSC	No	No	Yes
Building G	Classrooms, Restrooms, Stairway, Mechanical, and Storage	BSC	No	No	Yes
Building H	Classrooms, Restrooms, Stairway, Mechanical, and Storage	BSC	No	No	Yes
Building J	Classrooms, Tech Lab, Staff Lounge, Workroom, Storage, and Restrooms	BSC	No	No	Yes
Building K	Media Center/Library, Computer Lab, Storage, Mechanical, Health Office, Offices, Conference Room, Closets, Reception, Media Workroom, Janitor's Closet, A/V, and Media Workroom	BSC	No	No	Yes

Key:
BSC = Bulk Samples Collected
Architectural Letter = AL

DOMINION

SECTION 2

♦

INSPECTION REPORT

DOMINION

KYRENE MIDDLE SCHOOL

AHERA Asbestos Inspection Report

Prepared for:

Kyrene Elementary School District
8700 South Kyrene Road
Tempe, Arizona 85284

AHERA ASBESTOS INSPECTION REPORT

FOR

KYRENE MIDDLE SCHOOL
1050 EAST CARVER ROAD
TEMPE, ARIZONA 85284

PURCHASE ORDER NO. 251702

Prepared by:

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue, Building 7
Phoenix, Arizona 85027
(623) 516-1415

Dominion Project Number: AZ1418.57

AHERA Inspection Date: June 11 – June 12, 2025 & June 16, 2025

TABLE OF CONTENTS

LIMITATIONS ..... SECTION 1

INSPECTION PROCESS ..... SECTION 2

EXECUTIVE SUMMARY ..... SECTION 3

SITE PLANS ..... SECTION 4

HOMOGENEOUS MATERIALS INVENTORY LISTS ..... SECTION 5

PLM BULK SAMPLE SHEETS ..... SECTION 6

PLM BULK SAMPLE LOCATION MAPS ..... SECTION 7

PHYSICAL ASSESSMENT INFORMATION SHEETS ..... SECTION 8

LABORATORY REPORTS ..... SECTION 9

ASSUMED ACBM LOCATION MAPS ..... SECTION 10

INSPECTOR ACCREDITATION ..... SECTION 11

LABORATORY ACCREDITATION ..... SECTION 12

SECTION 1

♦

LIMITATIONS

LIMITATIONS

The conclusions and results contained herein are based solely on the information presented in this report. The sampling, testing, and observations described in the report represent conditions only at the specified times and locations. Additional materials or information which were hidden, undiscovered, inaccessible, or not a part of the findings presented herein, would result in the modification of the conclusions and recommendations made herein. Any response action guidelines are based solely on the findings contained herein. The response action guidelines are presented as a courtesy and are not to be considered a complete or detailed set of specifications. Dominion conducted this survey as directed by the client and in compliance with applicable regulations.

Dominion is not responsible for the accuracy of information provided by others, or for conditions or consequences arising from relevant facts that were withheld, concealed, undiscovered, or not fully disclosed. Dominion is not a law firm, and therefore, makes no representations regarding any potential liability of any person or entity for site conditions. Further, Dominion is not qualified to present medical advice. If any present or future health issues are in question, it is recommended that the findings in this report be presented to a qualified medical professional for evaluation.

Kyrene Middle School is currently being used daily, therefore, to avoid conspicuous damage and a possible trip and fall hazard, Dominion was only able to check for secondary flooring layers in the corners of each room. Therefore, if the carpets are to be replaced, additional investigation should be carried out into other areas of the flooring to ensure that an undetected second layer of flooring does not exist. Any necessary samples should be collected by a certified inspector prior to the disturbance of any discovered unsampled flooring.

The conclusions and results contained herein are based solely on the information presented in this report, are for the sole and exclusive use of the Client and are subject to the terms and conditions of "The Contract or Purchase Order." No other person or entity may rely on this report without the prior written consent of Dominion Environmental Consultants.

Dominion's scope of service for this report did not include the inspection for, or identification of fungi, lead paint or any other hazardous or controlled substances not specifically identified herein.

This report presents professional opinions and findings of a scientific or technical nature. Dominion is not a law firm and therefore makes no representations or warranty regarding any potential liability of any person or entity for site conditions.

SECTION 2

♦

INSPECTION PROCESS

INSPECTION PROCESS

The Environmental Protection Agency (EPA) in 40 CFR 763, the Asbestos Hazard Emergency Response Act (AHERA), requires Local Education Agencies (LEAs) to identify friable and non-friable asbestos-containing building material (ACBM) in public and private elementary and secondary schools by visually inspecting school buildings for such materials and by sampling all identified suspect materials if they are not assumed to be ACBM. Those samples are then to be analyzed using appropriate analysis techniques, by a qualified laboratory, as referred to in the regulations. AHERA requires LEAs to only utilize accredited personnel when conducting inspections, re-inspections, developing management plans, or performing response actions. This regulation also includes record-keeping requirements. LEAs may contractually delegate their duties under this rule, but they remain responsible for the proper performance of those duties. LEAs are encouraged to consult with EPA Regional Asbestos Coordinators, or if applicable a State's lead agency designated by the State Governor, for assistance in complying with this rule.

This report complies with AHERA based protocols outlined in 40 CFR 763.85, specifically:

- The campus was visually inspected to identify the locations of all suspected ACBM.
- All suspect materials were touched to determine friability and condition.
- Bulk samples were collected of all homogeneous areas of friable suspected ACBM and all homogeneous areas of non-friable suspected ACBM.
- The date of the inspection, the name and signature of the person making the inspection, State of accreditation, his or her accreditation number and any changes in the condition of known or assumed ACBM are included in this report, if applicable.
- The exact locations where samples were collected during the inspection are marked, as well as a description of the manner used to determine sampling locations, the name and signature of each accredited inspector who collected the samples, State of accreditation and if applicable, his or her accreditation number.
- Also included within the report are any assessments or reassessments made of friable material, the name and signature of the accredited inspector making the assessments, State of accreditation and if applicable, his or her accreditation number.

The sampling protocol outlined in 40 CFR 763.86 is as follows:

Surfacing material is material in a school building that is sprayed-on, troweled-on, or otherwise applied to surfaces, such as acoustic plaster on ceilings and fireproofing materials on structural members, or other materials on surfaces for acoustic, fireproofing, or other purposes. Surfacing materials are collected in a statistically random manner as follows:

- At least three (3) bulk samples shall be collected from each homogeneous area that is one thousand (1,000) square feet.

- At least five (5) bulk samples shall be collected from each homogeneous area that is greater than one thousand (1,000) square feet but less than or equal to five thousand (5,000) square feet.

- At least seven (7) bulk samples shall be collected from each homogeneous area that is greater than five thousand (5,000) square feet.

Thermal system insulation (TSI) in a school building means materials applied to pipes, fittings, boilers, breeching, tanks, ducts, or other interior structural components to prevent heat loss or gain, or water condensation, or for other purposes. TSI samples are collected in a randomly distributed manner as follows:

- A minimum of three (3) bulk samples are collected from each homogeneous area of TSI that is not assumed to be ACBM.

- Collect at least one (1) bulk sample from each homogeneous area of patched TSI that is not assumed to be ACBM if the patched section is less than six (6) linear or square feet.

- In a manner sufficient to determine whether the material is ACBM or not ACBM, collect bulk samples from each insulated mechanical system that is not assumed to be ACBM where cement or plaster is used on fittings such as tees, elbows, or valves.

- Bulk samples are not required to be collected from any homogeneous area where the accredited inspector has determined that the TSI is fiberglass, foam glass, rubber, or other non-ACBM.

  Miscellaneous material is sampled in a sufficient manner to determine whether the material is ACBM or not ACBM. An accredited inspector shall collect bulk samples from each homogeneous area of friable miscellaneous material that is not "assumed" to be ACBM. Therefore, Dominion will collect a minimum of three (3) samples of each miscellaneous material, as a matter of industry standards.

ASSESSMENT OF MATERIALS

In compliance with 40 CFR 763.88, Dominion inspectors have classified the ACBM and suspected ACBM in the school buildings into one of the following categories:

(1) Damaged or significantly damaged Thermal System Insulation ACBM
(2) Damaged friable surfacing ACBM
(3) Significantly damaged friable surfacing ACBM
(4) Damaged or significantly damaged friable miscellaneous ACBM
(5) ACBM with potential for damage
(6) ACBM with potential for significant damage
(7) Any remaining friable ACBM or friable suspected ACBM

As part of the assessment, the following issues have been taken into consideration:

i. Location and the amount of the material, both in total quantity and as a percentage of the functional space.
ii. The type of damage or significant damage (e.g., flaking, blistering, water damage, or other signs of physical damage).
iii. The severity of damage (e.g., major flaking, severely torn jackets, as opposed to occasional flaking, minor tears to jackets).
iv. Extent or spread of damage over large areas or large percentages of the homogeneous area.
v. Whether the material is accessible.
vi. The material's potential for disturbance.
vii. Known or suspected causes of damage or significant damage (e.g., air erosion, vandalism, vibration, water).
viii. Preventive measures might eliminate the reasonable likelihood of undamaged ACBM from becoming significantly damaged.

SECTION 3

♦

EXECUTIVE SUMMARY

EXECUTIVE SUMMARY

INTRODUCTION

Dominion Environmental Consultants, Inc. (Dominion) was authorized, by Mr. Mason Meade with the Kyrene Elementary School District (KESD), to perform the AHERA Asbestos Re-inspection of Kyrene Middle School, located at 1050 East Carver Road in Tempe, Arizona, via a written Purchase Order #251702, dated February 4, 2025.

Due to budgetary constraints, Dominion was directed by Mr. Meade to first sample the easily accessible building materials inside the building until a pre-determined number of samples were collected. Once the allotted number of samples per building had been collected, Dominion was then directed to "assume as asbestos-containing" the remaining suspect building materials. Pursuant to Mr. Meade's directions, the sampling order of importance was determined first on materials with the largest square footage, then least accessible materials, ceramic tiles, and materials least likely to be disturbed.

Dominion was also instructed to incorporate the information in Dominion's pervious Limited Asbestos Inspection Reports, Project Numbers AZ1418.04 dated June 8, 2017, AZ0959.2056 dated February 6, 2019, AZ0959.2635 dated November 19, 2020, AZ0959.3201 dated September 27, 2022, and AZ1418.11 dated March 13, 2024. Per the direction of Mr. Meade, Dominion was instructed to utilize the information from these previous reports and to only collect additional bulk samples of any previously unsampled building materials.

Kyrene Middle School campus consists of three (3) single story, slab on grade, block structures and three (3) two story block structures. No below grade levels were observed for any building on campus.

BACKGROUND INFORMATION

INITIAL LIMITED AHERA ASBESTOS SURVEY – JUNE 8, 2017

Dominion's Limited Asbestos Inspections of the Kyrene Middle School's Janitorial Closet, Band Hallway, and Restroom of Building E/L was conducted on June 8, 2017, by Ms. Krista Wahnefried, an AHERA accredited Asbestos Building Inspector (State of Arizona #25511-2447693-311078, expiration date August 29, 2017).

LIMITED AHERA ASBESTOS SURVEY – FEBRUARY 6, 2019

Dominion's Limited Asbestos Inspections of the Kyrene Middle School's F-207 Science Classroom of Building F were conducted on February 6, 2019, by Mr. Xin Lou, an AHERA accredited Asbestos Building Inspector (State of Arizona #G9017, expiration date October 5, 2019).

LIMITED AHERA ASBESTOS SURVEY – NOVEMBER 19, 2020

Dominion's Limited Asbestos Inspections of the Kyrene Middle School's Rooms G-107 and G-207 of Building G were conducted on November 19, 2020, by Mr. Nick Marcos, an AHERA accredited Asbestos Building Inspector (State of Arizona #4644-8873-040320, expiration date April 3, 2021).

LIMITED AHERA ASBESTOS SURVEY – SEPTEMBER 27, 2022

Dominion's Limited Asbestos Inspections of the Kyrene Middle School's Media Center Boy's Restroom of Building K were conducted on September 27, 2022, by Mr. Nick Marcos, an AHERA accredited Asbestos Building Inspector (State of Arizona #4644-8873-032422, expiration date March 24, 2023).

LIMITED AHERA ASBESTOS SURVEY – MARCH 13, 2024

Dominion's Limited Asbestos Inspections of the Kyrene Middle School's the Gymnasium of Building E, Room H107 of Building H, and the Weight Room and Back Entryway of Building J were conducted on March 13, 2024, by Mrs. Tracey Carpenter, an AHERA accredited Asbestos Building Inspector (State of Arizona #4644-14588-090523, expiration date September 5, 2024).

LIMITED AHERA ASBESTOS INSPECTION – JUNE 4, 2025

Dominion's AHERA Asbestos Inspection, of the Kyrene Middle School was conducted from June 11 to June 12, 2025 and June 16, 2025, by Mr. Nick Marcos, an AHERA accredited Asbestos Building Inspector. (State of Arizona #ON-188748-8873-031325, expiration date March 13, 2026).

COLLECTION OF BULK SAMPLES

Initial Limited AHERA Asbestos Survey – June 2017

A total of twelve (12) bulk samples were collected from eight (8) homogeneous building materials within the Janitorial Closet, Band Hallway and Restroom of Building E/L.

Identified in the following list are the eight (8) suspect homogeneous building materials sampled during the June 2017 limited asbestos inspection.

Building E/L – Janitorial Closet, Band Hallway, and Restroom – 8 Materials – 0 ACBM

- Blue Cove Base
- White Mastic for Blue Cove Base
- Orange Peel Textured Drywall System (Paint, Texture, Tape, Joint Compound, & Drywall)
- White Fiberglass Reinforced Plastic (FRP)
- Yellow Mastic for Fiberglass Reinforced Plastic (FRP)

- White 4” x 4” Ceramic Wall Tile
- Off-White Grout for White 4” x 4” Ceramic Wall Tile
- Yellow Mastic for White 4” x 4” Ceramic Wall Tile

Initial Limited AHERA Asbestos Survey – February 2019

A total of nine (9) bulk samples were collected from five (5) homogeneous building materials within the F-207 Science Classroom of Building F.

Identified in the following list are the five (5) suspect homogeneous building materials sampled during the February 2019 limited asbestos inspection.

Building F – F-207 Science Classroom – 5 Materials – 0 ACBM

- White Cabinet Caulking
- Green Paint for Cabinet Caulking
- Blue Cove Base
- White Mastic for Blue Cove Base
- Orange Peel Textured Drywall System (Paint, Texture, Tape, Joint Compound, & Drywall)

Initial Limited AHERA Asbestos Survey – November 2020

A total of twelve (12) bulk samples were collected from five (5) homogeneous building materials within Rooms G-107 and G-207 of Building G.

Identified in the following list are the five (5) suspect homogeneous building materials sampled during the November 2020 limited asbestos inspection.

Building G – Rooms G-107 and G-207 – 5 Materials – 0 ACBM

- Orange Peel Textured Drywall System (Paint, Texture, Tape, Joint Compound, and Drywall)
- White/Tan 2’ x 4’ Ceiling Tile
- White Counter Caulking
- Blue Cove Base
- Tan Mastic for Blue Cove Base

Initial Limited AHERA Asbestos Survey – September 2022

A total of eighteen (18) bulk samples were collected from nine (9) homogeneous building materials within the Media Center Boy’s Restroom of Building K.

Identified in the following list are the nine (9) suspect homogeneous building materials sampled during the September 2022 limited asbestos inspection.

Building K – Media Center Boy's Restroom – 9 Materials – 0 ACBM

- White 4" x 4" Ceramic Wall Tile
- Cream Mastic for White 4" x 4" Ceramic Wall Tile
- Gray Grout for White 4" x 4" Ceramic Wall Tile
- Green 4" x 4" Ceramic Wall Tile
- Blue 4" x 4" Ceramic Wall Tile
- White Fixture Caulking
- Greenboard Drywall
- Cream Mastic for Greenboard Drywall
- White Counter Caulking

Initial Limited AHERA Asbestos Survey – March 2024

A total of eighteen (18) bulk samples were collected from fourteen (14) homogeneous building materials within the Gymnasium of Building E, Room H107 of Building H, and the Weight Room and Back Entryway of Building J.

Identified in the following list are the eighteen (18) suspect homogeneous building materials sampled during the March 2024 limited asbestos inspection.

Building E – Gymnasium – 11 Material – 0 ACBM

- 2" x 2" White Ceramic Floor Tile
- Off-White Grout for 2" x 2" White Ceramic Floor Tile
- Gray Thinset for 2" x 2" White Ceramic Floor Tile
- Black Cove Base
- Beige Mastic for Black Cove Base
- Dark Teal Ceramic Bench Tiles
- Blue-Green Grout for Dark Teal Ceramic Bench Tiles
- Gray Thinset for Dark Teal Ceramic Bench Tiles
- Light Teal Ceramic Bench Tiles
- Blue-Green Grout for Light Teal Ceramic Bench Tiles
- Gray Thinset for Light Teal Ceramic Bench Tiles

Building H – Room H107 – 1 Material – 0 ACBM

- Orange Peel Textured Drywall System (Paint, Texture, Tape, Joint Compound, and Drywall)

Building J – Weight Room – 2 Materials – 0 ACBM

- 12" x 12" White w/Gray Specks Vinyl Floor Tile (VCT)
- Yellow Mastic for 12" x 12" White w/Gray Specks Vinyl Floor Tile (VCT)

2025 AHERA Asbestos Inspection - June 2025

During the 2025 AHERA Asbestos Re-inspection, a total of one hundred and four (104) bulk samples were collected from sixty-one (61) homogeneous building materials (multiple layers) throughout the Kyrene Middle School's Building E/L, F, G, H, J, and K. Identified in the following list are the sixty-one (61) suspect homogeneous materials Dominion sampled during the 2025 AHERA inspection.

Building E/L – 9 Materials – 0 ACBM

- Gray Multicolored Carpet Square
- Transparent Mastic for Gray Multicolored Carpet Square
- Black Carpet Square
- Transparent Mastic for Black Carpet Square
- Blue Cove Base
- Tan Mastic for Blue Cove Base
- 2' x 2' Gray Ceiling Tile
- 2' x 4' Gray Ceiling Tile
- Orange Peel Drywall System - White Paint (Texture, Tape, Joint Compound, and Drywall)

Building F – 10 Materials – 0 ACBM

- Gray Multicolored Carpet Square
- Semi-Transparent Mastic for Gray Multicolored Carpet Square
- Black Carpet Square
- Black Mastic for Black Carpet Square
- Blue Cove Base
- Cream Mastic for Blue Cove Base
- Orange Peel Drywall System - White Paint (Texture, Tape, Joint Compound, and Drywall)
- 2' x 4' Gray Ceiling Tile
- White w/Black 12" x 12" Vinyl Floor Tile (VCT)
- Yellow Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)

Building G – 13 Materials – 0 ACBM

- 2' x 4' Gray Ceiling Tile
- Orange Peel Textured Drywall System (Paint, Texture, Tape, Joint Compound, and Drywall)
- Gray Multicolored Carpet Square
- Transparent Mastic for Gray Multicolored Carpet Square
- Gray Leveling Compound for Carpet Square
- Orange Mastic for Gray Multicolored Carpet Square

- Blue Cove Base
- Tan Mastic for Blue Cove Base
- Black Carpet Square
- Transparent Mastic for Black Carpet Square
- Gray Leveling Compound for Black Carpet Square
- Tan Mastic for Black Carpet Square
- Orange Mastic for Black Carpet Square

Building H – 9 Materials – 0 ACBM

- Gray Decorative 2' x 4' Ceiling Tile
- Gray 2' x 4' Ceiling Tile
- Orange Peel Textured Drywall System (Paint, Texture, Tape, Joint Compound, and Drywall)
- Gray Multicolored Carpet Square
- Gray Mastic for Gray Multicolored Carpet Square
- Blue Cove Base
- Cream Mastic for Blue Cove Base
- Black Carpet Square
- Gray Mastic for Black Carpet Square

Building J – 9 Materials – 0 ACBM

- Old Brown 2' x 4' Ceiling Tile
- New Brown 2' x 4' Ceiling Tile
- Gray Multicolored Carpet Square
- Semi-Transparent Mastic for Carpet Square
- Black Cove Base
- Cream Mastic for Black Cove Base
- Black Carpet Square
- Semi-Transparent Mastic for Black Carpet Square
- Orange Peel Textured Drywall System (Paint, Texture, Tape, Joint Compound, and Drywall)

Building K – 10 Materials – 0 ACBM

- Pink Batt Insulation
- Brown/Black Wrap for Pink Batt Insulation
- 2' x 4' Gray Ceiling Tile
- 2' x 2' Gray Ceiling Tile
- Orange Peel Textured Drywall System (Paint, Texture, Tape, Joint Compound, and Drywall)
- Gray Multicolored Carpet Square
- Transparent Mastic for Gray Multicolored Carpet Square

- Gray Cementitious Material for Carpet Square
- Blue Cove Base
- Tan Mastic for Blue Cove Base

All the suspect bulk samples collected from C.I. Waggoner Elementary School were submitted to EMLab P&K (EMLab) in Phoenix, Arizona for analysis using Polarized Light Microscopy (PLM) methods. EMLab used the methods prescribed in Method 40 CFR, Part 763, in the Code of Federal Register in analyzing bulk samples. EMLab is certified by the National *Institute of Standards* and Technology as a National Voluntary Laboratory Accreditation Program (NVLAP), Number 500031-0. The suspect asbestos bulk samples were collected and submitted to the laboratory using established chain-of-custody procedures.

Bulk samples were collected utilizing safety and health practices as required by the Occupational Safety and Health Administration (OSHA). At the time of sample collection, the buildings were not occupied by students. Only limited administrative and custodial staff were present on campus.

ASSUMED ACBM – JUNE 4, 2025

Due to budgetary constraints, KESD instructed Dominion to assume any unsampled suspect building materials as asbestos containing until further asbestos bulk sampling can be budgeted and conducted. Therefore, listed below are the two hundred and forty-seven (247) building materials that were assumed to contain greater than one percent (>1%) asbestos.

Building E/L – 60 Assumed ACBM

- White w/Black 12" x 12" Vinyl Floor Tile (VCT)
- Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)
- Black 12" x 12" Vinyl Floor Tile (VCT)
- Mastic for Black 12" x 12" Vinyl Floor Tile (VCT)
- Black Stair Tread
- Mastic for Black Stair Tread
- Brick
- Mortar for Brick
- Tackboard
- Knockdown Drywall System
- Brown Fiberglass Reinforced Plastic (FRP)
- Mastic for Brown Fiberglass Reinforced Plastic (FRP)
- 2' x 4' Drywall Ceiling Tile
- Brown 6" x 6" Ceramic Floor Tile
- Grout for Brown 6" x 6" Ceramic Floor Tile
- Thinset for Brown 6" x 6" Ceramic Floor Tile
- Interior Caulking
- Exterior Caulking
- Gray Sink Coating

- Brown 4" x 6" Ceramic Wall Tile
- Grout for Brown 4" x 6" Ceramic Wall Tile
- Mastic for Brown 4" x 6" Ceramic Wall Tile
- Dark Brown 6" x 6" Replacement Ceramic Wall Tile
- Grout for Replacement Ceramic Wall Tile
- Mastic for Replacement Ceramic Wall Tile
- White w/Brown 4" x 4" Ceramic Wall Tile
- Grout for White w/Brown 4" x 4" Ceramic Wall Tile
- Mastic for White w/Brown 4" x 4" Ceramic Wall Tile
- Green 4" x 4" Ceramic Wall Tile
- Fixture Caulking
- Divider Wall
- Black Rubber Flooring
- Tan 4" x 4" Ceramic Wall Tile
- Grout for Tan 4" x 4" Ceramic Wall Tile
- Mastic for Tan 4" x 4" Ceramic Wall Tile
- Blue 4" x 4" Ceramic Wall Tile
- Tan 2" x 2" Ceramic Floor Tile
- Grout for Tan 2" x 2" Ceramic Floor Tile
- Thinset for Tan 2" x 2" Ceramic Floor Tile
- Green 2" x 2" Ceramic Floor Tile
- Blue 2" x 2" Ceramic Floor Tile
- Marble Threshold
- Black L-Shaped Cove Base
- Mastic for Black L-Shaped Cove Base
- Tan Multicolored 12" x 12" Vinyl Floor Tile (VCT)
- Mastic for Tan multicolored 12" x 12" (VCT)
- Tan 3" x 3" Ceramic Floor Tile
- Grout for Tan 3" x 3" Ceramic Floor Tile
- Thinset for Tan 3" x 3" Ceramic Floor Tile
- Block
- Mortar for Block
- Skylight Insulation Panel
- Silver Flex Duct Wrap
- Large Silver Duct Wrap
- Small Silver Duct Wrap
- Unfinished Drywall System
- Gray Duct Mastic
- Black Foam Pipe Insulation
- White Pipe Wrap
- Mastic for White Pipe Wrap

Building F – 34 Assumed ACBM

- Interior Caulking
- Exterior Caulking
- Divider Wall
- Gray Sink Coating
- Glass Block Mortar
- Brick
- Mortar for Brick
- Tackboard
- Tan 4" x 4" Ceramic Wall Tile
- Grout for Tan 4" x 4" Ceramic Wall Tile
- Mastic for Tan 4" x 4" Ceramic Wall Tile
- Blue 4" x 4" Ceramic Wall Tile
- Green 4" x 4" Ceramic Wall Tile
- Tan 2" x 2" Ceramic Floor Tile
- Grout for Tan 2" x 2" Ceramic Floor Tile
- Thinset for Tan 2" x 2" Ceramic Floor Tile
- Blue 2" x 2" Ceramic Floor Tile
- Green 2" x 2" Ceramic Floor Tile
- Fixture Caulking
- Fiberglass Reinforced Plastic (FRP)
- Mastic for Fiberglass Reinforced Plastic (FRP)
- Gray Stair Tread
- Mastic for Gray Stair Tread
- Gray 20" x 20" Floor Tile
- Mastic for Gray 20" x 20" Floor Tile
- Knockdown Drywall System
- Silver Flex Duct Wrap
- Silver Box Duct Wrap
- Gray Duct Mastic
- Unfinished Drywall System
- Black Foam Pipe Insulation
- White Pipe Wrap
- Insulation for White Pipe Wrap
- Skylight Insulation Panel

Building G – 38 Assumed ACBM

- Divider Wall
- Tackboard
- Interior Caulking
- Exterior Caulking

- White Sink Coating
- White w/Black 12" x 12" Vinyl Floor Tile (VCT)
- Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)
- Brick
- Mortar for Brick
- Tan 4" x 4" Ceramic Wall Tile
- Grout for Tan 4" x 4" Ceramic Wall Tile
- Mastic for Tan 4" x 4" Ceramic Wall Tile
- Green 4" x 4" Ceramic Wall Tile
- Blue 4" x 4" Ceramic Wall Tile
- Tan 2" x 2" Ceramic Floor Tile
- Grout for Tan 2" x 2" Ceramic Floor Tile
- Thinset for Tan 2" x 2" Ceramic Floor Tile
- Green 2" x 2" Ceramic Floor Tile
- Blue 2" x 2" Ceramic Floor Tile
- Marble Threshold
- Fixture Caulking
- Knockdown Drywall System
- Terrazzo Mop Sink
- Brown Fiberglass Reinforced Plastic (FRP)
- Mastic for Brown Fiberglass Reinforced Plastic (FRP)
- Glass Block Mortar
- Black Stair Tread
- Mastic for Black Stair Tread
- Black 20" x 20" Floor Tile
- Mastic for Black 20" x 20" Floor Tile
- Skylight Insulation Panel
- Silver Flex Duct Wrap
- Silver Box Duct Wrap
- Gray Duct Mastic
- Unfinished Drywall System
- Black Foam Pipe Insulation
- White Pipe Wrap
- Mastic for White Pipe Wrap

<u>Building H – 38 Assumed ACBM</u>

- White w/Black 12" x 12" Vinyl Floor Tile (VCT)
- Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)
- Interior Caulking
- Exterior Caulking
- Gray Sink Coating
- Divider Wall

- Brick
- Mortar for Brick
- Tackboard
- Black Stair Tread
- Mastic for Black Stair Tread
- Black Cove Base
- Mastic for Black Cove Base
- Black 20" x 20" Floor Tile
- Mastic for Black 20" x 20" Floor Tile
- Tan 4" x 4" Ceramic Wall Tile
- Grout for Tan 4" x 4" Ceramic Wall Tile
- Mastic for Tan 4" x 4" Ceramic Wall Tile
- Green 4" x 4" Ceramic Wall Tile
- Blue 4" x 4" Ceramic Wall Tile
- Tan 2" x 2" Ceramic Floor Tile
- Grout for Tan 2" x 2" Ceramic Floor Tile
- Thinset for Tan 2" x 2" Ceramic Floor Tile
- Green 2" x 2" Ceramic Floor Tile
- Blue 2" x 2" Ceramic Floor Tile
- Knockdown Drywall System
- White Sink Coating
- Glass Block Mortar
- Marble Threshold
- Fixture Caulking
- Skylight Insulation Panel
- Silver Flex Duct Wrap
- Silver Box Duct Wrap
- Gray Duct Mastic
- Unfinished Drywall System
- Black Foam Pipe Insulation
- White Pipe Wrap
- Mastic for White Pipe Wrap

Building J – 40 Assumed ACBM

- Fiberglass Reinforced Plastic (FRP)
- Mastic for Fiberglass Reinforced Plastic (FRP)
- Gray Sink Coating
- Interior Caulking
- Exterior Caulking
- Tan 4" x 4" Ceramic Wall Tile
- Grout for Tan 4" x 4" Ceramic Wall Tile
- Mastic for Tan 4" x 4" Ceramic Wall Tile

- Green 4" x 4" Ceramic Wall Tile
- Blue 4" x 4" Ceramic Wall Tile
- Tan 2" x 2" Ceramic Floor Tile
- Grout for Tan 2" x 2" Ceramic Floor Tile
- Thinset for Tan 2" x 2" Ceramic Floor Tile
- Green 2" x 2" Ceramic Floor Tile
- Blue 2" x 2" Ceramic Floor Tile
- Fixture Caulking
- Marble Threshold
- Blue Cove Base
- Mastic for Blue Cove Base
- Tackboard
- Gray 12" x 12" Vinyl Floor Tile (VCT)
- Mastic for Gray 12" x 12" Vinyl Floor Tile (VCT)
- Knockdown Drywall System
- Tan Multicolored 12" x 12" Vinyl Floor Tile (VCT)
- Mastic for Tan Multicolored 12" x 12" VCT
- Brick
- Mortar for Brick
- Gray Floor Coating
- White 6" x 6" Ceramic Wall Tile
- Grout for White 6" x 6" Ceramic Wall Tile
- Mastic for White 6" x 6" Ceramic Wall Tile
- Skylight Insulation Panel
- Large Silver Flex Duct Wrap
- Silver Box Duct Wrap
- Gray Duct Mastic
- Unfinished Drywall
- Black Foam Pipe Insulation
- White Pipe Wrap
- Mastic for White Pipe Wrap
- Residual 12" x 12" Ceiling Tile Mastic

Building K – 37 Assumed ACBM

- Black Carpet Square
- Mastic for Black Carpet Square
- Tan 4" x 4" Ceramic Wall Tile
- Grout for Tan 4" x 4" Ceramic Wall Tile
- Mastic for Tan 4" x 4" Ceramic Wall Tile
- Tan 2" x 2" Ceramic Floor Tile
- Grout for Tan 2" x 2" Ceramic Floor Tile
- Thinset for Tan 2" x 2" Ceramic Floor Tile

- Green 2" x 2" Ceramic Floor Tile
- Blue 2" x 2" Ceramic Floor Tile
- Marble Threshold
- Wallpaper
- Brick
- Mortar for Brick
- White w/Black 12" x 12" Vinyl Floor Tile (VCT)
- Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)
- Interior Caulking
- Exterior Caulking
- Knockdown Drywall System
- Gray Sink Coating
- Gray Carpet Square
- Mastic for Gray Carpet Square
- Dark Gray Cove Base
- Mastic for Dark Gray Cove Base
- Beige Multicolored 12" x 12" Vinyl Floor Tile (VCT)
- Mastic for Beige Multicolored 12" x 12" VCT
- Fiberglass Reinforced Plastic (FRP)
- Mastic for Fiberglass Reinforced Plastic (FRP)
- Terrazzo Mop Sink
- Unfinished Drywall
- Silver Flex Duct Wrap
- Silver Box Duct Wrap
- Black Pipe Foam Insulation
- Pipe Wrap
- Mastic for Pipe Wrap
- Gray Duct Mastic
- Skylight Insulation Panel

INSPECTION FINDINGS

Initial Limited AHERA Asbestos Survey – JUNE 8, 2017

All eight (8) of the homogeneous building materials sampled during the June 2017 inspection within the Janitorial Closet, Band Hallway, and Restroom of Building E/L were reported by the laboratory using the PLM analysis method to be “none detected” for asbestos content.

Initial Limited AHERA Asbestos Survey – FEBRUARY 6, 2019

All five (5) of the homogeneous building materials sampled during the February 2019 inspection within F-207 Science Classroom of Building F were reported by the laboratory using the PLM analysis method to be “none detected” for asbestos content.

Initial Limited AHERA Asbestos Survey – NOVEMBER 19, 2020

All five (5) of the homogeneous building materials sampled during the November 2020 inspection within Rooms G-107 and G-207 of Building G were reported by the laboratory using the PLM analysis method to be "none detected" for asbestos content.

Initial Limited AHERA Asbestos Survey – SEPTEMBER 27, 2022

All nine (9) of the homogeneous building materials sampled during the September 2022 inspection within the Media Center Boy's Restroom of Building K were reported by the laboratory using the PLM analysis method to be "none detected" for asbestos content.

Initial Limited AHERA Asbestos Survey – MARCH 13, 2024

All eleven (11) of the homogeneous building materials sampled during the March 2024 inspection within the Gymnasium of Building E, Room H107 of Building H, and the Weight Room and Back Entryway of Building J were reported by the laboratory using the PLM analysis method to be "none detected" for asbestos content.

2025 AHERA ASBESTOS RE-INSPECTION – JUNE 4, 2025

All sixty-one (61) of the homogeneous building materials sampled during the June 2025 inspection within Buildings E/L, F, G, H, J & K were reported by the laboratory using the PLM analysis method to be "none detected" for asbestos content.

As directed, and as listed above two hundred and forty-seven (247) suspect homogeneous building materials were *assumed* to contain greater than one percent (>1%) asbestos.

RECOMMENDATIONS

Any building material within the Kyrene Middle School campus not identified in this inspection report that is not wood, glass, or metal, is a suspect ACBM and should not be removed, sanded, ground, abraded, or otherwise disturbed by any person without being first properly trained as per 40 CFR 763.92 and, or 29 CFR 1926.1101. For detailed recommendations, please refer to the Kyrene Middle School AHERA Management Plan.

The ACBM or assumed ACBM located within the structures of the Kyrene Middle School campus can be managed in compliance with the Kyrene Elementary School District AHERA Management Plan until such a time as these building materials become degraded, have become friable, or will be disturbed by ongoing maintenance, renovation, or a demolition activity. Prior to a renovation or demolition activity, the previously listed assumed ACBM should be sampled by an AHERA Certified Building Inspector to determine the presence of asbestos.


At least once every six (6) months after a management plan is in effect, the KESD should conduct periodic surveillance in each building that it leases, owns, or otherwise uses as a school building that contains ACBM.

At least once every three (3) years after a management plan is in effect, the KESD should conduct an inspection of all ACBM on the school campus.

The AHERA inspection is limited to only the interior of the buildings and the underside of any covered walkways. This would mean that the additional suspect building materials found on the exterior of the buildings or structures, that are not regulated by AHERA are regulated by EPA NESHAP and OSHA. Therefore, prior to any disturbance of these un-sampled or newly installed suspect building materials, Dominion recommends that these suspect materials be sampled by an AHERA Certified Building Inspector and analyzed for asbestos content by a qualified laboratory prior to any disturbance.

The property owner or his representatives should retain the services of an independent asbestos consulting firm to monitor the performance of any asbestos abatement activities. The consulting firm should oversee the completeness of any asbestos removal and verify the quality of the air during the removal work and perform final clearance air sampling in accordance with the AHERA guidelines.

All documentation is being provided to the Kyrene Elementary School District and must be retained as a permanent record. Should you have any questions regarding the procedures that were followed on this project, please contact Dominion at any time. Thank you for the opportunity to provide these environmental consulting services.



2025 AHERA Building Inspector
Nick Marcos
AHERA Certificate Number: ON-188748-8873-031325
Expires: March 13, 2026

Historical Information

2024 AHERA Building Inspector
Tracey Carpenter
AHERA Certificate Number: ON-4644-14588-090523
Expired: September 6, 2024

2022 AHERA Building Inspector
Nick Marcos
AHERA Certificate Number: ON-188748-8873-032422
Expired: March 24, 2023

2020 AHERA Building Inspector
Nick Marcos
AHERA Certificate Number: ON-188748-8873-040320
Expired: April 3, 2021


2019 AHERA Building Inspector
Xin Lou
AHERA Certificate Number: G9017
Expired: October 5, 2019

2017 AHERA Building Inspector
Krista Wahnefried
AHERA Certificate Number: 25511-2447693-311078
Expired: August 29, 2017

SECTION 4

♦

SITE PLANS

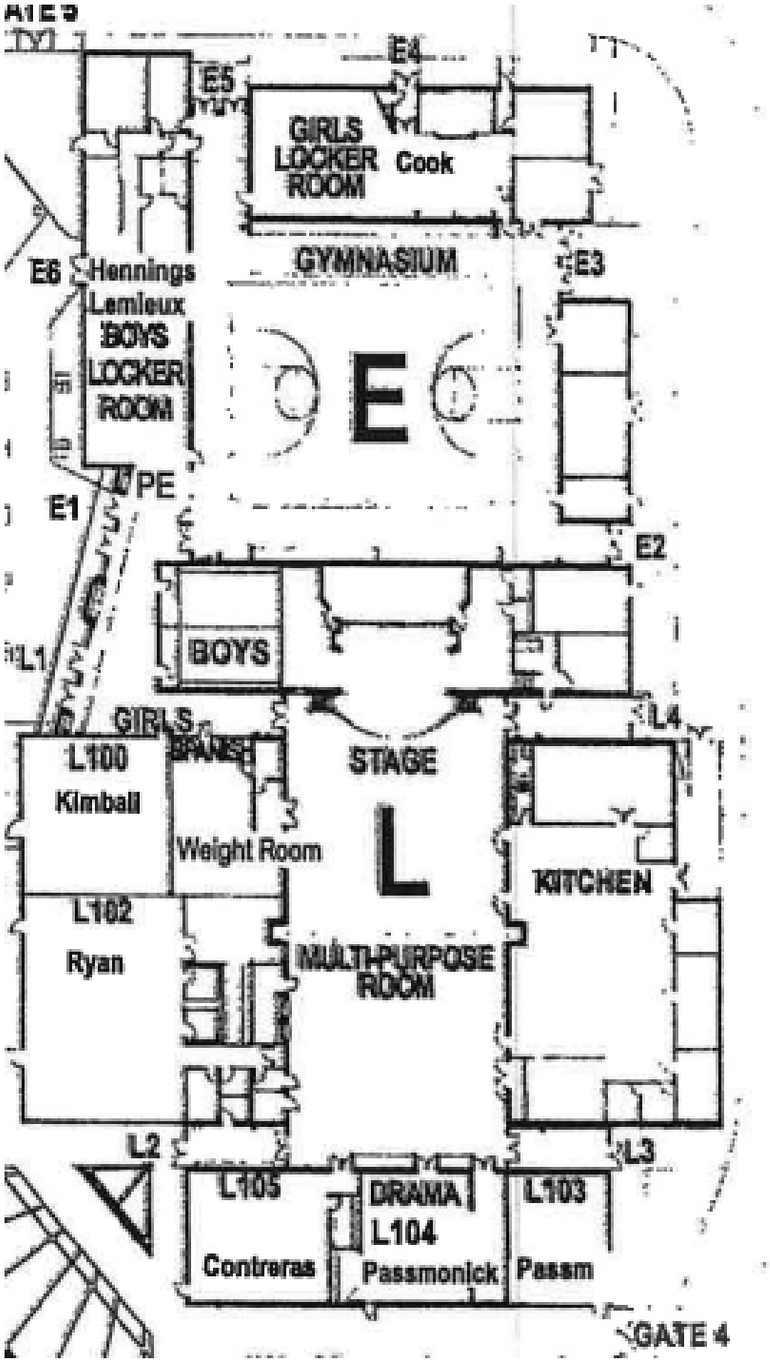


N

Site Plan (1)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building E/L

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

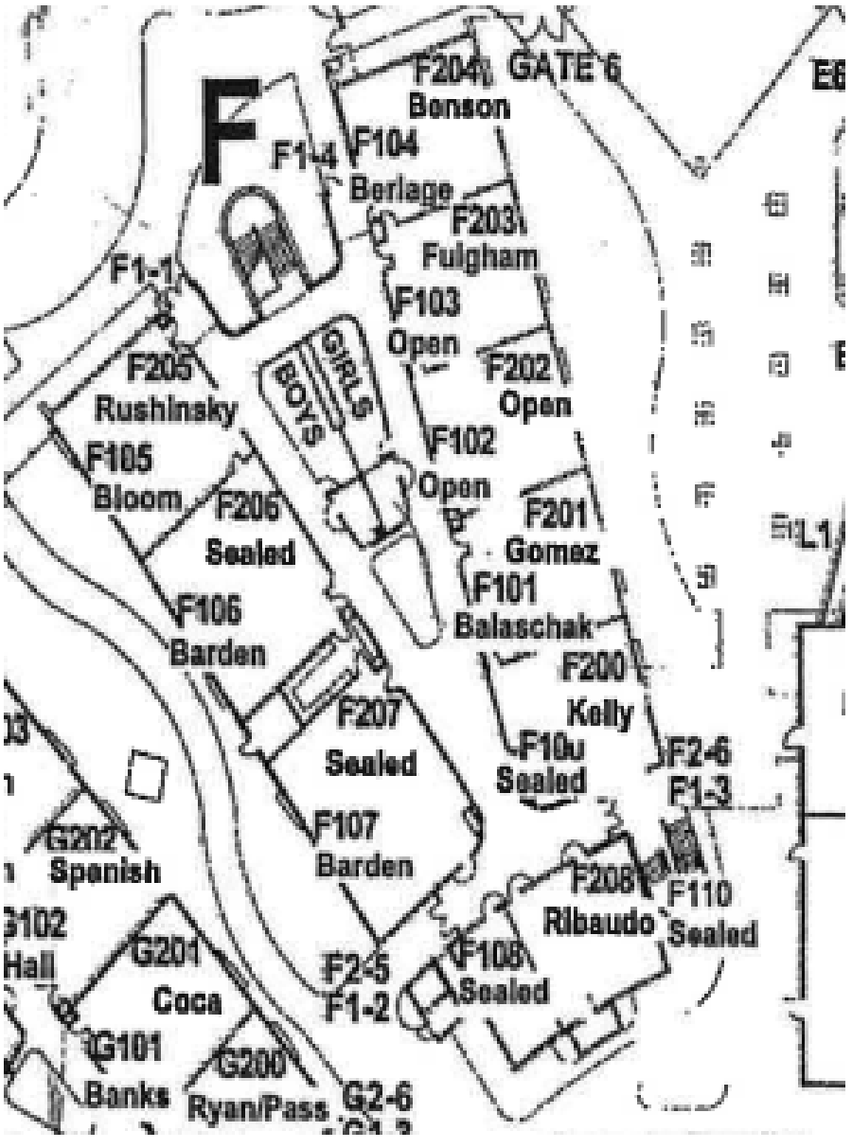

Site Plan (2)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building F

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415




Site Plan (3)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building G

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

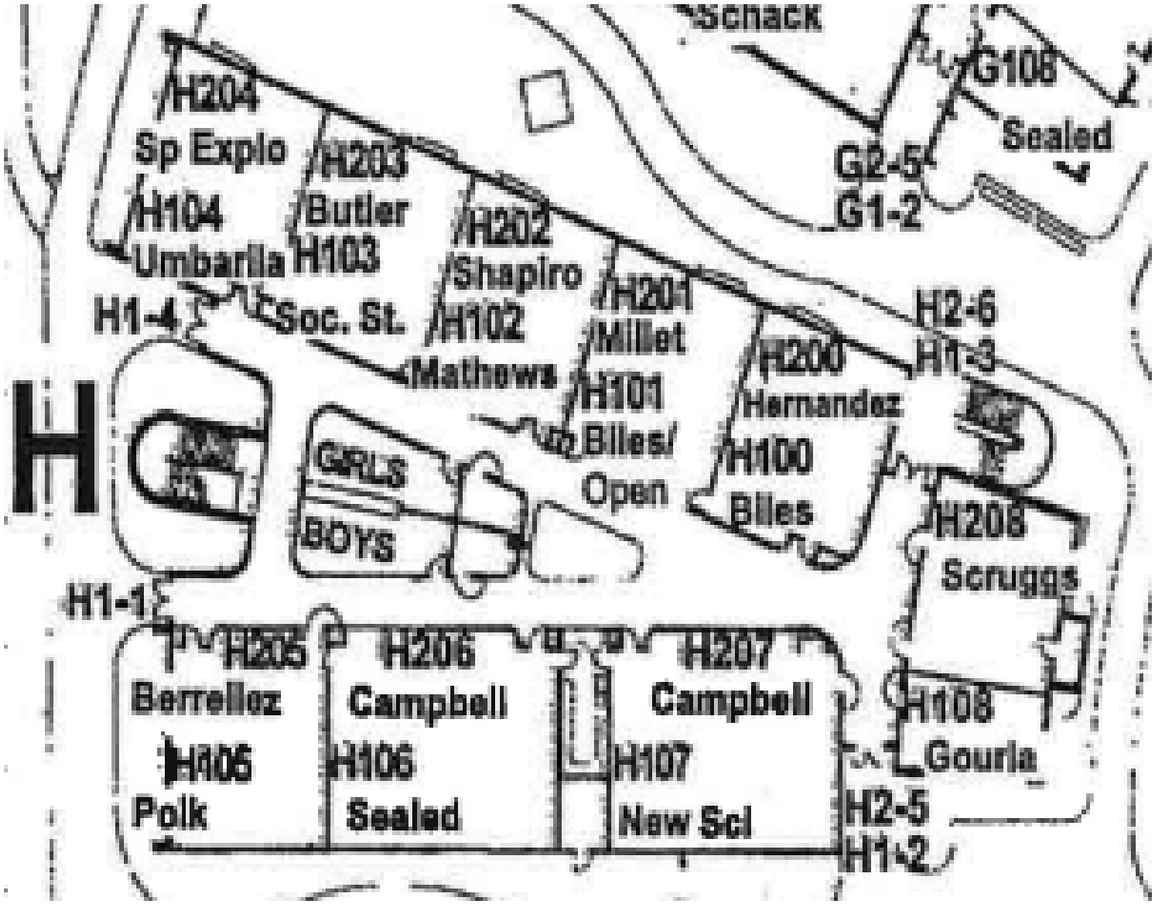


Site Plan (4)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building H

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

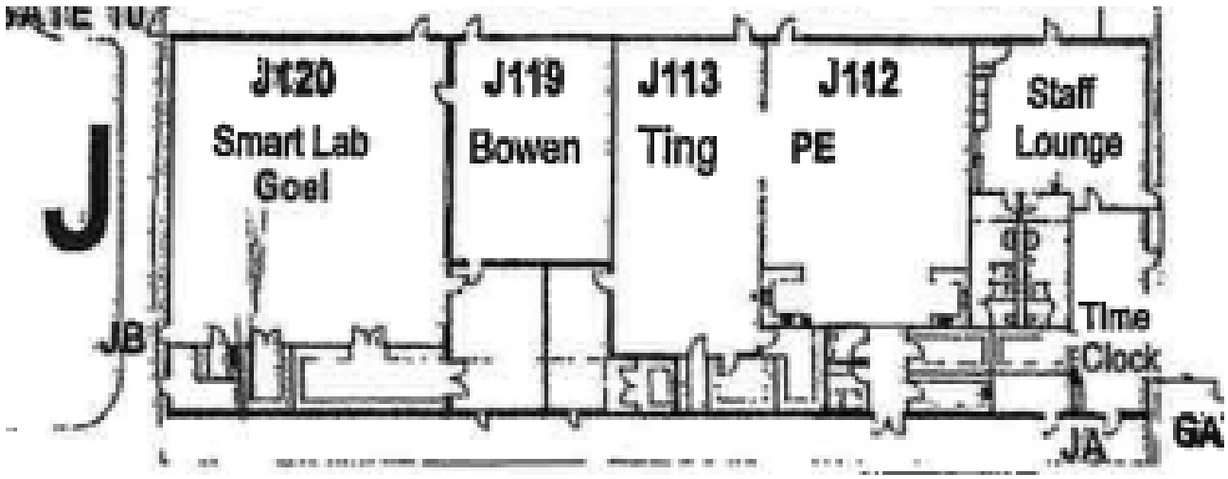


Site Plan (5)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building J

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

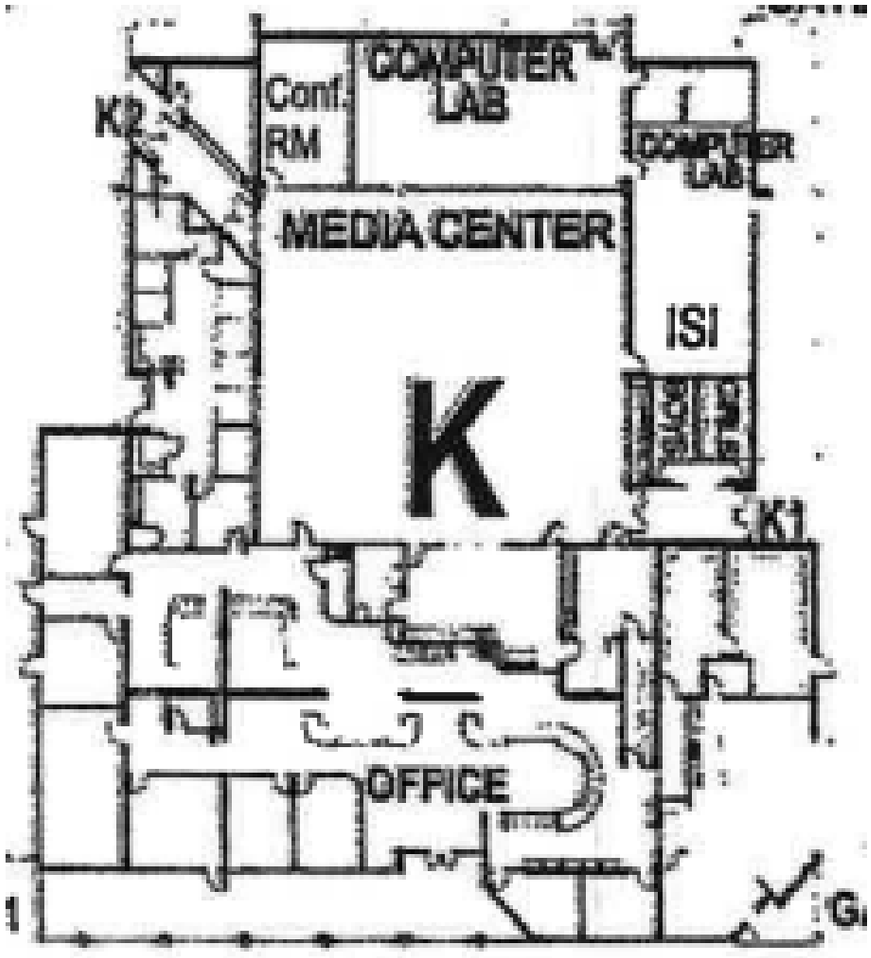

Site Plan (6)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building K

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

SECTION 5

♦

HOMOGENEOUS MATERIALS INVENTORY LISTS

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.04+AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 06/08/17+03/13/24+06/25/25	Site: Kyrene Middle School - Building E/L

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 06/08/2017 - AHERA Building Inspector: Krista Wahnefried (Certification #25511-2447693-311078)						
1	Blue Cove Base	Hallways	No	No	M	350
2	White Mastic for Blue Cove Base		No	No	M	
3	Orange Peel Drywall System - White Paint	Hallways	No	No	S	90,000
	White Texture		No	No	S	
	Cream Tape		No	No	M	
	White Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
4	White Fiberglass Reinforced Plastic (FRP)	Janitorial Closet	No	No	M	1,000
5	Yellow Mastic for White Fiberglass Reinforced Plastic (FRP)		No	No	M	
6	White 4" x 4" Ceramic Wall Tile	Restroom	No	No	M	1,000
7	Off-White Grout for White 4" x 4" Ceramic Wall Tile		No	No	M	
8	Yellow Mastic for White 4" x 4" Ceramic Wall Tile		No	No	M	
Inspection Date: 03/13/2024 - AHERA Building Inspector: Tracey Carpenter (Certification #4644-14588-090523)						
9	2" x 2" White Ceramic Floor Tile	Boy's Restroom	No	No	M	3,000
10	Off-White Grout for 2" x 2" White Ceramic Floor Tile		No	No	M	
11	Gray Thinset for 2" x 2" White Ceramic Floor Tile		No	No	M	
12	Black Cove Base	Gymnasium	No	No	M	300
13	Beige Mastic for Black Cove Base		No	No	M	
14	Dark Teal Ceramic Bench Tiles	Locker Rooms	No	No	M	1,000
15	Blue-Green Grout for Dark Teal Ceramic Bench Tiles		No	No	M	
16	Gray Thinset for Dark Teal Ceramic Bench Tiles		No	No	M	
17	Light Teal Ceramic Bench Tiles	Locker Rooms	No	No	M	1,000
18	Blue-Green Grout for Light Teal Ceramic Bench Tiles		No	No	M	
19	Gray Thinset for Light Teal Ceramic Bench Tiles		No	No	M	
Inspection Date: 06/16/2025 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-031325)						
20	Gray Multicolored Carpet Square	Classrooms Throughout	No	No	M	10,000
21	Transparent Mastic for Gray Multicolored Carpet Square		No	No	M	

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.04+AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 06/08/17+03/13/24+06/25/25	Site: Kyrene Middle School - Building E/L

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
22	Black Carpet Square	Entry Throughout Classrooms	No	No	M	150
23	Transparent Mastic for Black Carpet Square		No	No	M	
24	Blue Cove Base	Throughout	No	No	M	350
25	Tan Mastic for Blue Cove Base		No	No	M	
26	2' x 2' Gray Ceiling Tile	Throughout	No	Yes	M	30,000
27	2' x 4' Gray Ceiling Tile	Throughout	No	Yes	M	20,000
28	Orange Peel Drywall System - White Paint	Throughout	No	No	M	90,000
	White Texture		No	No	M	
	Cream Tape		No	No	M	
	White Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
06/16/2025 Assumed ACBM						
29	White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Cafeteria	Assumed	No	M	12,000
30	Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)		Assumed	No	M	
31	Black 12" x 12" Vinyl Floor Tile (VCT)	Stage	Assumed	No	M	2,000
32	Mastic for Black 12" x 12" Vinyl Floor Tile (VCT)		Assumed	No	M	
33	Black Stair Tread	Stage	Assumed	No	M	200
34	Mastic for Black Stair Tread		Assumed	No	M	
35	Brick	Exterior	Assumed	No	M	120,000
36	Mortar for Brick		Assumed	No	M	
37	Tackboard	Throughout	Assumed	No	M	1,500
38	Knockdown Drywall System	Electrical Rooms	Assumed	No	M	3,000
39	Brown Fiberglass Reinforced Plastic (FRP)	Kitchen	Assumed	No	M	5,000
40	Mastic for Brown Fiberglass Reinforced Plastic (FRP)		Assumed	No	M	
41	2' x 4' Drywall Ceiling Tile	Kitchen	Assumed	No	M	5,000
42	Brown 6" x 6" Ceramic Floor Tile	Throughout	Assumed	No	M	5,000
43	Grout for Brown 6" x 6" Ceramic Floor Tile		Assumed	No	M	500
44	Thinset for Brown 6" x 6" Ceramic Floor Tile		Assumed	No	M	5,000

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.04+AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 06/08/17+03/13/24+06/25/25	Site: Kyrene Middle School - Building E/L

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
45	Interior Caulking	Throughout	Assumed	No	M	200
46	Exterior Caulking	Throughout	Assumed	No	M	200
47	Gray Sink Coating	Sinks Throughout	Assumed	No	M	75
48	Brown 4" x 6" Ceramic Wall Tile	Kitchen	Assumed	No	M	2,000
49	Grout for Brown 4" x 6" Ceramic Wall Tile		Assumed	No	M	200
50	Mastic for Brown 4" x 6" Ceramic Wall Tile		Assumed	No	M	2,000
51	Dark Brown 6" x 6" Replacement Ceramic Wall Tile	Kitchen	Assumed	No	M	1,000
52	Grout for Replacement Ceramic Wall Tile		Assumed	No	M	100
53	Mastic for Replacement Ceramic Wall Tile		Assumed	No	M	1,000
54	White w/Brown 4" x 4" Ceramic Wall Tile	Kitchen Restroom	Assumed	No	M	1,000
55	Grout for White w/Brown 4" x 4" Ceramic Wall Tile		Assumed	No	M	100
56	Mastic for White w/Brown 4" x 4" Ceramic Wall Tile		Assumed	No	M	1,000
57	Green 4" x 4" Ceramic Wall Tile	Kitchen Restroom	Assumed	No	M	250
58	Fixture Caulking	Restrooms Throughout	Assumed	No	M	30
59	Divider Wall	Cafeteria	Assumed	No	M	5,000
60	Black Rubber Flooring	Gymnasium	Assumed	No	M	2,000
61	Tan 4" x 4" Ceramic Wall Tile	Kitchen Restroom	Assumed	No	M	4,000
62	Grout for Tan 4" x 4" Ceramic Wall Tile		Assumed	No	M	400
63	Mastic for Tan 4" x 4" Ceramic Wall Tile		Assumed	No	M	4,000
64	Blue 4" x 4" Ceramic Wall Tile	Restroom	Assumed	No	M	1,000
65	Tan 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	5,000
66	Grout for Tan 2" x 2" Ceramic Floor Tile		Assumed	No	M	500
67	Thinset for Tan 2" x 2" Ceramic Floor Tile		Assumed	No	M	5,000
68	Green 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	250
69	Blue 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	250
70	Marble Threshold	Throughout	Assumed	No	M	50
71	Black L-Shaped Cove Base	Gymnasium	Assumed	No	M	300
72	Mastic for Black L-Shaped Cove Base		Assumed	No	M	

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.04+AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 06/08/17+03/13/24+06/25/25	Site: Kyrene Middle School - Building E/L

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
73	Tan Multicolored 12" x 12" Vinyl Floor Tile (VCT)	Locker Rooms	Assumed	No	M	3,000
74	Mastic for Tan Multicolored 12" x 12" (VCT)		Assumed	No	M	
75	Tan 3" x 3" Ceramic Floor Tile	Locker Rooms	Assumed	No	M	1,500
76	Grout for Tan 3" x 3" Ceramic Floor Tile		Assumed	No	M	150
77	Thinset for Tan 3" x 3" Ceramic Floor Tile		Assumed	No	M	1,500
78	Block	Throughout	Assumed	No	M	150,000
79	Mortar for Block		Assumed	No	M	
80	Skylight Insulation Panel	Above Ceiling	Assumed	No	M	3,000
81	Silver Flex Duct Wrap	Above Ceiling	Assumed	No	M	2,000
82	Large Silver Duct Wrap	Above Ceiling	Assumed	No	M	2,000
83	Small Silver Duct Wrap	Above Ceiling	Assumed	No	M	1,000
84	Unfinished Drywall System	Above Ceiling	Assumed	No	M	30,000
85	Gray Duct Mastic	Above Ceiling	Assumed	No	M	200
86	Black Foam Pipe Insulation	Above Ceiling	Assumed	No	M	200
87	White Pipe Wrap	Above Ceiling	Assumed	No	M	2,000
88	Mastic for White Pipe Wrap	Above Ceiling	Assumed	No	M	

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ0959.2056+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 02/06/19+06/16/25	Site: Kyrene Middle School - Building F

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 02/06/2019 - AHERA Building Inspector: Xin Lou (Certification #G9017)						
1	White Cabinet Caulking	Room F-207	No	No	M	40
2	Green Paint for White Cabinet Caulking		No	No	M	
3	Blue Cove Base	Throughout	No	No	M	600
4	White Mastic for Blue Cove Base		No	No	M	
5	Orange Peel Drywall System - White Paint	Throughout	No	No	S	50,000
	White Texture		No	No	S	
	Cream Tape		No	No	M	
	White Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
Inspection Date: 06/16/2025 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-031325)						
6	Gray Multicolored Carpet Square	Throughout	No	No	M	22,000
7	Semi-Transparent Mastic for Gray Multicolored Carpet Square		No	No	M	
8	Black Carpet Square	Entry	No	No	M	250
9	Black Mastic for Black Carpet Square		No	No	M	
10	Blue Cove Base	Throughout	No	No	M	600
11	Cream Mastic for Blue Cove Base		No	No	M	
12	Orange Peel Drywall System - White Paint	Throughout	No	No	S	50,000
	White Texture		No	No	S	
	Cream Tape		No	No	M	
	White Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
13	2' x 4' Gray Ceiling Tile	Throughout	No	Yes	M	30,000
14	White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Throughout	No	No	M	5,000
15	Yellow Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)		No	No	M	
06/16/2025 Assumed ACBM						
16	Interior Caulking	Throughout	Assumed	No	M	200

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ0959.2056+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 02/06/19+06/16/25	Site: Kyrene Middle School - Building F

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
17	Exterior Caulking	Throughout	Assumed	No	M	200
18	Divider Wall	Throughout	Assumed	No	M	2,000
19	Gray Sink Coating	Throughout	Assumed	No	M	125
20	Glass Block Mortar	Throughout	Assumed	No	M	150
21	Brick	Throughout	Assumed	No	M	100,000
22	Mortar for Brick		Assumed	No	M	
23	Tackboard	Throughout	Assumed	No	M	8,000
24	Tan 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	4,000
25	Grout for Tan 4" x 4" Ceramic Wall Tile		Assumed	No	M	400
26	Mastic for Tan 4" x 4" Ceramic Wall Tile		Assumed	No	M	4,000
27	Blue 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	500
28	Green 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	500
29	Tan 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	4,000
30	Grout for Tan 2" x 2" Ceramic Floor Tile		Assumed	No	M	400
31	Thinset for Tan 2" x 2" Ceramic Floor Tile		Assumed	No	M	4,000
32	Blue 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	500
33	Green 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	500
34	Fixture Caulking	Throughout	Assumed	No	M	40
35	Fiberglass Reinforced Plastic (FRP)	Throughout	Assumed	No	M	150
36	Mastic for Fiberglass Reinforced Plastic (FRP)		Assumed	No	M	
37	Gray Stair Tread	Throughout	Assumed	No	M	600
38	Mastic for Gray Stair Tread		Assumed	No	M	
39	Gray 20" x 20" Floor Tile	Throughout	Assumed	No	M	500
40	Mastic for Gray 20" x 20" Floor Tile		Assumed	No	M	
41	Knockdown Drywall System	Throughout	Assumed	No	M	2,000
42	Silver Flex Duct Wrap	Above Ceiling	Assumed	No	M	2,000
43	Silver Box Duct Wrap	Above Ceiling	Assumed	No	M	3,000
44	Gray Duct Mastic	Above Ceiling	Assumed	No	M	300
45	Unfinished Drywall System	Above Ceiling	Assumed	No	M	6,000

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ0959.2056+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 02/06/19+06/16/25	Site: Kyrene Middle School - Building F

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
46	Black Foam Pipe Insulation	Above Ceiling	Assumed	No	M	200
47	White Pipe Wrap	Above Ceiling	Assumed	No	M	1,000
48	Insulation for White Pipe Wrap	Above Ceiling	Assumed	Yes	TSI	
49	Skylight Insulation Panel		Assumed	No	M	10,500

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ0959.2635+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 11/19/20+06/12/25	Site: Kyrene Middle School - Building G

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 11/19/20 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-040320)						
1	Orange Peel Drywall System - White Paint	Throughout	No	No	S	50,000
	White Texture		No	No	S	
	White Joint Compound		No	No	M	
	Cream Tape		No	No	M	
	White/Tan Drywall		No	No	M	
2	2' x 4' White/Tan Ceiling Tile	Rooms G-107 and G-207	No	Yes	M	30,000
3	White Counter Caulking	Rooms G-107 and G-208	No	No	M	200
4	Blue Cove Base	Throughout	No	No	M	600
5	Tan Mastic for Blue Cove Base		No	No	M	
Inspection Date: 06/12/25 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-031325						
6	2' x 4' Gray Ceiling Tile	Throughout	No	No	M	30,000
7	Orange Peel Drywall System - White Paint	Throughout	No	No	S	50,000
	White Texture		No	No	S	
	White Joint Compound		No	No	M	
	Cream Tape		No	No	M	
	White Drywall with Brown Paper		No	No	M	
8	Gray Multicolored Carpet Square	Throughout	No	No	M	22,000
9	Transparent Mastic for Gray Multicolored Carpet Square		No	No	M	
10	Gray Leveling Compound for Carpet Square		No	No	M	
11	Orange Mastic for Gray Multicolored Carpet Square		No	No	M	
12	Blue Cove Base	Throughout	No	No	M	600
13	Tan Mastic for Blue Cove Base		No	No	M	
14	Black Carpet Square	Throughout	No	No	M	250
15	Transparent Mastic for Black Carpet Square		No	No	M	
16	Gray Leveling Compound for Black Carpet Square		No	No	M	
17	Tan Mastic for Black Carpet Square		No	No	M	
18	Orange Mastic for Black Carpet Square		No	No	M	

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ0959.2635+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 11/19/20+06/12/25	Site: Kyrene Middle School - Building G

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
06/12/25 Assumed ACBM						
19	Divider Wall	Throughout	Assumed	No	M	2,000
20	Tackboard	Throughout	Assumed	No	M	8,000
21	Interior Caulking	Throughout	Assumed	No	M	200
22	Exterior Caulking	Throughout	Assumed	No	M	200
23	White Sink Coating	Throughout	Assumed	No	M	125
24	White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Throughout	Assumed	No	M	5,000
25	Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)		Assumed	No	M	
26	Brick	Throughout	Assumed	No	M	100,000
27	Mortar for Brick		Assumed	No	M	
28	Tan 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	4,000
29	Grout for Tan 4" x 4" Ceramic Wall Tile		Assumed	No	M	400
30	Mastic for Tan 4" x 4" Ceramic Wall Tile		Assumed	No	M	4,000
31	Green 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	500
32	Blue 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	500
33	Tan 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	4,000
34	Grout for Tan 2" x 2" Ceramic Floor Tile		Assumed	No	M	400
35	Thinset for Tan 2" x 2" Ceramic Floor Tile		Assumed	No	M	4,000
36	Green 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	500
37	Blue 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	500
38	Marble Threshold	Throughout	Assumed	No	M	25
39	Fixture Caulking	Throughout	Assumed	No	M	40
40	Knockdown Drywall System	Throughout	Assumed	No	M	2,000
41	Terrazzo Mop Sink	Throughout	Assumed	No	M	15
42	Brown Fiberglass Reinforced Plastic (FRP)	Throughout	Assumed	No	M	150
43	Mastic for Brown Fiberglass Reinforced Plastic (FRP)		Assumed	No	M	
44	Glass Block Mortar	Throughout	Assumed	No	M	150

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ0959.2635+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 11/19/20+06/12/25	Site: Kyrene Middle School - Building G

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
45	Black Stair Tread	Stairway	Assumed	No	M	200
46	Mastic for Black Stair Tread		Assumed	No	M	
47	Black 20" x 20" Floor Tile	Throughout	Assumed	No	M	500
48	Mastic for Black 20" x 20" Floor Tile		Assumed	No	M	
49	Skylight Insulation Panel	Above Ceiling	Assumed	No	M	10,500
50	Silver Flex Duct Wrap	Above Ceiling	Assumed	No	M	2,000
51	Silver Box Duct Wrap	Above Ceiling	Assumed	No	M	2,000
52	Gray Duct Mastic	Above Ceiling	Assumed	No	M	300
53	Unfinished Drywall System	Above Ceiling	Assumed	No	M	6,000
54	Black Foam Pipe Insulation	Above Ceiling	Assumed	No	M	200
55	White Pipe Wrap	Above Ceiling	Assumed	No	M	1,000
56	Mastic for White Pipe Wrap		Assumed	No	M	

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 03/13/25+06/12/25	Site: Kyrene Middle School - Building H

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 03/13/24 - AHERA Building Inspector: Tracey Carpenter (Certification #4644-14588-090523)						
1	Orange Peel Drywall System - White Paint	Throughout	No	No	S	50,000
	White Texture		No	No	S	
	Cream Tape		No	No	M	
	White Joint Compound		No	No	M	
	Pink Drywall with Brown Paper		No	No	M	
Inspection Date: 06/12/25 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-031325)						
2	Gray Decorative 2' x 4' Ceiling Tile	Throughout	No	No	M	5,000
3	Gray 2' x 4' Ceiling Tile	Throughout	No	No	M	5,000
4	Orange Peel Drywall System - White Paint	Throughout	No	No	S	50,000
	White Texture		No	No	S	
	Cream Tape		No	No	M	
	White Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
5	Gray Multicolored Carpet Square	Throughout	No	No	M	22,000
6	Gray Mastic for Gray Multicolored Carpet Square		No	No	M	
7	Blue Cove Base	Throughout	No	No	M	600
8	Cream Mastic for Blue Cove Base		No	No	M	
9	Black Carpet Square	Throughout	No	No	M	250
10	Gray Mastic for Black Carpet Square		No	No	M	
06/12/25 Assumed ACBM						
11	White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Throughout	Assumed	No	M	5,000
12	Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)		Assumed	No	M	
13	Interior Caulking	Throughout	Assumed	No	M	200
14	Exterior Caulking	Throughout	Assumed	No	M	200
15	Gray Sink Coating	Throughout	Assumed	No	M	125
16	Divider Wall	Throughout	Assumed	No	M	2,000

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 03/13/25+06/12/25	Site: Kyrene Middle School - Building H

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
17	Brick	Throughout	Assumed	No	M	100,000
18	Mortar for Brick		Assumed	No	M	
19	Tackboard	Throughout	Assumed	No	M	8,000
20	Black Stair Tread	Stairway	Assumed	No	M	200
21	Mastic for Black Stair Tread		Assumed	No	M	
22	Black Cove Base	Throughout	Assumed	No	M	150
23	Mastic for Black Cove Base		Assumed	No	M	
24	Black 20" x 20" Floor Tile	Throughout	Assumed	No	M	500
25	Mastic for Black 20" x 20" Floor Tile		Assumed	No	M	
26	Tan 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	4,000
27	Grout for Tan 4" x 4" Ceramic Wall Tile		Assumed	No	M	400
28	Mastic for Tan 4" x 4" Ceramic Wall Tile		Assumed	No	M	4,000
29	Green 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	500
30	Blue 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	500
31	Tan 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	4,000
32	Grout for Tan 2" x 2" Ceramic Floor Tile		Assumed	No	M	400
33	Thinset for Tan 2" x 2" Ceramic Floor Tile		Assumed	No	M	4,000
34	Green 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	500
35	Blue 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	500
36	Knockdown Drywall System	Throughout	Assumed	No	M	2,000
37	White Sink Coating	Throughout	Assumed	No	M	125
38	Glass Block Mortar	Throughout	Assumed	No	M	150
39	Marble Threshold	Throughout	Assumed	No	M	25
40	Fixture Caulking	Throughout	Assumed	No	M	40
41	Skylight Insulation Panel	Above Ceiling	Assumed	No	M	10,500
42	Silver Flex Duct Wrap	Above Ceiling	Assumed	No	M	2,000
43	Silver Box Duct Wrap	Above Ceiling	Assumed	No	M	3,000
44	Gray Duct Mastic	Above Ceiling	Assumed	No	M	300
45	Unfinished Drywall System	Above Ceiling	Assumed	No	M	6,000

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 03/13/25+06/12/25	Site: Kyrene Middle School - Building H

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
46	Black Foam Pipe Insulation	Above Ceiling	Assumed	No	M	200
47	White Pipe Wrap	Above Ceiling	Assumed	No	M	1,000
48	Mastic for White Pipe Wrap		Assumed	No	M	

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 03/13/24+06/11/25	Site: Kyrene Middle School - Building J

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 03/13/24 - AHERA Building Inspector: Tracey Carpenter (Certification #4644-14588-090523)						
1	12" x 12" White w/Gray Specs Vinyl Floor Tile (VCT)	Lounge/Workroom, J112 (3 Storage Closets), and J113	No	No	M	2,000
2	Yellow Mastic for 12" x 12" White w/Gray Specs (VCT)		No	No	M	
Inspection Date: 06/11/25 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-031325)						
3	Old Brown 2' x 4' Ceiling Tile	Throughout	No	No	M	5,000
4	New Brown 2' x 4' Ceiling Tile	Throughout	No	No	M	5,000
5	Gray Multicolored Carpet Square	Lounge, J119, and J120	No	No	M	5,000
6	Semi-Transparent Mastic for Carpet Square		No	No	M	
7	Black Cove Base	J112	No	No	M	150
8	Cream Mastic for Black Cove Base		No	No	M	
9	Black Carpet Square	Lounge, J119, and J120	No	No	M	300
10	Semi-Transparent Mastic for Black Carpet Square		No	No	M	
11	Orange Peel Drywall System - White Paint	Throughout	No	No	M	50,000
	White Texture		No	No	M	
	Cream Tape		No	No	M	
	White Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
06/11/25 Assumed ACBM						
12	Fiberglass Reinforced Plastic (FRP)	Throughout	Assumed	No	M	150
13	Mastic for Fiberglass Reinforced Plastic (FRP)		Assumed	No	M	
14	Gray Sink Coating	Throughout	Assumed	No	M	20
15	Interior Caulking	Throughout	Assumed	No	M	100
16	Exterior Caulking	Throughout	Assumed	No	M	100
17	Tan 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	3,000
18	Grout for Tan 4" x 4" Ceramic Wall Tile		Assumed	No	M	300
19	Mastic for Tan 4" x 4" Ceramic Wall Tile		Assumed	No	M	3,000
20	Green 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	500
21	Blue 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	500

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 03/13/24+06/11/25	Site: Kyrene Middle School - Building J

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
22	Tan 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	3,000
23	Grout for Tan 2" x 2" Ceramic Floor Tile		Assumed	No	M	300
24	Thinset for Tan 2" x 2" Ceramic Floor Tile		Assumed	No	M	3,000
25	Green 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	500
26	Blue 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	500
27	Fixture Caulking	Throughout	Assumed	No	M	50
28	Marble Threshold	Throughout	Assumed	No	M	25
29	Blue Cove Base	J112 (3 Storage Closets) and J113	Assumed	No	M	150
30	Mastic for Blue Cove Base		Assumed	No	M	
31	Tackboard	Throughout	Assumed	No	M	10,000
32	Gray 12" x 12" Vinyl Floor Tile (VCT)	Art J112	Assumed	No	M	1,500
33	Mastic for Gray 12" x 12" Vinyl Floor Tile (VCT)		Assumed	No	M	
34	Knockdown Drywall System	Electrical and Kiln Room	Assumed	No	M	2,000
35	Tan Multicolored 12" x 12" Vinyl Floor Tile (VCT)	Lounge Storage and J120 Storage	Assumed	No	M	600
36	Mastic for Tan Multicolored 12" x 12" VCT		Assumed	No	M	
37	Brick	Throughout	Assumed	No	M	60,000
38	Mortar for Brick		Assumed	No	M	
39	Gray Floor Coating	J120 Restroom	Assumed	No	M	150
40	White 6" x 6" Ceramic Wall Tile	J120 Restroom	Assumed	No	M	300
41	Grout for White 6" x 6" Ceramic Wall Tile		Assumed	No	M	30
42	Mastic for White 6" x 6" Ceramic Wall Tile		Assumed	No	M	300
43	Skylight Insulation Panel	Above Ceiling	Assumed	No	M	3,000
44	Large Silver Flex Duct Wrap	Above Ceiling	Assumed	No	M	2,000
45	Silver Box Duct Wrap	Above Ceiling	Assumed	No	M	2,000
46	Gray Duct Mastic	Above Ceiling	Assumed	No	M	200
47	Unfinished Drywall System	Above Ceiling	Assumed	No	M	6,000
48	Black Foam Pipe Insulation	Above Ceiling	Assumed	No	M	100
49	White Pipe Wrap	Above Ceiling	Assumed	No	M	500
50	Mastic for White Pipe Wrap		Assumed	No	M	

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 03/13/24+06/11/25	Site: Kyrene Middle School - Building J

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
51	Residual 12" x 12" Ceiling Tile Mastic	Above Ceiling	Assumed	No	M	2,000

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ0959.3201AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 09/27/22+06/11/25	Site: Kyrene Middle School - Building K

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 09/27/22 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-032422)						
1	White 4" x 4" Ceramic Wall Tile	Drinking Fountain	No	No	M	300
2	Cream Mastic for White 4" x 4" Ceramic Wall Tile		No	No	M	30
3	Gray Grout for White 4" x 4" Ceramic Wall Tile		No	No	M	300
4	Green 4" x 4" Ceramic Wall Tile	Throughout	No	No	M	500
5	Blue 4" x 4" Ceramic Wall Tile	Throughout	No	No	M	500
6	White Fixture Caulking	Throughout	No	No	M	100
7	Greenboard Drywall	Restrooms Near Media Center	No	No	M	250
8	Cream Mastic for Greenboard Drywall		No	No	M	
9	White Counter Caulking	Throughout	No	No	M	100
Inspection Date: 06/11/25 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-031325)						
10	Pink Batt Insulation	Above Ceiling	No	Yes	TSI	20,000
11	Brown/Black Wrap for Pink Batt Insulation		No	No	M	
12	2' x 4' Gray Ceiling Tile	Throughout	No	No	M	5,000
13	2' x 2' Gray Ceiling Tile	Throughout	No	No	M	15,000
14	Orange Peel Drywall System - White Paint	Throughout	No	No	S	80,000
	White Texture		No	No	S	
	Cream Tape		No	No	M	
	White Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
15	Gray Multicolored Carpet Square	Throughout	No	No	M	15,000
16	Transparent Mastic for Gray Multicolored Carpet Square		No	No	M	
17	Gray Cementitious Material for Carpet Square		No	No	M	
18	Blue Cove Base	Throughout	No	No	M	525
19	Tan Mastic for Blue Cove Base		No	No	M	
06/11/25 Assumed ACBM						
20	Black Carpet Square	Throughout	Assumed	No	M	300
21	Mastic for Black Carpet Square		Assumed	No	M	

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ0959.3201AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 09/27/22+06/11/25	Site: Kyrene Middle School - Building K

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
22	Tan 4" x 4" Ceramic Wall Tile	Throughout	Assumed	No	M	3,000
23	Grout for Tan 4" x 4" Ceramic Wall Tile		Assumed	No	M	300
24	Mastic for Tan 4" x 4" Ceramic Wall Tile		Assumed	No	M	3,000
25	Tan 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	3,000
26	Grout for Tan 2" x 2" Ceramic Floor Tile		Assumed	No	M	300
27	Thinset for Tan 2" x 2" Ceramic Floor Tile		Assumed	No	M	3,000
28	Green 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	500
29	Blue 2" x 2" Ceramic Floor Tile	Throughout	Assumed	No	M	500
30	Marble Threshold	Throughout	Assumed	No	M	50
31	Wallpaper	Throughout	Assumed	Yes	S	5,000
32	Brick	Throughout	Assumed	No	M	100,000
33	Mortar for Brick		Assumed	No	M	
34	White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Throughout	Assumed	No	M	2,000
35	Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)		Assumed	No	M	
36	Interior Caulking	Throughout	Assumed	No	M	100
37	Exterior Caulking	Throughout	Assumed	No	M	100
38	Knockdown Drywall System	IDF Room	Assumed	No	M	1,500
39	Gray Sink Coating	Throughout	Assumed	No	M	75
40	Gray Carpet Square	Media Center IDF and Library Resource	Assumed	No	M	100
41	Mastic for Gray Carpet Square		Assumed	No	M	
42	Dark Gray Cove Base	Janitorial Supply Closet, Media Center IDF, and Library Resource	Assumed	No	M	20
43	Mastic for Dark Gray Cove Base		Assumed	No	M	
44	Beige Multicolored 12" x 12" Vinyl Floor Tile (VCT)	Janitorial Supply Closet	Assumed	No	M	750
45	Mastic for Beige Multicolored 12" x 12" VCT		Assumed	No	M	
46	Fiberglass Reinforced Plastic (FRP)	Throughout	Assumed	No	M	500
47	Mastic for Fiberglass Reinforced Plastic (FRP)		Assumed	No	M	
48	Terrazzo Mop Sink	Throughout	Assumed	No	M	50
49	Unfinished Drywall System	Above Ceiling	Assumed	No	M	10,000

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ0959.3201AZ1418.57	Client: Kyrene Elementary School District
Inspection Date(s): 09/27/22+06/11/25	Site: Kyrene Middle School - Building K

Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
50	Silver Flex Duct Wrap	Above Ceiling	Assumed	No	M	2,000
51	Silver Box Duct Wrap	Above Ceiling	Assumed	No	M	2,000
52	Black Pipe Foam Insulation	Above Ceiling	Assumed	No	M	100
53	Pipe Wrap	Above Ceiling	Assumed	No	M	300
54	Mastic for Pipe Wrap		Assumed	No	M	
55	Gray Duct Mastic	Above Ceiling	Assumed	No	M	100
56	Skylight Insulation Panel	Above Ceiling	Assumed	No	M	2,000

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

SECTION 6

♦

PLM BULK
SAMPLE SHEETS

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.04+AZ1418.11+AZ1418.57	**Client: Kyrene Elementary School District**
Sample Date(s): 06/08/17+03/13/24+06/25/25	**Site: Kyrene Middle School - Building E/L**

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 06/08/2017 - AHERA Building Inspector: Krista Wahnefried (Certification #25511-2447693-311078)					
AZ1418.04- PLM-1	1	Blue Cove Base	Band Hall - Southwest Corner	Convenient	None Detected
	2	White Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.04- PLM-2	1	Blue Cove Base	Hall Outside Restroom - Southeast Corner	Convenient	None Detected
	2	White Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.04- PLM-3	1	Blue Cove Base	Band Hall - Southeast Corner	Convenient	None Detected
	2	White Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.04- PLM-4	3	Orange Peel Drywall System - White Paint	Band Hall - Southwest Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.04- PLM-5	3	Orange Peel Drywall System - White Paint	Hall Outside Restroom - Southeast Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.04- PLM-6	3	Orange Peel Drywall System - White Paint	Band Hall - Southeast Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.04- PLM-7	4	White Fiberglass Reinforced Plastic (FRP)	Janitorial Closet - Northwest	Convenient	None Detected
	5	Yellow Mastic for White Fiberglass Reinforced Plastic (FRP)		Convenient	None Detected
AZ1418.04- PLM-8	4	White Fiberglass Reinforced Plastic (FRP)	Janitorial Closet - Northwest	Convenient	None Detected
	5	Yellow Mastic for White Fiberglass Reinforced Plastic (FRP)		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.04+AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 06/08/17+03/13/24+06/25/25	Site: Kyrene Middle School - Building E/L

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.04- PLM-9	4	White Fiberglass Reinforced Plastic (FRP)	Janitorial Closet - Northwest	Convenient	None Detected
	5	Yellow Mastic for White Fiberglass Reinforced Plastic (FRP)		Convenient	None Detected
AZ1418.04- PLM-10	6	White 4" x 4" Ceramic Wall Tile	Restroom - West	Convenient	None Detected
	7	Off-White Grout for White 4" x 4" Ceramic Wall Tile		Convenient	None Detected
	8	Yellow Mastic for White 4" x 4" Ceramic Wall Tile		Convenient	None Detected
AZ1418.04- PLM-11	6	White 4" x 4" Ceramic Wall Tile	Restroom - Northwest Corner	Convenient	None Detected
	7	Off-White Grout for White 4" x 4" Ceramic Wall Tile		Convenient	None Detected
	8	Yellow Mastic for White 4" x 4" Ceramic Wall Tile		Convenient	None Detected
AZ1418.04- PLM-12	6	White 4" x 4" Ceramic Wall Tile	Restroom - Northeast	Convenient	None Detected
	7	Off-White Grout for White 4" x 4" Ceramic Wall Tile		Convenient	None Detected
	8	Yellow Mastic for White 4" x 4" Ceramic Wall Tile		Convenient	None Detected
Sample Date: 03/13/2024 - AHERA Building Inspector: Tracey Carpenter (Certification #4644-14588-090523)					
AZ1418.11-PLM 13	9	2" x 2" White Ceramic Floor Tile	Room Near Boy's Restroom - Northwest Corner	Convenient	None Detected
	10	Off-White Grout for 2" x 2" White Ceramic Floor Tile		Convenient	None Detected
	11	Gray Thinset for 2" x 2" White Ceramic Floor Tile		Convenient	None Detected
AZ1418.11-PLM 14	9	2" x 2" White Ceramic Floor Tile	Boy's Restroom - Southwest Corner	Convenient	None Detected
	10	Off-White Grout for 2" x 2" White Ceramic Floor Tile		Convenient	None Detected
	11	Gray Thinset for 2" x 2" White Ceramic Floor Tile		Convenient	None Detected
AZ1418.11-PLM 15	9	2" x 2" White Ceramic Floor Tile	Room Near Boy's Restroom - Center - East	Convenient	None Detected
	10	Off-White Grout for 2" x 2" White Ceramic Floor Tile		Convenient	None Detected
	11	Gray Thinset for 2" x 2" White Ceramic Floor Tile		Convenient	None Detected
AZ1418.11-PLM 16	12	Black Cove Base	Gymnasium - Southeast	Convenient	None Detected
	13	Beige Mastic for Black Cove Base		Convenient	None Detected
AZ1418.11-PLM 17	12	Black Cove Base	Gymnasium - South	Convenient	None Detected
	13	Beige Mastic for Black Cove Base		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.04+AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 06/08/17+03/13/24+06/25/25	Site: Kyrene Middle School - Building E/L

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.11-PLM 18	12	Black Cove Base	Gymnasium - Southwest	Convenient	None Detected
	13	Beige Mastic for Black Cove Base		Convenient	None Detected
AZ1418.11-PLM 19	14	Dark Teal Ceramic Bench Tiles	Girl's Locker Room - Center - Southeast	Convenient	None Detected
	15	Blue-Green Grout for Dark Teal Ceramic Bench Tiles		Convenient	None Detected
	16	Gray Thinset for Dark Teal Ceramic Bench Tiles		Convenient	None Detected
AZ1418.11-PLM 20	14	Dark Teal Ceramic Bench Tiles	Girl's Locker Room - Northwest	Convenient	None Detected
	15	Blue-Green Grout for Dark Teal Ceramic Bench Tiles		Convenient	None Detected
	16	Gray Thinset for Dark Teal Ceramic Bench Tiles		Convenient	None Detected
AZ1418.11-PLM 21	14	Dark Teal Ceramic Bench Tiles	Boy's Locker Room - North	Convenient	None Detected
	15	Blue-Green Grout for Dark Teal Ceramic Bench Tiles		Convenient	None Detected
	16	Gray Thinset for Dark Teal Ceramic Bench Tiles		Convenient	None Detected
AZ1418.11-PLM 22	17	Light Teal Ceramic Bench Tiles	Boy's Locker Room - Southwest	Convenient	None Detected
	18	Blue-Green Grout for Light Teal Ceramic Bench Tiles		Convenient	None Detected
	19	Gray Thinset for Light Teal Ceramic Bench Tiles		Convenient	None Detected
AZ1418.11-PLM 23	17	Light Teal Ceramic Bench Tiles	Boy's Locker Room - Southwest	Convenient	None Detected
	18	Blue-Green Grout for Light Teal Ceramic Bench Tiles		Convenient	None Detected
	19	Gray Thinset for Light Teal Ceramic Bench Tiles		Convenient	None Detected
AZ1418.11-PLM 24	17	Light Teal Ceramic Bench Tiles	Girl's Locker Room - Center - Southeast	Convenient	None Detected
	18	Blue-Green Grout for Light Teal Ceramic Bench Tiles		Convenient	None Detected
	19	Gray Thinset for Light Teal Ceramic Bench Tiles		Convenient	None Detected
Sample Date: 06/16/2025 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-031325)					
AZ1418.57-PLM-25	20	Gray Multicolored Carpet Square	Room East of L102 - Northwest	Convenient	None Detected
	21	Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57-PLM-26	20	Gray Multicolored Carpet Square	Room L105 - West	Convenient	None Detected
	21	Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57-PLM-27	20	Gray Multicolored Carpet Square	Room L103 - West	Convenient	None Detected
	21	Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.04+AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 06/08/17+03/13/24+06/25/25	Site: Kyrene Middle School - Building E/L

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.57-PLM-28	22	Black Carpet Square	Room L102 - Southwest	Convenient	None Detected
	23	Transparent Mastic for Black Carpet Square		Convenient	None Detected
AZ1418.57-PLM-29	22	Black Carpet Square	Hall to PE - Northwest	Convenient	None Detected
	23	Transparent Mastic for Black Carpet Square		Convenient	None Detected
AZ1418.57-PLM-30	22	Black Carpet Square	Room L102 - Northwest	Convenient	None Detected
	23	Transparent Mastic for Black Carpet Square		Convenient	None Detected
AZ1418.57-PLM-31	24	Blue Cove Base	Room L102 - Southeast	Convenient	None Detected
	25	Tan Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57-PLM-32	24	Blue Cove Base	Room L104 - Southwest	Convenient	None Detected
	25	Tan Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57-PLM-33	24	Blue Cove Base	Hallway South of Boy's RR - North	Convenient	None Detected
	25	Tan Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57-PLM-34	26	2' x 2' Gray Ceiling Tile	Room L102 - Center	Convenient	None Detected
AZ1418.57-PLM-35		2' x 2' Gray Ceiling Tile	Hall to PE - Southwest	Convenient	None Detected
AZ1418.57-PLM-36		2' x 2' Gray Ceiling Tile	Room L105 - Center - East	Convenient	None Detected
AZ1418.57-PLM-37	27	2' x 4' Gray Ceiling Tile	Room L100 - Southwest	Convenient	None Detected
AZ1418.57-PLM-38		2' x 4' Gray Ceiling Tile	Weight Room - Northwest	Convenient	None Detected
AZ1418.57-PLM-39		2' x 4' Gray Ceiling Tile	Weight Room - Southwest	Convenient	None Detected
AZ1418.57-PLM-40	28	Orange Peel Drywall System - White Paint	Room East of L102 - Northeast Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.57-PLM-41	28	Orange Peel Drywall System - White Paint	Hall East of Room L102 - South	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.04+AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 06/08/17+03/13/24+06/25/25	Site: Kyrene Middle School - Building E/L

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.57-PLM-42	28	Orange Peel Drywall System - White Paint	Room L105 - Northeast	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ0959.2056+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 02/06/19+06/16/25	Site: Kyrene Middle School - Building F

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 02/06/2019 - AHERA Building Inspector: Xin Lou (Certification #G9017)					
AZ0959.2056- PLM-1	1	White Cabinet Caulking	Room F207 - Southwest	Convenient	None Detected
	2	Green Paint for White Cabinet Caulking		Convenient	None Detected
AZ0959.2056- PLM-2	1	White Cabinet Caulking	Room F207 - South	Convenient	None Detected
	2	Green Paint for White Cabinet Caulking		Convenient	None Detected
AZ0959.2056- PLM-3	1	White Cabinet Caulking	Room F207 - Southwest	Convenient	None Detected
	2	Green Paint for White Cabinet Caulking		Convenient	None Detected
AZ0959.2056- PLM-4	3	Blue Cove Base	Room F207 - Southwest	Convenient	None Detected
	4	White Mastic for Blue Cove Base		Convenient	None Detected
AZ0959.2056- PLM-5	3	Blue Cove Base	Room F207 - Southeast	Convenient	None Detected
	4	White Mastic for Blue Cove Base		Convenient	None Detected
AZ0959.2056- PLM-6	3	Blue Cove Base	Room F207 - Southwest	Convenient	None Detected
	4	White Mastic for Blue Cove Base		Convenient	None Detected
AZ0959.2056- PLM-7	5	Orange Peel Drywall System - White Paint	Room F207 - Southwest Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ0959.2056- PLM-8	5	Orange Peel Drywall System - White Paint	Room F207 - South	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ0959.2056- PLM-9	5	Orange Peel Drywall System - White Paint	Room F207 - Southeast	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ0959.2056+AZ1418.57	**Client: Kyrene Elementary School District**
Sample Date(s): 02/06/19+06/16/25	**Site: Kyrene Middle School - Building F**

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 06/16/2025 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-031325)					
AZ1418.57-PLM-1	6	Gray Multicolored Carpet Square	First Floor - Exterior of Rm F107 - West	Convenient	None Detected
	7	Semi-Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57-PLM-2	6	Gray Multicolored Carpet Square	First Floor - Exterior of Rm F105 - Northwest	Convenient	None Detected
	7	Semi-Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57-PLM-3	6	Gray Multicolored Carpet Square	Second Floor - Room F204 - Northwest Corner	Convenient	None Detected
	7	Semi-Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57-PLM-4	8	Black Carpet Square	First Floor - Exterior of Rm F108 - Entryway	Convenient	None Detected
	9	Black Mastic for Black Carpet Square		Convenient	None Detected
AZ1418.57-PLM-5	8	Black Carpet Square	First Floor - Exterior of Rm F108 - West Entry	Convenient	None Detected
	9	Black Mastic for Black Carpet Square		Convenient	None Detected
AZ1418.57-PLM-6	8	Black Carpet Square	First Floor - Exterior of Rm F108 - East Entry	Convenient	None Detected
	9	Black Mastic for Black Carpet Square		Convenient	None Detected
AZ1418.57-PLM-7	10	Blue Cove Base	Second Floor - Room F206 - East Entry	Convenient	None Detected
	11	Cream Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57-PLM-8	10	Blue Cove Base	First Floor - Room F101 Entry	Convenient	None Detected
	11	Cream Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57-PLM-9	10	Blue Cove Base	First Floor - Room F108 - Southwest Corner	Convenient	None Detected
	11	Cream Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57-PLM-10	12	Orange Peel Drywall System - White Paint	First Floor - Room F108 - North	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ0959.2056+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 02/06/19+06/16/25	Site: Kyrene Middle School - Building F

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.57-PLM-11	12	Orange Peel Drywall System - White Paint	Second Floor - Room F208 - Southeast Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.57-PLM-12	12	Orange Peel Drywall System - White Paint	First Floor - Hall Between F106 & F107 - F107 Exit	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.57-PLM-13	13	2' x 4' Gray Ceiling Tile	First Floor - Room F107 - Center - South	Convenient	None Detected
AZ1418.57-PLM-14		2' x 4' Gray Ceiling Tile	Second Floor - Room F205 - South	Convenient	None Detected
AZ1418.57-PLM-15		2' x 4' Gray Ceiling Tile	Second Floor - Room F203 - South	Convenient	None Detected
AZ1418.57-PLM-16	14	White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Room E111 - Center	Convenient	None Detected
	15	Yellow Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)		Convenient	None Detected
AZ1418.57-PLM-17	14	White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Room E110 - Center	Convenient	None Detected
	15	Yellow Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)		Convenient	None Detected
AZ1418.57-PLM-18	14	White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Second Floor - Exterior of F201 & F202 - Center	Convenient	None Detected
	15	Yellow Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ0959.2635+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 11/19/20+06/12/25	Site: Kyrene Middle School - Building G

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 11/19/20 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-040320)					
AZ0959.2635- PLM-1	1	Orange Peel Drywall System - White Paint	Room 107 - Southwest	Convenient	None Detected
		White Texture		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White/Tan Drywall		Convenient	None Detected
AZ0959.2635- PLM-2	1	Orange Peel Drywall System - White Paint	Room 107 - Southwest	Convenient	None Detected
		White Texture		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White/Tan Drywall		Convenient	None Detected
AZ0959.2635- PLM-3	1	Orange Peel Drywall System - White Paint	Room 207 - Southwest	Convenient	None Detected
		White Texture		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White/Tan Drywall		Convenient	None Detected
AZ0959.2635- PLM-4	2	2' x 4' White/Tan Ceiling Tile	Room 107 - Southwest	Convenient	None Detected
AZ0959.2635- PLM-5		2' x 4' White/Tan Ceiling Tile	Room 107 - Southwest	Convenient	None Detected
AZ0959.2635- PLM-6		2' x 4' White/Tan Ceiling Tile	Room 207 - Southwest	Convenient	None Detected
AZ0959.2635- PLM-7	3	White Counter Caulking	Room 107 - Southwest	Convenient	None Detected
AZ0959.2635- PLM-8		White Counter Caulking	Room 107 - Southwest	Convenient	None Detected
AZ0959.2635- PLM-9		White Counter Caulking	Room 207 - Southwest	Convenient	None Detected
AZ0959.2635- PLM-10	4	Blue Cove Base	Room 107 - Southwest	Convenient	None Detected
	5	Tan Mastic for Blue Cove Base		Convenient	None Detected
AZ0959.2635- PLM-11	4	Blue Cove Base	Room 107 - Southwest	Convenient	None Detected
	5	Tan Mastic for Blue Cove Base		Convenient	None Detected
AZ0959.2635- PLM-12	4	Blue Cove Base	Room 207 - Southwest	Convenient	None Detected
	5	Tan Mastic for Blue Cove Base		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ0959.2635+AZ1418.57			Client: Kyrene Elementary School District		
Sample Date(s): 11/19/20+06/12/25			Site: Kyrene Middle School - Building G		
Sample Number	**HM#**	**Material Description**	**Sample Location**	**Manner of Sampling**	**Asbestos Content**
Sample Date: 06/12/25 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-031325)					
AZ1418.57-PLM-13	6	2' x 4' Gray Ceiling Tile	Second Floor - Room G206 - South	Convenient	None Detected
AZ1418.57-PLM-14		2' x 4' Gray Ceiling Tile	First Floor - Exterior of Rm G105 - Northwest	Convenient	None Detected
AZ1418.57-PLM-15		2' x 4' Gray Ceiling Tile	First Floor - Exterior of Rm G107 - South	Convenient	None Detected
AZ1418.57-PLM-16	7	Orange Peel Drywall System - White Paint	First Floor - Room G108 - Northwest	Convenient	None Detected
		White Texture		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.57-PLM-17	7	Orange Peel Drywall System - White Paint	Second Floor - Room G208 - East Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.57-PLM-18	7	Orange Peel Drywall System - White Paint	First Floor - Hall Between Rm G106 & G107 - G106 Exit	Convenient	None Detected
		White Texture		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.57-PLM-19	8	Gray Multicolored Carpet Square	Second Floor - Room G204 - South	Convenient	None Detected
	9	Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
	10	Gray Leveling Compound for Carpet Square		Convenient	None Detected
	11	Orange Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57-PLM-20	8	Gray Multicolored Carpet Square	First Floor - Room G102 - South	Convenient	None Detected
	9	Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
	10	Gray Leveling Compound for Carpet Square		Convenient	None Detected
	11	Orange Mastic for Gray Multicolored Carpet Square		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ0959.2635+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 11/19/20+06/12/25	Site: Kyrene Middle School - Building G

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.57-PLM-21	8	Gray Multicolored Carpet Square	First Floor - North of Girl's RR - North	Convenient	None Detected
	9	Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
	10	Gray Leveling Compound for Carpet Square		Convenient	None Detected
	11	Orange Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57-PLM-22	12	Blue Cove Base	First Floor - Room G101 - Northwest Corner	Convenient	None Detected
	13	Tan Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57-PLM-23	12	Blue Cove Base	Second Floor - Room G205 - South Corner	Convenient	None Detected
	13	Tan Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57-PLM-24	12	Blue Cove Base	Second Floor - Room G207 - South	Convenient	None Detected
	13	Tan Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57-PLM-25	14	Black Carpet Square	First Floor - Exterior of Rm G108 - South Entry	Convenient	None Detected
	15	Transparent Mastic for Black Carpet Square		Convenient	None Detected
	16	Gray Leveling Compound for Black Carpet Square		Convenient	None Detected
	17	Tan Mastic for Black Carpet Square		Convenient	None Detected
AZ1418.57-PLM-26	14	Black Carpet Square	First Floor - Exterior of Rm G108 - South Entry	Convenient	None Detected
	15	Transparent Mastic for Black Carpet Square		Convenient	None Detected
	16	Gray Leveling Compound for Black Carpet Square		Convenient	None Detected
	17	Tan Mastic for Black Carpet Square		Convenient	None Detected
AZ1418.57-PLM-27	14	Black Carpet Square	First Floor - Southeast Entry - North Corner	Convenient	None Detected
	15	Transparent Mastic for Black Carpet Square		Convenient	None Detected
	16	Gray Leveling Compound for Black Carpet Square		Convenient	None Detected
	18	Orange Mastic for Black Carpet Square		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 03/13/25+06/12/25	Site: Kyrene Middle School - Building H

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 03/13/24 - AHERA Building Inspector: Tracey Carpenter (Certification #4644-14588-090523)					
AZ1418.11- PLM-1	1	Orange Peel Drywall System - White Paint	Room H107 - Northeast	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		Pink Drywall with Brown Paper		Convenient	None Detected
AZ1418.11- PLM-2	1	Orange Peel Drywall System - White Paint	Room H107 - Northwest	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
AZ1418.11- PLM-3	1	Orange Peel Drywall System - White Paint	Room H107 - East	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		Pink Drywall with Brown Paper		Convenient	None Detected
Sample Date: 06/12/25 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-031325)					
AZ1418.57-PLM-4	2	Gray Decorative 2' x 4' Ceiling Tile	First Floor - Exterior of H105 - South	Convenient	None Detected
AZ1418.57-PLM-5		Gray Decorative 2' x 4' Ceiling Tile	First Floor - Exterior of H107 - South	Convenient	None Detected
AZ1418.57-PLM-6		Gray Decorative 2' x 4' Ceiling Tile	First Floor - North of Girl's RR - Center	Convenient	None Detected
AZ1418.57-PLM-7	3	Gray 2' x 4' Ceiling Tile	Second Floor - Room H203 - Southeast	Convenient	None Detected
AZ1418.57-PLM-8		Gray 2' x 4' Ceiling Tile	Second Floor - Room H106 - Southeast	Convenient	None Detected
AZ1418.57-PLM-9		Gray 2' x 4' Ceiling Tile	First Floor - Room H107 - Southeast	Convenient	None Detected
AZ1418.57-PLM-10	4	Orange Peel Drywall System - White Paint	First Floor - Room 108 - West	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 03/13/25+06/12/25	Site: Kyrene Middle School - Building H

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.57-PLM-11	4	Orange Peel Drywall System - White Paint	Second Floor - Room H208 - Northeast Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.57-PLM-12	4	Orange Peel Drywall System - White Paint	First Floor - Hall Between Rms H106 & H107 - H106 Exit	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.57-PLM-13	5	Gray Multicolored Carpet Square	First Floor - Room H101 - Center - Southeast	Convenient	None Detected
	6	Gray Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57-PLM-14	5	Gray Multicolored Carpet Square	First Floor - Northwest of Girl's RR - Center	Convenient	None Detected
	6	Gray Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57-PLM-15	5	Gray Multicolored Carpet Square	Second Floor - Room H205 - Southeast	Convenient	None Detected
	6	Gray Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57-PLM-16	7	Blue Cove Base	First Floor - Room H107 - Northwest Corner	Convenient	None Detected
	8	Cream Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57-PLM-17	7	Blue Cove Base	Second Floor - North of Boy's RR - Center	Convenient	None Detected
	8	Cream Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57-PLM-18	7	Blue Cove Base	Second Floor - Room H204 - Northeast Corner	Convenient	None Detected
	8	Cream Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57-PLM-19	9	Black Carpet Square	First Floor - South Entry - Center	Convenient	None Detected
	10	Gray Mastic for Black Carpet Square		Convenient	None Detected
AZ1418.57-PLM-20	9	Black Carpet Square	First Floor - South Entry - Center	Convenient	None Detected
	10	Gray Mastic for Black Carpet Square		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 03/13/25+06/12/25	Site: Kyrene Middle School - Building H

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.57-PLM-21	9	Black Carpet Square	First Floor - Northeast Entry - Center	Convenient	None Detected
	10	Gray Mastic for Black Carpet Square		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 03/13/24+06/11/25	Site: Kyrene Middle School - Building J

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 03/13/24 - AHERA Building Inspector: Tracey Carpenter (Certification #4644-14588-090523)					
AZ1418.11- PLM-1	1	12" x 12" White w/Gray Specs Vinyl Floor Tile (VCT)	Hallway South of Rm J112 - Southeast	Convenient	None Detected
	2	Yellow Mastic for 12" x 12" White w/Gray Specs Vinyl Floor Tile (VCT)		Convenient	None Detected
AZ1418.11- PLM-2	1	12" x 12" White w/Gray Specs Vinyl Floor Tile (VCT)	Hallway South of Rm J112 - South	Convenient	None Detected
	2	Yellow Mastic for 12" x 12" White w/Gray Specs Vinyl Floor Tile (VCT)		Convenient	None Detected
AZ1418.11- PLM-3	1	12" x 12" White w/Gray Specs Vinyl Floor Tile (VCT)	Hallway South of Rm J112 - Southwest	Convenient	None Detected
	2	Yellow Mastic for 12" x 12" White w/Gray Specs Vinyl Floor Tile (VCT)		Convenient	None Detected
Sample Date: 06/11/25 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-031325)					
AZ1418.57- PLM-4	3	Old Brown 2' x 4' Ceiling Tile	Workroom - Center - North	Convenient	None Detected
AZ1418.57- PLM-5		Old Brown 2' x 4' Ceiling Tile	Staff Lounge - Northeast	Convenient	None Detected
AZ1418.57- PLM-6		Old Brown 2' x 4' Ceiling Tile	Room J113 - Center - South	Convenient	None Detected
AZ1418.57- PLM-7	4	New Brown 2' x 4' Ceiling Tile	Room J120 - Southwest	Convenient	None Detected
AZ1418.57- PLM-8		New Brown 2' x 4' Ceiling Tile	Room J120 - South	Convenient	None Detected
AZ1418.57- PLM-9		New Brown 2' x 4' Ceiling Tile	Room J119 - South	Convenient	None Detected
AZ1418.57- PLM-10	5	Gray Multicolored Carpet Square	Staff Lounge - Northwest	Convenient	None Detected
	6	Semi-Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57- PLM-11	5	Gray Multicolored Carpet Square	Room J120 - Northeast	Convenient	None Detected
	6	Semi-Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57- PLM-12	5	Gray Multicolored Carpet Square	Workroom - North	Convenient	None Detected
	6	Semi-Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
AZ1418.57- PLM-13	7	Black Cove Base	Staff Lounge - Northeast	Convenient	None Detected
	8	Cream Mastic for Black Cove Base		Convenient	None Detected
AZ1418.57- PLM-14	7	Black Cove Base	Staff Lounge - Southeast	Convenient	None Detected
	8	Cream Mastic for Black Cove Base		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11+AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 03/13/24+06/11/25	Site: Kyrene Middle School - Building J

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.57- PLM-15	7	Black Cove Base	Room J120 - Southeast	Convenient	None Detected
	8	Cream Mastic for Black Cove Base		Convenient	None Detected
AZ1418.57- PLM-16	9	Black Carpet Square	Staff Lounge - North Entry	Convenient	None Detected
	10	Semi-Transparent Mastic for Black Carpet Square		Convenient	None Detected
AZ1418.57- PLM-17	9	Black Carpet Square	Workroom - South	Convenient	None Detected
	10	Semi-Transparent Mastic for Black Carpet Square		Convenient	None Detected
AZ1418.57- PLM-18	9	Black Carpet Square	Room J120 - Northeast Entry	Convenient	None Detected
	10	Semi-Transparent Mastic for Black Carpet Square		Convenient	None Detected
AZ1418.57- PLM-19	11	Orange Peel Drywall System - White Paint	Workroom Storage - Southeast Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.57- PLM-20	11	Orange Peel Drywall System - White Paint	Room J112 -Pantry - Northwest Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.57- PLM-21	11	Orange Peel Drywall System - White Paint	Room J113 - South Entry	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ0959.3201AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 09/27/22+06/11/25	Site: Kyrene Middle School - Building K

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 09/27/22 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-032422)					
AZ0959.3201- PLM-1	1	White 4" x 4" Ceramic Wall Tile	Girl's Restroom By Media Center - Southwest	Convenient	None Detected
	2	Cream Mastic for White 4" x 4" Ceramic Wall Tile		Convenient	None Detected
	3	Gray Grout for White 4" x 4" Ceramic Wall Tile		Convenient	None Detected
AZ0959.3201- PLM-2	1	White 4" x 4" Ceramic Wall Tile	Girl's Restroom By Media Center - South	Convenient	None Detected
	2	Cream Mastic for White 4" x 4" Ceramic Wall Tile		Convenient	None Detected
	3	Gray Grout for White 4" x 4" Ceramic Wall Tile		Convenient	None Detected
AZ0959.3201- PLM-3	1	White 4" x 4" Ceramic Wall Tile	Girl's Restroom By Media Center - Southeast	Convenient	None Detected
	2	Cream Mastic for White 4" x 4" Ceramic Wall Tile		Convenient	None Detected
	3	Gray Grout for White 4" x 4" Ceramic Wall Tile		Convenient	None Detected
AZ0959.3201- PLM-4	4	Green 4" x 4" Ceramic Wall Tile	Girl's Restroom By Media Center - Southwest	Convenient	None Detected
AZ0959.3201- PLM-5		Green 4" x 4" Ceramic Wall Tile	Girl's Restroom By Media Center - South	Convenient	None Detected
AZ0959.3201- PLM-6		Green 4" x 4" Ceramic Wall Tile	Girl's Restroom By Media Center - Southeast	Convenient	None Detected
AZ0959.3201- PLM-7	5	Blue 4" x 4" Ceramic Wall Tile	Girl's Restroom By Media Center - Southwest	Convenient	None Detected
AZ0959.3201- PLM-8		Blue 4" x 4" Ceramic Wall Tile	Girl's Restroom By Media Center - South	Convenient	None Detected
AZ0959.3201- PLM-9		Blue 4" x 4" Ceramic Wall Tile	Girl's Restroom By Media Center - Southeast	Convenient	None Detected
AZ0959.3201- PLM-10	6	White Fixture Caulking	Boy's Restroom By Media Center - Northwest	Convenient	None Detected
AZ0959.3201- PLM-11		White Fixture Caulking	Boy's Restroom By Media Center - North	Convenient	None Detected
AZ0959.3201- PLM-12		White Fixture Caulking	Boy's Restroom By Media Center - North	Convenient	None Detected
AZ0959.3201- PLM-13	7	Greenboard Drywall	Boy's Restroom By Media Center - Northwest	Convenient	None Detected
	8	Cream Mastic for Greenboard Drywall		Convenient	None Detected
AZ0959.3201- PLM-14	7	Greenboard Drywall	Girl's Restroom By Media Center - South	Convenient	None Detected
	8	Cream Mastic for Greenboard Drywall		Convenient	None Detected
AZ0959.3201- PLM-15	7	Greenboard Drywall	Boy's Restroom By Media Center - North	Convenient	None Detected
	8	Cream Mastic for Greenboard Drywall		Convenient	None Detected
AZ0959.3201- PLM-16	9	White Counter Caulking		Convenient	None Detected
AZ0959.3201- PLM-17		White Counter Caulking	Boy's Restroom By Media Center - Northeast	Convenient	None Detected
AZ0959.3201- PLM-18		White Counter Caulking	Boy's Restroom By Media Center - Northeast	Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ0959.3201AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 09/27/22+06/11/25	Site: Kyrene Middle School - Building K

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 06/11/25 - AHERA Building Inspector: Nick Marcos (Certification #4644-8873-031325)					
AZ1418.57- PLM-19	10	Pink Batt Insulation	Computer Lab - Southwest	Convenient	None Detected
	11	Brown/Black Wrap for Pink Batt Insulation		Convenient	None Detected
AZ1418.57- PLM-20	10	Pink Batt Insulation	Computer Lab ISI - Center - Southwest	Convenient	None Detected
	11	Brown/Black Wrap for Pink Batt Insulation		Convenient	None Detected
AZ1418.57- PLM-21	10	Pink Batt Insulation	Media Workroom - Center	Convenient	None Detected
	11	Brown/Black Wrap for Pink Batt Insulation		Convenient	None Detected
AZ1418.57- PLM-22	12	2' x 4' Gray Ceiling Tile	Conference Room - North	Convenient	None Detected
AZ1418.57- PLM-23		2' x 4' Gray Ceiling Tile	Computer Lab - Southeast	Convenient	None Detected
AZ1418.57- PLM-24		2' x 4' Gray Ceiling Tile	Computer Lab ISI - Center - Northeast	Convenient	None Detected
AZ1418.57- PLM-25	13	2' x 2' Gray Ceiling Tile	Reception Area - Northwest Hall - Center	Convenient	None Detected
AZ1418.57- PLM-26		2' x 2' Gray Ceiling Tile	Reception Area - West Hall - Center	Convenient	None Detected
AZ1418.57- PLM-27		2' x 2' Gray Ceiling Tile	Reception Area - Southeast Hall - Center	Convenient	None Detected
AZ1418.57- PLM-28	14	Orange Peel Drywall System - White Paint	Computer Lab - Northwest Room - Northwest Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.57- PLM-29	14	Orange Peel Drywall System - White Paint	Prof Lib - Northwest Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.57- PLM-30	14	Orange Peel Drywall System - White Paint	A/V - Northwest Corner	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected

Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ0959.3201AZ1418.57	Client: Kyrene Elementary School District
Sample Date(s): 09/27/22+06/11/25	Site: Kyrene Middle School - Building K

Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.57- PLM-31	15	Gray Multicolored Carpet Square	Media Center - Northwest	Convenient	None Detected
	16	Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
	17	Gray Cementitious Material for Carpet Square		Convenient	None Detected
AZ1418.57- PLM-32	15	Gray Multicolored Carpet Square	Computer Lab ISI - Southeast	Convenient	None Detected
	16	Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
	17	Gray Cementitious Material for Carpet Square		Convenient	None Detected
AZ1418.57- PLM-33	15	Gray Multicolored Carpet Square	Computer Lab - Northwest	Convenient	None Detected
	16	Transparent Mastic for Gray Multicolored Carpet Square		Convenient	None Detected
	17	Gray Cementitious Material for Carpet Square		Convenient	None Detected
AZ1418.57- PLM-34	18	Blue Cove Base	Media Center - Northeast	Convenient	None Detected
	19	Tan Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57- PLM-35	18	Blue Cove Base	Office 2 - Southwest Corner	Convenient	None Detected
	19	Tan Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.57- PLM-36	18	Blue Cove Base	Supply 2 - Northeast	Convenient	None Detected
	19	Tan Mastic for Blue Cove Base		Convenient	None Detected


Inspector: Nick Marcos
Certificate Number: ON-4644-8873-031325
State: Arizona

DOMINION

SECTION 7

♦

PLM BULK SAMPLE LOCATION MAPS

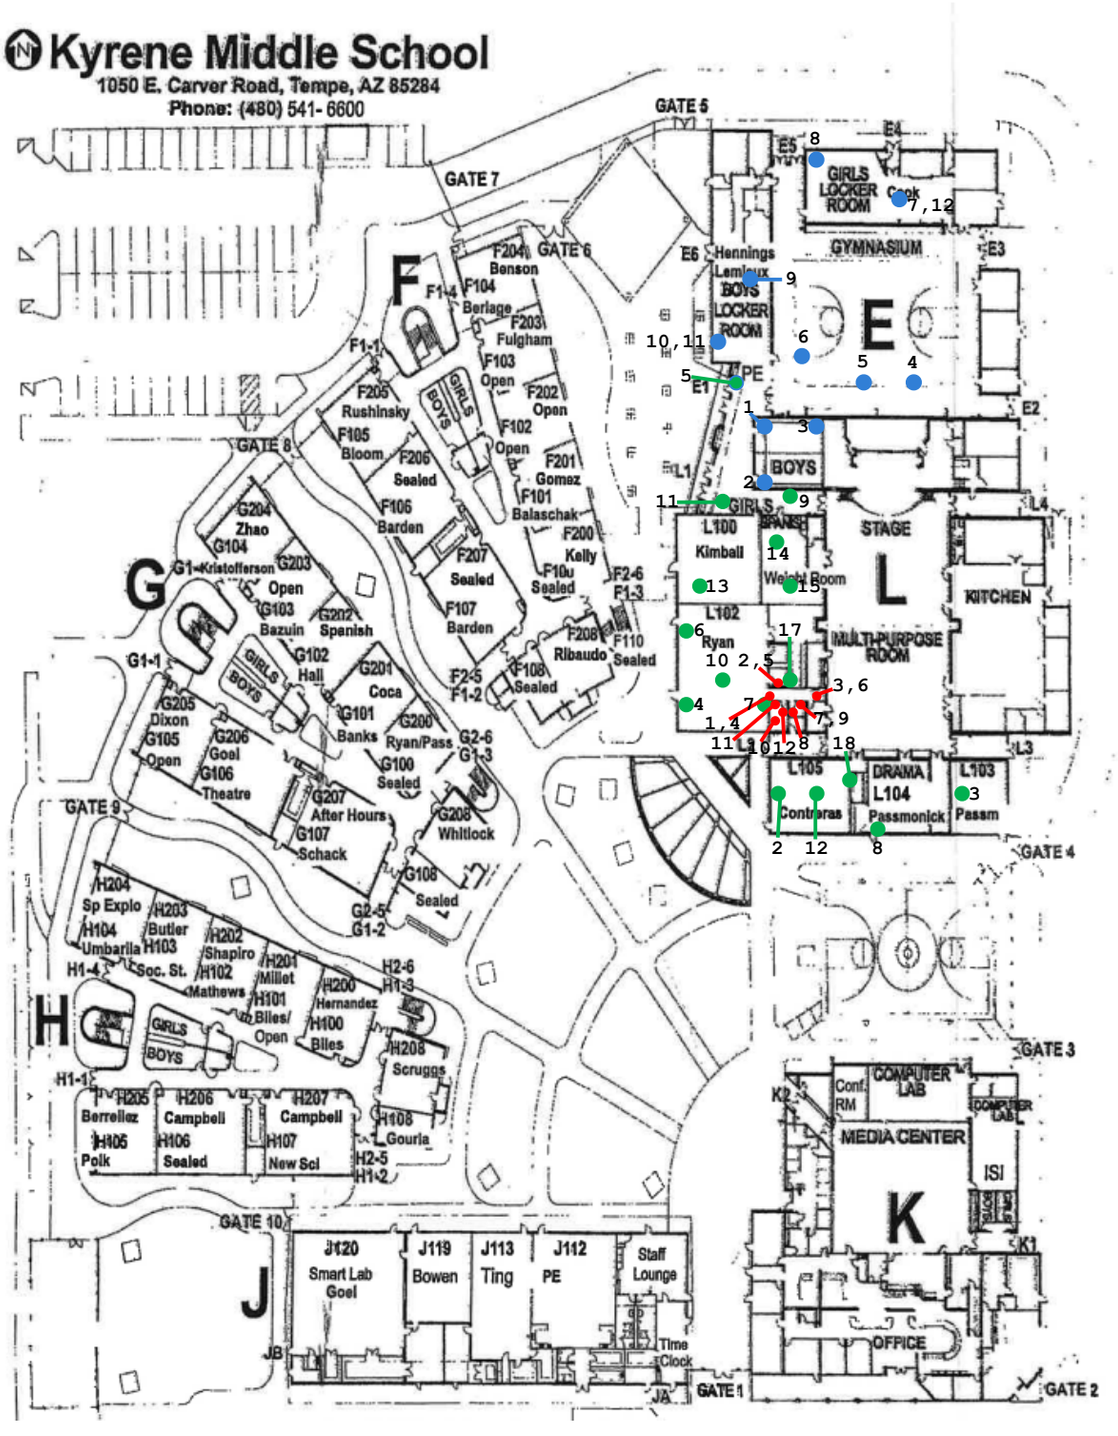


PLM Bulk Sample Location Map
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.11/AZ1418.57

Building E/L

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

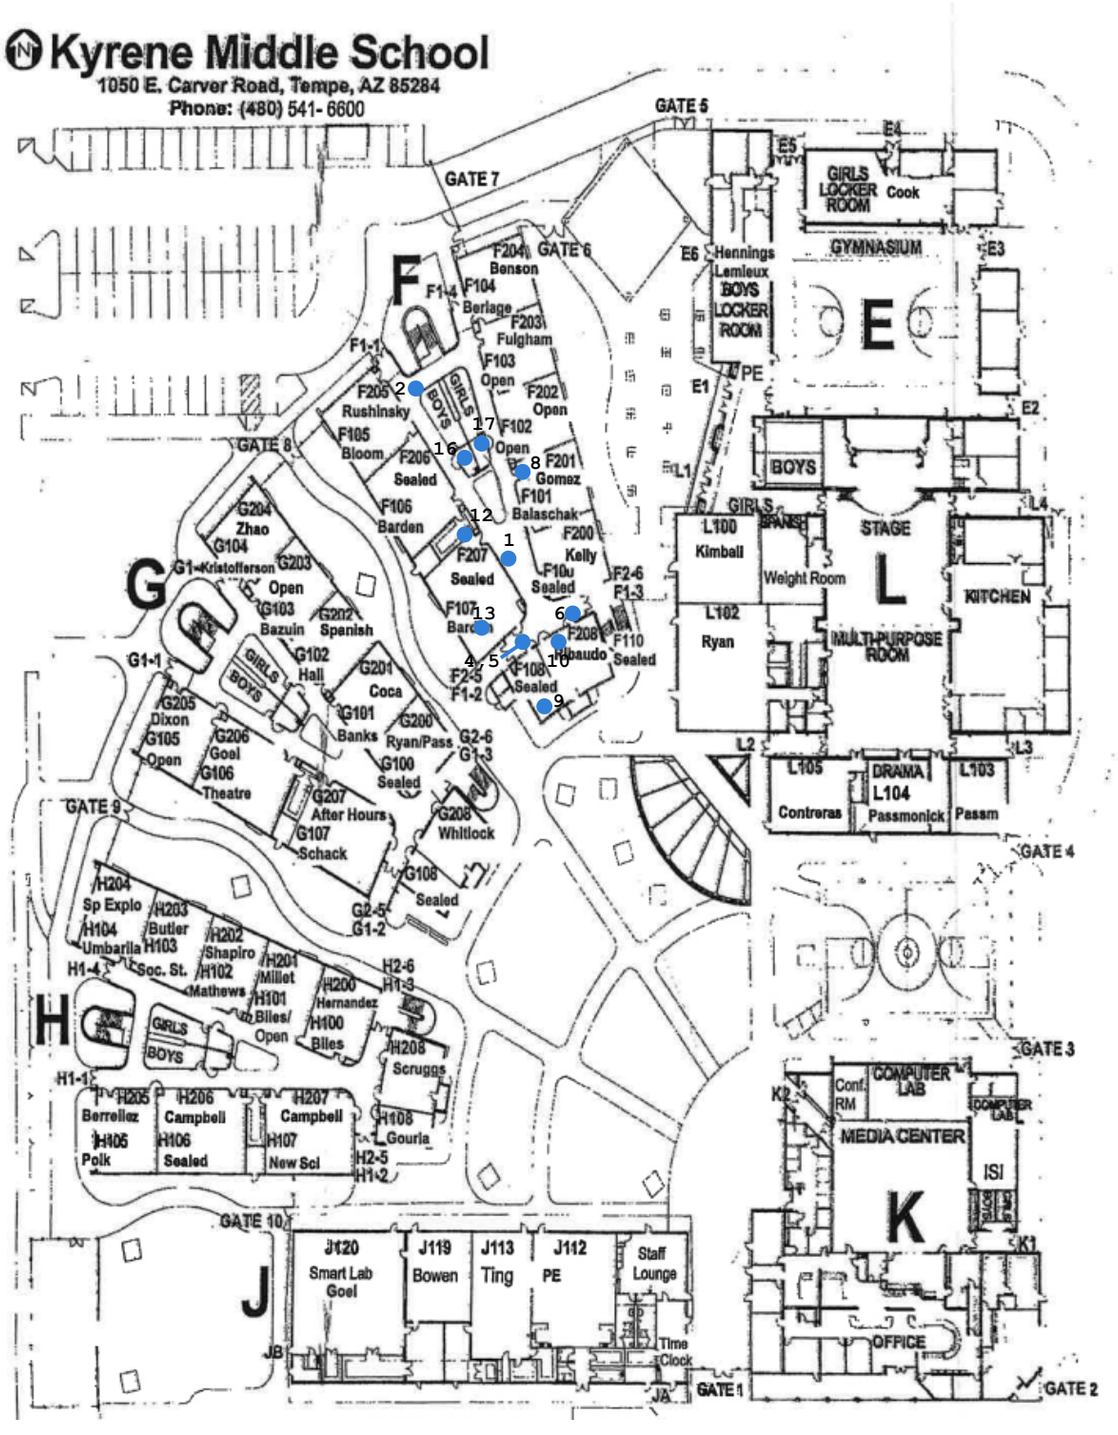

Sample dates:


- **February 6, 2019**
- **June 16, 2025**

PLM Bulk Sample Location Map (1)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.11/AZ1418.57

Building F - First Floor

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

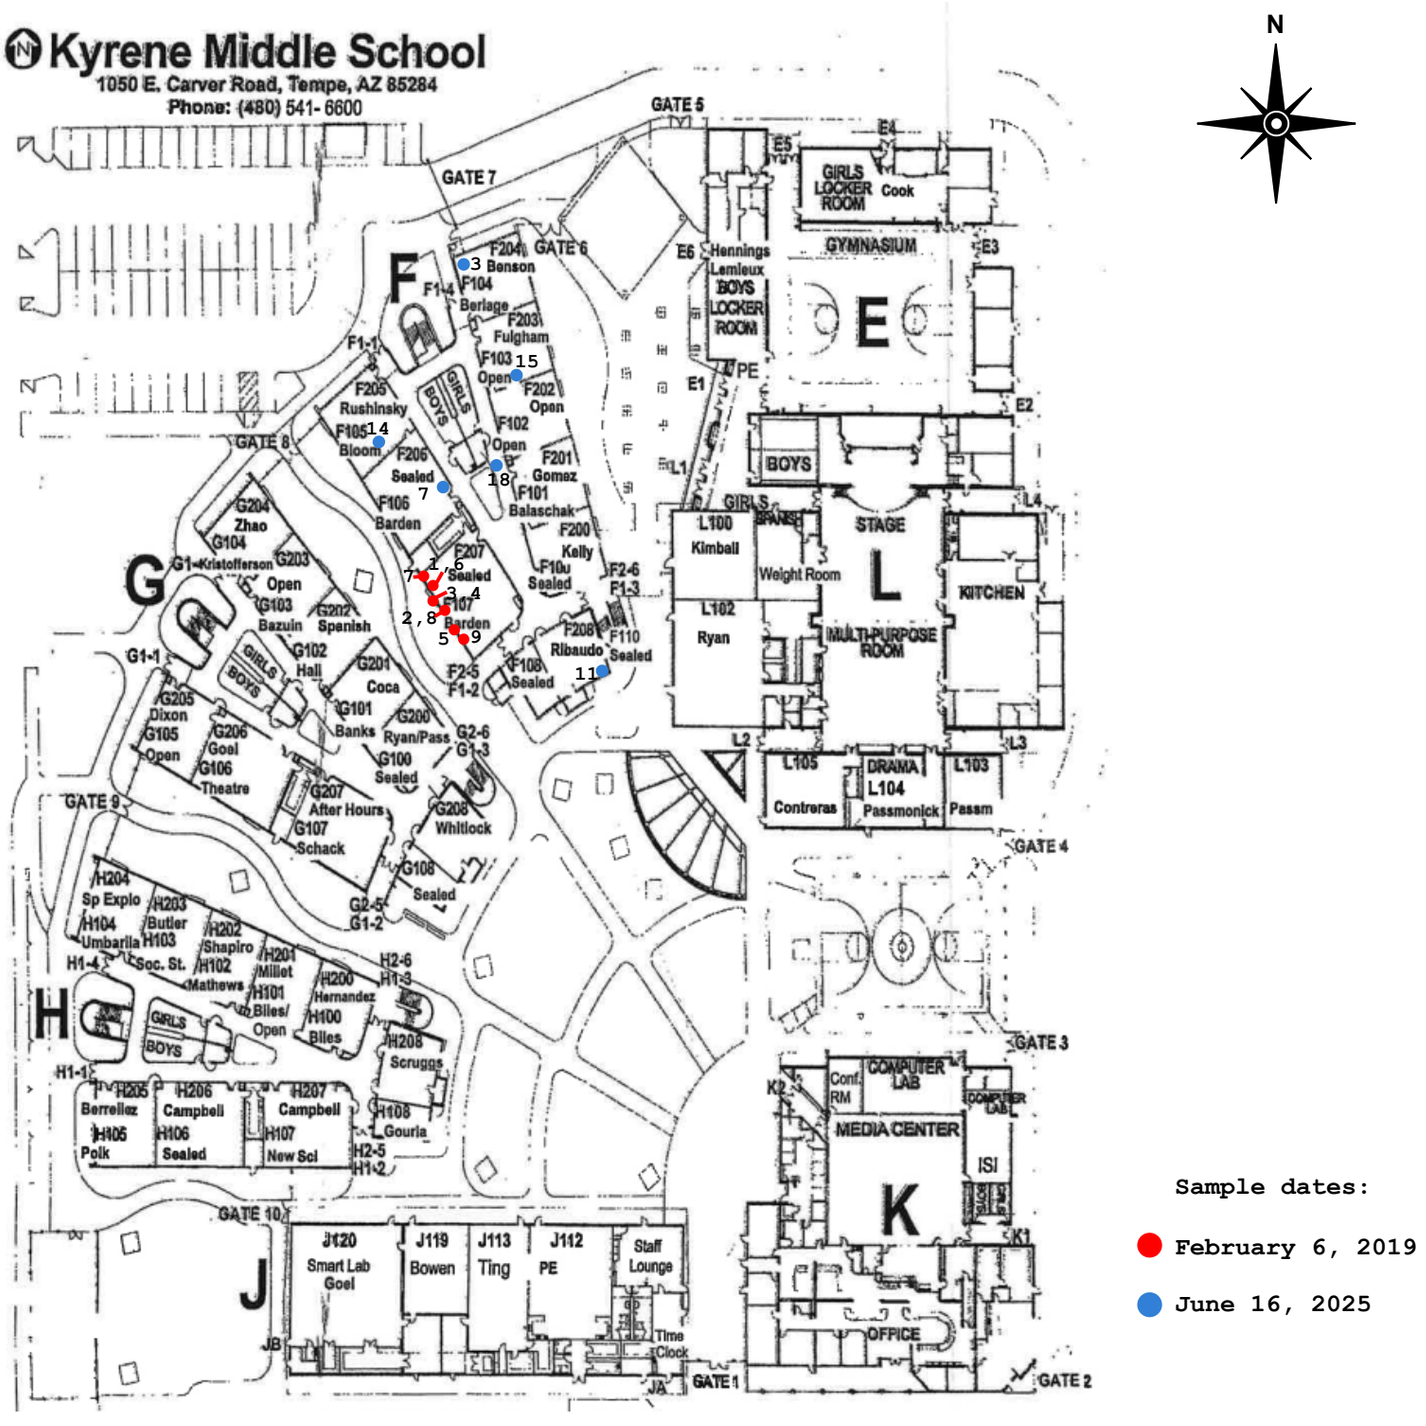


PLM Bulk Sample Location Map (2)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.11/AZ1418.57

Building F - Second Floor


Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

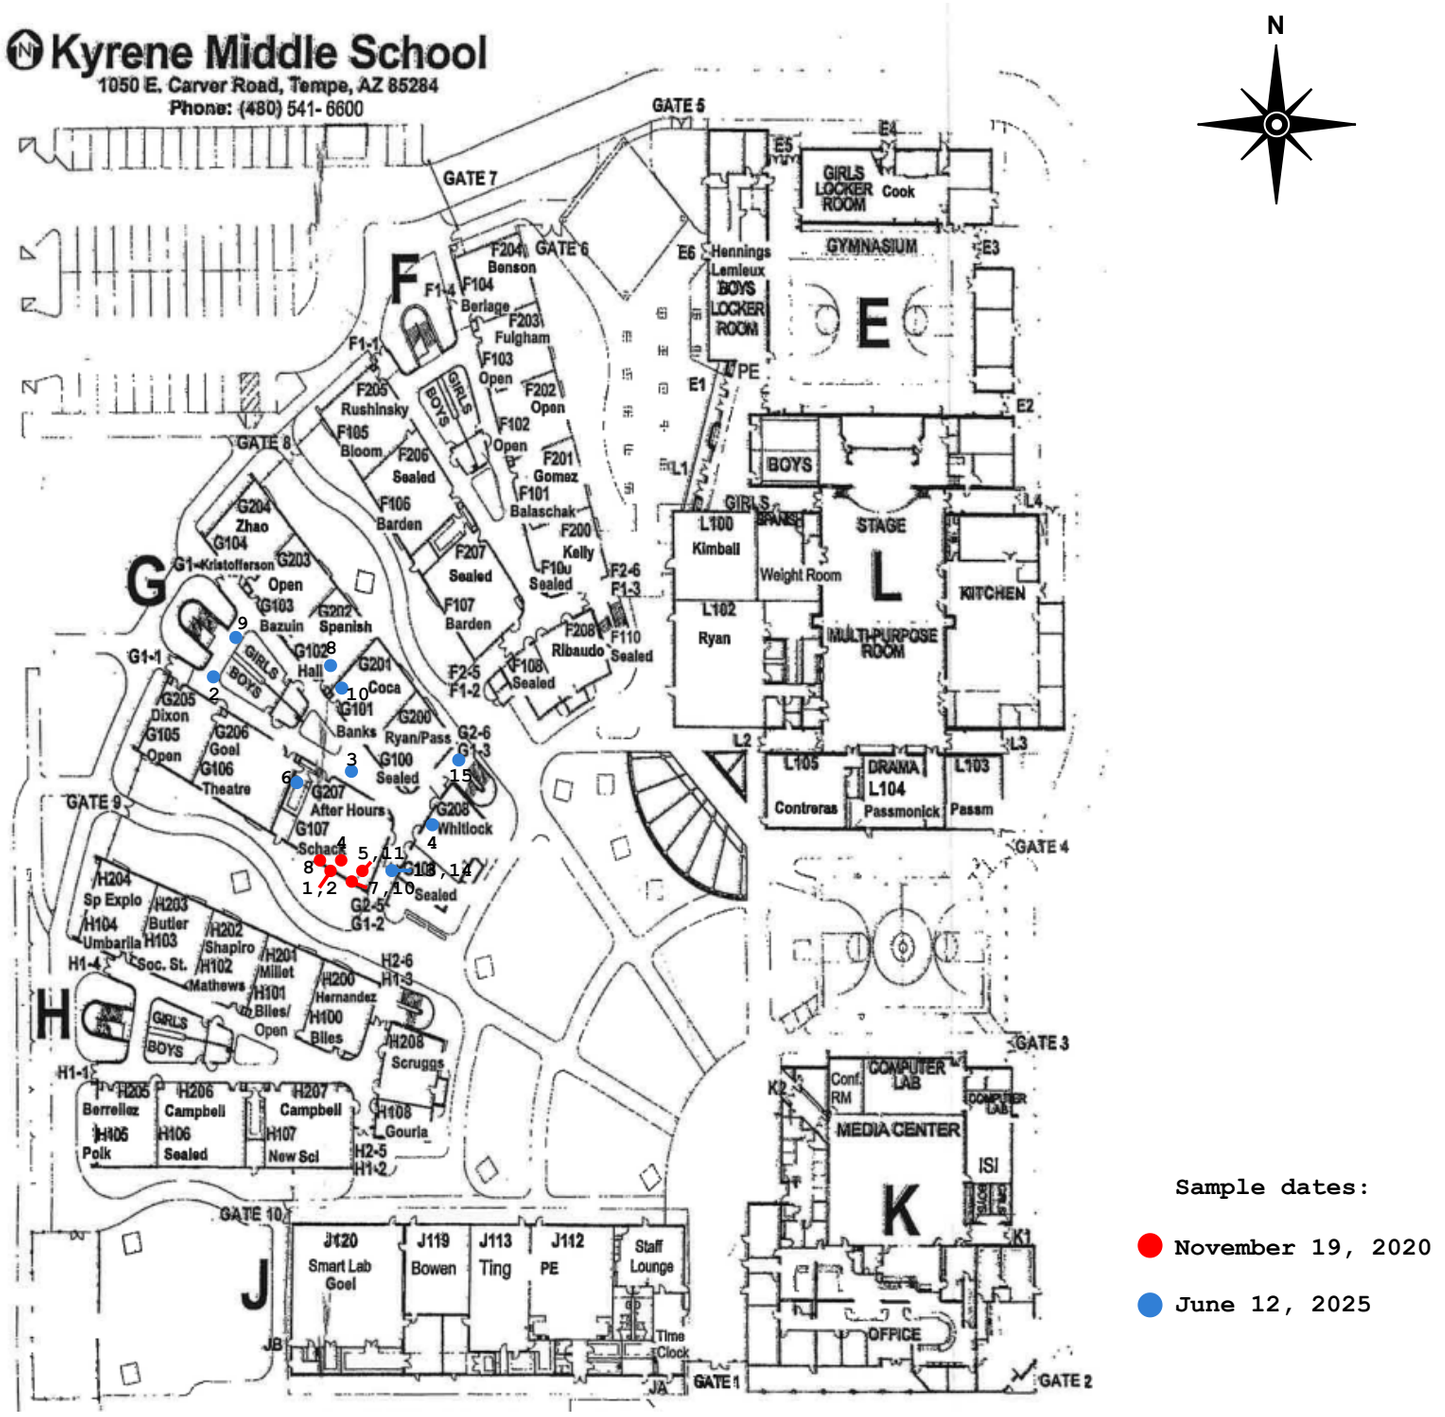

PLM Bulk Sample Location Map (1)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ0959.2635/AZ1418.57
Building G - First Floor

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

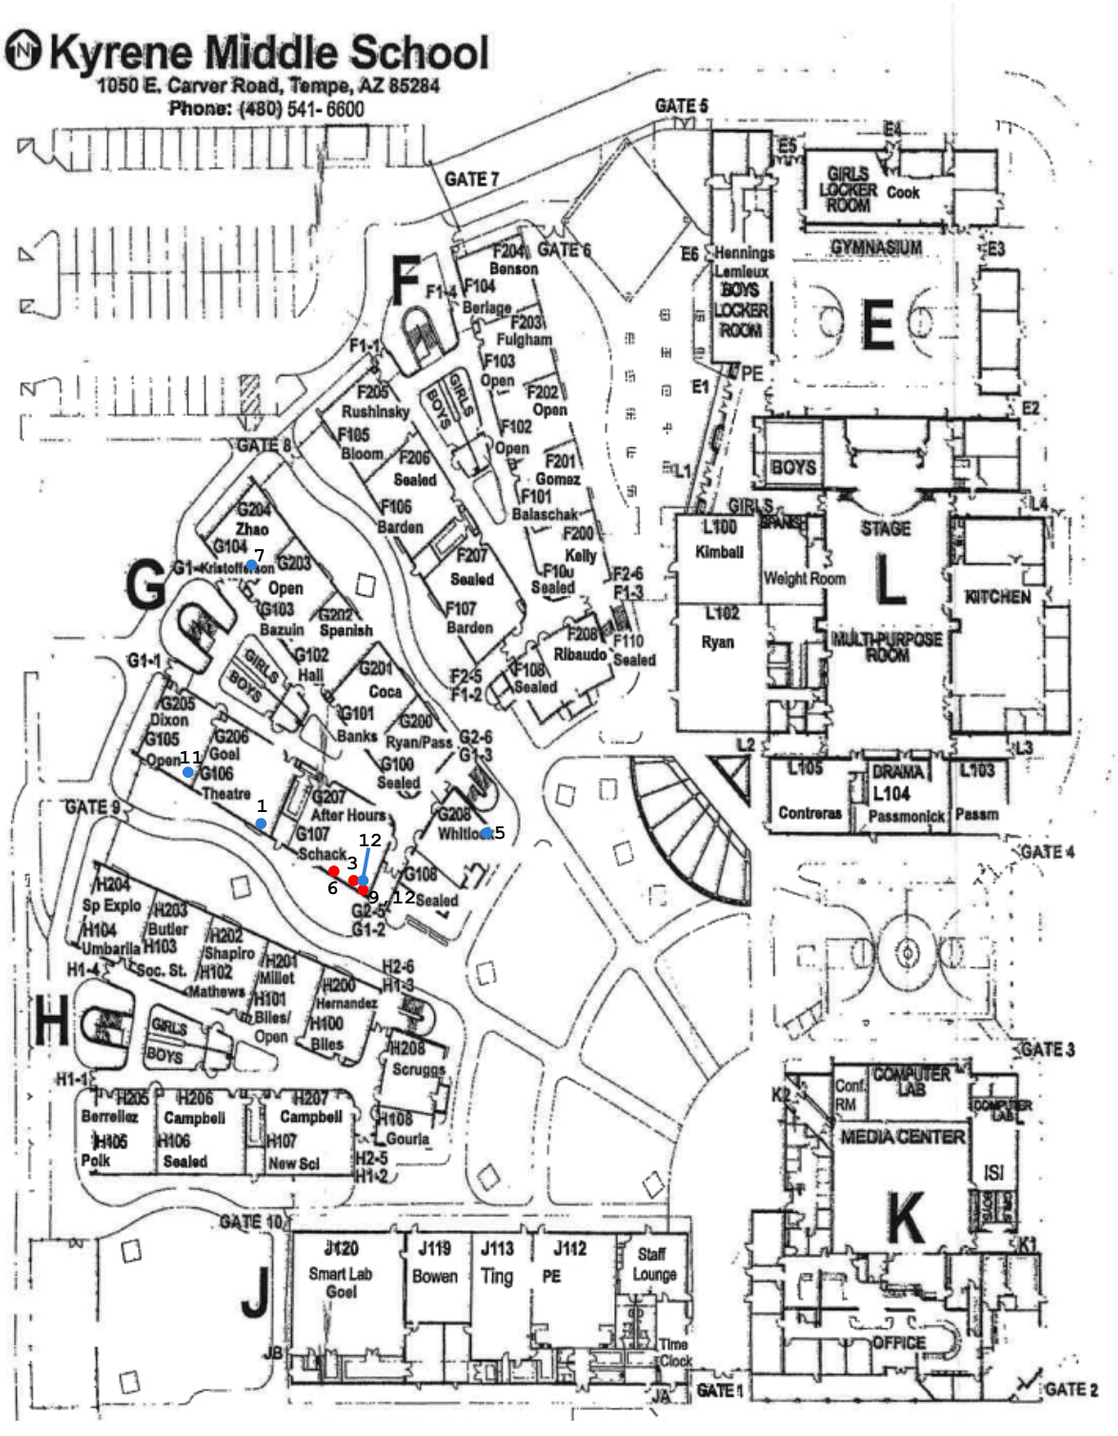


PLM Bulk Sample Location Map (2)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ0959.2635/AZ1418.57

Building G - Second Floor

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

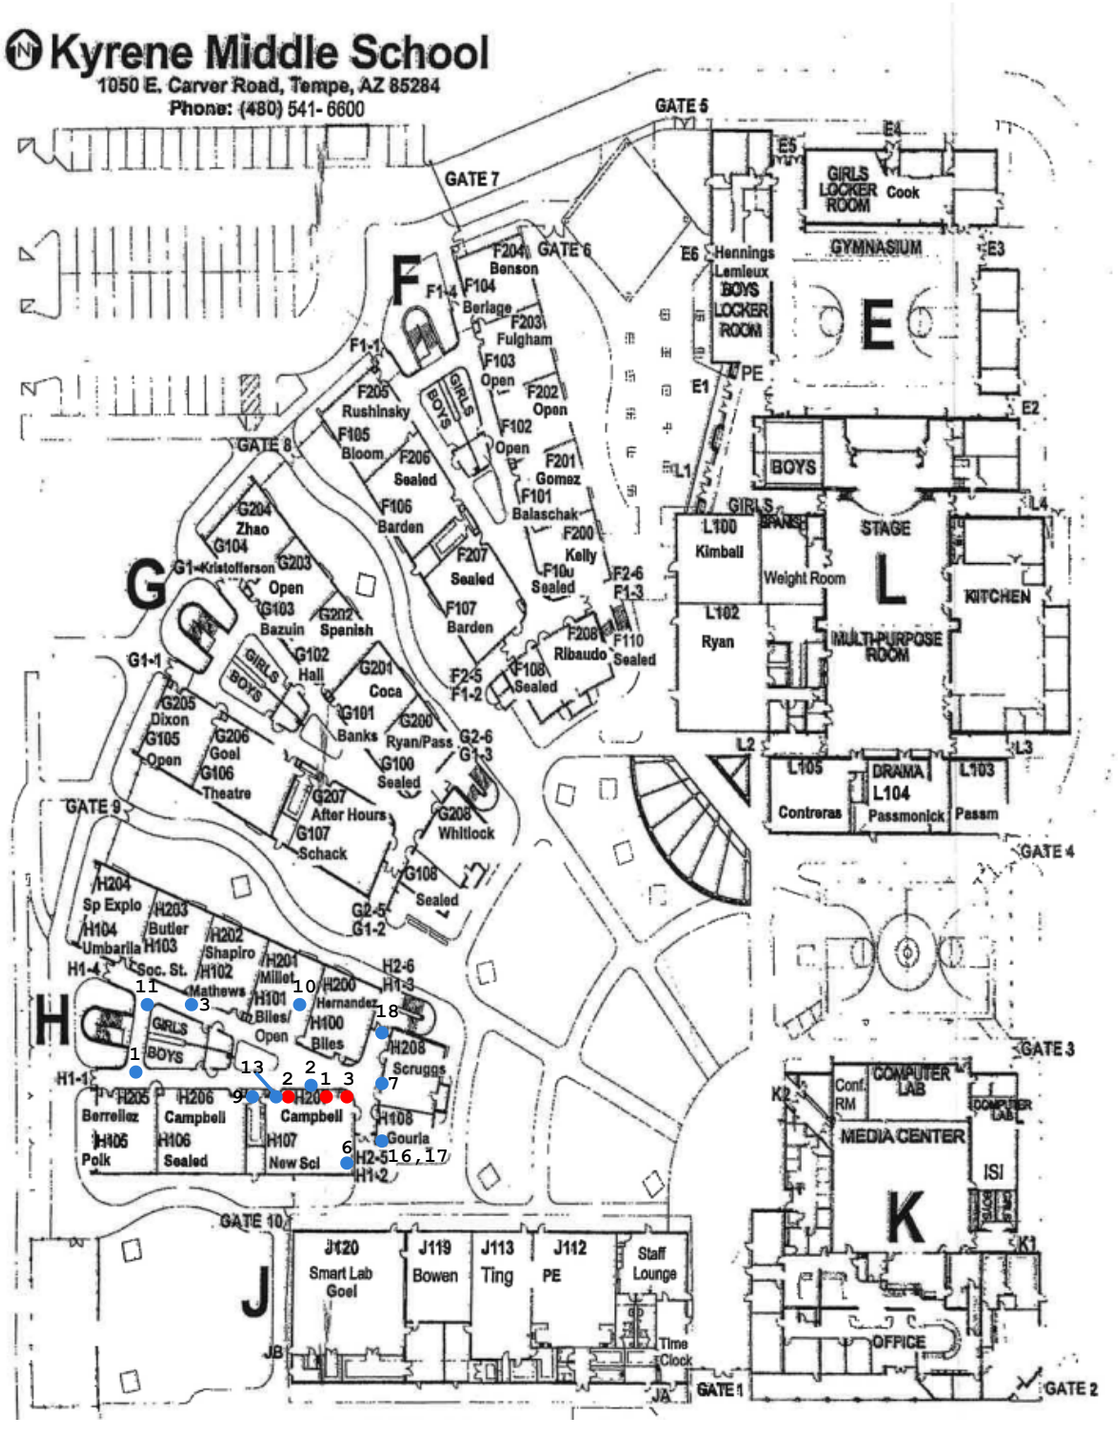


PLM Bulk Sample Location Map (1)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.11/AZ1418.57

Building H - First Floor


Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

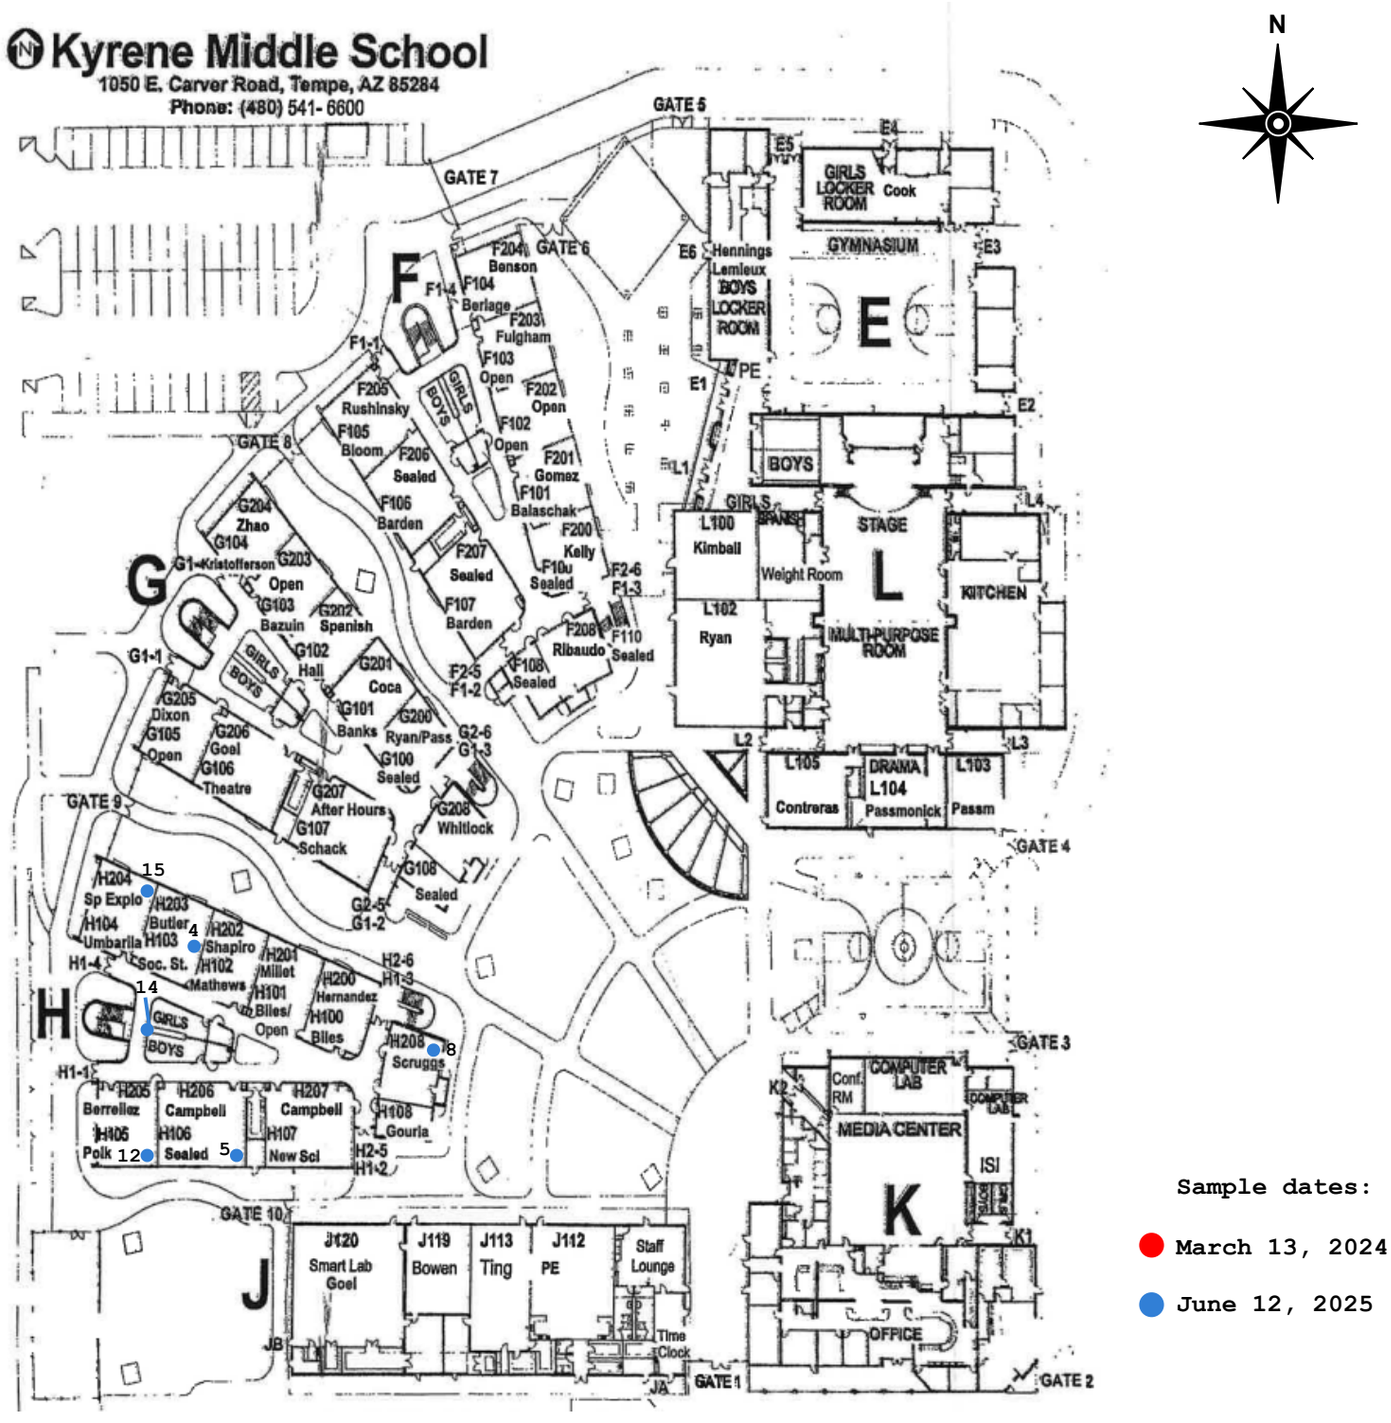

PLM Bulk Sample Location Map (2)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.11/AZ1418.57
Building H - Second Floor

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

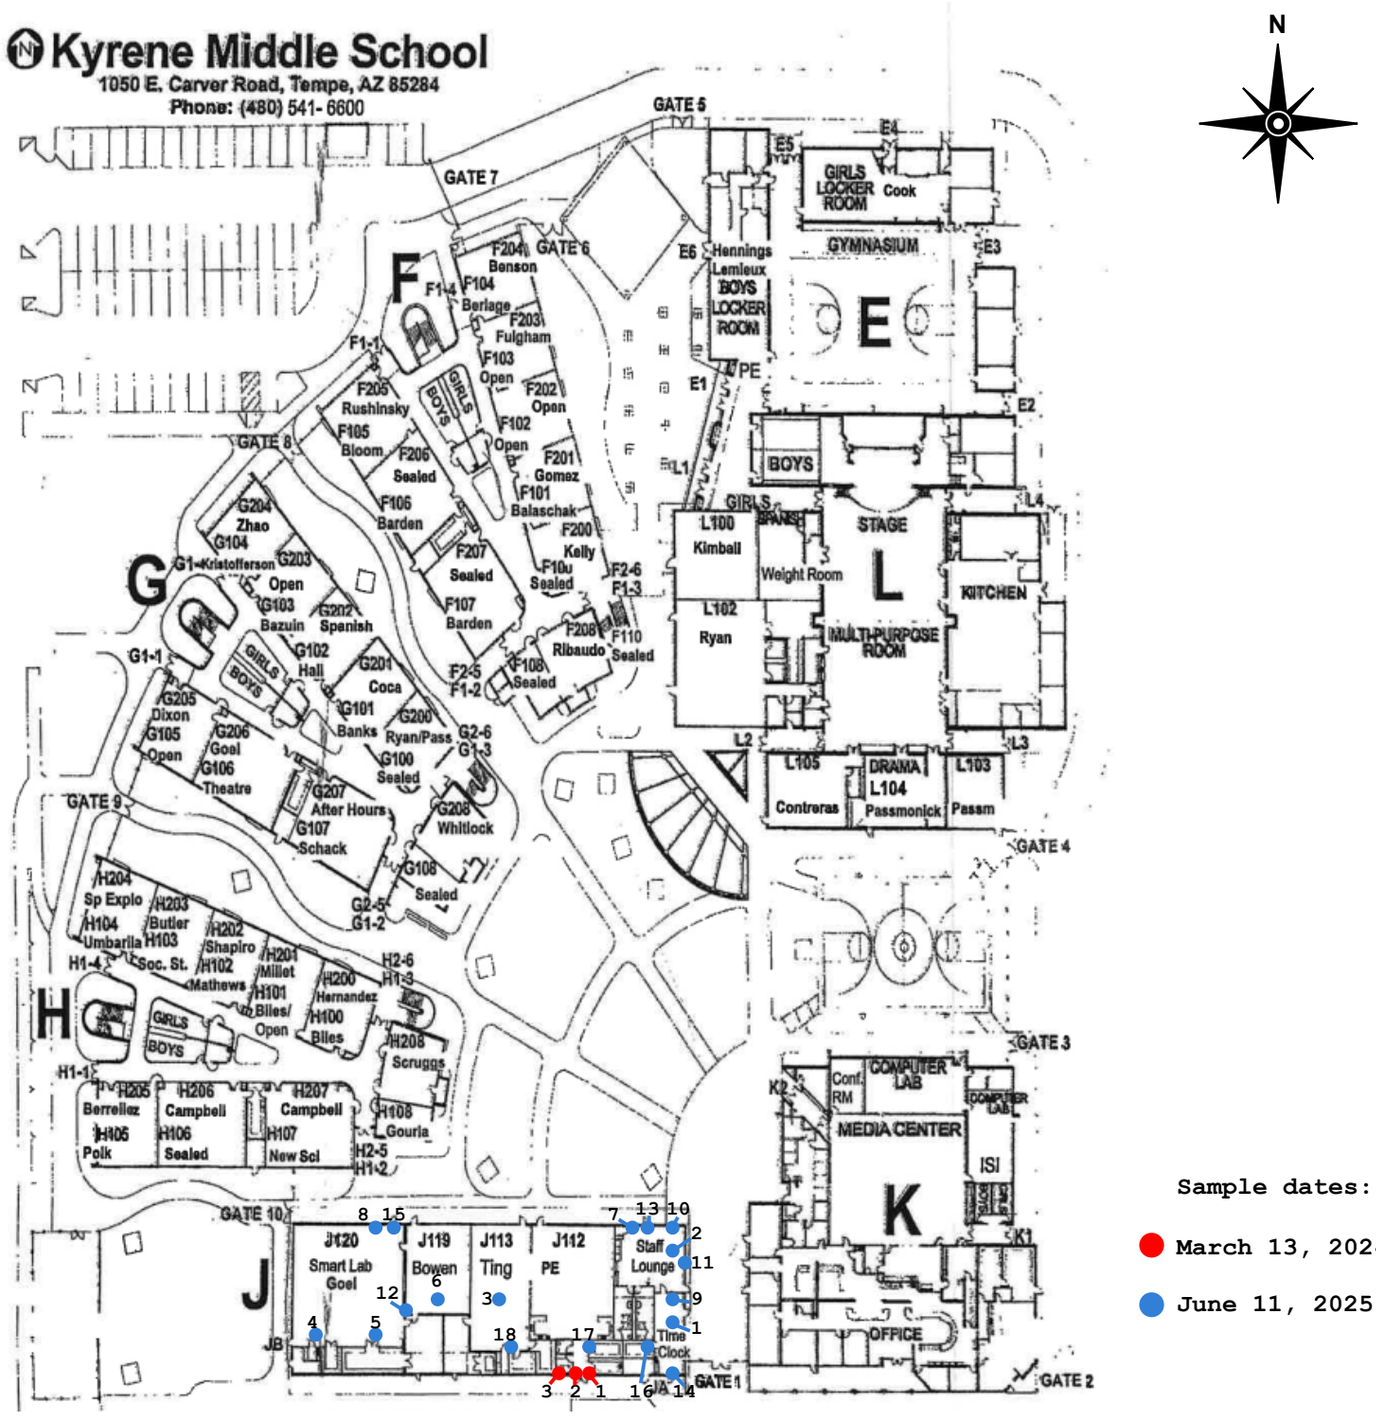


PLM Bulk Sample Location Map
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.11/AZ1418.57

Building J

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

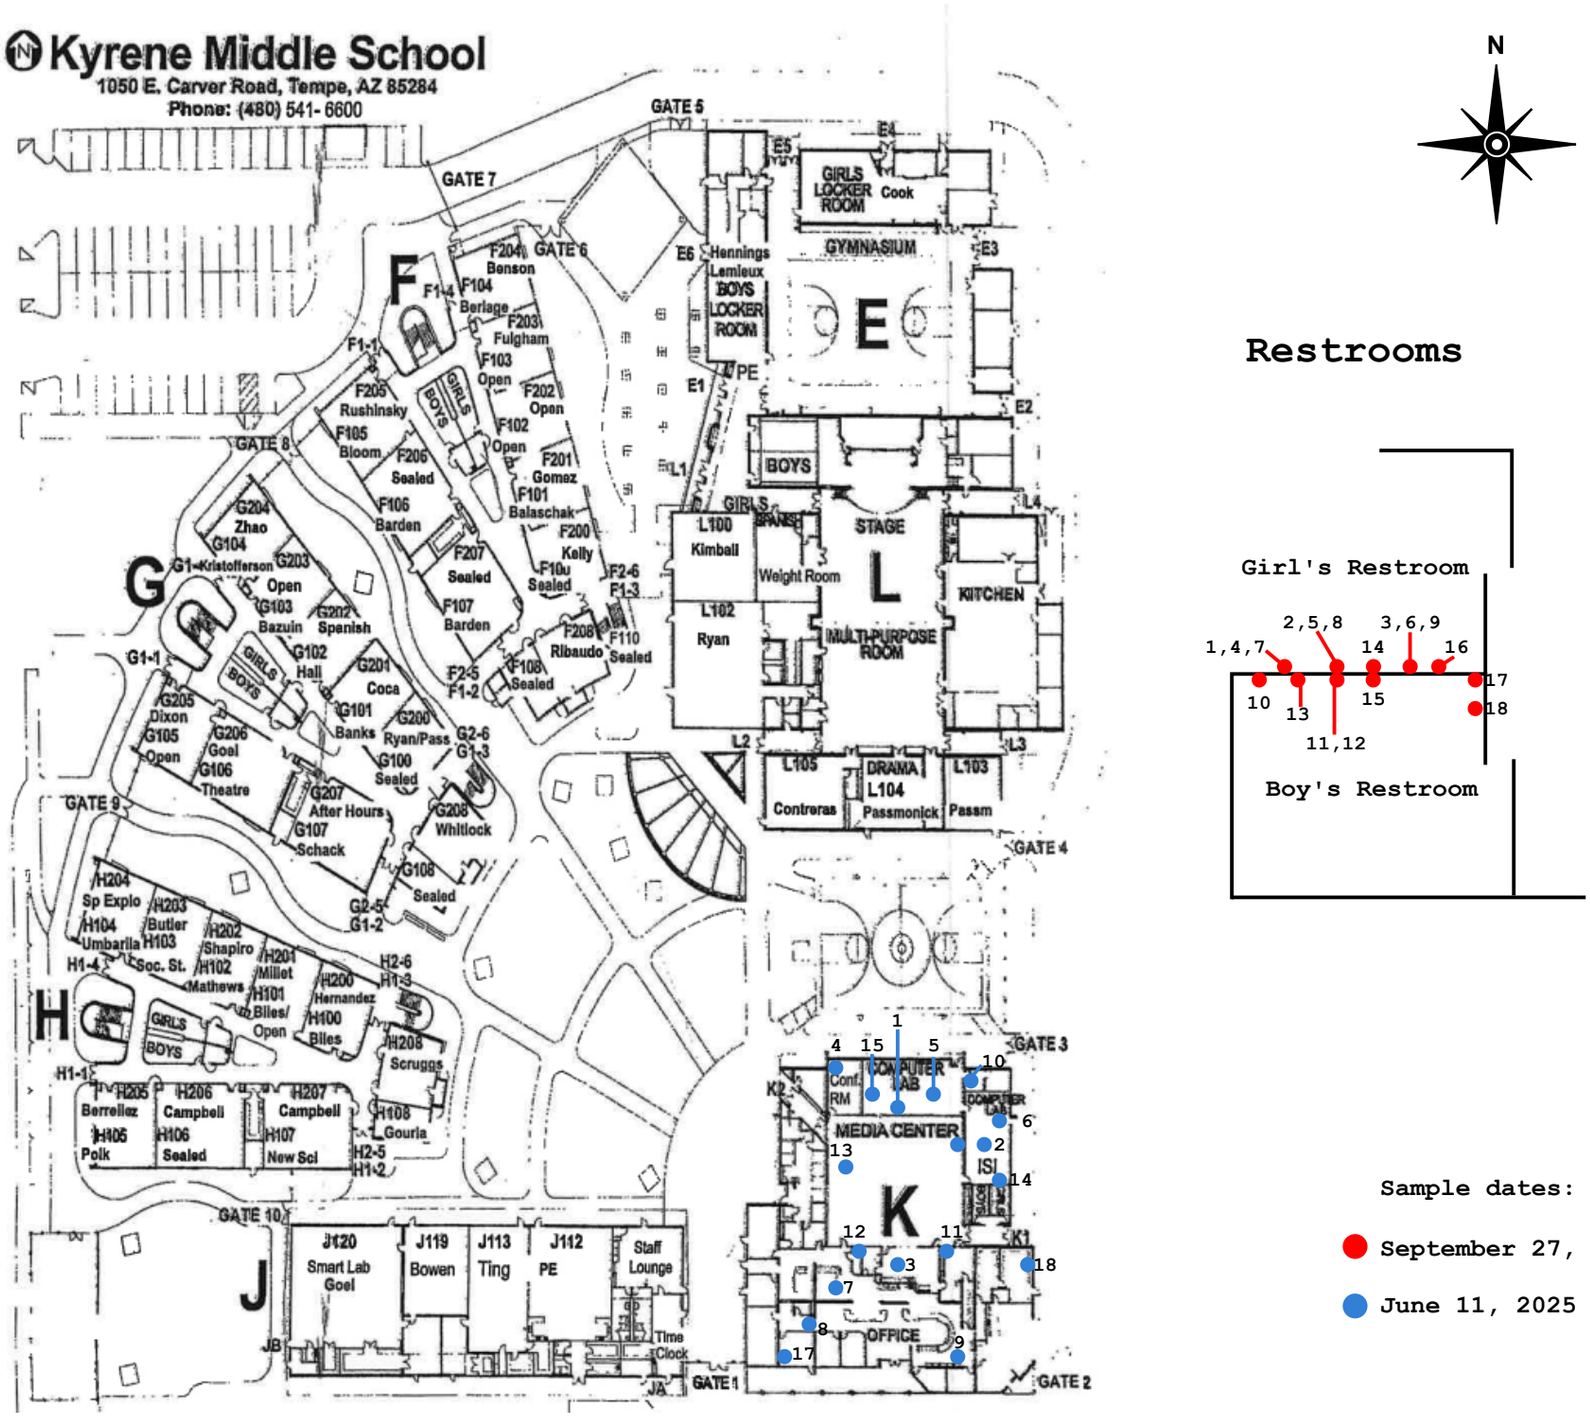

N

Restrooms

Sample dates:

- September 27, 2022
- June 11, 2025

PLM Bulk Sample Location Map
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ0959.3201/AZ1418.57

Building K

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

SECTION 8

♦

PHYSICAL ASSESSMENT INFORMATION SHEETS

BUILDING MATERIAL PHYSICAL ASSESSMENT INFORMATION SHEET

Project #: AZ1418.57 **Client:** Kyrene Elementary School District **Site:** Kyrene Middle School **Bldg #:** F

(HM) Material #: 48 **Quantity of Material:** 1,000 sq. ft. **Material in Air Plenum?** Yes **No**

Material Description: Insulation for White Pipe Wrap **Material Location(s):** Above Ceiling

Material Type: TSI Surfacing
Miscellaneous (Circle One)

Physical Assessment Categories

G	1) Damaged or significantly damaged TSI ACBM	G	5) ACBM with potential for damage
G	2) Damaged friable surfacing ACBM	G	6) ACBM with potential for significant damage
G	3) Significantly damaged friable surfacing ACBM	■	7) Any remaining friable ACBM or friable suspect ACBM
G	4) Damaged or significantly damaged friable misc. ACBM		

Material Condition

Damage Type: G Physical G Water G Air Erosion G Other
G Vandalism G Vibration ■ None

Damage Extent: ■ Low <1% evenly; 10% locally G Moderate <10% evenly; 10% - 25% locally G High >10% evenly; >25% locally

Description of Damage: None, Assumed ACBM

Exposure Factors

Accessibility:	■	Low	**Occupancy:**	■	Low	**Potential for Contact:**	■	Low	**Potential for Vibration:**	■	Low	**Potential for Air Erosion:**	■	Low
	G	Moderate		G	Moderate		G	Moderate		G	Moderate		G	Moderate
	G	High		G	High		G	High		G	High		G	High

Preventative Measures: Low Potential for Disturbance

Hazard Classification/Assessment Categories

■	1) Good condition with low potential for disturbance damage	G	5) Damaged condition with potential for disturbance damage
G	2) Good condition with potential for disturbance damage	G	6) Damaged condition with potential for significant disturbance damage
G	3) Good condition with potential for significant disturbance damage	G	7) Significant damage with potential for any disturbance
G	4) Damaged condition with low potential for disturbance damage		

Inspector: Nick Marcos
Certificate #: ON-188748-8873-031325 **State:** Arizona
Signature: Nick Marcos **Exp Date:** March 13, 2026

Management Planner: Tracey Carpenter
Certificate #: ON-4651-14588-070625 **State:** Arizona
Signature: Tracey Carpenter **Exp Date:** July 6, 2026

SECTION 9

♦

LABORATORY REPORTS

EMLab P&K
A TestAmerica Company

Report for:

Mrs. Krista Wahnefried
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Project: 1418.04; Kyrene Middle
EML ID: 1740200

Approved by:

Approved Signatory
Renee Luna

Dates of Analysis:
Asbestos PLM: 06-10-2017

Service SOPs: Asbestos PLM (EPA Methods 600/R-93/116 & 600/M4-82-020, SOP EM-AS-S-1267)

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the items tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

EMLab P&K ("the Company") shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

EMLab P&K
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 Fax (623) 780-7695 www.emlab.com

Client: Dominion Environmental Consultants, Inc.
C/O: Mrs. Krista Wahnefried
Re: 1418.04; Kyrene Middle

Date of Sampling: 06-08-2017
Date of Receipt: 06-08-2017
Date of Report: 06-12-2017

ASBESTOS PLM REPORT: EPA-600/M4-82-020 & EPA METHOD 600/R-93-116

Total Samples Submitted:	12
Total Samples Analyzed:	12
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM1, Blue Cove Base & Mastic

Lab ID-Version‡: 8122490-1

Sample Layers	Asbestos Content
Blue Baseboard	ND
White Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM2, Blue Cove Base & Mastic

Lab ID-Version‡: 8122491-1

Sample Layers	Asbestos Content
Blue Baseboard	ND
White Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM3, Blue Cove Base & Mastic

Lab ID-Version‡: 8122492-1

Sample Layers	Asbestos Content
Blue Baseboard	ND
White Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM4, Orange Pell Drywall (Paint,Texture,Tape,Joint Compound,& Drywall)

Lab ID-Version‡: 8122493-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. EMLab P&K reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

EMLab P&K
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 Fax (623) 780-7695 www.emlab.com

Client: Dominion Environmental Consultants, Inc.
C/O: Mrs. Krista Wahnefried
Re: 1418.04; Kyrene Middle

Date of Sampling: 06-08-2017
Date of Receipt: 06-08-2017
Date of Report: 06-12-2017

ASBESTOS PLM REPORT: EPA-600/M4-82-020 & EPA METHOD 600/R-93-116

Location: PLM5, Orange Pell Drywall (Paint,Texture,Tape,Joint Compound,& Drywall)

Lab ID-Version‡: 8122494-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM6, Orange Pell Drywall (Paint,Texture,Tape,Joint Compound,& Drywall)

Lab ID-Version‡: 8122495-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM7, FRP & Mastic

Lab ID-Version‡: 8122496-1

Sample Layers	Asbestos Content
White Fiberglass Reinforced Plastic	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	25% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM8, FRP & Mastic

Lab ID-Version‡: 8122497-1

Sample Layers	Asbestos Content
White Fiberglass Reinforced Plastic	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	25% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. EMLab P&K reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

EMLab P&K
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 Fax (623) 780-7695 www.emlab.com

Client: Dominion Environmental Consultants, Inc.
C/O: Mrs. Krista Wahnefried
Re: 1418.04; Kyrene Middle

Date of Sampling: 06-08-2017
Date of Receipt: 06-08-2017
Date of Report: 06-12-2017

ASBESTOS PLM REPORT: EPA-600/M4-82-020 & EPA METHOD 600/R-93-116

Location: PLM9, FRP & Mastic Lab ID-Version‡: 8122498-1

Sample Layers	Asbestos Content
White Fiberglass Reinforced Plastic	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	25% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM10, White 4"x4" Cermaic Wall Tile,Grout, & Mastic Lab ID-Version‡: 8122499-1

Sample Layers	Asbestos Content
White Ceramic Tile	ND
Off-White Grout	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM11, White 4"x4" Cermaic Wall Tile,Grout, & Mastic Lab ID-Version‡: 8122500-1

Sample Layers	Asbestos Content
White Ceramic Tile	ND
Off-White Grout	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM12, White 4"x4" Cermaic Wall Tile,Grout, & Mastic Lab ID-Version‡: 8122501-1

Sample Layers	Asbestos Content
White Ceramic Tile	ND
Off-White Grout	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. EMLab P&K reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

EMLab P&K
1501 West Knudsen Drive
Phoenix, AZ 85027
www.EMLabPK.com
Phone: 800-651-4802

001740200

Chain of Custody

Page: 1 of 1

Client Name: Dominion Environmental Consultants
Client Address: 20045 North 19th Avenue, Building 7, Phoenix, Arizona 85027
Send Report to: Kristie Wahlquist

Phone Number: (623) 516-1415
Fax Number: (623) 516-0017
Project Number: 1418.04
Project Name: Kyrene Middle
P.O. Number: 205960

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Total # Samples Submitted: 12 **Asbestos Analysis:** **PCM** Airborne Fiber Count (NIOSH 7400) ☐ **PLM** (EPA method 600/R-93-116) ☒

Turn Around Time Codes - (TAT) Standard - 2 Day (Default) ☒ Next Business Day ☐ Same Business Day Rush ☐ Weekend/Holiday ☐

Sample Number:	Sample Location/Description:	Sample Date:	Start/Stop Time:	Sample Volume (L)
PLM 1	Blue Cove Base + Mastic	6/8/17		
2	↓	↓		
3	↓			
4	Orange Peel Drywall (Paint, Texture, Tape, Joint Compound, Drywall)			
5	↓			
6	↓			
7	FRP + mastic			
8	↓			
9	↓			
10	White 4"x4" Ceramic wall tile, grout, + mastic			
11	↓			
12	↓	↓		

Custody Information:

Samples Relinquished: Kristie Wahlquist 6/8/17 13:20
Signature/Date/Time

Samples Received:
Signature/Date/Time

Samples Relinquished:
Signature/Date/Time

Samples Received:
Signature/Date/Time

eurofins | Built Environment Testing

Report for:

Tracey Carpenter
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, Inc.
Project: AZ1418.11; Kyrene Middle School - Bldg E
EML ID: 3573087

Approved by:

Renee Luna-Trepczynski

Approved Signatory
Renee Luna-Trepczynski

Dates of Analysis:
Asbestos PLM: 03-18-2024

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, Inc. ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, Inc.
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Tracey Carpenter
Re: AZ1418.11; Kyrene Middle School - Bldg E

Date of Sampling: 03-13-2024
Date of Receipt: 03-14-2024
Date of Report: 03-18-2024

ASBESTOS PLM REPORT

Total Samples Submitted:	12
Total Samples Analyzed:	12
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM-1, 2''x2'' White RR Floor Tiles & Grout & Thinset Lab ID-Version‡: 17464684-1

Sample Layers	Asbestos Content
White Ceramic Tile	ND
Off-White Grout	ND
Gray Thinset	ND
Sample Composite Homogeneity:	Poor

Location: PLM-2, 2''x2'' White RR Floor Tiles & Grout & Thinset Lab ID-Version‡: 17464685-1

Sample Layers	Asbestos Content
White Ceramic Tile	ND
Off-White Grout	ND
Gray Thinset	ND
Sample Composite Homogeneity:	Poor

Location: PLM-3, 2''x2'' White RR Floor Tiles & Grout & Thinset Lab ID-Version‡: 17464686-1

Sample Layers	Asbestos Content
White Ceramic Tile	ND
Off-White Grout	ND
Gray Thinset	ND
Sample Composite Homogeneity:	Poor

Location: PLM-4, L-Shape Black Cove Base & Mastic Lab ID-Version‡: 17464687-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Beige Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, Inc.
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Tracey Carpenter
Re: AZ1418.11; Kyrene Middle School - Bldg E

Date of Sampling: 03-13-2024
Date of Receipt: 03-14-2024
Date of Report: 03-18-2024

ASBESTOS PLM REPORT

Location: PLM-5, L-Shape Black Cove Base & Mastic Lab ID-Version‡: 17464688-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Beige Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-6, L-Shape Black Cove Base & Mastic Lab ID-Version‡: 17464689-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Beige Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-7, Dark Teal Bench/Tiles & Grout & Thinset Lab ID-Version‡: 17464690-1

Sample Layers	Asbestos Content
Green Ceramic Tile	ND
Blue-Green Grout	ND
Gray Thinset	ND
Sample Composite Homogeneity:	Poor

Location: PLM-8, Dark Teal Bench/Tiles & Grout & Thinset Lab ID-Version‡: 17464691-1

Sample Layers	Asbestos Content
Green Ceramic Tile	ND
Blue-Green Grout	ND
Gray Thinset	ND
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, Inc.
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Tracey Carpenter
Re: AZ1418.11; Kyrene Middle School - Bldg E

Date of Sampling: 03-13-2024
Date of Receipt: 03-14-2024
Date of Report: 03-18-2024

ASBESTOS PLM REPORT

Location: PLM-9, Dark Teal Bench/Tiles & Grout & Thinset Lab ID-Version‡: 17464692-1

Sample Layers	Asbestos Content
Green Ceramic Tile	ND
Blue-Green Grout	ND
Gray Thinset	ND
Sample Composite Homogeneity:	Poor

Location: PLM-10, Light Teal Bench Tiles & Grout & Thinset Lab ID-Version‡: 17464693-1

Sample Layers	Asbestos Content
Green Ceramic Tile	ND
Blue-Green Grout	ND
Gray Thinset	ND
Sample Composite Homogeneity:	Poor

Location: PLM-11, Light Teal Bench Tiles & Grout & Thinset Lab ID-Version‡: 17464694-1

Sample Layers	Asbestos Content
Green Ceramic Tile	ND
Blue-Green Grout	ND
Gray Thinset	ND
Sample Composite Homogeneity:	Poor

Location: PLM-12, Light Teal Bench Tiles & Grout & Thinset Lab ID-Version‡: 17464695-1

Sample Layers	Asbestos Content
Green Ceramic Tile	ND
Blue-Green Grout	ND
Gray Thinset	ND
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY eurofins | EMLab P&K

www.EMLabPK.com

Marlton, NJ: 3000 Lincoln Dr E, Ste. A, Marlton, NJ 08053 (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 * (800) 651-4802
SSF, CA: 6000 Shoreline Ct, Ste. 205, S. San Francisco, CA 94080 * (866) 888-6653

WEATHER	Fog	Rain	Snow	Wind	Clear
LEVEL None					
Light					
Moderate					
Heavy					

REQ

003573087

CONTACT INFORMATION			
Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave, Bldg 7, Phoenix, AZ 85027	
Contact:	Tracey Carpenter	Special Instructions: email results: tcarpenter@dominion-env.com	
Phone:	(602) 989-9992		

PROJECT INFORMATION				TURN AROUND TIME CODES - (TAT)	
Project ID:	AZ 1418.11			STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene Middle School - Bldg E			ND - Next Business Day	
Project Zip Code:	85284	Sampling Date/Time:	3/13/24 @4pm	SD - Same Business Day	
PO Number:	316031	Sampled By:	TLC	WH - Weekend/Holiday/ASAP	

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	2"x2" White RR Floor Tiles + Grout + Thinset	B / 1	STD / 1		
PLM 4-6	L-Shape Black Cove Base + Mastic	B / 1	STD / 1		
PLM 7-9	Dark Teal ~~Wall~~ Bench Tiles + Grout + Thinset	B / 1	STD / 1		
PLM 10-12	Light Teal Bench Tiles + Grout + Thinset	B / 1	STD / 1		

Non-Culturable

Spore Trap		Tape, Swab, Bulk			BioCas Swab,													
Spore Trap Analysis	Other biological particles - supplement	Direct Microscopic Exam (Qualitative)	Quantitative spore count direct exam	Dust Characterization	1-Media Surface Fungi (Genus ID + *Asp.* spp.)	Culturable Air Fungi (Genus ID + *Asp.* spp.)	Gram Stain and Counts (Culturable Air and Surface Bacteria)	*Legionella* culture	Total Coliform, *E.coli* (Presence/Absence)	QuantiTray-Sewage Screen	OTHER: (please specify test)		Asbestos in Air - PCM Airborne Fiber Count (NIOSH 7400)	Asbestos Bulk - PLM (EPA method 600/R-93-116)	Lead (Pb)	PCR (please specify test)	Allergens (please specify test)	
														X				
														X				
													X					
													X					

SAMPLE TYPE CODES			
BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	
SAS - Surface Air Sampler	B - Bulk	SO - Soil	
NP - Non-potable Water	P - Potable Water	D - Dust	

RELINQUISHED BY	DATE & TIME	RECEIVED BY	DATE & TIME
Tracey Carp	3/14/24 @ 8:30 AM		3-14-24

eurofins | Built Environment Testing

Report for:

Nick Marcos
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.57; Kyrene Middle School - Bldg. E/L
EML ID: 4112400

Approved by:



Approved Signatory
Renee Luna-Trepczynski

Dates of Analysis:
Asbestos PLM: 06-18-2025

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. E/L

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Total Samples Submitted:	18
Total Samples Analyzed:	18
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM-1, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20525339-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Transparent Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers 2% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM-2, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20525340-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Transparent Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers 2% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM-3, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20525341-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Transparent Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers 2% Glass Fibers
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. E/L

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM-4, Black Carpet Square and Mastic

Lab ID-Version‡: 20525342-1

Sample Layers	Asbestos Content
Black Carpet	ND
Transparent Mastic	ND
Composite Non-Asbestos Content:	65% Synthetic Fibers 2% Glass Fibers
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. E/L

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM-5, Black Carpet Square and Mastic Lab ID-Version‡: 20525343-1

Sample Layers	Asbestos Content
Black Carpet	ND
Transparent Mastic	ND
Composite Non-Asbestos Content:	65% Synthetic Fibers 2% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM-6, Black Carpet Square and Mastic Lab ID-Version‡: 20525344-1

Sample Layers	Asbestos Content
Black Carpet	ND
Transparent Mastic	ND
Composite Non-Asbestos Content:	65% Synthetic Fibers 2% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM-7, Blue Cove Base and Mastic Lab ID-Version‡: 20525345-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-8, Blue Cove Base and Mastic Lab ID-Version‡: 20525346-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. E/L

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM-9, Blue Cove Base and Mastic Lab ID-Version‡: 20525347-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-10, 2' X 2' Ceiling Tile Lab ID-Version‡: 20525348-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 20% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-11, 2' X 2' Ceiling Tile Lab ID-Version‡: 20525349-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 20% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-12, 2' X 2' Ceiling Tile Lab ID-Version‡: 20525350-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 20% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. E/L

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM-13, 2' X 4' Ceiling Tile Lab ID-Version‡: 20525351-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 20% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-14, 2' X 4' Ceiling Tile Lab ID-Version‡: 20525352-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 20% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-15, 2' X 4' Ceiling Tile Lab ID-Version‡: 20525353-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 20% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-16, Orange Peel D.W. (paint,tex,tape,j.c,d.w.) Lab ID-Version‡: 20525354-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. E/L

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM-17, Orange Peel D.W. (paint,tex,tape,j.c,d.w.) Lab ID-Version‡: 20525355-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-18, Orange Peel D.W. (paint,tex,tape,j.c,d.w.) Lab ID-Version‡: 20525356-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built


Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. E/L

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

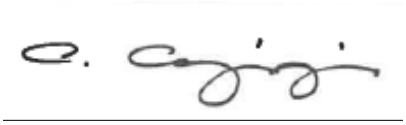

Analyst: Aaron Agajanian

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY

www.eurofinsus.com/Built

eurofins | Built Environment Testing

East:(866) 871-1984
West/Central:(800) 651-4802

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address:20045 N. 19th Ave., Phx, AZ 85027
Contact:	Nick Marcos	Special Instructions:
Phone:	623-516-1415	

PROJECT INFORMATION

Project ID:	AZ1418.57		
Project Description:	Kyrene Middle School - Bldg. E/L		
Project Zip Code:		Sampling Date/Time:	6/16/2025
PO Number:	13746	Sampled By:	NM

TURN AROUND TIME CODES - (TAT)

STD - Standard (Default)
ND - Next Business Day
SD - Same Business Day
WH - Weekend/Holiday/ASAP

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	Gray Multi-Color Carpet Square and Mastic	B	STD		
PLM 4-6	Black Carpet Square and Mastic	B	STD		
PLM 7-9	Blue Cove Base and Mastic	B	STD		
PLM 10-12	2' X 2' Ceiling Tile	B	STD		
PLM 13-15	2' X 4' Ceiling Tile	B	STD		
PLM 16-18	Orange Peel D.W. (paint,tex,tape,j.c.,d.w.)	B	STD		

REQUESTED SERVICES

Non-Culturable

Spore Trap Analysis
Other biological particles - supplement
Direct Microscopic Exam (Qualitative)
Quatitative spore count direct exam
Dust Characterization

Culturable

1-Media Surface Fungi (Genus ID + *Asp.* spp.)
Culturable Air Fungi (Genus ID + *Asp.* spp.)
Gram Stain and Counts (Culturable Air and Surf
Legionella culture
Total Coliform, *E coli* (Presence/Absence)
QuantiTray-Sewage Screen
OTHER: (please specify test)

Other Requests

	Asbestos in Air - PCM Airborne Fiber Count (NIOSH 7400)	Asbestos Bulk - PLM (EPA method 600/R-93-116)	Lead (Pb) / Paint Chip	PCR (please specify test)	Allergens (please specify test)
PLM 1-3		X			
PLM 4-6		X			
PLM 7-9		X			
PLM 10-12		X			
PLM 13-15		X			
PLM 16-18		X			

004112400

SAMPLE TYPE CODES

BC - BioCassette™	**CP** - Contact Plate	**T** - Tape	**O** - Other:
A1S - Andersen	**ST** - Spore Trap	**SW** - Swab	
SAS - Surface Air Sampler	**B** - Bulk	**SO** - Soil	
NP - Non-potable Water	**P** - Potable Water	**D** - Dust	

RELINQUISHED BY	DATE & TIME
Nick Marcos	6/16/2025

RECEIVED BY	DATE & TIME
Patty Lopp	6/16/25 4:44 pm

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at http://www.emlab.com/s/main/serviceterms.html

EMLab P&K
A TestAmerica Company

Report for:

Mr. Xin Lou
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Project: AZ0959.2056; Kyrene Middle School
EML ID: 2091519

Approved by:

Renee Luna-Trepczynski

Approved Signatory
Renee Luna-Trepczynski

Dates of Analysis:
Asbestos PLM: 02-07-2019

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the items tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

EMLab P&K ("the Company") shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

EMLab P&K
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 Fax (623) 780-7695 www.emlab.com

Client: Dominion Environmental Consultants, Inc.
C/O: Mr. Xin Lou
Re: AZ0959.2056; Kyrene Middle School

Date of Sampling: 02-06-2019
Date of Receipt: 02-06-2019
Date of Report: 02-07-2019

ASBESTOS PLM REPORT

Total Samples Submitted:	9
Total Samples Analyzed:	9
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM-1, Cabinet Caulking-Paint Lab ID-Version‡: 9888074-1

Sample Layers	Asbestos Content
Green Paint	ND
White Caulk	ND
Sample Composite Homogeneity:	Good

Location: PLM-2, Cabinet Caulking-Paint Lab ID-Version‡: 9888075-1

Sample Layers	Asbestos Content
Green Paint	ND
White Caulk	ND
Sample Composite Homogeneity:	Good

Location: PLM-3, Cabinet Caulking-Paint Lab ID-Version‡: 9888076-1

Sample Layers	Asbestos Content
Green Paint	ND
White Caulk	ND
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. EMLab P&K reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

EMLab P&K
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 Fax (623) 780-7695 www.emlab.com

Client: Dominion Environmental Consultants, Inc.
C/O: Mr. Xin Lou
Re: AZ0959.2056; Kyrene Middle School

Date of Sampling: 02-06-2019
Date of Receipt: 02-06-2019
Date of Report: 02-07-2019

ASBESTOS PLM REPORT

Location: PLM-4, Blue Cove Base, Mastic Lab ID-Version‡: 9888077-1

Sample Layers	Asbestos Content
Blue Baseboard	ND
White Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-5, Blue Cove Base, Mastic Lab ID-Version‡: 9888078-1

Sample Layers	Asbestos Content
Blue Baseboard	ND
White Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-6, Blue Cove Base, Mastic Lab ID-Version‡: 9888079-1

Sample Layers	Asbestos Content
Blue Baseboard	ND
White Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. EMLab P&K reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

EMLab P&K
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 Fax (623) 780-7695 www.emlab.com

Client: Dominion Environmental Consultants, Inc.
C/O: Mr. Xin Lou
Re: AZ0959.2056; Kyrene Middle School

Date of Sampling: 02-06-2019
Date of Receipt: 02-06-2019
Date of Report: 02-07-2019

ASBESTOS PLM REPORT

Location: PLM-7, Orange Peel Drywall System, (Paint, Texture, Tape, Joint Compound, Drywall)

Lab ID-Version‡: 9888080-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM-8, Orange Peel Drywall System, (Paint, Texture, Tape, Joint Compound, Drywall)

Lab ID-Version‡: 9888081-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM-9, Orange Peel Drywall System, (Paint, Texture, Tape, Joint Compound, Drywall)

Lab ID-Version‡: 9888082-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. EMLab P&K reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY — EMLab P

www.EMLabPK.com

Cherry Hill, NJ: 1936 Olney Avenue, Cherry Hill, NJ 08003 * **(866) 871-1984**
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 * **(800) 651-4802**
San Bruno, CA: 1150 Bayhill Drive, #100, San Bruno, CA 94066 * **(866) 888-66**

002091519

Snow	Wind	Clear

CONTACT INFORMATION

Company: Dominion Environmental Consultants Inc.
Address: 20045 N 19th Ave - Building 7, Phoenix, Arizona
Contact: Xin Lou
Special Instructions:
Phone: 602-810-8581

PROJECT INFORMATION

Project ID: AZ 0959.2056
Project Desc.: Kyrene Middle School
Project Zip Code:
Sampling Date & Time: 2/6/19
PO Number: 232690

TURNAROUND TIME (TAT)

STD - Standard (DEFAULT)
ND - Next Business Day
SD - Same Business Day Rush
WH - Weekend/Holiday

Sample ID	#	Description	Sample Type (Below)	TAT	Total Volume / Area (if applicable)	Notes / Special Requirements
PM-1	2	Cabinet Caulking, Paint	B	ND		
	3	↓	↓	↓		
	4	Blue Cove Base, Mastic				
	5	↓				
	6	↓				
	7	Orange Peel Drywall systems Paint				
	8	Texture, Tape, Joint Compound, Drywall				
↓	9	↓	↓	↓		

SAMPLE TYPE CODES

BC - BioCassette™	ST - Spore Trap: Zefon, Allergenco, Burkard...	T - Tape	D - Dust
AIS - Andersen		SW - Swab	SO - Soil
SAS - Surface Air Sampler	P - Potable Water	B - Bulk	
CP - Contact Plate	NP - Non-Potable Water	O - Other:	

RELINQUISHED BY	DATE & TIME
Xin Lou	2/6/19

RECEIVED BY	DATE & TIME
K Griffith 330	2/7/19

LABORATORY ANALYSIS REQUESTED (Check)

Non-Culturable		Culturable												Other Requests
Spore Trap	Tape Swab Bulk	BioCassette™ Andersen, SAS, Swab, Water, Bulk, Dust, Soil, Contact												
Fungi - Spore Trap Analysis	Spore Trap Analysis - Other particles	Direct Microscopic Exam (Qualitative)	Quantitative Spore Count Direct Exam	1-Media Surface Fungi (Genus ID + Asp. spp.)	2-Media Surface Fungi (Genus ID + Asp. spp.)	3-Media Surface Fungi (Genus ID + Asp. spp.)	Culturable Air Fungi (Genus ID + Asp. spp.)	Gram Stain and Counts (Culturable Air and Surface Bacteri	*Legionella* culture	Total Coliform, *E.coli* (Presence/Absence)	Membrane Filtration (Please specify organism)	MPN Bacteria (Please specify organism)	Quant Tray - Sewage Screen	Asbestos Analysis - PCM Airborne Fiber Count (NIOSH 74	Asbestos Analysis - PLM (EPA method 600/R-93-116)	PCR (please specify test)
															X	
															X	
															X	
															X	
															X	
															X	
															X	
															X	
															X	

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at www.emlabpk.com/terms.html
Copyright © 2002-2009 EMLab P&K

eurofins | Built Environment Testing

Report for:

Nick Marcos
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.57; Kyrene Middle School - Bldg. F
EML ID: 4112393

Approved by:



Approved Signatory
Renee Luna-Trepczynski

Dates of Analysis:
Asbestos PLM: 06-18-2025

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. F

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Total Samples Submitted:	18
Total Samples Analyzed:	18
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM-1, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20525420-1

Sample Layers	Asbestos Content
Gray Carpet	ND
Semi-Transparent Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-2, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20525421-1

Sample Layers	Asbestos Content
Gray Carpet	ND
Semi-Transparent Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-3, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20525422-1

Sample Layers	Asbestos Content
Gray Carpet	ND
Semi-Transparent Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-4, Black Carpet Square and Mastic Lab ID-Version‡: 20525423-1

Sample Layers	Asbestos Content
Black Carpet	ND
Black Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. F

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM-5, Black Carpet Square and Mastic Lab ID-Version‡: 20525424-1

Sample Layers	Asbestos Content
Black Carpet	ND
Black Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-6, Black Carpet Square and Mastic Lab ID-Version‡: 20525425-1

Sample Layers	Asbestos Content
Black Carpet	ND
Black Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-7, Blue Cove Base and Mastic Lab ID-Version‡: 20525426-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-8, Blue Cove Base and Mastic Lab ID-Version‡: 20525427-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. F

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM-9, Blue Cove Base and Mastic Lab ID-Version‡: 20525428-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-10, Orange Peel D.W. (paint,tex,tape,j.c.,d.w.) Lab ID-Version‡: 20525429-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-11, Orange Peel D.W. (paint,tex,tape,j.c.,d.w.) Lab ID-Version‡: 20525430-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. F

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM-12, Orange Peel D.W. (paint,tex,tape,j.c.,d.w.) Lab ID-Version‡: 20525431-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. F

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM-13, 2' X 4' Ceiling Tile Lab ID-Version‡: 20525432-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-14, 2' X 4' Ceiling Tile Lab ID-Version‡: 20525433-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-15, 2' X 4' Ceiling Tile Lab ID-Version‡: 20525434-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-16, White w/ Black 12" X 12" VCT and Mastic Lab ID-Version‡: 20525435-1

Sample Layers	Asbestos Content
White Floor Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. F

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM-17, White w/ Black 12" X 12" VCT and Mastic Lab ID-Version‡: 20525436-1

Sample Layers	Asbestos Content
White Floor Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-18, White w/ Black 12" X 12" VCT and Mastic Lab ID-Version‡: 20525437-1

Sample Layers	Asbestos Content
White Floor Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built


Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. F

Date of Sampling: 06-16-2025
Date of Receipt: 06-16-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Renee Luna-Trepczynski

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY

www.eurofinsus.com/Built

eurofins | Built Environment Testing

East:(866) 871-1984
West/Central:(800) 651-4802

WEATHER	Fog	Rain	Snow	Wind	Clear
LEVEL None					
Light					
Moderate					
Heavy					

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address:20045 N. 19th Ave., Phx, AZ 85027
Contact:	Nick Marcos	Special Instructions:
Phone:	623-516-1415	

PROJECT INFORMATION

Project ID:	AZ1418.57		
Project Description:	Kyrene Middle School - Bldg. F		
Project Zip Code:		Sampling Date/Time:	6/16/2025
PO Number:	13745	Sampled By	NM

TURN AROUND TIME CODES - (TAT)

STD - Standard (Default)
ND - Next Business Day
SD - Same Business Day
WH - Weekend/Holiday/ASAP

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

REQUESTED SERVICES

Non
Spor
Trap

004112393

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	Gray Multi-Color Carpet Square and Mastic	B	STD		
PLM 4-6	Black Carpet Square and Mastic	B	STD		
PLM 7-9	Blue Cove Base and Mastic	B	STD		
PLM 10-12	Orange Peel D.W. (paint,tex,tape,j.c.,d.w.)	B	STD		
PLM 13-15	2' X 4' Ceiling Tile	B	STD		
PLM 16-18	White w/ Black 12" X 12" VCT and Mastic	B	STD		

Spore Trap Analysis	Other biological particles - supplement	Direct Microscopic Exam (Qualitative)	Quantitative spore count direct exam	Dust Characterization	1-Media Surface Fungi (Genus ID + Asp. spp.)	Culturable Air Fungi (Genus ID + Asp. spp.)	Gram Stain and Counts (Culturable Air and Surface	Legionella culture	Total Coliform, E.coli (Presence/Absence)	QuantiTray-Sewage Screen	OTHER: (please specify test)

Other Requests

Asbestos in Air - PCM Airborne Fiber Count (NIOSH 7400)	Asbestos Bulk - PLM (EPA method 600/R-93-116)	Lead (Pb) / Paint Chip	PCR (please specify test)	Allergens (please specify test)
	X			
	X			
	X			
	X			
	X			
	X			

SAMPLE TYPE CODES

BC - BioCassette™	**CP** - Contact Plate	**T** - Tape	**O** - Other:
A1S - Andersen	**ST** - Spore Trap	**SW** - Swab	
SAS - Surface Air Sampler	**B** - Bulk	**SO** - Soil	
NP - Non-potable Water	**P** - Potable Water	**D** - Dust	

RELINQUISHED BY	DATE & TIME
Nick Marcos	6/16/2025

RECEIVED BY	DATE & TIME
Patty Vega	6/16/25 4:44 pm

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at http://www.emlab.com/s/main/serviceterms.html

eurofins | Built Environment Testing

Report for:

Nick Marcos
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.57; Kyrene Middle School - Bldg. G
EML ID: 4110232

Approved by:



Approved Signatory
Renee Luna-Trepczynski

Dates of Analysis:
Asbestos PLM: 06-17-2025

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

Total Samples Submitted:	15
Total Samples Analyzed:	15
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM 1, 2' x 4' Ceiling Tile Lab ID-Version‡: 20512256-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 10% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 2, 2' x 4' Ceiling Tile Lab ID-Version‡: 20512257-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 10% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 3, 2' x 4' Ceiling Tile Lab ID-Version‡: 20512258-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 10% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

Location: PLM 4, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512259-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

Location: PLM 5, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512260-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM 6, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512261-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM 7, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20512262-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Transparent Mastic	ND
Gray Leveling Compound	ND
Orange Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers < 1% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

Location: PLM 8, Gray Multi-Color Carpet Square and Mastic

Lab ID-Version‡: 20512263-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Transparent Mastic	ND
Gray Leveling Compound	ND
Orange Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers < 1% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

Location: PLM 9, Gray Multi-Color Carpet Square and Mastic

Lab ID-Version‡: 20512264-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Transparent Mastic	ND
Gray Leveling Compound	ND
Orange Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers < 1% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM 10, Blue Cove Base and Mastic

Lab ID-Version‡: 20512265-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM 11, Blue Cove Base and Mastic

Lab ID-Version‡: 20512266-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM 12, Blue Cove Base and Mastic

Lab ID-Version‡: 20512267-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

Location: PLM 13, Black Carpet Square and Mastic

Lab ID-Version‡: 20512268-1

Sample Layers	Asbestos Content
Black Carpet	ND
Transparent Mastic	ND
Gray Leveling Compound	ND
Tan Mastic	ND
Composite Non-Asbestos Content:	70% Synthetic Fibers < 1% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM 14, Black Carpet Square and Mastic

Lab ID-Version‡: 20512269-1

Sample Layers	Asbestos Content
Black Carpet	ND
Transparent Mastic	ND
Gray Leveling Compound	ND
Tan Mastic	ND
Composite Non-Asbestos Content:	70% Synthetic Fibers < 1% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM 15, Black Carpet Square and Mastic

Lab ID-Version‡: 20512270-1

Sample Layers	Asbestos Content
Black Carpet	ND
Transparent Mastic	ND
Gray Leveling Compound	ND
Orange Mastic	ND
Composite Non-Asbestos Content:	70% Synthetic Fibers < 1% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built


Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

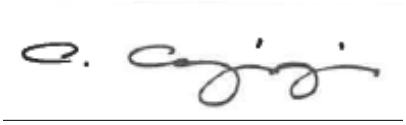

Analyst: Aaron Agajanian

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY

www.eurofinsus.com/Built

eurofins | Built Environment Testing

East:(866) 871-1984
West/Central:(800) 651-4802

WEATHER	Fog	Rain	Snow	Wind	Clear
LEVEL None					
Light					
Moderate					
Heavy					

004110232

CONTACT INFORMATION		
Company:	Dominion Environmental Consultants	Address:20045 N. 19th Ave., Phx, AZ 85027
Contact:	Nick Marcos	Special Instructions:
Phone:	623-516-1415	

PROJECT INFORMATION			
Project ID:	AZ1418.57		
Project Description:	Kyrene Middle School - Bldg. G		
Project Zip Code:		Sampling Date/Time:	6/12/2025
PO Number:	13744	Sampled By:	NM

TURN AROUND TIME CODES - (TAT)	
STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
ND - Next Business Day	
SD - Same Business Day	
WH - Weekend/Holiday/ASAP	

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	2' X 4' Ceiling Tile	B	STD		
PLM 4-6	Orange Peel D.W. (Paint,tex,tape,j.c.,d.w.)	B	STD		
PLM 7-9	Gray Multi-Color Carpet Square and Mastic	B	STD		
PLM 10-12	Blue Cove Base and Mastic	B	STD		
PLM 13-15	Black Carpet Square and Mastic	B	STD		

Non-Cultural: Spore Trap; Tape Swab; Requests

SAMPLE ID	Spore Trap Analysis	Other biological particles - supplement	Direct Microscopic Exam (Qualitative)	Qualitative spore count direct exam	Dust Characterization	1-Media Surface Fungi (Genus ID + Asp. spp.)	Culturable Air Fungi (Genus ID + Asp. spp.)	Gram Stain and Counts (Culturable Air and Surface Bacteria)	*Legionella* culture	Total Coliform, *E.coli* (Presence/Absence)	QuantiTray-Sewage Screen	OTHER: (please specify test)	Asbestos in Air - PCM Airborne Fiber Count (NIOSH 7400)	Asbestos Bulk - PLM (EPA method 600/R-93-116)	Lead (Pb) / Paint Chip	PCR (please specify test)	Allergens (please specify test)
PLM 1-3														X			
PLM 4-6														X			
PLM 7-9														X			
PLM 10-12														X			
PLM 13-15														X			

SAMPLE TYPE CODES			
BC - BioCassette™	**CP** - Contact Plate	**T** - Tape	**O** - Other:
A1S - Andersen	**ST** - Spore Trap	**SW** - Swab	
SAS - Surface Air Sampler	**B** - Bulk	**SO** - Soil	
NP - Non-potable Water	**P** - Potable Water	**D** - Dust	

RELINQUISHED BY	DATE & TIME	RECEIVED BY	DATE & TIME
Nick Marcos	6/13/2025	Patty Lugo	6/13/25 11:54 am

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at http://www.emlab.com/s/main/serviceterms.html

Aerobiology Laboratory Associates, Incorporated
Expertise Since 1997

Lab Use:
20049419
11/19/2020

ELITE Proficient — AZ, CA, CO, FL, GA, VA, NJ
NVLAP — AZ, CA, CO, VA
AZ, CA, CO, FL GA, NJ, VA

Page _____ of _____

Aerobiology Client	c395 Dominion Environmental Consultants, Inc.		
Field Contact	Nick Marcos	**Collected By/Date:** NM 11/19/20	**Relinquished By/Date:** NM 11/19/20
Reporting Address	20045 N. 19th Ave Building 7 Phoenix AZ 85027	Relinquished By/Date:	Received By/Date: 11-19-20 1050
Billing Address	20045 N. 19th Ave Building 7 Phoenix AZ 85027	Sampler Type: Andersen___ SAS___	SampleAire___ AeroTrap___ Other___ BioCulture___
Phone/Fax	623-516-1414	**PO#/Job#:** JH: AZ09S9.2635 PO: 2616336	
Reporting Email (s)	nmarcos@dominion-env.com	**Project Name:** Kyrene Middle School	
Routine ☐	24 Hour ☒ Same Day ☐ 4 Hour ☐ 2 Hour ☐	**Notes:**	
SAMPLING LOCATION ZIP CODE		**Lab Contacts:** Simone Singh (408) 498-7901 Mandy Palm (858) 444-7138	

	Sample No.	Test Code	Sample Location	Total Volume/Area
1	PLM 1	3002	Orange Peel drywall sys (paint, tex, tape, J.C. drywall)	
2	2		↓	
3	3			
4	4		2'x4' Ceiling tile	
5	5		↓	
6	6			
7	7		Counter Caulking	
8	8		↓	
9	9			
10	10		Blue Cove Base & Mastic	
11	11			
12	12			
13				
14				
15				

1054	Direct, Non-viable Spore Trap	1015	Culture - WATER Legionella
1049	Direct, Quantitative- **Swab/Tape**	1017	Culture - SWAB Legionella
1050	Direct, Qualitative- **Bulk**	1010	WATER - Potable - E. coli/total coliforms
1005	AIR Culture - Bacterial Count w/ ID's	1012	SWAB - E. coli/total coliforms
1030	AIR Culture - Fungal Count w/ ID's	1028	SWAB - Sewage Screen (E. coli/Entero/fecal coliforms)
1006	SWAB Culture - Bacterial Count w/ ID's	2056	WATER - Heterotrophic Plate Count
1031	SWAB Culture - Fungal Count w/ ID's	3001	ASBESTOS - Point count
1008	BULK Culture - Bacterial Count w/ ID's	3002	ASBESTOS - PLM Analysis
1033	BULK Culture - Fungal Count w/ ID's	3003	ASBESTOS - Particle characterization
1007	WATER Culture - Bacterial Count w/ID's	3004	ASBESTOS - PCM Analysis

Washington, D.C. (877) 648-9150 | Atlanta, GA (770) 947-2828 | Denver, CO (303) 232-3746 | Phoenix, AZ (602) 441-3700 | Cherry Hill, NJ (856) 486-1177 | Los Angeles, CA (714) 895-8401 | Ft. Lauderdale, FL (954) 451-3725

ALL SAMPLES ACCEPTABLE
INIT/DATE KO 11.19.20

NVLAP®
TESTING NVLAP LAB CODE 500097-0

Aerobiology Laboratory Associates, Incorporated
A Pace Analytical® Laboratory

Aerobiology Laboratory Associates, Inc.
2228 W Northern Ave. Suite B-110
Phoenix, AZ 85021
(602) 441-3700
www.aerobiology.net

Certificate of Analysis

Client:
Dominion Environmental Consultants, Inc
20045 N. 19th Ave Building 7
Phoenix, AZ 85027
Attn: Ryan Kuhn

Project Name: **261636/AZ0959.2635 Kyrene Middle School (NM)**
Project ID: 20049419

Date Collected:	11/19/2020
Date Received:	11/19/2020
Date Analyzed:	11/20/2020
Date Reported:	11/20/2020

Test Requested: **Asbestos Bulk Analysis, Polarized Light Microscopy (PLM)**: EPA 600/R-93/116 Method for Asbestos in Bulk Building Materials, EPA-40 CFR Appendix E to Subpart E of Part 763, Interim Method for Asbestos in Bulk Insulation Samples

Total Samples Submitted:	12
Total Samples Analyzed:	12
Total Samples with Asbestos (≥1%):	0

Location: PLM-1 Orange Peel Drywall Sys (Paint, Tex, Tape, JC, Drywall) Lab ID: 20049419-001

Physical Description of Sample/Layer	Asbestos Detected
White Paint	ND
White Texture	ND
White Joint Compound	ND
Cream Tape	ND
White/Tan Drywall	ND

Location: PLM-2 Orange Peel Drywall Sys (Paint, Tex, Tape, JC, Drywall) Lab ID: 20049419-002

Physical Description of Sample/Layer	Asbestos Detected
White Paint	ND
White Texture	ND
White Joint Compound	ND
Cream Tape	ND
White/Tan Drywall	ND

Location: PLM-3 Orange Peel Drywall Sys (Paint, Tex, Tape, JC, Drywall) Lab ID: 20049419-003


Physical Description of Sample/Layer	Asbestos Detected
White Paint	ND
White Texture	ND
White Joint Compound	ND
Cream Tape	ND
White/Tan Drywall	ND

Location: PLM-4 2'x 4' Ceiling Tile Lab ID: 20049419-004


Physical Description of Sample/Layer	Asbestos Detected
White/Tan Ceiling Tile	ND

Location: PLM-5 2'x 4' Ceiling Tile Lab ID: 20049419-005

Physical Description of Sample/Layer	Asbestos Detected
White/Tan Ceiling Tile	ND

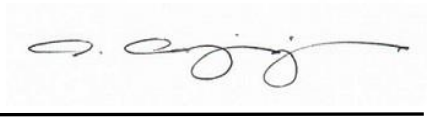

Aaron Agajanian
Analyst



Elle Teague
Manager-Asbestos

A Amosite
AC Actinolite
AN Anthophyllite
CHRY Chrysotile
CR Crocidolite
TR Tremolite
Trace Less Than 1%
ND None Detected

Non-Asbestos fiber percentage and matrix information available upon request

NVLAP
TESTING NVLAP LAB CODE 500097-0

Aerobiology Laboratory Associates, Incorporated
A Pace Analytical® Laboratory

Aerobiology Laboratory Associates, Inc.
2228 W Northern Ave. Suite B-110
Phoenix, AZ 85021
(602) 441-3700
www.aerobiology.net

Client:
Dominion Environmental Consultants, Inc
20045 N. 19th Ave Building 7
Phoenix, AZ 85027
Attn: Ryan Kuhn

Certificate of Analysis

Project Name: 261636/AZ0959.2635 Kyrene Middle School (NM)

Project ID: 20049419

Date Collected: 11/19/2020
Date Received: 11/19/2020
Date Analyzed: 11/20/2020
Date Reported: 11/20/2020

Test Requested: **Asbestos Bulk Analysis, Polarized Light Microscopy (PLM)**: EPA 600/R-93/116 Method for Asbestos in Bulk Building Materials, EPA-40 CFR Appendix E to Subpart E of Part 763, Interim Method for Asbestos in Bulk Insulation Samples

Location: PLM-6 2'x 4' Ceiling Tile Lab ID: 20049419-006

Physical Description of Sample/Layer	Asbestos Detected
White/Tan Ceiling Tile	ND

Location: PLM-7 Counter Caulking Lab ID: 20049419-007

Physical Description of Sample/Layer	Asbestos Detected
White Caulk	ND

Location: PLM-8 Counter Caulking Lab ID: 20049419-008

Physical Description of Sample/Layer	Asbestos Detected
White Caulk	ND

Location: PLM-9 Counter Caulking Lab ID: 20049419-009

Physical Description of Sample/Layer	Asbestos Detected
White Caulk	ND

Location: PLM-10 Blue Cove Base & Mastic Lab ID: 20049419-010

Physical Description of Sample/Layer	Asbestos Detected
Tan Mastic	ND
Blue Cove Base	ND

Location: PLM-11 Blue Cove Base & Mastic Lab ID: 20049419-011

Physical Description of Sample/Layer	Asbestos Detected
Tan Mastic	ND
Blue Cove Base	ND

Location: PLM-12 Blue Cove Base & Mastic Lab ID: 20049419-012

Physical Description of Sample/Layer	Asbestos Detected
Tan Mastic	ND
Blue Cove Base	ND

Aaron Agajanian
Analyst

Elle Teague
Manager-Asbestos

A Amosite
AC Actinolite
AN Anthophyllite
CHRY Chrysotile
CR Crocidolite
TR Tremolite
Trace Less Than 1%
ND None Detected

Non-Asbestos fiber percentage and matrix information available upon request

TESTING NVLAP LAB CODE 500097-0

Aerobiology Laboratory Associates, Inc.
2228 W Northern Ave. Suite B-110
Phoenix, AZ 85021
(602) 441-3700
www.aerobiology.net

Client:
Dominion Environmental Consultants, Inc
20045 N. 19th Ave Building 7
Phoenix, AZ 85027
Attn: Ryan Kuhn

Certificate of Analysis

Project Name: 261636/AZ0959.2635 Kyrene Middle School (NM)

Project ID: 20049419

Date Collected: 11/19/2020
Date Received: 11/19/2020
Date Analyzed: 11/20/2020
Date Reported: 11/20/2020

General Notes

* **ND** indicates no asbestos was detected.

* The method detection limit is 1%.

* **Trace** or "<1" indicates asbestos was identified in the sample, but the concentration is less than 1%.

* All regulated asbestos minerals (i.e. chrysotile, amosite, crocidolite, anthophyllite, tremolite, and actinolite) were sought in every layer of each sample, but only those asbestos minerals detected are listed. Amosite is the common name for the asbestiform variety of the minerals cummingtonite and grunerite. Crocidolite is the common name used for the asbestiform variety of the mineral riebeckite.

* Tile, vinyl, foam, plastic, and fine powder samples may contain asbestos fibers of such small diameter (< 0.25 microns in diameter) that these fibers cannot be detected by PLM. For such samples, more sensitive analytical methods (e.g. TEM, SEM, and XRD) are recommended if greater certainty about asbestos content is required. Semi-quantitative bulk TEM floor tile analysis is accepted under NESHAP regulations.

* These results are submitted pursuant to Aerobiology Laboratory Associates, Inc.'s current terms and conditions of sale, including the company's standard warranty and limitation of liability provisions. No responsibility or liability is assumed for the manner in which the results are used or interpreted.

* Unless notified in writing to return the samples covered by this report, Aerobiology Laboratory Associates, Inc. will store the samples for a minimum period of thirty (30) days before discarding. A shipping and handling charge will be assessed for the return of any samples.

* Aerobiology does not guarantee the results of tape lifts, microvacs, wipe, and/or debris samples. Accurate analysis cannot be performed due to particle size, media used, and/or amount of material given. Analysis of these materials should be performed by a TEM. A result of ND does not indicate that the sample area does not contain asbestos. It means the analyst could not identify asbestos in the specific sample for the reasons listed above.

Notes Required by NVLAP

* Aerobiology Laboratory shall be responsible for all the information provided in the report, except when information is provided by the customer. Aerobiology Laboratory is not responsible for the sampling activity.

* This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government.

* This test report relates only to the items tested or calibrated.

* This report is not valid unless it bears the name of a NVLAP-approved signatory.

* Any reproduction of this document must include the entire document in order for the report to be valid.

Non-Asbestos fiber percentage and matrix information available upon request

eurofins | Built Environment Testing

Report for:

Nick Marcos
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.57; Kyrene Middle School - Bldg. G
EML ID: 4110232

Approved by:



Approved Signatory
Renee Luna-Trepczynski

Dates of Analysis:
Asbestos PLM: 06-17-2025

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

Total Samples Submitted:	15
Total Samples Analyzed:	15
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM 1, 2' x 4' Ceiling Tile Lab ID-Version‡: 20512256-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 10% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 2, 2' x 4' Ceiling Tile Lab ID-Version‡: 20512257-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 10% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 3, 2' x 4' Ceiling Tile Lab ID-Version‡: 20512258-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 10% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

Location: PLM 4, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512259-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

Location: PLM 5, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512260-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM 6, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512261-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM 7, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20512262-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Transparent Mastic	ND
Gray Leveling Compound	ND
Orange Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers < 1% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

Location: PLM 8, Gray Multi-Color Carpet Square and Mastic

Lab ID-Version‡: 20512263-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Transparent Mastic	ND
Gray Leveling Compound	ND
Orange Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers < 1% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

Location: PLM 9, Gray Multi-Color Carpet Square and Mastic

Lab ID-Version‡: 20512264-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Transparent Mastic	ND
Gray Leveling Compound	ND
Orange Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers < 1% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM 10, Blue Cove Base and Mastic

Lab ID-Version‡: 20512265-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM 11, Blue Cove Base and Mastic

Lab ID-Version‡: 20512266-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM 12, Blue Cove Base and Mastic

Lab ID-Version‡: 20512267-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

Location: PLM 13, Black Carpet Square and Mastic

Lab ID-Version‡: 20512268-1

Sample Layers	Asbestos Content
Black Carpet	ND
Transparent Mastic	ND
Gray Leveling Compound	ND
Tan Mastic	ND
Composite Non-Asbestos Content:	70% Synthetic Fibers < 1% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM 14, Black Carpet Square and Mastic

Lab ID-Version‡: 20512269-1

Sample Layers	Asbestos Content
Black Carpet	ND
Transparent Mastic	ND
Gray Leveling Compound	ND
Tan Mastic	ND
Composite Non-Asbestos Content:	70% Synthetic Fibers < 1% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM 15, Black Carpet Square and Mastic

Lab ID-Version‡: 20512270-1

Sample Layers	Asbestos Content
Black Carpet	ND
Transparent Mastic	ND
Gray Leveling Compound	ND
Orange Mastic	ND
Composite Non-Asbestos Content:	70% Synthetic Fibers < 1% Cellulose < 1% Glass Fibers
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built


Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. G

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-17-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

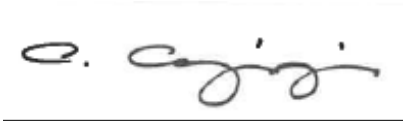

Analyst: Aaron Agajanian

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY

www.eurofinsus.com/Built
eurofins | Built Environment Testing

East:(866) 871-1984
West/Central:(800) 651-4802

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

004110232

CONTACT INFORMATION		
Company:	Dominion Environmental Consultants	Address:20045 N. 19th Ave., Phx, AZ 85027
Contact:	Nick Marcos	Special Instructions:
Phone:	623-516-1415	

PROJECT INFORMATION			
Project ID:	AZ1418.57		
Project Description:	Kyrene Middle School - Bldg. G		
Project Zip Code:		Sampling Date/Time:	6/12/2025
PO Number:	13744	Sampled By:	NM

TURN AROUND TIME CODES - (TAT)	
STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
ND - Next Business Day	
SD - Same Business Day	
WH - Weekend/Holiday/ASAP	

Analysis Requests: Non-Culturable (Spore Trap; Tape Swab, ...)

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)	Spore Trap Analysis	Other biological particles - supplement	Direct Microscopic Exam (Qualitative)	Qualitative spore count direct exam	Dust Characterization	1-Media Surface Fungi (Genus ID + *Asp.* spp.)	Culturable Air Fungi (Genus ID + *Asp.* spp.)	Gram Stain and Counts (Culturable Air and Surface Bacteria)	*Legionella* culture	Total Coliform, *E.coli* (Presence/Absence)	QuantiTray-Sewage Screen	OTHER: (please specify test)	Asbestos in Air - PCM Airborne Fiber Count (NIOSH 7400)	Asbestos Bulk - PLM (ERA method 600/R-93-116)	Lead (Pb) / Paint Chip	PCR (please specify test)	Allergens (please specify test)
PLM 1-3	2' X 4' Ceiling Tile	B	STD																X			
PLM 4-6	Orange Peel D.W. (Paint,tex,tape,j.c.,d.w.)	B	STD																X			
PLM 7-9	Gray Multi-Color Carpet Square and Mastic	B	STD																X			
PLM 10-12	Blue Cove Base and Mastic	B	STD																X			
PLM 13-15	Black Carpet Square and Mastic	B	STD																X			

SAMPLE TYPE CODES			
BC - BioCassette™	**CP** - Contact Plate	**T** - Tape	**O** - Other:
A1S - Andersen	**ST** - Spore Trap	**SW** - Swab	
SAS - Surface Air Sampler	**B** - Bulk	**SO** - Soil	
NP - Non-potable Water	**P** - Potable Water	**D** - Dust	

RELINQUISHED BY	DATE & TIME	RECEIVED BY	DATE & TIME
Nick Marcos	6/13/2025	Patty Vega	6/13/25 11:54 am

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at http://www.emlab.com/s/main/serviceterms.html

eurofins | Built Environment Testing

Report for:

Tracey Carpenter
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, Inc.
Project: AZ1418.11; Kyrene Middle School - Bldg H
EML ID: 3573064

Approved by:

Renee Luna-Trepczynski

Approved Signatory
Renee Luna-Trepczynski

Dates of Analysis:
Asbestos PLM: 03-18-2024

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, Inc. ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, Inc.
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Tracey Carpenter
Re: AZ1418.11; Kyrene Middle School - Bldg H

Date of Sampling: 03-14-2024
Date of Receipt: 03-14-2024
Date of Report: 03-18-2024

ASBESTOS PLM REPORT

Total Samples Submitted:	3
Total Samples Analyzed:	3
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM-1, Orange Peel Drywall (paint, tape, texture, joint compound & drywall)

Lab ID-Version‡: 17464286-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
Pink Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-2, Orange Peel Drywall (paint, tape, texture, joint compound & drywall)

Lab ID-Version‡: 17464287-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-3, Orange Peel Drywall (paint, tape, texture, joint compound & drywall)

Lab ID-Version‡: 17464288-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
Pink Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY eurofins

www.EMLabPK.com

EMLab P&K

Marlton, NJ: 3000 Lincoln Dr E, Ste. A, Marlton, NJ 08053 * (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 * (800) 651-4802
SSF, CA: 6000 Shoreline Ct, Ste. 205, S. San Francisco, CA 94080 * (866) 888-6653

WEATHER	Fog	Rain	Snow	Wind	Clear
LEVEL None					
Light					
Moderate					
Heavy					

003573064

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave, Bldg 7, Phoenix, AZ 85027	
Contact:	Tracey Carpenter	Special Instructions: email results: tcarpenter@dominion-env.com	
Phone:	(602) 989-9992		

PROJECT INFORMATION

Project ID:	AZ1418.11		
Project Description:	Kyrene Middle School-Bldg H		
Project Zip Code:		Sampling Date/Time:	3/14/24 @ 5:30 PM
PO Number:	316032	Sampled By:	TCC

TURN AROUND TIME CODES - (TAT)

STD - Standard (Default)
ND - Next Business Day
SD - Same Business Day
WH - Weekend/Holiday/ASAP

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	Orange Peel Drywall (paint, tape, texture, joint compound, + drywall)	B	STD		
		1	1		

Non-Cultureable: Spore Trap; Tape, Swab, Bulk

Spore Trap Analysis	Other biological particles - supplement	Direct Microscopic Exam (Qualitative)	Quantitative spore count direct exam	Dust Characterization	1-Media Surface Fungi (Genus ID + Asp. spp.)	Culturable Air Fungi (Genus ID + Asp. spp.)	Gram Stain and Counts (Culturable Air and Surface Bacteria)	Legionella culture	Total Coliform, E.coli (Presence/Absence)	QuantiTray-Sewage Screen	OTHER: (please specify test)	Asbestos in Air - PCM Airborne Fiber Count (NIOSH 7400)	Asbestos Bulk - PLM (EPA method 600/R-93-116)	Lead (Pb)	PCR (please specify test)	Allergens (please specify test)
													X			

SAMPLE TYPE CODES

BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	
SAS - Surface Air Sampler	B - Bulk	SO - Soil	
NP - Non-potable Water	P - Potable Water	D - Dust	

RELINQUISHED BY	DATE & TIME
Tracy Carp	3/14/24 @ 8:30 AM

RECEIVED BY	DATE & TIME
	3-14-24

eurofins | Built Environment Testing

Report for:

Nick Marcos
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.57; Kyrene Middle School - Bldg. H
EML ID: 4110228

Approved by:



Approved Signatory
Renee Luna-Trepczynski

Dates of Analysis:
Asbestos PLM: 06-18-2025

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. H

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Total Samples Submitted:	18
Total Samples Analyzed:	18
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM 1, Decorative 2' x 4' Ceiling Tile Lab ID-Version‡: 20512175-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 2, Decorative 2' x 4' Ceiling Tile Lab ID-Version‡: 20512176-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 3, Decorative 2' x 4' Ceiling Tile Lab ID-Version‡: 20512177-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 4, 2' x 4' Ceiling Tile Lab ID-Version‡: 20512178-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. H

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 5, 2' x 4' Ceiling Tile Lab ID-Version‡: 20512179-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 6, 2' x 4' Ceiling Tile Lab ID-Version‡: 20512180-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 7, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512181-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM 8, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512182-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. H

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 9, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512183-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM 10, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20512184-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Gray Mastic	ND
Composite Non-Asbestos Content:	70% Synthetic Fibers 5% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 11, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20512185-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Gray Mastic	ND
Composite Non-Asbestos Content:	70% Synthetic Fibers 5% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 12, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20512186-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Gray Mastic	ND
Composite Non-Asbestos Content:	70% Synthetic Fibers 5% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. H

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 13, Blue Cove Base and Mastic Lab ID-Version‡: 20512187-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM 14, Blue Cove Base and Mastic Lab ID-Version‡: 20512188-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM 15, Blue Cove Base and Mastic Lab ID-Version‡: 20512189-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM 16, Black Carpet Square and Mastic Lab ID-Version‡: 20512190-1

Sample Layers	Asbestos Content
Black Carpet	ND
Gray Mastic	ND
Composite Non-Asbestos Content:	80% Synthetic Fibers 5% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. H

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 17, Black Carpet Square and Mastic Lab ID-Version‡: 20512191-1

Sample Layers	Asbestos Content
Black Carpet	ND
Gray Mastic	ND
Composite Non-Asbestos Content:	80% Synthetic Fibers 5% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 18, Black Carpet Square and Mastic Lab ID-Version‡: 20512192-1

Sample Layers	Asbestos Content
Black Carpet	ND
Gray Mastic	ND
Composite Non-Asbestos Content:	80% Synthetic Fibers 5% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built


Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. H

Date of Sampling: 06-12-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Kayla Heinen

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY

www.eurofinsus.com/Built

eurofins | Built Environment Testing

East:(866) 871-1984
West/Central:(800) 651-4802

WEATHER	Fog	Rain	Snow	Wind	Clear
LEVEL None					
Light					
Moderate					
Heavy					

004110228

CONTACT INFORMATION		
Company:	Dominion Environmental Consultants	Address:20045 N. 19th Ave., Phx, AZ 85027
Contact:	Nick Marcos	Special Instructions:
Phone:	623-516-1415	

PROJECT INFORMATION			
Project ID:	AZ1418.57		
Project Description:	Kyrene Middle School - Bldg. H		
Project Zip Code:		Sampling Date/Time:	6/12/2025
PO Number:	13743	Sampled By:	NM

TURN AROUND TIME CODES - (TAT)	
STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
ND - Next Business Day	
SD - Same Business Day	
WH - Weekend/Holiday/ASAP	

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	Decorative 2' X 4' Ceiling Tile	B	STD		
PLM 4-6	2' X 4' Ceiling Tile	B	STD		
PLM 7-9	Orange Peel D.W. (Paint,tex,tape,j.c.,d.w.)	B	STD		
PLM 10-12	Gray Multi-Color Carpet Square and Mastic	B	STD		
PLM 13-15	Blue Cove Base and Mastic	B	STD		
PLM 16-18	Black Carpet Square and Mastic	B	STD		

Non-Cultu

Spore Trap	Ti Swa	Spore Trap Analysis	Other biological particles - supplement	Direct Microscopic Exam (Qualitative)	Quantitative spore count direct exam	Dust Characterization	1-Media Surface Fungi (Genus ID + *Asp.* spp.)	Culturable Air Fungi (Genus ID + *Asp.* spp.)	Gram Stain and Counts (Culturable Air and Surface Bacter	*Legionella* culture	Total Coliform, *E.coli* (Presence/Absence)	QuantiTray-Sewage Screen	OTHER: (please specify test)		Asbestos in Air - PCM Airborne Fiber Count (NIOSH 7400)	Asbestos Bulk - PLM (EPA method 600/R-93-116)	Lead (Pb) / Paint Chip	PCR (please specify test)	Allergens (please specify test)	
																X				
																X				
																X				
																X				
																X				
																X				

er Requests

SAMPLE TYPE CODES			
BC - BioCassette™	**CP** - Contact Plate	**T** - Tape	**O** - Other:
A1S - Andersen	**ST** - Spore Trap	**SW** - Swab	
SAS - Surface Air Sampler	**B** - Bulk	**SO** - Soil	
NP - Non-potable Water	**P** - Potable Water	**D** - Dust	

RELINQUISHED BY	DATE & TIME
Nick Marcos	6/13/2025

RECEIVED BY	DATE & TIME
Patty Lopez	6/13/25 11:53am

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at http://www.emlab.com/s/main/serviceterms.html

eurofins | Built Environment Testing

Report for:

Tracey Carpenter
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, Inc.
Project: AZ1418.11; Kyrene Middle School - Bldg J
EML ID: 3573059

Approved by:

Renee Luna-Trepczynski

Approved Signatory
Renee Luna-Trepczynski

Dates of Analysis:
Asbestos PLM: 03-18-2024

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, Inc. ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, Inc.
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Tracey Carpenter
Re: AZ1418.11; Kyrene Middle School - Bldg J

Date of Sampling: 03-13-2024
Date of Receipt: 03-14-2024
Date of Report: 03-18-2024

ASBESTOS PLM REPORT

Total Samples Submitted:	3
Total Samples Analyzed:	3
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM-1, 12''x12'' White w/Gray Specks VCT & Mastic Lab ID-Version‡: 17464328-1

Sample Layers	Asbestos Content
Yellow Mastic	ND
Gray/White Floor Tile	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-2, 12''x12'' White w/Gray Specks VCT & Mastic Lab ID-Version‡: 17464329-1

Sample Layers	Asbestos Content
Yellow Mastic	ND
Gray/White Floor Tile	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-3, 12''x12'' White w/Gray Specks VCT & Mastic Lab ID-Version‡: 17464330-1

Sample Layers	Asbestos Content
Yellow Mastic	ND
Gray/White Floor Tile	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY eurofins | EMLab P&K

www.EMLabPK.com

Marlton, NJ: 3000 Lincoln Dr E, Ste. A, Marlton, NJ 08053 * (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 * (800) 651-4802
SSF, CA: 6000 Shoreline Ct, Ste. 205, S. San Francisco, CA 94080 * (866) 888-6653

WEATHER	Fog	Rain	Snow	Wind	Clear
LEVEL None					
Light					
Moderate					
Heavy					

RE

003573059

CONTACT INFORMATION			
Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave, Bldg 7, Phoenix, AZ 85027	
Contact:	Tracey Carpenter	Special Instructions: email results: tcarpenter@dominion-env.com	
Phone:	(602) 989-9992		

PROJECT INFORMATION				TURN AROUND TIME CODES - (TAT)	
Project ID:	AZ1418.11			STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene Middle School-Bldg J			ND - Next Business Day	
Project Zip Code:	85284	Sampling Date/Time:	3/13/24 @ 530 Pm	SD - Same Business Day	
PO Number:	316033	Sampled By:	TLC	WH - Weekend/Holiday/ASAP	

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	12" x 12" White w/	B	STD		
	Gray Specks VCT	1	1		
	+ Mastic				

Non-Culturable																												
Spore Trap		Tape, Swab, Bulk			BioC Swa																							
Spore Trap Analysis	Other biological particles - supplement	Direct Microscopic Exam (Qualitative)	Quantitative spore count direct exam	Dust Characterization	1-Media Surface Fungi (Genus ID + *Asp.* spp.)	Culturable Air Fungi (Genus ID + *Asp.* spp.)	Gram Stain and Counts (Culturable Air and Surface Bacteri	*Legionella* culture	Total Coliform, *E.coli* (Presence/Absence)	QuantiTray-Sewage Screen	OTHER: (please specify test)		Asbestos in Air - PCM Airborne Fiber Count (NIOSH 7400)	Asbestos Bulk - PLM (EPA method 600/R-93-116)	Lead (Pb)	PCR (please specify test)	Allergens (please specify test)										
														X														

SAMPLE TYPE CODES			
BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	
SAS - Surface Air Sampler	B - Bulk	SO - Soil	
NP - Non-potable Water	P - Potable Water	D - Dust	

RELINQUISHED BY	DATE & TIME	RECEIVED BY	DATE & TIME
Tracy Carp	3/14/24 @ 8:30		3-14-24

eurofins | Built Environment Testing

Report for:

Nick Marcos
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.57; Kyrene Middle School - Bldg. J
EML ID: 4110217

Approved by:



Approved Signatory
Renee Luna-Trepczynski

Dates of Analysis:
Asbestos PLM: 06-18-2025

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. J

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Total Samples Submitted:	18
Total Samples Analyzed:	18
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM 1, Old 2' x 4' Ceiling Tile Lab ID-Version‡: 20512486-1

Sample Layers	Asbestos Content
Brown Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 5% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM 2, Old 2' x 4' Ceiling Tile Lab ID-Version‡: 20512487-1

Sample Layers	Asbestos Content
Brown Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 5% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM 3, Old 2' x 4' Ceiling Tile Lab ID-Version‡: 20512488-1

Sample Layers	Asbestos Content
Brown Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 5% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM 4, New 2' x 4' Ceiling Tile Lab ID-Version‡: 20512489-1

Sample Layers	Asbestos Content
Brown Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 20% Glass Fibers
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. J

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 5, New 2' x 4' Ceiling Tile Lab ID-Version‡: 20512490-1

Sample Layers	Asbestos Content
Brown Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 20% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM 6, New 2' x 4' Ceiling Tile Lab ID-Version‡: 20512491-1

Sample Layers	Asbestos Content
Brown Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 20% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM 7, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20512492-1

Sample Layers	Asbestos Content
Gray Carpet	ND
Semi-Transparent Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 8, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20512493-1

Sample Layers	Asbestos Content
Gray Carpet	ND
Semi-Transparent Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. J

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 9, Gray Multi-Color Carpet Square and Mastic Lab ID-Version‡: 20512494-1

Sample Layers	Asbestos Content
Gray Carpet	ND
Semi-Transparent Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 10, Black Cove Base and Mastic Lab ID-Version‡: 20512495-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM 11, Black Cove Base and Mastic Lab ID-Version‡: 20512496-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM 12, Black Cove Base and Mastic Lab ID-Version‡: 20512497-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. J

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 13, Black Carpet Square and Mastic Lab ID-Version‡: 20512498-1

Sample Layers	Asbestos Content
Black Carpet	ND
Semi-Transparent Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 14, Black Carpet Square and Mastic Lab ID-Version‡: 20512499-1

Sample Layers	Asbestos Content
Black Carpet	ND
Semi-Transparent Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 15, Black Carpet Square and Mastic Lab ID-Version‡: 20512500-1

Sample Layers	Asbestos Content
Black Carpet	ND
Semi-Transparent Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 16, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512501-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. J

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 17, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512502-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM 18, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512503-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built


Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. J

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Renee Luna-Trepczynski

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY

www.eurofinsus.com/Built

eurofins | Built Environment Testing

East:(866) 871-1984
West/Central:(800) 651-4802

WEATHER	Fog	Rain	Snow	Wind	Clear
LEVEL None					
Light					
Moderate					
Heavy					

Non-Cul

004110217

CONTACT INFORMATION		
Company:	Dominion Environmental Consultants	Address:20045 N. 19th Ave., Phx, AZ 85027
Contact:	Nick Marcos	Special Instructions:
Phone:	623-516-1415	

PROJECT INFORMATION			
Project ID:	AZ1418.57		
Project Description:	Kyrene Middle School - Bldg. J		
Project Zip Code:		Sampling Date/Time:	6/11/2025
PO Number:	13742	Sampled By:	NM

TURN AROUND TIME CODES - (TAT)	
STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
ND - Next Business Day	
SD - Same Business Day	
WH - Weekend/Holiday/ASAP	

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	Old 2' X 4' Ceiling Tile	B	STD		
PLM 4-6	New 2' X 4' Ceiling Tile	B	STD		
PLM 7-9	Gray Multi-Color Carpet Square and Mastic	B	STD		
PLM 10-12	Black Cove Base and Mastic	B	STD		
PLM 13-15	Black Carpet Square and Mastic	B	STD		
PLM 16-18	Orange Peel D.W. (Paint,tex,tape,j.c.,d.w.)	B	STD		

Spore Trap	Sw

Spore Trap Analysis	Other biological particles - supplement	Direct Microscopic Exam (Qualitative)	Qualitative spore count direct exam	Dust Characterization	1-Media Surface Fungi (Genus ID + *Asp.* spp.)	Culturable Air Fungi (Genus ID + *Asp.* spp.)	Gram Stain and Counts (Culturable Air and Surface Bacteria	*Legionella* culture	Total Coliform, *E.coli* (Presence/Absence)	QuantiTray-Sewage Screen	OTHER: (please specify test)	Asbestos in Air - PCM Airborne Fiber Count (NIOSH 7400)	Asbestos Bulk - PLM (EPA method 600/R-93-116)	Lead (Pb) / Paint Chip	PCR (please specify test)	Allergens (please specify test)
													X			
													X			
													X			
													X			
													X			
													X			

her Requests

SAMPLE TYPE CODES			
BC - BioCassette™	**CP** - Contact Plate	**T** - Tape	**O** - Other:
A1S - Andersen	**ST** - Spore Trap	**SW** - Swab	
SAS - Surface Air Sampler	**B** - Bulk	**SO** - Soil	
NP - Non-potable Water	**P** - Potable Water	**D** - Dust	

RELINQUISHED BY	DATE & TIME
Nick Marcos	6/13/2025

RECEIVED BY	DATE & TIME
Patty Lago	6/13/25 11:53am

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at http://www.emlab.com/s/main/serviceterms.html

Aerobiology Laboratory Associates, Incorporated
Expertise Since 1997

Lab Use: 22039698 9/27/2022

ELITE AZ, CA, CO, FL, GA, VA, NJ | NVLAP AZ, CA, CO, VA | AZ, CA, CO, FL GA, NJ, VA

09/27/22 JV

Aerobiology Client	c395 Dominion Environmental Consultants, Inc.		
Field Contact	Nick Marcos	Collected By/Date: NM 9/27/22	Relinquished By/Date: NM 9/27/22
Reporting Address	20045 N. 19th Ave Building 7 Phoenix AZ 85027	Relinquished By/Date:	Received By/Date: 092722@1121 JV
Billing Address	20045 N. 19th Ave Building 7 Phoenix AZ 85027	Sampler Type: Andersen___ SAS___	SampleAire___ AeroTrap___ Other___ BioCulture___
Phone/Fax	623-516-1414	PO#/Job#: JH: A20959.3201	PO: 292372
Reporting Email (s)	nmarcos@dominion-env.com	Project Name:	Kyrene Middle School
Routine ☒	24 Hour ☐ Same Day ☐ 4 Hour ☐ 2 Hour ☐	Notes:	
SAMPLING LOCATION ZIP CODE		Lab Contacts:	Simone Singh (408) 498-7901 Mandy Palm (858) 444-7138

	Sample No.	Test Code	Sample Location	Total Volume/Area
1	PLM 1-3	3002	White 4"x4" Ceramic Wall tile, Mastic, Grout	
2	4-6	"	Green 4"x4" Ceramic Wall tile	
3	7-9	"	Blue 4"x4" Ceramic Wall tile	
4	10-12	"	Fixture Caulking.	
5	13-15	"	RR Greenboard D.W.	
6	16-18	"	Counter Caulking.	
7				
8				
9				
10				
11				
12				
13				
14				
15				

1054	Direct, Non-viable Spore Trap	1015	Culture - WATER Legionella
1049	Direct, Quantitative- **Swab/Tape**	1017	Culture - SWAB Legionella
1050	Direct, Qualitative- **Bulk**	1010	WATER - Potable - E. coli/total coliforms
1005	AIR Culture - Bacterial Count w/ ID's	1012	SWAB - E. coli/total coliforms
1030	AIR Culture - Fungal Count w/ ID's	1028	SWAB - Sewage Screen (E. coli/Entero/fecal coliforms)
1006	SWAB Culture - Bacterial Count w/ ID's	2056	WATER - Heterotrophic Plate Count
1031	SWAB Culture - Fungal Count w/ ID's	3001	ASBESTOS - Point count
1008	BULK Culture - Bacterial Count w/ ID's	3002	ASBESTOS - PLM Analysis
1033	BULK Culture - Fungal Count w/ ID's	3003	ASBESTOS - Particle characterization
1007	WATER Culture - Bacterial Count w/ID's	3004	ASBESTOS - PCM Analysis

ALL SAMPLES ACCEPTABLE
INIT/DATE 09/27/22 JV

NVLAP
TESTING NVLAP LAB CODE 500097-0

Aerobiology Laboratory Associates, Incorporated
A Pace Analytical® Laboratory

Aerobiology Laboratory Associates, Inc.
2226 W Northern Ave. Suite C-110
Phoenix, AZ 85021
(602) 441-3700
www.aerobiology.net

Certificate of Analysis

Client:
Dominion Environmental Consultants, Inc
20045 N. 19th Ave Building 7
Phoenix, AZ 85027
Attn: Ryan Kuhn

Project Name: 292372/AZ0959.3201 Kyrene Middle School (NM)
Project ID: 22039698

Date Collected:	09/27/2022
Date Received:	09/27/2022
Date Analyzed:	09/27/2022
Date Reported:	09/27/2022

Test Requested: **Asbestos Bulk Analysis, Polarized Light Microscopy (PLM)**: EPA 600/R-93/116 Method for Asbestos in Bulk Building Materials, EPA-40 CFR Appendix E to Subpart E of Part 763, Interim Method for Asbestos in Bulk Insulation Samples

Total Samples Submitted:	18
Total Samples Analyzed:	18
Total Samples with Asbestos (≥1%):	0

Location: PLM-1 White 4"x4" Ceramic Wall Tile, Mastic, Grout Lab ID: 22039698-001

Physical Description of Sample/Layer	Asbestos Detected
White/Cream Tile	ND
Cream Mastic	ND
Gray Grout	ND

Location: PLM-2 White 4"x4" Ceramic Wall Tile, Mastic, Grout Lab ID: 22039698-002

Physical Description of Sample/Layer	Asbestos Detected
White/Cream Tile	ND
Cream Mastic	ND
Gray Grout	ND

Location: PLM-3 White 4"x4" Ceramic Wall Tile, Mastic, Grout Lab ID: 22039698-003

Physical Description of Sample/Layer	Asbestos Detected
White/Cream Tile	ND
Cream Mastic	ND
Gray Grout	ND

Location: PLM-4 Green 4"x4" Ceramic Wall Tile Lab ID: 22039698-004

Physical Description of Sample/Layer	Asbestos Detected
Green/Cream Tile	ND

Location: PLM-5 Green 4"x4" Ceramic Wall Tile Lab ID: 22039698-005

Physical Description of Sample/Layer	Asbestos Detected
Green/Cream Tile	ND

Location: PLM-6 Green 4"x4" Ceramic Wall Tile Lab ID: 22039698-006

Physical Description of Sample/Layer	Asbestos Detected
Green/Cream Tile	ND

Location: PLM-7 Blue 4"x4" Ceramic Wall Tile Lab ID: 22039698-007

Physical Description of Sample/Layer	Asbestos Detected
Emerald Green/White Tile	ND

Elle Teague
Analyst

Elle Teague
Manager-Asbestos

A Amosite
AC Actinolite
AN Anthophyllite
CHRY Chrysotile
CR Crocidolite
TR Tremolite
Trace Less Than 1%
ND None Detected

Non-Asbestos fiber percentage and matrix information available upon request

NVLAP
TESTING NVLAP LAB CODE 500097-0

Aerobiology Laboratory Associates, Incorporated
A Pace Analytical® Laboratory

Aerobiology Laboratory Associates, Inc.
2226 W Northern Ave. Suite C-110
Phoenix, AZ 85021
(602) 441-3700
www.aerobiology.net

Client:
Dominion Environmental Consultants, Inc
20045 N. 19th Ave Building 7
Phoenix, AZ 85027
Attn: Ryan Kuhn

Certificate of Analysis

Project Name: 292372/AZ0959.3201 Kyrene Middle School (NM)

Project ID: 22039698

Date Collected: 09/27/2022
Date Received: 09/27/2022
Date Analyzed: 09/27/2022
Date Reported: 09/27/2022

Test Requested: **Asbestos Bulk Analysis, Polarized Light Microscopy (PLM)**: EPA 600/R-93/116 Method for Asbestos in Bulk Building Materials, EPA-40 CFR Appendix E to Subpart E of Part 763, Interim Method for Asbestos in Bulk Insulation Samples

Location: PLM-8 Blue 4"x4" Ceramic Wall Tile Lab ID: 22039698-008

Physical Description of Sample/Layer	Asbestos Detected
Emerald Green/White Tile	ND

Location: PLM-9 Blue 4"x4" Ceramic Wall Tile Lab ID: 22039698-009

Physical Description of Sample/Layer	Asbestos Detected
Emerald Green/White Tile	ND

Location: PLM-10 Fixture Caulking Lab ID: 22039698-010

Physical Description of Sample/Layer	Asbestos Detected
White Caulk	ND

Location: PLM-11 Fixture Caulking Lab ID: 22039698-011

Physical Description of Sample/Layer	Asbestos Detected
White Caulk	ND

Location: PLM-12 Fixture Caulking Lab ID: 22039698-012

Physical Description of Sample/Layer	Asbestos Detected
White Caulk	ND

Location: PLM-13 RR Greenboard D.W. Lab ID: 22039698-013

Physical Description of Sample/Layer	Asbestos Detected
Brown/Tan/Green Drywall	ND
Cream Mastic	ND

Location: PLM-14 RR Greenboard D.W. Lab ID: 22039698-014

Physical Description of Sample/Layer	Asbestos Detected
Brown/Tan/Green Drywall	ND
Cream Mastic	ND

Location: PLM-15 RR Greenboard D.W. Lab ID: 22039698-015

Physical Description of Sample/Layer	Asbestos Detected
Brown/Tan/Green Drywall	ND
Cream Mastic	ND

Elle Teague
Analyst

Elle Teague
Manager-Asbestos

A Amosite
AC Actinolite
AN Anthophyllite
CHRY Chrysotile
CR Crocidolite
TR Tremolite
Trace Less Than 1%
ND None Detected

Non-Asbestos fiber percentage and matrix information available upon request

TESTING NVLAP LAB CODE 500097-0

Aerobiology Laboratory Associates, Inc.
2226 W Northern Ave. Suite C-110
Phoenix, AZ 85021
(602) 441-3700
www.aerobiology.net

Certificate of Analysis

Client:
Dominion Environmental Consultants, Inc
20045 N. 19th Ave Building 7
Phoenix, AZ 85027
Attn: Ryan Kuhn

Project Name: 292372/AZ0959.3201 Kyrene Middle School (NM)
Project ID: 22039698

Date Collected: 09/27/2022
Date Received: 09/27/2022
Date Analyzed: 09/27/2022
Date Reported: 09/27/2022

Test Requested: **Asbestos Bulk Analysis, Polarized Light Microscopy (PLM)**: EPA 600/R-93/116 Method for Asbestos in Bulk Building Materials, EPA-40 CFR Appendix E to Subpart E of Part 763, Interim Method for Asbestos in Bulk Insulation Samples

Location: PLM-16 Counter Caulking Lab ID: 22039698-016

Physical Description of Sample/Layer	Asbestos Detected
White Caulk	ND

Location: PLM-17 Counter Caulking Lab ID: 22039698-017

Physical Description of Sample/Layer	Asbestos Detected
White Caulk	ND

Location: PLM-18 Counter Caulking Lab ID: 22039698-018

Physical Description of Sample/Layer	Asbestos Detected
White Caulk	ND

Elle Teague
Analyst

Elle Teague
Manager-Asbestos

A Amosite
AC Actinolite
AN Anthophyllite
CHRY Chrysotile
CR Crocidolite
TR Tremolite
Trace Less Than 1%
ND None Detected

Non-Asbestos fiber percentage and matrix information available upon request

Aerobiology Laboratory Associates, Inc.
2226 W Northern Ave. Suite C-110
Phoenix, AZ 85021
(602) 441-3700
www.aerobiology.net

Client:
Dominion Environmental Consultants, Inc
20045 N. 19th Ave Building 7
Phoenix, AZ 85027
Attn: Ryan Kuhn

Certificate of Analysis

Project Name: 292372/AZ0959.3201 Kyrene Middle School (NM)

Project ID: 22039698

Date Collected: 09/27/2022
Date Received: 09/27/2022
Date Analyzed: 09/27/2022
Date Reported: 09/27/2022

General Notes

* **ND** indicates no asbestos was detected.

* The method detection limit is 1%.

* **Trace** or "<1" indicates asbestos was identified in the sample, but the concentration is less than 1%.

* All regulated asbestos minerals (i.e. chrysotile, amosite, crocidolite, anthophyllite, tremolite, and actinolite) were sought in every layer of each sample, but only those asbestos minerals detected are listed. Amosite is the common name for the asbestiform variety of the minerals cummingtonite and grunerite. Crocidolite is the common name used for the asbestiform variety of the mineral riebeckite.

* Tile, vinyl, foam, plastic, and fine powder samples may contain asbestos fibers of such small diameter (< 0.25 microns in diameter) that these fibers cannot be detected by PLM. For such samples, more sensitive analytical methods (e.g. TEM, SEM, and XRD) are recommended if greater certainty about asbestos content is required. Semi-quantitative bulk TEM floor tile analysis is accepted under NESHAP regulations.

* These results are submitted pursuant to Aerobiology Laboratory Associates, Inc.'s current terms and conditions of sale, including the company's standard warranty and limitation of liability provisions. No responsibility or liability is assumed for the manner in which the results are used or interpreted.

* Unless notified in writing to return the samples covered by this report, Aerobiology Laboratory Associates, Inc. will store the samples for a minimum period of thirty (30) days before discarding. A shipping and handling charge will be assessed for the return of any samples.

* Aerobiology does not guarantee the results of tape lifts, microvacs, wipe, and/or debris samples. Accurate analysis cannot be performed due to particle size, media used, and/or amount of material given. Analysis of these materials should be performed by a TEM. A result of ND does not indicate that the sample area does not contain asbestos. It means the analyst could not identify asbestos in the specific sample for the reasons listed above.

Notes Required by NVLAP

* Aerobiology Laboratory shall be responsible for all the information provided in the report, except when information is provided by the customer. Aerobiology Laboratory is not responsible for the sampling activity.

* This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the Federal Government.

* This test report relates only to the items tested or calibrated.

* This report is not valid unless it bears the name of a NVLAP-approved signatory.

* Any reproduction of this document must include the entire document in order for the report to be valid.

eurofins | Built Environment Testing

Report for:

Nick Marcos
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.57; Kyrene Middle School - Bldg. K
EML ID: 4110230

Approved by:



Approved Signatory
Renee Luna-Trepczynski

Dates of Analysis:
Asbestos PLM: 06-18-2025

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. K

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Total Samples Submitted:	18
Total Samples Analyzed:	18
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM 1, Batt Insulation

Lab ID-Version‡: 20512366-1

Sample Layers	Asbestos Content
Brown/Black Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	60% Glass Fibers 15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM 2, Batt Insulation

Lab ID-Version‡: 20512367-1

Sample Layers	Asbestos Content
Brown/Black Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	60% Glass Fibers 15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM 3, Batt Insulation

Lab ID-Version‡: 20512368-1

Sample Layers	Asbestos Content
Brown/Black Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	60% Glass Fibers 15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM 4, 2' x 4' Ceiling Tile

Lab ID-Version‡: 20512369-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	65% Cellulose
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. K

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 5, 2' x 4' Ceiling Tile Lab ID-Version‡: 20512370-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	65% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM 6, 2' x 4' Ceiling Tile Lab ID-Version‡: 20512371-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	65% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM 7, 2' x 2' Ceiling Tile Lab ID-Version‡: 20512372-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	65% Cellulose 5% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 8, 2' x 2' Ceiling Tile Lab ID-Version‡: 20512373-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	65% Cellulose 5% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. K

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 9, 2' x 2' Ceiling Tile Lab ID-Version‡: 20512374-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	65% Cellulose 5% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM 10, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512375-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM 11, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512376-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. K

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 12, Orange Peel D.W. (Paint, Tex, Tape, J.C., D.W.) Lab ID-Version‡: 20512377-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. K

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 13, Gray Multi-Color Carpet Square and Mastic

Lab ID-Version‡: 20512378-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Transparent Mastic	ND
Gray Cementitious Material	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers 2% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM 14, Gray Multi-Color Carpet Square and Mastic

Lab ID-Version‡: 20512379-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Transparent Mastic	ND
Gray Cementitious Material	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers 2% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM 15, Gray Multi-Color Carpet Square and Mastic

Lab ID-Version‡: 20512380-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Transparent Mastic	ND
Gray Cementitious Material	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers 2% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM 16, Blue Cove Base and Mastic

Lab ID-Version‡: 20512381-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. K

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

Location: PLM 17, Blue Cove Base and Mastic

Lab ID-Version‡: 20512382-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM 18, Blue Cove Base and Mastic

Lab ID-Version‡: 20512383-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC
1501 West Knudsen Drive, Phoenix, AZ 85027
(800) 651-4802 www.eurofinsus.com/Built


Client: Dominion Environmental Consultants, Inc.
C/O: Nick Marcos
Re: AZ1418.57; Kyrene Middle School - Bldg. K

Date of Sampling: 06-11-2025
Date of Receipt: 06-13-2025
Date of Report: 06-18-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

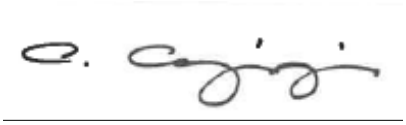

Analyst: Aaron Agajanian

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY

www.eurofinsus.com/Built

eurofins | Built Environment Testing

East:(866) 871-1984
West/Central:(800) 651-4802

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

004110230

CONTACT INFORMATION		
Company:	Dominion Environmental Consultants	Address:20045 N. 19th Ave., Phx, AZ 85027
Contact:	Nick Marcos	Special Instructions:
Phone:	623-516-1415	

PROJECT INFORMATION			
Project ID:	AZ1418.57		
Project Description:	Kyrene Middle School - Bldg. K		
Project Zip Code:		Sampling Date/Time:	6/11/2025
PO Number:	13741	Sampled By:	NM

TURN AROUND TIME CODES - (TAT)	
STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
ND - Next Business Day	
SD - Same Business Day	
WH - Weekend/Holiday/ASAP	

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	Batt Insulation and Backing	B	STD		
PLM 4-6	2' X 4' Ceiling Tile	B	STD		
PLM 7-9	2' X 2' Ceiling Tile	B	STD		
PLM 10-12	Orange Peel D.W. (Paint,tex,tape,j.c.,d.w.)	B	STD		
PLM 13-15	Gray Multi-Color Carpet Square and Mastic	B	STD		
PLM 16-18	Blue Cove Base and Mastic	B	STD		

Non-Culturable

Other Requests

Spore Trap	Swab	Spore Trap Analysis	Other biological particles - supplement	Direct Microscopic Exam (Qualitative)	Qualitative spore count direct exam	Dust Characterization	1-Media Surface Fungi (Genus ID + *Asp.* spp.)	Culturable Air Fungi (Genus ID + *Asp.* spp.)	Gram Stain and Counts (Culturable Air and Surface Bact	*Legionella* culture	Total Coliform, *E.coli* (Presence/Absence)	QuantiTray-Sewage Screen	OTHER: (please specify test)		Asbestos in Air - PCM Airborne Fiber Count (NIOSH 740	Asbestos Bulk - PLM (EPA method 600/R-93-116)	Lead (Pb) / Paint Chip	PCR (please specify test)	Allergens (please specify test)	
																X				
																X				
																X				
																X				
																X				
																X				

SAMPLE TYPE CODES			
BC - BioCassette™	**CP** - Contact Plate	**T** - Tape	**O** - Other:
A1S - Andersen	**ST** - Spore Trap	**SW** - Swab	
SAS - Surface Air Sampler	**B** - Bulk	**SO** - Soil	
NP - Non-potable Water	**P** - Potable Water	**D** - Dust	

RELINQUISHED BY	DATE & TIME
Nick Marcos	6/13/2025


RECEIVED BY	DATE & TIME
Patty Lago	6/13/25 11:53am

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at http://www.emlab.com/s/main/serviceterms.html

SECTION 10

♦

ASSUMED ACBM LOCATION MAPS

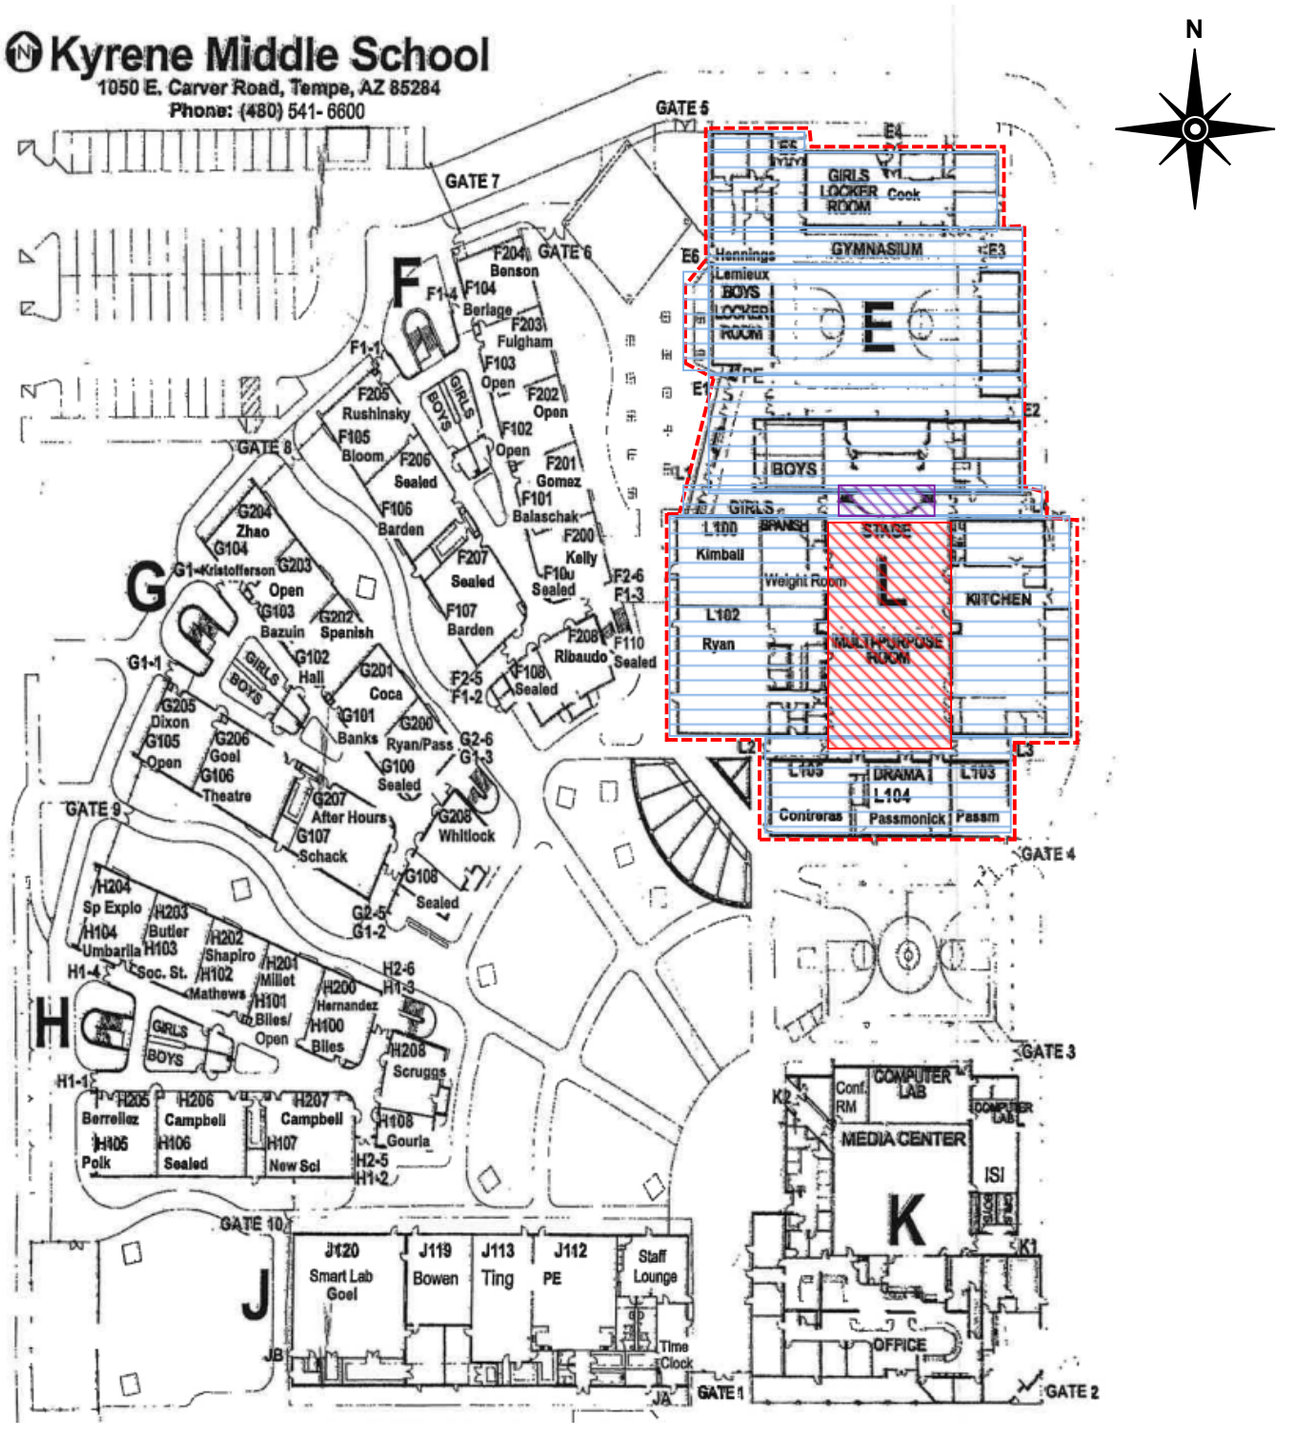

Assumed Asbestos-Containing
Brick & Mortar

Assumed Asbestos-Containing

Tacboard, Brown 6" x 6" Ceramic
Floor Tile, Grout, & Thinset,
Interior Caulking, &
Exterior Caulking

Assumed Asbestos-Containing
White w/Black 12" x 12" VCT
& Mastic


Assumed Asbestos-Containing
Black 12" x 12" VCT & Mastic
& Black Stair Tread & Mastic

Assumed Asbestos-Containing Material Location Map (1)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building E/L

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

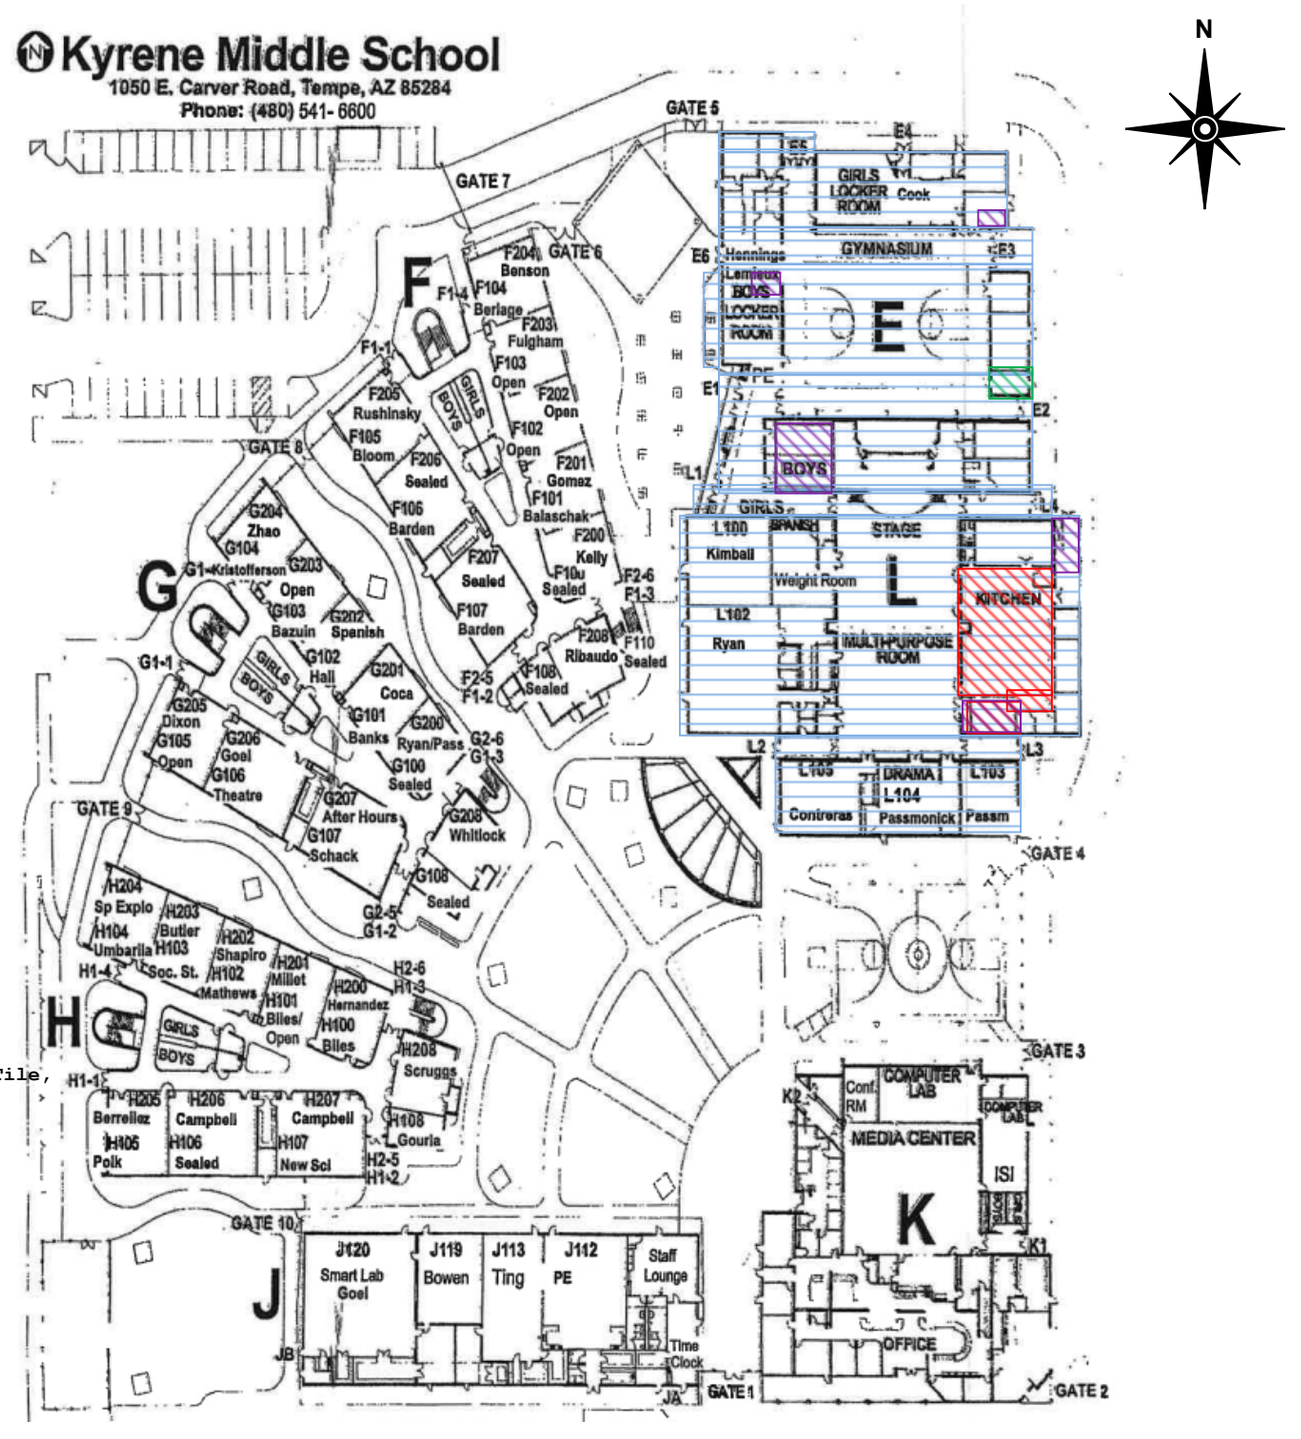


Assumed Asbestos-Containing Material Location Map (2)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building E/L

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

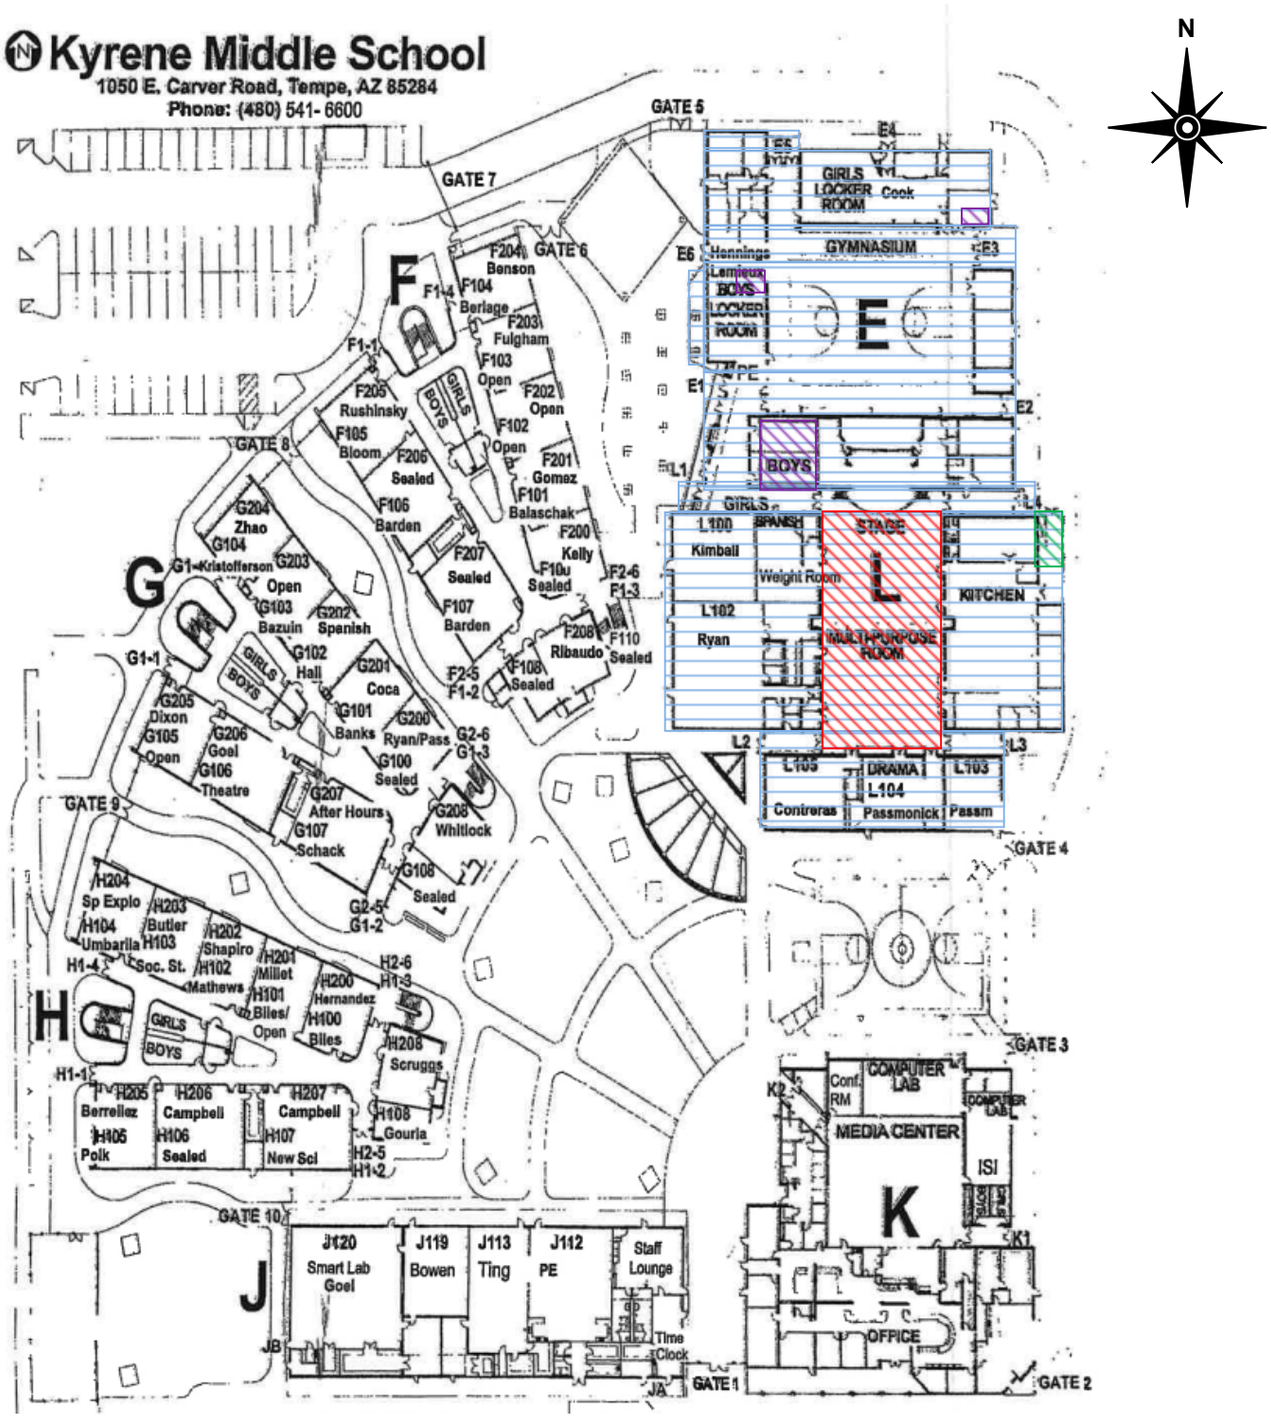

Assumed Asbestos-Containing
Fixture Caulking & Blue
4" x 4" Ceramic
Wall Tile

Assumed Asbestos-Containing


Tan 2" x 2" Ceramic Floor Tile,
Grout, & Thinset, Green
2" x 2" Ceramic Floor Tile,
Blue 2" x 2" Ceramic Floor Tile,
& Marble Threshold

Assumed Asbestos-Containing
Divider Wall

Assumed Asbestos-Containing
White w/Brown 4" x 4" Ceramic
Wall Tile, Grout, & Mastic
Green 4" x 4" Ceramic
Wall Tile, & Tan 4" x 4" Ceramic
Wall Tile, Grout, & Mastic


Assumed Asbestos-Containing Material Location Map (3) — Project No. AZ1418.57
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284 — Building E/L

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

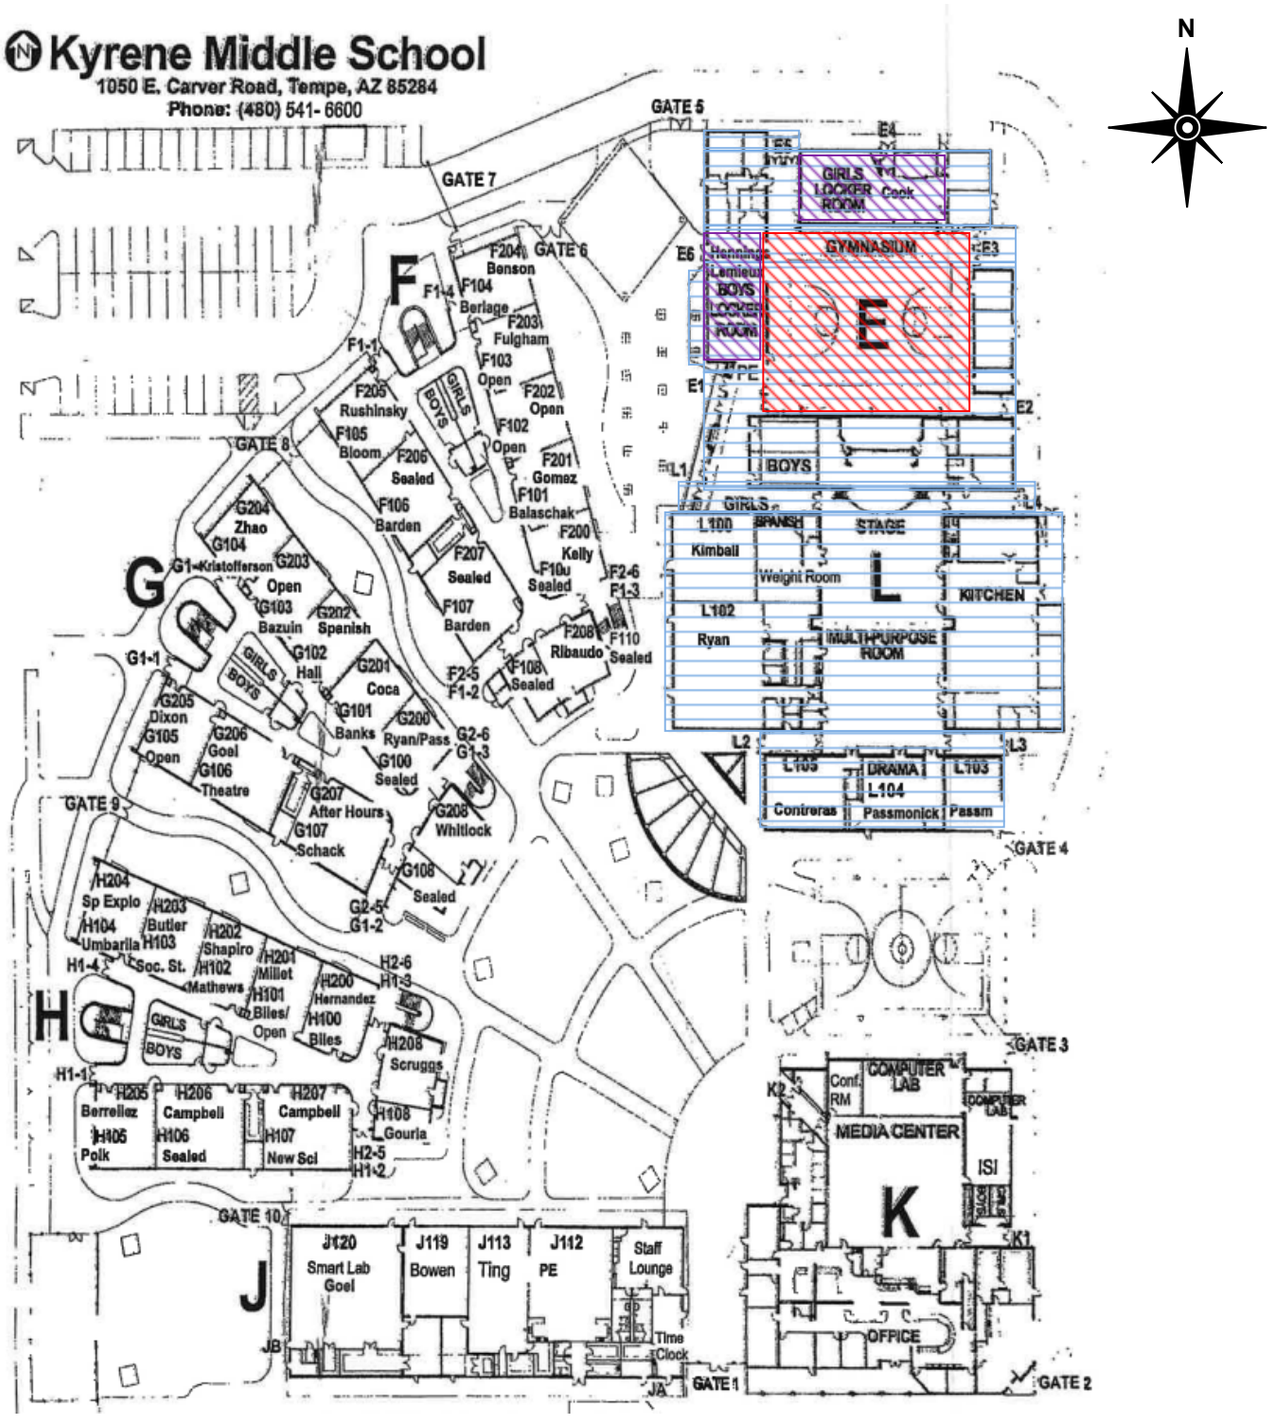

Assumed Asbestos-Containing Material Location Map (4) — Project No. AZ1418.57
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284 — Building E/L

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

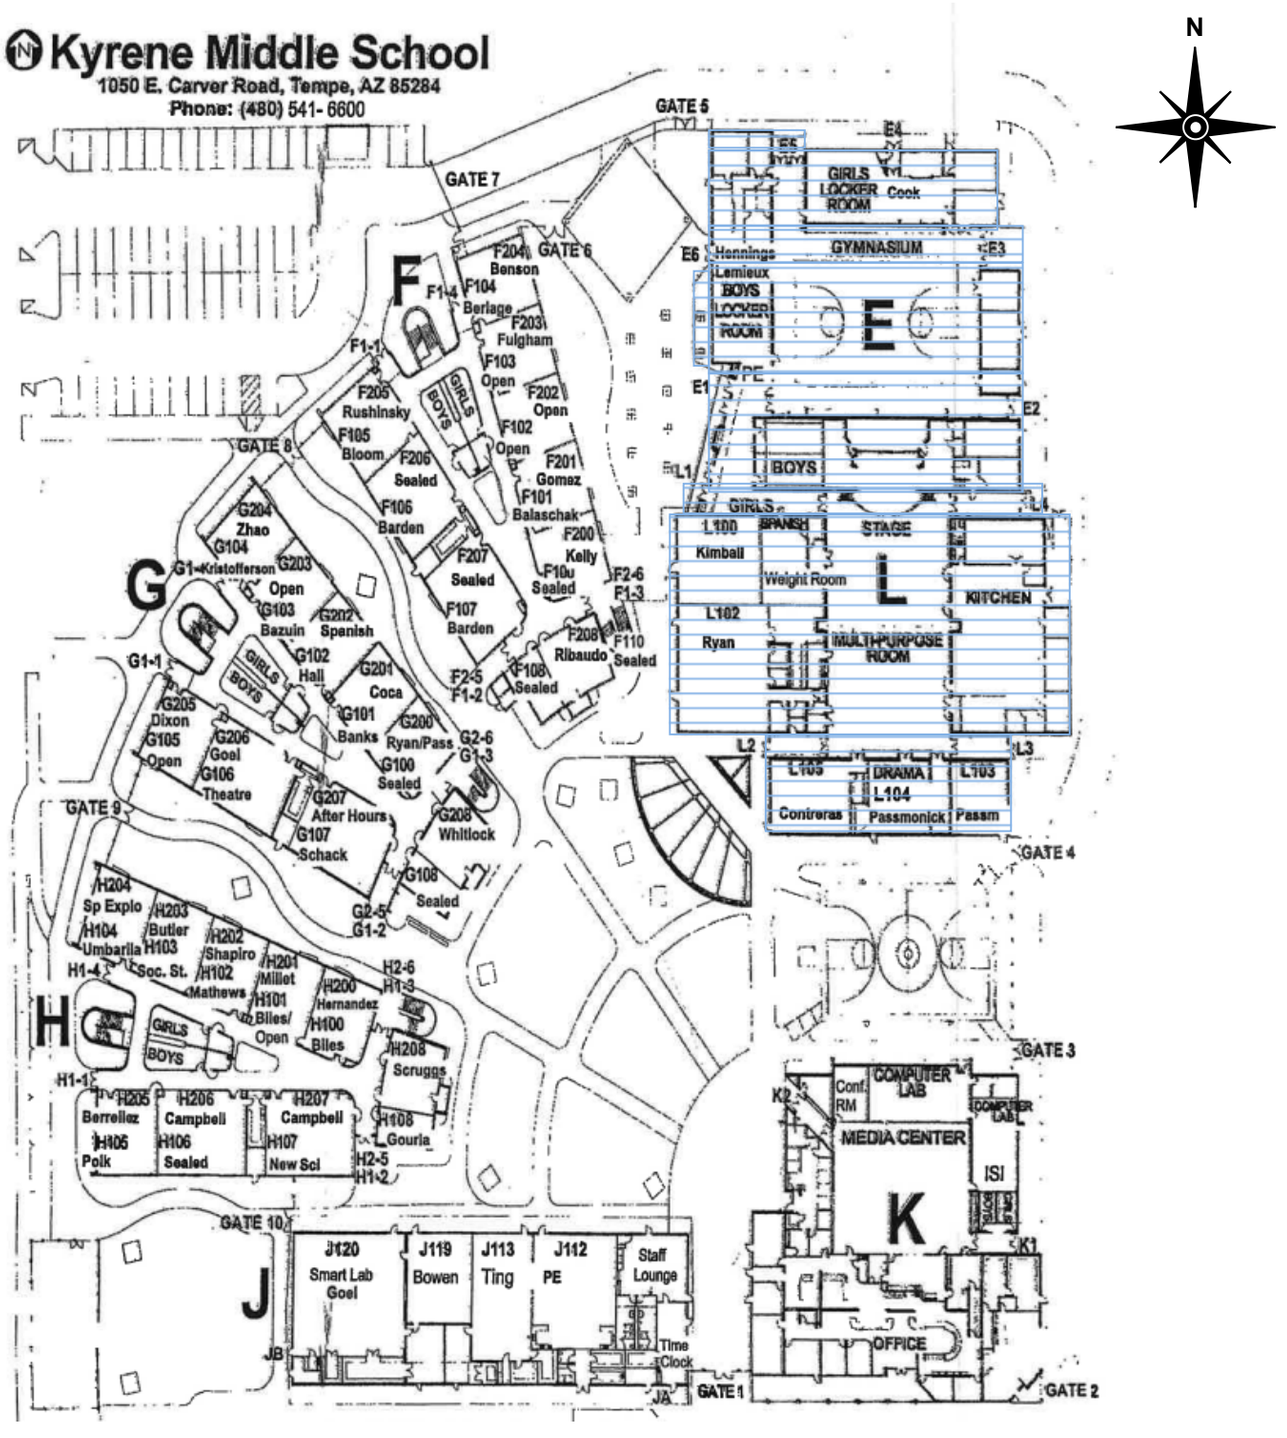


Assumed Asbestos-Containing

Skylight Insulation Panel,
Silver Flex Duct Wrap,
Large Silver Duct Wrap,
Small Silver Duct Wrap,
Unfinished Drywall System,
Gray Duct Mastic,
Black Foam Pipe Insulation,
White Pipe Wrap & Mastic

*** Above the Ceiling**

Assumed Asbestos-Containing Material Location Map (5) — Project No. AZ1418.57
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284 — Building E/L

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

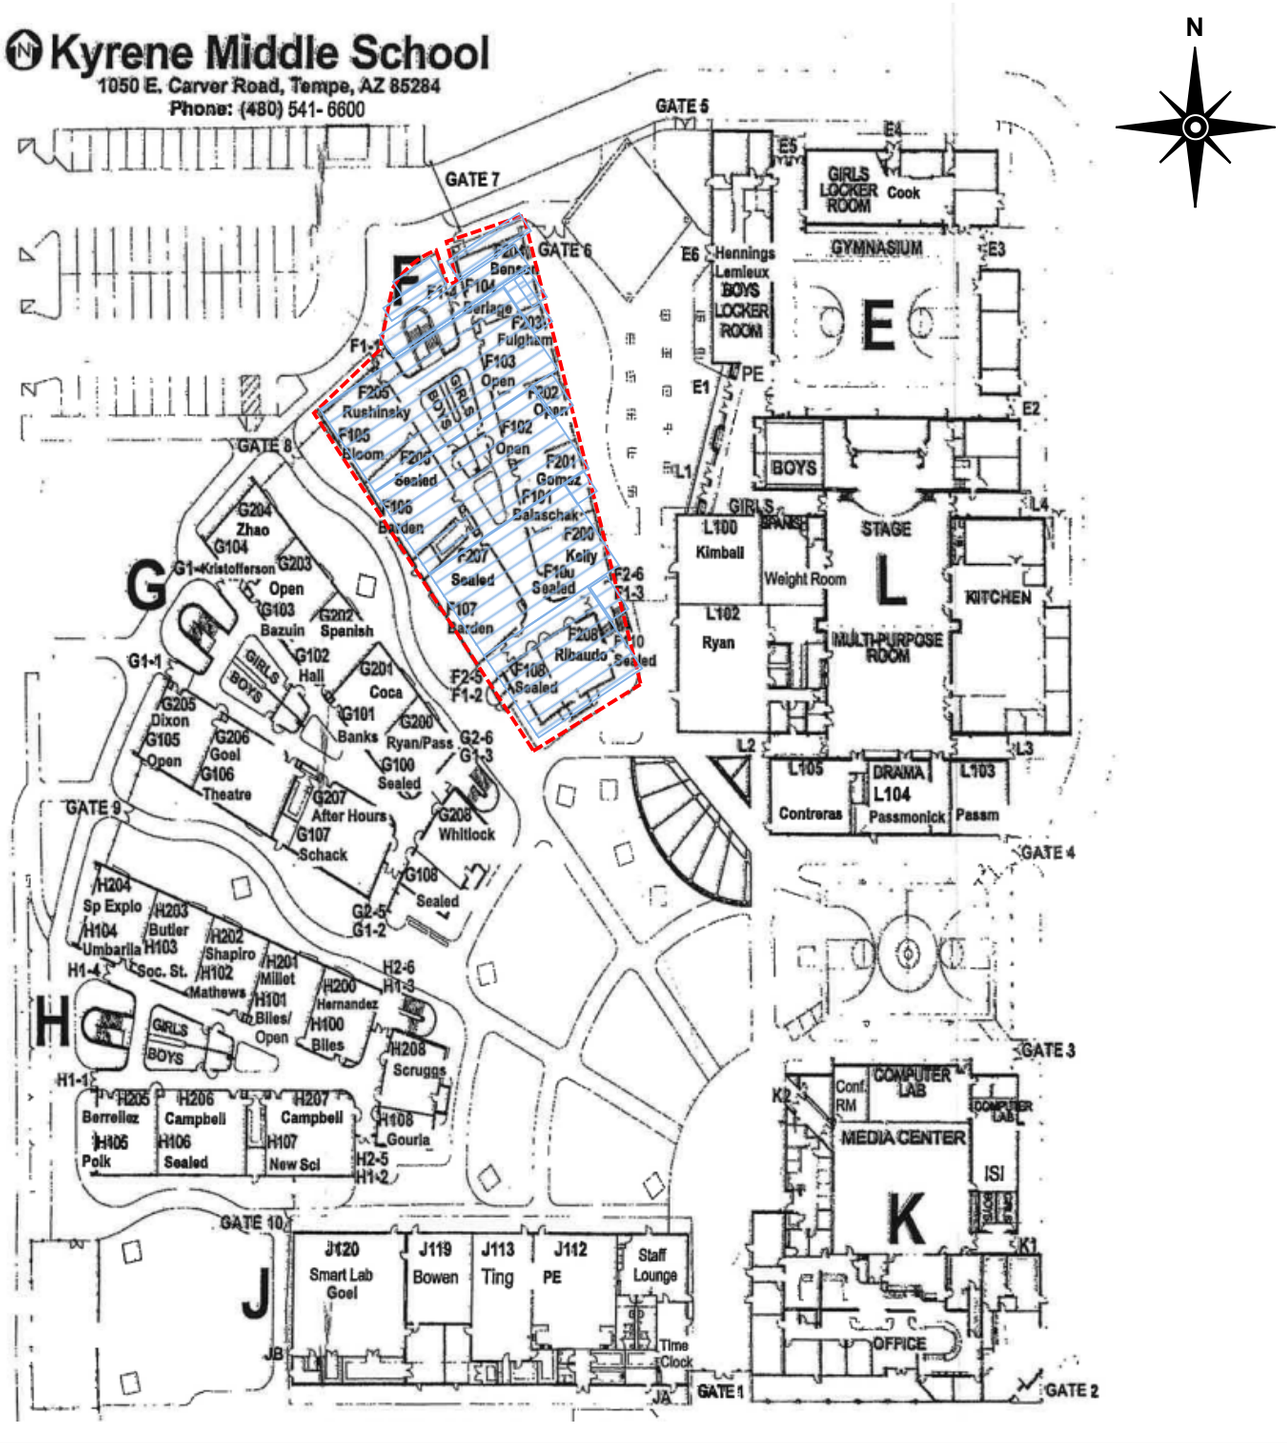

Assumed Asbestos-Containing

Divider Wall, Gray Sink Coating, Glass Block Mortar, Brick & Mortar, Tacboard, Tan 4" x 4" Ceramic Wall Tile, Grout, & Mastic, Blue 4" x 4" Ceramic Wall Tile, Green 4" x 4" Ceramic Wall Tile, Tan 2" x 2" Ceramic Floor Tile, Grout, & Thinset, Blue 2" x 2" Ceramic Floor Tile, & Green 2" x 2" Ceramic Floor Tile

---

Assumed Asbestos-Containing Exterior Caulking

Assumed Asbestos-Containing Material Location Map (1)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building F

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415



Assumed Asbestos-Containing


Interior Caulking,
Fixture Caulking, FRP & Mastic,
Gray 20 " x 20" Floor Tile &
Mastic, & Knockdown
Drywall System

Assumed Asbestos-Containing

Gray Stair Tread & Mastic

Assumed Asbestos-Containing Material Location Map (2) — Project No. AZ1418.57
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284 — Building F

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

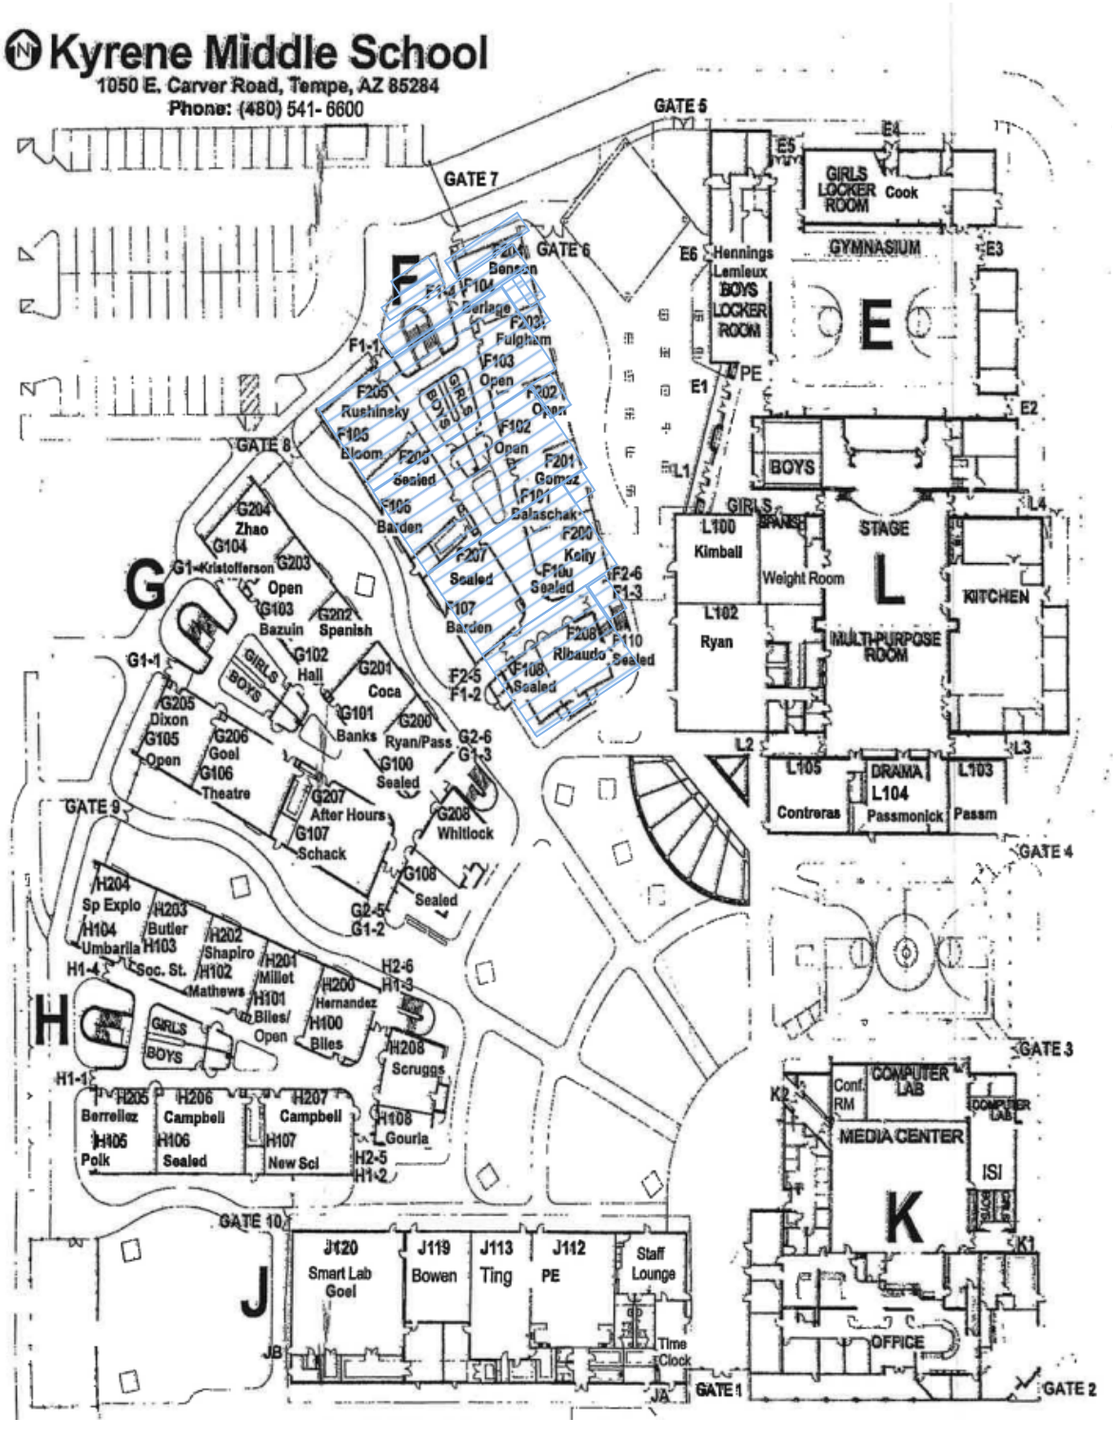


Assumed Asbestos-Containing

Silver Flex Duct Wrap,
Silver Box Duct Wrap,
Gray Duct Mastic,
Unfinished Drywall System,
Black Foam Pipe Insulation,
White Pipe Wrap & Insulation,
& Skylight Insulation Panel

* Above the Ceiling

Assumed Asbestos-Containing Material Location Map (3) — Project No. AZ1418.57
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284 — Building F

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

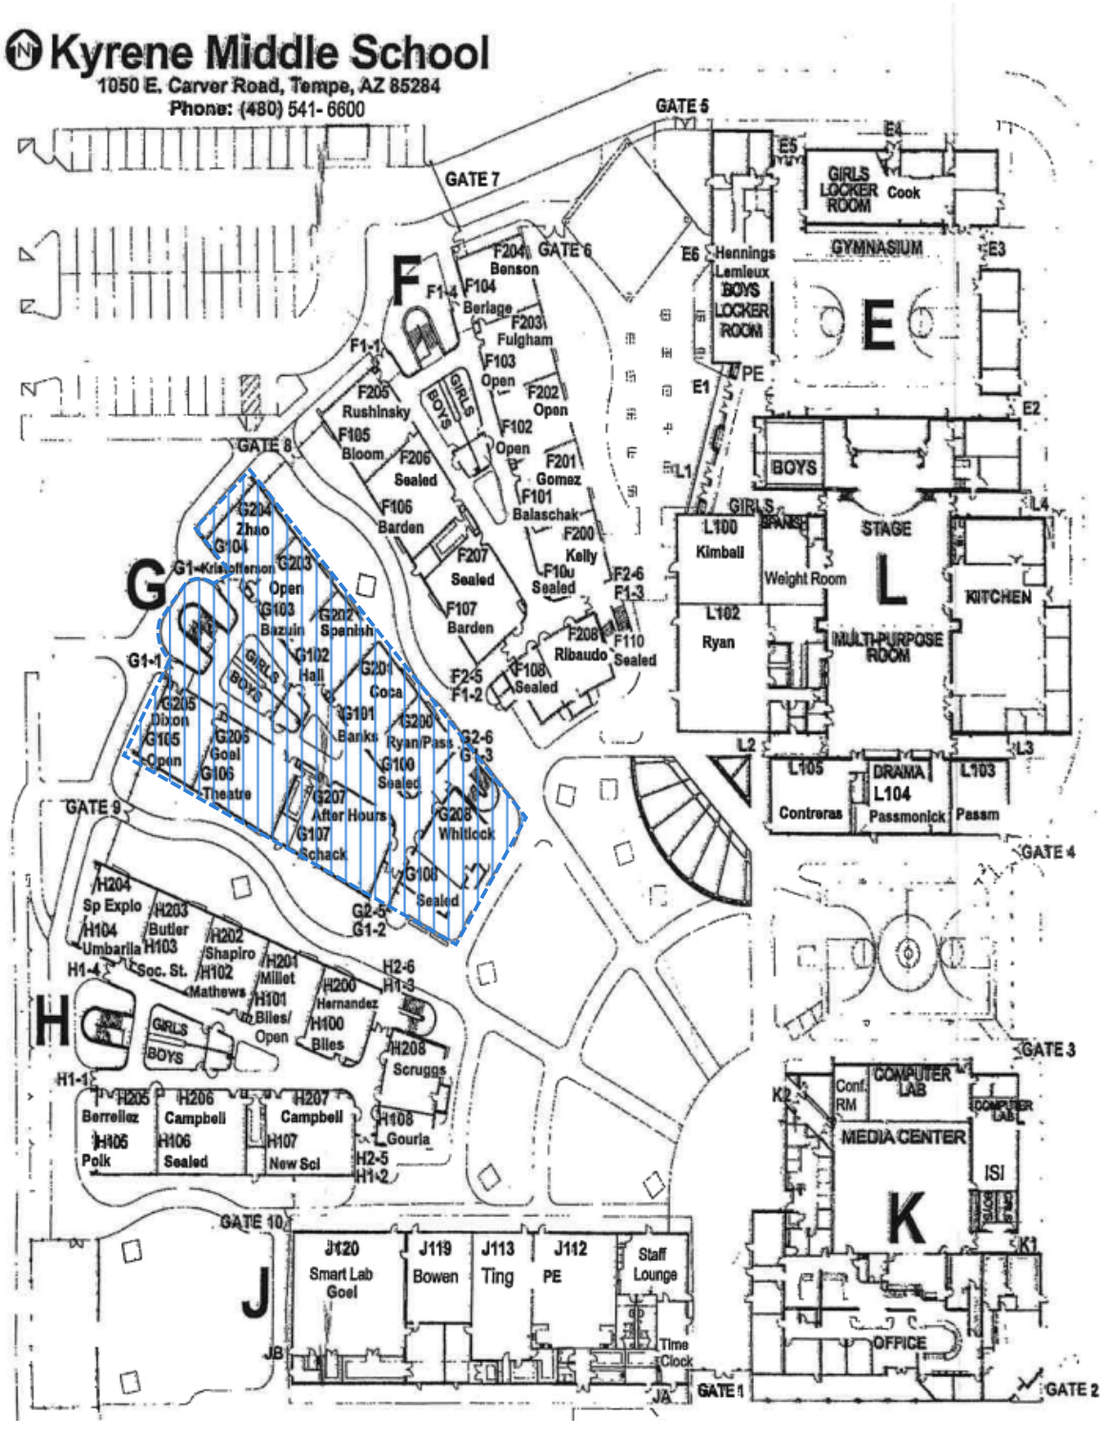


Assumed Asbestos-Containing

Divider Wall, Tacboard, Interior Caulking, White Sink Coating, White w/Black 12" x 12" VCT & Mastic, Brick & Mortar, Tan 4" x 4" Ceramic Wall Tile, Grout, & Mastic, Green 4" x 4" Ceramic Wall Tile, & Blue 4" x 4" Ceramic Wall Tile

Assumed Asbestos-Containing Exterior Caulking

Assumed Asbestos-Containing Material Location Map (1) — Project No. AZ1418.57
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284 — Building G

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

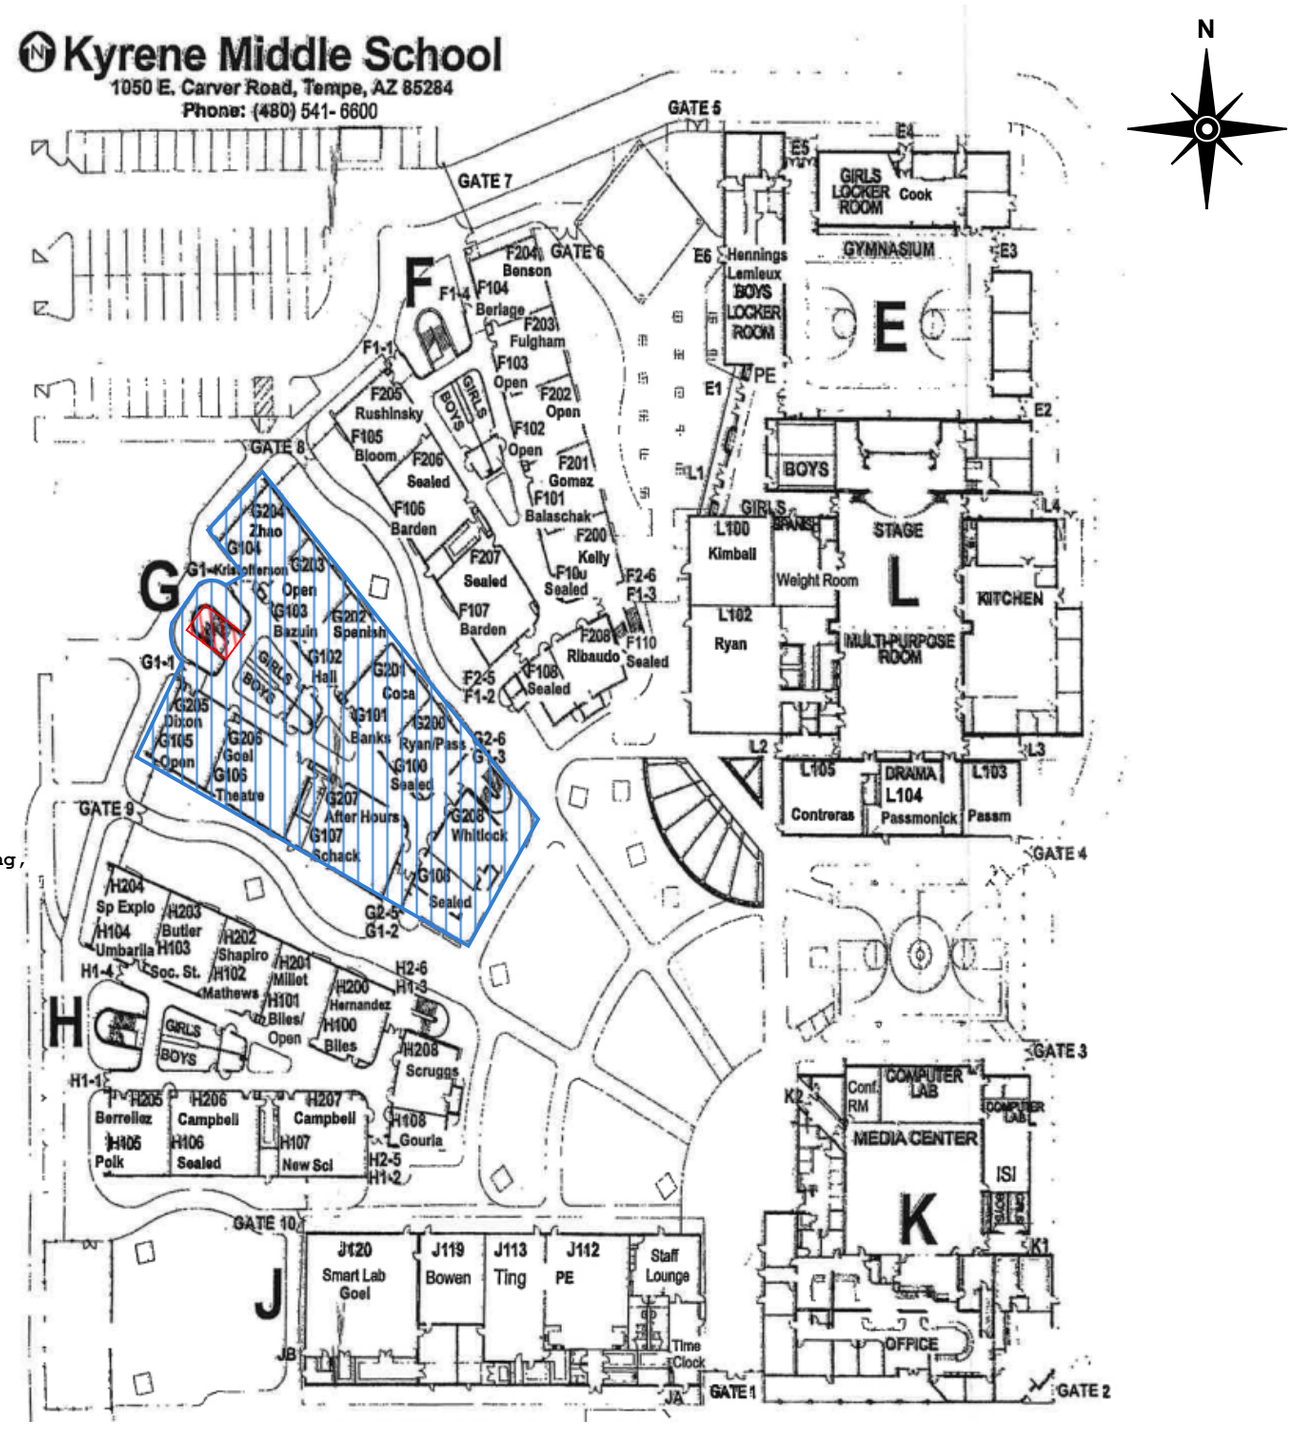

Assumed Asbestos-Containing

Tan 2" x 2" Ceramic Floor Tile, Grout, & Thinset, Green 2" x 2" Ceramic Floor Tile, Blue 2" x 2" Ceramic Floor Tile, Marble Threshold, Fixture Caulking, Knockdown Drywall System, Brown FRP & Mastic, Terrazo Mop Sink, & Glass Block Mortar


Assumed Asbestos-Containing Black Stair Tread & Mastic

Assumed Asbestos-Containing Material Location Map (2)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building G

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

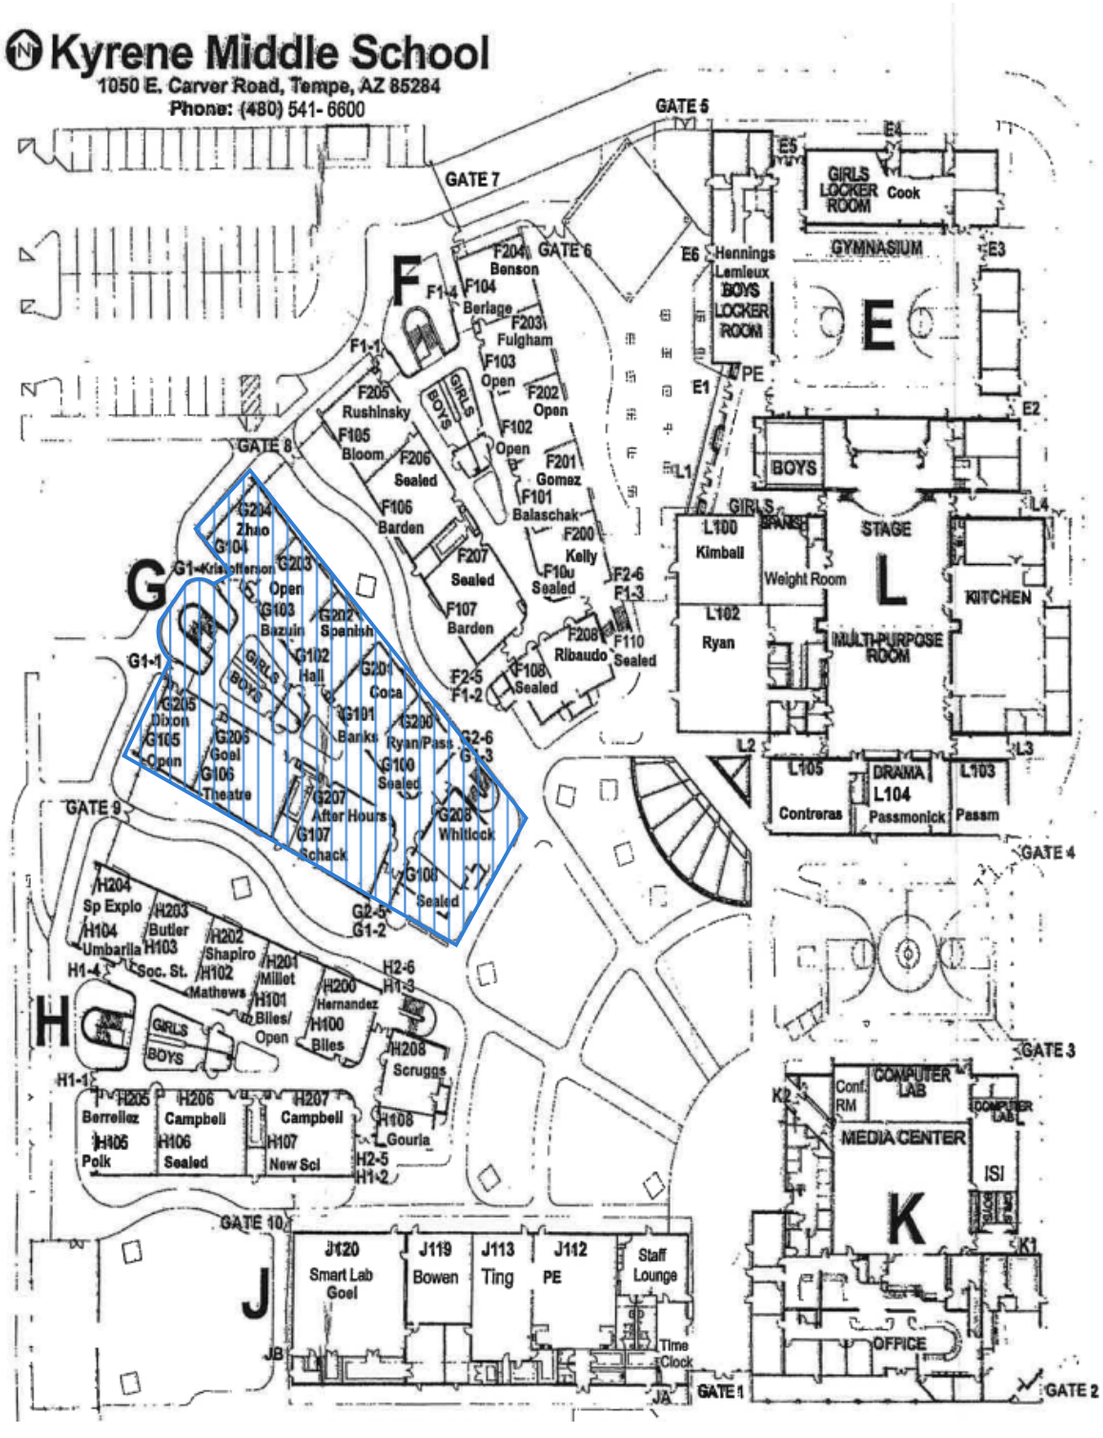

Assumed Asbestos-Containing

Skylight Insulation Panel,
Silver Flex Duct Wrap,
Silver Box Duct Wrap,
Gray Duct Mastic,
Unfinished Drywall System,
Black Foam Pipe Insulation,
White Pipe Wrap & Mastic


*Above the Ceiling

Assumed Asbestos-Containing Material Location Map (3)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building G

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

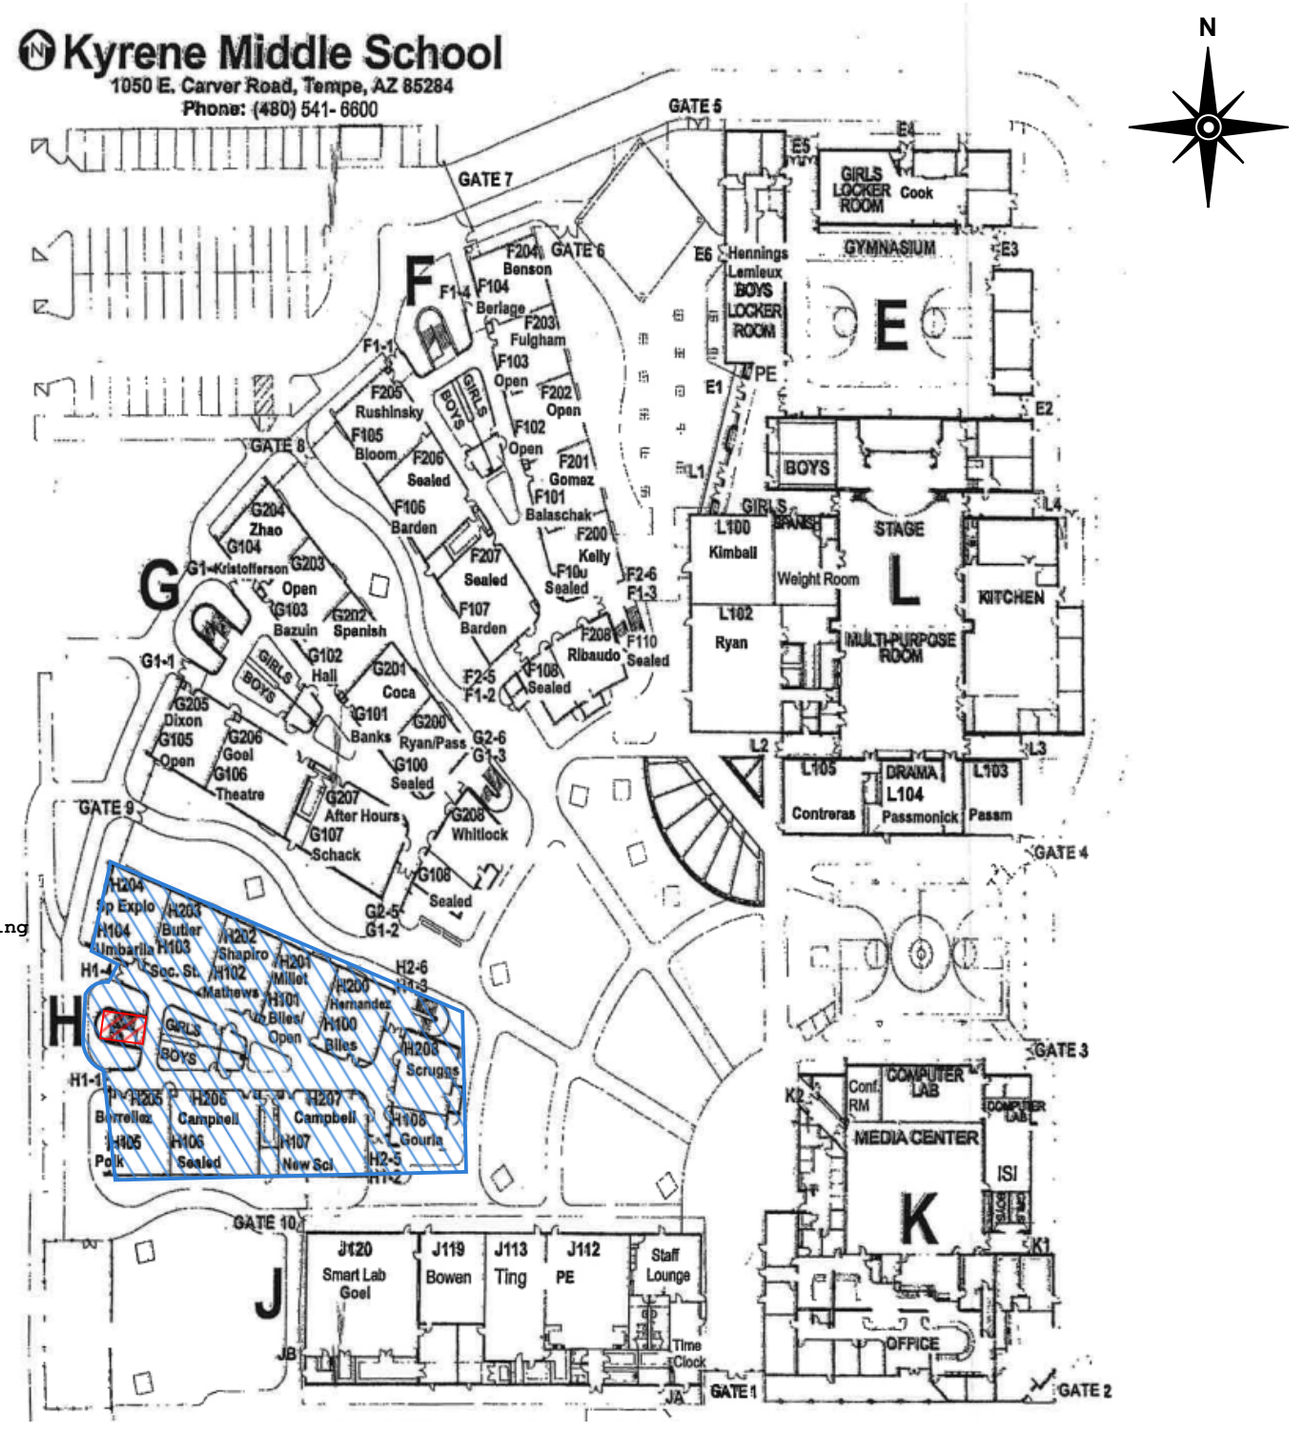


Assumed Asbestos-Containing

Tan 2" x 2" Ceramic Floor Tile, Grout, & Thinset, Green 2" x 2" Ceramic Floor Tile, Blue 2" x 2" Ceramic Floor Tile, Knockdown Drywall System, White Sink Coating, Glass Block Mortar, Marble Threshold,& Fixture Caulking

Assumed Asbestos-Containing
Black Stair Tread & Mastic

Assumed Asbestos-Containing Material Location Map (1) — Project No. AZ1418.57
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284 — Building H

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

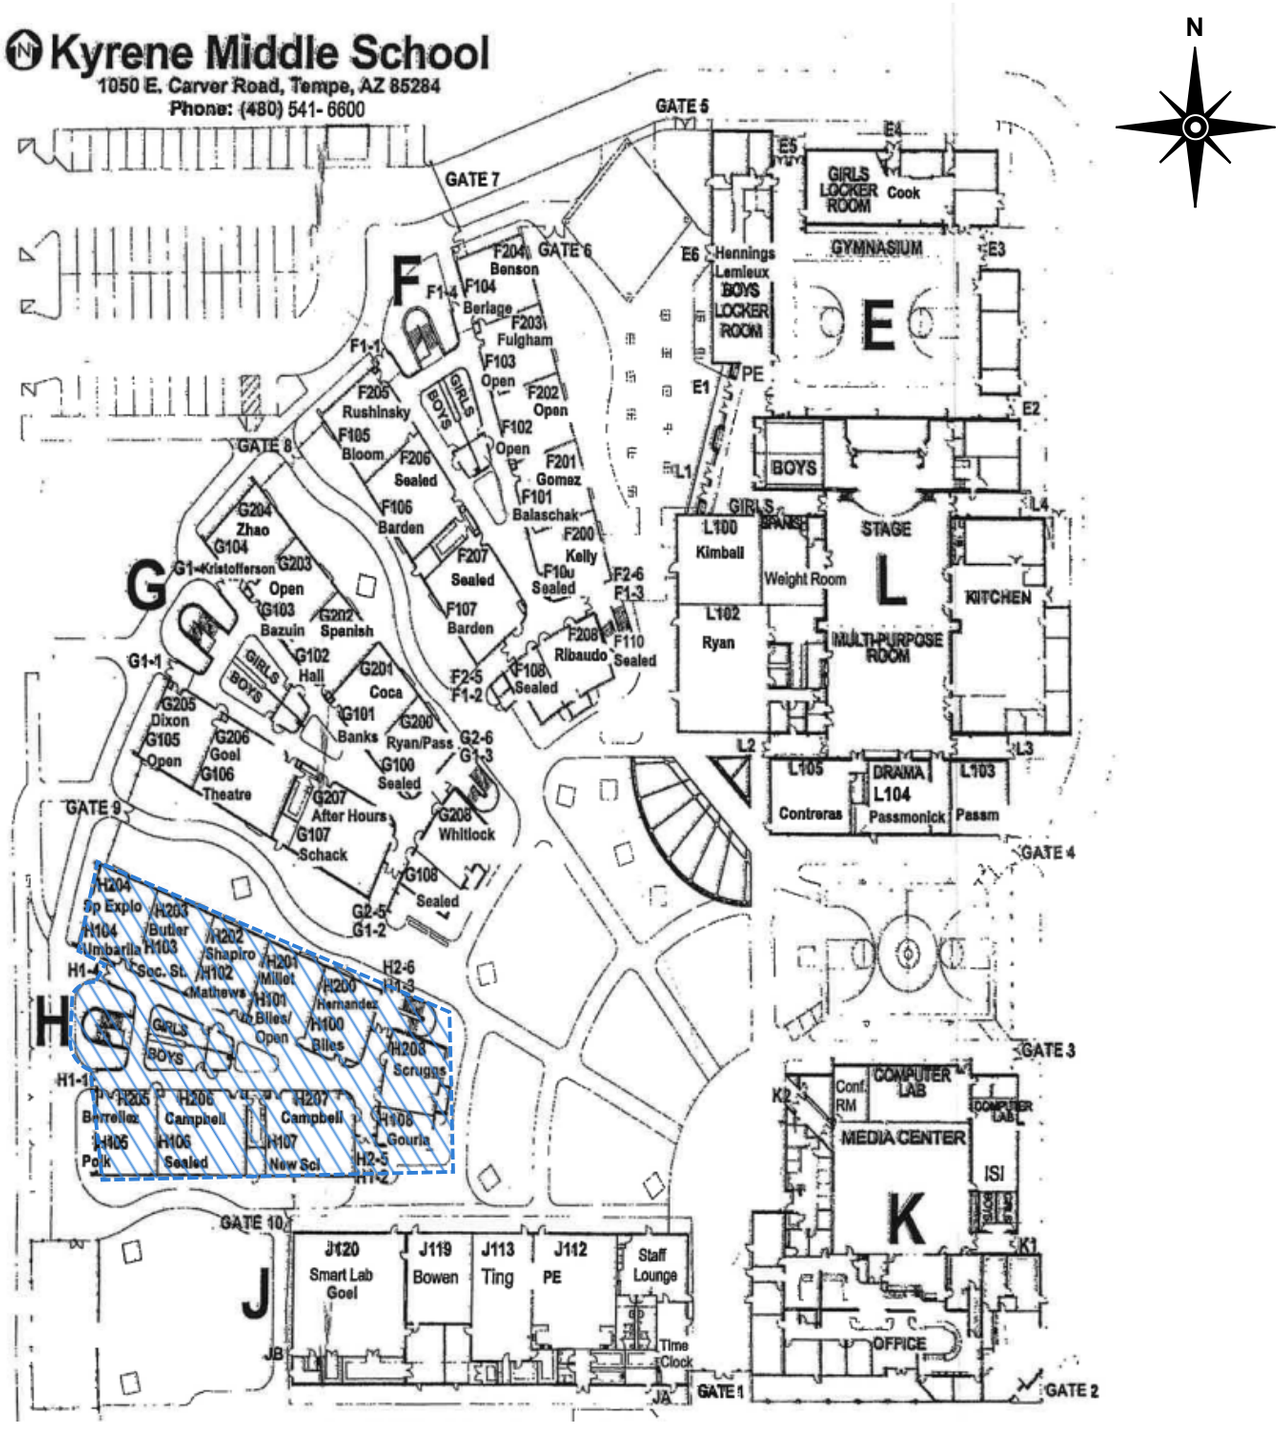

Assumed Asbestos-Containing

White w/Black 12" x 12" VCT & Mastic, Interior Caulking, Gray Sink Coating, Divider Wall, Brick & Mortar, Tacboard, Tan 4" x 4" Ceramic Wall Tile, Grout, & Thinset, Green 4" x 4" Ceramic Wall Tile, Blue 4" x 4" Ceramic Wall Tile, Black Cove Base & Mastic, & Black 20" x 20" Floor Tile & Mastic


Assumed Asbestos-Containing Exterior Caulking

Assumed Asbestos-Containing Material Location Map (2)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building H

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

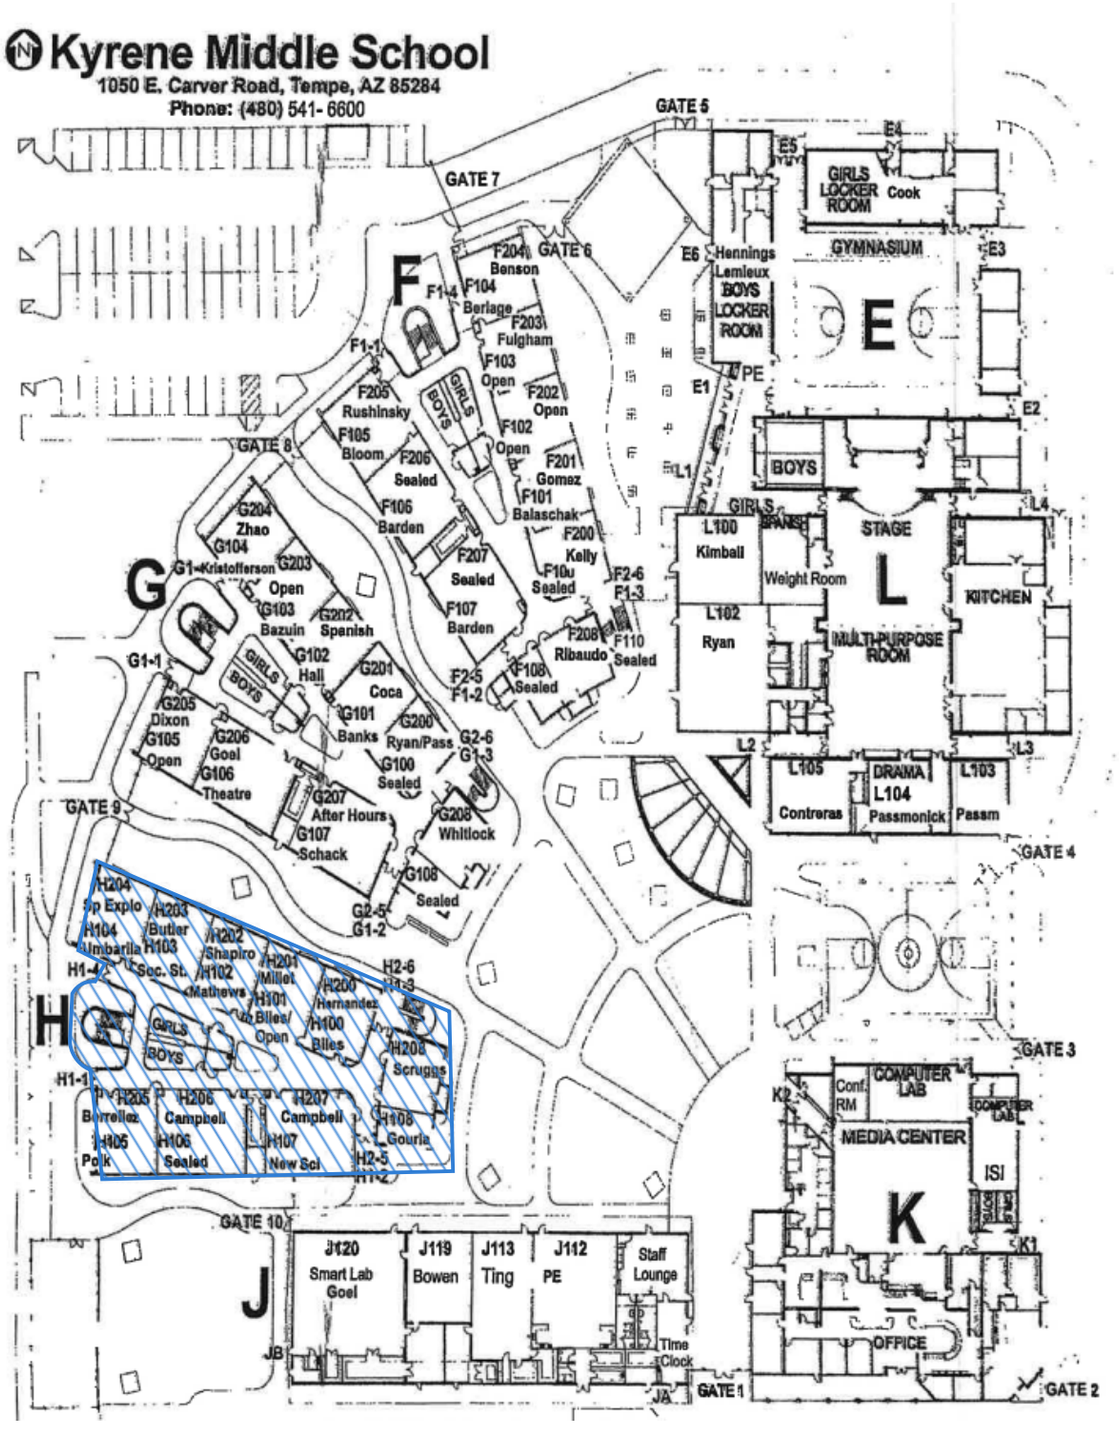


Assumed Asbestos-Containing

Skylight Insulation Panel,
Silver Flex Duct Wrap,
Silver Box Duct Wrap,
Gray Duct Mastic,
Unfinished Drywall System,
Black Foam Pipe Insulation,
& White Pipe Wrap & Mastic

* Above the Ceiling

Assumed Asbestos-Containing Material Location Map (3) — Project No. AZ1418.57
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284 — Building H

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

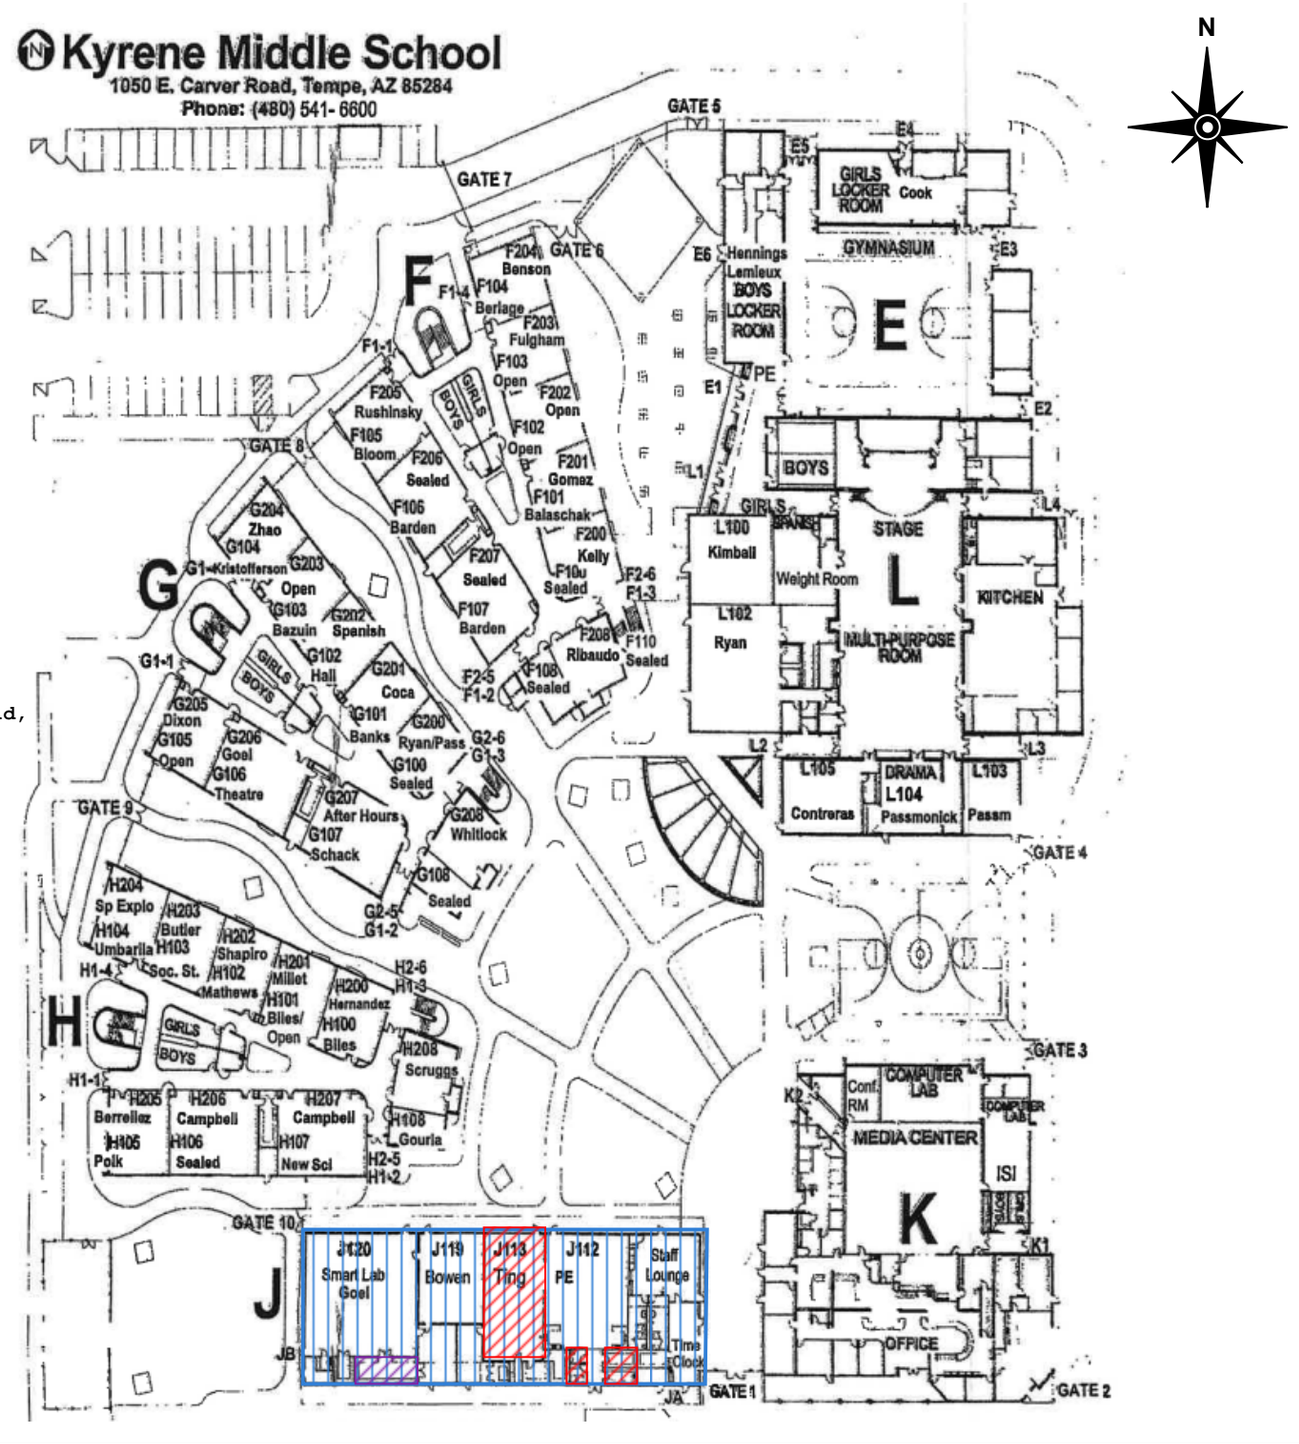

Assumed Asbestos-Containing

Tan 2" x 2" Ceramic Floor Tile, Grout, & Thinset, Green 2" x 2" Ceramic Floor Tile, Blue 2" x 2" Ceramic Floor Tile, Fixture Caulking, Marble Threshold, Tacboard, & Brick & Mortar

Assumed Asbestos-Containing
Blue Cove Base & Mastic


Assumed Asbestos-Containing
Knockdown Drywall System

Assumed Asbestos-Containing Material Location Map (1)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building J

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

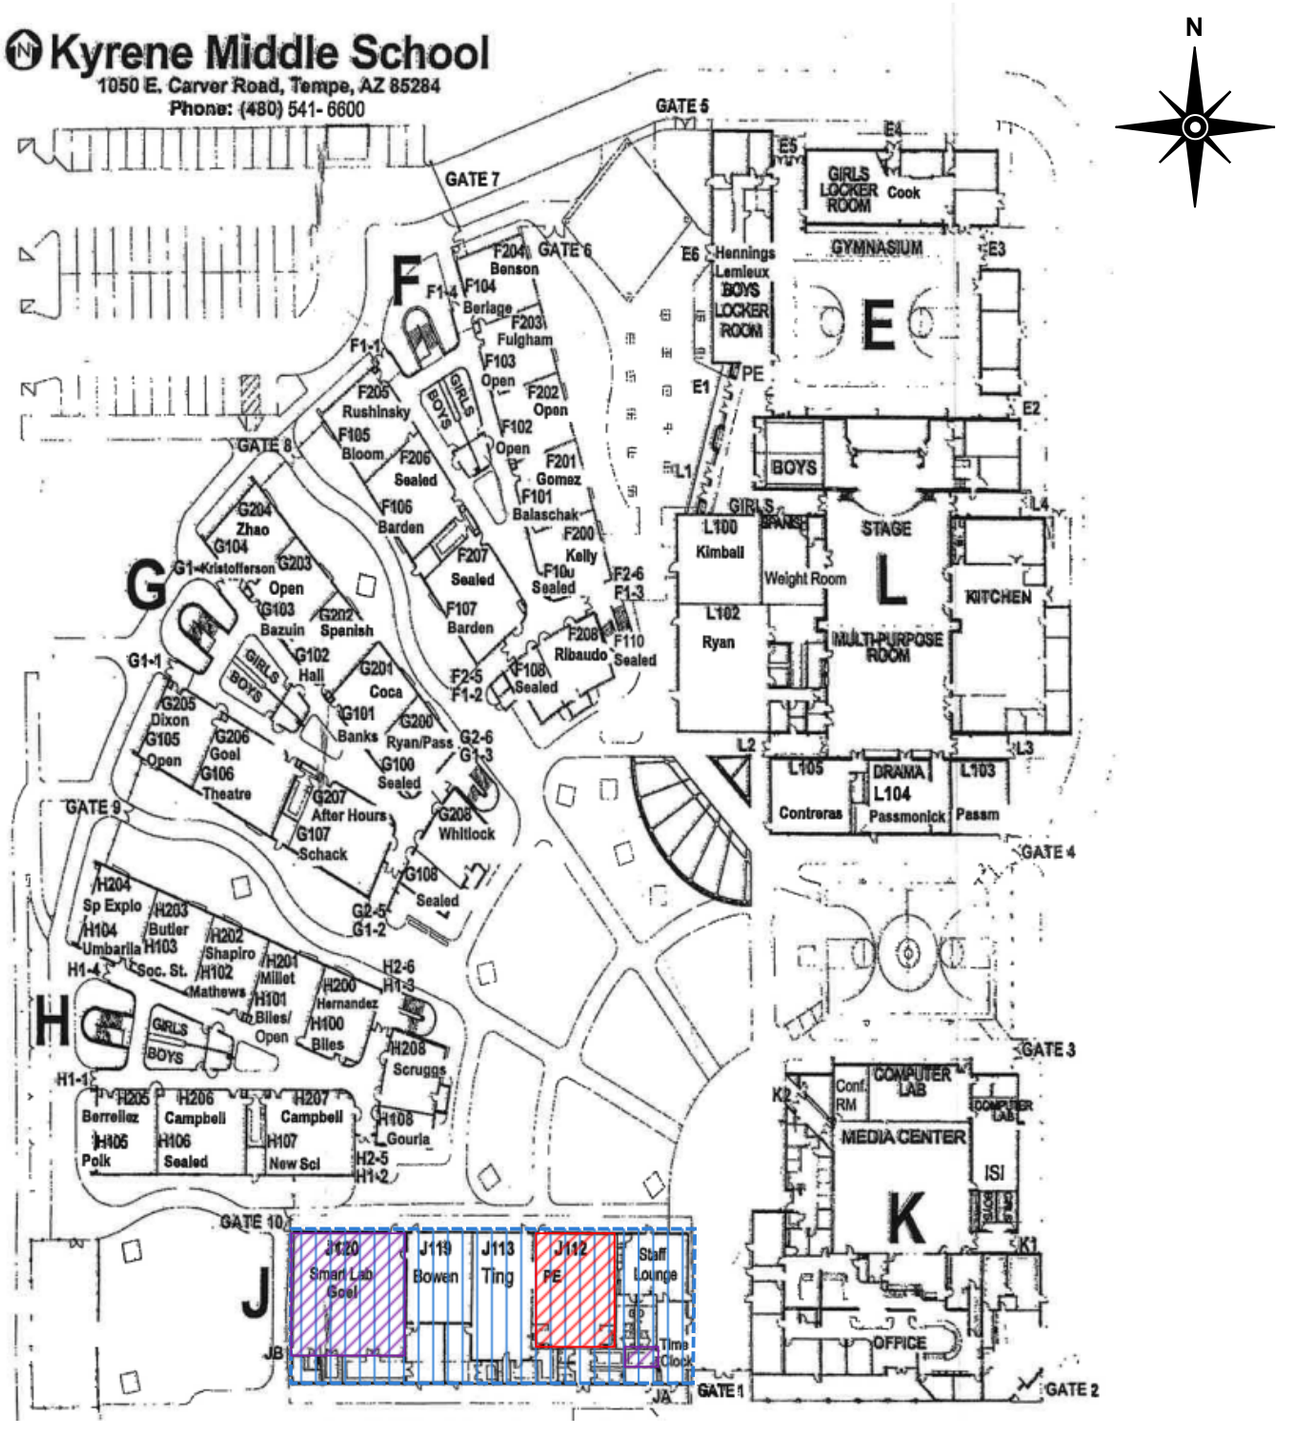

Assumed Asbestos-Containing
Exterior Caulking

Assumed Asbestos-Containing

FRP & Mastic, Gray Sink Coating,
Interior Caulking,
Tan 4" x 4" Ceramic Wall Tile,
Grout, & Thinset, Green 4" x 4"
Ceramic Wall Tile, & Blue 4" x 4"
Ceramic Wall Tile

Assumed Asbestos-Containing
Gray 12" x 12" VCT & Mastic


Assumed Asbestos-Containing
Tan Multicolored 12" x 12"
VCT & Mastic

Assumed Asbestos-Containing Material Location Map (2)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building J

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

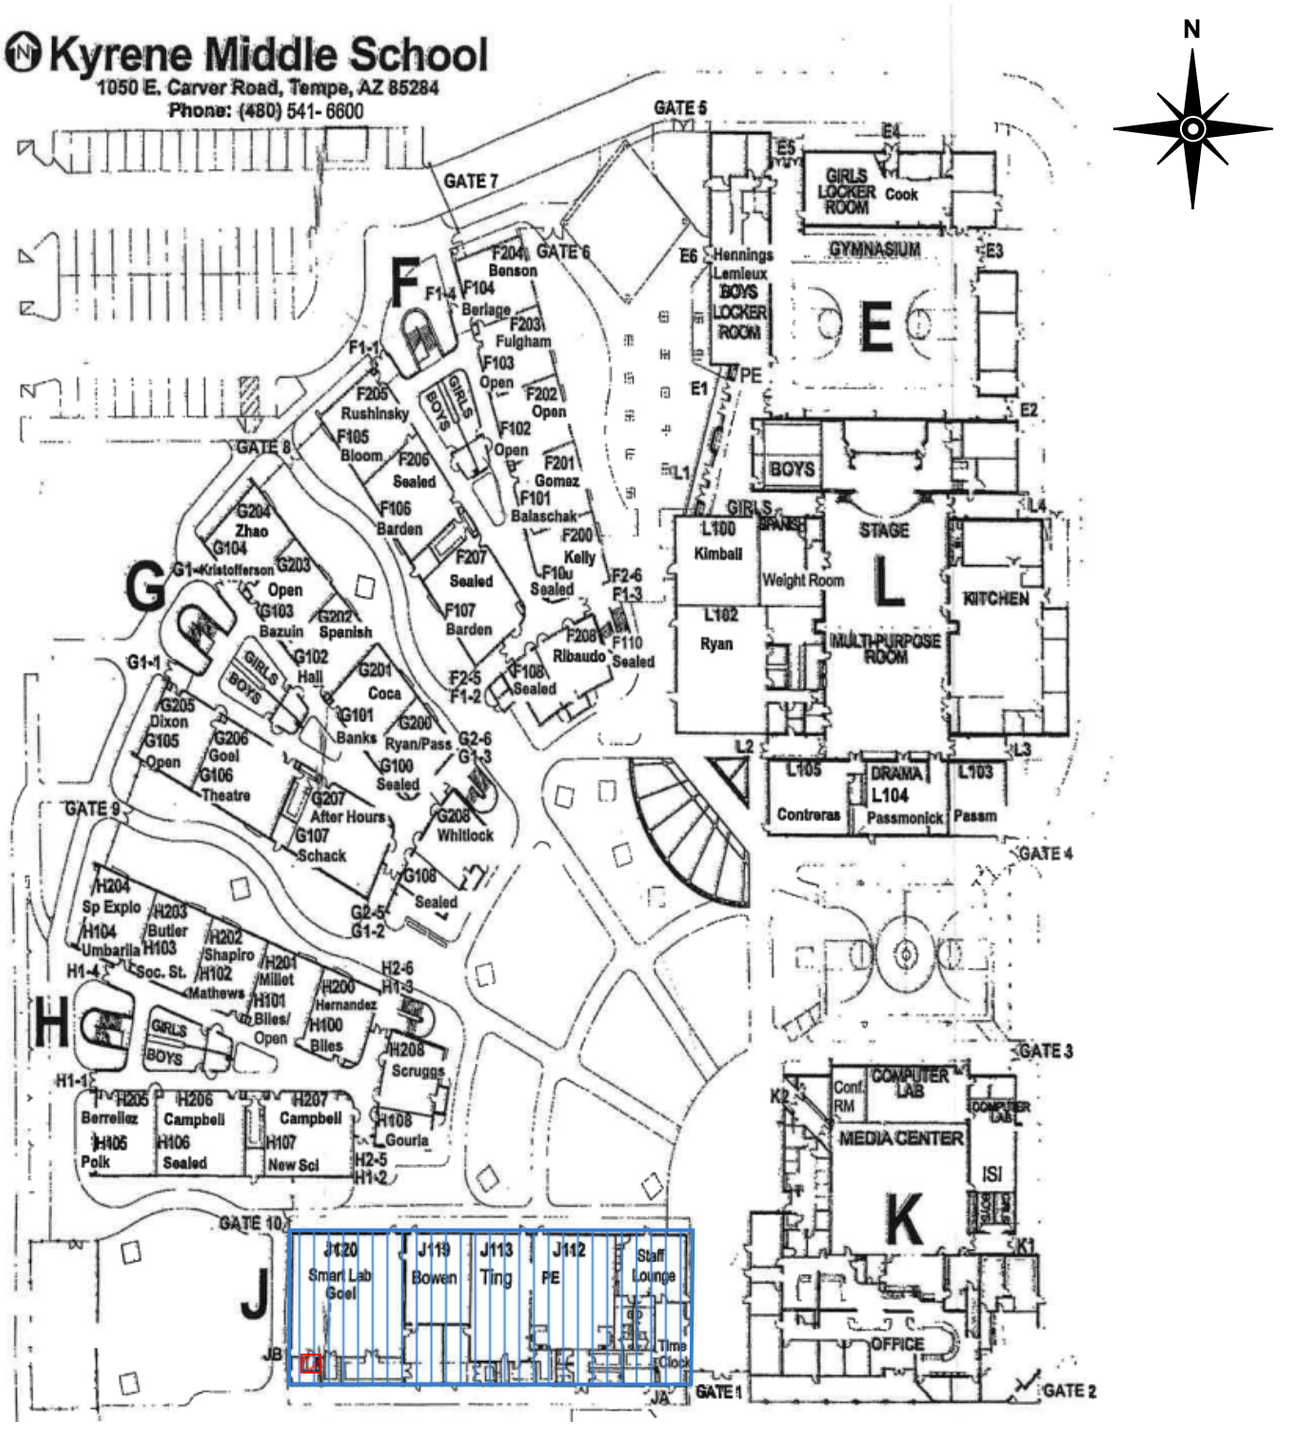

Assumed Asbestos-Containing


Skylight Insulation Panel,
Large Silver Flex Duct Wrap,
Silver Box Duct Wrap,
Gray Duct Mastic,
Unfinished Drywall System,
Black Foam Pipe Insulation,
White Pipe Wrap & Mastic, &
Residual 12" x 12" Ceiling
Tile Mastic

* Above the Ceiling

Assumed Asbestos-Containing
Gray Floor Coating &
White 6" x 6" Ceramic Wall Tile,
Grout, & Mastic

Assumed Asbestos-Containing Material Location Map (3) — Project No. AZ1418.57
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284 — Building J

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

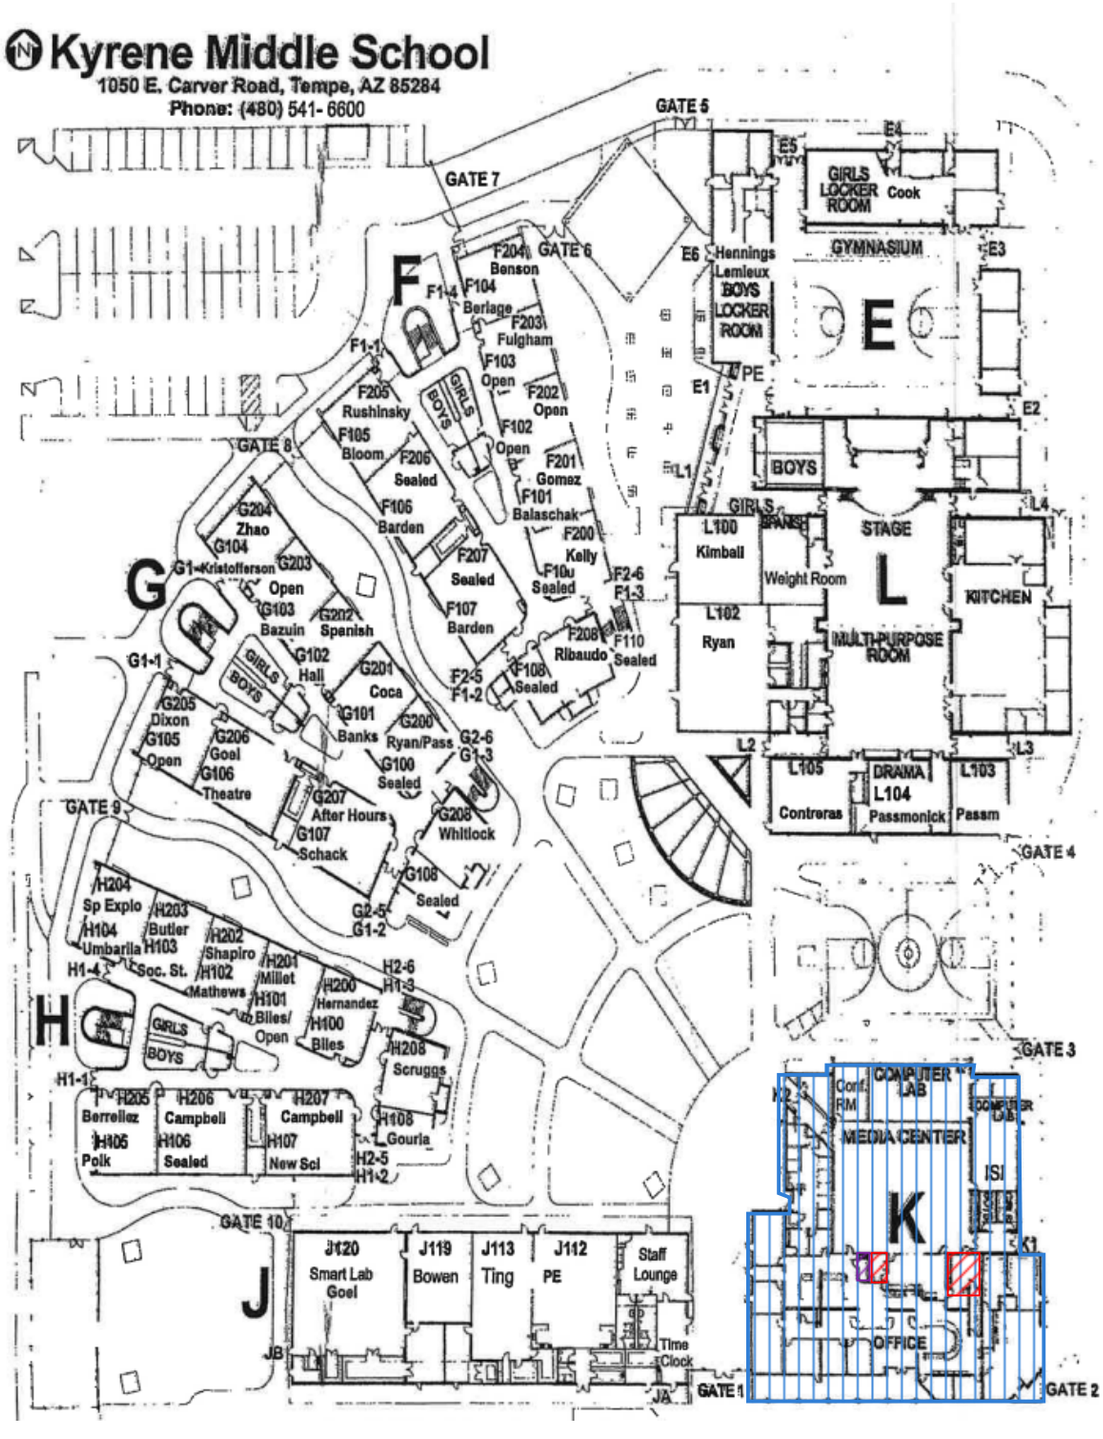

Assumed Asbestos-Containing

Tan 2" x 2" Ceramic Floor Tile, Grout, & Thinset, Green 2" x 2" Ceramic Floor Tile, Blue 2" x 2" Ceramic Floor Tile, Marble Threshold, Wallpaper, Brick & Mortar, White w/Black 12" x 12" VCT & Mortar, & Interior Caulking

Assumed Asbestos-Containing Gray Carpet Square & Mastic


Assumed Asbestos-Containing Beige Multicolored 12" x 12" VCT & Mastic

Assumed Asbestos-Containing Material Location Map (1)
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284

Project No. AZ1418.57

Building K

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

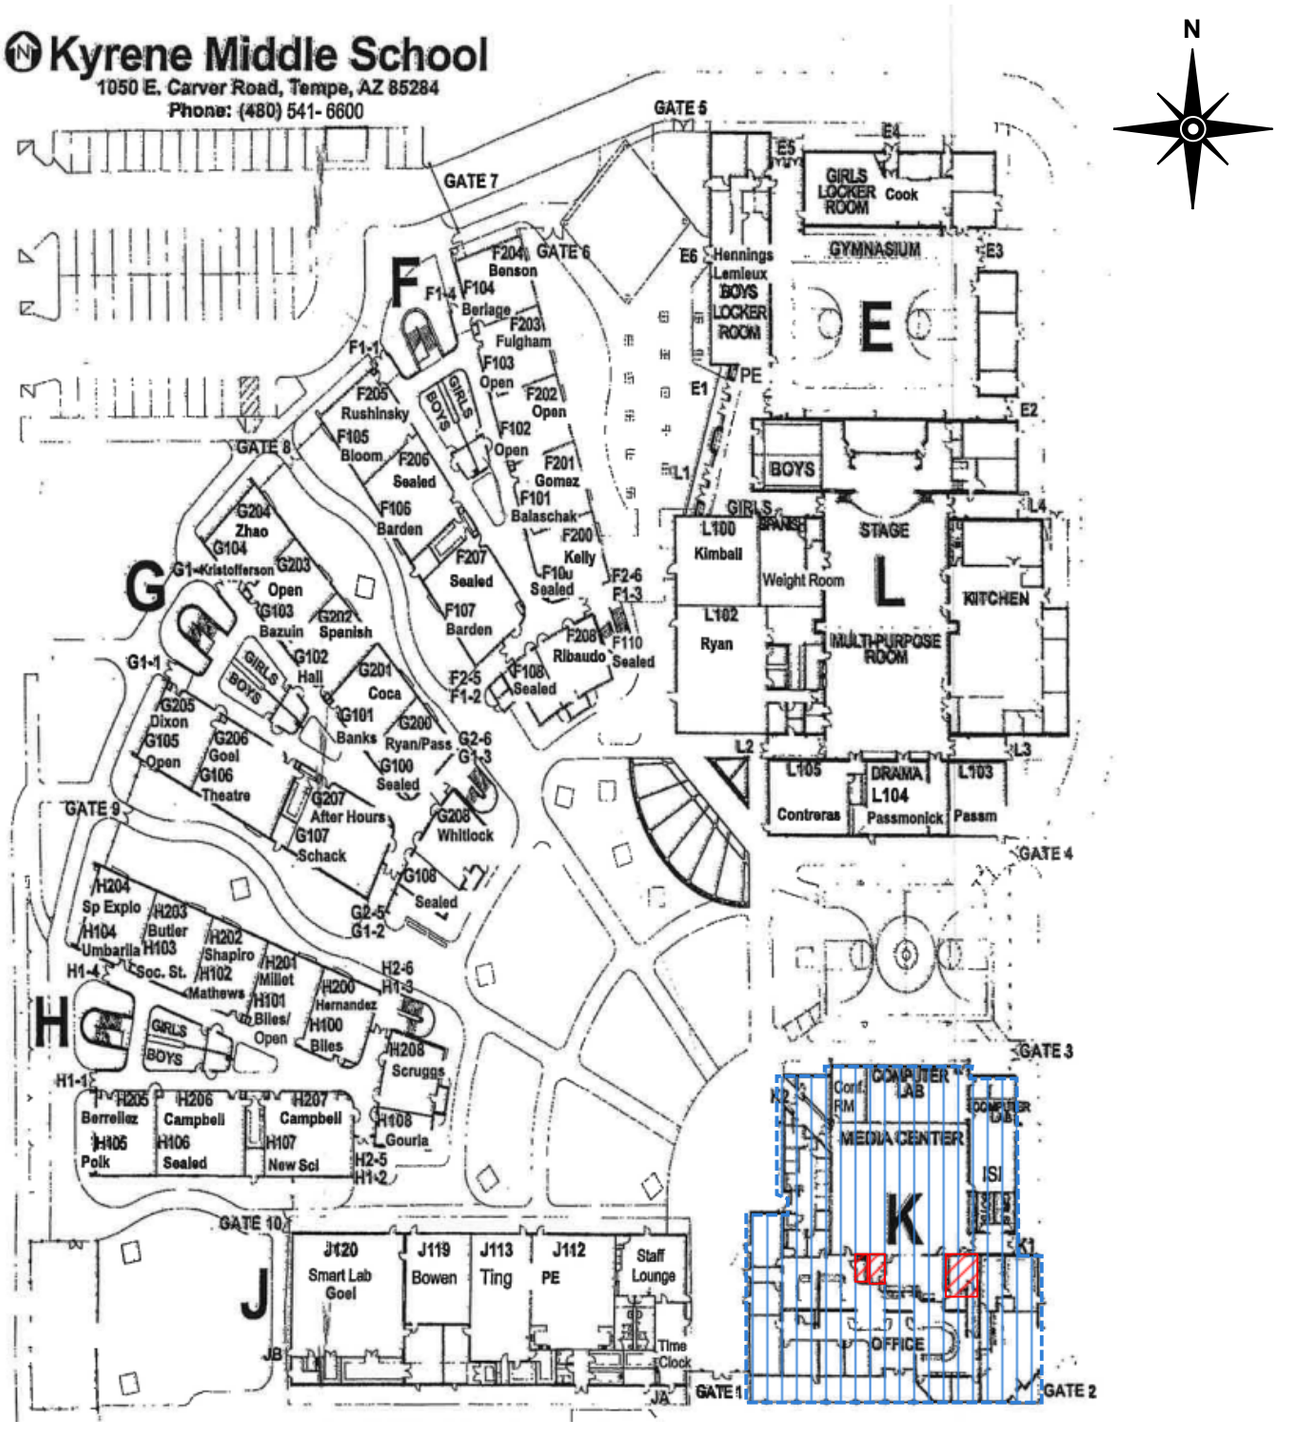

Assumed Asbestos-Containing
Exterior Caulking


Assumed Asbestos-Containing

Black Carpet Square & Mastic,
Tan 4" x 4" Ceramic Floor Tile,
Grout, & Thinset,
Gray Sink Coating,
FRP & Mastic, &
Terrazo Mop Sink

Assumed Asbestos-Containing
Dark Gray Cove Base & Mastic

Assumed Asbestos-Containing Material Location Map (2) — Project No. AZ1418.57
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284 — Building K

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

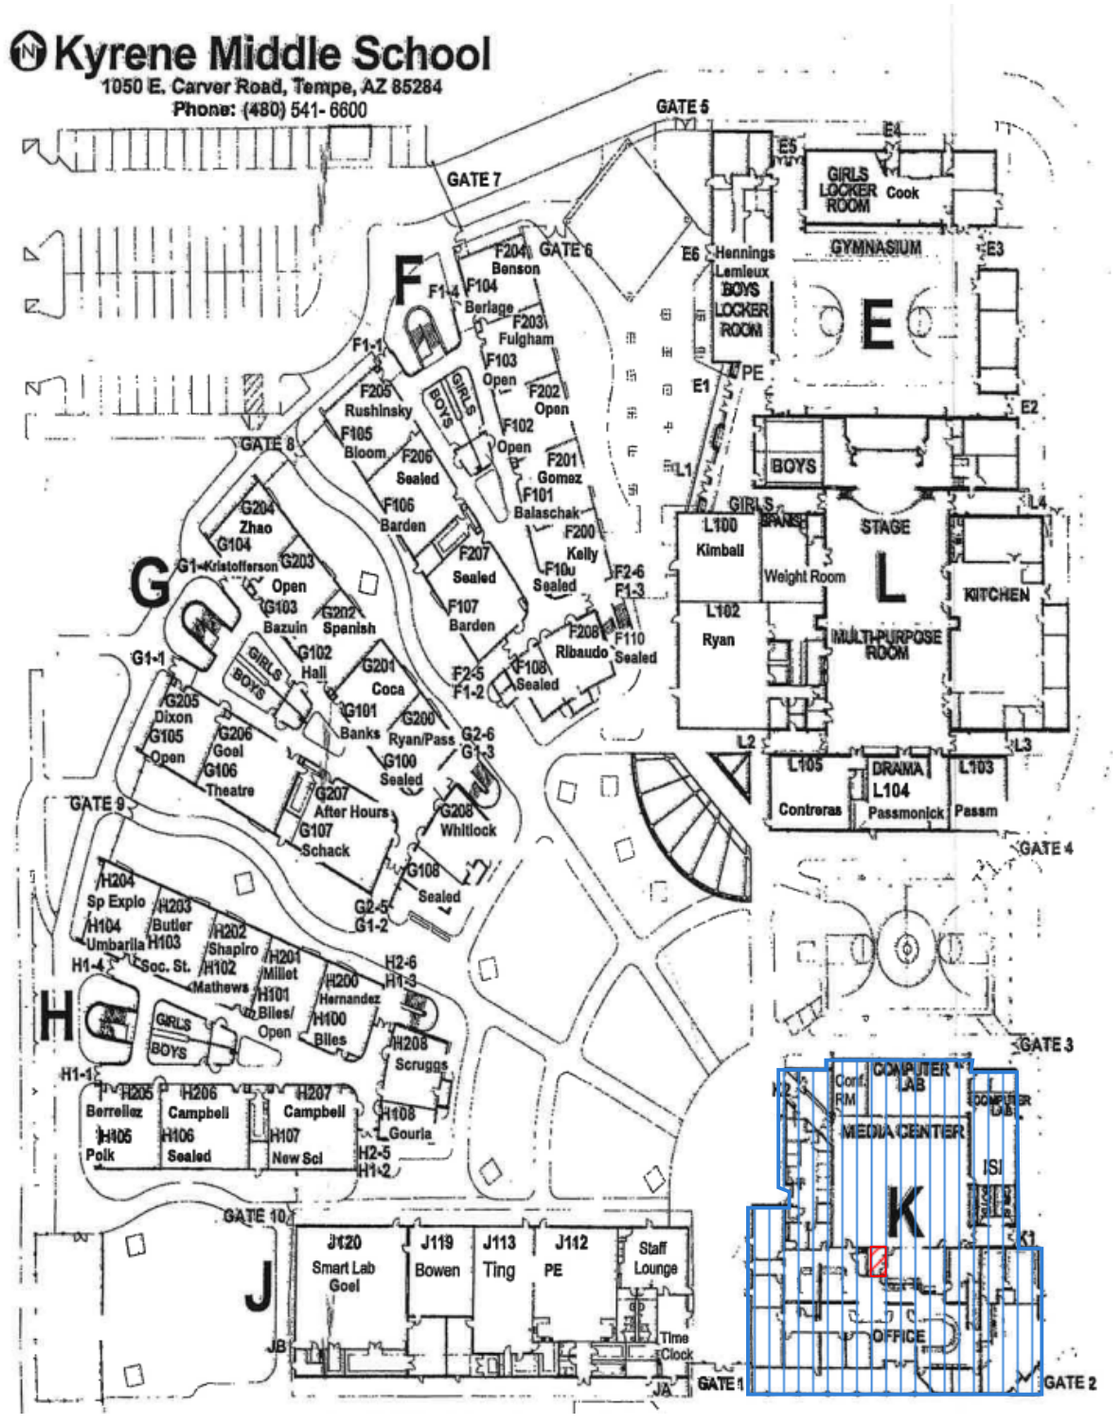

Assumed Asbestos-Containing
Unfinished Drywall System,
Silver Flex Duct Wrap,
Silver Box Duct Wrap,
Black Pipe Foam Insulation,
Pipe Wrap & Mastic,
Gray Duct Mastic,
& Skylight Insulation Panel

* Above the Ceiling

Assumed Asbestos-Containing
Knockdown Drywall System

Assumed Asbestos-Containing Material Location Map (3) — Project No. AZ1418.57
Kyrene Middle School
1050 East Carver Road, Tempe, Arizona 85284 — Building K

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

SECTION 11

♦

INSPECTOR ACCREDITATIONS

THE ASBESTOS INSTITUTE

Certifies that

Krista Wahnefried

has attended and received instruction in the EPA approved course

AHERA Building Inspector Refresher

on

August 19, 2017

and successfully completed and passed the competency exam.

4646-230-081917

Date of Examination:
19-Aug-2017

Date of Expiration:
19-Aug-2018

William T. Cavness
Director

Approved Instructor

THE ASBESTOS INSTITUTE
20033 N. 19th Ave, Building 6, Phoenix, AZ 85027
602-864-6564 – www.theasbestosinstitute.com

This training meets all requirements for asbestos certification under Toxic Substance Control Act Title II.

THE ASBESTOS INSTITUTE

Certifies that

Tracey Carpenter

has attended and received instruction in the EPA approved course

AHERA Building Inspector Refresher

on

August 29, 2024

and successfully completed and passed the competency exam.

Certificate:
ON-188748-14588-082924

Date of Examination:
29-Aug-2024

Date of Expiration:
29-Aug-2025

William T. Cavness
Director

Approved Instructor

THE ASBESTOS INSTITUTE
20033 N. 19th Ave, Building 6, Phoenix, AZ 85027
602-864-6564 – www.theasbestosinstitute.com

The person receiving this certificate has completed the requisite training for asbestos accreditation under TSCA Title II.

THE ASBESTOS INSTITUTE

Certifies that

Nicholas Marcos

has attended and received instruction in the EPA approved course

AHERA Building Inspector Refresher

on

March 13, 2025

and successfully completed and passed the competency exam.

Certificate:
ON-188748-8873-031325

Date of Examination:
13-Mar-2025
Date of Expiration:
13-Mar-2026

A. Zwanenburg
Director

Approved Instructor

THE ASBESTOS INSTITUTE
20033 N. 19th Ave, Building 6, Phoenix, AZ 85027
602-864-6564 – www.theasbestosinstitute.com

FL Course # CRS228

The person receiving this certificate has completed the requisite training for asbestos accreditation under TSCA Title II.

SECTION 12

♦

LABORATORY ACCREDITATIONS

United States Department of Commerce
National Institute of Standards and Technology

Certificate of Accreditation to ISO/IEC 17025:2005

NVLAP LAB CODE: 500097-0

Aerobiology Laboratory Associates, Inc., Phoenix, AZ

Phoenix, AZ

is accredited by the National Voluntary Laboratory Accreditation Program for specific services, listed on the Scope of Accreditation, for:

Asbestos Fiber Analysis

This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2005. This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality management system (refer to joint ISO-ILAC-IAF Communique dated January 2009).

2020-01-01 through 2020-12-31

Effective Dates

For the National Voluntary Laboratory Accreditation Program

United States Department of Commerce
National Institute of Standards and Technology

Certificate of Accreditation to ISO/IEC 17025:2017

NVLAP LAB CODE: 500097-0

Aerobiology Laboratory Associates, Inc., Phoenix, AZ

Phoenix, AZ

is accredited by the National Voluntary Laboratory Accreditation Program for specific services, listed on the Scope of Accreditation, for:

Asbestos Fiber Analysis

This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2017. This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality management system (refer to joint ISO-ILAC-IAF Communique dated January 2009).

2022-01-01 through 2022-12-31

Effective Dates

For the National Voluntary Laboratory Accreditation Program

National Voluntary
Laboratory Accreditation Program

SCOPE OF ACCREDITATION TO ISO/IEC 17025:2017

Aerobiology Laboratory Associates, Inc., Phoenix, AZ
2228 West Northern Ave, Suite B110
Phoenix, AZ 85021
Ms. Elvira Teague
Phone: 602-441-3700
Email: elle@aerobiology.net
http://www.aerobiology.net

ASBESTOS FIBER ANALYSIS **NVLAP LAB CODE 500097-0**

Bulk Asbestos Analysis

Code	***Description***
18/A01	EPA -- 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples
18/A03	EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials

For the National Voluntary Laboratory Accreditation Program

United States Department of Commerce
National Institute of Standards and Technology

Certificate of Accreditation to ISO/IEC 17025:2017

NVLAP LAB CODE: 500031-0

Eurofins EMLab P&K

Phoenix, AZ

is accredited by the National Voluntary Laboratory Accreditation Program for specific services, listed on the Scope of Accreditation, for:

Asbestos Fiber Analysis

This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2017. This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality management system (refer to joint ISO-ILAC-IAF Communique dated January 2009).

2024-01-01 through 2024-12-31

Effective Dates

For the National Voluntary Laboratory Accreditation Program

National Voluntary Laboratory Accreditation Program

SCOPE OF ACCREDITATION TO ISO/IEC 17025:2017

Eurofins EMLab P&K
1501 W. Knudsen Dr.
Phoenix, AZ 85027-1307
Claudia Palermo
Phone: 856-334-1001
Email: claudia.palermo@et.eurofinsus.com
https://www.eurofinsus.com/environment-testing/built-environment/

ASBESTOS FIBER ANALYSIS — NVLAP LAB CODE 500031-0

Bulk Asbestos Analysis

Code	*Description*
18/A01	EPA -- 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples
18/A03	EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials

For the National Voluntary Laboratory Accreditation Program

United States Department of Commerce
National Institute of Standards and Technology

Certificate of Accreditation to ISO/IEC 17025:2017

NVLAP LAB CODE: 500031-0

Eurofins EMLab P&K

Phoenix, AZ

is accredited by the National Voluntary Laboratory Accreditation Program for specific services, listed on the Scope of Accreditation, for:

Asbestos Fiber Analysis

This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2017. This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality management system (refer to joint ISO-ILAC-IAF Communique on ISO/IEC 17025).

2025-01-01 through 2025-12-31

Effective Dates

For the National Voluntary Laboratory Accreditation Program

National Voluntary Laboratory Accreditation Program

SCOPE OF ACCREDITATION TO ISO/IEC 17025:2017

Eurofins EMLab P&K
1501 W. Knudsen Dr.
Phoenix, AZ 85027-1307
Joshua Snyder
Phone: 800-651-4802
Email: joshua.snyder@et.eurofinsus.com
https://www.eurofinsus.com/environment-testing/built-environment/

ASBESTOS FIBER ANALYSIS — NVLAP LAB CODE 500031-0

Bulk Asbestos Analysis

Code	*Description*
18/A01	EPA -- 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples
18/A03	EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials

For the National Voluntary Laboratory Accreditation Program

SECTION 3

♦

DESIGNATED PERSON IDENTIFICATION

AHERA
Designated Person
796.93(e)(4)

LEA Designated Person

Print Name:

Address:

Phone:

Training Course Name:

Dates of Training:

Hours of Training:

Signature:

Date:

SECTION 4

♦

AHERA TRAINING CERTIFICATIONS OF SCHOOL STAFF MEMBERS

SECTION 5

♦

RESPONSE ACTIONS WITH DETAILS, REASONS AND SCHEDULES

Response Actions

Management Planner:

Print Name: Tracey Carpenter **Signature:** Tracey Carpenter

State of Accreditation or EPA: EPA AHERA - Arizona

Accreditation # & Date: # ON-4651-14588-070625, July 6, 2026

Date: July 16, 2025

Building: F

Homogeneous Area #: 48

Homogeneous Area Description: Insulation for White Pipe Wrap

Location: Above Ceiling

Action:	**Repair**	**Remove**	**O & M**	X
	Encapsulation	**Enclose**		

Reason: N/A

Schedule (Start/Finish): End of ACBM Life

ACBM Remaining After Response Action: 1,000 sq. ft.

DOMINION ENVIRONMENTAL CONSULTANTS, INC.
20045 North 19th Avenue ✦ Building #7 ✦ Phoenix, Arizona 85027
Tel: (623) 516-1415 ✦ Fax: (623) 516-0017
www.dominion-env.com

Response Actions

Management Planner:

Print Name: Tracey Carpenter **Signature:** Tracey Carpenter

State of Accreditation or EPA: EPA AHERA - Arizona

Accreditation # & Date: # ON-4651-14588-070625, July 6, 2026

Date: July 16, 2025

Building: K

Homogeneous Area #: 31

Homogeneous Area Description: Wallpaper

Location: Throughout

Action:	**Repair**	**Remove**	**O & M**	X
	Encapsulation	**Enclose**		

Reason: N/A

Schedule (Start/Finish): End of ACBM Life

ACBM Remaining After Response Action: 5,000 sq. ft.

DOMINION ENVIRONMENTAL CONSULTANTS, INC.
20045 North 19th Avenue ✦ Building #7 ✦ Phoenix, Arizona 85027
Tel: (623) 516-1415 ✦ Fax: (623) 516-0017
www.dominion-env.com

SECTION 6

♦

ACCREDITATION STATEMENT

Assurance of Accreditation
Under this Management Plan

763.93(e)(7)

Inspector:

Name: Nick Marcos
State of Accreditation or EPA: EPA AHERA Building Inspector - Arizona
Accreditation Date(s): March 13, 2025 – March 13, 2026
Accreditation Number(s): ON-188748-8873-031325

Management Planner:

Name: Tracey Carpenter
State of Accreditation or EPA: EPA AHERA Management Planner – Arizona
Accreditation Date(s) Valid: July 6, 2025 – July 6, 2026
Accreditation Number(s): ON-4651-14588-070625

Any Project Designer, Contractor/Supervisor or Worker who performs work on response actions under this Management Plan shall be accredited by either an EPA approved state contractor accreditation plan or an EPA approved course under section 206(b) to Title II of the Toxic Substance Control Act.

SECTION 7

♦

REMAINING ACBM

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	**Campus: Kyrene Middle School**
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: E/L	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
29	White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Cafeteria	12,000
30	Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)		12,000
31	Black 12" x 12" Vinyl Floor Tile (VCT)	Stage	2,000
32	Mastic for Black 12" x 12" Vinyl Floor Tile (VCT)		2,000
33	Black Stair Tread	Stage	200
34	Mastic for Black Stair Tread		200
35	Brick	Exterior	120,000
36	Mortar for Brick		120,000
37	Tacboard	Throughout	1,500
38	Knockdown Drywall System	Electrical Rooms	3,000
39	Brown Fiberglass Reinforced Plastic (FRP)	Kitchen	5,000
40	Mastic for Brown Fiberglass Reinforced Plastic (FRP)		5,000
41	2' x 4' Drywall Ceiling Tile	Kitchen	5,000
42	Brown 6" x 6" Ceramic Floor Tile	Throughout	5,000
43	Grout for Brown 6" x 6" Ceramic Floor Tile		500
44	Thinset for Brown 6" x 6" Ceramic Floor Tile		5,000
45	Interior Caulking	Throughout	200
46	Exterior Caulking	Throughout	200
47	Gray Sink Coating	Sinks Throughout	75
48	Brown 4" x 6" Ceramic Wall Tile	Kitchen	2,000
49	Grout for Brown 4" x 6" Ceramic Wall Tile		200
50	Mastic for Brown 4" x 6" Ceramic Wall Tile		2,000
51	Dark Brown 6" x 6" Replacement Ceramic Wall Tile	Kitchen	1,000
52	Grout for Replacement Ceramic Wall Tile		100
53	Mastic for Replacement Ceramic Wall Tile		1,000
54	White w/Brown 4" x 4" Ceramic Wall Tile	Kitchen Restroom	1,000
55	Grout for White w/Brown 4" x 4" Ceramic Wall Tile		100
56	Mastic for White w/Brown 4" x 4" Ceramic Wall Tile		1,000
57	Green 4" x 4" Ceramic Wall Tile	Kitchen Restroom	250

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	**Campus: Kyrene Middle School**
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: E/L	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
58	Fixture Caulking	Restrooms Throughout	30
59	Divider Wall	Cafeteria	5,000
60	Black Rubber Flooring	Gymnasium	2,000
61	Tan 4" x 4" Ceramic Wall Tile	Kitchen Restroom	4,000
62	Grout for Tan 4" x 4" Ceramic Wall Tile		400
63	Mastic for Tan 4" x 4" Ceramic Wall Tile		4,000
64	Blue 4" x 4" Ceramic Wall Tile	Restroom	1,000
65	Tan 2" x 2" Ceramic Floor Tile	Throughout	5,000
66	Grout for Tan 2" x 2" Ceramic Floor Tile		500
67	Thinset for Tan 2" x 2" Ceramic Floor Tile		5,000
68	Green 2" x 2" Ceramic Floor Tile	Throughout	250
69	Blue 2" x 2" Ceramic Floor Tile	Throughout	250
70	Marble Threshold	Throughout	50
71	Black L-Shaped Cove Base	Gymnasium	300
72	Mastic for Black L-Shaped Cove Base		300
73	Tan Mutlicolored 12" x 12" Vinyl Floor Tile (VCT)	Locker Rooms	3,000
74	Mastic for Tan Mutlicolored 12" x 12" (VCT)		3,000
75	Tan 3" x 3" Ceramic Floor Tile	Locker Rooms	1,500
76	Grout for Tan 3" x 3" Ceramic Floor Tile		150
77	Thinset for Tan 3" x 3" Ceramic Floor Tile		1,500
78	Block	Throughout	150,000
79	Mortar for Block		150,000
80	Skylight Insulation Panel	Above Ceiling	3,000
81	Silver Flex Duct Wrap	Above Ceiling	2,000
82	Large Silver Duct Wrap	Above Ceiling	2,000
83	Small Silver Duct Wrap	Above Ceiling	1,000
84	Unfinished Drywall System	Above Ceiling	30,000
85	Gray Duct Mastic	Above Ceiling	200
86	Black Foam Pipe Insulation	Above Ceiling	200

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	Campus: Kyrene Middle School
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: E/L	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
87	White Pipe Wrap	Above Ceiling	2,000
88	Mastic for White Pipe Wrap	Above Ceiling	2,000

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	Campus: Kyrene Middle School
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: F	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
16	Interior Caulking	Throughout	200
17	Exterior Caulking	Throughout	200
18	Divider Wall	Throughout	2,000
19	Gray Sink Coating	Throughout	125
20	Glass Block Mortar	Throughout	150
21	Brick	Throughout	100,000
22	Mortar for Brick		100,000
23	Tacboard	Throughout	8,000
24	Tan 4" x 4" Ceramic Wall Tile	Throughout	4,000
25	Grout for Tan 4" x 4" Ceramic Wall Tile		400
26	Mastic for Tan 4" x 4" Ceramic Wall Tile		4,000
27	Blue 4" x 4" Ceramic Wall Tile	Throughout	500
28	Green 4" x 4" Ceramic Wall Tile	Throughout	500
29	Tan 2" x 2" Ceramic Floor Tile	Throughout	4,000
30	Grout for Tan 2" x 2" Ceramic Floor Tile		400
31	Thinset for Tan 2" x 2" Ceramic Floor Tile		4,000
32	Blue 2" x 2" Ceramic Floor Tile	Throughout	500
33	Green 2" x 2" Ceramic Floor Tile	Throughout	500
34	Fixture Caulking	Throughout	40
35	Fiberglass Reinforced Plastic (FRP)	Throughout	150
36	Mastic for Fiberglass Reinforced Plastic (FRP)		150
37	Gray Stair Tread	Throughout	600
38	Mastic for Gray Stair Tread		600
39	Gray 20" x 20" Floor Tile	Throughout	500
40	Mastic for Gray 20" x 20" Floor Tile		500
41	Knockdown Drywall System	Throughout	2,000
42	Silver Flex Duct Wrap	Above Ceiling	2,000
43	Silver Box Duct Wrap	Above Ceiling	3,000
44	Gray Duct Mastic	Above Ceiling	300

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	**Campus: Kyrene Middle School**
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: F	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
45	Unfinished Drywall System	Above Ceiling	6,000
46	Black Foam Pipe Insulation	Above Ceiling	200
47	White Pipe Wrap	Above Ceiling	1,000
48	Insulation for White Pipe Wrap	Above Ceiling	1,000
49	Skylight Insulation Panel		10,500

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	Campus: Kyrene Middle School
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: G	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
19	Divider Wall	Throughout	2,000
20	Tacboard	Throughout	8,000
21	Interior Caulking	Throughout	200
22	Exterior Caulking	Throughout	200
23	White Sink Coating	Throughout	125
24	White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Throughout	5,000
25	Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)		5,000
26	Brick	Throughout	100,000
27	Mortar for Brick		100,000
28	Tan 4" x 4" Ceramic Wall Tile	Throughout	4,000
29	Grout for Tan 4" x 4" Ceramic Wall Tile		400
30	Mastic for Tan 4" x 4" Ceramic Wall Tile		4,000
31	Green 4" x 4" Ceramic Wall Tile	Throughout	500
32	Blue 4" x 4" Ceramic Wall Tile	Throughout	500
33	Tan 2" x 2" Ceramic Floor Tile	Throughout	4,000
34	Grout for Tan 2" x 2" Ceramic Floor Tile		400
35	Thinset for Tan 2" x 2" Ceramic Floor Tile		4,000
36	Green 2" x 2" Ceramic Floor Tile	Throughout	500
37	Blue 2" x 2" Ceramic Floor Tile	Throughout	500
38	Marble Threshold	Throughout	25
39	Fixture Caulking	Throughout	40
40	Knockdown Drywall System	Throughout	2,000
41	Terrazo Mop Sink	Throughout	15
42	Brown Fiberglass Reinforced Plastic (FRP)	Throughout	150
43	Mastic for Brown Fiberglass Reinforced Plastic (FRP)		150
44	Glass Block Mortar	Throughout	150
45	Black Stair Tread	Stairway	200
46	Mastic for Black Stair Tread		200

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	**Campus: Kyrene Middle School**
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: G	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
47	Black 20" x 20" Floor Tile	Throughout	500
48	Mastic for Black 20" x 20" Floor Tile		500
49	Skylight Insulation Panel	Above Ceiling	10,500
50	Silver Flex Duct Wrap	Above Ceiling	2,000
51	Silver Box Duct Wrap	Above Ceiling	2,000
52	Gray Duct Mastic	Above Ceiling	300
53	Unfinished Drywall System	Above Ceiling	6,000
54	Black Foam Pipe Insulation	Above Ceiling	200
55	White Pipe Wrap	Above Ceiling	1,000
56	Mastic for White Pipe Wrap		1,000

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	**Campus: Kyrene Middle School**
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: H	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
11	White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Throughout	5,000
12	Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)		5,000
13	Interior Caulking	Throughout	200
14	Exterior Caulking	Throughout	200
15	Gray Sink Coating	Throughout	125
16	Divider Wall	Throughout	2,000
17	Brick	Throughout	100,000
18	Mortar for Brick		100,000
19	Tacboard	Throughout	8,000
20	Black Stair Tread	Stairway	200
21	Mastic for Black Stair Tread		200
22	Black Cove Base	Throughout	150
23	Mastic for Black Cove Base		150
24	Black 20" x 20" Floor Tile	Throughout	500
25	Mastic for Black 20" x 20" Floor Tile		500
26	Tan 4" x 4" Ceramic Wall Tile	Throughout	4,000
27	Grout for Tan 4" x 4" Ceramic Wall Tile		400
28	Mastic for Tan 4" x 4" Ceramic Wall Tile		4,000
29	Green 4" x 4" Ceramic Wall Tile	Throughout	500
30	Blue 4" x 4" Ceramic Wall Tile	Throughout	500
31	Tan 2" x 2" Ceramic Floor Tile	Throughout	4,000
32	Grout for Tan 2" x 2" Ceramic Floor Tile		400
33	Thinset for Tan 2" x 2" Ceramic Floor Tile		4,000
34	Green 2" x 2" Ceramic Floor Tile	Throughout	500
35	Blue 2" x 2" Ceramic Floor Tile	Throughout	500
36	Knockdown Drywall System	Throughout	2,000
37	White Sink Coating	Throughout	125
38	Glass Block Mortar	Throughout	150

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	**Campus: Kyrene Middle School**
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: H	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
39	Marble Threshold	Throughout	25
40	Fixture Caulking	Throughout	40
41	Skylight Insulation Panel	Above Ceiling	10,500
42	Silver Flex Duct Wrap	Above Ceiling	2,000
43	Silver Box Duct Wrap	Above Ceiling	3,000
44	Gray Duct Mastic	Above Ceiling	300
45	Unfinished Drywall System	Above Ceiling	6,000
46	Black Foam Pipe Insulation	Above Ceiling	200
47	White Pipe Wrap	Above Ceiling	1,000
48	Mastic for White Pipe Wrap		1,000

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	**Campus: Kyrene Middle School**
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: J	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
12	Fiberglass Reinforced Plastic (FRP)	Throughout	5,000
13	Mastic for Fiberglass Reinforced Plastic (FRP)		5,000
14	Gray Sink Coating	Throughout	20
15	Interior Caulking	Throughout	100
16	Exterior Caulking	Throughout	100
17	Tan 4" x 4" Ceramic Wall Tile	Throughout	3,000
18	Grout for Tan 4" x 4" Ceramic Wall Tile		300
19	Mastic for Tan 4" x 4" Ceramic Wall Tile		3,000
20	Green 4" x 4" Ceramic Wall Tile	Throughout	500
21	Blue 4" x 4" Ceramic Wall Tile	Throughout	500
22	Tan 2" x 2" Ceramic Floor Tile	Throughout	3,000
23	Grout for Tan 2" x 2" Ceramic Floor Tile		300
24	Thinset for Tan 2" x 2" Ceramic Floor Tile		3,000
25	Green 2" x 2" Ceramic Floor Tile	Throughout	500
26	Blue 2" x 2" Ceramic Floor Tile	Throughout	500
27	Fixture Caulking	Throughout	50
28	Marble Threshold	Throughout	25
29	Blue Cove Base	J112 (3 Storage Closets) and J113	150
30	Mastic for Blue Cove Base		150
31	Tacboard	Throughout	10,000
32	Gray 12" x 12" Vinyl Floor Tile (VCT)	Art J112	1,500
33	Mastic for Gray 12" x 12" Vinyl Floor Tile (VCT)		1,500
34	Knockdown Drywall System	Electrical and Kiln Room	2,000
35	Tan Multicolored 12" x 12" Vinyl Floor Tile (VCT)	Lounge Storage and J120 Storage	600
36	Mastic for Tan Multicolored 12" x 12" VCT		600
37	Brick	Throughout	60,000
38	Mortar for Brick		60,000
39	Gray Floor Coating	J120 Restroom	150

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	**Campus: Kyrene Middle School**
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: J	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
40	White 6" x 6" Ceramic Wall Tile	J120 Restroom	300
41	Grout for White 6" x 6" Ceramic Wall Tile		30
42	Mastic for White 6" x 6" Ceramic Wall Tile		300
43	Skylight Insulation Panel	Above Ceiling	3,000
44	Large Silver Flex Duct Wrap	Above Ceiling	2,000
45	Silver Box Duct Wrap	Above Ceiling	2,000
46	Gray Duct Mastic	Above Ceiling	200
47	Unfinished Drywall System	Above Ceiling	6,000
48	Black Foam Pipe Insulation	Above Ceiling	100
49	White Pipe Wrap	Above Ceiling	500
50	Mastic for White Pipe Wrap		500
51	Residual 12" x 12" Ceiling Tile Mastic	Above Ceiling	2,000

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	**Campus: Kyrene Middle School**
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: K	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
20	Black Carpet Square	Throughout	300
21	Mastic for Black Carpet Square		300
22	Tan 4" x 4" Ceramic Wall Tile	Throughout	3,000
23	Grout for Tan 4" x 4" Ceramic Wall Tile		300
24	Mastic for Tan 4" x 4" Ceramic Wall Tile		3,000
25	Tan 2" x 2" Ceramic Floor Tile	Throughout	3,000
26	Grout for Tan 2" x 2" Ceramic Floor Tile		300
27	Thinset for Tan 2" x 2" Ceramic Floor Tile		3,000
28	Green 2" x 2" Ceramic Floor Tile	Throughout	500
29	Blue 2" x 2" Ceramic Floor Tile	Throughout	500
30	Marble Threshold	Throughout	50
31	Wallpaper	Throughout	5,000
32	Brick	Throughout	100,000
33	Mortar for Brick		100,000
34	White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Throughout	2,000
35	Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)		2,000
36	Interior Caulking	Throughout	100
37	Exterior Caulking	Throughout	100
38	Knockdown Drywall System	IDF Room	1,500
39	Gray Sink Coating	Throughout	75
40	Gray Carpet Square	Media Center IDF and Library Resource	100
41	Mastic for Gray Carpet Square		100
42	Dark Gray Cove Base	Janitorial Supply Closet, Media Center IDF, and Library Resource	20
43	Mastic for Dark Gray Cove Base		20
44	Beige Multicolored 12" x 12" Vinyl Floor Tile (VCT)	Janitorial Supply Closet	750
45	Mastic for Beige Multicolored 12" x 12" VCT		750
46	Fiberglass Reinforced Plastic (FRP)	Throughout	500
47	Mastic for Fiberglass Reinforced Plastic (FRP)		500

Dominion Environmental Consultants, Inc.
Remaining ACBM After Planned Response Actions

Client: Kyrene Elementary School District	**Campus: Kyrene Middle School**
	Address: 1050 East Carver Road, Tempe, Arizona 85284
Building: K	

Homogeneous Area Number	Material Description	Location(s)	Approximate Quantity (sq. ft.)
48	Terrazo Mop Sink	Throughout	50
49	Unfinished Drywall System	Above Ceiling	10,000
50	Silver Flex Duct Wrap	Above Ceiling	2,000
51	Silver Box Duct Wrap	Above Ceiling	2,000
52	Black Pipe Foam Insulation	Above Ceiling	100
53	Pipe Wrap	Above Ceiling	300
54	Mastic for Pipe Wrap		300
55	Gray Duct Mastic	Above Ceiling	100
56	Skylight Insulation Panel	Above Ceiling	2,000

SECTION 8

♦

OPERATIONS & MAINTENANCE PLAN

KYRENE ELEMENTARY SCHOOL DISTRICT

OPERATIONS AND MAINTENANCE PLAN

for

ASBESTOS CONTROL

O & M POLICIES AND PROCEDURES

1. INTRODUCTION

Asbestos is a common name for a group of natural minerals that separate into strong, fine fibers when crushed or broken. Its unique fiber properties include tensile strength, thermal insulation, chemical resistance, condensation control, friction resistance, and non-combustibility. Asbestos has been mined from the earth like coal for thousands of years.

The two groups of asbestos are serpentine and amphibole. The three most commonly found asbestos types are:

* Serpentine chrysotile, known as the "white" asbestos, is found in about 91 percent of all asbestos used in commercial products. It has fine, long, flexible fibers with high tensile strength and is primarily mined in Canada and the Soviet Union.
* Amphibole amosite, known as the "brown" asbestos, is found in about 8 percent of all asbestos used in commercial products. It has straight, brittle fibers and resists temperatures up through 480 degrees Celsius. It is mined primarily in South Africa.
* Crocidolite, known as the "blue" asbestos, is found in less than 1 percent of all asbestos used in commercial products. It is the strongest of asbestos with straight and brittle fibers and is also mined in South Africa.

Also included in the amphibole group are anthophyllite, tremolite and actinolite. These types are rarely used in commercial products but may be found as contaminants included in the base ingredients of commercial products.

History

The asbestos industry began in the 1870s when the first commercial chrysotile mine opened in Quebec, Canada. In South Africa, crocidolite was mined in the 1880's while amosite mining began in 1916.

From 1870-1900, asbestos was used in insulation and gaskets. After 1900, its most common use was on steam pipes and boilers in ships. In the 1940's, asbestos was mostly used in the form of mechanical insulation. The three classifications of building materials that contain asbestos include: (1) Thermal System Insulation (TSI), which is mechanical system insulation used to control heat transfer or condensate on plumbing and HVAC systems; (2) Surfacing Material, which is any material sprayed or troweled on surfaces, such as fireproofing, plaster or acoustical applications; (3) Miscellaneous Material, which includes anything which is not TSI or Surfacing, such as roofing, flooring, drywall, or asbestos cement products.

The 1940's marked major changes in the use of asbestos in the United States. Asbestos use was expanded to include architectural finishes. Amosite became widely used for insulation in ships and shipyards. Spray-applied fireproofing materials were largely used in buildings. From 1945 to 1980, it has been estimated that more than half of the large, multi-story buildings constructed contain asbestos spray-applied materials.

Asbestos-Related Diseases

Asbestos fibers enter the body in two ways: (1) inhalation or (2) ingestion. They cannot enter the body by penetrating the skin.

The three main asbestos–related diseases are (1) Lung Cancer, a cancer of the bronchial tube area of the lungs, (2) Asbestosis, a scarring of the lung at the alveoli area which restricts oxygen intake, and (3) Mesothelioma, a tumor or cancer occurring on the tissue which lines the lung area and the intestinal area of the body.

The latency period for asbestos-related diseases is usually 20 - 40 years, depending on the disease. Exposure to asbestos is asymptomatic. While generally not treatable, asbestos diseases are dose–response related and quite preventable (the purpose of a pro-active O & M program).

Asbestos Today

At one time there were over 3,600 commercial products that contained varying amounts of asbestos. The Federal Environmental Protection Agency (EPA) and Occupational Safety and Health Administration (OSHA) estimate that over 2,000 of the 3,600 asbestos containing products were used in a variety of building materials. By 1978 EPA had banned the use of asbestos in any spray application and TSI. However, most other uses of ACM are still allowed.

Asbestos Management In Buildings

The first three steps to manage ACM in a facility are:

* Identify and determine the extent of the problem,
* Perform a hazard assessment on each material to determine its potential for asbestos fiber release, and
* Develop a plan and schedule to deal with ACM in each facility. This is the Asbestos Management Plan.

In the planning process, there are five options to deal with the ACM. They include (1) operations and maintenance (O & M) program, (2) repair, (3) enclosure, (4) encapsulation and (5) removal. While removal of asbestos from facilities is the only permanent option, and will be required at some point of building use, (disturbance by renovation or demolition: see 40 CFR 61 Subpart M, 11/20/90), it is not always the most practical initial option. Often, O & M practices are recommended as the most feasible and economic option that may protect human health and the environment. It should also be noted that any control option other than removal will result in the need for an O & M program to maintain the ACM which is being left in the building until removal is required.

Description of an O & M Plan

An O & M plan is a set of policies, procedures and work practices that are intended to minimize occupant exposure to ACM. The O & M plan is designed to protect workers and other building occupants who work around ACM. A good O & M plan will provide guidance for protection by (1) cleaning-up and repairing any existing contamination from past damage or disturbances, (2)

preventing further release of asbestos fibers through good work practices, and (3) maintaining asbestos in good condition through an effective program of monitoring the condition of ACM and repairing any damage. An O & M Program is proactive.

* All good O & M plans have common elements that include:

1. A Policy Statement
1. Labeling and Notification
2. Training
3. Employee Protection Programs
4. Medical Surveillance Program
5. Special Cleaning
6. Work Permit System
7. Special Work Practices
8. Exposure Monitoring
9. Emergency Response Programs
10. Periodic Surveillance
11. Record Keeping
12. Disposal Of ACM

Technical assistance to develop a complete plan may be needed from building staff, maintenance and custodial personnel, and other journeymen who may work at the facility. Architects, engineers, consultants, contractors, medical advisors, and legal counsel can also be good resources to develop the O & M Plan.

An Operations and Maintenance Plan, to be useful and understandable, must be site specific to each individual building. It should address *specifically* O & M cleaning, repair, and maintenance in areas of asbestos containing building materials (ACBM) at certain locations in the building. For instance, it should not be a general statement on worker protection but should be an ACBM specific statement on work practices and policy.

The O & M Program must be based on a complete and comprehensive building inspection designed to identify and locate *all* the ACBM in a building. Only with this important pre-requisite in place, will an O & M Program be successful in avoiding potential ACM exposure to people and resulting liability to the building owner.

Survey Summary

The O & M Program manual should include a summary of the asbestos survey information. It should include the types of material found to contain asbestos and the locations at which it is to be found. Schematic floor plan drawings can be very helpful in this section.

2. POLICY STATEMENT

Personnel Responsibilities

The success of the O & M plan depends on the active involvement and understanding of all parties. This may range from the facility administration to the manager of the asbestos program and the

building staff. Each facility must ensure all asbestos-related activities are done to comply with relevant federal, state, and local laws. To do this, each facility must designate a person to ensure compliance with relevant laws and the policies and procedures of the O & M manual. This person is known as the Asbestos Program Manager (APM).

In addition, each facility may provide support staff, including a response team, to assist the APM in carrying out his/her responsibilities. Below is a list of job responsibilities assigned for key personnel to develop and implement O & M plans.

Asbestos Program Manager

The APM, or designee, must implement the asbestos control program. As appropriate, responsibilities include the following:

* Manage the O & M plan; document, update and announce its activities.

* Notify *all* short-term and outside contractors of the presence, location and quantity of ACM in the facility, and all tenants occupying areas that contain ACM.

* Maintain and manage the documented inventory of ACM and its location.

* Review and approve/reject all work permit applications.

* Participate in the development, review, and monitoring of abatement project designs, and/or repair and alteration projects. Comply with relevant standards and laws when disturbing ACM.

* Ensure that asbestos projects are documented and record keeping complies with relevant laws and the O & M Manual.

* Seek technical direction and assistance from a qualified industrial hygienist or environmental services firm. This may be for the program development and implementation, inspection, and reinspection of ACM, and/or personnel training.

* **It is essential that the APM have the authority to enforce the O & M Program and the support of management to accomplish that.**

Response Team Leader

* Keep an inventory of equipment and supplies.

* Check warning labels and replace them as needed.

* Coordinate and report work and emergency practices.

* Assist the APM, or designee, with his/her duties.

Response Team

* Conduct OSHA Class III (small-scale, short duration) activities.
* Conduct initial and periodic cleaning.
* Respond to fiber release episodes.
* Conduct or help conduct periodic surveillance.
* Assist the APM, or designee, and response team leader with record keeping duties.

Consulting Staff

* Assist in development and implementation of O & M plan.
* Enhance the facilities asbestos program through consultation.
* Perform air monitoring when requested.

3. TRAINING

Federal and/or state OSHA regulations require training of any employee who may come in contact with, disturb, or clean up ACM.

A written plan is vital to provide step-by-step procedures and the documented intent at each facility. To implement and carry out a successful O & M program, a well-designed training program is needed.

Training provides an awareness of the presence of ACM, types of ACM, consequences of disturbing ACM, and proper work practices to minimize release of fibers. Also, training must alert people to the presence of management goals in dealing with ACM and proper procedures in the event of an emergency.

Below is a review of the three training levels which should be required for O & M programs.

OSHA Class IV Training (General Awareness Training)

OSHA requires this level of training for any employee who may come in contact with or clean up previously generated debris containing asbestos. OSHA training is required before an employee conducts this work and annually thereafter.

All custodial and maintenance personnel who work in a building containing ACM should have at least two hours of asbestos awareness training. This training should extend to temporary as well as permanent employees. Training topics include types and uses of asbestos, health effects of exposure, location of ACM in each building they work in, how to recognize damage/deterioration of ACM, the name and telephone number of the APM, or designee, and the availability and location of the facility's Asbestos Inspection Report. This training may be done by the APM or designee, or by an outside trainer. The training required by OSHA is described in EPA’s AHERA regulation at 40 CFR 763.92(a)(1).

OSHA Class III Training (Small-Scale, Short Duration Work)

Employees who conduct any activity that may result in the disturbance of ACM should complete an approved 16-hour training course. Topics should include the two-hour awareness, proper handling methods, personal protective equipment, applicable regulations, and hands-on training. A review examination of the training may be useful as a tool to encourage study and understanding of the subjects covered.

The training for each individual must be documented as to date, location, and length of training. This documentation should be preserved in permanent files and new employees must be trained prior to working with ACM. This training is defined in EPA's AHERA regulations at 40 CFR 763.92(a)(2).

Asbestos Program Manager (APM) Training

APMs should receive training in the health effects of asbestos exposure, detection, identification and assessment of ACM, options for controlling ACM, asbestos management programs, and relevant federal, state, and local laws. The extent of this training must be adequate to manage the asbestos issues at the site. It may be as brief as the 16 hour training, or as extensive as accredited courses under EPA's Model Accreditation Program. (It may be useful for the APM to receive training as an EPA Inspector and Management Planner, Project Designer or Contractor/Supervisor).

All training must be documented. Records of all training should be kept for an indefinite period.

Training records/forms must be kept for each person who takes any asbestos-related training. The list below contains training records which must be kept by each facility.

* For each employee taking the two-hour General Awareness Training complete the **General Awareness Training Form** or equivalent form.
* For each employee who completes the 16-hour training fill out a **Small-Scale Worker Training Form** or equivalent form.
* Regardless of the training taken, the APM, or designee should complete and sign an **Asbestos Management Coordinator Training Form** or equivalent form.

* Also, each facility should require proof of proper training for all outside contractors who handle or come in contact with asbestos in the facility. This documentation for training should be kept in permanent record keeping files for the facility.

AHERA training requirements are discussed in the EPA regulation 40 CFR 763.84 and 763.92. All facilities covered by AHERA should review this regulation to comply with training requirements. OSHA training requirements are found at 29 CFR 1926.1101(k)(9) as Class III and Class IV Training.

Note: Some states and/or local regulatory agencies may differ from these recommendations. Please seek consultation concerning this matter to ensure compliance with regulations.

4. EMPLOYEE PROTECTION

Each facility should develop and implement an employee protection plan to ensure safe work practices for employees handling ACM.

Respiratory Protection

OSHA at 29 CFR 1926.1101 requires respiratory protection when employee exposure levels exceed or may exceed the permissible exposure limit (PEL) as defined below:

* PEL includes the 8-hour time-weighted average limit (TWA) and the excursion limit (EL).
* TWA is defined as 0.1 f/cc averaged over eight hours.
* EL is defined as 1.0 f/cc measured for 30 minutes.

It is not always possible to know the exact employee exposure until after an O & M or small-scale project is done. Therefore, OSHA requires that an initial exposure assessment be conducted before a project begins, to determine any potential exposure to the workers involved (see OSHA at 29 CFR 1926.1101(f). Interim protection with at least a half-face, negative-pressure, air-purifying respirator, equipped with P100 filters should be required, along with protective clothing. A higher level of respiratory protection may be needed for some projects decided on a case-by-case basis.

However, these OSHA exposure levels are compliance triggers only and have no reference to "safe" levels of exposure, nor were they intended to. They are meant only to be levels which could be easily quantified or measured and therefore, demonstrated in a court of law if need be, to enforce a variety of mandated compliance issues.

To better protect workers from exposure and protect building owners and employers from liability, the stated intent of all good Respirator Protection Programs should be to protect workers to *at least* a maximum level of exposure calculated at 0.01 f/cc. The U.S. EPA AHERA regulation, although not mandatory for public and commercial buildings, requires that schools document a "final clearance" air sampling of at least this level before an asbestos abatement area may be reoccupied by unprotected building users.

Each facility should develop and implement a written respiratory program to comply with relevant federal, state, and local laws. The elements for an acceptable respiratory protection program are found at 29 CFR 1910.134©, and include:

1. Procedures for selecting respirators;
2. Medical evaluations of employees required to use respirators;
3. Fit testing procedures for employees required to use respirators;
4. Procedures for proper use of respirators;
5. Procedures and schedules for cleaning, storing and maintaining respirators;
6. Procedures to ensure adequate air for atmosphere-supplying respirators;
7. Training of employees in respiratory hazards;
8. Training of employees in use and limitations of respirators; and
9. Procedures for regular evaluation of the program.

The following OSHA regulations are mandatory as they apply to respirator use in asbestos O & M programs:

* 29 CFR 1910.134
* 29 CFR 1926.1101(h)
* 29 CFR 1926.1101(m)
* 29 CFR 1926.1101 Appendix D

Personal Protective Equipment

OSHA requires that respirators and protective clothing be used by any employee disturbing ACM (generating visible debris), unless a valid negative exposure assessment is documented for that particular job. This requirement does not extend to Class IV work.

In addition to respirators, each facility should provide and, under most conditions, require the use of protective coveralls, rubber boots or shoe covers, and gloves. Each facility should also provide and require the use of eye protection as needed. If the facility does not use disposable, single-use coveralls, they must abide by regulatory requirements for laundering contaminated clothing. These requirements include, but are not limited to, laundering clothing in such a manner that asbestos fibers are not released and notifying the person doing the laundering that the clothing is asbestos contaminated. The clothing must be transported in properly labeled, sealed, impermeable bags or containers. (See 29 CFR 1926.1101(I)). Although the use of launderable coveralls is allowed by Federal regulations, their use is not recommended. Complete decontamination of cloth is difficult to verify. It is therefore recommended that filtered, breathable coveralls be used, with a tested particulate holdout of at least 98% on 3–5-micron particulate.

Decontamination Procedures

Each facility should ensure that all workers perform proper decontamination procedures following all small-scale and/or O & M projects. These procedures may include, but are not limited to:

* Vacuuming. The worker must vacuum the disposable coveralls with an HEPA (high efficiency particulate air) vacuum. If a worker is wearing two suits, he/she should use a HEPA vacuum to decontaminate the outer suit and then remove it.
* Showering. Showering is not required by OSHA and may be used at the discretion of the APM. The worker will proceed to a shower to further decontaminate or to a room to change into street or work clothing.
* Disposal. In all cases, the worker will dispose of the coveralls and gloves as asbestos-contaminated waste.
* Respirator Care. The last item a worker will remove is the respirator. Respirators are decontaminated as follows:
    * Wipe off respirators with a damp cloth prior to removal.
    * Loosen straps and exhale as the respirator is removed.
    * Soak filters and dispose of asbestos contaminated waste.
    * Wash, dry, reassemble, and store respirator according to procedures outlined in each facility's written respirator program.

5. MEDICAL SURVEILLANCE

Medical surveillance is required under the OSHA Construction Standard at 29 CFR 1926.1101(m) for employees working with ACM. Where this regulation is more protective than 29 CFR 1910.134, it takes precedent over it.

Medical Surveillance is required:

* When employees conduct work for 30 or more days per year that may expose them at or above the PEL (0.1 f/cc); or
* When they are required to wear negative-pressure respirators.

To determine the need for medical surveillance for employees, each facility should provide an ongoing program of personnel air monitoring when employees perform asbestos work.

Each facility should ensure that employees participate in a medical surveillance program under the situations below:

* If an employee is handling ACM;
* If an employee, regardless of their job, meets the criteria specified by the Asbestos Construction Standard as described above; and
* If an employee, regardless of their job, meets the criteria specified by the Asbestos General Industry Standard, at 29 CFR 1910.1001 (l).

If an employee in the asbestos medical surveillance program has employment terminated for any reason, a final medical exam should be made available within thirty (30) days of termination. No termination exam is needed if the employee has completed an asbestos examination within the previous six (6) months.

Medical surveillance is conducted to comply with relevant federal, state, and local laws.

The following is an example of a written medical surveillance program which may be used to comply with the OSHA regulations, and which must be maintained on the site where the asbestos related O & M work takes place.

MEDICAL SURVEILLANCE PROGRAM

The Medical Surveillance Program for _____ consists of the following main elements:

1. Initial Examination
2. Annual Examination
3. Termination Examination
4. Signed opinion by physician
5. Employee medical record

1. Initial Examination

As required in the OSHA regulations at both 29 CFR 1926.1101 and 29 CFR 1910.1001, all employees who will be assigned to an occupation exposed to airborne asbestos must have an initial examination performed by a licensed physician.

The initial examination may cover the following items:

1. General medical history
2. Initial OSHA Medical Questionnaire
3. Respiratory Measurements
4. Anthropometric Measurements
    A. Height
    B. Weight
5. Vital Signs
    A. Blood Pressure
    B. Pulse
    C. Temperature
6. Ophthalmologic Screening
    A. Visual Acuity - near and far
    B. Color Vision
    C. Depth Perception
7. Urinalysis
8. Pulmonary Function Screen
    A. FEV-1, FVC, FEV1/FCV ratio
9. Chest X-ray
10. Complete physical exam by a licensed physician
11. Physician evaluation for respirator use clearance
12. Report of the medical evaluation.

A copy of the physician approval for occupational respirator use will be maintained on the job site and a copy of the medical exam will be given to the employee. All medical records will be filed and sorted in a safe place indefinitely and for a minimum of 30 years.

2. Annual Examination

All employees who may be exposed to airborne asbestos will undergo an annual medical examination, which will be the same as the Initial Examination, except for the OSHA questionnaire and the X-rays. The OSHA questionnaire will be the abbreviated form for use with annual examinations and the X-rays will be given every five years, except for those employees with 10+ years into the asbestos latency period and 35 to 45 years of age. This X-ray will be given every 2 years. All employees over 45 years of age must have the X-ray annually.

	Years since	Age of Employee:		
	1st exposure	15-35	35-45	45+
Frequency	0-10	every 5 yrs.	every 5 yrs.	every 5 yrs.
of X-rays	10+	every 5 yrs.	every 2 yrs.	annually

The annual signed physicians' opinion on fitness for work in a respirator in an asbestos environment will be maintained on the job site and a copy of the annual medical exam will be forwarded to the employee. All medical documentation will be stored and kept indefinitely for a minimum of 30 years.

3. Termination Examination

As per the OSHA standard at 29 CFR 1910.1001(1)(4)(I) and (ii), _____ will provide or make available a termination of employment medical examination for any employee who has been exposed to asbestos. The medical examination will be in accordance with the requirements of the periodic or annual medical examination and will be given, or made available, within 30 calendar days before or after the date of termination of employment.

4. Information provided to Physician

_____ will provide the following information to the examining physician:

1. A copy of the OSHA Regulations at 29 CFR 1926.1101 and Appendices D, E, and I.
2. A description of the employees' duties as they relate to asbestos exposure.
3. The employee's anticipated exposure level.
4. A description of any personal protective and respiratory equipment used.
5. Information from previous medical examinations not otherwise available to the physician.
6. Instructions to the physician not to reveal, in the written opinion given to the employer, specific findings or diagnoses unrelated to occupational exposure to asbestos, without a signed consent form from employee.

A copy of this information will be maintained in the company files and a reference to this information will be included in the medical file on each employee.

5. Physician's Written Opinion

_____ will establish, as a part of it's permanent records, a medical surveillance record on each employee. This record will be maintained for the duration of the employment, plus a minimum of 30 years. This record will be made available, upon written request, to OSHA, the affected employee, and former employees or their designated representatives. The employee medical record will contain at least the following information:

1. The name and social security number of the employee.
2. A copy of the employee's medical examination results, including the medical history, questionnaire responses, results of any tests and physicians recommendations.
3. Any employee medical complaints related to asbestos exposure.
4. A copy of or reference to the information provided to the physician by the employer.

Physician Information

This information is for compliance with the OSHA standard at 29 CFR 1926.1101(m)(3) and is to be used as a reference for all medical surveillance exams conducted for _____.

1. The employee's duties will be to work with asbestos containing building materials (ACBM) in an asbestos abatement setting. Various job descriptions are work area preparation, work inside the contaminated area (encapsulation, enclosure, removal), loading, transporting, and unloading of ACBM.

2. The employees' anticipated exposure level range will be from a trace (.001 f/cc) to an anticipated maximum of 10 f/cc. This exposure will vary with the task performed, but will mainly be below the PEL of 0.1 f/cc.

3. The personal protective equipment furnished with the employee will be a respirator, full body covering with disposable coveralls, latex gloves, and rubber boots. Hard hats will be issued when applicable. The respirator system used will be NIOSH approved for the work and will be well within the limits of the OSHA protection factor chart.

   The minimum respirator protection usually furnished by _____ is a half-mask air-purifying respirator equipped with P100 cartridges. If the fiber level in the ambient air in the work area ever elevates past 1 f/cc, the respiratory protection will be changed to a full-face air-purifying respirator.

4. According to federal regulations at 29 CFR 1926.1101(m)(4)(ii), the physician is to be instructed by the employer not to reveal in the written opinion given to the employer specific findings or diagnoses unrelated to occupational exposure to asbestos.

6. NOTIFICATION PROCEDURES

A notification program informs employees and building occupants about the presence of ACM in their facility. It shows the steps to take to avoid disturbing ACM. It also informs occupants and employees about what to do and who to contact in case of an asbestos-related emergency.

Notification of occupants can be done through letters, meetings and/or the posting of warning signs and labels. Warning signs and labels can be attached directly to ACM or posted to alert people to a hazard prior to entering an area. It is suggested that new employees receive this information during employee orientation. "Awareness" sessions like those discussed in Section 3 of this manual can also be used.

Each facility must also inform short-term workers and outside contractors who may come in contact with ACM, about the presence of ACM in the facility in which they are working. This step is necessary to avoid the disturbance of ACM during contracted activities, and to comply with the OSHA standard at 29 CFR 1926.1101(k)(2). OSHA requires that the building owner identify, quantify, and locate all ACM, and inform persons who may disturb the material before that disturbance takes place. OSHA holds the building owner responsible for employee exposure to asbestos in a facility, even though the employee does not work for him.

Notification Letters

Each facility should provide notification that complies with relevant federal, state, and local laws. Employees, tenants, and occupants should receive notification containing the details below:

* The presence and location of asbestos in their facility.

* The content, location, and availability of the Asbestos Inspection Report and O & M Plan.

* The health hazards associated with exposure to airborne asbestos fibers.

* The types of actions that could result in the release of asbestos fibers.

* The name, location, and phone number of the APM, or designee, in the event of damage or disturbance of ACM.

All contractors and short-term workers, including the telephone company, repair and utility workers and exterminators, are to be notified of the presence of ACM in the facility. The specific location of ACM in the areas where contractors and short-term workers are working is given along with instructions not to disturb any ACM. The APM, or designee, must be consulted prior to any disturbance of ACM. The contractor and short-term workers should sign the Contractor Notification Form, or equivalent form and the Short-term Worker Notification Form, or equivalent form, stating that they have been informed of ACM.

Each facility should instruct the appropriate contractors that no ACM may be installed without prior written approval of the APM, or designee. The contractor must sign a statement certifying that the products they used and/or installed are non-asbestos-containing materials. A Non-Asbestos-Containing Material Certification Form, or equivalent form, is to be signed by each contractor prior to installing products within the facility. This information will save subsequent testing and sampling prior to future maintenance, renovation, and demolition projects that affect this material.

Signs

Danger signs must be posted in regulated areas, as required by OSHA, any time disturbance of ACM is about to take place. To comply with this requirement, each facility must post warning signs at each entrance and exit to an area where O & M activities involving ACM are taking place. O & M activities include initial cleaning, repair, small-scale removal, and emergency response cleanup, regardless of the fiber contamination level.

Warning signs must comply with all relevant federal, state, and local laws and must bear the following:

DANGER
ASBESTOS
CANCER AND LUNG DISEASE HAZARD
AUTHORIZED PERSONNEL ONLY

(And where it is required, the sign will also include)

RESPIRATORS AND PROTECTIVE CLOTHING ARE REQUIRED IN THIS AREA

In cases where warning signs are posted because of fiber contamination levels, each facility should document:

* The location of warning signs.
* The extent of the contamination.
* The length of time the signs were posted.
* The corrective action taken to reduce contamination levels; and
* Proof of the action's effectiveness (i.e., air samples).

Signs must also be posted at the entrance to any mechanical area, warning of the presence of ACM, with instructions on who to contact before working in the area.

Labels

Each facility should attach warning labels on all mechanical system insulation that has not been sampled and proven not to contain asbestos. In addition, all suspect asbestos containing materials in routine maintenance areas should be labeled:

DANGER
CONTAINS ASBESTOS FIBER
AVOID CREATING DUST
CANCER AND LUNG DISEASE HAZARD

All labels must be clearly visible. Labels should be attached at the beginning and end of each continuous pipe run and at least every 75 feet. Extra labels should be required at each valve, flange, or change in direction. Each time a pipe passes through a wall, floor, or ceiling a label should be posted on each side of the penetration.

SAMPLE NOTIFICATION LETTER

Dear Occupants:

As you may be aware, this facility has had an asbestos survey completed and an O & M Program developed. The survey documents the areas that have asbestos containing materials (ACM), and the O & M Program provides the guidance needed to maintain ACM in good condition until its eventual removal. This survey and O & M Program are in the Asbestos Program Manager's office and is available during office hours to anyone for review.

Inhalation of asbestos fibers can be harmful. However, when ACM is maintained in good condition, the potential hazard diminishes, and ACM may be kept in place for the life of the building or until renovation could disturb it.

To avoid exposure, it is **important** to: **(1)** know what types of materials may contain asbestos; **(2)** avoid damaged areas; and **(3)** contact the building management when damaged areas are found so the problem can be immediately remedied. Common applications of asbestos in buildings have included spray-applied fireproofing, soundproofing, or thermal insulation, acoustic plaster soundproofing or ceiling tiles, pipe insulation, asbestos cement products (transite), floor tile and mastic, vinyl sheet flooring and backing, and roofing materials.

Most buildings contain some of these materials, but it is important to realize that not all of them contain asbestos. The survey pinpoints ACM and their locations throughout the building.

To prevent potential release of asbestos fibers, the Asbestos Program Manager must approve any activity that may disturb these materials.

Please call management concerning any damaged areas.

When feasible, we will continue the process of removing asbestos containing materials. All work is done to comply with relevant federal and state laws. Much of the work is done during off hours to further protect building occupants from exposure.

Should you have any questions or comments, please contact the building management.

7. PERIODIC SURVEILLANCE AND REINSPECTION PROGRAM

An important aspect of the O & M program is visual monitoring of ACM, done at set intervals. The purpose of the monitoring is to detect damage or deteriorated ACM as early as possible so that corrective action can be taken.

Custodial and maintenance personnel are instructed to observe the condition of ACM in their area. They are also instructed to report any damage to their supervisor and the APM, or designee, as soon as possible.

Periodic Surveillance

Although no formal training is required by regulatory agencies, it is recommended that person(s) conducting the periodic surveillance receive training and experience beyond the general awareness training. This may include EPA Inspector/Management Planner certification and training on interpreting the facility's Asbestos Assessment Study.

Periodic surveillance documents the condition of all ACM by using a Periodic Surveillance Form. A copy of the form is submitted to the APM, or designee. Periodic surveillance should be done at least every 6 months. This may be more frequent depending on such factors as accessibility, area use, and the type of ACM present.

Schools covered by AHERA are subject to special surveillance programs. The APM, or designee, should consult 40 CFR 763.92(b), for more details.

Reinspection

A complete reinspection of the facility by an accredited Inspector/Management Planner should be accomplished every 3 years and the O & M Plan updated at that time. This reinspection is necessary to keep the O & M Plan updated as to any response actions that may have occurred, and to address any change in the condition of ACBM. Any change in use of an area containing ACM or use of the functional space that contains the ACBM should be noted for purposes of assessment.

In February 1992, EPA published a useful checklist guide for reinspection’s titled "A Guide to Performing Reinspection Under The Asbestos Hazard Emergency Response Act (AHERA)" (EPA 77/B-92/001). The guide may be obtained by calling EPA's Toxics Hotline at (202) 554-1404.

8. EXPOSURE MONITORING

Air monitoring can be a useful tool to further evaluate the condition of ACM and its potential to release asbestos fibers. Air sampling, when done correctly, may provide early warning about any deterioration of ACM. To be meaningful, air monitoring is done over a long period of time throughout the entire building under normal use conditions.

Periodic Area Monitoring

Periodic air monitoring in a building is merely a supplement to an ACM surveillance program. Each facility may conduct periodic monitoring in buildings with friable ACM found in conjunction with air plenums, in areas of significant air movement, and in areas with significant vibration.

Air sampling is recommended on a regular basis, appropriate for the specific conditions as referenced above. The samples may be analyzed using either phase contrast microscopy (PCM) or transmission electron microscopy (TEM), or a combination of both. Each method has advantages and disadvantages.

	Advantages	Disadvantages
PCM	Standardized procedures Quick (less than 1 hour) Less Expensive	Sees only long &/or fat fibers; Can't distinguish between asbestos and non-asbestos fibers
TEM	Standardized procedures Sees thin &/or short fibers Distinguishes between asbestos and non-asbestos fibers	Slow (more than 6 hours) Expensive

Employee Exposure Monitoring

Each facility should provide an employee exposure monitoring plan to comply with relevant federal, state, and local laws. Although OSHA allows the use of previously generated data (see 29 CFR 1926.1101(f)) in place of actual employee air monitoring, air monitoring of employees should be done in order to better design work practices which not only protect the employee from exposure, but also protect the facility from potential contamination. The data, which this air monitoring generates, should be preserved in the permanent record in order to protect the employer or building owner from any future liability. However, even though employee air monitoring is done, a formal negative exposure assessment must document each disturbance or clean up of ACM.

9. WORK PERMIT SYSTEM

Each facility should implement a "work permit" program to control indiscriminate disturbance from maintenance, renovation, and remodel work. It is also recommended that a "work permit" program be designed to control other asbestos-related activities. A sample program is outlined below. If the facility contracts for asbestos-related activities, this task could be included in the bid specification and/or contract documents. The APM, or designee, may choose another person to assist in implementation and coordination.

The "work permit" system requires any person doing work impacting building materials in the facility to submit a Job Request Form, or equivalent form, to the APM, or designee, prior to doing any work. This form would identify the specific personnel who do the work, including outside contractors, and would describe:

* the time and location of the job in question;

* the type of job; and

* any known information about the presence of ACM.

Once the APM, or designee, receives the Job Request Form, the steps below are taken:

* Review data. Review the Asbestos Inspection Report and any other records to determine whether or not any asbestos will be affected by the job. If ACM is unlikely to be disturbed, the APM, or designee, will note the presence of ACM on the form. The APM, or designee, will instruct the proper people not to disturb the ACM and the steps to take in the unlikely event of a disturbance.

* Visit the site. Make a site visit of the proposed work if it is determined that ACM is present and likely to be disturbed. The APM, or designee does the site visit.

* Plan work practices. Comply with the O & M plan and all relevant federal, state, and local laws to minimize disturbance of ACM. If not found in the O & M manual, document the work practices to be used and add them to the O & M plan. New procedures must comply with all aspects of the O & M plan and relevant laws.

* Record information. Use a "Maintenance Work Authorization Form", or equivalent form, and send to the proper personnel. Provide a copy to any outside contractor involved in the work.

* Revisit the worksite. Visit the work site during the job. Document any observations on an "Evaluation of Work Form", or equivalent form. See that the work practices being used comply with the OSHA standard at a minimum.

* Filing. Place a copy of the forms listed above in the permanent files.

This work permit system is the key to avoiding accidental exposure to workers or contamination of the facility. It is therefore essential that the APM have the authority to enforce the program.

10. RECORD KEEPING

The purpose of record keeping is to document information regarding each facility's O & M activities. A well-maintained and organized system of record keeping will demonstrate that the health and safety of those working or visiting each facility was not compromised.

A benefit of a comprehensive, organized record keeping program is that renovation of a facility is easier because of historical documentation. Also, the complex legal issues involved with asbestos make record keeping especially important.

Each facility should keep the following, or equivalent, records:

ACTIVITY	RECORDS
O & M work done by outside Contractors	Copy of training documents Copy of Respirator Protection Program Copy of Medical Surveillance Program Final Clearance Documentation
Notification to occupants	Copy of notification letter or minutes, etc.
Notification to short-term Workers	Short-term Notification Record Everything listed for outside contractors
Training	OSHA Class IV (General Awareness) OSHA Class III (Small-scale, short duration work) Respirator Training Hazard Communication Training
Medical Surveillance	Physician's Written Opinion Name & SSN of employee Employee complaint, re-exposure Copy of information to physician
Respiratory Protection	Copy of training program Respirator Inspection Form Fit-test Record Copy of Respirator Protection Program
Periodic Surveillance	Periodic Surveillance Record
Re-Inspections	Re-inspection Record and Report
O & M Activities	Job Request Form Job Authorization Form Visual Inspection Report Notification to Regulators
Emergencies	Emergency Record
Fiber Release Episodes	Fiber Release Record
Transportation of Waste	Chain-of-custody Form Dump Receipts Hazardous Waste Manifest

Each facility also keeps records of all major abatement operations such as enclosure, encapsulation, and removal. The asbestos consultant and/or the abatement contractor may supply these records. The records below may be kept as part of abatement records:

* The contract documents including specifications, RFPs, and scope of work;

* The abatement contract qualifications;

* The abatement contractor submittals, including those specified in contract documents;

* The asbestos consultant qualifications;

* The asbestos laboratory qualifications including QA/QC plans;

* The results of analysis of all air samples;

* Contractor logbooks;

* The laboratory QA/QC records; and

* All final reports from consultant.

The APM, or designee, is responsible for keeping records. The APM, or designee, may need the assistance of clerical and maintenance staff to fulfill record keeping duties. At minimum, record keeping must meet relevant federal, state, and local laws.

	RECORDS	RETENTION
*	Medical surveillance	Employment + 30 years
*	Air Sampling/Employee Exposure Monitoring	30 years
*	Training	Employment + year (Recommended: 30 years)
*	Respiratory Protection (Inspections, fit-tests, and training)	30 years
*	All other records	30 years

Schools covered by AHERA are subject to additional record keeping requirements. The APM or designee should consult 40 CFR 763.94 for more information.

SAMPLE FORMS

TABLE OF CONTENTS

Page

Class IV (General Asbestos Awareness) Training Form 23

Class III (Small-Scale Worker) Training Form 24

Contractor Notification Form 25

Short-Term Worker Notification Form 26

Periodic Surveillance Form 27

Job Request Form 28

Maintenance Work Authorization Form 29

ACM Work Evaluation Form 30

Initial and Periodic Cleaning Form 31

Fiber Release Episode Report 32

Respirator Training Record 33

Medical/Safety Letter 35

Medical Authorization for Respirator Use 38

CLASS IV (GENERAL ASBESTOS AWARENESS)
TRAINING FORM

LOCATION OF TRAINING:

DATE OF TRAINING:

TRAINING PROVIDER:

DURATION FOR TRAINING PROVIDED:

LIST OF PEOPLE WHO ATTENDED THIS TRAINING

Print Name	Signature	Job Title

I, _____, the Asbestos Program Manager, or appointed designee, acknowledge that the above-listed people did attend this training.

SIGNATURE:_____ DATE:
Asbestos Program Manager (or appointed designee)

FACILITY:_____ APM:
(Print or type)

CLASS III (SMALL-SCALE WORKER)
TRAINING FORM

LOCATION OF TRAINING:

DATE OF TRAINING:

TRAINING PROVIDER:

DURATION FOR TRAINING PROVIDED:

LIST OF PEOPLE WHO ATTENDED THIS TRAINING

Print Name	Signature	Job Title

I, _____, the Asbestos Program Manager, or appointed designee, acknowledge that the above-listed people did attend this training.

SIGNATURE:_____ DATE:
Asbestos Program Manager (or appointed designee)

FACILITY:_____ APM:
(Print or type)

CONTRACTOR
NOTIFICATION FORM

To comply with relevant federal and state laws, and the Facilities Operations and Maintenance Policies and Procedures, Facility will provide the Contractor with data regarding the locations of asbestos-containing material (ACM). This will be done prior to the Contractor entering any building under the facility's jurisdiction.

Please complete this form and return to:

I,_____, representing and having authority for (company), hereby indicate and agree that a representative of _____ (name and title), has provided me information regarding the specific locations and materials that are asbestos-containing and which may be encountered or have the potential of being encountered during the course of activities on project _____(name or number) in (building).

I agree that neither I, nor any of my employees, agent, subcontractors, or other individuals or entities over whom I have any responsibility or control will disturb ACM as found in the Asbestos Survey for the above-mentioned building.

I further understand and agree that should I, my employees, agents, subcontractors or other individuals or entities over whom I have control, encounter any material(s) suspected of containing asbestos, said material(s) shall not be disturbed without first notifying the agency's Asbestos Program Manager, or appointed designee, and receiving approval that such material may be disturbed.

_____ _____

Print Name Signature

_____ _____

Company _____ Position_____

Date _____

SHORT-TERM WORKER
NOTIFICATION FORM

FACILITY:

BUILDING NAME OR NUMBER WHERE WORK IS TO BE PERFORMED:

DESCRIPTION OF WORK TO BE PERFORMED:

DATE WORK TO BE PERFORMED:

NAME OF PERSON PERFORMING WORK:

I have reviewed the facility's Asbestos Survey regarding the location(s) of asbestos-containing material (ACM) and have been cautioned against any disturbance and damage of these materials.

If my work requires the disturbance or damage of any ACM, or if I accidentally disturb or damage the material, I will stop my work and immediately inform the Asbestos program manager, or appointed designee.

_____ _____

Print Name Signature

_____ _____

Company _____ Position_____

Date _____

PERIODIC SURVEILLANCE FORM

BUILDING INFORMATION:

Building Number: _____Building

Name:

Location:

AREA INFORMATION:

Number: _____ Location:

Changes in Condition:

MATERIAL INFORMATION:

COMMENTS:

INSPECTED ON:_____ BY:_____ (Please Print)

SIGNATURE:_____ :

JOB REQUEST FORM

SUBMIT APPLICATION TO ASBESTOS PROGRAM MANAGER, OR APPOINTED DESIGNEE. DO NOT BEGIN WORK UNTIL AUTHORIZATION IS RECEIVED.

NAME: _____ DATE: _____

NUMBER: _____ REQUEST NUMBER: _____

START DATE: _____

ANTICIPATED FINISH DATE: _____

LOCATION OF WORK: _____

WILL ASBESTOS-CONTAINING MATERIALS BE AFFECTED? ___ YES ___ NO

NAME AND TELEPHONE NUMBER OF SUPERVISOR: _____

APM COMMENTS: _____

SIGNATURE: _____ DATE: _____
Asbestos Program Manager
(or appointed designee)

FACILITY: _____ APM: _____
(Print or type) (Print or type)

MAINTENANCE WORK
AUTHORIZATION FORM

FACILITY: _____ NO. _____

AUTHORIZATION IS GIVEN TO PROCEED WITH THE FOLLOWING MAINTENANCE-WORK:

PRESENCE OF ASBESTOS-CONTAINING MATERIAL (ACM):

___ ACM IS NOT PRESENT IN THE VICINITY OF THE MAINTENANCE WORK
___ ACM IS PRESENT BUT DISTURBANCE IS UNLIKELY. HOWEVER, IF CONDITIONS CHANGE, THE APM WILL RE-EVALUATE THE WORK REQUEST PRIOR TO PROCEEDING.
___ ACM IS PRESENT AND MAY BE DISTURBED.

THE FOLLOWING WORK PRACTICES SHALL BE EMPLOYED TO AVOID OR

MINIMIZE DISTURBANCE OF ACM: _____

_____

THE FOLLOWING PROTECTIVE EQUIPMENT SHALL BE USED/WORN DURING THE

WORK TO PROTECT WORKERS: _____

SPECIAL PRACTICES AND/OR EQUIPMENT REQUIRED: _____

_____

SIGNATURE: _____ DATE: _____
Asbestos Program Manager
(or appointed designee)

ACM WORK
EVALUATION FORM

FACILITY:

LOCATION OF WORK PERFORMED:

DATE OF WORK: APPROVAL FORM NO:

DESCRIPTION OF WORK:

EVALUATION OF WORK PREFORMED:

EVALUATION OF EQUIPMENT & PROCEDURES TO PROTECT WORKERS:

AIR SAMPLE RESULTS

NAME: _____ RESULTS:

NAME: _____ RESULTS:

NAME: _____ RESULTS:

STORAGE LOCATION:

DISPOSAL SITE: DATE:

SIGNED:_____ DATE:

Asbestos Program Manager
(or appointed designee)

INITIAL AND PERIODIC
CLEANING FORM

FACILITY:

BUILDING NAME:

TYPE OF CLEANING: _____ INITIAL _____ PERIODIC _____ OTHER

NAME OF PEOPLE PERFORMING CLEANING:

CLEANING METHODS (CHECK METHODS USED)

___ HEPA VACUUMED ___ WET METHODS ___ PROPER DISPOSAL

___ PROTECTIVE EQUIPMENT USED

WRITTEN DESCRIPTION OF CLEANING METHODS:

LOCATION OF CLEANING:

RESPONSE TEAM LEADER CERTIFIES THAT THE ABOVE CLEANING WAS DONE TO COMPLY WITH THE RELEVANT FEDERAL AND STATE LAWS AND THE FACILITIES MANUAL.

_____	_____	_____
Print Name	Signature	Date

CONTRACTOR REPRESENTATIVE CERTIFIES THAT THE ABOVE CLEANING WAS DONE TO COMPLY WITH THE FACILITIES CLEANING SPECIFICATIONS/ REQUIREMENTS.

_____	_____	_____
Print Name	Signature	Date

Asbestos Program Manager:

_____	_____	_____
Print Name	Signature	Date

FIBER RELEASE EPISODE (UNCONTROLLED RELEASE)
REPORT

FACILITY:

LOCATION OF FIBER RELEASE (BUILDING NAME, ADDRESS, ROOM NUMBER):

NAME OF PERSON REPORTING THE RELEASE:

DATE OF RELEASE:

DESCRIBE THE EPISODE:

DESCRIBE CLEAN-UP PROCEDURES:

NAME OF PERSON(S) CLEANING UP RELEASE:

ARE THEY CERTIFIED ASBESTOS WORKERS? ____ YES ____ NO

IF YES, WHAT ARE THE CERTIFICATION NUMBERS?

Signed:_____ Date: _____

Asbestos Program Manager
(or appointed designee)

RESPIRATOR TRAINING RECORD

Employee Name: _____ Date: _____

The following has been discussed with me:

1. The nature of the respiratory hazard.
2. Why engineering controls cannot be used in place of respiratory equipment.
3. The reasons why I must wear the respirator, and the disciplinary actions that will be taken for intentional incorrect wear.
4. What type of respirator will be used for particular hazards.
5. The limitations and capabilities of each respirator.
6. Purpose of the medical evaluation to determine authorization for respirator use.
7. The conditions that prevent a good face seal.
8. The necessity of wearing the respirator as instructed, without modification.
9. Recognizing and handling emergency situations when wearing a respirator.

I have been instructed in the following:

1. How to wear a respirator.
2. How to adjust a respirator.
3. How to determine a proper fit and to perform a fit-check every time I put on a negative-pressure, air-purifying respirator.
4. How to inspect the respirator.
5. How to clean the respirator.
6. How to store the respirator.

I understand the above items concerning respirator use, care, and inspection.

_____	_____	_____
Signature	Date	Witness

Make and Model of respirator:

Type of Mask:

Fit-Testing Method	Respirator Size
____ Quantitative Fit Test	____ Small
____ Banana Oil Test	____ Medium
____ Irritant Smoke	____ Large
___ Saccharin Test	
____ Positive-Pressure Fit-Check	
____ Negative-Pressure Fit-Check	

_____	_____
Employee's Signature	Fitter's Signature

MEDICAL/SAFETY LETTER

To Whom It May Concern:

The following is a description of our employee's duties as they relate to the employee's exposure to airborne asbestos.

_____ is a _____ in our facility's maintenance department.

His/Her primary asbestos-related job duties include the following:

* Small-scale, short-duration activities.
* Minor fiber release episode clean-ups.
* Initial cleaning.

OSHA Class III (small-scale, short-duration) Activity:

Our employee may perform small-scale, short-duration asbestos abatement activities. Normally, this work involves tasks such as, but not limited to:

* Removal, encapsulation, enclosure, or repair of asbestos-containing materials in small quantities.
* Replacement of asbestos-containing gaskets on valves and other items.
* Installation of electrical conduits or other items through or proximate to asbestos-containing materials.

The anticipated exposure levels while working on small-scale, short-duration activities is expected to be below 0.1 fibers per cubic centimeter (f/cc) based on an 8-hour TWA. Of course, our employees are required to wear a negative-pressure respirator and disposable coveralls, at a minimum, every time that they handle ACM.

Minor Fiber Release Episodes:

Our employee may perform clean-up of minor fiber releases. The anticipated exposure levels while cleaning up a minor fiber release episode is expected to be below 0.1 f/cc based on an 8-hour TWA. Our employees are required to wear, at a minimum, a negative-pressure respirator and disposable clothing while performing this work.

Initial Cleaning:

Our employee may perform initial cleaning in buildings with friable ACM. The anticipated exposure levels while clean-up of a minor fiber release episode is expected to be below 0.1 f/cc based on an 8-hour TWA. Our employees are required to wear, at a minimum, a negative-pressure respirator and disposable clothing while performing this work.

If information from the previous medical examination of the employee is available, this information will be brought to the exam with the employee.

A copy of the following OSHA regulations has also been provided:

* 29 CFR 1926.58
* Appendix D
* Appendix E
* Appendix I

Important note to physician: To comply with regulation 1926.58 of OSHA, the physician shall not reveal in the written opinion given to the employer, specific findings or diagnoses unrelated to occupation exposure to asbestos, tremolite, anthophyllite, or actinolite.

If you have any questions or concerns regarding this information, please contact me at the below address or phone:

Name _____ Phone _____

Street _____ City _____

State _____ Zip _____

Agency _____ Facility _____

==========

Documentation

Name of Clinic _____ Phone _____

Street _____ City _____

State _____ Zip _____

Signature of Clinic Representative _____ Date _____

Signature of Employee _____ Date _____

MEDICAL AUTHORIZATION FOR RESPIRATOR USE

Employer:

Employee: Social Security Number:

Date of Birth:

Supervisor Department

Circle Types of Respirator(s) to Be Used:

Atmosphere-supplying respirator	Continuous-flow respirator
Open-circuit SCBA	Closed-circuit SCBA
Supplies-air respirator	Combination air-line SCBA
Air-purifying (non-powered)	Air-purifying (powered)

Level of Work Effort (Mark one)
____ Light ____ Moderate ____ Heavy ____ Strenuous

Extent of Use

1. On a daily basis
2. Occasionally - but more than once a week
3. Rarely - or for emergency situations only

Length of Time of Anticipated Effort in Hours:

Special Work Considerations (i.e., high places, temperature, hazardous material, protective clothing, etc.) If none, state "none".

_____ _____
Asbestos Program Manager Signature Date
(or appointed designee)

Employee:

Have you ever worn a respirator before? ____ Yes ____ No

If yes, describe any difficulties noted with respirator use:

_____ _____
Employee Signature Date

MEDICAL AUTHORIZATION FOR RESPIRATOR USE (CONT.)

Physician's Evaluation:

CLASS: (Circle)
1. No Restrictions on respirator use
2. Some specific use restrictions
3. No respirator use permitted

Restrictions:

Examining Physician's Signature: _____ Date: _____

11. WORK PRACTICES

Work practices in each of the three areas addressed in this section should be specific to the ACBM located in the facility, and to the functional spaces (room/area) which contain the ACBM.

A. Special Cleaning

All initial and periodic or additional cleaning areas of friable or damaged ACBM must be done with wet methods, HEPA vacuums, steam cleaners or a combination of those methods. The training program should impress on the maintenance and custodial staff the importance of *never* using conventional vacuums to clean up asbestos contaminated debris, and *never* dry sweep or dust in contaminated environments. Initial cleaning should be done in protective coveralls and respirators, with proper decontamination procedures being followed upon completion. All waste or debris should be treated as asbestos and properly disposed of. For regulatory guidance, see AHERA at 40 CFR 763.91(c) and OSHA at 29 CFR 1926.1101(g)(10) and (l)(1)&(2).

These special cleaning procedures will also apply to any clean up after an uncontrolled fiber release episode.

B. Emergency Response

An accidental contamination or "fiber release episode" may be addressed in one of two ways, depending on the size of the episode. For small or "minor" fiber release episodes (i.e., the falling or dislodging of 3 square or linear feet or less of friable ACBM), the custodial or maintenance people trained in the 16-hour O & M procedures may address cleanup in the following manner:

1. Turn off the HVAC system in the area.
2. Thoroughly saturate the debris.
3. Clean the area using the methods mentioned in A above.
4. Dispose of all debris as asbestos using the methods in Chapter 11.
5. Immediately repair the damages to the ACBM.

For larger or "major" fiber release episodes (i.e., the falling or dislodging of more than 3 square or linear feet), the custodial or maintenance people trained in the 16-hour O & M procedures may only:

1. Restrict entry in the area and post signs.
2. Turn off the HVAC system.
3. Contact the accredited outside contractor or in-house emergency response team.

The clean-up of a major fiber release episode should include planning, special work practices (see OSHA at 29 CFR 1926.1101), final clearance documentation, and record keeping of a major asbestos abatement project.

C. Maintenance Work Practices

The user of this document should be familiar with all the major federal requirements for conducting asbestos related maintenance work (OSHA 29 CFR 1926.1101(g)(9) &(10); AHERA 40 CFR 763, Subpart E, Appendix B; NESHAP 40 CFR 61.145 and 61.150 where applicable) and design his work procedures within the intent of these rules and guidelines. If more stringent safeguards are needed to protect workers and the facility, they should be researched and implemented.

An enormous amount of this research specific to O & M work procedures has already been completed by a panel of over 100 experts under the guidance of the National Institute of Building Sciences (NIBS). NIBS has produced a "Guidance Manual, Asbestos Operations and Maintenance Work Practices" which details approximately 125 O & M work procedures step by step. Also included are sections on Asbestos Program Manager and asbestos worker procedures preparatory to these work practices. To duplicate any of this work here would be redundant and probably inadequate, as the work procedures must necessarily be specific to both the ACBM being addressed and the exposure element involved.

The APM is urged to obtain a copy of the NIBS guide and use it in the design and execution of the work to be addressed at each particular site. NIBS may be contacted at: National Institute of Building Sciences, 1201 L street, N.W., Suite 400, Washington, DC 20005, or by telephone at (202) 289-7800.

12. DISPOSAL/STORAGE REQUIREMENTS

The following section explains the federal requirements for storage and disposal of asbestos-containing waste. Although the federal regulations will not normally apply to maintenance amounts of generated asbestos waste, they should be used as guidelines for liability management. ***Please consult with the state and local regulatory agencies if more stringent requirements apply.***

1. GENERATOR REQUIREMENTS

The term "Generator" refers to the owner or operator of the facility or the owner or operator of the demolition/renovation operator or both. The generator is legally responsible and liable for the proper handling, storage and disposal of all ACM abated from the building(s) and/or property. Refer to the NESHAP requirements at 40 CFR 61.150 for the federal requirements.

2. HANDLING OF ASBESTOS WASTE

The generator must discharge no visible emissions during collection, processing, packaging, or transportation of the waste. To accomplish this requirement, the generator must adequately wet the waste material and seal it while wet in leak tight containers or wrapping. The containers must be labeled with the following 3 labels:

(OSHA)

DANGER
CONTAINS ASBESTOS FIBERS
CANCER AND LUNG DISEASE HAZARD
AVOID BREATHING AIRBORNE ASBESTOS FIBERS

(DOT)

RQ ASBESTOS
NA 2212
CLASS 9

(EPA)

Name and address of generator
(site specific)

Although not specified by federal law, 6 mil. poly bags are normally used where applicable as a minimal level of compliance.

3. DISPOSAL

All asbestos-containing waste should be deposited as soon as is practical at a waste site approved by the state NESHAP agency. Vehicles used to transport the waste must be marked during loading and unloading with the following sign:

DANGER
ASBESTOS DUST HAZARD
CANCER AND LUNG DISEASE HAZARD
AUTHORIZED PERSONNEL ONLY

4. ON-SITE STORAGE

In some instances, the generator cannot arrange for prompt off-site transportation of the asbestos waste. Also, it may not be economically feasible for a generator to provide transportation until substantial waste has been generated. However, there may be local regulations which govern how long the waste may be stored on-site. The limit for storing waste on-site in most states is 3 months to one year beginning on the date the asbestos waste is generated. It is advisable, but not required, to place the disposal bags in impermeable containers (i.e., steel, fiberboard, or fiberglass drums). The date of generation should be marked on the outside of the containers. If the storage vessels are also deemed for disposal, the appropriate labels must be affixed to the outside of the container.

5. WASTE SHIPMENT RECORD

A "Waste Shipment Record" must be sent with the waste transporter to the disposal site, containing the following information:

A. Name, address, and telephone of Generator
B. Name and address of local NESHAP authority
C. Approximate quantity in cubic yards
D. Name and telephone of disposal site operator
E. Name and site location of disposal site
F. Date transported
G. Name, address, and telephone of transporter
H. Certification of compliance

If a signed copy is not received back from the disposal site within 35 days, the transporter, and/or disposal site must be contacted for information. If the signed copy is then not received within 45 days of shipment, the local or regional EPA must be contacted in writing. All waste shipment records must be retained for at least 2 years. An example of a waste shipment records form and instructions are provided.

Waste Shipment Record

(1) Work Site Name _____ Mailing Address _____

Owner's Name _____ Owner's Telephone Number _____

(2) Operator's Name and address _____ Operator's Telephone Number _____

(3) Waste Disposal Site (WDS) Name and Mailing Address _____

Physical Site Location _____ WDS Telephone Number _____

(4) Name, and address of responsible agency _____

(5) Description of Materials _____

(6) Containers: Number and type _____

(7) Total quantity m^3 (yd^3) _____

(8) Special handling instructions and additional information: _____

(9) Operators Certification: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and government regulations.

Printed/typed name & title _____ Signature _____ Date _____

(10) Transporter 1 (Acknowledgment of receipt of materials):

Printed/typed name & title _____ Signature _____ Date: _____

Address and telephone number _____

(11) Transporter 2 (Acknowledgment of receipt of materials)

Printed/typed name & title _____ Signature _____ Date _____

Address and telephone number _____

(12) Discrepancies: _____

(13) Waste disposal site owner or operator: Certification of receipt of asbestos materials covered by this manifest except as noted in item 12.

Printed/typed name & title _____ Signature _____ Date _____

Instructions

Waste Generator Section (Items 1-9)

1. Enter the name of the facility at which asbestos waste is generated and the address where the facility is located. In the appropriate spaces, also enter the name of the owner of the facility and the owner's phone number.

2. If a demolition or renovation, enter the name and address of the company and authorized agent responsible for performing the asbestos removal. In the appropriate spaces, also enter the phone number of the operator.

3. Enter the name, address, and physical site location of the waste disposal site (WDS) that will be receiving the asbestos materials. In the appropriate spaces, also enter the phone number of the WDS. Enter "on-site" if the waste will be disposed of on the generator's property.

4. Provide the name and address of the local, state, or EPA regional office responsible for administering the asbestos NESHAP program.

5. Indicate the types of asbestos waste materials generated. If from a demolition or renovation, indicate the amount of asbestos that is:

    * Friable asbestos material
    * Non-friable asbestos material

6. Enter the number of containers used to transport the asbestos materials in item 5. Also enter one of the following container codes used in transporting each type of asbestos material (specify any other type of container used if not listed below):

    * DM - Metal drums, barrels
    * DP - Plastic drums, barrels
    * BA - 6 mil plastic bags or wrapping

7. Enter the quantities of each type of asbestos material removed in units of cubic meters (cubic yards).

8. Use this space to indicate special transportation, treatment, storage, disposal, or bill of lading information. If an alternate waste disposal site is designated, note it here. Emergency response telephone numbers or similar information may be included here.

9. The authorized agent of the waste generator must read and then sign and date this certification. The date is the date of receipt by transporter.

*NOTE: The waste generator must retain a copy of this form.

Transporter Section (Items 10 & 11)

10,11. Enter the name, address, and telephone number of each transporter used, if applicable. Print or type the full name and title of the person accepting responsibility and acknowledging receipt of materials as listed on this waste shipment record for transport. Enter date of receipt and signature.

* NOTE: The transporter must retain a copy of this form.

Disposal Site Section (Items 12 & 13)

12. The authorized representative of the WDS must note in this space any discrepancy between waste described on this manifest and waste received as well as any improperly enclosed or contained waste. Any rejected materials should be listed, and the destination of those materials provided. A site that converts asbestos-containing waste material to non-asbestos material is considered a WDS.

13. The signature (by hand) of the authorized WDS agent includes acceptance and agreement with statements on this manifest except as noted in item 12. The date is the date of signature and receipt of shipment.

Note: This WDS must retain a completed copy of this form. The WDS must also send a completed copy to the operator listed in item 2.

13. COST ESTIMATES OF CLEANING EQUIPMENT

The list below includes enough equipment for small-scale abatement jobs. Most facilities will not need as much equipment and, therefore, much of this equipment is optional. This section will not be applicable to facilities that do not have an in-house program for small-scale abatement.

One Time Purchase	Character	Costs
HEPA vacuum	w/1.5" attachments	1600.00
Full face respirator		141.00
Half face respirator		18.00
Personal monitor kit	8 hrs. at max. capacity	285.00
Mister - hand held	quart	1.50
with tank	3 gallon	35.00
Caution signs	12 or more (10 x 14")	3.85
Extension cord	100 feet	15.00
Ground fault circuit interrupter		15.00
Nylon brushes	5	32.52

Disposable Materials/Cleaning Supplies

Filters: HEPA Vacuum	12-gallon capacity	65.00
paper vacuum	microfilter	7.50
HEPA respirator	case of 10	22.50
Vacuum bags	6 mil polyethylene	34.65
Wet wipe cloths	20 x 40" case of 300	10.00
Muslin	10 square yards	16.20
Cheese cloth	10 square yards	7.00
Latex gloves	box of 100	62.00
5-micron water pump filter		3.50

Abatement Supplies

Surfactant	5 gallons	45.00
Encapsulant lag kote	5 gallons	40.72
lag kloth	5 gallons	75.50
Duct tape	2" case of 24	87.00
Protective disposable clothing with hooded, zipping type, booties	case of 25	43.00
6 mil polyethylene plastic bags	22 x 50" case	45.00
polyethylene	20 x 100' rolls	27.00
Glove bags	44 x 60" case of 25	90.00
Razor knives	10	35.00
Wire saws	10	15.00
Scrapers	10	77.70
Wire cutters	10	75.00
Chisel rock hammer	1	25.00

14. TERMS AND ABBREVIATIONS

ACBM - Asbestos Containing Building Materials.

Accessible - When referring to ACM, accessible means the material is subject to disturbance by building occupants, custodial, or maintenance personnel in the course of their normal activities.

Accredited or Accreditation - Refers to a person, firm, or laboratory having met the requirements found in Section 206 of Title II of the AHERA Act.

ACM - Asbestos Containing Materials.

Acoustical Material - Material which often contains Asbestos, Vermiculite, and Perlites that has been applied to ceilings or walls to dampen sound.
AHERA - The Asbestos Hazard Emergency Response Act of 1986 (40 CFR Part 763). Final rule as published in the Federal Register, Vol. 52, No. 210.

Air Plenums - A space above a ceiling used to circulate or condition air throughout the adjacent areas.

Air Samples - Samples of airborne fibers taken by drawing air through an appropriate filter media which traps the fibers. This sample is then analyzed by polarized light or electron microscopy.

Amosite - Brown asbestos, with brittle fibers often used for extreme thermal conditions.

APM - Asbestos Program Manager.

Approved Shower - A shower used for decontamination, with wastewater filtered down to the 5 micron range, and capable of supplying hot water at a temperature of 100 degrees F. or greater.

APR - Air-purifying respirator.

Asbestos - A naturally occurring mineral which includes chrysotile, actinolite, anthophyllite, tremolite, or crocidolite in fibrous structure, or any combination of these that have been chemically treated or altered, as determined by polarized light microscopy (PLM).

Asbestos Containing Material (ACM) - When referring to a building means any material or product that contains greater than 1% of asbestos.

Asbestos Containing Building Materials (ACBM) - is surfacing ACM, thermal ACM, or miscellaneous ACM that is found in or on the structural members of a building.

Asbestos Debris - Pieces of ACBM that can be identified by color, texture, or fiber content as originating from adjacent ACM.

Asbestos Fiber - Is any fiber of chrysotile, actinolite, amosite, tremolite, anthophyllite, crocidolite at least 5 micrometers in length and with a length-to-width ratio (aspect) of greater than 3 to 1.

Asbestos Management Plan - A document to assist in administering the asbestos program in a facility, that includes recommendations for response to ACM in the building, and which includes the O & M Program.

Asbestosis - A chronic disease during which the lungs become scarred because of a biological reaction to the inhalation of asbestos fibers.

ASHAA - Asbestos School Hazard Abatement Act of 1984. A funding vehicle for schools.

Authorized Person - Is any person authorized by an employer and required by work duties to be present in regulated area or activities.

Bulk Samples - Samples of suspect asbestos containing material. These samples are then analyzed by Polarized Light Microscopy (PLM).

CFR - Code of Federal Regulations.

Chrysotile - White asbestos, fine, silky, flexible fibers with high tensile strength.

Clean Room - Is an uncontaminated room having facilities for the storage of employees' street clothing and uncontaminated supplies and equipment.

Competent Person - Is a person capable of identifying existing asbestos hazards in the workplace and who has the authority to take prompt corrective measures.

Condition Factors - A description of the ACM's condition.

Crawl Space - An area of a building only a few feet high, often below the building level, but above the ground.

Crocidolite - Blue asbestos, has brittle fibers.

Decontamination Area - Is an enclosed area adjacent and connected to the work area consisting of an equipment room, shower area, and clean room which are used for the decontamination of personnel, equipment, and materials.

Demolition – As regulated by the NESHAP, means the wrecking or taking out of any load-supporting structural member. It generally should be interpreted as wrecking the structure or leveling the site.

Doffing - The action of taking off personal protective equipment.

Donning - The action of putting on personal protective equipment.

Employee Exposure - Exposure to airborne asbestos, actinolite, tremolite, anthophyllite, or any combination of these minerals that would occur if the employees were not wearing respiratory protection.

Encapsulation - The treatment of ACM/ACBM in place in a building with a liquid material that bridges or penetrates the asbestos fibers in an adhesive matrix to prevent the release of those fibers.

Bridging - Encapsulation technique that creates a membrane on the ACM surface.

Penetration - Encapsulation technique where the encapsulating mixture penetrates the ACM material and binds its components together.

Enclosure - Is an airtight, impermeable, permanent mechanical barrier around or over ACM/ACBM to prevent the release of asbestos into the air.
Equipment Room - A contaminated room located within the decontamination area, that is supplied with impermeable bags for the disposal of contaminated personal protective clothing and equipment. Usually called the "dirty" room.
F/CC - Fibers per cubic centimeter. A measurement to express the level of fibers in the air.

Facility - Is any institutional, commercial, public, industrial, or residential structure, installation or building; any ship; any active or inactive waste disposal sites. Defines a facility where NESHAP applies. A single residential building no larger than 4 dwelling units is not a facility.

Facility Component - Any pipe, duct, boiler, tank, reactor, turbine or furnace at or in a facility; or any structural members of a facility.

Fiber Release Episode - Is any uncontrolled or unintentional disturbance of ACM/ACBM that results in a visible emission.

Fibrils - A small bundle of individual fibers.

Fireproofing - Material sprayed or troweled onto facility components or structural members to prevent or retard their loss of strength during a fire. Often contains asbestos.

Fit-testing - The action, either by qualitative or quantitative measurement, of ensuring a respirator has a proper seal to the workers' face and is functioning properly.

Friable - Easily crumbled by hand pressure or material that has been made friable.

Friable Asbestos Containing Material - Is any material, containing greater the 1% asbestos, that can be crumpled, pulverized, or reduced to powder, when dry, by hand pressure.

Glove bag - A poly bag used to remove pipe insulation.

Hazard - Is any circumstance, mechanism, or event which has the potential to create injury or loss.

HEPA – High Efficiency Particulate Air. This prefix to the word "filter" defines a level of filter efficiency capable of trapping and retaining at least 99.97% of all mono-dispersed fibers greater than 0.3 micrometers in diameter.

Homogeneous Area - An area that is determined to be uniform in color, texture, depth, content, or age.

Inadvertent Contamination - The disturbance of ACM/ACBM not caused intentionally by individuals or parties involved in the project.

Inspection - The process of locating ACM, determining its condition, and reporting the results. This inspection is the basis of the management plan.

Latency - The period of a disease without manifestation of symptoms. The length of time between exposure and diagnosis.

Magnesia - A type of thermal insulation, usually white and often pre-formed into squares or rectangles, often contains asbestos.

Mechanical Area - An area of a facility not normally accessed by the public; often contains HVAC equipment, boilers, heat exchangers, tanks, pipes, ducts, and other mechanical equipment.

Medical Surveillance Program - A program to ensure that personnel are physically and psychologically able to wear respiratory protection equipment and are able to perform asbestos related activities.

Mesothelioma - A cancer of the lining of the lungs (pleural) or abdominal (peritoneal) cavity.

Miscellaneous ACM - Miscellaneous material that contains greater than 1% asbestos.

Miscellaneous Material - Building materials that are not thermal system or surfacing material.

MSDS - Material Safety Data Sheets. A technical document or report that provides precautions, protective measures, chemical makeup (active ingredients), and steps to take after a release. A primary source of information concerning chemical hazards.

Mudded Joint Fittings - Plaster compound packed onto pipe joints and around valves, tees, and pumps for thermal insulation; often contains asbestos; also called “hard-cast fittings”.

Negative Air - A reduced pressure, or pressure differential process where the air pressure in the work area is less than that outside the work area. The differential is measured in inches of water column (vacuum).

NESHAP - National Emission Standards for Hazardous Air Pollutants.

NIOSH - National Institute of Occupational Safety and Health. The agency that sets the standards for respirators and other protective equipment.

Non-friable - That material in a building which when dry may not be crumbled, pulverized, or reduced to powder by hand pressure.

O & M - Operations and Maintenance.

Operations and Maintenance Program (O & M) - A program aimed at maintaining friable ACM/ACBM through training, awareness, and standardized work practices. An outreach of a comprehensive O & M program is the cleanup and repair of previously damaged ACM, as well as the prevention of further damage.

OSHA - The Occupational Safety and Health Administration of the United States Department of Labor.

Outside Air - The air outside the regulated area; often called "ambient".

Packing - Material used as gasketing in valves; often contains asbestos.

PAPR - Powered Air Purifying Respirator.

PCM - Phase Contrast Microscopy. A method used to analyze air samples for the presence of airborne fibers. **PEL** - Permissible Exposure Limit. A level of airborne asbestos above which no unprotected employee shall be exposed. Currently the PEL (Federal) is 0.1 f/cc of air as an 8-hour Time Weighted Average, and an Excursion Limit of 1.0 f/cc measured for 30 minutes. See 29 CFR 1926.1101.

Planned Renovation - Facility work such as remodel, or asbestos removal, which has been planned.

PLM - Polarized Light Microscopy. A method used to analyze bulk samples for the presence of asbestos.

Potential Damage - Circumstances in which:

1. Friable ACBM is in an area regularly used by building occupants, including maintenance personnel, in the course of their normal duties, and

2.There are indications that there is a reasonable likelihood that the material or its covering will become damaged, deteriorated, or delaminated due to factors such as changes in building use, changes in operations and maintenance practices, changes in occupancy, or recurrent damage.

Preventive Measures – As used in the AHERA regulation, a preventive measure is a response to non-friable ACM and/or small scale, short duration work on ACM. It is also used as a recommended remedy for friable or TSI in good condition but about to become significantly damaged.

Regulated Areas – An area in which Class I, II or III asbestos work is done. It must be posted with regulatory posting and administered by a competent person.

Re-Inspection - A re-evaluation of the ACM's condition once every three years by an accredited inspector.

Removal - A response action where the asbestos is stripped or permanently removed

Renovation - Is the modification of any existing structure or portion thereof where exposure to airborne asbestos may result.

Repair - Is the restructuring, overhauling, rebuilding, or reconditioning of structures or surfaces where asbestos is present. Repair is a response action under AHERA, requiring certified persons to design and conduct the work.

Respirator - A device worn over the mouth and nose to prevent the inhalation of noxious substances.

Respiratory Protection Plan - A program to provide the information, training, and equipment necessary for proper respiratory protection while working with ACM.

Response Action - Methods of controlling asbestos that include Repair, Removal, Encapsulation, O & M, or Enclosure. A response action is a response to friable material or TSI, bigger than maintenance, and inside the building.

Routine Maintenance Area - An area, such as a boiler room or mechanical room, not normally frequented by the public in which maintenance employees or contract workers regularly conduct maintenance activities.

SEM - Scanning Electron Microscopy. A method to analyze air or bulk samples for the presence of asbestos.

Serpentine - A major classification of asbestos minerals. Chrysotile is serpentine asbestos.

Surfacing Material - That material which is sprayed-on, troweled-on, or otherwise applied as acoustical plaster, fireproofing, or as decorative finishes.

TEM - Transmission Electron Microscopy. Currently the most definite analysis method for the determination of asbestos presence in air, water, or bulk samples.

Thermal System Insulation - Material applied to pipes, fittings, boilers, interior mechanical structures, and ducts to prevent heat loss or gain, condensation or for other purposes. TSI is mechanical system insulation.

TSCA - Toxic Substance Control Act.

TWA - Time Weighted Average. An average concentration of material over an 8 hour time period.

TYVEK - A brand name for non-breathable disposable clothing worn while working with asbestos.

USEPA - United States Environmental Protection Agency. The agency charged with implementing AHERA and NESHAP.

Visible Emissions - Any emissions, which are visually detectable without special instruments coming from asbestos containing material. Visible emissions include trash on the ground and water leaking out of containers.

Wet Cleaning - A cleaning technique where the material is kept wet, and/or towels or mops are used to reduce the potential of the material becoming airborne.

SECTION 9

♦

EXAMPLE OF INITIAL & ANNUAL NOTIFICATION

DOMINION

EXAMPLE OF INITIAL AND ANNUAL NOTIFICATION LETTER

Date: July 16, 2025

To Whom It May Concern,

In accordance with the Asbestos Hazard Emergency Response Act (AHERA), accredited building inspectors have completed an asbestos inspection of the Kyrene Middle School campus, located at 1050 East Carver Road in Tempe, Arizona. The inspection, performed June 11 to June 12, 2025 and June 16, 2025, was conducted in accordance with the Environmental Protection Agency's (EPA) Rule "Asbestos-Containing Materials in Schools", 40 CFR Part 763.

Samples of suspect asbestos-containing materials were collected during the inspection and were submitted to a laboratory for analysis.

A copy of the inspection report for the buildings on the Kyrene Middle School campus, as well as the periodic surveillance records and the site's Management Plan are kept at the District LEA's office. An additional copy of the previously referenced documents are available during normal business hours from 8:00 a.m. to 5:00 p.m. in the Administrative Office of Kyrene Middle School.

Sincerely,

Kyrene Elementary School District

DOMINION ENVIRONMENTAL CONSULTANTS, INC.
20045 North 19th Avenue - Building 7• Phoenix, Arizona 85027
Tel: (623) 516-1415 Fax: (623) 516-0017
www.dominion-env.com

SECTION 10

♦

COST ESTIMATION

KYRENE ELEMENTARY SCHOOL DISTRICT
Kyrene Middle School

COST ESTIMATION				
Asbestos-Containing Building Materials	**Location**	**Estimated Quantity**	**Cost (per Sq. Ft.)**	**Estimated Removal Cost**
White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Bldg E/L	12,000	$5.00	$ 60,000.00
Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Bldg E/L	12,000	$5.00	$ 60,000.00
Black 12" x 12" Vinyl Floor Tile (VCT)	Bldg E/L	2,000	$5.00	$ 10,000.00
Mastic for Black 12" x 12" Vinyl Floor Tile (VCT)	Bldg E/L	2,000	$5.00	$ 10,000.00
Black Stair Tread	Bldg E/L	200	$5.00	$ 1,000.00
Mastic for Black Stair Tread	Bldg E/L	200	$5.00	$ 1,000.00
Brick	Bldg E/L	120,000	$5.00	$ 600,000.00
Mortar for Brick	Bldg E/L	120,000	$5.00	$ 600,000.00
Tacboard	Bldg E/L	1,500	$6.00	$ 9,000.00
Knockdown Drywall System	Bldg E/L	3,000	$12.00	$ 36,000.00
Brown Fiberglass Reinforced Plastic (FRP)	Bldg E/L	5,000	$5.00	$ 25,000.00
Mastic for Brown Fiberglass Reinforced Plastic (FRP)	Bldg E/L	5,000	$5.00	$ 25,000.00
2' x 4' Drywall Ceiling Tile	Bldg E/L	5,000	$5.00	$ 25,000.00
Brown 6" x 6" Ceramic Floor Tile	Bldg E/L	5,000	$5.00	$ 25,000.00
Grout for Brown 6" x 6" Ceramic Floor Tile	Bldg E/L	500	$3.00	$ 1,500.00
Thinset for Brown 6" x 6" Ceramic Floor Tile	Bldg E/L	5,000	$5.00	$ 25,000.00
Interior Caulking	Bldg E/L	200	$3.00	$ 600.00
Exterior Caulking	Bldg E/L	200	$3.00	$ 600.00
Gray Sink Coating	Bldg E/L	75	$4.00	$ 300.00
Brown 4" x 6" Ceramic Wall Tile	Bldg E/L	2,000	$5.00	$ 10,000.00
Grout for Brown 4" x 6" Ceramic Wall Tile	Bldg E/L	200	$3.00	$ 600.00
Mastic for Brown 4" x 6" Ceramic Wall Tile	Bldg E/L	2,000	$5.00	$ 10,000.00
Dark Brown 6" x 6" Replacement Ceramic Wall Tile	Bldg E/L	1,000	$5.00	$ 5,000.00
Grout for Replacement Ceramic Wall Tile	Bldg E/L	100	$3.00	$ 300.00
Mastic for Replacement Ceramic Wall Tile	Bldg E/L	1,000	$5.00	$ 5,000.00
White w/Brown 4" x 4" Ceramic Wall Tile	Bldg E/L	1,000	$5.00	$ 5,000.00
Grout for White w/Brown 4" x 4" Ceramic Wall Tile	Bldg E/L	100	$3.00	$ 300.00
Mastic for White w/Brown 4" x 4" Ceramic Wall Tile	Bldg E/L	1,000	$5.00	$ 5,000.00
Green 4" x 4" Ceramic Wall Tile	Bldg E/L	250	$5.00	$ 1,250.00
Fixture Caulking	Bldg E/L	30	$3.00	$ 90.00
Divider Wall	Bldg E/L	5,000	$5.00	$ 25,000.00
Black Rubber Flooring	Bldg E/L	2,000	$5.00	$ 10,000.00
Tan 4" x 4" Ceramic Wall Tile	Bldg E/L	4,000	$5.00	$ 20,000.00
Grout for Tan 4" x 4" Ceramic Wall Tile	Bldg E/L	400	$3.00	$ 1,200.00
Mastic for Tan 4" x 4" Ceramic Wall Tile	Bldg E/L	4,000	$5.00	$ 20,000.00

KYRENE ELEMENTARY SCHOOL DISTRICT
Kyrene Middle School

COST ESTIMATION				
Asbestos-Containing Building Materials	**Location**	**Estimated Quantity**	**Cost (per Sq. Ft.)**	**Estimated Removal Cost**
Blue 4" x 4" Ceramic Wall Tile	Bldg E/L	1,000	$5.00	$ 5,000.00
Tan 2" x 2" Ceramic Floor Tile	Bldg E/L	5,000	$5.00	$ 25,000.00
Grout for Tan 2" x 2" Ceramic Floor Tile	Bldg E/L	500	$3.00	$ 1,500.00
Thinset for Tan 2" x 2" Ceramic Floor Tile	Bldg E/L	5,000	$5.00	$ 25,000.00
Green 2" x 2" Ceramic Floor Tile	Bldg E/L	250	$5.00	$ 1,250.00
Blue 2" x 2" Ceramic Floor Tile	Bldg E/L	250	$5.00	$ 1,250.00
Marble Threshold	Bldg E/L	50	$4.00	$ 200.00
Black L-Shaped Cove Base	Bldg E/L	300	$5.00	$ 1,500.00
Mastic for Black L-Shaped Cove Base	Bldg E/L	300	$5.00	$ 1,500.00
Tan Mutlicolored 12" x 12" Vinyl Floor Tile (VCT)	Bldg E/L	3,000	$5.00	$ 15,000.00
Mastic for Tan Mutlicolored 12" x 12" (VCT)	Bldg E/L	3,000	$5.00	$ 15,000.00
Tan 3" x 3" Ceramic Floor Tile	Bldg E/L	1,500	$5.00	$ 7,500.00
Grout for Tan 3" x 3" Ceramic Floor Tile	Bldg E/L	150	$3.00	$ 450.00
Thinset for Tan 3" x 3" Ceramic Floor Tile	Bldg E/L	1,500	$5.00	$ 7,500.00
Block	Bldg E/L	150,000	$5.00	$ 750,000.00
Mortar for Block	Bldg E/L	150,000	$5.00	$ 750,000.00
Skylight Insulation Panel	Bldg E/L	3,000	$5.00	$ 15,000.00
Silver Flex Duct Wrap	Bldg E/L	2,000	$3.00	$ 6,000.00
Large Silver Duct Wrap	Bldg E/L	2,000	$3.00	$ 6,000.00
Small Silver Duct Wrap	Bldg E/L	1,000	$3.00	$ 3,000.00
Unfinished Drywall System	Bldg E/L	30,000	$10.00	$ 300,000.00
Gray Duct Mastic	Bldg E/L	200	$3.00	$ 600.00
Black Foam Pipe Insulation	Bldg E/L	200	$3.00	$ 600.00
White Pipe Wrap	Bldg E/L	2,000	$3.00	$ 6,000.00
Mastic for White Pipe Wrap	Bldg E/L	2,000	$5.00	$ 10,000.00
Interior Caulking	Bldg F	200	$3.00	$ 600.00
Exterior Caulking	Bldg F	200	$3.00	$ 600.00
Divider Wall	Bldg F	2,000	$5.00	$ 10,000.00
Gray Sink Coating	Bldg F	125	$4.00	$ 500.00
Glass Block Mortar	Bldg F	150	$5.00	$ 750.00
Brick	Bldg F	100,000	$5.00	$ 500,000.00
Mortar for Brick	Bldg F	100,000	$5.00	$ 500,000.00
Tacboard	Bldg F	8,000	$6.00	$ 48,000.00
Tan 4" x 4" Ceramic Wall Tile	Bldg F	4,000	$5.00	$ 20,000.00
Grout for Tan 4" x 4" Ceramic Wall Tile	Bldg F	400	$3.00	$ 1,200.00
Mastic for Tan 4" x 4" Ceramic Wall Tile	Bldg F	4,000	$5.00	$ 20,000.00

KYRENE ELEMENTARY SCHOOL DISTRICT
Kyrene Middle School

COST ESTIMATION				
Asbestos-Containing Building Materials	**Location**	**Estimated Quantity**	**Cost (per Sq. Ft.)**	**Estimated Removal Cost**
Blue 4" x 4" Ceramic Wall Tile	Bldg F	500	$5.00	$ 2,500.00
Green 4" x 4" Ceramic Wall Tile	Bldg F	500	$5.00	$ 2,500.00
Tan 2" x 2" Ceramic Floor Tile	Bldg F	4,000	$5.00	$ 20,000.00
Grout for Tan 2" x 2" Ceramic Floor Tile	Bldg F	400	$3.00	$ 1,200.00
Thinset for Tan 2" x 2" Ceramic Floor Tile	Bldg F	4,000	$5.00	$ 20,000.00
Blue 2" x 2" Ceramic Floor Tile	Bldg F	500	$5.00	$ 2,500.00
Green 2" x 2" Ceramic Floor Tile	Bldg F	500	$5.00	$ 2,500.00
Fixture Caulking	Bldg F	40	$3.00	$ 120.00
Fiberglass Reinforced Plastic (FRP)	Bldg F	150	$5.00	$ 750.00
Mastic for Fiberglass Reinforced Plastic (FRP)	Bldg F	150	$5.00	$ 750.00
Gray Stair Tread	Bldg F	600	$5.00	$ 3,000.00
Mastic for Gray Stair Tread	Bldg F	600	$5.00	$ 3,000.00
Gray 20" x 20" Floor Tile	Bldg F	500	$5.00	$ 2,500.00
Mastic for Gray 20" x 20" Floor Tile	Bldg F	500	$5.00	$ 2,500.00
Knockdown Drywall System	Bldg F	2,000	$12.00	$ 24,000.00
Silver Flex Duct Wrap	Bldg F	2,000	$3.00	$ 6,000.00
Silver Box Duct Wrap	Bldg F	3,000	$3.00	$ 9,000.00
Gray Duct Mastic	Bldg F	300	$3.00	$ 900.00
Unfinished Drywall System	Bldg F	6,000	$10.00	$ 60,000.00
Black Foam Pipe Insulation	Bldg F	200	$3.00	$ 600.00
White Pipe Wrap	Bldg F	1,000	$3.00	$ 3,000.00
Insulation for White Pipe Wrap	Bldg F	1,000	$5.00	$ 5,000.00
Skylight Insulation Panel	Bldg F	10,500	$5.00	$ 52,500.00
Divider Wall	Bldg G	2,000	$5.00	$ 10,000.00
Tacboard	Bldg G	8,000	$6.00	$ 48,000.00
Interior Caulking	Bldg G	200	$3.00	$ 600.00
Exterior Caulking	Bldg G	200	$3.00	$ 600.00
White Sink Coating	Bldg G	125	$4.00	$ 500.00
White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Bldg G	5,000	$5.00	$ 25,000.00
Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Bldg G	5,000	$5.00	$ 25,000.00
Brick	Bldg G	100,000	$5.00	$ 500,000.00
Mortar for Brick	Bldg G	100,000	$5.00	$ 500,000.00
Tan 4" x 4" Ceramic Wall Tile	Bldg G	4,000	$5.00	$ 20,000.00
Grout for Tan 4" x 4" Ceramic Wall Tile	Bldg G	400	$3.00	$ 1,200.00
Mastic for Tan 4" x 4" Ceramic Wall Tile	Bldg G	4,000	$5.00	$ 20,000.00

KYRENE ELEMENTARY SCHOOL DISTRICT
Kyrene Middle School

COST ESTIMATION				
Asbestos-Containing Building Materials	**Location**	**Estimated Quantity**	**Cost (per Sq. Ft.)**	**Estimated Removal Cost**
Green 4" x 4" Ceramic Wall Tile	Bldg G	500	$5.00	$ 2,500.00
Blue 4" x 4" Ceramic Wall Tile	Bldg G	500	$5.00	$ 2,500.00
Tan 2" x 2" Ceramic Floor Tile	Bldg G	4,000	$5.00	$ 20,000.00
Grout for Tan 2" x 2" Ceramic Floor Tile	Bldg G	400	$3.00	$ 1,200.00
Thinset for Tan 2" x 2" Ceramic Floor Tile	Bldg G	4,000	$5.00	$ 20,000.00
Green 2" x 2" Ceramic Floor Tile	Bldg G	500	$5.00	$ 2,500.00
Blue 2" x 2" Ceramic Floor Tile	Bldg G	500	$5.00	$ 2,500.00
Marble Threshold	Bldg G	25	$4.00	$ 100.00
Fixture Caulking	Bldg G	40	$3.00	$ 120.00
Knockdown Drywall System	Bldg G	2,000	$12.00	$ 24,000.00
Terrazo Mop Sink	Bldg G	15	$6.00	$ 90.00
Brown Fiberglass Reinforced Plastic (FRP)	Bldg G	150	$5.00	$ 750.00
Mastic for Brown Fiberglass Reinforced Plastic (FRP)	Bldg G	150	$5.00	$ 750.00
Glass Block Mortar	Bldg G	150	$5.00	$ 750.00
Black Stair Tread	Bldg G	200	$5.00	$ 1,000.00
Mastic for Black Stair Tread	Bldg G	200	$5.00	$ 1,000.00
Black 20" x 20" Floor Tile	Bldg G	500	$5.00	$ 2,500.00
Mastic for Black 20" x 20" Floor Tile	Bldg G	500	$5.00	$ 2,500.00
Skylight Insulation Panel	Bldg G	10,500	$5.00	$ 52,500.00
Silver Flex Duct Wrap	Bldg G	2,000	$3.00	$ 6,000.00
Silver Box Duct Wrap	Bldg G	2,000	$3.00	$ 6,000.00
Gray Duct Mastic	Bldg G	300	$3.00	$ 900.00
Unfinished Drywall System	Bldg G	6,000	$10.00	$ 60,000.00
Black Foam Pipe Insulation	Bldg G	200	$3.00	$ 600.00
White Pipe Wrap	Bldg G	1,000	$3.00	$ 3,000.00
Mastic for White Pipe Wrap	Bldg G	1,000	$5.00	$ 5,000.00
White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Bldg H	5,000	$5.00	$ 25,000.00
Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Bldg H	5,000	$5.00	$ 25,000.00
Interior Caulking	Bldg H	200	$3.00	$ 600.00
Exterior Caulking	Bldg H	200	$3.00	$ 600.00
Gray Sink Coating	Bldg H	125	$4.00	$ 500.00
Divider Wall	Bldg H	2,000	$5.00	$ 10,000.00
Brick	Bldg H	100,000	$5.00	$ 500,000.00
Mortar for Brick	Bldg H	100,000	$5.00	$ 500,000.00
Tacboard	Bldg H	8,000	$6.00	$ 48,000.00

COST ESTIMATION

Asbestos-Containing Building Materials	Location	Estimated Quantity	Cost (per Sq. Ft.)	Estimated Removal Cost
Black Stair Tread	Bldg H	200	$5.00	$ 1,000.00
Mastic for Black Stair Tread	Bldg H	200	$5.00	$ 1,000.00
Black Cove Base	Bldg H	150	$5.00	$ 750.00
Mastic for Black Cove Base	Bldg H	150	$5.00	$ 750.00
Black 20" x 20" Floor Tile	Bldg H	500	$5.00	$ 2,500.00
Mastic for Black 20" x 20" Floor Tile	Bldg H	500	$5.00	$ 2,500.00
Tan 4" x 4" Ceramic Wall Tile	Bldg H	4,000	$5.00	$ 20,000.00
Grout for Tan 4" x 4" Ceramic Wall Tile	Bldg H	400	$3.00	$ 1,200.00
Mastic for Tan 4" x 4" Ceramic Wall Tile	Bldg H	4,000	$5.00	$ 20,000.00
Green 4" x 4" Ceramic Wall Tile	Bldg H	500	$5.00	$ 2,500.00
Blue 4" x 4" Ceramic Wall Tile	Bldg H	500	$5.00	$ 2,500.00
Tan 2" x 2" Ceramic Floor Tile	Bldg H	4,000	$5.00	$ 20,000.00
Grout for Tan 2" x 2" Ceramic Floor Tile	Bldg H	400	$3.00	$ 1,200.00
Thinset for Tan 2" x 2" Ceramic Floor Tile	Bldg H	4,000	$5.00	$ 20,000.00
Green 2" x 2" Ceramic Floor Tile	Bldg H	500	$5.00	$ 2,500.00
Blue 2" x 2" Ceramic Floor Tile	Bldg H	500	$5.00	$ 2,500.00
Knockdown Drywall System	Bldg H	2,000	$12.00	$ 24,000.00
White Sink Coating	Bldg H	125	$4.00	$ 500.00
Glass Block Mortar	Bldg H	150	$5.00	$ 750.00
Marble Threshold	Bldg H	25	$4.00	$ 100.00
Fixture Caulking	Bldg H	40	$3.00	$ 120.00
Skylight Insulation Panel	Bldg H	10,500	$5.00	$ 52,500.00
Silver Flex Duct Wrap	Bldg H	2,000	$3.00	$ 6,000.00
Silver Box Duct Wrap	Bldg H	3,000	$3.00	$ 9,000.00
Gray Duct Mastic	Bldg H	300	$3.00	$ 900.00
Unfinished Drywall System	Bldg H	6,000	$10.00	$ 60,000.00
Black Foam Pipe Insulation	Bldg H	200	$3.00	$ 600.00
White Pipe Wrap	Bldg H	1,000	$3.00	$ 3,000.00
Mastic for White Pipe Wrap	Bldg H	1,000	$5.00	$ 5,000.00
Fiberglass Reinforced Plastic (FRP)	Bldg J	5,000	$5.00	$ 25,000.00
Mastic for Fiberglass Reinforced Plastic (FRP)	Bldg J	5,000	$5.00	$ 25,000.00
Gray Sink Coating	Bldg J	20	$4.00	$ 80.00
Interior Caulking	Bldg J	100	$3.00	$ 300.00
Exterior Caulking	Bldg J	100	$3.00	$ 300.00
Tan 4" x 4" Ceramic Wall Tile	Bldg J	3,000	$5.00	$ 15,000.00
Grout for Tan 4" x 4" Ceramic Wall Tile	Bldg J	300	$3.00	$ 900.00

COST ESTIMATION

Asbestos-Containing Building Materials	Location	Estimated Quantity	Cost (per Sq. Ft.)	Estimated Removal Cost
Mastic for Tan 4" x 4" Ceramic Wall Tile	Bldg J	3,000	$5.00	$ 15,000.00
Green 4" x 4" Ceramic Wall Tile	Bldg J	500	$5.00	$ 2,500.00
Blue 4" x 4" Ceramic Wall Tile	Bldg J	500	$5.00	$ 2,500.00
Tan 2" x 2" Ceramic Floor Tile	Bldg J	3,000	$5.00	$ 15,000.00
Grout for Tan 2" x 2" Ceramic Floor Tile	Bldg J	300	$3.00	$ 900.00
Thinset for Tan 2" x 2" Ceramic Floor Tile	Bldg J	3,000	$5.00	$ 15,000.00
Green 2" x 2" Ceramic Floor Tile	Bldg J	500	$5.00	$ 2,500.00
Blue 2" x 2" Ceramic Floor Tile	Bldg J	500	$5.00	$ 2,500.00
Fixture Caulking	Bldg J	50	$3.00	$ 150.00
Marble Threshold	Bldg J	25	$4.00	$ 100.00
Blue Cove Base	Bldg J	150	$5.00	$ 750.00
Mastic for Blue Cove Base	Bldg J	150	$5.00	$ 750.00
Tacboard	Bldg J	10,000	$6.00	$ 60,000.00
Gray 12" x 12" Vinyl Floor Tile (VCT)	Bldg J	1,500	$5.00	$ 7,500.00
Mastic for Gray 12" x 12" Vinyl Floor Tile (VCT)	Bldg J	1,500	$5.00	$ 7,500.00
Knockdown Drywall System	Bldg J	2,000	$12.00	$ 24,000.00
Tan Multicolored 12" x 12" Vinyl Floor Tile (VCT)	Bldg J	600	$5.00	$ 3,000.00
Mastic for Tan Multicolored 12" x 12" VCT	Bldg J	600	$5.00	$ 3,000.00
Brick	Bldg J	60,000	$5.00	$ 300,000.00
Mortar for Brick	Bldg J	60,000	$5.00	$ 300,000.00
Gray Floor Coating	Bldg J	150	$4.00	$ 600.00
White 6" x 6" Ceramic Wall Tile	Bldg J	300	$5.00	$ 1,500.00
Grout for White 6" x 6" Ceramic Wall Tile	Bldg J	30	$3.00	$ 90.00
Mastic for White 6" x 6" Ceramic Wall Tile	Bldg J	300	$5.00	$ 1,500.00
Skylight Insulation Panel	Bldg J	3,000	$5.00	$ 15,000.00
Large Silver Flex Duct Wrap	Bldg J	2,000	$3.00	$ 6,000.00
Silver Box Duct Wrap	Bldg J	2,000	$3.00	$ 6,000.00
Gray Duct Mastic	Bldg J	200	$3.00	$ 600.00
Unfinished Drywall System	Bldg J	6,000	$10.00	$ 60,000.00
Black Foam Pipe Insulation	Bldg J	100	$3.00	$ 300.00
White Pipe Wrap	Bldg J	500	$3.00	$ 1,500.00
Mastic for White Pipe Wrap	Bldg J	500	$5.00	$ 2,500.00
Residual 12" x 12" Ceiling Tile Mastic	Bldg J	2,000	$5.00	$ 10,000.00
Black Carpet Square	Bldg K	300	$5.00	$ 1,500.00
Mastic for Black Carpet Square	Bldg K	300	$5.00	$ 1,500.00
Tan 4" x 4" Ceramic Wall Tile	Bldg K	3,000	$5.00	$ 15,000.00

COST ESTIMATION

Asbestos-Containing Building Materials	Location	Estimated Quantity	Cost (per Sq. Ft.)	Estimated Removal Cost
Grout for Tan 4" x 4" Ceramic Wall Tile	Bldg K	300	$3.00	$ 900.00
Mastic for Tan 4" x 4" Ceramic Wall Tile	Bldg K	3,000	$5.00	$ 15,000.00
Tan 2" x 2" Ceramic Floor Tile	Bldg K	3,000	$5.00	$ 15,000.00
Grout for Tan 2" x 2" Ceramic Floor Tile	Bldg K	300	$3.00	$ 900.00
Thinset for Tan 2" x 2" Ceramic Floor Tile	Bldg K	3,000	$5.00	$ 15,000.00
Green 2" x 2" Ceramic Floor Tile	Bldg K	500	$5.00	$ 2,500.00
Blue 2" x 2" Ceramic Floor Tile	Bldg K	500	$5.00	$ 2,500.00
Marble Threshold	Bldg K	50	$4.00	$ 200.00
Wallpaper	Bldg K	5,000	$4.00	$ 20,000.00
Brick	Bldg K	100,000	$5.00	$ 500,000.00
Mortar for Brick	Bldg K	100,000	$5.00	$ 500,000.00
White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Bldg K	2,000	$5.00	$ 10,000.00
Mastic for White w/Black 12" x 12" Vinyl Floor Tile (VCT)	Bldg K	2,000	$5.00	$ 10,000.00
Interior Caulking	Bldg K	100	$3.00	$ 300.00
Exterior Caulking	Bldg K	100	$3.00	$ 300.00
Knockdown Drywall System	Bldg K	1,500	$12.00	$ 18,000.00
Gray Sink Coating	Bldg K	75	$4.00	$ 300.00
Gray Carpet Square	Bldg K	100	$5.00	$ 500.00
Mastic for Gray Carpet Square	Bldg K	100	$5.00	$ 500.00
Dark Gray Cove Base	Bldg K	20	$5.00	$ 100.00
Mastic for Dark Gray Cove Base	Bldg K	20	$5.00	$ 100.00
Beige Multicolored 12" x 12" Vinyl Floor Tile (VCT)	Bldg K	750	$5.00	$ 3,750.00
Mastic for Beige Multicolored 12" x 12" VCT	Bldg K	750	$5.00	$ 3,750.00
Fiberglass Reinforced Plastic (FRP)	Bldg K	500	$5.00	$ 2,500.00
Mastic for Fiberglass Reinforced Plastic (FRP)	Bldg K	500	$5.00	$ 2,500.00
Terrazo Mop Sink	Bldg K	50	$6.00	$ 300.00
Unfinished Drywall System	Bldg K	10,000	$10.00	$ 100,000.00
Silver Flex Duct Wrap	Bldg K	2,000	$3.00	$ 6,000.00
Silver Box Duct Wrap	Bldg K	2,000	$3.00	$ 6,000.00
Black Pipe Foam Insulation	Bldg K	100	$3.00	$ 300.00
Pipe Wrap	Bldg K	300	$3.00	$ 900.00
Mastic for Pipe Wrap	Bldg K	300	$5.00	$ 1,500.00
Gray Duct Mastic	Bldg K	100	$3.00	$ 300.00
Skylight Insulation Panel	Bldg K	2,000	$5.00	$ 10,000.00
Total Estimated Cost				**$5,119,070.00**

KYRENE ELEMENTARY SCHOOL DISTRICT
Kyrene Middle School

RESOURCE EVALUATION		
Reinspection Costs / Year	**Estimated Years**	**Totals**
$1,200.00	20	$24,000.00
O & M / Year	**Estimated Years**	**Totals**
$500.00	20	$10,000.00
6 Month Periodic Surveillance / Year	**Estimated Years**	**Totals**
$2,400.00	20	$48,000.00

Training/ Year	Training Cost/Year	Estimated Years	
2 Hour Initial Training Class	10 Staff Members @ $150.00 ea. = $1,500.00	20	$30,000.00
16 Hour Initial Training Class	2 Staff Members @ $250.00 ea. = $500.00	20	$10,000.00
Refresher Class	12 Staff Members @ $150.00 ea = $1,800.00	20	$36,000.00

Total Annual Cost	$7,900.00
Total Cost Over Life of O & M	$158,000.00
Cost of Removal at End of Building Life	$5,119,070.00
Total Cost at End of Building Life	$5,277,070.00

SECTION 11

♦

MANAGEMENT PLANNER
OPTIONAL COMPLIANCE STATEMENT

Optional Management Planner
Compliance Statement

763.93(f)

I certify that I have prepared and/or reviewed this Management Plan and that such plan is in compliance with the Asbestos Hazard Emergency Response Act at 40 CFR 763, Subpart E.

I also certify that I have no financial connection with any party who implements or will implement this Management Plan.

Printed Name: Tracey Carpenter Date: July 16, 2025

Signature: Tracey Carpenter

State of Accreditation or EPA: EPA AHERA Management Planner - Arizona

Accreditation Date: July 6, 2025 – July 6, 2026

Accreditation Number: ON-4651-14588-070625

THE ASBESTOS INSTITUTE

Certifies that

Tracey Carpenter

has attended and received instruction in the EPA approved course

AHERA Management Planner Refresher

on

July 06, 2025

and successfully completed and passed the competency exam.

Certificate:
ON-4651-14588-070625

Date of Examination:
6-Jul-2025

Date of Expiration:
06-Jul-2026

A. Zwanenburg
Director

Approved Instructor

THE ASBESTOS INSTITUTE
20033 N. 19th Ave, Building 6, Phoenix, AZ 85027
602-864-6564 – www.theasbestosinstitute.com

FL Course # CRS227

The person receiving this certificate has completed the requisite training for asbestos accreditation under TSCA Title II.

SECTION 12

♦

SIGNED STATEMENT BY DESIGNATED PERSON

Local Education Agency (LEA) General Responsibilities Under AHERA

Pursuant to Section 763.84 and Section 763.93 of the EPA Asbestos in Schools Regulations (40 CFR, Part 763), each management plan must contain a true and correct statement signed by the LEA designated person, that certifies that the general LEA responsibilities have been met. This form is provided to assist you in complying with this portion of AHERA.

LEA Name:_____

LEA Address:_____

Designated Person Name:_____

Designated Person Address:_____

ASSURANCES

1. This AHERA management plan was developed and has been submitted pursuant to the Asbestos Hazard Emergency Response Act of 1986, Public Law 99-915; and the United States Environmental Protection Agency Rule: Asbestos Containing Material in Schools, 40 CFR, Part 763; and the undersigned does hereby certify that the LEA has and will ensure the following:

2. The activities of any persons who perform inspections, reinspections and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with Part 763.

3. All custodial and maintenance employees are properly trained as required in Part 763 and all other applicable Federal and/or State regulations (e.g., the Occupational Safety and Health Administration Asbestos Standard for Construction, the EPA Worker Protection Rule or applicable state regulations).

4. All workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, post-response action activities, including period reinspection and surveillance activities, that are planned or in progress.

5. All short-term workers (e.g., telephone repair workers, utility workers or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACM and suspected ACM assumed to be ACM.

6. All warning labels are posted in accordance with Section 763.95.

7. All management plans are available for inspection and notification of such availability has been provided as specified in the management plan under Section 763.93(g).

8. The undersigned person designated by the LEA pursuant to Section 763.84 (g)(1) has received adequate training as stipulated in Section 763.84(g)(2).

9. The LEA has and will consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under Part 763.

SIGNATURE_____DATE_____
LEA Designated Person, pursuant to
40 CFR 763.93(I) and 763.84.