


Midwest
Environmental
Consulting, L.L.C.

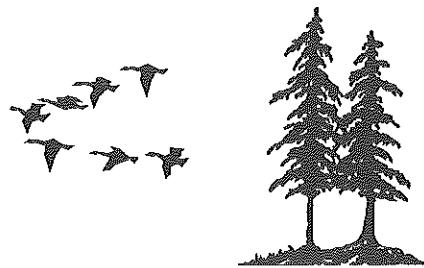

Printed on Recycled Paper

**Monroe Community School
Saint Paul Public Schools**

Lead-Based Paint Inspection

Inspection Dates: 4/20/97, 7/3/97, 6/9/98, 6/10/98, 6/22/98

submitted to:

Saint Paul Public Schools

MEC Project # 62/0197AA

INTRODUCTION

At the request of Saint Paul Public Schools Environmental Safety Department, Midwest Environmental Consulting, L.L.C. (MEC), conducted a lead-based paint inspection at Monroe Community School, 810 Palace Avenue, St. Paul, MN. The purpose of this inspection was to identify lead-based painted, varnished, or otherwise coated building components on the interior and exterior of the school building.

The inspection protocol incorporated applicable portions of the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-based Paint Hazards in Housing* (HUD Guidelines, June 1995) and OSHA 1926.62 requirements (Lead in Construction). The HUD guidelines are formulated to guide agencies in conducting random sampling of the interiors and exteriors of dwellings and common areas in public housing. The OSHA requirement is designed to minimize worker exposure when working with material containing lead.

The United States Environmental Protection Agency defines "lead-based paint" as a paint or other surface coating that contains lead equal to or in excess of 1.0 milligrams per square centimeter when analyzed by XRF or more than 0.5% by weight (5000 parts per million) by laboratory analysis of a bulk sample.

Minnesota Department of Labor and Industry (MN OSHA) adopted the EPA lead levels for the purpose of enforcing OSHA 1926.62 federal regulations. Detection of lead in dried paint film by XRF is a dependable indicator of levels of lead and is accepted by MN OSHA.

No samples were taken for laboratory analysis at this school.

For this Saint Paul Public Schools Lead Inspection, all building components were tested on site using a Niton XL® X-ray Fluorescence Spectrum Analyzer⁽¹⁾. Building components included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases. Only painted or glazed surfaces or surfaces which were varnished were tested. Suspended ceilings, structural steel, and corrugated decking were not included in the inspection. Neither anodized (e.g., window sashes) nor plastic (e.g., vinyl baseboard and vinyl mini-blinds) were included in the scope of this inspection.

⁽¹⁾ This is a portable hand held machine that can analyze building components instantly for lead concentrations.

Each building was divided into unique sites based on the year of construction or renovation. Portable classrooms, playgrounds, and other detached buildings were automatically designated as a unique site. Each site was inspected independently assuming differences in painting history and construction characteristics.

SITE DESCRIPTION AND BUILDING HISTORY

According to information provided to MEC by Saint Paul Public Schools, Monroe Community School was constructed in essentially three phases. The initial phase includes the 39,865 square-foot older section of the building and dates from 1926. The second phase dates from 1964. The third phase, the library, is from 1978.

All room and area designations used in this report are depicted on sampling maps found in Appendix A.

XRF SAMPLE RESULTS TABLE

The results of all samples analyzed are listed in the table at the end of this section. The following is a description of the column headings:

| | |
|-----------------|--|
| Site | Each school is divided into sites based on their unique construction characteristics. Each site has a unique date of construction or major renovation. |
| Sample # | Each sample taken was given a unique number to identify the type and location of the sample. The sampling date is an integral part of the sample number. |
| Analysis | This defines the type of analysis which can be categorized into two types: 1) XRF: This is an on-site analysis using a hand held Niton XL® X-ray Fluorescence Spectrum Analyzer; 2) Bulk or Chip: This is a bulk sample where paint is removed from the substrate and sent to a laboratory for analysis; |
| Floor | This is the level of the building in which the area tested was found, example, 1 (first floor), 0 (basement), etc. |
| Area | This further defines the specific functional space inspected such as a classroom, exterior, playground, gym, kitchen, etc. |

| | |
|------------------|--|
| Room # | This is typically the actual number on the room as identified at the building. |
| Component | Building "components" included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases. |
| Feature | Identifies more detailed information of the component. |
| Condition | This describes condition of the surface, whether it is intact, cracked, peeling, or chalking. |
| Substrate | This refers to the material the building component is made of (wood, concrete, drywall, metal, etc.). |
| Result | This is the analysis results for lead. Less than 1.0 mg/cm ² or less than 0.5% by weight is considered to be non-lead and these building components are below the action levels of EPA and HUD. (All results are in mg/cm ² except where noted.) |

The table of results is designed for quick information on lead concentrations of tested building components. Generally, all repetitions of a test combination within a given room or area, may be assumed to contain similar concentrations of lead to that of the tested sample. For instance, the lead concentration of a tested wooden window sash was found to be above the action level of 1.0 mg/cm² in a given classroom. The classroom has five windows, all of wood, the same color and appearing to be of the same era. It can be assumed that the remaining four wooden window sashes each contain lead above the action limit.

Other columns identify the component and the component feature tested, condition of the component, type of substrate and the result of the analytical test.

As an example, the following illustration shows that the wooden door jamb in Room 123, first floor in the 1923 building section was in good, solid condition, and had an XRF test result of 0.3 mg/cm², which is below the action level.

Illustration Only

| Site | Sample # | Date | Analysis | Floor | Area | Room # | Component | Feature | Condition | Substrate | Results |
|------------|----------|------|----------|-------|------|--------|-----------|---------|-----------|-----------|---------|
| 1923 Bldg. | 52 | | XRF | 1 | Room | 123 | Door | Jamb | Solid | Wood | 0.3 |

In a similar manner, the table shows that the plaster walls in room 23, on the second floor has peeling paint with more than 1.0 mg/cm² (shaded).

ILLUSTRATION ONLY

| Site | Sample # | Date | Analysis | Floor | Area | Room # | Component | Feature | Condition | Substrate | Results |
|------------|----------|------|----------|-------|------|--------|-----------|-----------|-----------|-----------|---------|
| 1910 Bldg. | 16 | | XRF | 2 | Room | 23 | Door | Jamb | Peeling | Wood | 0.25 |
| 1910 Bldg. | 17 | | XRF | 2 | Room | 23 | Wall | Wall | Peeling | Plaster | 1.2 |
| 1910 Bldg. | 18 | | XRF | 2 | Room | 23 | Ceiling | Peeling | Plaster | 0.25 | |
| 1910 Bldg. | 19 | | XRF | 2 | Room | 23 | Wall | Baseboard | Peeling | Wood | 0.002 |

APPLICABLE REGULATIONS

When building components test above 1.0 mg/cm² of lead by XRF or 0.5% lead by weight from laboratory analysis all employees and contractors who will be working with these components in a construction related activity must be notified. The requirements of OSHA 1926.62, Lead in Construction are enforceable. This regulation defines construction work as "work for construction, alteration and/or repair, including painting and decorating." This regulation further defines monitoring requirements to minimize employee exposure to lead during construction activities.

When work is performed on external painted building structures (i.e. flashing, fire escapes, playground equipment, handrails, etc.), regulations of the Minnesota Pollution Control Agency (MPCA) may also be applicable. For removal of lead based paint from steel structures, MN Rules 7025.0200 - 7025.0380 apply to steel materials on the exterior of a building, or on the property when levels exceed 0.5 mg/cm² based on the average of three XRF spectrum results of the sample tested, or 5,000 ppm by laboratory analysis. If it is other than a steel surface, then MPCA regulates the painted surfaces under MN Rules 7025.010 - 7025.0080, when surfaces are to be disturbed using abrasive blasting methods.

Please contact MEC directly if you have questions about any portion of this report or the lead-based paint inspection itself.



APPENDIX A

XRF TESTING DATA WITH LOCATION MAPS

86] 12] 9

A **B**
Sister -
~~1964~~ 1964

FIRST FLOOR PLAN - SOUTH

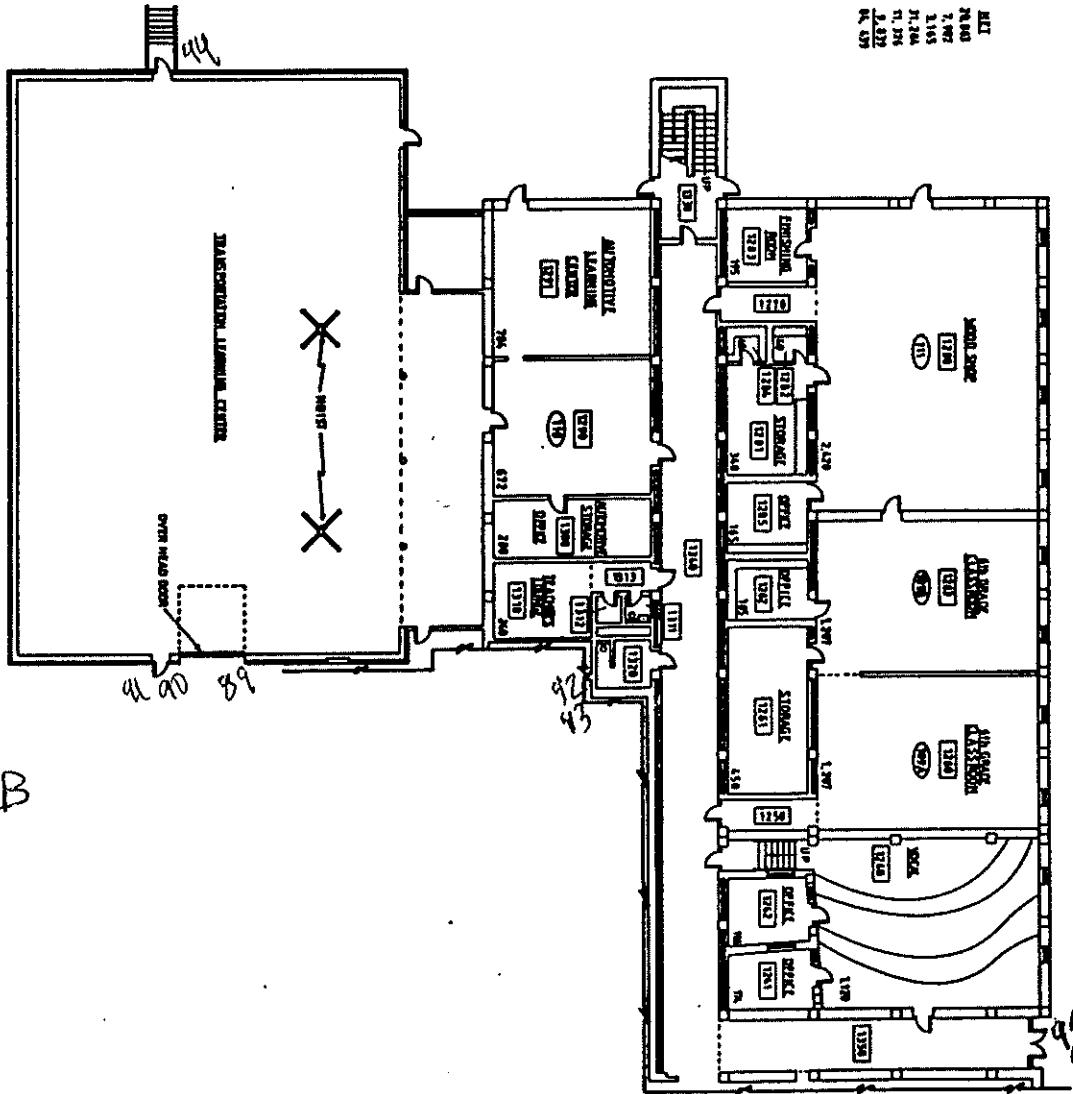


| | STUDENTS | ADM. |
|----------------------|----------|---------|
| POLY PLATE NORTH | 26,640 | 28,003 |
| POLY PLATE SOUTH | 22,614 | 23,003 |
| PLATE PLATES | 19,342 | 21,155 |
| SCREW PLATE NORTHERN | 21,204 | 21,204 |
| SCREW PLATE SOUTHERN | 16,149 | 17,255 |
| THIN PLATES | 21,622 | 22,527 |
| WIRE | 165,964 | 164,497 |

INDEPENDENT SCHOOL DIST. #625
360 COLBORNE STREET
ST. PAUL, MINNESOTA 55102

MONROE COMMUNITY SCHOOL
810 PALACE AVE.
ST. PAUL, MN


CONSTRUCTED: 1926, 54, 78

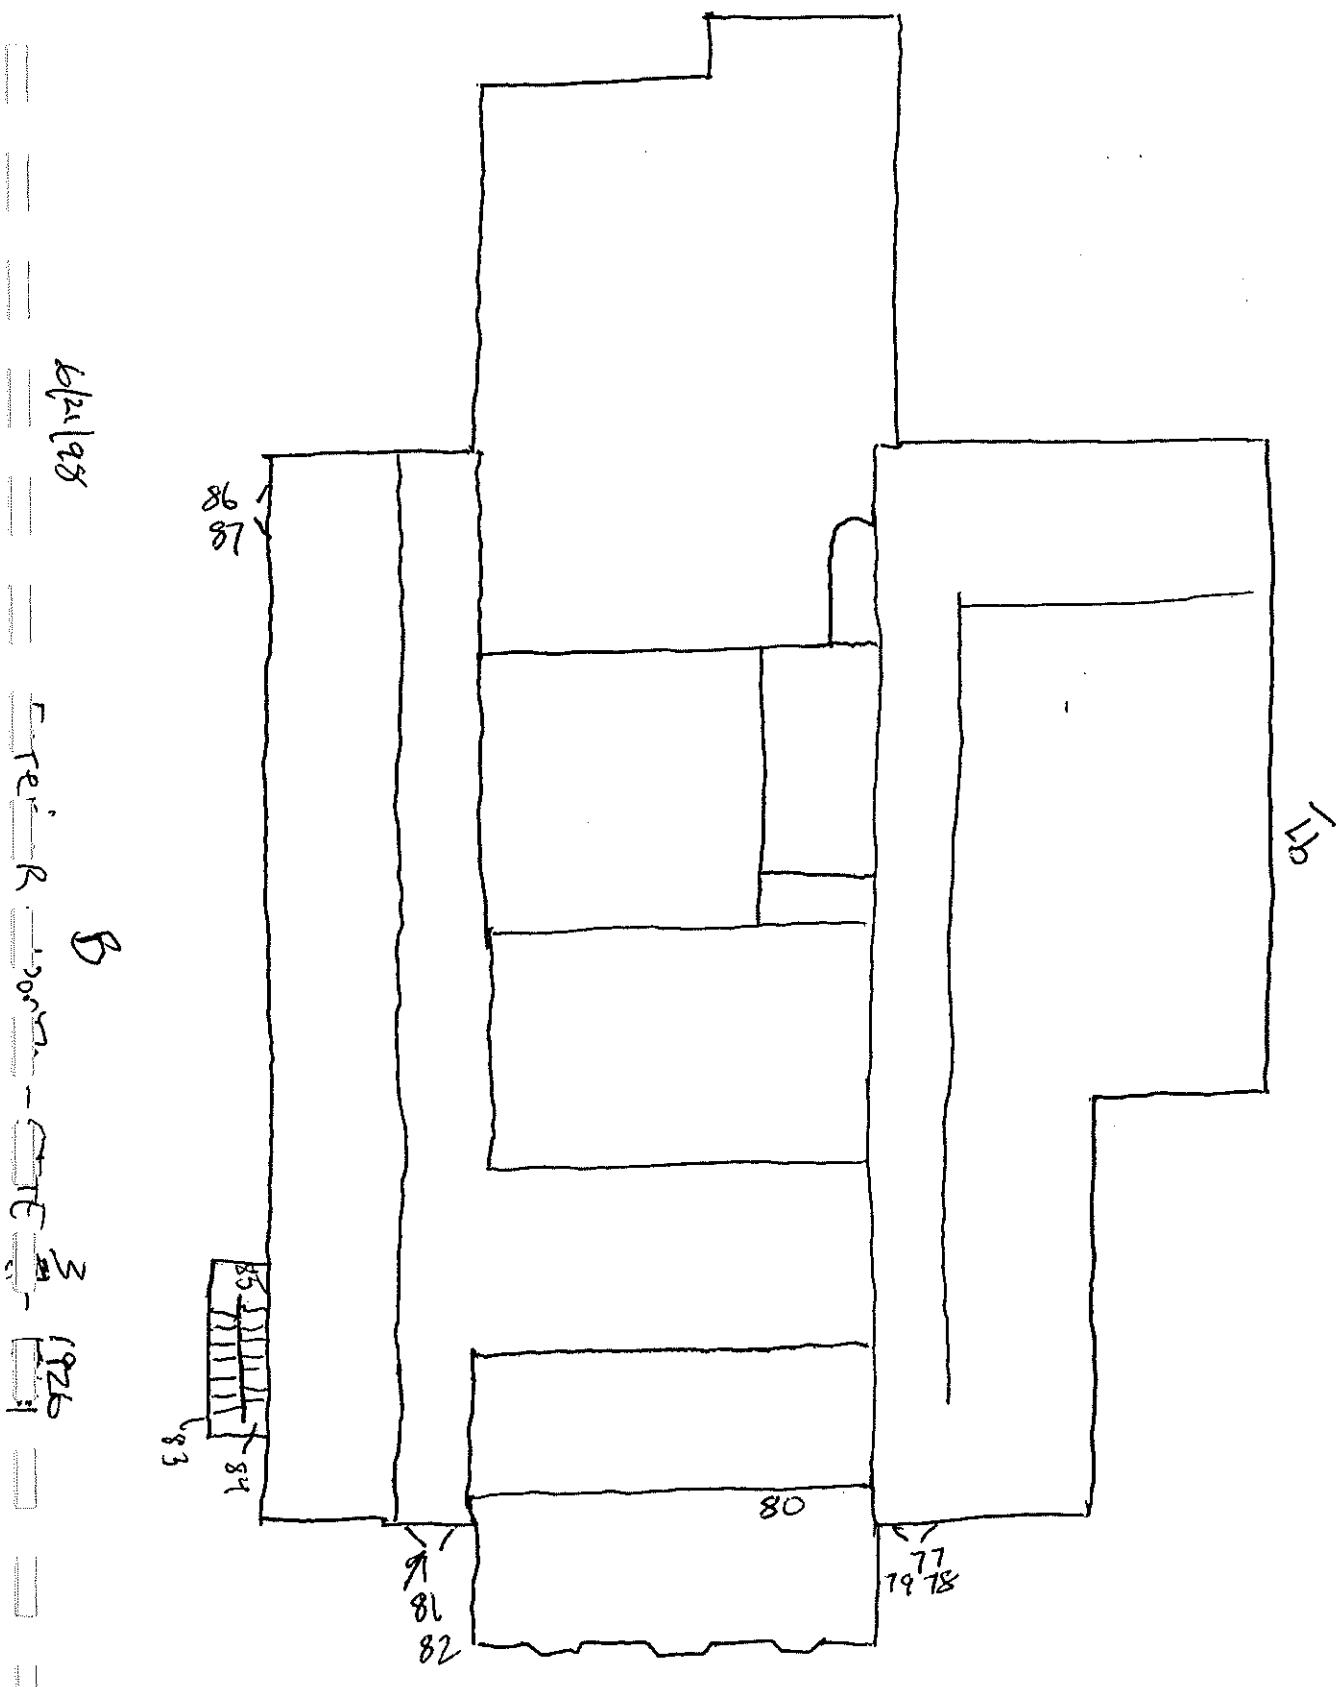

A

N →

D

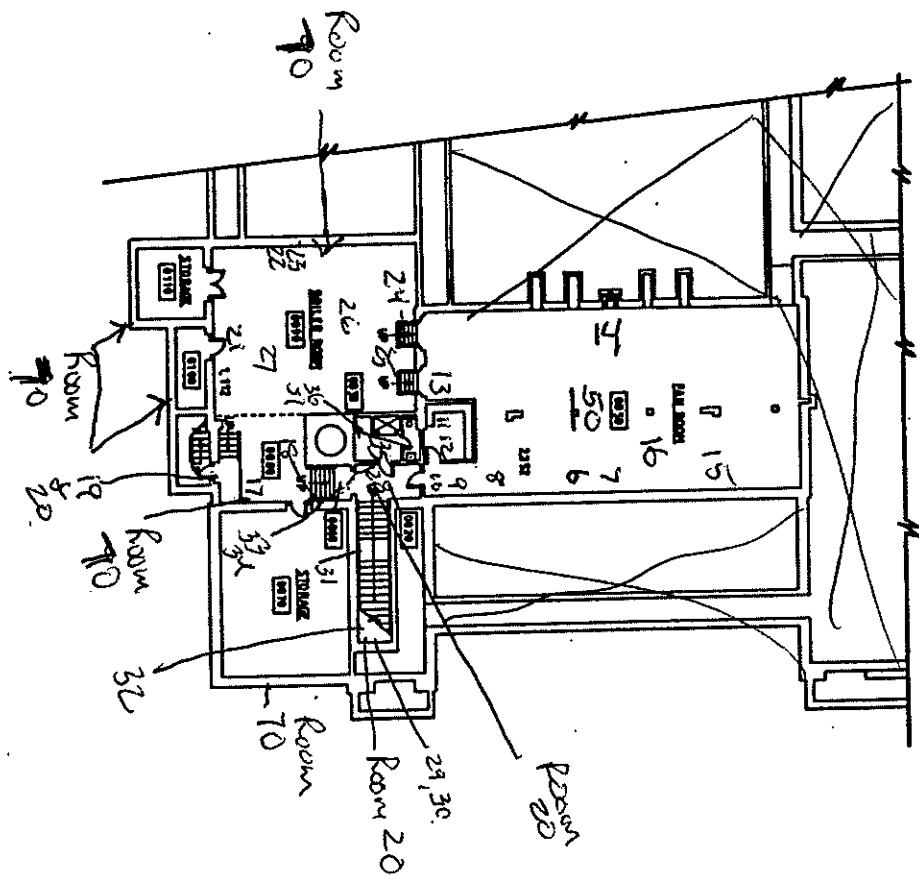

6/10/98

BASEMENT FLOOR PLAN





INDEPENDENT SCHOOL DIST. #625
360 COLBORNE STREET
ST. PAUL, MINNESOTA 55102

MONROE COMMUNITY SCHOOL
810 PALACE AVE.
ST. PAUL, MN

CONSTRUCTED: 1926, 64, 78

NET
5
11

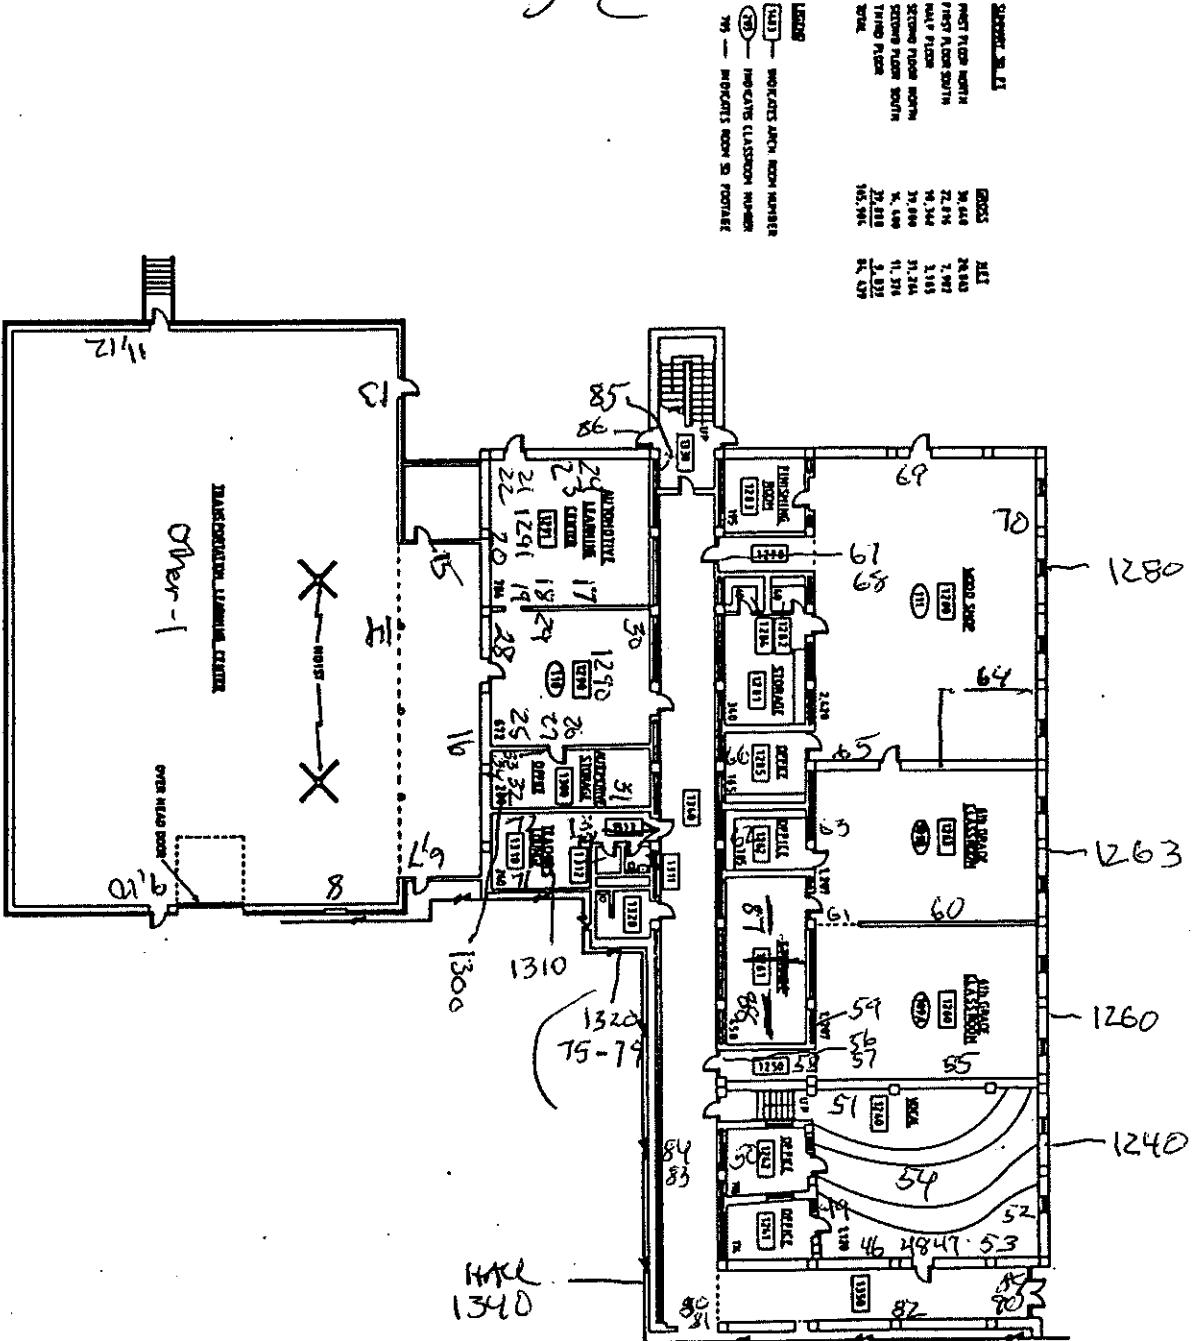

FIRST FLOOR PLAN-SOUTH

INDEPENDENT SCHOOL DIST. #625
360 COLBORNE STREET
ST. PAUL, MINNESOTA 55102

MONROE COMMUNITY SCHOOL
810 PALACE AVE.
ST. PAUL, MN

CONSTRUCTED: 1926, 64, 78

SITE 2
1964

11M0-220K 1-EM


11-1007-0026



— 46 —


| | | | | |
|-------------------|----------------------------|------|-----------------|---------------------|
| Post-it® Fax Note | | 7671 | Date <u>6-2</u> | # of pages <u>1</u> |
| To | <u>NONROE</u> | | | From <u>Comael</u> |
| Co/Dept. | <u>Jone [illegible] R.</u> | | | <u>Co MML</u> |
| Phone # | <u>8686</u> | | | Phone # |
| Fax # | <u>253-4227</u> | | | <u>253-4227</u> |

Staff
names to

YES AVENUE

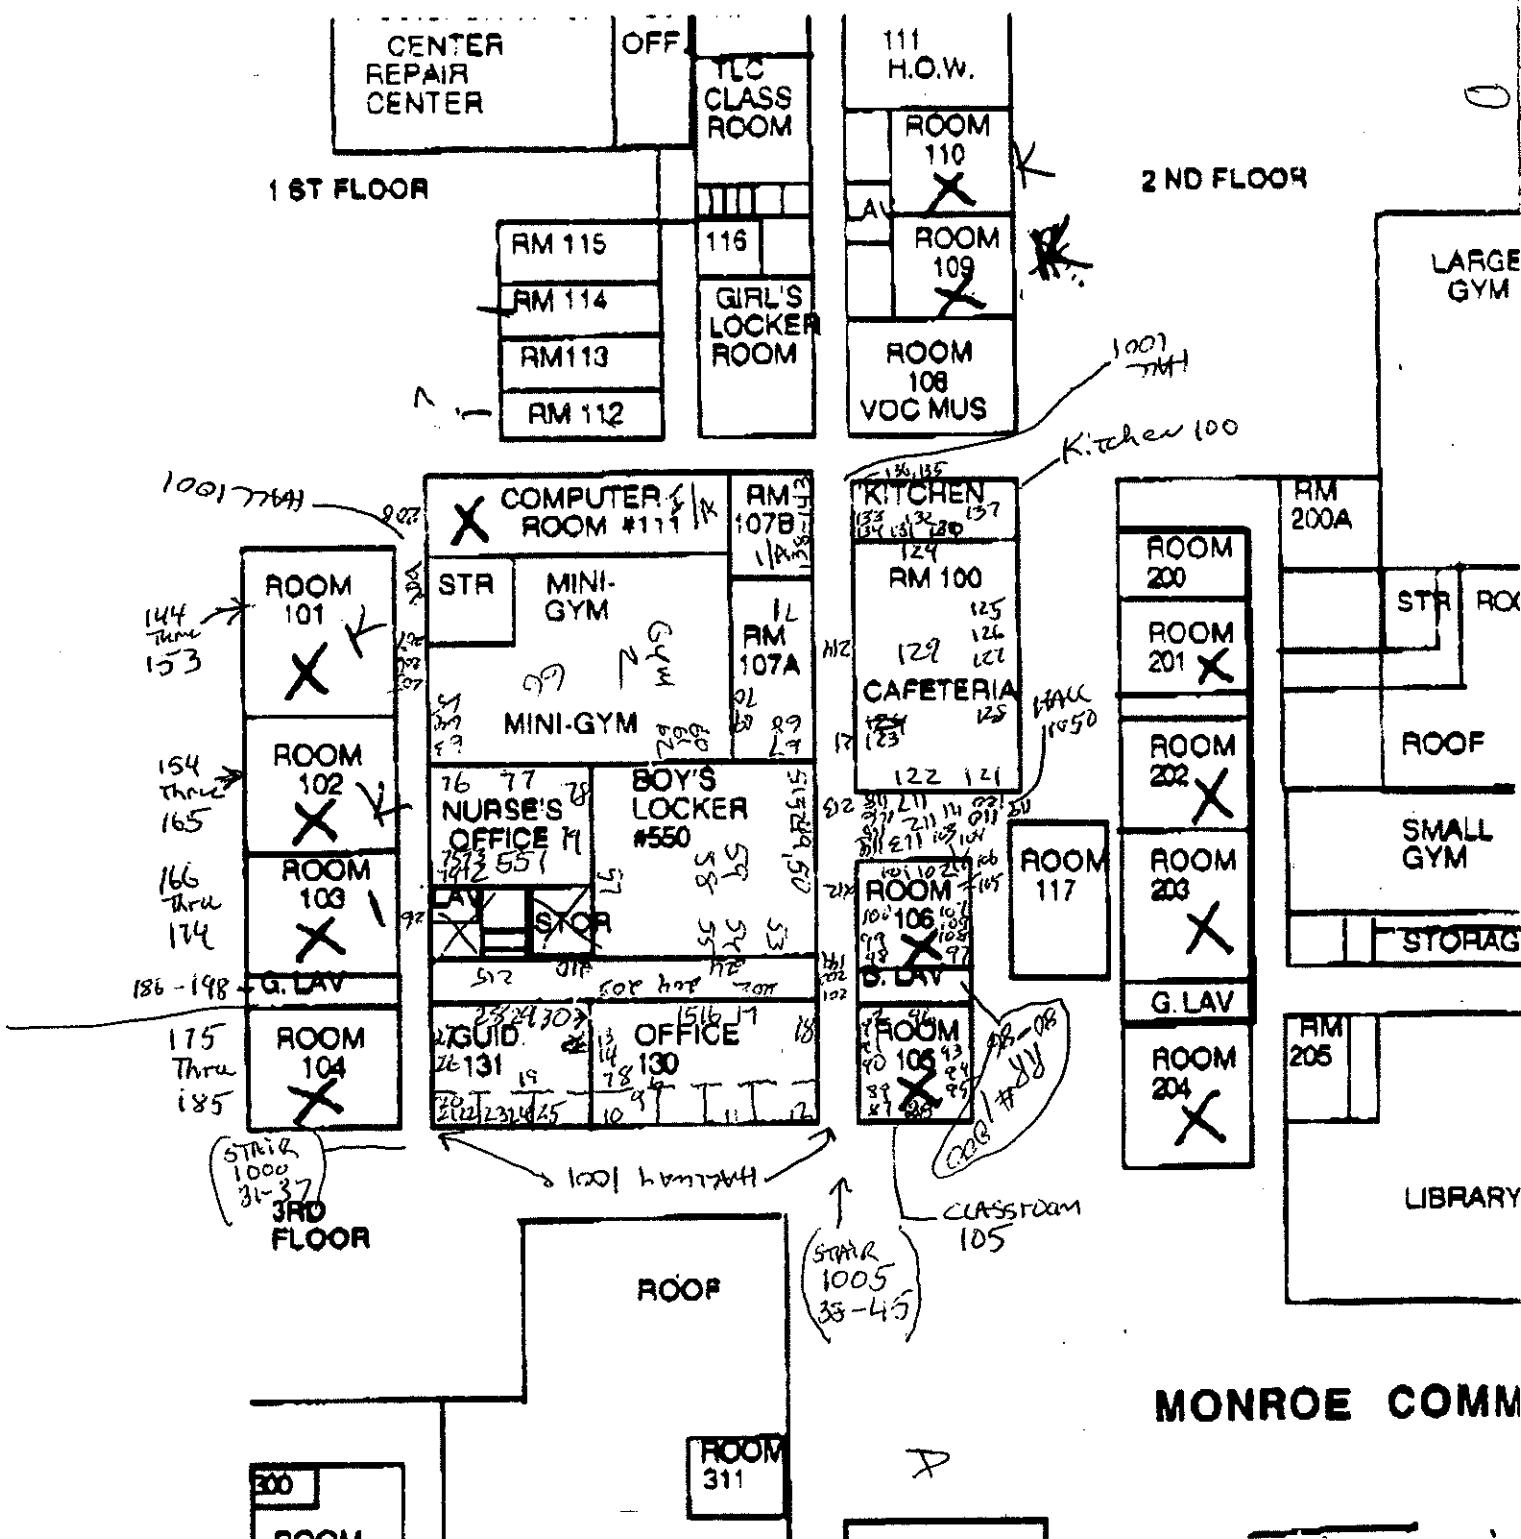


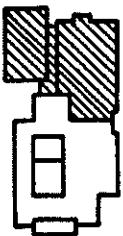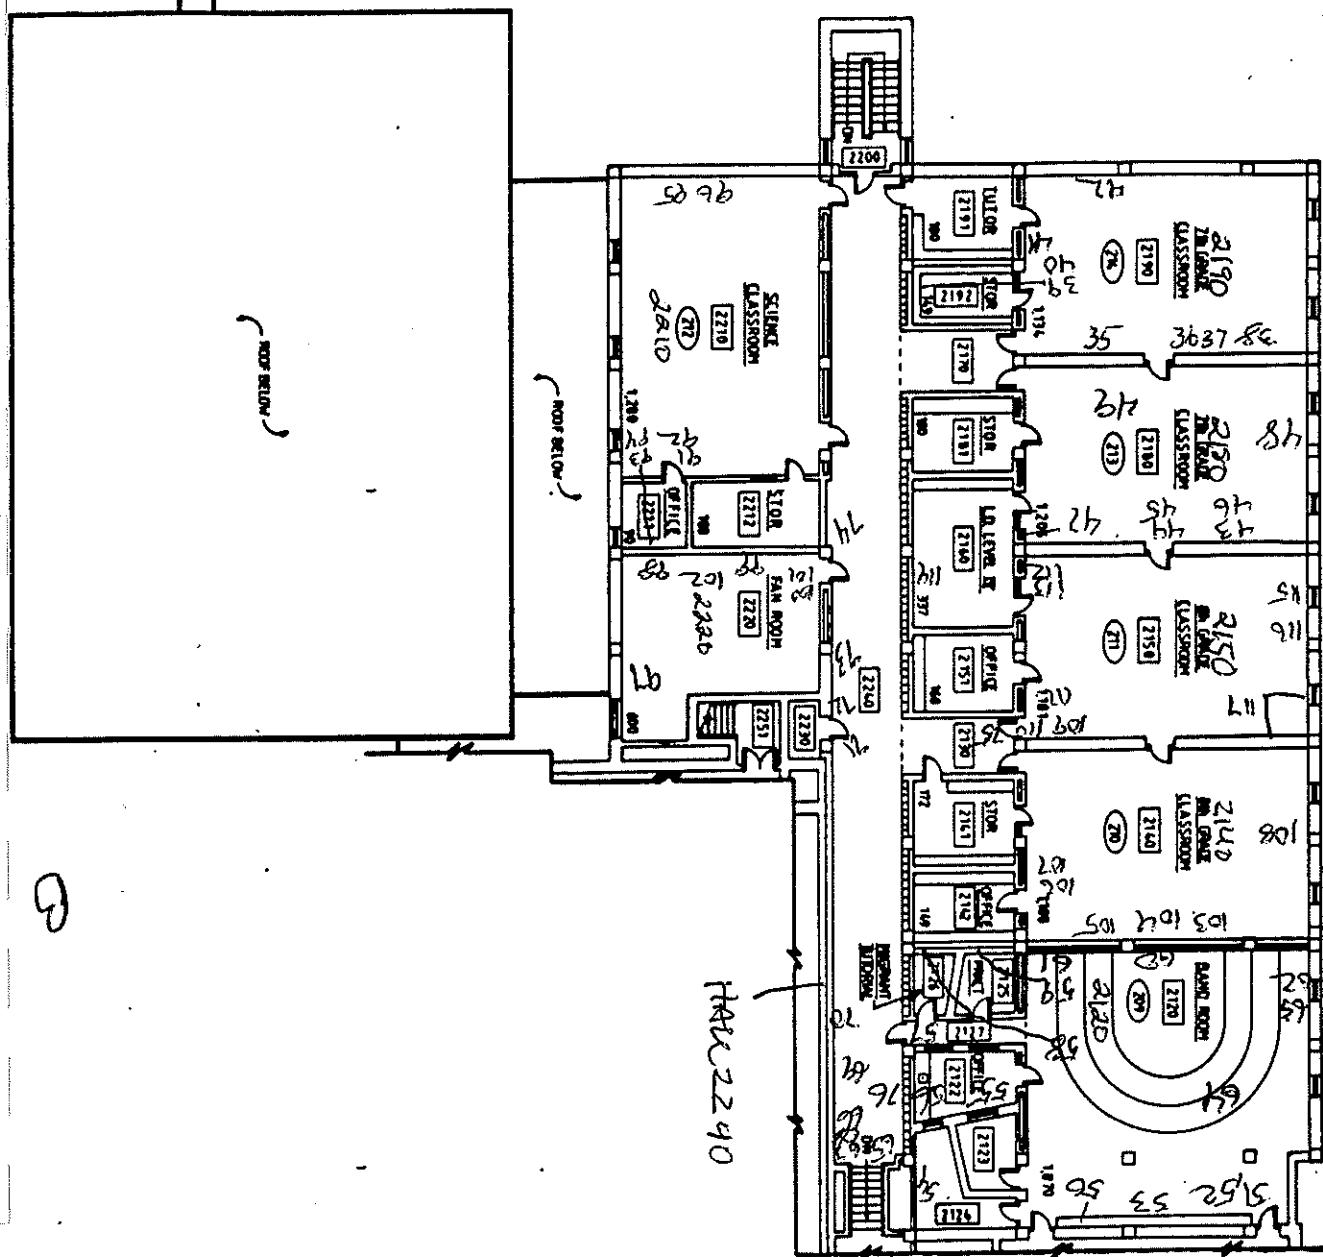

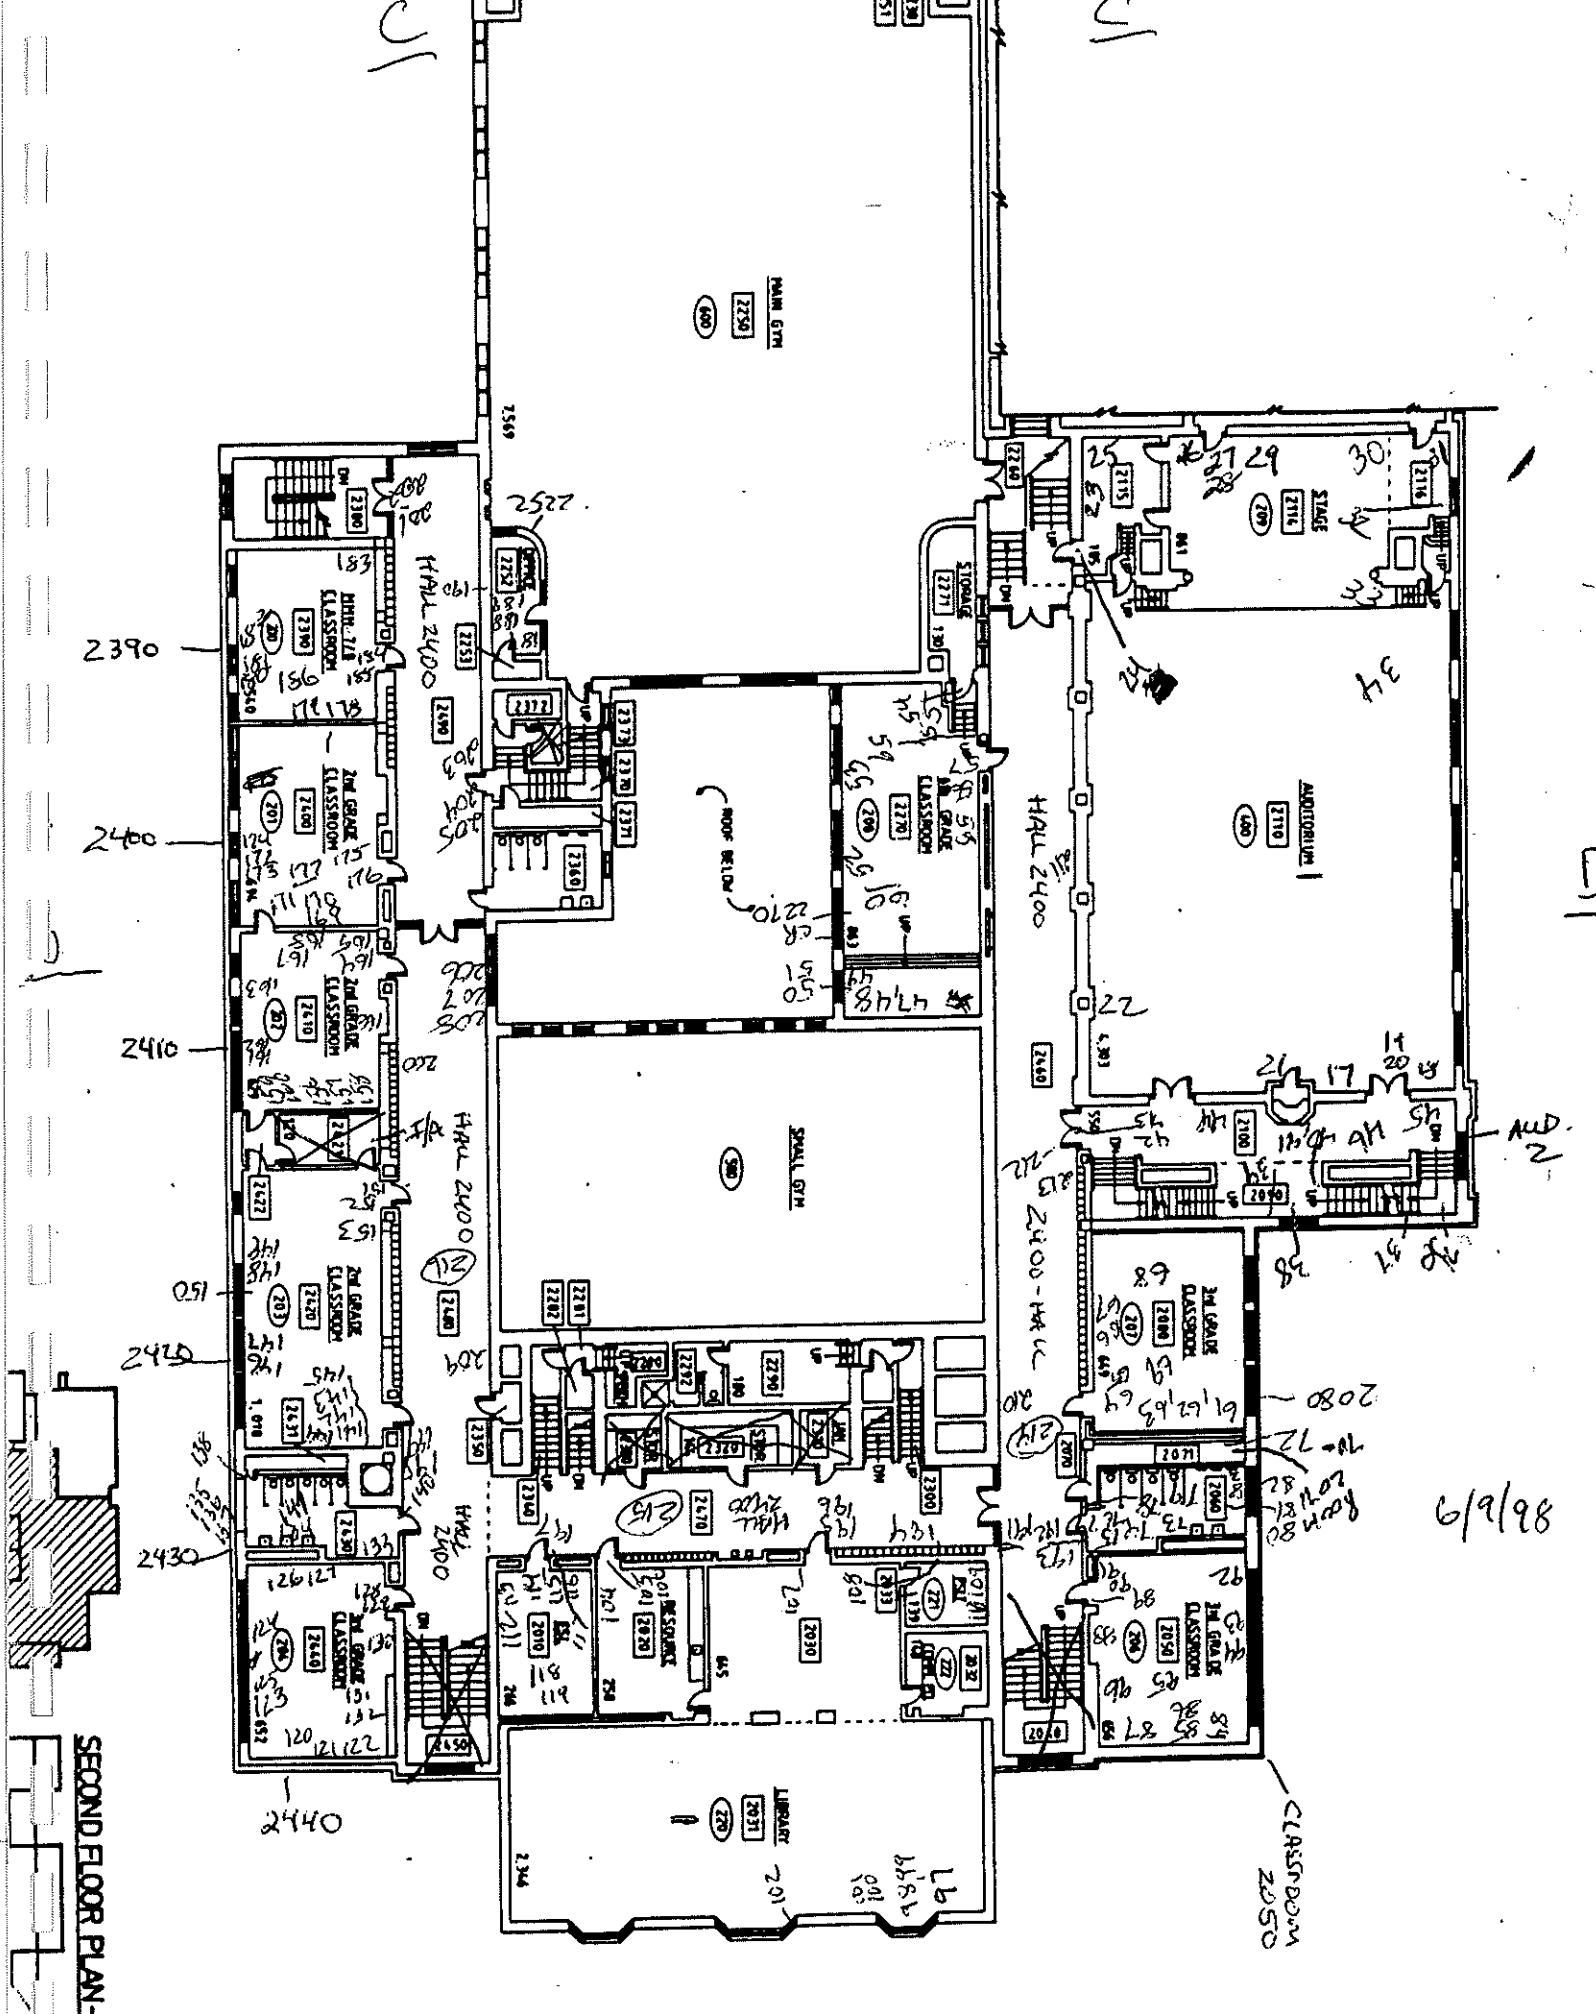


SECOND FLOOR PLAN - NOR

SECOND FLOOR PLAN - NO. 1

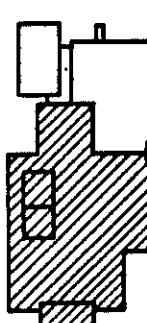


~~186-200~~ 7-3-97

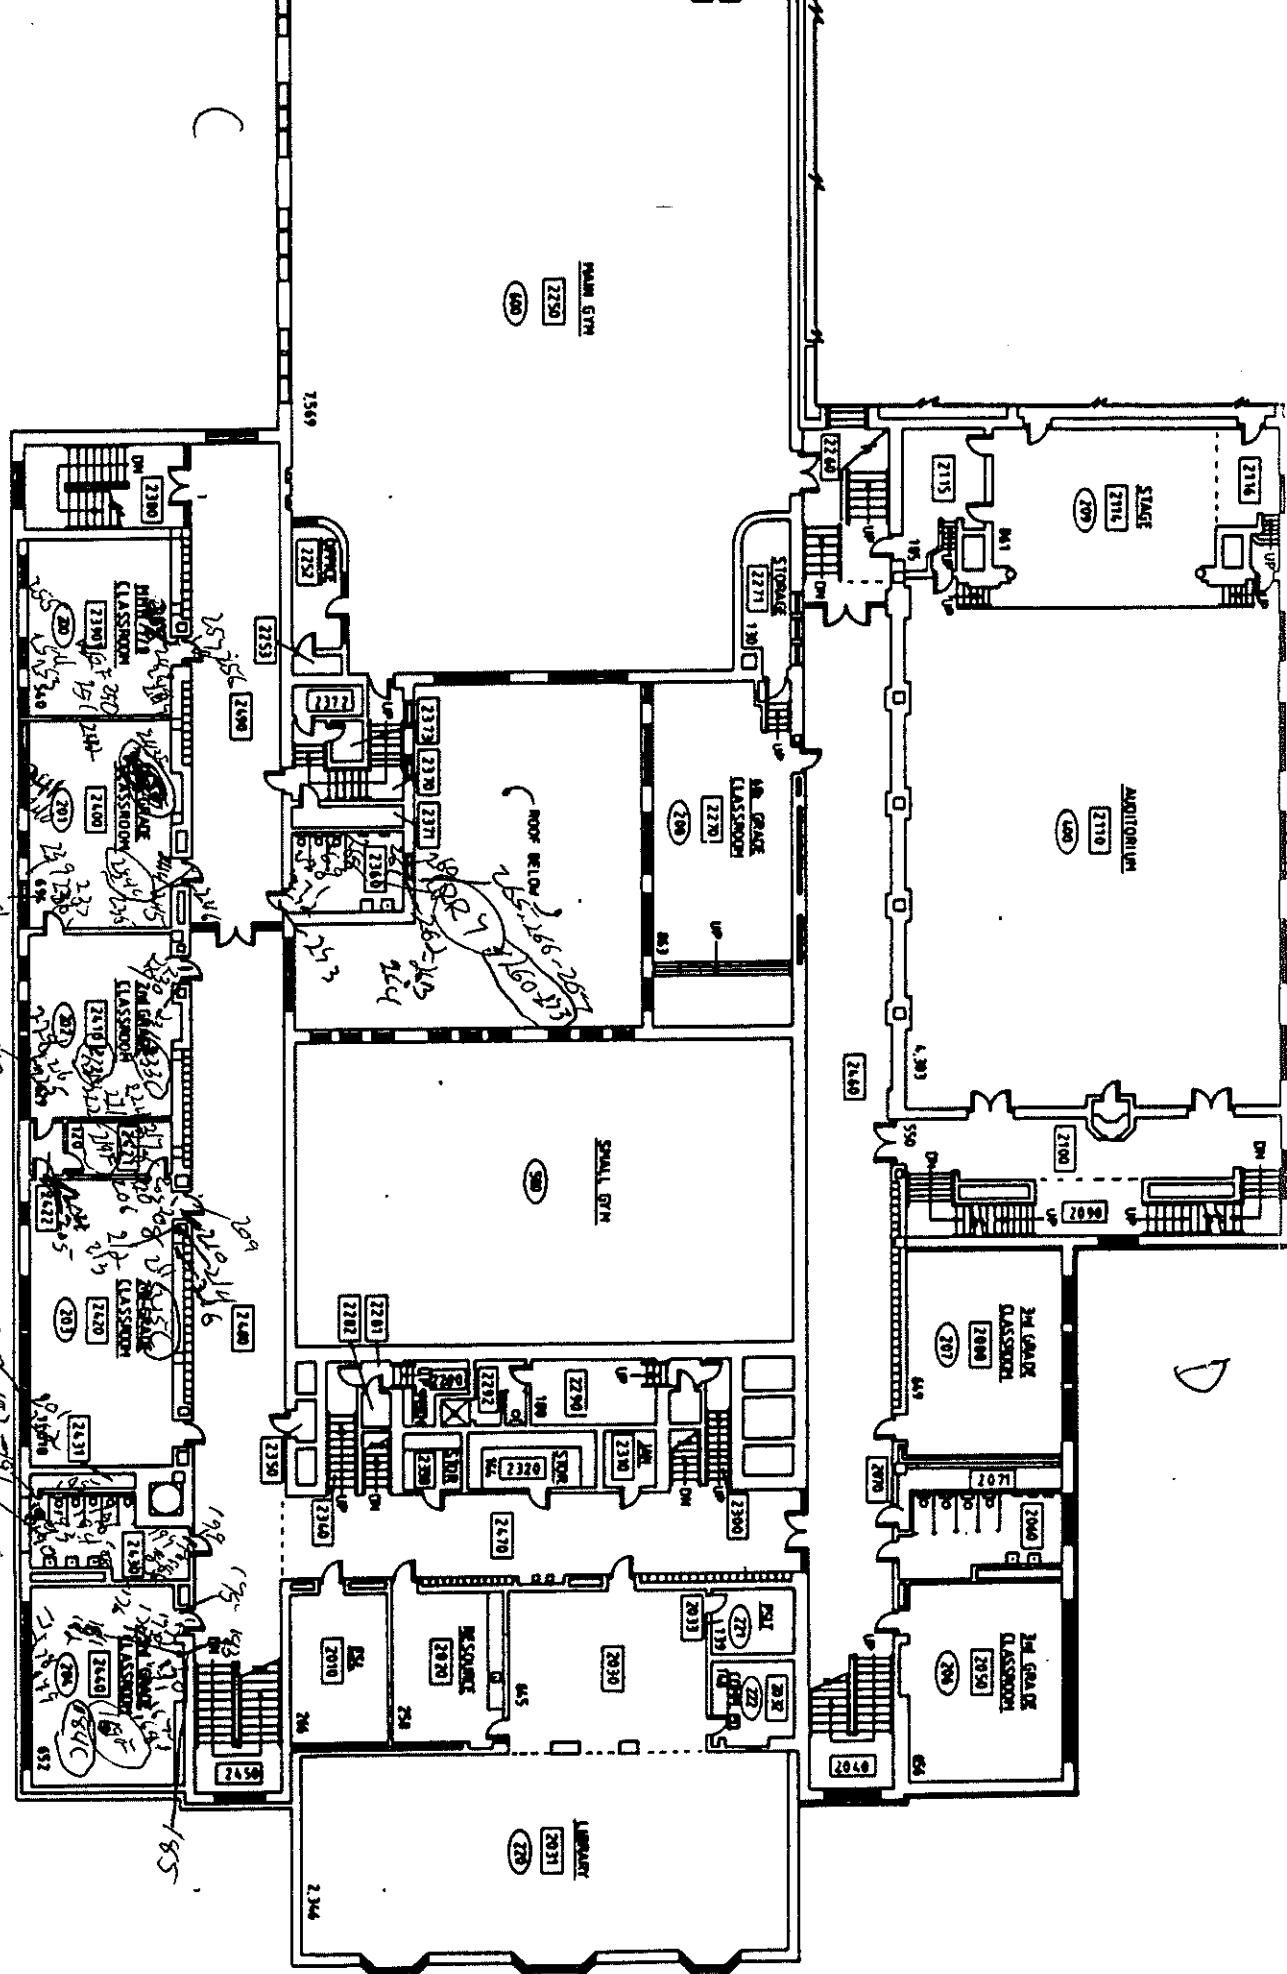


6/9/98

THIRD FLOOR PLAN

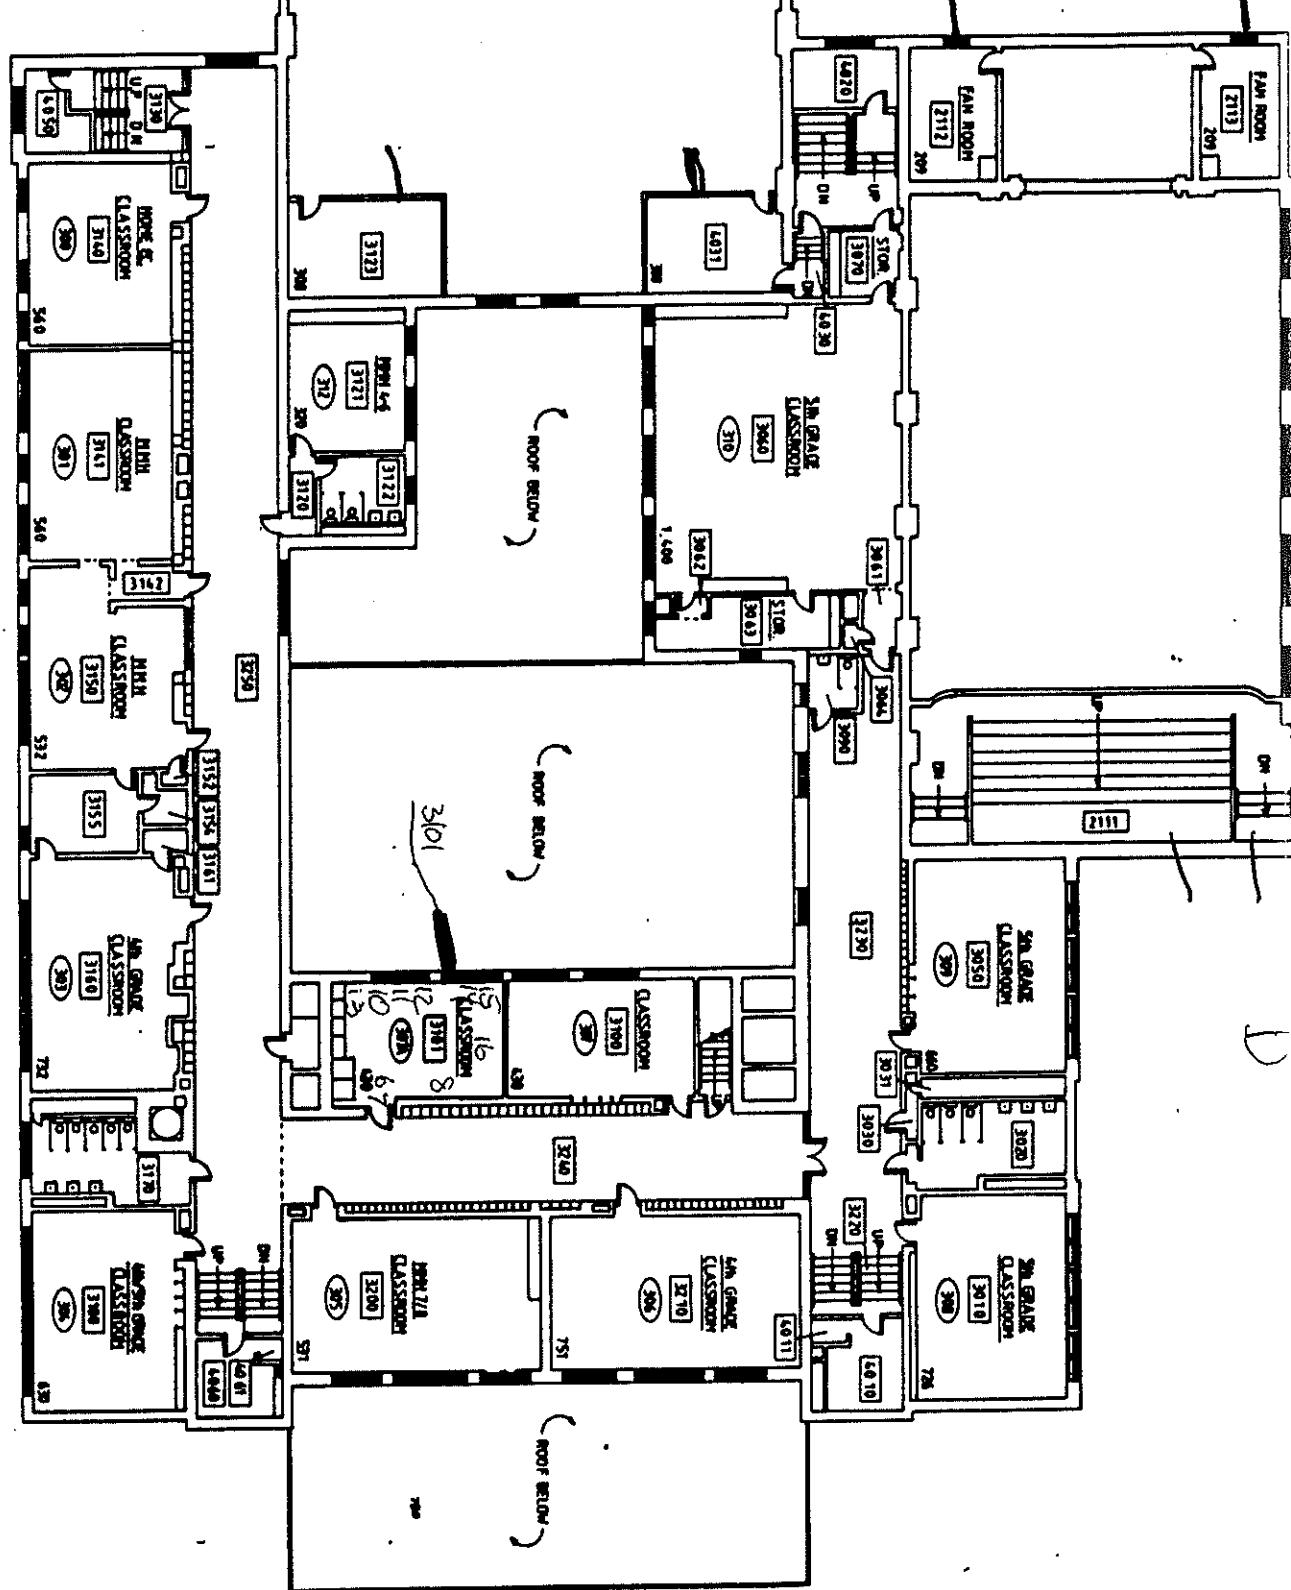

THIRD FLOOR PLAN

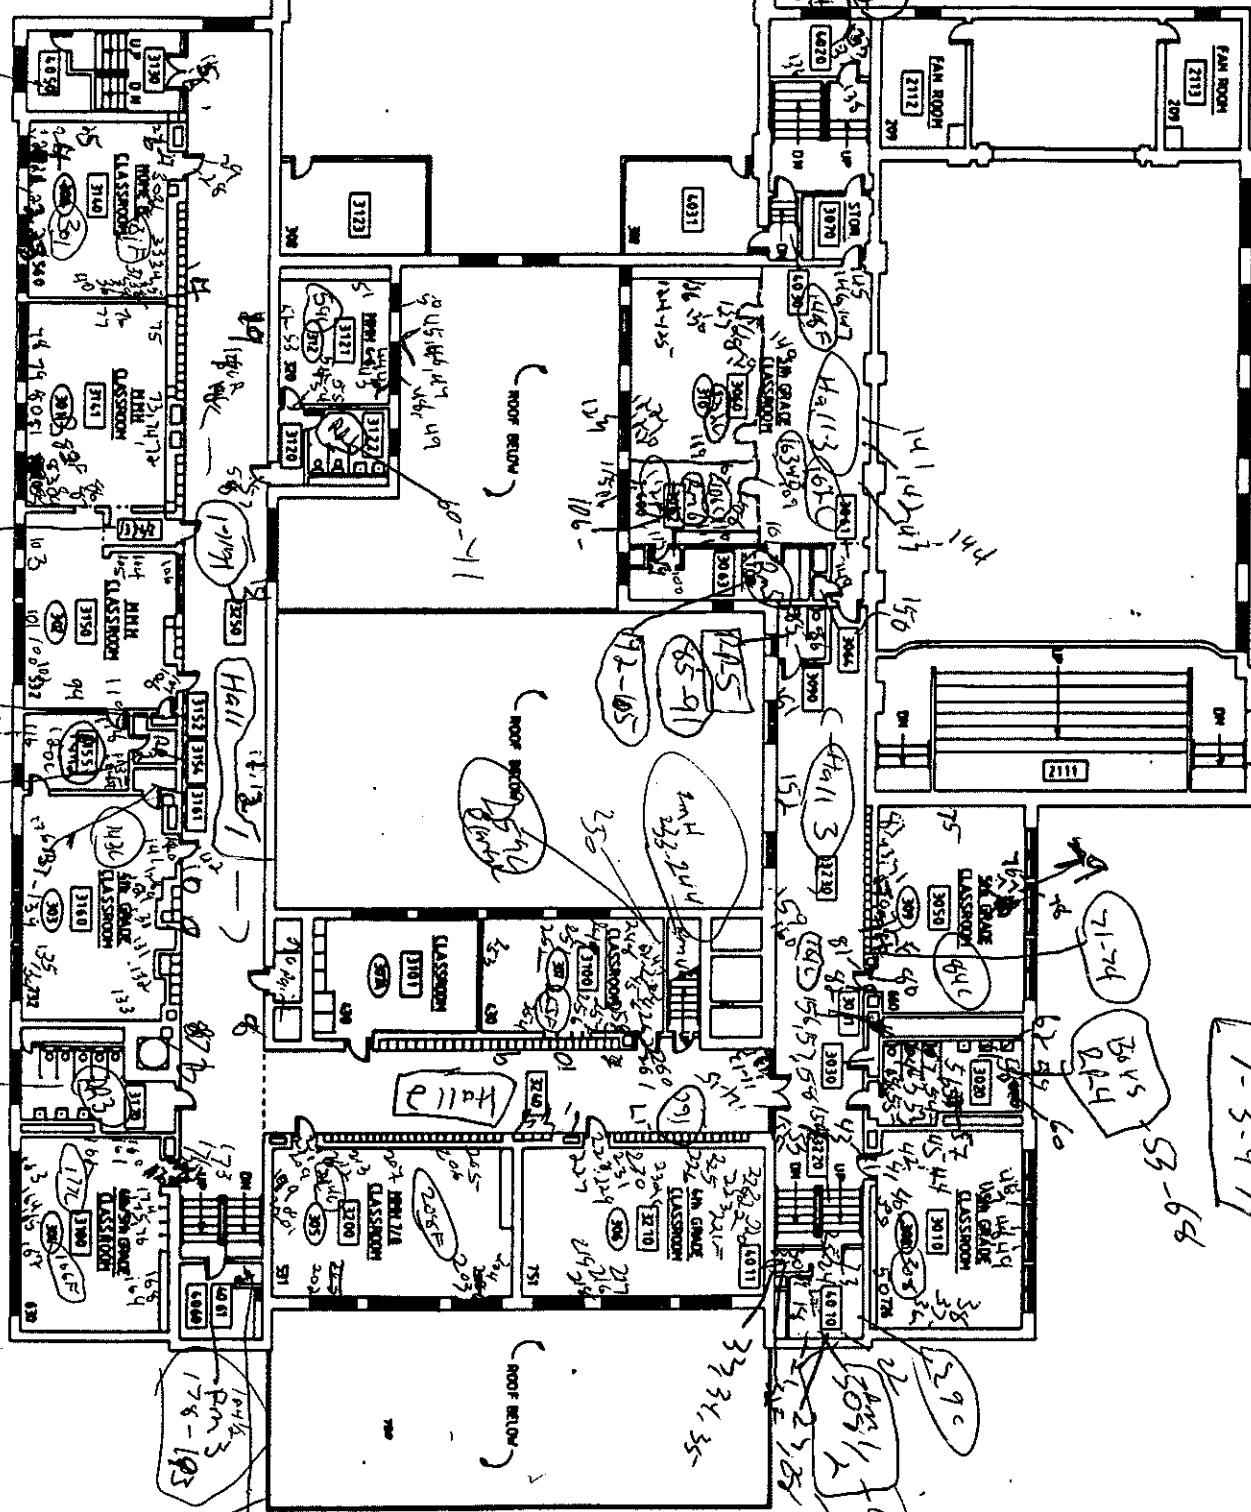


INDEPENDENT SCHOOL DIST. #625
360 COLBORNE STREET
ST. PAUL, MINNESOTA 55102



MONROE COMMUNITY SCHOOL
810 PALACE AVE.
ST. PAUL, MN

CONSTRUCTED: 1926, 64,78

Sheet
9



HALF FLOOR PLAN

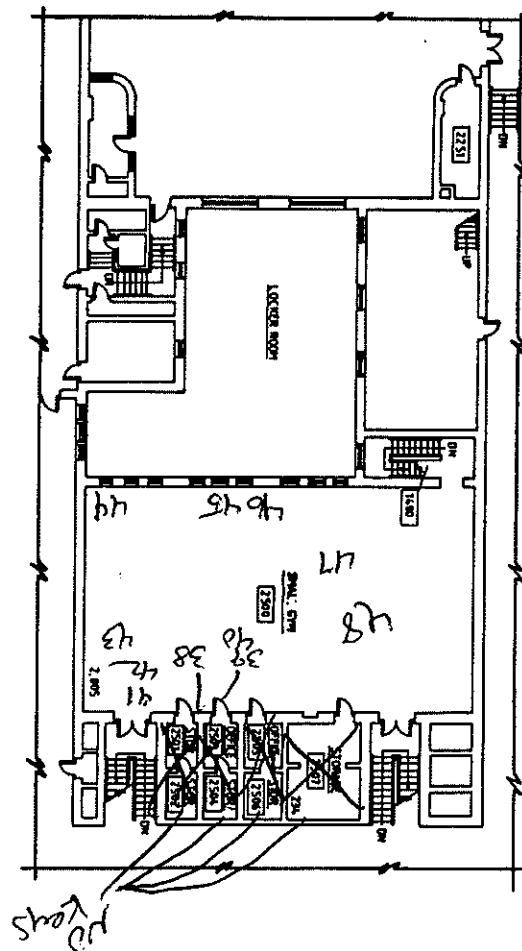

4

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L |
|----|-------------------------|----------|----------|---------|-------|------------|-------|----------------|-------------|-----------|-----------|--------|
| 1 | Monroe Community School | | | | | | | | | | | |
| 2 | | | | | | | | | | | | |
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 4 | 1926 Bldg | 17 | XRF | 6/9/98 | 2 | Auditorium | 1 | Wall | Middle Wall | Solid | Plaster | 1.12 |
| 5 | 1926 Bldg | 18 | XRF | 6/9/98 | 2 | Auditorium | 1 | Wall | Middle Wall | Solid | Plaster | 0.95 |
| 6 | 1926 Bldg | 19 | XRF | 6/9/98 | 2 | Auditorium | 1 | Door | Door | Solid | Metal | 5.09 |
| 7 | 1926 Bldg | 20 | XRF | 6/9/98 | 2 | Auditorium | 1 | Door | Casing | Solid | Wood | 3.03 |
| 8 | 1926 Bldg | 21 | XRF | 6/9/98 | 2 | Auditorium | 1 | Door | Door | Solid | Wood | 0.05 |
| 9 | 1926 Bldg | 22 | XRF | 6/9/98 | 2 | Auditorium | 1 | Wall | Middle Wall | Solid | Plaster | 0.07 |
| 10 | 1926 Bldg | 23 | XRF | 6/9/98 | 2 | Auditorium | 1 | Wall | Middle Wall | Solid | Plaster | 0.09 |
| 11 | 1926 Bldg | 24 | XRF | 6/9/98 | 2 | Auditorium | 1 | Door | Jamb | Solid | Wood | 1.9 |
| 12 | 1926 Bldg | 25 | XRF | 6/9/98 | 2 | Auditorium | 1 | Door | Door | Solid | Metal | 0.19 |
| 13 | 1926 Bldg | 26 | XRF | 6/9/98 | 2 | Auditorium | 1 | Wall | Middle Wall | Solid | Plaster | 0.01 |
| 14 | 1926 Bldg | 27 | XRF | 6/9/98 | 2 | Auditorium | 1 | Door | Door | Solid | Metal | 1.27 |
| 15 | 1926 Bldg | 28 | XRF | 6/9/98 | 2 | Auditorium | 1 | Door | Casing | Solid | Metal | 0.18 |
| 16 | 1926 Bldg | 29 | XRF | 6/9/98 | 2 | Auditorium | 1 | Wall | Baseboard | Peeling | Wood | 0.12 |
| 17 | 1926 Bldg | 30 | XRF | 6/9/98 | 2 | Auditorium | 1 | | Radiator | Solid | Metal | 0.17 |
| 18 | 1926 Bldg | 31 | XRF | 6/9/98 | 2 | Auditorium | 1 | Wall | Middle Wall | Solid | Plaster | 0.14 |
| 19 | 1926 Bldg | 32 | XRF | 6/9/98 | 2 | Auditorium | 1 | | Radiator | Solid | Metal | 0.21 |
| 20 | 1926 Bldg | 33 | XRF | 6/9/98 | 2 | Auditorium | 1 | Floor | | Solid | Wood | 0 |
| 21 | 1926 Bldg | 34 | XRF | 6/9/98 | 2 | Auditorium | 1 | Seat | Base | Solid | Metal | 0.97 |
| 22 | 1926 Bldg | 35 | XRF | 6/9/98 | 2 | Auditorium | 1 | Wall | Middle Wall | Solid | Plaster | 0.32 |
| 23 | 1926 Bldg | 36 | XRF | 6/9/98 | 2 | Auditorium | 2 | Wall | Middle Wall | Solid | Plaster | 0.12 |
| 24 | 1926 Bldg | 37 | XRF | 6/9/98 | 2 | Auditorium | 2 | Stairs | Hand rail | Solid | Wood | 0.02 |
| 25 | 1926 Bldg | 38 | XRF | 6/9/98 | 2 | Auditorium | 2 | | Radiator | Solid | Metal | 0.07 |
| 26 | 1926 Bldg | 39 | XRF | 6/9/98 | 2 | Auditorium | 2 | Window | Mullion | Cracked | Wood | 0.06 |
| 27 | 1926 Bldg | 40 | XRF | 6/9/98 | 2 | Auditorium | 2 | Door | Door | Solid | Wood | 0 |
| 28 | 1926 Bldg | 41 | XRF | 6/9/98 | 2 | Auditorium | 2 | Door | Casing | Solid | Metal | 0.09 |
| 29 | 1926 Bldg | 42 | XRF | 6/9/98 | 2 | Auditorium | 2 | Door | Door | Cracked | Metal | 5.09 |
| 30 | 1926 Bldg | 43 | XRF | 6/9/98 | 2 | Auditorium | 2 | Door | Casing | Solid | Wood | 3.37 |
| 31 | 1926 Bldg | 44 | XRF | 6/9/98 | 2 | Auditorium | 2 | Wall | Wall | Solid | Plaster | 0.08 |
| 32 | 1926 Bldg | 45 | XRF | 6/9/98 | 2 | Auditorium | 2 | | Radiator | Solid | Metal | 0.14 |
| 33 | 1926 Bldg | 46 | XRF | 6/9/98 | 2 | Auditorium | 2 | Ceiling | | Solid | Plaster | 0.01 |
| 34 | 1926 Bldg | 121 | XRF | 6/10/98 | 1 | Cafeteria | 100 | Door | Door | Solid | Metal | 5.09 |
| 35 | 1926 Bldg | 122 | XRF | 6/10/98 | 1 | Cafeteria | 100 | Wall | Middle Wall | Solid | Plaster | 0.03 |
| 36 | 1926 Bldg | 123 | XRF | 6/10/98 | 1 | Cafeteria | 100 | Wall | Wall | Solid | Plaster | 0.13 |
| 37 | 1926 Bldg | 124 | XRF | 6/10/98 | 1 | Cafeteria | 100 | Wall | Wall | Solid | Plaster | 0.24 |
| 38 | 1926 Bldg | 125 | XRF | 6/10/98 | 1 | Cafeteria | 100 | | Radiator | Solid | Metal | 0.14 |
| 39 | 1926 Bldg | 126 | XRF | 6/10/98 | 1 | Cafeteria | 100 | Window | Mullion | Solid | Wood | 0.04 |
| 40 | 1926 Bldg | 127 | XRF | 6/10/98 | 1 | Cafeteria | 100 | Window | Casing | Solid | Wood | 0.17 |
| 41 | 1926 Bldg | 128 | XRF | 6/10/98 | 1 | Cafeteria | 100 | Window | Casing | Solid | Metal | 0 |
| 42 | 1926 Bldg | 129 | XRF | 6/10/98 | 1 | Cafeteria | 100 | | Column | Solid | Plaster | 0.14 |
| 43 | 1926 Bldg | 119 | XRF | 7/3/97 | 3 | Classroom | 30 | Wall | Middle Wall | Solid | Drywall | 0 |
| 44 | 1926 Bldg | 120 | XRF | 7/3/97 | 3 | Classroom | 30 | Wall | Wall | Solid | Plaster | 0.28 |
| 45 | 1926 Bldg | 121 | XRF | 7/3/97 | 3 | Classroom | 30 | Wall | Baseboard | Cracked | Metal | 3.19 |
| 46 | 1926 Bldg | 122 | XRF | 7/3/97 | 3 | Classroom | 30 | | Radiator | Solid | Metal | 0.42 |
| 47 | 1926 Bldg | 123 | XRF | 7/3/97 | 3 | Classroom | 30 | Window | Casing | Cracked | Metal | 0.5 |
| 48 | 1926 Bldg | 124 | XRF | 7/3/97 | 3 | Classroom | 30 | Cabinet | Door | Solid | Wood | 0.04 |
| 49 | 1926 Bldg | 125 | XRF | 7/3/97 | 3 | Classroom | 30 | Cabinet | Shelf | Solid | Wood | 0.03 |
| 50 | 1926 Bldg | 126 | XRF | 7/3/97 | 3 | Classroom | 30 | Bulletin Board | Trim | Solid | Wood | 0.03 |
| 51 | 1926 Bldg | 127 | XRF | 7/3/97 | 3 | Classroom | 30 | Door | Door | Solid | Wood | 0 |
| 52 | 1926 Bldg | 128 | XRF | 7/3/97 | 3 | Classroom | 30 | Door | Casing | Cracked | Metal | 0.01 |
| 53 | 1926 Bldg | 129 | XRF | 7/3/97 | 3 | Classroom | 30 | Window | Casing | Solid | Metal | 0 |
| 54 | 1926 Bldg | 130 | XRF | 7/3/97 | 3 | Classroom | 30 | Wall | Wall Rgstr | Solid | Metal | 0 |
| 55 | 1926 Bldg | 131 | XRF | 7/3/97 | 3 | Classroom | 30 | Floor | | Solid | Wood | 0 |
| 56 | 1926 Bldg | 132 | XRF | 7/3/97 | 3 | Classroom | 30 | Ceiling | | Solid | Plaster | 0.11 |
| 57 | 1926 Bldg | 144 | XRF | 6/10/98 | 1 | Classroom | 101 | Wall | Baseboard | Solid | Wood | 3.12 |
| 58 | 1926 Bldg | 145 | XRF | 6/10/98 | 1 | Classroom | 101 | | Radiator | Peeling | Metal | 0.27 |
| 59 | 1926 Bldg | 146 | XRF | 6/10/98 | 1 | Classroom | 101 | Window | Casing | Solid | Wood | 0.07 |
| 60 | 1926 Bldg | 147 | XRF | 6/10/98 | 1 | Classroom | 101 | Window | Casing | Solid | Metal | 0 |
| 61 | 1926 Bldg | 148 | XRF | 6/10/98 | 1 | Classroom | 101 | Window | Mullion | Solid | Wood | 0.06 |
| 62 | 1926 Bldg | 149 | XRF | 6/10/98 | 1 | Classroom | 101 | Door | Door | Solid | Wood | 0.04 |
| 63 | 1926 Bldg | 150 | XRF | 6/10/98 | 1 | Classroom | 101 | Chalkboard | Rail | Solid | Wood | 0.05 |
| 64 | 1926 Bldg | 151 | XRF | 6/10/98 | 1 | Classroom | 101 | Wall | Wall | Solid | Plaster | 0.06 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L |
|-----|-----------|----------|----------|---------|-------|-----------|-------|----------------|------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 65 | 1926 Bldg | 152 | XRF | 6/10/98 | 1 | Classroom | 101 | Cabinet | Door | Solid | Wood | 0.07 |
| 66 | 1926 Bldg | 153 | XRF | 6/10/98 | 1 | Classroom | 101 | Ceiling | | Solid | Plaster | 0.07 |
| 67 | 1926 Bldg | 154 | XRF | 6/10/98 | 1 | Classroom | 102 | Wall | Baseboar | Solid | Wood | 2.74 |
| 68 | 1926 Bldg | 155 | XRF | 6/10/98 | 1 | Classroom | 102 | Wall | Wall | Solid | Plaster | 0.05 |
| 69 | 1926 Bldg | 156 | XRF | 6/10/98 | 1 | Classroom | 102 | Chalkboard | Rail | Solid | Wood | 0.07 |
| 70 | 1926 Bldg | 157 | XRF | 6/10/98 | 1 | Classroom | 102 | | Radiator | Solid | Metal | 0.24 |
| 71 | 1926 Bldg | 158 | XRF | 6/10/98 | 1 | Classroom | 102 | Window | Casing | Solid | Metal | 0 |
| 72 | 1926 Bldg | 159 | XRF | 6/10/98 | 1 | Classroom | 102 | Window | Mullion | Solid | Wood | 0.07 |
| 73 | 1926 Bldg | 160 | XRF | 6/10/98 | 1 | Classroom | 102 | Wall | Wall | Solid | Plaster | 0.07 |
| 74 | 1926 Bldg | 161 | XRF | 6/10/98 | 1 | Classroom | 102 | Wall | Wall | Solid | Plaster | 0.12 |
| 75 | 1926 Bldg | 162 | XRF | 6/10/98 | 1 | Classroom | 102 | Door | Door | Solid | Wood | 0.05 |
| 76 | 1926 Bldg | 163 | XRF | 6/10/98 | 1 | Classroom | 102 | Wall | Midle Wall | Solid | Plaster | 0.06 |
| 77 | 1926 Bldg | 164 | XRF | 6/10/98 | 1 | Classroom | 102 | Cabinet | Door | Solid | Wood | 0.06 |
| 78 | 1926 Bldg | 165 | XRF | 6/10/98 | 1 | Classroom | 102 | Ceiling | | Solid | Plaster | 0.15 |
| 79 | 1926 Bldg | 166 | XRF | 6/10/98 | 1 | Classroom | 103 | Wall | Baseboar | Solid | Wood | 0.29 |
| 80 | 1926 Bldg | 167 | XRF | 6/10/98 | 1 | Classroom | 103 | Chalkboard | Rail | Solid | Wood | 0.04 |
| 81 | 1926 Bldg | 168 | XRF | 6/10/98 | 1 | Classroom | 103 | Wall | Midle Wall | Solid | Plaster | 5.09 |
| 82 | 1926 Bldg | 169 | XRF | 6/10/98 | 1 | Classroom | 103 | Window | Mullion | Solid | Wood | 0.06 |
| 83 | 1926 Bldg | 170 | XRF | 6/10/98 | 1 | Classroom | 103 | Window | Casing | Solid | Metal | 0 |
| 84 | 1926 Bldg | 171 | XRF | 6/10/98 | 1 | Classroom | 103 | Door | Door | Solid | Wood | 0.05 |
| 85 | 1926 Bldg | 172 | XRF | 6/10/98 | 1 | Classroom | 103 | Wall | Midle Wall | Solid | Plaster | 0.52 |
| 86 | 1926 Bldg | 173 | XRF | 6/10/98 | 1 | Classroom | 103 | Floor | | Solid | Wood | 0 |
| 87 | 1926 Bldg | 174 | XRF | 6/10/98 | 1 | Classroom | 103 | Ceiling | | Solid | Plaster | 0.27 |
| 88 | 1926 Bldg | 175 | XRF | 6/10/98 | 1 | Classroom | 104 | Wall | Baseboar | Solid | Wood | 0.43 |
| 89 | 1926 Bldg | 176 | XRF | 6/10/98 | 1 | Classroom | 104 | Chalkboard | Rail | Solid | Wood | 0.04 |
| 90 | 1926 Bldg | 177 | XRF | 6/10/98 | 1 | Classroom | 104 | Wall | Wall | Solid | Plaster | 0.2 |
| 91 | 1926 Bldg | 178 | XRF | 6/10/98 | 1 | Classroom | 104 | | Radiator | Solid | Metal | 1.83 |
| 92 | 1926 Bldg | 179 | XRF | 6/10/98 | 1 | Classroom | 104 | Window | Mullion | Solid | Wood | 0.14 |
| 93 | 1926 Bldg | 180 | XRF | 6/10/98 | 1 | Classroom | 104 | Window | Casing | Solid | Metal | 0 |
| 94 | 1926 Bldg | 181 | XRF | 6/10/98 | 1 | Classroom | 104 | Door | Door | Solid | Wood | 0 |
| 95 | 1926 Bldg | 182 | XRF | 6/10/98 | 1 | Classroom | 104 | Wall | Midle Wall | Solid | Plaster | 5.09 |
| 96 | 1926 Bldg | 183 | XRF | 6/10/98 | 1 | Classroom | 104 | Cabinet | Door | Solid | Wood | 0.07 |
| 97 | 1926 Bldg | 184 | XRF | 6/10/98 | 1 | Classroom | 104 | Floor | | Solid | Wood | 0 |
| 98 | 1926 Bldg | 185 | XRF | 6/10/98 | 1 | Classroom | 104 | Ceiling | | Solid | Plaster | 0.05 |
| 99 | 1926 Bldg | 87 | XRF | 6/10/98 | 1 | Classroom | 105 | Wall | Wall | Solid | Plaster | 5.09 |
| 100 | 1926 Bldg | 88 | XRF | 6/10/98 | 1 | Classroom | 105 | Wall | Baseboar | Solid | Wood | 0.27 |
| 101 | 1926 Bldg | 89 | XRF | 6/10/98 | 1 | Classroom | 105 | Chalkboard | Rail | Solid | Wood | 0.11 |
| 102 | 1926 Bldg | 90 | XRF | 6/10/98 | 1 | Classroom | 105 | Cabinet | Door | Solid | Wood | 0.06 |
| 103 | 1926 Bldg | 91 | XRF | 6/10/98 | 1 | Classroom | 105 | Door | Door | Solid | Wood | 0 |
| 104 | 1926 Bldg | 92 | XRF | 6/10/98 | 1 | Classroom | 105 | Wall | Midle Wall | Solid | Plaster | 0.06 |
| 105 | 1926 Bldg | 93 | XRF | 6/10/98 | 1 | Classroom | 105 | | Radiator | Solid | Metal | 2.13 |
| 106 | 1926 Bldg | 94 | XRF | 6/10/98 | 1 | Classroom | 105 | Window | Mullion | Solid | Wood | 0.05 |
| 107 | 1926 Bldg | 95 | XRF | 6/10/98 | 1 | Classroom | 105 | Window | Casing | Solid | Metal | 0 |
| 108 | 1926 Bldg | 96 | XRF | 6/10/98 | 1 | Classroom | 105 | Ceiling | | Solid | Plaster | 0.02 |
| 109 | 1926 Bldg | 97 | XRF | 6/10/98 | 1 | Classroom | 106 | Chalkboard | Rail | Solid | Wood | 0.06 |
| 110 | 1926 Bldg | 98 | XRF | 6/10/98 | 1 | Classroom | 106 | Door | Door | Solid | Wood | 0.08 |
| 111 | 1926 Bldg | 99 | XRF | 6/10/98 | 1 | Classroom | 106 | Wall | Midle Wall | Solid | Plaster | 0.05 |
| 112 | 1926 Bldg | 100 | XRF | 6/10/98 | 1 | Classroom | 106 | Cabinet | Door | Solid | Wood | 0.05 |
| 113 | 1926 Bldg | 101 | XRF | 6/10/98 | 1 | Classroom | 106 | Wall | Baseboar | Solid | Wood | 2.67 |
| 114 | 1926 Bldg | 102 | XRF | 6/10/98 | 1 | Classroom | 106 | Wall | Wall | Solid | Plaster | 0.15 |
| 115 | 1926 Bldg | 103 | XRF | 6/10/98 | 1 | Classroom | 106 | Wall | Wall | Solid | Plaster | 0.1 |
| 116 | 1926 Bldg | 104 | XRF | 6/10/98 | 1 | Classroom | 106 | | Radiator | Solid | Metal | 0.17 |
| 117 | 1926 Bldg | 105 | XRF | 6/10/98 | 1 | Classroom | 106 | Window | Mullion | Solid | Wood | 0.05 |
| 118 | 1926 Bldg | 106 | XRF | 6/10/98 | 1 | Classroom | 106 | Window | Casing | Solid | Wood | 0.1 |
| 119 | 1926 Bldg | 107 | XRF | 6/10/98 | 1 | Classroom | 106 | Window | Casing | Solid | Metal | 0 |
| 120 | 1926 Bldg | 108 | XRF | 6/10/98 | 1 | Classroom | 106 | Floor | | Solid | Wood | 0 |
| 121 | 1926 Bldg | 109 | XRF | 6/10/98 | 1 | Classroom | 106 | Ceiling | | Solid | Plaster | 0.02 |
| 122 | 1926 Bldg | 247 | XRF | 7/3/97 | 2 | Classroom | 200 | Wall | Wall | Solid | Plaster | 0.05 |
| 123 | 1926 Bldg | 248 | XRF | 7/3/97 | 2 | Classroom | 200 | Cabinet | Door | Solid | Wood | 0.04 |
| 124 | 1926 Bldg | 249 | XRF | 7/3/97 | 2 | Classroom | 200 | Bulletin Board | Trim | Solid | Wood | 0.06 |
| 125 | 1926 Bldg | 250 | XRF | 7/3/97 | 2 | Classroom | 200 | Wall | Midle Wall | Cracked | Plaster | 0.19 |
| 126 | 1926 Bldg | 251 | XRF | 7/3/97 | 2 | Classroom | 200 | Wall | Baseboar | Peeling | Metal | 4.49 |
| 127 | 1926 Bldg | 252 | XRF | 7/3/97 | 2 | Classroom | 200 | Floor | | Solid | Wood | 0 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L |
|-----|-----------|----------|----------|--------|-------|-----------|-------|----------------|------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 128 | 1926 Bldg | 253 | XRF | 7/3/97 | 2 | Classroom | 200 | Univent | | Cracked | Metal | 0.24 |
| 129 | 1926 Bldg | 254 | XRF | 7/3/97 | 2 | Classroom | 200 | Window | Casing | Solid | Wood | 0.06 |
| 130 | 1926 Bldg | 255 | XRF | 7/3/97 | 2 | Classroom | 200 | Window | Radiator | Solid | Metal | 0.14 |
| 131 | 1926 Bldg | 256 | XRF | 7/3/97 | 2 | Classroom | 200 | Door | Door | Cracked | Wood | 0.05 |
| 132 | 1926 Bldg | 257 | XRF | 7/3/97 | 2 | Classroom | 200 | Door | Casing | Cracked | Wood | 0.04 |
| 133 | 1926 Bldg | 258 | XRF | 7/3/97 | 2 | Classroom | 200 | Wall | Wall | Solid | Plaster | 0.37 |
| 134 | 1926 Bldg | 234 | XRF | 7/3/97 | 2 | Classroom | 201 | Ceiling | | Solid | Plaster | 0.05 |
| 135 | 1926 Bldg | 235 | XRF | 7/3/97 | 2 | Classroom | 201 | Wall | Baseboar | Cracked | Metal | 2.98 |
| 136 | 1926 Bldg | 236 | XRF | 7/3/97 | 2 | Classroom | 201 | Door | Door | Solid | Wood | 0.08 |
| 137 | 1926 Bldg | 237 | XRF | 7/3/97 | 2 | Classroom | 201 | Door | Casing | Solid | Wood | 0.03 |
| 138 | 1926 Bldg | 238 | XRF | 7/3/97 | 2 | Classroom | 201 | | Radiator | Solid | Metal | 0.2 |
| 139 | 1926 Bldg | 239 | XRF | 7/3/97 | 2 | Classroom | 201 | Window | Casing | Solid | Wood | 0.14 |
| 140 | 1926 Bldg | 240 | XRF | 7/3/97 | 2 | Classroom | 201 | Wall | Wall | Cracked | Plaster | 0.37 |
| 141 | 1926 Bldg | 241 | XRF | 7/3/97 | 2 | Classroom | 201 | | Radiator | Cracked | Metal | 0.01 |
| 142 | 1926 Bldg | 242 | XRF | 7/3/97 | 2 | Classroom | 201 | Wall | Wall | Cracked | Drywall | 0.13 |
| 143 | 1926 Bldg | 243 | XRF | 7/3/97 | 2 | Classroom | 201 | Floor | | Cracked | Wood | 0 |
| 144 | 1926 Bldg | 244 | XRF | 7/3/97 | 2 | Classroom | 201 | Wall | Wall | Cracked | Plaster | 0.3 |
| 145 | 1926 Bldg | 245 | XRF | 7/3/97 | 2 | Classroom | 201 | Door | Door | Cracked | Wood | 0.07 |
| 146 | 1926 Bldg | 246 | XRF | 7/3/97 | 2 | Classroom | 201 | Door | Casing | Cracked | Wood | 0.03 |
| 147 | 1926 Bldg | 221 | XRF | 7/3/97 | 2 | Classroom | 202 | Wall | Wall | Cracked | Plaster | 0.49 |
| 148 | 1926 Bldg | 222 | XRF | 7/3/97 | 2 | Classroom | 202 | Wall | Baseboar | Cracked | Metal | 5.09 |
| 149 | 1926 Bldg | 223 | XRF | 7/3/97 | 2 | Classroom | 202 | Floor | | Cracked | Wood | 0 |
| 150 | 1926 Bldg | 224 | XRF | 7/3/97 | 2 | Classroom | 202 | Bulletin Board | Rail | Solid | Wood | 0.05 |
| 151 | 1926 Bldg | 225 | XRF | 7/3/97 | 2 | Classroom | 202 | | Radiator | Solid | Wood | 0.24 |
| 152 | 1926 Bldg | 226 | XRF | 7/3/97 | 2 | Classroom | 202 | Univent | | Cracked | Metal | 0.42 |
| 153 | 1926 Bldg | 227 | XRF | 7/3/97 | 2 | Classroom | 202 | Window | Casing | Solid | Wood | 0.04 |
| 154 | 1926 Bldg | 228 | XRF | 7/3/97 | 2 | Classroom | 202 | Wall | Midle Wall | Cracked | Plaster | 0.38 |
| 155 | 1926 Bldg | 229 | XRF | 7/3/97 | 2 | Classroom | 202 | Wall | Wall | Cracked | Plaster | 0.05 |
| 156 | 1926 Bldg | 230 | XRF | 7/3/97 | 2 | Classroom | 202 | Door | Door | Cracked | Wood | 0.06 |
| 157 | 1926 Bldg | 231 | XRF | 7/3/97 | 2 | Classroom | 202 | Door | Casing | Cracked | Wood | 0.01 |
| 158 | 1926 Bldg | 232 | XRF | 7/3/97 | 2 | Classroom | 202 | Cabinet | Door | Cracked | Wood | 0.02 |
| 159 | 1926 Bldg | 233 | XRF | 7/3/97 | 2 | Classroom | 202 | Ceiling | | Cracked | Plaster | 0.01 |
| 160 | 1926 Bldg | 201 | XRF | 7/3/97 | 2 | Classroom | 203 | Wall | Wall | Cracked | Plaster | 0.04 |
| 161 | 1926 Bldg | 202 | XRF | 7/3/97 | 2 | Classroom | 203 | | Radiator | Cracked | Metal | 5.09 |
| 162 | 1926 Bldg | 203 | XRF | 7/3/97 | 2 | Classroom | 203 | Window | Casing | Solid | Wood | 0.14 |
| 163 | 1926 Bldg | 204 | XRF | 7/3/97 | 2 | Classroom | 203 | Door | Door | Solid | Wood | 0.05 |
| 164 | 1926 Bldg | 205 | XRF | 7/3/97 | 2 | Classroom | 203 | Door | Casing | Solid | Wood | 0.03 |
| 165 | 1926 Bldg | 206 | XRF | 7/3/97 | 2 | Classroom | 203 | Wall | Baseboar | Cracked | Wood | 0.29 |
| 166 | 1926 Bldg | 207 | XRF | 7/3/97 | 2 | Classroom | 203 | Wall | Chair rail | Solid | Wood | 0.04 |
| 167 | 1926 Bldg | 208 | XRF | 7/3/97 | 2 | Classroom | 203 | Wall | Wall | Cracked | Plaster | 0.59 |
| 168 | 1926 Bldg | 209 | XRF | 7/3/97 | 2 | Classroom | 203 | Door | Door | Cracked | Wood | 0.03 |
| 169 | 1926 Bldg | 210 | XRF | 7/3/97 | 2 | Classroom | 203 | Door | Casing | Cracked | Wood | 0.04 |
| 170 | 1926 Bldg | 211 | XRF | 7/3/97 | 2 | Classroom | 203 | Cabinet | Door | Cracked | Wood | 0.03 |
| 171 | 1926 Bldg | 212 | XRF | 7/3/97 | 2 | Classroom | 203 | Wall | Midle Wall | Cracked | Plaster | 0.08 |
| 172 | 1926 Bldg | 213 | XRF | 7/3/97 | 2 | Classroom | 203 | Wall | Wall Rgstr | Solid | Metal | 0.22 |
| 173 | 1926 Bldg | 214 | XRF | 7/3/97 | 2 | Classroom | 203 | Door | Crown mo | Solid | Wood | 0.08 |
| 174 | 1926 Bldg | 215 | XRF | 7/3/97 | 2 | Classroom | 203 | Ceiling | | Solid | Plaster | 0.04 |
| 175 | 1926 Bldg | 216 | XRF | 7/3/97 | 2 | Classroom | 203 | Wall | Wall | Cracked | Plaster | 0.08 |
| 176 | 1926 Bldg | 217 | XRF | 7/3/97 | 2 | Classroom | 203 | Door | Door | Cracked | Plaster | 0.04 |
| 177 | 1926 Bldg | 218 | XRF | 7/3/97 | 2 | Classroom | 203 | Door | Shelf | Cracked | Wood | 0.27 |
| 178 | 1926 Bldg | 219 | XRF | 7/3/97 | 2 | Classroom | 203 | Door | Floor | Cracked | Wood | 0 |
| 179 | 1926 Bldg | 220 | XRF | 7/3/97 | 2 | Classroom | 203 | Door | Casing | Solid | Wood | 0.03 |
| 180 | 1926 Bldg | 167 | XRF | 7/3/97 | 2 | Classroom | 204 | Wall | Wall | Cracked | Plaster | 3.45 |
| 181 | 1926 Bldg | 168 | XRF | 7/3/97 | 2 | Classroom | 204 | Wall | Baseboar | Cracked | Wood | 0.31 |
| 182 | 1926 Bldg | 169 | XRF | 7/3/97 | 2 | Classroom | 204 | Floor | | Cracked | Wood | 0 |
| 183 | 1926 Bldg | 170 | XRF | 7/3/97 | 2 | Classroom | 204 | Door | Cabinet | Solid | Wood | 0.04 |
| 184 | 1926 Bldg | 171 | XRF | 7/3/97 | 2 | Classroom | 204 | Door | Inside | Solid | Wood | 0.01 |
| 185 | 1926 Bldg | 172 | XRF | 7/3/97 | 2 | Classroom | 204 | Door | Door | Cracked | Wood | 0 |
| 186 | 1926 Bldg | 173 | XRF | 7/3/97 | 2 | Classroom | 204 | Window | Casing | Solid | Metal | 0.04 |
| 187 | 1926 Bldg | 174 | XRF | 7/3/97 | 2 | Classroom | 204 | Door | Casing | Cracked | Wood | 0.06 |
| 188 | 1926 Bldg | 175 | XRF | 7/3/97 | 2 | Classroom | 204 | Wall | Wall | Cracked | Plaster | 0.92 |
| 189 | 1926 Bldg | 176 | XRF | 7/3/97 | 2 | Classroom | 204 | Chalkboard | Rail | Cracked | Wood | 0.09 |
| 190 | 1926 Bldg | 177 | XRF | 7/3/97 | 2 | Classroom | 204 | Wall | Chair rall | Sold | Wood | 0.04 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | |
|-----|-----------|----------|----------|---------|-------|-----------|-------|----------------|------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 191 | 1926 Bldg | 178 | XRF | 7/3/97 | 2 | Classroom | 204 | Window | Casing | Solid | Wood | 0.09 |
| 192 | 1926 Bldg | 179 | XRF | 7/3/97 | 2 | Classroom | 204 | Window | Stool | Solid | Tile | 0.05 |
| 193 | 1926 Bldg | 180 | XRF | 7/3/97 | 2 | Classroom | 204 | | Radiator | Cracked | Metal | 5.09 |
| 194 | 1926 Bldg | 181 | XRF | 7/3/97 | 2 | Classroom | 204 | Wall | Midle Wall | Solid | Plaster | 0.08 |
| 195 | 1926 Bldg | 182 | XRF | 7/3/97 | 2 | Classroom | 204 | Wall | Wall Rgstr | Solid | Metal | 5.09 |
| 196 | 1926 Bldg | 183 | XRF | 7/3/97 | 2 | Classroom | 204 | Door | Crown mo | Solid | Wood | 0.33 |
| 197 | 1926 Bldg | 184 | XRF | 7/3/97 | 2 | Classroom | 204 | Ceiling | | Solid | Plaster | 0 |
| 198 | 1926 Bldg | 185 | XRF | 7/3/97 | 2 | Classroom | 204 | Wall | Wall | Solid | Plaster | 0.25 |
| 199 | 1926 Bldg | 20 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Wall | Cracked | Plaster | 0.3 |
| 200 | 1926 Bldg | 21 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Peeling | Plaster | | 0.32 |
| 201 | 1926 Bldg | 22 | XRF | 4/20/97 | 3 | Classroom | 301 | Window | Casing | Peeling | Wood | 0.07 |
| 202 | 1926 Bldg | 23 | XRF | 4/20/97 | 3 | Classroom | 301 | Window | Casing | Solid | Wood | 0.07 |
| 203 | 1926 Bldg | 24 | XRF | 4/20/97 | 3 | Classroom | 301 | | Radiator | Cracked | Metal | 0.5 |
| 204 | 1926 Bldg | 25 | XRF | 4/20/97 | 3 | Classroom | 301 | Cabinet | Door | Solid | Wood | 0 |
| 205 | 1926 Bldg | 26 | XRF | 4/20/97 | 3 | Classroom | 301 | Bookcase | Inside | Solid | Wood | 0.02 |
| 206 | 1926 Bldg | 27 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Wall | Solid | Plaster | 0.2 |
| 207 | 1926 Bldg | 28 | XRF | 4/20/97 | 3 | Classroom | 301 | Door | Door | Cracked | Wood | 0.05 |
| 208 | 1926 Bldg | 29 | XRF | 4/20/97 | 3 | Classroom | 301 | Door | Casing | Solid | Wood | 0.03 |
| 209 | 1926 Bldg | 30 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Baseboar | Cracked | Metal | 3.57 |
| 210 | 1926 Bldg | 31 | XRF | 4/20/97 | 3 | Classroom | 301 | Floor | | Solid | Wood | 0 |
| 211 | 1926 Bldg | 32 | XRF | 4/20/97 | 3 | Classroom | 301 | Cabinet | Door | Solid | Metal | 0.04 |
| 212 | 1926 Bldg | 33 | XRF | 4/20/97 | 3 | Classroom | 301 | Cabinet | Shelf | Solid | Metal | 0 |
| 213 | 1926 Bldg | 34 | XRF | 4/20/97 | 3 | Classroom | 301 | Wire Tray | | Solid | Metal | 0 |
| 214 | 1926 Bldg | 35 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Wall | Solid | Drywall | 0.01 |
| 215 | 1926 Bldg | 36 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Midle Wall | Solid | Drywall | 0.02 |
| 216 | 1926 Bldg | 37 | XRF | 4/20/97 | 3 | Classroom | 301 | Door | Door | Solid | Wood | 0 |
| 217 | 1926 Bldg | 38 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Wall Rgstr | Solid | Metal | 0.01 |
| 218 | 1926 Bldg | 39 | XRF | 4/20/97 | 3 | Classroom | 301 | Door | Casing | Solid | Metal | 0.03 |
| 219 | 1926 Bldg | 40 | XRF | 4/20/97 | 3 | Classroom | 301 | Cabinet | Door | Solid | Wood | 0.01 |
| 220 | 1926 Bldg | 72 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Midle Wall | Cracked | Plaster | 0.14 |
| 221 | 1926 Bldg | 73 | XRF | 4/20/97 | 3 | Classroom | 301 | Wire Tray | | Solid | Metal | 0 |
| 222 | 1926 Bldg | 74 | XRF | 4/20/97 | 3 | Classroom | 301 | Cabinet | Outside | Solid | Metal | 0 |
| 223 | 1926 Bldg | 75 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Wall Rgstr | Solid | Metal | 0.22 |
| 224 | 1926 Bldg | 76 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Wall | Solid | Drywall | 0.01 |
| 225 | 1926 Bldg | 77 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Midle Wall | Solid | Drywall | 0 |
| 226 | 1926 Bldg | 78 | XRF | 4/20/97 | 3 | Classroom | 301 | Cabinet | Door | Solid | Wood | 0 |
| 227 | 1926 Bldg | 79 | XRF | 4/20/97 | 3 | Classroom | 301 | Window | Casing | Solid | Wood | 0.07 |
| 228 | 1926 Bldg | 80 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Wall | Cracked | Plaster | 0.05 |
| 229 | 1926 Bldg | 81 | XRF | 4/20/97 | 3 | Classroom | 301 | Wall | Baseboar | Cracked | Metal | 5.09 |
| 230 | 1926 Bldg | 82 | XRF | 4/20/97 | 3 | Classroom | 301 | Floor | | Solid | Wood | 0 |
| 231 | 1926 Bldg | 83 | XRF | 4/20/97 | 3 | Classroom | 301 | | Radiator | Solid | Metal | 0 |
| 232 | 1926 Bldg | 84 | XRF | 4/20/97 | 3 | Classroom | 301 | Bookcase | Inside | Solid | Wood | 0 |
| 233 | 1926 Bldg | 85 | XRF | 4/20/97 | 3 | Classroom | 301 | Bulletin Board | Trim | Solid | Wood | 0 |
| 234 | 1926 Bldg | 86 | XRF | 4/20/97 | 3 | Classroom | 301 | Door | Door | Solid | Wood | 0.03 |
| 235 | 1926 Bldg | 87 | XRF | 4/20/97 | 3 | Classroom | 301 | Door | Casing | Solid | Wood | 0 |
| 236 | 1926 Bldg | 128 | XRF | 4/20/97 | 3 | Classroom | 303 | Wall | Wall | Cracked | Plaster | 0.03 |
| 237 | 1926 Bldg | 129 | XRF | 4/20/97 | 3 | Classroom | 303 | Wall | Baseboar | Peeling | Metal | 3.2 |
| 238 | 1926 Bldg | 130 | XRF | 4/20/97 | 3 | Classroom | 303 | Bulletin Board | Trim | Solid | Wood | 0.02 |
| 239 | 1926 Bldg | 131 | XRF | 4/20/97 | 3 | Classroom | 303 | Wire Tray | | Solid | Metal | 0.06 |
| 240 | 1926 Bldg | 132 | XRF | 4/20/97 | 3 | Classroom | 303 | Cabinet | Door | Solid | Wood | 0.04 |
| 241 | 1926 Bldg | 133 | XRF | 4/20/97 | 3 | Classroom | 303 | Wall | Midle Wall | Cracked | Plaster | 0.06 |
| 242 | 1926 Bldg | 134 | XRF | 4/20/97 | 3 | Classroom | 303 | Window | Casing | Solid | Wood | 0.07 |
| 243 | 1926 Bldg | 135 | XRF | 4/20/97 | 3 | Classroom | 303 | | Radiator | Cracked | Metal | 0.14 |
| 244 | 1926 Bldg | 136 | XRF | 4/20/97 | 3 | Classroom | 303 | Cabinet | Door | Solid | Wood | 0.04 |
| 245 | 1926 Bldg | 137 | XRF | 4/20/97 | 3 | Classroom | 303 | Closet | Wall | Solid | Plaster | 0.17 |
| 246 | 1926 Bldg | 138 | XRF | 4/20/97 | 3 | Classroom | 303 | Shelf | Suport | Solid | Wood | 0 |
| 247 | 1926 Bldg | 139 | XRF | 4/20/97 | 3 | Classroom | 303 | Closet | Casing | Solid | Wood | 0 |
| 248 | 1926 Bldg | 140 | XRF | 4/20/97 | 3 | Classroom | 303 | Wall | Midle Wall | Cracked | Plaster | 0.16 |
| 249 | 1926 Bldg | 141 | XRF | 4/20/97 | 3 | Classroom | 303 | Door | Door | Cracked | Wood | 0.06 |
| 250 | 1926 Bldg | 142 | XRF | 4/20/97 | 3 | Classroom | 303 | Door | Jamb | Cracked | Wood | 0.03 |
| 251 | 1926 Bldg | 143 | XRF | 4/20/97 | 3 | Classroom | 303 | Ceiling | | Cracked | Plaster | 0.01 |
| 252 | 1926 Bldg | 160 | XRF | 4/20/97 | 3 | Classroom | 304 | Wall | Wall | Solid | Plaster | 3.67 |
| 253 | 1926 Bldg | 161 | XRF | 4/20/97 | 3 | Classroom | 304 | Wall | Baseboar | Cracked | Wood | 0.24 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L |
|-----|-----------|----------|----------|---------|-------|-----------|-------|------------|------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 254 | 1926 Bldg | 162 | XRF | 4/20/97 | 3 | Classroom | 304 | Chalkboard | Rail | Solid | Wood | 0.06 |
| 255 | 1926 Bldg | 163 | XRF | 4/20/97 | 3 | Classroom | 304 | Wall | Midle Wall | Cracked | Plaster | 0.42 |
| 256 | 1926 Bldg | 164 | XRF | 4/20/97 | 3 | Classroom | 304 | Radiator | Peeling | Metal | | 5.09 |
| 257 | 1926 Bldg | 165 | XRF | 4/20/97 | 3 | Classroom | 304 | Window | Casing | Cracked | Wood | 0.06 |
| 258 | 1926 Bldg | 166 | XRF | 4/20/97 | 3 | Classroom | 304 | Floor | | Solid | Wood | 0 |
| 259 | 1926 Bldg | 167 | XRF | 4/20/97 | 3 | Classroom | 304 | Wall | Chair rail | Solid | Wood | 0.3 |
| 260 | 1926 Bldg | 168 | XRF | 4/20/97 | 3 | Classroom | 304 | Cabinet | Door | Solid | Wood | 0.04 |
| 261 | 1926 Bldg | 169 | XRF | 4/20/97 | 3 | Classroom | 304 | Cabinet | Inside | Solid | Wood | 0.03 |
| 262 | 1926 Bldg | 170 | XRF | 4/20/97 | 3 | Classroom | 304 | Wall | Midle Wall | Solid | Plaster | 5.09 |
| 263 | 1926 Bldg | 171 | XRF | 4/20/97 | 3 | Classroom | 304 | Door | Door | Cracked | Wood | 0 |
| 264 | 1926 Bldg | 172 | XRF | 4/20/97 | 3 | Classroom | 304 | Window | Casing | Solid | Metal | 0.03 |
| 265 | 1926 Bldg | 173 | XRF | 4/20/97 | 3 | Classroom | 304 | Door | Casing | Cracked | Wood | 0.05 |
| 266 | 1926 Bldg | 174 | XRF | 4/20/97 | 3 | Classroom | 304 | Wall | Wall | Cracked | Plaster | 0.05 |
| 267 | 1926 Bldg | 175 | XRF | 4/20/97 | 3 | Classroom | 304 | Door | Crown mo | Cracked | Wood | 0.05 |
| 268 | 1926 Bldg | 176 | XRF | 4/20/97 | 3 | Classroom | 304 | Wall | Wall Rgstr | Solid | Metal | 0.48 |
| 269 | 1926 Bldg | 177 | XRF | 4/20/97 | 3 | Classroom | 304 | Ceiling | | Solid | Plaster | 0.05 |
| 270 | 1926 Bldg | 199 | XRF | 4/20/97 | 3 | Classroom | 305 | Wall | Wall | Cracked | Plaster | 5.09 |
| 271 | 1926 Bldg | 200 | XRF | 4/20/97 | 3 | Classroom | 305 | Wall | Baseboar | Cracked | Wood | 0.45 |
| 272 | 1926 Bldg | 201 | XRF | 4/20/97 | 3 | Classroom | 305 | Chalkboard | Rail | Cracked | Wood | 0.04 |
| 273 | 1926 Bldg | 202 | XRF | 4/20/97 | 3 | Classroom | 305 | | Radiator | Peeling | Metal | 5.09 |
| 274 | 1926 Bldg | 203 | XRF | 4/20/97 | 3 | Classroom | 305 | Window | Casing | Solid | Wood | 0.03 |
| 275 | 1926 Bldg | 204 | XRF | 4/20/97 | 3 | Classroom | 305 | Wall | Midle Wall | Cracked | Plaster | 0 |
| 276 | 1926 Bldg | 205 | XRF | 4/20/97 | 3 | Classroom | 305 | Wall | Wall Rgstr | Solid | Metal | 0.04 |
| 277 | 1926 Bldg | 206 | XRF | 4/20/97 | 3 | Classroom | 305 | Wall | Midle Wall | Cracked | Plaster | 0.15 |
| 278 | 1926 Bldg | 207 | XRF | 4/20/97 | 3 | Classroom | 305 | Cabinet | Door | Solid | Wood | 0.03 |
| 279 | 1926 Bldg | 208 | XRF | 4/20/97 | 3 | Classroom | 305 | Floor | | Solid | Wood | 0 |
| 280 | 1926 Bldg | 209 | XRF | 4/20/97 | 3 | Classroom | 305 | Wall | Midle Wall | Solid | Plaster | 5.09 |
| 281 | 1926 Bldg | 210 | XRF | 4/20/97 | 3 | Classroom | 305 | Door | Door | Solid | Wood | 0.06 |
| 282 | 1926 Bldg | 211 | XRF | 4/20/97 | 3 | Classroom | 305 | Door | Casing | Solid | Wood | 0.03 |
| 283 | 1926 Bldg | 212 | XRF | 4/20/97 | 3 | Classroom | 305 | Door | Crown mo | Solid | Wood | 0.22 |
| 284 | 1926 Bldg | 213 | XRF | 4/20/97 | 3 | Classroom | 305 | Wall | Wall | Solid | Plaster | 0.33 |
| 285 | 1926 Bldg | 214 | XRF | 4/20/97 | 3 | Classroom | 305 | Ceiling | | Solid | Plaster | 0.12 |
| 286 | 1926 Bldg | 216 | XRF | 4/20/97 | 3 | Classroom | 306 | Wall | Wall | Cracked | Plaster | 0.15 |
| 287 | 1926 Bldg | 217 | XRF | 4/20/97 | 3 | Classroom | 306 | Window | Casing | Solid | Wood | 0 |
| 288 | 1926 Bldg | 218 | XRF | 4/20/97 | 3 | Classroom | 306 | | Radiator | Peeling | Metal | 5.09 |
| 289 | 1926 Bldg | 219 | XRF | 4/20/97 | 3 | Classroom | 306 | Radiator | Protector | Solid | Wood | 0 |
| 290 | 1926 Bldg | 220 | XRF | 4/20/97 | 3 | Classroom | 306 | Wall | Baseboar | Cracked | Wood | 0.24 |
| 291 | 1926 Bldg | 221 | XRF | 4/20/97 | 3 | Classroom | 306 | Floor | | Solid | Wood | 0.03 |
| 292 | 1926 Bldg | 222 | XRF | 4/20/97 | 3 | Classroom | 306 | Wall | Wall | Cracked | Plaster | 3.52 |
| 293 | 1926 Bldg | 223 | XRF | 4/20/97 | 3 | Classroom | 306 | Chalkboard | Rail | Solid | Wood | 0.05 |
| 294 | 1926 Bldg | 224 | XRF | 4/20/97 | 3 | Classroom | 306 | Wall | Midle Wall | Solid | Plaster | 0.21 |
| 295 | 1926 Bldg | 225 | XRF | 4/20/97 | 3 | Classroom | 306 | Cabinet | Door | Solid | Wood | 0.04 |
| 296 | 1926 Bldg | 226 | XRF | 4/20/97 | 3 | Classroom | 306 | Wall | Wall Rgstr | Solid | Metal | 0.2 |
| 297 | 1926 Bldg | 227 | XRF | 4/20/97 | 3 | Classroom | 306 | Wall | Midle Wall | Solid | Plaster | 5.09 |
| 298 | 1926 Bldg | 228 | XRF | 4/20/97 | 3 | Classroom | 306 | Door | Door | Solid | Wood | 0.06 |
| 299 | 1926 Bldg | 229 | XRF | 4/20/97 | 3 | Classroom | 306 | Door | Casing | Solid | Wood | 0.09 |
| 300 | 1926 Bldg | 230 | XRF | 4/20/97 | 3 | Classroom | 306 | Door | Crown mo | Solid | Wood | 0.06 |
| 301 | 1926 Bldg | 231 | XRF | 4/20/97 | 3 | Classroom | 306 | Wall | Wall | Cracked | Plaster | 0.09 |
| 302 | 1926 Bldg | 232 | XRF | 4/20/97 | 3 | Classroom | 306 | Ceiling | | Solid | Plaster | 0.07 |
| 303 | 1926 Bldg | 245 | XRF | 4/20/97 | 3 | Classroom | 307 | Wall | Wall | Cracked | Plaster | 0.38 |
| 304 | 1926 Bldg | 246 | XRF | 4/20/97 | 3 | Classroom | 307 | Wall | Wall Rgstr | Solid | Metal | 0.17 |
| 305 | 1926 Bldg | 247 | XRF | 4/20/97 | 3 | Classroom | 307 | Chalkboard | Rail | Solid | Metal | 0.05 |
| 306 | 1926 Bldg | 248 | XRF | 4/20/97 | 3 | Classroom | 307 | | Radiator | Solid | Metal | 0.57 |
| 307 | 1926 Bldg | 249 | XRF | 4/20/97 | 3 | Classroom | 307 | Wall | Midle Wall | Cracked | Plaster | 0.17 |
| 308 | 1926 Bldg | 250 | XRF | 4/20/97 | 3 | Classroom | 307 | Wall | Wall | Solid | Plaster | 0.16 |
| 309 | 1926 Bldg | 251 | XRF | 4/20/97 | 3 | Classroom | 307 | | Radiator | Solid | Metal | 0.18 |
| 310 | 1926 Bldg | 252 | XRF | 4/20/97 | 3 | Classroom | 307 | Window | Casing | Solid | Wood | 0.06 |
| 311 | 1926 Bldg | 253 | XRF | 4/20/97 | 3 | Classroom | 307 | Wall | Midle Wall | Solid | Drywall | 0 |
| 312 | 1926 Bldg | 254 | XRF | 4/20/97 | 3 | Classroom | 307 | Wall | Baseboar | Cracked | Metal | 2.31 |
| 313 | 1926 Bldg | 255 | XRF | 4/20/97 | 3 | Classroom | 307 | Floor | | Solid | Wood | 0.01 |
| 314 | 1926 Bldg | 256 | XRF | 4/20/97 | 3 | Classroom | 307 | Cabinet | Door | Solid | Wood | 0.05 |
| 315 | 1926 Bldg | 257 | XRF | 4/20/97 | 3 | Classroom | 307 | Wall | Wall | Solid | Plaster | 0.01 |
| 316 | 1926 Bldg | 258 | XRF | 4/20/97 | 3 | Classroom | 307 | Ceiling | | Solid | Plaster | 0.01 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | |
|-----|-----------|----------|----------|---------|-------|-----------|-------|----------------|-------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 317 | 1926 Bldg | 259 | XRF | 4/20/97 | 3 | Classroom | 307 | Ceiling | | Solid | Plaster | 0.06 |
| 318 | 1926 Bldg | 260 | XRF | 4/20/97 | 3 | Classroom | 307 | Door | Door | Cracked | Wood | 0.06 |
| 319 | 1926 Bldg | 261 | XRF | 4/20/97 | 3 | Classroom | 307 | Door | Jamb | Cracked | Wood | 0.03 |
| 320 | 1926 Bldg | 262 | XRF | 4/20/97 | 3 | Classroom | 307 | Wall | Middle Wall | Solid | Plaster | 0.14 |
| 321 | 1926 Bldg | 36 | XRF | 7/3/97 | 3 | Classroom | 308 | Wall | Wall | Solid | Plaster | 5.09 |
| 322 | 1926 Bldg | 37 | XRF | 7/3/97 | 3 | Classroom | 308 | Wall | Baseboard | Solid | Wood | 0.3 |
| 323 | 1926 Bldg | 38 | XRF | 7/3/97 | 3 | Classroom | 308 | Bulletin Board | Trim | Solid | Wood | 0.07 |
| 324 | 1926 Bldg | 39 | XRF | 7/3/97 | 3 | Classroom | 308 | Cabinet | Door | Solid | Wood | 0.04 |
| 325 | 1926 Bldg | 40 | XRF | 7/3/97 | 3 | Classroom | 308 | Cabinet | Inside | Solid | Wood | 0 |
| 326 | 1926 Bldg | 41 | XRF | 7/3/97 | 3 | Classroom | 308 | Door | Door | Cracked | Metal | 0 |
| 327 | 1926 Bldg | 42 | XRF | 7/3/97 | 3 | Classroom | 308 | Door | Casing | Cracked | Wood | 0.06 |
| 328 | 1926 Bldg | 43 | XRF | 7/3/97 | 3 | Classroom | 308 | Wall | Wall | Cracked | Plaster | 5.09 |
| 329 | 1926 Bldg | 44 | XRF | 7/3/97 | 3 | Classroom | 308 | Wall | Wall Rgstr | Solid | Metal | 0.17 |
| 330 | 1926 Bldg | 45 | XRF | 7/3/97 | 3 | Classroom | 308 | Wall | Wall | Cracked | Plaster | 0.02 |
| 331 | 1926 Bldg | 46 | XRF | 7/3/97 | 3 | Classroom | 308 | | Radiator | Peeling | Metal | 5.09 |
| 332 | 1926 Bldg | 47 | XRF | 7/3/97 | 3 | Classroom | 308 | Window | Casing | Solid | Wood | 0.1 |
| 333 | 1926 Bldg | 48 | XRF | 7/3/97 | 3 | Classroom | 308 | Wall | Chair rail | Solid | Wood | 0.04 |
| 334 | 1926 Bldg | 49 | XRF | 7/3/97 | 3 | Classroom | 308 | Window | Stool | Solid | Tile | 0.05 |
| 335 | 1926 Bldg | 50 | XRF | 7/3/97 | 3 | Classroom | 308 | Door | Crown mo | Solid | Wood | 0.07 |
| 336 | 1926 Bldg | 51 | XRF | 7/3/97 | 3 | Classroom | 308 | Floor | | Solid | Wood | 0.01 |
| 337 | 1926 Bldg | 52 | XRF | 7/3/97 | 3 | Classroom | 308 | Ceiling | | Solid | Plaster | 0.11 |
| 338 | 1926 Bldg | 70 | XRF | 7/3/97 | 3 | Classroom | 309 | Wall | Wall | Cracked | Plaster | 0.14 |
| 339 | 1926 Bldg | 71 | XRF | 7/3/97 | 3 | Classroom | 309 | Wall | Baseboard | Cracked | Metal | 3.19 |
| 340 | 1926 Bldg | 72 | XRF | 7/3/97 | 3 | Classroom | 309 | Floor | | Solid | Wood | 0 |
| 341 | 1926 Bldg | 73 | XRF | 7/3/97 | 3 | Classroom | 309 | Chalkboard | Rail | Cracked | Wood | 0.04 |
| 342 | 1926 Bldg | 74 | XRF | 7/3/97 | 3 | Classroom | 309 | Cabinet | Door | Solid | Wood | 0.05 |
| 343 | 1926 Bldg | 75 | XRF | 7/3/97 | 3 | Classroom | 309 | Wall | Middle Wall | Cracked | Plaster | 0.11 |
| 344 | 1926 Bldg | 76 | XRF | 7/3/97 | 3 | Classroom | 309 | | Radiator | Solid | Metal | 0.23 |
| 345 | 1926 Bldg | 77 | XRF | 7/3/97 | 3 | Classroom | 309 | Window | Stool | Solid | Wood | 0.13 |
| 346 | 1926 Bldg | 78 | XRF | 7/3/97 | 3 | Classroom | 309 | Window | Casing | Solid | Wood | 0.06 |
| 347 | 1926 Bldg | 79 | XRF | 7/3/97 | 3 | Classroom | 309 | Wall | Wall | Cracked | Plaster | 0.24 |
| 348 | 1926 Bldg | 80 | XRF | 7/3/97 | 3 | Classroom | 309 | Door | Door | Cracked | Wood | 0.03 |
| 349 | 1926 Bldg | 81 | XRF | 7/3/97 | 3 | Classroom | 309 | Door | Casing | Cracked | Wood | 0.05 |
| 350 | 1926 Bldg | 82 | XRF | 7/3/97 | 3 | Classroom | 309 | Wall | Wall | Solid | Plaster | 0.12 |
| 351 | 1926 Bldg | 83 | XRF | 7/3/97 | 3 | Classroom | 309 | Wall | Wall Rgstr | Solid | Metal | 0.09 |
| 352 | 1926 Bldg | 84 | XRF | 7/3/97 | 3 | Classroom | 309 | Ceiling | | Solid | Plaster | 0.07 |
| 353 | 1926 Bldg | 42 | XRF | 4/20/97 | 3 | Classroom | 312 | Wall | Wall | Cracked | Plaster | 0.18 |
| 354 | 1926 Bldg | 43 | XRF | 4/20/97 | 3 | Classroom | 312 | Wall | Middle Wall | Cracked | Plaster | 0.17 |
| 355 | 1926 Bldg | 44 | XRF | 4/20/97 | 3 | Classroom | 312 | Window | Sash | Solid | Metal | 0.56 |
| 356 | 1926 Bldg | 45 | XRF | 4/20/97 | 3 | Classroom | 312 | Window | Casing | Solid | Metal | 0.8 |
| 357 | 1926 Bldg | 46 | XRF | 4/20/97 | 3 | Classroom | 312 | Window | Sill | Solid | Metal | 1.07 |
| 358 | 1926 Bldg | 47 | XRF | 4/20/97 | 3 | Classroom | 312 | Window | Sash | Cracked | Wood | 0.09 |
| 359 | 1926 Bldg | 48 | XRF | 4/20/97 | 3 | Classroom | 312 | | Radiator | Peeling | Metal | 4.32 |
| 360 | 1926 Bldg | 49 | XRF | 4/20/97 | 3 | Classroom | 312 | Radiator | Protector | Cracked | Metal | 0.19 |
| 361 | 1926 Bldg | 50 | XRF | 4/20/97 | 3 | Classroom | 312 | | Radiator | Solid | Metal | 0.15 |
| 362 | 1926 Bldg | 51 | XRF | 4/20/97 | 3 | Classroom | 312 | Bookcase | Shelf | Solid | Wood | 0 |
| 363 | 1926 Bldg | 52 | XRF | 4/20/97 | 3 | Classroom | 312 | Chalkboard | Rail | Solid | Wood | 0 |
| 364 | 1926 Bldg | 53 | XRF | 4/20/97 | 3 | Classroom | 312 | Wall | Wall | Cracked | Plaster | 0.04 |
| 365 | 1926 Bldg | 54 | XRF | 4/20/97 | 3 | Classroom | 312 | Wall | Wall Rgstr | Solid | Metal | 0.18 |
| 366 | 1926 Bldg | 55 | XRF | 4/20/97 | 3 | Classroom | 312 | Wall | Baseboard | Cracked | Metal | 5.09 |
| 367 | 1926 Bldg | 56 | XRF | 4/20/97 | 3 | Classroom | 312 | Floor | | Cracked | Wood | 0.01 |
| 368 | 1926 Bldg | 57 | XRF | 4/20/97 | 3 | Classroom | 312 | Door | Door | Cracked | Wood | 0.06 |
| 369 | 1926 Bldg | 58 | XRF | 4/20/97 | 3 | Classroom | 312 | Door | Casing | Cracked | Wood | 0.05 |
| 370 | 1926 Bldg | 59 | XRF | 4/20/97 | 3 | Classroom | 312 | Ceiling | | Cracked | Plaster | 0.08 |
| 371 | 1926 Bldg | 112 | XRF | 6/9/98 | 2 | Classroom | 2010 | Chalkboard | Rail | Solid | Wood | 0.03 |
| 372 | 1926 Bldg | 113 | XRF | 6/9/98 | 2 | Classroom | 2010 | Wall | Baseboard | Solid | Wood | 0.35 |
| 373 | 1926 Bldg | 114 | XRF | 6/9/98 | 2 | Classroom | 2010 | Wall | Middle Wall | Solid | Plaster | 5.09 |
| 374 | 1926 Bldg | 115 | XRF | 6/9/98 | 2 | Classroom | 2010 | Door | Door | Solid | Wood | 0.04 |
| 375 | 1926 Bldg | 116 | XRF | 6/9/98 | 2 | Classroom | 2010 | Door | Casing | Solid | Wood | 0.06 |
| 376 | 1926 Bldg | 117 | XRF | 6/9/98 | 2 | Classroom | 2010 | Wall | Middle Wall | Solid | Plaster | 5.09 |
| 377 | 1926 Bldg | 118 | XRF | 6/9/98 | 2 | Classroom | 2010 | Ceiling | | Solid | Plaster | 0.23 |
| 378 | 1926 Bldg | 119 | XRF | 6/9/98 | 2 | Classroom | 2010 | Floor | | Cracked | Wood | 0 |
| 379 | 1926 Bldg | 84 | XRF | 6/9/98 | 2 | Classroom | 2050 | Wall | Wall | Solid | Plaster | 0.1 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L |
|-----|-----------|----------|----------|--------|-------|-----------|-------|----------------|------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 380 | 1926 Bldg | 85 | XRF | 6/9/98 | 2 | Classroom | 2050 | Bulletin Board | Panel | Solid | Wood | 0.62 |
| 381 | 1926 Bldg | 86 | XRF | 6/9/98 | 2 | Classroom | 2050 | Wall | Baseboar | Solid | Wood | 0.36 |
| 382 | 1926 Bldg | 87 | XRF | 6/9/98 | 2 | Classroom | 2050 | Chalkboard | Rail | Peeling | Wood | 0.05 |
| 383 | 1926 Bldg | 88 | XRF | 6/9/98 | 2 | Classroom | 2050 | Cabinet | Door | Solid | Wood | 0.05 |
| 384 | 1926 Bldg | 89 | XRF | 6/9/98 | 2 | Classroom | 2050 | Wall | Midle Wall | Solid | Plaster | 3.87 |
| 385 | 1926 Bldg | 90 | XRF | 6/9/98 | 2 | Classroom | 2050 | Door | Door | Solid | Wood | 0 |
| 386 | 1926 Bldg | 91 | XRF | 6/9/98 | 2 | Classroom | 2050 | Door | Jamb | Solid | Wood | 0.02 |
| 387 | 1926 Bldg | 92 | XRF | 6/9/98 | 2 | Classroom | 2050 | | Radiator | Peeling | Metal | 5.09 |
| 388 | 1926 Bldg | 93 | XRF | 6/9/98 | 2 | Classroom | 2050 | Window | Casing | Solid | Metal | 0 |
| 389 | 1926 Bldg | 94 | XRF | 6/9/98 | 2 | Classroom | 2050 | Window | Apron | Solid | Wood | 0.07 |
| 390 | 1926 Bldg | 95 | XRF | 6/9/98 | 2 | Classroom | 2050 | Floor | | Cracked | Wood | 0 |
| 391 | 1926 Bldg | 96 | XRF | 6/9/98 | 2 | Classroom | 2050 | Ceiling | | Solid | Plaster | 0.06 |
| 392 | 1926 Bldg | 61 | XRF | 6/9/98 | 2 | Classroom | 2080 | Wall | Wall | Solid | Plaster | 0.14 |
| 393 | 1926 Bldg | 62 | XRF | 6/9/98 | 2 | Classroom | 2080 | Chalkboard | Rail | Solid | Wood | 0.03 |
| 394 | 1926 Bldg | 63 | XRF | 6/9/98 | 2 | Classroom | 2080 | Bulletin Board | Trim | Solid | Wood | 0.89 |
| 395 | 1926 Bldg | 64 | XRF | 6/9/98 | 2 | Classroom | 2080 | Door | Door | Solid | Wood | 0.05 |
| 396 | 1926 Bldg | 65 | XRF | 6/9/98 | 2 | Classroom | 2080 | Wall | Midle Wall | Solid | Plaster | 0.46 |
| 397 | 1926 Bldg | 66 | XRF | 6/9/98 | 2 | Classroom | 2080 | Cabinet | Door | Solid | Wood | 0.04 |
| 398 | 1926 Bldg | 67 | XRF | 6/9/98 | 2 | Classroom | 2080 | Wall | Baseboar | Solid | Wood | 0.32 |
| 399 | 1926 Bldg | 68 | XRF | 6/9/98 | 2 | Classroom | 2080 | Ceiling | | Solid | Plaster | 0.2 |
| 400 | 1926 Bldg | 69 | XRF | 6/9/98 | 2 | Classroom | 2080 | Floor | | Cracked | Wood | 0 |
| 401 | 1926 Bldg | 47 | XRF | 6/9/98 | 2 | Classroom | 2270 | Wall | Midle Wall | Solid | Plaster | 0.08 |
| 402 | 1926 Bldg | 48 | XRF | 6/9/98 | 2 | Classroom | 2270 | | Radiator | Solid | Metal | 0.1 |
| 403 | 1926 Bldg | 49 | XRF | 6/9/98 | 2 | Classroom | 2270 | Wall | Baseboar | Solid | Wood | 2.03 |
| 404 | 1926 Bldg | 50 | XRF | 6/9/98 | 2 | Classroom | 2270 | Window | Casing | Solid | Metal | 0 |
| 405 | 1926 Bldg | 51 | XRF | 6/9/98 | 2 | Classroom | 2270 | Window | Casing | Solid | Wood | 0.57 |
| 406 | 1926 Bldg | 52 | XRF | 6/9/98 | 2 | Classroom | 2270 | Wall | Midle Wall | Solid | Plaster | 0 |
| 407 | 1926 Bldg | 53 | XRF | 6/9/98 | 2 | Classroom | 2270 | | Radiator | Peeling | Metal | 0.11 |
| 408 | 1926 Bldg | 54 | XRF | 6/9/98 | 2 | Classroom | 2270 | Door | Door | Solid | Wood | 5.09 |
| 409 | 1926 Bldg | 55 | XRF | 6/9/98 | 2 | Classroom | 2270 | Door | Casing | Solid | Wood | 3.5 |
| 410 | 1926 Bldg | 56 | XRF | 6/9/98 | 2 | Classroom | 2270 | Door | Door | Solid | Wood | 0.04 |
| 411 | 1926 Bldg | 57 | XRF | 6/9/98 | 2 | Classroom | 2270 | Door | Jamb | Solid | Wood | 0.02 |
| 412 | 1926 Bldg | 58 | XRF | 6/9/98 | 2 | Classroom | 2270 | Wall | Wall | Solid | Plaster | 0.02 |
| 413 | 1926 Bldg | 59 | XRF | 6/9/98 | 2 | Classroom | 2270 | Stairs | Hand rail | Solid | Wood | 0.02 |
| 414 | 1926 Bldg | 60 | XRF | 6/9/98 | 2 | Classroom | 2270 | Ceiling | | Solid | Plaster | 0.04 |
| 415 | 1926 Bldg | 178 | XRF | 6/9/98 | 2 | Classroom | 2390 | Wall | Baseboar | Solid | Wood | 2.01 |
| 416 | 1926 Bldg | 179 | XRF | 6/9/98 | 2 | Classroom | 2390 | Wall | Wall | Solid | Plaster | 0.03 |
| 417 | 1926 Bldg | 180 | XRF | 6/9/98 | 2 | Classroom | 2390 | | Radiator | Solid | Metal | 0.21 |
| 418 | 1926 Bldg | 181 | XRF | 6/9/98 | 2 | Classroom | 2390 | Window | Apron | Solid | Wood | 0.02 |
| 419 | 1926 Bldg | 182 | XRF | 6/9/98 | 2 | Classroom | 2390 | Window | Casing | Solid | Metal | 0 |
| 420 | 1926 Bldg | 183 | XRF | 6/9/98 | 2 | Classroom | 2390 | Wall | Wall | Solid | Plaster | 0.1 |
| 421 | 1926 Bldg | 184 | XRF | 6/9/98 | 2 | Classroom | 2390 | Door | Door | Solid | Wood | 0.03 |
| 422 | 1926 Bldg | 185 | XRF | 6/9/98 | 2 | Classroom | 2390 | Wall | Midle Wall | Solid | Plaster | 0.21 |
| 423 | 1926 Bldg | 186 | XRF | 6/9/98 | 2 | Classroom | 2390 | Floor | | Cracked | Wood | 0 |
| 424 | 1926 Bldg | 169 | XRF | 6/9/98 | 2 | Classroom | 2400 | Wall | Baseboar | Solid | Wood | 1.96 |
| 425 | 1926 Bldg | 170 | XRF | 6/9/98 | 2 | Classroom | 2400 | Wall | Wall | Solid | Plaster | 0.04 |
| 426 | 1926 Bldg | 171 | XRF | 6/9/98 | 2 | Classroom | 2400 | Door | Door | Solid | Wood | 0.04 |
| 427 | 1926 Bldg | 172 | XRF | 6/9/98 | 2 | Classroom | 2400 | | Radiator | Solid | Metal | 0.1 |
| 428 | 1926 Bldg | 173 | XRF | 6/9/98 | 2 | Classroom | 2400 | Window | Apron | Solid | Wood | 0.01 |
| 429 | 1926 Bldg | 174 | XRF | 6/9/98 | 2 | Classroom | 2400 | Window | Casing | Solid | Metal | 0 |
| 430 | 1926 Bldg | 175 | XRF | 6/9/98 | 2 | Classroom | 2400 | Wall | Wall | Solid | Plaster | 0.07 |
| 431 | 1926 Bldg | 176 | XRF | 6/9/98 | 2 | Classroom | 2400 | Door | Door | Solid | Wood | 0.04 |
| 432 | 1926 Bldg | 177 | XRF | 6/9/98 | 2 | Classroom | 2400 | Floor | | Cracked | Wood | 0 |
| 433 | 1926 Bldg | 156 | XRF | 6/9/98 | 2 | Classroom | 2410 | Wall | Baseboar | Solid | Wood | 3.26 |
| 434 | 1926 Bldg | 157 | XRF | 6/9/98 | 2 | Classroom | 2410 | Wall | Wall | Solid | Plaster | 0.34 |
| 435 | 1926 Bldg | 158 | XRF | 6/9/98 | 2 | Classroom | 2410 | Chalkboard | Rail | Solid | Wood | 0.05 |
| 436 | 1926 Bldg | 159 | XRF | 6/9/98 | 2 | Classroom | 2410 | Door | Door | Solid | Wood | 0.04 |
| 437 | 1926 Bldg | 160 | XRF | 6/9/98 | 2 | Classroom | 2410 | Door | Casing | Solid | Wood | 0.03 |
| 438 | 1926 Bldg | 161 | XRF | 6/9/98 | 2 | Classroom | 2410 | | Radiator | Solid | Metal | 0.23 |
| 439 | 1926 Bldg | 162 | XRF | 6/9/98 | 2 | Classroom | 2410 | Window | Mullion | Solid | Wood | 0.03 |
| 440 | 1926 Bldg | 163 | XRF | 6/9/98 | 2 | Classroom | 2410 | Window | Casing | Solid | Metal | 0 |
| 441 | 1926 Bldg | 164 | XRF | 6/9/98 | 2 | Classroom | 2410 | Door | Door | Solid | Wood | 0.03 |
| 442 | 1926 Bldg | 165 | XRF | 6/9/98 | 2 | Classroom | 2410 | Wall | Midle Wall | Solid | Plaster | 0.31 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | |
|-----|-----------|----------|----------|---------|-------|-----------|-------|----------------|-------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 443 | 1926 Bldg | 166 | XRF | 6/9/98 | 2 | Classroom | 2410 | Cabinet | Door | Solid | Wood | 0.02 |
| 444 | 1926 Bldg | 167 | XRF | 6/9/98 | 2 | Classroom | 2410 | Floor | | Cracked | Wood | 0 |
| 445 | 1926 Bldg | 168 | XRF | 6/9/98 | 2 | Classroom | 2410 | Ceiling | | Solid | Plaster | 0 |
| 446 | 1926 Bldg | 142 | XRF | 6/9/98 | 2 | Classroom | 2420 | Chalkboard | Rail | Solid | Wood | 0.04 |
| 447 | 1926 Bldg | 143 | XRF | 6/9/98 | 2 | Classroom | 2420 | Bulletin Board | Trim | Solid | Wood | 1.97 |
| 448 | 1926 Bldg | 144 | XRF | 6/9/98 | 2 | Classroom | 2420 | Wall | Baseboar | Solid | Wood | 0.25 |
| 449 | 1926 Bldg | 145 | XRF | 6/9/98 | 2 | Classroom | 2420 | Wall | Wall | Solid | Plaster | 0.26 |
| 450 | 1926 Bldg | 146 | XRF | 6/9/98 | 2 | Classroom | 2420 | | Radiator | Peeling | Metal | 5.09 |
| 451 | 1926 Bldg | 147 | XRF | 6/9/98 | 2 | Classroom | 2420 | Window | Mullion | Solid | Wood | 0.07 |
| 452 | 1926 Bldg | 148 | XRF | 6/9/98 | 2 | Classroom | 2420 | Window | Casing | Solid | Metal | 0 |
| 453 | 1926 Bldg | 149 | XRF | 6/9/98 | 2 | Classroom | 2420 | Window | Casing | Solid | Wood | 0.01 |
| 454 | 1926 Bldg | 150 | XRF | 6/9/98 | 2 | Classroom | 2420 | Wall | Middle Wall | Solid | Plaster | 0.07 |
| 455 | 1926 Bldg | 151 | XRF | 6/9/98 | 2 | Classroom | 2420 | Door | Door | Solid | Wood | 0.02 |
| 456 | 1926 Bldg | 152 | XRF | 6/9/98 | 2 | Classroom | 2420 | Wall | Middle Wall | Solid | Plaster | 0.46 |
| 457 | 1926 Bldg | 153 | XRF | 6/9/98 | 2 | Classroom | 2420 | Cabinet | Door | Solid | Wood | 0.04 |
| 458 | 1926 Bldg | 154 | XRF | 6/9/98 | 2 | Classroom | 2420 | Floor | | Cracked | Wood | 0 |
| 459 | 1926 Bldg | 155 | XRF | 6/9/98 | 2 | Classroom | 2420 | Ceiling | | Solid | Plaster | 0.09 |
| 460 | 1926 Bldg | 120 | XRF | 6/9/98 | 2 | Classroom | 2440 | Wall | Wall | Solid | Plaster | 0.08 |
| 461 | 1926 Bldg | 121 | XRF | 6/9/98 | 2 | Classroom | 2440 | Chalkboard | Rail | Solid | Wood | 0.08 |
| 462 | 1926 Bldg | 122 | XRF | 6/9/98 | 2 | Classroom | 2440 | | Radiator | Solid | Metal | 0.31 |
| 463 | 1926 Bldg | 123 | XRF | 6/9/98 | 2 | Classroom | 2440 | Wall | Middle Wall | Solid | Plaster | 5.09 |
| 464 | 1926 Bldg | 124 | XRF | 6/9/98 | 2 | Classroom | 2440 | Window | Casing | Solid | Metal | 0 |
| 465 | 1926 Bldg | 125 | XRF | 6/9/98 | 2 | Classroom | 2440 | Window | Casing | Solid | Wood | 0.07 |
| 466 | 1926 Bldg | 126 | XRF | 6/9/98 | 2 | Classroom | 2440 | Wall | Baseboar | Solid | Wood | 0.37 |
| 467 | 1926 Bldg | 127 | XRF | 6/9/98 | 2 | Classroom | 2440 | Chalkboard | Rail | Solid | Wood | 0.06 |
| 468 | 1926 Bldg | 128 | XRF | 6/9/98 | 2 | Classroom | 2440 | Door | Door | Solid | Wood | 0 |
| 469 | 1926 Bldg | 129 | XRF | 6/9/98 | 2 | Classroom | 2440 | Door | Jamb | Solid | Wood | 0.09 |
| 470 | 1926 Bldg | 130 | XRF | 6/9/98 | 2 | Classroom | 2440 | Wall | Middle Wall | Solid | Plaster | 4.42 |
| 471 | 1926 Bldg | 131 | XRF | 6/9/98 | 2 | Classroom | 2440 | Cabinet | Door | Solid | Wood | 0.06 |
| 472 | 1926 Bldg | 132 | XRF | 6/9/98 | 2 | Classroom | 2440 | Floor | | Cracked | Wood | 0 |
| 473 | 1926 Bldg | 6 | XRF | 6/9/98 | 3 | Classroom | 3101 | Door | Door | Solid | Wood | 0 |
| 474 | 1926 Bldg | 7 | XRF | 6/9/98 | 3 | Classroom | 3101 | Door | Casing | Solid | Metal | 0 |
| 475 | 1926 Bldg | 8 | XRF | 6/9/98 | 3 | Classroom | 3101 | Wall | Wall | Solid | Plaster | 0.22 |
| 476 | 1926 Bldg | 9 | XRF | 6/9/98 | 3 | Classroom | 3101 | Cabinet | Door | Solid | Wood | 0.03 |
| 477 | 1926 Bldg | 10 | XRF | 6/9/98 | 3 | Classroom | 3101 | Wall | Wall | Solid | Plaster | 0.32 |
| 478 | 1926 Bldg | 11 | XRF | 6/9/98 | 3 | Classroom | 3101 | | Radiator | Solid | Metal | 0.12 |
| 479 | 1926 Bldg | 12 | XRF | 6/9/98 | 3 | Classroom | 3101 | Window | Mullion | Solid | Wood | 0.05 |
| 480 | 1926 Bldg | 13 | XRF | 6/9/98 | 3 | Classroom | 3101 | Wall | Wall | Solid | Plaster | 0 |
| 481 | 1926 Bldg | 14 | XRF | 6/9/98 | 3 | Classroom | 3101 | Ceiling | | Solid | Plaster | 0.01 |
| 482 | 1926 Bldg | 15 | XRF | 6/9/98 | 3 | Classroom | 3101 | Window | Casing | Solid | Metal | 0 |
| 483 | 1926 Bldg | 16 | XRF | 6/9/98 | 3 | Classroom | 3101 | Floor | | Solid | Wood | 0 |
| 484 | 1926 Bldg | 38 | XRF | 6/10/98 | 1 | Gym | 1 | Wall | Midle Wall | Solid | Concrete | 5.09 |
| 485 | 1926 Bldg | 39 | XRF | 6/10/98 | 1 | Gym | 1 | Door | Door | Solid | Wood | 0.05 |
| 486 | 1926 Bldg | 40 | XRF | 6/10/98 | 1 | Gym | 1 | Door | Casing | Solid | Wood | 0.04 |
| 487 | 1926 Bldg | 41 | XRF | 6/10/98 | 1 | Gym | 1 | Wall | Wall Rgstr | Solid | Metal | 0.33 |
| 488 | 1926 Bldg | 42 | XRF | 6/10/98 | 1 | Gym | 1 | Door | Jamb | Cracked | Wood | 0.02 |
| 489 | 1926 Bldg | 43 | XRF | 6/10/98 | 1 | Gym | 1 | Wall | Wall | Solid | Concrete | 5.09 |
| 490 | 1926 Bldg | 44 | XRF | 6/10/98 | 1 | Gym | 1 | Door | Casing | Solid | Wood | 0.02 |
| 491 | 1926 Bldg | 45 | XRF | 6/10/98 | 1 | Gym | 1 | Door | Backboar | Solid | Metal | 0 |
| 492 | 1926 Bldg | 46 | XRF | 6/10/98 | 1 | Gym | 1 | Wall | Wall | Solid | Concrete | 2.93 |
| 493 | 1926 Bldg | 47 | XRF | 6/10/98 | 1 | Gym | 1 | Floor | | Solid | Wood | 0 |
| 494 | 1926 Bldg | 48 | XRF | 6/10/98 | 1 | Gym | 1 | Ceiling | | Solid | Wood | 0 |
| 495 | 1926 Bldg | 60 | XRF | 6/10/98 | 1 | Gym | 2 | Wall | Midle Wall | Solid | Concrete | 0.01 |
| 496 | 1926 Bldg | 61 | XRF | 6/10/98 | 1 | Gym | 2 | Door | Door | Solid | Metal | 0.03 |
| 497 | 1926 Bldg | 62 | XRF | 6/10/98 | 1 | Gym | 2 | Door | Jamb | Solid | Metal | 0.07 |
| 498 | 1926 Bldg | 63 | XRF | 6/10/98 | 1 | Gym | 2 | Door | Door | Solid | Metal | 0.01 |
| 499 | 1926 Bldg | 64 | XRF | 6/10/98 | 1 | Gym | 2 | Door | Jamb | Solid | Metal | 0.01 |
| 500 | 1926 Bldg | 65 | XRF | 6/10/98 | 1 | Gym | 2 | Stairs | Hand rail | Solid | Metal | 0.07 |
| 501 | 1926 Bldg | 66 | XRF | 6/10/98 | 1 | Gym | 2 | Ceiling | | Solid | Concrete | 0.1 |
| 502 | 1926 Bldg | 6 | XRF | 4/20/97 | 3 | Hall | 1 | Wall | Wall | Solid | Plaster | 0.46 |
| 503 | 1926 Bldg | 7 | XRF | 4/20/97 | 3 | Hall | 1 | Wall | Midle Wall | Solid | Plaster | 0.14 |
| 504 | 1926 Bldg | 8 | XRF | 4/20/97 | 3 | Hall | 1 | Wall | Wall | Solid | Plaster | 0.04 |
| 505 | 1926 Bldg | 9 | XRF | 4/20/97 | 3 | Hall | 1 | Wall | Chair rail | Solid | Wood | 0.04 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | |
|-----|-----------|----------|----------|---------|-------|------|-------|----------------|------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 506 | 1926 Bldg | 10 | XRF | 4/20/97 | 3 | Hall | 1 | | Locker | Cracked | Metal | 0.18 |
| 507 | 1926 Bldg | 11 | XRF | 4/20/97 | 3 | Hall | 1 | | Radiator | Cracked | Metal | 0.08 |
| 508 | 1926 Bldg | 12 | XRF | 4/20/97 | 3 | Hall | 1 | Window | Casing | Cracked | Metal | 0.51 |
| 509 | 1926 Bldg | 13 | XRF | 4/20/97 | 3 | Hall | 1 | Wall | Wall Rgstr | Solid | Metal | 0.11 |
| 510 | 1926 Bldg | 14 | XRF | 4/20/97 | 3 | Hall | 1 | Wall | Wall Rgstr | Solid | Metal | 0.26 |
| 511 | 1926 Bldg | 15 | XRF | 4/20/97 | 3 | Hall | 1 | Door | Door | Solid | Metal | 5.09 |
| 512 | 1926 Bldg | 16 | XRF | 4/20/97 | 3 | Hall | 1 | Door | Casing | Cracked | Metal | 5.09 |
| 513 | 1926 Bldg | 17 | XRF | 4/20/97 | 3 | Hall | 1 | Ceiling | Diffuser | Cracked | Metal | 0.1 |
| 514 | 1926 Bldg | 18 | XRF | 4/20/97 | 3 | Hall | 1 | Ceiling | | Cracked | Plaster | 0.03 |
| 515 | 1926 Bldg | 19 | XRF | 4/20/97 | 3 | Hall | 1 | | Locker | Cracked | Metal | 0.29 |
| 516 | 1926 Bldg | 6 | XRF | 7/3/97 | 3 | Hall | 2 | Wall | Wall | Cracked | Plaster | 5.09 |
| 517 | 1926 Bldg | 7 | XRF | 7/3/97 | 3 | Hall | 2 | Wall | Chair rail | Cracked | Wood | 0.08 |
| 518 | 1926 Bldg | 8 | XRF | 7/3/97 | 3 | Hall | 2 | | Elec Pane | Solid | Metal | 0.05 |
| 519 | 1926 Bldg | 9 | XRF | 7/3/97 | 3 | Hall | 2 | Cabinet | Door | Solid | Wood | 0.03 |
| 520 | 1926 Bldg | 10 | XRF | 7/3/97 | 3 | Hall | 2 | | Locker | Cracked | Metal | 0.69 |
| 521 | 1926 Bldg | 11 | XRF | 7/3/97 | 3 | Hall | 2 | Door | Casing | Cracked | Metal | 5.09 |
| 522 | 1926 Bldg | 12 | XRF | 7/3/97 | 3 | Hall | 2 | Window | Sash | Solid | Metal | 5.09 |
| 523 | 1926 Bldg | 13 | XRF | 7/3/97 | 3 | Hall | 2 | Wall | Midle Wall | Cracked | Plaster | 5.09 |
| 524 | 1926 Bldg | 14 | XRF | 7/3/97 | 3 | Hall | 2 | Wall | Wall | Cracked | Plaster | 0.06 |
| 525 | 1926 Bldg | 15 | XRF | 7/3/97 | 3 | Hall | 2 | Door | Crown mo | Solid | Wood | 0.02 |
| 526 | 1926 Bldg | 16 | XRF | 7/3/97 | 3 | Hall | 2 | Ceiling | | Cracked | Plaster | 0.1 |
| 527 | 1926 Bldg | 17 | XRF | 7/3/97 | 3 | Hall | 2 | Wall | Wall Rgstr | Solid | Metal | 5.09 |
| 528 | 1926 Bldg | 140 | XRF | 7/3/97 | 3 | Hall | 3 | Wall | Wall | Solid | Drywall | 0.01 |
| 529 | 1926 Bldg | 141 | XRF | 7/3/97 | 3 | Hall | 3 | Wall | Wall | Cracked | Plaster | 0.06 |
| 530 | 1926 Bldg | 142 | XRF | 7/3/97 | 3 | Hall | 3 | Bulletin Board | Trim | Solid | Wood | 0.04 |
| 531 | 1926 Bldg | 143 | XRF | 7/3/97 | 3 | Hall | 3 | Wall | Midle Wall | Solid | Plaster | 0.06 |
| 532 | 1926 Bldg | 144 | XRF | 7/3/97 | 3 | Hall | 3 | Wall | Baseboar | Cracked | Metal | 4.37 |
| 533 | 1926 Bldg | 145 | XRF | 7/3/97 | 3 | Hall | 3 | Door | Door | Solid | Wood | 0 |
| 534 | 1926 Bldg | 146 | XRF | 7/3/97 | 3 | Hall | 3 | Window | Casing | Solid | Metal | 0.05 |
| 535 | 1926 Bldg | 147 | XRF | 7/3/97 | 3 | Hall | 3 | Door | Casing | Cracked | Metal | 3.23 |
| 536 | 1926 Bldg | 148 | XRF | 7/3/97 | 3 | Hall | 3 | Floor | | Solid | Wood | 0 |
| 537 | 1926 Bldg | 149 | XRF | 7/3/97 | 3 | Hall | 3 | Cabinet | Door | Solid | Wood | 0.04 |
| 538 | 1926 Bldg | 150 | XRF | 7/3/97 | 3 | Hall | 3 | | Elec Pane | Solid | Metal | 0.06 |
| 539 | 1926 Bldg | 151 | XRF | 7/3/97 | 3 | Hall | 3 | Wall | Wall | Peeling | Plaster | 0.07 |
| 540 | 1926 Bldg | 152 | XRF | 7/3/97 | 3 | Hall | 3 | | Locker | Cracked | Metal | 0.97 |
| 541 | 1926 Bldg | 153 | XRF | 7/3/97 | 3 | Hall | 3 | Door | Door | Solid | Metal | 0 |
| 542 | 1926 Bldg | 154 | XRF | 7/3/97 | 3 | Hall | 3 | Door | Casing | Solid | Metal | 0.01 |
| 543 | 1926 Bldg | 155 | XRF | 7/3/97 | 3 | Hall | 3 | Wall | Chair rail | Cracked | Wood | 0.03 |
| 544 | 1926 Bldg | 156 | XRF | 7/3/97 | 3 | Hall | 3 | Closet | Wall | Cracked | Plaster | 4.37 |
| 545 | 1926 Bldg | 157 | XRF | 7/3/97 | 3 | Hall | 3 | Closet | Shelf | Cracked | Wood | 0.09 |
| 546 | 1926 Bldg | 158 | XRF | 7/3/97 | 3 | Hall | 3 | Closet | Casing | Cracked | Wood | 0.05 |
| 547 | 1926 Bldg | 159 | XRF | 7/3/97 | 3 | Hall | 3 | Window | Casing | Cracked | Wood | 0.04 |
| 548 | 1926 Bldg | 160 | XRF | 7/3/97 | 3 | Hall | 3 | Wall | Wall | Solid | Plaster | 0.07 |
| 549 | 1926 Bldg | 161 | XRF | 7/3/97 | 3 | Hall | 3 | Ceiling | | Cracked | Plaster | 0.14 |
| 550 | 1926 Bldg | 162 | XRF | 7/3/97 | 3 | Hall | 3 | Ceiling | | Peeling | Plaster | 0.06 |
| 551 | 1926 Bldg | 163 | XRF | 7/3/97 | 3 | Hall | 3 | Window | Casing | Peeling | Wood | 0.03 |
| 552 | 1926 Bldg | 164 | XRF | 7/3/97 | 3 | Hall | 3 | Ceiling | Hatch | Cracked | Wood | 0.03 |
| 553 | 1926 Bldg | 199 | XRF | 6/10/98 | 1 | Hall | 1001 | Door | Door | Solid | Metal | 0.05 |
| 554 | 1926 Bldg | 200 | XRF | 6/10/98 | 1 | Hall | 1001 | Door | Casing | Solid | Metal | 0.04 |
| 555 | 1926 Bldg | 201 | XRF | 6/10/98 | 1 | Hall | 1001 | | Locker | Solid | Metal | 0.67 |
| 556 | 1926 Bldg | 202 | XRF | 6/10/98 | 1 | Hall | 1001 | Wall | Wall | Solid | Plaster | 5.09 |
| 557 | 1926 Bldg | 203 | XRF | 6/10/98 | 1 | Hall | 1001 | Wall | Wall | Solid | Concrete | 5.09 |
| 558 | 1926 Bldg | 204 | XRF | 6/10/98 | 1 | Hall | 1001 | | Elec Pane | Solid | Metal | 0.01 |
| 559 | 1926 Bldg | 205 | XRF | 6/10/98 | 1 | Hall | 1001 | Wall | Wall | Solid | Concrete | 0.09 |
| 560 | 1926 Bldg | 206 | XRF | 6/10/98 | 1 | Hall | 1001 | Wall | Wall | Solid | Plaster | 0.06 |
| 561 | 1926 Bldg | 207 | XRF | 6/10/98 | 1 | Hall | 1001 | Door | Door | Solid | Wood | 0.03 |
| 562 | 1926 Bldg | 208 | XRF | 6/10/98 | 1 | Hall | 1001 | Window | Casing | Solid | Metal | 5.09 |
| 563 | 1926 Bldg | 209 | XRF | 6/10/98 | 1 | Hall | 1001 | | Radiator | Solid | Metal | 0.12 |
| 564 | 1926 Bldg | 210 | XRF | 6/10/98 | 1 | Hall | 1001 | Wall | Wall | Solid | Plaster | 5.09 |
| 565 | 1926 Bldg | 211 | XRF | 6/10/98 | 1 | Hall | 1001 | | Locker | Solid | Metal | 0.63 |
| 566 | 1926 Bldg | 212 | XRF | 6/10/98 | 1 | Hall | 1001 | Wall | Wall | Solid | Plaster | 0.12 |
| 567 | 1926 Bldg | 213 | XRF | 6/10/98 | 1 | Hall | 1001 | Door | Door | Solid | Metal | 5.09 |
| 568 | 1926 Bldg | 214 | XRF | 6/10/98 | 1 | Hall | 1001 | Ceiling | | Solid | Plaster | 0.12 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L |
|-----|-----------|----------|----------|---------|-------|---------|-------|-----------|------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 569 | 1926 Bldg | 215 | XRF | 6/10/98 | 1 | Hall | 1001 | Ceiling | Solid | Plaster | 0.07 | |
| 570 | 1926 Bldg | 216 | XRF | 6/10/98 | 1 | Hall | 1001 | Ceiling | Solid | Plaster | 0.03 | |
| 571 | 1926 Bldg | 110 | XRF | 6/10/98 | 1 | Hall | 1050 | Wall | Midle Wall | Solid | Plaster | 0.02 |
| 572 | 1926 Bldg | 111 | XRF | 6/10/98 | 1 | Hall | 1050 | | Radiator | Solid | Metal | 0.03 |
| 573 | 1926 Bldg | 112 | XRF | 6/10/98 | 1 | Hall | 1050 | Door | Door | Solid | Wood | 0.01 |
| 574 | 1926 Bldg | 113 | XRF | 6/10/98 | 1 | Hall | 1050 | Door | Casing | Solid | Wood | 0.03 |
| 575 | 1926 Bldg | 114 | XRF | 6/10/98 | 1 | Hall | 1050 | | Locker | Solid | Metal | 0.19 |
| 576 | 1926 Bldg | 115 | XRF | 6/10/98 | 1 | Hall | 1050 | Window | Mullion | Solid | Wood | 0.05 |
| 577 | 1926 Bldg | 116 | XRF | 6/10/98 | 1 | Hall | 1050 | Window | Casing | Solid | Metal | 0 |
| 578 | 1926 Bldg | 117 | XRF | 6/10/98 | 1 | Hall | 1050 | Wall | Wall | Solid | Plaster | 0.08 |
| 579 | 1926 Bldg | 118 | XRF | 6/10/98 | 1 | Hall | 1050 | Door | Door | Solid | Wood | 5.09 |
| 580 | 1926 Bldg | 119 | XRF | 6/10/98 | 1 | Hall | 1050 | Door | Casing | Solid | Wood | 2.38 |
| 581 | 1926 Bldg | 120 | XRF | 6/10/98 | 1 | Hall | 1050 | Door | Door | Cracked | Wood | 0 |
| 582 | 1926 Bldg | 191 | XRF | 6/9/98 | 2 | Hall | 2400 | Wall | Midle Wall | Solid | Plaster | 0.09 |
| 583 | 1926 Bldg | 192 | XRF | 6/9/98 | 2 | Hall | 2400 | Door | Door | Solid | Metal | 0.03 |
| 584 | 1926 Bldg | 193 | XRF | 6/9/98 | 2 | Hall | 2400 | Door | Jamb | Solid | Metal | 0.01 |
| 585 | 1926 Bldg | 194 | XRF | 6/9/98 | 2 | Hall | 2400 | | Locker | Solid | Metal | 0.73 |
| 586 | 1926 Bldg | 195 | XRF | 6/9/98 | 2 | Hall | 2400 | Door | Door | Solid | Wood | 0.01 |
| 587 | 1926 Bldg | 196 | XRF | 6/9/98 | 2 | Hall | 2400 | Door | Casing | Solid | Wood | 0 |
| 588 | 1926 Bldg | 197 | XRF | 6/9/98 | 2 | Hall | 2400 | Door | Casing | Solid | Wood | 0.07 |
| 589 | 1926 Bldg | 198 | XRF | 6/9/98 | 2 | Hall | 2400 | Wall | Wall | Solid | Concrete | 5.09 |
| 590 | 1926 Bldg | 199 | XRF | 6/9/98 | 2 | Hall | 2400 | Wall | Wall | Solid | Concrete | 5.09 |
| 591 | 1926 Bldg | 200 | XRF | 6/9/98 | 2 | Hall | 2400 | | Locker | Solid | Metal | 0.19 |
| 592 | 1926 Bldg | 201 | XRF | 6/9/98 | 2 | Hall | 2400 | Door | Door | Solid | Metal | 5.09 |
| 593 | 1926 Bldg | 202 | XRF | 6/9/98 | 2 | Hall | 2400 | Door | Jamb | Solid | Metal | 3.99 |
| 594 | 1926 Bldg | 203 | XRF | 6/9/98 | 2 | Hall | 2400 | Wall | Wall | Solid | Plaster | 0.04 |
| 595 | 1926 Bldg | 204 | XRF | 6/9/98 | 2 | Hall | 2400 | Door | Door | Solid | Metal | 5.09 |
| 596 | 1926 Bldg | 205 | XRF | 6/9/98 | 2 | Hall | 2400 | Door | Casing | Solid | Metal | 1.7 |
| 597 | 1926 Bldg | 206 | XRF | 6/9/98 | 2 | Hall | 2400 | | Radiator | Solid | Metal | 0.08 |
| 598 | 1926 Bldg | 207 | XRF | 6/9/98 | 2 | Hall | 2400 | Window | Casing | Solid | Metal | 0 |
| 599 | 1926 Bldg | 208 | XRF | 6/9/98 | 2 | Hall | 2400 | Window | Mullion | Solid | Wood | 0.55 |
| 600 | 1926 Bldg | 209 | XRF | 6/9/98 | 2 | Hall | 2400 | Wall | Chair rail | Solid | Wood | 0.05 |
| 601 | 1926 Bldg | 210 | XRF | 6/9/98 | 2 | Hall | 2400 | Wall | Wall | Solid | Concrete | 0.01 |
| 602 | 1926 Bldg | 211 | XRF | 6/9/98 | 2 | Hall | 2400 | | Locker | Solid | Metal | 0.88 |
| 603 | 1926 Bldg | 212 | XRF | 6/9/98 | 2 | Hall | 2400 | Door | Door | Solid | Metal | 5.09 |
| 604 | 1926 Bldg | 213 | XRF | 6/9/98 | 2 | Hall | 2400 | Door | Casing | Solid | Metal | 1.97 |
| 605 | 1926 Bldg | 214 | XRF | 6/9/98 | 2 | Hall | 2400 | Ceiling | | Solid | Plaster | 0 |
| 606 | 1926 Bldg | 215 | XRF | 6/9/98 | 2 | Hall | 2400 | Ceiling | | Solid | Plaster | 0.42 |
| 607 | 1926 Bldg | 216 | XRF | 6/9/98 | 2 | Hall | 2400 | Ceiling | | Solid | Plaster | 0 |
| 608 | 1926 Bldg | 130 | XRF | 6/10/98 | 1 | Kitchen | 100 | Door | Door | Solid | Metal | 5.09 |
| 609 | 1926 Bldg | 131 | XRF | 6/10/98 | 1 | Kitchen | 100 | Door | Jamb | Solid | Wood | 3.34 |
| 610 | 1926 Bldg | 132 | XRF | 6/10/98 | 1 | Kitchen | 100 | Wall | Midle Wall | Solid | Plaster | 0.34 |
| 611 | 1926 Bldg | 133 | XRF | 6/10/98 | 1 | Kitchen | 100 | Door | Door | Solid | Wood | 0.05 |
| 612 | 1926 Bldg | 134 | XRF | 6/10/98 | 1 | Kitchen | 100 | Door | Casing | Solid | Wood | 0.04 |
| 613 | 1926 Bldg | 135 | XRF | 6/10/98 | 1 | Kitchen | 100 | Door | Door | Solid | Metal | 0.65 |
| 614 | 1926 Bldg | 136 | XRF | 6/10/98 | 1 | Kitchen | 100 | Door | Casing | Solid | Metal | 0.6 |
| 615 | 1926 Bldg | 137 | XRF | 6/10/98 | 1 | Kitchen | 100 | Ceiling | | Solid | Plaster | 0 |
| 616 | 1926 Bldg | 6 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Wall-Lwr | Solid | Plaster | 0.11 |
| 617 | 1926 Bldg | 7 | XRF | 6/11/98 | 1 | Main | 131 | Door | Door | Solid | Wood | 0.04 |
| 618 | 1926 Bldg | 8 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Wall-Upr | Solid | Plaster | 0.11 |
| 619 | 1926 Bldg | 9 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Wall-Upr | Solid | Plaster | 0.04 |
| 620 | 1926 Bldg | 10 | XRF | 6/11/98 | 1 | Main | 131 | | Radiator | Solid | Metal | 3.35 |
| 621 | 1926 Bldg | 11 | XRF | 6/11/98 | 1 | Main | 131 | Window | Casing-Rh | Solid | Metal | 0 |
| 622 | 1926 Bldg | 12 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Wall-Upr | Solid | Plaster | 2.53 |
| 623 | 1926 Bldg | 13 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Wall-Upr | Solid | Plaster | 0.2 |
| 624 | 1926 Bldg | 14 | XRF | 6/11/98 | 1 | Main | 131 | Door | Jamb-Lft | Solid | Wood | 0 |
| 625 | 1926 Bldg | 15 | XRF | 6/11/98 | 1 | Main | 131 | Door | Door | Solid | Wood | 0.21 |
| 626 | 1926 Bldg | 16 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Wall-Upr | Solid | Plaster | 0.17 |
| 627 | 1926 Bldg | 17 | XRF | 6/11/98 | 1 | Main | 131 | Cabinet | Door-Out | Solid | Wood | 0.01 |
| 628 | 1926 Bldg | 18 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Wall-Upr | Solid | Plaster | 4.42 |
| 629 | 1926 Bldg | 19 | XRF | 6/11/98 | 1 | Main | 131 | | Wall-Upr | Solid | Plaster | 0.27 |
| 630 | 1926 Bldg | 20 | XRF | 6/11/98 | 1 | Main | 131 | | Radiator | Solid | Metal | 0 |
| 631 | 1926 Bldg | 21 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Midle Wall | Solid | Plaster | >>5.0 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L |
|-----|-----------|----------|----------|---------|-------|----------|-------|-----------|------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 632 | 1926 Bldg | 22 | XRF | 6/11/98 | 1 | Main | 131 | Window | Casing-Rh | Solid | Metal | 0 |
| 633 | 1926 Bldg | 23 | XRF | 6/11/98 | 1 | Main | 131 | Window | Casing-Rh | Solid | Wood | 0 |
| 634 | 1926 Bldg | 24 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Midle Wall | Solid | Plaster | 0.05 |
| 635 | 1926 Bldg | 25 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Midle Wall | Solid | Plaster | 0.15 |
| 636 | 1926 Bldg | 26 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Wall-Upr | Solid | Plaster | 0.21 |
| 637 | 1926 Bldg | 27 | XRF | 6/11/98 | 1 | Main | 131 | Bookcase | Shelf | Solid | Wood | 0 |
| 638 | 1926 Bldg | 28 | XRF | 6/11/98 | 1 | Main | 131 | Door | Door | Solid | Wood | 0.04 |
| 639 | 1926 Bldg | 29 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Wall-Upr | Solid | Plaster | 0.22 |
| 640 | 1926 Bldg | 30 | XRF | 6/11/98 | 1 | Main | 131 | Wall | Wall-Lwr | Solid | Plaster | 0.21 |
| 641 | 1926 Bldg | 236 | XRF | 4/20/97 | 4 | Outside | 0 | Door | Door | Solid | Metal | 0.44 |
| 642 | 1926 Bldg | 237 | XRF | 4/20/97 | 4 | Outside | 0 | Door | Casing | Peeling | Metal | 0.62 |
| 643 | 1926 Bldg | 238 | XRF | 4/20/97 | 4 | Outside | 0 | Stairs | Hand rail | Cracked | Metal | 0.16 |
| 644 | 1926 Bldg | 239 | XRF | 4/20/97 | 4 | Outside | 0 | | Rain Gutt | Cracked | Metal | 0.31 |
| 645 | 1926 Bldg | 240 | XRF | 4/20/97 | 4 | Outside | 0 | Ext Wall | Trim | Cracked | Metal | 0.31 |
| 646 | 1926 Bldg | 241 | XRF | 4/20/97 | 4 | Outside | 0 | Wall | Wall Rgstr | Peeling | Wood | 3.62 |
| 647 | 1926 Bldg | 264 | XRF | 7/3/97 | 2 | Outside | 0 | Ext Wall | Trim | Solid | Metal | 0.06 |
| 648 | 1926 Bldg | 265 | XRF | 7/3/97 | 2 | Outside | 0 | Ext Wall | Trim | Solid | Metal | 0.18 |
| 649 | 1926 Bldg | 266 | XRF | 7/3/97 | 2 | Outside | 0 | Ext Wall | Trim | Solid | Metal | 0.21 |
| 650 | 1926 Bldg | 267 | XRF | 7/3/97 | 2 | Outside | 0 | Ext Wall | Trim | Solid | Metal | 0.14 |
| 651 | 1926 Bldg | 77 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Door | Cracked | Wood | 0 |
| 652 | 1926 Bldg | 78 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Casing | Cracked | Wood | 5.09 |
| 653 | 1926 Bldg | 79 | XRF | 6/22/98 | 1 | Outside | 0 | Stairs | Hand rail | Solid | Metal | 0.02 |
| 654 | 1926 Bldg | 80 | XRF | 6/22/98 | 1 | Outside | 0 | Window | Stool | Solid | Metal | 0 |
| 655 | 1926 Bldg | 81 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Door | Solid | Wood | 0.01 |
| 656 | 1926 Bldg | 82 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Casing | Cracked | Wood | 5.09 |
| 657 | 1926 Bldg | 83 | XRF | 6/22/98 | 1 | Outside | 0 | Stairs | Hand rail | Solid | Metal | 0.23 |
| 658 | 1926 Bldg | 84 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Door | Solid | Metal | 0.09 |
| 659 | 1926 Bldg | 85 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Door | Solid | Metal | 0.02 |
| 660 | 1926 Bldg | 86 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Door | Solid | Wood | 0.05 |
| 661 | 1926 Bldg | 87 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Casing | Cracked | Wood | 5.09 |
| 662 | 1926 Bldg | 97 | XRF | 6/22/98 | 1 | Outside | 0 | Wall | Wall | Solid | Concrete | 0.01 |
| 663 | 1926 Bldg | 60 | XRF | 4/20/97 | 3 | Restroom | 1 | Ceiling | | Peeling | Plaster | 0.07 |
| 664 | 1926 Bldg | 61 | XRF | 4/20/97 | 3 | Restroom | 1 | Wall | Wall | Peeling | Plaster | 0.08 |
| 665 | 1926 Bldg | 62 | XRF | 4/20/97 | 3 | Restroom | 1 | Wall | Midle Wall | Cracked | Plaster | 0.04 |
| 666 | 1926 Bldg | 63 | XRF | 4/20/97 | 3 | Restroom | 1 | Wall | Wall | Cracked | Plaster | 0.11 |
| 667 | 1926 Bldg | 64 | XRF | 4/20/97 | 3 | Restroom | 1 | | Radiator | Solid | Metal | 0.16 |
| 668 | 1926 Bldg | 65 | XRF | 4/20/97 | 3 | Restroom | 1 | Window | Casing | Cracked | Metal | 0.68 |
| 669 | 1926 Bldg | 66 | XRF | 4/20/97 | 3 | Restroom | 1 | Window | Mullion | Solid | Metal | 0.54 |
| 670 | 1926 Bldg | 67 | XRF | 4/20/97 | 3 | Restroom | 1 | Window | Sill | Solid | Metal | 0.71 |
| 671 | 1926 Bldg | 68 | XRF | 4/20/97 | 3 | Restroom | 1 | Bookcase | Shelf | Cracked | Wood | 0 |
| 672 | 1926 Bldg | 69 | XRF | 4/20/97 | 3 | Restroom | 1 | Door | Door | Cracked | Wood | 0.06 |
| 673 | 1926 Bldg | 70 | XRF | 4/20/97 | 3 | Restroom | 1 | Door | Casing | Solid | Wood | 0.06 |
| 674 | 1926 Bldg | 71 | XRF | 4/20/97 | 3 | Restroom | 1 | Wall | Wall Rgstr | Solid | Metal | 0.13 |
| 675 | 1926 Bldg | 121 | XRF | 4/20/97 | 3 | Restroom | 2 | Ceiling | | Cracked | Plaster | 0 |
| 676 | 1926 Bldg | 122 | XRF | 4/20/97 | 3 | Restroom | 2 | Wall | Wall | Cracked | Plaster | 0.15 |
| 677 | 1926 Bldg | 123 | XRF | 4/20/97 | 3 | Restroom | 2 | Wall | Wall | Cracked | Plaster | 0.15 |
| 678 | 1926 Bldg | 124 | XRF | 4/20/97 | 3 | Restroom | 2 | Cabinet | Door | Solid | Wood | 0.05 |
| 679 | 1926 Bldg | 125 | XRF | 4/20/97 | 3 | Restroom | 2 | Wall | Baseboar | Cracked | Metal | 2.79 |
| 680 | 1926 Bldg | 126 | XRF | 4/20/97 | 3 | Restroom | 2 | Door | Door | Solid | Wood | 0.06 |
| 681 | 1926 Bldg | 127 | XRF | 4/20/97 | 3 | Restroom | 2 | Door | Casing | Solid | Wood | 0.05 |
| 682 | 1926 Bldg | 144 | XRF | 4/20/97 | 3 | Restroom | 3 | Wall | Wall | Cracked | Plaster | 5.09 |
| 683 | 1926 Bldg | 145 | XRF | 4/20/97 | 3 | Restroom | 3 | Wall | Chair rail | Solid | Wood | 0.05 |
| 684 | 1926 Bldg | 146 | XRF | 4/20/97 | 3 | Restroom | 3 | Wall | Wall Rgstr | Solid | Metal | 0.3 |
| 685 | 1926 Bldg | 147 | XRF | 4/20/97 | 3 | Restroom | 3 | Door | Stall Door | Cracked | Wood | 5.09 |
| 686 | 1926 Bldg | 148 | XRF | 4/20/97 | 3 | Restroom | 3 | Door | Stall Door | Cracked | Wood | 0.02 |
| 687 | 1926 Bldg | 149 | XRF | 4/20/97 | 3 | Restroom | 3 | Door | Door | Solid | Wood | 0.05 |
| 688 | 1926 Bldg | 150 | XRF | 4/20/97 | 3 | Restroom | 3 | Door | Casing | Solid | Wood | 0.03 |
| 689 | 1926 Bldg | 151 | XRF | 4/20/97 | 3 | Restroom | 3 | Window | Casing | Solid | Wood | 0.09 |
| 690 | 1926 Bldg | 152 | XRF | 4/20/97 | 3 | Restroom | 3 | | Radiator | Cracked | Metal | 0.31 |
| 691 | 1926 Bldg | 153 | XRF | 4/20/97 | 3 | Restroom | 3 | Wall | Midle Wall | Cracked | Plaster | 2.03 |
| 692 | 1926 Bldg | 154 | XRF | 4/20/97 | 3 | Restroom | 3 | Mirror | Frame | Cracked | Wood | 0.05 |
| 693 | 1926 Bldg | 155 | XRF | 4/20/97 | 3 | Restroom | 3 | Wall | Wall | Cracked | Plaster | 0.11 |
| 694 | 1926 Bldg | 156 | XRF | 4/20/97 | 3 | Restroom | 3 | Door | Door | Solid | Wood | 0.06 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | |
|-----|-----------|----------|----------|---------|-------|----------|-------|-----------|-------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 695 | 1926 Bldg | 157 | XRF | 4/20/97 | 3 | Restroom | 3 | Door | Casing | Solid | Wood | 0.02 |
| 696 | 1926 Bldg | 158 | XRF | 4/20/97 | 3 | Restroom | 3 | Ceiling | | Cracked | Plaster | 2.65 |
| 697 | 1926 Bldg | 53 | XRF | 7/3/97 | 3 | Restroom | 4 | Wall | Wall | Cracked | Plaster | 5.09 |
| 698 | 1926 Bldg | 54 | XRF | 7/3/97 | 3 | Restroom | 4 | Wall | Chair rail | Solid | Wood | 0.01 |
| 699 | 1926 Bldg | 55 | XRF | 7/3/97 | 3 | Restroom | 4 | Wall | Middle Wall | Cracked | Plaster | 1.8 |
| 700 | 1926 Bldg | 56 | XRF | 7/3/97 | 3 | Restroom | 4 | Mirror | Frame | Cracked | Wood | 0 |
| 701 | 1926 Bldg | 57 | XRF | 7/3/97 | 3 | Restroom | 4 | Mirror | Frame | Solid | Wood | 0.05 |
| 702 | 1926 Bldg | 58 | XRF | 7/3/97 | 3 | Restroom | 4 | Window | Casing | Cracked | Wood | 0.07 |
| 703 | 1926 Bldg | 59 | XRF | 7/3/97 | 3 | Restroom | 4 | Window | Stool | Solid | Tile | 0.02 |
| 704 | 1926 Bldg | 60 | XRF | 7/3/97 | 3 | Restroom | 4 | | Radiator | Cracked | Metal | 5.09 |
| 705 | 1926 Bldg | 61 | XRF | 7/3/97 | 3 | Restroom | 4 | Wall | Wall | Cracked | Plaster | 2.04 |
| 706 | 1926 Bldg | 62 | XRF | 7/3/97 | 3 | Restroom | 4 | Wall | Wall Rgstr | Solid | Metal | 2.09 |
| 707 | 1926 Bldg | 63 | XRF | 7/3/97 | 3 | Restroom | 4 | Door | Stall Door | Cracked | Wood | 0.05 |
| 708 | 1926 Bldg | 64 | XRF | 7/3/97 | 3 | Restroom | 4 | Wall | Wall Rgstr | Solid | Metal | 0.31 |
| 709 | 1926 Bldg | 65 | XRF | 7/3/97 | 3 | Restroom | 4 | Door | Casing | Cracked | Wood | 0.04 |
| 710 | 1926 Bldg | 66 | XRF | 7/3/97 | 3 | Restroom | 4 | Door | Door | Cracked | Wood | 0.04 |
| 711 | 1926 Bldg | 67 | XRF | 7/3/97 | 3 | Restroom | 4 | Support | Bracket | Solid | Metal | 0.02 |
| 712 | 1926 Bldg | 68 | XRF | 7/3/97 | 3 | Restroom | 4 | Ceiling | | Cracked | Plaster | 2.27 |
| 713 | 1926 Bldg | 85 | XRF | 7/3/97 | 3 | Restroom | 5 | Wall | Wall | Cracked | Plaster | 0.29 |
| 714 | 1926 Bldg | 86 | XRF | 7/3/97 | 3 | Restroom | 5 | Wall | Chalking | Plaster | 0.05 | |
| 715 | 1926 Bldg | 87 | XRF | 7/3/97 | 3 | Restroom | 5 | | Radiator | Solid | Metal | 0.26 |
| 716 | 1926 Bldg | 88 | XRF | 7/3/97 | 3 | Restroom | 5 | Window | Casing | Solid | Wood | 0.03 |
| 717 | 1926 Bldg | 89 | XRF | 7/3/97 | 3 | Restroom | 5 | Door | Door | Cracked | Wood | 0.05 |
| 718 | 1926 Bldg | 90 | XRF | 7/3/97 | 3 | Restroom | 5 | Door | Casing | Cracked | Wood | 0.03 |
| 719 | 1926 Bldg | 91 | XRF | 7/3/97 | 3 | Restroom | 5 | Ceiling | | Solid | Plaster | 0.07 |
| 720 | 1926 Bldg | 186 | XRF | 7/3/97 | 2 | Restroom | 6 | Wall | Wall | Cracked | Plaster | 5.09 |
| 721 | 1926 Bldg | 187 | XRF | 7/3/97 | 2 | Restroom | 6 | Wall | Middle Wall | Solid | Plaster | 1.55 |
| 722 | 1926 Bldg | 188 | XRF | 7/3/97 | 2 | Restroom | 6 | Mirror | Frame | Solid | Wood | 0.06 |
| 723 | 1926 Bldg | 189 | XRF | 7/3/97 | 2 | Restroom | 6 | Window | Casing | Cracked | Wood | 0.07 |
| 724 | 1926 Bldg | 190 | XRF | 7/3/97 | 2 | Restroom | 6 | | Radiator | Cracked | Metal | 3.53 |
| 725 | 1926 Bldg | 191 | XRF | 7/3/97 | 2 | Restroom | 6 | Door | Door | Cracked | Wood | 0.03 |
| 726 | 1926 Bldg | 192 | XRF | 7/3/97 | 2 | Restroom | 6 | Door | Jamb | Cracked | Wood | 0.05 |
| 727 | 1926 Bldg | 193 | XRF | 7/3/97 | 2 | Restroom | 6 | Door | Stall Door | Cracked | Wood | 5.09 |
| 728 | 1926 Bldg | 194 | XRF | 7/3/97 | 2 | Restroom | 6 | Wall | Wall Rgstr | Solid | Metal | 0.1 |
| 729 | 1926 Bldg | 195 | XRF | 7/3/97 | 2 | Restroom | 6 | Wall | Wall | Cracked | Plaster | 1.82 |
| 730 | 1926 Bldg | 196 | XRF | 7/3/97 | 2 | Restroom | 6 | Door | Stall Door | Cracked | Wood | 0.05 |
| 731 | 1926 Bldg | 197 | XRF | 7/3/97 | 2 | Restroom | 6 | Wall | Chair rail | Solid | Wood | 0.05 |
| 732 | 1926 Bldg | 198 | XRF | 7/3/97 | 2 | Restroom | 6 | Door | Door | Solid | Wood | 0.09 |
| 733 | 1926 Bldg | 199 | XRF | 7/3/97 | 2 | Restroom | 6 | Door | Casing | Cracked | Wood | 0.06 |
| 734 | 1926 Bldg | 200 | XRF | 7/3/97 | 2 | Restroom | 6 | Ceiling | | Solid | Plaster | 1.67 |
| 735 | 1926 Bldg | 259 | XRF | 7/3/97 | 2 | Restroom | 7 | Wall | Wall | Solid | Plaster | 0.18 |
| 736 | 1926 Bldg | 260 | XRF | 7/3/97 | 2 | Restroom | 7 | | Radiator | Cracked | Metal | 0.14 |
| 737 | 1926 Bldg | 261 | XRF | 7/3/97 | 2 | Restroom | 7 | Window | Casing | Cracked | Metal | 0.73 |
| 738 | 1926 Bldg | 262 | XRF | 7/3/97 | 2 | Restroom | 7 | Window | Sash | Solid | Metal | 0.58 |
| 739 | 1926 Bldg | 263 | XRF | 7/3/97 | 2 | Restroom | 7 | Window | Sill | Solid | Metal | 0.87 |
| 740 | 1926 Bldg | 268 | XRF | 7/3/97 | 2 | Restroom | 7 | Wall | Middle Wall | Solid | Plaster | 0.13 |
| 741 | 1926 Bldg | 269 | XRF | 7/3/97 | 2 | Restroom | 7 | Wall | Wall Rgstr | Solid | Metal | 0.33 |
| 742 | 1926 Bldg | 270 | XRF | 7/3/97 | 2 | Restroom | 7 | Wall | Wall | Solid | Plaster | 0.11 |
| 743 | 1926 Bldg | 271 | XRF | 7/3/97 | 2 | Restroom | 7 | Wall | Wall Rgstr | Solid | Metal | 0.24 |
| 744 | 1926 Bldg | 272 | XRF | 7/3/97 | 2 | Restroom | 7 | Door | Door | Solid | Wood | 0.04 |
| 745 | 1926 Bldg | 273 | XRF | 7/3/97 | 2 | Restroom | 7 | Door | Casing | Solid | Wood | 0.07 |
| 746 | 1926 Bldg | 80 | XRF | 6/10/98 | 1 | Restroom | 1000 | Wall | Wall | Solid | Concrete | 5.09 |
| 747 | 1926 Bldg | 81 | XRF | 6/10/98 | 1 | Restroom | 1000 | Wall | Wall | Solid | Concrete | 1.75 |
| 748 | 1926 Bldg | 82 | XRF | 6/10/98 | 1 | Restroom | 1000 | Door | Door | Solid | Wood | 0.04 |
| 749 | 1926 Bldg | 83 | XRF | 6/10/98 | 1 | Restroom | 1000 | Door | Casing | Solid | Wood | 0.04 |
| 750 | 1926 Bldg | 84 | XRF | 6/10/98 | 1 | Restroom | 1000 | | Radiator | Solid | Metal | 0.01 |
| 751 | 1926 Bldg | 85 | XRF | 6/10/98 | 1 | Restroom | 1000 | Window | Mullion | Solid | Wood | 0.08 |
| 752 | 1926 Bldg | 86 | XRF | 6/10/98 | 1 | Restroom | 1000 | Ceiling | | Solid | Concrete | 1.13 |
| 753 | 1926 Bldg | 186 | XRF | 6/10/98 | 1 | Restroom | 1075 | Wall | Wall | Solid | Plaster | 1.5 |
| 754 | 1926 Bldg | 187 | XRF | 6/10/98 | 1 | Restroom | 1075 | Wall | Wall | Solid | Concrete | 5.09 |
| 755 | 1926 Bldg | 188 | XRF | 6/10/98 | 1 | Restroom | 1075 | Wall | Chair rail | Solid | Wood | 0.03 |
| 756 | 1926 Bldg | 189 | XRF | 6/10/98 | 1 | Restroom | 1075 | Wall | Frame | Solid | Wood | 0.04 |
| 757 | 1926 Bldg | 190 | XRF | 6/10/98 | 1 | Restroom | 1075 | | Radiator | Cracked | Metal | 0.25 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L |
|-----|-----------|----------|----------|---------|-------|----------|-------|-----------|------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 758 | 1926 Bldg | 191 | XRF | 6/10/98 | 1 | Restroom | 1075 | Window | Casing | Cracked | Metal | 0 |
| 759 | 1926 Bldg | 192 | XRF | 6/10/98 | 1 | Restroom | 1075 | Window | Mullion | Cracked | Wood | 0.07 |
| 760 | 1926 Bldg | 193 | XRF | 6/10/98 | 1 | Restroom | 1075 | Door | Door | Cracked | Wood | 0.04 |
| 761 | 1926 Bldg | 194 | XRF | 6/10/98 | 1 | Restroom | 1075 | Wall | Wall | Solid | Plaster | 1.32 |
| 762 | 1926 Bldg | 195 | XRF | 6/10/98 | 1 | Restroom | 1075 | Door | Stall Door | Cracked | Wood | 3.19 |
| 763 | 1926 Bldg | 196 | XRF | 6/10/98 | 1 | Restroom | 1075 | Door | Door | Solid | Wood | 0.04 |
| 764 | 1926 Bldg | 197 | XRF | 6/10/98 | 1 | Restroom | 1075 | Door | Casing | Solid | Wood | 0.02 |
| 765 | 1926 Bldg | 198 | XRF | 6/10/98 | 1 | Restroom | 1075 | Ceiling | | Solid | Plaster | 1.46 |
| 766 | 1926 Bldg | 73 | XRF | 6/9/98 | 2 | Restroom | 2060 | Wall | Wall | Solid | Plaster | 1.51 |
| 767 | 1926 Bldg | 74 | XRF | 6/9/98 | 2 | Restroom | 2060 | Wall | Wall | Solid | Concrete | 5.09 |
| 768 | 1926 Bldg | 75 | XRF | 6/9/98 | 2 | Restroom | 2060 | Wall | Chair rail | Solid | Wood | 0.02 |
| 769 | 1926 Bldg | 76 | XRF | 6/9/98 | 2 | Restroom | 2060 | Door | Door | Solid | Wood | 0.03 |
| 770 | 1926 Bldg | 77 | XRF | 6/9/98 | 2 | Restroom | 2060 | Door | Jamb | Solid | Wood | 0.02 |
| 771 | 1926 Bldg | 78 | XRF | 6/9/98 | 2 | Restroom | 2060 | Wall | Bthrm Stnl | Cracked | Metal | 0.16 |
| 772 | 1926 Bldg | 79 | XRF | 6/9/98 | 2 | Restroom | 2060 | Door | Stall Door | Solid | Wood | 0 |
| 773 | 1926 Bldg | 80 | XRF | 6/9/98 | 2 | Restroom | 2060 | | Radiator | Peeling | Metal | 0.1 |
| 774 | 1926 Bldg | 81 | XRF | 6/9/98 | 2 | Restroom | 2060 | Window | Casing | Solid | Metal | 0 |
| 775 | 1926 Bldg | 82 | XRF | 6/9/98 | 2 | Restroom | 2060 | Window | Mullion | Solid | Wood | 0.07 |
| 776 | 1926 Bldg | 83 | XRF | 6/9/98 | 2 | Restroom | 2060 | Ceiling | | Solid | Plaster | 1.83 |
| 777 | 1926 Bldg | 133 | XRF | 6/9/98 | 2 | Restroom | 2430 | Wall | Wall | Solid | Concrete | 5.09 |
| 778 | 1926 Bldg | 134 | XRF | 6/9/98 | 2 | Restroom | 2430 | Wall | Midle Wall | Solid | Concrete | 0.03 |
| 779 | 1926 Bldg | 135 | XRF | 6/9/98 | 2 | Restroom | 2430 | | Radiator | Peeling | Metal | 0.04 |
| 780 | 1926 Bldg | 136 | XRF | 6/9/98 | 2 | Restroom | 2430 | Window | Casing | Solid | Metal | 0 |
| 781 | 1926 Bldg | 137 | XRF | 6/9/98 | 2 | Restroom | 2430 | Window | Apron | Solid | Wood | 0.08 |
| 782 | 1926 Bldg | 138 | XRF | 6/9/98 | 2 | Restroom | 2430 | Door | Door | Solid | Wood | 0.03 |
| 783 | 1926 Bldg | 139 | XRF | 6/9/98 | 2 | Restroom | 2430 | Door | Stall Door | Solid | Wood | 5.09 |
| 784 | 1926 Bldg | 140 | XRF | 6/9/98 | 2 | Restroom | 2430 | Door | Door | Solid | Wood | 0.03 |
| 785 | 1926 Bldg | 141 | XRF | 6/9/98 | 2 | Restroom | 2430 | Ceiling | | Solid | Plaster | 1.59 |
| 786 | 1926 Bldg | 88 | XRF | 4/20/97 | 3 | Room | 1 | Wall | Wall | Solid | Plaster | 0.1 |
| 787 | 1926 Bldg | 89 | XRF | 4/20/97 | 3 | Room | 1 | Wall | Wall | Solid | Plaster | 0.28 |
| 788 | 1926 Bldg | 90 | XRF | 4/20/97 | 3 | Room | 1 | Cabinet | Door | Solid | Wood | 0 |
| 789 | 1926 Bldg | 91 | XRF | 4/20/97 | 3 | Room | 1 | Cabinet | Floor | Solid | Metal | 0.01 |
| 790 | 1926 Bldg | 92 | XRF | 4/20/97 | 3 | Room | 1 | Door | Door | Solid | Wood | 0.07 |
| 791 | 1926 Bldg | 93 | XRF | 4/20/97 | 3 | Room | 1 | Door | Casing | Solid | Wood | 0 |
| 792 | 1926 Bldg | 94 | XRF | 4/20/97 | 3 | Room | 1 | Hatch | Midle Wall | Solid | Metal | 0 |
| 793 | 1926 Bldg | 95 | XRF | 4/20/97 | 3 | Room | 1 | Ceiling | | Solid | Plaster | 0.37 |
| 794 | 1926 Bldg | 96 | XRF | 4/20/97 | 3 | Room | 1 | Ceiling | Hatch | Solid | Metal | 0.14 |
| 795 | 1926 Bldg | 97 | XRF | 4/20/97 | 3 | Room | 1 | Wall | Baseboar | Cracked | Metal | 5.09 |
| 796 | 1926 Bldg | 113 | XRF | 4/20/97 | 3 | Room | 2 | Wall | Midle Wall | Cracked | Plaster | 0.05 |
| 797 | 1926 Bldg | 114 | XRF | 4/20/97 | 3 | Room | 2 | Wall | Baseboar | Cracked | Metal | 4.01 |
| 798 | 1926 Bldg | 115 | XRF | 4/20/97 | 3 | Room | 2 | Cabinet | Door | Solid | Wood | 0 |
| 799 | 1926 Bldg | 116 | XRF | 4/20/97 | 3 | Room | 2 | Window | Casing | Solid | Wood | 0.06 |
| 800 | 1926 Bldg | 117 | XRF | 4/20/97 | 3 | Room | 2 | | Radiator | Cracked | Metal | 0.03 |
| 801 | 1926 Bldg | 118 | XRF | 4/20/97 | 3 | Room | 2 | Door | Door | Cracked | Wood | 0.07 |
| 802 | 1926 Bldg | 119 | XRF | 4/20/97 | 3 | Room | 2 | Door | Casing | Solid | Wood | 0.06 |
| 803 | 1926 Bldg | 120 | XRF | 4/20/97 | 3 | Room | 2 | Ceiling | | Solid | Plaster | 0.04 |
| 804 | 1926 Bldg | 178 | XRF | 4/20/97 | 3 | Room | 3 | Wall | Midle Wall | Solid | Plaster | 2.36 |
| 805 | 1926 Bldg | 179 | XRF | 4/20/97 | 3 | Room | 3 | Door | Crown mo | Solid | Wood | 0.13 |
| 806 | 1926 Bldg | 180 | XRF | 4/20/97 | 3 | Room | 3 | Wall | Wall | Solid | Plaster | 1.57 |
| 807 | 1926 Bldg | 181 | XRF | 4/20/97 | 3 | Room | 3 | Ceiling | | Cracked | Plaster | 0.06 |
| 808 | 1926 Bldg | 182 | XRF | 4/20/97 | 3 | Room | 3 | Door | Door | Solid | Wood | 0.06 |
| 809 | 1926 Bldg | 183 | XRF | 4/20/97 | 3 | Room | 3 | Door | Casing | Solid | Wood | 0.32 |
| 810 | 1926 Bldg | 184 | XRF | 4/20/97 | 3 | Room | 3 | Bookcase | Shelf | Solid | Wood | 0 |
| 811 | 1926 Bldg | 185 | XRF | 4/20/97 | 3 | Room | 3 | Mirror | Frame | Solid | Wood | 0.1 |
| 812 | 1926 Bldg | 186 | XRF | 4/20/97 | 3 | Room | 3 | Window | Casing | Solid | Wood | 0.43 |
| 813 | 1926 Bldg | 187 | XRF | 4/20/97 | 3 | Room | 3 | Window | Stool | Solid | Concrete | 0.45 |
| 814 | 1926 Bldg | 188 | XRF | 4/20/97 | 3 | Room | 3 | | Radiator | Cracked | Metal | 1.27 |
| 815 | 1926 Bldg | 189 | XRF | 4/20/97 | 3 | Room | 3 | Radiator | Protector | Solid | Wood | 0 |
| 816 | 1926 Bldg | 190 | XRF | 4/20/97 | 3 | Room | 3 | Wall | Baseboar | Solid | Wood | 0.19 |
| 817 | 1926 Bldg | 191 | XRF | 4/20/97 | 3 | Room | 3 | Wall | Baseboar | Solid | Wood | 0.27 |
| 818 | 1926 Bldg | 192 | XRF | 4/20/97 | 3 | Room | 3 | Wall | Wall | Peeling | Plaster | 5.09 |
| 819 | 1926 Bldg | 193 | XRF | 4/20/97 | 3 | Room | 3 | Floor | | Solid | Wood | 0 |
| 820 | 1926 Bldg | 194 | XRF | 4/20/97 | 3 | Room | 3 | Closet | Wall | Cracked | Plaster | 3.92 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L |
|-----|-----------|----------|----------|---------|-------|------|-------|----------------|-------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 821 | 1926 Bldg | 195 | XRF | 4/20/97 | 3 | Room | 3 | Closet | Wall | Cracked | Plaster | 0.3 |
| 822 | 1926 Bldg | 196 | XRF | 4/20/97 | 3 | Room | 3 | Closet | Shelf | Solid | Wood | 0 |
| 823 | 1926 Bldg | 197 | XRF | 4/20/97 | 3 | Room | 3 | Closet | Floor | Cracked | Concrete | 0.92 |
| 824 | 1926 Bldg | 198 | XRF | 4/20/97 | 3 | Room | 3 | Closet | Casing | Solid | Wood | 0.33 |
| 825 | 1926 Bldg | 233 | XRF | 4/20/97 | 4 | Room | 4 | Window | Casing | Cracked | Metal | 2.24 |
| 826 | 1926 Bldg | 234 | XRF | 4/20/97 | 4 | Room | 4 | Door | Door | Solid | Metal | 5.09 |
| 827 | 1926 Bldg | 235 | XRF | 4/20/97 | 4 | Room | 4 | Door | Casing | Cracked | Metal | 5.09 |
| 828 | 1926 Bldg | 242 | XRF | 4/20/97 | 4 | Room | 4 | Stairs | Hand rail | Cracked | Metal | 4.45 |
| 829 | 1926 Bldg | 243 | XRF | 4/20/97 | 3 | Room | 4 | Door | Door | Cracked | Metal | 0.16 |
| 830 | 1926 Bldg | 244 | XRF | 4/20/97 | 3 | Room | 4 | Door | Casing | Cracked | Metal | 0.37 |
| 831 | 1926 Bldg | 92 | XRF | 7/3/97 | 3 | Room | 5 | Wall | Middle Wall | Cracked | Plaster | 0.03 |
| 832 | 1926 Bldg | 93 | XRF | 7/3/97 | 3 | Room | 5 | Bookcase | Shelf | Cracked | Wood | 0 |
| 833 | 1926 Bldg | 94 | XRF | 7/3/97 | 3 | Room | 5 | Floor | | Solid | Wood | 0.01 |
| 834 | 1926 Bldg | 95 | XRF | 7/3/97 | 3 | Room | 5 | Cabinet | Door | Solid | Wood | 0 |
| 835 | 1926 Bldg | 96 | XRF | 7/3/97 | 3 | Room | 5 | Wall | Baseboard | Solid | Wood | 0.1 |
| 836 | 1926 Bldg | 97 | XRF | 7/3/97 | 3 | Room | 5 | Window | Casing | Cracked | Metal | 0.1 |
| 837 | 1926 Bldg | 98 | XRF | 7/3/97 | 3 | Room | 5 | Window | Stool | Peeling | Wood | 0.08 |
| 838 | 1926 Bldg | 99 | XRF | 7/3/97 | 3 | Room | 5 | Closet | Wall | Cracked | Plaster | 0.07 |
| 839 | 1926 Bldg | 100 | XRF | 7/3/97 | 3 | Room | 5 | Closet | Casing | Cracked | Wood | 0 |
| 840 | 1926 Bldg | 101 | XRF | 7/3/97 | 3 | Room | 5 | Door | Door | Cracked | Wood | 0.05 |
| 841 | 1926 Bldg | 102 | XRF | 7/3/97 | 3 | Room | 5 | Door | Casing | Cracked | Wood | 0.02 |
| 842 | 1926 Bldg | 103 | XRF | 7/3/97 | 3 | Room | 5 | Sink | Base | Solid | Wood | 0.01 |
| 843 | 1926 Bldg | 104 | XRF | 7/3/97 | 3 | Room | 5 | Wall | Wall Rgstr | Cracked | Metal | 0.26 |
| 844 | 1926 Bldg | 105 | XRF | 7/3/97 | 3 | Room | 5 | Ceiling | | Cracked | Plaster | 0.09 |
| 845 | 1926 Bldg | 106 | XRF | 7/3/97 | 3 | Room | 6 | Ceiling | | Solid | Plaster | 0.06 |
| 846 | 1926 Bldg | 107 | XRF | 7/3/97 | 3 | Room | 6 | Wall | Middle Wall | Solid | Drywall | 0 |
| 847 | 1926 Bldg | 108 | XRF | 7/3/97 | 3 | Room | 6 | Door | Door | Solid | Wood | 0 |
| 848 | 1926 Bldg | 109 | XRF | 7/3/97 | 3 | Room | 6 | Door | Casing | Solid | Metal | 0 |
| 849 | 1926 Bldg | 110 | XRF | 7/3/97 | 3 | Room | 6 | Wall | Wall | Solid | Plaster | 0.09 |
| 850 | 1926 Bldg | 111 | XRF | 7/3/97 | 3 | Room | 6 | Wall | Baseboard | Cracked | Metal | 2.41 |
| 851 | 1926 Bldg | 112 | XRF | 7/3/97 | 3 | Room | 6 | Floor | | Solid | Wood | 0.01 |
| 852 | 1926 Bldg | 113 | XRF | 7/3/97 | 3 | Room | 6 | Bulletin Board | Trim | Solid | Wood | 0.06 |
| 853 | 1926 Bldg | 114 | XRF | 7/3/97 | 3 | Room | 6 | Wall | Wall | Solid | Plaster | 0.03 |
| 854 | 1926 Bldg | 115 | XRF | 7/3/97 | 3 | Room | 6 | Wall | Radiator | Cracked | Metal | 0.2 |
| 855 | 1926 Bldg | 116 | XRF | 7/3/97 | 3 | Room | 6 | Window | Casing | Cracked | Metal | 0.42 |
| 856 | 1926 Bldg | 117 | XRF | 7/3/97 | 3 | Room | 6 | Door | Casing | Solid | Wood | 0.04 |
| 857 | 1926 Bldg | 32 | XRF | 6/10/98 | 0 | Room | 20 | Ceiling | | Peeling | Concrete | 0.02 |
| 858 | 1926 Bldg | 33 | XRF | 6/10/98 | 0 | Room | 20 | Door | Door | Solid | Metal | 0.42 |
| 859 | 1926 Bldg | 34 | XRF | 6/10/98 | 0 | Room | 20 | Door | Jamb | Cracked | Metal | 5.09 |
| 860 | 1926 Bldg | 35 | XRF | 6/10/98 | 0 | Room | 20 | Wall | Middle Wall | Solid | Concrete | 0.03 |
| 861 | 1926 Bldg | 36 | XRF | 6/10/98 | 0 | Room | 20 | Door | Door | Solid | Wood | 0.3 |
| 862 | 1926 Bldg | 37 | XRF | 6/10/98 | 0 | Room | 20 | Door | Casing | Solid | Wood | 0.44 |
| 863 | 1926 Bldg | 6 | XRF | 6/10/98 | 0 | Room | 50 | Wall | Middle Wall | Solid | Concrete | 0.06 |
| 864 | 1926 Bldg | 7 | XRF | 6/10/98 | 0 | Room | 50 | | Elec Pane | Solid | Metal | 0.08 |
| 865 | 1926 Bldg | 8 | XRF | 6/10/98 | 0 | Room | 50 | | Locker | Solid | Metal | 0.4 |
| 866 | 1926 Bldg | 9 | XRF | 6/10/98 | 0 | Room | 50 | Door | Door | Solid | Metal | 3.08 |
| 867 | 1926 Bldg | 10 | XRF | 6/10/98 | 0 | Room | 50 | Door | Casing | Solid | Metal | 2.6 |
| 868 | 1926 Bldg | 11 | XRF | 6/10/98 | 0 | Room | 50 | Wall | Middle Wall | Solid | Concrete | 0.08 |
| 869 | 1926 Bldg | 12 | XRF | 6/10/98 | 0 | Room | 50 | Cabinet | Shelf | Solid | Wood | 0.34 |
| 870 | 1926 Bldg | 13 | XRF | 6/10/98 | 0 | Room | 50 | Door | Door | Solid | Metal | 3.23 |
| 871 | 1926 Bldg | 14 | XRF | 6/10/98 | 0 | Room | 50 | Vent | Duct | Peeling | Metal | 4.41 |
| 872 | 1926 Bldg | 15 | XRF | 6/10/98 | 0 | Room | 50 | Floor | | Cracked | Concrete | 0.02 |
| 873 | 1926 Bldg | 16 | XRF | 6/10/98 | 0 | Room | 50 | Ceiling | | Solid | Concrete | 0.07 |
| 874 | 1926 Bldg | 17 | XRF | 6/10/98 | 0 | Room | 70 | Wall | Middle Wall | Solid | Concrete | 0.17 |
| 875 | 1926 Bldg | 18 | XRF | 6/10/98 | 0 | Room | 70 | Stairs | Hand rail | Cracked | Metal | 0.23 |
| 876 | 1926 Bldg | 19 | XRF | 6/10/98 | 0 | Room | 70 | Door | Door | Cracked | Metal | 0.54 |
| 877 | 1926 Bldg | 20 | XRF | 6/10/98 | 0 | Room | 70 | Door | Jamb | Solid | Metal | 1.22 |
| 878 | 1926 Bldg | 21 | XRF | 6/10/98 | 0 | Room | 70 | Door | Door | Solid | Metal | 2.09 |
| 879 | 1926 Bldg | 22 | XRF | 6/10/98 | 0 | Room | 70 | | Elec Pane | Solid | Metal | 0.2 |
| 880 | 1926 Bldg | 23 | XRF | 6/10/98 | 0 | Room | 70 | | Transom | Solid | Wood | 0.07 |
| 881 | 1926 Bldg | 24 | XRF | 6/10/98 | 0 | Room | 70 | Door | Door | Solid | Metal | 5.09 |
| 882 | 1926 Bldg | 25 | XRF | 6/10/98 | 0 | Room | 70 | Stairs | Rail cap | Cracked | Wood | 0.08 |
| 883 | 1926 Bldg | 26 | XRF | 6/10/98 | 0 | Room | 70 | Floor | | Cracked | Concrete | 0.03 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L |
|-----|-----------|----------|----------|---------|-------|------|-------|-----------|-------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 884 | 1926 Bldg | 27 | XRF | 6/10/98 | 0 | Room | 70 | Ceiling | | Solid | Concrete | 0.21 |
| 885 | 1926 Bldg | 67 | XRF | 6/10/98 | 1 | Room | 107 | Wall | Middle Wall | Solid | Concrete | 0.15 |
| 886 | 1926 Bldg | 68 | XRF | 6/10/98 | 1 | Room | 107 | Stairs | Hand rail | Solid | Wood | 0 |
| 887 | 1926 Bldg | 69 | XRF | 6/10/98 | 1 | Room | 107 | | Radiator | Solid | Metal | 0.1 |
| 888 | 1926 Bldg | 70 | XRF | 6/10/98 | 1 | Room | 107 | Stairs | Rail cap | Solid | Concrete | 0.24 |
| 889 | 1926 Bldg | 71 | XRF | 6/10/98 | 1 | Room | 107 | Ceiling | | Solid | Concrete | 0.12 |
| 890 | 1926 Bldg | 138 | XRF | 6/10/98 | 1 | Room | 107 | Wall | Middle Wall | Solid | Drywall | 0.03 |
| 891 | 1926 Bldg | 139 | XRF | 6/10/98 | 1 | Room | 107 | Wall | Baseboard | Solid | Wood | 0.39 |
| 892 | 1926 Bldg | 140 | XRF | 6/10/98 | 1 | Room | 107 | Door | Door | Solid | Wood | 0.05 |
| 893 | 1926 Bldg | 141 | XRF | 6/10/98 | 1 | Room | 107 | Door | Jamb | Solid | Wood | 0 |
| 894 | 1926 Bldg | 142 | XRF | 6/10/98 | 1 | Room | 107 | Wall | Wall | Solid | Plaster | 0.43 |
| 895 | 1926 Bldg | 143 | XRF | 6/10/98 | 1 | Room | 107 | Ceiling | | Solid | Plaster | 0.04 |
| 896 | 1926 Bldg | 28 | XRF | 6/10/98 | 0 | Room | 220 | Wall | Middle Wall | Solid | Concrete | 0.11 |
| 897 | 1926 Bldg | 29 | XRF | 6/10/98 | 0 | Room | 220 | Door | Door | Cracked | Wood | 0.02 |
| 898 | 1926 Bldg | 30 | XRF | 6/10/98 | 0 | Room | 220 | Door | Jamb | Solid | Wood | 0.01 |
| 899 | 1926 Bldg | 31 | XRF | 6/10/98 | 0 | Room | 220 | Stairs | Hand rail | Cracked | Metal | 0.77 |
| 900 | 1926 Bldg | 28 | XRF | 7/3/97 | 3 | Room | 308 | Radiator | Protector | Cracked | Wood | 0 |
| 901 | 1926 Bldg | 29 | XRF | 7/3/97 | 3 | Room | 308 | Ceiling | | Solid | Plaster | 2.22 |
| 902 | 1926 Bldg | 18 | XRF | 7/3/97 | 3 | Room | 308 | Wall | Middle Wall | Cracked | Plaster | 0.08 |
| 903 | 1926 Bldg | 19 | XRF | 7/3/97 | 3 | Room | 308 | Wall | Baseboard | Cracked | Wood | 0.34 |
| 904 | 1926 Bldg | 20 | XRF | 7/3/97 | 3 | Room | 308 | Floor | | Solid | Wood | 0 |
| 905 | 1926 Bldg | 21 | XRF | 7/3/97 | 3 | Room | 308 | Window | Casing | Solid | Wood | 0.03 |
| 906 | 1926 Bldg | 22 | XRF | 7/3/97 | 3 | Room | 308 | Window | Stool | Solid | Tile | 0.07 |
| 907 | 1926 Bldg | 23 | XRF | 7/3/97 | 3 | Room | 308 | Door | Door | Cracked | Wood | 0.09 |
| 908 | 1926 Bldg | 24 | XRF | 7/3/97 | 3 | Room | 308 | Door | Casing | Cracked | Wood | 0.04 |
| 909 | 1926 Bldg | 25 | XRF | 7/3/97 | 3 | Room | 308 | Blinds | | Cracked | Vinyl | 0.56 |
| 910 | 1926 Bldg | 26 | XRF | 7/3/97 | 3 | Room | 308 | Blinds | | Cracked | Vinyl | 0.58 |
| 911 | 1926 Bldg | 27 | XRF | 7/3/97 | 3 | Room | 308 | | Radiator | Solid | Metal | 2.31 |
| 912 | 1926 Bldg | 30 | XRF | 7/3/97 | 3 | Room | 308 | Closet | Wall | Solid | Plaster | 4.2 |
| 913 | 1926 Bldg | 31 | XRF | 7/3/97 | 3 | Room | 308 | Closet | Wall | Solid | Plaster | 0.17 |
| 914 | 1926 Bldg | 32 | XRF | 7/3/97 | 3 | Room | 308 | Closet | Floor | Cracked | Concrete | 0.19 |
| 915 | 1926 Bldg | 33 | XRF | 7/3/97 | 3 | Room | 308 | Closet | Shelf | Cracked | Wood | 0 |
| 916 | 1926 Bldg | 34 | XRF | 7/3/97 | 3 | Room | 308 | Closet | Casing | Cracked | Wood | 0.04 |
| 917 | 1926 Bldg | 35 | XRF | 7/3/97 | 3 | Room | 308 | Wall | Chair rail | Cracked | Wood | 0.02 |
| 918 | 1926 Bldg | 133 | XRF | 7/3/97 | 3 | Room | 312 | Wall | Wall | Solid | Plaster | 0.23 |
| 919 | 1926 Bldg | 134 | XRF | 7/3/97 | 3 | Room | 312 | Wall | Radiator | Solid | Metal | 0.12 |
| 920 | 1926 Bldg | 135 | XRF | 7/3/97 | 3 | Room | 312 | Window | Casing | Cracked | Wood | 0.05 |
| 921 | 1926 Bldg | 136 | XRF | 7/3/97 | 3 | Room | 312 | Window | Casing | Cracked | Wood | 0.04 |
| 922 | 1926 Bldg | 137 | XRF | 7/3/97 | 3 | Room | 312 | Door | Door | Cracked | Wood | 5.09 |
| 923 | 1926 Bldg | 138 | XRF | 7/3/97 | 3 | Room | 312 | Door | Casing | Cracked | Metal | 3.55 |
| 924 | 1926 Bldg | 139 | XRF | 7/3/97 | 3 | Room | 312 | Ceiling | | Solid | Plaster | 0.05 |
| 925 | 1926 Bldg | 49 | XRF | 6/10/98 | 1 | Room | 550 | Wall | Wall | Solid | Concrete | 5.09 |
| 926 | 1926 Bldg | 50 | XRF | 6/10/98 | 1 | Room | 550 | Wall | Wall | Solid | Concrete | 4.08 |
| 927 | 1926 Bldg | 51 | XRF | 6/10/98 | 1 | Room | 550 | Bookcase | Shelf | Solid | Wood | 2.11 |
| 928 | 1926 Bldg | 52 | XRF | 6/10/98 | 1 | Room | 550 | | Radiator | Solid | Metal | 2.47 |
| 929 | 1926 Bldg | 53 | XRF | 6/10/98 | 1 | Room | 550 | Wall | Wall Rgstr | Solid | Metal | 2.01 |
| 930 | 1926 Bldg | 54 | XRF | 6/10/98 | 1 | Room | 550 | Door | Door | Solid | Wood | 0.02 |
| 931 | 1926 Bldg | 55 | XRF | 6/10/98 | 1 | Room | 550 | Door | Jamb | Solid | Wood | 0.04 |
| 932 | 1926 Bldg | 56 | XRF | 6/10/98 | 1 | Room | 550 | Wall | Middle Wall | Solid | Plaster | 0.12 |
| 933 | 1926 Bldg | 57 | XRF | 6/10/98 | 1 | Room | 550 | Door | Door | Solid | Wood | 0 |
| 934 | 1926 Bldg | 58 | XRF | 6/10/98 | 1 | Room | 550 | | Locker | Solid | Metal | 1.2 |
| 935 | 1926 Bldg | 59 | XRF | 6/10/98 | 1 | Room | 550 | Ceiling | | Solid | Concrete | 5.09 |
| 936 | 1926 Bldg | 72 | XRF | 6/10/98 | 1 | Room | 551 | Door | Door | Solid | Wood | 0.04 |
| 937 | 1926 Bldg | 73 | XRF | 6/10/98 | 1 | Room | 551 | Door | Jamb | Solid | Wood | 0.03 |
| 938 | 1926 Bldg | 74 | XRF | 6/10/98 | 1 | Room | 551 | Wall | Middle Wall | Solid | Plaster | 0.12 |
| 939 | 1926 Bldg | 75 | XRF | 6/10/98 | 1 | Room | 551 | Wall | Baseboard | Solid | Wood | 4.49 |
| 940 | 1926 Bldg | 76 | XRF | 6/10/98 | 1 | Room | 551 | Wall | Wall | Solid | Plaster | 5.09 |
| 941 | 1926 Bldg | 77 | XRF | 6/10/98 | 1 | Room | 551 | Window | Casing | Solid | Wood | 0.01 |
| 942 | 1926 Bldg | 78 | XRF | 6/10/98 | 1 | Room | 551 | Cabinet | Door | Solid | Wood | 0.11 |
| 943 | 1926 Bldg | 79 | XRF | 6/10/98 | 1 | Room | 551 | Ceiling | | Solid | Plaster | 5.09 |
| 944 | 1926 Bldg | 70 | XRF | 6/9/98 | 2 | Room | 2071 | Wall | Wall | Solid | Plaster | 4.06 |
| 945 | 1926 Bldg | 71 | XRF | 6/9/98 | 2 | Room | 2071 | Door | Jamb | Cracked | Wood | 0.02 |
| 946 | 1926 Bldg | 72 | XRF | 6/9/98 | 2 | Room | 2071 | Wall | Middle Wall | Solid | Plaster | 0.84 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | |
|------|-----------|----------|----------|---------|-------|-----------|-------|------------|------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 947 | 1926 Bldg | 187 | XRF | 6/9/98 | 2 | Room | 2252 | Door | Door | Solid | Wood | 5.09 |
| 948 | 1926 Bldg | 188 | XRF | 6/9/98 | 2 | Room | 2252 | Door | Casing | Solid | Wood | 3.24 |
| 949 | 1926 Bldg | 189 | XRF | 6/9/98 | 2 | Room | 2252 | Wall | Midle Wall | Solid | Concrete | 0.06 |
| 950 | 1926 Bldg | 190 | XRF | 6/9/98 | 2 | Room | 2252 | Ceiling | | Solid | Plaster | 0.05 |
| 951 | 1926 Bldg | 31 | XRF | 6/11/98 | 1 | Stairwell | 1000 | Door | Door | Solid | Wood | 0.01 |
| 952 | 1926 Bldg | 32 | XRF | 6/11/98 | 1 | Stairwell | 1000 | Door | Casing-Rh | Solid | Wood | 0.02 |
| 953 | 1926 Bldg | 33 | XRF | 6/11/98 | 1 | Stairwell | 1000 | Wall | Wall-Lwr | Solid | Concrete | >>5.0 |
| 954 | 1926 Bldg | 34 | XRF | 6/11/98 | 1 | Stairwell | 1000 | Stairs | Hand rail | Solid | Wood | 0.04 |
| 955 | 1926 Bldg | 35 | XRF | 6/11/98 | 1 | Stairwell | 1000 | Wall | Wall-Upr | Solid | Concrete | >>5.0 |
| 956 | 1926 Bldg | 36 | XRF | 6/11/98 | 1 | Stairwell | 1000 | | Radiator | Peeling | Metal | 0.57 |
| 957 | 1926 Bldg | 37 | XRF | 6/11/98 | 1 | Stairwell | 1000 | Ceiling | | Solid | Plaster | >>5.0 |
| 958 | 1926 Bldg | 38 | XRF | 6/11/98 | 1 | Stairwell | 1005 | Wall | Wall-Upr | Solid | Plaster | >>5.0 |
| 959 | 1926 Bldg | 39 | XRF | 6/11/98 | 1 | Stairwell | 1005 | Door | Door | Solid | Wood | 0 |
| 960 | 1926 Bldg | 40 | XRF | 6/11/98 | 1 | Stairwell | 1005 | Door | Casing-Lft | Solid | Wood | 0.03 |
| 961 | 1926 Bldg | 41 | XRF | 6/11/98 | 1 | Stairwell | 1005 | Wall | Wall-Upr | Solid | Concrete | >>5.0 |
| 962 | 1926 Bldg | 42 | XRF | 6/11/98 | 1 | Stairwell | 1005 | | Radiator | Peeling | Metal | 1.51 |
| 963 | 1926 Bldg | 43 | XRF | 6/11/98 | 1 | Stairwell | 1005 | Wall | Midle Wall | Solid | Plaster | >0.34 |
| 964 | 1926 Bldg | 44 | XRF | 6/11/98 | 1 | Stairwell | 1005 | Wall | Wall-Lwr | Solid | Concrete | >>5.0 |
| 965 | 1926 Bldg | 45 | XRF | 6/11/98 | 1 | Stairwell | 1005 | Stairs | Hand rail | Solid | Wood | 0 |
| 966 | 1964 Bldg | 46 | XRF | 6/11/98 | 1 | Classroom | 1240 | Wall | Midle Wall | Solid | Concrete | 0.39 |
| 967 | 1964 Bldg | 47 | XRF | 6/11/98 | 1 | Classroom | 1240 | Door | Door | Solid | Wood | 0 |
| 968 | 1964 Bldg | 48 | XRF | 6/11/98 | 1 | Classroom | 1240 | Door | Jamb-Lft | Solid | Metal | 0.14 |
| 969 | 1964 Bldg | 49 | XRF | 6/11/98 | 1 | Classroom | 1240 | Window | Casing-Rh | Solid | Metal | 0.14 |
| 970 | 1964 Bldg | 50 | XRF | 6/11/98 | 1 | Classroom | 1240 | Wall | Wall-Lwr | Solid | Concrete | 0.08 |
| 971 | 1964 Bldg | 51 | XRF | 6/11/98 | 1 | Classroom | 1240 | Wall | Wall-Upr | Solid | Plaster | >0.48 |
| 972 | 1964 Bldg | 52 | XRF | 6/11/98 | 1 | Classroom | 1240 | | Radiator | Solid | Metal | 0 |
| 973 | 1964 Bldg | 53 | XRF | 6/11/98 | 1 | Classroom | 1240 | Cabinet | Door-Out | Solid | Wood | 0 |
| 974 | 1964 Bldg | 54 | XRF | 6/11/98 | 1 | Classroom | 1240 | Ceiling | | Solid | Plaster | 0.09 |
| 975 | 1964 Bldg | 55 | XRF | 6/11/98 | 1 | Classroom | 1260 | Wall | Wall-Upr | Solid | Concrete | 0.01 |
| 976 | 1964 Bldg | 56 | XRF | 6/11/98 | 1 | Classroom | 1260 | Door | Door | Solid | Wood | 0 |
| 977 | 1964 Bldg | 57 | XRF | 6/11/98 | 1 | Classroom | 1260 | Door | Jamb-Lft | Solid | Wood | 0.17 |
| 978 | 1964 Bldg | 58 | XRF | 6/11/98 | 1 | Classroom | 1260 | Wall | Midle Wall | Solid | Concrete | 0.03 |
| 979 | 1964 Bldg | 59 | XRF | 6/11/98 | 1 | Classroom | 1260 | | Elec Pane | Solid | Metal | 0 |
| 980 | 1964 Bldg | 60 | XRF | 6/11/98 | 1 | Classroom | 1263 | Wall | Midle Wall | Solid | Concrete | 0 |
| 981 | 1964 Bldg | 61 | XRF | 6/11/98 | 1 | Classroom | 1263 | Window | Casing-Rh | Solid | Metal | 0.29 |
| 982 | 1964 Bldg | 62 | XRF | 6/11/98 | 1 | Classroom | 1263 | Wall | Wall-Upr | Solid | Concrete | 0.33 |
| 983 | 1964 Bldg | 63 | XRF | 6/11/98 | 1 | Classroom | 1263 | Cabinet | Door-Out | Solid | Wood | 0.02 |
| 984 | 1964 Bldg | 64 | XRF | 6/11/98 | 1 | Classroom | 1280 | Wall | Midle Wall | Solid | Wood | 0 |
| 985 | 1964 Bldg | 65 | XRF | 6/11/98 | 1 | Classroom | 1280 | Wall | Midle Wall | Solid | Concrete | 0.05 |
| 986 | 1964 Bldg | 66 | XRF | 6/11/98 | 1 | Classroom | 1280 | Cabinet | Door-Out | Solid | Wood | 0.03 |
| 987 | 1964 Bldg | 67 | XRF | 6/11/98 | 1 | Classroom | 1280 | Door | Door | Solid | Wood | 0 |
| 988 | 1964 Bldg | 68 | XRF | 6/11/98 | 1 | Classroom | 1280 | Door | Casing-Lft | Solid | Metal | 0.24 |
| 989 | 1964 Bldg | 69 | XRF | 6/11/98 | 1 | Classroom | 1280 | Door | Door | Solid | Metal | 0.56 |
| 990 | 1964 Bldg | 70 | XRF | 6/11/98 | 1 | Classroom | 1280 | Wall | Wall-Upr | Solid | Concrete | 0.04 |
| 991 | 1964 Bldg | 25 | XRF | 6/22/98 | 1 | Classroom | 1290 | Wall | Midle Wall | Solid | Concrete | 0.02 |
| 992 | 1964 Bldg | 26 | XRF | 6/22/98 | 1 | Classroom | 1290 | Door | Door | Solid | Wood | 0 |
| 993 | 1964 Bldg | 27 | XRF | 6/22/98 | 1 | Classroom | 1290 | Door | Jamb | Solid | Metal | 0.12 |
| 994 | 1964 Bldg | 28 | XRF | 6/22/98 | 1 | Classroom | 1290 | Cabinet | Door | Solid | Wood | 0.01 |
| 995 | 1964 Bldg | 29 | XRF | 6/22/98 | 1 | Classroom | 1290 | Wall | Midle Wall | Solid | Drywall | 0 |
| 996 | 1964 Bldg | 30 | XRF | 6/22/98 | 1 | Classroom | 1290 | Wall | Baseboar | Solid | Tile | 1.5 |
| 997 | 1964 Bldg | 17 | XRF | 6/22/98 | 1 | Classroom | 1291 | Wall | Midle Wall | Solid | Drywall | 0 |
| 998 | 1964 Bldg | 18 | XRF | 6/22/98 | 1 | Classroom | 1291 | Door | Door | Solid | Wood | 0 |
| 999 | 1964 Bldg | 19 | XRF | 6/22/98 | 1 | Classroom | 1291 | Door | Casing | Solid | Wood | 0 |
| 1000 | 1964 Bldg | 20 | XRF | 6/22/98 | 1 | Classroom | 1291 | Wall | Midle Wall | Solid | Concrete | 0.03 |
| 1001 | 1964 Bldg | 21 | XRF | 6/22/98 | 1 | Classroom | 1291 | Door | Door | Solid | Metal | 0.45 |
| 1002 | 1964 Bldg | 22 | XRF | 6/22/98 | 1 | Classroom | 1291 | Door | Jamb | Solid | Metal | 0.31 |
| 1003 | 1964 Bldg | 23 | XRF | 6/22/98 | 1 | Classroom | 1291 | Wall | Baseboar | Solid | Tile | 2.04 |
| 1004 | 1964 Bldg | 24 | XRF | 6/22/98 | 1 | Classroom | 1291 | Chalkboard | Rail | Solid | Wood | 0.01 |
| 1005 | 1964 Bldg | 103 | XRF | 6/11/98 | 2 | Classroom | 2140 | Wall | Wall-Upr | Solid | Concrete | 0.03 |
| 1006 | 1964 Bldg | 104 | XRF | 6/11/98 | 2 | Classroom | 2140 | Wall | Midle Wall | Solid | | 0.07 |
| 1007 | 1964 Bldg | 105 | XRF | 6/11/98 | 2 | Classroom | 2140 | Cabinet | Door-Out | Solid | Wood | 0 |
| 1008 | 1964 Bldg | 106 | XRF | 6/11/98 | 2 | Classroom | 2140 | Door | Door | Solid | Wood | 0 |
| 1009 | 1964 Bldg | 107 | XRF | 6/11/98 | 2 | Classroom | 2140 | Door | Jamb-Rht | Solid | Metal | 0.17 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| 3 | A | B | C | D | E | F | G | H | I | J | K | L |
|------|-----------|----------|----------|---------|-------|-----------|-------|-----------|-------------|-----------|-----------|--------|
| | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 1010 | 1964 Bldg | 108 | XRF | 6/11/98 | 2 | Classroom | 2140 | Radiator | Solid | Metal | | 0 |
| 1011 | 1964 Bldg | 109 | XRF | 6/11/98 | 2 | Classroom | 2150 | Wall | Middle Wall | Solid | Concrete | 0.04 |
| 1012 | 1964 Bldg | 110 | XRF | 6/11/98 | 2 | Classroom | 2150 | Door | Door | Solid | Wood | 0 |
| 1013 | 1964 Bldg | 111 | XRF | 6/11/98 | 2 | Classroom | 2150 | Door | Door | Solid | Metal | 0.15 |
| 1014 | 1964 Bldg | 112 | XRF | 6/11/98 | 2 | Classroom | 2150 | Wall | Wall-Upr | Solid | Concrete | 0.04 |
| 1015 | 1964 Bldg | 113 | XRF | 6/11/98 | 2 | Classroom | 2150 | Window | Casing-Rh | Solid | Metal | 0.31 |
| 1016 | 1964 Bldg | 114 | XRF | 6/11/98 | 2 | Classroom | 2150 | Wall | Wall-Upr | Solid | Concrete | 0.41 |
| 1017 | 1964 Bldg | 115 | XRF | 6/11/98 | 2 | Classroom | 2150 | | Radiator | Solid | Metal | 0 |
| 1018 | 1964 Bldg | 116 | XRF | 6/11/98 | 2 | Classroom | 2150 | Radiator | Protector | Solid | Wood | 0 |
| 1019 | 1964 Bldg | 117 | XRF | 6/11/98 | 2 | Classroom | 2150 | Wall-3 | Middle Wall | Solid | Drywall | 0 |
| 1020 | 1964 Bldg | 43 | XRF | 6/22/98 | 2 | Classroom | 2180 | Wall | Wall | Solid | Concrete | 0.05 |
| 1021 | 1964 Bldg | 44 | XRF | 6/22/98 | 2 | Classroom | 2180 | Wall | Wall | Solid | Concrete | 0.07 |
| 1022 | 1964 Bldg | 45 | XRF | 6/22/98 | 2 | Classroom | 2180 | Door | Door | Solid | Wood | 0 |
| 1023 | 1964 Bldg | 46 | XRF | 6/22/98 | 2 | Classroom | 2180 | Door | Casing | Solid | Metal | 0.28 |
| 1024 | 1964 Bldg | 47 | XRF | 6/22/98 | 2 | Classroom | 2180 | Window | Casing | Solid | Metal | 0.35 |
| 1025 | 1964 Bldg | 48 | XRF | 6/22/98 | 2 | Classroom | 2180 | | Radiator | Solid | Metal | 0 |
| 1026 | 1964 Bldg | 49 | XRF | 6/22/98 | 2 | Classroom | 2180 | Cabinet | Door | Solid | Wood | 0 |
| 1027 | 1964 Bldg | 38 | XRF | 6/22/98 | 2 | Classroom | 2190 | Cabinet | Door | Solid | Wood | 0.01 |
| 1028 | 1964 Bldg | 39 | XRF | 6/22/98 | 2 | Classroom | 2190 | Wall | Wall | Solid | Concrete | 0.29 |
| 1029 | 1964 Bldg | 40 | XRF | 6/22/98 | 2 | Classroom | 2190 | | Radiator | Solid | Metal | 0.03 |
| 1030 | 1964 Bldg | 41 | XRF | 6/22/98 | 2 | Classroom | 2190 | Window | Casing | Solid | Metal | 0.28 |
| 1031 | 1964 Bldg | 42 | XRF | 6/22/98 | 2 | Classroom | 2190 | Wall | Middle Wall | Solid | Concrete | 0.06 |
| 1032 | 1964 Bldg | 91 | XRF | 6/11/98 | 2 | Classroom | 2210 | Door | Door | Solid | Wood | 0 |
| 1033 | 1964 Bldg | 92 | XRF | 6/11/98 | 2 | Classroom | 2210 | Door | Jamb-Rht | Solid | Metal | 0.13 |
| 1034 | 1964 Bldg | 93 | XRF | 6/11/98 | 2 | Classroom | 2210 | Cabinet | Door-Out | Solid | Wood | 0.01 |
| 1035 | 1964 Bldg | 94 | XRF | 6/11/98 | 2 | Classroom | 2210 | Wall | Middle Wall | Solid | Concrete | 0.03 |
| 1036 | 1964 Bldg | 95 | XRF | 6/11/98 | 2 | Classroom | 2210 | | Radiator | Solid | Metal | 0 |
| 1037 | 1964 Bldg | 96 | XRF | 6/11/98 | 2 | Classroom | 2210 | Wall | Wall-Upr | Solid | Concrete | 0.8 |
| 1038 | 1964 Bldg | 80 | XRF | 6/11/98 | 1 | Hall | 1340 | Door | Door | Solid | Metal | 0.6 |
| 1039 | 1964 Bldg | 81 | XRF | 6/11/98 | 1 | Hall | 1340 | Door | Jamb-Lft | Solid | Metal | 0.27 |
| 1040 | 1964 Bldg | 82 | XRF | 6/11/98 | 1 | Hall | 1340 | Wall | Middle Wall | Solid | Concrete | 0.04 |
| 1041 | 1964 Bldg | 83 | XRF | 6/11/98 | 1 | Hall | 1340 | Wall | Middle Wall | Solid | Concrete | 0.03 |
| 1042 | 1964 Bldg | 84 | XRF | 6/11/98 | 1 | Hall | 1340 | | Locker | Solid | Metal | 0 |
| 1043 | 1964 Bldg | 85 | XRF | 6/11/98 | 1 | Hall | 1340 | | Radiator | Solid | Metal | 0.03 |
| 1044 | 1964 Bldg | 86 | XRF | 6/11/98 | 1 | Hall | 1340 | | Radiator | Solid | Metal | 0 |
| 1045 | 1964 Bldg | 87 | XRF | 6/11/98 | 1 | Hall | 1340 | Wall | Middle Wall | Solid | Concrete | 0 |
| 1046 | 1964 Bldg | 88 | XRF | 6/11/98 | 1 | Hall | 1340 | Ceiling | | Solid | Plaster | 0.01 |
| 1047 | 1964 Bldg | 89 | XRF | 6/11/98 | 1 | Hall | 1340 | Door | Door | Solid | Metal | 0.01 |
| 1048 | 1964 Bldg | 90 | XRF | 6/11/98 | 1 | Hall | 1340 | Window | Casing-Rh | Solid | Metal | >0.27 |
| 1049 | 1964 Bldg | 65 | XRF | 6/22/98 | 2 | Hall | 2240 | Wall | Wall | Solid | Plaster | 0.32 |
| 1050 | 1964 Bldg | 66 | XRF | 6/22/98 | 2 | Hall | 2240 | Door | Door | Solid | Metal | 0.84 |
| 1051 | 1964 Bldg | 67 | XRF | 6/22/98 | 2 | Hall | 2240 | Door | Jamb | Solid | Metal | 0.36 |
| 1052 | 1964 Bldg | 68 | XRF | 6/22/98 | 2 | Hall | 2240 | Stairs | Baseboar | Solid | Metal | 0.17 |
| 1053 | 1964 Bldg | 69 | XRF | 6/22/98 | 2 | Hall | 2240 | | Radiator | Solid | Metal | 0.01 |
| 1054 | 1964 Bldg | 70 | XRF | 6/22/98 | 2 | Hall | 2240 | | Locker | Solid | Metal | 0.86 |
| 1055 | 1964 Bldg | 71 | XRF | 6/22/98 | 2 | Hall | 2240 | Door | Door | Solid | Wood | 0 |
| 1056 | 1964 Bldg | 72 | XRF | 6/22/98 | 2 | Hall | 2240 | Door | Casing | Solid | Metal | 0.22 |
| 1057 | 1964 Bldg | 73 | XRF | 6/22/98 | 2 | Hall | 2240 | | Elec Pane | Solid | Metal | 0.01 |
| 1058 | 1964 Bldg | 74 | XRF | 6/22/98 | 2 | Hall | 2240 | | Locker | Solid | Metal | 0.02 |
| 1059 | 1964 Bldg | 75 | XRF | 6/22/98 | 2 | Hall | 2240 | Wall | Middle Wall | Solid | Concrete | 0.01 |
| 1060 | 1964 Bldg | 76 | XRF | 6/22/98 | 2 | Hall | 2240 | Stairs | Hand rail | Solid | Metal | 0 |
| 1061 | 1964 Bldg | 6 | XRF | 6/22/98 | 1 | Other | 1 | Door | Door | Solid | Wood | 0 |
| 1062 | 1964 Bldg | 7 | XRF | 6/22/98 | 1 | Other | 1 | Door | Casing | Solid | Metal | 0.02 |
| 1063 | 1964 Bldg | 8 | XRF | 6/22/98 | 1 | Other | 1 | Wall | Wall Rgstr | Peeling | Metal | 0.05 |
| 1064 | 1964 Bldg | 9 | XRF | 6/22/98 | 1 | Other | 1 | Door | Door | Solid | Metal | 0.02 |
| 1065 | 1964 Bldg | 10 | XRF | 6/22/98 | 1 | Other | 1 | Door | Casing | Solid | Metal | 0.05 |
| 1066 | 1964 Bldg | 11 | XRF | 6/22/98 | 1 | Other | 1 | Door | Door | Solid | Metal | 0.02 |
| 1067 | 1964 Bldg | 12 | XRF | 6/22/98 | 1 | Other | 1 | Door | Casing | Solid | Metal | 0.04 |
| 1068 | 1964 Bldg | 13 | XRF | 6/22/98 | 1 | Other | 1 | Door | Casing | Solid | Metal | 0.05 |
| 1069 | 1964 Bldg | 14 | XRF | 6/22/98 | 1 | Other | 1 | Wall | Middle Wall | Solid | Wood | 0 |
| 1070 | 1964 Bldg | 15 | XRF | 6/22/98 | 1 | Other | 1 | | Elec Pane | Solid | Metal | 0.07 |
| 1071 | 1964 Bldg | 16 | XRF | 6/22/98 | 1 | Other | 1 | | Locker | Solid | Metal | 0.03 |
| 1072 | 1964 Bldg | 88 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Door | Solid | Metal | 0.04 |

Saint Paul Public Schools
 Monroe Community School
 Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L |
|------|-----------|----------|----------|---------|-------|---------|-------|-----------|------------|-----------|-----------|--------|
| 3 | Site | Sample # | Analysis | Date | Floor | Area | Room# | Component | Feature | Condition | Substrate | Result |
| 1073 | 1964 Bldg | 89 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Door | Solid | | 0.05 |
| 1074 | 1964 Bldg | 90 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Door | Cracked | Metal | 0.02 |
| 1075 | 1964 Bldg | 91 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Casing | Solid | Metal | 0.03 |
| 1076 | 1964 Bldg | 93 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Casing | Solid | Metal | 0.03 |
| 1077 | 1964 Bldg | 94 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Door | Peeling | Metal | 0.02 |
| 1078 | 1964 Bldg | 95 | XRF | 6/22/98 | 1 | Outside | 0 | Door | Door | Solid | Metal | 0.02 |
| 1079 | 1964 Bldg | 96 | XRF | 6/22/98 | 1 | Outside | 0 | Window | Sill | Solid | Metal | 0.02 |
| 1080 | 1964 Bldg | 92 | XRF | 6/22/98 | 1 | Outside | 1 | Door | Door | Solid | Metal | 0.03 |
| 1081 | 1964 Bldg | 31 | XRF | 6/22/98 | 1 | Room | 1300 | Wall | Baseboard | Solid | | 0.52 |
| 1082 | 1964 Bldg | 32 | XRF | 6/22/98 | 1 | Room | 1300 | Wall | Wall | Solid | Concrete | 0.54 |
| 1083 | 1964 Bldg | 33 | XRF | 6/22/98 | 1 | Room | 1300 | Door | Jamb | Solid | Metal | 0.14 |
| 1084 | 1964 Bldg | 34 | XRF | 6/22/98 | 1 | Room | 1300 | Door | Door | Solid | Wood | 0 |
| 1085 | 1964 Bldg | 71 | XRF | 6/11/98 | 1 | Room | 1310 | Wall | Midle Wall | Solid | Concrete | 0.42 |
| 1086 | 1964 Bldg | 72 | XRF | 6/11/98 | 1 | Room | 1310 | | Radiator | Solid | Metal | >0.03 |
| 1087 | 1964 Bldg | 73 | XRF | 6/11/98 | 1 | Room | 1310 | Door | Door | Solid | Wood | 0 |
| 1088 | 1964 Bldg | 74 | XRF | 6/11/98 | 1 | Room | 1310 | Door | Jamb-Lft | Solid | Metal | 0.13 |
| 1089 | 1964 Bldg | 75 | XRF | 6/11/98 | 1 | Room | 1320 | Wall | Midle Wall | Solid | Concrete | 0.04 |
| 1090 | 1964 Bldg | 76 | XRF | 6/11/98 | 1 | Room | 1320 | Wall | Bthrm Sill | Solid | Metal | 0.34 |
| 1091 | 1964 Bldg | 77 | XRF | 6/11/98 | 1 | Room | 1320 | Door | Door | Solid | Wood | 0 |
| 1092 | 1964 Bldg | 78 | XRF | 6/11/98 | 1 | Room | 1320 | Door | Jamb-Lft | Solid | Metal | 0.18 |
| 1093 | 1964 Bldg | 79 | XRF | 6/11/98 | 1 | Room | 1320 | Ceiling | | Solid | Plaster | 0.06 |
| 1094 | 1964 Bldg | 50 | XRF | 6/22/98 | 2 | Room | 2120 | Wall | Midle Wall | Solid | Plaster | 0.46 |
| 1095 | 1964 Bldg | 51 | XRF | 6/22/98 | 2 | Room | 2120 | Door | Door | Solid | Wood | 0 |
| 1096 | 1964 Bldg | 52 | XRF | 6/22/98 | 2 | Room | 2120 | Door | Casing | Solid | Metal | 0.14 |
| 1097 | 1964 Bldg | 53 | XRF | 6/22/98 | 2 | Room | 2120 | Cabinet | Outside | Solid | Wood | 0 |
| 1098 | 1964 Bldg | 54 | XRF | 6/22/98 | 2 | Room | 2120 | Wall | Wall | Solid | Concrete | 0.58 |
| 1099 | 1964 Bldg | 55 | XRF | 6/22/98 | 2 | Room | 2120 | Window | Casing | Solid | Metal | 0.17 |
| 1100 | 1964 Bldg | 56 | XRF | 6/22/98 | 2 | Room | 2120 | Cabinet | Door | Solid | Wood | 0 |
| 1101 | 1964 Bldg | 57 | XRF | 6/22/98 | 2 | Room | 2120 | Wall | Wall | Solid | Concrete | 0.03 |
| 1102 | 1964 Bldg | 58 | XRF | 6/22/98 | 2 | Room | 2120 | Wall | Midle Wall | Solid | Concrete | 0.03 |
| 1103 | 1964 Bldg | 59 | XRF | 6/22/98 | 2 | Room | 2120 | Wall | Midle Wall | Solid | Concrete | 0.05 |
| 1104 | 1964 Bldg | 60 | XRF | 6/22/98 | 2 | Room | 2120 | | Radiator | Solid | Metal | 0 |
| 1105 | 1964 Bldg | 61 | XRF | 6/22/98 | 2 | Room | 2120 | Wall | Wall | Solid | Concrete | 0.05 |
| 1106 | 1964 Bldg | 62 | XRF | 6/22/98 | 2 | Room | 2120 | | Radiator | Solid | Metal | 0.02 |
| 1107 | 1964 Bldg | 63 | XRF | 6/22/98 | 2 | Room | 2120 | Wall | Baseboard | Solid | Tile | 2.2 |
| 1108 | 1964 Bldg | 64 | XRF | 6/22/98 | 2 | Room | 2120 | Ceiling | | Solid | Plaster | 0.01 |
| 1109 | 1964 Bldg | 35 | XRF | 6/22/98 | 2 | Room | 2190 | Wall | Midle Wall | Solid | Concrete | 0.03 |
| 1110 | 1964 Bldg | 36 | XRF | 6/22/98 | 2 | Room | 2190 | Door | Door | Solid | Wood | 0 |
| 1111 | 1964 Bldg | 37 | XRF | 6/22/98 | 2 | Room | 2190 | Door | Casing | Solid | Metal | 0.18 |
| 1112 | 1964 Bldg | 97 | XRF | 6/11/98 | 2 | Room | 2220 | Wall | Midle Wall | Solid | Concrete | 0.03 |
| 1113 | 1964 Bldg | 98 | XRF | 6/11/98 | 2 | Room | 2220 | Wall | Midle Wall | Solid | Concrete | 0.06 |
| 1114 | 1964 Bldg | 99 | XRF | 6/11/98 | 2 | Room | 2220 | Stairs | Baseboard | Solid | Metal | 0.07 |
| 1115 | 1964 Bldg | 100 | XRF | 6/11/98 | 2 | Room | 2220 | Door | Door | Solid | Wood | 0 |
| 1116 | 1964 Bldg | 101 | XRF | 6/11/98 | 2 | Room | 2220 | Door | Jamb-Lft | Solid | Metal | 0.22 |
| 1117 | 1964 Bldg | 102 | XRF | 6/11/98 | 2 | Room | 2220 | Ceiling | | Solid | Plaster | 0.12 |
| 1118 | 1978 Bldg | 97 | XRF | 6/9/98 | 2 | Library | 1 | Wall | Midle Wall | Solid | Plaster | 0.11 |
| 1119 | 1978 Bldg | 98 | XRF | 6/9/98 | 2 | Library | 1 | Bookcase | Shelf | Solid | Wood | 0 |
| 1120 | 1978 Bldg | 99 | XRF | 6/9/98 | 2 | Library | 1 | Window | Mullion | Solid | Wood | 0 |
| 1121 | 1978 Bldg | 100 | XRF | 6/9/98 | 2 | Library | 1 | | Radiator | Solid | Metal | 0 |
| 1122 | 1978 Bldg | 101 | XRF | 6/9/98 | 2 | Library | 1 | Wall | Wall Rgstr | Solid | Metal | 0.22 |
| 1123 | 1978 Bldg | 102 | XRF | 6/9/98 | 2 | Library | 1 | Wall | Midle Wall | Solid | Plaster | 0.28 |
| 1124 | 1978 Bldg | 103 | XRF | 6/9/98 | 2 | Library | 1 | Window | Casing | Solid | Metal | 0 |
| 1125 | 1978 Bldg | 104 | XRF | 6/9/98 | 2 | Library | 1 | Wall | Midle Wall | Solid | Plaster | 0.37 |
| 1126 | 1978 Bldg | 105 | XRF | 6/9/98 | 2 | Library | 1 | Door | Door | Solid | Wood | 0.07 |
| 1127 | 1978 Bldg | 106 | XRF | 6/9/98 | 2 | Library | 1 | Door | Jamb | Solid | Wood | 0.02 |
| 1128 | 1978 Bldg | 107 | XRF | 6/9/98 | 2 | Library | 1 | Wall | Wall | Solid | Plaster | 5.09 |
| 1129 | 1978 Bldg | 108 | XRF | 6/9/98 | 2 | Library | 1 | Wall | Midle Wall | Solid | Plaster | 0.09 |
| 1130 | 1978 Bldg | 109 | XRF | 6/9/98 | 2 | Library | 1 | Bookcase | Shelf | Solid | Wood | 0.03 |
| 1131 | 1978 Bldg | 110 | XRF | 6/9/98 | 2 | Library | 1 | Wall | Wall | Solid | Plaster | 0.18 |
| 1132 | 1978 Bldg | 111 | XRF | 6/9/98 | 2 | Library | 1 | Wall | Wall | Solid | Plaster | 0.39 |

APPENDIX B INSPECTORS

**Greg A. Myers
MDH Lead Inspector # 116**

**William Sloan
MDH Lead Inspector # 476**