


Midwest
Environmental
Consulting, L.L.C.

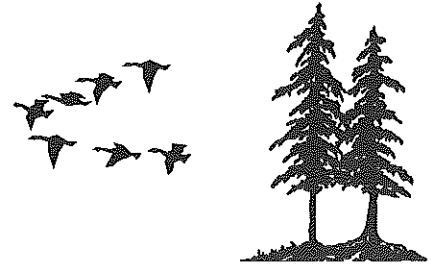

♻️ Printed on Recycled Paper

**Harding High School
Saint Paul Public Schools**

Lead-Based Paint Inspection

**Inspection Dates: 5/20/97, 5/21/97, 5/22/97, 5/24/97, 5/27/97,
5/28/97, 5/29/97, 5/31/97, 6/1/97**

submitted to:

Saint Paul Public Schools

MEC Project # 62/0197AG

38894 Llama Street NW * Dalbo, Minnesota 55017 * (612) 689-3612
fax (612) 689-5209

INTRODUCTION

At the request of Saint Paul Public Schools Environmental Safety Department, Midwest Environmental Consulting, L.L.C. (MEC), conducted a lead-based paint inspection at Harding High School, 1540 East Sixth Street, St. Paul, MN. The purpose of this inspection was to identify lead-based painted, varnished, or otherwise coated building components on the interior and exterior of the school building.

The inspection protocol incorporated applicable portions of the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-based Paint Hazards in Housing* (HUD Guidelines, June 1995) and OSHA 1926.62 requirements (Lead in Construction). The HUD guidelines are formulated to guide agencies in conducting random sampling of the interiors and exteriors of dwellings and common areas in public housing. The OSHA requirement is designed to minimize worker exposure when working with material containing lead.

Confirmatory testing was conducted when inconclusive XRF results were encountered. Inconclusive refers to XRF readings less than 0.2 mg/cm² (milligrams per square centimeter). Inconclusive results were confirmed with laboratory analysis of paint chip samples (Appendix B). This report contains a list of such results.

The United States Environmental Protection Agency defines "lead-based paint" as a paint or other surface coating that contains lead equal to or in excess of 1.0 milligrams per square centimeter when analyzed by XRF or more than 0.5% by weight (5000 parts per million) by laboratory analysis of a bulk sample.

Minnesota Department of Labor and Industry (MN OSHA) adopted the EPA lead levels for the purpose of enforcing OSHA 1926.62 federal regulations. Detection of lead in dried paint film by XRF is a dependable indicator of levels of lead and is accepted by MN OSHA.

For this Saint Paul Public Schools Lead Inspection, all building components were tested on site using a Niton XL® X-ray Fluorescence Spectrum Analyzer⁽¹⁾. Building components included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases. Only painted or glazed surfaces or surfaces which were varnished were tested. Suspended ceilings, structural steel, and corrugated decking were not included in the inspection. Neither anodized (e.g., window sashes) nor plastic (e.g., vinyl baseboard and vinyl mini-blinds) were included in the scope of this inspection.

⁽¹⁾ This is a portable hand held machine that can analyze building components instantly for lead concentrations.

Each building was divided into unique sites based on the year of construction or renovation. Portable classrooms, playgrounds, and other detached buildings were automatically designated as a unique site. Each site was inspected independently assuming differences in painting history and construction characteristics.

SITE DESCRIPTION AND BUILDING HISTORY

According to information provided to MEC by Saint Paul Public Schools, Harding High School was constructed in essentially four phases. The initial phase includes the 205,805 square-foot older section of the building and dates from 1963. The second phase is a 5,164 square foot addition dating from 1983. The third phase is a 16,446 square foot addition from 1993, and the fourth addition is 36,770 square feet and dates from 1995.

The 1983 and 1993 additions were not inspected because of the ages.

All room and area designations used in this report are depicted on sampling maps found in Appendix A.

XRF SAMPLE RESULTS TABLE

The results of all samples analyzed are listed in the table at the end of this section. The following is a description of the column headings:

Site	Each school is divided into sites based on their unique construction characteristics. Each site has a unique date of construction or major renovation.
Sample #	Each sample taken was given a unique number to identify the type and location of the sample. The sampling date is an integral part of the sample number.
Analysis	This defines the type of analysis which can be categorized into two types: 1) XRF: This is an on-site analysis using a hand held Niton XL® X-ray Fluorescence Spectrum Analyzer; 2) Bulk or Chip: This is a bulk sample where paint is removed from the substrate and sent to a laboratory for analysis;
Floor	This is the level of the building in which the area tested was found, example, 1 (first floor), 0 (basement), etc.

- Area** This further defines the specific functional space inspected such as a classroom, exterior, playground, gym, kitchen, etc.
- Room #** This is typically the actual number on the room as identified at the building.
- Component** Building "components" included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases.
- Feature** Identifies more detailed information of the component.
- Condition** This describes condition of the surface, whether it is intact, cracked, peeling, or chalking.
- Substrate** This refers to the material the building component is made of (wood, concrete, drywall, metal, etc.).
- Result** This is the analysis results for lead. Less than 1.0 mg/cm² or less than 0.5% by weight is considered to be non-lead and these building components are below the action levels of EPA and HUD. (All results are in mg/cm² except where noted.)

The table of results is designed for quick information on lead concentrations of tested building components. Generally, all repetitions of a test combination within a given room or area, may be assumed to contain similar concentrations of lead to that of the tested sample. For instance, the lead concentration of a tested wooden window sash was found to be above the action level of 1.0 mg/cm² in a given classroom. The classroom has five windows, all of wood, the same color and appearing to be of the same era. It can be assumed that the remaining four wooden window sashes each contain lead above the action limit.

Other columns identify the component and the component feature tested, condition of the component, type of substrate and the result of the analytical test.

As an example, the following illustration shows that the wooden door jamb in Room 123, first floor in the 1923 building section was in good, solid condition, and had an XRF test result of 0.3 mg/cm², which is below the action level.

Illustration Only

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1923 Bldg.	52		XRF	1	Room	123	Door	Jamb	Solid	Wood	0.3

In a similar manner, the table shows that the plaster walls in room 23, on the second floor has peeling paint with more than 1.0 mg/cm² (shaded).

ILLUSTRATION ONLY

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1910 Bldg.	16		XRF	2	Room	23	Door	Jamb	Peeling	Wood	0.25
1910 Bldg.	17		XRF	2	Room	23	Wall	Wall	Peeling	Plaster	1.2
1910 Bldg.	18		XRF	2	Room	23		Ceiling	Peeling	Plaster	0.25
1910 Bldg.	19		XRF	2	Room	23	Wall	Baseboard	Peeling	Wood	0.002

APPLICABLE REGULATIONS

When building components test above 1.0 mg/cm² of lead by XRF or 0.5% lead by weight from laboratory analysis all employees and contractors who will be working with these components in a construction related activity must be notified. The requirements of OSHA 1926.62, Lead in Construction are enforceable. This regulation defines construction work as "work for construction, alteration and/or repair, including painting and decorating." This regulation further defines monitoring requirements to minimize employee exposure to lead during construction activities.

When work is performed on external painted building structures (i.e. flashing, fire escapes, playground equipment, handrails, etc.), regulations of the Minnesota Pollution Control Agency (MPCA) may also be applicable. For removal of lead based paint from steel structures, MN Rules 7025.0200 - 7025.0380 apply to steel materials on the exterior of a building, or on the property when levels exceed 0.5 mg/cm² based on the average of three XRF spectrum results of the sample tested, or 5,000 ppm by laboratory analysis. If it is other than a steel surface, then MPCA regulates the painted surfaces under MN Rules 7025.010 - 7025.0080, when surfaces are to be disturbed using abrasive blasting methods.

Please contact MEC directly if you have questions about any portion of this report or the lead-based paint inspection itself.



APPENDIX A

XRF TESTING DATA
WITH
LOCATION MAPS

Sixth Street Staff Parking

East Side Community Center
Merrick Community Services

1000's

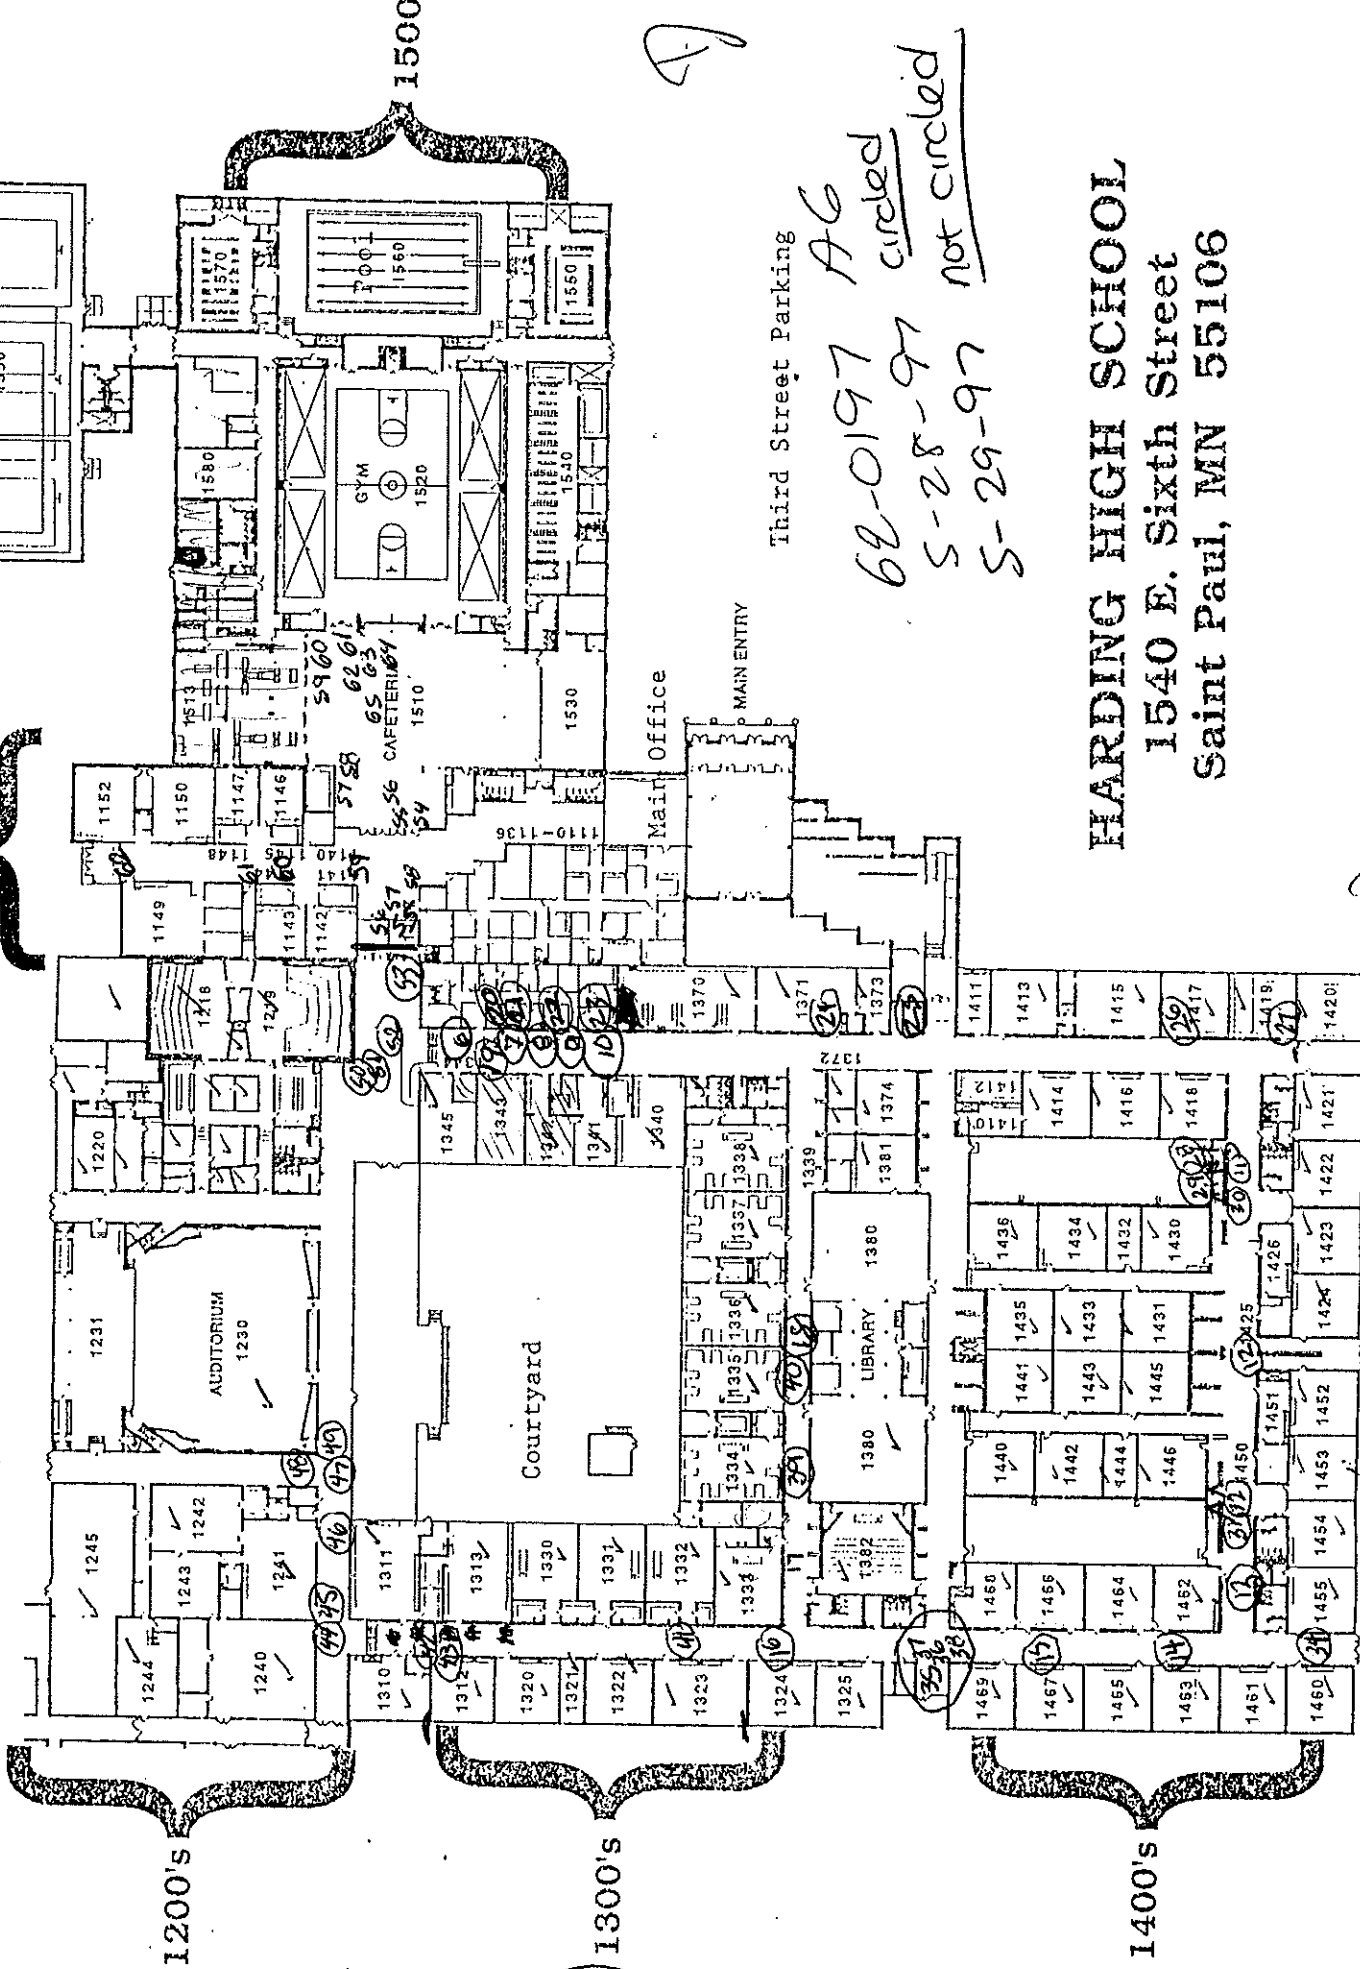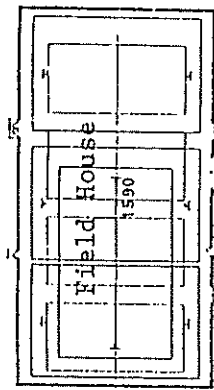

Third Street Parking

62-0197 AG
S-28-97 circled
S-29-97 not circled

HARDING HIGH SCHOOL
1540 E. Sixth Street
Saint Paul, MN 55106

East Side Community Center
Merrick Community Services

Sixth Street Staff Parking

1100's

1200's

1300's


I400's


1500's

Third Street Parking

5-31-97
Buck Samples
1997

HARDING HIGH SCHOOL
1540 E. Sixth Street
Saint Paul, MN 55106

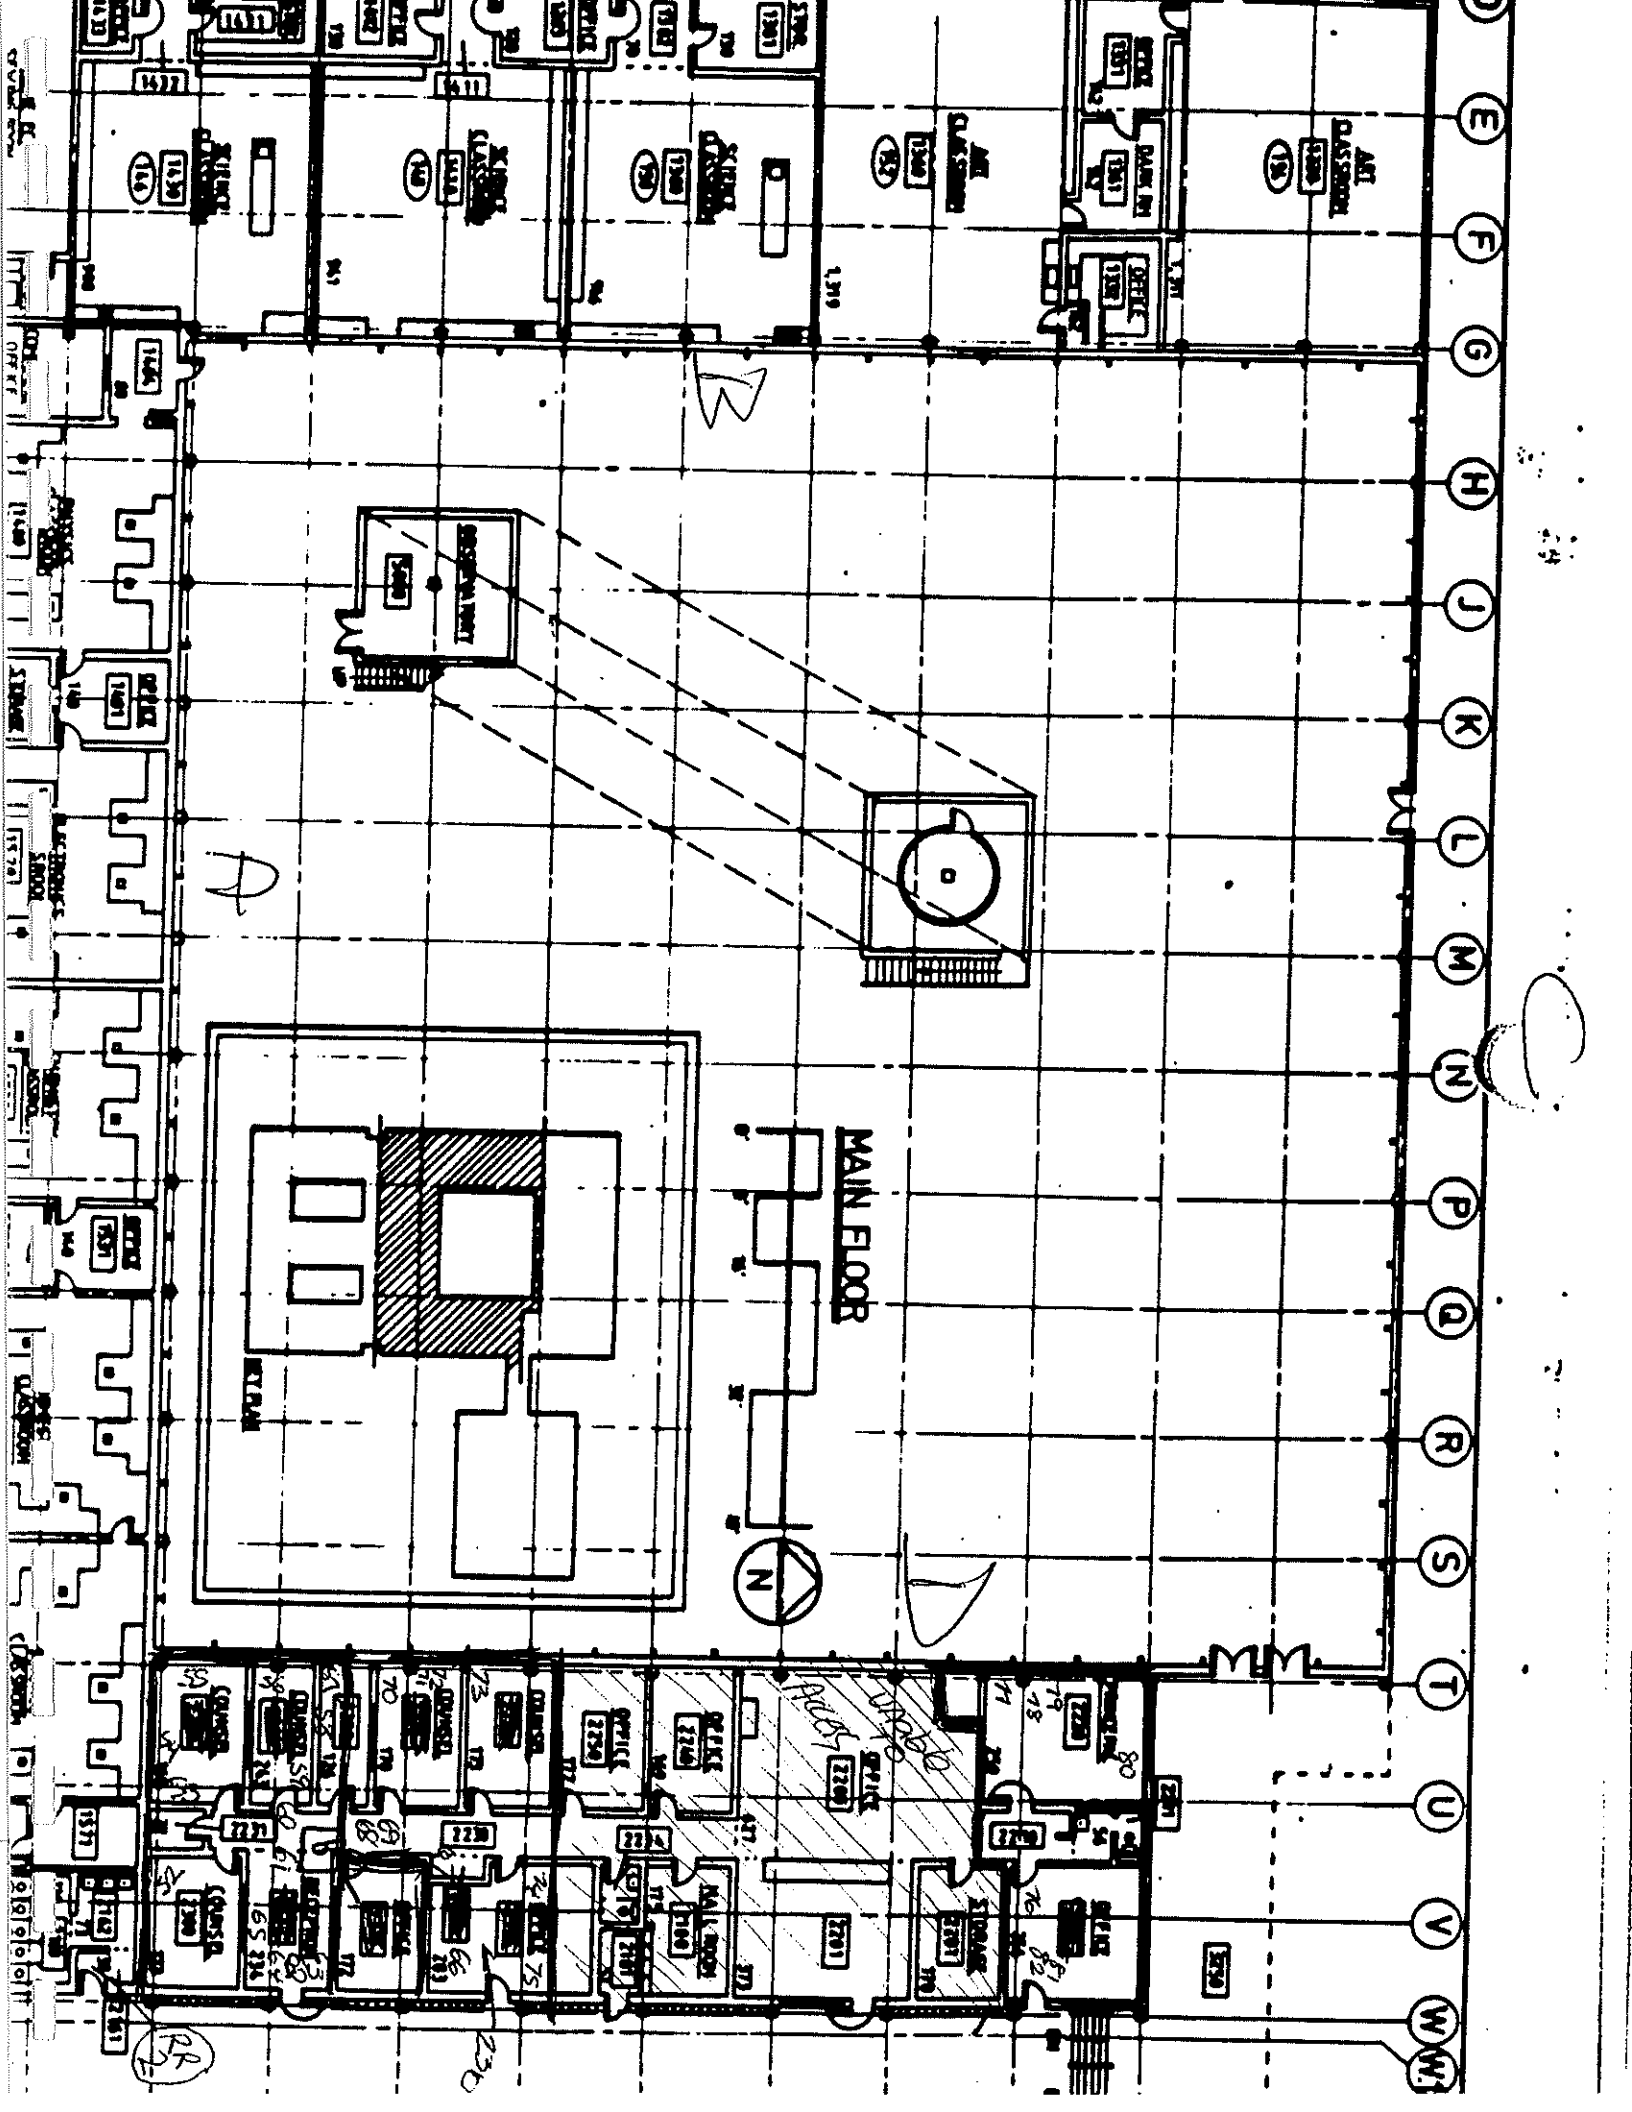

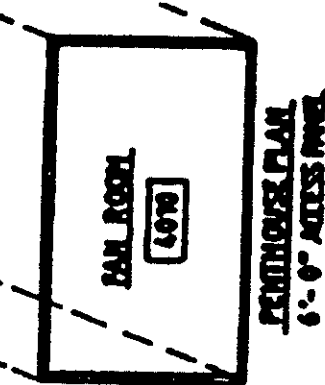

LEGEND

1167	INDICATES ARCH ROOM NUMBER
203	INDICATES CLASS ROOM NUMBER
785	INDICATES ROOM SQ. FOOTAGE

SUMMARY 58. F.I.	
FIRST FLOOR SOUTH	680.55
	52,670
FIRST FLOOR	64,300
FIRST FLOOR NORTH	27,360
FIRST FLOOR WEST	21,520
FIRST FLOOR EAST	62,030
TOTAL	<u>207,860</u>


62-0197 AG
S-24-97


9



[illegible]

2009-09-26

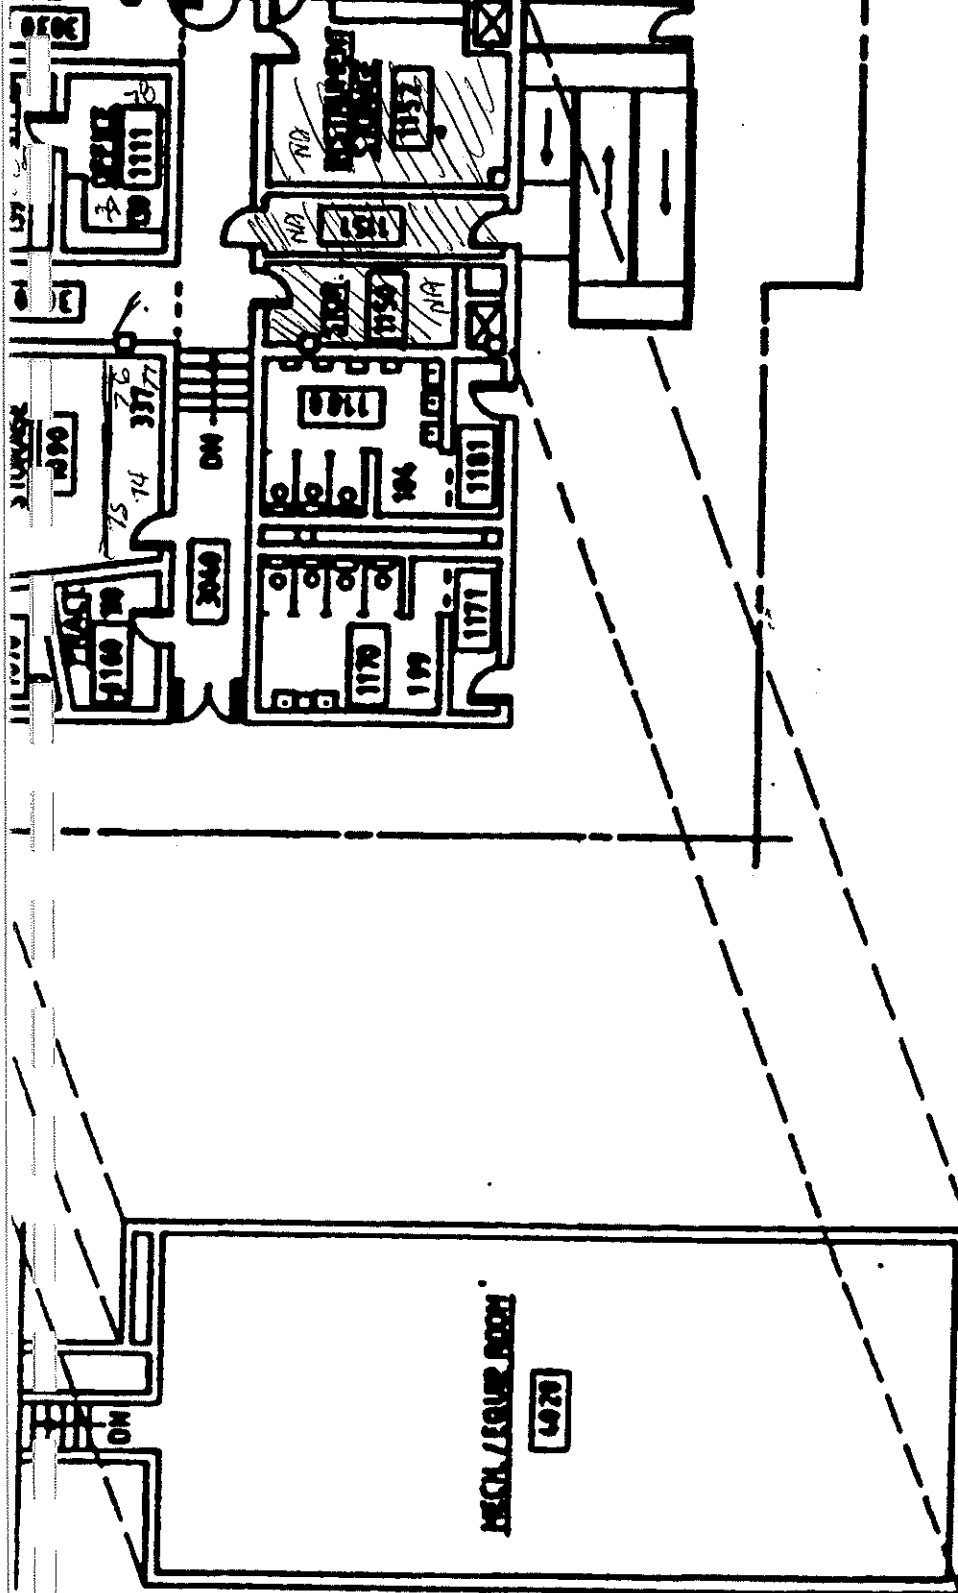


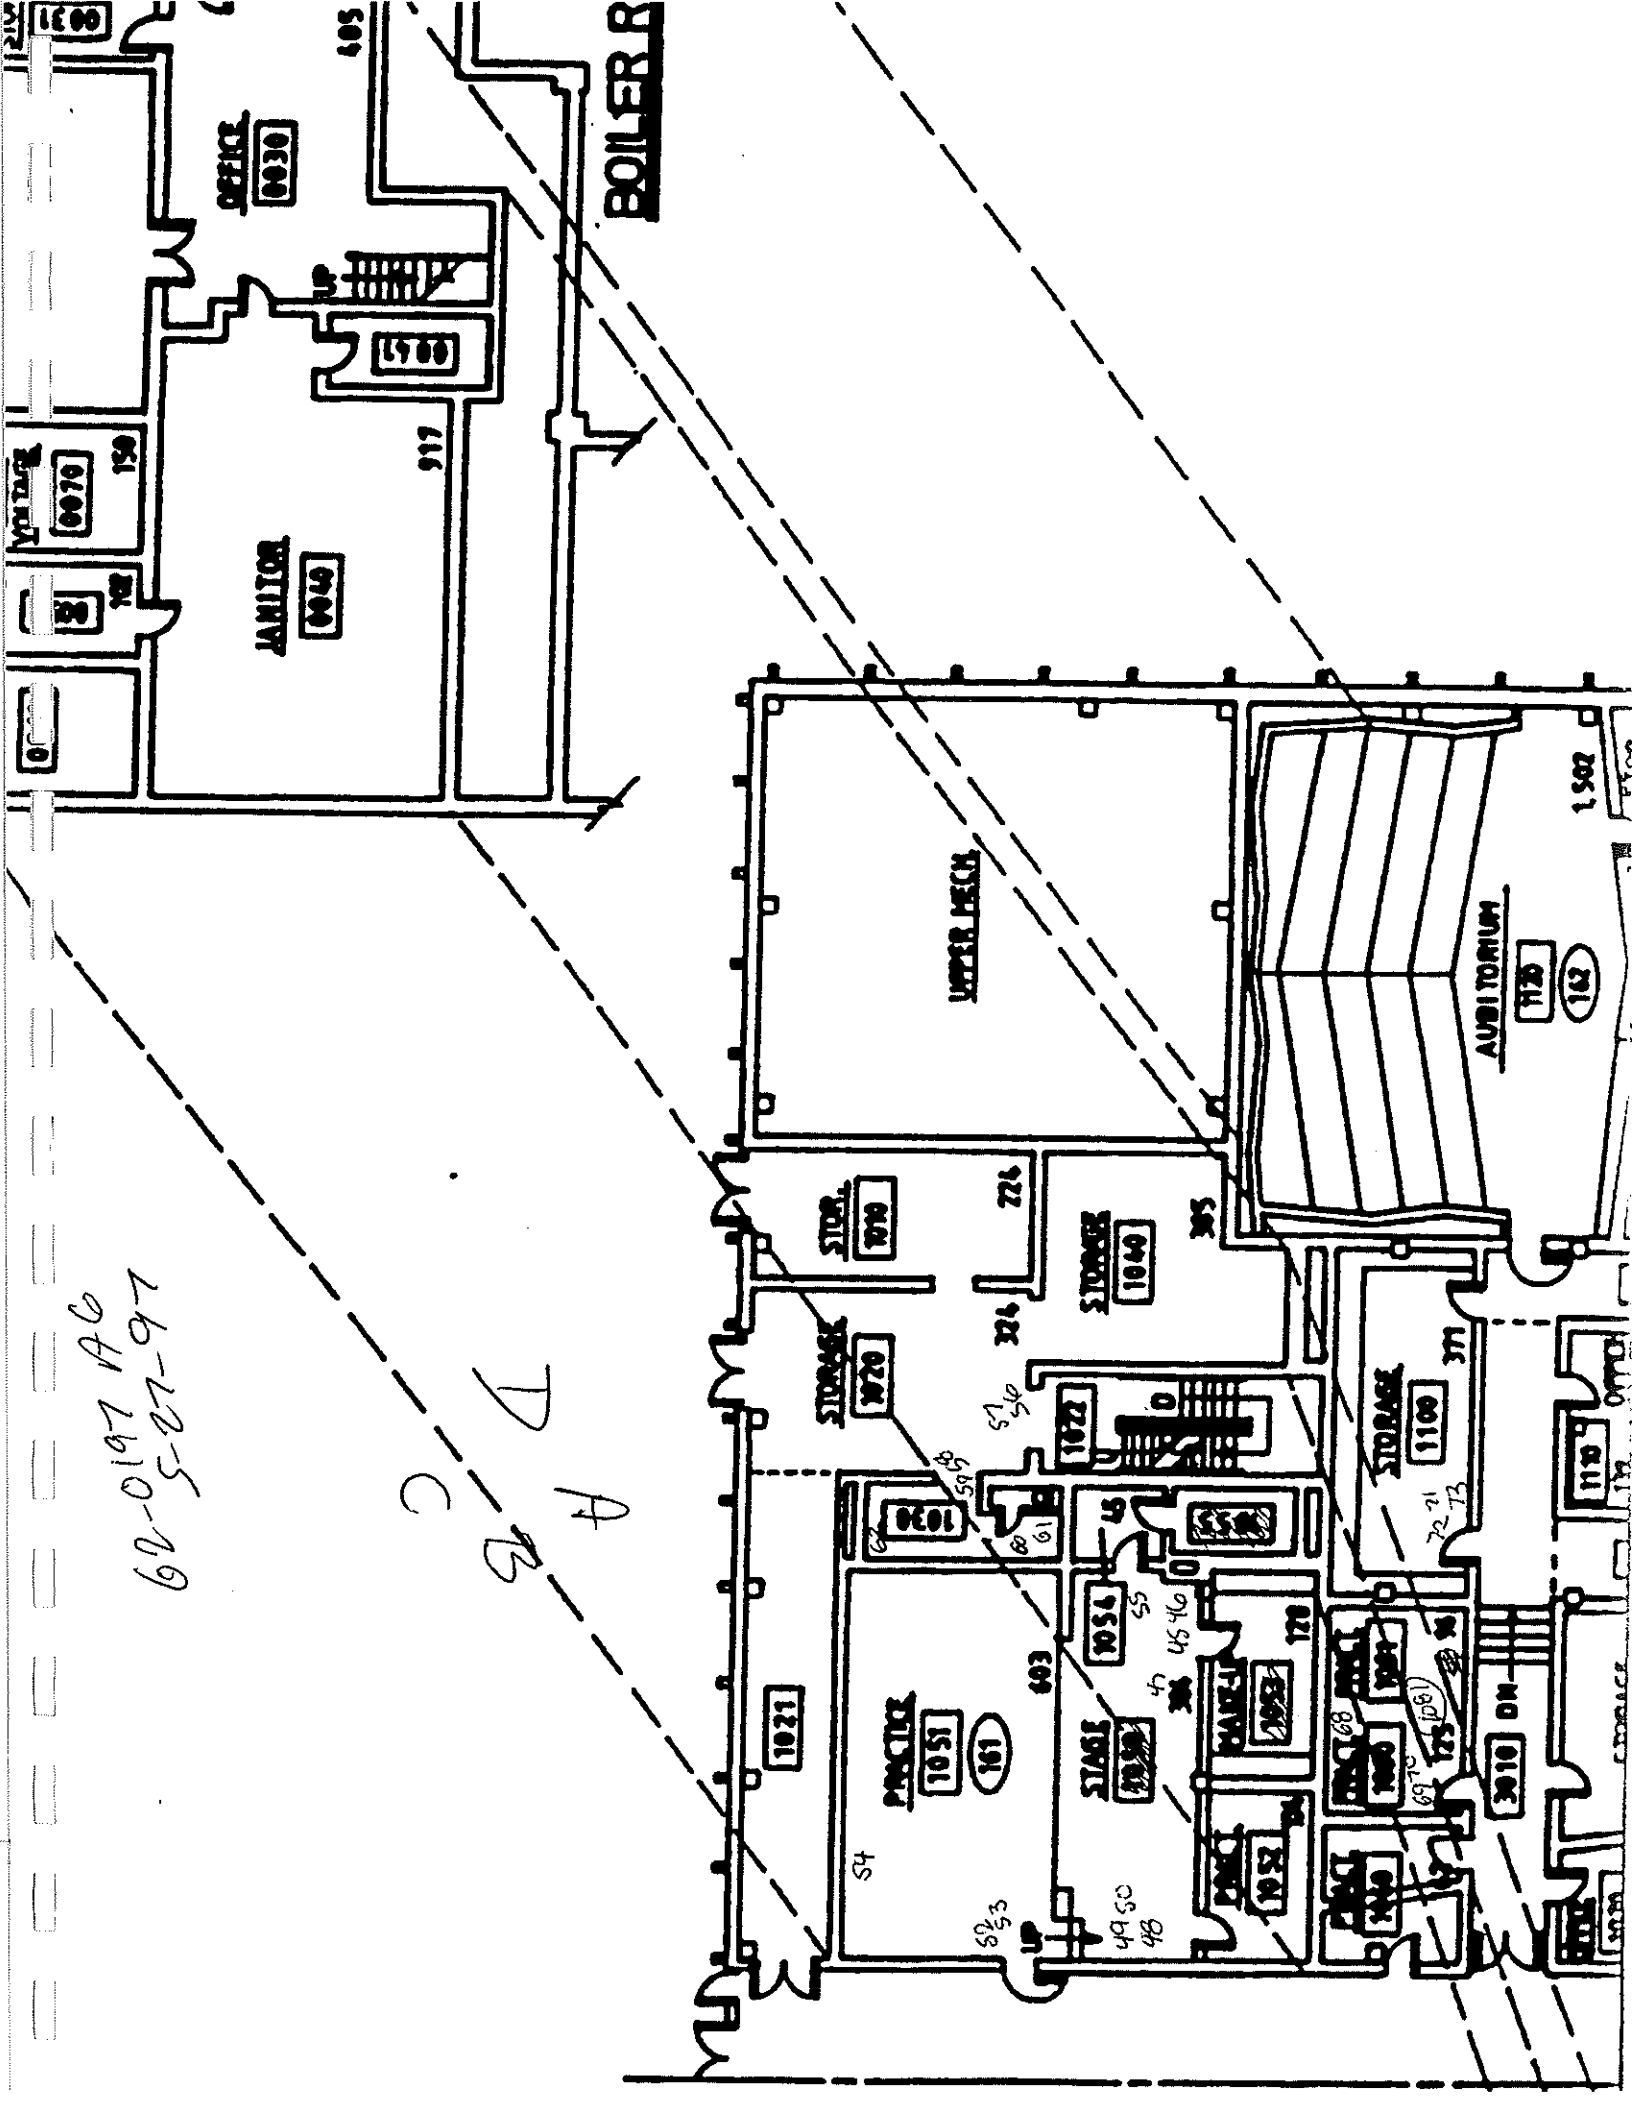


16-12-5-97
1610-97

A
B
C
D

4

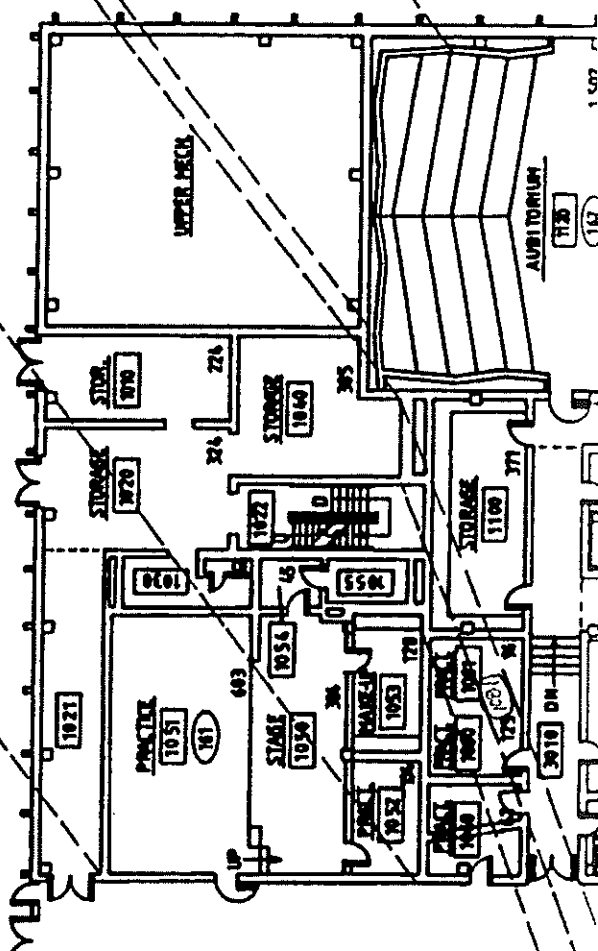

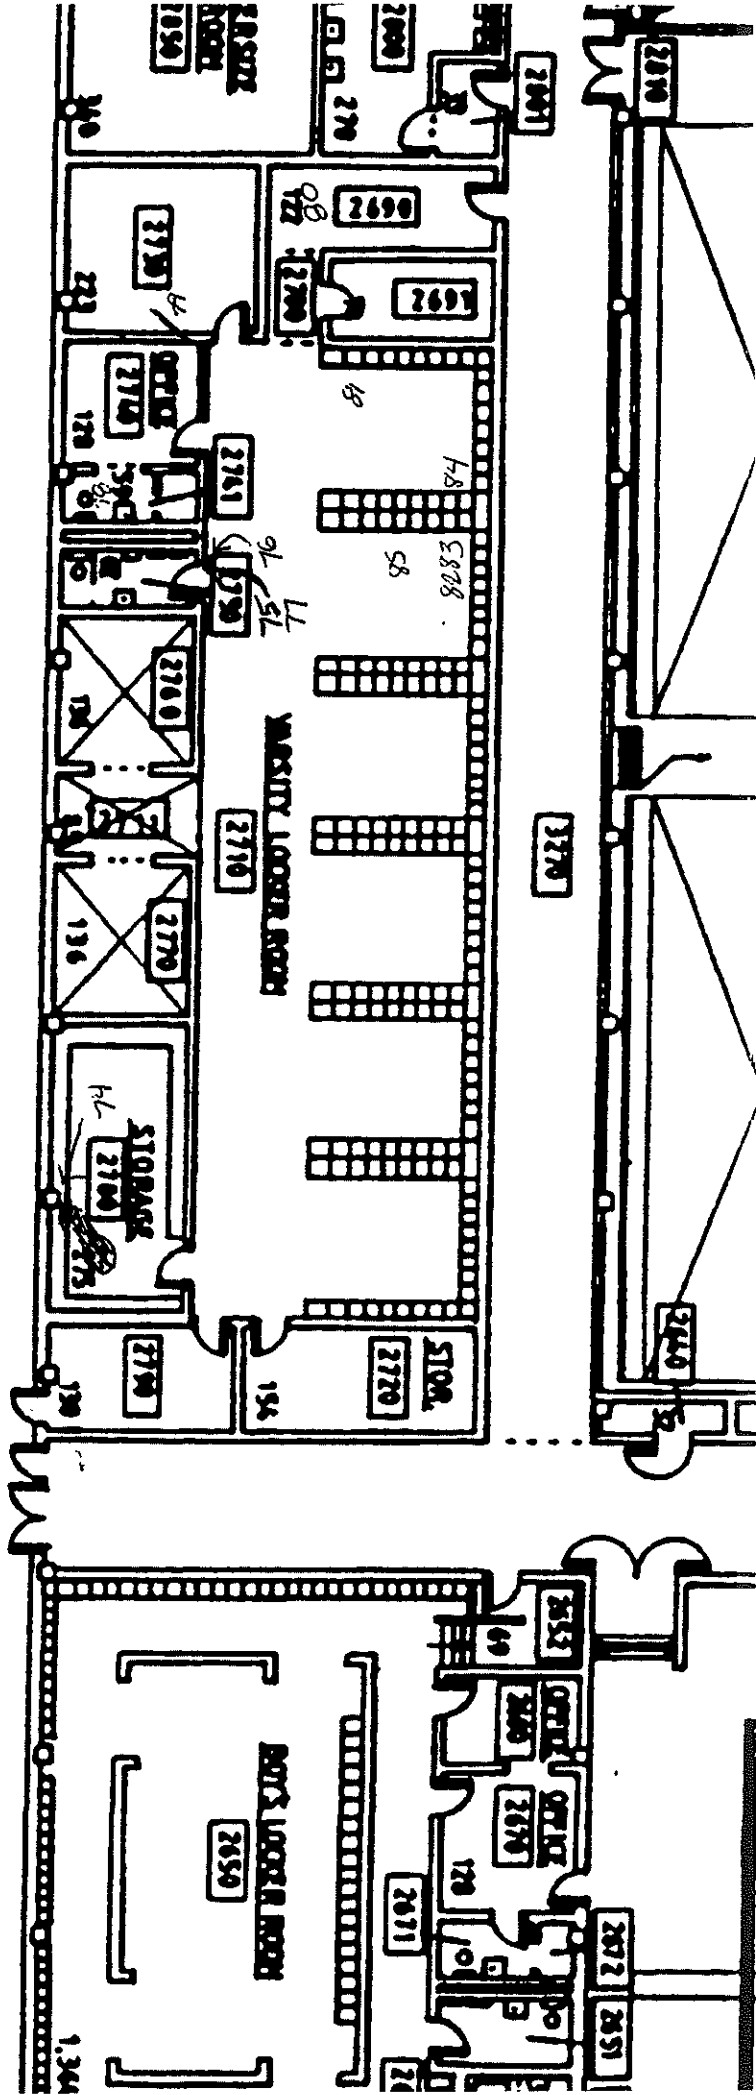


A hand-drawn floor plan of a school building, oriented horizontally. The plan shows a central corridor with rooms on both sides. Rooms are labeled with their names and numbers. The layout includes:


- Top Section (Left to Right):**
 - OFFICE 117, LOUNGE 107, LOUNGE 105, MODEL STORE 96, STUD. EDUCATION 81.
 - Room numbers: 117, 107, 105, 96, 81, 84, 85, 86, 87, 88, 89, 90, 91, 92, 93, 94, 95, 96, 97, 98, 99, 100, 101, 102, 103, 104, 105, 106, 107, 108, 109, 110, 111, 112, 113, 114, 115, 116, 117, 118, 119, 120, 121, 122, 123, 124, 125, 126, 127, 128, 129, 130, 131, 132, 133, 134, 135, 136, 137, 138, 139, 140, 141, 142, 143, 144, 145, 146, 147, 148, 149, 150, 151, 152, 153, 154, 155, 156, 157, 158, 159, 160, 161, 162, 163, 164, 165, 166, 167, 168, 169, 170, 171, 172, 173, 174, 175, 176, 177, 178, 179, 180, 181, 182, 183, 184, 185, 186, 187, 188, 189, 190, 191, 192, 193, 194, 195, 196, 197, 198, 199, 200, 201, 202, 203, 204, 205, 206, 207, 208, 209, 210, 211, 212, 213, 214, 215, 216, 217, 218, 219, 220, 221, 222, 223, 224, 225, 226, 227, 228, 229, 230, 231, 232, 233, 234, 235, 236, 237, 238, 239, 240, 241, 242, 243, 244, 245, 246, 247, 248, 249, 250, 251, 252, 253, 254, 255, 256, 257, 258, 259, 260, 261, 262, 263, 264, 265, 266, 267, 268, 269, 270, 271, 272, 273, 274, 275, 276, 277, 278, 279, 280, 281, 282, 283, 284, 285, 286, 287, 288, 289, 290, 291, 292, 293, 294, 295, 296, 297, 298, 299, 300, 301, 302, 303, 304, 305, 306, 307, 308, 309, 310, 311, 312, 313, 314, 315, 316, 317, 318, 319, 320, 321, 322, 323, 324, 325, 326, 327, 328, 329, 330, 331, 332, 333, 334, 335, 336, 337, 338, 339, 340, 341, 342, 343, 344, 345, 346, 347, 348, 349, 350, 351, 352, 353, 354, 355, 356, 357, 358, 359, 360, 361, 362, 363, 364, 365, 366, 367, 368, 369, 370, 371, 372, 373, 374, 375, 376, 377, 378, 379, 380, 381, 382, 383, 384, 385, 386, 387, 388, 389, 390, 391, 392, 393, 394, 395, 396, 397, 398, 399, 400, 401, 402, 403, 404, 405, 406, 407, 408, 409, 410, 411, 412, 413, 414, 415, 416, 417, 418, 419, 420, 421, 422, 423, 424, 425, 426, 427, 428, 429, 430, 431, 432, 433, 434, 435, 436, 437, 438, 439, 440, 441, 442, 443, 444, 445, 446, 447, 448, 449, 450, 451, 452, 453, 454, 455, 456, 457, 458, 459, 460, 461, 462, 463, 464, 465, 466, 467, 468, 469, 470, 471, 472, 473, 474, 475, 476, 477, 478, 479, 480, 481, 482, 483, 484, 485, 486, 487, 488, 489, 490, 491, 492, 493, 494, 495, 496, 497, 498, 499, 500, 501, 502, 503, 504, 505, 506, 507, 508, 509, 510, 511, 512, 513, 514, 515, 516, 517, 518, 519, 520, 521, 522, 523, 524, 525, 526, 527, 528, 529, 530, 531, 532, 533, 534, 535, 536, 537, 538, 539, 540, 541, 542, 543, 544, 545, 546, 547, 548, 549, 550, 551, 552, 553, 554, 555, 556, 557, 558, 559, 560, 561, 562, 563, 564, 565, 566, 567, 568, 569, 570, 571, 572, 573, 574, 575, 576, 577, 578, 579, 580, 581, 582, 583, 584, 585, 586, 587, 588, 589, 590, 591, 592, 593, 594, 595, 596, 597, 598, 599, 600, 601, 602, 603, 604, 605, 606, 607, 608, 609, 610, 611, 612, 613, 614, 615, 616, 617, 618, 619, 620, 621, 622, 623, 624, 625, 626, 627, 628, 629, 630, 631, 632, 633, 634, 635, 636, 637, 638, 639, 640, 641, 642, 643, 644, 645, 646, 647, 648, 649, 650, 651, 652, 653, 654, 655, 656, 657, 658, 659, 660, 661, 662, 663, 664, 665, 666, 667, 668, 669, 670, 671, 672, 673, 674, 675, 676, 677, 678, 679, 680, 681, 682, 683, 684, 685, 686, 687, 688, 689, 690, 691, 692, 693, 694, 695, 696, 697, 698, 699, 700, 701, 702, 703, 704, 705, 706, 707, 708, 709, 710, 711, 712, 713, 714, 715, 716, 717, 718, 719, 720, 721, 722, 723, 724, 725, 726, 727, 728, 729, 730, 731, 732, 733, 734, 735, 736, 737, 738, 739, 740, 741, 742, 743, 744, 745, 746, 747, 748, 749, 750, 751, 752, 753, 754, 755, 756, 757, 758, 759, 760, 761, 762, 763, 764, 765, 766, 767, 768, 769, 770, 771, 772, 773, 774, 775, 776, 777, 778, 779, 780, 781, 782, 783, 784, 785, 786, 787, 788, 789, 790, 791, 792, 793, 794, 795, 796, 797, 798, 799, 800, 801, 802, 803, 804, 805, 806, 807, 808, 809, 810, 811, 812, 813, 814, 815, 816, 817, 818, 819, 820, 821, 822, 823, 824, 825, 826, 827, 828, 829, 830, 831, 832, 833, 834, 835, 836, 837, 838, 839, 840, 841, 842, 843, 844, 845, 846, 847, 848, 849, 850, 851, 852, 853, 854, 855, 856, 857, 858, 859, 860, 861, 862, 863, 864, 865, 866, 867, 868, 869, 870, 871, 872, 873, 874, 8


62-0197
1A6

5-29-97

C
B
A
D

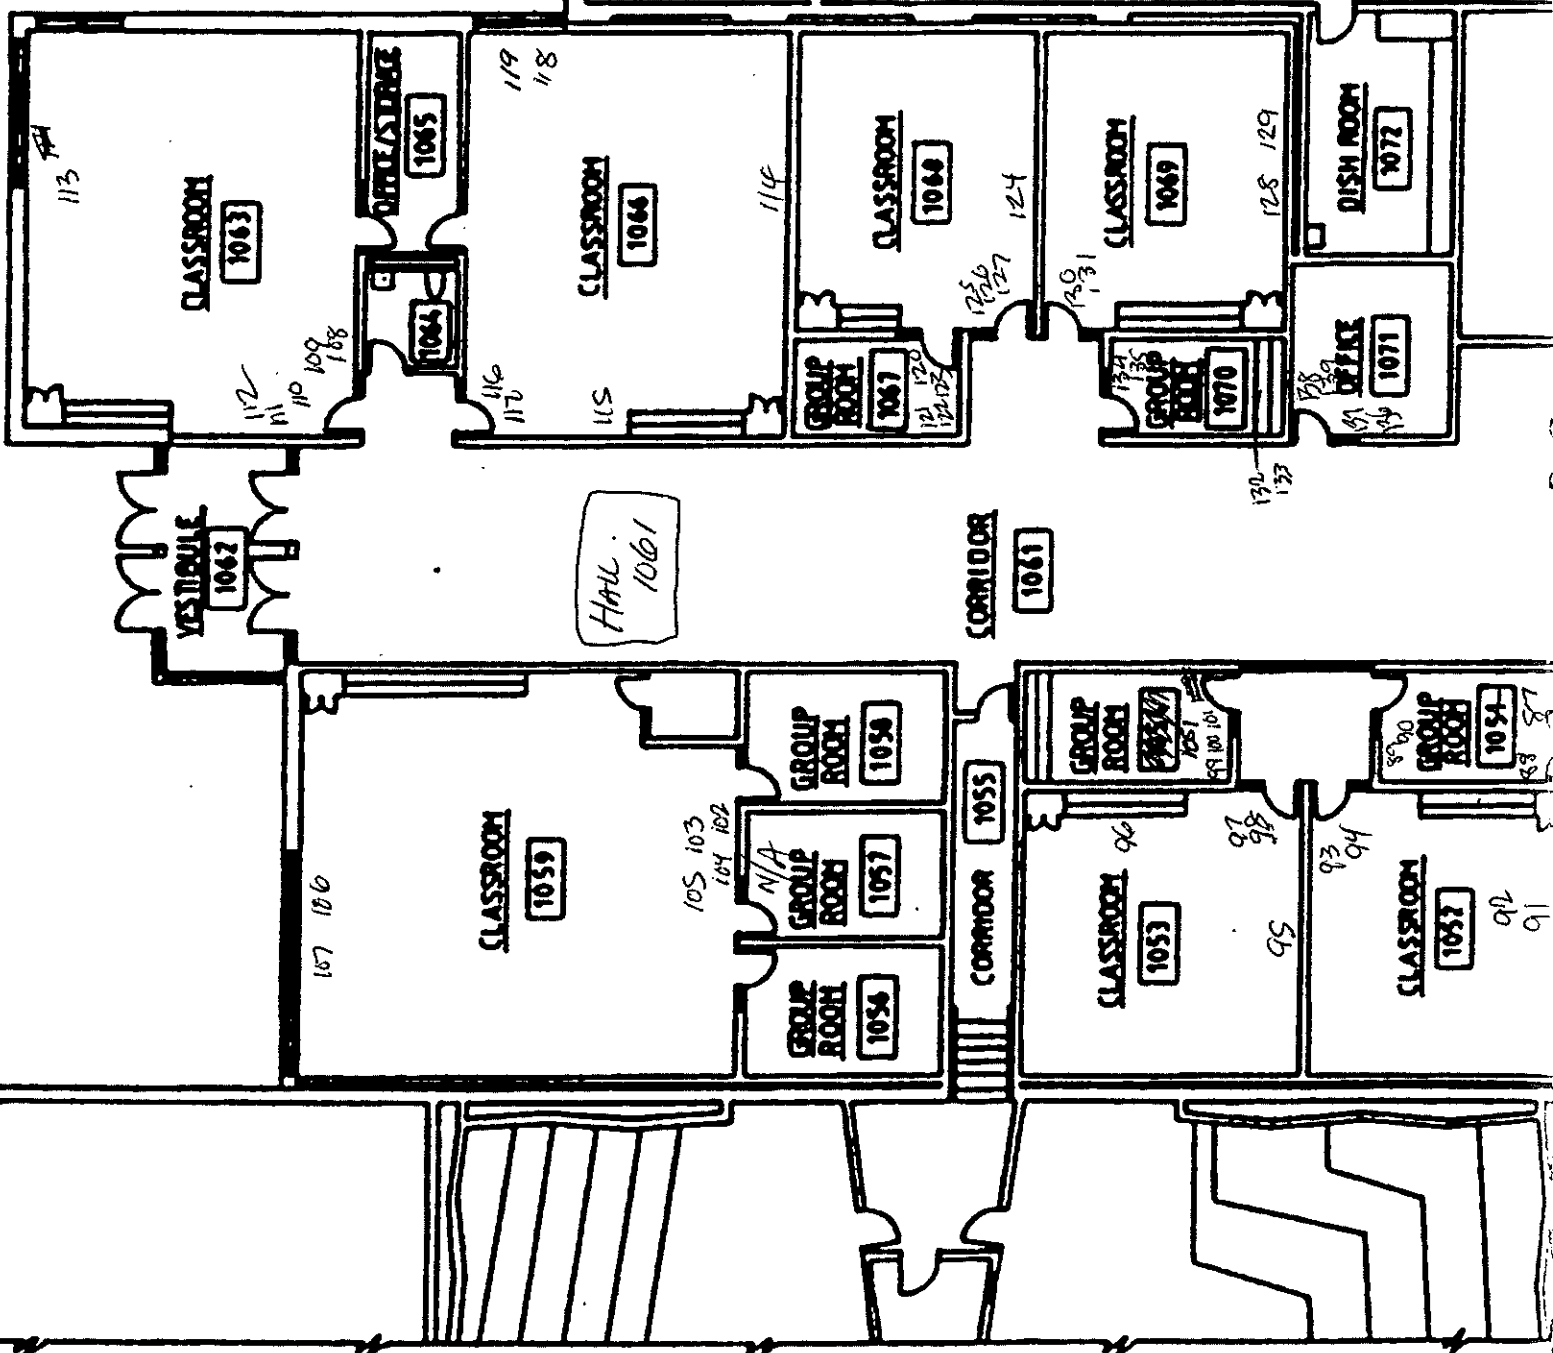

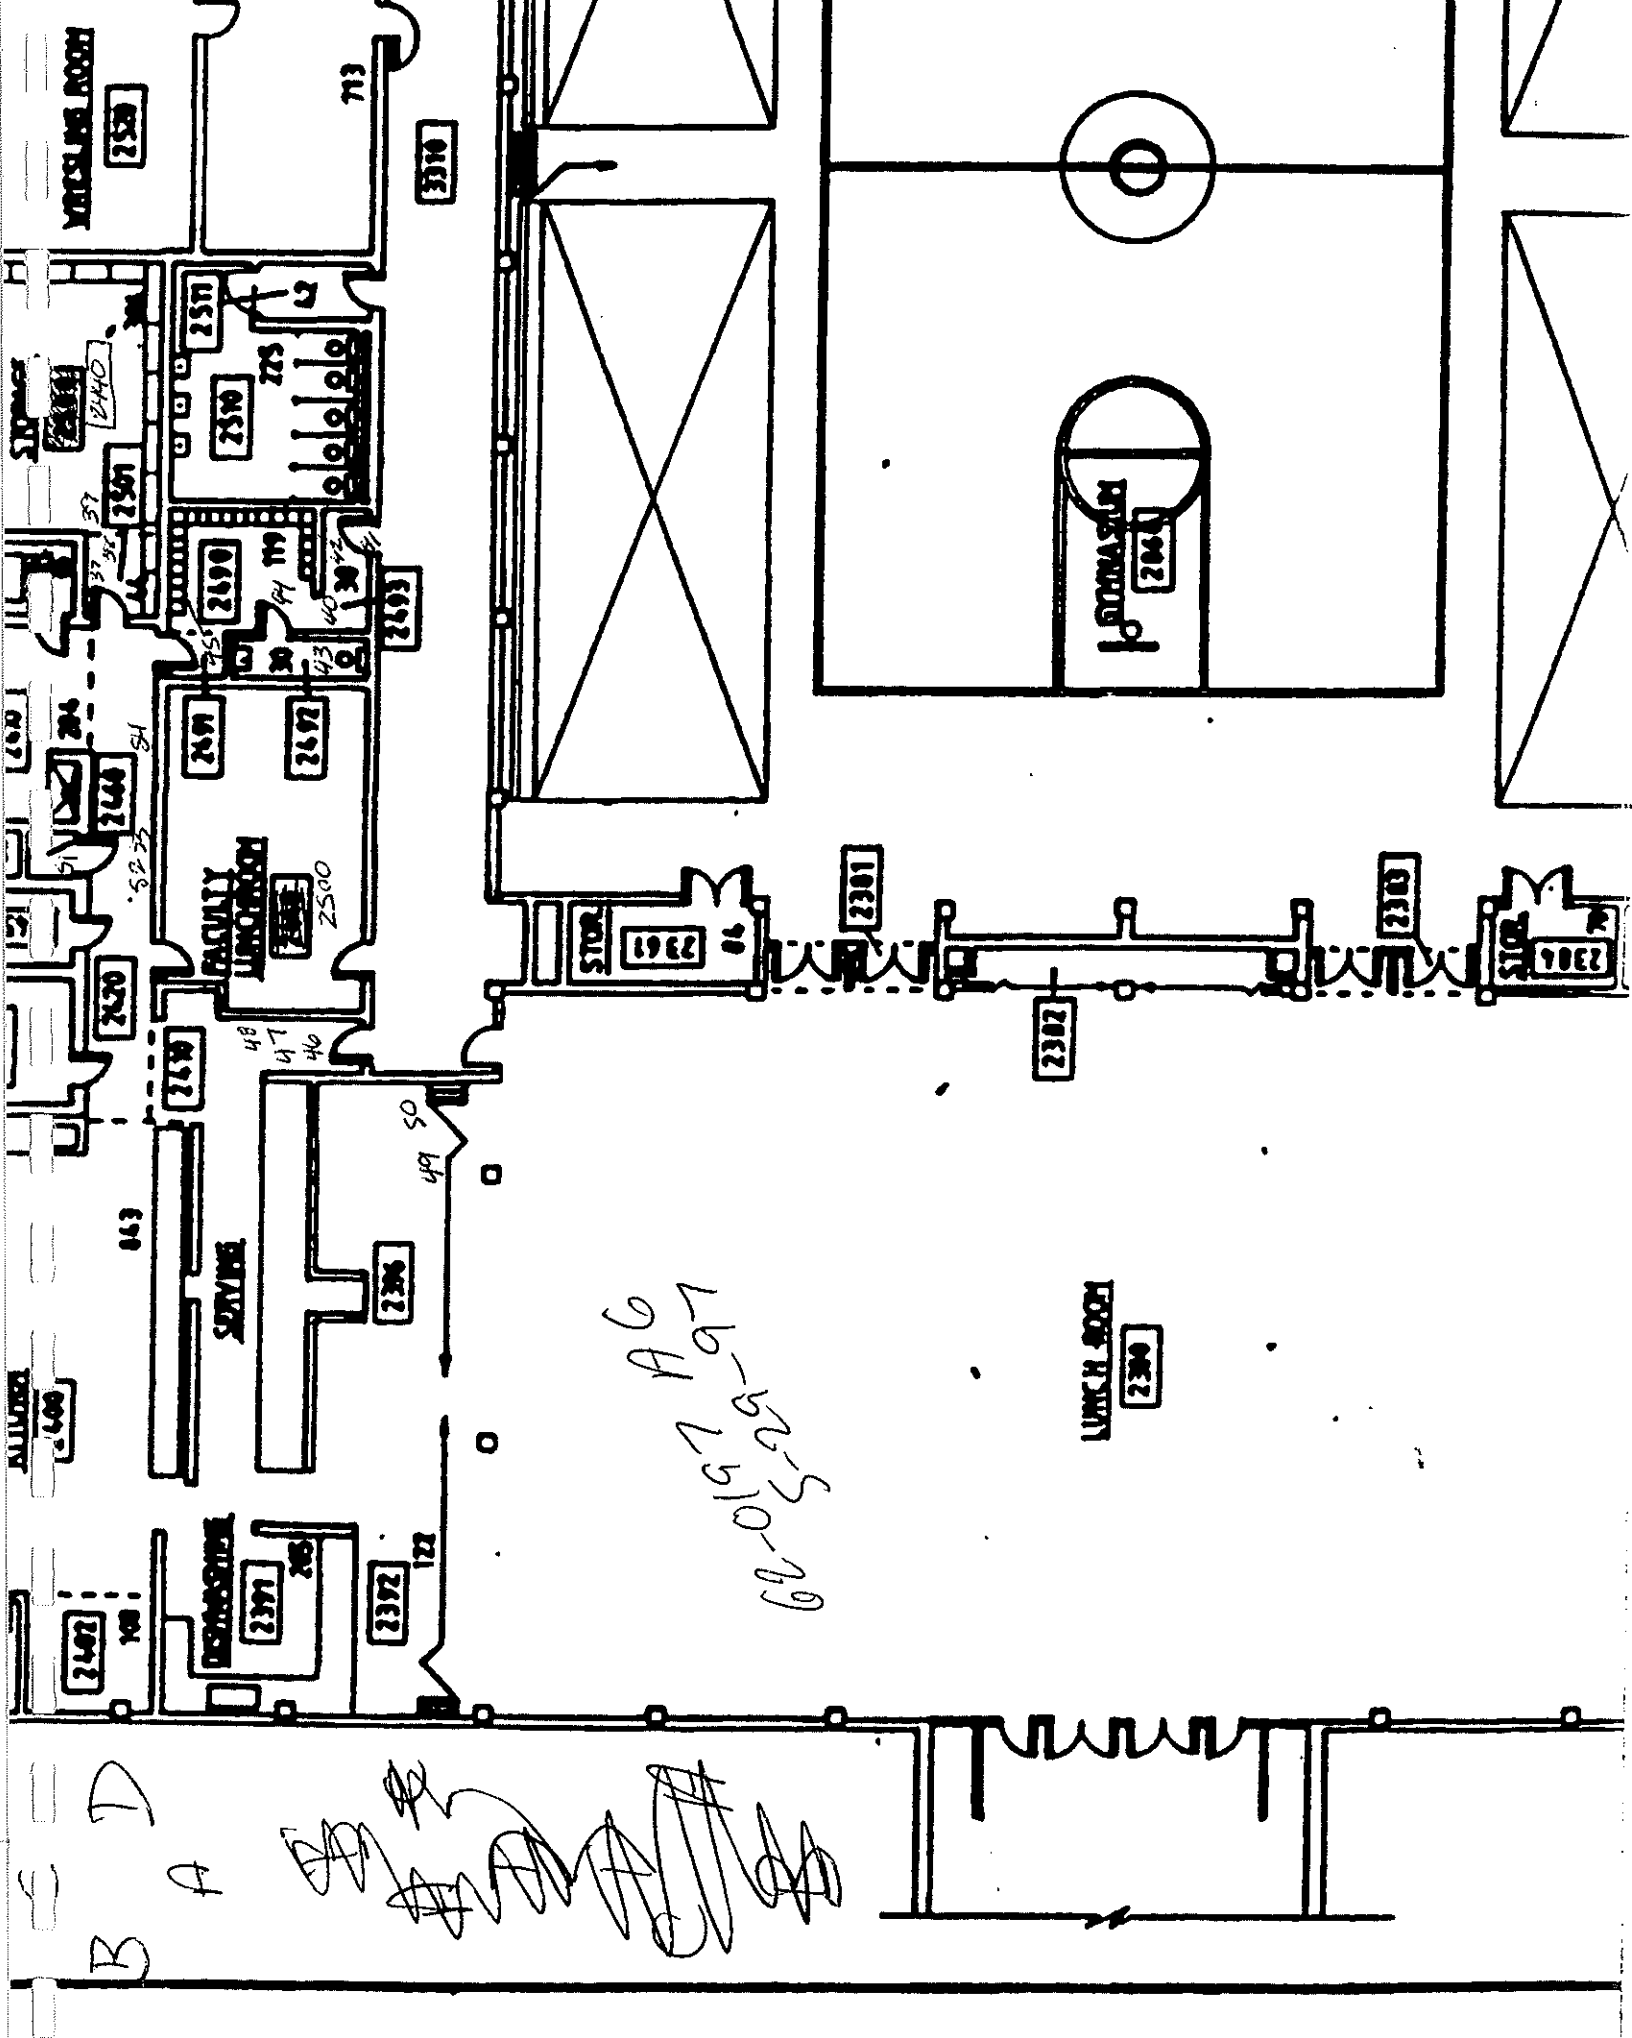


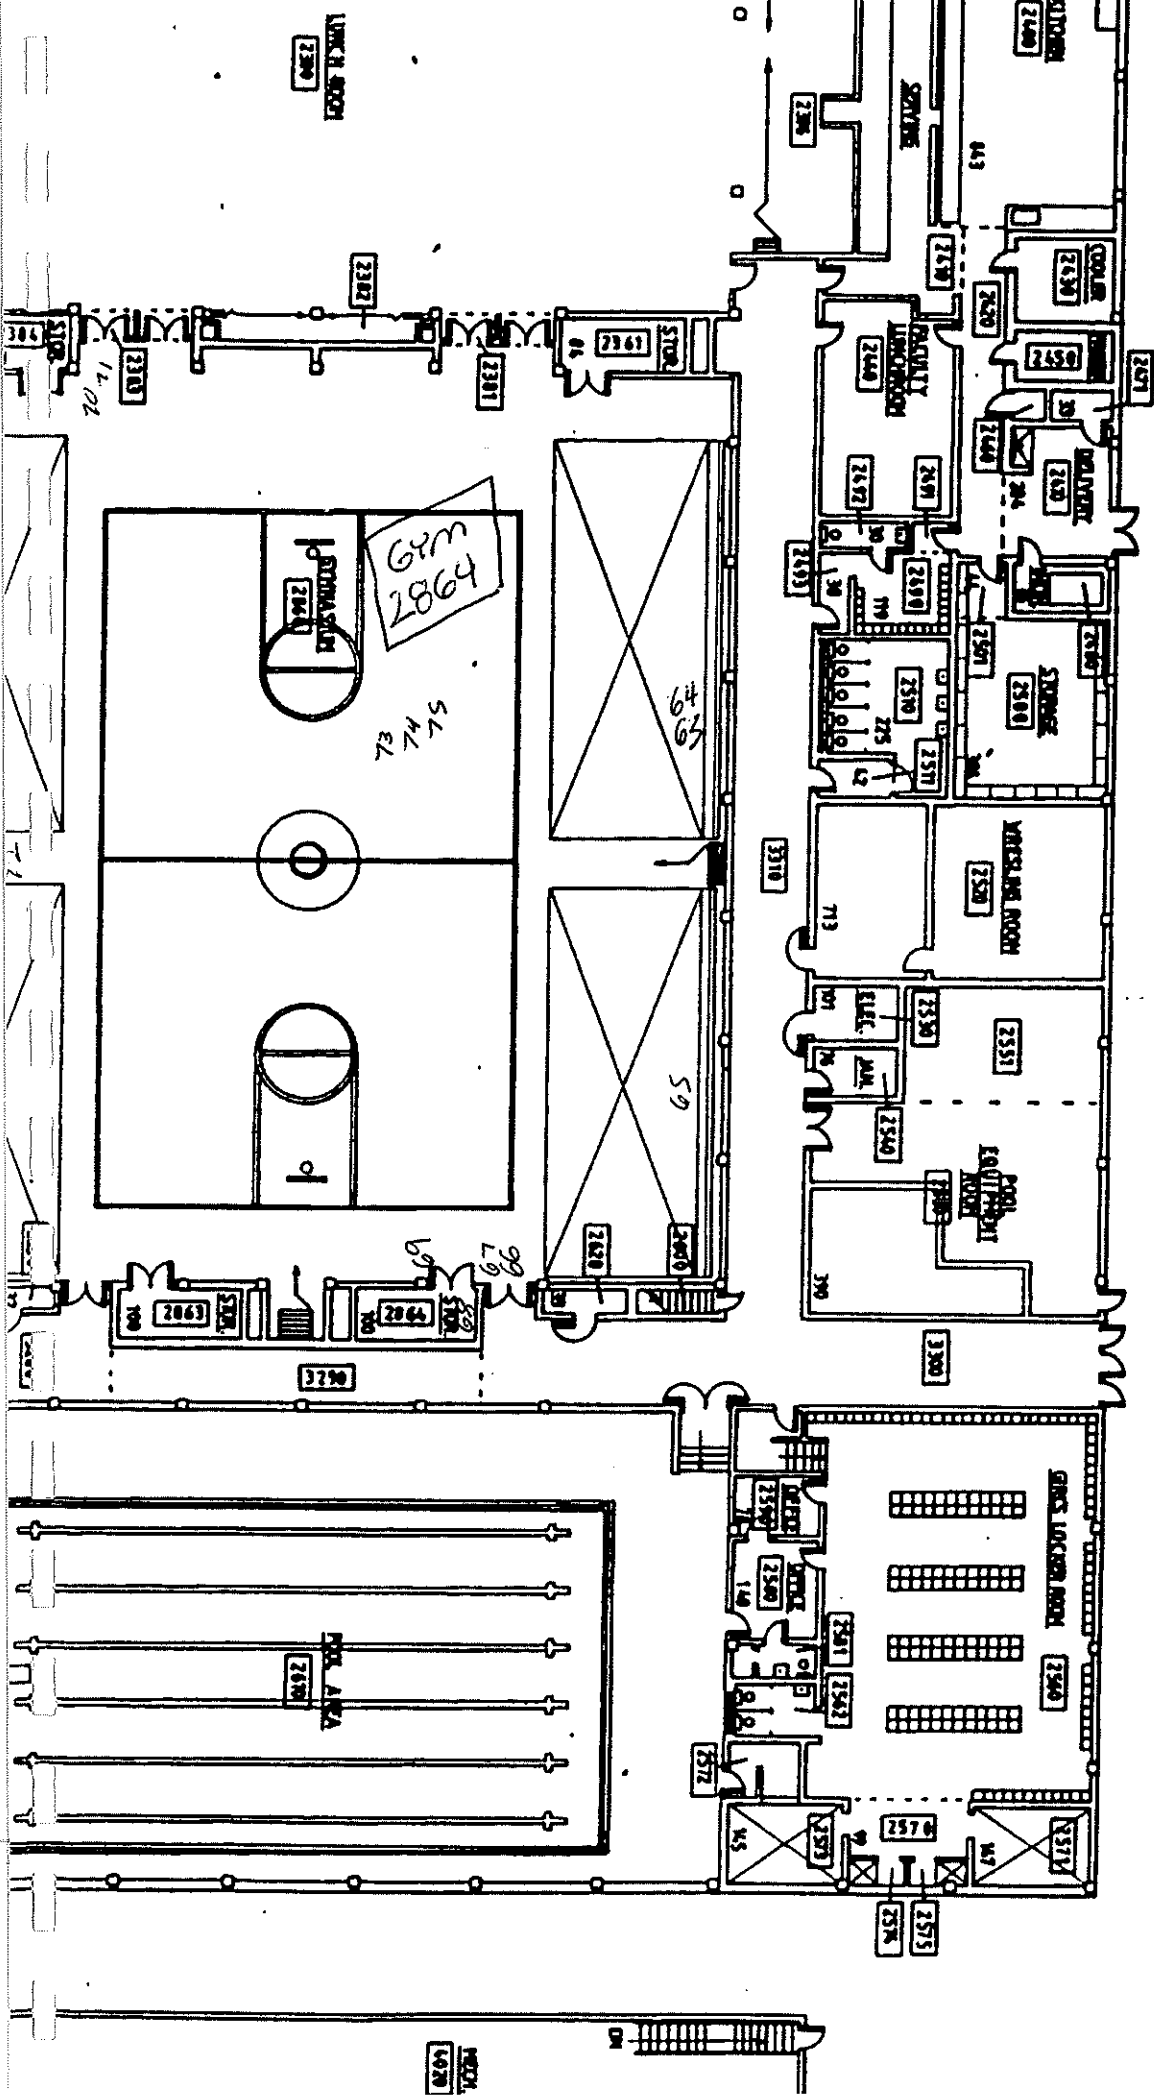

360 COLBORNE STREET



FIRST FLOOR - EAST




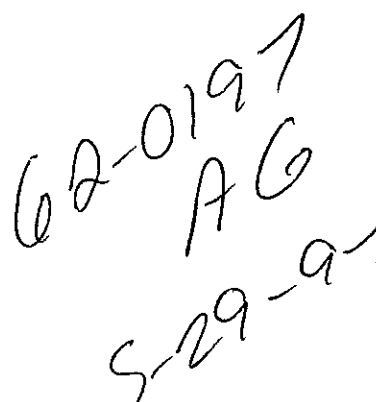



62-0197
AG
5-29-9-


HARDING SR. HIGH SCHOOL
1540 EAST SIXTH STREET

CONSTRUCTED 1963

A
B
C
D

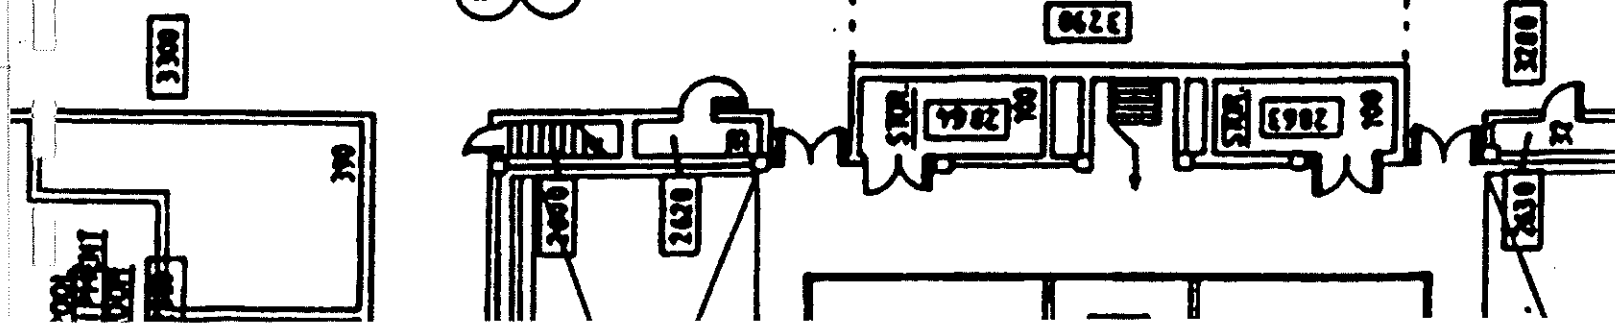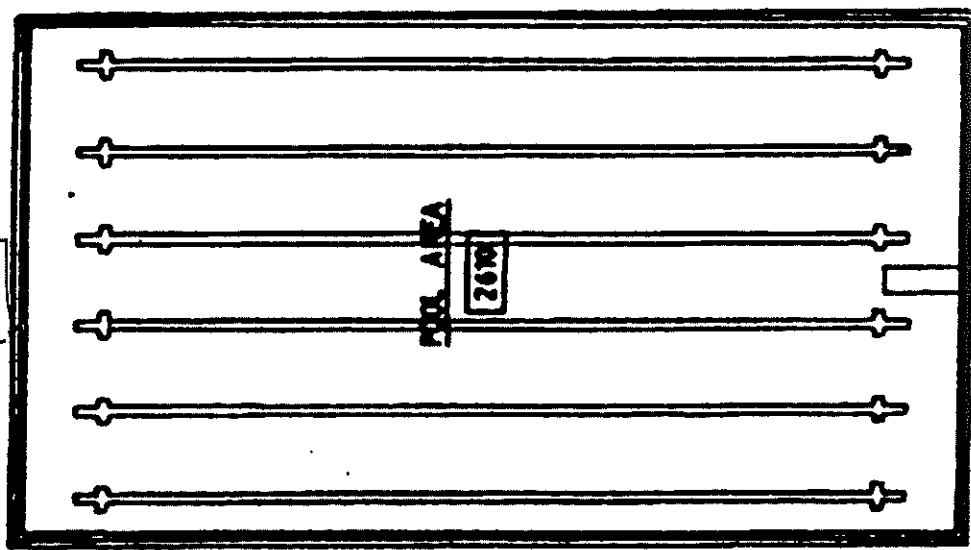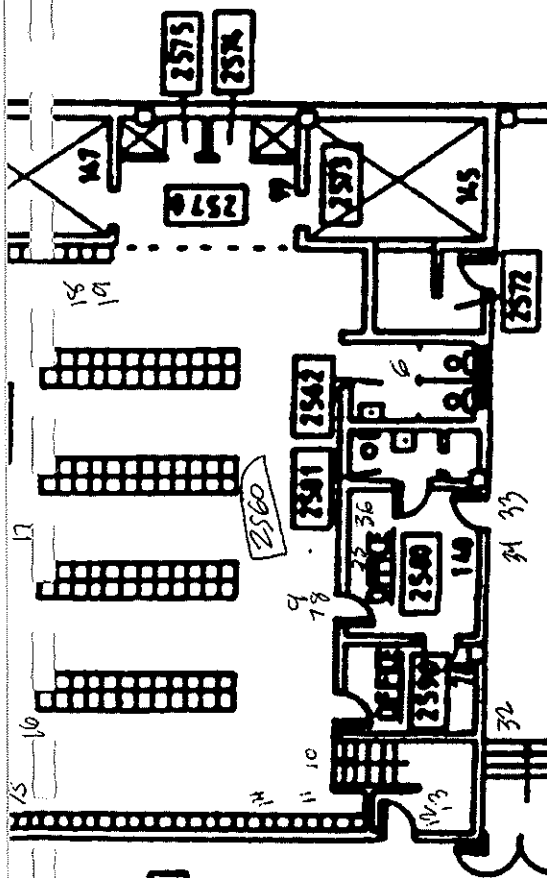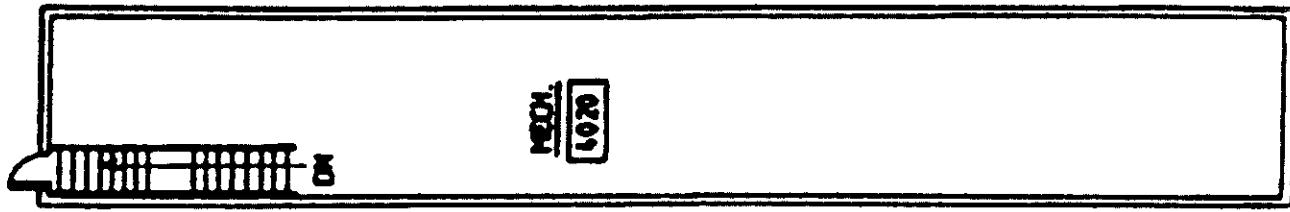

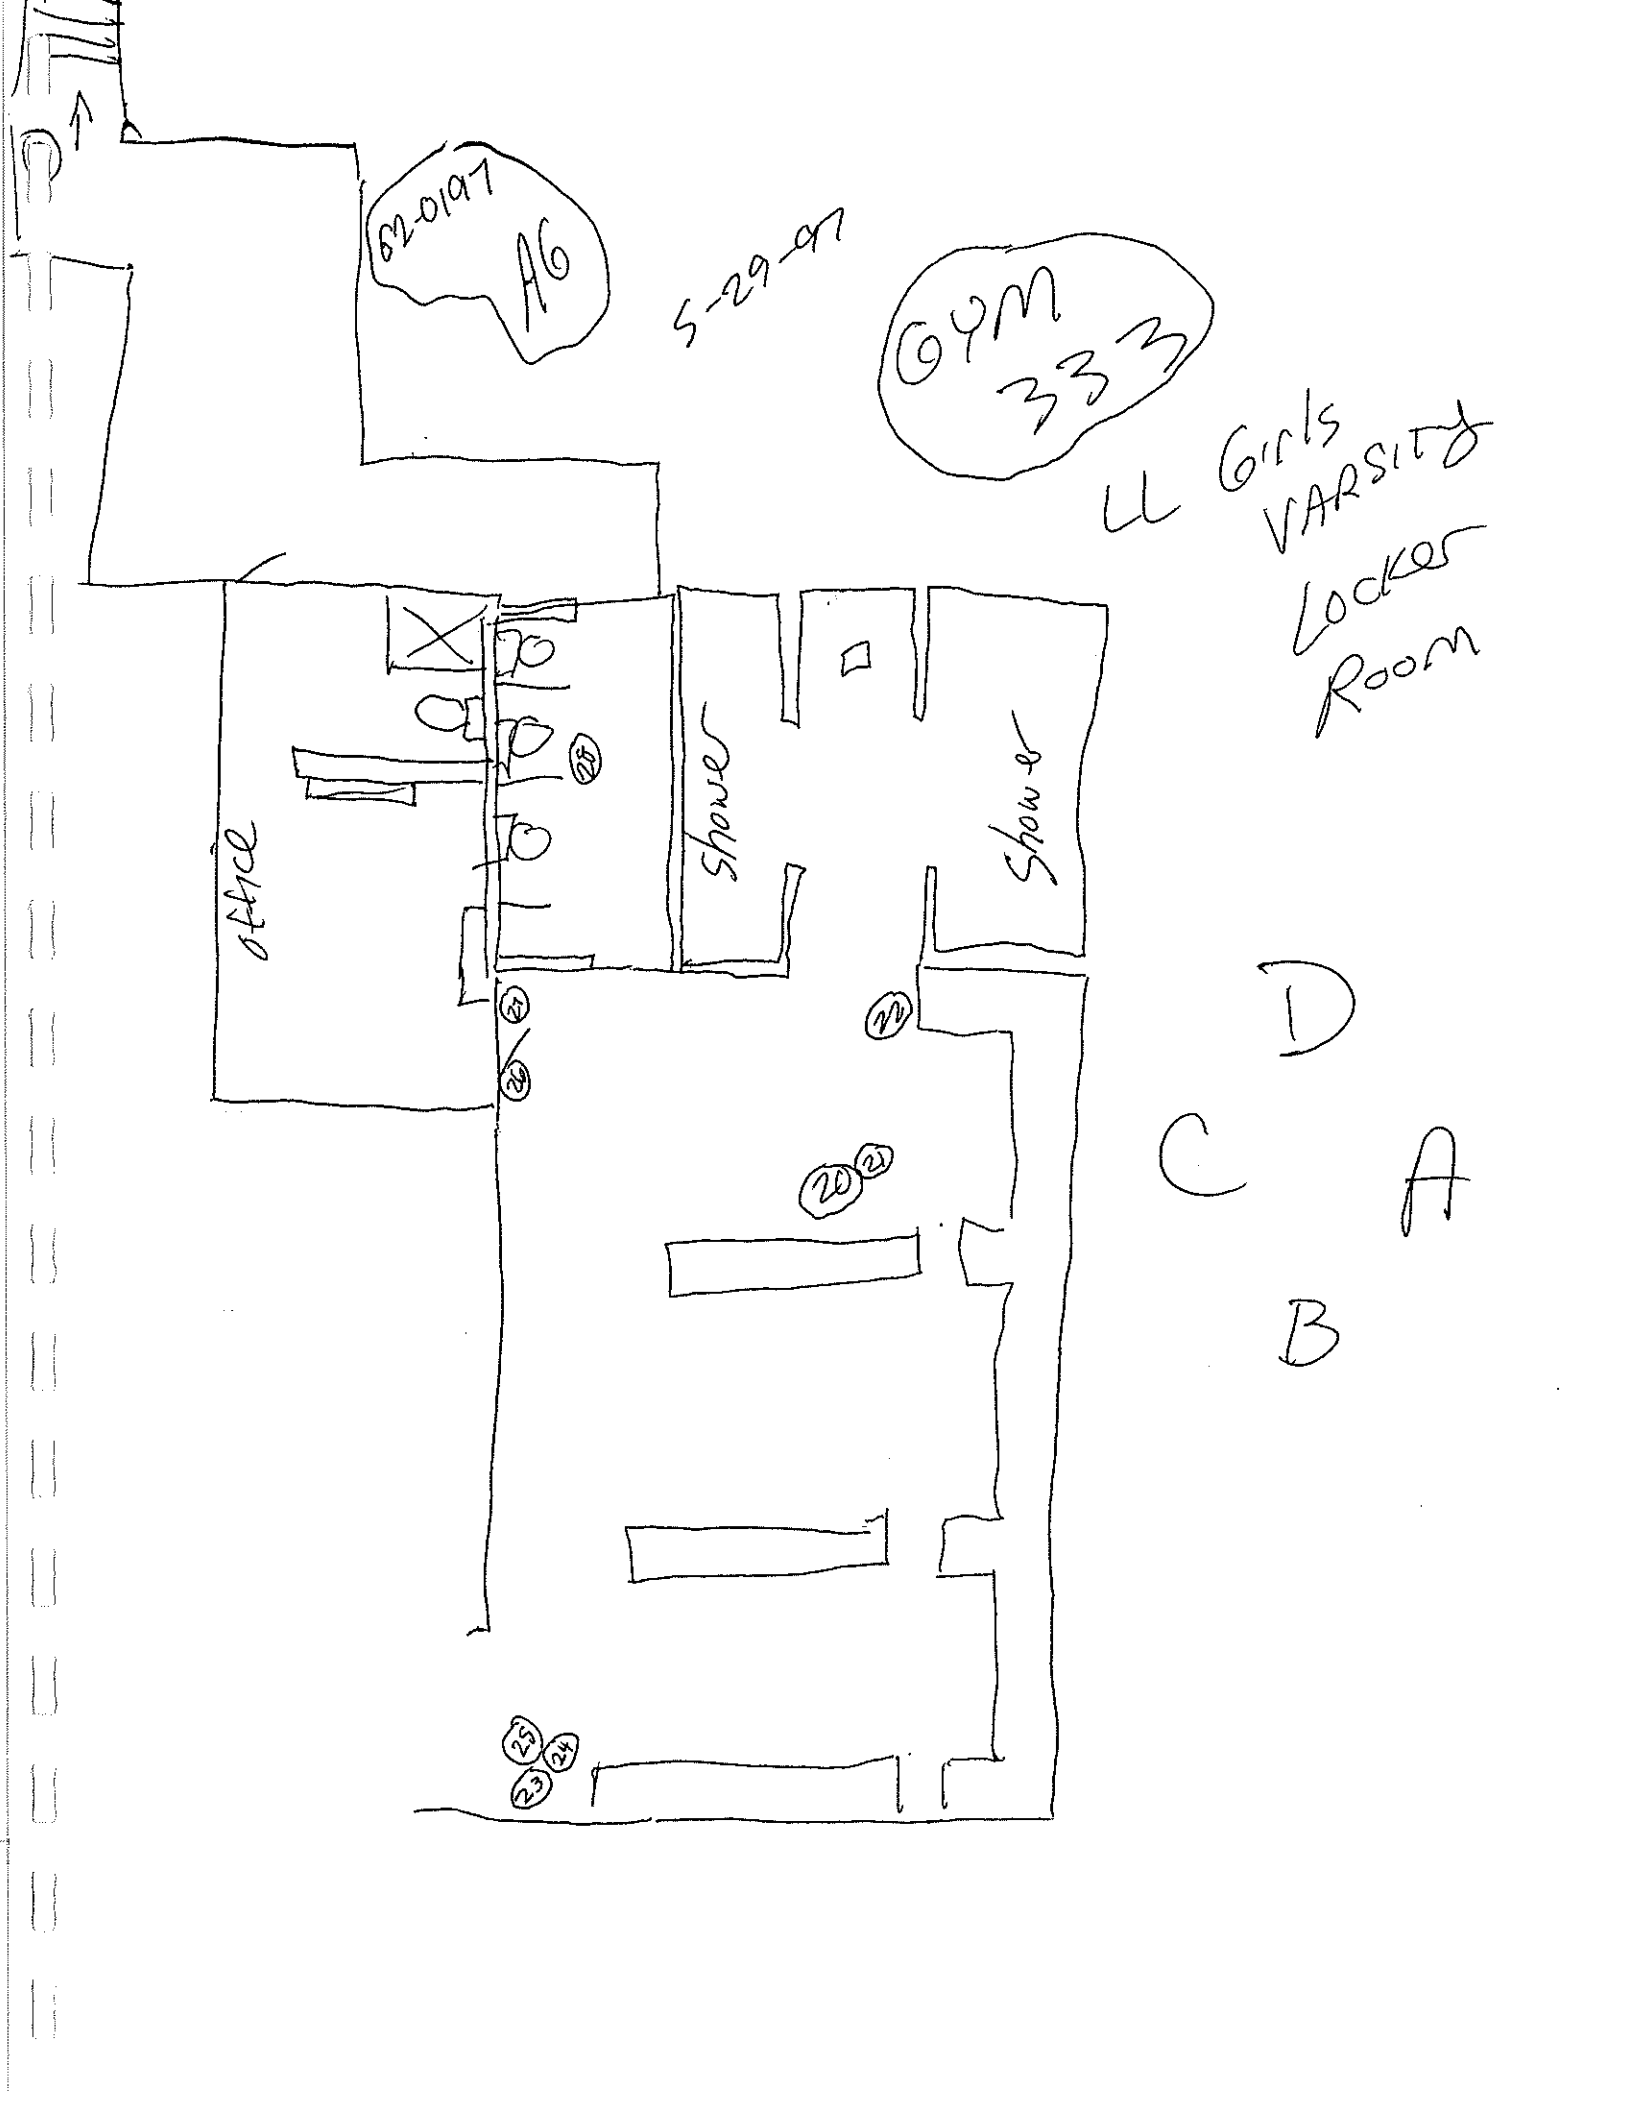

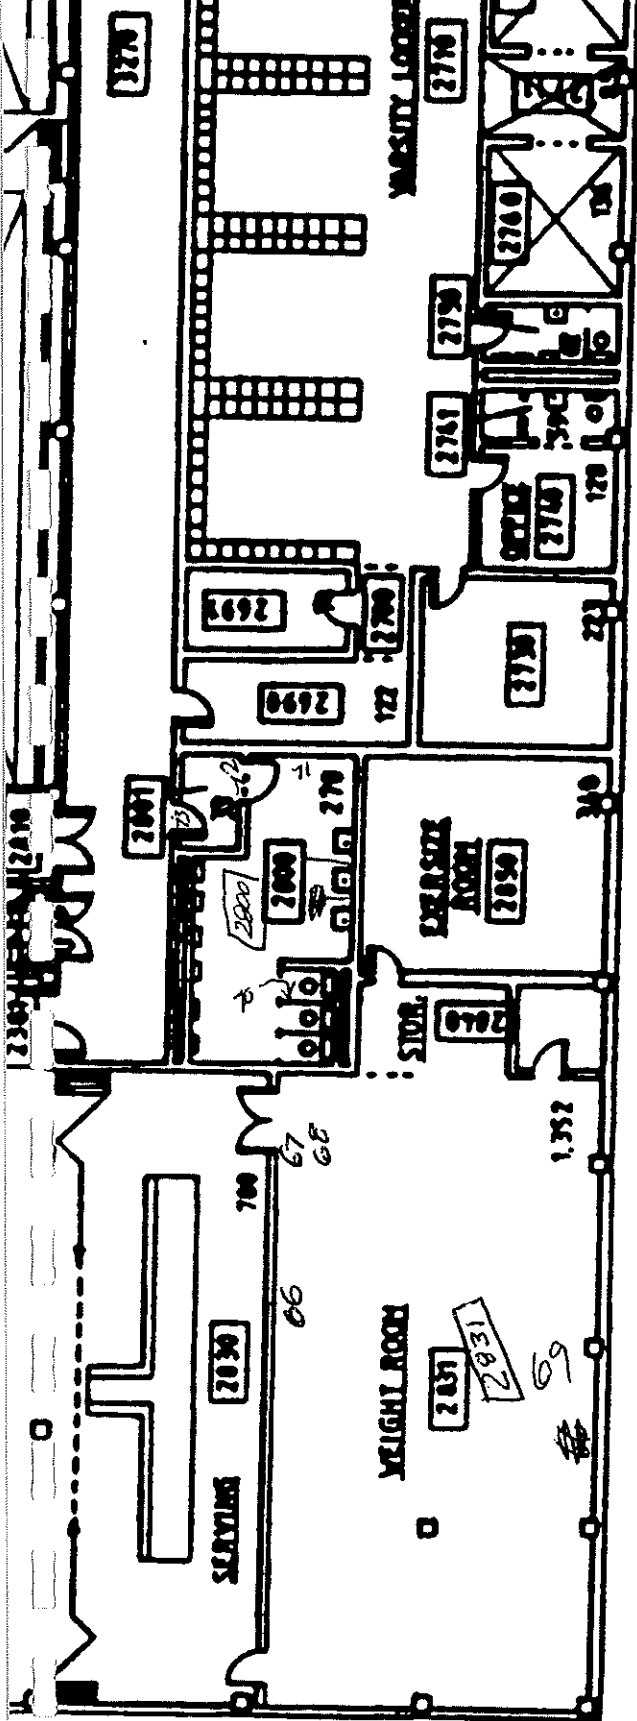


C
B D
A



INDEPENDENT SCHOOL DIST. #625

360 COLBORNE STREET

ST. PAUL, MINNESOTA 55102

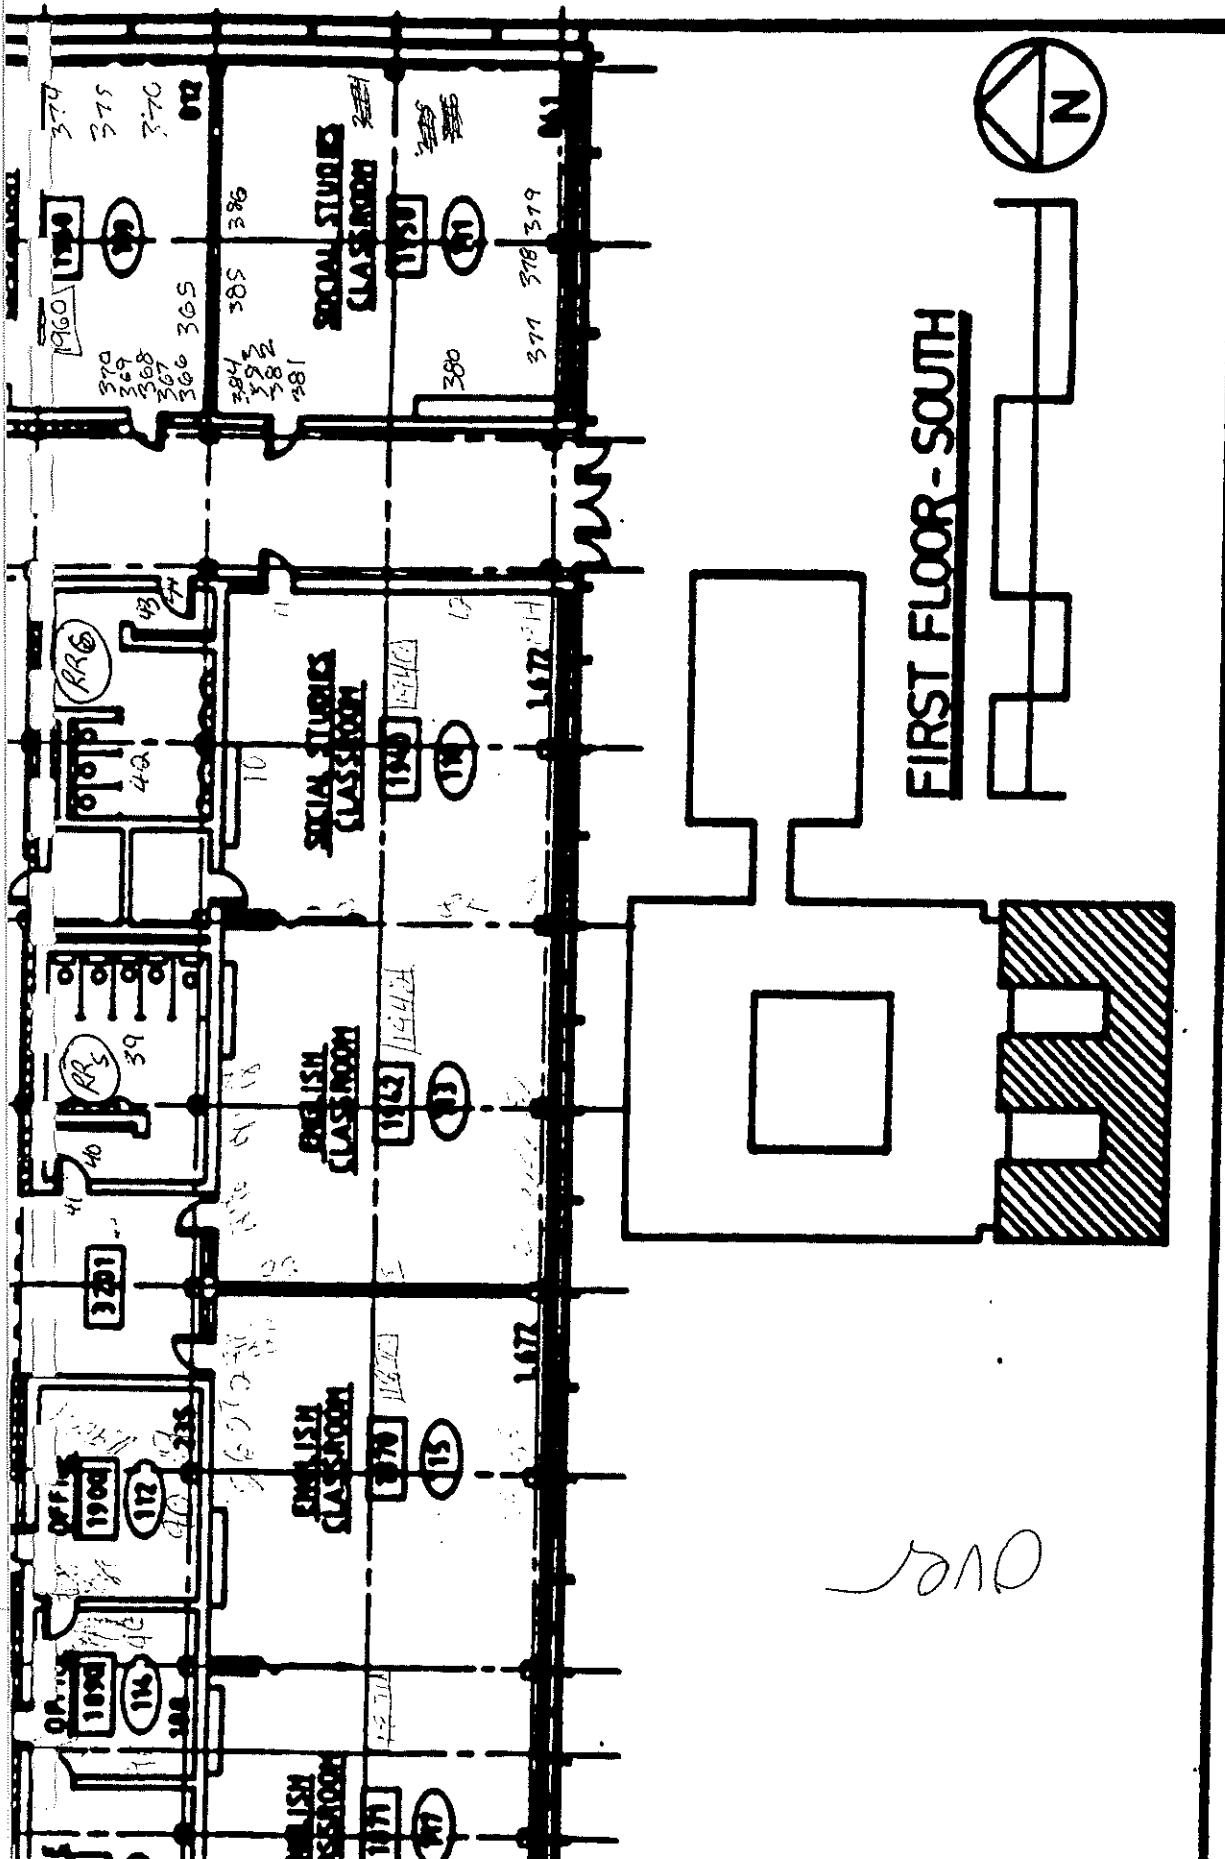



FIRST FLOOR - SOUTH

62-0197
 5-22-97
 5-24-97
 5-27-97
 Black
 Red
 Blue


over

INDEPENDENT SCHOOL DIST. 402
360 COLBORNE STREET
ST. PAUL, MINNESOTA 55102

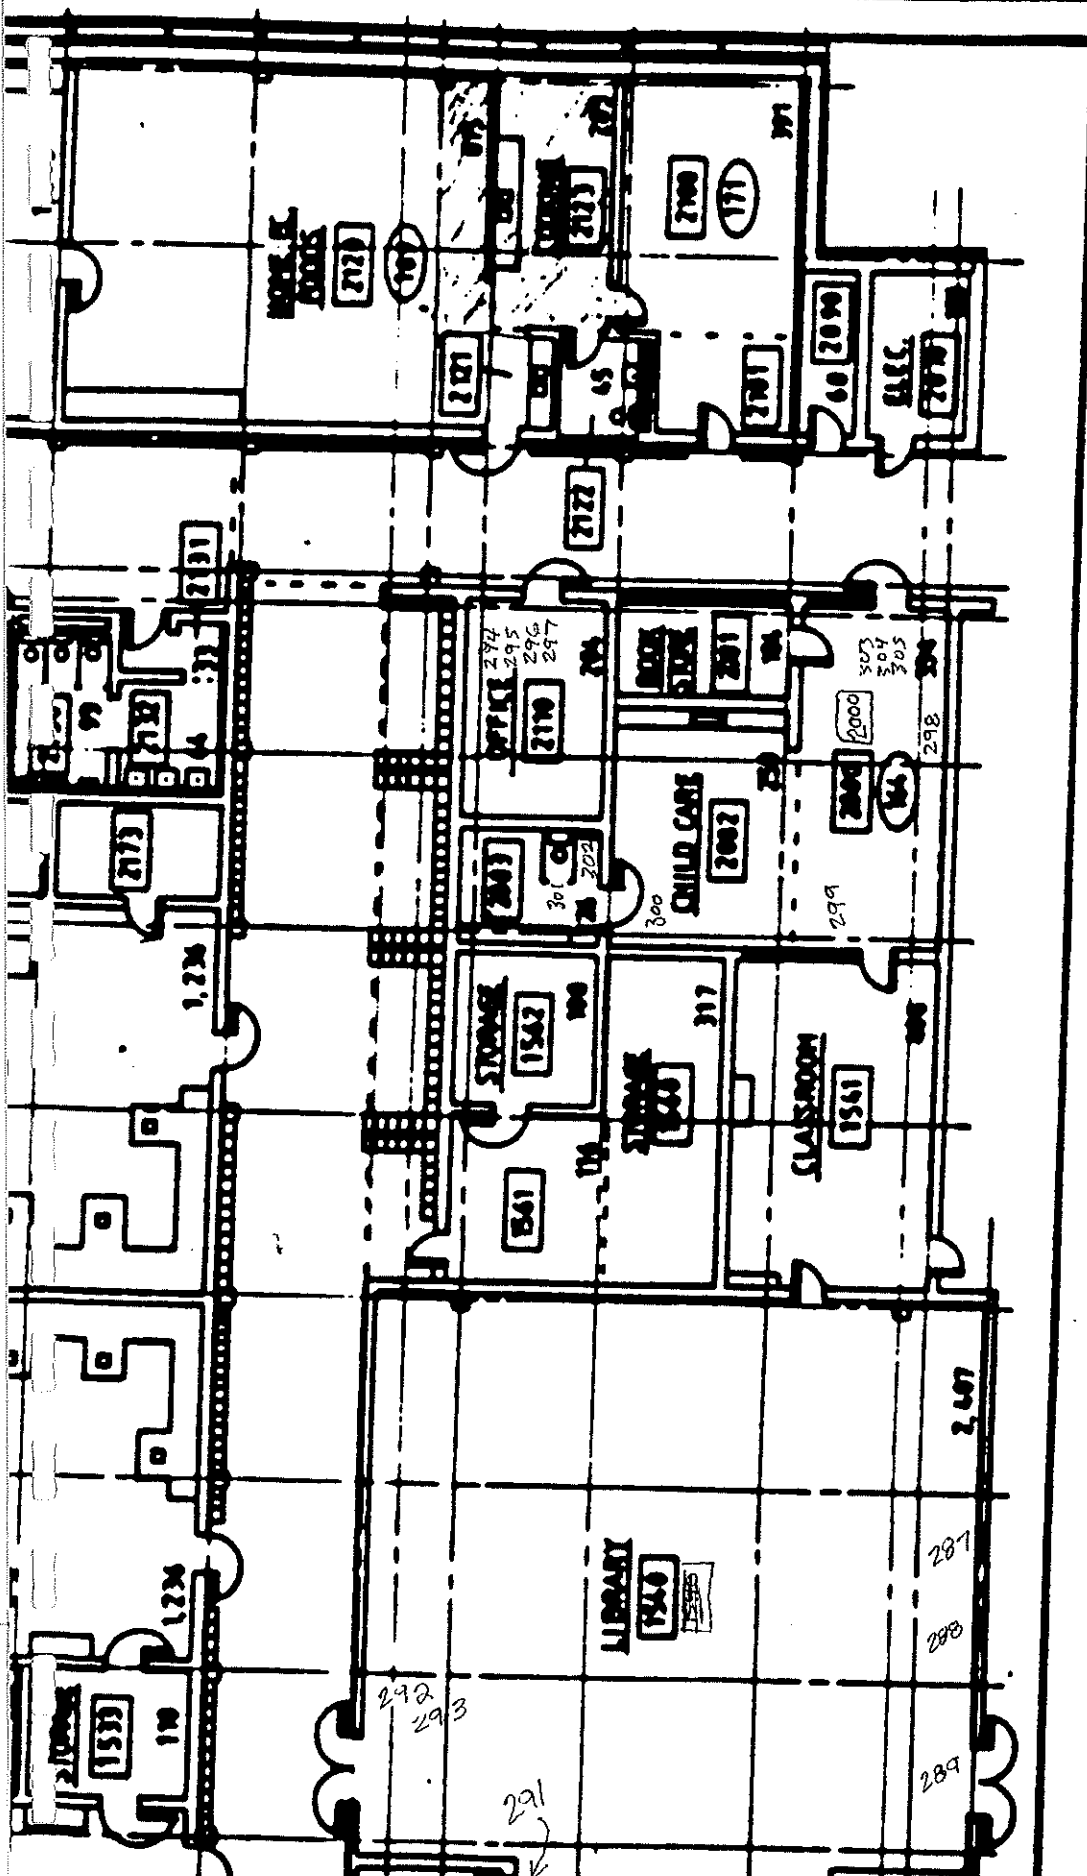

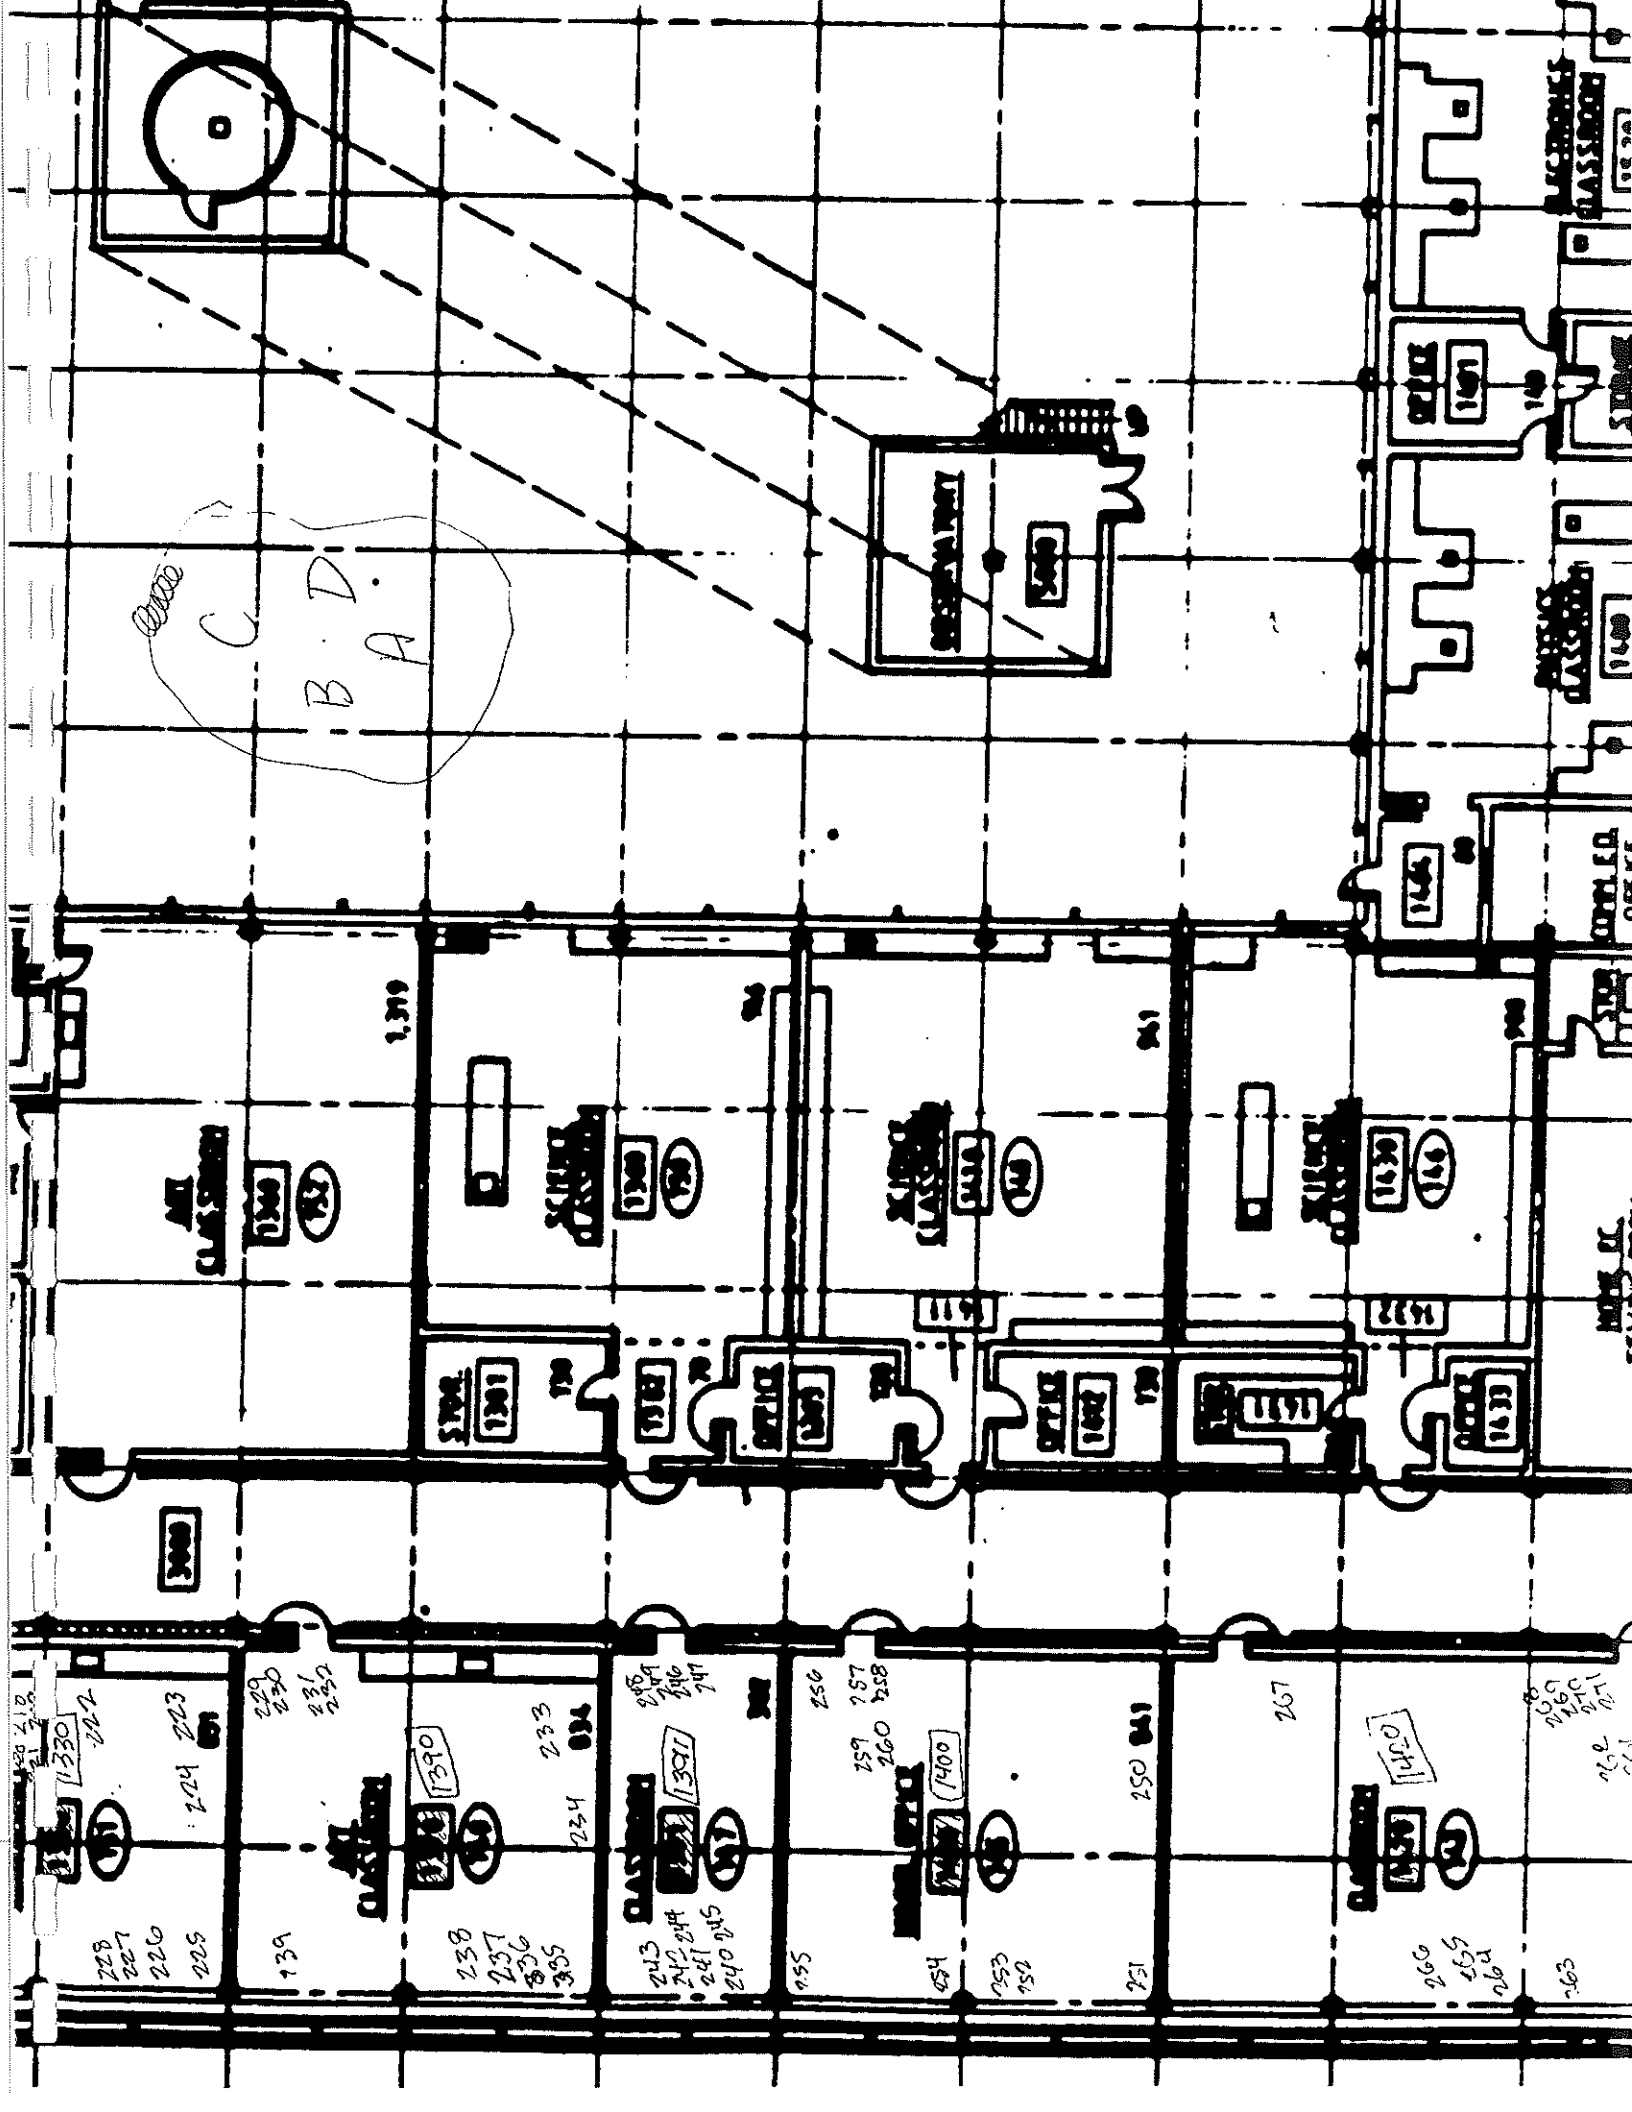




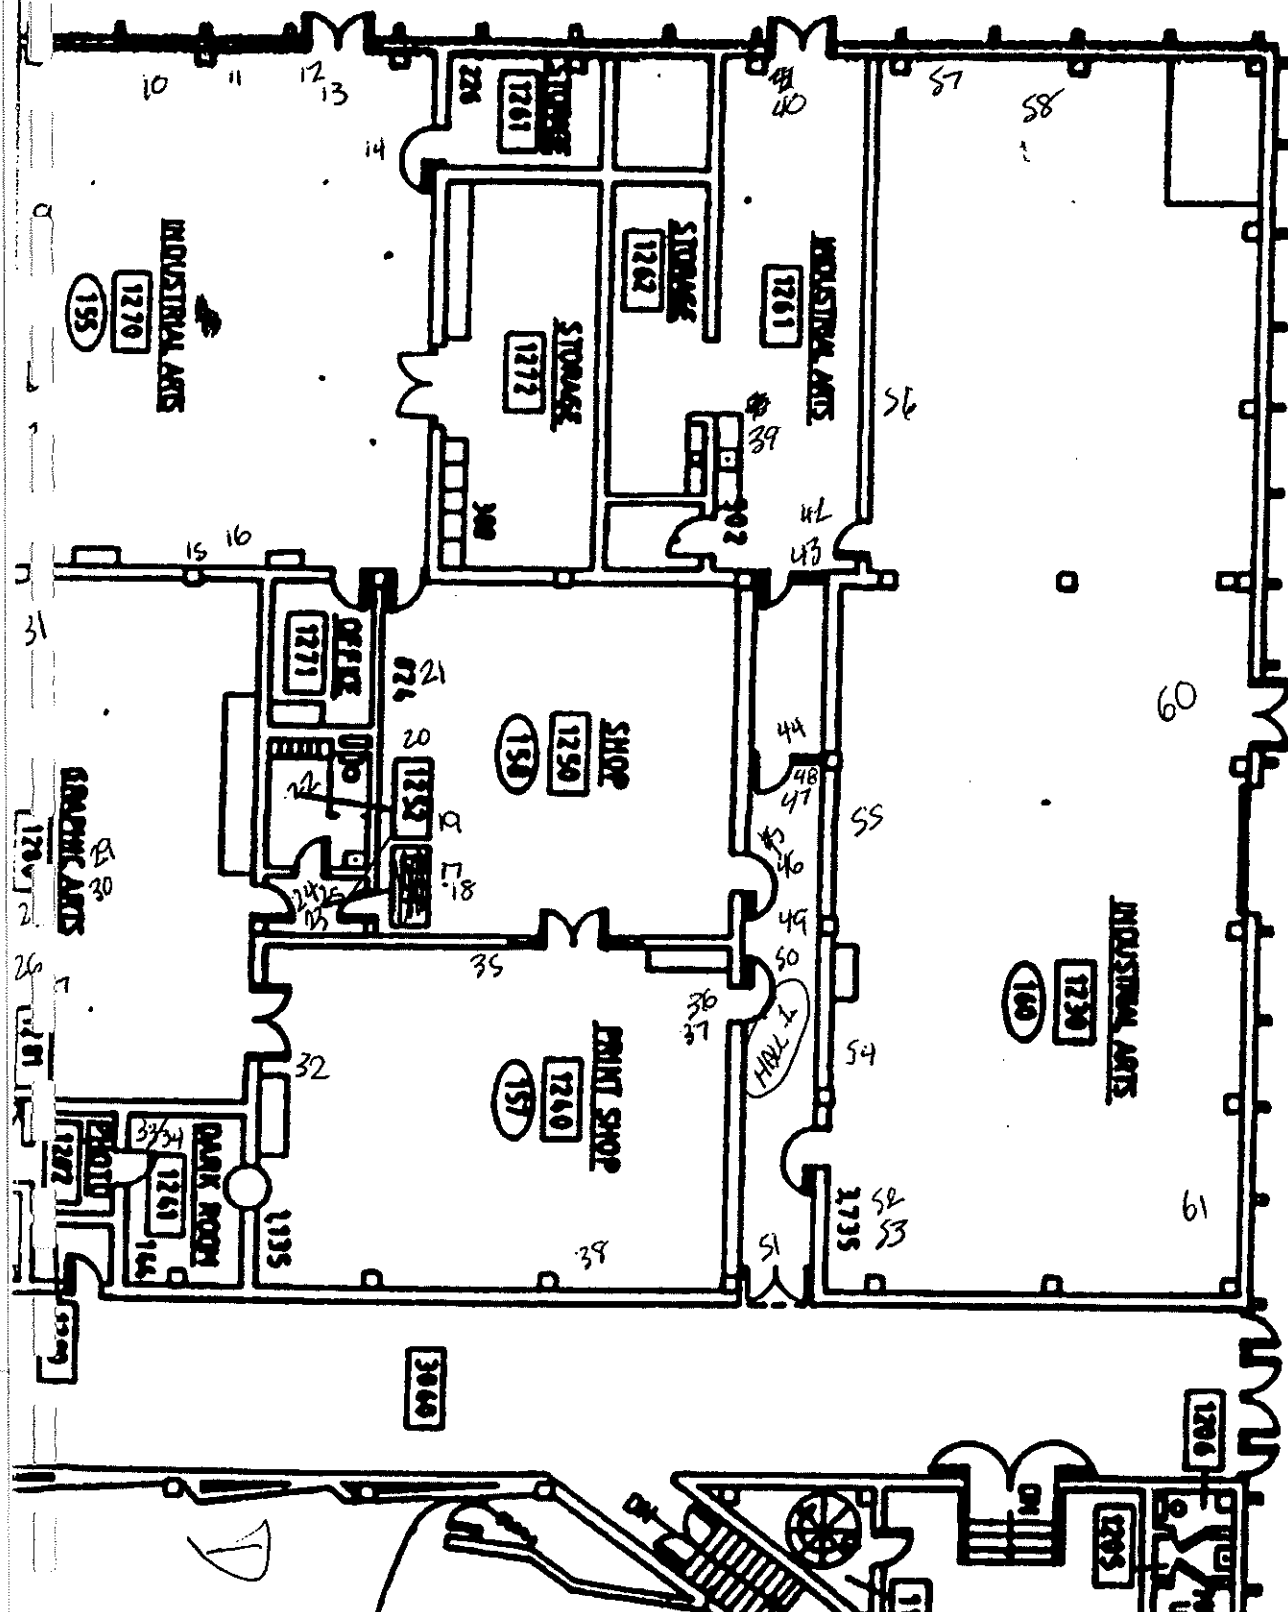

62 0197 A 6

D

CLASSROOM 999

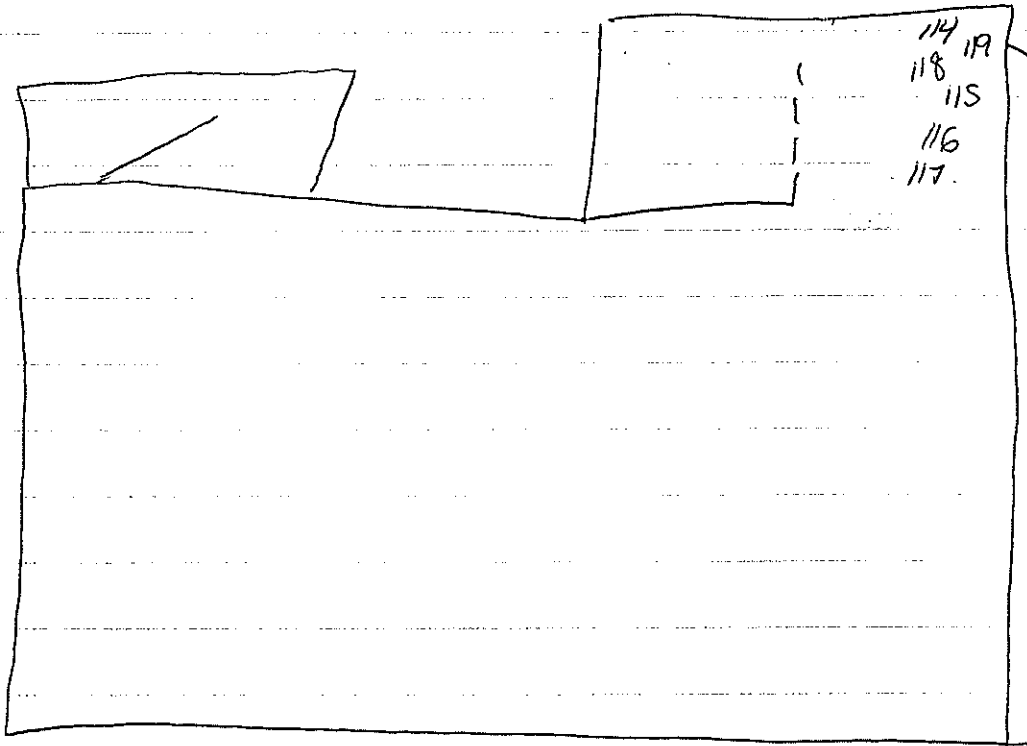



A

B


62-0197 A6
5-20-97

62-0197 A6
5-20-97

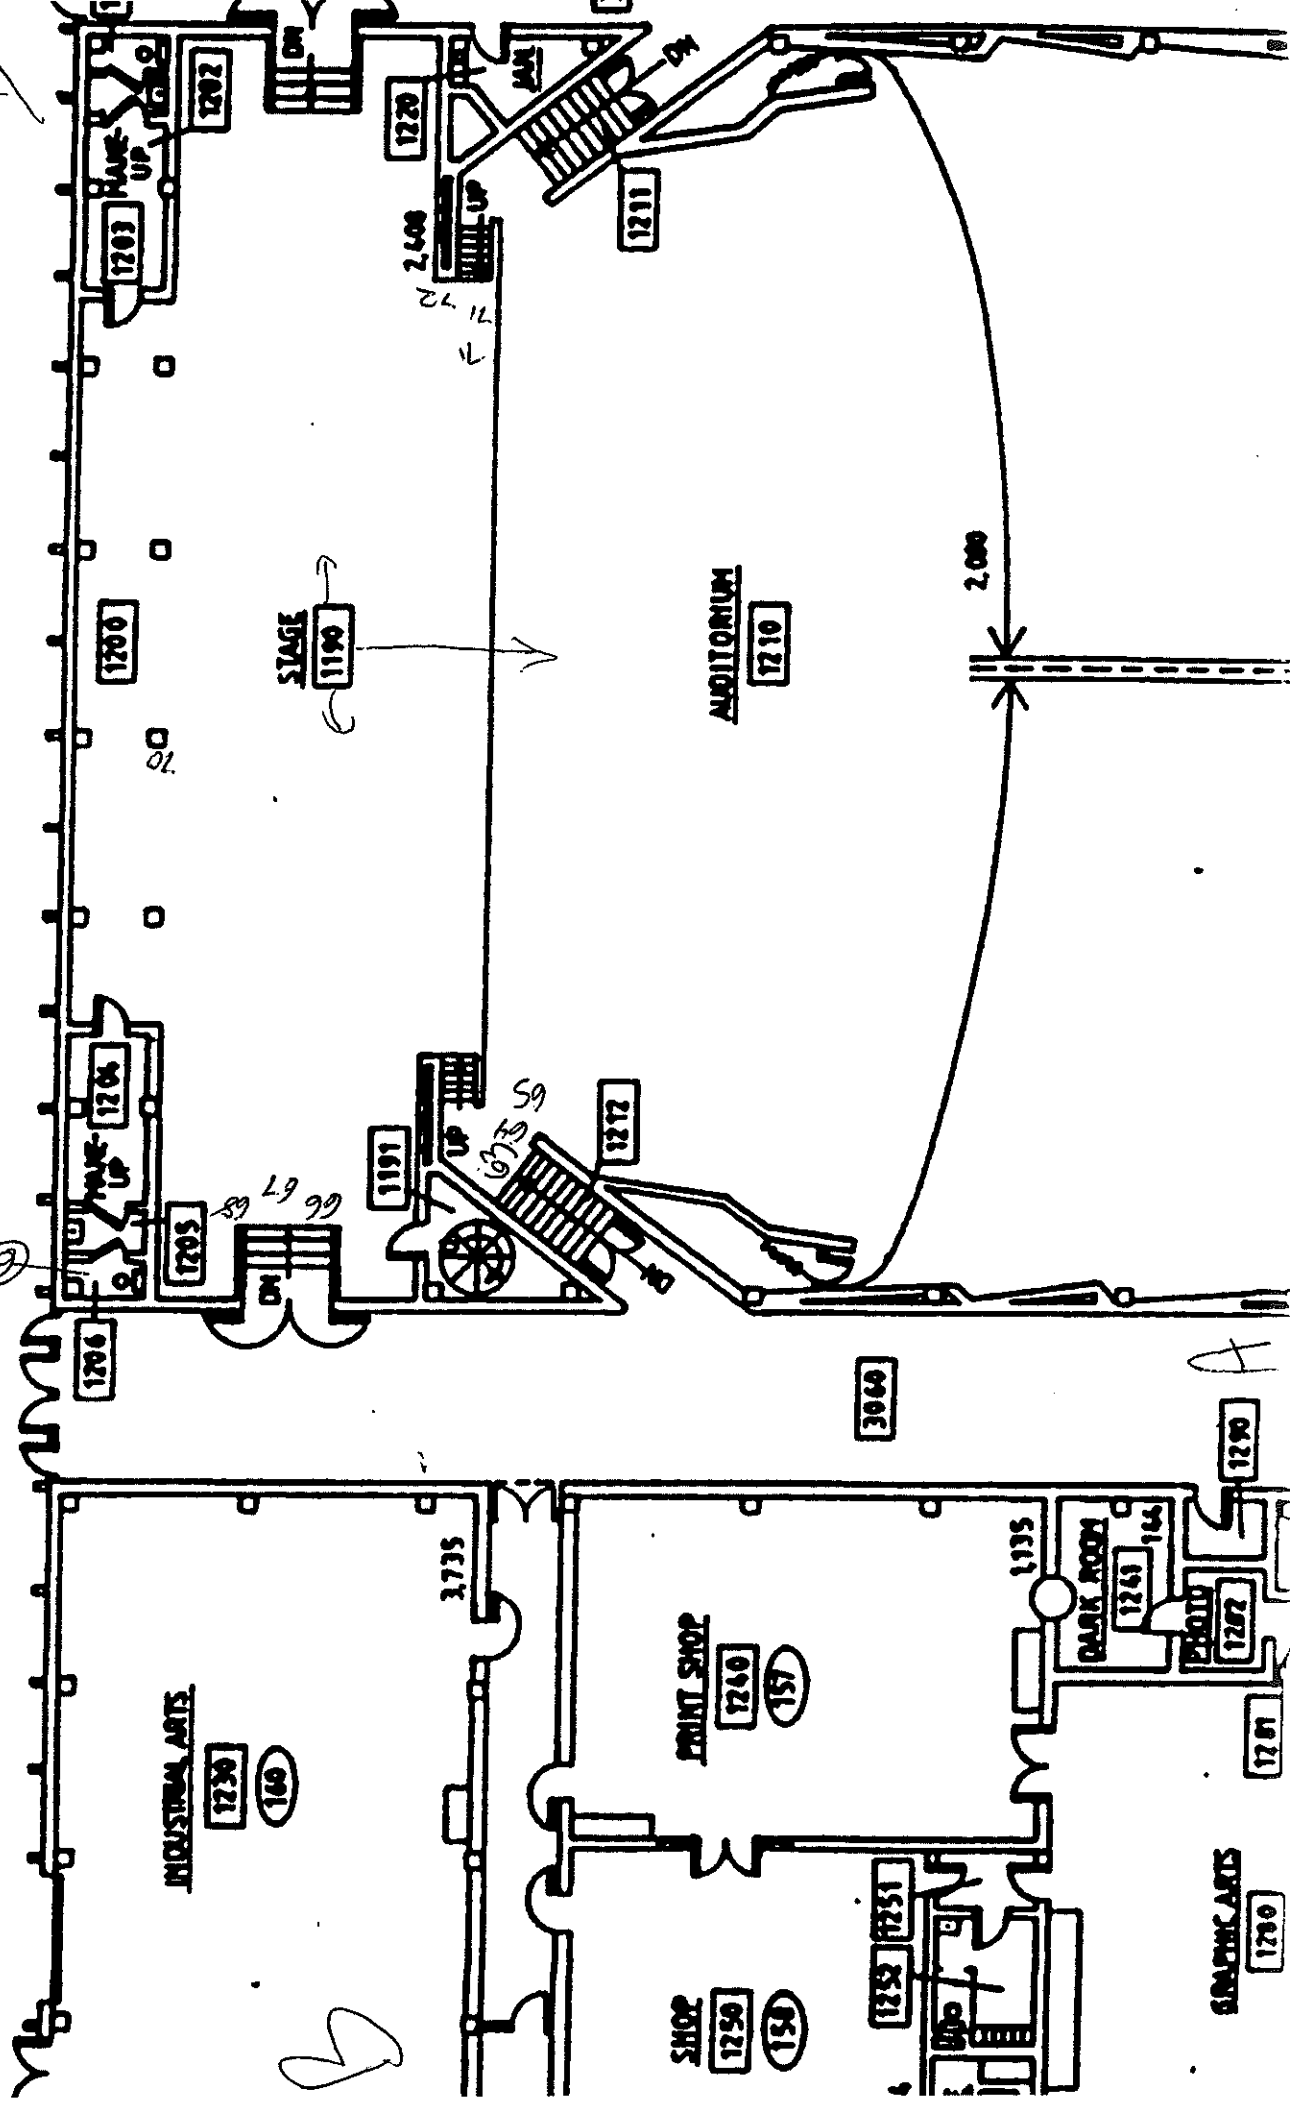

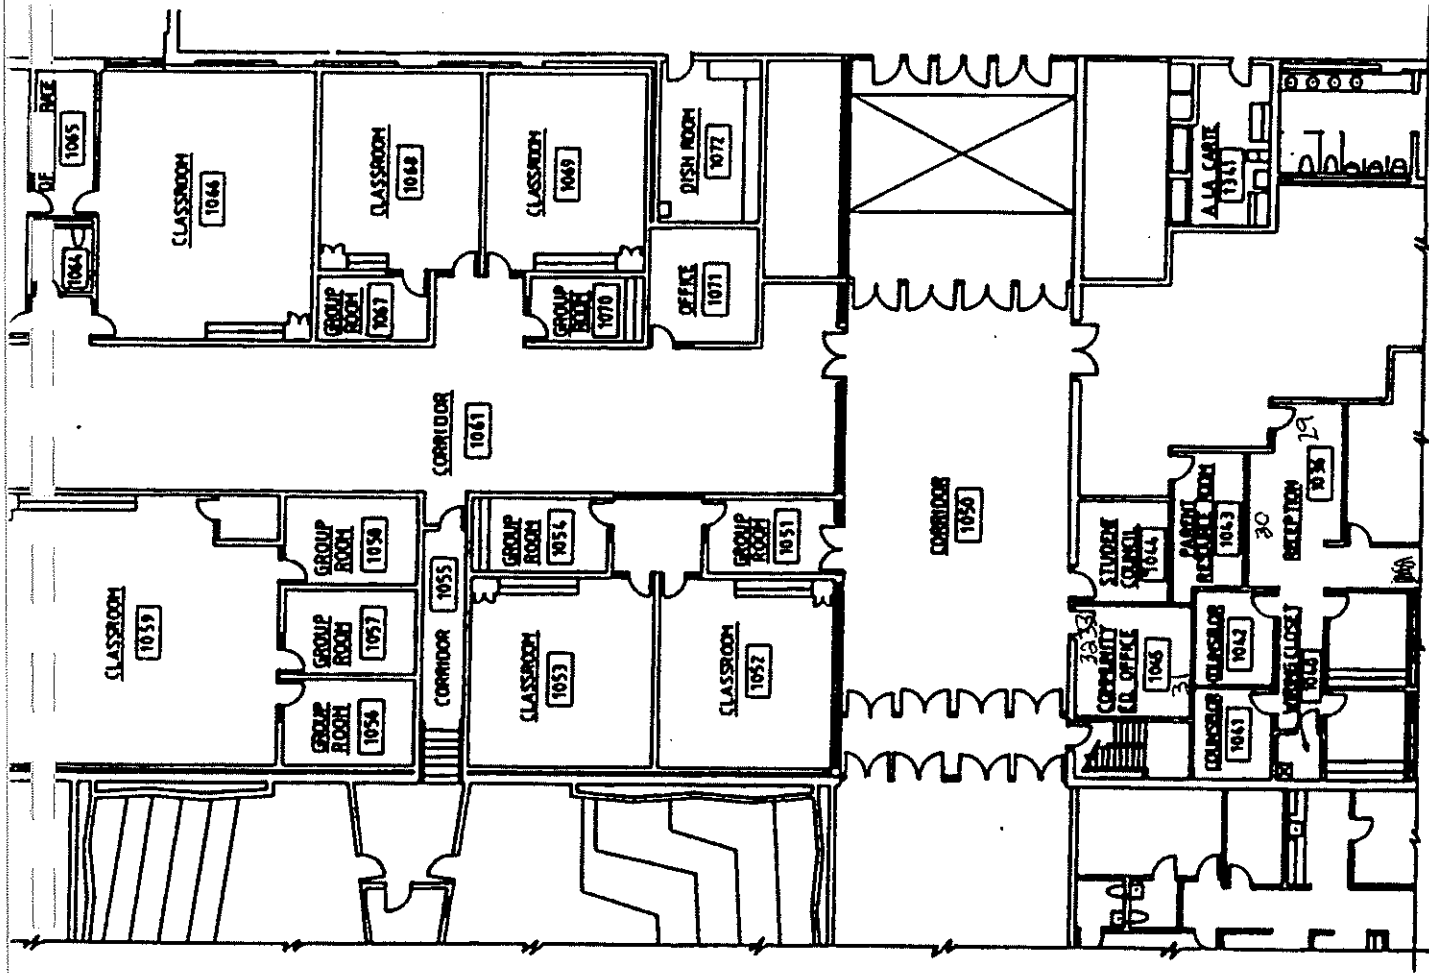


A
B
C
D

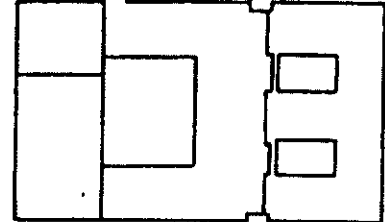

FIRST FLOOR - NOR



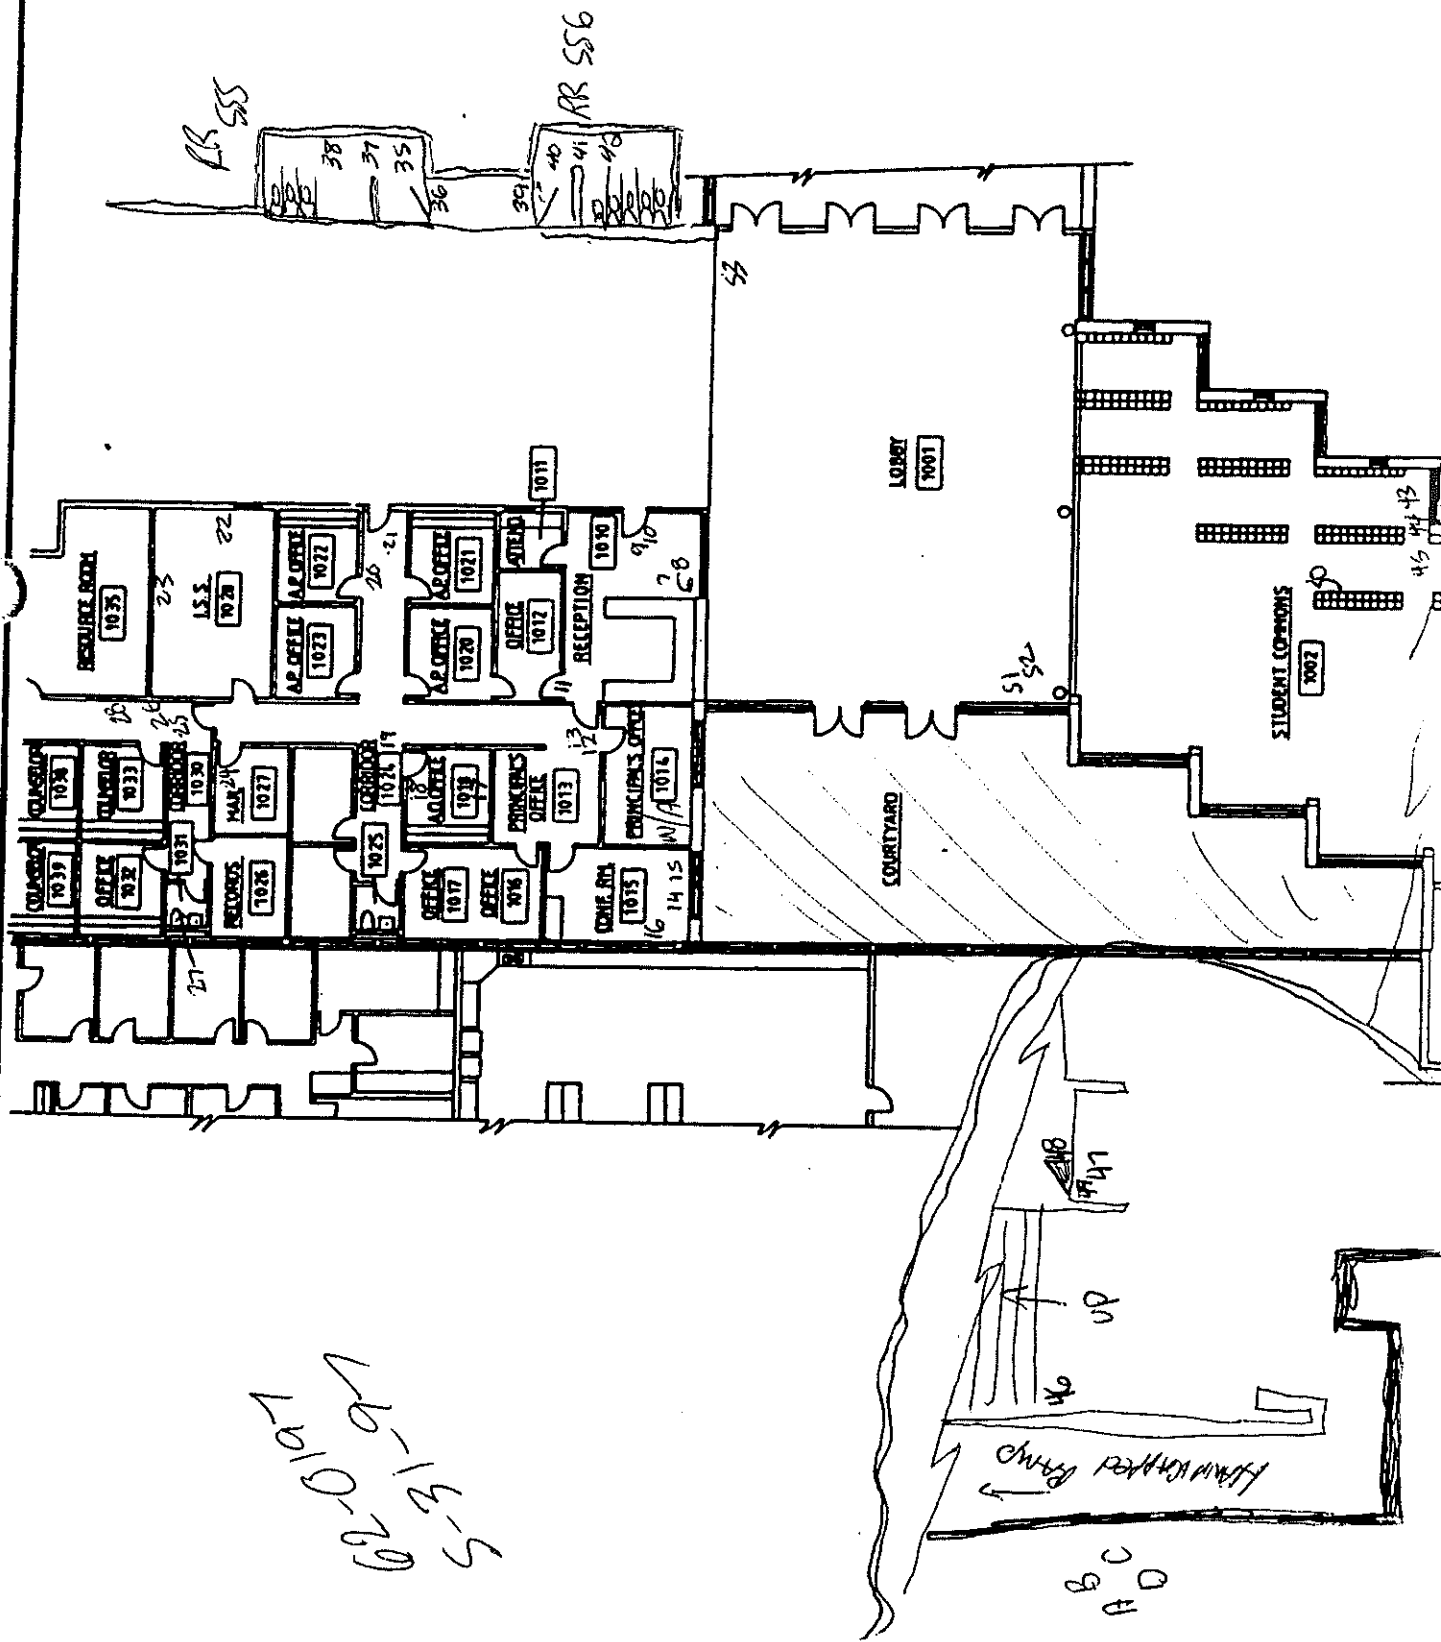

62-0-1017
5-3-1017



A
B
C
D

A
B
C
D


Handwritten Ramp

UP

Diagram showing a stepped profile with dimensions 8, 16, 32, and 48. A circular feature with a 'Z' inside is also shown.

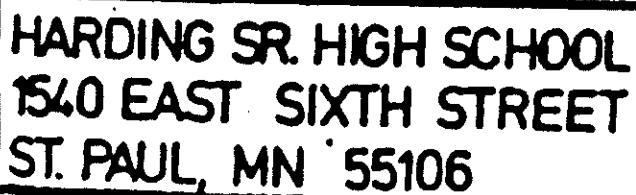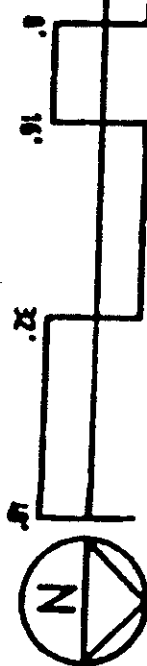

CONSTRUCTED 1963

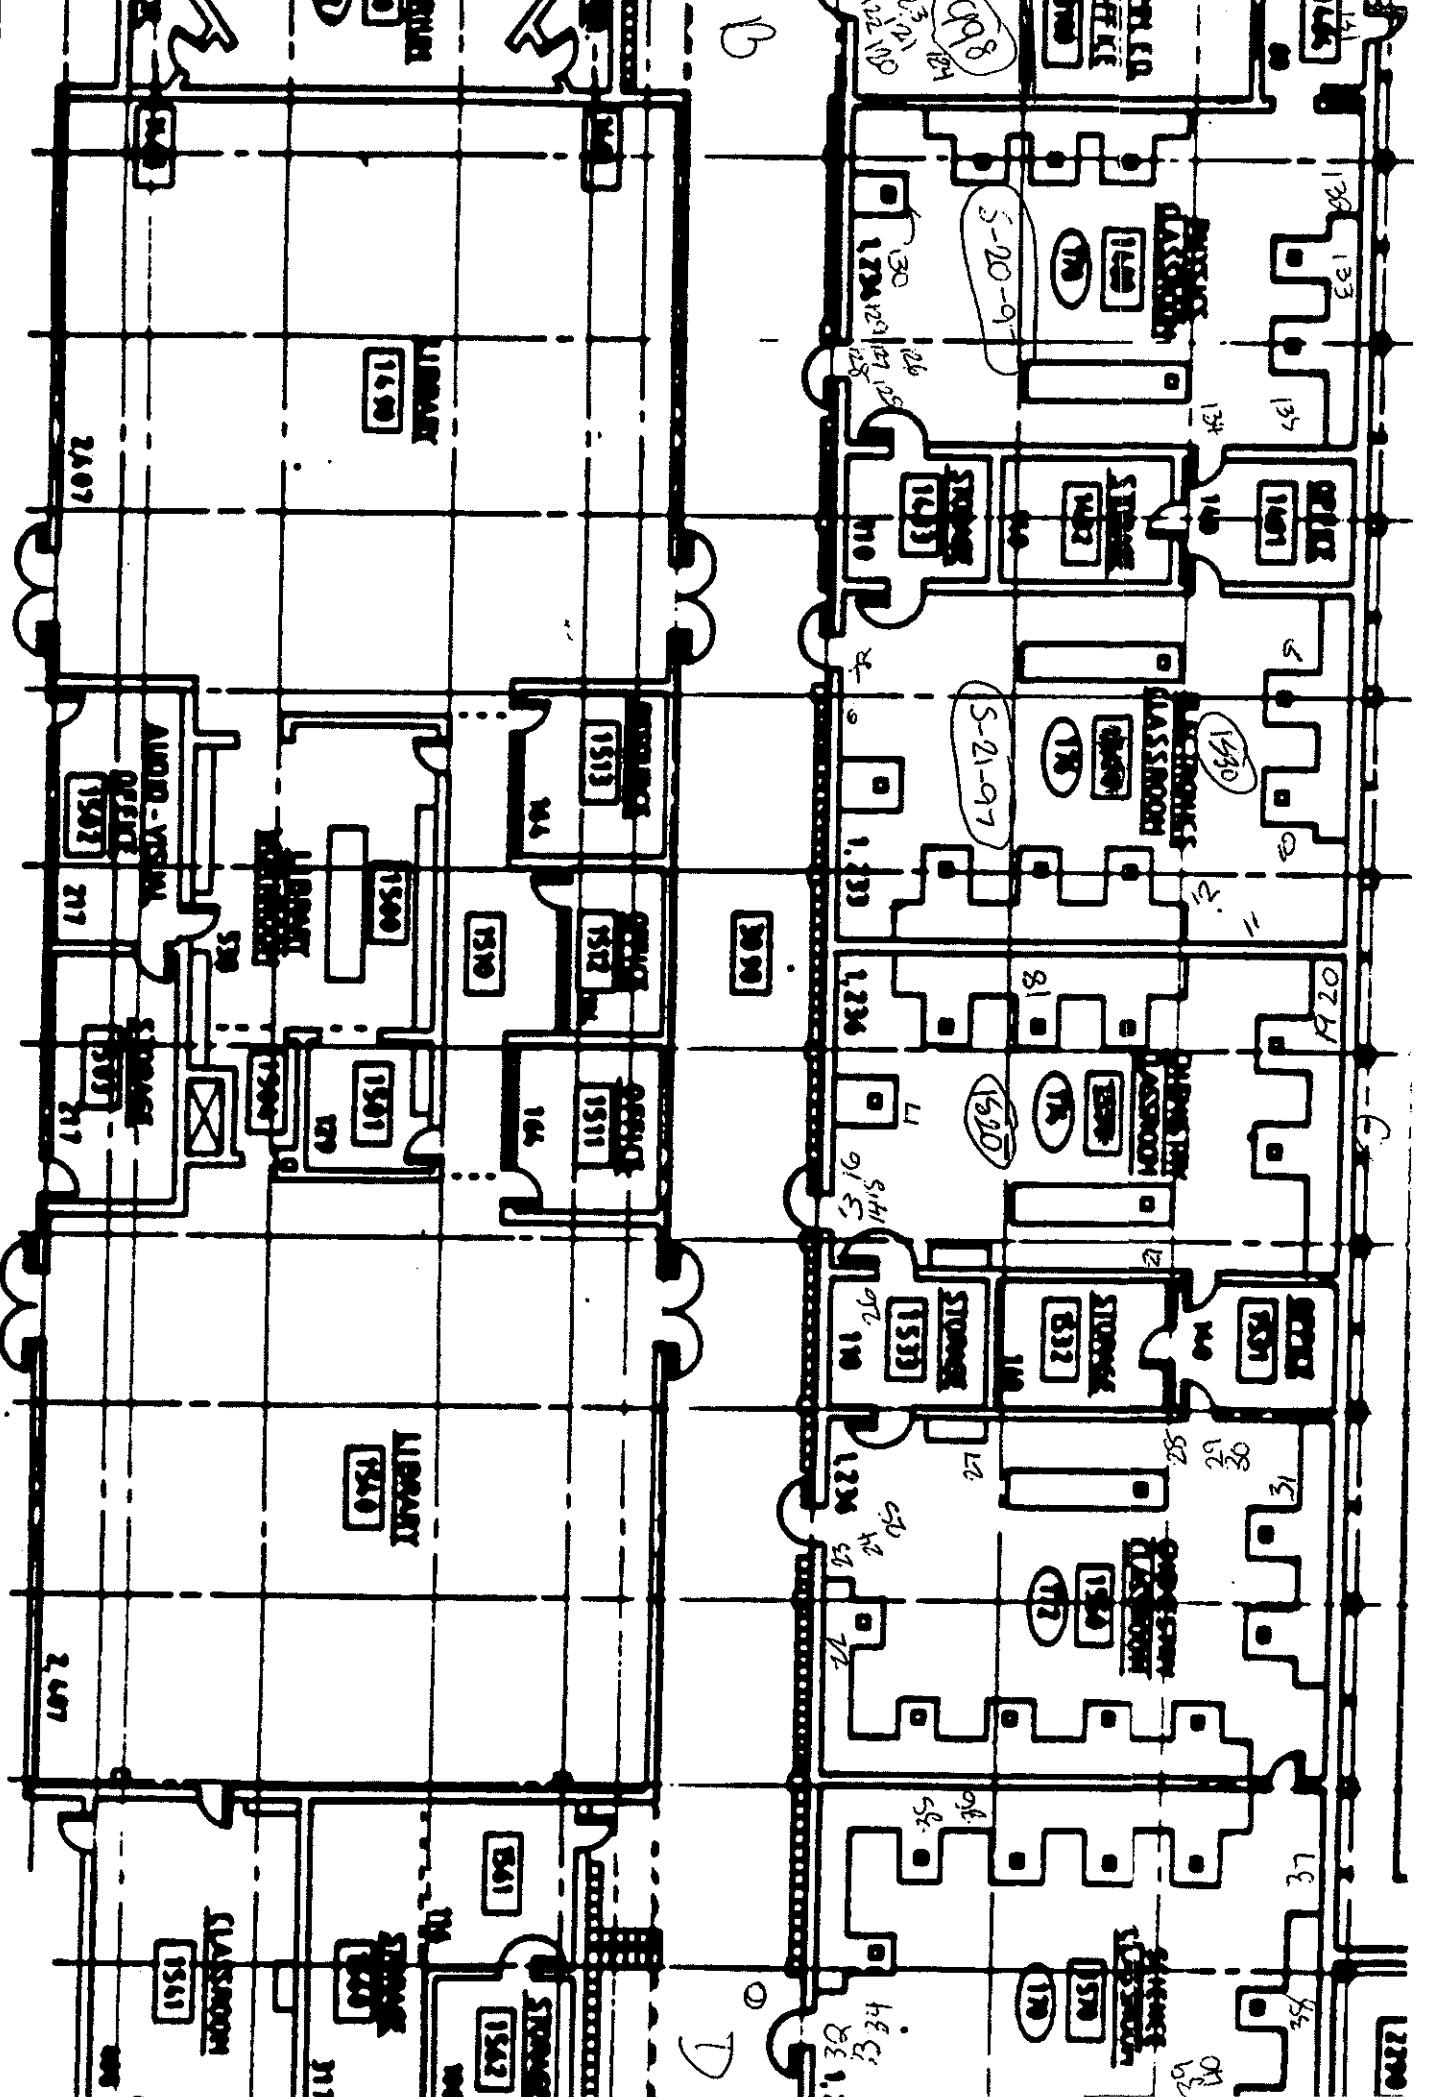

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1	Harding High School											
2												
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
4	1963 Bldg	63	XRF	5/20/97	1	Auditoriu	1190	Door	Door	Solid	Wood	0
5	1963 Bldg	64	XRF	5/20/97	1	Auditoriu	1190	Door	Casing	Solid	Metal	0.06
6	1963 Bldg	65	XRF	5/20/97	1	Auditoriu	1190	Fire Extinguish	Cabinet	Solid	Metal	0.01
7	1963 Bldg	66	XRF	5/20/97	1	Auditoriu	1190	Wall	Midle Wall	Solid	Concrte	0.06
8	1963 Bldg	67	XRF	5/20/97	1	Auditoriu	1190	Door	Door	Solid	Metal	0.02
9	1963 Bldg	68	XRF	5/20/97	1	Auditoriu	1190	Stairs	Hand rail	Solid	Metal	0.04
10	1963 Bldg	69	XRF	5/20/97	1	Auditoriu	1190		Radiator	Solid	Metal	0.27
11	1963 Bldg	70	XRF	5/20/97	1	Auditoriu	1190	Column	Wall	Solid	Plaster	0.03
12	1963 Bldg	71	XRF	5/20/97	1	Auditoriu	1190	Floor		Solid	Wood	0
13	1963 Bldg	72	XRF	5/20/97	1	Auditoriu	1190	Stairs	Tread	Solid	Wood	0
14	1963 Bldg	306	XRF	5/22/97	1	Auditoriu	1460	Wall	Midle Wall	Solid	Concrte	0.03
15	1963 Bldg	307	XRF	5/22/97	1	Auditoriu	1460	Wall	Mural	Solid	Concrte	0.03
16	1963 Bldg	308	XRF	5/22/97	1	Auditoriu	1460	Wall	Wall	Solid	Concrte	0.01
17	1963 Bldg	309	XRF	5/22/97	1	Auditoriu	1460	Door	Door	Solid	Wood	0
18	1963 Bldg	310	XRF	5/22/97	1	Auditoriu	1460	Window	Casing	Solid	Metal	0.05
19	1963 Bldg	311	XRF	5/22/97	1	Auditoriu	1460	Door	Header	Solid	Wood	0.08
20	1963 Bldg	312	XRF	5/22/97	1	Auditoriu	1460	Support Beam		Solid	Metal	0.06
21	1963 Bldg	313	XRF	5/22/97	1	Auditoriu	1460	Support Beam		Solid	Metal	0.06
22	1963 Bldg	54	XRF	5/28/97	1	Cafeteria	1	Wall	Wall	Solid	Wood	0.01
23	1963 Bldg	55	XRF	5/28/97	1	Cafeteria	1	Door	Door	Solid	Metal	0
24	1963 Bldg	56	XRF	5/28/97	1	Cafeteria	1	Door	Casing	Solid	Metal	0
25	1963 Bldg	57	XRF	5/28/97	1	Cafeteria	1	Wall	Midle Wall	Solid	Concrte	0
26	1963 Bldg	58	XRF	5/28/97	1	Cafeteria	1	Wall	Midle Wall	Solid	Drywall	0
27	1963 Bldg	59	XRF	5/28/97	1	Cafeteria	1	Door	Door	Solid	Wood	0
28	1963 Bldg	60	XRF	5/28/97	1	Cafeteria	1	Door	Casing	Solid	Wood	0
29	1963 Bldg	61	XRF	5/28/97	1	Cafeteria	1	Door	Door	Solid	Metal	0.01
30	1963 Bldg	62	XRF	5/28/97	1	Cafeteria	1	Door	Casing	Solid	Metal	0.13
31	1963 Bldg	63	XRF	5/28/97	1	Cafeteria	1	Wall	Midle Wall	Solid	Wood	0
32	1963 Bldg	64	XRF	5/28/97	1	Cafeteria	1	Door	Header	Solid	Wood	0
33	1963 Bldg	65	XRF	5/28/97	1	Cafeteria	1	Door	Door	Solid	Wood	0
34	1963 Bldg	46	XRF	5/29/97	1	Cafeteria	2400	Door	Door	Solid	Wood	0
35	1963 Bldg	47	XRF	5/29/97	1	Cafeteria	2400	Door	Casing	Solid	Metal	0.05
36	1963 Bldg	48	XRF	5/29/97	1	Cafeteria	2400		Elec Panel	Solid	Metal	0.02
37	1963 Bldg	49	XRF	5/29/97	1	Cafeteria	2400	Door	Door	Solid	Wood	0
38	1963 Bldg	50	XRF	5/29/97	1	Cafeteria	2400	Door	Casing	Solid	Wood	0
39	1963 Bldg	51	XRF	5/29/97	1	Cafeteria	2400	Wall	Midle Wall	Solid	Concrte	0.02
40	1963 Bldg	52	XRF	5/29/97	1	Cafeteria	2400	Wall	Midle Wall	Solid	Concrte	0.02
41	1963 Bldg	53	XRF	5/29/97	1	Cafeteria	2400	Door	Casing	Solid	Metal	0
42	1963 Bldg	54	XRF	5/29/97	1	Cafeteria	2400	Door	Door	Solid	Metal	0
43	1963 Bldg	114	XRF	5/20/97	1	Classroo	999	Cabinet	Door	Solid	Wood	0
44	1963 Bldg	115	XRF	5/20/97	1	Classroo	999	Door	Casing	Solid	Metal	0.05
45	1963 Bldg	116	XRF	5/20/97	1	Classroo	999	Door	Door	Solid	Wood	0
46	1963 Bldg	117	XRF	5/20/97	1	Classroo	999	Door	Door	Solid	Wood	0
47	1963 Bldg	118	XRF	5/20/97	1	Classroo	999	Wall	Midle Wall	Solid	Concrte	0.05
48	1963 Bldg	119	XRF	5/20/97	1	Classroo	999	Door	Header	Solid	Wood	0.03
49	1963 Bldg	45	XRF	5/27/97	1	Classroo	1051	Door	Door	Solid	Wood	0
50	1963 Bldg	46	XRF	5/27/97	1	Classroo	1051	Door	Casing	Solid	Metal	0.06
51	1963 Bldg	47	XRF	5/27/97	1	Classroo	1051	Wall	Midle Wall	Solid	Concrte	0.07
52	1963 Bldg	48	XRF	5/27/97	1	Classroo	1051	Wall	Midle Wall	Solid	Concrte	0.06
53	1963 Bldg	49	XRF	5/27/97	1	Classroo	1051	Wall	Midle Wall	Solid	Concrte	0.05
54	1963 Bldg	50	XRF	5/27/97	1	Classroo	1051	Support Beam		Solid	Metal	0.04
55	1963 Bldg	51	XRF	5/27/97	1	Classroo	1051	Support Beam		Solid	Metal	0.1
56	1963 Bldg	52	XRF	5/27/97	1	Classroo	1051	Door	Header	Solid	Wood	0.02
57	1963 Bldg	53	XRF	5/27/97	1	Classroo	1051	Door	Header	Solid	Wood	0.01
58	1963 Bldg	54	XRF	5/27/97	1	Classroo	1051	Wall	Midle Wall	Solid	Wood	0.02
59	1963 Bldg	55	XRF	5/27/97	1	Classroo	1051	Wall	Wall	Solid	Concrte	0.03
60	1963 Bldg	91	XRF	5/29/97	1	Classroo	1052	Wall	Wall	Solid	Drywall	0

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
61	1963 Bldg	92	XRF	5/29/97	1	Classroom	1052	Wall	Midle Wall	Solid	Concrte	0
62	1963 Bldg	93	XRF	5/29/97	1	Classroom	1052	Door	Door	Solid	Wood	0
63	1963 Bldg	94	XRF	5/29/97	1	Classroom	1052	Window	Casing	Solid	Metal	0
64	1963 Bldg	95	XRF	5/29/97	1	Classroom	1053	Wall	Wall	Solid	Drywall	0
65	1963 Bldg	96	XRF	5/29/97	1	Classroom	1053	Wall	Midle Wall	Solid	Concrte	0.01
66	1963 Bldg	97	XRF	5/29/97	1	Classroom	1053	Door	Door	Solid	Wood	0
67	1963 Bldg	98	XRF	5/29/97	1	Classroom	1053	Door	Casing	Solid	Metal	0
68	1963 Bldg	108	XRF	5/29/97	1	Classroom	1063	Wall	Midle Wall	Solid	Concrte	0
69	1963 Bldg	109	XRF	5/29/97	1	Classroom	1063	Door	Door	Solid	Wood	0
70	1963 Bldg	110	XRF	5/29/97	1	Classroom	1063	Window	Casing	Solid	Metal	0
71	1963 Bldg	111	XRF	5/29/97	1	Classroom	1063	Wall	Wall	Solid	Drywall	0.05
72	1963 Bldg	112	XRF	5/29/97	1	Classroom	1063	Window	Casing	Solid	Metal	0
73	1963 Bldg	113	XRF	5/29/97	1	Classroom	1063		Radiator	Solid	Metal	0
74	1963 Bldg	114	XRF	5/29/97	1	Classroom	1066	Wall	Wall	Solid	Drywall	0
75	1963 Bldg	115	XRF	5/29/97	1	Classroom	1066	Wall	Midle Wall	Solid	Concrte	0
76	1963 Bldg	116	XRF	5/29/97	1	Classroom	1066	Door	Door	Solid	Wood	0
77	1963 Bldg	117	XRF	5/29/97	1	Classroom	1066	Door	Casing	Solid	Metal	0
78	1963 Bldg	118	XRF	5/29/97	1	Classroom	1066		Radiator	Solid	Metal	0
79	1963 Bldg	119	XRF	5/29/97	1	Classroom	1066	Window	Casing	Solid	Metal	0
80	1963 Bldg	124	XRF	5/29/97	1	Classroom	1068	Wall	Midle Wall	Solid	Concrte	0.03
81	1963 Bldg	125	XRF	5/29/97	1	Classroom	1068	Door	Door	Solid	Wood	0
82	1963 Bldg	126	XRF	5/29/97	1	Classroom	1068	Door	Casing	Solid	Metal	0
83	1963 Bldg	127	XRF	5/29/97	1	Classroom	1068	Wall	Wall	Solid	Drywall	0
84	1963 Bldg	128	XRF	5/29/97	1	Classroom	1069	Wall	Midle Wall	Solid	Concrte	0
85	1963 Bldg	129	XRF	5/29/97	1	Classroom	1069	Wall	Wall	Solid	Drywall	0.01
86	1963 Bldg	130	XRF	5/29/97	1	Classroom	1069	Door	Door	Solid	Wood	0
87	1963 Bldg	131	XRF	5/29/97	1	Classroom	1069	Window	Casing	Solid	Metal	0
88	1963 Bldg	91	XRF	5/27/97	1	Classroom	1140	Cabinet	Casing	Solid	Wood	0
89	1963 Bldg	92	XRF	5/27/97	1	Classroom	1140	Door	Door	Solid	Wood	0
90	1963 Bldg	93	XRF	5/27/97	1	Classroom	1140	Door	Casing	Solid	Metal	0.19
91	1963 Bldg	94	XRF	5/27/97	1	Classroom	1140	Cabinet	Door	Solid	Wood	0
92	1963 Bldg	95	XRF	5/27/97	1	Classroom	1140	Wall	Wall	Solid	Plaster	0.2
93	1963 Bldg	32	XRF	5/20/97	1	Classroom	1240	Wall	Midle Wall	Solid	Concrte	0.04
94	1963 Bldg	33	XRF	5/20/97	1	Classroom	1240	Door	Door	Solid	Wood	0
95	1963 Bldg	34	XRF	5/20/97	1	Classroom	1240	Door	Casing	Solid	Wood	0.09
96	1963 Bldg	35	XRF	5/20/97	1	Classroom	1240	Wall	Midle Wall	Solid	Concrte	0
97	1963 Bldg	36	XRF	5/20/97	1	Classroom	1240	Door	Door	Solid	Wood	0
98	1963 Bldg	37	XRF	5/20/97	1	Classroom	1240	Door	Casing	Solid	Metal	0.03
99	1963 Bldg	38	XRF	5/20/97	1	Classroom	1240	Wall	Midle Wall	Solid	Metal	0.04
100	1963 Bldg	17	XRF	5/20/97	1	Classroom	1250	Door	Casing	Solid	Metal	0.04
101	1963 Bldg	18	XRF	5/20/97	1	Classroom	1250	Door	Door	Solid	Wood	0
102	1963 Bldg	19	XRF	5/20/97	1	Classroom	1250	Wall	Midle Wall	Solid	Concrte	0.04
103	1963 Bldg	20	XRF	5/20/97	1	Classroom	1250	Wall	Midle Wall	Solid	Concrte	0.03
104	1963 Bldg	21	XRF	5/20/97	1	Classroom	1250		Locker	Solid	Wood	0
105	1963 Bldg	39	XRF	5/20/97	1	Classroom	1261	Wall	Midle Wall	Solid	Concrte	0
106	1963 Bldg	40	XRF	5/20/97	1	Classroom	1261	Door	Door	Solid	Wood	0.06
107	1963 Bldg	41	XRF	5/20/97	1	Classroom	1261		Locker	Solid	Metal	0
108	1963 Bldg	42	XRF	5/20/97	1	Classroom	1261	Door	Casing	Solid	Metal	0
109	1963 Bldg	43	XRF	5/20/97	1	Classroom	1261	Wall	Midle Wall	Solid	Metal	0.01
110	1963 Bldg	44	XRF	5/20/97	1	Classroom	1261	Wall	Wall	Solid	Concrte	0
111	1963 Bldg	26	XRF	5/20/97	1	Classroom	1280	Door	Door	Solid	Wood	0
112	1963 Bldg	27	XRF	5/20/97	1	Classroom	1280	Door	Casing	Solid	Metal	0
113	1963 Bldg	28	XRF	5/20/97	1	Classroom	1280	Wall	Midle Wall	Solid	Concrte	0
114	1963 Bldg	29	XRF	5/20/97	1	Classroom	1280	Wall	Midle Wall	Solid	Concrte	0.09
115	1963 Bldg	30	XRF	5/20/97	1	Classroom	1280	Wall	Midle Wall	Solid	Concrte	0.02
116	1963 Bldg	31	XRF	5/20/97	1	Classroom	1280	Door	Door	Solid	Wood	0
117	1963 Bldg	73	XRF	5/20/97	1	Classroom	1330	Wall	Midle Wall	Solid	Drywall	0
118	1963 Bldg	74	XRF	5/20/97	1	Classroom	1330	Cabinet	Door	Solid	Wood	0
119	1963 Bldg	75	XRF	5/20/97	1	Classroom	1330	Wall	Wall	Solid	Concrte	0.03

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
120	1963 Bldg	76	XRF	5/20/97	1	Classroom	1330	Door	Door	Solid	Wood	0
121	1963 Bldg	77	XRF	5/20/97	1	Classroom	1330	Window	Casing	Solid	Metal	0.03
122	1963 Bldg	78	XRF	5/20/97	1	Classroom	1330	Wall	Wall	Solid	Metal	0
123	1963 Bldg	79	XRF	5/20/97	1	Classroom	1330	Wall	Middle Wall	Solid	Concrete	0.04
124	1963 Bldg	80	XRF	5/20/97	1	Classroom	1330		Radiator	Solid	Metal	0.19
125	1963 Bldg	81	XRF	5/20/97	1	Classroom	1330	Window	Stool	Solid	Metal	0.06
126	1963 Bldg	82	XRF	5/20/97	1	Classroom	1330	Door	Door	Solid	Metal	0.05
127	1963 Bldg	218	XRF	5/22/97	1	Classroom	1330	Door	Door	Solid	Wood	0
128	1963 Bldg	219	XRF	5/22/97	1	Classroom	1330	Door	Casing	Solid	Metal	0.06
129	1963 Bldg	220	XRF	5/22/97	1	Classroom	1330	Door	Header	Solid	Wood	0.03
130	1963 Bldg	221	XRF	5/22/97	1	Classroom	1330	Door	Header	Solid	Wood	0.03
131	1963 Bldg	222	XRF	5/22/97	1	Classroom	1330	Cabinet	Door	Cracked	Wood	0
132	1963 Bldg	223	XRF	5/22/97	1	Classroom	1330	Wall	Middle Wall	Solid	Concrete	0.04
133	1963 Bldg	224	XRF	5/22/97	1	Classroom	1330	Wall	Wall	Solid	Concrete	0.03
134	1963 Bldg	225	XRF	5/22/97	1	Classroom	1330		Radiator	Solid	Metal	0.04
135	1963 Bldg	226	XRF	5/22/97	1	Classroom	1330	Window	Header	Solid	Wood	0.04
136	1963 Bldg	227	XRF	5/22/97	1	Classroom	1330	Support Beam		Solid	Metal	0.04
137	1963 Bldg	228	XRF	5/22/97	1	Classroom	1330	Support Beam		Solid	Metal	0.02
138	1963 Bldg	83	XRF	5/20/97	1	Classroom	1360	Cabinet	Door	Solid	Wood	0
139	1963 Bldg	84	XRF	5/20/97	1	Classroom	1360	Wall	Wall	Solid	Concrete	0.02
140	1963 Bldg	85	XRF	5/20/97	1	Classroom	1360	Wall	Wall	Solid	Wood	0.01
141	1963 Bldg	86	XRF	5/20/97	1	Classroom	1360	Door	Casing	Solid	Metal	0.08
142	1963 Bldg	87	XRF	5/20/97	1	Classroom	1360	Wall	Wall	Solid	Concrete	0.06
143	1963 Bldg	88	XRF	5/20/97	1	Classroom	1360	Wall	Middle Wall	Solid	Concrete	0.09
144	1963 Bldg	89	XRF	5/20/97	1	Classroom	1360	Door	Casing	Solid	Wood	0
145	1963 Bldg	90	XRF	5/20/97	1	Classroom	1360	Door	Door	Solid	Wood	0
146	1963 Bldg	91	XRF	5/20/97	1	Classroom	1360		Locker	Solid	Metal	0.01
147	1963 Bldg	92	XRF	5/20/97	1	Classroom	1360	Door	Door	Solid	Metal	0.05
148	1963 Bldg	93	XRF	5/20/97	1	Classroom	1360		Radiator	Solid	Metal	0.14
149	1963 Bldg	94	XRF	5/20/97	1	Classroom	1380	Cabinet	Door	Solid	Wood	0
150	1963 Bldg	95	XRF	5/20/97	1	Classroom	1380	Wall	Wall	Solid	Drywall	0
151	1963 Bldg	96	XRF	5/20/97	1	Classroom	1380	Window	Casing	Solid	Metal	0.12
152	1963 Bldg	97	XRF	5/20/97	1	Classroom	1380	Door	Door	Solid	Wood	0
153	1963 Bldg	98	XRF	5/20/97	1	Classroom	1380	Wall	Wall	Solid	Concrete	0.02
154	1963 Bldg	99	XRF	5/20/97	1	Classroom	1380		Radiator	Solid	Metal	0.17
155	1963 Bldg	229	XRF	5/22/97	1	Classroom	1390	Door	Header	Solid	Wood	0.03
156	1963 Bldg	230	XRF	5/22/97	1	Classroom	1390	Door	Header	Solid	Wood	0.02
157	1963 Bldg	231	XRF	5/22/97	1	Classroom	1390	Door	Door	Solid	Wood	0
158	1963 Bldg	232	XRF	5/22/97	1	Classroom	1390	Door	Casing	Solid	Metal	0.07
159	1963 Bldg	233	XRF	5/22/97	1	Classroom	1390	Wall	Middle Wall	Solid	Concrete	0.02
160	1963 Bldg	234	XRF	5/22/97	1	Classroom	1390	Cabinet	Door	Solid	Wood	0
161	1963 Bldg	235	XRF	5/22/97	1	Classroom	1390	Wall	Wall	Solid	Concrete	0.03
162	1963 Bldg	236	XRF	5/22/97	1	Classroom	1390	Window	Header	Solid	Wood	0.02
163	1963 Bldg	237	XRF	5/22/97	1	Classroom	1390	Support Beam		Solid	Metal	0.02
164	1963 Bldg	238	XRF	5/22/97	1	Classroom	1390	Support Beam		Solid	Metal	0.03
165	1963 Bldg	239	XRF	5/22/97	1	Classroom	1390		Radiator	Solid	Metal	0.11
166	1963 Bldg	250	XRF	5/22/97	1	Classroom	1400	Wall	Middle Wall	Solid	Concrete	0.03
167	1963 Bldg	251	XRF	5/22/97	1	Classroom	1400	Wall	Wall	Solid	Concrete	0.02
168	1963 Bldg	252	XRF	5/22/97	1	Classroom	1400		Radiator	Solid	Metal	0.07
169	1963 Bldg	253	XRF	5/22/97	1	Classroom	1400		Radiator	Solid	Metal	0.04
170	1963 Bldg	254	XRF	5/22/97	1	Classroom	1400	Window	Header	Solid	Wood	0.03
171	1963 Bldg	255	XRF	5/22/97	1	Classroom	1400	Wall	Middle Wall	Solid	Concrete	0.02
172	1963 Bldg	256	XRF	5/22/97	1	Classroom	1400	Cabinet	Door	Solid	Wood	0
173	1963 Bldg	257	XRF	5/22/97	1	Classroom	1400	Door	Door	Solid	Wood	0
174	1963 Bldg	258	XRF	5/22/97	1	Classroom	1400	Window	Casing	Solid	Metal	0.09
175	1963 Bldg	259	XRF	5/22/97	1	Classroom	1400	Door	Header	Solid	Wood	0.03
176	1963 Bldg	260	XRF	5/22/97	1	Classroom	1400	Door	Header	Solid	Wood	0.02
177	1963 Bldg	100	XRF	5/20/97	1	Classroom	1410	Wall	Wall	Solid	Concrete	0.01
178	1963 Bldg	101	XRF	5/20/97	1	Classroom	1410	Wall	Wall	Solid	Concrete	0.02

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
179	1963 Bldg	102	XRF	5/20/97	1	Classroo	1410	Wall	Wall Rgstr	Solid	Metal	0
180	1963 Bldg	103	XRF	5/20/97	1	Classroo	1410	Door	Door	Solid	Wood	0
181	1963 Bldg	104	XRF	5/20/97	1	Classroo	1410	Window	Casing	Solid	Metal	0.03
182	1963 Bldg	105	XRF	5/20/97	1	Classroo	1410	Cabinet	Door	Solid	Wood	0
183	1963 Bldg	106	XRF	5/20/97	1	Classroo	1410	Wall	Wall Rgstr	Solid	Metal	0.08
184	1963 Bldg	261	XRF	5/22/97	1	Classroo	1420	Wall	Midle Wall	Solid	Concrte	0.02
185	1963 Bldg	262	XRF	5/22/97	1	Classroo	1420	Wall	Wall	Solid	Concrte	0.01
186	1963 Bldg	263	XRF	5/22/97	1	Classroo	1420		Radiator	Solid	Metal	0.12
187	1963 Bldg	264	XRF	5/22/97	1	Classroo	1420	Support Beam		Solid	Metal	0.02
188	1963 Bldg	265	XRF	5/22/97	1	Classroo	1420	Support Beam		Solid	Metal	0.02
189	1963 Bldg	266	XRF	5/22/97	1	Classroo	1420	Window	Header	Solid	Wood	0.01
190	1963 Bldg	267	XRF	5/22/97	1	Classroo	1420	Cabinet	Door	Solid	Wood	0
191	1963 Bldg	268	XRF	5/22/97	1	Classroo	1420	Door	Header	Solid	Wood	0.03
192	1963 Bldg	269	XRF	5/22/97	1	Classroo	1420	Door	Header	Solid	Wood	0.03
193	1963 Bldg	270	XRF	5/22/97	1	Classroo	1420	Door	Casing	Solid	Metal	0.07
194	1963 Bldg	271	XRF	5/22/97	1	Classroo	1420	Door	Door	Solid	Wood	0
195	1963 Bldg	107	XRF	5/20/97	1	Classroo	1430	Wall	Wall	Solid	Concrte	0.05
196	1963 Bldg	108	XRF	5/20/97	1	Classroo	1430	Wall	Wall	Solid	Concrte	0.03
197	1963 Bldg	109	XRF	5/20/97	1	Classroo	1430	Cabinet	Door	Solid	Wood	0
198	1963 Bldg	110	XRF	5/20/97	1	Classroo	1430	Wall	Wall	Solid	Drywall	0
199	1963 Bldg	111	XRF	5/20/97	1	Classroo	1430	Door	Door	Solid	Wood	0
200	1963 Bldg	112	XRF	5/20/97	1	Classroo	1430	Door	Casing	Solid	Metal	0.05
201	1963 Bldg	113	XRF	5/20/97	1	Classroo	1430		Radiator	Solid	Metal	0.12
202	1963 Bldg	272	XRF	5/22/97	1	Classroo	1440	Wall	Wall	Solid	Concrte	0.04
203	1963 Bldg	273	XRF	5/22/97	1	Classroo	1440	Wall	Wall	Solid	Concrte	0.02
204	1963 Bldg	274	XRF	5/22/97	1	Classroo	1440		Radiator	Solid	Metal	0.06
205	1963 Bldg	275	XRF	5/22/97	1	Classroo	1440	Window	Header	Solid	Wood	0.01
206	1963 Bldg	276	XRF	5/22/97	1	Classroo	1440	Support Beam		Solid	Metal	0.03
207	1963 Bldg	277	XRF	5/22/97	1	Classroo	1440	Support Beam		Solid	Metal	0.03
208	1963 Bldg	278	XRF	5/22/97	1	Classroo	1440	Support Beam		Solid	Metal	0.03
209	1963 Bldg	279	XRF	5/22/97	1	Classroo	1440	Wall	Wall	Solid	Concrte	0.01
210	1963 Bldg	280	XRF	5/22/97	1	Classroo	1440	Door	Door	Solid	Wood	0
211	1963 Bldg	281	XRF	5/22/97	1	Classroo	1440	Door	Casing	Solid	Metal	0.08
212	1963 Bldg	282	XRF	5/22/97	1	Classroo	1440	Door	Header	Solid	Wood	0.03
213	1963 Bldg	283	XRF	5/22/97	1	Classroo	1440	Door	Header	Solid	Wood	0.02
214	1963 Bldg	284	XRF	5/22/97	1	Classroo	1440	Cabinet	Door	Solid	Wood	0
215	1963 Bldg	285	XRF	5/22/97	1	Classroo	1440	Door	Header	Solid	Wood	0.01
216	1963 Bldg	125	XRF	5/20/97	1	Classroo	1480	Wall	Midle Wall	Solid	Concrte	0.08
217	1963 Bldg	126	XRF	5/20/97	1	Classroo	1480	Door	Header	Solid	Wood	0
218	1963 Bldg	127	XRF	5/20/97	1	Classroo	1480	Window	Casing	Solid	Metal	0.03
219	1963 Bldg	128	XRF	5/20/97	1	Classroo	1480	Door	Door	Solid	Wood	0
220	1963 Bldg	129	XRF	5/20/97	1	Classroo	1480	Wall	Wall	Solid	Concrte	0.06
221	1963 Bldg	130	XRF	5/20/97	1	Classroo	1480	Cabinet	Door	Solid	Wood	0
222	1963 Bldg	131	XRF	5/20/97	1	Classroo	1480	Door	Door	Solid	Metal	0
223	1963 Bldg	132	XRF	5/20/97	1	Classroo	1480		Radiator	Solid	Metal	0.22
224	1963 Bldg	133	XRF	5/20/97	1	Classroo	1480	Window	Header	Solid	Wood	0
225	1963 Bldg	134	XRF	5/20/97	1	Classroo	1480	Door	Header	Solid	Wood	0
226	1963 Bldg	135	XRF	5/20/97	1	Classroo	1480		Locker	Solid	Metal	0
227	1963 Bldg	13	XRF	5/21/97	1	Classroo	1520	Door	Door	Solid	Wood	0
228	1963 Bldg	14	XRF	5/21/97	1	Classroo	1520	Door	Casing	Solid	Metal	0.07
229	1963 Bldg	15	XRF	5/21/97	1	Classroo	1520	Door	Header	Solid	Wood	0
230	1963 Bldg	16	XRF	5/21/97	1	Classroo	1520	Wall	Wall	Solid	Concrte	0.04
231	1963 Bldg	17	XRF	5/21/97	1	Classroo	1520	Cabinet	Outside	Solid	Wood	0
232	1963 Bldg	18	XRF	5/21/97	1	Classroo	1520	Wall	Wall	Solid	Concrte	0.02
233	1963 Bldg	19	XRF	5/21/97	1	Classroo	1520		Radiator	Solid	Metal	0.05
234	1963 Bldg	20	XRF	5/21/97	1	Classroo	1520	Wall	Midle Wall	Solid	Concrte	0.07
235	1963 Bldg	21	XRF	5/21/97	1	Classroo	1520	Door	Header	Solid	Wood	0
236	1963 Bldg	6	XRF	5/21/97	1	Classroo	1530	Wall	Midle Wall	Solid	Concrte	0.05
237	1963 Bldg	7	XRF	5/21/97	1	Classroo	1530	Door	Door	Solid	Wood	0

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
238	1963 Bldg	8	XRF	5/21/97	1	Classroo	1530	Window	Casing	Solid	Metal	0.04
239	1963 Bldg	9	XRF	5/21/97	1	Classroo	1530		Radiator	Solid	Metal	0.14
240	1963 Bldg	10	XRF	5/21/97	1	Classroo	1530	Support Beam		Solid	Metal	0.12
241	1963 Bldg	11	XRF	5/21/97	1	Classroo	1530	Wall	Wall	Solid	Concrte	0.06
242	1963 Bldg	12	XRF	5/21/97	1	Classroo	1530	Cabinet	Outside	Solid	Wood	0
243	1963 Bldg	22	XRF	5/21/97	1	Classroo	1550	Wall	Midle Wall	Solid	Concrte	0.04
244	1963 Bldg	23	XRF	5/21/97	1	Classroo	1550	Wall	Midle Wall	Solid	Metal	0.13
245	1963 Bldg	24	XRF	5/21/97	1	Classroo	1550	Door	Casing	Solid	Metal	0.06
246	1963 Bldg	25	XRF	5/21/97	1	Classroo	1550	Door	Door	Solid	Wood	0
247	1963 Bldg	26	XRF	5/21/97	1	Classroo	1550	Door	Casing	Solid	Metal	0.14
248	1963 Bldg	27	XRF	5/21/97	1	Classroo	1550	Cabinet	Door	Solid	Wood	0
249	1963 Bldg	28	XRF	5/21/97	1	Classroo	1550	Wall	Wall	Solid	Concrte	0.03
250	1963 Bldg	29	XRF	5/21/97	1	Classroo	1550	Window	Header	Solid	Wood	0
251	1963 Bldg	30	XRF	5/21/97	1	Classroo	1550	Window	Header	Solid	Wood	0
252	1963 Bldg	31	XRF	5/21/97	1	Classroo	1550		Radiator	Solid	Metal	0.15
253	1963 Bldg	32	XRF	5/21/97	1	Classroo	1570	Door	Casing	Solid	Metal	0.04
254	1963 Bldg	33	XRF	5/21/97	1	Classroo	1570	Door	Door	Solid	Wood	0
255	1963 Bldg	34	XRF	5/21/97	1	Classroo	1570	Door	Header	Solid	Wood	0
256	1963 Bldg	35	XRF	5/21/97	1	Classroo	1570	Wall	Midle Wall	Solid	Concrte	0.07
257	1963 Bldg	36	XRF	5/21/97	1	Classroo	1570	Wall	Wall	Solid	Concrte	0.05
258	1963 Bldg	37	XRF	5/21/97	1	Classroo	1570		Radiator	Solid	Metal	0.17
259	1963 Bldg	38	XRF	5/21/97	1	Classroo	1570	Cabinet	Door	Solid	Wood	0
260	1963 Bldg	39	XRF	5/21/97	1	Classroo	1570	Window	Header	Solid	Wood	0.04
261	1963 Bldg	40	XRF	5/21/97	1	Classroo	1570	Window	Header	Solid	Wood	0.01
262	1963 Bldg	16	XRF	5/27/97	1	Classroo	1600	Door	Header	Solid	Wood	0.14
263	1963 Bldg	17	XRF	5/27/97	1	Classroo	1600	Door	Header	Solid	Wood	0.1
264	1963 Bldg	18	XRF	5/27/97	1	Classroo	1600	Door	Door	Solid	Wood	0
265	1963 Bldg	19	XRF	5/27/97	1	Classroo	1600	Door	Casing	Solid	Metal	0.08
266	1963 Bldg	20	XRF	5/27/97	1	Classroo	1600	Cabinet	Door	Solid	Wood	0
267	1963 Bldg	21	XRF	5/27/97	1	Classroo	1600	Wall	Wall	Solid	Concrte	0.03
268	1963 Bldg	22	XRF	5/27/97	1	Classroo	1600	Wall	Wall	Solid	Concrte	0.02
269	1963 Bldg	23	XRF	5/27/97	1	Classroo	1600		Radiator	Solid	Metal	0.08
270	1963 Bldg	24	XRF	5/27/97	1	Classroo	1600	Window	Header	Solid	Wood	0.01
271	1963 Bldg	184	XRF	5/21/97	1	Classroo	1641	Wall	Wall	Solid	Drywall	0
272	1963 Bldg	185	XRF	5/21/97	1	Classroo	1641	Door	Door	Solid	Wood	0
273	1963 Bldg	186	XRF	5/21/97	1	Classroo	1641	Door	Casing	Solid	Metal	0.03
274	1963 Bldg	187	XRF	5/21/97	1	Classroo	1641		Radiator	Solid	Metal	0
275	1963 Bldg	188	XRF	5/21/97	1	Classroo	1641	Support Beam		Solid	Metal	0.03
276	1963 Bldg	6	XRF	5/27/97	1	Classroo	1660	Wall	Midle Wall	Solid	Concrte	0.04
277	1963 Bldg	7	XRF	5/27/97	1	Classroo	1660	Door	Door	Solid	Wood	0
278	1963 Bldg	8	XRF	5/27/97	1	Classroo	1660	Door	Header	Solid	Wood	0.05
279	1963 Bldg	9	XRF	5/27/97	1	Classroo	1660	Door	Header	Solid	Wood	0.04
280	1963 Bldg	10	XRF	5/27/97	1	Classroo	1660	Door	Door	Solid	Metal	0.01
281	1963 Bldg	11	XRF	5/27/97	1	Classroo	1660	Door	Casing	Solid	Metal	0
282	1963 Bldg	12	XRF	5/27/97	1	Classroo	1660	Wall	Wall	Solid	Concrte	0.02
283	1963 Bldg	13	XRF	5/27/97	1	Classroo	1660	Support Beam		Solid	Metal	0.01
284	1963 Bldg	14	XRF	5/27/97	1	Classroo	1660	Window	Header	Solid	Wood	0.01
285	1963 Bldg	15	XRF	5/27/97	1	Classroo	1660		Radiator	Solid	Metal	0.09
286	1963 Bldg	196	XRF	5/21/97	1	Classroo	1661	Wall	Wall	Solid	Drywall	0
287	1963 Bldg	197	XRF	5/21/97	1	Classroo	1661		Radiator	Solid	Metal	0
288	1963 Bldg	198	XRF	5/21/97	1	Classroo	1661	Wall	Wall	Solid	Concrte	0
289	1963 Bldg	199	XRF	5/21/97	1	Classroo	1661	Support Beam		Solid	Metal	0.03
290	1963 Bldg	200	XRF	5/21/97	1	Classroo	1661	Door	Door	Solid	Wood	0
291	1963 Bldg	201	XRF	5/21/97	1	Classroo	1661	Door	Casing	Solid	Metal	0
292	1963 Bldg	189	XRF	5/21/97	1	Classroo	1681	Wall	Midle Wall	Solid	Drywall	0
293	1963 Bldg	190	XRF	5/21/97	1	Classroo	1681	Bookcase	Shelf	Solid	Wood	0
294	1963 Bldg	191	XRF	5/21/97	1	Classroo	1681	Wall	Wall	Solid	Concrte	0
295	1963 Bldg	192	XRF	5/21/97	1	Classroo	1681		Radiator	Solid	Metal	0
296	1963 Bldg	193	XRF	5/21/97	1	Classroo	1681	Support Beam		Solid	Metal	0

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
297	1963 Bldg	194	XRF	5/21/97	1	Classroo	1681	Door	Door	Solid	Wood	0
298	1963 Bldg	195	XRF	5/21/97	1	Classroo	1681	Door	Casing	Solid	Metal	0
299	1963 Bldg	77	XRF	5/24/97	1	Classroo	1730	Wall	Wall	Solid	Concrte	0.04
300	1963 Bldg	78	XRF	5/24/97	1	Classroo	1730	Window	Casing	Peeling	Metal	0.06
301	1963 Bldg	79	XRF	5/24/97	1	Classroo	1730		Radiator	Solid	Metal	0.17
302	1963 Bldg	80	XRF	5/24/97	1	Classroo	1730	Door	Header	Solid	Wood	0.09
303	1963 Bldg	81	XRF	5/24/97	1	Classroo	1730	Door	Header	Solid	Wood	0.05
304	1963 Bldg	82	XRF	5/24/97	1	Classroo	1730	Wall	Wall	Solid	Concrte	0.07
305	1963 Bldg	83	XRF	5/24/97	1	Classroo	1730	Door	Door	Solid	Wood	0
306	1963 Bldg	84	XRF	5/24/97	1	Classroo	1730	Door	Casing	Solid	Metal	0.1
307	1963 Bldg	85	XRF	5/24/97	1	Classroo	1730	Cabinet	Door	Solid	Wood	0
308	1963 Bldg	58	XRF	5/24/97	1	Classroo	1740		Radiator	Solid	Metal	0.11
309	1963 Bldg	59	XRF	5/24/97	1	Classroo	1740	Support Beam		Solid	Metal	0.03
310	1963 Bldg	60	XRF	5/24/97	1	Classroo	1740	Support Beam		Solid	Metal	0.06
311	1963 Bldg	61	XRF	5/24/97	1	Classroo	1740	Window	Header	Solid	Wood	0.02
312	1963 Bldg	62	XRF	5/24/97	1	Classroo	1740	Wall	Middle Wall	Solid	Concrte	0
313	1963 Bldg	63	XRF	5/24/97	1	Classroo	1740	Cabinet	Door	Solid	Wood	0
314	1963 Bldg	64	XRF	5/24/97	1	Classroo	1740	Door	Door	Solid	Wood	0
315	1963 Bldg	65	XRF	5/24/97	1	Classroo	1740	Door	Casing	Solid	Metal	0.08
316	1963 Bldg	66	XRF	5/24/97	1	Classroo	1740	Door	Header	Solid	Wood	0
317	1963 Bldg	67	XRF	5/24/97	1	Classroo	1742		Radiator	Solid	Metal	0.12
318	1963 Bldg	68	XRF	5/24/97	1	Classroo	1742	Window	Header	Solid	Wood	0.02
319	1963 Bldg	69	XRF	5/24/97	1	Classroo	1742	Support Beam		Solid	Metal	0.02
320	1963 Bldg	70	XRF	5/24/97	1	Classroo	1742	Support Beam		Solid	Metal	0.01
321	1963 Bldg	71	XRF	5/24/97	1	Classroo	1742	Wall	Wall	Solid	Concrte	0.02
322	1963 Bldg	72	XRF	5/24/97	1	Classroo	1742	Door	Header	Solid	Wood	0.01
323	1963 Bldg	73	XRF	5/24/97	1	Classroo	1742	Door	Casing	Solid	Metal	0.07
324	1963 Bldg	74	XRF	5/24/97	1	Classroo	1742	Door	Door	Solid	Wood	0
325	1963 Bldg	75	XRF	5/24/97	1	Classroo	1742	Cabinet	Door	Solid	Wood	0
326	1963 Bldg	76	XRF	5/24/97	1	Classroo	1742	Wall	Middle Wall	Solid	Plaster	0.02
327	1963 Bldg	25	XRF	5/27/97	1	Classroo	1760	Door	Door	Solid	Wood	0
328	1963 Bldg	26	XRF	5/27/97	1	Classroo	1760	Door	Casing	Solid	Metal	0.04
329	1963 Bldg	27	XRF	5/27/97	1	Classroo	1760	Wall	Middle Wall	Solid	Concrte	0.02
330	1963 Bldg	28	XRF	5/27/97	1	Classroo	1760	Cabinet	Door	Solid	Wood	0
331	1963 Bldg	29	XRF	5/27/97	1	Classroo	1760	Door	Header	Solid	Wood	0.07
332	1963 Bldg	30	XRF	5/27/97	1	Classroo	1760		Radiator	Solid	Metal	0.1
333	1963 Bldg	31	XRF	5/27/97	1	Classroo	1760	Window	Header	Solid	Wood	0.01
334	1963 Bldg	32	XRF	5/27/97	1	Classroo	1760	Support Beam		Solid	Metal	0.04
335	1963 Bldg	202	XRF	5/21/97	1	Classroo	1761	Wall	Middle Wall	Solid	Drywall	0
336	1963 Bldg	203	XRF	5/21/97	1	Classroo	1761		Radiator	Solid	Metal	0
337	1963 Bldg	204	XRF	5/21/97	1	Classroo	1761	Wall	Wall	Solid	Concrte	0
338	1963 Bldg	205	XRF	5/21/97	1	Classroo	1761	Support Beam		Solid	Metal	0.07
339	1963 Bldg	206	XRF	5/21/97	1	Classroo	1761	Door	Door	Solid	Wood	0
340	1963 Bldg	207	XRF	5/21/97	1	Classroo	1761	Door	Casing	Solid	Metal	0.02
341	1963 Bldg	41	XRF	5/24/97	1	Classroo	1790	Window	Header	Solid	Wood	0.01
342	1963 Bldg	42	XRF	5/24/97	1	Classroo	1790	Support Beam		Solid	Metal	0.05
343	1963 Bldg	43	XRF	5/24/97	1	Classroo	1790		Radiator	Solid	Metal	0.05
344	1963 Bldg	44	XRF	5/24/97	1	Classroo	1790	Cabinet	Door	Solid	Wood	0
345	1963 Bldg	45	XRF	5/24/97	1	Classroo	1790	Door	Header	Solid	Wood	0.02
346	1963 Bldg	46	XRF	5/24/97	1	Classroo	1790	Door	Casing	Solid	Metal	0.1
347	1963 Bldg	47	XRF	5/24/97	1	Classroo	1790	Door	Door	Solid	Wood	0
348	1963 Bldg	48	XRF	5/24/97	1	Classroo	1790	Wall	Middle Wall	Solid	Concrte	0.02
349	1963 Bldg	49	XRF	5/24/97	1	Classroo	1791		Radiator	Solid	Metal	0.04
350	1963 Bldg	50	XRF	5/24/97	1	Classroo	1791	Support Beam		Solid	Metal	0.1
351	1963 Bldg	51	XRF	5/24/97	1	Classroo	1791	Support Beam		Solid	Metal	0.08
352	1963 Bldg	52	XRF	5/24/97	1	Classroo	1791	Wall	Wall	Solid	Concrte	0.06
353	1963 Bldg	53	XRF	5/24/97	1	Classroo	1791	Window	Header	Solid	Wood	0.02
354	1963 Bldg	54	XRF	5/24/97	1	Classroo	1791	Door	Door	Solid	Wood	0
355	1963 Bldg	55	XRF	5/24/97	1	Classroo	1791	Door	Header	Solid	Wood	0.04

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
356	1963 Bldg	56	XRF	5/24/97	1	Classroom	1791	Door	Casing	Solid	Metal	0.07
357	1963 Bldg	57	XRF	5/24/97	1	Classroom	1791	Cabinet	Door	Solid	Wood	0
358	1963 Bldg	106	XRF	5/24/97	1	Classroom	1800	Wall	Midle Wall	Solid	Concrte	0.04
359	1963 Bldg	107	XRF	5/24/97	1	Classroom	1800	Support Beam		Solid	Metal	0.08
360	1963 Bldg	108	XRF	5/24/97	1	Classroom	1800	Wall	Wall	Solid	Concrte	0.02
361	1963 Bldg	109	XRF	5/24/97	1	Classroom	1800	Door	Door	Solid	Wood	0
362	1963 Bldg	110	XRF	5/24/97	1	Classroom	1800	Door	Casing	Solid	Metal	0.08
363	1963 Bldg	111	XRF	5/24/97	1	Classroom	1800	Door	Header	Solid	Wood	0.01
364	1963 Bldg	112	XRF	5/24/97	1	Classroom	1800	Door	Header	Solid	Wood	0
365	1963 Bldg	175	XRF	5/21/97	1	Classroom	1830	Support Beam		Solid	Metal	0.04
366	1963 Bldg	176	XRF	5/21/97	1	Classroom	1830	Support Beam		Solid	Metal	0.05
367	1963 Bldg	177	XRF	5/21/97	1	Classroom	1830	Wall	Midle Wall	Solid	Concrte	0.01
368	1963 Bldg	178	XRF	5/21/97	1	Classroom	1830	Cabinet	Door	Solid	Wood	0
369	1963 Bldg	179	XRF	5/21/97	1	Classroom	1830	Door	Door	Solid	Wood	0
370	1963 Bldg	180	XRF	5/21/97	1	Classroom	1830	Door	Casing	Solid	Metal	0.05
371	1963 Bldg	181	XRF	5/21/97	1	Classroom	1830	Door	Header	Solid	Wood	0.04
372	1963 Bldg	182	XRF	5/21/97	1	Classroom	1830	Door	Header	Solid	Wood	0.03
373	1963 Bldg	183	XRF	5/21/97	1	Classroom	1830	Wall	Wall	Solid	Concrte	0.07
374	1963 Bldg	170	XRF	5/21/97	1	Classroom	1840	Door	Door	Solid	Wood	0
375	1963 Bldg	171	XRF	5/21/97	1	Classroom	1840	Door	Casing	Solid	Metal	0.08
376	1963 Bldg	172	XRF	5/21/97	1	Classroom	1840	Cabinet	Door	Solid	Wood	0
377	1963 Bldg	173	XRF	5/21/97	1	Classroom	1840	Door	Header	Solid	Wood	0.01
378	1963 Bldg	174	XRF	5/21/97	1	Classroom	1840	Wall	Wall	Solid	Concrte	0.05
379	1963 Bldg	153	XRF	5/21/97	1	Classroom	1841	Wall	Wall	Solid	Concrte	0.05
380	1963 Bldg	154	XRF	5/21/97	1	Classroom	1841	Door	Header	Solid	Wood	0.03
381	1963 Bldg	155	XRF	5/21/97	1	Classroom	1841	Door	Door	Solid	Wood	0
382	1963 Bldg	156	XRF	5/21/97	1	Classroom	1841	Door	Casing	Solid	Metal	0.08
383	1963 Bldg	157	XRF	5/21/97	1	Classroom	1841	Cabinet	Door	Solid	Wood	0
384	1963 Bldg	127	XRF	5/21/97	1	Classroom	1842	Door	Door	Solid	Wood	0
385	1963 Bldg	128	XRF	5/21/97	1	Classroom	1842	Door	Casing	Solid	Metal	0
386	1963 Bldg	129	XRF	5/21/97	1	Classroom	1842	Wall	Midle Wall	Solid	Drywall	0
387	1963 Bldg	130	XRF	5/21/97	1	Classroom	1842		Radiator	Solid	Metal	0
388	1963 Bldg	131	XRF	5/21/97	1	Classroom	1842	Wall	Midle Wall	Solid	Concrte	0.04
389	1963 Bldg	164	XRF	5/21/97	1	Classroom	1850	Door	Door		Wood	0
390	1963 Bldg	165	XRF	5/21/97	1	Classroom	1850	Door	Casing	Solid	Metal	0.07
391	1963 Bldg	166	XRF	5/21/97	1	Classroom	1850	Wall	Midle Wall	Solid	Concrte	0.15
392	1963 Bldg	167	XRF	5/21/97	1	Classroom	1850	Door	Header	Solid	Wood	0.03
393	1963 Bldg	168	XRF	5/21/97	1	Classroom	1850	Cabinet	Door	Solid	Wood	0
394	1963 Bldg	169	XRF	5/21/97	1	Classroom	1850	Wall	Midle Wall	Solid	Concrte	0.06
395	1963 Bldg	158	XRF	5/21/97	1	Classroom	1851	Wall	Midle Wall	Solid	Concrte	0.09
396	1963 Bldg	159	XRF	5/21/97	1	Classroom	1851	Wall	Midle Wall	Solid	Concrte	0.04
397	1963 Bldg	160	XRF	5/21/97	1	Classroom	1851	Door	Door	Solid	Wood	0
398	1963 Bldg	161	XRF	5/21/97	1	Classroom	1851	Door	Casing	Solid	Metal	0.07
399	1963 Bldg	162	XRF	5/21/97	1	Classroom	1851	Door	Header	Solid	Wood	0.02
400	1963 Bldg	163	XRF	5/21/97	1	Classroom	1851	Cabinet	Door	Solid	Wood	0
401	1963 Bldg	122	XRF	5/21/97	1	Classroom	1852	Wall	Wall	Solid	Drywall	0
402	1963 Bldg	123	XRF	5/21/97	1	Classroom	1852	Door	Door	Solid	Wood	0
403	1963 Bldg	124	XRF	5/21/97	1	Classroom	1852	Door	Casing	Solid	Metal	0.02
404	1963 Bldg	125	XRF	5/21/97	1	Classroom	1852		Radiator	Solid	Metal	0
405	1963 Bldg	126	XRF	5/21/97	1	Classroom	1852	Wall	Midle Wall	Solid	Concrte	0
406	1963 Bldg	144	XRF	5/21/97	1	Classroom	1860	Wall	Midle Wall	Solid	Concrte	0.04
407	1963 Bldg	145	XRF	5/21/97	1	Classroom	1860	Wall	Wall	Solid	Concrte	0.01
408	1963 Bldg	146	XRF	5/21/97	1	Classroom	1860	Support Beam		Solid	Metal	0.07
409	1963 Bldg	147	XRF	5/21/97	1	Classroom	1860	Support Beam		Solid	Metal	0.09
410	1963 Bldg	148	XRF	5/21/97	1	Classroom	1860	Door	Door	Solid	Wood	0
411	1963 Bldg	149	XRF	5/21/97	1	Classroom	1860	Door	Casing	Solid	Metal	0.07
412	1963 Bldg	150	XRF	5/21/97	1	Classroom	1860	Door	Header	Solid	Wood	0.08
413	1963 Bldg	151	XRF	5/21/97	1	Classroom	1860	Cabinet	Door	Solid	Wood	0
414	1963 Bldg	152	XRF	5/21/97	1	Classroom	1860		Locker	Solid	Metal	0

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
415	1963 Bldg	138	XRF	5/21/97	1	Classroo	1862	Wall	Midle Wall	Solid	Drywall	0
416	1963 Bldg	139	XRF	5/21/97	1	Classroo	1862	Door	Door	Solid	Wood	0
417	1963 Bldg	140	XRF	5/21/97	1	Classroo	1862	Door	Casing	Solid	Metal	0.03
418	1963 Bldg	141	XRF	5/21/97	1	Classroo	1862		Radiator	Solid	Metal	0
419	1963 Bldg	142	XRF	5/21/97	1	Classroo	1862	Wall	Wall	Solid	Concrte	0
420	1963 Bldg	143	XRF	5/21/97	1	Classroo	1862	Wall	Wall	Solid	Concrte	0.01
421	1963 Bldg	25	XRF	5/24/97	1	Classroo	1870	Wall	Radiator	Solid	Metal	0.11
422	1963 Bldg	26	XRF	5/24/97	1	Classroo	1870	Window	Header	Solid	Wood	0
423	1963 Bldg	27	XRF	5/24/97	1	Classroo	1870	Cabinet	Door	Solid	Wood	0
424	1963 Bldg	28	XRF	5/24/97	1	Classroo	1870	Support Beam		Solid	Metal	0.1
425	1963 Bldg	29	XRF	5/24/97	1	Classroo	1870	Door	Header	Solid	Wood	0.01
426	1963 Bldg	30	XRF	5/24/97	1	Classroo	1870	Door	Door	Solid	Wood	0
427	1963 Bldg	31	XRF	5/24/97	1	Classroo	1870	Door	Casing	Solid	Metal	0.06
428	1963 Bldg	32	XRF	5/24/97	1	Classroo	1870	Wall	Wall	Solid	Concrte	0
429	1963 Bldg	33	XRF	5/24/97	1	Classroo	1871		Radiator	Solid	Metal	0.06
430	1963 Bldg	34	XRF	5/24/97	1	Classroo	1871	Window	Header	Solid	Wood	0.01
431	1963 Bldg	35	XRF	5/24/97	1	Classroo	1871	Support Beam		Solid	Metal	0.05
432	1963 Bldg	36	XRF	5/24/97	1	Classroo	1871	Door	Door	Solid	Wood	0
433	1963 Bldg	37	XRF	5/24/97	1	Classroo	1871	Door	Casing	Solid	Metal	0.06
434	1963 Bldg	38	XRF	5/24/97	1	Classroo	1871	Door	Header	Solid	Wood	0.01
435	1963 Bldg	39	XRF	5/24/97	1	Classroo	1871	Cabinet	Door	Solid	Wood	0
436	1963 Bldg	40	XRF	5/24/97	1	Classroo	1871	Wall	Wall	Solid	Concrte	0
437	1963 Bldg	6	XRF	5/24/97	1	Classroo	1940		Radiator	Solid	Metal	0.04
438	1963 Bldg	7	XRF	5/24/97	1	Classroo	1940	Window	Header	Solid	Wood	0.01
439	1963 Bldg	8	XRF	5/24/97	1	Classroo	1940	Support Beam		Solid	Metal	0.05
440	1963 Bldg	9	XRF	5/24/97	1	Classroo	1940	Support Beam		Solid	Metal	0.01
441	1963 Bldg	10	XRF	5/24/97	1	Classroo	1940	Wall	Midle Wall	Solid	Concrte	0
442	1963 Bldg	11	XRF	5/24/97	1	Classroo	1940	Door	Door	Solid	Wood	0
443	1963 Bldg	12	XRF	5/24/97	1	Classroo	1940	Bookcase	Shelf	Solid	Metal	0
444	1963 Bldg	13	XRF	5/24/97	1	Classroo	1940	Door	Casing	Solid	Metal	0.08
445	1963 Bldg	14	XRF	5/24/97	1	Classroo	1940	Door	Header	Solid	Wood	0.01
446	1963 Bldg	15	XRF	5/24/97	1	Classroo	1942		Radiator	Solid	Metal	0.2
447	1963 Bldg	16	XRF	5/24/97	1	Classroo	1942	Window	Header	Solid	Wood	0.01
448	1963 Bldg	17	XRF	5/24/97	1	Classroo	1942	Support Beam		Solid	Metal	0.01
449	1963 Bldg	18	XRF	5/24/97	1	Classroo	1942	Support Beam		Solid	Metal	0.02
450	1963 Bldg	19	XRF	5/24/97	1	Classroo	1942	Wall	Wall	Solid	Concrte	0.01
451	1963 Bldg	20	XRF	5/24/97	1	Classroo	1942	Bookcase	Shelf	Solid	Wood	0.01
452	1963 Bldg	21	XRF	5/24/97	1	Classroo	1942	Door	Header	Solid	Wood	0.06
453	1963 Bldg	22	XRF	5/24/97	1	Classroo	1942	Door	Door	Solid	Wood	0
454	1963 Bldg	23	XRF	5/24/97	1	Classroo	1942	Door	Casing	Solid	Metal	0.06
455	1963 Bldg	24	XRF	5/24/97	1	Classroo	1942	Cabinet	Door	Solid	Wood	0
456	1963 Bldg	377	XRF	5/22/97	1	Classroo	1950		Radiator	Solid	Metal	0.08
457	1963 Bldg	378	XRF	5/22/97	1	Classroo	1950	Support Beam		Solid	Metal	0.02
458	1963 Bldg	379	XRF	5/22/97	1	Classroo	1950	Window	Header	Solid	Wood	0.01
459	1963 Bldg	380	XRF	5/22/97	1	Classroo	1950	Cabinet	Door	Solid	Wood	0
460	1963 Bldg	381	XRF	5/22/97	1	Classroo	1950	Door	Header	Solid	Wood	0.06
461	1963 Bldg	382	XRF	5/22/97	1	Classroo	1950	Door	Header	Solid	Wood	0.06
462	1963 Bldg	383	XRF	5/22/97	1	Classroo	1950	Door	Casing	Solid	Metal	0.07
463	1963 Bldg	384	XRF	5/22/97	1	Classroo	1950	Door	Door	Solid	Wood	0
464	1963 Bldg	385	XRF	5/22/97	1	Classroo	1950	Wall	Wall	Solid	Concrte	0.07
465	1963 Bldg	386	XRF	5/22/97	1	Classroo	1950	Wall	Wall	Solid	Concrte	0.09
466	1963 Bldg	365	XRF	5/22/97	1	Classroo	1960	Wall	Wall	Solid	Concrte	0.01
467	1963 Bldg	366	XRF	5/22/97	1	Classroo	1960	Door	Header	Solid	Wood	0.02
468	1963 Bldg	367	XRF	5/22/97	1	Classroo	1960	Door	Header	Solid	Wood	0.04
469	1963 Bldg	368	XRF	5/22/97	1	Classroo	1960	Door	Header	Solid	Wood	0.07
470	1963 Bldg	369	XRF	5/22/97	1	Classroo	1960	Door	Door	Solid	Wood	0
471	1963 Bldg	370	XRF	5/22/97	1	Classroo	1960	Door	Casing	Solid	Metal	0.07
472	1963 Bldg	371	XRF	5/22/97	1	Classroo	1960	Cabinet	Door	Solid	Wood	0
473	1963 Bldg	372	XRF	5/22/97	1	Classroo	1960	Wall	Wall	Solid	Concrte	0.07

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
474	1963 Bldg	373	XRF	5/22/97	1	Classroom	1960		Radiator	Solid	Metal	0.13
475	1963 Bldg	374	XRF	5/22/97	1	Classroom	1960	Window	Header	Solid	Wood	0.01
476	1963 Bldg	375	XRF	5/22/97	1	Classroom	1960	Support Beam		Solid	Metal	0.03
477	1963 Bldg	376	XRF	5/22/97	1	Classroom	1960	Support Beam		Solid	Metal	0.04
478	1963 Bldg	84	XRF	5/21/97	1	Classroom	1970	Wall	Wall	Solid	Concrte	0.03
479	1963 Bldg	85	XRF	5/21/97	1	Classroom	1970	Wall	Wall	Solid	Concrte	0.04
480	1963 Bldg	86	XRF	5/21/97	1	Classroom	1970		Radiator	Solid	Metal	0.17
481	1963 Bldg	87	XRF	5/21/97	1	Classroom	1970	Window	Casing	Solid	Wood	0.01
482	1963 Bldg	88	XRF	5/21/97	1	Classroom	1970	Door	Door	Solid	Wood	0
483	1963 Bldg	89	XRF	5/21/97	1	Classroom	1970	Door	Casing	Solid	Metal	0.09
484	1963 Bldg	90	XRF	5/21/97	1	Classroom	1970	Door	Header	Solid	Wood	0.01
485	1963 Bldg	91	XRF	5/21/97	1	Classroom	1970	Door	Header	Solid	Wood	0.02
486	1963 Bldg	354	XRF	5/22/97	1	Classroom	1980	Wall	Wall	Solid	Concrte	0.03
487	1963 Bldg	355	XRF	5/22/97	1	Classroom	1980	Wall	Wall	Solid	Concrte	0.04
488	1963 Bldg	356	XRF	5/22/97	1	Classroom	1980	Cabinet	Door	Solid	Wood	0
489	1963 Bldg	357	XRF	5/22/97	1	Classroom	1980	Door	Door	Solid	Wood	0
490	1963 Bldg	358	XRF	5/22/97	1	Classroom	1980	Door	Casing	Solid	Metal	0.08
491	1963 Bldg	359	XRF	5/22/97	1	Classroom	1980	Door	Header	Solid	Wood	0.01
492	1963 Bldg	360	XRF	5/22/97	1	Classroom	1980	Door	Header	Solid	Wood	0.01
493	1963 Bldg	361	XRF	5/22/97	1	Classroom	1980		Radiator	Solid	Metal	0.24
494	1963 Bldg	362	XRF	5/22/97	1	Classroom	1980	Window	Header	Solid	Wood	0.01
495	1963 Bldg	363	XRF	5/22/97	1	Classroom	1980	Support Beam		Solid	Metal	0.07
496	1963 Bldg	364	XRF	5/22/97	1	Classroom	1980	Support Beam		Solid	Metal	0.04
497	1963 Bldg	92	XRF	5/21/97	1	Classroom	1990	Wall	Midle Wall	Solid	Concrte	0.05
498	1963 Bldg	93	XRF	5/21/97	1	Classroom	1990	Bookcase	Shelf	Solid	Wood	0
499	1963 Bldg	94	XRF	5/21/97	1	Classroom	1990	Wall	Wall	Solid	Concrte	0.02
500	1963 Bldg	95	XRF	5/21/97	1	Classroom	1990		Radiator	Solid	Metal	0.1
501	1963 Bldg	96	XRF	5/21/97	1	Classroom	1990	Window	Casing	Solid	Wood	0.01
502	1963 Bldg	97	XRF	5/21/97	1	Classroom	1990	Door	Door	Solid	Wood	0
503	1963 Bldg	98	XRF	5/21/97	1	Classroom	1990	Door	Casing	Solid	Metal	0.08
504	1963 Bldg	99	XRF	5/21/97	1	Classroom	1990	Door	Header	Solid	Wood	0.05
505	1963 Bldg	100	XRF	5/21/97	1	Classroom	1990	Door	Header	Solid	Wood	0.02
506	1963 Bldg	298	XRF	5/22/97	1	Classroom	2000	Support Beam		Solid	Metal	0.06
507	1963 Bldg	299	XRF	5/22/97	1	Classroom	2000	Wall	Wall	Solid	Concrte	0
508	1963 Bldg	300	XRF	5/22/97	1	Classroom	2000		Locker	Solid	Metal	0
509	1963 Bldg	301	XRF	5/22/97	1	Classroom	2000	Wall	Bthrm Stil	Solid	Metal	0
510	1963 Bldg	302	XRF	5/22/97	1	Classroom	2000	Wall	Midle Wall	Solid	Concrte	0
511	1963 Bldg	303	XRF	5/22/97	1	Classroom	2000	Door	Header	Solid	Wood	0.05
512	1963 Bldg	304	XRF	5/22/97	1	Classroom	2000	Door	Door	Solid	Wood	0
513	1963 Bldg	305	XRF	5/22/97	1	Classroom	2000	Door	Casing	Solid	Metal	0.1
514	1963 Bldg	344	XRF	5/22/97	1	Classroom	2001	Wall	Wall	Solid	Concrte	0.07
515	1963 Bldg	345	XRF	5/22/97	1	Classroom	2001	Wall	Wall	Solid	Concrte	0.03
516	1963 Bldg	346	XRF	5/22/97	1	Classroom	2001	Door	Casing	Solid	Metal	0.06
517	1963 Bldg	347	XRF	5/22/97	1	Classroom	2001	Door	Header	Solid	Wood	0.03
518	1963 Bldg	348	XRF	5/22/97	1	Classroom	2001	Door	Header	Solid	Wood	0.03
519	1963 Bldg	349	XRF	5/22/97	1	Classroom	2001	Door	Door	Solid	Wood	0
520	1963 Bldg	350	XRF	5/22/97	1	Classroom	2001		Radiator	Solid	Metal	0.04
521	1963 Bldg	351	XRF	5/22/97	1	Classroom	2001	Window	Header	Solid	Wood	0
522	1963 Bldg	352	XRF	5/22/97	1	Classroom	2001	Support Beam		Solid	Metal	0.04
523	1963 Bldg	353	XRF	5/22/97	1	Classroom	2001	Support Beam		Solid	Metal	0.08
524	1963 Bldg	333	XRF	5/22/97	1	Classroom	2030	Wall	Midle Wall	Solid	Concrte	0.04
525	1963 Bldg	334	XRF	5/22/97	1	Classroom	2030	Wall	Wall	Solid	Concrte	0.04
526	1963 Bldg	335	XRF	5/22/97	1	Classroom	2030	Cabinet	Door	Solid	Wood	0
527	1963 Bldg	336	XRF	5/22/97	1	Classroom	2030	Door	Header	Solid	Wood	0.02
528	1963 Bldg	337	XRF	5/22/97	1	Classroom	2030	Door	Header	Solid	Wood	0.04
529	1963 Bldg	338	XRF	5/22/97	1	Classroom	2030	Door	Door	Solid	Wood	0
530	1963 Bldg	339	XRF	5/22/97	1	Classroom	2030	Door	Casing	Solid	Metal	0.08
531	1963 Bldg	340	XRF	5/22/97	1	Classroom	2030		Radiator	Solid	Metal	0.05
532	1963 Bldg	341	XRF	5/22/97	1	Classroom	2030	Window	Header	Solid	Wood	0.01

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
533	1963 Bldg	342	XRF	5/22/97	1	Classroo	2030	Support Beam		Solid	Metal	0.04
534	1963 Bldg	343	XRF	5/22/97	1	Classroo	2030	Support Beam		Solid	Metal	0.04
535	1963 Bldg	326	XRF	5/22/97	1	Classroo	2040	Wall	Wall	Solid	Concrte	0.01
536	1963 Bldg	327	XRF	5/22/97	1	Classroo	2040	Door	Header	Solid	Wood	0.01
537	1963 Bldg	328	XRF	5/22/97	1	Classroo	2040	Door	Door	Solid	Wood	0
538	1963 Bldg	329	XRF	5/22/97	1	Classroo	2040	Door	Casing	Solid	Metal	0.04
539	1963 Bldg	330	XRF	5/22/97	1	Classroo	2040	Cabinet	Door	Solid	Wood	0
540	1963 Bldg	331	XRF	5/22/97	1	Classroo	2040	Window	Header	Solid	Wood	0
541	1963 Bldg	332	XRF	5/22/97	1	Classroo	2040		Radiator	Solid	Metal	0.27
542	1963 Bldg	314	XRF	5/22/97	1	Classroo	2150	Wall	Wall	Solid	Concrte	0.03
543	1963 Bldg	315	XRF	5/22/97	1	Classroo	2150	Cabinet	Door	Solid	Wood	0
544	1963 Bldg	316	XRF	5/22/97	1	Classroo	2150	Door	Door	Solid	Wood	0
545	1963 Bldg	317	XRF	5/22/97	1	Classroo	2150	Door	Casing	Solid	Metal	0.05
546	1963 Bldg	318	XRF	5/22/97	1	Classroo	2150	Door	Header	Solid	Wood	0
547	1963 Bldg	319	XRF	5/22/97	1	Classroo	2150	Cabinet	Door	Solid	Metal	0
548	1963 Bldg	320	XRF	5/22/97	1	Classroo	2150	Cabinet	Door	Solid	Metal	0
549	1963 Bldg	321	XRF	5/22/97	1	Classroo	2150	Wall	Midle Wall	Solid	Drywall	0
550	1963 Bldg	322	XRF	5/22/97	1	Classroo	2150	Cabinet	Door	Solid	Metal	0
551	1963 Bldg	323	XRF	5/22/97	1	Classroo	2150	Wall	Midle Wall	Solid	Concrte	0.01
552	1963 Bldg	324	XRF	5/22/97	1	Classroo	2150		Radiator	Solid	Metal	0.08
553	1963 Bldg	325	XRF	5/22/97	1	Classroo	2150	Window	Header	Solid	Wood	0.02
554	1963 Bldg	76	XRF	5/21/97	1	Classroo	2220	Wall	Midle Wall	Solid	Concrte	0
555	1963 Bldg	77	XRF	5/21/97	1	Classroo	2220		Radiator	Solid	Metal	0
556	1963 Bldg	78	XRF	5/21/97	1	Classroo	2220	Window	Casing	Solid	Wood	0.01
557	1963 Bldg	79	XRF	5/21/97	1	Classroo	2220	Support Beam		Solid	Metal	0.11
558	1963 Bldg	80	XRF	5/21/97	1	Classroo	2220	Wall	Wall	Solid	Plaster	0.02
559	1963 Bldg	81	XRF	5/21/97	1	Classroo	2220	Door	Door	Solid	Wood	0
560	1963 Bldg	82	XRF	5/21/97	1	Classroo	2220	Door	Casing	Solid	Metal	0.1
561	1963 Bldg	83	XRF	5/21/97	1	Classroo	2220	Door	Header	Solid	Wood	0.01
562	1963 Bldg	52	XRF	5/21/97	1	Classroo	2300	Wall	Midle Wall	Solid	Drywall	0
563	1963 Bldg	53	XRF	5/21/97	1	Classroo	2300	Cabinet	Outside	Solid	Metal	0
564	1963 Bldg	54	XRF	5/21/97	1	Classroo	2300	Wall	Midle Wall	Solid	Concrte	0.03
565	1963 Bldg	55	XRF	5/21/97	1	Classroo	2300		Radiator	Solid	Metal	0
566	1963 Bldg	56	XRF	5/21/97	1	Classroo	2300	Support Beam		Solid	Metal	0.07
567	1963 Bldg	57	XRF	5/21/97	1	Classroo	2300	Cabinet	Outside	Solid	Metal	0
568	1963 Bldg	58	XRF	5/21/97	1	Classroo	2300	Window	Casing	Solid	Metal	0
569	1963 Bldg	59	XRF	5/21/97	1	Classroo	2300	Door	Casing	Solid	Metal	0
570	1963 Bldg	60	XRF	5/21/97	1	Classroo	2300	Door	Door	Solid	Wood	0
571	1963 Bldg	61	XRF	5/21/97	1	Classroo	2300		Locker	Solid	Metal	0
572	1963 Bldg	62	XRF	5/21/97	1	Classroo	2300	Window	Casing	Solid	Metal	0
573	1963 Bldg	63	XRF	5/21/97	1	Classroo	2300	Door	Door	Solid	Wood	0
574	1963 Bldg	64	XRF	5/21/97	1	Classroo	2300	Door	Header	Solid	Wood	0.01
575	1963 Bldg	65	XRF	5/21/97	1	Classroo	2300	Wall	Wall	Solid	Concrte	0.03
576	1963 Bldg	66	XRF	5/21/97	1	Classroo	2310	Wall	Midle Wall	Solid	Concrte	0
577	1963 Bldg	67	XRF	5/21/97	1	Classroo	2310	Bookcase	Shelf	Solid	Wood	0
578	1963 Bldg	68	XRF	5/21/97	1	Classroo	2310	Door	Door	Solid	Wood	0
579	1963 Bldg	69	XRF	5/21/97	1	Classroo	2310	Door	Casing	Solid	Metal	0
580	1963 Bldg	70	XRF	5/21/97	1	Classroo	2310	Support Beam		Solid	Metal	0.05
581	1963 Bldg	71	XRF	5/21/97	1	Classroo	2310	Window	Casing	Solid	Wood	0
582	1963 Bldg	72	XRF	5/21/97	1	Classroo	2310	Wall	Wall	Solid	Concrte	0.02
583	1963 Bldg	73	XRF	5/21/97	1	Classroo	2310		Radiator	Solid	Metal	0
584	1963 Bldg	74	XRF	5/21/97	1	Classroo	2310	Wall	Midle Wall	Solid	Concrte	0.07
585	1963 Bldg	75	XRF	5/21/97	1	Classroo	2310	Wall	Midle Wall	Solid	Concrte	0.02
586	1963 Bldg	20	XRF	5/29/97	1	Gym	333	Bench		Solid	Wood	0
587	1963 Bldg	21	XRF	5/29/97	1	Gym	333	Bench	Rest	Solid	Metal	0.33
588	1963 Bldg	22	XRF	5/29/97	1	Gym	333		Locker	Solid	Metal	0.91
589	1963 Bldg	23	XRF	5/29/97	1	Gym	333	Wall	Midle Wall	Solid	Concrte	0
590	1963 Bldg	24	XRF	5/29/97	1	Gym	333	Wall	Wall	Solid	Concrte	0.02
591	1963 Bldg	25	XRF	5/29/97	1	Gym	333	Wall	Wall	Solid	Concrte	0

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
592	1963 Bldg	26	XRF	5/29/97	1	Gym	333	Door	Door	Solid	Wood	0
593	1963 Bldg	27	XRF	5/29/97	1	Gym	333	Door	Casing	Solid	Metal	0.01
594	1963 Bldg	28	XRF	5/29/97	1	Gym	333	Door	Stall Door	Solid	Metal	0.1
595	1963 Bldg	29	XRF	5/29/97	1	Gym	333	Stairs	Hand rail	Solid	Metal	0
596	1963 Bldg	6	XRF	5/29/97	1	Gym	2560	Door	Stall Door	Solid	Metal	0.3
597	1963 Bldg	7	XRF	5/29/97	1	Gym	2560	Door	Casing	Solid	Metal	0.06
598	1963 Bldg	8	XRF	5/29/97	1	Gym	2560	Door	Door	Solid	Wood	0
599	1963 Bldg	9	XRF	5/29/97	1	Gym	2560	Door	Header	Solid	Wood	0.01
600	1963 Bldg	10	XRF	5/29/97	1	Gym	2560	Stairs	Hand rail	Peeling	Metal	0.01
601	1963 Bldg	11	XRF	5/29/97	1	Gym	2560	Stairs	Hand rail	Solid	Metal	0
602	1963 Bldg	12	XRF	5/29/97	1	Gym	2560	Door	Door	Solid	Metal	0
603	1963 Bldg	13	XRF	5/29/97	1	Gym	2560	Door	Casing	Solid	Metal	0
604	1963 Bldg	14	XRF	5/29/97	1	Gym	2560	Wall	Midle Wall	Solid	Concrte	0
605	1963 Bldg	15	XRF	5/29/97	1	Gym	2560	Wall	Midle Wall	Solid	Metal	0.25
606	1963 Bldg	16	XRF	5/29/97	1	Gym	2560		Locker	Solid	Metal	0.02
607	1963 Bldg	17	XRF	5/29/97	1	Gym	2560	Bench		Solid	Wood	0
608	1963 Bldg	18	XRF	5/29/97	1	Gym	2560	Wall	Wall	Solid	Plaster	0.01
609	1963 Bldg	19	XRF	5/29/97	1	Gym	2560	Wall	Wall	Solid	Plaster	0
610	1963 Bldg	30	XRF	5/29/97	1	Gym	2610	Bench		Peeling	Plastic	0.01
611	1963 Bldg	31	XRF	5/29/97	1	Gym	2610	Bench		Peeling	Plastic	0.06
612	1963 Bldg	32	XRF	5/29/97	1	Gym	2610	Stairs	Hand rail	Peeling	Metal	0.03
613	1963 Bldg	33	XRF	5/29/97	1	Gym	2610	Door	Door	Solid	Metal	0.06
614	1963 Bldg	34	XRF	5/29/97	1	Gym	2610	Door	Casing	Solid	Metal	0.06
615	1963 Bldg	35	XRF	5/29/97	1	Gym	2610	Door	Door	Solid	Wood	0
616	1963 Bldg	36	XRF	5/29/97	1	Gym	2610	Door	Header	Solid	Wood	0
617	1963 Bldg	76	XRF	5/29/97	1	Gym	2650	Bench		Solid	Wood	0
618	1963 Bldg	77	XRF	5/29/97	1	Gym	2650	Bench	Post	Solid	Metal	0.1
619	1963 Bldg	78	XRF	5/29/97	1	Gym	2650		Locker	Solid	Metal	0.01
620	1963 Bldg	79	XRF	5/29/97	1	Gym	2650	Wall	Wall	Solid	Plaster	0
621	1963 Bldg	80	XRF	5/29/97	1	Gym	2650	Wall	Midle Wall	Solid	Concrte	0.05
622	1963 Bldg	81	XRF	5/29/97	1	Gym	2650	Stairs	Hand rail	Solid	Metal	0
623	1963 Bldg	82	XRF	5/29/97	1	Gym	2650	Door	Door	Solid	Metal	0
624	1963 Bldg	83	XRF	5/29/97	1	Gym	2650	Door	Casing	Solid	Metal	0
625	1963 Bldg	84	XRF	5/29/97	1	Gym	2650	Stairs	Hand rail	Solid	Metal	0
626	1963 Bldg	85	XRF	5/29/97	1	Gym	2650	Door	Door	Solid	Wood	0
627	1963 Bldg	86	XRF	5/29/97	1	Gym	2650	Door	Casing	Solid	Metal	0.05
628	1963 Bldg	74	XRF	5/28/97	1	Gym	2710	Wall	Midle Wall	Solid	Concrte	0.07
629	1963 Bldg	75	XRF	5/28/97	1	Gym	2710	Door	Door	Solid	Wood	0
630	1963 Bldg	76	XRF	5/28/97	1	Gym	2710	Door	Casing	Peeling	Metal	0.07
631	1963 Bldg	77	XRF	5/28/97	1	Gym	2710	Door	Header	Solid	Wood	0.01
632	1963 Bldg	78	XRF	5/28/97	1	Gym	2710	Door	Bthrm Stil	Solid	Metal	0.06
633	1963 Bldg	79	XRF	5/28/97	1	Gym	2710	Door	Door	Solid	Wood	0
634	1963 Bldg	80	XRF	5/28/97	1	Gym	2710		Radiator	Solid	Metal	0.22
635	1963 Bldg	81	XRF	5/28/97	1	Gym	2710		Locker	Solid	Metal	0.01
636	1963 Bldg	82	XRF	5/28/97	1	Gym	2710	Wall	Wall	Solid	Concrte	0.06
637	1963 Bldg	83	XRF	5/28/97	1	Gym	2710	Wall	Wall	Solid	Concrte	0.05
638	1963 Bldg	84	XRF	5/28/97	1	Gym	2710	Wall	Wall	Solid	Concrte	0.02
639	1963 Bldg	85	XRF	5/28/97	1	Gym	2710	Bench		Solid	Wood	0
640	1963 Bldg	63	XRF	5/29/97	1	Gym	2864	Wall	Wall	Solid	Concrte	0
641	1963 Bldg	64	XRF	5/29/97	1	Gym	2864	Wall	Wall	Solid	Concrte	0
642	1963 Bldg	65	XRF	5/29/97	1	Gym	2864	Bleachers		Solid	Wood	0
643	1963 Bldg	66	XRF	5/29/97	1	Gym	2864	Door	Door	Solid	Wood	0
644	1963 Bldg	67	XRF	5/29/97	1	Gym	2864	Door	Casing	Solid	Metal	0.07
645	1963 Bldg	68	XRF	5/29/97	1	Gym	2864	Wall	Midle Wall	Solid	Drywall	0
646	1963 Bldg	69	XRF	5/29/97	1	Gym	2864	Door	Door	Solid	Wood	0
647	1963 Bldg	70	XRF	5/29/97	1	Gym	2864	Door	Header	Solid	Wood	0
648	1963 Bldg	71	XRF	5/29/97	1	Gym	2864	Door	Header	Solid	Wood	0
649	1963 Bldg	72	XRF	5/29/97	1	Gym	2864	Wall	Wall	Solid	Concrte	0
650	1963 Bldg	73	XRF	5/29/97	1	Gym	2864	Floor		Solid	Wood	0

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
651	1963 Bldg	74	XRF	5/29/97	1	Gym	2864	Floor		Solid	Wood	0
652	1963 Bldg	75	XRF	5/29/97	1	Gym	2864	Floor		Solid	Wood	0
653	1963 Bldg	45	XRF	5/20/97	1	Hall	1	Door	Door	Solid	Wood	0
654	1963 Bldg	46	XRF	5/20/97	1	Hall	1	Door	Casing	Solid	Metal	0.05
655	1963 Bldg	47	XRF	5/20/97	1	Hall	1	Door	Casing	Solid	Metal	0.03
656	1963 Bldg	48	XRF	5/20/97	1	Hall	1	Wall	Midle Wall	Solid	Concrte	0
657	1963 Bldg	49	XRF	5/20/97	1	Hall	1		Radiator	Solid	Metal	0.06
658	1963 Bldg	50	XRF	5/20/97	1	Hall	1	Wall	Midle Wall	Solid	Metal	0.03
659	1963 Bldg	51	XRF	5/20/97	1	Hall	1	Door	Door	Solid	Metal	0.02
660	1963 Bldg	6	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0.01
661	1963 Bldg	7	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0.26
662	1963 Bldg	8	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0.03
663	1963 Bldg	9	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0.16
664	1963 Bldg	10	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0.01
665	1963 Bldg	11	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0.12
666	1963 Bldg	12	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0.1
667	1963 Bldg	13	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0.01
668	1963 Bldg	14	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0.01
669	1963 Bldg	15	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0.02
670	1963 Bldg	16	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0.01
671	1963 Bldg	17	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0
672	1963 Bldg	18	XRF	5/28/97	1	Hall	1		Locker	Solid	Metal	0.01
673	1963 Bldg	19	XRF	5/28/97	1	Hall	1	Wall	Midle Wall	Solid	Concrte	0.01
674	1963 Bldg	20	XRF	5/28/97	1	Hall	1	Door	Door	Solid	Wood	0
675	1963 Bldg	21	XRF	5/28/97	1	Hall	1	Door	Casing	Solid	Metal	0.04
676	1963 Bldg	22	XRF	5/28/97	1	Hall	1	Support Beam		Solid	Metal	0.06
677	1963 Bldg	23	XRF	5/28/97	1	Hall	1	Door	Header	Solid	Wood	0.01
678	1963 Bldg	24	XRF	5/28/97	1	Hall	1	Door	Header	Solid	Wood	0
679	1963 Bldg	25	XRF	5/28/97	1	Hall	1	Door	Door	Solid	Metal	0.05
680	1963 Bldg	26	XRF	5/28/97	1	Hall	1	Door	Casing	Solid	Metal	0.03
681	1963 Bldg	27	XRF	5/28/97	1	Hall	1	Door	Header	Solid	Wood	0.01
682	1963 Bldg	28	XRF	5/28/97	1	Hall	1	Door	Door	Solid	Metal	0.06
683	1963 Bldg	29	XRF	5/28/97	1	Hall	1		Radiator	Solid	Metal	0.02
684	1963 Bldg	30	XRF	5/28/97	1	Hall	1	Window	Casing	Solid	Metal	0.07
685	1963 Bldg	31	XRF	5/28/97	1	Hall	1	Door	Header	Solid	Wood	0.01
686	1963 Bldg	32	XRF	5/28/97	1	Hall	1	Wall	Midle Wall	Solid	Wood	0
687	1963 Bldg	33	XRF	5/28/97	1	Hall	1	Window	Header	Solid	Wood	0.02
688	1963 Bldg	34	XRF	5/28/97	1	Hall	1	Door	Header	Solid	Wood	0.01
689	1963 Bldg	35	XRF	5/28/97	1	Hall	1	Door	Door	Solid	Metal	0.01
690	1963 Bldg	36	XRF	5/28/97	1	Hall	1	Window	Casing	Solid	Metal	0.05
691	1963 Bldg	37	XRF	5/28/97	1	Hall	1	Wall	Wall	Solid	Wood	0
692	1963 Bldg	38	XRF	5/28/97	1	Hall	1	Door	Door	Solid	Metal	0
693	1963 Bldg	39	XRF	5/28/97	1	Hall	1	Wall	Midle Wall	Solid	Drywall	0
694	1963 Bldg	40	XRF	5/28/97	1	Hall	1	Door	Header	Solid	Wood	0
695	1963 Bldg	41	XRF	5/28/97	1	Hall	1	Door	Header	Solid	Wood	0.42
696	1963 Bldg	42	XRF	5/28/97	1	Hall	1	Wall	Midle Wall	Solid	Concrte	0.05
697	1963 Bldg	43	XRF	5/28/97	1	Hall	1	Door	Header	Solid	Wood	0.01
698	1963 Bldg	44	XRF	5/28/97	1	Hall	1	Door	Door	Solid	Wood	0
699	1963 Bldg	45	XRF	5/28/97	1	Hall	1	Wall	Wall-Lwr	Solid	Wood	0
700	1963 Bldg	46	XRF	5/28/97	1	Hall	1		Radiator	Solid	Metal	0.07
701	1963 Bldg	47	XRF	5/28/97	1	Hall	1		Radiator	Solid	Metal	0.07
702	1963 Bldg	48	XRF	5/28/97	1	Hall	1		Radiator	Solid	Metal	0.2
703	1963 Bldg	49	XRF	5/28/97	1	Hall	1	Door	Header	Solid	Wood	0.02
704	1963 Bldg	50	XRF	5/28/97	1	Hall	1	Door	Casing	Solid	Metal	0.03
705	1963 Bldg	51	XRF	5/28/97	1	Hall	1	Support Beam		Solid	Metal	0.07
706	1963 Bldg	52	XRF	5/28/97	1	Hall	1	Stairs	Baluster	Solid	Metal	0.02
707	1963 Bldg	53	XRF	5/28/97	1	Hall	1	Wall	Wall	Solid	Wood	0.02
708	1963 Bldg	43	XRF	5/31/97	1	Hall	1001	Window	Casing	Solid	Metal	0
709	1963 Bldg	44	XRF	5/31/97	1	Hall	1001		Radiator	Solid	Metal	0.06

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
710	1963 Bldg	45	XRF	5/31/97	1	Hall	1001	Wall	Midle Wall	Solid	Concrte	0.01
711	1963 Bldg	46	XRF	5/31/97	1	Hall	1001	Stairs	Hand rail	Solid	Metal	0
712	1963 Bldg	47	XRF	5/31/97	1	Hall	1001	Wall	Midle Wall	Solid	Drywall	0
713	1963 Bldg	48	XRF	5/31/97	1	Hall	1001	Door	Door	Solid	Metal	0
714	1963 Bldg	49	XRF	5/31/97	1	Hall	1001	Door	Casing	Solid	Metal	0.02
715	1963 Bldg	50	XRF	5/31/97	1	Hall	1001		Locker	Solid	Metal	0.01
716	1963 Bldg	51	XRF	5/31/97	1	Hall	1001	Window	Casing	Solid	Metal	0.19
717	1963 Bldg	52	XRF	5/31/97	1	Hall	1001		Radiator	Solid	Metal	0.05
718	1963 Bldg	53	XRF	5/31/97	1	Hall	1001	Cabinet	Door	Solid	Wood	0
719	1963 Bldg	54	XRF	5/31/97	1	Hall	1001	Window	Casing	Solid	Metal	0
720	1963 Bldg	56	XRF	5/27/97	1	Hall	1021	Door	Door	Solid	Metal	0.03
721	1963 Bldg	57	XRF	5/27/97	1	Hall	1021	Door	Casing	Solid	Metal	0.05
722	1963 Bldg	58	XRF	5/27/97	1	Hall	1021	Door	Door	Solid	Wood	0
723	1963 Bldg	59	XRF	5/27/97	1	Hall	1021	Door	Jamb	Solid	Metal	0.09
724	1963 Bldg	60	XRF	5/27/97	1	Hall	1021		Radiator	Solid	Metal	0.22
725	1963 Bldg	61	XRF	5/27/97	1	Hall	1021	Wall	Bthrm Stil	Solid	Metal	0.2
726	1963 Bldg	62	XRF	5/27/97	1	Hall	1021		Locker	Solid	Metal	0.01
727	1963 Bldg	55	XRF	5/29/97	1	Hall	1061	Stairs	Hand rail	Solid	Metal	0
728	1963 Bldg	56	XRF	5/29/97	1	Hall	1061	Door	Door	Solid	Metal	0
729	1963 Bldg	57	XRF	5/29/97	1	Hall	1061	Door	Casing	Solid	Metal	0
730	1963 Bldg	58	XRF	5/29/97	1	Hall	1061	Wall	Wall	Solid	Metal	0
731	1963 Bldg	59	XRF	5/29/97	1	Hall	1061	Wall	Mural	Solid	Concrte	0
732	1963 Bldg	60	XRF	5/29/97	1	Hall	1061	Wall	Midle Wall	Solid	Concrte	0
733	1963 Bldg	61	XRF	5/29/97	1	Hall	1061	Door	Door	Solid	Wood	0
734	1963 Bldg	62	XRF	5/29/97	1	Hall	1061	Door	Casing	Solid	Metal	0.19
735	1963 Bldg	287	XRF	5/22/97	1	Library	1490	Bookcase	Shelf	Solid	Wood	0
736	1963 Bldg	288	XRF	5/22/97	1	Library	1490	Wall	Midle Wall	Solid	Concrte	0.04
737	1963 Bldg	289	XRF	5/22/97	1	Library	1490	Door	Door	Solid	Wood	0
738	1963 Bldg	290	XRF	5/22/97	1	Library	1490	Wall	Midle Wall	Solid	Concrte	0.02
739	1963 Bldg	291	XRF	5/22/97	1	Library	1490	Door	Header	Solid	Wood	0.01
740	1963 Bldg	292	XRF	5/22/97	1	Library	1490	Window	Casing	Solid	Metal	0.03
741	1963 Bldg	293	XRF	5/22/97	1	Library	1490	Wall	Wall	Solid	Drywall	0
742	1963 Bldg	6	XRF	5/31/97	1	Main	1	Wall	Wall	Solid	Drywall	0
743	1963 Bldg	7	XRF	5/31/97	1	Main	1	Wall	Wall	Solid	Concrte	0
744	1963 Bldg	8	XRF	5/31/97	1	Main	1	Window	Casing	Solid	Metal	0
745	1963 Bldg	9	XRF	5/31/97	1	Main	1	Door	Door	Solid	Wood	0
746	1963 Bldg	10	XRF	5/31/97	1	Main	1	Door	Casing	Solid	Metal	0
747	1963 Bldg	11	XRF	5/31/97	1	Main	1	Wall	Midle Wall	Solid	Drywall	0
748	1963 Bldg	12	XRF	5/31/97	1	Main	1	Door	Door	Solid	Wood	0
749	1963 Bldg	13	XRF	5/31/97	1	Main	1	Door	Casing	Solid	Metal	0
750	1963 Bldg	14	XRF	5/31/97	1	Main	1	Window	Casing	Solid	Metal	0.01
751	1963 Bldg	15	XRF	5/31/97	1	Main	1		Radiator	Solid	Metal	0
752	1963 Bldg	16	XRF	5/31/97	1	Main	1	Wall	Midle Wall	Solid	Drywall	0
753	1963 Bldg	17	XRF	5/31/97	1	Main	1	Wall	Wall	Solid	Drywall	0
754	1963 Bldg	18	XRF	5/31/97	1	Main	1	Door	Casing	Solid	Metal	0
755	1963 Bldg	19	XRF	5/31/97	1	Main	1	Wall	Midle Wall	Solid	Drywall	0.02
756	1963 Bldg	20	XRF	5/31/97	1	Main	1	Window	Casing	Solid	Metal	0
757	1963 Bldg	21	XRF	5/31/97	1	Main	1	Door	Door	Solid	Wood	0
758	1963 Bldg	22	XRF	5/31/97	1	Main	1	Wall	Midle Wall	Solid	Concrte	0
759	1963 Bldg	23	XRF	5/31/97	1	Main	1	Wall	Midle Wall	Solid	Drywall	0.06
760	1963 Bldg	24	XRF	5/31/97	1	Main	1	Wall	Midle Wall	Solid	Drywall	0.02
761	1963 Bldg	25	XRF	5/31/97	1	Main	1	Door	Door	Solid	Wood	0
762	1963 Bldg	26	XRF	5/31/97	1	Main	1	Window	Casing	Solid	Metal	0
763	1963 Bldg	27	XRF	5/31/97	1	Main	1	Wall	Wall	Solid	Drywall	0
764	1963 Bldg	28	XRF	5/31/97	1	Main	1	Wall	Wall	Solid	Drywall	0.02
765	1963 Bldg	29	XRF	5/31/97	1	Main	1	Wall	Midle Wall	Solid	Concrte	0
766	1963 Bldg	30	XRF	5/31/97	1	Main	1	Wall	Midle Wall	Solid	Drywall	0.01
767	1963 Bldg	31	XRF	5/31/97	1	Main	1	Wall	Midle Wall	Solid	Drywall	0
768	1963 Bldg	32	XRF	5/31/97	1	Main	1	Door	Door	Solid	Wood	0.02

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
769	1963 Bldg	33	XRF	5/31/97	1	Main	1	Window	Casing	Solid	Metal	0
770	1963 Bldg	34	XRF	5/31/97	1	Main	1	Wall	Midle Wall	Solid	Concrte	0
771	1963 Bldg	6	XRF	6/1/97	1	Outside	1	Window	Casing	Solid	Metal	0.12
772	1963 Bldg	7	XRF	6/1/97	1	Outside	1	Window	Casing	Solid	Metal	0
773	1963 Bldg	8	XRF	6/1/97	1	Outside	1	Window	Casing	Solid	Metal	0
774	1963 Bldg	9	XRF	6/1/97	1	Outside	1	Door	Door	Solid	Metal	0.03
775	1963 Bldg	10	XRF	6/1/97	1	Outside	1	Door	Casing	Solid	Metal	0.08
776	1963 Bldg	11	XRF	6/1/97	1	Outside	1	Stairs	Hand rail	Solid	Metal	1.05
777	1963 Bldg	44	XRF	5/21/97	1	Restroom	1	Door	Stall Door	Solid	Metal	0
778	1963 Bldg	45	XRF	5/21/97	1	Restroom	1	Door	Door	Solid	Wood	0
779	1963 Bldg	46	XRF	5/21/97	1	Restroom	1	Door	Header	Solid	Wood	0.04
780	1963 Bldg	47	XRF	5/21/97	1	Restroom	1	Door	Casing	Solid	Metal	0.06
781	1963 Bldg	48	XRF	5/21/97	1	Restroom	2	Door	Door	Solid	Wood	0
782	1963 Bldg	49	XRF	5/21/97	1	Restroom	2	Door	Header	Solid	Wood	0.03
783	1963 Bldg	50	XRF	5/21/97	1	Restroom	2	Door	Casing	Solid	Metal	0.07
784	1963 Bldg	51	XRF	5/21/97	1	Restroom	2	Door	Stall Door	Solid	Metal	0.15
785	1963 Bldg	39	XRF	5/27/97	1	Restroom	5	Door	Stall Door	Solid	Metal	0.06
786	1963 Bldg	40	XRF	5/27/97	1	Restroom	5	Door	Header	Solid	Wood	0.02
787	1963 Bldg	41	XRF	5/27/97	1	Restroom	5	Door	Casing	Solid	Metal	0.06
788	1963 Bldg	42	XRF	5/27/97	1	Restroom	6	Wall	Bthrm Stil	Solid	Metal	0.24
789	1963 Bldg	43	XRF	5/27/97	1	Restroom	6	Door	Header	Solid	Wood	0.04
790	1963 Bldg	44	XRF	5/27/97	1	Restroom	6	Door	Casing	Solid	Metal	0.05
791	1963 Bldg	35	XRF	5/31/97	1	Restroom	555	Wall	Midle Wall	Solid	Concrte	0
792	1963 Bldg	36	XRF	5/31/97	1	Restroom	555	Door	Casing	Solid	Metal	0
793	1963 Bldg	37	XRF	5/31/97	1	Restroom	555	Wall	Midle Wall	Solid	Drywall	0
794	1963 Bldg	38	XRF	5/31/97	1	Restroom	555		Radiator	Solid	Metal	0.03
795	1963 Bldg	39	XRF	5/31/97	1	Restroom	556	Door	Casing	Solid	Metal	0
796	1963 Bldg	40	XRF	5/31/97	1	Restroom	556	Wall	Midle Wall	Solid	Concrte	0
797	1963 Bldg	41	XRF	5/31/97	1	Restroom	556	Wall	Midle Wall	Solid	Drywall	0
798	1963 Bldg	42	XRF	5/31/97	1	Restroom	556		Radiator	Solid	Metal	0
799	1963 Bldg	99	XRF	5/27/97	1	Restroom	1170	Door	Header	Solid	Wood	0.02
800	1963 Bldg	100	XRF	5/27/97	1	Restroom	1170	Door	Casing	Solid	Metal	0.05
801	1963 Bldg	101	XRF	5/27/97	1	Restroom	1170		Radiator	Solid	Metal	0.04
802	1963 Bldg	96	XRF	5/27/97	1	Restroom	1180	Door	Casing	Solid	Metal	0.07
803	1963 Bldg	97	XRF	5/27/97	1	Restroom	1180		Radiator	Solid	Metal	0.1
804	1963 Bldg	98	XRF	5/27/97	1	Restroom	1180	Door	Header	Solid	Wood	0.02
805	1963 Bldg	286	XRF	5/22/97	1	Restroom	1610	Door	Stall Door	Solid	Metal	0.04
806	1963 Bldg	33	XRF	5/27/97	1	Restroom	1750	Wall	Bthrm Stil	Solid	Metal	0.06
807	1963 Bldg	34	XRF	5/27/97	1	Restroom	1750	Door	Casing	Solid	Metal	0.09
808	1963 Bldg	35	XRF	5/27/97	1	Restroom	1750	Door	Header	Solid	Wood	0.05
809	1963 Bldg	36	XRF	5/27/97	1	Restroom	1800	Door	Stall Door	Solid	Metal	0.08
810	1963 Bldg	37	XRF	5/27/97	1	Restroom	1800	Door	Casing	Solid	Metal	0.05
811	1963 Bldg	38	XRF	5/27/97	1	Restroom	1800	Door	Header	Solid	Wood	0.03
812	1963 Bldg	70	XRF	5/28/97	1	Restroom	2800	Wall	Bthrm Stil	Solid	Metal	0.61
813	1963 Bldg	71	XRF	5/28/97	1	Restroom	2800		Radiator	Solid	Metal	0.13
814	1963 Bldg	72	XRF	5/28/97	1	Restroom	2800	Door	Casing	Solid	Metal	0.08
815	1963 Bldg	73	XRF	5/28/97	1	Restroom	2800	Door	Door	Solid	Wood	0
816	1963 Bldg	63	XRF	5/27/97	0	Room	30	Wall	Midle Wall	Solid	Concrte	0.03
817	1963 Bldg	64	XRF	5/27/97	0	Room	30	Door	Door	Solid	Metal	0.02
818	1963 Bldg	65	XRF	5/27/97	0	Room	30	Door	Casing	Solid	Metal	0.06
819	1963 Bldg	66	XRF	5/27/97	0	Room	30	Wall	Midle Wall	Solid	Concrte	0.03
820	1963 Bldg	67	XRF	5/27/97	0	Room	30	Stairs	Hand rail	Solid	Metal	0.08
821	1963 Bldg	120	XRF	5/20/97	1	Room	998	Wall	Midle Wall	Solid	Drywall	0
822	1963 Bldg	121	XRF	5/20/97	1	Room	998	Door	Door	Solid	Wood	0
823	1963 Bldg	122	XRF	5/20/97	1	Room	998	Door	Casing	Solid	Metal	0
824	1963 Bldg	123	XRF	5/20/97	1	Room	998	Wall	Wall Rgstr	Solid	Metal	0
825	1963 Bldg	124	XRF	5/20/97	1	Room	998	Wall	Midle Wall	Solid	Concrte	0
826	1963 Bldg	99	XRF	5/29/97	1	Room	1051	Wall	Wall	Solid	Drywall	0.08
827	1963 Bldg	100	XRF	5/29/97	1	Room	1051	Wall	Midle Wall	Solid	Concrte	0

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
828	1963 Bldg	101	XRF	5/29/97	1	Room	1051	Door	Door	Solid	Wood	0
829	1963 Bldg	87	XRF	5/29/97	1	Room	1054	Wall	Midle Wall	Solid	Concrte	0
830	1963 Bldg	88	XRF	5/29/97	1	Room	1054	Wall	Wall	Solid	Drywall	0
831	1963 Bldg	89	XRF	5/29/97	1	Room	1054	Door	Door	Solid	Wood	0
832	1963 Bldg	90	XRF	5/29/97	1	Room	1054	Door	Casing	Solid	Metal	0
833	1963 Bldg	102	XRF	5/29/97	1	Room	1059	Wall	Midle Wall	Solid	Concrte	0
834	1963 Bldg	103	XRF	5/29/97	1	Room	1059	Door	Door	Solid	Wood	0
835	1963 Bldg	104	XRF	5/29/97	1	Room	1059	Door	Casing	Solid	Metal	0
836	1963 Bldg	105	XRF	5/29/97	1	Room	1059	Wall	Wall	Solid	Drywall	0
837	1963 Bldg	106	XRF	5/29/97	1	Room	1059		Radiator	Solid	Metal	0.01
838	1963 Bldg	107	XRF	5/29/97	1	Room	1059	Window	Casing	Solid	Metal	0
839	1963 Bldg	120	XRF	5/29/97	1	Room	1067	Wall	Midle Wall	Solid	Concrte	0
840	1963 Bldg	121	XRF	5/29/97	1	Room	1067	Wall	Wall	Solid	Drywall	0
841	1963 Bldg	122	XRF	5/29/97	1	Room	1067	Door	Door	Solid	Wood	0
842	1963 Bldg	123	XRF	5/29/97	1	Room	1067	Door	Casing	Solid	Metal	0.04
843	1963 Bldg	132	XRF	5/29/97	1	Room	1070	Wall	Midle Wall	Solid	Concrte	0
844	1963 Bldg	133	XRF	5/29/97	1	Room	1070	Wall	Wall	Solid	Drywall	0
845	1963 Bldg	134	XRF	5/29/97	1	Room	1070	Door	Door	Solid	Wood	0
846	1963 Bldg	135	XRF	5/29/97	1	Room	1070	Door	Casing	Solid	Metal	0
847	1963 Bldg	136	XRF	5/29/97	1	Room	1071	Wall	Wall	Solid	Drywall	0
848	1963 Bldg	137	XRF	5/29/97	1	Room	1071	Wall	Midle Wall	Solid	Concrte	0
849	1963 Bldg	138	XRF	5/29/97	1	Room	1071	Door	Door	Solid	Wood	0
850	1963 Bldg	139	XRF	5/29/97	1	Room	1071	Window	Casing	Solid	Metal	0
851	1963 Bldg	68	XRF	5/27/97	1	Room	1081	Wall	Midle Wall	Solid	Concrte	0.01
852	1963 Bldg	69	XRF	5/27/97	1	Room	1081	Door	Door	Solid	Wood	0
853	1963 Bldg	70	XRF	5/27/97	1	Room	1081	Door	Casing	Solid	Metal	0.05
854	1963 Bldg	74	XRF	5/27/97	1	Room	1090	Door	Casing	Solid	Metal	0.06
855	1963 Bldg	75	XRF	5/27/97	1	Room	1090	Wall	Midle Wall	Solid	Concrte	0
856	1963 Bldg	76	XRF	5/27/97	1	Room	1090	Door	Casing	Solid	Metal	0.02
857	1963 Bldg	77	XRF	5/27/97	1	Room	1090	Wall	Wall	Solid	Concrte	0.01
858	1963 Bldg	71	XRF	5/27/97	1	Room	1100	Cabinet	Door	Solid	Wood	0
859	1963 Bldg	72	XRF	5/27/97	1	Room	1100	Door	Casing	Solid	Metal	0.08
860	1963 Bldg	73	XRF	5/27/97	1	Room	1100	Wall	Midle Wall	Solid	Concrte	0.04
861	1963 Bldg	78	XRF	5/27/97	1	Room	1111	Window	Casing	Solid	Metal	0.05
862	1963 Bldg	79	XRF	5/27/97	1	Room	1111	Wall	Midle Wall	Solid	Concrte	0.03
863	1963 Bldg	80	XRF	5/27/97	1	Room	1111	Cabinet	Door	Solid	Wood	0
864	1963 Bldg	81	XRF	5/27/97	1	Room	1111	Door	Door	Solid	Wood	0
865	1963 Bldg	82	XRF	5/27/97	1	Room	1120	Wall	Midle Wall	Solid	Plaster	0.02
866	1963 Bldg	83	XRF	5/27/97	1	Room	1120	Cabinet	Casing	Solid	Wood	0
867	1963 Bldg	84	XRF	5/27/97	1	Room	1120	Door	Door	Solid	Wood	0
868	1963 Bldg	85	XRF	5/27/97	1	Room	1120	Door	Jamb	Solid	Wood	0
869	1963 Bldg	86	XRF	5/27/97	1	Room	1120	Door	Casing	Solid	Metal	0.08
870	1963 Bldg	87	XRF	5/27/97	1	Room	1122	Wall	Midle Wall	Solid	Plaster	0.15
871	1963 Bldg	88	XRF	5/27/97	1	Room	1122	Cabinet	Door	Solid	Wood	0
872	1963 Bldg	89	XRF	5/27/97	1	Room	1122	Door	Casing	Solid	Metal	0.07
873	1963 Bldg	90	XRF	5/27/97	1	Room	1122	Door	Door	Solid	Wood	0
874	1963 Bldg	52	XRF	5/20/97	1	Room	1230	Wall	Midle Wall	Solid	Concrte	0.05
875	1963 Bldg	53	XRF	5/20/97	1	Room	1230	Wall	Midle Wall	Solid	Concrte	0.06
876	1963 Bldg	54	XRF	5/20/97	1	Room	1230		Elec Panel	Solid	Metal	0.01
877	1963 Bldg	55	XRF	5/20/97	1	Room	1230	Wall	Midle Wall	Solid	Concrte	0.03
878	1963 Bldg	56	XRF	5/20/97	1	Room	1230	Wall	Wall	Solid	Concrte	0.09
879	1963 Bldg	57	XRF	5/20/97	1	Room	1230		Radiator	Solid	Metal	0.23
880	1963 Bldg	58	XRF	5/20/97	1	Room	1230	Wall	Midle Wall	Solid	Concrte	0.02
881	1963 Bldg	59	XRF	5/20/97	1	Room	1230	Bookcase	Shelf	Solid	Wood	0
882	1963 Bldg	60	XRF	5/20/97	1	Room	1230	Door	Door	Solid	Metal	0.06
883	1963 Bldg	61	XRF	5/20/97	1	Room	1230	Wall	Midle Wall	Solid	Concrte	0.05
884	1963 Bldg	62	XRF	5/20/97	1	Room	1230	Wall	Midle Wall	Solid	Concrte	0.01
885	1963 Bldg	22	XRF	5/20/97	1	Room	1252	Wall	Bthrm Still	Solid	Metal	0.91
886	1963 Bldg	23	XRF	5/20/97	1	Room	1252	Wall	Midle Wall	Solid	Concrte	0.06

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
887	1963 Bldg	24	XRF	5/20/97	1	Room	1252	Door	Casing	Solid	Metal	0.07
888	1963 Bldg	25	XRF	5/20/97	1	Room	1252	Door	Door	Solid	Wood	0
889	1963 Bldg	6	XRF	5/20/97	1	Room	1270	Support Beam		Solid	Metal	0.01
890	1963 Bldg	7	XRF	5/20/97	1	Room	1270	Door	Door	Solid	Metal	0
891	1963 Bldg	8	XRF	5/20/97	1	Room	1270	Door	Casing	Solid	Metal	0.05
892	1963 Bldg	9	XRF	5/20/97	1	Room	1270	Wall	Midle Wall	Solid	Concrte	0.02
893	1963 Bldg	10	XRF	5/20/97	1	Room	1270	Wall	Midle Wall	Solid	Concrte	0.01
894	1963 Bldg	11	XRF	5/20/97	1	Room	1270		Radiator	Solid	Metal	0.15
895	1963 Bldg	12	XRF	5/20/97	1	Room	1270	Door	Door	Solid	Metal	0.15
896	1963 Bldg	13	XRF	5/20/97	1	Room	1270	Door	Casing	Solid	Metal	0.03
897	1963 Bldg	14	XRF	5/20/97	1	Room	1270	Door	Door	Solid	Wood	0.03
898	1963 Bldg	15	XRF	5/20/97	1	Room	1270	Wall	Midle Wall	Solid	Metal	0.05
899	1963 Bldg	16	XRF	5/20/97	1	Room	1270		Locker	Solid	Metal	0.15
900	1963 Bldg	240	XRF	5/22/97	1	Room	1391		Radiator	Solid	Metal	0.07
901	1963 Bldg	241	XRF	5/22/97	1	Room	1391	Support Beam		Solid	Metal	0.02
902	1963 Bldg	242	XRF	5/22/97	1	Room	1391	Window	Header	Solid	Wood	0.02
903	1963 Bldg	243	XRF	5/22/97	1	Room	1391	Wall	Wall	Solid	Concrte	0.13
904	1963 Bldg	244	XRF	5/22/97	1	Room	1391	Wall	Wall	Solid	Concrte	0.05
905	1963 Bldg	245	XRF	5/22/97	1	Room	1391	Wall	Midle Wall	Solid	Concrte	0.03
906	1963 Bldg	246	XRF	5/22/97	1	Room	1391	Door	Door	Solid	Wood	0
907	1963 Bldg	247	XRF	5/22/97	1	Room	1391	Door	Casing	Solid	Metal	0.06
908	1963 Bldg	248	XRF	5/22/97	1	Room	1391	Door	Header	Solid	Wood	0.03
909	1963 Bldg	249	XRF	5/22/97	1	Room	1391	Door	Header	Solid	Wood	0.03
910	1963 Bldg	387	XRF	5/22/97	1	Room	1640	Wall	Midle Wall	Solid	Concrte	0.08
911	1963 Bldg	388	XRF	5/22/97	1	Room	1640	Door	Door	Solid	Metal	0.02
912	1963 Bldg	389	XRF	5/22/97	1	Room	1640	Door	Casing	Solid	Metal	0.05
913	1963 Bldg	390	XRF	5/22/97	1	Room	1640	Door	Header	Solid	Wood	0.01
914	1963 Bldg	391	XRF	5/22/97	1	Room	1640	Door	Door	Solid	Wood	0
915	1963 Bldg	392	XRF	5/22/97	1	Room	1640	Cabinet	Door	Solid	Wood	0
916	1963 Bldg	393	XRF	5/22/97	1	Room	1640	Ceiling		Solid	Plaster	0.01
917	1963 Bldg	394	XRF	5/22/97	1	Room	1640		Radiator	Solid	Metal	0.12
918	1963 Bldg	395	XRF	5/22/97	1	Room	1640	Window	Header	Solid	Wood	0.01
919	1963 Bldg	396	XRF	5/22/97	1	Room	1640	Support Beam		Solid	Metal	0.05
920	1963 Bldg	397	XRF	5/22/97	1	Room	1640	Support Beam		Solid	Metal	0.03
921	1963 Bldg	132	XRF	5/21/97	1	Room	1861	Door	Door	Solid	Wood	0
922	1963 Bldg	133	XRF	5/21/97	1	Room	1861	Door	Casing	Solid	Metal	0
923	1963 Bldg	134	XRF	5/21/97	1	Room	1861	Wall	Midle Wall	Solid	Drywall	0
924	1963 Bldg	135	XRF	5/21/97	1	Room	1861	Wall	Wall	Solid	Concrte	0
925	1963 Bldg	136	XRF	5/21/97	1	Room	1861		Radiator	Solid	Metal	0
926	1963 Bldg	137	XRF	5/21/97	1	Room	1861	Wall	Midle Wall	Solid	Concrte	0.05
927	1963 Bldg	100	XRF	5/24/97	1	Room	1880	Wall	Midle Wall	Solid	Concrte	0.05
928	1963 Bldg	101	XRF	5/24/97	1	Room	1880	Support Beam		Solid	Metal	0.02
929	1963 Bldg	102	XRF	5/24/97	1	Room	1880	Cabinet	Door	Solid	Wood	0
930	1963 Bldg	103	XRF	5/24/97	1	Room	1880	Door	Door	Solid	Wood	0
931	1963 Bldg	104	XRF	5/24/97	1	Room	1880	Door	Casing	Solid	Metal	0.06
932	1963 Bldg	105	XRF	5/24/97	1	Room	1880	Door	Header	Solid	Wood	0
933	1963 Bldg	94	XRF	5/24/97	1	Room	1890	Bookcase	Shelf	Solid	Wood	0
934	1963 Bldg	95	XRF	5/24/97	1	Room	1890	Wall	Midle Wall	Solid	Concrte	0.12
935	1963 Bldg	96	XRF	5/24/97	1	Room	1890	Door	Header	Solid	Wood	0
936	1963 Bldg	97	XRF	5/24/97	1	Room	1890	Door	Casing	Solid	Metal	0.08
937	1963 Bldg	98	XRF	5/24/97	1	Room	1890	Door	Door	Solid	Wood	0
938	1963 Bldg	99	XRF	5/24/97	1	Room	1890	Wall	Midle Wall	Solid	Drywall	0
939	1963 Bldg	89	XRF	5/24/97	1	Room	1900	Wall	Midle Wall	Solid	Concrte	0.02
940	1963 Bldg	90	XRF	5/24/97	1	Room	1900	Support Beam		Solid	Metal	0.16
941	1963 Bldg	91	XRF	5/24/97	1	Room	1900	Door	Header	Solid	Wood	0
942	1963 Bldg	92	XRF	5/24/97	1	Room	1900	Window	Casing	Solid	Metal	0.07
943	1963 Bldg	93	XRF	5/24/97	1	Room	1900	Door	Door	Solid	Wood	0
944	1963 Bldg	101	XRF	5/21/97	1	Room	2010	Wall	Midle Wall	Solid	Concrte	0
945	1963 Bldg	102	XRF	5/21/97	1	Room	2010	Wall	Wall	Solid	Concrte	0.03

Saint Paul Public Schools
Harding High School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample#	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
946	1963 Bldg	103	XRF	5/21/97	1	Room	2010		Radiator	Solid	Metal	0.09
947	1963 Bldg	104	XRF	5/21/97	1	Room	2010	Window	Header	Solid	Wood	0.02
948	1963 Bldg	105	XRF	5/21/97	1	Room	2010	Support Beam		Solid	Metal	0.05
949	1963 Bldg	106	XRF	5/21/97	1	Room	2010	Wall	Bthrm Still	Solid	Metal	0.18
950	1963 Bldg	107	XRF	5/21/97	1	Room	2010	Door	Casing	Solid	Wood	0
951	1963 Bldg	108	XRF	5/21/97	1	Room	2010	Cabinet	Door	Solid	Wood	0
952	1963 Bldg	109	XRF	5/21/97	1	Room	2010	Door	Door	Solid	Wood	0
953	1963 Bldg	110	XRF	5/21/97	1	Room	2010	Door	Casing	Solid	Metal	0.09
954	1963 Bldg	111	XRF	5/21/97	1	Room	2010	Door	Header	Solid	Wood	0.04
955	1963 Bldg	112	XRF	5/21/97	1	Room	2010	Door	Header	Solid	Wood	0.03
956	1963 Bldg	113	XRF	5/21/97	1	Room	2020	Wall	Midle Wall	Solid	Concrte	0.05
957	1963 Bldg	114	XRF	5/21/97	1	Room	2020	Wall	Wall	Solid	Concrte	0.04
958	1963 Bldg	115	XRF	5/21/97	1	Room	2020	Wall	Wall	Solid	Plaster	0.01
959	1963 Bldg	116	XRF	5/21/97	1	Room	2020	Wall	Wall	Solid	Plaster	0.01
960	1963 Bldg	117	XRF	5/21/97	1	Room	2020	Cabinet	Door	Solid	Wood	0
961	1963 Bldg	118	XRF	5/21/97	1	Room	2020	Door	Header	Solid	Wood	0.05
962	1963 Bldg	119	XRF	5/21/97	1	Room	2020	Door	Header	Solid	Wood	0.06
963	1963 Bldg	120	XRF	5/21/97	1	Room	2020	Door	Door	Solid	Wood	0
964	1963 Bldg	121	XRF	5/21/97	1	Room	2020	Door	Casing	Solid	Metal	0.09
965	1963 Bldg	294	XRF	5/22/97	1	Room	2110	Wall	Midle Wall	Solid	Concrte	0.03
966	1963 Bldg	295	XRF	5/22/97	1	Room	2110	Door	Casing	Solid	Metal	0.07
967	1963 Bldg	296	XRF	5/22/97	1	Room	2110	Door	Header	Solid	Wood	0.02
968	1963 Bldg	297	XRF	5/22/97	1	Room	2110	Door	Door	Solid	Wood	0
969	1963 Bldg	37	XRF	5/29/97	1	Room	2440	Door	Door	Solid	Wood	0
970	1963 Bldg	38	XRF	5/29/97	1	Room	2440	Door	Casing	Solid	Metal	0.07
971	1963 Bldg	39	XRF	5/29/97	1	Room	2440	Wall	Midle Wall	Solid	Concrte	0.07
972	1963 Bldg	40	XRF	5/29/97	1	Room	2490	Wall	Midle Wall	Solid	Concrte	0.02
973	1963 Bldg	41	XRF	5/29/97	1	Room	2490	Door	Door	Solid	Wood	0
974	1963 Bldg	42	XRF	5/29/97	1	Room	2490	Door	Casing	Solid	Metal	0.07
975	1963 Bldg	43	XRF	5/29/97	1	Room	2490	Door	Stall Door	Solid	Metal	0.11
976	1963 Bldg	44	XRF	5/29/97	1	Room	2490	Door	Door	Solid	Wood	0
977	1963 Bldg	45	XRF	5/29/97	1	Room	2490		Locker	Solid	Metal	0.01
978	1963 Bldg	66	XRF	5/28/97	1	Room	2831	Wall	Midle Wall	Solid	Concrte	0.01
979	1963 Bldg	67	XRF	5/28/97	1	Room	2831	Door	Door	Solid	Wood	0
980	1963 Bldg	68	XRF	5/28/97	1	Room	2831	Door	Casing	Solid	Metal	0.02
981	1963 Bldg	69	XRF	5/28/97	1	Room	2831		Radiator	Solid	Metal	0.24

APPENDIX B

LABORATORY SAMPLE ANALYSIS DATA


LABORATORY ANALYSIS REPORT**DATE:** June 25, 1997**PAGE:** 1 Of 1**CLIENT:** Midwest Environmental Cons.
5385 401st Ave. NW
Dalbo, MN 55017**PROJECT NO.:** 061197-200888
COLLECTION DATE: 5/31/97
COLLECTED BY: Client
RECEIVED DATE: 6/11/97
PROJECT DESCRP.: 62/0197AG**CONTACT:** Richard Cox/Greg Myers

<u>SAMPLE #</u>	<u>DESCP.</u>	<u>MDL</u>	<u>LEAD</u> (6010A) Units=mg/kg	<u>ANALYSIS</u> <u>DATE</u>
			<u>RESULTS</u>	
L973578-1	PC1	39	2200	6/24/97
L973578-2	PC2	25	5900	6/24/97
L973578-3	PC3	27	12,000	6/24/97
L973578-4	PC4	42	4200	6/24/97
L973578-5	PC5	25	1400	6/24/97
L973578-6	PC6	46	110	6/24/97
L973578-7	PC7	33	ND	6/24/97

*ND means Not Detected or below reported MDL**MDL means Method Detection Limit**mg/kg means Milligrams Per Kilogram which is equivalent to Parts Per Million (ppm)*

This report has been reviewed by me for technical accuracy and completeness. The analyses were performed using EPA or other approved methodologies and the results were reported on an "as received" basis unless otherwise noted. Organic soil analyses were reported on a dry weight basis. The results reported relate only to the items tested. Please contact me if you have any questions or comments regarding this report. Spectrum Labs, Inc. appreciates the opportunity to provide this analytical service for you.

Report Submitted By,

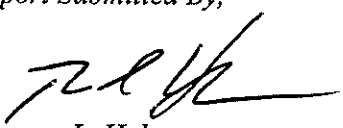
Thomas L. Halverson
Laboratory ManagerTLH:wmc
mec176-6*As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.*

Midwest Environmental Consulting, L.L.C.

5385 401st Ave. NW, Dalbo, MN 55017
612-689-3612/612-757-5541/FAX-612-689-5209
Client Address 1540 E 6th ST
Contact Richard Cox

CHAIN OF CUSTODY RECORD

Project Number 60-0197 AG
Client HARDING SR H.S.
Project _____
Phone/Fax _____

[illegible]

Sampled By: HARGROVE Date: 7-25-31 Time: _____

Delivered By:  Date: 9/28/11 Time: 12:46

Received By: _____ Date: _____ Time: _____

Delivered By: _____
Date: _____
Time: _____

Received By Lab: B. Br Date: 6/11 Time: 1246

Disposition of Samples

Notes:

APPENDIX C INSPECTOR

Bob Hargrove
MDH Lead Inspector # 416