


Midwest  
Environmental  
Consulting, L.L.C.

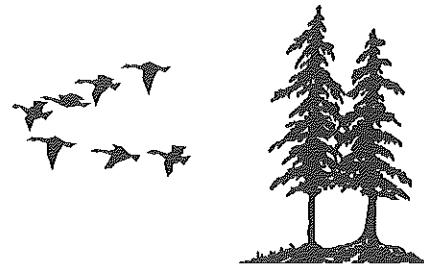

Printed on Recycled Paper

**Highland Park Senior High School  
Saint Paul Public Schools**

**Lead-Based Paint Inspection**

**Inspection Dates: 2/16/97, 2/19/97, 2/20/97, 2/26/97, 2/28/97, 3/1/97,  
3/2/97, 3/5/97, 3/6/97, 3/13/97, 3/14/97, 4/10/97**

**submitted to:**

**Saint Paul Public Schools**

**MEC Project # 62/0197M**

## INTRODUCTION

At the request of Saint Paul Public Schools Environmental Safety Department, Midwest Environmental Consulting, L.L.C. (MEC), conducted a lead-based paint inspection at Highland Park Senior High School, 1015 S. Snelling Avenue, St. Paul, MN. The purpose of this inspection was to identify lead-based painted, varnished, or otherwise coated building components on the interior and exterior of the school building.

The inspection protocol incorporated applicable portions of the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-based Paint Hazards in Housing* (HUD Guidelines, June 1995) and OSHA 1926.62 requirements (Lead in Construction). The HUD guidelines are formulated to guide agencies in conducting random sampling of the interiors and exteriors of dwellings and common areas in public housing. The OSHA requirement is designed to minimize worker exposure when working with material containing lead.

Confirmatory testing was conducted when inconclusive XRF results were encountered. Inconclusive refers to XRF readings less than 0.2 mg/cm<sup>2</sup> (milligrams per square centimeter). Inconclusive results were confirmed with laboratory analysis of paint chip samples (Appendix B). This report contains a list of such results.

The United States Environmental Protection Agency defines "lead-based paint" as a paint or other surface coating that contains lead equal to or in excess of 1.0 milligrams per square centimeter when analyzed by XRF or more than 0.5% by weight (5000 parts per million) by laboratory analysis of a bulk sample.

Minnesota Department of Labor and Industry (MN OSHA) adopted the EPA lead levels for the purpose of enforcing OSHA 1926.62 federal regulations. Detection of lead in dried paint film by XRF is a dependable indicator of levels of lead and is accepted by MN OSHA.

For this Saint Paul Public Schools Lead Inspection, all building components were tested on site using a Niton XL® X-ray Fluorescence Spectrum Analyzer<sup>(1)</sup>. Building components included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases. Only painted or glazed surfaces or surfaces which were varnished were tested. Suspended ceilings, structural steel, and corrugated decking were not included in the inspection. Neither anodized (e.g., window sashes) nor plastic (e.g., vinyl baseboard and vinyl mini-blinds) were included in the scope of this inspection.

---

<sup>(1)</sup> This is a portable hand held machine that can analyze building components instantly for lead concentrations.

Each building was divided into unique sites based on the year of construction or renovation. Portable classrooms, playgrounds, and other detached buildings were automatically designated as a unique site. Each site was inspected independently assuming differences in painting history and construction characteristics.

## SITE DESCRIPTION AND BUILDING HISTORY

According to information provided to MEC by Saint Paul Public Schools, Highland Park Senior High School was constructed in essentially three phases. The initial phase includes the 194,589 square-foot older section of the building and dates from 1964. The second phase is a 18,690 square foot addition dating from 1971. The third phase is a 2,122 square foot addition from 1983.

The 1964 and 1971 phases are considered to be site 1. The Auditorium at the Senior High School is considered to be a 1971 phase.

The 1983 addition was not inspected because of the date of construction.

On this project site is an old school-house.

All room and area designations used in this report are depicted on sampling maps found in Appendix A.

## XRF SAMPLE RESULTS TABLE

The results of all samples analyzed are listed in the table at the end of this section. The following is a description of the column headings:

<b>Site</b>	Each school is divided into sites based on their unique construction characteristics. Each site has a unique date of construction or major renovation.
<b>Sample #</b>	Each sample taken was given a unique number to identify the type and location of the sample. The sampling date is an integral part of the sample number.
<b>Analysis</b>	This defines the type of analysis which can be categorized into two types:  1) XRF: This is an on-site analysis using a hand held Niton XL® X-ray Fluorescence Spectrum Analyzer; 2) Bulk or Chip: This is a bulk sample where paint is removed from the substrate and sent to a laboratory for analysis;

<b>Floor</b>	This is the level of the building in which the area tested was found, example, 1 (first floor), 0 (basement), etc.
<b>Area</b>	This further defines the specific functional space inspected such as a classroom, exterior, playground, gym, kitchen, etc.
<b>Room #</b>	This is typically the actual number on the room as identified at the building.
<b>Component</b>	Building "components" included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases.
<b>Feature</b>	Identifies more detailed information of the component.
<b>Condition</b>	This describes condition of the surface, whether it is intact, cracked, peeling, or chalking.
<b>Substrate</b>	This refers to the material the building component is made of (wood, concrete, drywall, metal, etc.).
<b>Result</b>	This is the analysis results for lead. Less than 1.0 mg/cm <sup>2</sup> or less than 0.5% by weight is considered to be non-lead and these building components are below the action levels of EPA and HUD. (All results are in mg/cm <sup>2</sup> except where noted.)

The table of results is designed for quick information on lead concentrations of tested building components. Generally, all repetitions of a test combination within a given room or area, may be assumed to contain similar concentrations of lead to that of the tested sample. For instance, the lead concentration of a tested wooden window sash was found to be above the action level of 1.0 mg/cm<sup>2</sup> in a given classroom. The classroom has five windows, all of wood, the same color and appearing to be of the same era. It can be assumed that the remaining four wooden window sashes each contain lead above the action limit.

Other columns identify the component and the component feature tested, condition of the component, type of substrate and the result of the analytical test.

As an example, the following illustration shows that the wooden door jamb in Room 123, first floor in the 1923 building section was in good, solid condition, and had an XRF test result of 0.3 mg/cm<sup>2</sup>, which is below the action level.

**Illustration Only**

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1923 Bldg.	52		XRF	1 Room		123	Door	Jamb	Solid	Wood	0.3

In a similar manner, the table shows that the plaster walls in room 23, on the second floor has peeling paint with more than 1.0 mg/cm<sup>2</sup> (shaded).

**ILLUSTRATION ONLY**

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1910 Bldg.	16		XRF	2 Room		23	Door	Jamb	Peeling	Wood	0.25
1910 Bldg.	17		XRF	2 Room		23	Wall	Wall	Peeling	Plaster	1.2
1910 Bldg.	18		XRF	2 Room		23	Ceiling	Peeling	Plaster		0.25
1910 Bldg.	19		XRF	2 Room		23	Wall	Baseboard	Peeling	Wood	0.002

**APPLICABLE REGULATIONS**

When building components test above 1.0 mg/cm<sup>2</sup> of lead by XRF or 0.5% lead by weight from laboratory analysis all employees and contractors who will be working with these components in a construction related activity must be notified. The requirements of OSHA 1926.62, Lead in Construction are enforceable. This regulation defines construction work as "work for construction, alteration and/or repair, including painting and decorating." This regulation further defines monitoring requirements to minimize employee exposure to lead during construction activities.


When work is performed on external painted building structures (i.e. flashing, fire escapes, playground equipment, handrails, etc.), regulations of the Minnesota Pollution Control Agency (MPCA) may also be applicable. For removal of lead based paint from steel structures, MN Rules 7025.0200 - 7025.0380 apply to steel materials on the exterior of a building, or on the property when levels exceed 0.5 mg/cm<sup>2</sup> based on the average of three XRF spectrum results of the sample tested, or 5,000 ppm by laboratory analysis. If it is other than a steel surface, then MPCA regulates the painted surfaces under MN Rules 7025.010 - 7025.0080, when surfaces are to be disturbed using abrasive blasting methods.

Please contact MEC directly if you have questions about any portion of this report or the lead-based paint inspection itself.

# **APPENDIX A**

## **XRF TESTING DATA WITH LOCATION MAPS**



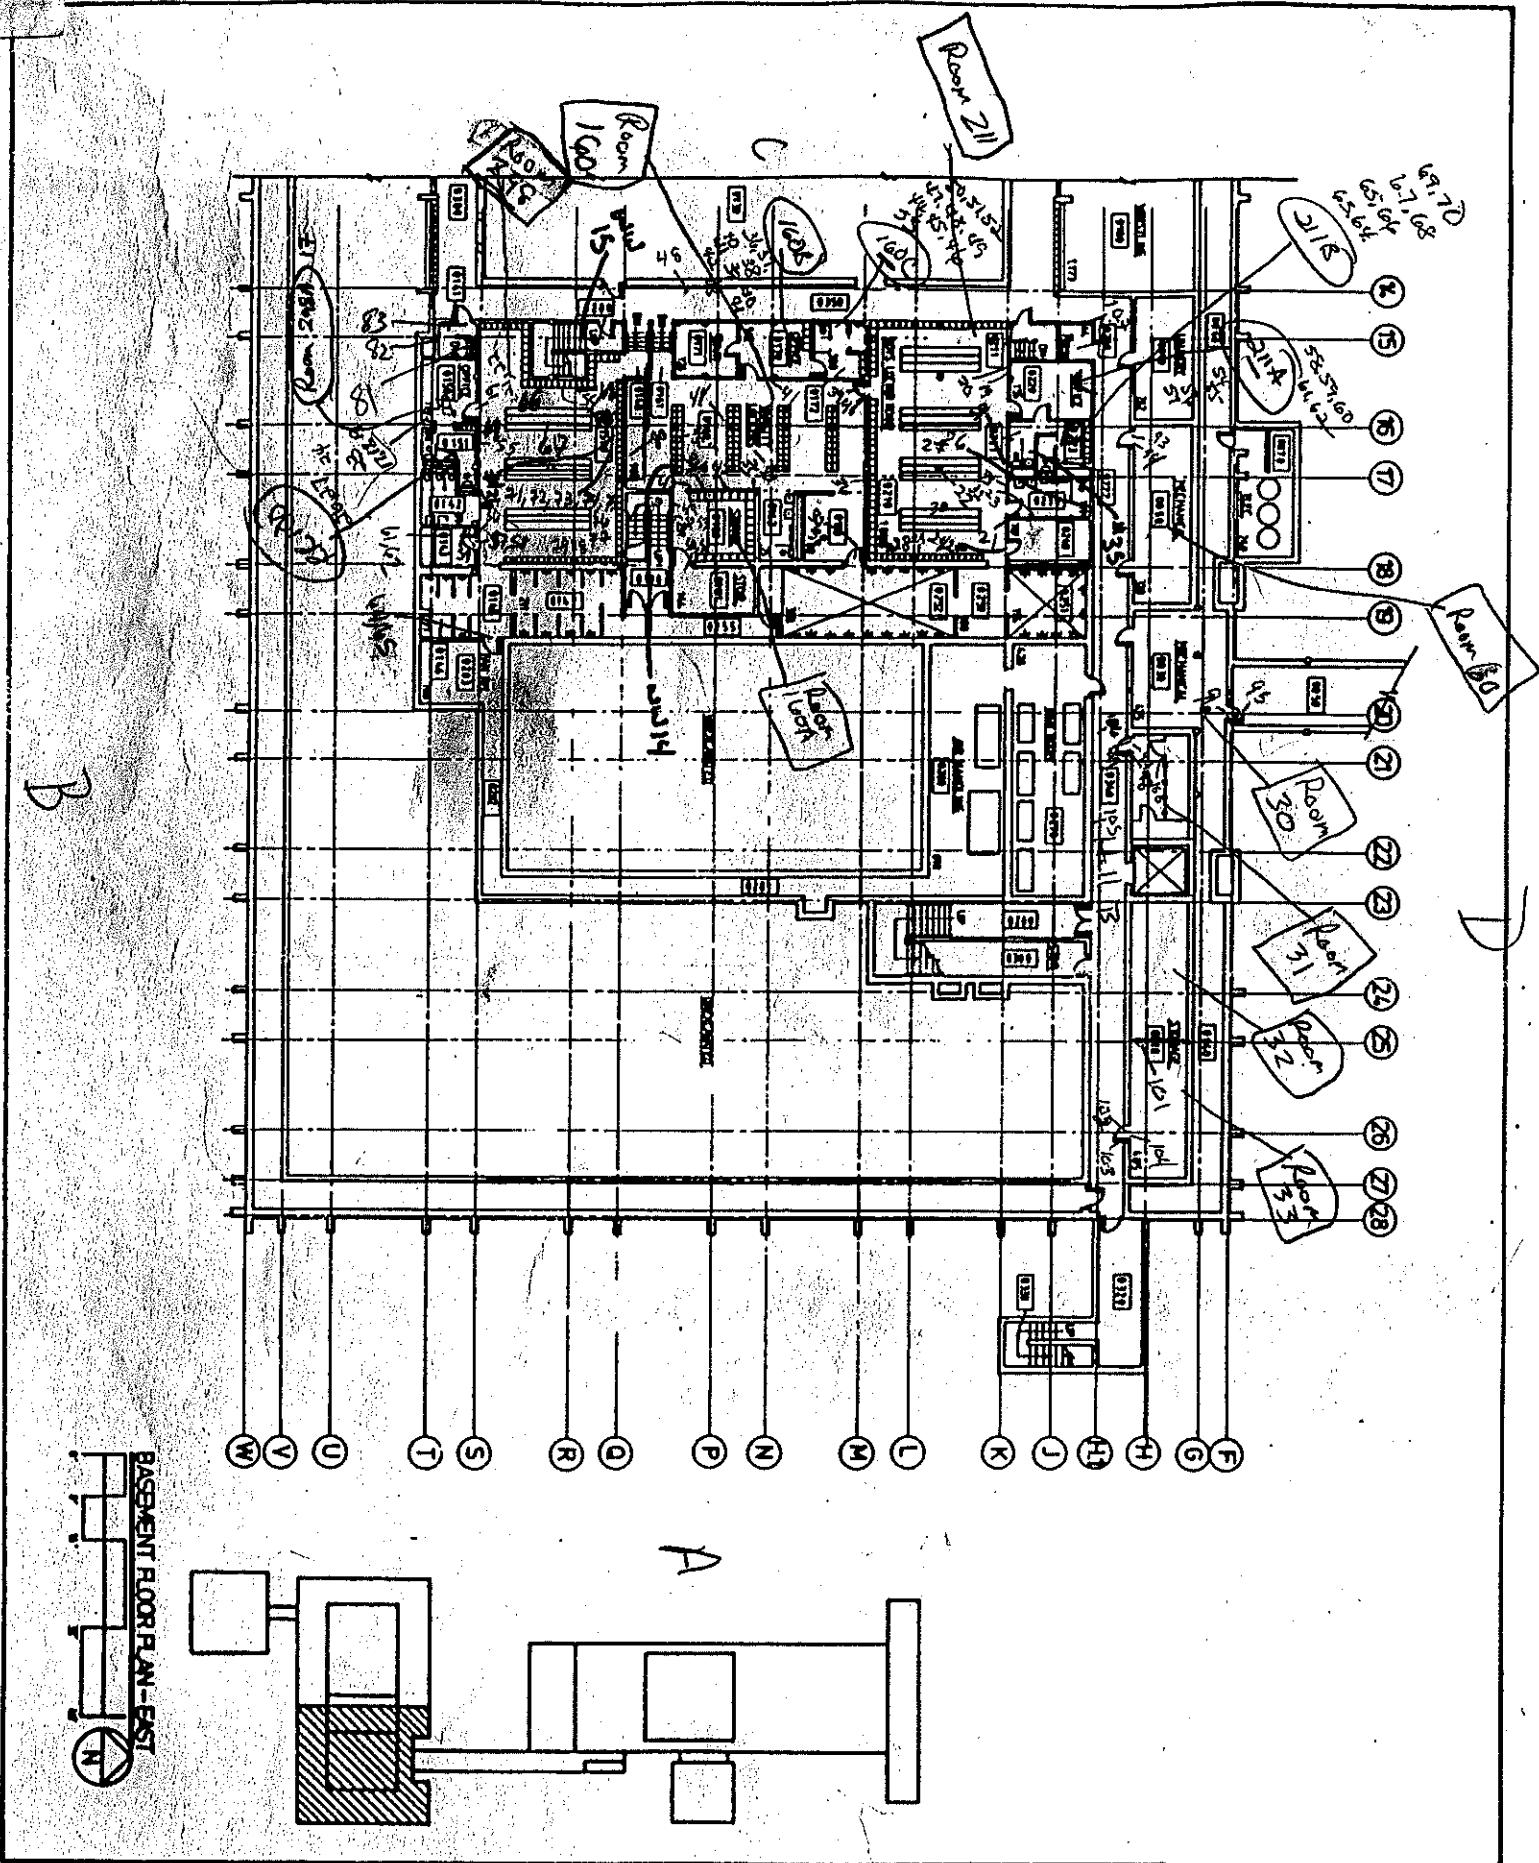


INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

HIGHLAND PARK SR. HIGH  
1015 SQ. SNELLING AVE.  
ST. PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971

16

Note: These are part of Room 100

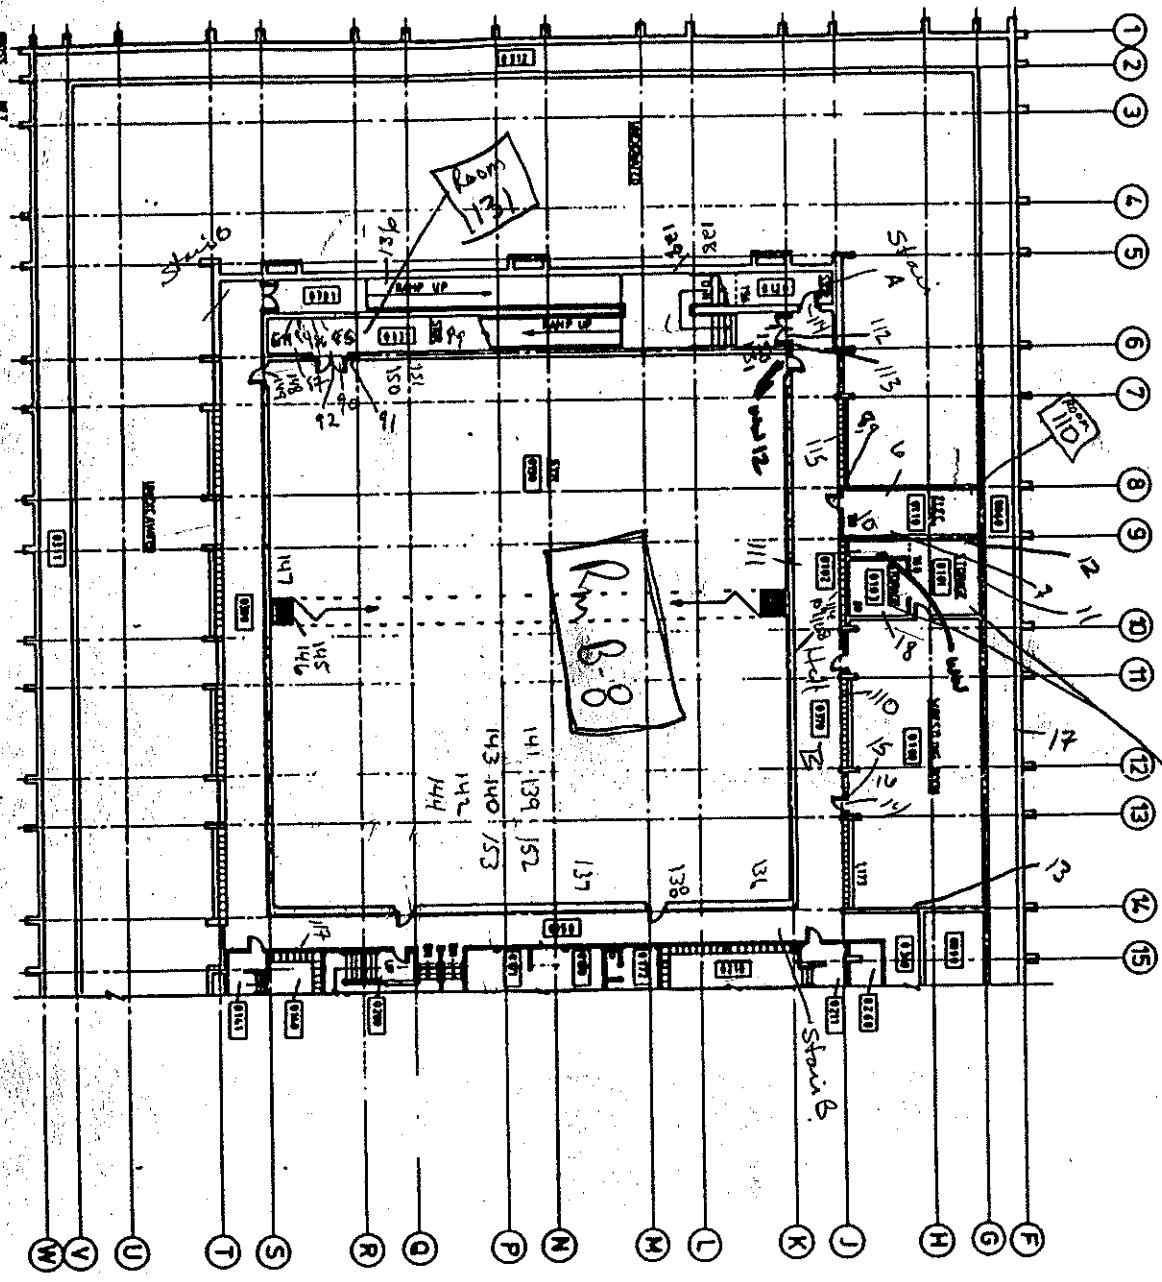


INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

HIGHLAND PARK SR. HIGH  
1015 SO. SNELLING AVE.  
ST. PAUL, MINNESOTA 55116.

CONSTRUCTED: 1964, 1971

BEST  
3  
16

**BASMENT FLOOR PLAN - EAST**

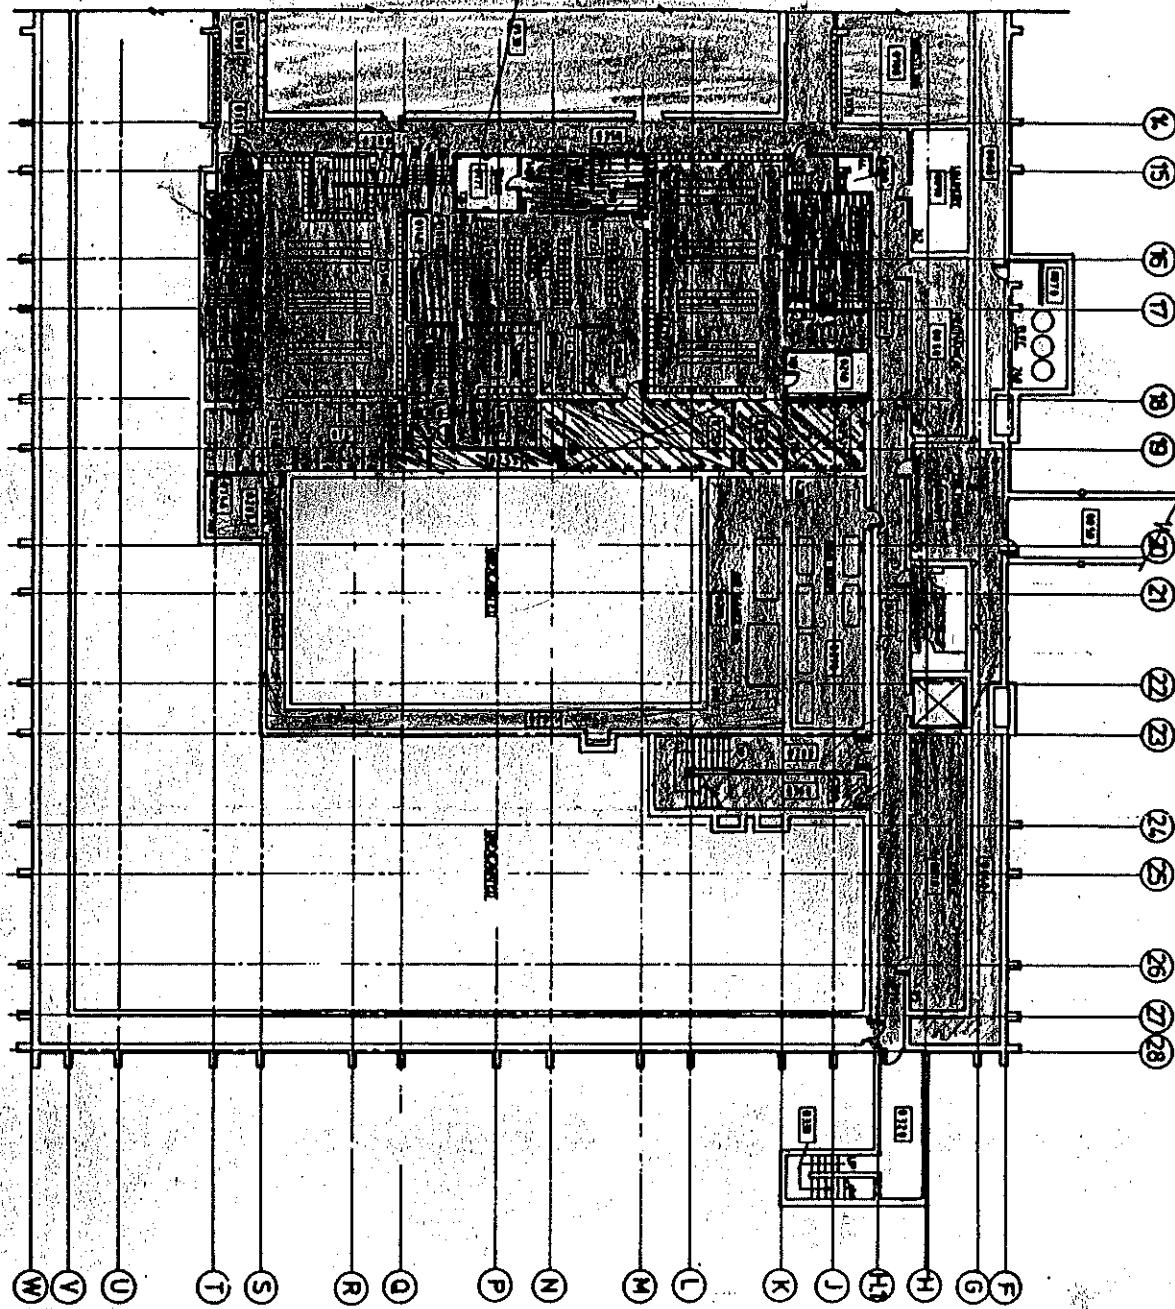

*The accessible*

INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102



HIGHLAND PARK SR. HIGH  
1015 SQ. SNELLING AVE.  
ST. PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971

6  
16

4/10/97

Girls Locker Room

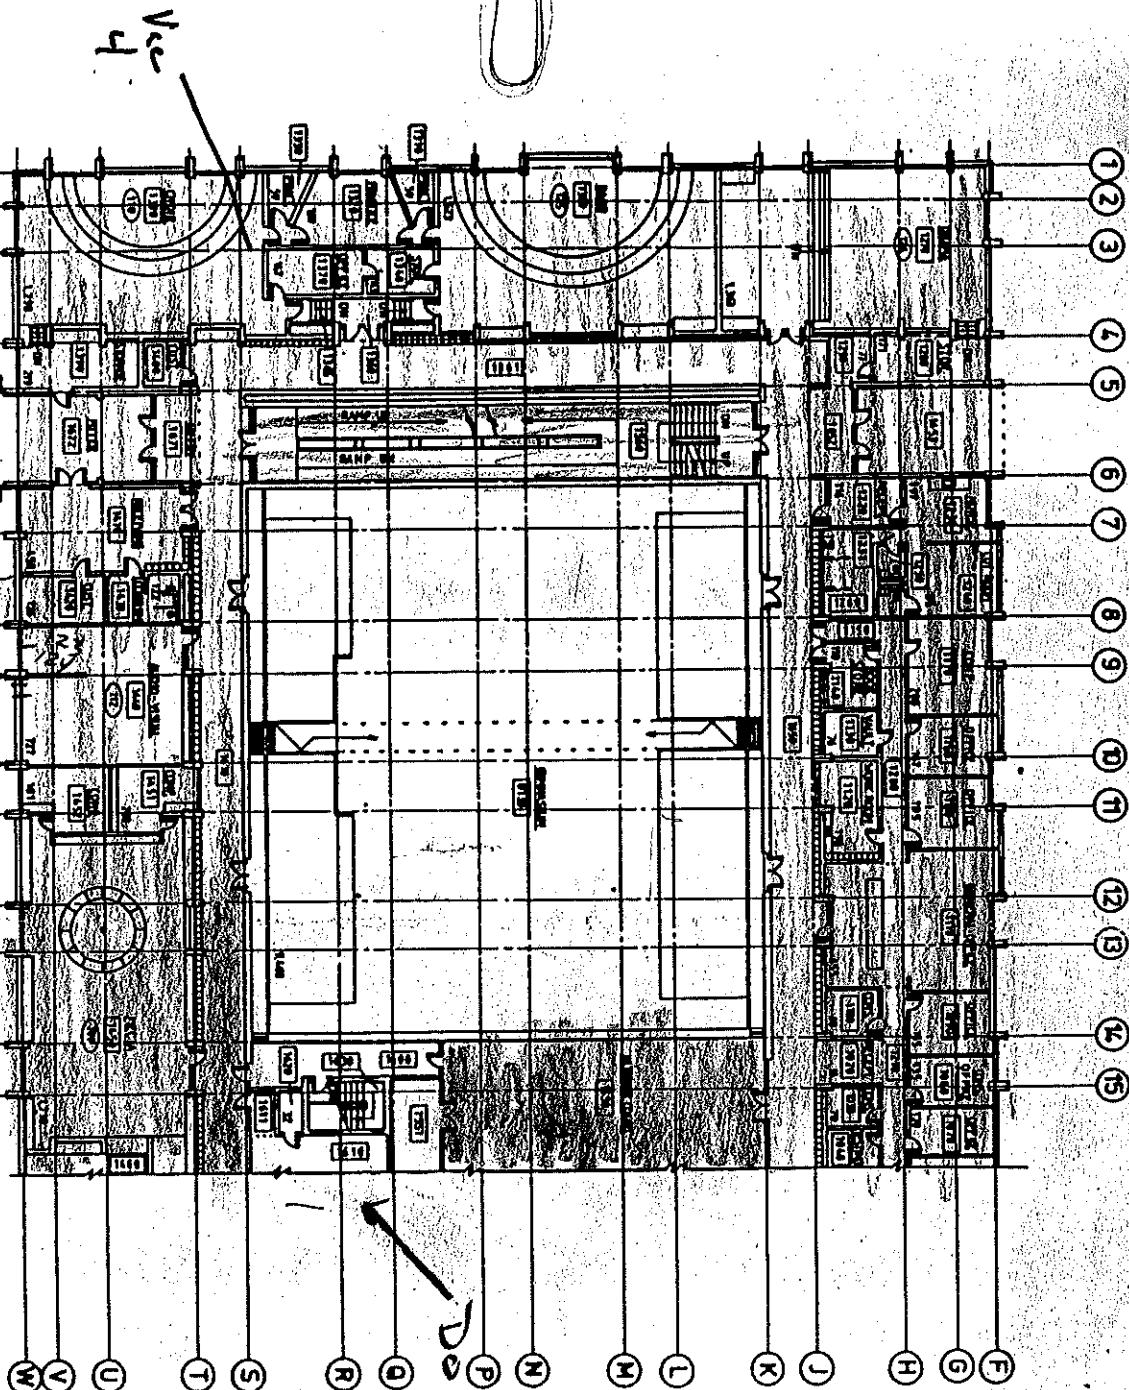


INDEPENDENT SCHOOL DIST. #25  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

HIGHLAND PARK SR. HIGH  
1015 SQ. SNELLING AVE.  
ST. PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971

DET 4  
16

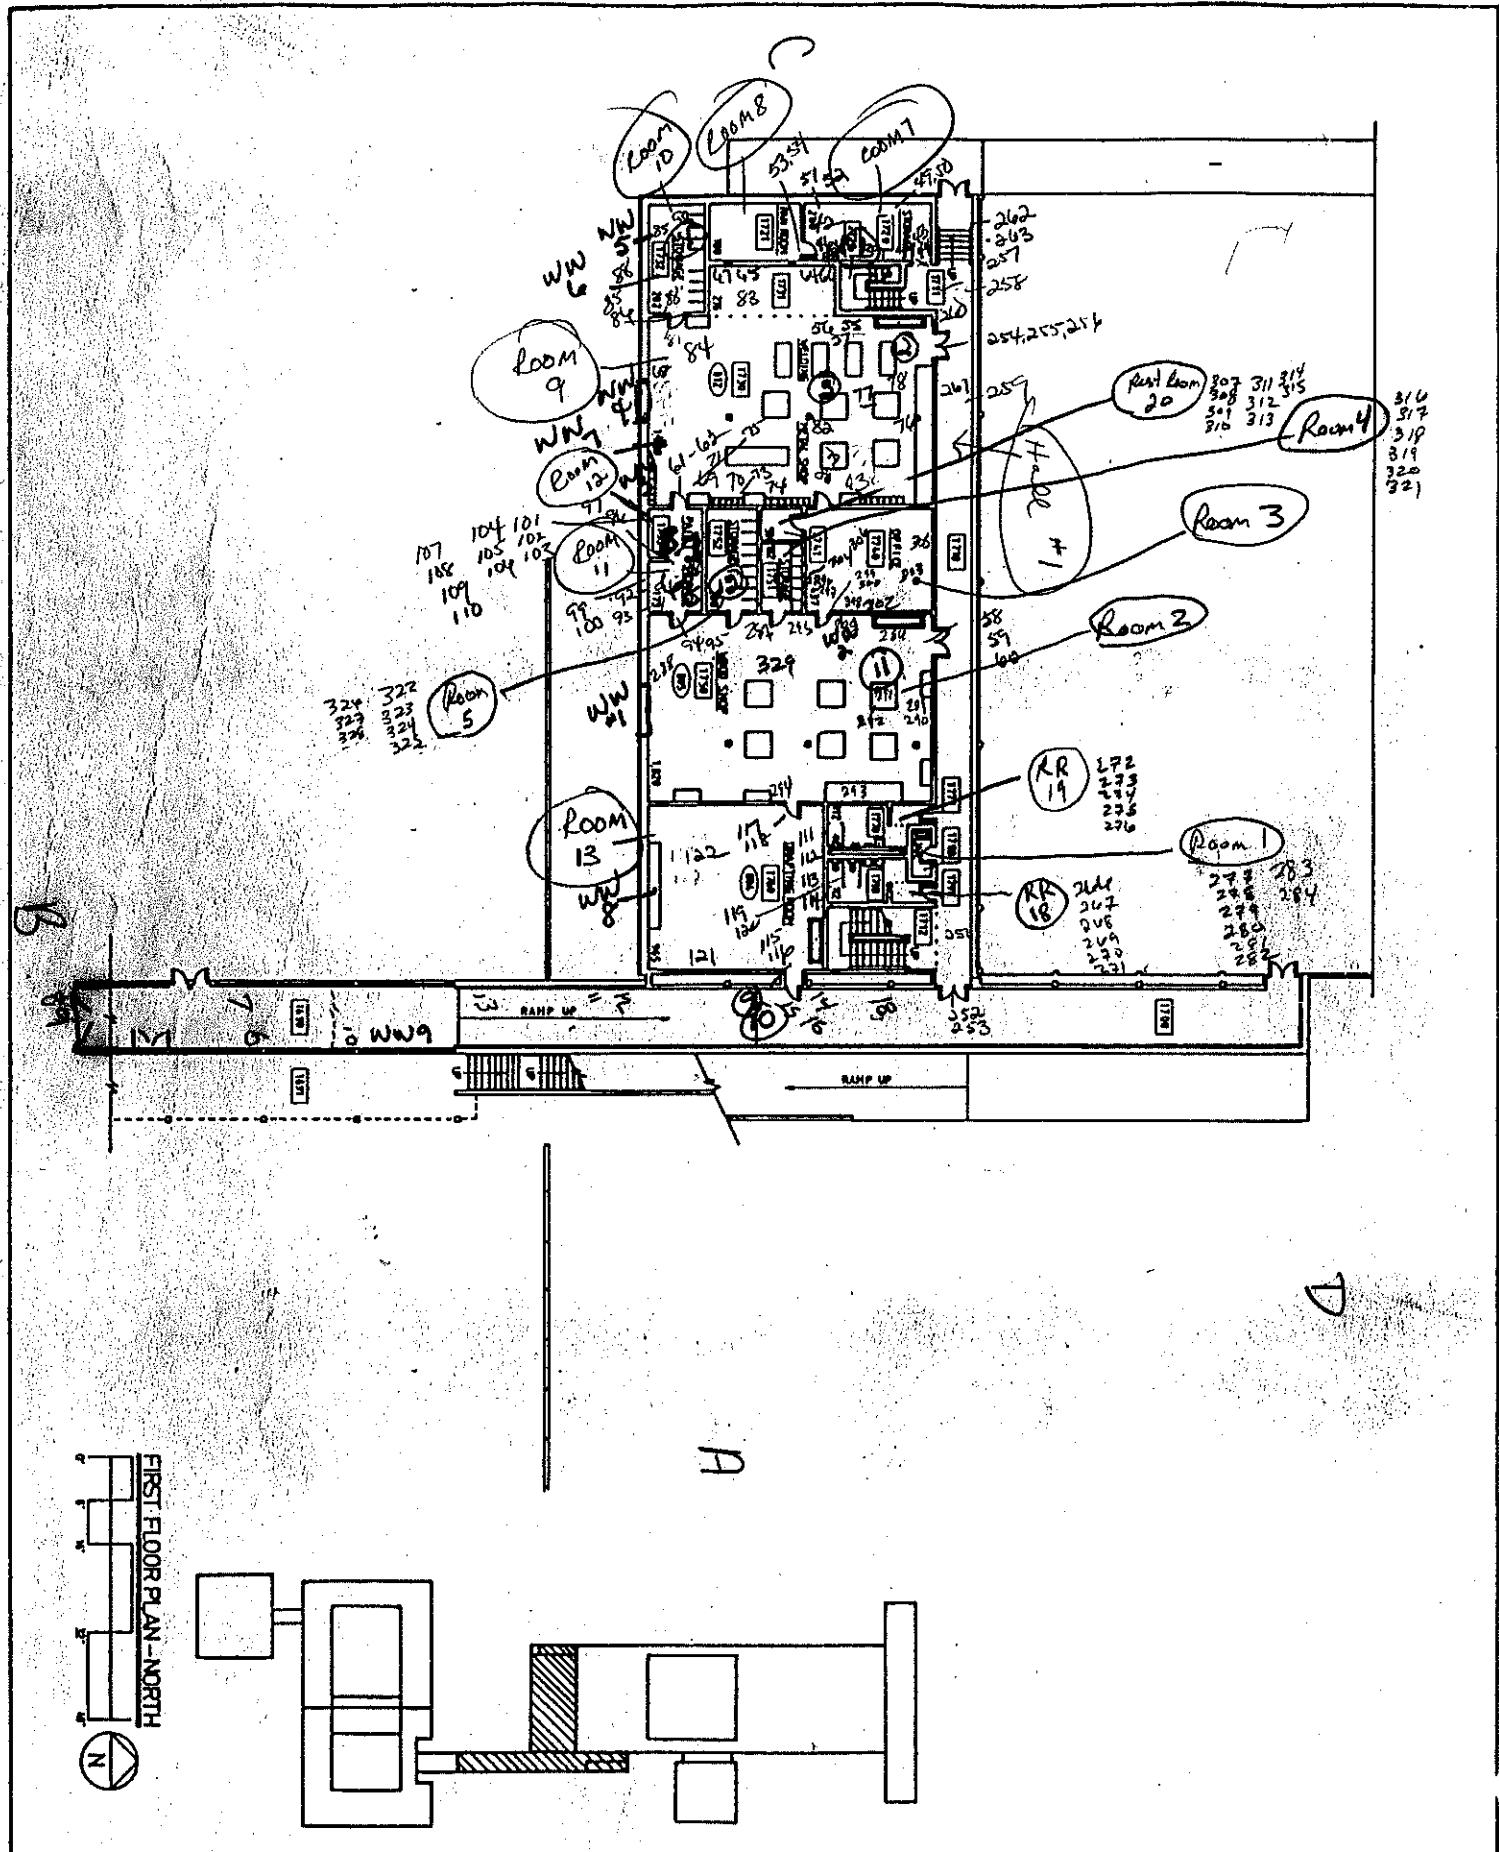


INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

HIGHLAND PARK SR. HIGH  
1015 SQ. SNELLING AVE.  
ST. PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971


16

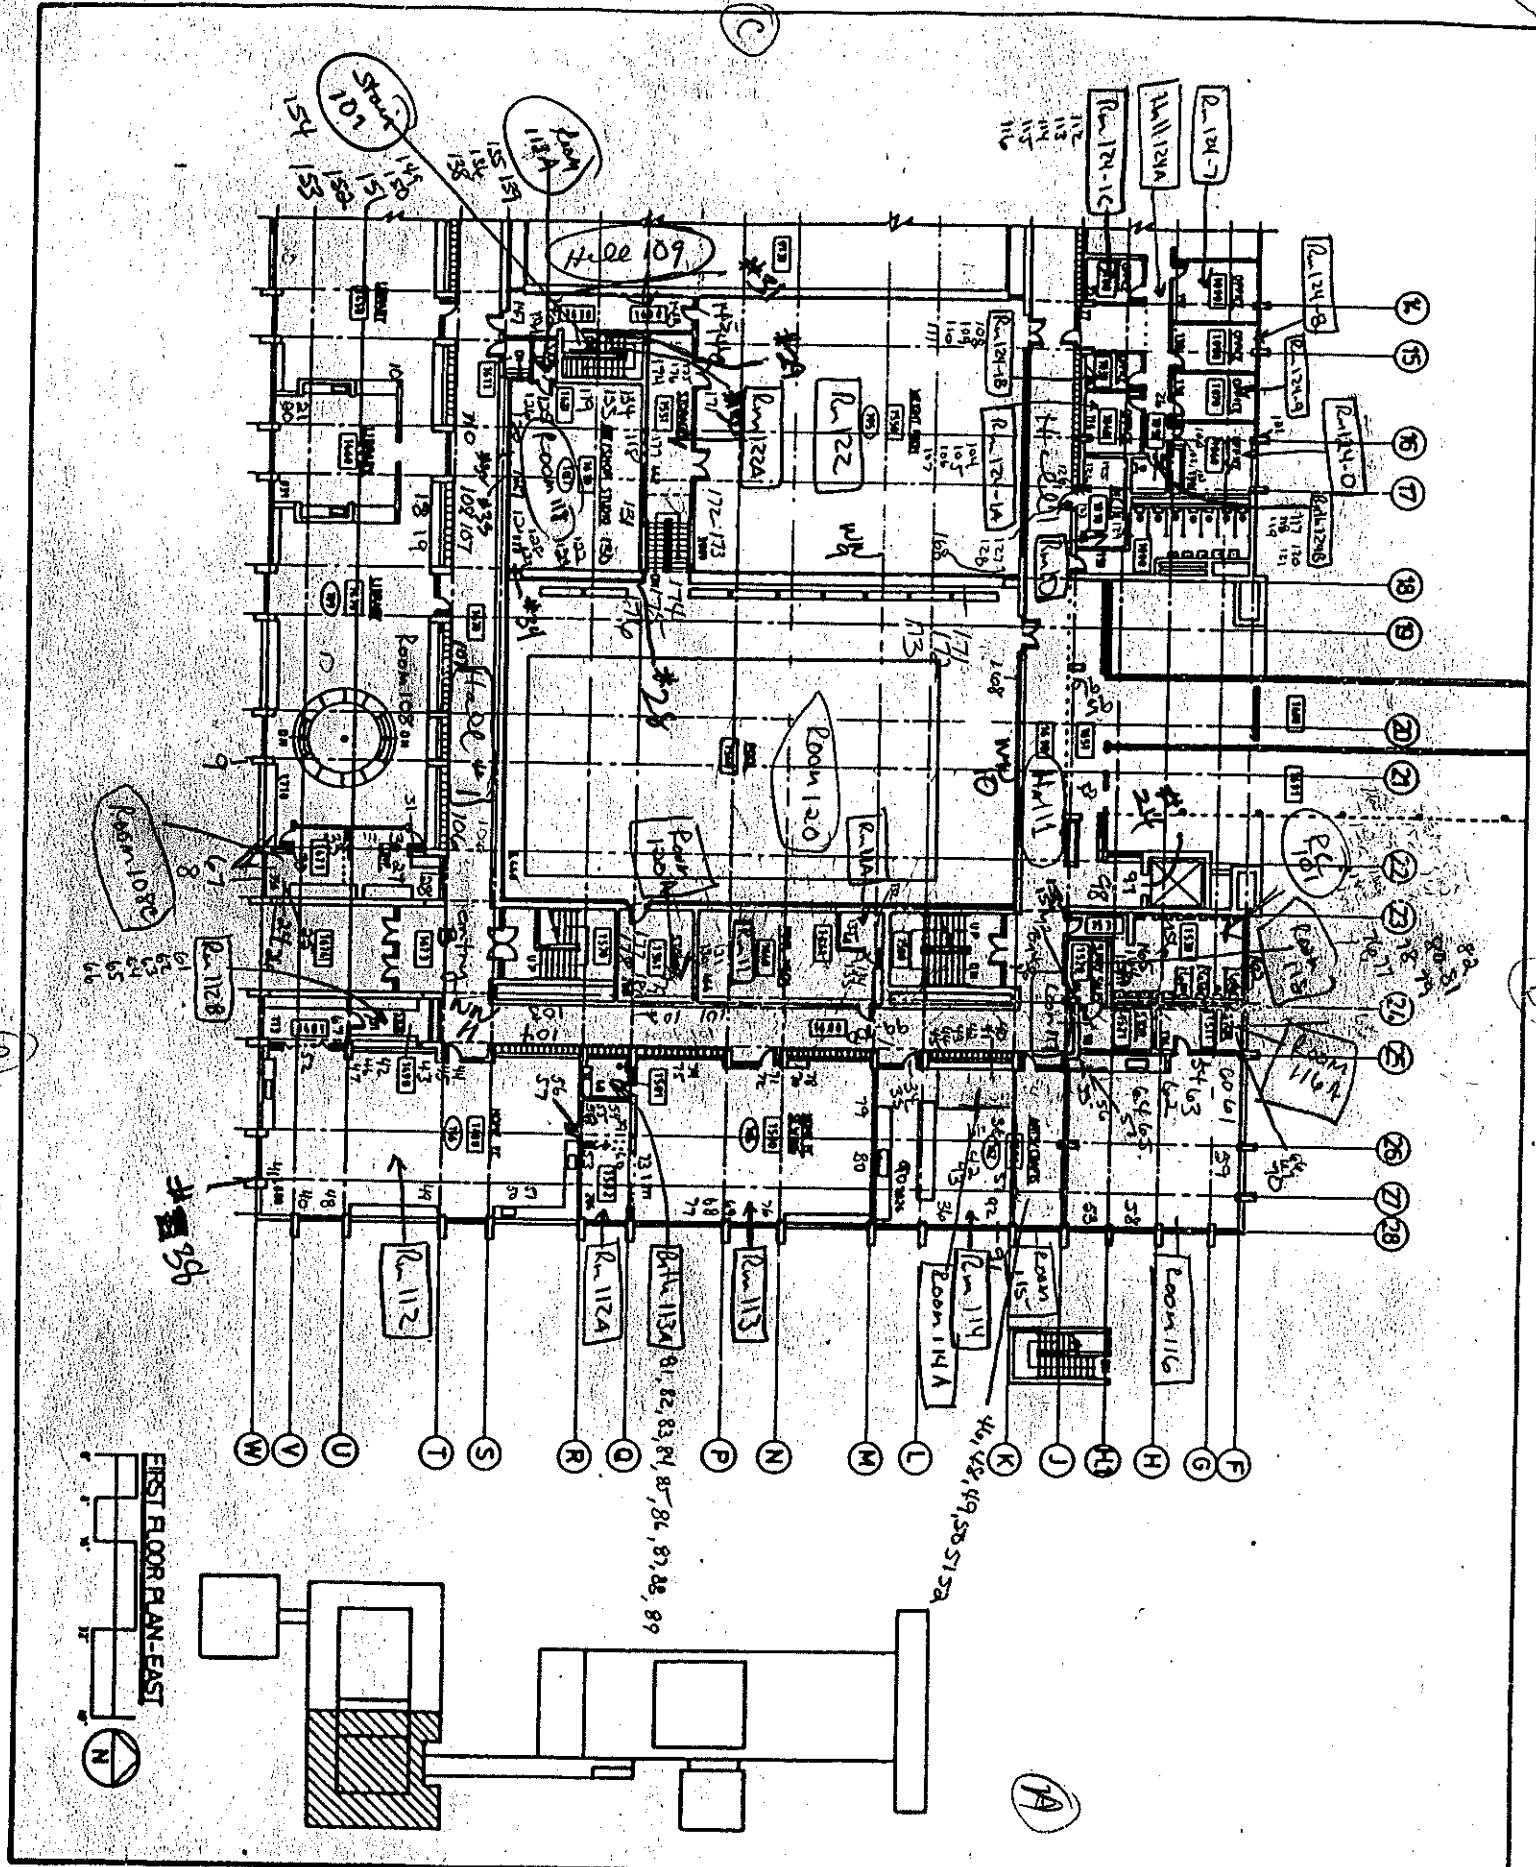

INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

HIGHLAND PARK SR. HIGH  
1015 SO. SNELLING AVE.  
ST. PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971

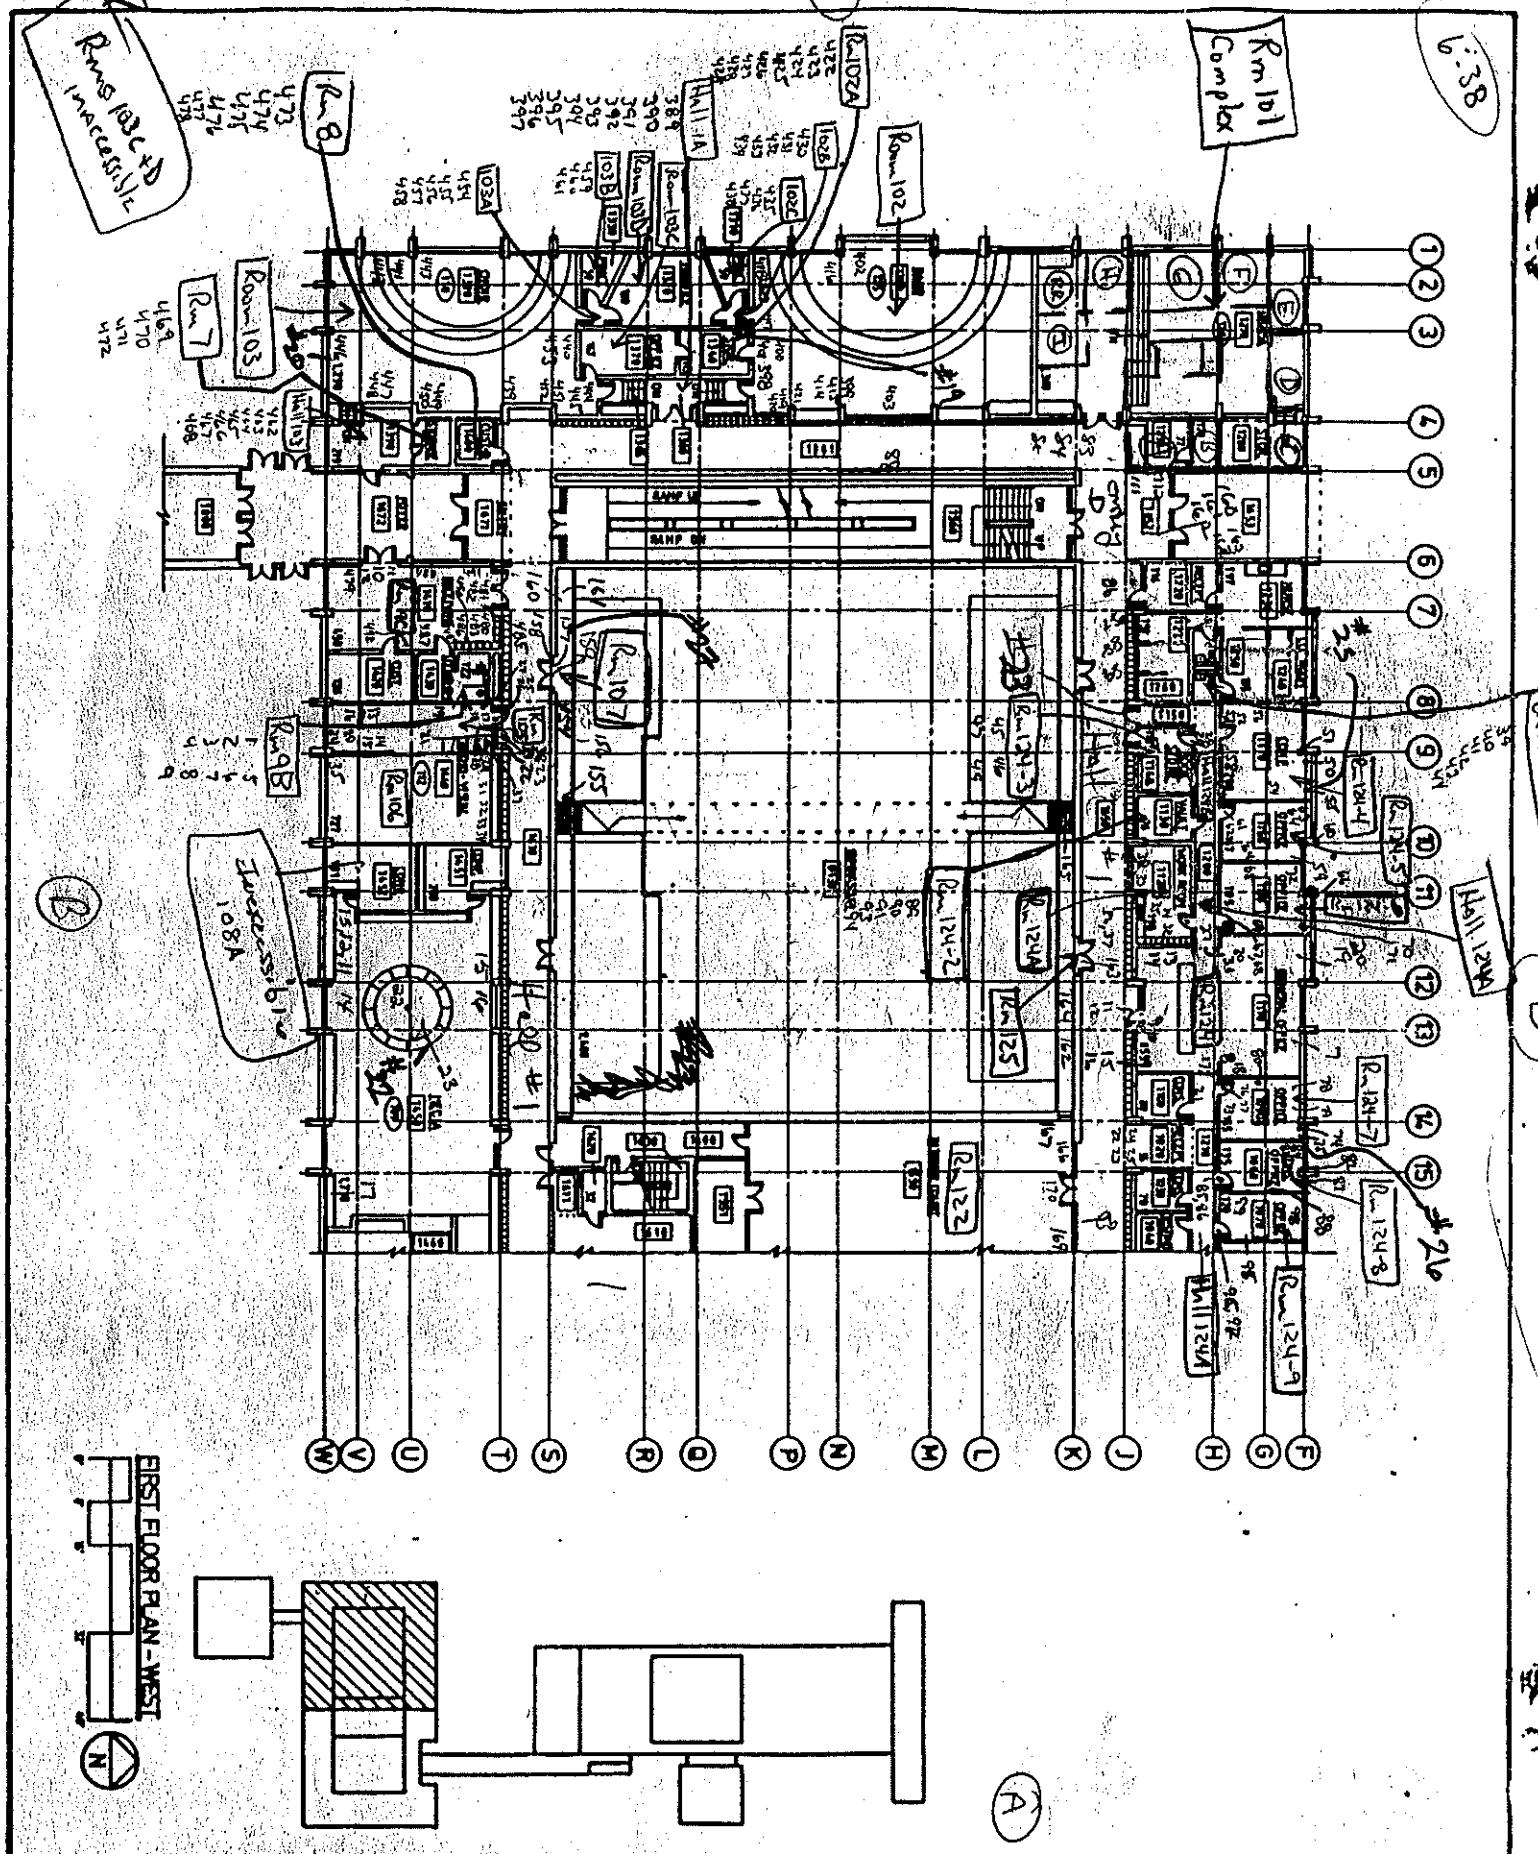


INDEPENDENT SCHOOL DIST. #623  
300 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

HIGHLAND PARK SR. HIGH  
1015 SO. SNELLING AVE.  
ST. PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971

DET 4  
16

Phoenix 101 Complex

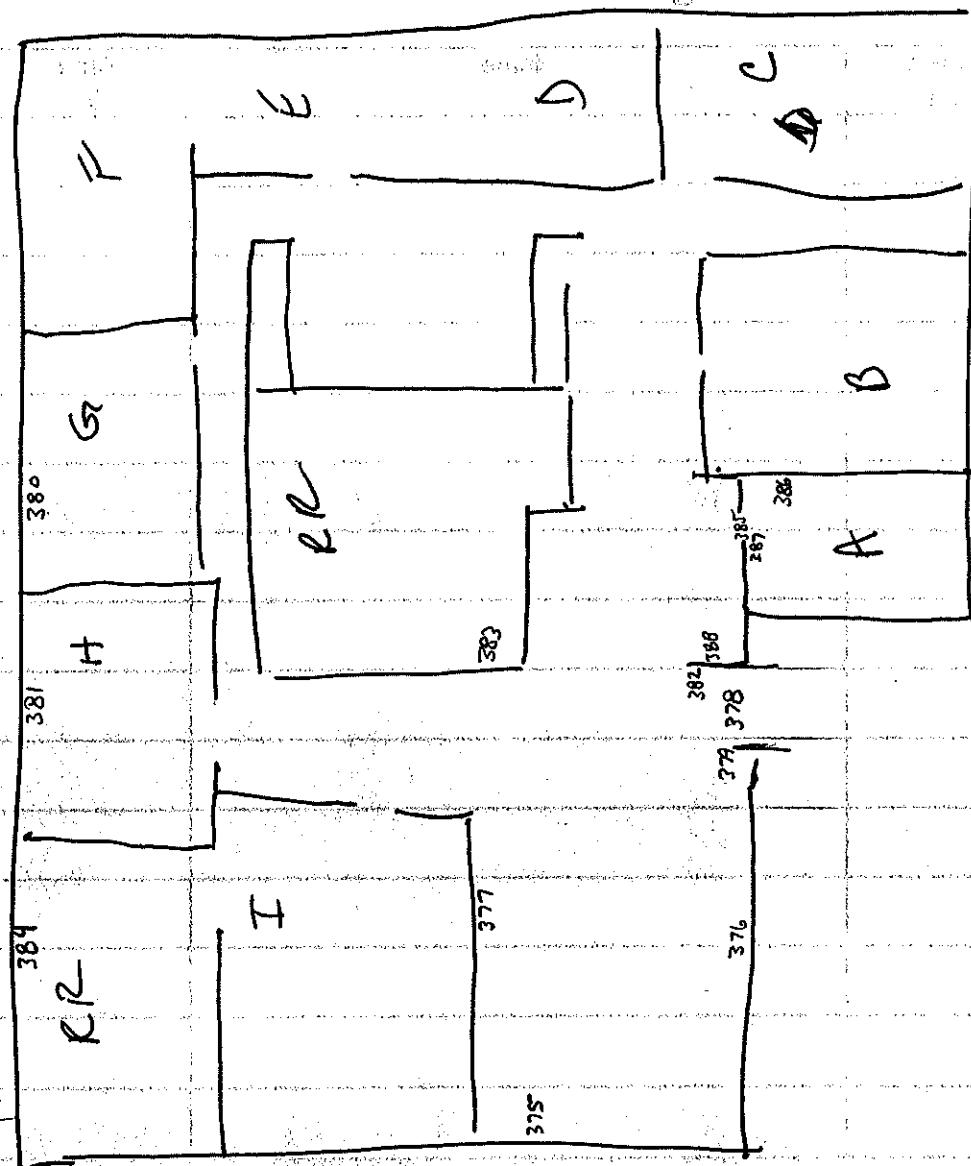


NORTH

(B)

(A)


(D)

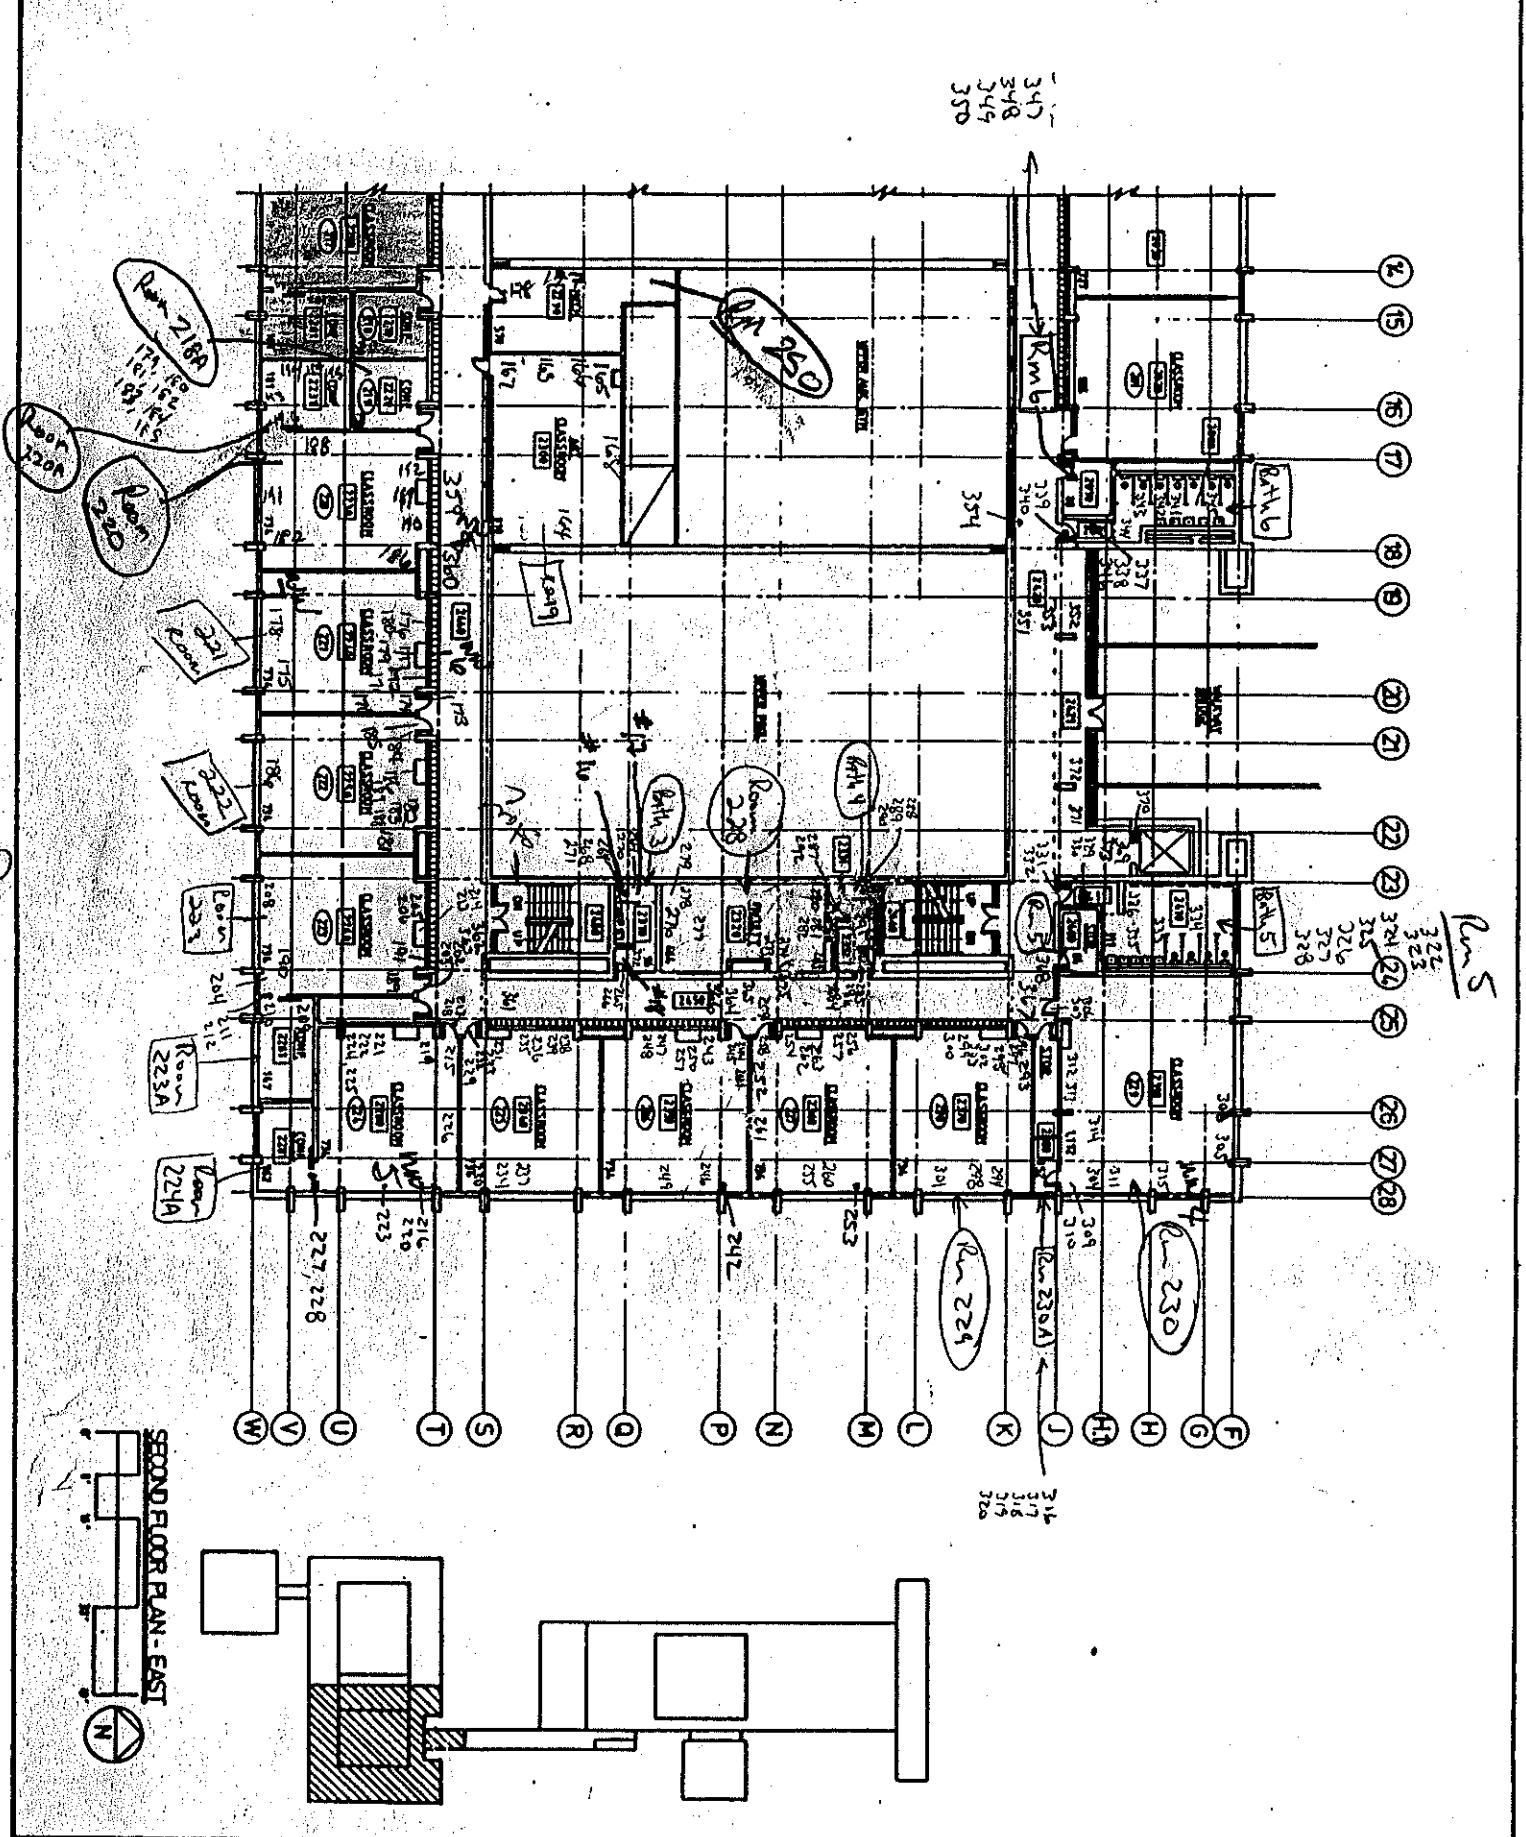


INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

HIGHLAND PARK SR. HIGH  
1015 SQ. SNELLING AVE.  
ST. PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971



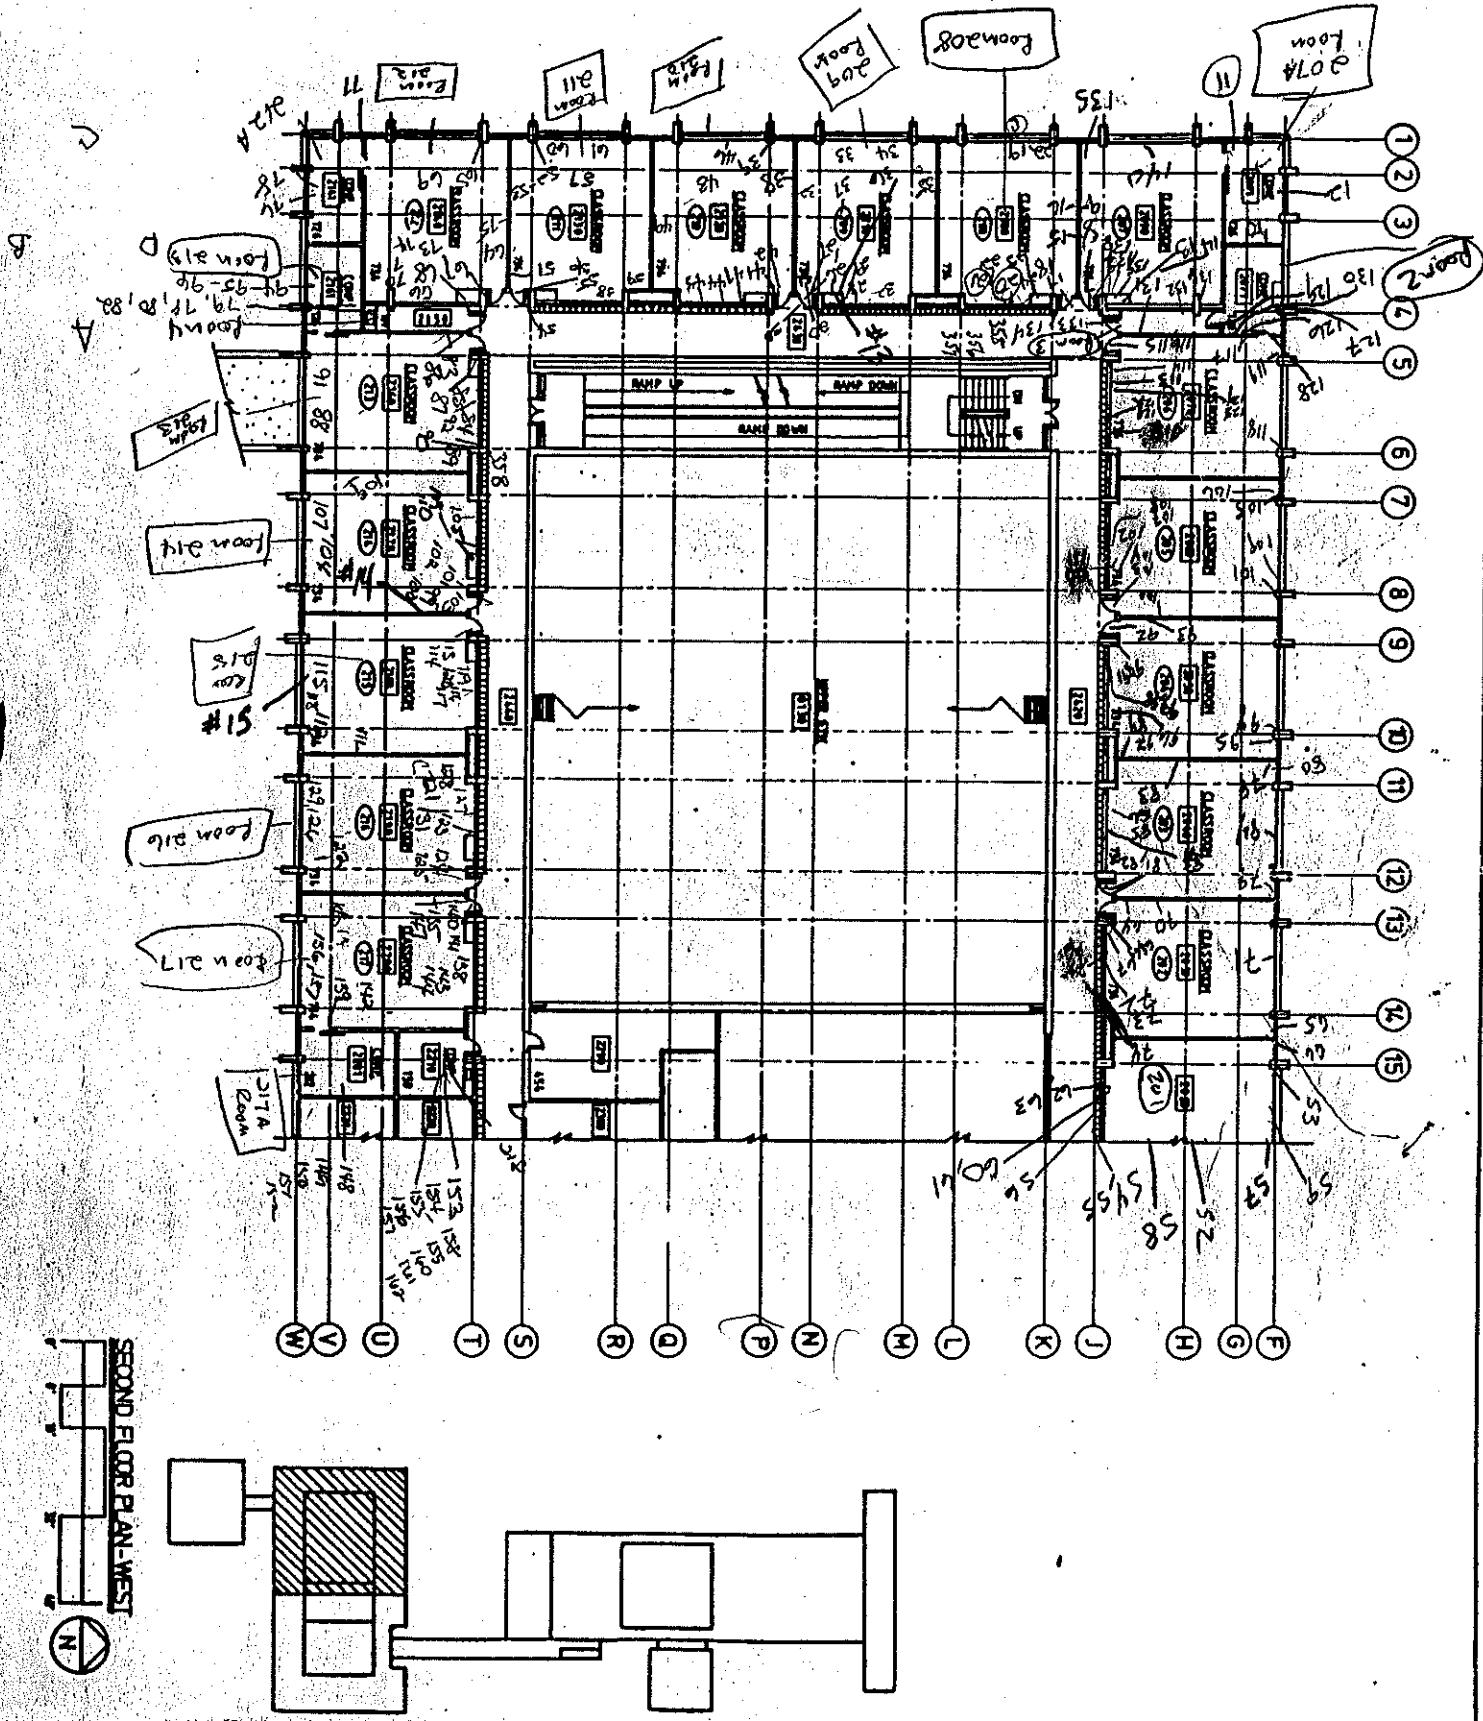


INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102



HIGHLAND PARK SR. HIGH  
1015 SQ SNELLING AVE.  
ST PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971

५६

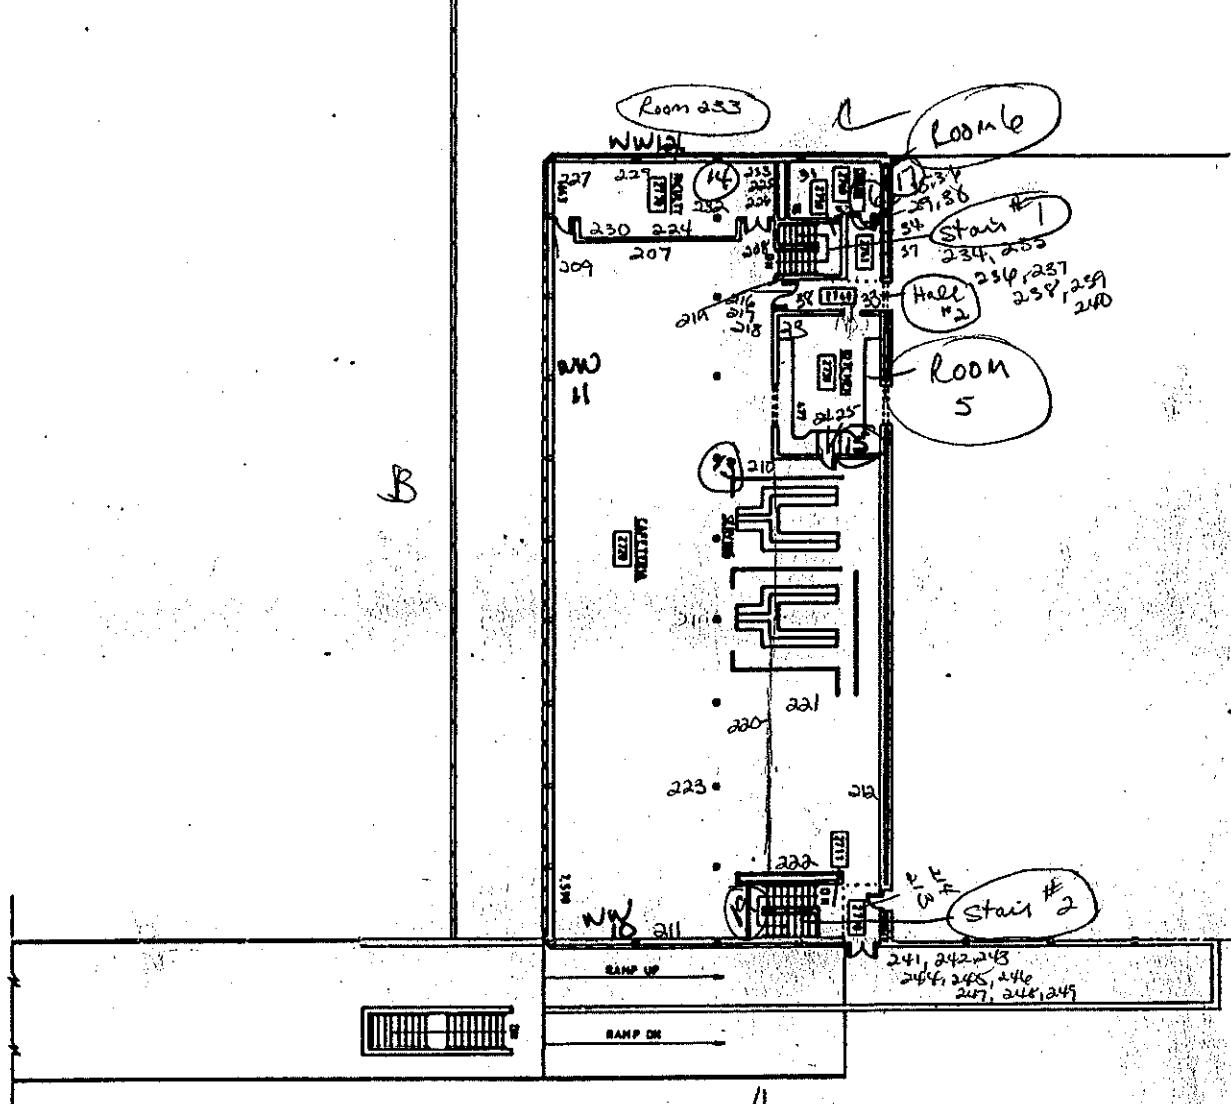

A

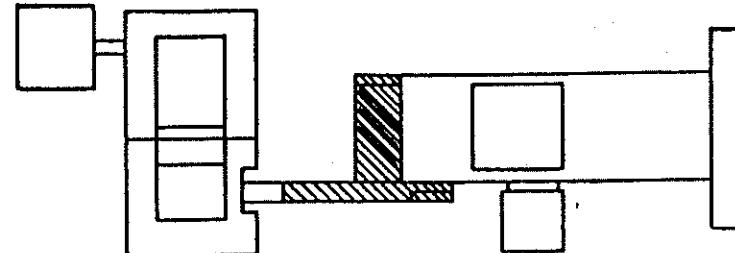


INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

HIGHLAND PARK SR. HIGH  
1015 SQ. SNELLING AVE.  
ST. PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971

SET 10  
16

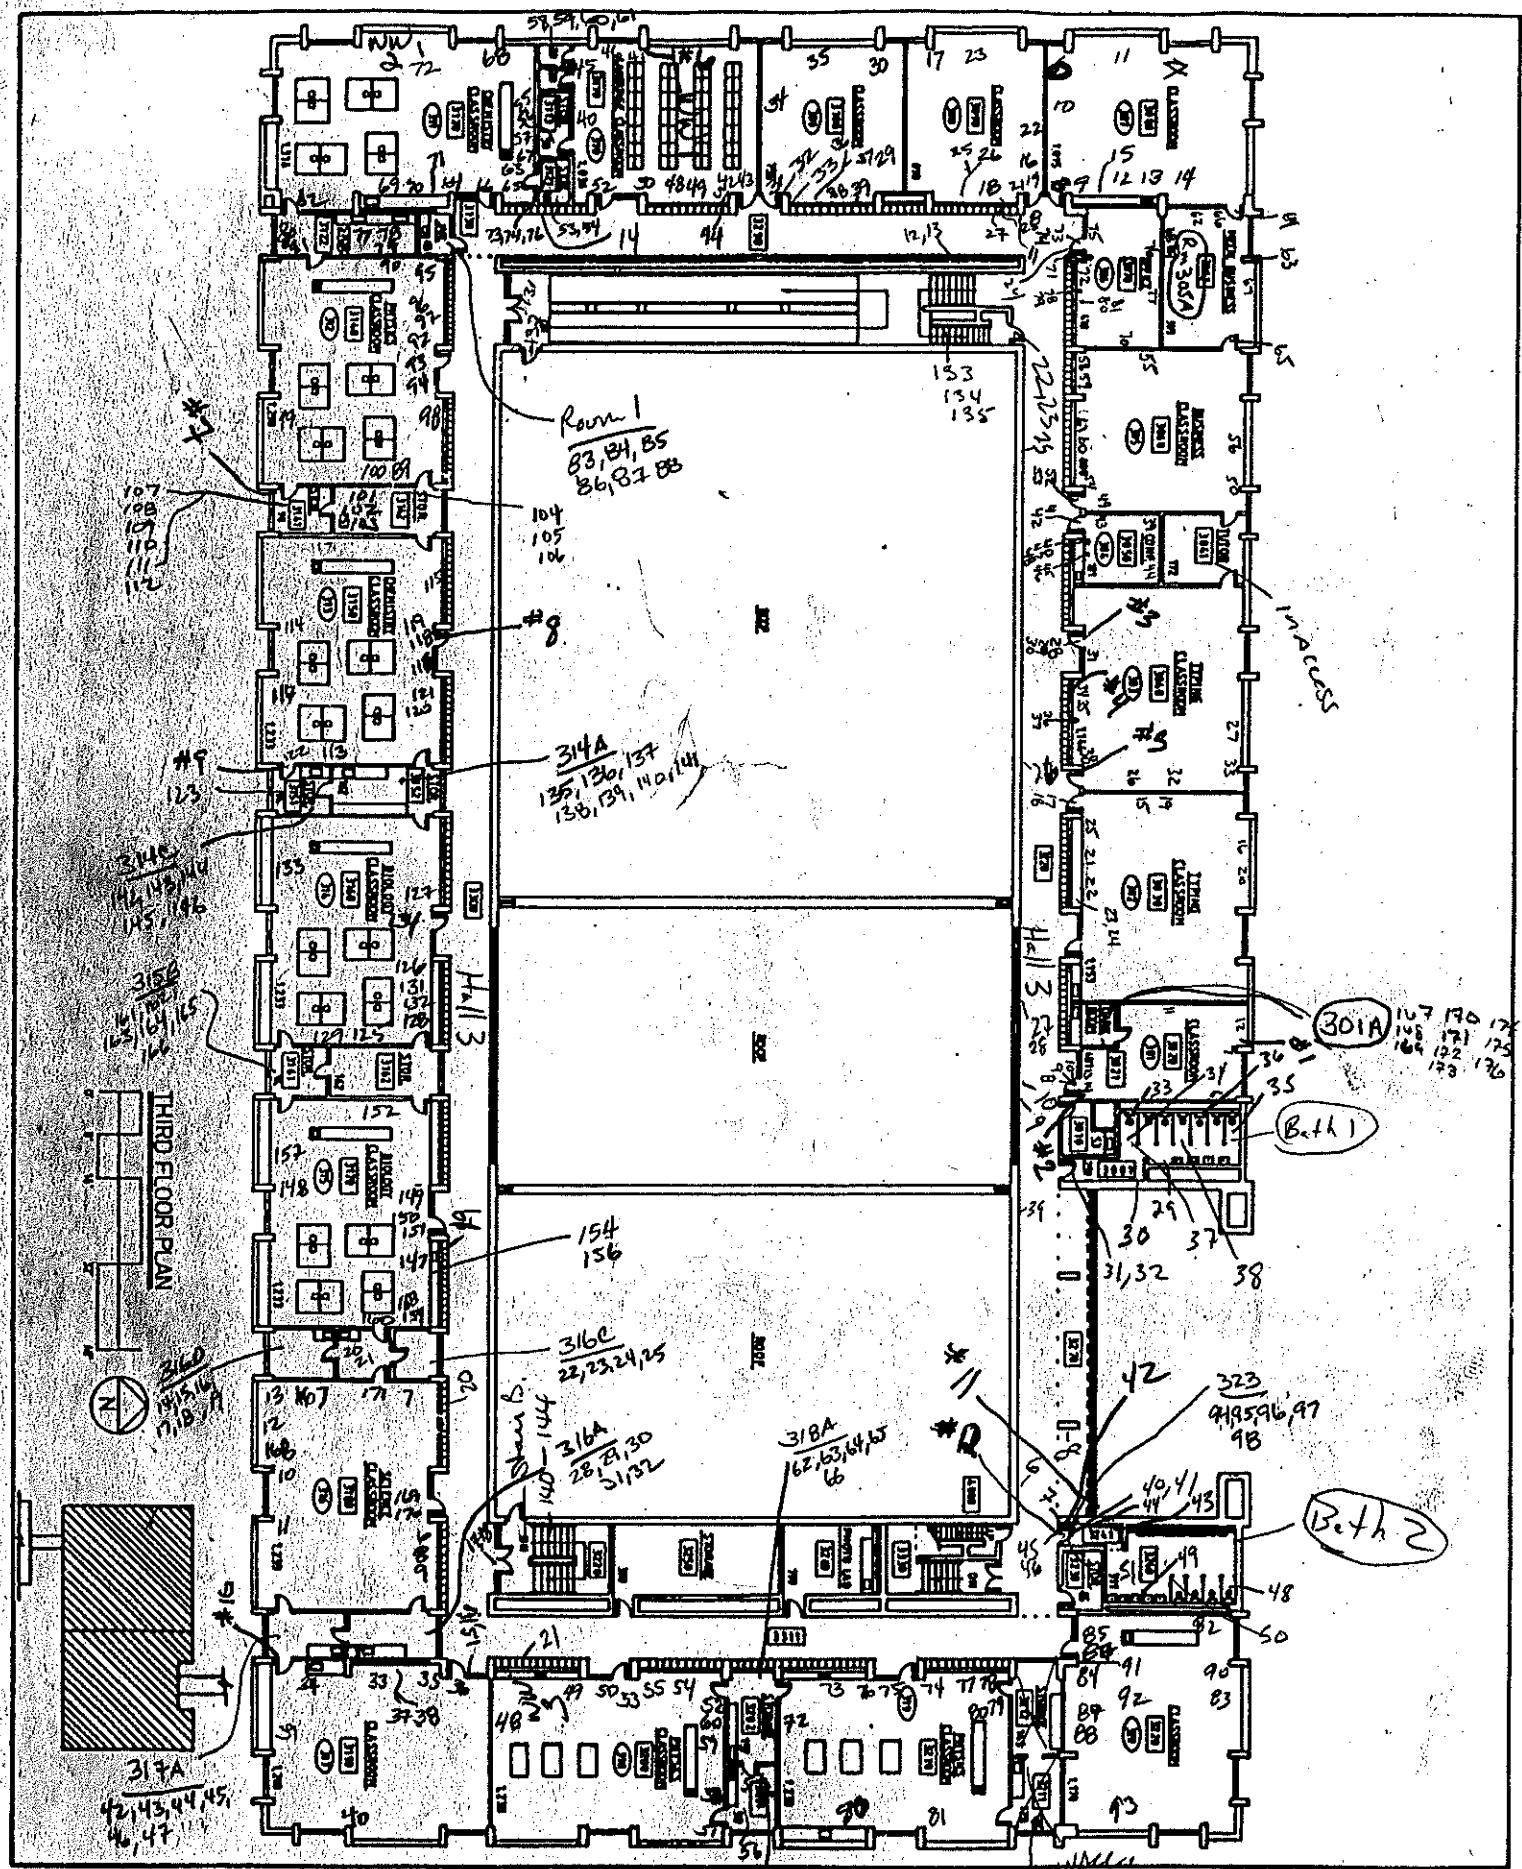



INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

HIGHLAND PARK SR. HIGH  
1015 SQ. SNELLING AVE.  
ST. PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971

Room 318B  
69, 68, 69, 70

**PENTHOUSE FLOOR PLAN**

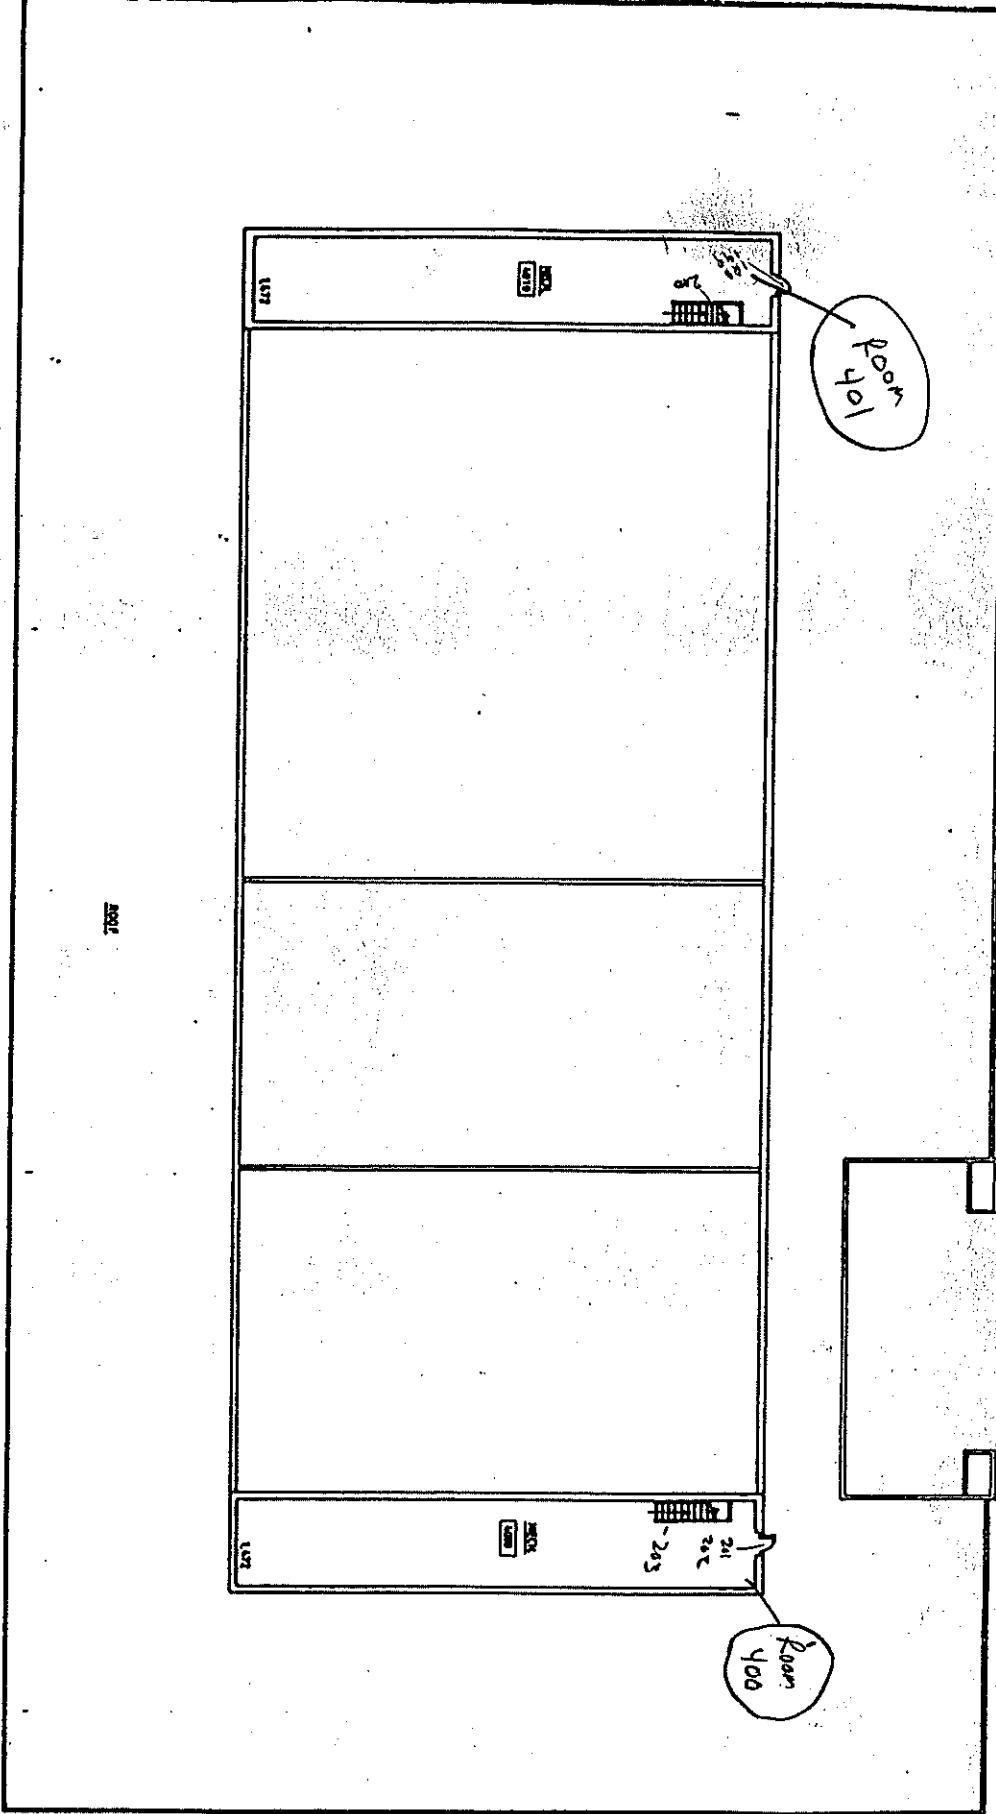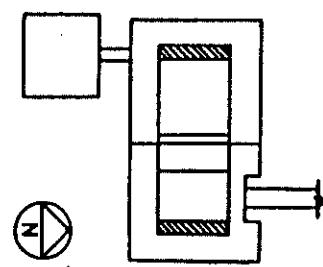


INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

HIGHLAND PARK SR. HIGH  
1015 SO. SNELLING AVE.  
ST. PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971


REC'D 12/16/16

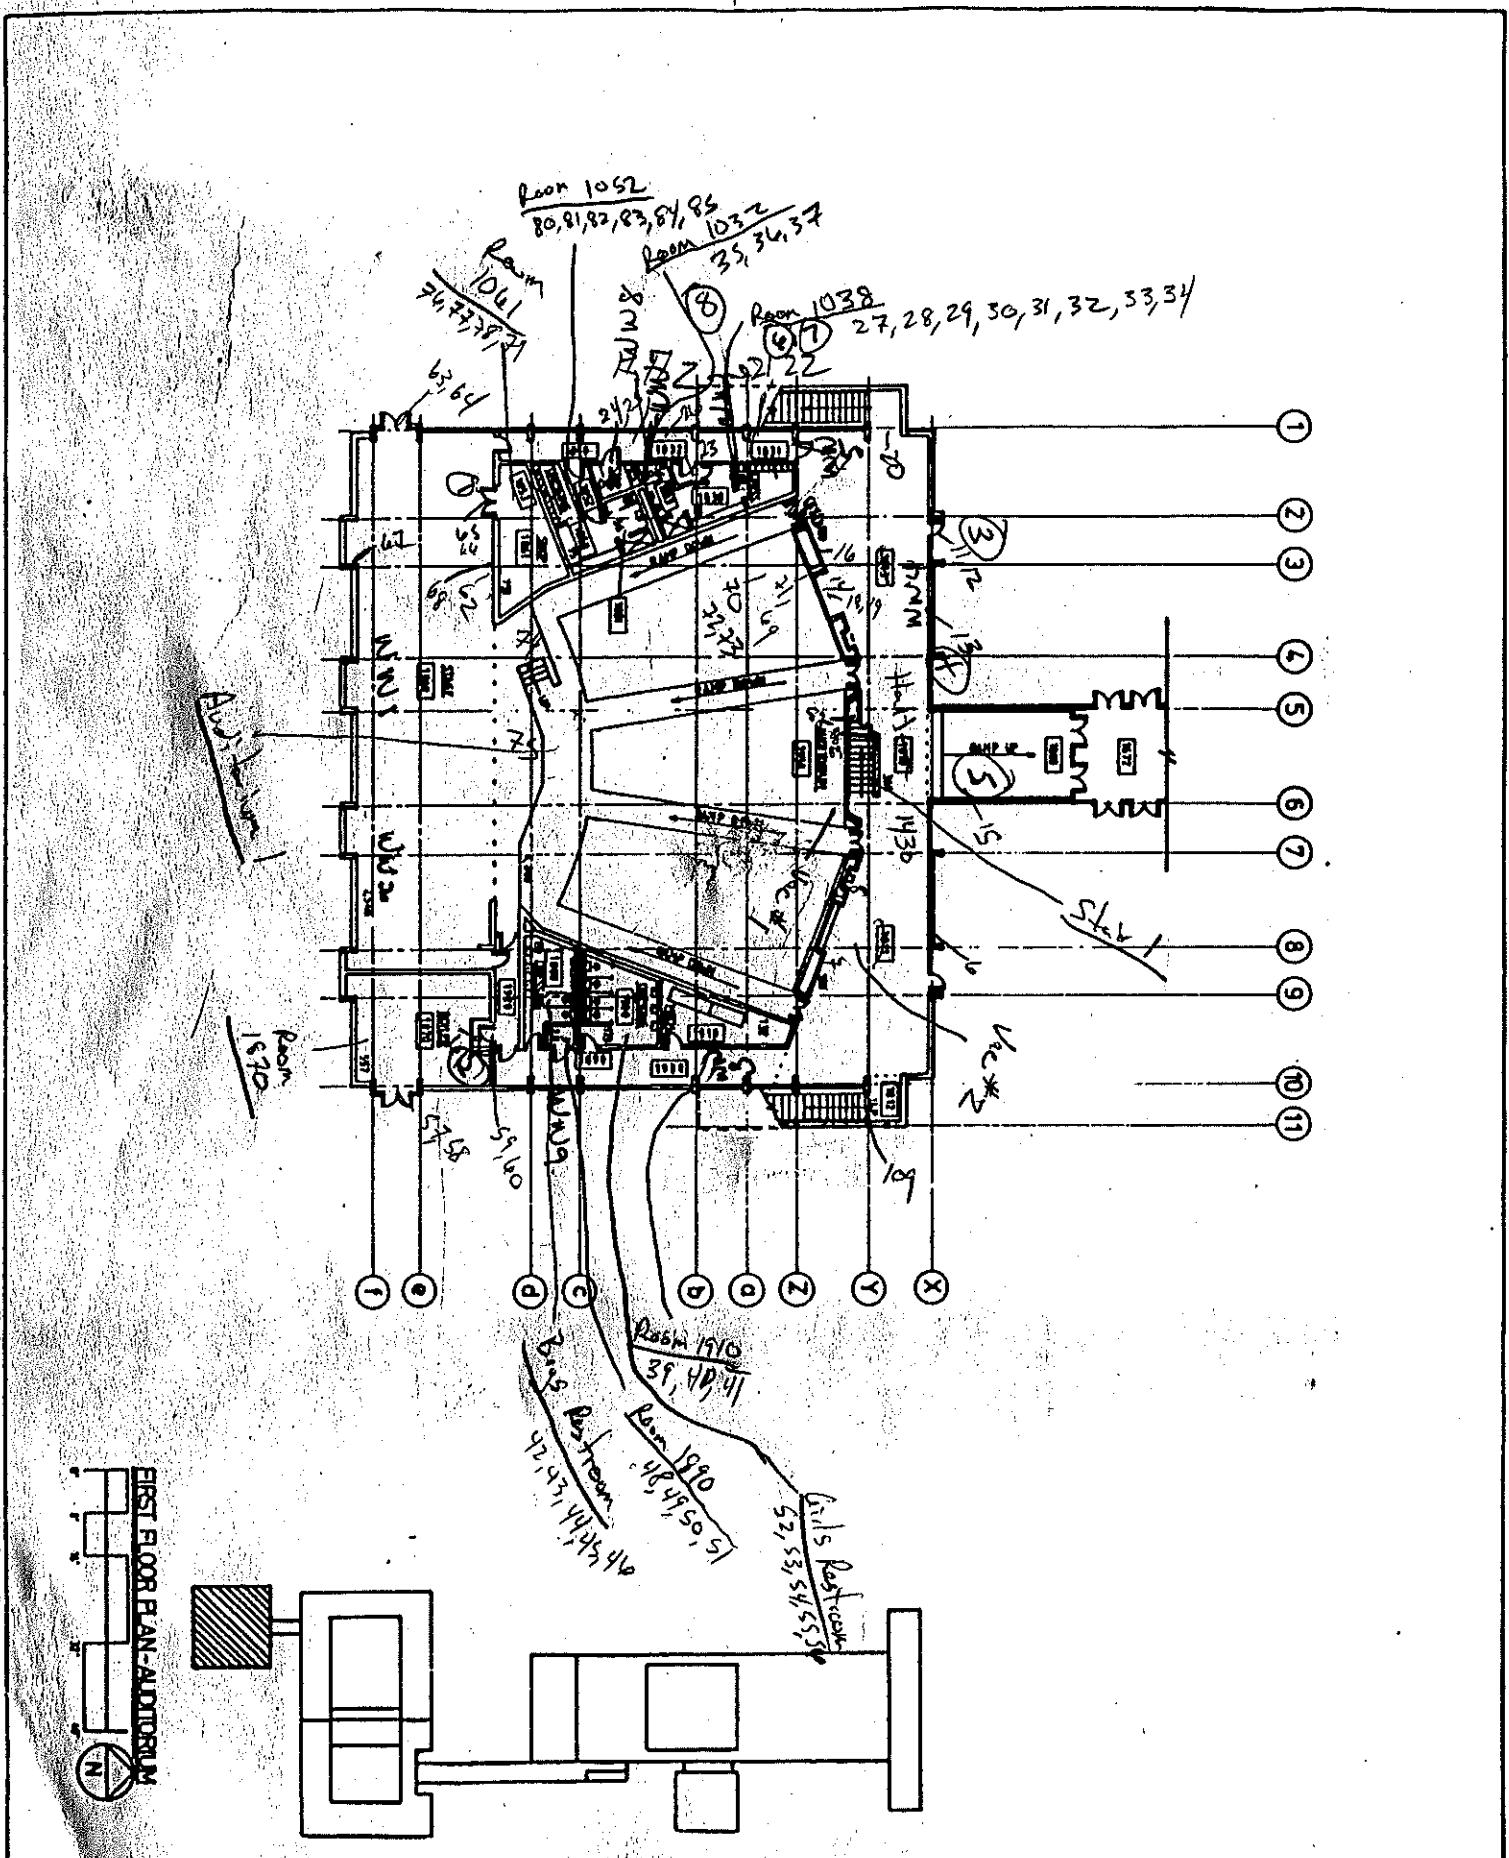




INDEPENDENT SCHOOL DIST. #625  
300 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

HIGHLAND PARK SR. HIGH  
1015 SQ SNELLING AVE.  
ST. PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971

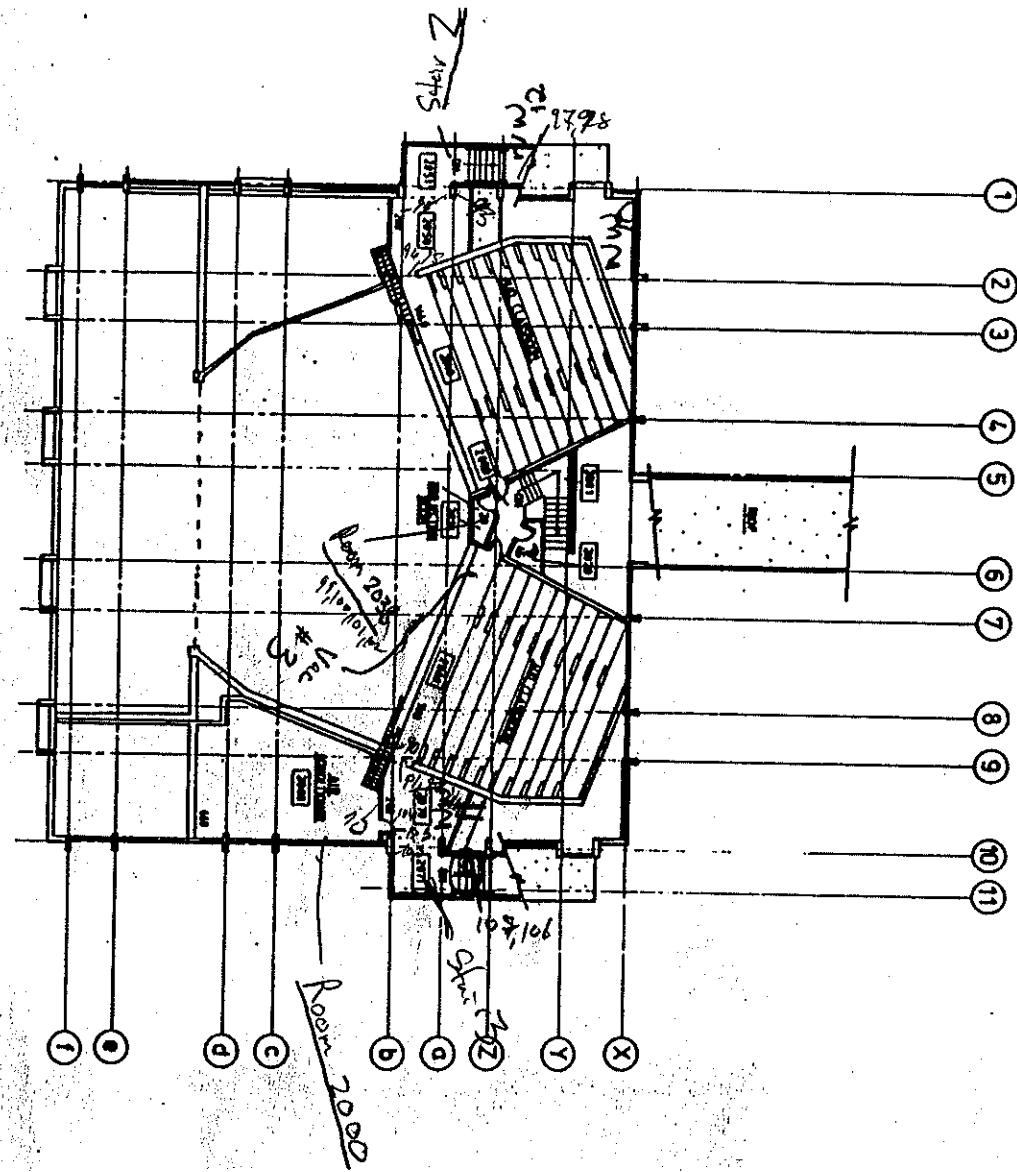

**SECOND FLOOR PLAN ADDITION**

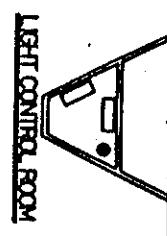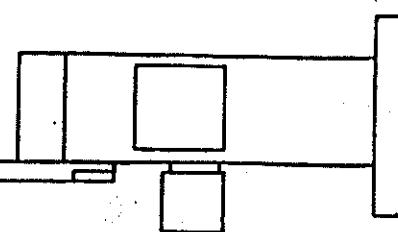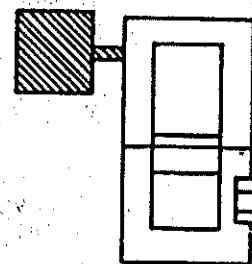

INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

HIGHLAND PARK SR. HIGH  
1015 SO. SNELLING AVE.  
ST. PAUL, MINNESOTA 55116

CONSTRUCTED: 1964, 1971

2  
16

# Little School House

## Site 7

WILMINGTON

DE 19803

A

WW5

W  
WW6

W  
WW7

W  
WW8

Room 1

WW4

80

72

74

WW78  
3 77  
3 79

W

8

W

WW2

99

W

84

WW12

91

90 WW1

76  
87 86 85

Room 2

95

75

93  
92

WW10

W.

98

WW11

POOL

89

88

910

100

C



Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1	Highland Park Senior High School											
2												
3	1964 & 1971 Bldgs	29	XRF	2/26/97	3 Bath		1 Wall	Midle Wall	Solid	Tile	1.3	
4	1964 & 1971 Bldgs	30	XRF	2/26/97	3 Bath		1 Wall	Midle Wall	Solid	Concrte	0.05	
5	1964 & 1971 Bldgs	31	XRF	2/26/97	3 Bath		1 Door	Door	Solid	Wood	0.01	
6	1964 & 1971 Bldgs	32	XRF	2/26/97	3 Bath		1 Door	Jamb	Solid	Metal	0	
7	1964 & 1971 Bldgs	33	XRF	2/26/97	3 Bath		1 Ceiling		Solid	Plaster	0.27	
8	1964 & 1971 Bldgs	34	XRF	2/26/97	3 Bath		1 Floor		Solid	Tile	0.27	
9	1964 & 1971 Bldgs	35	XRF	2/26/97	3 Bath		1	Radiator	Solid	Metal	0.01	
10	1964 & 1971 Bldgs	36	XRF	2/26/97	3 Bath		1 Wall	Wall Rgstr	Solid	Metal	0.03	
11	1964 & 1971 Bldgs	37	XRF	2/26/97	3 Bath		1 Bath	Partitian	Solid	Metal	0	
12	1964 & 1971 Bldgs	38	XRF	2/26/97	3 Bath		1 Bath	Partitian	Solid	Metal	0.04	
13	1964 & 1971 Bldgs	43	XRF	2/26/97	3 Bath		2 Wall	Midle Wall	Solid	Tile	1.53	
14	1964 & 1971 Bldgs	44	XRF	2/26/97	3 Bath		2 Wall	Midle Wall	Solid	Concrte	0.06	
15	1964 & 1971 Bldgs	45	XRF	2/26/97	3 Bath		2 Door	Door	Solid	Wood	0.01	
16	1964 & 1971 Bldgs	46	XRF	2/26/97	3 Bath		2 Door	Jamb	Solid	Metal	0	
17	1964 & 1971 Bldgs	48	XRF	2/26/97	3 Bath		2 Ceiling		Solid	Plaster	0.23	
18	1964 & 1971 Bldgs	49	XRF	2/26/97	3 Bath		2 Wall	Wall Rgstr	Solid	Metal	0.04	
19	1964 & 1971 Bldgs	50	XRF	2/26/97	3 Bath		2 Bath	Partitian	Solid	Metal	0.29	
20	1964 & 1971 Bldgs	51	XRF	2/26/97	3 Bath		2 Floor		Solid	Tile	0.16	
21	1964 & 1971 Bldgs	264	XRF	3/1/97	2 Bath		3 Wall	Midle Wall	Solid	Tile	0.92	
22	1964 & 1971 Bldgs	265	XRF	3/1/97	2 Bath		3 Door	Door	Solid	Wood	0.01	
23	1964 & 1971 Bldgs	266	XRF	3/1/97	2 Bath		3 Door	Jamb	Solid	Metal	0.3	
24	1964 & 1971 Bldgs	268	XRF	3/1/97	2 Bath		3 Ceiling		Solid	Drywall	0.14	
25	1964 & 1971 Bldgs	269	XRF	3/1/97	2 Bath		3 Bath	Partitian	Solid	Metal	0	
26	1964 & 1971 Bldgs	270	XRF	3/1/97	2 Bath		3 Ceiling	Diffuser	Solid	Metal	0.09	
27	1964 & 1971 Bldgs	271	XRF	3/1/97	2 Bath		3 Mirror	Ledge	Solid	Metal	0.09	
28	1964 & 1971 Bldgs	272	XRF	3/1/97	2 Bath		3 Floor		Solid	Tile	0.08	
29	1964 & 1971 Bldgs	284	XRF	3/1/97	2 Bath		4 Wall	Wall	Solid	Tile	1.33	
30	1964 & 1971 Bldgs	285	XRF	3/1/97	2 Bath		4 Door	Door	Solid	Wood	0.01	
31	1964 & 1971 Bldgs	286	XRF	3/1/97	2 Bath		4 Door	Jamb	Solid	Metal	0.3	
32	1964 & 1971 Bldgs	287	XRF	3/1/97	2 Bath		4 Door	Door	Solid	Wood	0	
33	1964 & 1971 Bldgs	288	XRF	3/1/97	2 Bath		4 Ceiling		Solid	Plaster	0.3	
34	1964 & 1971 Bldgs	289	XRF	3/1/97	2 Bath		4 Ceiling	Diffuser	Solid	Metal	0	
35	1964 & 1971 Bldgs	290	XRF	3/1/97	2 Bath		4 Bath	Partitian	Solid	Metal	0.04	
36	1964 & 1971 Bldgs	291	XRF	3/1/97	2 Bath		4 Mirror	Ledge	Solid	Metal	0.06	
37	1964 & 1971 Bldgs	292	XRF	3/1/97	2 Bath		4 Floor		Solid	Tile	0.17	
38	1964 & 1971 Bldgs	329	XRF	3/1/97	2 Bath		5 Wall	Midle Wall	Solid	Tile	1.58	
39	1964 & 1971 Bldgs	330	XRF	3/1/97	2 Bath		5 Wall	Wall	Solid	Concrete	0.03	
40	1964 & 1971 Bldgs	331	XRF	3/1/97	2 Bath		5 Door	Door	Solid	Wood	0	
41	1964 & 1971 Bldgs	332	XRF	3/1/97	2 Bath		5 Door	Jamb	Solid	Metal	0	
42	1964 & 1971 Bldgs	333	XRF	3/1/97	2 Bath		5 Bath	Partitian	Solid	Metal	0.02	
43	1964 & 1971 Bldgs	334	XRF	3/1/97	2 Bath		5 Ceiling		Solid	Plaster	0.28	
44	1964 & 1971 Bldgs	335	XRF	3/1/97	2 Bath		5 Wall	Diffuser	Solid	Metal	0.01	
45	1964 & 1971 Bldgs	336	XRF	3/1/97	2 Bath		5 Floor		Solid	Tile	0.15	
46	1964 & 1971 Bldgs	337	XRF	3/1/97	2 Bath		6 Wall	Midle Wall	Solid	Tile	1.55	
47	1964 & 1971 Bldgs	338	XRF	3/1/97	2 Bath		6 Wall	Midle Wall	Solid	Concrte	0.02	
48	1964 & 1971 Bldgs	339	XRF	3/1/97	2 Bath		6 Door	Door	Solid	Wood	0	
49	1964 & 1971 Bldgs	340	XRF	3/1/97	2 Bath		6 Door	Jamb	Solid	Metal	0	
50	1964 & 1971 Bldgs	341	XRF	3/1/97	2 Bath		6 Ceiling		Solid	Plaster	0.33	
51	1964 & 1971 Bldgs	342	XRF	3/1/97	2 Bath		6 Bath	Partitian	Solid	Metal	0.01	
52	1964 & 1971 Bldgs	343	XRF	3/1/97	2 Bath		6 Wall	Diffuser	Solid	Metal	0.01	
53	1964 & 1971 Bldgs	344	XRF	3/1/97	2 Bath		6 Mirror	Ledge	Solid	Metal	0.05	
54	1964 & 1971 Bldgs	345	XRF	3/1/97	2 Bath		6	Radiator	Solid	Metal	0	
55	1964 & 1971 Bldgs	346	XRF	3/1/97	2 Bath		6 Floor		Solid	Tile	0.09	
56	1964 & 1971 Bldgs	81	XRF	3/2/97	1 Bath	113A	Wall	Wall	Solid	Concrte	0	
57	1964 & 1971 Bldgs	82	XRF	3/2/97	1 Bath	113A	Wall	Wall	Solid	Concrte	0.03	
58	1964 & 1971 Bldgs	83	XRF	3/2/97	1 Bath	113A	Door	Door	Solid	Wood	0	
59	1964 & 1971 Bldgs	84	XRF	3/2/97	1 Bath	113A	Door	Jamb	Solid	Metal	0.29	
60	1964 & 1971 Bldgs	85	XRF	3/2/97	1 Bath	113A	Ceiling		Solid	Plaster	0.22	
61	1964 & 1971 Bldgs	86	XRF	3/2/97	1 Bath	113A	Ceiling	Diffuser	Solid	Metal	0	
62	1964 & 1971 Bldgs	87	XRF	3/2/97	1 Bath	113A	Cabinet	Door	Solid	Wood	0	
63	1964 & 1971 Bldgs	88	XRF	3/2/97	1 Bath	113A	Cabinet	Floor	Solid	Wood	0	
64	1964 & 1971 Bldgs	89	XRF	3/2/97	1 Bath	113A	Floor		Solid	Tile	0.14	

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
65	1964 & 1971 Bldgs	39	XRF	3/6/97	1	Bath	124A	Wall	Wall	Solid	Tile	1.53
66	1964 & 1971 Bldgs	40	XRF	3/6/97	1	Bath	124A	Door	Door	Solid	Wood	0
67	1964 & 1971 Bldgs	41	XRF	3/6/97	1	Bath	124A	Door	Jamb	Solid	Metal	0.07
68	1964 & 1971 Bldgs	42	XRF	3/6/97	1	Bath	124A	Ceiling		Solid	Plaster	0.17
69	1964 & 1971 Bldgs	43	XRF	3/6/97	1	Bath	124A	Ceiling	Diffuser	Solid	Metal	0.01
70	1964 & 1971 Bldgs	44	XRF	3/6/97	1	Bath	124A	Floor		Solid	Tile	0.15
71	1964 & 1971 Bldgs	117	XRF	3/6/97	1	Bath	124B	Wall	Midle Wall	Solid	Tile	1.22
72	1964 & 1971 Bldgs	118	XRF	3/6/97	1	Bath	124B	Door	Jamb	Solid	Metal	0.25
73	1964 & 1971 Bldgs	119	XRF	3/6/97	1	Bath	124B	Ceiling		Solid	Plaster	0.4
74	1964 & 1971 Bldgs	120	XRF	3/6/97	1	Bath	124B	Bookcase	Shelf	Solid	Metal	0.13
75	1964 & 1971 Bldgs	121	XRF	3/6/97	1	Bath	124B	Floor		Solid	Tile	0.09
76	1964 & 1971 Bldgs	83	XRF	2/19/97	3	Custodial	F	Wall	Midle Wall	Cracked	Concrte	0.03
77	1964 & 1971 Bldgs	84	XRF	2/19/97	3	Custodial	F	Broom	Rack	Solid	Wood	0.02
78	1964 & 1971 Bldgs	85	XRF	2/19/97	3	Custodial	F	Door	Door	Solid	Wood	0.01
79	1964 & 1971 Bldgs	86	XRF	2/19/97	3	Custodial	F	Door	Jamb	Solid	Metal	0.13
80	1964 & 1971 Bldgs	87	XRF	2/19/97	3	Custodial	F	Wall	Wall	Solid	Plaster	0.03
81	1964 & 1971 Bldgs	88	XRF	2/19/97	3	Custodial	F		Elec Panel	Solid	Metal	0
82	1964 & 1971 Bldgs	83	XRF	3/5/97	1	Hall		1 Wall	Wall	Solid	Concrete	0
83	1964 & 1971 Bldgs	84	XRF	3/5/97	1	Hall		1 Wall	Wall	Solid	Concrete	0.02
84	1964 & 1971 Bldgs	85	XRF	3/5/97	1	Hall		1 Wall	Wall	Solid	Concrete	0.02
85	1964 & 1971 Bldgs	86	XRF	3/5/97	1	Hall		1 Wall	Wall	Solid	Plaster	0.66
86	1964 & 1971 Bldgs	87	XRF	3/5/97	1	Hall		1 Wall	Midle Wall	Solid	Tile	0.08
87	1964 & 1971 Bldgs	88	XRF	3/5/97	1	Hall		1 Wall	Midle Wall	Solid	Tile	0.01
88	1964 & 1971 Bldgs	89	XRF	3/5/97	1	Hall		1 Wall	Wall	Solid	Wood	0.01
89	1964 & 1971 Bldgs	90	XRF	3/5/97	1	Hall		1 Wall	Wall	Solid	Concrete	0.07
90	1964 & 1971 Bldgs	91	XRF	3/5/97	1	Hall		1 Wall	Midle Wall	Solid	Masonite	0
91	1964 & 1971 Bldgs	92	XRF	3/5/97	1	Hall		1 Wall	Midle Wall	Solid	Plaster	0.52
92	1964 & 1971 Bldgs	93	XRF	3/5/97	1	Hall		1 Door	Door	Solid	Metal	0.28
93	1964 & 1971 Bldgs	94	XRF	3/5/97	1	Hall		1 Door	Casing	Solid	Metal	0.27
94	1964 & 1971 Bldgs	95	XRF	3/5/97	1	Hall		1 Door	Door	Solid	Metal	0.05
95	1964 & 1971 Bldgs	96	XRF	3/5/97	1	Hall		1 Door	Jamb	Solid	Metal	0.06
96	1964 & 1971 Bldgs	97	XRF	3/5/97	1	Hall		1 Elevator	Door	Solid	Metal	0.1
97	1964 & 1971 Bldgs	98	XRF	3/5/97	1	Hall		1 Elevator	Jamb	Solid	Metal	0.09
98	1964 & 1971 Bldgs	99	XRF	3/5/97	1	Hall		1 Door	Door	Solid	Wood	0
99	1964 & 1971 Bldgs	100	XRF	3/5/97	1	Hall		1 Door	Casing	Solid	Wood	0.01
100	1964 & 1971 Bldgs	101	XRF	3/5/97	1	Hall		1 Wall	Baseboard	Solid	Tile	0.96
101	1964 & 1971 Bldgs	102	XRF	3/5/97	1	Hall		1 Speaker	Cover	Solid	Metal	0.01
102	1964 & 1971 Bldgs	103	XRF	3/5/97	1	Hall		1 Wall	Wall Rgstr	Solid	Metal	0.02
103	1964 & 1971 Bldgs	104	XRF	3/5/97	1	Hall		1 Locker		Solid	Metal	0.98
104	1964 & 1971 Bldgs	105	XRF	3/5/97	1	Hall		1 Locker		Solid	Metal	0
105	1964 & 1971 Bldgs	106	XRF	3/5/97	1	Hall		1 Locker		Solid	Metal	0.01
106	1964 & 1971 Bldgs	107	XRF	3/5/97	1	Hall		1 Wall	Midle Wall	Solid	Wood	0
107	1964 & 1971 Bldgs	108	XRF	3/5/97	1	Hall		1	Hand rail	Solid	Wood	0.01
108	1964 & 1971 Bldgs	109	XRF	3/5/97	1	Hall		1	Hand rail	Solid	Metal	0.86
109	1964 & 1971 Bldgs	110	XRF	3/5/97	1	Hall		1 Security	Gate	Solid	Metal	0
110	1964 & 1971 Bldgs	111	XRF	3/5/97	1	Hall		1 Ceiling		Solid	Plaster	0.09
111	1964 & 1971 Bldgs	112	XRF	3/5/97	1	Hall		1	Radiator	Solid	Metal	0.04
112	1964 & 1971 Bldgs	113	XRF	3/5/97	1	Hall		1 Unlisted	Radiator	Solid	Metal	0.27
113	1964 & 1971 Bldgs	351	XRF	3/1/97	2	Hall		2 Wall	Wall	Solid	Concrete	0.03
114	1964 & 1971 Bldgs	352	XRF	3/1/97	2	Hall		2 Wall	Midle Wall	Solid	Concrete	0.02
115	1964 & 1971 Bldgs	353	XRF	3/1/97	2	Hall		2 Wall	Midle Wall	Solid	Concrete	0.01
116	1964 & 1971 Bldgs	354	XRF	3/1/97	2	Hall		2 Wall	Midle Wall	Solid	Wood	0.04
117	1964 & 1971 Bldgs	355	XRF	3/1/97	2	Hall		2 Wall	Wall	Solid	Plaster	1.29
118	1964 & 1971 Bldgs	356	XRF	3/1/97	2	Hall		2 Wall	Midle Wall	Solid	Tile	0.04
119	1964 & 1971 Bldgs	357	XRF	3/1/97	2	Hall		2 Wall	Midle Wall	Solid	Tile	0.03
120	1964 & 1971 Bldgs	358	XRF	3/1/97	2	Hall		2 Wall	Midle Wall	Solid	Concrete	0.02
121	1964 & 1971 Bldgs	359	XRF	3/1/97	2	Hall		2 Locker		Solid	Metal	0.01
122	1964 & 1971 Bldgs	360	XRF	3/1/97	2	Hall		2 Locker		Solid	Metal	0
123	1964 & 1971 Bldgs	361	XRF	3/1/97	2	Hall		2 Locker		Solid	Metal	0.4
124	1964 & 1971 Bldgs	362	XRF	3/1/97	2	Hall		2 Door	Door	Solid	Metal	0.4
125	1964 & 1971 Bldgs	363	XRF	3/1/97	2	Hall		2 Door	Jamb	Solid	Metal	0.25
126	1964 & 1971 Bldgs	364	XRF	3/1/97	2	Hall		2 Ceiling		Solid	Plaster	0.08
127	1964 & 1971 Bldgs	365	XRF	3/1/97	2	Hall		2 Wall	Diffuser	Solid	Metal	0
128	1964 & 1971 Bldgs	366	XRF	3/1/97	2	Hall		2 Speaker	Cover	Solid	Metal	0

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
129	1964 & 1971 Bldgs	367	XRF	3/1/97	2 Hall		2 Door	Casing	Solid	Wood	0.01	
130	1964 & 1971 Bldgs	368	XRF	3/1/97	2 Hall		2 Door	Door	Solid	Metal	0.02	
131	1964 & 1971 Bldgs	369	XRF	3/1/97	2 Hall		2 Elevator	Door	Solid	Metal	0.1	
132	1964 & 1971 Bldgs	370	XRF	3/1/97	2 Hall		2 Elevator	Jamb	Solid	Metal	0.17	
133	1964 & 1971 Bldgs	371	XRF	3/1/97	2 Hall		2	Hand rail	Solid	Metal	0.94	
134	1964 & 1971 Bldgs	372	XRF	3/1/97	2 Hall		2	Hand rail	Solid	Wood	0	
135	1964 & 1971 Bldgs	373	XRF	3/1/97	2 Hall		2	Radiator	Solid	Metal	0	
136	1964 & 1971 Bldgs	6	XRF	2/26/97	3 Hall		3 Wall	Midle Wall	Solid	Concre	0.01	
137	1964 & 1971 Bldgs	7	XRF	2/26/97	3 Hall		3 Wall	Midle Wall	Solid	Concre	0.02	
138	1964 & 1971 Bldgs	8	XRF	2/26/97	3 Hall		3 Wall	Midle Wall	Solid	Concre	0.01	
139	1964 & 1971 Bldgs	9	XRF	2/26/97	3 Hall		3 Wall	Midle Wall	Solid	Wood	0	
140	1964 & 1971 Bldgs	10	XRF	2/26/97	3 Hall		3 Wall	Midle Wall	Solid	Metal	0	
141	1964 & 1971 Bldgs	11	XRF	2/26/97	3 Hall		3 Wall	Midle Wall	Solid	Concrte	0.01	
142	1964 & 1971 Bldgs	12	XRF	2/26/97	3 Hall		3 Wall	Midle Wall	Solid	Tile	0.03	
143	1964 & 1971 Bldgs	13	XRF	2/26/97	3 Hall		3 Wall	Midle Wall	Solid	Tile	0.04	
144	1964 & 1971 Bldgs	14	XRF	2/26/97	3 Hall		3 Wall	Wall	Solid	Plaster	0.69	
145	1964 & 1971 Bldgs	15	XRF	2/26/97	3 Hall		3 Door	Door	Solid	Wood	0	
146	1964 & 1971 Bldgs	16	XRF	2/26/97	3 Hall		3 Door	Jamb	Solid	Metal	0.5	
147	1964 & 1971 Bldgs	17	XRF	2/26/97	3 Hall		3 Door	Door	Solid	Metal	0.33	
148	1964 & 1971 Bldgs	18	XRF	2/26/97	3 Hall		3 Door	Casing	Solid	Metal	0.3	
149	1964 & 1971 Bldgs	19	XRF	2/26/97	3 Hall		3 Locker		Solid	Metal	0	
150	1964 & 1971 Bldgs	20	XRF	2/26/97	3 Hall		3 Locker		Solid	Metal	0.04	
151	1964 & 1971 Bldgs	21	XRF	2/26/97	3 Hall		3 Locker		Solid	Metal	0.52	
152	1964 & 1971 Bldgs	22	XRF	2/26/97	3 Hall		3 Door	Door	Solid	Metal	0.3	
153	1964 & 1971 Bldgs	23	XRF	2/26/97	3 Hall		3 Door	Jamb	Solid	Metal	0.14	
154	1964 & 1971 Bldgs	24	XRF	2/26/97	3 Hall		3 Ceiling		Solid	Plaster	0.07	
155	1964 & 1971 Bldgs	25	XRF	2/26/97	3 Hall		3	Radiator	Solid	Metal	0.01	
156	1964 & 1971 Bldgs	26	XRF	2/26/97	3 Hall		3 Wall	Baseboard	Solid	Tile	1.64	
157	1964 & 1971 Bldgs	27	XRF	2/26/97	3 Hall		3 Stairs	Hand rail	Solid	Metal	0.65	
158	1964 & 1971 Bldgs	28	XRF	2/26/97	3 Hall		3 Stairs	Hand rail	Solid	Wood	0	
159	1964 & 1971 Bldgs	39	XRF	2/26/97	3 Hall		3 Speaker	Cover	Solid	Metal	0	
160	1964 & 1971 Bldgs	40	XRF	2/26/97	3 Hall		3 Door	Door	Solid	Metal	0.09	
161	1964 & 1971 Bldgs	41	XRF	2/26/97	3 Hall		3 Door	Casing	Solid	Metal	0.14	
162	1964 & 1971 Bldgs	42	XRF	2/26/97	3 Hall		3	Radiator	Solid	Metal	0	
163	1964 & 1971 Bldgs	462	XRF	3/2/97	1 Hall		103	Radiator	Solid	Metal	0.01	
164	1964 & 1971 Bldgs	463	XRF	3/2/97	1 Hall		103 Wall	Wall	Solid	Concre	0	
165	1964 & 1971 Bldgs	464	XRF	3/2/97	1 Hall		103 Wall	Wall	Solid	Concre	0.07	
166	1964 & 1971 Bldgs	465	XRF	3/2/97	1 Hall		103 Wall	Midle Wall	Solid	Drywall	0.02	
167	1964 & 1971 Bldgs	466	XRF	3/2/97	1 Hall		103 Door	Door	Solid	Wood	0.05	
168	1964 & 1971 Bldgs	467	XRF	3/2/97	1 Hall		103 Door	Jamb	Solid	Metal	0	
169	1964 & 1971 Bldgs	468	XRF	3/2/97	1 Hall		103 Door	Header	Solid	Metal	0	
170	1964 & 1971 Bldgs	21	XRF	3/6/97	1 Hall		124A Wall	Wall	Solid	Concre	0.01	
171	1964 & 1971 Bldgs	22	XRF	3/6/97	1 Hall		124A Door	Door	Solid	Wood	0	
172	1964 & 1971 Bldgs	23	XRF	3/6/97	1 Hall		124A Door	Jamb	Solid	Metal	0.41	
173	1964 & 1971 Bldgs	24	XRF	3/6/97	1 Hall		124A Ceiling		Solid	Plaster	0.15	
174	1964 & 1971 Bldgs	25	XRF	3/6/97	1 Hall		124A Soffit		Solid	Metal	0.23	
175	1964 & 1971 Bldgs	26	XRF	3/6/97	1 Hall		124A Wall	Diffuser	Solid	Metal	0.01	
176	1964 & 1971 Bldgs	27	XRF	3/6/97	1 Hall		124B Wall	Wall	Solid	Concre	0	
177	1964 & 1971 Bldgs	28	XRF	3/6/97	1 Hall		124B Door	Door	Solid	Wood	0	
178	1964 & 1971 Bldgs	29	XRF	3/6/97	1 Hall		124B Door	Caslng	Solid	Metal	0.15	
179	1964 & 1971 Bldgs	30	XRF	3/6/97	1 Hall		124B Half	Door	Solid	Wood	0	
180	1964 & 1971 Bldgs	31	XRF	3/6/97	1 Hall		124B Door	Jamb	Solid	Metal	0.01	
181	1964 & 1971 Bldgs	389	XRF	3/1/97	1 Hall	1A	1A Wall	Wall	Solid	Concre	0	
182	1964 & 1971 Bldgs	390	XRF	3/1/97	1 Hall	1A	1A Wall	Wall	Solid	Concre	0.01	
183	1964 & 1971 Bldgs	391	XRF	3/1/97	1 Hall	1A	Door	Door	Solid	Wood	0	
184	1964 & 1971 Bldgs	392	XRF	3/1/97	1 Hall	1A	Door	Jamb	Solid	Metal	0.12	
185	1964 & 1971 Bldgs	393	XRF	3/1/97	1 Hall	1A	Bulletin Board	Board	Solid	Wood	1.04	
186	1964 & 1971 Bldgs	394	XRF	3/1/97	1 Hall	1A	Cabinet	Door	Solid	Wood	0	
187	1964 & 1971 Bldgs	395	XRF	3/1/97	1 Hall	1A		Hand rail	Solid	Wood	0	
188	1964 & 1971 Bldgs	396	XRF	3/1/97	1 Hall	1A	Ceiling		Solid	Plaster	0.08	
189	1964 & 1971 Bldgs	397	XRF	3/1/97	1 Hall	1A	Ceiling		Solid	Metal	0.14	
190	1964 & 1971 Bldgs	105	XRF	3/13/97	0 Hall	B	Wall	Wall	Solid	Concre	0.03	
191	1964 & 1971 Bldgs	106	XRF	3/13/97	0 Hall	B	Wall	Wall	Solid	Concre	0.01	
192	1964 & 1971 Bldgs	107	XRF	3/13/97	0 Hall	B	Wall	Midle Wall	Solid	Concre	0	

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
193	1964 & 1971 Bldgs	108	XRF	3/13/97	0	Hall	B	Wall	Baseboard	Solid	Tile	1.18
194	1964 & 1971 Bldgs	109	XRF	3/13/97	0	Hall	B	Ceiling		Solid	Wood	0
195	1964 & 1971 Bldgs	110	XRF	3/13/97	0	Hall	B	Wall	Wall	Solid	Plaster	0.49
196	1964 & 1971 Bldgs	111	XRF	3/13/97	0	Hall	B	Speaker	Cover	Solid	Metal	0.01
197	1964 & 1971 Bldgs	112	XRF	3/13/97	0	Hall	B	Door	Door	Solid	Metal	0.23
198	1964 & 1971 Bldgs	113	XRF	3/13/97	0	Hall	B	Door	Jamb	Solid	Metal	0.27
199	1964 & 1971 Bldgs	114	XRF	3/13/97	0	Hall	B	Door	Door	Solid	Wood	0
200	1964 & 1971 Bldgs	115	XRF	3/13/97	0	Hall	B	Locker		Solid	Metal	0
201	1964 & 1971 Bldgs	116	XRF	3/13/97	0	Hall	B	Locker		Solid	Metal	0
202	1964 & 1971 Bldgs	117	XRF	3/13/97	0	Hall	B		Elec Panel	Solid	Metal	0
203	1964 & 1971 Bldgs	157	XRF	3/14/97	1	Entry	B	Wall	Wall	Solid	Concrte	0.05
204	1964 & 1971 Bldgs	158	XRF	3/14/97	1	Entry	B	Ceiling		Solid	Plaster	0.12
205	1964 & 1971 Bldgs	159	XRF	3/14/97	1	Entry	B		Radiator	Solid	Metal	0.06
206	1964 & 1971 Bldgs	160	XRF	3/14/97	1	Entry	D	Wall	Wall	Solid	Concrte	0.02
207	1964 & 1971 Bldgs	161	XRF	3/14/97	1	Entry	D	Wall	Wall	Solid	Metal	0.55
208	1964 & 1971 Bldgs	162	XRF	3/14/97	1	Entry	D	Ceiling		Solid	Plaster	0.09
209	1964 & 1971 Bldgs	163	XRF	3/14/97	1	Entry	D		Radiator	Solid	Metal	0.08
210	1964 & 1971 Bldgs	383	XRF	3/1/97	1	Room	0	Wall	Wall	Solid	Tile	0.39
211	1964 & 1971 Bldgs	384	XRF	3/1/97	1	Room	0		Radiator	Solid	Metal	0
212	1964 & 1971 Bldgs	126	XRF	2/26/97	2	Room	2	Wall	Wall	Solid	Concrte	0.01
213	1964 & 1971 Bldgs	127	XRF	2/26/97	2	Room	2	Wall	Wall	Solid	Concrte	0.03
214	1964 & 1971 Bldgs	128	XRF	2/26/97	2	Room	2	Door	Door	Solid	Wood	0.01
215	1964 & 1971 Bldgs	129	XRF	2/26/97	2	Room	2	Door	Casing	Solid	Wood	0.01
216	1964 & 1971 Bldgs	130	XRF	2/26/97	2	Room	2	Wall	Baseboard	Solid	Tile	1.83
217	1964 & 1971 Bldgs	131	XRF	2/26/97	2	Room	3	Wall	Midle Wall	Solid	Concrte	0.04
218	1964 & 1971 Bldgs	132	XRF	2/26/97	2	Room	3	Wall	Wall	Solid	Concrte	0.01
219	1964 & 1971 Bldgs	133	XRF	2/26/97	2	Room	3	Door	Door	Solid	Wood	0
220	1964 & 1971 Bldgs	134	XRF	2/26/97	2	Room	3	Door	Jamb	Solid	Metal	0.18
221	1964 & 1971 Bldgs	79	XRF	2/28/97	2	Room	4	Wall	Wall	Solid	Concrte	0.01
222	1964 & 1971 Bldgs	80	XRF	2/28/97	2	Room	4	Door	Door	Solid	Wood	0.01
223	1964 & 1971 Bldgs	81	XRF	2/28/97	2	Room	4	Door	Jamb	Solid	Metal	0.16
224	1964 & 1971 Bldgs	82	XRF	2/28/97	2	Room	4	Bookcase	Shelf	Solid	Wood	0.01
225	1964 & 1971 Bldgs	322	XRF	3/1/97	2	Room	5	Wall	Wall	Solid	Concrte	0.02
226	1964 & 1971 Bldgs	323	XRF	3/1/97	2	Room	5	Door	Door	Solid	Wood	0
227	1964 & 1971 Bldgs	324	XRF	3/1/97	2	Room	5	Door	Jamb	Solid	Metal	0.24
228	1964 & 1971 Bldgs	325	XRF	3/1/97	2	Room	5	Ceiling		Solid	Concrte	0.02
229	1964 & 1971 Bldgs	326	XRF	3/1/97	2	Room	5	Cabinet	Door	Solid	Wood	0.01
230	1964 & 1971 Bldgs	327	XRF	3/1/97	2	Room	5	Cabinet	Shelf	Solid	Wood	0.01
231	1964 & 1971 Bldgs	328	XRF	3/1/97	2	Room	5	Wall	Baseboard	Solid	Tile	1.35
232	1964 & 1971 Bldgs	347	XRF	3/1/97	2	Room	6	Wall	Midle Wall	Solid	Concrte	0.03
233	1964 & 1971 Bldgs	348	XRF	3/1/97	2	Room	6	Wall	Midle Wall	Solid	Wood	3.01
234	1964 & 1971 Bldgs	349	XRF	3/1/97	2	Room	6	Door	Door	Solid	Wood	0
235	1964 & 1971 Bldgs	350	XRF	3/1/97	2	Room	6	Door	Jamb	Solid	Metal	0.31
236	1964 & 1971 Bldgs	469	XRF	3/2/97	1	Room	7	Wall	Wall	Solid	Concrte	0.03
237	1964 & 1971 Bldgs	470	XRF	3/2/97	1	Room	7	Wall	Wall	Solid	Concrte	0.04
238	1964 & 1971 Bldgs	471	XRF	3/2/97	1	Room	7	Bookcase	Shelf	Solid	Wood	0
239	1964 & 1971 Bldgs	472	XRF	3/2/97	1	Room	7	Shelf	Bracket	Solid	Metal	0.12
240	1964 & 1971 Bldgs	473	XRF	3/2/97	1	Room	8	Wall	Wall	Solid	Concrte	0.01
241	1964 & 1971 Bldgs	474	XRF	3/2/97	1	Room	8	Wall	Wall	Solid	Concrte	0.01
242	1964 & 1971 Bldgs	475	XRF	3/2/97	1	Room	8	Door	Door	Solid	Wood	0
243	1964 & 1971 Bldgs	476	XRF	3/2/97	1	Room	8	Door	Jamb	Solid	Metal	0.09
244	1964 & 1971 Bldgs	477	XRF	3/2/97	1	Room	8	Wall	Wall	Solid	Plaster	0.23
245	1964 & 1971 Bldgs	478	XRF	3/2/97	1	Room	8	Ceiling		Solid	Concrte	0.01
246	1964 & 1971 Bldgs	123	XRF	3/6/97	1	Room	10	Wall	Wall	Solid	Concrte	0.01
247	1964 & 1971 Bldgs	124	XRF	3/6/97	1	Room	10	Wall	Wall	Solid	Concrte	0.02
248	1964 & 1971 Bldgs	125	XRF	3/6/97	1	Room	10	Wall	Midle Wall	Solid	Wood	3.03
249	1964 & 1971 Bldgs	126	XRF	3/6/97	1	Room	10	Wall	Midle Wall	Solid	Wood	0
250	1964 & 1971 Bldgs	127	XRF	3/6/97	1	Room	10	Door	Door	Solid	Metal	0.28
251	1964 & 1971 Bldgs	128	XRF	3/6/97	1	Room	10	Door	Jamb	Solid	Metal	0.24
252	1964 & 1971 Bldgs	129	XRF	3/6/97	1	Room	10	Ceiling		Peeling	Plaster	0.05
253	1964 & 1971 Bldgs	130	XRF	3/6/97	1	Room	11	Wall	Wall	Solid	Concrte	0.02
254	1964 & 1971 Bldgs	131	XRF	3/6/97	1	Room	11	Ceiling		Solid	Concrte	0.04
255	1964 & 1971 Bldgs	95	XRF	3/13/97	0	Room	30	Door	Door	Solid	Metal	0.32
256	1964 & 1971 Bldgs	96	XRF	3/13/97	0	Room	30	Door	Jamb	Solid	Metal	0.29

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
257	1964 & 1971 Bldgs	97	XRF	3/13/97	0	Room	31	Door	Door	Solid	Wood	0
258	1964 & 1971 Bldgs	98	XRF	3/13/97	0	Room	31	Door	Jamb	Solid	Wood	0.34
259	1964 & 1971 Bldgs	99	XRF	3/13/97	0	Room	31	Door	Header	Solid	Metal	5.09
260	1964 & 1971 Bldgs	100	XRF	3/13/97	0	Room	31	Cage		Solid	Metal	0.24
261	1964 & 1971 Bldgs	101	XRF	3/13/97	0	Room	33	Wall	Midle Wall	Solid	Drywall	0.05
262	1964 & 1971 Bldgs	102	XRF	3/13/97	0	Room	33	Door	Door	Solid	Wood	0
263	1964 & 1971 Bldgs	103	XRF	3/13/97	0	Room	33	Door	Jamb	Solid	Metal	0.56
264	1964 & 1971 Bldgs	104	XRF	3/13/97	0	Room	33	Door	Header	Solid	Metal	5.09
265	1964 & 1971 Bldgs	93	XRF	3/13/97	0	Room	60	Door	Door	Solid	Metal	0.24
266	1964 & 1971 Bldgs	94	XRF	3/13/97	0	Room	60	Door	Jamb	Solid	Metal	0.28
267	1964 & 1971 Bldgs	11	XRF	3/13/97	0	Room	100	Wall	Wall	Solid	Concrte	0.02
268	1964 & 1971 Bldgs	12	XRF	3/13/97	0	Room	100	Wall	Wall	Solid	Concrte	0.03
269	1964 & 1971 Bldgs	13	XRF	3/13/97	0	Room	100	Wall	Wall	Solid	Concrte	0.01
270	1964 & 1971 Bldgs	14	XRF	3/13/97	0	Room	100	Door	Door	Solid	Wood	0
271	1964 & 1971 Bldgs	15	XRF	3/13/97	0	Room	100	Door	Jamb	Solid	Metal	0.47
272	1964 & 1971 Bldgs	16	XRF	3/13/97	0	Room	100	Ceiling		Solid	Concrte	0.01
273	1964 & 1971 Bldgs	17	XRF	3/13/97	0	Room	100	Bookcase	Shelf	Solid	Wood	0
274	1964 & 1971 Bldgs	18	XRF	3/13/97	0	Room	100	Wall	Wall	Solid	Metal	0
275	1964 & 1971 Bldgs	375	XRF	3/1/97	1	Room	101	Wall	Midle Wall	Solid	Concre	0.03
276	1964 & 1971 Bldgs	376	XRF	3/1/97	1	Room	101	Wall	Wall	Solid	Concre	0.01
277	1964 & 1971 Bldgs	377	XRF	3/1/97	1	Room	101	Wall	Midle Wall	Solid	Drywall	0.01
278	1964 & 1971 Bldgs	378	XRF	3/1/97	1	Room	101	Door	Door	Solid	Wood	0
279	1964 & 1971 Bldgs	379	XRF	3/1/97	1	Room	101	Door	Jamb	Solid	Metal	0.11
280	1964 & 1971 Bldgs	380	XRF	3/1/97	1	Room	101		Radiator	Solid	Metal	0
281	1964 & 1971 Bldgs	381	XRF	3/1/97	1	Room	101	Ceiling		Solid	Concre	0.01
282	1964 & 1971 Bldgs	382	XRF	3/1/97	1	Room	101	Window	Stool	Solid	Wood	0
283	1964 & 1971 Bldgs	398	XRF	3/1/97	1	Room	102	Wall	Wall	Solid	Concre	0.01
284	1964 & 1971 Bldgs	399	XRF	3/1/97	1	Room	102	Wall	Wall	Solid	Concrete	0.03
285	1964 & 1971 Bldgs	400	XRF	3/1/97	1	Room	102	Door	Door	Solid	Wood	0.01
286	1964 & 1971 Bldgs	401	XRF	3/1/97	1	Room	102	Door	Jamb	Solid	Metal	0.14
287	1964 & 1971 Bldgs	402	XRF	3/1/97	1	Room	102	Wall	Wall	Solid	Tile	1.35
288	1964 & 1971 Bldgs	403	XRF	3/1/97	1	Room	102	Wall	Midle Wall	Solid	Wood	0
289	1964 & 1971 Bldgs	414	XRF	3/2/97	1	Room	102	Ceiling		Solid	Plaster	0.17
290	1964 & 1971 Bldgs	415	XRF	3/2/97	1	Room	102	Ceiling		Solid	Plaster	0.06
291	1964 & 1971 Bldgs	416	XRF	3/2/97	1	Room	102	Ceiling		Solid	Metal	0.11
292	1964 & 1971 Bldgs	417	XRF	3/2/97	1	Room	102		Radiator	Solid	Metal	0.51
293	1964 & 1971 Bldgs	418	XRF	3/2/97	1	Room	102	Speaker	Cover	Solid	Metal	0
294	1964 & 1971 Bldgs	419	XRF	3/2/97	1	Room	102	Wall	Baseboard	Solid	Tile	1.43
295	1964 & 1971 Bldgs	420	XRF	3/2/97	1	Room	102	Cabinet	Door	Solid	Wood	0.01
296	1964 & 1971 Bldgs	421	XRF	3/2/97	1	Room	102	Cabinet	Inside	Solid	Wood	0.01
297	1964 & 1971 Bldgs	422	XRF	3/2/97	1	Room	102	Cabinet	Inside	Solid	Wood	0
298	1964 & 1971 Bldgs	439	XRF	3/2/97	1	Room	103	Wall	Wall	Solid	Concre	0.02
299	1964 & 1971 Bldgs	440	XRF	3/2/97	1	Room	103	Wall	Wall	Solid	Concre	0.01
300	1964 & 1971 Bldgs	441	XRF	3/2/97	1	Room	103	Wall	Wall	Solid	Tile	1.46
301	1964 & 1971 Bldgs	442	XRF	3/2/97	1	Room	103	Wall	Midle Wall	Solid	Wood	0
302	1964 & 1971 Bldgs	443	XRF	3/2/97	1	Room	103	Bulletin	Board	Solid	Wood	0.9
303	1964 & 1971 Bldgs	444	XRF	3/2/97	1	Room	103	Door	Door	Solid	Wood	0
304	1964 & 1971 Bldgs	445	XRF	3/2/97	1	Room	103	Door	Jamb	Solid	Metal	0.34
305	1964 & 1971 Bldgs	446	XRF	3/2/97	1	Room	103		Radiator	Solid	Metal	0.14
306	1964 & 1971 Bldgs	447	XRF	3/2/97	1	Room	103	Door	Door	Solid	Metal	0.01
307	1964 & 1971 Bldgs	448	XRF	3/2/97	1	Room	103	Door	Jamb	Solid	Metal	0
308	1964 & 1971 Bldgs	449	XRF	3/2/97	1	Room	103	Ceiling		Solid	Plaster	0.24
309	1964 & 1971 Bldgs	450	XRF	3/2/97	1	Room	103	Ceiling		Solid	Metal	0.22
310	1964 & 1971 Bldgs	451	XRF	3/2/97	1	Room	103	Cabinet	Shelf	Solid	Wood	0
311	1964 & 1971 Bldgs	452	XRF	3/2/97	1	Room	103	Cabinet	Door	Solid	Wood	0
312	1964 & 1971 Bldgs	453	XRF	3/2/97	1	Room	103	Speaker	Cover	Solid	Metal	0
313	1964 & 1971 Bldgs	13	XRF	3/2/97	1	Room	105	Wall	Wall	Solid	Concrte	0
314	1964 & 1971 Bldgs	14	XRF	3/2/97	1	Room	105	Wall	Wall	Solid	Concrte	0
315	1964 & 1971 Bldgs	15	XRF	3/2/97	1	Room	105	Wall	Midle Wall	Solid	Concrte	0.03
316	1964 & 1971 Bldgs	16	XRF	3/2/97	1	Room	105	Wall	Wall	Solid	Concrte	0
317	1964 & 1971 Bldgs	17	XRF	3/2/97	1	Room	105	Door	Door	Solid	Wood	0
318	1964 & 1971 Bldgs	18	XRF	3/2/97	1	Room	105	Door	Jamb	Solid	Metal	0.14
319	1964 & 1971 Bldgs	19	XRF	3/2/97	1	Room	105	Wall	Baseboard	Solid	Tile	1.29
320	1964 & 1971 Bldgs	20	XRF	3/2/97	1	Room	105	Wall	Baseboard	Solid	Tile	0.18

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L
321	1964 & 1971 Bldgs	21	XRF	3/2/97	1 Room	105		Hand rail	Solid	Metal	0.01
322	1964 & 1971 Bldgs	22	XRF	3/2/97	1 Room	105	Door	Door	Solid	Metal	0
323	1964 & 1971 Bldgs	23	XRF	3/2/97	1 Room	105	Door	Jamb	Solid	Metal	0
324	1964 & 1971 Bldgs	24	XRF	3/2/97	1 Room	105	Ceiling		Solid	Concrete	0.03
325	1964 & 1971 Bldgs	25	XRF	3/2/97	1 Room	105	Ceiling		Solid	Plaster	0.15
326	1964 & 1971 Bldgs	26	XRF	3/2/97	1 Room	105	Soffit		Solid	Metal	0.14
327	1964 & 1971 Bldgs	27	XRF	3/2/97	1 Room	105	Wall	Hatch	Solid	Metal	0
328	1964 & 1971 Bldgs	28	XRF	3/2/97	1 Room	106	Wall	Wall	Solid	Concrete	0
329	1964 & 1971 Bldgs	29	XRF	3/2/97	1 Room	106	Wall	Wall	Solid	Concrete	0.01
330	1964 & 1971 Bldgs	31	XRF	3/2/97	1 Room	106	Cabinet	Door	Solid	Wood	0
331	1964 & 1971 Bldgs	32	XRF	3/2/97	1 Room	106	Cabinet	Shelf	Solid	Wood	0
332	1964 & 1971 Bldgs	33	XRF	3/2/97	1 Room	106	Ceiling		Solid	Plaster	0.09
333	1964 & 1971 Bldgs	34	XRF	3/2/97	1 Room	106	Soffit		Solid	Metal	0.2
334	1964 & 1971 Bldgs	35	XRF	3/2/97	1 Room	106		Radiator	Solid	Metal	0.24
335	1964 & 1971 Bldgs	36	XRF	3/2/97	1 Room	106	Wall	Diffuser	Solid	Metal	0
336	1964 & 1971 Bldgs	37	XRF	3/2/97	1 Room	106	Wall	Baseboard	Solid	Tile	0.2
337	1964 & 1971 Bldgs	38	XRF	3/2/97	1 Room	106	Door	Door	Solid	Wood	0
338	1964 & 1971 Bldgs	39	XRF	3/2/97	1 Room	106	Door	Jamb	Solid	Metal	0
339	1964 & 1971 Bldgs	154	XRF	3/6/97	1 Room	107	Wall	Midle Wall	Solid	Concrete	0.01
340	1964 & 1971 Bldgs	155	XRF	3/6/97	1 Room	107	Accordian	Door	Solid	Wood	0
341	1964 & 1971 Bldgs	156	XRF	3/6/97	1 Room	107		Hand rail	Solid	Metal	0.07
342	1964 & 1971 Bldgs	157	XRF	3/6/97	1 Room	107	Door	Door	Solid	Wood	0
343	1964 & 1971 Bldgs	158	XRF	3/6/97	1 Room	107	Door	Jamb	Solid	Metal	0.19
344	1964 & 1971 Bldgs	159	XRF	3/6/97	1 Room	107	Door	Header	Solid	Metal	5.09
345	1964 & 1971 Bldgs	160	XRF	3/6/97	1 Room	107	Winch	Support	Solid	Wood	0
346	1964 & 1971 Bldgs	161	XRF	3/6/97	1 Room	107	Winch	Support	Solid	Metal	0
347	1964 & 1971 Bldgs	6	XRF	3/5/97	1 Room	108	Wall	Wall	Solid	Concrete	0.02
348	1964 & 1971 Bldgs	7	XRF	3/5/97	1 Room	108	Wall	Wall	Solid	Concrete	0.01
349	1964 & 1971 Bldgs	8	XRF	3/5/97	1 Room	108	Wall	Wall	Solid	Plaster	0.24
350	1964 & 1971 Bldgs	9	XRF	3/5/97	1 Room	108	Wall	Wall	Solid	Concrete	0.03
351	1964 & 1971 Bldgs	10	XRF	3/5/97	1 Room	108	Wall	Midle Wall	Solid	Plaster	0.22
352	1964 & 1971 Bldgs	11	XRF	3/5/97	1 Room	108	Door	Door	Solid	Wood	0
363	1964 & 1971 Bldgs	12	XRF	3/5/97	1 Room	108	Door	Jamb	Solid	Metal	0.27
354	1964 & 1971 Bldgs	13	XRF	3/5/97	1 Room	108	Window	Casing	Solid	Metal	0
355	1964 & 1971 Bldgs	14	XRF	3/5/97	1 Room	108	Ceiling		Solid	Concrete	0.02
356	1964 & 1971 Bldgs	15	XRF	3/5/97	1 Room	108	Ceiling		Solid	Plaster	0.09
357	1964 & 1971 Bldgs	16	XRF	3/5/97	1 Room	108	Soffit		Solid	Metal	0.39
358	1964 & 1971 Bldgs	17	XRF	3/5/97	1 Room	108		Radiator	Solid	Metal	0.2
359	1964 & 1971 Bldgs	18	XRF	3/5/97	1 Room	108	Bookcase	Shelf	Solid	Wood	0.02
360	1964 & 1971 Bldgs	19	XRF	3/5/97	1 Room	108	Bookcase	Inside	Solid	Wood	0.01
361	1964 & 1971 Bldgs	20	XRF	3/5/97	1 Room	108	Cabinet	Door	Solid	Wood	0
362	1964 & 1971 Bldgs	21	XRF	3/5/97	1 Room	108	Cabinet	Floor	Solid	Wood	0
363	1964 & 1971 Bldgs	22	XRF	3/5/97	1 Room	108	Seat	Back	Solid	Wood	0
364	1964 & 1971 Bldgs	23	XRF	3/5/97	1 Room	108	Support	Post	Solid	Metal	0.14
365	1964 & 1971 Bldgs	40	XRF	3/2/97	1 Room	112	Wall	Wall	Solid	Concrete	0.01
366	1964 & 1971 Bldgs	41	XRF	3/2/97	1 Room	112	Wall	Wall	Solid	Concrete	0.07
367	1964 & 1971 Bldgs	42	XRF	3/2/97	1 Room	112	Wall	Midle Wall	Solid	Concrete	0.09
368	1964 & 1971 Bldgs	43	XRF	3/2/97	1 Room	112	Wall	Wall	Solid	Metal	0.23
369	1964 & 1971 Bldgs	44	XRF	3/2/97	1 Room	112	Door	Door	Solid	Wood	0.01
370	1964 & 1971 Bldgs	45	XRF	3/2/97	1 Room	112	Door	Jamb	Solid	Metal	0.51
371	1964 & 1971 Bldgs	46	XRF	3/2/97	1 Room	112	Ceiling		Solid	Plaster	0.21
372	1964 & 1971 Bldgs	47	XRF	3/2/97	1 Room	112	Soffit		Solid	Metal	0.16
373	1964 & 1971 Bldgs	48	XRF	3/2/97	1 Room	112		Radiator	Solid	Metal	0.13
374	1964 & 1971 Bldgs	49	XRF	3/2/97	1 Room	112	Ceiling		Solid	Concrete	0.02
375	1964 & 1971 Bldgs	50	XRF	3/2/97	1 Room	112	Cabinet	Door	Solid	Wood	0
376	1964 & 1971 Bldgs	51	XRF	3/2/97	1 Room	112	Cabinet	Shelf	Solid	Wood	0.01
377	1964 & 1971 Bldgs	52	XRF	3/2/97	1 Room	112	Accordian	Door	Solid	Wood	0.01
378	1964 & 1971 Bldgs	67	XRF	3/2/97	1 Room	112	Wall	Diffuser	Solid	Metal	0
379	1964 & 1971 Bldgs	68	XRF	3/2/97	1 Room	113	Wall	Wall	Solid	Concrete	0
380	1964 & 1971 Bldgs	69	XRF	3/2/97	1 Room	113	Wall	Wall	Solid	Concrete	0.04
381	1964 & 1971 Bldgs	70	XRF	3/2/97	1 Room	113	Wall	Wall	Solid	Metal	0.39
382	1964 & 1971 Bldgs	71	XRF	3/2/97	1 Room	113	Door	Door	Solid	Wood	0
383	1964 & 1971 Bldgs	72	XRF	3/2/97	1 Room	113	Door	Jamb	Solid	Metal	0.24
384	1964 & 1971 Bldgs	73	XRF	3/2/97	1 Room	113	Accordian	Door	Solid	Wood	0.01

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
385	1964 & 1971 Bldgs	74	XRF	3/2/97	1	Room	113	Ceiling		Solid	Plaster	0.13
386	1964 & 1971 Bldgs	75	XRF	3/2/97	1	Room	113	Soffit		Solid	Metal	0.09
387	1964 & 1971 Bldgs	76	XRF	3/2/97	1	Room	113	Ceiling		Solid	Concrte	0.05
388	1964 & 1971 Bldgs	77	XRF	3/2/97	1	Room	113		Radiator	Solid	Metal	0.1
389	1964 & 1971 Bldgs	78	XRF	3/2/97	1	Room	113	Cabinet	Door	Solid	Wood	0
390	1964 & 1971 Bldgs	79	XRF	3/2/97	1	Room	113	Bookcase	Shelf	Solid	Wood	0
391	1964 & 1971 Bldgs	80	XRF	3/2/97	1	Room	113	Bookcase	Inside	Solid	Wood	0
392	1964 & 1971 Bldgs	90	XRF	3/2/97	1	Room	114	Wall	Wall	Solid	Concrete	0.03
393	1964 & 1971 Bldgs	91	XRF	3/2/97	1	Room	114	Wall	Wall	Solid	Concrete	0.03
394	1964 & 1971 Bldgs	92	XRF	3/2/97	1	Room	114	Wall	Midle Wall	Solid	Drywall	0
395	1964 & 1971 Bldgs	34	XRF	3/5/97	1	Room	114	Door	Door	Solid	Wood	0.01
396	1964 & 1971 Bldgs	35	XRF	3/5/97	1	Room	114	Door	Jamb	Solid	Metal	0.31
397	1964 & 1971 Bldgs	36	XRF	3/5/97	1	Room	114		Radiator	Solid	Metal	0.08
398	1964 & 1971 Bldgs	37	XRF	3/5/97	1	Room	114	Cabinet	Door	Solid	Wood	0
399	1964 & 1971 Bldgs	38	XRF	3/5/97	1	Room	114	Cabinet	Inside	Solid	Wood	0.01
400	1964 & 1971 Bldgs	39	XRF	3/5/97	1	Room	114	Wall	Diffuser	Solid	Metal	0
401	1964 & 1971 Bldgs	46	XRF	3/5/97	1	Room	115	Wall	Wall	Solid	Concrete	0.03
402	1964 & 1971 Bldgs	48	XRF	3/5/97	1	Room	115	Wall	Wall	Solid	Concrete	0.02
403	1964 & 1971 Bldgs	49	XRF	3/5/97	1	Room	115	Wall	Wall	Solid	Metal	0.49
404	1964 & 1971 Bldgs	50	XRF	3/5/97	1	Room	115	Wall	Midle Wall	Solid	Drywall	0
405	1964 & 1971 Bldgs	51	XRF	3/5/97	1	Room	115	Door	Door	Solid	Wood	0
406	1964 & 1971 Bldgs	52	XRF	3/5/97	1	Room	115	Door	Jamb	Solid	Metal	0.23
407	1964 & 1971 Bldgs	53	XRF	3/5/97	1	Room	116	Wall	Wall	Solid	Concrete	0.03
408	1964 & 1971 Bldgs	54	XRF	3/5/97	1	Room	116	Wall	Wall	Solid	Concrete	0.03
409	1964 & 1971 Bldgs	55	XRF	3/5/97	1	Room	116	Wall	Midle Wall	Solid	Drywall	0
410	1964 & 1971 Bldgs	56	XRF	3/5/97	1	Room	116	Door	Door	Solid	Wood	0
411	1964 & 1971 Bldgs	57	XRF	3/5/97	1	Room	116	Door	Jamb	Solid	Metal	0.42
412	1964 & 1971 Bldgs	58	XRF	3/5/97	1	Room	116		Radiator	Solid	Metal	0.07
413	1964 & 1971 Bldgs	59	XRF	3/5/97	1	Room	116	Ceiling		Solid	Concrete	0.03
414	1964 & 1971 Bldgs	60	XRF	3/5/97	1	Room	116	Ceiling		Solid	Plaster	0.03
415	1964 & 1971 Bldgs	61	XRF	3/5/97	1	Room	116	Soffit		Solid	Metal	0.11
416	1964 & 1971 Bldgs	62	XRF	3/5/97	1	Room	116	Bookcase	Shelf	Solid	Wood	0.01
417	1964 & 1971 Bldgs	63	XRF	3/5/97	1	Room	116	Bookcase	Inside	Solid	Wood	0.01
418	1964 & 1971 Bldgs	64	XRF	3/5/97	1	Room	116	Cabinet	Door	Solid	Wood	0.01
419	1964 & 1971 Bldgs	65	XRF	3/5/97	1	Room	116	Cabinet	Shelf	Solid	Wood	0
420	1964 & 1971 Bldgs	72	XRF	3/5/97	1	Room	117	Wall	Wall	Solid	Concrete	0.01
421	1964 & 1971 Bldgs	73	XRF	3/5/97	1	Room	117	Wall	Wall	Solid	Drywall	0.04
422	1964 & 1971 Bldgs	74	XRF	3/5/97	1	Room	117	Door	Door	Solid	Wood	0
423	1964 & 1971 Bldgs	75	XRF	3/5/97	1	Room	117	Door	Jamb	Solid	Wood	0.16
424	1964 & 1971 Bldgs	76	XRF	3/5/97	1	Room	118	Wall	Wall	Solid	Concrete	0.01
425	1964 & 1971 Bldgs	77	XRF	3/5/97	1	Room	118	Wall	Midle Wall	Solid	Drywall	0.03
426	1964 & 1971 Bldgs	78	XRF	3/5/97	1	Room	118	Wall	Midle Wall	Solid	Concrete	0.03
427	1964 & 1971 Bldgs	79	XRF	3/5/97	1	Room	118	Door	Door	Solid	Wood	0.01
428	1964 & 1971 Bldgs	80	XRF	3/5/97	1	Room	118	Door	Jamb	Solid	Metal	0.3
429	1964 & 1971 Bldgs	81	XRF	3/5/97	1	Room	118	Door	Door	Solid	Wood	0
430	1964 & 1971 Bldgs	82	XRF	3/5/97	1	Room	118	Bookcase	Shelf	Solid	Wood	0
431	1964 & 1971 Bldgs	168	XRF	3/14/97	1	Room	120	Wall	Wall	Solid	Concrete	1.6
432	1964 & 1971 Bldgs	169	XRF	3/14/97	1	Room	120	Wall	Wall	Solid	Concrete	1.4
433	1964 & 1971 Bldgs	170	XRF	3/14/97	1	Room	120	Wall	Wall	Solid	Concrete	1.4
434	1964 & 1971 Bldgs	171	XRF	3/14/97	1	Room	120	Wall	Wall	Solid	Concrete	0.93
435	1964 & 1971 Bldgs	172	XRF	3/14/97	1	Room	120	Bench		Solid	Concrete	0.03
436	1964 & 1971 Bldgs	173	XRF	3/14/97	1	Room	120	Bench		Solid	Metal	0.04
437	1964 & 1971 Bldgs	174	XRF	3/14/97	1	Room	120	Wall	Midle Wall	Solid	Plaster	0.01
438	1964 & 1971 Bldgs	175	XRF	3/14/97	1	Room	120	Wall	Midle Wall	Solid	Metal	0.14
439	1964 & 1971 Bldgs	176	XRF	3/14/97	1	Room	120	Wall	Wall	Solid	Concrete	0.02
440	1964 & 1971 Bldgs	166	XRF	3/6/97	1	Room	122	Wall	Midle Wall	Solid	Wood	0.01
441	1964 & 1971 Bldgs	167	XRF	3/6/97	1	Room	122	Wall	Midle Wall	Solid	Wood	0.03
442	1964 & 1971 Bldgs	168	XRF	3/6/97	1	Room	122	Wall	Midle Wall	Solid	Tile	5.09
443	1964 & 1971 Bldgs	169	XRF	3/6/97	1	Room	122	Wall	Midle Wall	Solid	Wood	0.02
444	1964 & 1971 Bldgs	170	XRF	3/6/97	1	Room	122	Door	Door	Solid	Wood	0
445	1964 & 1971 Bldgs	171	XRF	3/6/97	1	Room	122	Door	Jamb	Solid	Metal	0.02
446	1964 & 1971 Bldgs	172	XRF	3/6/97	1	Room	122	Floor		Solid	Wood	0
447	1964 & 1971 Bldgs	173	XRF	3/6/97	1	Room	122	Cabinet	Shelf	Solid	Wood	0
448	1964 & 1971 Bldgs	6	XRF	3/6/97	1	Room	124	Wall	Wall	Solid	Concrete	0

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
449	1964 & 1971 Bldgs	7	XRF	3/6/97	1	Room	124	Wall	Wall	Solid	Concrte	0.01
450	1964 & 1971 Bldgs	8	XRF	3/6/97	1	Room	124	Wall	Wall	Solid	Concrte	0.01
451	1964 & 1971 Bldgs	9	XRF	3/6/97	1	Room	124	Wall	Midle Wall	Solid	Concrte	0.04
452	1964 & 1971 Bldgs	10	XRF	3/6/97	1	Room	124	Wall	Midle Wall	Solid	Concrte	0.01
453	1964 & 1971 Bldgs	11	XRF	3/6/97	1	Room	124	Door	Door	Solid	Wood	0
454	1964 & 1971 Bldgs	12	XRF	3/6/97	1	Room	124	Door	Jamb	Solid	Metal	0.19
455	1964 & 1971 Bldgs	13	XRF	3/6/97	1	Room	124	Wall	Midle Wall	Solid	Metal	0.69
456	1964 & 1971 Bldgs	14	XRF	3/6/97	1	Room	124	Cork	Board	Solid	Wood	0.94
457	1964 & 1971 Bldgs	15	XRF	3/6/97	1	Room	124	Ceiling		Solid	Plaster	0.06
458	1964 & 1971 Bldgs	16	XRF	3/6/97	1	Room	124	Soffit		Solid	Metal	0.31
459	1964 & 1971 Bldgs	17	XRF	3/6/97	1	Room	124	Wall	Baseboard	Solid	Tile	1.66
460	1964 & 1971 Bldgs	18	XRF	3/6/97	1	Room	124	Wall	Hatch	Solid	Metal	0.01
461	1964 & 1971 Bldgs	19	XRF	3/6/97	1	Room	124	Cabinet	Door	Solid	Wood	0
462	1964 & 1971 Bldgs	20	XRF	3/6/97	1	Room	124	Cabinet	Shelf	Solid	Wood	0
463	1964 & 1971 Bldgs	162	XRF	3/6/97	1	Room	125	Wall	Wall	Solid	Concrte	0.01
464	1964 & 1971 Bldgs	163	XRF	3/6/97	1	Room	125	Door	Header	Solid	Metal	5.09
465	1964 & 1971 Bldgs	164	XRF	3/6/97	1	Room	125		Hand rail	Solid	Metal	0.01
466	1964 & 1971 Bldgs	165	XRF	3/6/97	1	Room	125	Accordian	Door	Solid	Wood	0
467	1964 & 1971 Bldgs	84	XRF	3/13/97	0	Room	131	Wall	Wall	Solid	Concrte	0.01
468	1964 & 1971 Bldgs	85	XRF	3/13/97	0	Room	131	Wall	Midle Wall	Solid	Concrte	0.3
469	1964 & 1971 Bldgs	86	XRF	3/13/97	0	Room	131	Wall	Midle Wall	Solid	Concrte	0.05
470	1964 & 1971 Bldgs	87	XRF	3/13/97	0	Room	131	Wall	Midle Wall	Solid	Concrte	0.02
471	1964 & 1971 Bldgs	88	XRF	3/13/97	0	Room	131	Wall	Midle Wall	Solid	Concrte	0.02
472	1964 & 1971 Bldgs	89	XRF	3/13/97	0	Room	131	Ceiling		Solid	Concrte	0
473	1964 & 1971 Bldgs	90	XRF	3/13/97	0	Room	131	Door	Door	Solid	Wood	0.01
474	1964 & 1971 Bldgs	91	XRF	3/13/97	0	Room	131	Door	Jamb	Solid	Metal	0.27
475	1964 & 1971 Bldgs	92	XRF	3/13/97	0	Room	131	Door	Header	Solid	Metal	5.09
476	1964 & 1971 Bldgs	34	XRF	3/13/97	0	Room	160	Wall	Wall	Solid	Concrte	0
477	1964 & 1971 Bldgs	35	XRF	3/13/97	0	Room	160	Wall	Midle Wall	Solid	Concrte	0.01
478	1964 & 1971 Bldgs	36	XRF	3/13/97	0	Room	160	Wall	Wall	Solid	Concrte	0.01
479	1964 & 1971 Bldgs	37	XRF	3/13/97	0	Room	160	Door	Door	Solid	Wood	0.23
480	1964 & 1971 Bldgs	38	XRF	3/13/97	0	Room	160	Door	Jamb	Solid	Metal	0.37
481	1964 & 1971 Bldgs	39	XRF	3/13/97	0	Room	160	Door	Door	Solid	Wood	0
482	1964 & 1971 Bldgs	40	XRF	3/13/97	0	Room	160	Door	Jamb	Solid	Metal	0.26
483	1964 & 1971 Bldgs	41	XRF	3/13/97	0	Room	160	Speaker	Cover	Solid	Metal	0.01
484	1964 & 1971 Bldgs	42	XRF	3/13/97	0	Room	160	Wall	Wall Rgstr	Solid	Metal	0
485	1964 & 1971 Bldgs	43	XRF	3/13/97	0	Room	160	Wall	Wall	Solid	Concrte	0.01
486	1964 & 1971 Bldgs	44	XRF	3/13/97	0	Room	160	Wall	Baseboard	Solid	Concrte	0.02
487	1964 & 1971 Bldgs	45	XRF	3/13/97	0	Room	160	Locker		Solid	Metal	0.01
488	1964 & 1971 Bldgs	46	XRF	3/13/97	0	Room	160	Bench		Solid	Wood	0
489	1964 & 1971 Bldgs	48	XRF	3/13/97	0	Room	160		Hand rail	Solid	Metal	0
490	1964 & 1971 Bldgs	52	XRF	2/26/97	2	Room	201	Wall	Wall	Solid	Concrte	0.03
491	1964 & 1971 Bldgs	53	XRF	2/26/97	2	Room	201	Wall	Wall	Solid	Concrte	0.01
492	1964 & 1971 Bldgs	54	XRF	2/26/97	2	Room	201	Door	Door	Solid	Wood	0
493	1964 & 1971 Bldgs	55	XRF	2/26/97	2	Room	201	Door	Jamb	Solid	Wood	0.23
494	1964 & 1971 Bldgs	56	XRF	2/26/97	2	Room	201	Wall	Midle Wall	Solid	Metal	0.26
495	1964 & 1971 Bldgs	57	XRF	2/26/97	2	Room	201	Wall	Midle Wall	Solid	Concrte	0.02
496	1964 & 1971 Bldgs	58	XRF	2/26/97	2	Room	201	Wall	Baseboard	Solid	Tile	0.91
497	1964 & 1971 Bldgs	59	XRF	2/26/97	2	Room	201		Radiator	Solid	Metal	0.16
498	1964 & 1971 Bldgs	60	XRF	2/26/97	2	Room	201	Ceiling		Solid	Plaster	0.1
499	1964 & 1971 Bldgs	61	XRF	2/26/97	2	Room	201	Soffit		Solid	Plaster	0.16
500	1964 & 1971 Bldgs	62	XRF	2/26/97	2	Room	201	Cabinet	Outside	Solid	Wood	0
501	1964 & 1971 Bldgs	63	XRF	2/26/97	2	Room	201	Cabinet	Door	Solid	Wood	0
502	1964 & 1971 Bldgs	64	XRF	2/26/97	2	Room	202	Wall	Wall	Solid	Concrte	0.01
503	1964 & 1971 Bldgs	65	XRF	2/26/97	2	Room	202	Wall	Wall	Solid	Concrte	0.01
504	1964 & 1971 Bldgs	66	XRF	2/26/97	2	Room	202	Wall	Midle Wall	Solid	Concrte	0.12
505	1964 & 1971 Bldgs	67	XRF	2/26/97	2	Room	202	Wall	Wall	Solid	Metal	0.36
506	1964 & 1971 Bldgs	68	XRF	2/26/97	2	Room	202	Door	Door	Solid	Wood	0
507	1964 & 1971 Bldgs	69	XRF	2/26/97	2	Room	202	Door	Jamb	Solid	Metal	0.16
508	1964 & 1971 Bldgs	70	XRF	2/26/97	2	Room	202	Wall	Baseboard	Solid	Tile	1.71
509	1964 & 1971 Bldgs	71	XRF	2/26/97	2	Room	202		Radiator	Solid	Metal	0.37
510	1964 & 1971 Bldgs	72	XRF	2/26/97	2	Room	202	Ceiling		Solid	Plaster	0.03
511	1964 & 1971 Bldgs	73	XRF	2/26/97	2	Room	202	Soffit		Solid	Metal	0.14
512	1964 & 1971 Bldgs	74	XRF	2/26/97	2	Room	202	Wall	Midle Wall	Solid	Wood	0

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
513	1964 & 1971 Bldgs	75	XRF	2/26/97	2	Room	202	Cabinet	Outside	Solid	Wood	0
514	1964 & 1971 Bldgs	76	XRF	2/26/97	2	Room	202	Cabinet	Door	Solid	Wood	0.01
515	1964 & 1971 Bldgs	78	XRF	2/26/97	2	Room	203	Wall	Wall	Solid	Concrete	0.01
516	1964 & 1971 Bldgs	79	XRF	2/26/97	2	Room	203	Wall	Wall	Solid	Concrete	0.03
517	1964 & 1971 Bldgs	80	XRF	2/26/97	2	Room	203	Ceiling		Solid	Concrete	0.01
518	1964 & 1971 Bldgs	81	XRF	2/26/97	2	Room	203	Door	Door	Solid	Wood	0.01
519	1964 & 1971 Bldgs	82	XRF	2/26/97	2	Room	203	Door	Jamb	Solid	Metal	0.21
520	1964 & 1971 Bldgs	83	XRF	2/26/97	2	Room	203	Wall	Baseboard	Solid	Tile	1.56
521	1964 & 1971 Bldgs	84	XRF	2/26/97	2	Room	203		Radiator	Solid	Metal	0.58
522	1964 & 1971 Bldgs	85	XRF	2/26/97	2	Room	203	Ceiling		Solid	Plaster	0.11
523	1964 & 1971 Bldgs	86	XRF	2/26/97	2	Room	203	Soffit		Solid	Metal	0.24
524	1964 & 1971 Bldgs	87	XRF	2/26/97	2	Room	203	Cabinet	Outside	Solid	Wood	0
525	1964 & 1971 Bldgs	88	XRF	2/26/97	2	Room	203	Cabinet	Door	Solid	Wood	0
526	1964 & 1971 Bldgs	89	XRF	2/26/97	2	Room	204	Wall	Wall	Solid	Concrete	0.01
527	1964 & 1971 Bldgs	90	XRF	2/26/97	2	Room	204	Wall	Wall	Solid	Concrete	0.01
528	1964 & 1971 Bldgs	91	XRF	2/26/97	2	Room	204	Wall	Midle Wall	Solid	Metal	0.28
529	1964 & 1971 Bldgs	92	XRF	2/26/97	2	Room	204	Door	Door	Solid	Wood	0.01
530	1964 & 1971 Bldgs	93	XRF	2/26/97	2	Room	204	Door	Jamb	Solid	Metal	0
531	1964 & 1971 Bldgs	94	XRF	2/26/97	2	Room	204		Radiator	Solid	Metal	0.21
532	1964 & 1971 Bldgs	95	XRF	2/26/97	2	Room	204	Ceiling		Solid	Concrete	0.08
533	1964 & 1971 Bldgs	96	XRF	2/26/97	2	Room	204	Ceiling		Solid	Concrete	0.07
534	1964 & 1971 Bldgs	97	XRF	2/26/97	2	Room	204	Soffit		Solid	Metal	0.24
535	1964 & 1971 Bldgs	98	XRF	2/26/97	2	Room	204	Cabinet	Outside	Solid	Wood	0.01
536	1964 & 1971 Bldgs	99	XRF	2/26/97	2	Room	204	Cabinet	Door	Solid	Wood	0
537	1964 & 1971 Bldgs	100	XRF	2/26/97	2	Room	205	Wall	Wall	Solid	Concrete	0.01
538	1964 & 1971 Bldgs	101	XRF	2/26/97	2	Room	205	Wall	Midle Wall	Solid	Concrete	0.02
539	1964 & 1971 Bldgs	102	XRF	2/26/97	2	Room	205	Wall	Wall	Solid	Metal	0.38
540	1964 & 1971 Bldgs	103	XRF	2/26/97	2	Room	205	Door	Door	Solid	Wood	0
541	1964 & 1971 Bldgs	104	XRF	2/26/97	2	Room	205	Door	Jamb	Solid	Metal	0.17
542	1964 & 1971 Bldgs	105	XRF	2/26/97	2	Room	205	Window	Panel	Solid	Wood	0
543	1964 & 1971 Bldgs	106	XRF	2/26/97	2	Room	205	Ceiling		Solid	Concrete	0.01
544	1964 & 1971 Bldgs	107	XRF	2/26/97	2	Room	205	Ceiling		Solid	Plaster	0.02
545	1964 & 1971 Bldgs	108	XRF	2/26/97	2	Room	205	Soffit		Solid	Metal	0.23
546	1964 & 1971 Bldgs	109	XRF	2/26/97	2	Room	205		Radiator	Solid	Metal	0.13
547	1964 & 1971 Bldgs	110	XRF	2/26/97	2	Room	205	Cabinet	Outside	Solid	Wood	0
548	1964 & 1971 Bldgs	111	XRF	2/26/97	2	Room	205	Cabinet	Door	Solid	Wood	0
549	1964 & 1971 Bldgs	112	XRF	2/26/97	2	Room	206	Wall	Wall	Solid	Concrete	0.02
550	1964 & 1971 Bldgs	113	XRF	2/26/97	2	Room	206	Wall	Wall	Solid	Concrete	0.05
551	1964 & 1971 Bldgs	114	XRF	2/26/97	2	Room	206	Wall	Wall	Solid	Metal	0.22
552	1964 & 1971 Bldgs	115	XRF	2/26/97	2	Room	206	Door	Door	Solid	Wood	0
553	1964 & 1971 Bldgs	116	XRF	2/26/97	2	Room	206	Door	Jamb	Solid	Metal	0.11
554	1964 & 1971 Bldgs	117	XRF	2/26/97	2	Room	206	Wall	Baseboard	Solid	Tile	1.26
555	1964 & 1971 Bldgs	118	XRF	2/26/97	2	Room	206		Radiator	Solid	Metal	0.34
556	1964 & 1971 Bldgs	119	XRF	2/26/97	2	Room	206	Ceiling		Solid	Concrete	0.01
557	1964 & 1971 Bldgs	120	XRF	2/26/97	2	Room	206	Ceiling		Solid	Plaster	0.11
558	1964 & 1971 Bldgs	121	XRF	2/26/97	2	Room	206	Ceiling		Solid	Plaster	0.07
559	1964 & 1971 Bldgs	122	XRF	2/26/97	2	Room	206	Soffit		Solid	Metal	0.14
560	1964 & 1971 Bldgs	124	XRF	2/26/97	2	Room	206	Cabinet	Door	Solid	Wood	0
561	1964 & 1971 Bldgs	125	XRF	2/26/97	2	Room	206	Cabinet	Shelf	Solid	Wood	0.01
562	1964 & 1971 Bldgs	135	XRF	2/26/97	2	Room	207	Wall	Wall	Solid	Concrete	0.02
563	1964 & 1971 Bldgs	136	XRF	2/26/97	2	Room	207	Wall	Wall	Solid	Concrete	0.02
564	1964 & 1971 Bldgs	137	XRF	2/26/97	2	Room	207	Door	Door	Solid	Wood	0
565	1964 & 1971 Bldgs	138	XRF	2/26/97	2	Room	207	Door	Jamb	Solid	Metal	0.3
566	1964 & 1971 Bldgs	139	XRF	2/26/97	2	Room	207	Wall	Wall	Solid	Metal	0.4
567	1964 & 1971 Bldgs	140	XRF	2/26/97	2	Room	207		Radiator	Solid	Metal	0.13
568	1964 & 1971 Bldgs	6	XRF	2/28/97	2	Room	207	Soffit		Solid	Plaster	0.07
569	1964 & 1971 Bldgs	7	XRF	2/28/97	2	Room	207	Ceiling		Solid	Plaster	0.1
570	1964 & 1971 Bldgs	8	XRF	2/28/97	2	Room	207	Soffit		Solid	Metal	0.17
571	1964 & 1971 Bldgs	9	XRF	2/28/97	2	Room	207	Wall	Baseboard	Solid	Tile	1.39
572	1964 & 1971 Bldgs	13	XRF	2/28/97	2	Room	207	Cabinet	Outside	Solid	Wood	0
573	1964 & 1971 Bldgs	14	XRF	2/28/97	2	Room	207	Cabinet	Door	Solid	Wood	0
574	1964 & 1971 Bldgs	15	XRF	2/28/97	2	Room	208	Wall	Wall	Solid	Concrete	0.01
575	1964 & 1971 Bldgs	16	XRF	2/28/97	2	Room	208	Wall	Wall	Solid	Concrete	0.05
576	1964 & 1971 Bldgs	17	XRF	2/28/97	2	Room	208	Door	Door	Solid	Wood	0.01

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
577	1964 & 1971 Bldgs	18	XRF	2/28/97	2 Room	208	Door	Jamb	Solid	Metal	0.28	
578	1964 & 1971 Bldgs	19	XRF	2/28/97	2 Room	208	Ceiling		Solid	Concrete	0.02	
579	1964 & 1971 Bldgs	20	XRF	2/28/97	2 Room	208	Wall	Wall	Solid	Metal	0.29	
580	1964 & 1971 Bldgs	21	XRF	2/28/97	2 Room	208	Soffit		Solid	Plaster	0.05	
581	1964 & 1971 Bldgs	22	XRF	2/28/97	2 Room	208	Soffit		Solid	Metal	0.14	
582	1964 & 1971 Bldgs	23	XRF	2/28/97	2 Room	208		Radiator	Solid	Metal	0.31	
583	1964 & 1971 Bldgs	24	XRF	2/28/97	2 Room	208	Cabinet	Door	Solid	Wood	0	
584	1964 & 1971 Bldgs	25	XRF	2/28/97	2 Room	208	Cabinet	Outside	Solid	Wood	0	
585	1964 & 1971 Bldgs	26	XRF	2/28/97	2 Room	209	Wall	Wall	Solid	Concrete	0.01	
586	1964 & 1971 Bldgs	27	XRF	2/28/97	2 Room	209	Wall	Wall	Solid	Concrete	0.04	
587	1964 & 1971 Bldgs	28	XRF	2/28/97	2 Room	209	Wall	Wall	Solid	Metal	0.31	
588	1964 & 1971 Bldgs	29	XRF	2/28/97	2 Room	209	Door	Door	Solid	Wood	0	
589	1964 & 1971 Bldgs	30	XRF	2/28/97	2 Room	209	Door	Jamb	Solid	Metal	0.15	
590	1964 & 1971 Bldgs	31	XRF	2/28/97	2 Room	209	Ceiling	Jamb	Solid	Concrete	0.07	
591	1964 & 1971 Bldgs	32	XRF	2/28/97	2 Room	209	Soffit		Solid	Plaster	0.09	
592	1964 & 1971 Bldgs	33	XRF	2/28/97	2 Room	209	Soffit		Solid	Metal	0.2	
593	1964 & 1971 Bldgs	34	XRF	2/28/97	2 Room	209		Radiator	Solid	Metal	0.22	
594	1964 & 1971 Bldgs	35	XRF	2/28/97	2 Room	209	Wall	Baseboard	Solid	Tile	1.26	
595	1964 & 1971 Bldgs	36	XRF	2/28/97	2 Room	209	Cabinet	Outside	Solid	Wood	0.01	
596	1964 & 1971 Bldgs	37	XRF	2/28/97	2 Room	209	Cabinet	Door	Solid	Wood	0.01	
597	1964 & 1971 Bldgs	38	XRF	2/28/97	2 Room	210	Wall	Wall	Solid	Concrete	0.03	
598	1964 & 1971 Bldgs	39	XRF	2/28/97	2 Room	210	Wall	Wall	Solid	Concrete	0.03	
599	1964 & 1971 Bldgs	40	XRF	2/28/97	2 Room	210	Wall	Wall	Solid	Metal	0.42	
600	1964 & 1971 Bldgs	41	XRF	2/28/97	2 Room	210	Door	Door	Solid	Wood	0	
601	1964 & 1971 Bldgs	42	XRF	2/28/97	2 Room	210	Door	Jamb	Solid	Metal	0.2	
602	1964 & 1971 Bldgs	43	XRF	2/28/97	2 Room	210	Ceiling		Solid	Concrete	0.03	
603	1964 & 1971 Bldgs	44	XRF	2/28/97	2 Room	210	Soffit		Solid	Plaster	0.14	
604	1964 & 1971 Bldgs	45	XRF	2/28/97	2 Room	210	Soffit		Solid	Metal	0.15	
605	1964 & 1971 Bldgs	46	XRF	2/28/97	2 Room	210		Radiator	Solid	Metal	0.1	
606	1964 & 1971 Bldgs	47	XRF	2/28/97	2 Room	210	Cabinet	Door	Solid	Wood	0	
607	1964 & 1971 Bldgs	48	XRF	2/28/97	2 Room	210	Cabinet	Outside	Solid	Wood	0	
608	1964 & 1971 Bldgs	49	XRF	2/28/97	2 Room	210	Wall	Baseboard	Solid	Tile	1.5	
609	1964 & 1971 Bldgs	51	XRF	2/28/97	2 Room	211	Wall	Wall	Solid	Concrete	0.01	
610	1964 & 1971 Bldgs	52	XRF	2/28/97	2 Room	211	Wall	Wall	Solid	Concrete	0.03	
611	1964 & 1971 Bldgs	53	XRF	2/28/97	2 Room	211	Wall	Wall	Solid	Concrete	0.02	
612	1964 & 1971 Bldgs	54	XRF	2/28/97	2 Room	211	Wall	Wall	Solid	Metal	0.28	
613	1964 & 1971 Bldgs	55	XRF	2/28/97	2 Room	211	Door	Door	Solid	Wood	0	
614	1964 & 1971 Bldgs	56	XRF	2/28/97	2 Room	211	Door	Jamb	Solid	Metal	0.1	
615	1964 & 1971 Bldgs	57	XRF	2/28/97	2 Room	211	Ceiling		Solid	Concrete	0.03	
616	1964 & 1971 Bldgs	58	XRF	2/28/97	2 Room	211	Ceiling		Solid	Plaster	0.14	
617	1964 & 1971 Bldgs	59	XRF	2/28/97	2 Room	211	Soffit		Solid	Metal	0.16	
618	1964 & 1971 Bldgs	60	XRF	2/28/97	2 Room	211		Radiator	Solid	Metal	0.35	
619	1964 & 1971 Bldgs	61	XRF	2/28/97	2 Room	211	Bulletin	Board	Solid	Wood	0.99	
620	1964 & 1971 Bldgs	62	XRF	2/28/97	2 Room	211	Cabinet	Door	Solid	Wood	0	
621	1964 & 1971 Bldgs	63	XRF	2/28/97	2 Room	211	Cabinet	Outside	Solid	Wood	0.01	
622	1964 & 1971 Bldgs	19	XRF	3/13/97	0 Room	211	Wall	Wall	Solid	Concrete	0.01	
623	1964 & 1971 Bldgs	20	XRF	3/13/97	0 Room	211	Wall	Wall	Solid	Concrete	0	
624	1964 & 1971 Bldgs	21	XRF	3/13/97	0 Room	211	Wall	Wall	Solid	Concrete	0.01	
625	1964 & 1971 Bldgs	22	XRF	3/13/97	0 Room	211	Column		Solid	Concrete	0.01	
626	1964 & 1971 Bldgs	23	XRF	3/13/97	0 Room	211	Wall	Midle Wall	Solid	Tile	1.39	
627	1964 & 1971 Bldgs	24	XRF	3/13/97	0 Room	211	Door	Door	Solid	Wood	0	
628	1964 & 1971 Bldgs	25	XRF	3/13/97	0 Room	211	Door	Jamb	Solid	Metal	0.22	
629	1964 & 1971 Bldgs	26	XRF	3/13/97	0 Room	211	Ceiling		Solid	Plaster	0.01	
630	1964 & 1971 Bldgs	27	XRF	3/13/97	0 Room	211	Ceiling	Diffuser	Solid	Metal	0	
631	1964 & 1971 Bldgs	28	XRF	3/13/97	0 Room	211	Locker		Solid	Metal	0	
632	1964 & 1971 Bldgs	29	XRF	3/13/97	0 Room	211	Locker		Solid	Metal	0.02	
633	1964 & 1971 Bldgs	30	XRF	3/13/97	0 Room	211	Bench		Solid	Metal	0.23	
634	1964 & 1971 Bldgs	31	XRF	3/13/97	0 Room	211	Bookcase	Bracket	Solid	Metal	0.05	
635	1964 & 1971 Bldgs	32	XRF	3/13/97	0 Room	211	Ceiling		Solid	Concrete	0.01	
636	1964 & 1971 Bldgs	33	XRF	3/13/97	0 Room	211	Wall	Wall Rgstr	Solid	Metal	0	
637	1964 & 1971 Bldgs	64	XRF	2/28/97	2 Room	212	Wall	Wall	Solid	Concrete	0.02	
638	1964 & 1971 Bldgs	65	XRF	2/28/97	2 Room	212	Wall	Wall	Solid	Concrete	0.05	
639	1964 & 1971 Bldgs	66	XRF	2/28/97	2 Room	212	Wall	Wall	Solid	Metal	0.36	
640	1964 & 1971 Bldgs	67	XRF	2/28/97	2 Room	212	Door	Door	Solid	Wood	0.01	

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
641	1964 & 1971 Bldgs	68	XRF	2/28/97	2 Room	212	Door	Jamb	Solid	Metal	0.14	
642	1964 & 1971 Bldgs	69	XRF	2/28/97	2 Room	212	Ceiling		Solid	Concrete	0.02	
643	1964 & 1971 Bldgs	70	XRF	2/28/97	2 Room	212	Soffit		Solid	Plaster	0.05	
644	1964 & 1971 Bldgs	71	XRF	2/28/97	2 Room	212	Soffit		Solid	Metal	0.13	
645	1964 & 1971 Bldgs	72	XRF	2/28/97	2 Room	212		Radiator	Solid	Metal	0.16	
646	1964 & 1971 Bldgs	73	XRF	2/28/97	2 Room	212	Cabinet	Door	Solid	Wood	0.02	
647	1964 & 1971 Bldgs	74	XRF	2/28/97	2 Room	212	Cabinet	Outside	Solid	Wood	0	
648	1964 & 1971 Bldgs	75	XRF	2/28/97	2 Room	212	Wall	Baseboard	Solid	Tile	0.83	
649	1964 & 1971 Bldgs	83	XRF	2/28/97	2 Room	213	Wall	Wall	Solid	Concrete	0.02	
650	1964 & 1971 Bldgs	84	XRF	2/28/97	2 Room	213	Wall	Wall	Solid	Concrete	0.02	
651	1964 & 1971 Bldgs	85	XRF	2/28/97	2 Room	213	Wall	Wall	Solid	Metal	0.51	
652	1964 & 1971 Bldgs	86	XRF	2/28/97	2 Room	213	Door	Door	Solid	Wood	0.01	
653	1964 & 1971 Bldgs	87	XRF	2/28/97	2 Room	213	Door	Jamb	Solid	Metal	0.14	
654	1964 & 1971 Bldgs	88	XRF	2/28/97	2 Room	213	Ceiling		Solid	Concrete	0.02	
655	1964 & 1971 Bldgs	89	XRF	2/28/97	2 Room	213	Soffit		Solid	Plaster	0.03	
656	1964 & 1971 Bldgs	90	XRF	2/28/97	2 Room	213	Soffit		Solid	Metal	0.11	
657	1964 & 1971 Bldgs	91	XRF	2/28/97	2 Room	213		Radiator	Solid	Metal	0.12	
658	1964 & 1971 Bldgs	92	XRF	2/28/97	2 Room	213	Cabinet	Outside	Solid	Wood	0.01	
659	1964 & 1971 Bldgs	93	XRF	2/28/97	2 Room	213	Cabinet	Door	Solid	Wood	0.01	
660	1964 & 1971 Bldgs	99	XRF	2/28/97	2 Room	214	Wall	Wall	Solid	Concrete	0.06	
661	1964 & 1971 Bldgs	100	XRF	2/28/97	2 Room	214	Wall	Wall	Solid	Concrete	0.01	
662	1964 & 1971 Bldgs	101	XRF	2/28/97	2 Room	214	Wall	Wall	Solid	Metal	0.29	
663	1964 & 1971 Bldgs	102	XRF	2/28/97	2 Room	214	Door	Door	Solid	Wood	0.01	
664	1964 & 1971 Bldgs	103	XRF	2/28/97	2 Room	214	Door	Jamb	Solid	Metal	0.18	
665	1964 & 1971 Bldgs	104	XRF	2/28/97	2 Room	214	Ceiling		Solid	Concrete	0.04	
666	1964 & 1971 Bldgs	105	XRF	2/28/97	2 Room	214	Soffit		Solid	Plaster	0.12	
667	1964 & 1971 Bldgs	106	XRF	2/28/97	2 Room	214	Soffit		Solid	Metal	0.17	
668	1964 & 1971 Bldgs	107	XRF	2/28/97	2 Room	214		Radiator	Solid	Metal	0.31	
669	1964 & 1971 Bldgs	108	XRF	2/28/97	2 Room	214	Wall	Baseboard	Solid	Tile	1.64	
670	1964 & 1971 Bldgs	109	XRF	2/28/97	2 Room	214	Cabinet	Door	Solid	Wood	0.01	
671	1964 & 1971 Bldgs	110	XRF	2/28/97	2 Room	214	Cabinet	Shelf	Solid	Wood	0.01	
672	1964 & 1971 Bldgs	111	XRF	2/28/97	2 Room	215	Wall	Wall	Solid	Concrete	0.04	
673	1964 & 1971 Bldgs	112	XRF	2/28/97	2 Room	215	Wall	Wall	Solid	Concrete	0.02	
674	1964 & 1971 Bldgs	113	XRF	2/28/97	2 Room	215	Door	Door	Solid	Wood	0.01	
675	1964 & 1971 Bldgs	114	XRF	2/28/97	2 Room	215	Door	Jamb	Solid	Metal	0.13	
676	1964 & 1971 Bldgs	115	XRF	2/28/97	2 Room	215	Ceiling		Solid	Concrete	0.02	
677	1964 & 1971 Bldgs	116	XRF	2/28/97	2 Room	215	Soffit		Solid	Plaster	0.07	
678	1964 & 1971 Bldgs	117	XRF	2/28/97	2 Room	215	Soffit		Solid	Metal	0.1	
679	1964 & 1971 Bldgs	118	XRF	2/28/97	2 Room	215		Radiator	Solid	Metal	0.16	
680	1964 & 1971 Bldgs	119	XRF	2/28/97	2 Room	215	Cabinet	Door	Solid	Wood	0	
681	1964 & 1971 Bldgs	120	XRF	2/28/97	2 Room	215	Cabinet	Outside	Solid	Wood	0.01	
682	1964 & 1971 Bldgs	121	XRF	2/28/97	2 Room	216	Wall	Wall	Solid	Concrete	0.06	
683	1964 & 1971 Bldgs	122	XRF	2/28/97	2 Room	216	Wall	Wall	Solid	Concrete	0.04	
684	1964 & 1971 Bldgs	123	XRF	2/28/97	2 Room	216	Wall	Wall	Solid	Metal	0.29	
685	1964 & 1971 Bldgs	124	XRF	2/28/97	2 Room	216	Door	Door	Solid	Wood	0.01	
686	1964 & 1971 Bldgs	125	XRF	2/28/97	2 Room	216	Door	Jamb	Solid	Metal	0.13	
687	1964 & 1971 Bldgs	126	XRF	2/28/97	2 Room	216	Ceiling		Solid	Concrete	0.02	
688	1964 & 1971 Bldgs	127	XRF	2/28/97	2 Room	216	Soffit		Solid	Plaster	0.1	
689	1964 & 1971 Bldgs	128	XRF	2/28/97	2 Room	216	Soffit		Solid	Metal	0.11	
690	1964 & 1971 Bldgs	129	XRF	2/28/97	2 Room	216		Radiator	Solid	Metal	0.54	
691	1964 & 1971 Bldgs	130	XRF	2/28/97	2 Room	216	Wall	Baseboard	Solid	Tile	1.5	
692	1964 & 1971 Bldgs	131	XRF	2/28/97	2 Room	216	Cabinet	Door	Solid	Wood	0	
693	1964 & 1971 Bldgs	132	XRF	2/28/97	2 Room	216	Cabinet	Outside	Solid	Wood	0	
694	1964 & 1971 Bldgs	134	XRF	2/28/97	2 Room	217	Chalkboard	Rail	Solid	Wood	0.96	
695	1964 & 1971 Bldgs	135	XRF	2/28/97	2 Room	217	Wall	Wall	Solid	Concrete	0.04	
696	1964 & 1971 Bldgs	136	XRF	2/28/97	2 Room	217	Wall	Wall	Solid	Concrete	0.02	
697	1964 & 1971 Bldgs	137	XRF	2/28/97	2 Room	217	Wall	Wall	Solid	Wood	1.22	
698	1964 & 1971 Bldgs	138	XRF	2/28/97	2 Room	217	Wall	Wall	Solid	Metal	0.22	
699	1964 & 1971 Bldgs	139	XRF	2/28/97	2 Room	217	Wall	Midle Wall	Solid	Metal	0.21	
700	1964 & 1971 Bldgs	140	XRF	2/28/97	2 Room	217	Door	Door	Solid	Wood	0.01	
701	1964 & 1971 Bldgs	141	XRF	2/28/97	2 Room	217	Door	Jamb	Solid	Metal	0.13	
702	1964 & 1971 Bldgs	142	XRF	2/28/97	2 Room	217	Ceiling		Solid	Concrete	0.02	
703	1964 & 1971 Bldgs	143	XRF	2/28/97	2 Room	217	Soffit		Solid	Plaster	0.09	
704	1964 & 1971 Bldgs	144	XRF	2/28/97	2 Room	217	Soffit		Solid	Metal	0.17	

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
705	1964 & 1971 Bldgs	145	XRF	2/28/97	2	Room	217		Radiator	Solid	Metal	0.3
706	1964 & 1971 Bldgs	146	XRF	2/28/97	2	Room	217	Cabinet	Outside	Solid	Wood	0
707	1964 & 1971 Bldgs	147	XRF	2/28/97	2	Room	217	Cabinet	Door	Solid	Wood	0.01
708	1964 & 1971 Bldgs	153	XRF	2/28/97	2	Room	218	Wall	Wall	Solid	Concrete	0.02
709	1964 & 1971 Bldgs	154	XRF	2/28/97	2	Room	218	Wall	Wall	Solid	Concrete	1.26
710	1964 & 1971 Bldgs	155	XRF	2/28/97	2	Room	218	Wall	Wall	Solid	Concrete	0.02
711	1964 & 1971 Bldgs	156	XRF	2/28/97	2	Room	218	Wall	Midle Wall	Solid	Plaster	0.04
712	1964 & 1971 Bldgs	157	XRF	2/28/97	2	Room	218	Door	Door	Solid	Wood	0.01
713	1964 & 1971 Bldgs	158	XRF	2/28/97	2	Room	218	Door	Jamb	Solid	Metal	0.34
714	1964 & 1971 Bldgs	159	XRF	2/28/97	2	Room	218	Ceiling		Solid	Plaster	0.06
715	1964 & 1971 Bldgs	160	XRF	2/28/97	2	Room	218	Cabinet	Door	Solid	Wood	0
716	1964 & 1971 Bldgs	161	XRF	2/28/97	2	Room	218	Cabinet	Shelf	Solid	Wood	0.01
717	1964 & 1971 Bldgs	162	XRF	2/28/97	2	Room	218	Wall	Baseboard	Solid	Tile	0.88
718	1964 & 1971 Bldgs	163	XRF	2/28/97	2	Room	219	Wall	Midle Wall	Solid	Drywall	0.03
719	1964 & 1971 Bldgs	164	XRF	2/28/97	2	Room	219	Wall	Wall	Solid	Tile	5.09
720	1964 & 1971 Bldgs	165	XRF	2/28/97	2	Room	219	Wall	Wall	Solid	Drywall	0.02
721	1964 & 1971 Bldgs	166	XRF	2/28/97	2	Room	219	Rack		Solid	Wood	0
722	1964 & 1971 Bldgs	167	XRF	2/28/97	2	Room	219	Door	Door	Solid	Wood	0
723	1964 & 1971 Bldgs	168	XRF	2/28/97	2	Room	219	Wall	Wall Rgstr	Solid	Metal	0.01
724	1964 & 1971 Bldgs	169	XRF	2/28/97	2	Room	219	Wall	Wall	Solid	Metal	0.01
725	1964 & 1971 Bldgs	170	XRF	2/28/97	2	Room	221	Wall	Wall	Solid	Concrete	0.02
726	1964 & 1971 Bldgs	171	XRF	2/28/97	2	Room	221	Wall	Wall	Solid	Concrete	0.04
727	1964 & 1971 Bldgs	172	XRF	2/28/97	2	Room	221	Wall	Wall	Solid	Metal	0.45
728	1964 & 1971 Bldgs	173	XRF	2/28/97	2	Room	221	Door	Door	Solid	Wood	0.01
729	1964 & 1971 Bldgs	174	XRF	2/28/97	2	Room	221	Door	Jamb	Solid	Metal	0.29
730	1964 & 1971 Bldgs	175	XRF	2/28/97	2	Room	221	Ceiling		Solid	Concrete	0.01
731	1964 & 1971 Bldgs	176	XRF	2/28/97	2	Room	221	Ceiling		Solid	Plaster	0.09
732	1964 & 1971 Bldgs	177	XRF	2/28/97	2	Room	221	Soffit		Solid	Metal	0.2
733	1964 & 1971 Bldgs	178	XRF	2/28/97	2	Room	221		Radiator	Solid	Metal	0.54
734	1964 & 1971 Bldgs	179	XRF	2/28/97	2	Room	221	Cabinet	Door	Solid	Wood	0
735	1964 & 1971 Bldgs	180	XRF	2/28/97	2	Room	221	Cabinet	Outside	Solid	Wood	0
736	1964 & 1971 Bldgs	181	XRF	2/28/97	2	Room	222	Wall	Wall	Solid	Concrete	0.02
737	1964 & 1971 Bldgs	182	XRF	2/28/97	2	Room	222	Wall	Wall	Solid	Concrete	0.03
738	1964 & 1971 Bldgs	183	XRF	2/28/97	2	Room	222	Wall	Wall	Solid	Metal	0.69
739	1964 & 1971 Bldgs	184	XRF	2/28/97	2	Room	222	Door	Door	Solid	Wood	0
740	1964 & 1971 Bldgs	185	XRF	2/28/97	2	Room	222	Door	Jamb	Solid	Metal	0.41
741	1964 & 1971 Bldgs	186	XRF	2/28/97	2	Room	222		Radiator	Solid	Metal	0.64
742	1964 & 1971 Bldgs	187	XRF	2/28/97	2	Room	222	Cabinet	Door	Solid	Wood	0.01
743	1964 & 1971 Bldgs	188	XRF	2/28/97	2	Room	222	Cabinet	Floor	Solid	Wood	0.01
744	1964 & 1971 Bldgs	189	XRF	2/28/97	2	Room	223	Wall	Wall	Solid	Concrete	0.01
745	1964 & 1971 Bldgs	190	XRF	2/28/97	2	Room	223	Wall	Wall	Solid	Concrete	0.03
746	1964 & 1971 Bldgs	191	XRF	2/28/97	2	Room	223	Wall	Wall	Solid	Metal	0.38
747	1964 & 1971 Bldgs	202	XRF	3/1/97	2	Room	223	Door	Door	Solid	Wood	0.01
748	1964 & 1971 Bldgs	203	XRF	3/1/97	2	Room	223	Door	Jamb	Solid	Metal	0.33
749	1964 & 1971 Bldgs	204	XRF	3/1/97	2	Room	223	Ceiling		Solid	Concrete	0.02
750	1964 & 1971 Bldgs	205	XRF	3/1/97	2	Room	223	Soffit		Solid	Plaster	0.09
751	1964 & 1971 Bldgs	206	XRF	3/1/97	2	Room	223	Soffit		Solid	Metal	0.15
752	1964 & 1971 Bldgs	207	XRF	3/1/97	2	Room	223		Radiator	Solid	Metal	0.27
753	1964 & 1971 Bldgs	208	XRF	3/1/97	2	Room	223		Radiator	Solid	Metal	0.25
754	1964 & 1971 Bldgs	213	XRF	3/1/97	2	Room	223	Cabinet	Door	Solid	Wood	0.02
755	1964 & 1971 Bldgs	214	XRF	3/1/97	2	Room	223	Cabinet	Outside	Solid	Wood	0.01
756	1964 & 1971 Bldgs	215	XRF	3/1/97	2	Room	224	Wall	Wall	Solid	Concrete	0.09
757	1964 & 1971 Bldgs	216	XRF	3/1/97	2	Room	224	Wall	Wall	Solid	Concrete	0.01
758	1964 & 1971 Bldgs	217	XRF	3/1/97	2	Room	224	Door	Door	Solid	Wood	0.01
759	1964 & 1971 Bldgs	218	XRF	3/1/97	2	Room	224	Door	Jamb	Solid	Metal	0.34
760	1964 & 1971 Bldgs	219	XRF	3/1/97	2	Room	224	Wall	Wall	Solid	Metal	0.35
761	1964 & 1971 Bldgs	220	XRF	3/1/97	2	Room	224	Ceiling		Solid	Concrete	0.01
762	1964 & 1971 Bldgs	221	XRF	3/1/97	2	Room	224	Ceiling		Solid	Plaster	0.03
763	1964 & 1971 Bldgs	222	XRF	3/1/97	2	Room	224	Soffit		Solid	Metal	0.16
764	1964 & 1971 Bldgs	223	XRF	3/1/97	2	Room	224		Radiator	Solid	Metal	0.2
765	1964 & 1971 Bldgs	224	XRF	3/1/97	2	Room	224	Cabinet	Door	Solid	Wood	0
766	1964 & 1971 Bldgs	225	XRF	3/1/97	2	Room	224	Cabinet	Outside	Solid	Wood	0
767	1964 & 1971 Bldgs	226	XRF	3/1/97	2	Room	224	Wall	Baseboard	Solid	Plaster	1.45
768	1964 & 1971 Bldgs	229	XRF	3/1/97	2	Room	225	Wall	Wall	Solid	Concrete	0.01

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
769	1964 & 1971 Bldgs	230	XRF	3/1/97	2	Room	225	Wall	Wall	Solid	Concrete	0.05
770	1964 & 1971 Bldgs	231	XRF	3/1/97	2	Room	225	Wall	Wall	Solid	Metal	0.37
771	1964 & 1971 Bldgs	232	XRF	3/1/97	2	Room	225	Door	Door	Solid	Wood	0
772	1964 & 1971 Bldgs	233	XRF	3/1/97	2	Room	225	Door	Jamb	Solid	Metal	0.48
773	1964 & 1971 Bldgs	234	XRF	3/1/97	2	Room	225	Ceiling		Solid	Concrete	0.05
774	1964 & 1971 Bldgs	235	XRF	3/1/97	2	Room	225	Ceiling		Solid	Plaster	0.06
775	1964 & 1971 Bldgs	236	XRF	3/1/97	2	Room	225	Soffit		Solid	Metal	0.15
776	1964 & 1971 Bldgs	237	XRF	3/1/97	2	Room	225		Radiator	Solid	Metal	0.23
777	1964 & 1971 Bldgs	238	XRF	3/1/97	2	Room	225	Cabinet	Door	Solid	Wood	0
778	1964 & 1971 Bldgs	239	XRF	3/1/97	2	Room	225	Cabinet	Door	Solid	Wood	0.01
779	1964 & 1971 Bldgs	241	XRF	3/1/97	2	Room	226	Wall	Wall	Solid	Concrete	0.02
780	1964 & 1971 Bldgs	242	XRF	3/1/97	2	Room	226	Wall	Wall	Solid	Concrete	0.03
781	1964 & 1971 Bldgs	243	XRF	3/1/97	2	Room	226	Wall	Wall	Solid	Metal	0.52
782	1964 & 1971 Bldgs	244	XRF	3/1/97	2	Room	226	Door	Door	Solid	Wood	0.01
783	1964 & 1971 Bldgs	245	XRF	3/1/97	2	Room	226	Door	Jamb	Solid	Metal	0.38
784	1964 & 1971 Bldgs	246	XRF	3/1/97	2	Room	226	Ceiling		Solid	Concrete	0.02
785	1964 & 1971 Bldgs	247	XRF	3/1/97	2	Room	226	Ceiling		Solid	Plaster	0.06
786	1964 & 1971 Bldgs	248	XRF	3/1/97	2	Room	226	Soffit		Solid	Metal	0.08
787	1964 & 1971 Bldgs	249	XRF	3/1/97	2	Room	226		Radiator	Solid	Metal	0.28
788	1964 & 1971 Bldgs	250	XRF	3/1/97	2	Room	226	Cabinet	Outside	Solid	Wood	0
789	1964 & 1971 Bldgs	251	XRF	3/1/97	2	Room	226	Cabinet	Door	Solid	Wood	0
790	1964 & 1971 Bldgs	252	XRF	3/1/97	2	Room	227	Wall	Wall	Solid	Concrete	0.02
791	1964 & 1971 Bldgs	253	XRF	3/1/97	2	Room	227	Wall	Wall	Solid	Concrete	0.03
792	1964 & 1971 Bldgs	254	XRF	3/1/97	2	Room	227	Wall	Wall	Solid	Metal	0.39
793	1964 & 1971 Bldgs	255	XRF	3/1/97	2	Room	227	Ceiling		Solid	Concrete	0.01
794	1964 & 1971 Bldgs	256	XRF	3/1/97	2	Room	227	Ceiling		Solid	Plaster	0.04
795	1964 & 1971 Bldgs	257	XRF	3/1/97	2	Room	227	Soffit		Solid	Metal	0.18
796	1964 & 1971 Bldgs	258	XRF	3/1/97	2	Room	227	Door	Door	Solid	Wood	0.01
797	1964 & 1971 Bldgs	259	XRF	3/1/97	2	Room	227	Door	Jamb	Solid	Metal	0.46
798	1964 & 1971 Bldgs	260	XRF	3/1/97	2	Room	227		Radiator	Solid	Metal	0.42
799	1964 & 1971 Bldgs	261	XRF	3/1/97	2	Room	227	Wall	Baseboard	Solid	Concrete	1.52
800	1964 & 1971 Bldgs	262	XRF	3/1/97	2	Room	227	Cabinet	Door	Solid	Wood	0.01
801	1964 & 1971 Bldgs	263	XRF	3/1/97	2	Room	227	Cabinet	Outside	Solid	Wood	0
802	1964 & 1971 Bldgs	273	XRF	3/1/97	2	Room	228	Wall	Wall	Solid	Concrete	0.01
803	1964 & 1971 Bldgs	274	XRF	3/1/97	2	Room	228	Door	Door	Solid	Wood	0.01
804	1964 & 1971 Bldgs	275	XRF	3/1/97	2	Room	228	Door	Jamb	Solid	Metal	0.22
805	1964 & 1971 Bldgs	276	XRF	3/1/97	2	Room	228	Wall	Baseboard	Solid	Tile	1.69
806	1964 & 1971 Bldgs	277	XRF	3/1/97	2	Room	228	Ceiling	Diffuser	Solid	Metal	0.01
807	1964 & 1971 Bldgs	278	XRF	3/1/97	2	Room	228	Ceiling	Hatch	Solid	Metal	0
808	1964 & 1971 Bldgs	279	XRF	3/1/97	2	Room	228	Coat	Rack	Solid	Wood	0
809	1964 & 1971 Bldgs	280	XRF	3/1/97	2	Room	228	Wall	Hatch	Solid	Wood	0
810	1964 & 1971 Bldgs	281	XRF	3/1/97	2	Room	228	Cabinet	Door	Solid	Wood	0
811	1964 & 1971 Bldgs	282	XRF	3/1/97	2	Room	228	Cabinet	Shelf	Solid	Wood	0
812	1964 & 1971 Bldgs	283	XRF	3/1/97	2	Room	228	Bookcase	Shelf	Solid	Wood	0
813	1964 & 1971 Bldgs	293	XRF	3/1/97	2	Room	229	Wall	Wall	Solid	Concrete	0.03
814	1964 & 1971 Bldgs	294	XRF	3/1/97	2	Room	229	Wall	Wall	Solid	Concrete	0.03
815	1964 & 1971 Bldgs	295	XRF	3/1/97	2	Room	229	Wall	Wall	Solid	Metal	0.57
816	1964 & 1971 Bldgs	296	XRF	3/1/97	2	Room	229	Door	Door	Solid	Wood	0
817	1964 & 1971 Bldgs	297	XRF	3/1/97	2	Room	229	Door	Jamb	Solid	Metal	0.25
818	1964 & 1971 Bldgs	298	XRF	3/1/97	2	Room	229	Ceiling		Solid	Concrete	0.01
819	1964 & 1971 Bldgs	299	XRF	3/1/97	2	Room	229	Ceiling		Solid	Plaster	0.26
820	1964 & 1971 Bldgs	300	XRF	3/1/97	2	Room	229	Soffit		Solid	Metal	0.24
821	1964 & 1971 Bldgs	301	XRF	3/1/97	2	Room	229		Radiator	Solid	Metal	0.59
822	1964 & 1971 Bldgs	302	XRF	3/1/97	2	Room	229	Cabinet	Door	Solid	Wood	0
823	1964 & 1971 Bldgs	303	XRF	3/1/97	2	Room	229	Cabinet	Outside	Solid	Wood	0.01
824	1964 & 1971 Bldgs	304	XRF	3/1/97	2	Room	230	Wall	Wall	Solid	Concrete	0.02
825	1964 & 1971 Bldgs	305	XRF	3/1/97	2	Room	230	Wall	Wall	Solid	Concrete	0.03
826	1964 & 1971 Bldgs	306	XRF	3/1/97	2	Room	230	Door	Door	Solid	Wood	0.01
827	1964 & 1971 Bldgs	307	XRF	3/1/97	2	Room	230	Door	Jamb	Solid	Metal	0.36
828	1964 & 1971 Bldgs	308	XRF	3/1/97	2	Room	230	Ceiling		Solid	Concrete	0.01
829	1964 & 1971 Bldgs	309	XRF	3/1/97	2	Room	230	Ceiling		Solid	Plaster	0.07
830	1964 & 1971 Bldgs	310	XRF	3/1/97	2	Room	230	Soffit		Solid	Metal	0.15
831	1964 & 1971 Bldgs	311	XRF	3/1/97	2	Room	230		Radiator	Solid	Metal	0.44
832	1964 & 1971 Bldgs	312	XRF	3/1/97	2	Room	230	Cabinet	Door	Solid	Wood	0.01

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
833	1964 & 1971 Bldgs	313	XRF	3/1/97	2	Room	230	Cabinet	Shelf	Solid	Wood	0
834	1964 & 1971 Bldgs	314	XRF	3/1/97	2	Room	230	Floor		Solid	Wood	0
835	1964 & 1971 Bldgs	315	XRF	3/1/97	2	Room	230	Stairs	Hand rail	Solid	Wood	0
836	1964 & 1971 Bldgs	6	XRF	2/16/97	3	Room	301	Wall	Wall	Solid	Concrete	0.01
837	1964 & 1971 Bldgs	7	XRF	2/16/97	3	Room	301	Wall	Wall	Solid	Concrete	0.04
838	1964 & 1971 Bldgs	8	XRF	2/16/97	3	Room	301	Door	Door	Solid	Wood	0.01
839	1964 & 1971 Bldgs	9	XRF	2/16/97	3	Room	301	Door	Jamb	Solid	Metal	0.24
840	1964 & 1971 Bldgs	10	XRF	2/16/97	3	Room	301	Door	Casing	Solid	Wood	0.01
841	1964 & 1971 Bldgs	11	XRF	2/16/97	3	Room	301	Wall	Baseboard	Solid	Concrete	1.27
842	1964 & 1971 Bldgs	12	XRF	2/16/97	3	Room	301		Radiator	Solid	Metal	0.11
843	1964 & 1971 Bldgs	13	XRF	2/16/97	3	Room	301	Ceiling		Solid	Plaster	0.06
844	1964 & 1971 Bldgs	14	XRF	2/16/97	3	Room	301	Soffit		Solid	Metal	0.15
845	1964 & 1971 Bldgs	15	XRF	2/16/97	3	Room	302	Wall	Wall	Solid	Concrete	0.01
846	1964 & 1971 Bldgs	16	XRF	2/16/97	3	Room	302	Wall	Wall	Solid	Concrete	0.02
847	1964 & 1971 Bldgs	17	XRF	2/16/97	3	Room	302	Door	Door	Solid	Wood	0.02
848	1964 & 1971 Bldgs	18	XRF	2/16/97	3	Room	302	Door	Jamb	Solid	Metal	0.34
849	1964 & 1971 Bldgs	19	XRF	2/16/97	3	Room	302	Wall	Baseboard	Solid	Concrete	0.99
850	1964 & 1971 Bldgs	20	XRF	2/16/97	3	Room	302		Radiator	Solid	Metal	0.36
851	1964 & 1971 Bldgs	21	XRF	2/16/97	3	Room	302	Ceiling		Solid	Plaster	0.03
852	1964 & 1971 Bldgs	22	XRF	2/16/97	3	Room	302	Soffit		Solid	Metal	0.27
853	1964 & 1971 Bldgs	23	XRF	2/16/97	3	Room	302	Cabinet	Door	Solid	Wood	0.01
854	1964 & 1971 Bldgs	24	XRF	2/16/97	3	Room	302	Cabinet	Shelf	Solid	Wood	0.01
855	1964 & 1971 Bldgs	25	XRF	2/16/97	3	Room	302	Door	Casing	Solid	Wood	0.01
856	1964 & 1971 Bldgs	26	XRF	2/16/97	3	Room	303	Wall	Wall	Solid	Concrete	0.01
857	1964 & 1971 Bldgs	27	XRF	2/16/97	3	Room	303	Wall	Wall	Solid	Concrete	0.02
858	1964 & 1971 Bldgs	28	XRF	2/16/97	3	Room	303	Door	Door	Solid	Wood	0.02
859	1964 & 1971 Bldgs	29	XRF	2/16/97	3	Room	303	Door	Jamb	Solid	Wood	0.11
860	1964 & 1971 Bldgs	30	XRF	2/16/97	3	Room	303	Door	Jamb	Solid	Wood	0.16
861	1964 & 1971 Bldgs	31	XRF	2/16/97	3	Room	303	Door	Casing	Solid	Wood	0
862	1964 & 1971 Bldgs	32	XRF	2/16/97	3	Room	303	Wall	Baseboard	Solid	Concrete	1.27
863	1964 & 1971 Bldgs	33	XRF	2/16/97	3	Room	303		Radiator	Solid	Metal	0.44
864	1964 & 1971 Bldgs	34	XRF	2/16/97	3	Room	303	Ceiling		Solid	Plaster	0.1
865	1964 & 1971 Bldgs	35	XRF	2/16/97	3	Room	303	Soffit		Solid	Metal	0.15
866	1964 & 1971 Bldgs	36	XRF	2/16/97	3	Room	303	Cabinet	Door	Solid	Wood	0
867	1964 & 1971 Bldgs	37	XRF	2/16/97	3	Room	303	Cabinet	Floor	Solid	Wood	0.01
868	1964 & 1971 Bldgs	38	XRF	2/16/97	3	Room	303	Wall	Midle Wall	Solid	Metal	0.22
869	1964 & 1971 Bldgs	39	XRF	2/16/97	3	Room	304	Wall	Wall	Solid	Concrete	0.01
870	1964 & 1971 Bldgs	40	XRF	2/16/97	3	Room	304	Wall	Wall	Solid	Concrete	0.04
871	1964 & 1971 Bldgs	41	XRF	2/16/97	3	Room	304	Door	Door	Solid	Wood	0.01
872	1964 & 1971 Bldgs	42	XRF	2/16/97	3	Room	304	Door	Jamb	Solid	Metal	0.18
873	1964 & 1971 Bldgs	43	XRF	2/16/97	3	Room	304	Wall	Baseboard	Solid	Concrete	1.15
874	1964 & 1971 Bldgs	44	XRF	2/16/97	3	Room	304		Radiator	Solid	Metal	0.23
875	1964 & 1971 Bldgs	45	XRF	2/16/97	3	Room	304	Ceiling		Solid	Plaster	0.05
876	1964 & 1971 Bldgs	46	XRF	2/16/97	3	Room	304	Soffit		Solid	Metal	0.16
877	1964 & 1971 Bldgs	47	XRF	2/16/97	3	Room	304	Cabinet	Door	Solid	Wood	0
878	1964 & 1971 Bldgs	48	XRF	2/16/97	3	Room	304	Cabinet	Shelf	Solid	Wood	0.01
879	1964 & 1971 Bldgs	49	XRF	2/16/97	3	Room	305	Wall	Wall	Solid	Concrete	0.01
880	1964 & 1971 Bldgs	50	XRF	2/16/97	3	Room	305	Wall	Wall	Solid	Concrete	0.03
881	1964 & 1971 Bldgs	52	XRF	2/16/97	3	Room	305	Door	Door	Solid	Wood	0.01
882	1964 & 1971 Bldgs	53	XRF	2/16/97	3	Room	305	Door	Jamb	Solid	Metal	0.23
883	1964 & 1971 Bldgs	54	XRF	2/16/97	3	Room	305	Wall	Midle Wall	Solid	Metal	0.42
884	1964 & 1971 Bldgs	55	XRF	2/16/97	3	Room	305	Wall	Baseboard	Solid	Concrete	1.03
885	1964 & 1971 Bldgs	56	XRF	2/16/97	3	Room	305		Radiator	Solid	Metal	0.11
886	1964 & 1971 Bldgs	57	XRF	2/16/97	3	Room	305	Ceiling		Solid	Plaster	0.21
887	1964 & 1971 Bldgs	58	XRF	2/16/97	3	Room	305	Ceiling		Solid	Plaster	0.05
888	1964 & 1971 Bldgs	59	XRF	2/16/97	3	Room	305	Soffit		Solid	Metal	0.25
889	1964 & 1971 Bldgs	60	XRF	2/16/97	3	Room	305	Cabinet	Door	Solid	Wood	0.01
890	1964 & 1971 Bldgs	61	XRF	2/16/97	3	Room	305	Cabinet	Outside	Solid	Wood	0.01
891	1964 & 1971 Bldgs	70	XRF	2/16/97	3	Room	306	Wall	Wall	Solid	Concrete	0.01
892	1964 & 1971 Bldgs	71	XRF	2/16/97	3	Room	306	Wall	Wall	Solid	Concrete	0.01
893	1964 & 1971 Bldgs	72	XRF	2/16/97	3	Room	306	Wall	Wall	Solid	Metal	0.35
894	1964 & 1971 Bldgs	73	XRF	2/16/97	3	Room	306	Door	Door	Solid	Concrete	0.01
895	1964 & 1971 Bldgs	74	XRF	2/16/97	3	Room	306	Door	Jamb	Solid	Metal	0.23
896	1964 & 1971 Bldgs	75	XRF	2/16/97	3	Room	306	Door	Casing	Solid	Wood	0

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
897	1964 & 1971 Bldgs	76	XRF	2/16/97	3	Room	306	Wall	Baseboard	Solid	Concrete	1.46
898	1964 & 1971 Bldgs	77	XRF	2/16/97	3	Room	306		Radiator	Solid	Metal	0.14
899	1964 & 1971 Bldgs	78	XRF	2/16/97	3	Room	306	Ceiling		Solid	Plaster	0.03
900	1964 & 1971 Bldgs	79	XRF	2/16/97	3	Room	306	Soffit		Solid	Metal	0.18
901	1964 & 1971 Bldgs	80	XRF	2/16/97	3	Room	306	Cabinet	Outside	Solid	Wood	0.01
902	1964 & 1971 Bldgs	81	XRF	2/16/97	3	Room	306	Cabinet	Inside	Solid	Wood	0
903	1964 & 1971 Bldgs	6	XRF	2/19/97	3	Room	307	Wall	Wall	Solid	Concrete	0.02
904	1964 & 1971 Bldgs	7	XRF	2/19/97	3	Room	307	Wall	Wall	Solid	Concrete	0.03
905	1964 & 1971 Bldgs	8	XRF	2/19/97	3	Room	307	Door	Door	Solid	Wood	0.02
906	1964 & 1971 Bldgs	9	XRF	2/19/97	3	Room	307	Door	Jamb	Solid	Metal	0.15
907	1964 & 1971 Bldgs	10	XRF	2/19/97	3	Room	307	Wall	Baseboard	Solid	Tile	1.68
908	1964 & 1971 Bldgs	11	XRF	2/19/97	3	Room	307		Radiator	Solid	Metal	0.4
909	1964 & 1971 Bldgs	12	XRF	2/19/97	3	Room	307	Ceiling		Solid	Plaster	0.05
910	1964 & 1971 Bldgs	13	XRF	2/19/97	3	Room	307	Soffit		Solid	Metal	0.11
911	1964 & 1971 Bldgs	14	XRF	2/19/97	3	Room	307	Cabinet	Outside	Solid	Wood	0
912	1964 & 1971 Bldgs	15	XRF	2/19/97	3	Room	307	Cabinet	Shelf	Solid	Wood	0.01
913	1964 & 1971 Bldgs	16	XRF	2/19/97	3	Room	308	Wall	Wall	Solid	Concrete	0.01
914	1964 & 1971 Bldgs	17	XRF	2/19/97	3	Room	308	Wall	Wall	Solid	Concrete	0.02
915	1964 & 1971 Bldgs	18	XRF	2/19/97	3	Room	308	Wall	Midle Wall	Solid	Metal	0.37
916	1964 & 1971 Bldgs	19	XRF	2/19/97	3	Room	308	Door	Door	Solid	Wood	0.01
917	1964 & 1971 Bldgs	21	XRF	2/19/97	3	Room	308	Door	Jamb	Solid	Metal	0.25
918	1964 & 1971 Bldgs	22	XRF	2/19/97	3	Room	308	Wall	Baseboard	Solid	Tile	1.2
919	1964 & 1971 Bldgs	23	XRF	2/19/97	3	Room	308		Radiator	Solid	Metal	0.31
920	1964 & 1971 Bldgs	24	XRF	2/19/97	3	Room	308	Ceiling		Solid	Plaster	0.19
921	1964 & 1971 Bldgs	25	XRF	2/19/97	3	Room	308	Soffit		Solid	Plaster	0.04
922	1964 & 1971 Bldgs	26	XRF	2/19/97	3	Room	308	Soffit		Solid	Metal	0.19
923	1964 & 1971 Bldgs	27	XRF	2/19/97	3	Room	308	Cabinet	Door	Solid	Wood	0.01
924	1964 & 1971 Bldgs	28	XRF	2/19/97	3	Room	308	Cabinet	Outside	Solid	Wood	0.01
925	1964 & 1971 Bldgs	29	XRF	2/19/97	3	Room	309	Wall	Wall	Solid	Concrete	0.01
926	1964 & 1971 Bldgs	30	XRF	2/19/97	3	Room	309	Wall	Wall	Solid	Concrete	0.02
927	1964 & 1971 Bldgs	31	XRF	2/19/97	3	Room	309	Door	Door	Solid	Wood	0.01
928	1964 & 1971 Bldgs	32	XRF	2/19/97	3	Room	309	Door	Jamb	Solid	Metal	0.16
929	1964 & 1971 Bldgs	33	XRF	2/19/97	3	Room	309	Wall	Midle Wall	Solid	Metal	0.31
930	1964 & 1971 Bldgs	34	XRF	2/19/97	3	Room	309	Wall	Baseboard	Solid	Tile	0.69
931	1964 & 1971 Bldgs	35	XRF	2/19/97	3	Room	309		Radiator	Solid	Metal	0.1
932	1964 & 1971 Bldgs	36	XRF	2/19/97	3	Room	309	Soffit		Solid	Plaster	0.04
933	1964 & 1971 Bldgs	37	XRF	2/19/97	3	Room	309	Soffit		Solid	Metal	0.39
934	1964 & 1971 Bldgs	38	XRF	2/19/97	3	Room	309	Cabinet	Door	Solid	Wood	0.01
935	1964 & 1971 Bldgs	39	XRF	2/19/97	3	Room	309	Cabinet	Outside	Solid	Wood	0.01
936	1964 & 1971 Bldgs	40	XRF	2/19/97	3	Room	310	Wall	Wall	Solid	Concrete	0.03
937	1964 & 1971 Bldgs	41	XRF	2/19/97	3	Room	310	Wall	Wall	Solid	Concrete	0.06
938	1964 & 1971 Bldgs	42	XRF	2/19/97	3	Room	310	Door	Door	Solid	Wood	0.01
939	1964 & 1971 Bldgs	43	XRF	2/19/97	3	Room	310	Door	Jamb	Solid	Metal	0.19
940	1964 & 1971 Bldgs	44	XRF	2/19/97	3	Room	310	Wall	Midle Wall	Solid	Metal	0.43
941	1964 & 1971 Bldgs	45	XRF	2/19/97	3	Room	310	Wall	Baseboard	Solid	Tile	0.66
942	1964 & 1971 Bldgs	46	XRF	2/19/97	3	Room	310		Radiator	Solid	Tile	0.1
943	1964 & 1971 Bldgs	47	XRF	2/19/97	3	Room	310	Soffit		Solid	Plaster	0.02
944	1964 & 1971 Bldgs	48	XRF	2/19/97	3	Room	310	Soffit		Solid	Plaster	0.03
945	1964 & 1971 Bldgs	49	XRF	2/19/97	3	Room	310	Soffit		Solid	Metal	0.15
946	1964 & 1971 Bldgs	50	XRF	2/19/97	3	Room	310	Door	Casing	Solid	Wood	0
947	1964 & 1971 Bldgs	51	XRF	2/19/97	3	Room	310	Cabinet	Outside	Solid	Wood	0.01
948	1964 & 1971 Bldgs	52	XRF	2/19/97	3	Room	310		Elec Panel	Solid	Metal	0
949	1964 & 1971 Bldgs	53	XRF	2/19/97	3	Room	310	Wall	Midle Wall	Solid	Concrete	0.03
950	1964 & 1971 Bldgs	54	XRF	2/19/97	3	Room	310	Cabinet	Door	Solid	Wood	0.01
951	1964 & 1971 Bldgs	89	XRF	2/19/97	3	Room	312	Wall	Wall	Solid	Concrete	0.01
952	1964 & 1971 Bldgs	90	XRF	2/19/97	3	Room	312	Wall	Wall	Solid	Concrete	0.04
953	1964 & 1971 Bldgs	92	XRF	2/19/97	3	Room	312	Door	Door	Solid	Wood	0.01
954	1964 & 1971 Bldgs	93	XRF	2/19/97	3	Room	312	Door	Jamb	Solid	Metal	0.22
955	1964 & 1971 Bldgs	94	XRF	2/19/97	3	Room	312	Wall	Midle Wall	Solid	Metal	0.48
956	1964 & 1971 Bldgs	95	XRF	2/19/97	3	Room	312	Wall	Baseboard	Solid	Tile	1.27
957	1964 & 1971 Bldgs	96	XRF	2/19/97	3	Room	312	Soffit		Solid	Plaster	0.05
958	1964 & 1971 Bldgs	97	XRF	2/19/97	3	Room	312	Soffit		Solid	Metal	0.15
959	1964 & 1971 Bldgs	98	XRF	2/19/97	3	Room	312	Cabinet	Outside	Solid	Wood	0.06
960	1964 & 1971 Bldgs	99	XRF	2/19/97	3	Room	312	Cabinet	Door	Solid	Wood	0.01

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
961	1964 & 1971 Bldgs	100	XRF	2/19/97	3 Room	312	Wall	Wall Rgstr	Solid	Metal	0.01	
962	1964 & 1971 Bldgs	113	XRF	2/19/97	3 Room	313	Wall	Wall	Solid	Concrte	0.01	
963	1964 & 1971 Bldgs	114	XRF	2/19/97	3 Room	313	Wall	Wall	Solid	Concrte	0.03	
964	1964 & 1971 Bldgs	115	XRF	2/19/97	3 Room	313	Wall	Midle Wall	Solid	Metal	0.53	
965	1964 & 1971 Bldgs	116	XRF	2/19/97	3 Room	313	Cabinet	Shelf	Solid	Wood	0.02	
966	1964 & 1971 Bldgs	117	XRF	2/19/97	3 Room	313	Cabinet	Door	Solid	Wood	0.01	
967	1964 & 1971 Bldgs	118	XRF	2/19/97	3 Room	313	Door	Door	Solid	Wood	0.01	
968	1964 & 1971 Bldgs	119	XRF	2/19/97	3 Room	313	Door	Header	Solid	Metal	0.13	
969	1964 & 1971 Bldgs	120	XRF	2/19/97	3 Room	313	Soffit		Solid	Plaster	0.13	
970	1964 & 1971 Bldgs	121	XRF	2/19/97	3 Room	313	Soffit		Solid	Metal	0.08	
971	1964 & 1971 Bldgs	122	XRF	2/19/97	3 Room	313	Door	Header	Solid	Metal	0	
972	1964 & 1971 Bldgs	123	XRF	2/19/97	3 Room	313		Radiator	Solid	Metal	0	
973	1964 & 1971 Bldgs	125	XRF	2/19/97	3 Room	314	Wall	Wall	Solid	Concrte	0.01	
974	1964 & 1971 Bldgs	126	XRF	2/19/97	3 Room	314	Wall	Wall	Solid	Concrte	0.04	
975	1964 & 1971 Bldgs	127	XRF	2/19/97	3 Room	314	Wall	Midle Wall	Solid	Metal	0.35	
976	1964 & 1971 Bldgs	128	XRF	2/19/97	3 Room	314	Door	Door	Solid	Wood	0.01	
977	1964 & 1971 Bldgs	129	XRF	2/19/97	3 Room	314	Wall	Baseboard	Solid	Tile	1.59	
978	1964 & 1971 Bldgs	131	XRF	2/19/97	3 Room	314	Soffit		Solid	Plaster	0.01	
979	1964 & 1971 Bldgs	132	XRF	2/19/97	3 Room	314	Soffit		Solid	Metal	0.24	
980	1964 & 1971 Bldgs	133	XRF	2/19/97	3 Room	314	Cabinet	Door	Solid	Wood	0.01	
981	1964 & 1971 Bldgs	134	XRF	2/19/97	3 Room	314	Cabinet	Outside	Solid	Wood	0.01	
982	1964 & 1971 Bldgs	147	XRF	2/19/97	3 Room	315	Wall	Wall	Solid	Concrte	0.02	
983	1964 & 1971 Bldgs	148	XRF	2/19/97	3 Room	315	Wall	Wall	Solid	Concrte	0.02	
984	1964 & 1971 Bldgs	149	XRF	2/19/97	3 Room	315	Wall	Midle Wall	Solid	Metal	0.22	
985	1964 & 1971 Bldgs	150	XRF	2/19/97	3 Room	315	Door	Door	Solid	Wood	0.01	
986	1964 & 1971 Bldgs	151	XRF	2/19/97	3 Room	315	Door	Jamb	Solid	Metal	0.43	
987	1964 & 1971 Bldgs	152	XRF	2/19/97	3 Room	315	Wall	Baseboard	Solid	Tile	0.97	
988	1964 & 1971 Bldgs	153	XRF	2/19/97	3 Room	315	Soffit		Solid	Plaster	0.25	
989	1964 & 1971 Bldgs	154	XRF	2/19/97	3 Room	315	Soffit		Solid	Plaster	0.02	
990	1964 & 1971 Bldgs	156	XRF	2/19/97	3 Room	315	Soffit		Solid	Metal	0.15	
991	1964 & 1971 Bldgs	157	XRF	2/19/97	3 Room	315	Cabinet	Shelf	Solid	Wood	0.03	
992	1964 & 1971 Bldgs	158	XRF	2/19/97	3 Room	315	Window	Header	Solid	Metal	5.09	
993	1964 & 1971 Bldgs	159	XRF	2/19/97	3 Room	315	Wall	Wall Rgstr	Solid	Metal	0.03	
994	1964 & 1971 Bldgs	160	XRF	2/19/97	3 Room	315	Door	Header	Solid	Metal	5.09	
995	1964 & 1971 Bldgs	167	XRF	2/19/97	3 Room	316	Wall	Wall	Solid	Concrte	0.03	
996	1964 & 1971 Bldgs	168	XRF	2/19/97	3 Room	316	Wall	Wall	Solid	Concrte	0.02	
997	1964 & 1971 Bldgs	169	XRF	2/19/97	3 Room	316	Door	Door	Solid	Wood	0.01	
998	1964 & 1971 Bldgs	170	XRF	2/19/97	3 Room	316	Door	Header	Solid	Metal	0.38	
999	1964 & 1971 Bldgs	171	XRF	2/19/97	3 Room	316	Door	Header	Solid	Wood	0.02	
1000	1964 & 1971 Bldgs	6	XRF	2/20/97	3 Room	316	Wall	Midle Wall	Solid	Metal	0.24	
1001	1964 & 1971 Bldgs	7	XRF	2/20/97	3 Room	316	Wall	Baseboard	Solid	Tile	1.01	
1002	1964 & 1971 Bldgs	8	XRF	2/20/97	3 Room	316	Soffit		Solid	Plaster	0.06	
1003	1964 & 1971 Bldgs	9	XRF	2/20/97	3 Room	316	Soffit		Solid	Metal	0.16	
1004	1964 & 1971 Bldgs	10	XRF	2/20/97	3 Room	316	Cabinet	Door	Solid	Wood	0.04	
1005	1964 & 1971 Bldgs	11	XRF	2/20/97	3 Room	316	Cabinet	Inside	Solid	Wood	0	
1006	1964 & 1971 Bldgs	12	XRF	2/20/97	3 Room	316	Cabinet	Inside	Solid	Wood	0.92	
1007	1964 & 1971 Bldgs	13	XRF	2/20/97	3 Room	316	Window	Casing	Solid	Metal	0.44	
1008	1964 & 1971 Bldgs	20	XRF	2/20/97	3 Room	316		Radiator	Solid	Metal	1.39	
1009	1964 & 1971 Bldgs	21	XRF	2/20/97	3 Room	316		Radiator	Solid	Metal	0.1	
1010	1964 & 1971 Bldgs	33	XRF	2/20/97	3 Room	317	Wall	Wall	Solid	Concrte	0.03	
1011	1964 & 1971 Bldgs	34	XRF	2/20/97	3 Room	317	Door	Door	Solid	Wood	0.02	
1012	1964 & 1971 Bldgs	35	XRF	2/20/97	3 Room	317	Wall	Midle Wall	Solid	Metal	0.27	
1013	1964 & 1971 Bldgs	36	XRF	2/20/97	3 Room	317	Door	Jamb	Solid	Metal	0.73	
1014	1964 & 1971 Bldgs	37	XRF	2/20/97	3 Room	317	Soffit		Solid	Plaster	0.07	
1015	1964 & 1971 Bldgs	38	XRF	2/20/97	3 Room	317	Soffit		Solid	Metal	0.31	
1016	1964 & 1971 Bldgs	39	XRF	2/20/97	3 Room	317		Radiator	Solid	Metal	0.17	
1017	1964 & 1971 Bldgs	40	XRF	2/20/97	3 Room	317	Cabinet	Door	Solid	Wood	0.03	
1018	1964 & 1971 Bldgs	48	XRF	2/20/97	3 Room	318	Wall	Wall	Solid	Concrte	0.02	
1019	1964 & 1971 Bldgs	49	XRF	2/20/97	3 Room	318	Wall	Wall	Solid	Concrte	0.03	
1020	1964 & 1971 Bldgs	50	XRF	2/20/97	3 Room	318	Wall	Midle Wall	Solid	Metal	0.22	
1021	1964 & 1971 Bldgs	51	XRF	2/20/97	3 Room	318	Wall	Midle Wall	Solid	Concrte	0.01	
1022	1964 & 1971 Bldgs	52	XRF	2/20/97	3 Room	318	Door	Door	Solid	Wood	0.01	
1023	1964 & 1971 Bldgs	53	XRF	2/20/97	3 Room	318	Door	Jamb	Solid	Metal	0.45	
1024	1964 & 1971 Bldgs	54	XRF	2/20/97	3 Room	318	Soffit		Solid	Plaster	0.03	

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1025	1964 & 1971 Bldgs	55	XRF	2/20/97	3	Room	318	Soffit		Solid	Metal	0.19
1026	1964 & 1971 Bldgs	56	XRF	2/20/97	3	Room	318		Radiator	Solid	Metal	0.01
1027	1964 & 1971 Bldgs	57	XRF	2/20/97	3	Room	318	Wall	Midle Wall	Solid	Concrete	0
1028	1964 & 1971 Bldgs	58	XRF	2/20/97	3	Room	318	Door	Header	Solid	Metal	0
1029	1964 & 1971 Bldgs	59	XRF	2/20/97	3	Room	318	Lab	Top	Solid	Wood	0
1030	1964 & 1971 Bldgs	60	XRF	2/20/97	3	Room	318	Wall	Baseboard	Solid	Tile	1.05
1031	1964 & 1971 Bldgs	61	XRF	2/20/97	3	Room	318	Cabinet	Door	Solid	Wood	0
1032	1964 & 1971 Bldgs	72	XRF	2/20/97	3	Room	321	Wall	Wall	Solid	Concrete	0.01
1033	1964 & 1971 Bldgs	73	XRF	2/20/97	3	Room	321	Wall	Wall	Solid	Concrete	0.03
1034	1964 & 1971 Bldgs	74	XRF	2/20/97	3	Room	321	Wall	Midle Wall	Solid	Metal	0.66
1035	1964 & 1971 Bldgs	75	XRF	2/20/97	3	Room	321	Door	Door	Solid	Wood	0.01
1036	1964 & 1971 Bldgs	76	XRF	2/20/97	3	Room	321	Window	Casing	Solid	Metal	0.23
1037	1964 & 1971 Bldgs	77	XRF	2/20/97	3	Room	321	Soffit		Solid	Plaster	0.04
1038	1964 & 1971 Bldgs	78	XRF	2/20/97	3	Room	321	Soffit		Solid	Plaster	0.18
1039	1964 & 1971 Bldgs	79	XRF	2/20/97	3	Room	321	Wall	Wall Rgstr	Solid	Metal	0.01
1040	1964 & 1971 Bldgs	80	XRF	2/20/97	3	Room	321	Lab	Top	Solid	Wood	0
1041	1964 & 1971 Bldgs	81	XRF	2/20/97	3	Room	321	Cabinet	Outside	Solid	Wood	0.04
1042	1964 & 1971 Bldgs	82	XRF	2/20/97	3	Room	322	Wall	Wall	Solid	Concrete	0
1043	1964 & 1971 Bldgs	83	XRF	2/20/97	3	Room	322	Wall	Wall	Solid	Concrete	0.04
1044	1964 & 1971 Bldgs	84	XRF	2/20/97	3	Room	322	Wall	Midle Wall	Solid	Metal	0.29
1045	1964 & 1971 Bldgs	85	XRF	2/20/97	3	Room	322	Door	Door	Solid	Wood	0.03
1046	1964 & 1971 Bldgs	87	XRF	2/20/97	3	Room	322	Door	Jamb	Solid	Metal	0.36
1047	1964 & 1971 Bldgs	88	XRF	2/20/97	3	Room	322	Soffit		Solid	Plaster	0.1
1048	1964 & 1971 Bldgs	89	XRF	2/20/97	3	Room	322	Soffit		Solid	Metal	0.15
1049	1964 & 1971 Bldgs	90	XRF	2/20/97	3	Room	322		Radiator	Solid	Metal	0.14
1050	1964 & 1971 Bldgs	91	XRF	2/20/97	3	Room	322	Cabinet	Outside	Solid	Wood	0.01
1051	1964 & 1971 Bldgs	92	XRF	2/20/97	3	Room	322	Floor		Solid	Wood	0.01
1052	1964 & 1971 Bldgs	93	XRF	2/20/97	3	Room	322		Hand rail	Solid	Wood	0
1053	1964 & 1971 Bldgs	94	XRF	2/20/97	3	Room	323	Wall	Wall	Solid	Concrete	0.02
1054	1964 & 1971 Bldgs	95	XRF	2/20/97	3	Room	323	Wall	Baseboard	Solid	Tile	1.22
1055	1964 & 1971 Bldgs	96	XRF	2/20/97	3	Room	323	Door	Door	Solid	Wood	0.01
1056	1964 & 1971 Bldgs	97	XRF	2/20/97	3	Room	323	Door	Jamb	Solid	Metal	0.26
1057	1964 & 1971 Bldgs	98	XRF	2/20/97	3	Room	323	Wall	Wall	Solid	Concrete	0.03
1058	1964 & 1971 Bldgs	164	XRF	3/14/97	1	Room	400	Floor		Solid	Concrete	0.02
1059	1964 & 1971 Bldgs	165	XRF	3/14/97	1	Room	400	Door	Door	Solid	Metal	0.34
1060	1964 & 1971 Bldgs	166	XRF	3/14/97	1	Room	400	Door	Jamb	Solid	Metal	0.29
1061	1964 & 1971 Bldgs	167	XRF	3/14/97	1	Room	400	Stairs	Hand rail	Solid	Metal	0.2
1062	1964 & 1971 Bldgs	89	XRF	3/6/97	1	Room	1232	Wall	Wall	Solid	Concrete	0.01
1063	1964 & 1971 Bldgs	90	XRF	3/6/97	1	Room	1232	Door	Door	Solid	Metal	0.35
1064	1964 & 1971 Bldgs	91	XRF	3/6/97	1	Room	1232	Door	Jamb	Solid	Metal	0.2
1065	1964 & 1971 Bldgs	92	XRF	3/6/97	1	Room	1232	Door	Jamb	Solid	Metal	0.21
1066	1964 & 1971 Bldgs	93	XRF	3/6/97	1	Room	1232	Ceiling		Solid	Plaster	0.25
1067	1964 & 1971 Bldgs	94	XRF	3/6/97	1	Room	1232	Door	Header	Solid	Metal	5.09
1068	1964 & 1971 Bldgs	100	XRF	3/6/97	1	Room	1240	Wall	Wall	Solid	Concrete	0.03
1069	1964 & 1971 Bldgs	101	XRF	3/6/97	1	Room	1240	Wall	Wall	Solid	Concrete	0.04
1070	1964 & 1971 Bldgs	102	XRF	3/6/97	1	Room	1240	Door	Door	Solid	Wood	0.02
1071	1964 & 1971 Bldgs	103	XRF	3/6/97	1	Room	1240	Door	Jamb	Solid	Metal	0.15
1072	1964 & 1971 Bldgs	45	XRF	3/6/97	1	Room	1243	Wall	Wall	Solid	Concrete	0.01
1073	1964 & 1971 Bldgs	46	XRF	3/6/97	1	Room	1243	Wall	Wall	Solid	Concrete	0.02
1074	1964 & 1971 Bldgs	47	XRF	3/6/97	1	Room	1243	Door	Door	Solid	Wood	0
1075	1964 & 1971 Bldgs	49	XRF	3/6/97	1	Room	1243	Door	Jamb	Solid	Metal	0.14
1076	1964 & 1971 Bldgs	50	XRF	3/6/97	1	Room	1244	Wall	Wall	Solid	Concrete	0.02
1077	1964 & 1971 Bldgs	51	XRF	3/6/97	1	Room	1244	Wall	Wall	Solid	Concrete	0.01
1078	1964 & 1971 Bldgs	52	XRF	3/6/97	1	Room	1244	Door	Door	Solid	Wood	0.01
1079	1964 & 1971 Bldgs	53	XRF	3/6/97	1	Room	1244	Door	Jamb	Solid	Metal	0.14
1080	1964 & 1971 Bldgs	54	XRF	3/6/97	1	Room	1244	Wall	Midle Wall	Solid	Wood	0.52
1081	1964 & 1971 Bldgs	55	XRF	3/6/97	1	Room	1244		Radiator	Solid	Metal	0.06
1082	1964 & 1971 Bldgs	56	XRF	3/6/97	1	Room	1244	Bookcase	Shelf	Solid	Wood	0
1083	1964 & 1971 Bldgs	57	XRF	3/6/97	1	Room	1244	Bookcase	Insilde	Solid	Wood	0
1084	1964 & 1971 Bldgs	58	XRF	3/6/97	1	Room	1244	Bulletin	Board	Solid	Wood	0
1085	1964 & 1971 Bldgs	59	XRF	3/6/97	1	Room	1245	Wall	Wall	Solid	Concrete	0.02
1086	1964 & 1971 Bldgs	60	XRF	3/6/97	1	Room	1245	Wall	Wall	Solid	Concrete	0.04
1087	1964 & 1971 Bldgs	61	XRF	3/6/97	1	Room	1245	Door	Door	Solid	Wood	0
1088	1964 & 1971 Bldgs	62	XRF	3/6/97	1	Room	1245	Door	Jamb	Solid	Metal	0.22

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1089	1964 & 1971 Bldgs	63	XRF	3/6/97	1 Room	1245	Bookcase	Shelf	Solid	Wood		0
1090	1964 & 1971 Bldgs	64	XRF	3/6/97	1 Room	1245	Bulletin	Board	Solid	Wood		0
1091	1964 & 1971 Bldgs	65	XRF	3/6/97	1 Room	1246	Wall	Wall	Solid	Concrete	0.01	
1092	1964 & 1971 Bldgs	66	XRF	3/6/97	1 Room	1246	Wall	Wall	Solid	Concrete	0.02	
1093	1964 & 1971 Bldgs	67	XRF	3/6/97	1 Room	1246	Door	Door	Solid	Wood		0
1094	1964 & 1971 Bldgs	68	XRF	3/6/97	1 Room	1246	Door	Jamb	Solid	Metal	0.18	
1095	1964 & 1971 Bldgs	69	XRF	3/6/97	1 Room	1246	Wall	Baseboard	Solid	Tile	1.56	
1096	1964 & 1971 Bldgs	70	XRF	3/6/97	1 Room	1246	Bookcase	Shelf	Solid	Wood	0.02	
1097	1964 & 1971 Bldgs	71	XRF	3/6/97	1 Room	1246	Bookcase	Inside	Solid	Wood	0.01	
1098	1964 & 1971 Bldgs	72	XRF	3/6/97	1 Room	1246	Bulletin	Board	Solid	Wood	0	
1099	1964 & 1971 Bldgs	73	XRF	3/6/97	1 Room	1247	Wall	Wall	Solid	Concrete	0.01	
1100	1964 & 1971 Bldgs	74	XRF	3/6/97	1 Room	1247	Wall	Wall	Solid	Concrete	0.03	
1101	1964 & 1971 Bldgs	75	XRF	3/6/97	1 Room	1247	Wall	Midle Wall	Solid	Plaster	0.06	
1102	1964 & 1971 Bldgs	76	XRF	3/6/97	1 Room	1247	Door	Door	Solid	Wood		0
1103	1964 & 1971 Bldgs	77	XRF	3/6/97	1 Room	1247	Door	Jamb	Solid	Metal	0.2	
1104	1964 & 1971 Bldgs	78	XRF	3/6/97	1 Room	1247		Radiator	Solid	Metal	0.13	
1105	1964 & 1971 Bldgs	79	XRF	3/6/97	1 Room	1247	Bookcase	Shelf	Solid	Wood	0	
1106	1964 & 1971 Bldgs	80	XRF	3/6/97	1 Room	1247	Bulletin	Board	Solid	Wood	0	
1107	1964 & 1971 Bldgs	81	XRF	3/6/97	1 Room	1248	Wall	Wall	Solid	Concrete	0.02	
1108	1964 & 1971 Bldgs	82	XRF	3/6/97	1 Room	1248	Wall	Wall	Solid	Concrete	0.02	
1109	1964 & 1971 Bldgs	83	XRF	3/6/97	1 Room	1248	Wall	Midle Wall	Solid	Plaster	0.18	
1110	1964 & 1971 Bldgs	84	XRF	3/6/97	1 Room	1248	Wall	Midle Wall	Solid	Plaster	0.03	
1111	1964 & 1971 Bldgs	85	XRF	3/6/97	1 Room	1248	Door	Door	Solid	Wood	0	
1112	1964 & 1971 Bldgs	86	XRF	3/6/97	1 Room	1248	Door	Jamb	Solid	Metal	0.27	
1113	1964 & 1971 Bldgs	87	XRF	3/6/97	1 Room	1248		Radiator	Solid	Metal	0.08	
1114	1964 & 1971 Bldgs	88	XRF	3/6/97	1 Room	1248	Bulletin	Board	Solid	Wood	0	
1115	1964 & 1971 Bldgs	95	XRF	3/6/97	1 Room	1249	Wall	Wall	Solid	Concrete	0.02	
1116	1964 & 1971 Bldgs	96	XRF	3/6/97	1 Room	1249	Door	Door	Solid	Wood	0.01	
1117	1964 & 1971 Bldgs	97	XRF	3/6/97	1 Room	1249	Door	Jamb	Solid	Metal	0.23	
1118	1964 & 1971 Bldgs	98	XRF	3/6/97	1 Room	1249		Radiator	Solid	Metal	0.44	
1119	1964 & 1971 Bldgs	99	XRF	3/6/97	1 Room	1249	Bulletin	Board	Solid	Wood	0	
1120	1964 & 1971 Bldgs	385	XRF	3/1/97	1 Room	101A	Door	Door	Solid	Wood	0	
1121	1964 & 1971 Bldgs	386	XRF	3/1/97	1 Room	101A	Wall	Midle Wall	Solid	Drywall	0	
1122	1964 & 1971 Bldgs	387	XRF	3/1/97	1 Room	101A	Door	Jamb	Solid	Metal	0	
1123	1964 & 1971 Bldgs	388	XRF	3/1/97	1 Room	101A	Mini-Blinds		Solid	Vinyl	0.8	
1124	1964 & 1971 Bldgs	423	XRF	3/2/97	1 Room	102A	Wall	Wall	Solid	Concrete	0	
1125	1964 & 1971 Bldgs	424	XRF	3/2/97	1 Room	102A	Door	Door	Solid	Wood	0	
1126	1964 & 1971 Bldgs	425	XRF	3/2/97	1 Room	102A	Door	Door	Solid	Metal	0.11	
1127	1964 & 1971 Bldgs	426	XRF	3/2/97	1 Room	102A	Ceiling	Hatch	Solid	Metal	0.64	
1128	1964 & 1971 Bldgs	427	XRF	3/2/97	1 Room	102A	Ceiling	Diffuser	Solid	Metal	0.01	
1129	1964 & 1971 Bldgs	428	XRF	3/2/97	1 Room	102A	Closet	Shelf	Solid	Wood	0	
1130	1964 & 1971 Bldgs	429	XRF	3/2/97	1 Room	102A	Shelf	Bracket	Solid	Metal	0.09	
1131	1964 & 1971 Bldgs	430	XRF	3/2/97	1 Room	102B	Wall	Wall	Solid	Concrete	0.01	
1132	1964 & 1971 Bldgs	431	XRF	3/2/97	1 Room	102B	Door	Door	Solid	Wood	0	
1133	1964 & 1971 Bldgs	432	XRF	3/2/97	1 Room	102B	Door	Jamb	Solid	Metal	0.14	
1134	1964 & 1971 Bldgs	433	XRF	3/2/97	1 Room	102B	Wall	Baseboard	Solid	Tile	1.35	
1135	1964 & 1971 Bldgs	434	XRF	3/2/97	1 Room	102B	Door	Header	Solid	Metal	3.75	
1136	1964 & 1971 Bldgs	435	XRF	3/2/97	1 Room	102C	Wall	Wall	Solid	Concrete	0.01	
1137	1964 & 1971 Bldgs	436	XRF	3/2/97	1 Room	102C	Wall	Midle Wall	Solid	Wood	0	
1138	1964 & 1971 Bldgs	437	XRF	3/2/97	1 Room	102C	Door	Door	Solid	Wood	0	
1139	1964 & 1971 Bldgs	438	XRF	3/2/97	1 Room	102C	Door	Jamb	Solid	Metal	0.13	
1140	1964 & 1971 Bldgs	454	XRF	3/2/97	1 Room	103A	Wall	Wall	Solid	Concrete	0.09	
1141	1964 & 1971 Bldgs	455	XRF	3/2/97	1 Room	103A	Door	Door	Solid	Wood	0	
1142	1964 & 1971 Bldgs	456	XRF	3/2/97	1 Room	103A	Door	Jamb	Solid	Metal	0.18	
1143	1964 & 1971 Bldgs	457	XRF	3/2/97	1 Room	103A	Wall	Baseboard	Solid	Tile	1.21	
1144	1964 & 1971 Bldgs	458	XRF	3/2/97	1 Room	103A	Door	Header	Solid	Metal	5.09	
1145	1964 & 1971 Bldgs	459	XRF	3/2/97	1 Room	103B	Wall	Wall	Solid	Concrete	0	
1146	1964 & 1971 Bldgs	460	XRF	3/2/97	1 Room	103B	Wall	Midle Wall	Solid	Wood	0	
1147	1964 & 1971 Bldgs	461	XRF	3/2/97	1 Room	103B		Radiator	Solid	Metal	0.15	
1148	1964 & 1971 Bldgs	24	XRF	3/5/97	1 Room	108C	Wall	Wall	Solid	Concrete	0.02	
1149	1964 & 1971 Bldgs	25	XRF	3/5/97	1 Room	108C	Wall	Wall	Solid	Concrete	0.02	
1150	1964 & 1971 Bldgs	26	XRF	3/5/97	1 Room	108C	Wall	Midle Wall	Solid	Concrete	0.02	
1151	1964 & 1971 Bldgs	27	XRF	3/5/97	1 Room	108C	Wall	Wall	Solid	Plaster	0.2	
1152	1964 & 1971 Bldgs	28	XRF	3/5/97	1 Room	108C	Door	Door	Solid	Wood	0	

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1153	1964 & 1971 Bldgs	29	XRF	3/5/97	1	Room	108C	Door	Jamb	Solid	Metal	0.21
1154	1964 & 1971 Bldgs	30	XRF	3/5/97	1	Room	108C	Wall	Baseboard	Solid	Tile	1.7
1155	1964 & 1971 Bldgs	31	XRF	3/5/97	1	Room	108C	Bookcase	Shelf	Solid	Wood	0
1156	1964 & 1971 Bldgs	32	XRF	3/5/97	1	Room	108C	Cabinet	Door	Solid	Wood	0
1157	1964 & 1971 Bldgs	33	XRF	3/5/97	1	Room	108C	Cabinet	Shelf	Solid	Wood	0.01
1158	1964 & 1971 Bldgs	6	XRF	3/13/97	0	Room	110B	Wall	Midle Wall	Solid	Concrte	0.02
1159	1964 & 1971 Bldgs	7	XRF	3/13/97	0	Room	110B	Wall	Midle Wall	Solid	Concrte	0.01
1160	1964 & 1971 Bldgs	8	XRF	3/13/97	0	Room	110B	Door	Door	Solid	Wood	0.01
1161	1964 & 1971 Bldgs	9	XRF	3/13/97	0	Room	110B	Door	Jamb	Solid	Metal	0.47
1162	1964 & 1971 Bldgs	10	XRF	3/13/97	0	Room	110B	Ceiling		Solid	Concrte	0
1163	1964 & 1971 Bldgs	53	XRF	3/2/97	1	Room	112A	Wall	Midle Wall	Solid	Concrte	0.01
1164	1964 & 1971 Bldgs	54	XRF	3/2/97	1	Room	112A	Cabinet	Door	Solid	Concrte	0
1165	1964 & 1971 Bldgs	55	XRF	3/2/97	1	Room	112A	Cabinet	Shelf	Solid	Concrte	0
1166	1964 & 1971 Bldgs	56	XRF	3/2/97	1	Room	112A	Door	Door	Solid	Wood	0
1167	1964 & 1971 Bldgs	57	XRF	3/2/97	1	Room	112A	Door	Jamb	Solid	Metal	0.34
1168	1964 & 1971 Bldgs	58	XRF	3/2/97	1	Room	112A	Wall	Diffuser	Solid	Metal	0.01
1169	1964 & 1971 Bldgs	59	XRF	3/2/97	1	Room	112A	Window	Casing	Solid	Metal	0.36
1170	1964 & 1971 Bldgs	60	XRF	3/2/97	1	Room	112A	Wall	Baseboard	Solid	Tile	1.35
1171	1964 & 1971 Bldgs	61	XRF	3/2/97	1	Room	112B	Wall	Wall	Solid	Concrte	0.01
1172	1964 & 1971 Bldgs	62	XRF	3/2/97	1	Room	112B	Door	Door	Solid	Wood	0.02
1173	1964 & 1971 Bldgs	63	XRF	3/2/97	1	Room	112B	Door	Jamb	Solid	Metal	0.26
1174	1964 & 1971 Bldgs	64	XRF	3/2/97	1	Room	112B	Cabinet	Door	Solid	Wood	0.01
1175	1964 & 1971 Bldgs	65	XRF	3/2/97	1	Room	112B	Cabinet	Inside	Solid	Wood	0
1176	1964 & 1971 Bldgs	66	XRF	3/2/97	1	Room	112B		Elec Panel	Solid	Metal	0
1177	1964 & 1971 Bldgs	40	XRF	3/5/97	1	Room	114A	Wall	Wall	Solid	Concrte	0.01
1178	1964 & 1971 Bldgs	41	XRF	3/5/97	1	Room	114A	Wall	Wall	Solid	Concrte	0.02
1179	1964 & 1971 Bldgs	42	XRF	3/5/97	1	Room	114A	Wall	Wall	Solid	Drywall	0
1180	1964 & 1971 Bldgs	43	XRF	3/5/97	1	Room	114A	Door	Door	Solid	Wood	0
1181	1964 & 1971 Bldgs	44	XRF	3/5/97	1	Room	114A	Door	Jamb	Solid	Metal	0.09
1182	1964 & 1971 Bldgs	45	XRF	3/5/97	1	Room	114A	Ceiling	Diffuser	Solid	Metal	0
1183	1964 & 1971 Bldgs	66	XRF	3/5/97	1	Room	116A	Wall	Wall	Solid	Concrte	0.01
1184	1964 & 1971 Bldgs	67	XRF	3/5/97	1	Room	116A	Wall	Baseboard	Solid	Tile	1.47
1185	1964 & 1971 Bldgs	68	XRF	3/5/97	1	Room	116A	Wall	Baseboard	Solid	Tile	0.98
1186	1964 & 1971 Bldgs	69	XRF	3/5/97	1	Room	116A	Wall	Baseboard	Solid	Tile	1.49
1187	1964 & 1971 Bldgs	70	XRF	3/5/97	1	Room	116A	Door	Door	Solid	Wood	0
1188	1964 & 1971 Bldgs	71	XRF	3/5/97	1	Room	116A	Door	Jamb	Solid	Metal	0.01
1189	1964 & 1971 Bldgs	132	XRF	3/6/97	1	Room	11A	Wall	Wall	Solid	Concrte	0
1190	1964 & 1971 Bldgs	133	XRF	3/6/97	1	Room	11A	Door	Door	Solid	Wood	0
1191	1964 & 1971 Bldgs	134	XRF	3/6/97	1	Room	11A	Door	Jamb	Solid	Metal	0.38
1192	1964 & 1971 Bldgs	135	XRF	3/6/97	1	Room	11A	Ceiling		Solid	Plaster	0
1193	1964 & 1971 Bldgs	177	XRF	3/14/97	1	Room	120A	Wall	Wall	Solid	Concrte	0.01
1194	1964 & 1971 Bldgs	178	XRF	3/14/97	1	Room	120A	Door	Door	Solid	Wood	0
1195	1964 & 1971 Bldgs	179	XRF	3/14/97	1	Room	120A	Door	Jamb	Solid	Metal	0.27
1196	1964 & 1971 Bldgs	180	XRF	3/14/97	1	Room	120A	Cabinet	Door	Solid	Wood	0
1197	1964 & 1971 Bldgs	174	XRF	3/6/97	1	Room	122A	Wall	Midle Wall	Solid	Drywall	0.02
1198	1964 & 1971 Bldgs	175	XRF	3/6/97	1	Room	122A	Door	Door	Solid	Wood	0
1199	1964 & 1971 Bldgs	176	XRF	3/6/97	1	Room	122A	Door	Jamb	Solid	Metal	0.03
1200	1964 & 1971 Bldgs	177	XRF	3/6/97	1	Room	122A	Floor		Solid	Wood	0
1201	1964 & 1971 Bldgs	104	XRF	3/6/97	1	Room	1241A	Wall	Wall	Solid	Concrte	0.05
1202	1964 & 1971 Bldgs	105	XRF	3/6/97	1	Room	1241A	Wall	Wall	Solid	Concrte	0.03
1203	1964 & 1971 Bldgs	106	XRF	3/6/97	1	Room	1241A	Door	Door	Solid	Wood	0
1204	1964 & 1971 Bldgs	107	XRF	3/6/97	1	Room	1241A	Door	Jamb	Solid	Metal	0.24
1205	1964 & 1971 Bldgs	108	XRF	3/6/97	1	Room	1241B	Wall	Wall	Solid	Concrte	0.02
1206	1964 & 1971 Bldgs	109	XRF	3/6/97	1	Room	1241B	Wall	Wall	Solid	Concrte	0.06
1207	1964 & 1971 Bldgs	110	XRF	3/6/97	1	Room	1241B	Door	Door	Solid	Wood	0
1208	1964 & 1971 Bldgs	111	XRF	3/6/97	1	Room	1241B	Door	Jamb	Solid	Metal	0.23
1209	1964 & 1971 Bldgs	112	XRF	3/6/97	1	Room	1241C	Wall	Wall	Solid	Concrte	0.02
1210	1964 & 1971 Bldgs	113	XRF	3/6/97	1	Room	1241C	Wall	Midle Wall	Solid	Wood	0
1211	1964 & 1971 Bldgs	114	XRF	3/6/97	1	Room	1241C	Door	Door	Solid	Wood	0
1212	1964 & 1971 Bldgs	115	XRF	3/6/97	1	Room	1241C	Door	Jamb	Solid	Metal	0.2
1213	1964 & 1971 Bldgs	116	XRF	3/6/97	1	Room	1241C	Bulletin	Board	Solid	Wood	0
1214	1964 & 1971 Bldgs	32	XRF	3/6/97	1	Room	124A	Wall	Wall	Solid	Concrte	0
1215	1964 & 1971 Bldgs	33	XRF	3/6/97	1	Room	124A	Wall	Wall	Solid	Concrte	0.04
1216	1964 & 1971 Bldgs	34	XRF	3/6/97	1	Room	124A	Door	Door	Solid	Wood	0

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1217	1964 & 1971 Bldgs	35	XRF	3/6/97	1	Room	124A	Door	Jamb	Solid	Metal	0.21
1218	1964 & 1971 Bldgs	36	XRF	3/6/97	1	Room	124A	Cabinet	Door	Solid	Wood	0
1219	1964 & 1971 Bldgs	37	XRF	3/6/97	1	Room	124A	Cabinet	Inside	Solid	Wood	0.01
1220	1964 & 1971 Bldgs	38	XRF	3/6/97	1	Room	124A	Wall	Baseboard	Solid	Tile	1.23
1221	1964 & 1971 Bldgs	49	XRF	3/13/97	0	Room	160A	Wall	Wall	Solid	Concrete	0.01
1222	1964 & 1971 Bldgs	50	XRF	3/13/97	0	Room	160A	Door	Door	Solid	Wood	0
1223	1964 & 1971 Bldgs	51	XRF	3/13/97	0	Room	160A	Door	Jamb	Solid	Metal	0.27
1224	1964 & 1971 Bldgs	52	XRF	3/13/97	0	Room	160A	Bulletin	Board	Solid	Wood	0
1225	1964 & 1971 Bldgs	53	XRF	3/13/97	0	Room	160A	Locker		Solid	Metal	0
1226	1964 & 1971 Bldgs	10	XRF	2/28/97	2	Room	207A	Wall	Wall	Solid	Concrete	0.01
1227	1964 & 1971 Bldgs	11	XRF	2/28/97	2	Room	207A	Door	Door	Solid	Wood	0
1228	1964 & 1971 Bldgs	12	XRF	2/28/97	2	Room	207A	Ceiling		Solid	Concrete	0.02
1229	1964 & 1971 Bldgs	76	XRF	2/28/97	2	Room	212A	Wall	Wall	Solid	Concrete	0.01
1230	1964 & 1971 Bldgs	77	XRF	2/28/97	2	Room	212A	Door	Door	Solid	Wood	0.01
1231	1964 & 1971 Bldgs	78	XRF	2/28/97	2	Room	212A		Radiator	Solid	Metal	0.19
1232	1964 & 1971 Bldgs	94	XRF	2/28/97	2	Room	213A	Wall	Wall	Solid	Concrete	0.01
1233	1964 & 1971 Bldgs	95	XRF	2/28/97	2	Room	213A	Wall	Wall	Solid	Concrete	0.03
1234	1964 & 1971 Bldgs	96	XRF	2/28/97	2	Room	213A	Door	Door	Solid	Wood	0
1235	1964 & 1971 Bldgs	97	XRF	2/28/97	2	Room	213A	Ceiling		Solid	Concrete	0.01
1236	1964 & 1971 Bldgs	148	XRF	2/28/97	2	Room	217A	Wall	Wall	Solid	Concrete	0.02
1237	1964 & 1971 Bldgs	149	XRF	2/28/97	2	Room	217A	Wall	Midle Wall	Solid	Concrete	1.47
1238	1964 & 1971 Bldgs	150	XRF	2/28/97	2	Room	217A	Wall	Wall	Solid	Concrete	0.03
1239	1964 & 1971 Bldgs	151	XRF	2/28/97	2	Room	217A	Door	Door	Solid	Wood	0
1240	1964 & 1971 Bldgs	152	XRF	2/28/97	2	Room	217A	Door	Casing	Solid	Metal	0.3
1241	1964 & 1971 Bldgs	209	XRF	3/1/97	2	Room	223A	Wall	Wall	Solid	Concrete	0.03
1242	1964 & 1971 Bldgs	210	XRF	3/1/97	2	Room	223A	Wall	Wall	Solid	Concrete	0.02
1243	1964 & 1971 Bldgs	211	XRF	3/1/97	2	Room	223A	Door	Door	Solid	Wood	0
1244	1964 & 1971 Bldgs	212	XRF	3/1/97	2	Room	223A	Door	Header	Solid	Metal	5.09
1245	1964 & 1971 Bldgs	227	XRF	3/1/97	2	Room	224A	Door	Door	Solid	Wood	0.01
1246	1964 & 1971 Bldgs	228	XRF	3/1/97	2	Room	224A	Door	Header	Solid	Metal	5.09
1247	1964 & 1971 Bldgs	316	XRF	3/1/97	2	Room	230A	Wall	Wall	Solid	Concrete	0.08
1248	1964 & 1971 Bldgs	317	XRF	3/1/97	2	Room	230A	Wall	Wall	Solid	Concrete	0.02
1249	1964 & 1971 Bldgs	318	XRF	3/1/97	2	Room	230A	Wall	Midle Wall	Solid	Drywall	0
1250	1964 & 1971 Bldgs	319	XRF	3/1/97	2	Room	230A	Door	Door	Solid	Wood	0.02
1251	1964 & 1971 Bldgs	320	XRF	3/1/97	2	Room	230A	Door	Jamb	Solid	Metal	0.28
1252	1964 & 1971 Bldgs	54	XRF	3/13/97	0	Room	298A	Wall	Wall	Solid	Concrete	0.01
1253	1964 & 1971 Bldgs	55	XRF	3/13/97	0	Room	298A	Wall	Wall	Solid	Concrete	0.01
1254	1964 & 1971 Bldgs	56	XRF	3/13/97	0	Room	298A	Wall	Midle Wall	Solid	Concrete	0.01
1255	1964 & 1971 Bldgs	57	XRF	3/13/97	0	Room	298A	Door	Door	Solid	Wood	0
1256	1964 & 1971 Bldgs	58	XRF	3/13/97	0	Room	298A	Door	Jamb	Solid	Metal	0.25
1257	1964 & 1971 Bldgs	59	XRF	3/13/97	0	Room	298A	Wall	Midle Wall	Solid	Tile	1.5
1258	1964 & 1971 Bldgs	60	XRF	3/13/97	0	Room	298A	Ceiling		Solid	Plaster	0.03
1259	1964 & 1971 Bldgs	61	XRF	3/13/97	0	Room	298A	Ceiling		Solid	Plaster	0.01
1260	1964 & 1971 Bldgs	62	XRF	3/13/97	0	Room	298A	Ceiling	Diffuser	Solid	Metal	0
1261	1964 & 1971 Bldgs	63	XRF	3/13/97	0	Room	298A	Ceiling	Diffuser	Solid	Metal	0.04
1262	1964 & 1971 Bldgs	64	XRF	3/13/97	0	Room	298A	Door	Door	Solid	Metal	0.27
1263	1964 & 1971 Bldgs	65	XRF	3/13/97	0	Room	298A	Door	Jamb	Solid	Metal	0.33
1264	1964 & 1971 Bldgs	66	XRF	3/13/97	0	Room	298A	Bath	Partitian	Solid	Metal	0.01
1265	1964 & 1971 Bldgs	67	XRF	3/13/97	0	Room	298A	Bench		Solid	Metal	0.24
1266	1964 & 1971 Bldgs	68	XRF	3/13/97	0	Room	298A	Shelf	Bracket	Solid	Metal	0
1267	1964 & 1971 Bldgs	69	XRF	3/13/97	0	Room	298A	Shelf	Bracket	Solid	Metal	0.06
1268	1964 & 1971 Bldgs	70	XRF	3/13/97	0	Room	298A	Locker		Solid	Metal	0
1269	1964 & 1971 Bldgs	71	XRF	3/13/97	0	Room	298A	Locker		Solid	Metal	0
1270	1964 & 1971 Bldgs	72	XRF	3/13/97	0	Room	298A	Locker		Solid	Metal	1.53
1271	1964 & 1971 Bldgs	73	XRF	3/13/97	0	Room	298A	Locker		Solid	Metal	0.03
1272	1964 & 1971 Bldgs	74	XRF	3/13/97	0	Room	298A	Locker		Solid	Metal	0.01
1273	1964 & 1971 Bldgs	75	XRF	3/13/97	0	Room	298A	Locker		Solid	Metal	0.23
1274	1964 & 1971 Bldgs	76	XRF	3/13/97	0	Room	298A	Locker		Solid	Metal	0.09
1275	1964 & 1971 Bldgs	77	XRF	3/13/97	0	Room	298A	Locker		Solid	Metal	0
1276	1964 & 1971 Bldgs	78	XRF	3/13/97	0	Room	298A	Locker		Solid	Metal	0.01
1277	1964 & 1971 Bldgs	79	XRF	3/13/97	0	Room	298A	Locker		Solid	Metal	0
1278	1964 & 1971 Bldgs	80	XRF	3/13/97	0	Room	298A	Stairs	Hand rail	Solid	Metal	0
1279	1964 & 1971 Bldgs	81	XRF	3/13/97	0	Room	298A	Stairs	Hand rail	Solid	Wood	0
1280	1964 & 1971 Bldgs	82	XRF	3/13/97	0	Room	298A	Bulletin	Board	Solid	Wood	1.02

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1281	1964 & 1971 Bldgs	83	XRF	3/13/97	0	Room	298A	Ceiling		Solid	Concrte	0
1282	1964 & 1971 Bldgs	62	XRF	2/16/97	3	Room	305A	Wall	Wall	Solid	Concrte	0.05
1283	1964 & 1971 Bldgs	63	XRF	2/16/97	3	Room	305A	Wall	Wall	Solid	Concrte	0.01
1284	1964 & 1971 Bldgs	64	XRF	2/16/97	3	Room	305A	Door	Door	Solid	Wood	0.01
1285	1964 & 1971 Bldgs	65	XRF	2/16/97	3	Room	305A	Door	Jamb	Solid	Metal	0.16
1286	1964 & 1971 Bldgs	66	XRF	2/16/97	3	Room	305A	Wall	Baseboard	Solid	Concrte	1.1
1287	1964 & 1971 Bldgs	67	XRF	2/16/97	3	Room	305A		Radiator	Solid	Metal	0.32
1288	1964 & 1971 Bldgs	68	XRF	2/16/97	3	Room	305A	Cabinet	Door	Solid	Wood	0.01
1289	1964 & 1971 Bldgs	69	XRF	2/16/97	3	Room	305A	Cabinet	Floor	Solid	Wood	0.02
1290	1964 & 1971 Bldgs	55	XRF	2/19/97	3	Room	310B	Wall	Midle Wall	Solid	Concrte	0.01
1291	1964 & 1971 Bldgs	56	XRF	2/19/97	3	Room	310B	Door	Door	Solid	Wood	0.01
1292	1964 & 1971 Bldgs	57	XRF	2/19/97	3	Room	310B	Door	Jamb	Solid	Metal	0.13
1293	1964 & 1971 Bldgs	58	XRF	2/19/97	3	Room	310C	Wall	Midle Wall	Solid	Concrte	0.02
1294	1964 & 1971 Bldgs	59	XRF	2/19/97	3	Room	310C	Wall	Baseboard	Solid	Tile	1.94
1295	1964 & 1971 Bldgs	60	XRF	2/19/97	3	Room	310C	Cabinet	Door	Solid	Wood	0.02
1296	1964 & 1971 Bldgs	61	XRF	2/19/97	3	Room	310C	Cabinet	Door	Solid	Wood	0.11
1297	1964 & 1971 Bldgs	73	XRF	2/19/97	3	Room	311A	Wall	Midle Wall	Solid	Concrte	0.05
1298	1964 & 1971 Bldgs	74	XRF	2/19/97	3	Room	311A	Door	Door	Solid	Wood	0.01
1299	1964 & 1971 Bldgs	76	XRF	2/19/97	3	Room	311A	Door	Jamb	Solid	Metal	0.1
1300	1964 & 1971 Bldgs	77	XRF	2/19/97	3	Room	311B	Wall	Midle Wall	Solid	Concrte	0.03
1301	1964 & 1971 Bldgs	78	XRF	2/19/97	3	Room	311B	Wall	Baseboard	Solid	Tile	1.25
1302	1964 & 1971 Bldgs	79	XRF	2/19/97	3	Room	311B	Cabinet	Outside	Solid	Wood	0.04
1303	1964 & 1971 Bldgs	80	XRF	2/19/97	3	Room	311B	Window	Mullion	Solid	Metal	0.03
1304	1964 & 1971 Bldgs	81	XRF	2/19/97	3	Room	311B		Radiator	Solid	Metal	0
1305	1964 & 1971 Bldgs	82	XRF	2/19/97	3	Room	311B	Door	Header	Solid	Metal	5.09
1306	1964 & 1971 Bldgs	63	XRF	2/19/97	3	Room	311C	Wall	Wall	Solid	Concrte	0.01
1307	1964 & 1971 Bldgs	64	XRF	2/19/97	3	Room	311C	Wall	Wall	Solid	Concrte	0.02
1308	1964 & 1971 Bldgs	65	XRF	2/19/97	3	Room	311C	Door	Door	Solid	Wood	0.01
1309	1964 & 1971 Bldgs	66	XRF	2/19/97	3	Room	311C	Door	Jamb	Solid	Metal	0.33
1310	1964 & 1971 Bldgs	67	XRF	2/19/97	3	Room	311C	Wall	Baseboard	Solid	Tile	1.52
1311	1964 & 1971 Bldgs	68	XRF	2/19/97	3	Room	311C		Radiator	Solid	Metal	0.08
1312	1964 & 1971 Bldgs	69	XRF	2/19/97	3	Room	311C	Soffit		Solid	Plaster	0.05
1313	1964 & 1971 Bldgs	70	XRF	2/19/97	3	Room	311C	Soffit		Solid	Metal	0.34
1314	1964 & 1971 Bldgs	71	XRF	2/19/97	3	Room	311C	Cabinet	Door	Solid	Metal	0.01
1315	1964 & 1971 Bldgs	72	XRF	2/19/97	3	Room	311C	Cabinet	Shelf	Solid	Metal	0.05
1316	1964 & 1971 Bldgs	101	XRF	2/19/97	3	Room	312A	Wall	Midle Wall	Solid	Concrte	0.03
1317	1964 & 1971 Bldgs	102	XRF	2/19/97	3	Room	312A	Door	Door	Solid	Wood	0
1318	1964 & 1971 Bldgs	103	XRF	2/19/97	3	Room	312A	Door	Jamb	Solid	Metal	0.36
1319	1964 & 1971 Bldgs	104	XRF	2/19/97	3	Room	312A		Radiator	Solid	Metal	0.11
1320	1964 & 1971 Bldgs	105	XRF	2/19/97	3	Room	312A	Window	Casing	Solid	Metal	0.01
1321	1964 & 1971 Bldgs	106	XRF	2/19/97	3	Room	312A	Cabinet	Shelf	Solid	Wood	0
1322	1964 & 1971 Bldgs	107	XRF	2/19/97	3	Room	312B	Wall	Midle Wall	Solid	Concrte	0.02
1323	1964 & 1971 Bldgs	108	XRF	2/19/97	3	Room	312B	Door	Door	Solid	Wood	0.01
1324	1964 & 1971 Bldgs	109	XRF	2/19/97	3	Room	312B	Door	Jamb	Solid	Metal	0.08
1325	1964 & 1971 Bldgs	110	XRF	2/19/97	3	Room	312B	Wall	Baseboard	Solid	Tile	1.3
1326	1964 & 1971 Bldgs	111	XRF	2/19/97	3	Room	312B	Cabinet	Door	Solid	Wood	0.02
1327	1964 & 1971 Bldgs	112	XRF	2/19/97	3	Room	312B	Wall	Wall	Solid	Concrte	0.07
1328	1964 & 1971 Bldgs	135	XRF	2/19/97	3	Room	314A	Wall	Midle Wall	Solid	Concrte	0.01
1329	1964 & 1971 Bldgs	136	XRF	2/19/97	3	Room	314A	Wall	Wall	Solid	Concrte	0.01
1330	1964 & 1971 Bldgs	137	XRF	2/19/97	3	Room	314A	Wall	Baseboard	Solid	Tile	1.39
1331	1964 & 1971 Bldgs	138	XRF	2/19/97	3	Room	314A		Radiator	Solid	Metal	0.11
1332	1964 & 1971 Bldgs	139	XRF	2/19/97	3	Room	314A	Door	Door	Solid	Wood	0.01
1333	1964 & 1971 Bldgs	140	XRF	2/19/97	3	Room	314A	Door	Header	Solid	Metal	5.09
1334	1964 & 1971 Bldgs	141	XRF	2/19/97	3	Room	314A	Cabinet	Door	Solid	Wood	0.02
1335	1964 & 1971 Bldgs	142	XRF	2/19/97	3	Room	314C	Wall	Midle Wall	Solid	Concrte	0.02
1336	1964 & 1971 Bldgs	143	XRF	2/19/97	3	Room	314C	Door	Door	Solid	Wood	0.01
1337	1964 & 1971 Bldgs	144	XRF	2/19/97	3	Room	314C	Door	Jamb	Solid	Metal	0.1
1338	1964 & 1971 Bldgs	145	XRF	2/19/97	3	Room	314C	Wall	Wall Rgstr	Solid	Metal	0
1339	1964 & 1971 Bldgs	146	XRF	2/19/97	3	Room	314C	Cabinet	Door	Solid	Wood	0.04
1340	1964 & 1971 Bldgs	161	XRF	2/19/97	3	Room	315B	Wall	Wall	Solid	Concrte	0.01
1341	1964 & 1971 Bldgs	162	XRF	2/19/97	3	Room	315B	Wall	Wall	Solid	Concrte	0.02
1342	1964 & 1971 Bldgs	163	XRF	2/19/97	3	Room	315B	Door	Door	Solid	Wood	0
1343	1964 & 1971 Bldgs	164	XRF	2/19/97	3	Room	315B		Radiator	Solid	Metal	0
1344	1964 & 1971 Bldgs	165	XRF	2/19/97	3	Room	315B	Door	Jamb	Solid	Metal	0.26

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1345	1964 & 1971 Bldgs	166	XRF	2/19/97	3	Room	315B	Cabinet	Door	Solid	Wood	0.04
1346	1964 & 1971 Bldgs	28	XRF	2/20/97	3	Room	316A	Wall	Midle Wall	Solid	Concrete	0.01
1347	1964 & 1971 Bldgs	29	XRF	2/20/97	3	Room	316A	Door	Door	Solid	Wood	0.01
1348	1964 & 1971 Bldgs	30	XRF	2/20/97	3	Room	316A	Door	Jamb	Solid	Wood	0.3
1349	1964 & 1971 Bldgs	31	XRF	2/20/97	3	Room	316A		Radiator	Solid	Metal	0.11
1350	1964 & 1971 Bldgs	32	XRF	2/20/97	3	Room	316A	Cabinet	Door	Solid	Wood	0
1351	1964 & 1971 Bldgs	22	XRF	2/20/97	3	Room	316C	Wall	Midle Wall	Solid	Tile	1.36
1352	1964 & 1971 Bldgs	23	XRF	2/20/97	3	Room	316C	Wall	Wall	Solid	Concrete	0.05
1353	1964 & 1971 Bldgs	24	XRF	2/20/97	3	Room	316C	Door	Door	Solid	Wood	0
1354	1964 & 1971 Bldgs	25	XRF	2/20/97	3	Room	316C	Door	Jamb	Solid	Metal	0.38
1355	1964 & 1971 Bldgs	26	XRF	2/20/97	3	Room	316C		Radiator	Solid	Metal	0.1
1356	1964 & 1971 Bldgs	27	XRF	2/20/97	3	Room	316C	Ceiling		Solid	Plaster	0.32
1357	1964 & 1971 Bldgs	14	XRF	2/20/97	3	Room	316D	Wall	Midle Wall	Solid	Tile	1.7
1358	1964 & 1971 Bldgs	15	XRF	2/20/97	3	Room	316D	Door	Door	Solid	Wood	0
1359	1964 & 1971 Bldgs	16	XRF	2/20/97	3	Room	316D	Door	Jamb	Solid	Metal	0.29
1360	1964 & 1971 Bldgs	17	XRF	2/20/97	3	Room	316D	Ceiling		Solid	Plaster	0.46
1361	1964 & 1971 Bldgs	18	XRF	2/20/97	3	Room	316D	Wall	Diffuser	Solid	Metal	0
1362	1964 & 1971 Bldgs	19	XRF	2/20/97	3	Room	316D		Radiator	Solid	Metal	0
1363	1964 & 1971 Bldgs	42	XRF	2/20/97	3	Room	317A	Wall	Wall	Solid	Concrete	0.01
1364	1964 & 1971 Bldgs	43	XRF	2/20/97	3	Room	317A	Wall	Midle Wall	Solid	Concrete	0.02
1365	1964 & 1971 Bldgs	44	XRF	2/20/97	3	Room	317A	Wall	Wall	Solid	Concrete	0.06
1366	1964 & 1971 Bldgs	45	XRF	2/20/97	3	Room	317A	Door	Door	Solid	Wood	0.02
1367	1964 & 1971 Bldgs	46	XRF	2/20/97	3	Room	317A	Door	Jamb	Solid	Metal	0.34
1368	1964 & 1971 Bldgs	47	XRF	2/20/97	3	Room	317A	Cabinet	Outside	Solid	Wood	0.01
1369	1964 & 1971 Bldgs	62	XRF	2/20/97	3	Room	318A	Wall	Wall	Solid	Concrete	0.01
1370	1964 & 1971 Bldgs	63	XRF	2/20/97	3	Room	318A	Door	Door	Solid	Wood	0.01
1371	1964 & 1971 Bldgs	64	XRF	2/20/97	3	Room	318A	Door	Jamb	Solid	Metal	0.31
1372	1964 & 1971 Bldgs	65	XRF	2/20/97	3	Room	318A	Door	Header	Solid	Metal	4.41
1373	1964 & 1971 Bldgs	66	XRF	2/20/97	3	Room	318A		Radiator	Solid	Metal	0.13
1374	1964 & 1971 Bldgs	67	XRF	2/20/97	3	Room	318B	Wall	Wall	Solid	Concrete	0.04
1375	1964 & 1971 Bldgs	68	XRF	2/20/97	3	Room	318B	Door	Door	Solid	Wood	0.02
1376	1964 & 1971 Bldgs	69	XRF	2/20/97	3	Room	318B	Door	Jamb	Solid	Metal	0.28
1377	1964 & 1971 Bldgs	70	XRF	2/20/97	3	Room	318B	Wall	Baseboard	Solid	Tile	1.75
1378	1964 & 1971 Bldgs	71	XRF	2/20/97	3	Room	318B	Cabinet	Floor	Solid	Wood	0.01
1379	1964 & 1971 Bldgs	136	XRF	3/6/97	B0	Room	8B	Wall	Wall	Solid	Concrete	0.01
1380	1964 & 1971 Bldgs	137	XRF	3/6/97	B0	Room	8B	Wall	Wall	Solid	Concrete	0.02
1381	1964 & 1971 Bldgs	138	XRF	3/6/97	B0	Room	8B	Wall	Midle Wall	Solid	Concrete	0.01
1382	1964 & 1971 Bldgs	139	XRF	3/6/97	B0	Room	8B	Floor		Solid	Wood	0
1383	1964 & 1971 Bldgs	140	XRF	3/6/97	B0	Room	8B	Floor		Solid	Wood	0.22
1384	1964 & 1971 Bldgs	141	XRF	3/6/97	B0	Room	8B	Floor		Solid	Wood	0
1385	1964 & 1971 Bldgs	142	XRF	3/6/97	B0	Room	8B	Floor		Solid	Wood	0
1386	1964 & 1971 Bldgs	143	XRF	3/6/97	B0	Room	8B	Floor		Solid	Wood	0
1387	1964 & 1971 Bldgs	144	XRF	3/6/97	B0	Room	8B	Floor		Solid	Wood	0
1388	1964 & 1971 Bldgs	145	XRF	3/6/97	B0	Room	8B	Accordian	Door	Solid	Wood	0
1389	1964 & 1971 Bldgs	146	XRF	3/6/97	B0	Room	8B	Accordian	Door	Solid	Wood	0
1390	1964 & 1971 Bldgs	147	XRF	3/6/97	B0	Room	8B	Bleachers		Solid	Wood	0
1391	1964 & 1971 Bldgs	148	XRF	3/6/97	B0	Room	8B	Door	Door	Solid	Wood	0
1392	1964 & 1971 Bldgs	149	XRF	3/6/97	B0	Room	8B	Door	Jamb	Solid	Metal	0.31
1393	1964 & 1971 Bldgs	150	XRF	3/6/97	B0	Room	8B	Floor		Solid	Tile	0.11
1394	1964 & 1971 Bldgs	151	XRF	3/6/97	B0	Room	8B	Floor		Solid	Wood	0
1395	1964 & 1971 Bldgs	152	XRF	3/6/97	B0	Room	8B	Basketball	Rim	Solid	Metal	0.03
1396	1964 & 1971 Bldgs	153	XRF	3/6/97	B0	Room	8B	Backboard	Truss	Solid	Metal	0
1397	1964 & 1971 Bldgs	1	XRF	3/2/97	1	Room	9B	Wall	Wall	Solid	Concrete	1.6
1398	1964 & 1971 Bldgs	2	XRF	3/2/97	1	Room	9B	Door	Door	Solid	Wood	0.01
1399	1964 & 1971 Bldgs	3	XRF	3/2/97	1	Room	9B	Door	Jamb	Solid	Metal	0.21
1400	1964 & 1971 Bldgs	4	XRF	3/2/97	1	Room	9B	Ceiling		Solid	Plaster	0
1401	1964 & 1971 Bldgs	5	XRF	3/2/97	1	Room	9B	Ceiling	Diffuser	Solid	Metal	0.01
1402	1964 & 1971 Bldgs	6	XRF	3/2/97	1	Room	9B	Bath	Partitlan	Solid	Metal	0
1403	1964 & 1971 Bldgs	7	XRF	3/2/97	1	Room	9B	Floor		Solid	Tile	0.14
1404	1964 & 1971 Bldgs	8	XRF	3/2/97	1	Room	9B	Wall	Diffuser	Solid	Metal	0
1405	1964 & 1971 Bldgs	9	XRF	3/2/97	1	Room	9B	Mirror	Ledge	Solid	Wood	0.07
1406	1964 & 1971 Bldgs	479	XRF	3/2/97	1	Room	9C	Wall	Wall	Solid	Concrete	0
1407	1964 & 1971 Bldgs	480	XRF	3/2/97	1	Room	9C	Wall	Wall	Solid	Concrete	0.03
1408	1964 & 1971 Bldgs	481	XRF	3/2/97	1	Room	9C	Door	Door	Solid	Wood	0

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1409	1964 & 1971 Bldgs	482	XRF	3/2/97	1	Room	9C	Door	Jamb	Solid	Metal	0.23
1410	1964 & 1971 Bldgs	483	XRF	3/2/97	1	Room	9C	Soffit		Solid	Plaster	0.41
1411	1964 & 1971 Bldgs	485	XRF	3/2/97	1	Room	9C	Soffit		Solid	Metal	0.26
1412	1964 & 1971 Bldgs	486	XRF	3/2/97	1	Room	9C	Ceiling		Solid	Concrete	0.01
1413	1964 & 1971 Bldgs	487	XRF	3/2/97	1	Room	9C	Wall	Diffuser	Solid	Metal	0
1414	1964 & 1971 Bldgs	488	XRF	3/2/97	1	Room	9C		Elec Panel	Solid	Metal	0.01
1415	1964 & 1971 Bldgs	489	XRF	3/2/97	1	Room	9C	Cabinet	Door	Solid	Wood	0.01
1416	1964 & 1971 Bldgs	490	XRF	3/2/97	1	Room	9C	Cabinet	Shelf	Solid	Wood	0.01
1417	1964 & 1971 Bldgs	491	XRF	3/2/97	1	Room	9C	Bulletin	Board	Solid	Wood	0.08
1418	1964 & 1971 Bldgs	492	XRF	3/2/97	1	Room	9C	Bulletin	Board	Solid	Wood	0
1419	1964 & 1971 Bldgs	10	XRF	3/2/97	1	Room	9C	Door	Door	Solid	Metal	0.39
1420	1964 & 1971 Bldgs	11	XRF	3/2/97	1	Room	9C	Door	Jamb	Solid	Metal	0.09
1421	1964 & 1971 Bldgs	12	XRF	3/2/97	1	Room	9C	Door	Header	Solid	Metal	5.09
1422	1964 & 1971 Bldgs	128	XRF	3/14/97	1	Stairwell	A	Wall	Wall	Solid	Concrete	0.02
1423	1964 & 1971 Bldgs	129	XRF	3/14/97	1	Stairwell	A	Wall	Wall	Solid	Concrete	1.36
1424	1964 & 1971 Bldgs	130	XRF	3/14/97	1	Stairwell	A	Door	Door	Solid	Metal	0.25
1425	1964 & 1971 Bldgs	131	XRF	3/14/97	1	Stairwell	A	Door	Jamb	Solid	Metal	0.3
1426	1964 & 1971 Bldgs	132	XRF	3/14/97	1	Stairwell	A	Door	Header	Solid	Metal	5.09
1427	1964 & 1971 Bldgs	133	XRF	3/14/97	1	Stairwell	A	Ceiling	Peg Board	Solid	Wood	0.03
1428	1964 & 1971 Bldgs	134	XRF	3/14/97	1	Stairwell	A		Elec Panel	Solid	Metal	0
1429	1964 & 1971 Bldgs	135	XRF	3/14/97	1	Stairwell	A	Wall	Diffuser	Solid	Metal	0.23
1430	1964 & 1971 Bldgs	136	XRF	3/14/97	1	Stairwell	A	Stairs	Hand rail	Solid	Wood	0
1431	1964 & 1971 Bldgs	137	XRF	3/14/97	1	Stairwell	A	Speaker	Cover	Solid	Metal	0
1432	1964 & 1971 Bldgs	138	XRF	3/14/97	1	Stairwell	A	Security	Gate	Solid	Metal	0
1433	1964 & 1971 Bldgs	139	XRF	3/14/97	1	Stairwell	B	Wall	Wall	Solid	Concrete	0.01
1434	1964 & 1971 Bldgs	140	XRF	3/14/97	1	Stairwell	B	Wall	Wall	Solid	Concrete	1.22
1435	1964 & 1971 Bldgs	141	XRF	3/14/97	3	Stairwell	B	Door	Door	Solid	Metal	0.32
1436	1964 & 1971 Bldgs	142	XRF	3/14/97	3	Stairwell	B	Door	Jamb	Solid	Metal	0.16
1437	1964 & 1971 Bldgs	143	XRF	3/14/97	3	Stairwell	B	Ceiling	Peg Board	Solid	Wood	0.04
1438	1964 & 1971 Bldgs	144	XRF	3/14/97	1	Stairwell	B		Radiator	Solid	Metal	0.01
1439	1964 & 1971 Bldgs	145	XRF	3/14/97	2	Stairwell	B	Stairs	Hand rail	Solid	Wood	0
1440	1964 & 1971 Bldgs	146	XRF	3/14/97	2	Stairwell	B		Elec Panel	Solid	Metal	0
1441	1964 & 1971 Bldgs	147	XRF	3/14/97	1	Stairwell	B	Security	Gate	Solid	Metal	0
1442	1964 & 1971 Bldgs	148	XRF	3/14/97	1	Stairwell	B	Wall	Middle Wall	Solid	Concrete	0.02
1443	1964 & 1971 Bldgs	149	XRF	3/14/97	1	Stairwell	C	Wall	Wall	Solid	Concrete	0.01
1444	1964 & 1971 Bldgs	150	XRF	3/14/97	1	Stairwell	C	Wall	Wall	Solid	Concrete	1.27
1445	1964 & 1971 Bldgs	151	XRF	3/14/97	1	Stairwell	C	Door	Door	Solid	Metal	0.33
1446	1964 & 1971 Bldgs	152	XRF	3/14/97	1	Stairwell	C	Door	Jamb	Solid	Metal	0.34
1447	1964 & 1971 Bldgs	153	XRF	3/14/97	1	Stairwell	C	Ceiling	Peg Board	Solid	Wood	0
1448	1964 & 1971 Bldgs	154	XRF	3/14/97	1	Stairwell	C		Elec Panel	Solid	Metal	0
1449	1964 & 1971 Bldgs	155	XRF	3/14/97	1	Stairwell	C	Stairs	Hand rail	Solid	Wood	0
1450	1964 & 1971 Bldgs	156	XRF	3/14/97	1	Stairwell	C		Radiator	Solid	Metal	0
1451	1971 Bldg.	62	XRF	4/10/97	1	Auditoriu		1 Wall	Midle Wall	Solid	Concrete	0.01
1452	1971 Bldg.	63	XRF	4/10/97	1	Auditoriu		1 Door	Door	Solid	Metal	0.08
1453	1971 Bldg.	64	XRF	4/10/97	1	Auditoriu		1 Door	Jamb	Solid	Metal	0.05
1454	1971 Bldg.	65	XRF	4/10/97	1	Auditoriu		1 Door	Door	Solid	Wood	0
1455	1971 Bldg.	66	XRF	4/10/97	1	Auditoriu		1 Door	Jamb	Solid	Metal	0.04
1456	1971 Bldg.	67	XRF	4/10/97	1	Auditoriu		1	Radiator	Solid	Metal	0.04
1457	1971 Bldg.	68	XRF	4/10/97	1	Auditoriu		1 Wall	Diffuser	Solid	Metal	0
1458	1971 Bldg.	69	XRF	4/10/97	1	Auditoriu		1 Ceiling		Solid	Plaster	0.03
1459	1971 Bldg.	70	XRF	4/10/97	1	Auditoriu		1 Ceiling	Diffuser	Solid	Metal	0.02
1460	1971 Bldg.	71	XRF	4/10/97	1	Auditoriu		1 Chair	Rail	Solid	Wood	0
1461	1971 Bldg.	72	XRF	4/10/97	1	Auditoriu		1 Chair	Seat	Solid	Wood	0
1462	1971 Bldg.	73	XRF	4/10/97	1	Auditoriu		1 Chair	Seat	Solid	Metal	0.01
1463	1971 Bldg.	74	XRF	4/10/97	1	Auditoriu		1 Floor		Solid	Wood	0.04
1464	1971 Bldg.	75	XRF	4/10/97	1	Auditoriu		1 Floor		Solid	Wood	0.01
1465	1971 Bldg.	90	XRF	4/10/97	2	Auditoriu	Upper	Stairs	Hand rail	Solid	Metal	0.08
1466	1971 Bldg.	91	XRF	4/10/97	2	Auditoriu	Upper	Door	Door	Solid	Wood	0
1467	1971 Bldg.	92	XRF	4/10/97	2	Auditoriu	Upper	Door	Jamb	Solid	Metal	0.07
1468	1971 Bldg.	21	XRF	4/10/97	1	Hall		2 Wall	Midle Wall	Solid	Concrete	0
1469	1971 Bldg.	22	XRF	4/10/97	1	Hall		2 Ceiling		Solid	Plaster	0.03
1470	1971 Bldg.	23	XRF	4/10/97	1	Hall		2 Ceiling	Diffuser	Solid	Metal	0.01
1471	1971 Bldg.	24	XRF	4/10/97	1	Hall		2 Door	Door	Solid	Wood	0
1472	1971 Bldg.	25	XRF	4/10/97	1	Hall		2 Door	Jamb	Solid	Metal	0.04

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1473	1971 Bldg.	26	XRF	4/10/97	1	Hall	2		Radiator	Solid	Metal	0.01
1474	1971 Bldg.	6	XRF	4/10/97	1	Hall	1430	Wall	Wall	Solid	Concrete	0.04
1475	1971 Bldg.	7	XRF	4/10/97	1	Hall	1430	Wall	Midle Wall	Solid	Plaster	0
1476	1971 Bldg.	8	XRF	4/10/97	1	Hall	1430	Wall	Wall	Solid	Drywall	0.03
1477	1971 Bldg.	9	XRF	4/10/97	1	Hall	1430	Door	Door	Solid	Wood	0.01
1478	1971 Bldg.	10	XRF	4/10/97	1	Hall	1430	Door	Jamb	Solid	Metal	0.04
1479	1971 Bldg.	11	XRF	4/10/97	1	Hall	1430	Door	Door	Solid	Wood	0.02
1480	1971 Bldg.	12	XRF	4/10/97	1	Hall	1430	Door	Jamb	Solid	Metal	0.08
1481	1971 Bldg.	13	XRF	4/10/97	1	Hall	1430		Radiator	Solid	Metal	0.01
1482	1971 Bldg.	14	XRF	4/10/97	1	Hall	1430	Ceiling		Solid	Plaster	0.02
1483	1971 Bldg.	15	XRF	4/10/97	1	Hall	1430		Radiator	Solid	Metal	0.07
1484	1971 Bldg.	16	XRF	4/10/97	1	Hall	1430	Wall	Wall Rgstr	Solid	Metal	0
1485	1971 Bldg.	17	XRF	4/10/97	1	Hall	1430	Wall	Wall Rgstr	Solid	Metal	0
1486	1971 Bldg.	18	XRF	4/10/97	1	Hall	1430	Bench		Solid	Wood	0
1487	1971 Bldg.	19	XRF	4/10/97	1	Hall	1430	Bench	Support	Solid	Metal	0.05
1488	1971 Bldg.	20	XRF	4/10/97	1	Hall	1430	Security	Gate	Solid	Metal	0
1489	1971 Bldg.	42	XRF	4/10/97	1	Restroom	B	Wall	Midle Wall	Solid	Concrete	0.01
1490	1971 Bldg.	43	XRF	4/10/97	1	Restroom	B	Door	Door	Solid	Wood	0.01
1491	1971 Bldg.	44	XRF	4/10/97	1	Restroom	B	Door	Jamb	Solid	Metal	0.01
1492	1971 Bldg.	45	XRF	4/10/97	1	Restroom	B	Ceiling		Solid	Plaster	0.04
1493	1971 Bldg.	46	XRF	4/10/97	1	Restroom	B	Ceiling	Diffuser	Solid	Metal	0.02
1494	1971 Bldg.	52	XRF	4/10/97	1	Restroom	G	Wall	Midle Wall	Solid	Concrete	0
1495	1971 Bldg.	53	XRF	4/10/97	1	Restroom	G	Door	Door	Solid	Wood	0
1496	1971 Bldg.	54	XRF	4/10/97	1	Restroom	G	Door	Jamb	Solid	Metal	0.03
1497	1971 Bldg.	55	XRF	4/10/97	1	Restroom	G	Ceiling		Solid	Plaster	0.02
1498	1971 Bldg.	56	XRF	4/10/97	1	Restroom	G	Wall	Bthrm Stl	Solid	Metal	0.05
1499	1971 Bldg.	35	XRF	4/10/97	1	Room	1032	Ceiling		Solid	Plaster	0.08
1500	1971 Bldg.	36	XRF	4/10/97	1	Room	1032	Door	Door	Solid	Wood	0
1501	1971 Bldg.	37	XRF	4/10/97	1	Room	1032	Door	Jamb	Solid	Metal	0.07
1502	1971 Bldg.	38	XRF	4/10/97	1	Room	1032		Elec Panel	Solid	Metal	0.01
1503	1971 Bldg.	27	XRF	4/10/97	1	Room	1038	Wall	Midle Wall	Solid	Concrete	0.04
1504	1971 Bldg.	28	XRF	4/10/97	1	Room	1038	Door	Door	Solid	Wood	0
1505	1971 Bldg.	29	XRF	4/10/97	1	Room	1038	Door	Jamb	Solid	Metal	0.05
1506	1971 Bldg.	30	XRF	4/10/97	1	Room	1038	Ceiling		Solid	Plaster	0.02
1507	1971 Bldg.	31	XRF	4/10/97	1	Room	1038	Ceiling	Diffuser	Solid	Metal	0.02
1508	1971 Bldg.	32	XRF	4/10/97	1	Room	1038		Radiator	Solid	Metal	0.01
1509	1971 Bldg.	33	XRF	4/10/97	1	Room	1038	Wall	Bthrm Stl	Solid	Metal	0.07
1510	1971 Bldg.	34	XRF	4/10/97	1	Room	1038	Door	Stall Door	Solid	Metal	0.08
1511	1971 Bldg.	80	XRF	4/10/97	1	Room	1052	Wall	Midle Wall	Solid	Concrete	0.02
1512	1971 Bldg.	81	XRF	4/10/97	1	Room	1052	Door	Door	Solid	Wood	0
1513	1971 Bldg.	82	XRF	4/10/97	1	Room	1052	Door	Jamb	Solid	Metal	0.04
1514	1971 Bldg.	83	XRF	4/10/97	1	Room	1052	Door	Bthrm Stl	Solid	Metal	0.02
1515	1971 Bldg.	84	XRF	4/10/97	1	Room	1052	Ceiling		Solid	Plaster	0.02
1516	1971 Bldg.	85	XRF	4/10/97	1	Room	1052	Ceiling	Diffuser	Solid	Metal	0.03
1517	1971 Bldg.	76	XRF	4/10/97	1	Room	1061	Wall	Midle Wall	Solid	Concrete	0.02
1518	1971 Bldg.	77	XRF	4/10/97	1	Room	1061	Door	Door	Solid	Wood	0.01
1519	1971 Bldg.	78	XRF	4/10/97	1	Room	1061	Door	Jamb	Solid	Metal	0.05
1520	1971 Bldg.	79	XRF	4/10/97	1	Room	1061	Ceiling		Solid	Plaster	0
1521	1971 Bldg.	57	XRF	4/10/97	1	Room	1870	Door	Door	Solid	Metal	0.03
1522	1971 Bldg.	58	XRF	4/10/97	1	Room	1870	Door	Jamb	Solid	Metal	0.03
1523	1971 Bldg.	59	XRF	4/10/97	1	Room	1870	Door	Door	Solid	Wood	0
1524	1971 Bldg.	60	XRF	4/10/97	1	Room	1870	Door	Jamb	Solid	Metal	0.05
1525	1971 Bldg.	61	XRF	4/10/97	1	Room	1870	Stairs	Hand rail	Solid	Metal	0.06
1526	1971 Bldg.	48	XRF	4/10/97	1	Room	1890	Ceiling		Solid	Plaster	0
1527	1971 Bldg.	49	XRF	4/10/97	1	Room	1890	Door	Door	Solid	Wood	0
1528	1971 Bldg.	50	XRF	4/10/97	1	Room	1890	Wall	Diffuser	Solid	Metal	0.02
1529	1971 Bldg.	51	XRF	4/10/97	1	Room	1890	Door	Jamb	Solid	Metal	0.06
1530	1971 Bldg.	39	XRF	4/10/97	1	Room	1910	Ceiling		Solid	Plaster	0
1531	1971 Bldg.	40	XRF	4/10/97	1	Room	1910	Door	Door	Solid	Wood	0.01
1532	1971 Bldg.	41	XRF	4/10/97	1	Room	1910	Door	Jamb	Solid	Metal	0.05
1533	1971 Bldg.	110	XRF	4/10/97	1	Room	2000	Wall	Midle Wall	Solid	Plaster	0
1534	1971 Bldg.	99	XRF	4/10/97	1	Room	2038	Wall	Midle Wall	Solid	Plaster	0
1535	1971 Bldg.	100	XRF	4/10/97	1	Room	2038	Door	Door	Solid	Wood	0
1536	1971 Bldg.	101	XRF	4/10/97	1	Room	2038	Door	Jamb	Solid	Metal	0.08

Saint Paul Public Schools  
 Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1537	1971 Bldg.	102	XRF	4/10/97	1	Room	2038	Ceiling		Solid	Plaster	0.01
1538	1971 Bldg.	125	XRF	4/10/97	1	Room	C	Wall	Midle Wall	Solid	Concrete	0.02
1539	1971 Bldg.	126	XRF	4/10/97	1	Room	C	Wall	Midle Wall	Solid	Brick	0.04
1540	1971 Bldg.	127	XRF	4/10/97	1	Room	C	Door	Door	Solid	Wood	0
1541	1971 Bldg.	128	XRF	4/10/97	1	Room	C	Door	Jamb	Solid	Metal	0.02
1542	1971 Bldg.	111	XRF	4/10/97	1	Room	L	Wall	Wall	Solid	Concrete	0.02
1543	1971 Bldg.	112	XRF	4/10/97	1	Room	L	Wall	Wall	Solid	Concrete	0.03
1544	1971 Bldg.	113	XRF	4/10/97	1	Room	L		Column	Solid	Plaster	0
1545	1971 Bldg.	114	XRF	4/10/97	1	Room	L		Column	Solid	Plaster	0.01
1546	1971 Bldg.	115	XRF	4/10/97	1	Room	L	Door	Door	Solid	Wood	0
1547	1971 Bldg.	116	XRF	4/10/97	1	Room	L	Door	Jamb	Solid	Metal	0.03
1548	1971 Bldg.	117	XRF	4/10/97	1	Room	L	Wall	Baseboard	Solid	Tile	0
1549	1971 Bldg.	118	XRF	4/10/97	1	Room	L	Wall	Wall	Solid	Brick	0.03
1550	1971 Bldg.	119	XRF	4/10/97	1	Room	L	Ceiling		Solid	Plaster	0.01
1551	1971 Bldg.	120	XRF	4/10/97	1	Room	L	Wall	Bthrm Stll	Solid	Metal	0.01
1552	1971 Bldg.	121	XRF	4/10/97	1	Room	L		Locker	Solid	Metal	0.99
1553	1971 Bldg.	122	XRF	4/10/97	1	Room	L	Wall	Wall Rgstr	Solid	Metal	0
1554	1971 Bldg.	123	XRF	4/10/97	1	Room	L	Door	Door	Solid	Metal	0.02
1555	1971 Bldg.	124	XRF	4/10/97	1	Room	L	Door	Jamb	Solid	Metal	0.04
1556	1971 Bldg.	87	XRF	4/10/97	1	Stairwell	0	Stairs	Wall	Solid	Plaster	0
1557	1971 Bldg.	88	XRF	4/10/97	1	Stairwell	0	Stairs	Rail cap	Solid	Plaster	0.01
1558	1971 Bldg.	89	XRF	4/10/97	1	Stairwell	0	Stairs	Hand rail	Solid	Wood	0
1559	1971 Bldg.	93	XRF	4/10/97	1	Stairwell	2	Wall	Midle Wall	Solid	Concrete	0.03
1560	1971 Bldg.	94	XRF	4/10/97	1	Stairwell	2	Wall	Midle Wall	Solid	Plaster	0.01
1561	1971 Bldg.	95	XRF	4/10/97	1	Stairwell	2	Door	Door	Solid	Wood	0
1562	1971 Bldg.	96	XRF	4/10/97	1	Stairwell	2	Door	Jamb	Solid	Metal	0.07
1563	1971 Bldg.	97	XRF	4/10/97	1	Stairwell	2	Stairs	Hand rail	Solid	Wood	0
1564	1971 Bldg.	98	XRF	4/10/97	1	Stairwell	2		Radiator	Solid	Metal	0.03
1565	1971 Bldg.	103	XRF	4/10/97	1	Stairwell	3	Ceiling		Solid	Concrete	0.06
1566	1971 Bldg.	104	XRF	4/10/97	1	Stairwell	3	Wall	Midle Wall	Solid	Plaster	0.01
1567	1971 Bldg.	105	XRF	4/10/97	1	Stairwell	3	Door	Door	Solid	Wood	0
1568	1971 Bldg.	106	XRF	4/10/97	1	Stairwell	3	Door	Jamb	Solid	Metal	0.07
1569	1971 Bldg.	107	XRF	4/10/97	1	Stairwell	3	Stairs	Hand rail	Solid	Wood	0
1570	1971 Bldg.	108	XRF	4/10/97	1	Stairwell	3		Radiator	Solid	Metal	0.06
1571	1971 Bldg.	109	XRF	4/10/97	1	Stairwell	3	Security	Gate	Solid	Metal	0

Saint Paul Public Schools  
 Little School House Highland Park Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1	Highland Park Little School House											
2												
3	Site	Sample #	Analysis	Date	Floor	Area	Room #	Componen	Feature	Condition	Substrate	Result
4	Unkn	71	XRF	6/17/97	1	Room		1 Wall	Wall	Solid	Wood	0.04
5	Unkn	72	XRF	6/17/97	1	Room		1 Wall	Wall	Solid	Plaster	0.03
6	Unkn	73	XRF	6/17/97	1	Room		1 Wall	Baseboar	Solid	Wood	0.01
7	Unkn	74	XRF	6/17/97	1	Room		1 Wall	Baseboar	Solid	Wood	0.01
8	Unkn	75	XRF	6/17/97	1	Room		1 Door	Door	Solid	Wood	0.02
9	Unkn	76	XRF	6/17/97	1	Room		1 Door	Casing	Solid	Wood	0.02
10	Unkn	77	XRF	6/17/97	1	Room		1 Window	Mullion	Solid	Wood	0.15
11	Unkn	78	XRF	6/17/97	1	Room		1 Window	Casing	Solid	Wood	5.09
12	Unkn	79	XRF	6/17/97	1	Room		1 Window	Stool	Solid	Wood	5.09
13	Unkn	80	XRF	6/17/97	1	Room		1 Chalkboar	Rail	Solid	Wood	0.02
14	Unkn	81	XRF	6/17/97	1	Room		1 Chalkboar	Rail	Solid	Wood	0.03
15	Unkn	82	XRF	6/17/97	1	Room	1		Radiator	Solid	Metal	0.1
16	Unkn	83	XRF	6/17/97	1	Room		1 Floor		Solid	Wood	0.02
17	Unkn	84	XRF	6/17/97	1	Room		2 Wall	Wall	Solid	Wood	0.05
18	Unkn	85	XRF	6/17/97	1	Room		2 Wall	Wall	Solid	Wood	0.1
19	Unkn	86	XRF	6/17/97	1	Room		2 Wall	Wall	Solid	Plaster	0.02
20	Unkn	87	XRF	6/17/97	1	Room		2 Wall	Baseboar	Solid	Wood	0.02
21	Unkn	88	XRF	6/17/97	1	Room		2 Door	Door	Solid	Wood	0
22	Unkn	89	XRF	6/17/97	1	Room		2 Door	Casing	Solid	Wood	5.09
23	Unkn	90	XRF	6/17/97	1	Room		2 Window	Stool	Solid	Wood	5.09
24	Unkn	91	XRF	6/17/97	1	Room	2		Elec Panel	Solid	Metal	0
25	Unkn	92	XRF	6/17/97	1	Room	2		Radiator	Solid	Metal	0.03
26	Unkn	93	XRF	6/17/97	1	Room	2		Radiator	Solid	Metal	0.03
27	Unkn	94	XRF	6/17/97	1	Room	2	Wall	Chair rail	Solid	Wood	5.09
28	Unkn	95	XRF	6/17/97	1	Room	2	Floor		Solid	Wood	0.03
29	Unkn	96	XRF	6/17/97	1	Outside	0	Door	Door	Solid	Wood	0
30	Unkn	97	XRF	6/17/97	1	Outside	0	Door	Casing	Solid	Wood	5.09
31	Unkn	98	XRF	6/17/97	1	Outside	0	Window	Shutter	Solid	Wood	0.62
32	Unkn	99	XRF	6/17/97	1	Outside	0	Wall	Wall Rgstr	Solid	Metal	0.03
33	Unkn	100	XRF	6/17/97	1	Outside	0	Window	Sill	Solid	Wood	0.86

## **APPENDIX B**

### **LABORATORY SAMPLE ANALYSIS DATA**

**LABORATORY ANALYSIS REPORT****DATE:** August 6, 1997**PAGE:**

1 Of 1

**CLIENT:** Midwest Environmental Cons.  
5385 401st Ave. NW  
Dalbo, MN 55017**PROJECT NO.:** 071697-200888  
**COLLECTION DATE:** 7/08/97  
**COLLECTED BY:** Client  
**RECEIVED DATE:** 7/16/97  
**PROJECT DESCRIPT.:** 62/0197M**CONTACT:** Richard Cox

<b>SAMPLE #</b>	<b>DESCP.</b>	<b>MDL</b>	<b>LEAD</b> (6010A)	<b>ANALYSIS</b>	<b>RESULTS</b>	<b>DATE</b>
			Units=mg/kg			
L974634-1	M-63	20	1600		1600	8/04/97
L974634-2	M-61	27	5500		ND	8/04/97
L974634-3	M-12	32	5000		ND	8/04/97
L974634-4	M-13	19	460		ND	8/04/97
L974634-5	M-15	32	1100		ND	8/04/97
L974634-6	M-33	56	ND		ND	8/04/97
L974634-7	M-34	61	ND		ND	8/04/97
L974634-8	M-35	39	260		ND	8/06/97
L974634-9	M-108	27	950		ND	8/06/97
L974634-10	M-129	23	74		ND	8/06/97
L974634-11	M-132	38	ND		ND	8/06/97
L974634-12	M-124	34	510		ND	8/06/97
L974634-13	M-136	36	1400		ND	8/06/97

**ND** means Not Detected or below reported MDL**MDL** means Method Detection Limit**mg/kg** means Milligrams Per Kilogram which is equivalent to Parts Per Million (ppm)

This report has been reviewed by me for technical accuracy and completeness. The analyses were performed using EPA or other approved methodologies and the results were reported on an "as received" basis unless otherwise noted. Organic soil analyses were reported on a dry weight basis. The results reported relate only to the items tested. Please contact me if you have any questions or comments regarding this report. Spectrum Labs, Inc. appreciates the opportunity to provide this analytical service for you.

Report Submitted By,

Thomas L. Halverson  
Laboratory ManagerTLH:wmc  
mec218-1

As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.



A member of The Marmon Group of Companies

# Midwest Environmental Consulting, L.L.C.



## CHAIN OF CUSTODY RECORD

5385 401st Ave. NW, Duluth, MN 55017  
612-689-3612/612-757-5541/FAX-612-689-5209

Client Address \_\_\_\_\_  
Contact \_\_\_\_\_

Project Number 62/0197M  
Client S. Paul School District  
Project Hjkline Park S. High School  
Phone/Fax \_\_\_\_\_

Sample ID	Sample Description	Collection Date/Time	Matrix (Vol/Area)	Analysis Requested
B-62/0197M-6337	Loon 7 Plastic White	7-8-97	—	Pb % wt. or ppm
6-3-97 40	Loon 9 Dose Green	—	—	—
6-3-97 78	Loon 9 Dose Grey	—	—	—
6-3-97 80	Loon 9 Duct tape Grey	—	—	—
6-3-97 90	Loon 10 Reeks black	—	—	—
6-3-97 98	Loon 11 painted grey	—	—	—
6-3-97 100	Loon 11 cubing white	—	—	—
6-3-97 105	Loon 12 dose white	—	—	—
6-3-97 109	Loon 12 dose grey	—	—	—
6-3-97 115	Loon 13 Dose brown	—	—	—
6-3-97 116	Loon 13 Dose lensing brown	—	—	—
6-3-97 298	Loon 2 hook green	—	—	—
6-3-97 139	out side pipe grey	—	—	—
6-2-97 528	Loon 5 duct white	—	—	—
6-2-97 210	Cupcasing wrap white	—	—	—

Sampled By: <u>Ben Agius</u> Date: <u>7-8-97</u> Time: <u>11:20</u>	Delivered By: <u>Craig Myers</u> Date: <u>7/14/97</u> Time: <u>11:20</u>
Received By: <u>M. Howell</u> Date: <u>7/16/97</u> Time: <u>11:20</u>	Delivered By: _____ Date: _____ Time: _____
Received By Lab: _____	Disposition of Samples _____
Notes: Site 6	

**LABORATORY ANALYSIS REPORT**

**DATE:** July 31, 1997      **PAGE:** 1 Of 3

**CLIENT:** Midwest Environmental Cons.  
5385 401st Ave. NW  
Duluth, MN 55017      **PROJECT NO.:** 071697-200888  
**COLLECTION DATE:** 7/11/97  
**COLLECTED BY:** Client  
**RECEIVED DATE:** 7/16/97  
**PROJECT DESCRIPT.:** (B/W)62/0197M

**CONTACT:** Richard Cox

<b>ANALYSIS</b>	<b>UNITS</b>	<b>Sample No.:</b>	<b>RESULT</b>	<b>DATE</b>
Lead (6010A)	mg/kg	L974632-1 Sample ID.: 17	690	7/29/97
Lead (6010A)	mg/kg	L974632-2 Sample ID.: 25	1700	7/29/97
Lead (6010A)	ug/ft <sup>2</sup>	L974632-3 Sample ID.: 50	3200	7/29/97
Lead (6010A)	ug/ft <sup>2</sup>	L974632-4 Sample ID.: 5.0	1400	7/29/97
Lead (6010A)	ug/ft <sup>2</sup>	L974632-5 Sample ID.: 50	6000	7/29/97
Lead (6010A)	ug/ft <sup>2</sup>	L974632-6 Sample ID.: 50	7800	7/29/97
Lead (6010A)	ug/ft <sup>2</sup>	L974632-7 Sample ID.: 5.0	74	7/29/97

*ND means Not Detected or below reported MDL*

*MDL means Method Detection Limit*

*mg/kg means Milligrams Per Kilogram which is equivalent to Parts Per Million (ppm)*

*ug/ft<sup>2</sup> means Micrograms Per Square Foot.*

*As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.*



A member of The Marmon Group of Companies

**LABORATORY ANALYSIS REPORT**

**DATE:** July 31, 1997      **PAGE:** 2 Of 3

**CLIENT:** Midwest Environmental Cons.  
5385 401st Ave. NW  
Duluth, MN 55017      **PROJECT NO.:** 071697-200888  
**COLLECTION DATE:** 7/11/97  
**COLLECTED BY:** Client  
**RECEIVED DATE:** 7/16/97  
**PROJECT DESCRIPT.:** (B/W)62/0197M

**CONTACT:** Richard Cox

<u>ANALYSIS</u>	<u>UNITS</u>	<u>Sample No.:</u> <u>Sample ID.:</u>	<u>MDL</u>	<u>RESULT</u>	<u>ANALYSIS</u>	<u>DATE</u>
Lead (6010A)	ug/ft <sup>2</sup>	L974632-8 M-6	5.0	1900		7/29/97
Lead (6010A)	ug/ft <sup>2</sup>	L974632-9 M-7	50	4700		7/29/97
Lead (6010A)	ug/ft <sup>2</sup>	L974632-10 M-8	50	7800		7/29/97
Lead (6010A)	ug/ft <sup>2</sup>	L974632-11 M-9	5.0	66		7/30/97
Lead (6010A)	ug/ft <sup>2</sup>	L974632-12 M-10	50	3400		7/30/97
Lead (6010A)	ug/ft <sup>2</sup>	L974632-13 M-11	50	24,000		7/30/97
Lead (6010A)	ug/ft <sup>2</sup>	L974632-14 M-12	5.0	250		7/30/97

*ND means Not Detected or below reported MDL*

*MDL means Method Detection Limit*

*ug/ft<sup>2</sup> means Micrograms Per Square Foot.*

*As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.*




A member of The Marmon Group of Companies

**LABORATORY ANALYSIS REPORT****DATE:** July 31, 1997**PAGE:**

3 Of 3

**CLIENT:** Midwest Environmental Cons.  
5385 401st Ave. NW  
Dalbo, MN 55017**PROJECT NO.:** 071697-200888  
**COLLECTION DATE:** 7/11/97  
**COLLECTED BY:** Client  
**RECEIVED DATE:** 7/16/97  
**PROJECT DESCRIPT.:** (B/W)62/0197M**CONTACT:** Richard Cox

This report has been reviewed by me for technical accuracy and completeness. The analyses were performed using EPA or other approved methodologies and the results were reported on an "as received" basis unless otherwise noted. Organic soil analyses were reported on a dry weight basis. The results reported relate only to the items tested. Please contact me if you have any questions or comments regarding this report. Spectrum Labs, Inc. appreciates the opportunity to provide this analytical service for you.

*Report Submitted By,*

Thomas L. Halverson  
Laboratory Manager

TLH:wmc  
mec212-1

*As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.*



A member of The Marmon Group of Companies

# Midwest Environmental Consulting, L.L.C.

5385 401st Ave. NW, Dalbo, MN 55017

612-689-3612/612-757-5541/FAX-612-689-5209

Client Address \_\_\_\_\_

Contact \_\_\_\_\_

# CHAIN OF CUSTODY RECORD

Project Number 62/0197M

Client St. Paul School District

Project Highland Park Little School House

Phone/Fax \_\_\_\_\_

Sample ID	Sample Description	Collection Date/Time	Matrix (Vol/Area)	Analysis Requested
B-62/0197M-83	Room 1 radiator bry	7-11-97	—	Pb% wt. or ppm
85	Room 1 wood Ocean	↓	—	↓
W-62/0197M-1	Room 2	7-11-97	1 SF	Pb, Ug, /sf <sup>2</sup>
1	Room 1		1 SF	
2	Room 1		1 SF	
3	Room 1		1 SF	
4	Room 1		1 SF	
5	Room 1		1 SF	
6	Room 1		1 SF	
7	Room 1		1 SF	
8	Room 1		1 SF	
9	Room 2		1 SF	
10	Room 2		1 SF	
11	Room 2		1 SF	
12	Room 2		1 SF	

Sampled By: Bryan Angson Date: 7-11-97 Time: 11:20a Delivered By: Greg Ainge Date: 7-16-97 Time: 11:20a

Received By Lab: 1000 AM Date: 7/16/97 Time: 1120 Delivered By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_

Received By Lab: 1000 AM Date: 7/16/97 Time: 1120 Disposition of Samples \_\_\_\_\_

Notes: Site 7

Parent & Wives on chain of custody

## **APPENDIX C INSPECTORS**

**Roger Jeremiah  
MDH Lead Inspector # 139**

**Michael Buck  
MDH Lead Inspector # 140**

**Bryan Angstman  
MDH Lead Inspector #467**

**Patrick Leahy  
MDH Lead Inspector # 237**

**John Allen  
MDH Lead Inspector #236**