


Midwest
Environmental
Consulting, LLC.

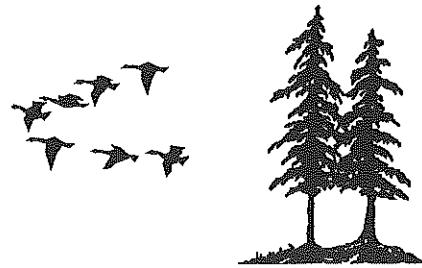

Printed on Recycled Paper

**Humboldt Secondary Complex *JR*
Saint Paul Public Schools**

Lead-Based Paint Inspection

Inspection Dates: 2/8/97, 2/11/97, 2/18/97, 2/19/97, 2/23/97

submitted to:

Saint Paul Public Schools

MEC Project # 62/0197F

INTRODUCTION

At the request of Saint Paul Public Schools Environmental Safety Department, Midwest Environmental Consulting, L.L.C. (MEC), conducted a lead-based paint inspection at Humboldt Secondary Complex, 640 Humboldt Ave., St. Paul, MN. The purpose of this inspection was to identify lead-based painted, varnished, or otherwise coated building components on the interior and exterior of the school building.

The inspection protocol incorporated applicable portions of the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-based Paint Hazards in Housing* (HUD Guidelines, June 1995) and OSHA 1926.62 requirements (Lead in Construction). The HUD guidelines are formulated to guide agencies in conducting random sampling of the interiors and exteriors of dwellings and common areas in public housing. The OSHA requirement is designed to minimize worker exposure when working with material containing lead.

Confirmatory testing was conducted when inconclusive XRF results were encountered. Inconclusive refers to XRF readings less than 0.2 mg/cm² (milligrams per square centimeter). Inconclusive results were confirmed with laboratory analysis of paint chip samples (Appendix B). This report contains a list of such results.

The United States Environmental Protection Agency defines "lead-based paint" as a paint or other surface coating that contains lead equal to or in excess of 1.0 milligrams per square centimeter when analyzed by XRF or more than 0.5% by weight (5000 parts per million) by laboratory analysis of a bulk sample.

Minnesota Department of Labor and Industry (MN OSHA) adopted the EPA lead levels for the purpose of enforcing OSHA 1926.62 federal regulations. Detection of lead in dried paint film by XRF is a dependable indicator of levels of lead and is accepted by MN OSHA.

For this Saint Paul Public Schools Lead Inspection, all building components were tested on site using a Niton XL® X-ray Fluorescence Spectrum Analyzer⁽¹⁾. Building components included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases. Only painted or glazed surfaces or surfaces which were varnished were tested. Suspended ceilings, structural steel, and corrugated decking were not included in the inspection. Neither anodized (e.g., window sashes) nor plastic (e.g., vinyl baseboard and vinyl mini-blinds) were included in the scope of this inspection.

⁽¹⁾ This is a portable hand held machine that can analyze building components instantly for lead concentrations.

Each building was divided into unique sites based on the year of construction or renovation. Portable classrooms, playgrounds, and other detached buildings were automatically designated as a unique site. Each site was inspected independently assuming differences in painting history and construction characteristics.

SITE DESCRIPTION AND BUILDING HISTORY

According to information provided to MEC by Saint Paul Public Schools, Humboldt Secondary Complex was constructed in essentially four phases. The initial phase (site 1) includes the 64,360 square-foot older section of the building and dates from 1909. A second phase (site 1) of 14,474 square feet dates from 1924. A 21,993 square foot addition (site 2) from 1959 is the third addition, and a 22,283 square foot addition (site 3) from 1976 is considered to be the fourth phase for the purpose of this inspection.

The Senior High School addition, that contains the cafeteria and pool, constructed in 1976, is considered to be site 4.

All room and area designations used in this report are depicted on sampling maps found in Appendix A.

XRF SAMPLE RESULTS TABLE

The results of all samples analyzed are listed in the table at the end of this section. The following is a description of the column headings:

| | |
|-----------------|--|
| Site | Each school is divided into sites based on their unique construction characteristics. Each site has a unique date of construction or major renovation. |
| Sample # | Each sample taken was given a unique number to identify the type and location of the sample. The sampling date is an integral part of the sample number. |
| Analysis | This defines the type of analysis which can be categorized into two types: 1) XRF: This is an on-site analysis using a hand held Niton XL® X-ray Fluorescence Spectrum Analyzer; 2) Bulk or Chip: This is a bulk sample where paint is removed from the substrate and sent to a laboratory for analysis; |
| Floor | This is the level of the building in which the area tested was found, example, 1 (first floor), 0 (basement), etc. |

| | |
|------------------|--|
| Area | This further defines the specific functional space inspected such as a classroom, exterior, playground, gym, kitchen, etc. |
| Room # | This is typically the actual number on the room as identified at the building. |
| Component | Building "components" included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases. |
| Feature | Identifies more detailed information of the component. |
| Condition | This describes condition of the surface, whether it is intact, cracked, peeling, or chalking. |
| Substrate | This refers to the material the building component is made of (wood, concrete, drywall, metal, etc.). |
| Result | This is the analysis results for lead. Less than 1.0 mg/cm ² or less than 0.5% by weight is considered to be non-lead and these building components are below the action levels of EPA and HUD. (All results are in mg/cm ² except where noted.) |

The table of results is designed for quick information on lead concentrations of tested building components. Generally, all repetitions of a test combination within a given room or area, may be assumed to contain similar concentrations of lead to that of the tested sample. For instance, the lead concentration of a tested wooden window sash was found to be above the action level of 1.0 mg/cm² in a given classroom. The classroom has five windows, all of wood, the same color and appearing to be of the same era. It can be assumed that the remaining four wooden window sashes each contain lead above the action limit.

Other columns identify the component and the component feature tested, condition of the component, type of substrate and the result of the analytical test.

As an example, the following illustration shows that the wooden door jamb in Room 123, first floor in the 1923 building section was in good, solid condition, and had an XRF test result of 0.3 mg/cm², which is below the action level.

Illustration Only

| Site | Sample # | Date | Analysis | Floor | Area | Room # | Component | Feature | Condition | Substrate | Results |
|------------|----------|------|----------|-------|------|--------|-----------|---------|-----------|-----------|---------|
| 1923 Bldg. | 52 | | XRF | 1 | Room | 123 | Door | Jamb | Solid | Wood | 0.3 |

In a similar manner, the table shows that the plaster walls in room 23, on the second floor has peeling paint with more than 1.0 mg/cm² (shaded).

ILLUSTRATION ONLY

| Site | Sample # | Date | Analysis | Floor | Area | Room # | Component | Feature | Condition | Substrate | Results |
|------------|----------|------|----------|-------|------|--------|-----------|-----------|-----------|-----------|---------|
| 1910 Bldg. | 16 | | XRF | 2 | Room | 23 | Door | Jamb | Peeling | Wood | 0.25 |
| 1910 Bldg. | 17 | | XRF | 2 | Room | 23 | Wall | Wall | Peeling | Plaster | 1.2 |
| 1910 Bldg. | 18 | | XRF | 2 | Room | 23 | Ceiling | Peeling | Plaster | | 0.25 |
| 1910 Bldg. | 19 | | XRF | 2 | Room | 23 | Wall | Baseboard | Peeling | Wood | 0.002 |

APPLICABLE REGULATIONS

When building components test above 1.0 mg/cm² of lead by XRF or 0.5% lead by weight from laboratory analysis all employees and contractors who will be working with these components in a construction related activity must be notified. The requirements of OSHA 1926.62, Lead in Construction are enforceable. This regulation defines construction work as "work for construction, alteration and/or repair, including painting and decorating." This regulation further defines monitoring requirements to minimize employee exposure to lead during construction activities.

When work is performed on external painted building structures (i.e. flashing, fire escapes, playground equipment, handrails, etc.), regulations of the Minnesota Pollution Control Agency (MPCA) may also be applicable. For removal of lead based paint from steel structures, MN Rules 7025.0200 - 7025.0380 apply to steel materials on the exterior of a building, or on the property when levels exceed 0.5 mg/cm² based on the average of three XRF spectrum results of the sample tested, or 5,000 ppm by laboratory analysis. If it is other than a steel surface, then MPCA regulates the painted surfaces under MN Rules 7025.010 - 7025.0080, when surfaces are to be disturbed using abrasive blasting methods.

Please contact MEC directly if you have questions about any portion of this report or the lead-based paint inspection itself.

APPENDIX A

XRF TESTING DATA WITH LOCATION MAPS

NOTE -- 211/212 one room
NOTE -- 226 is closer of 227


62/0197E

SITE I

2/18/97 - O
2/19/97 - O


JR. HIGH UNIT VEN
1956 ADDITION
SHEET #2


Rubens ein

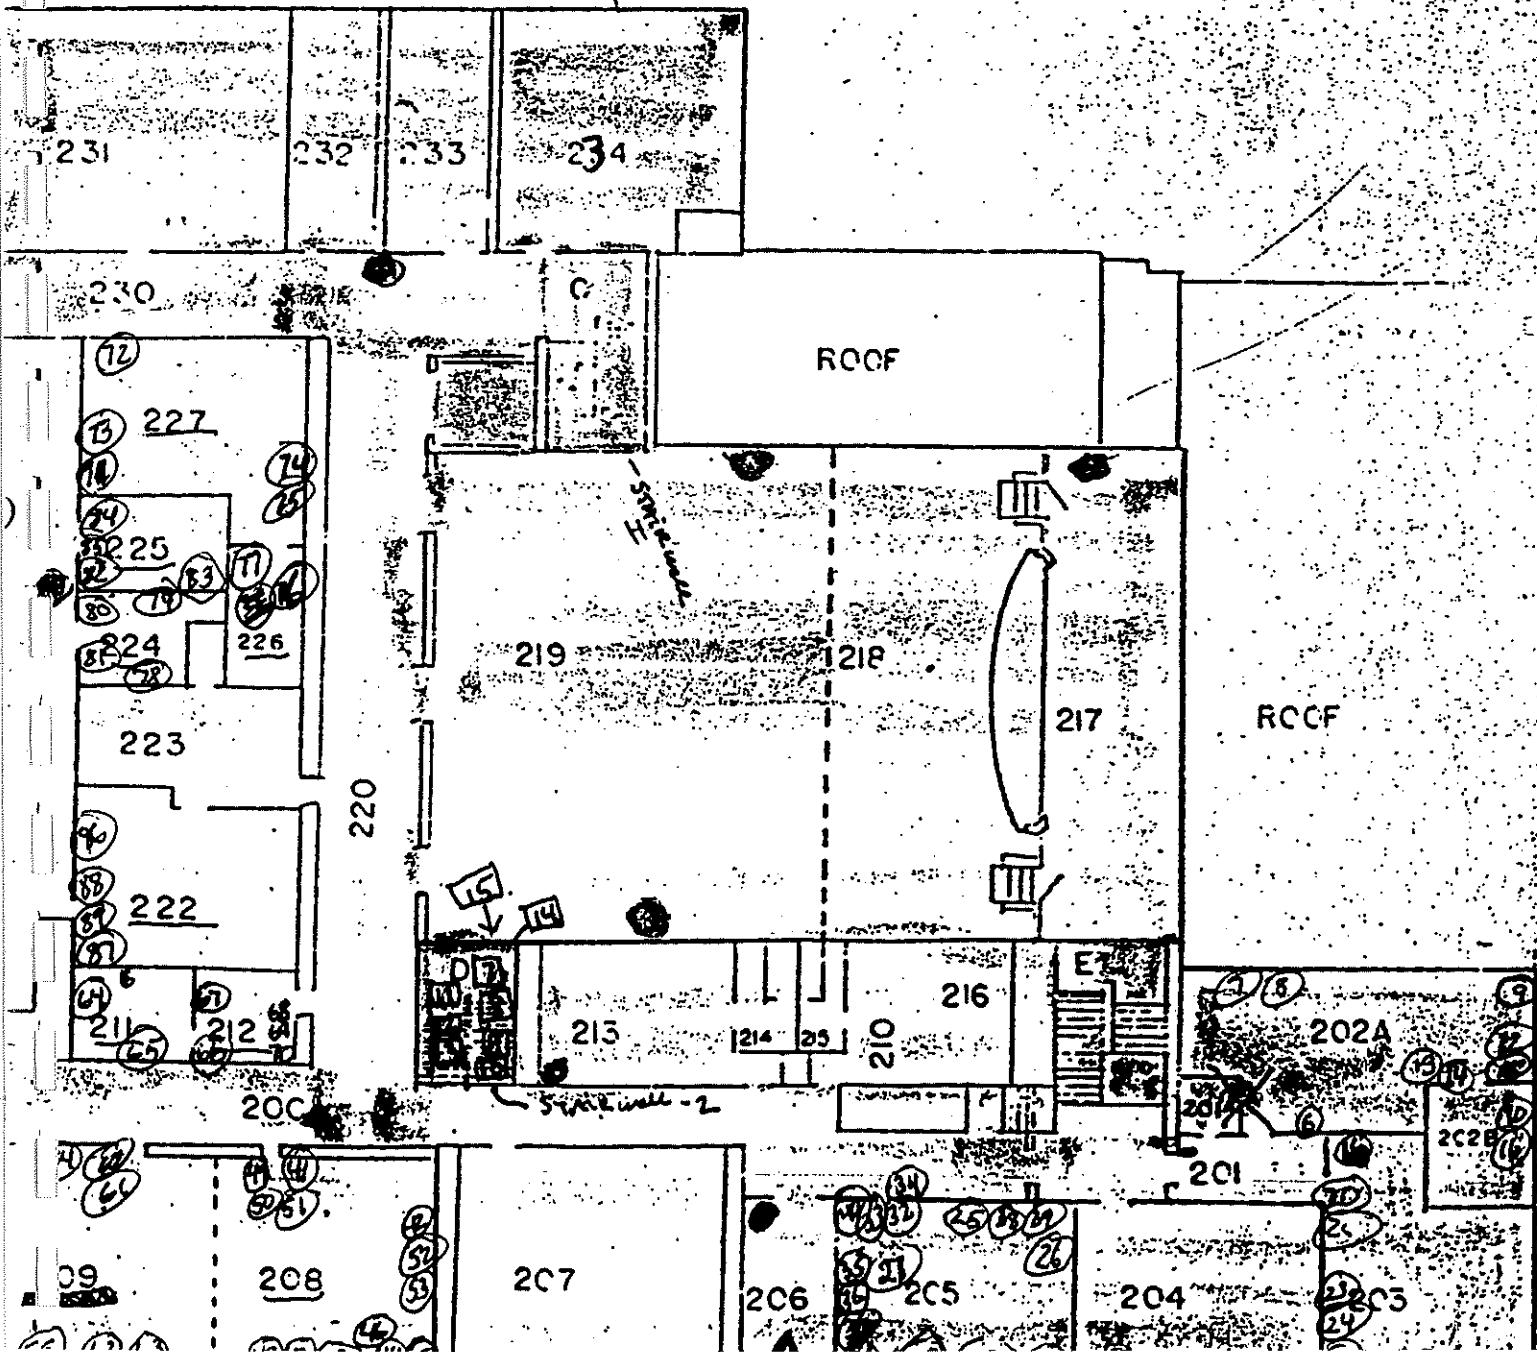


C
389 45 36

62/097F

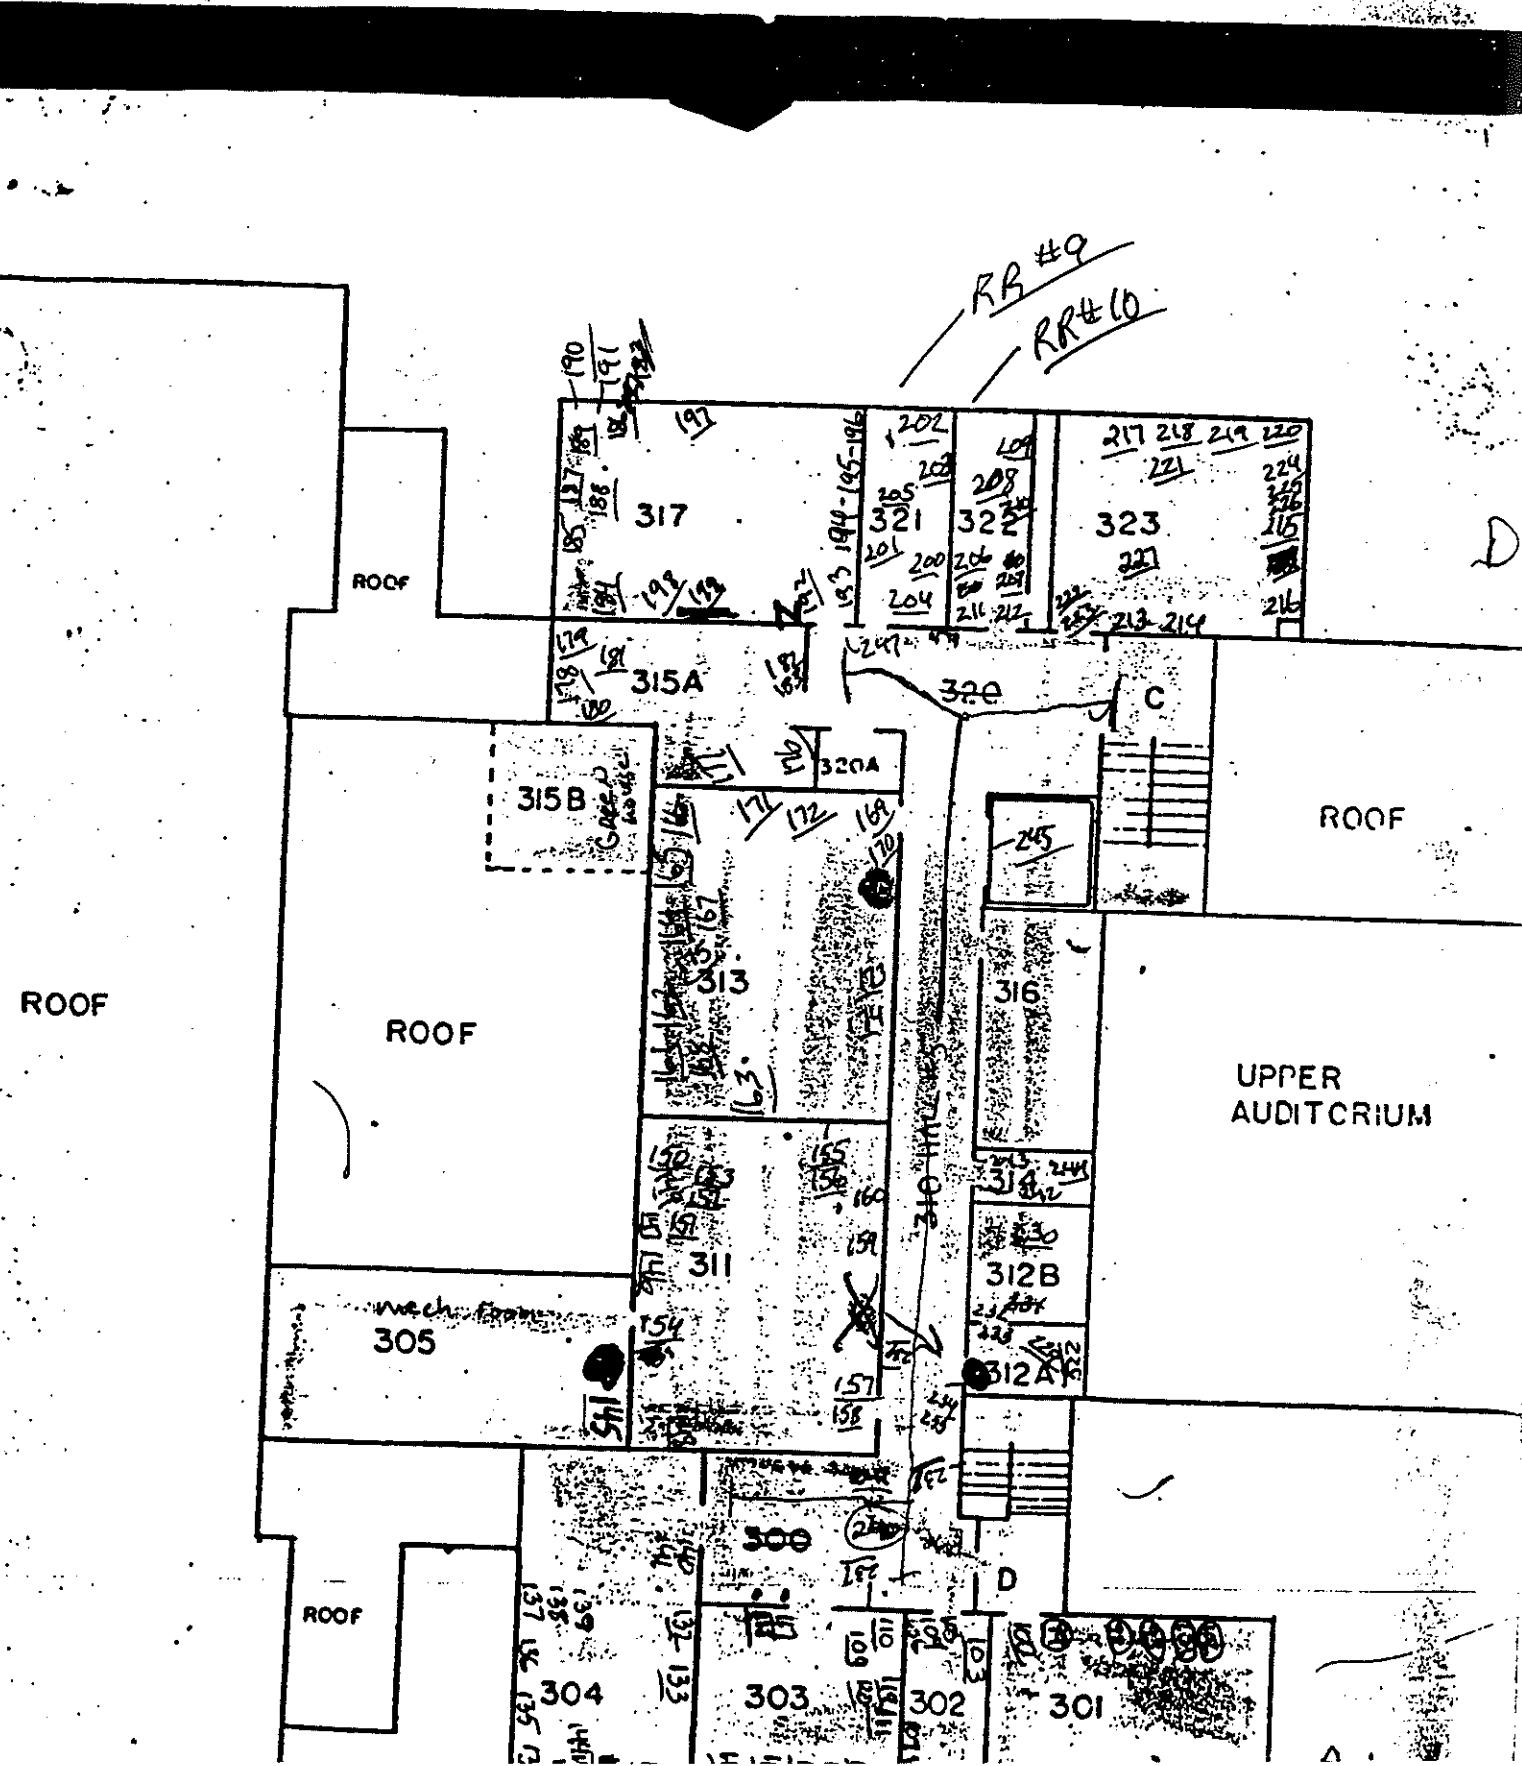


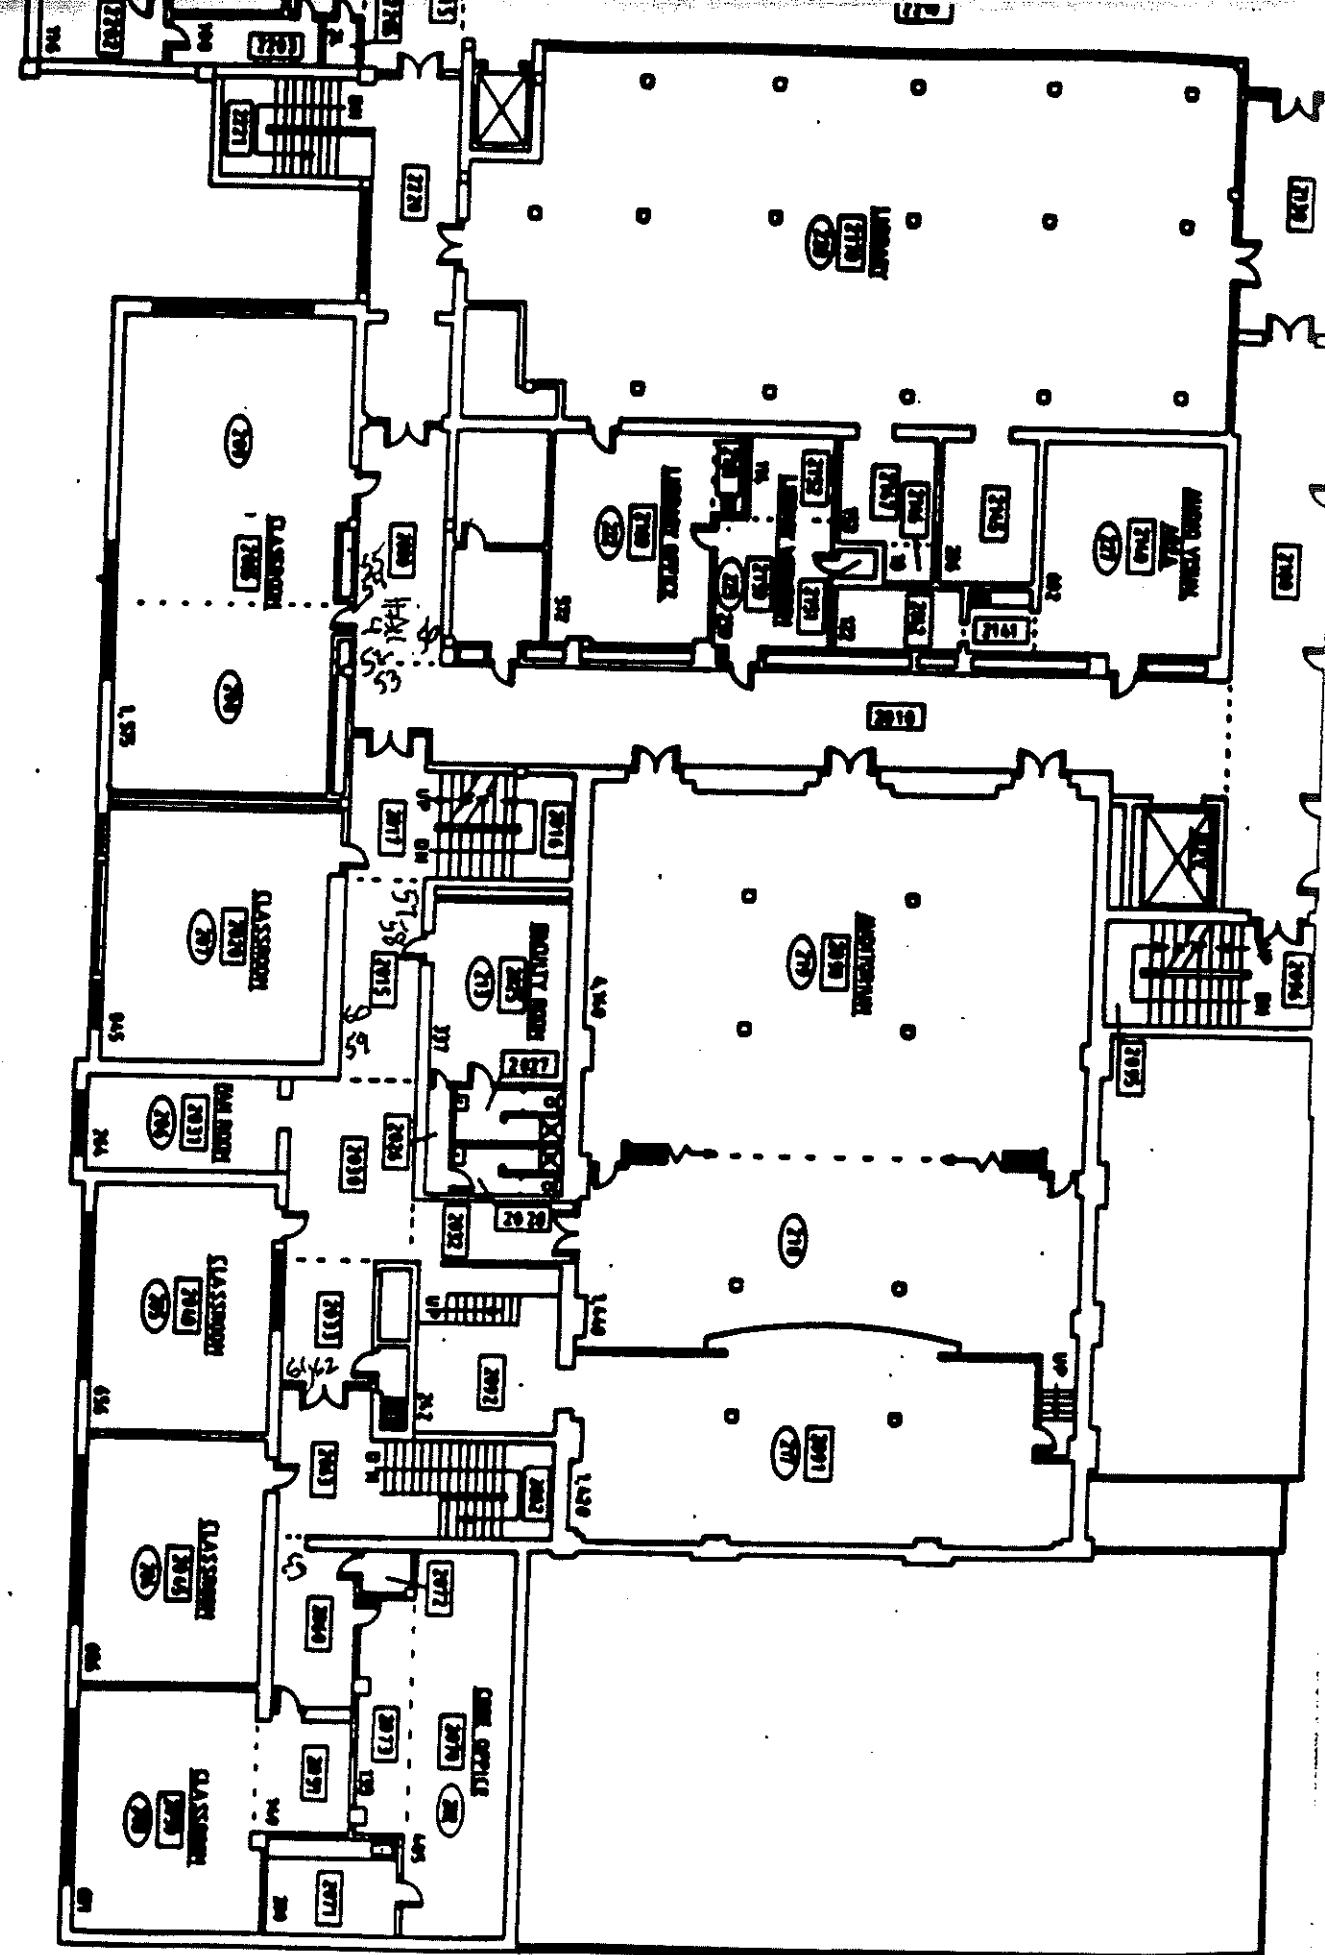

62/0197 F
Sitel

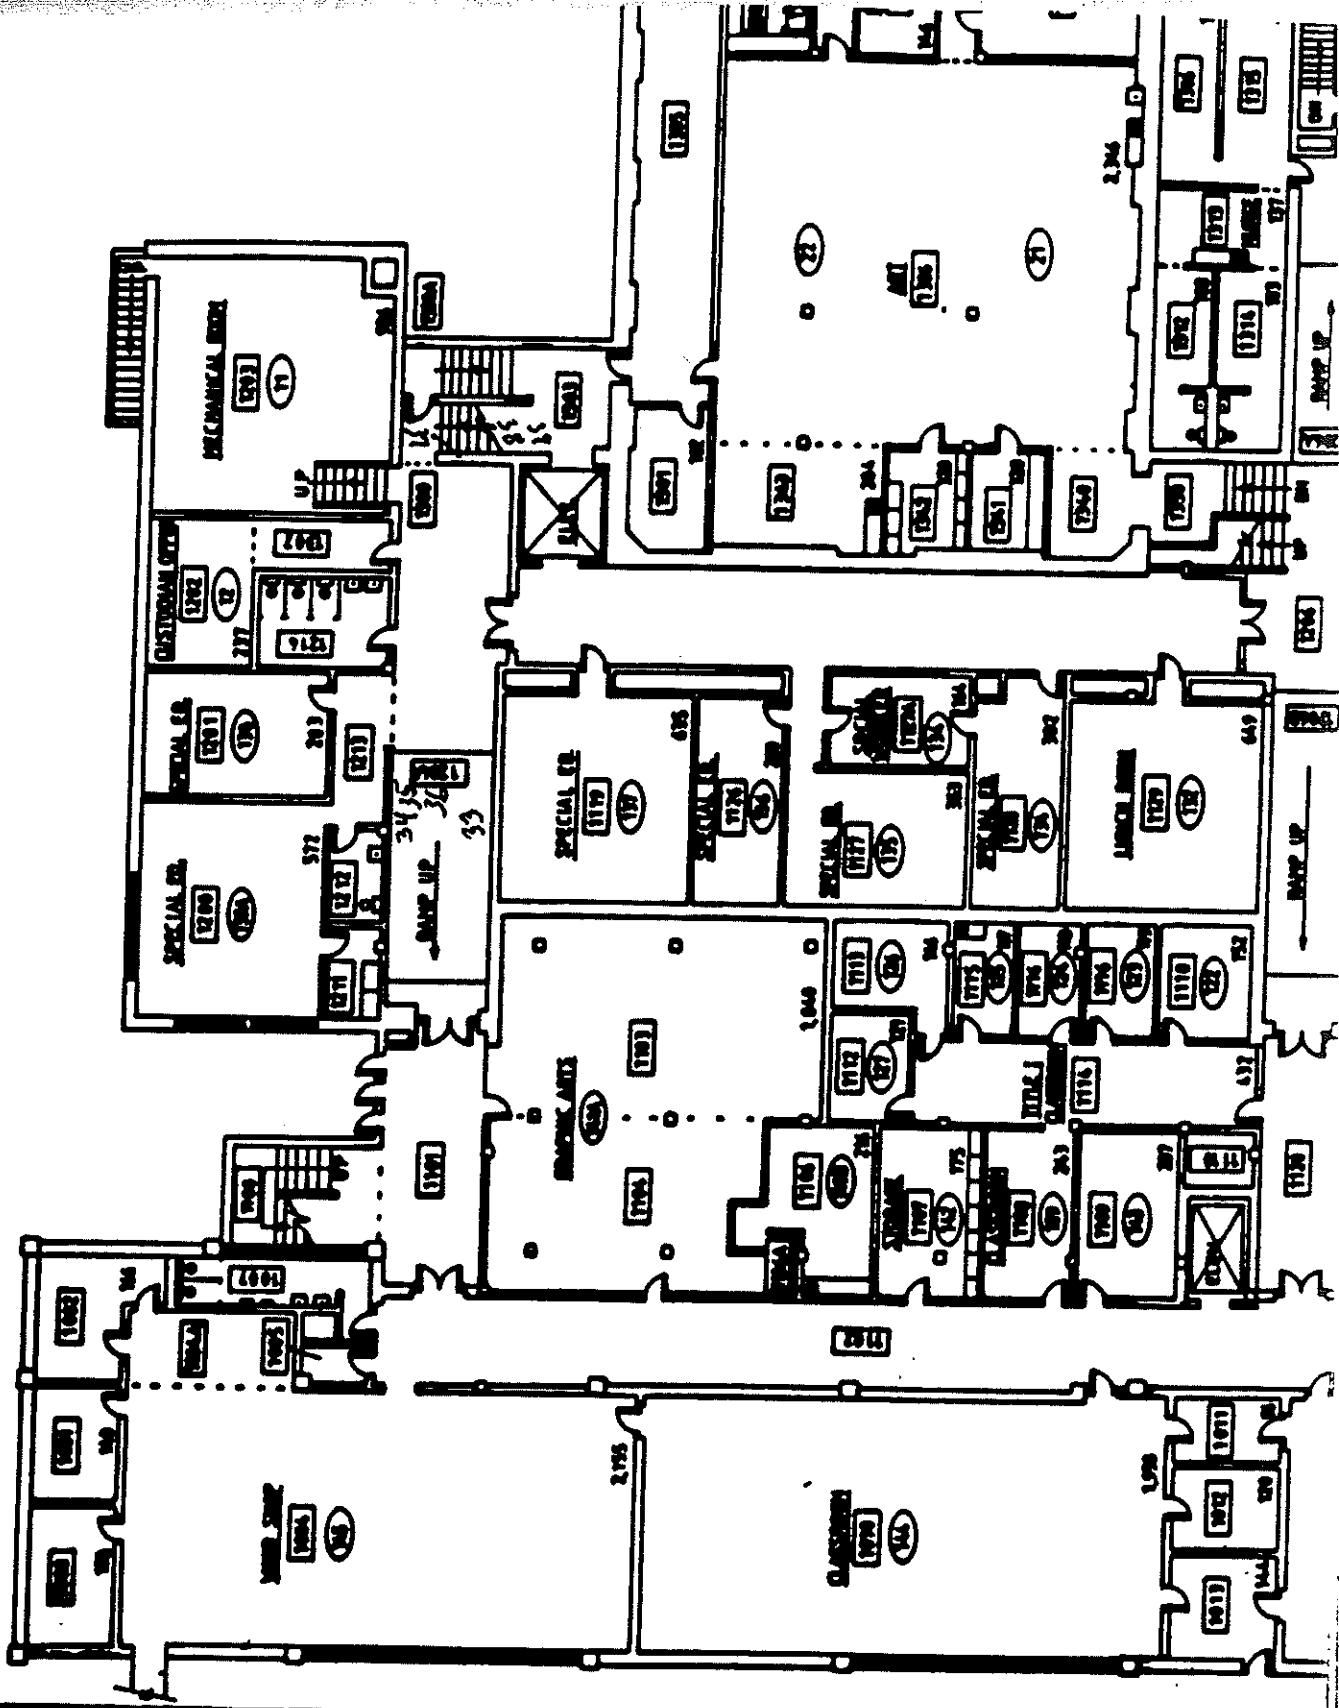



62/0197F
Site 1

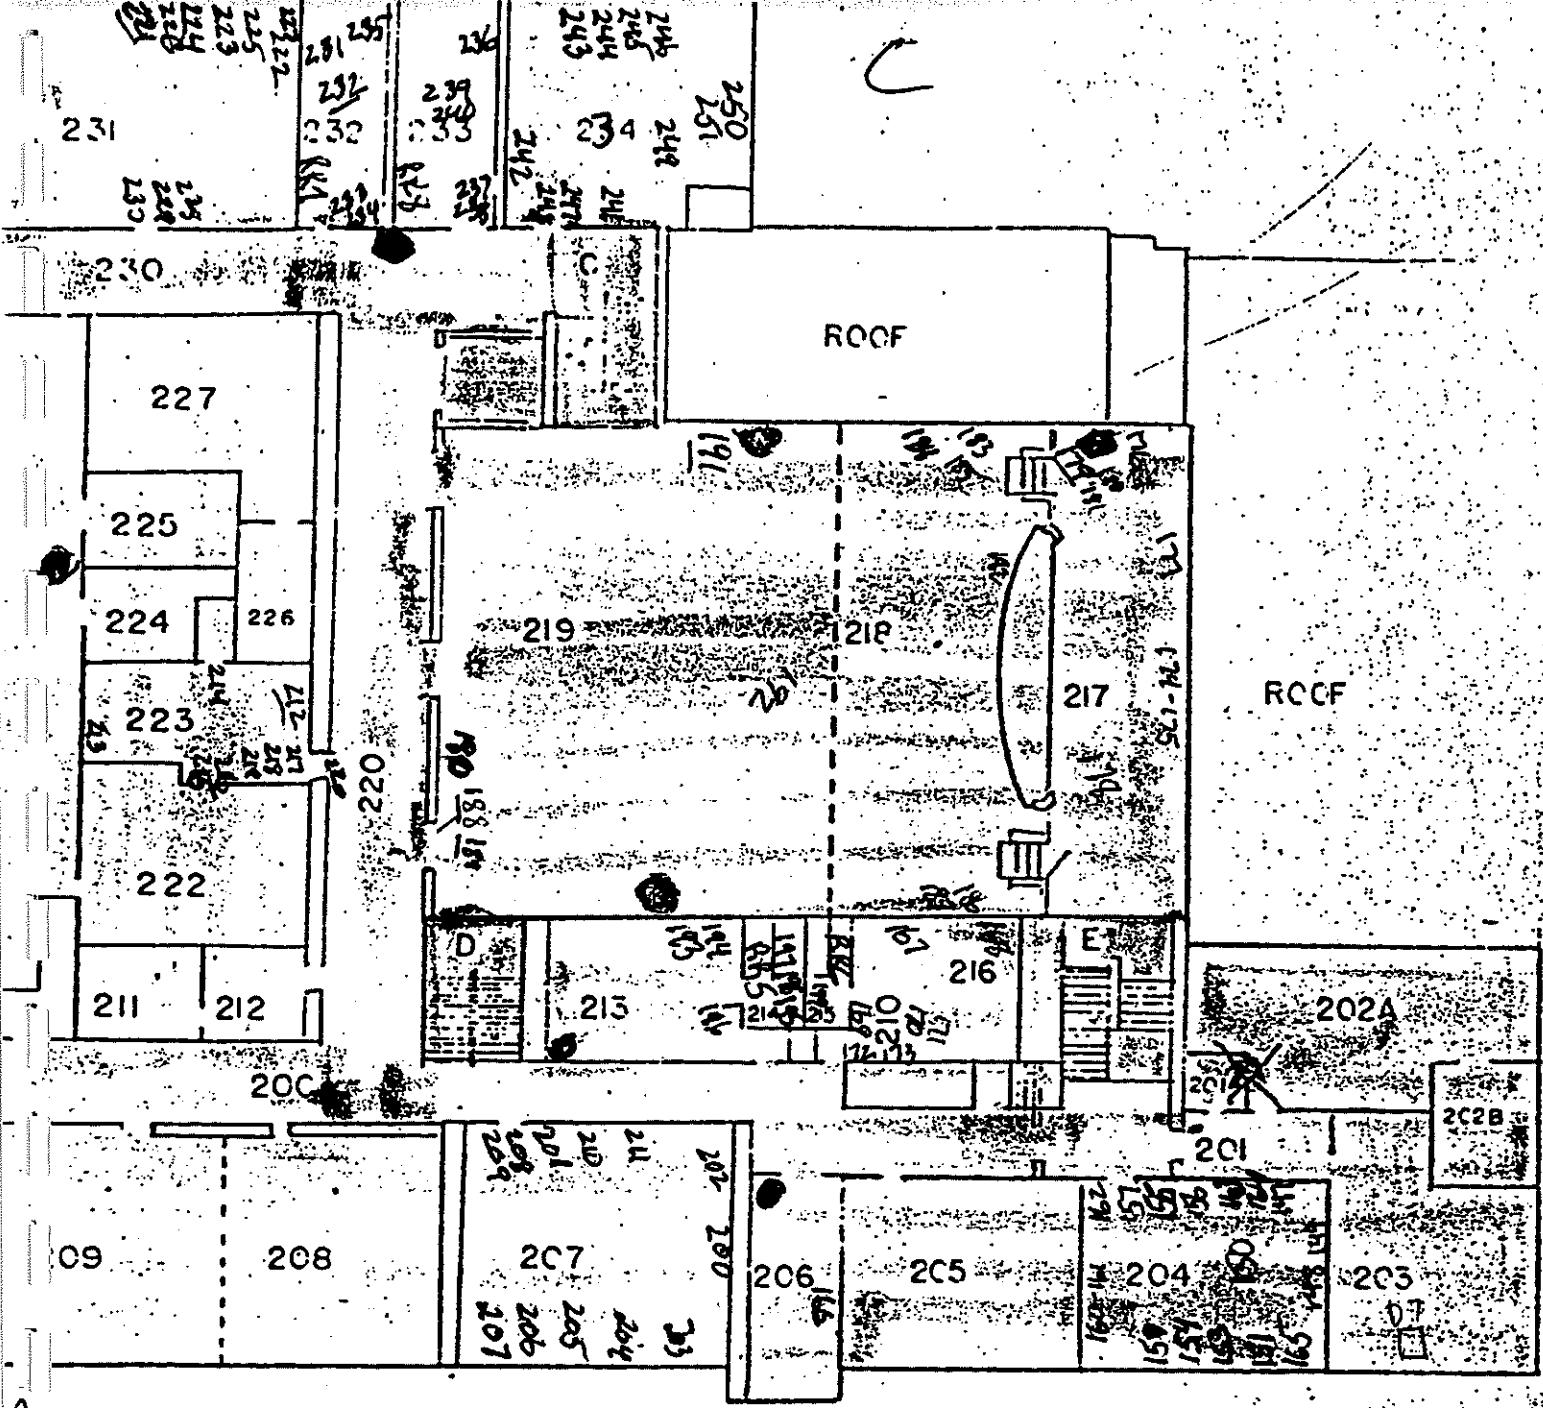

size 1 - 2/16/97
2/18/99
2/19/97

40Km for
202, 203, 205, 206, 209
2/1/92, 2/2/92, 2/27
62/0197F

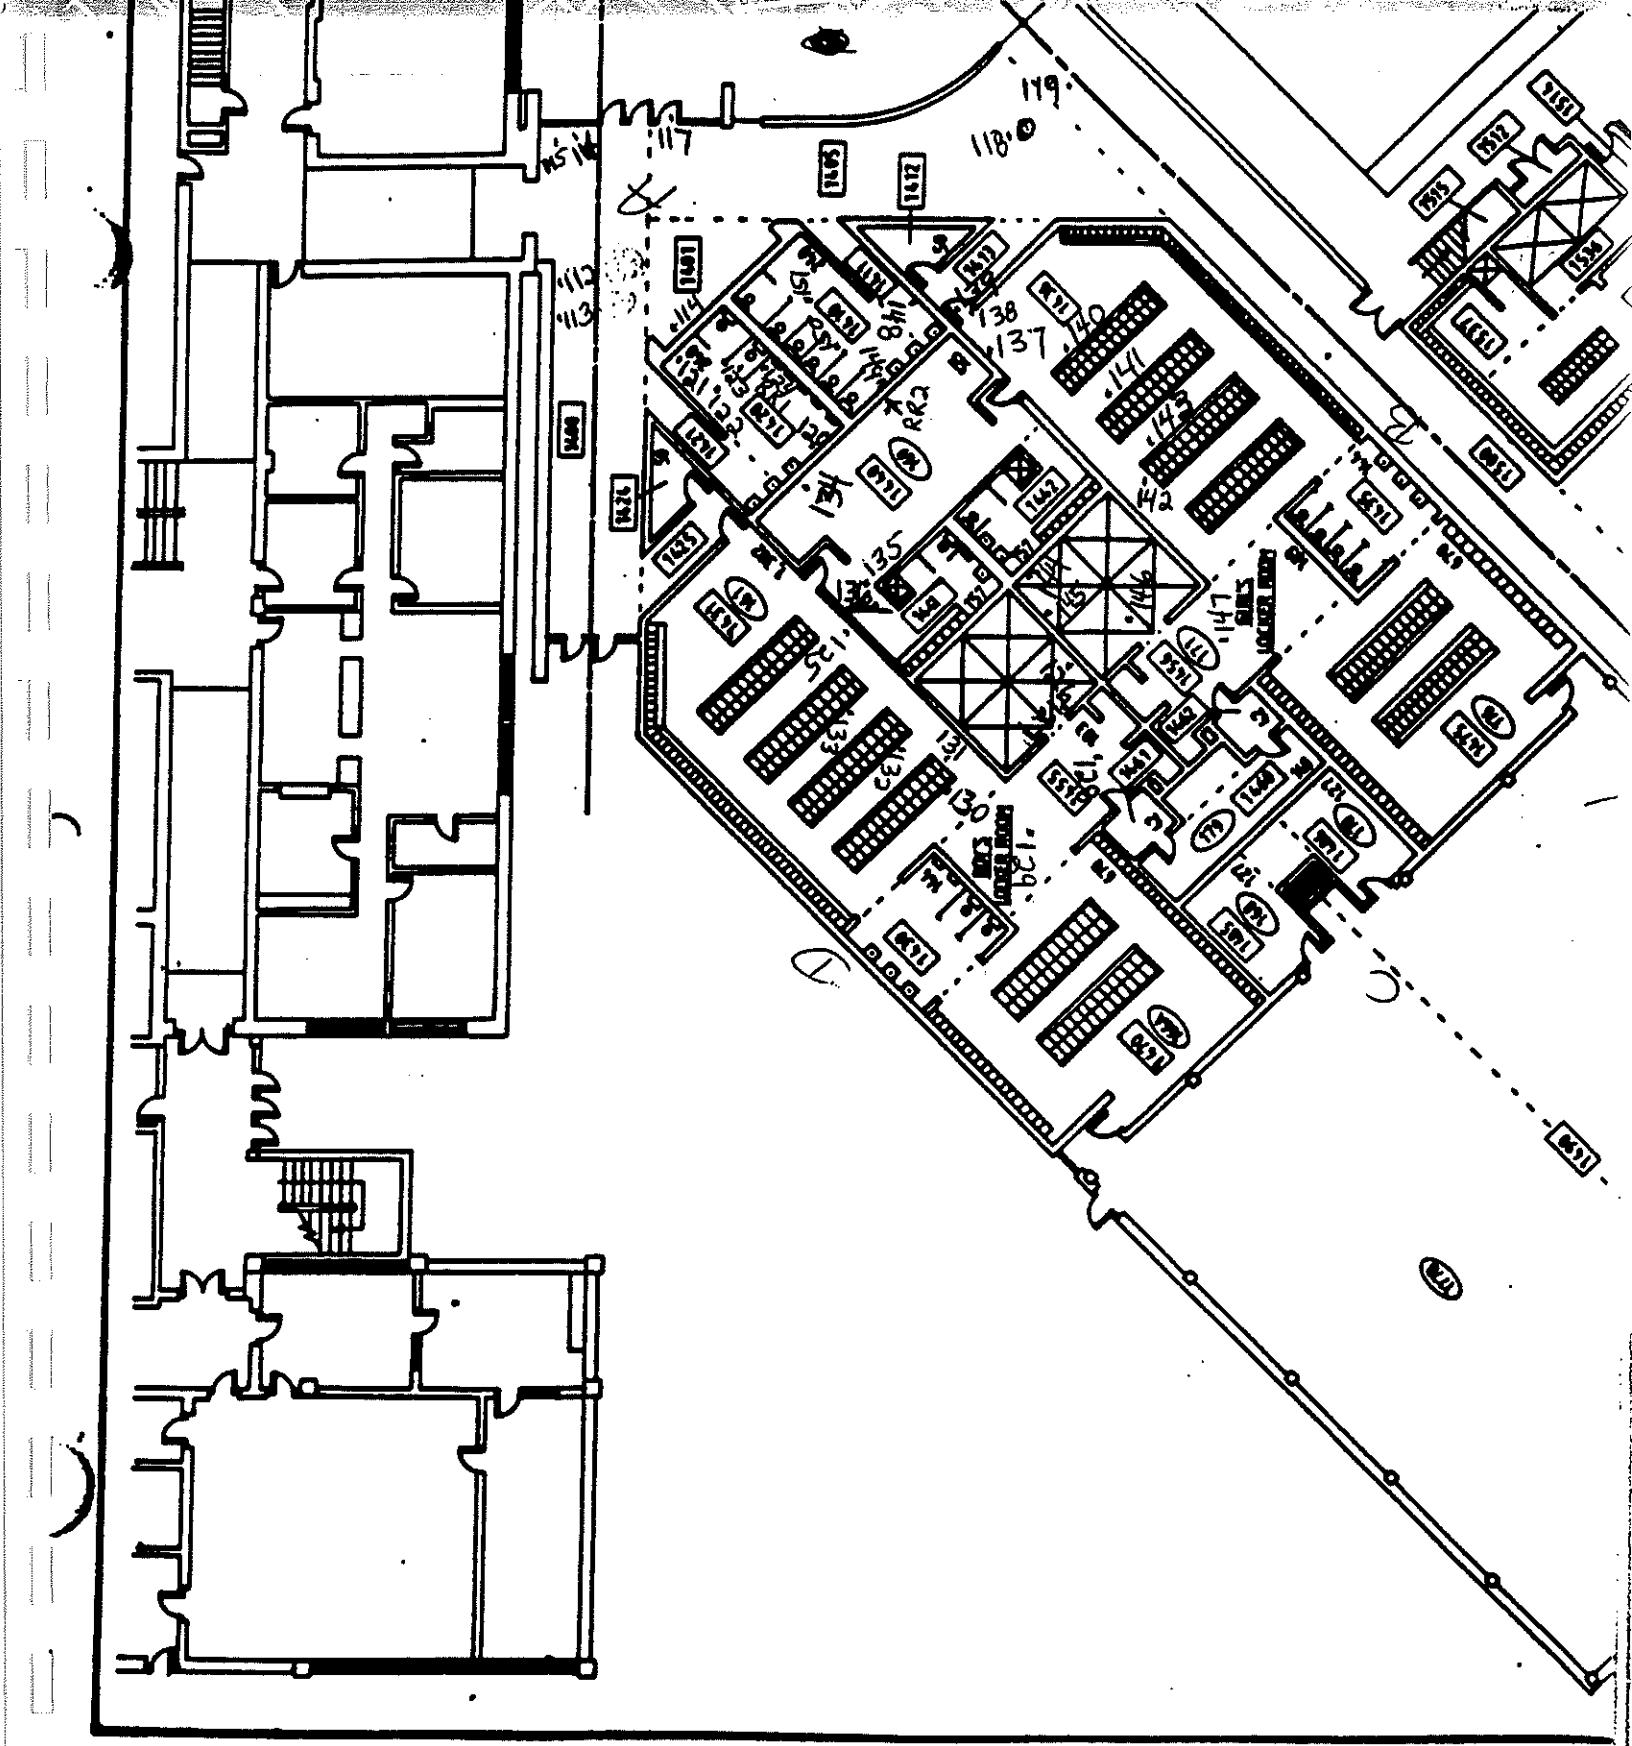

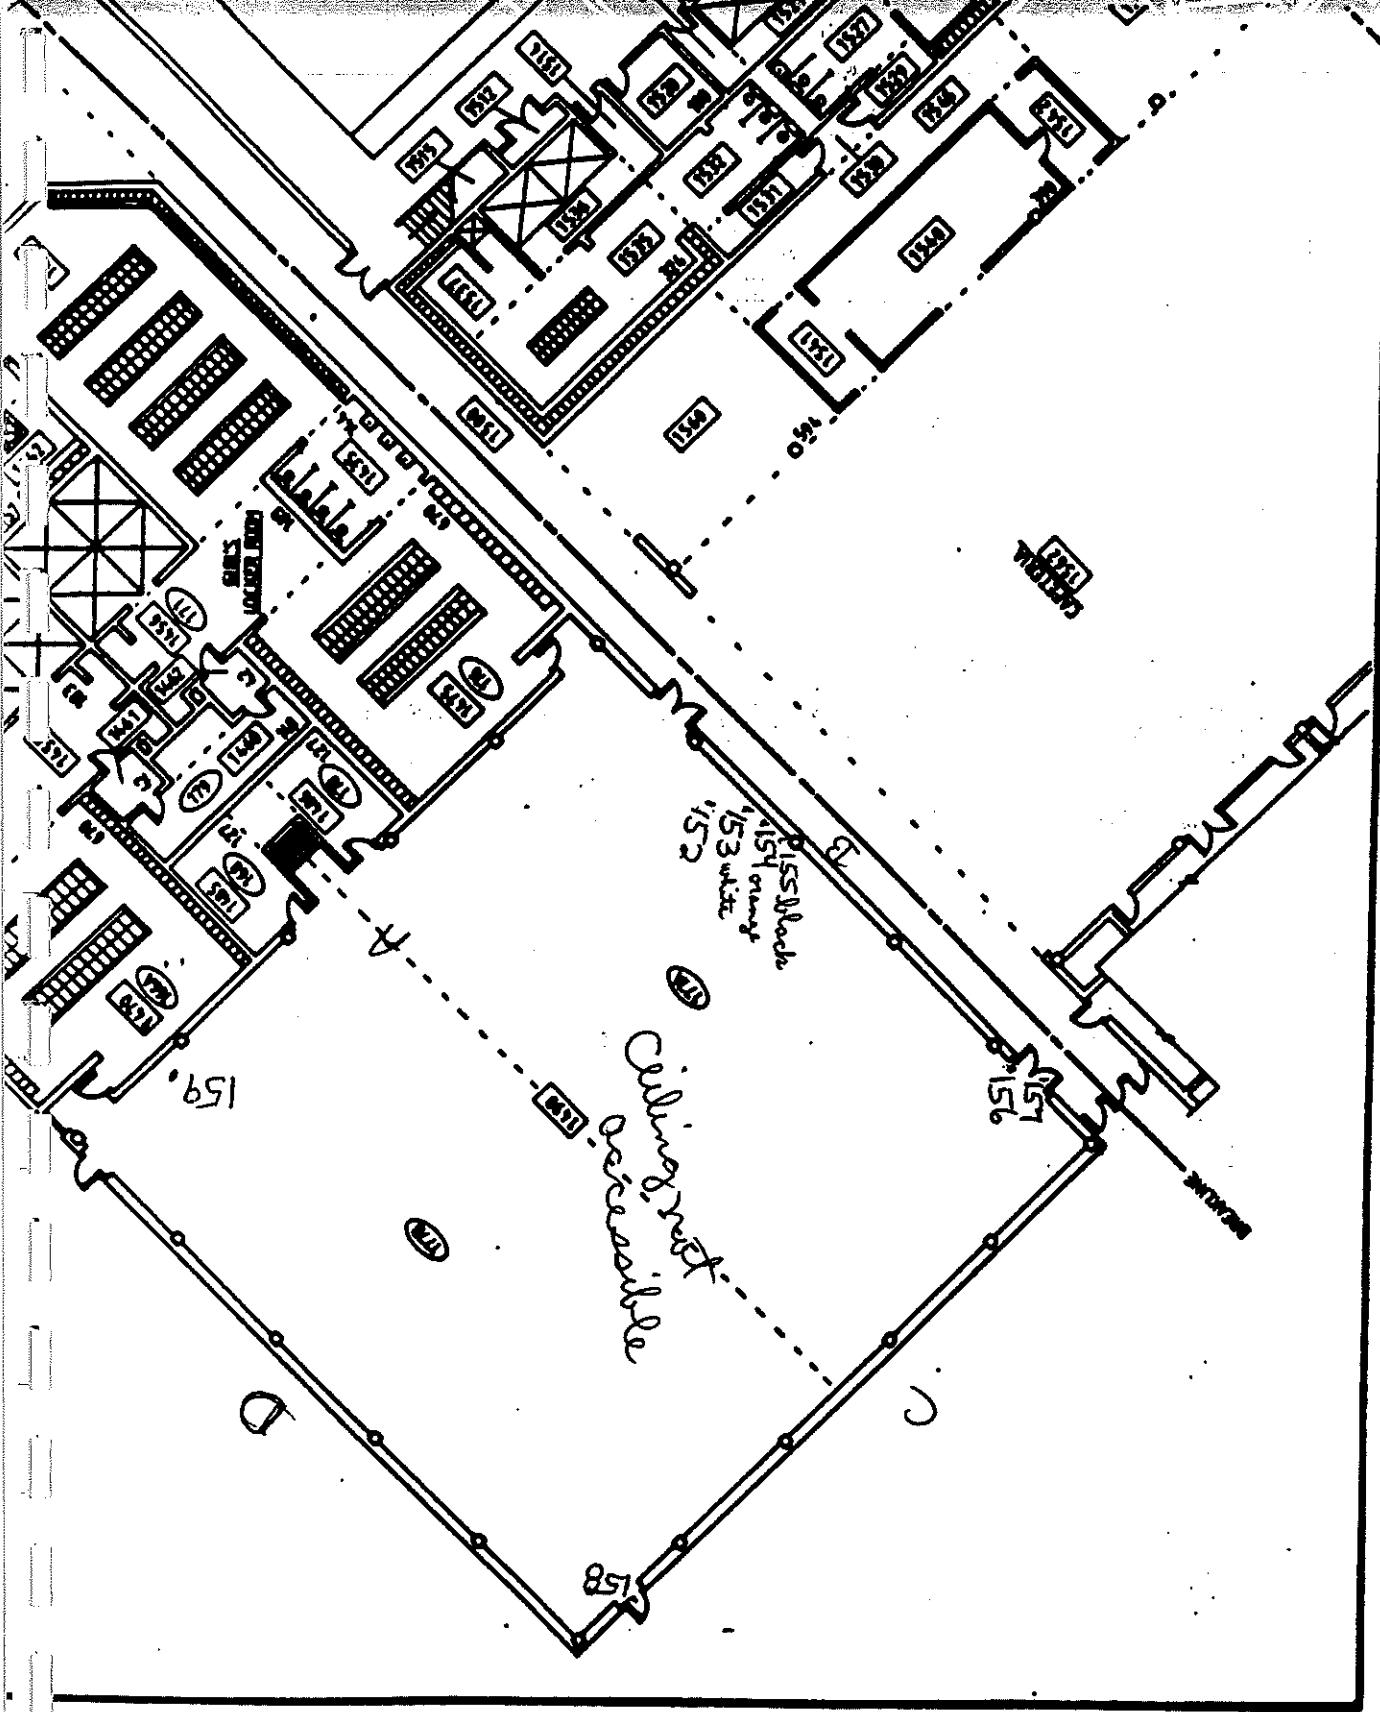



FIRST FLOOR - SOUTH


ST. PAUL, MINNESOTA 55102
300 COLLEGEONE STREET • 62


ST. PAUL, MINNESOTA
60 HUMBLEDT AVE.

CONSTRUCTED: 1909, 1912, 1933, 1976

HOMESTEAD JUNIOR HIGH SCHOOL

9
7
5
4
3
2
1
0

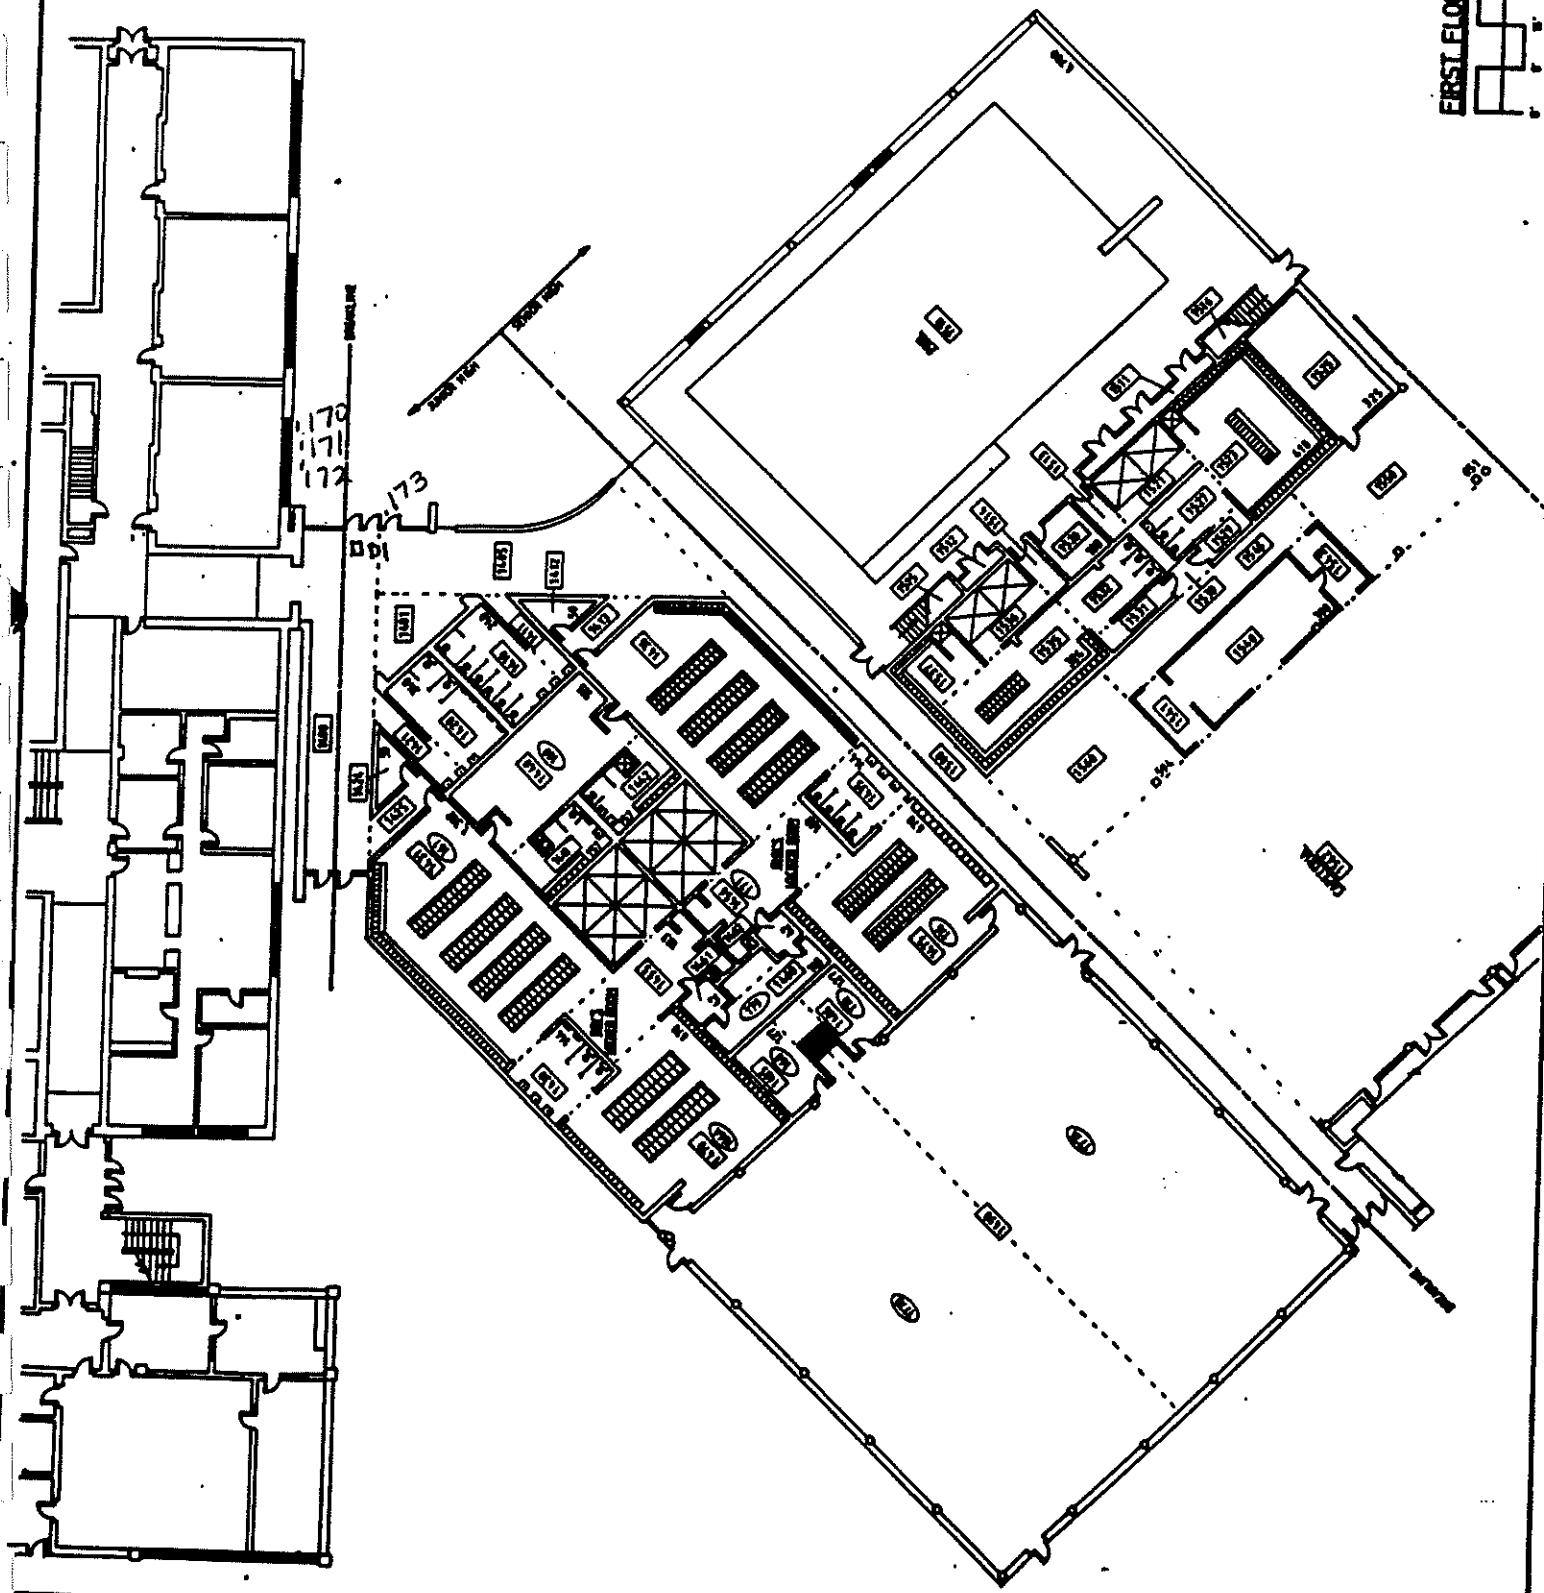

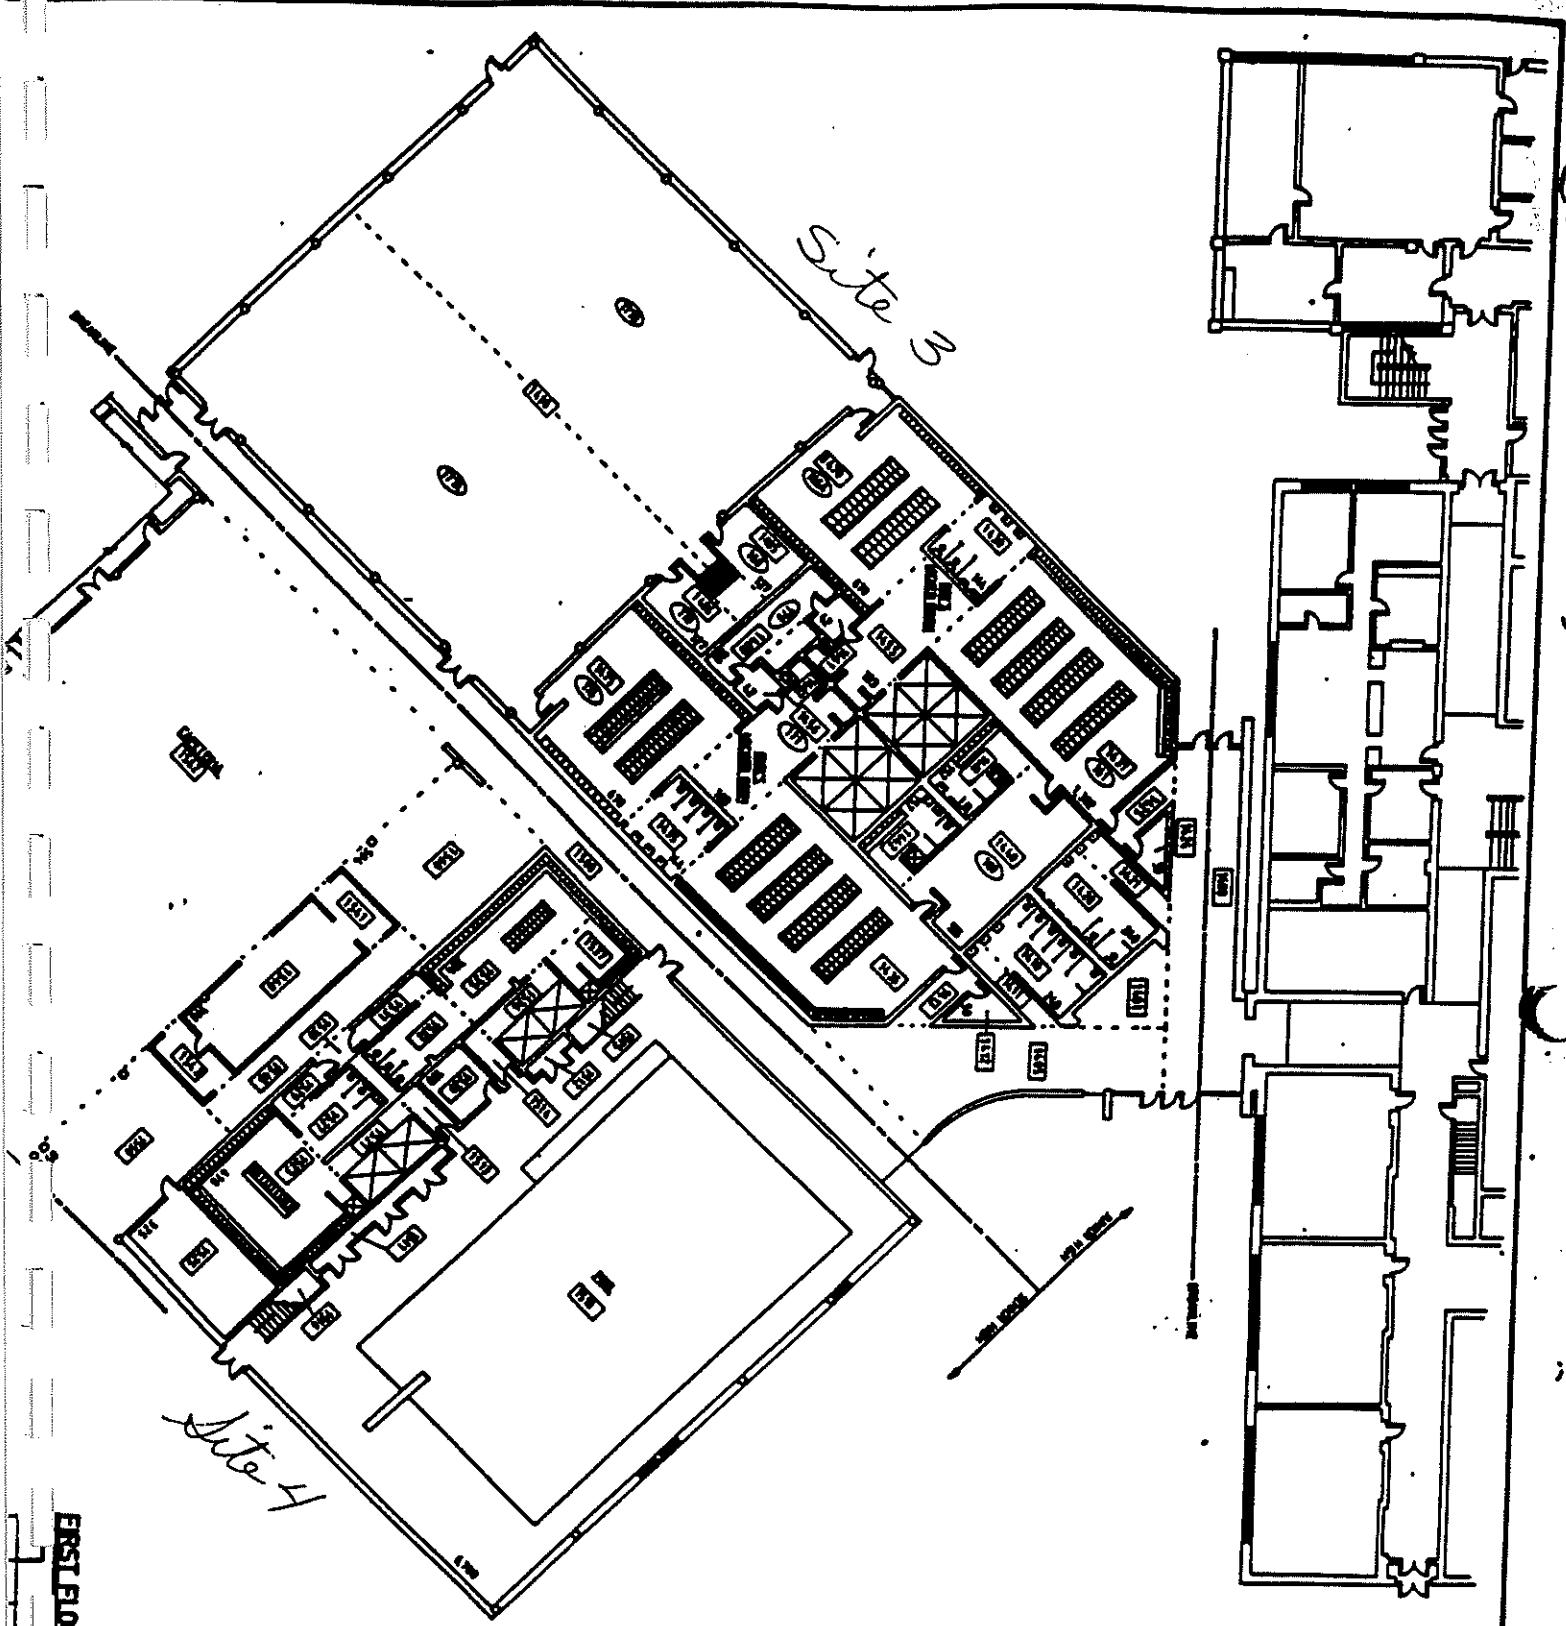

FIRST FLOOR - SOUTHERN

INDEPENDENT SCHOOL DIST. #623
380 COLBORNE STREET
ST. PAUL, MINNESOTA 55102

HUMBOLDT JUNIOR HIGH SCHOOL
640 HUMBOLDT AVE.
ST. PAUL, MINNESOTA

CONSTRUCTED: 1909, 1924, 1955, 1976

7
9

Site 4:

FIRST FLOOR - SOUTH




FIRST FLOOR - SOUTH




**INDEPENDENT SCHOOL DIST. #825
360 COLBORNE STREET
ST. PAUL, MINNESOTA 55102**


**HUMBOLDT JUNIOR HIGH SCHOOL
640 HUMBOLDT AVE.
ST. PAUL, MINNESOTA**

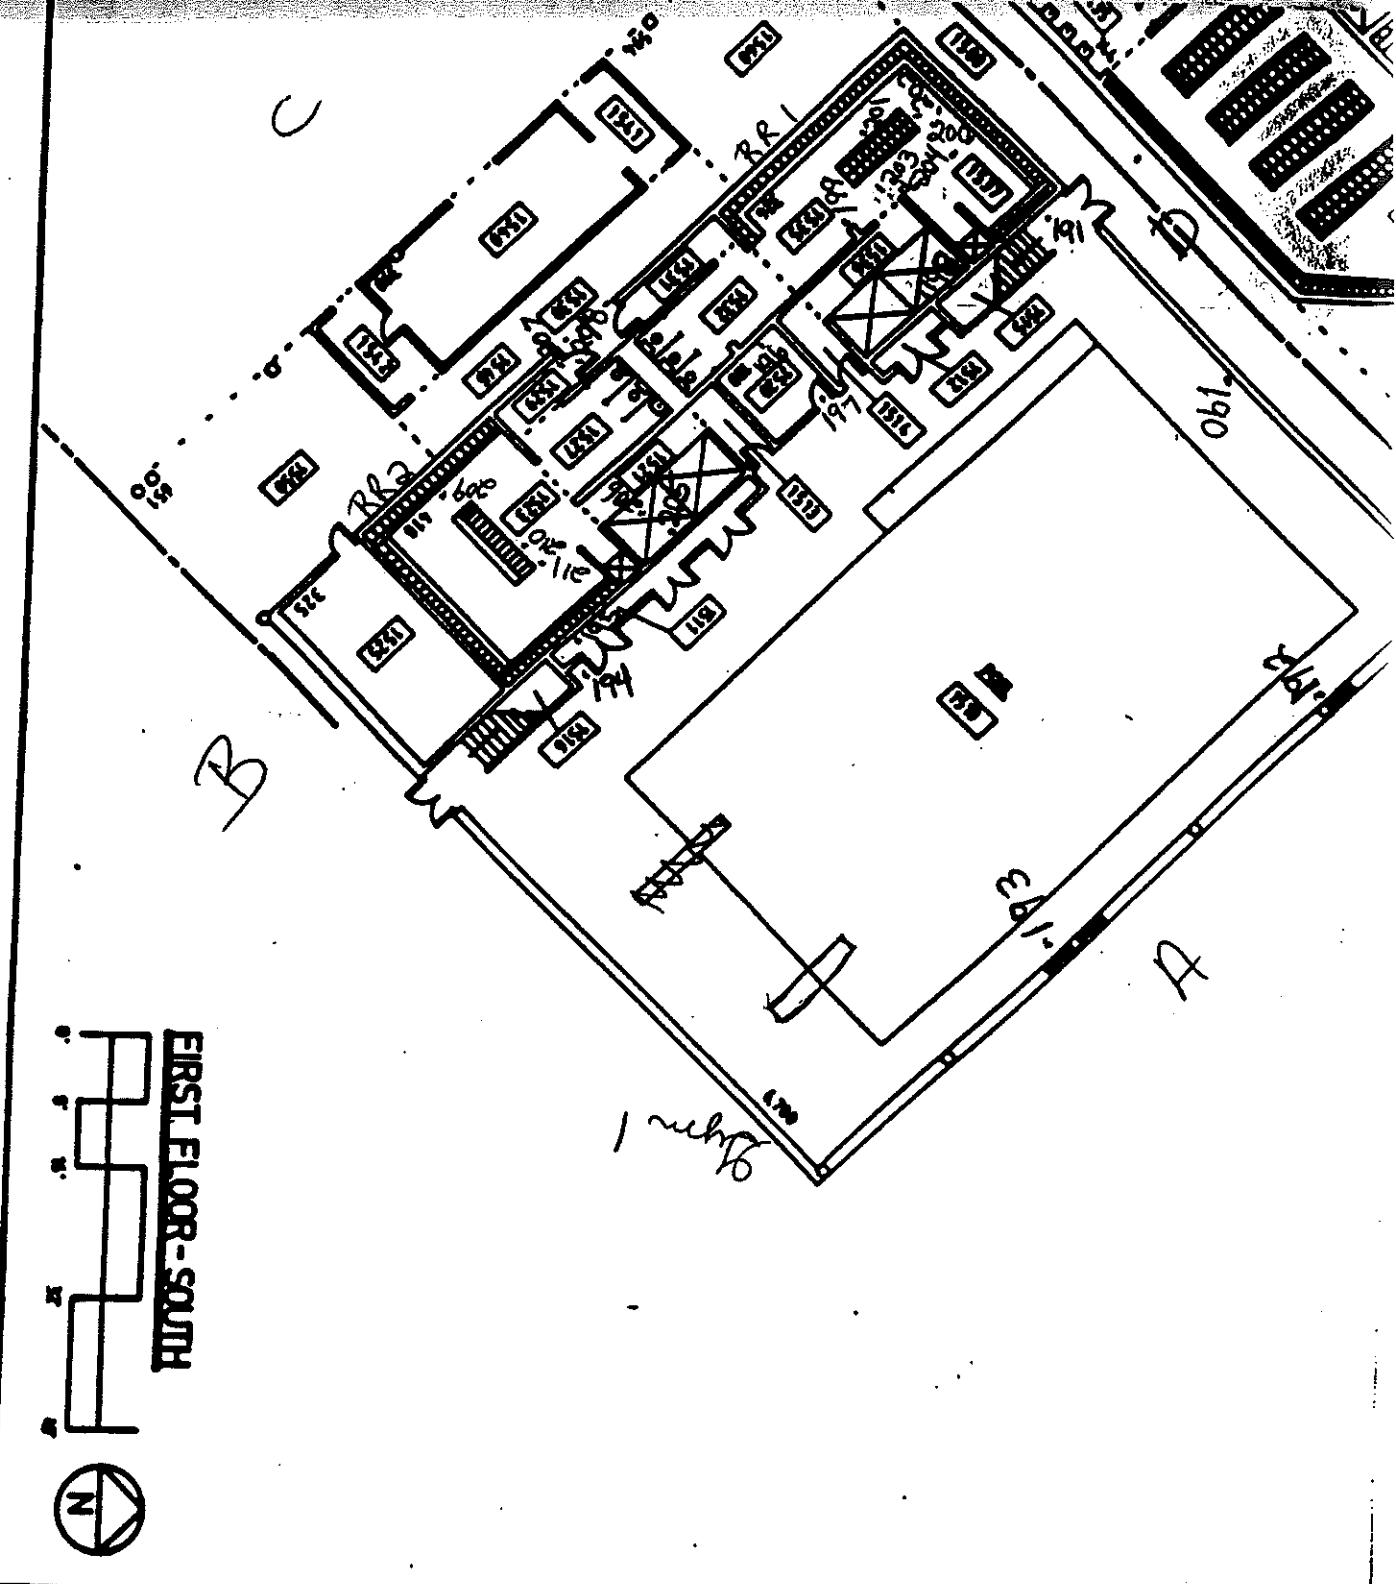

Site 4

X3

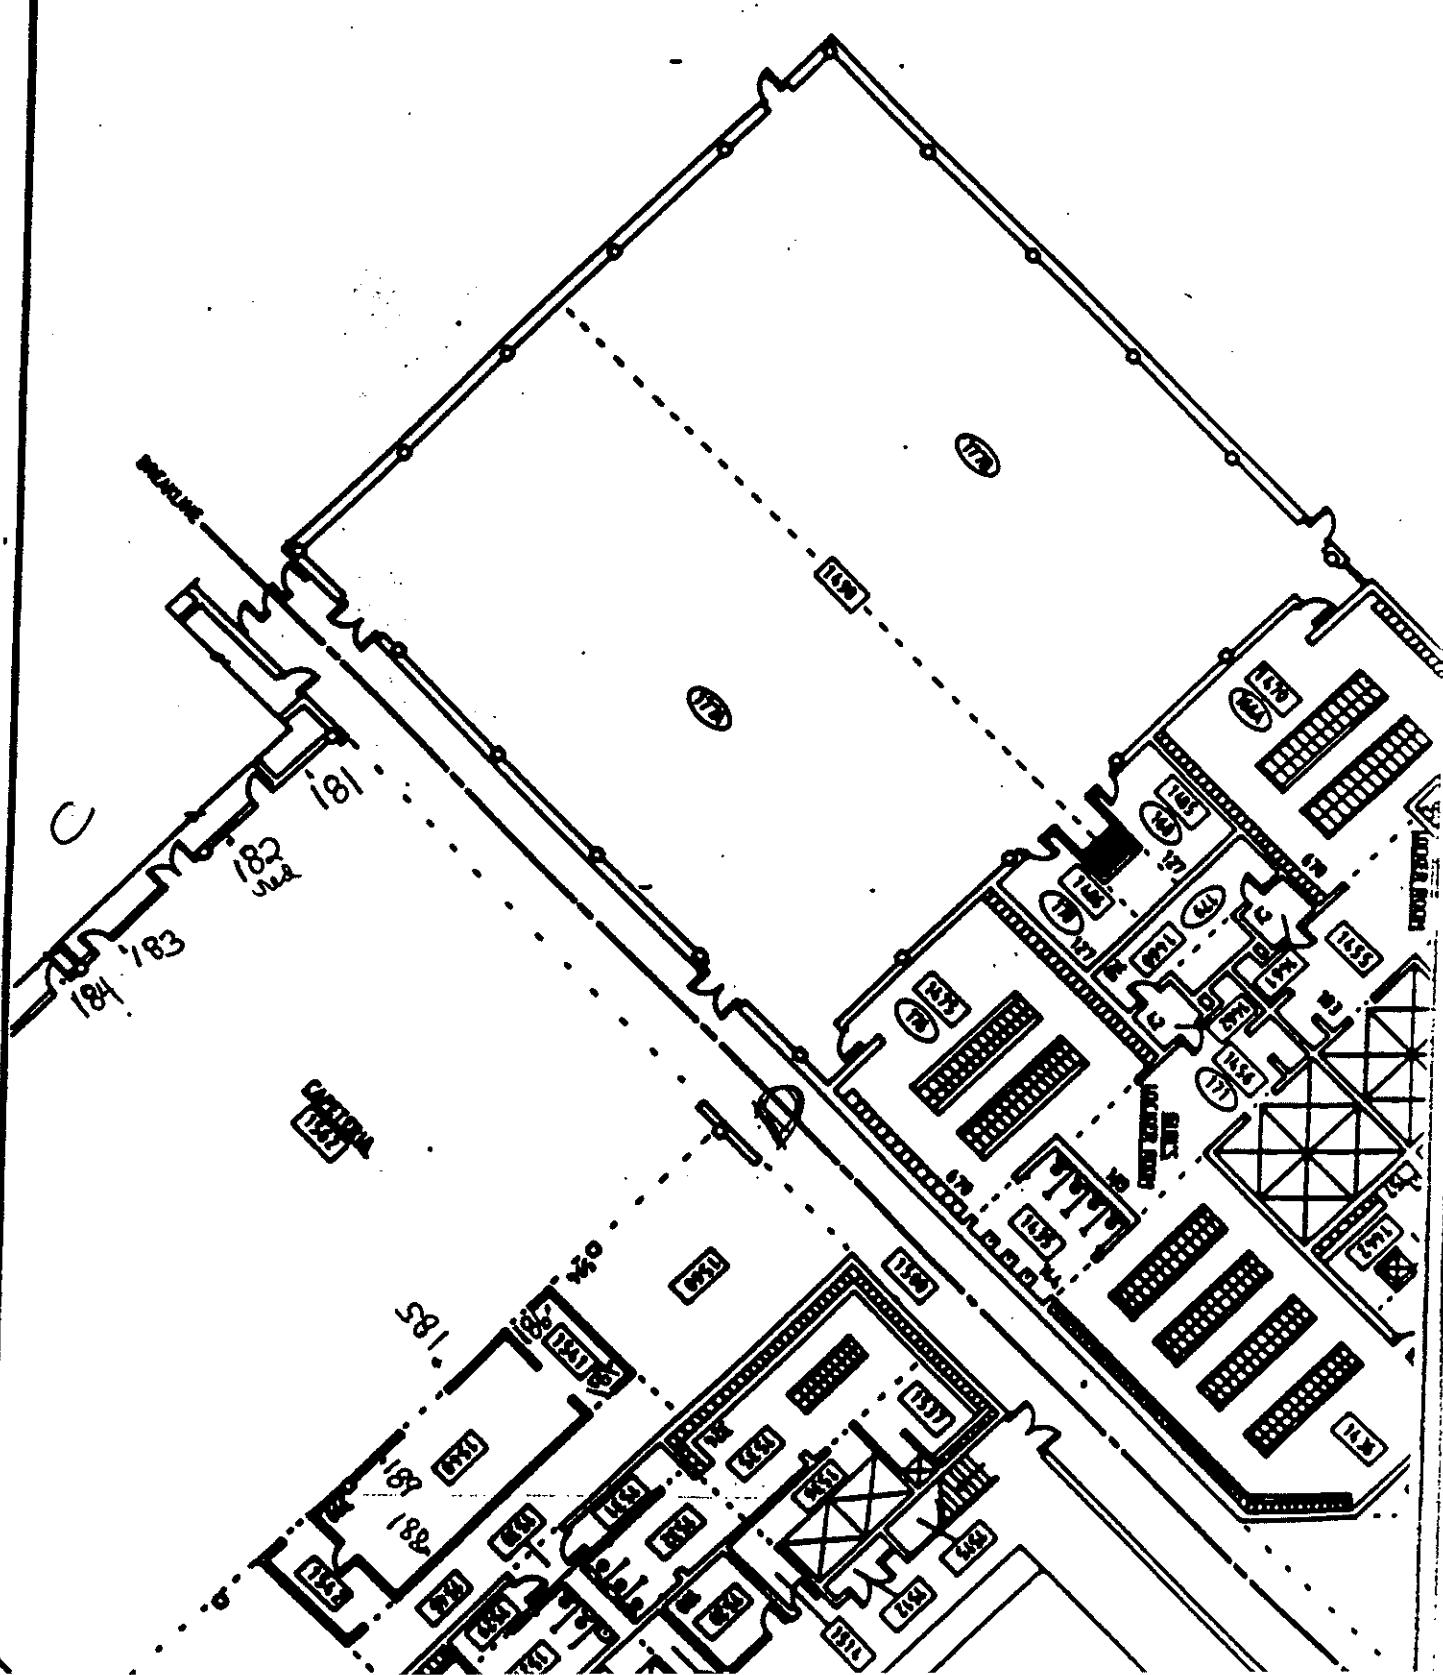


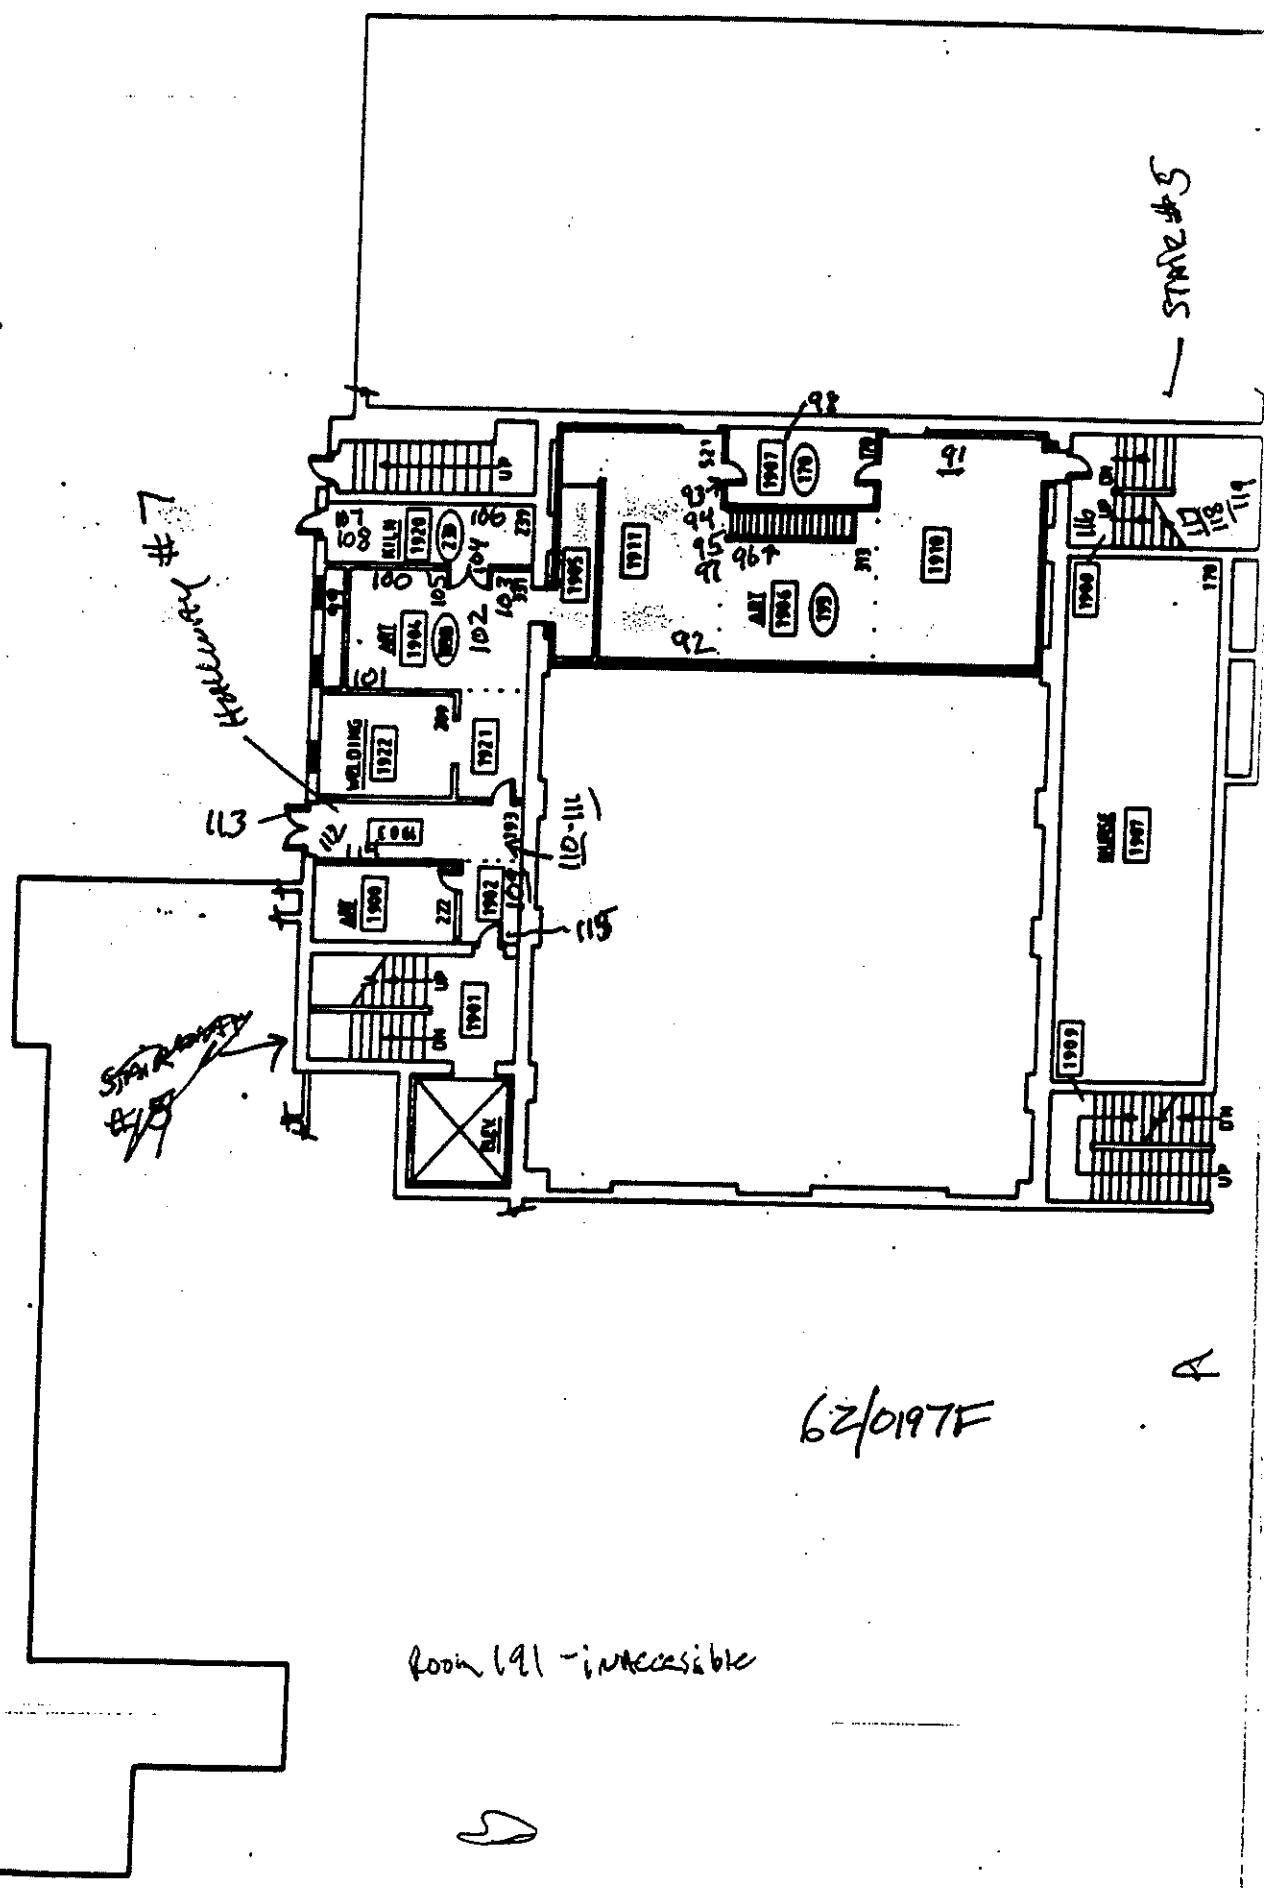


Striveill - 3,4,5

三

62/0197F

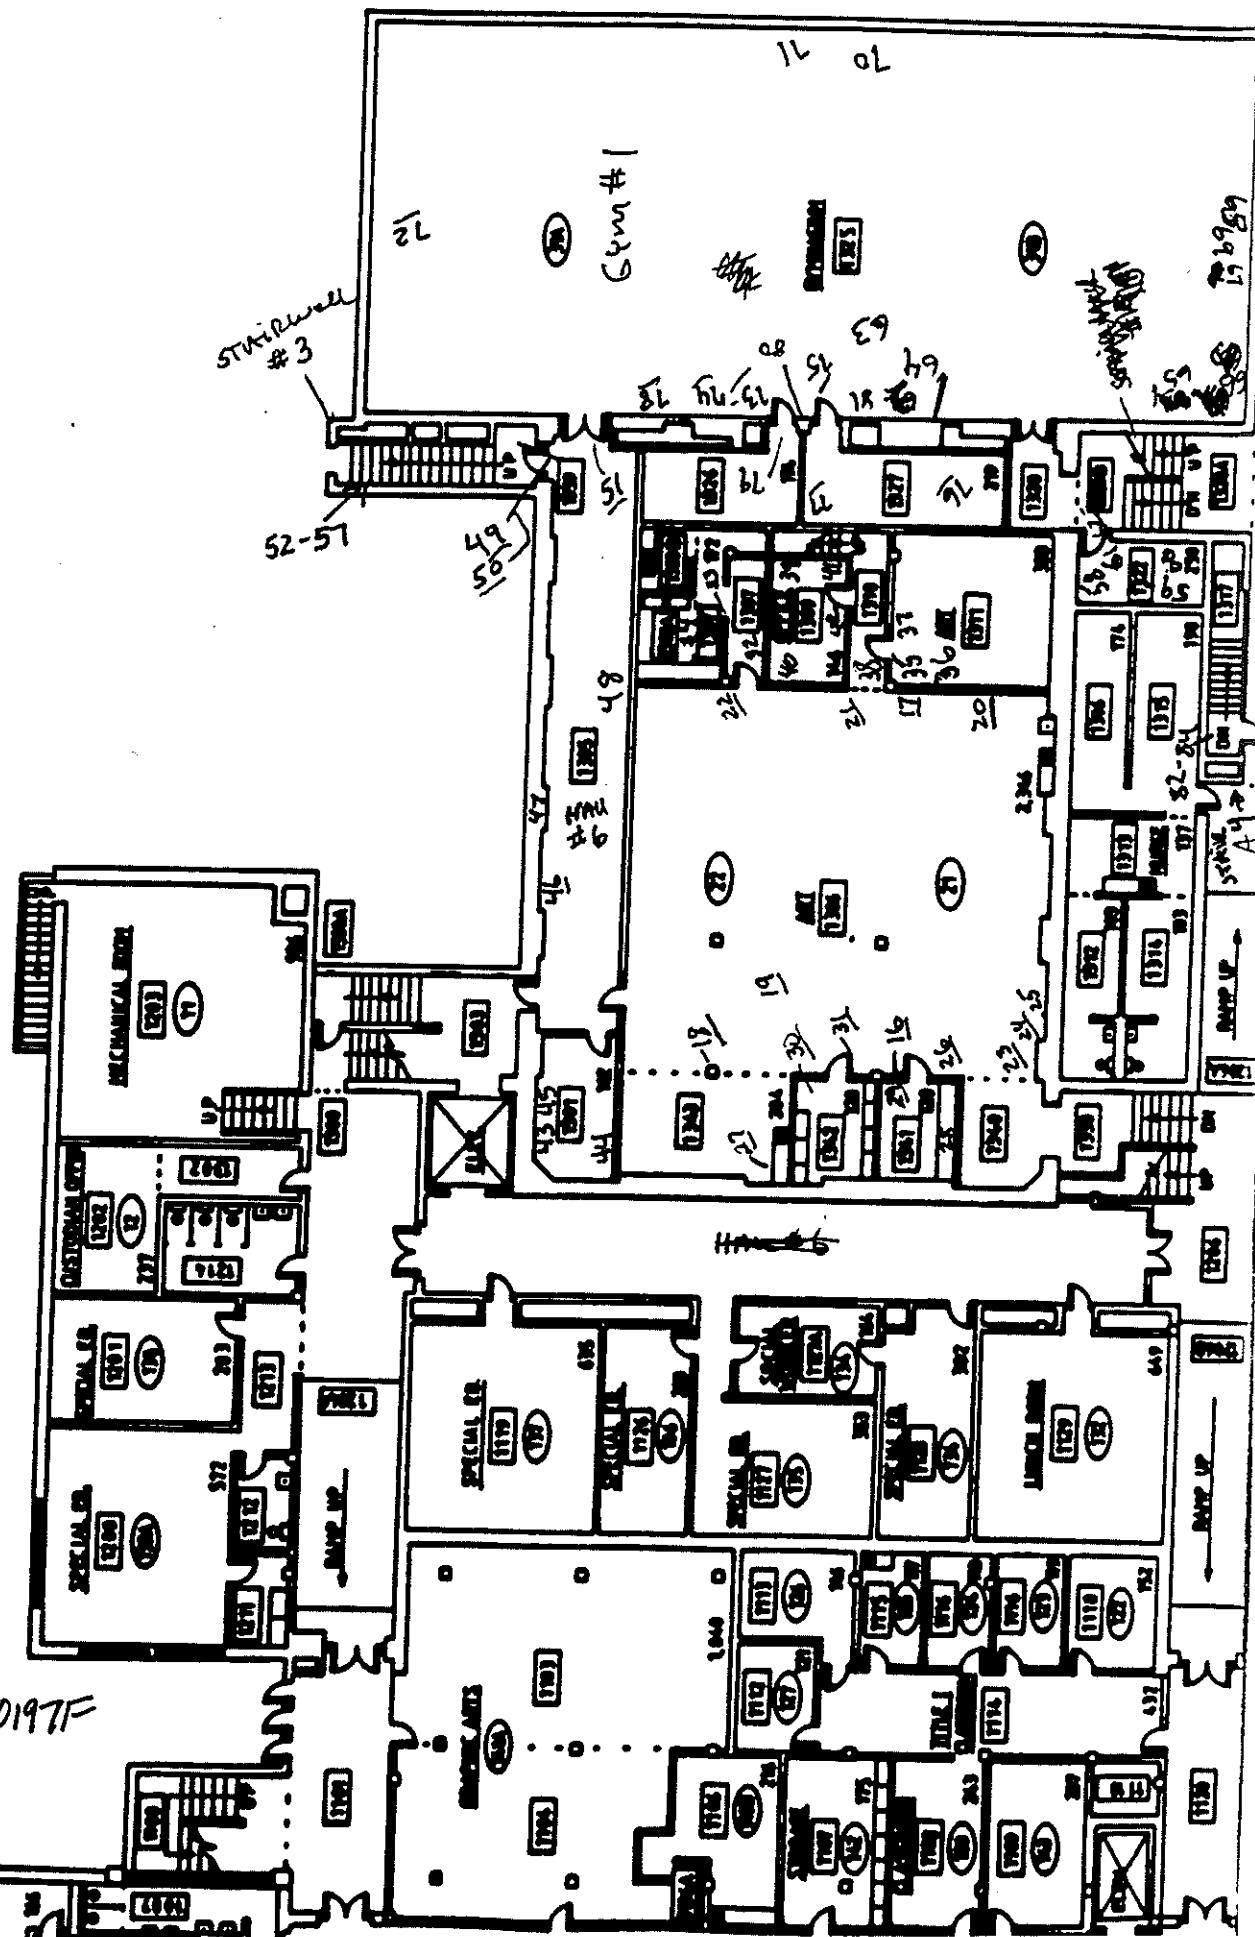



FIRST FLOOR NO

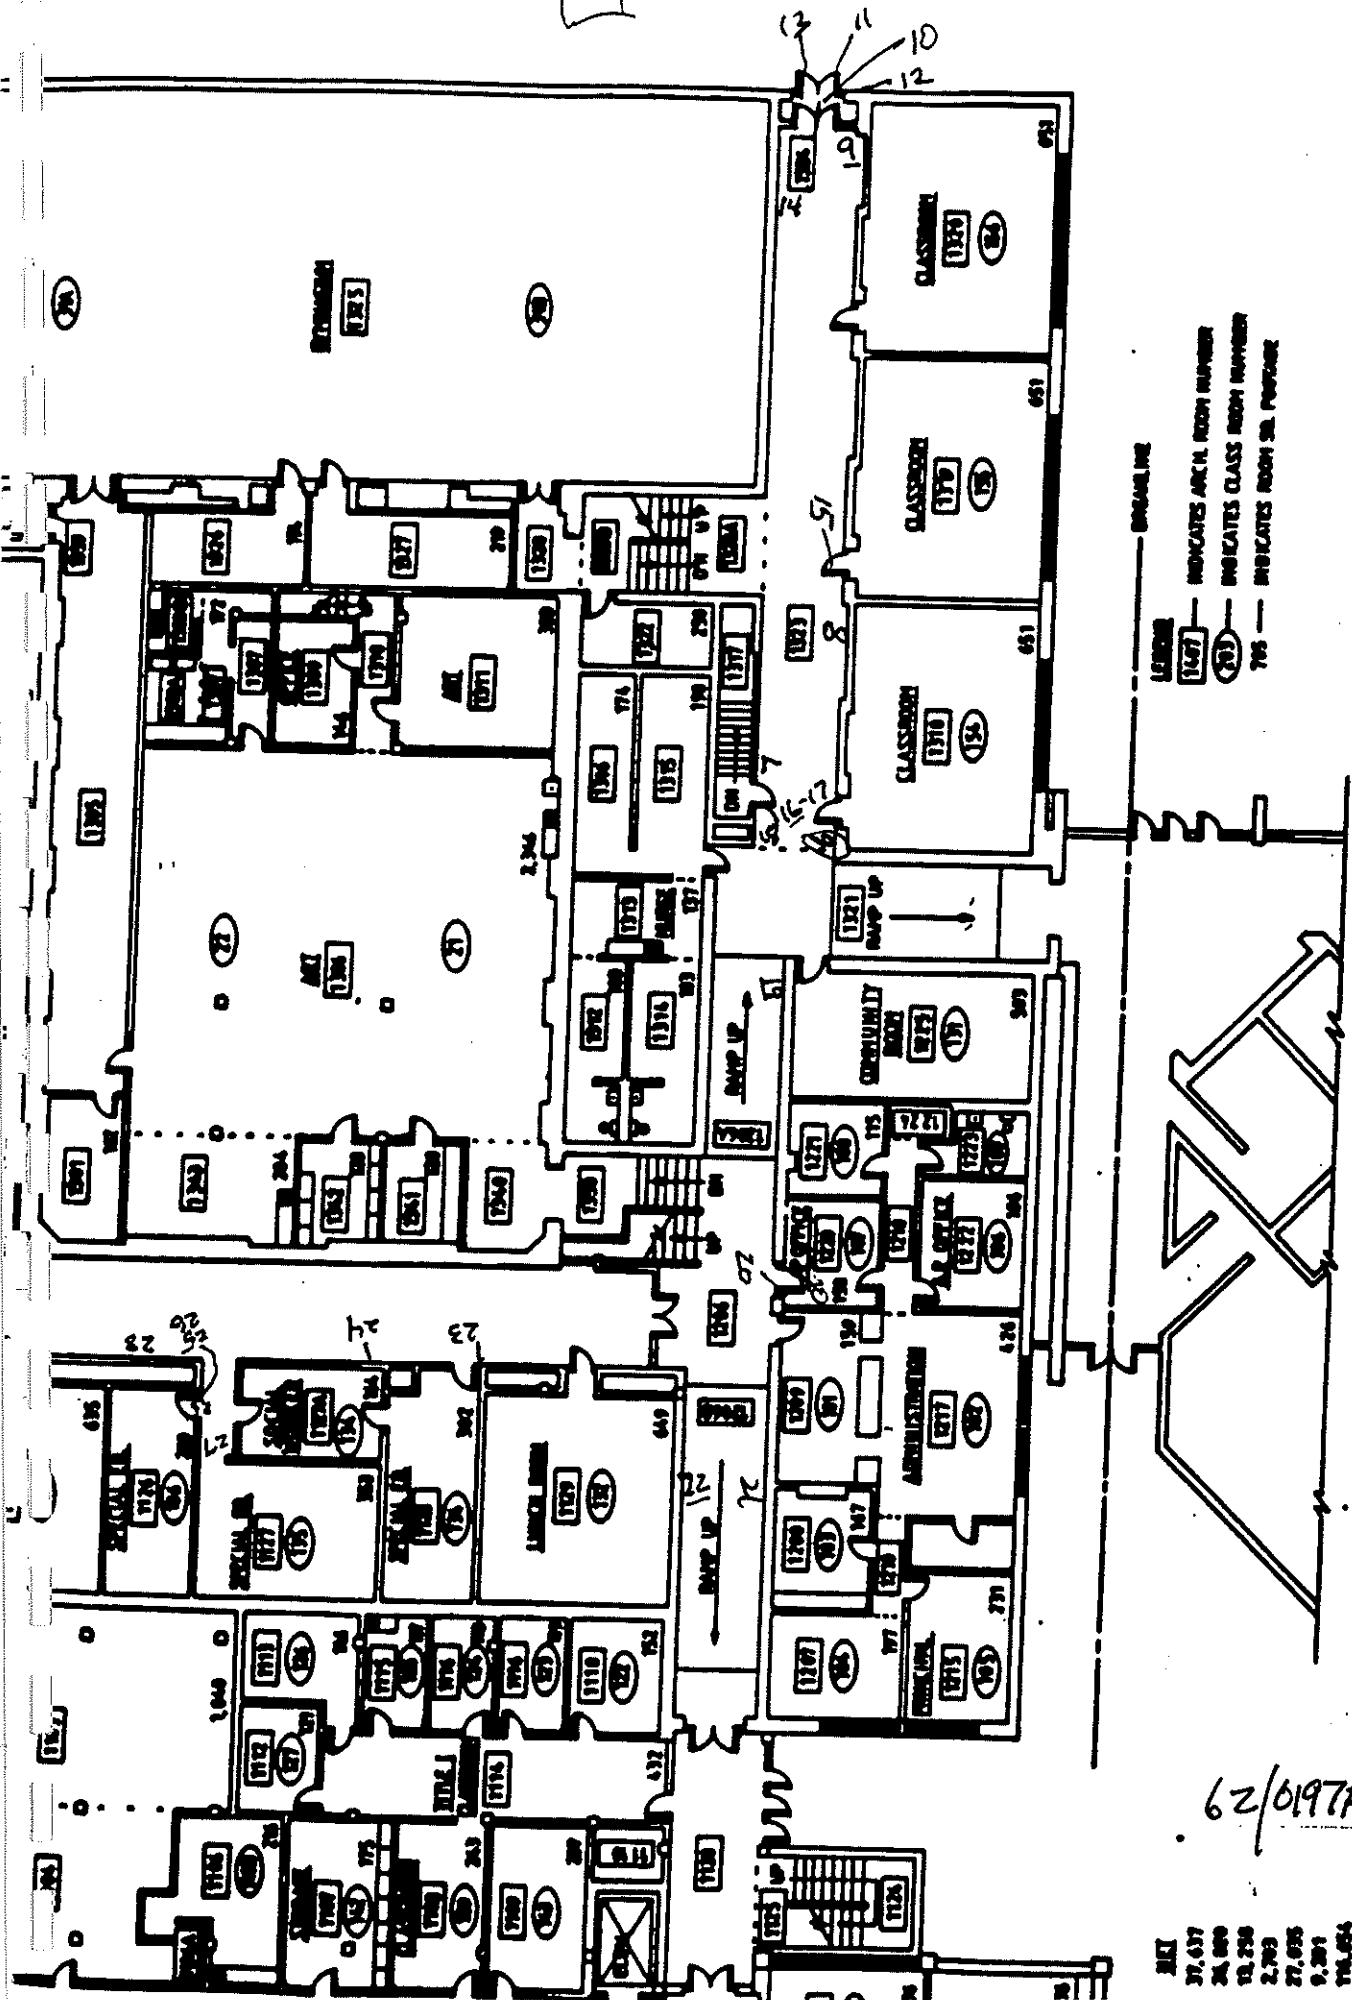

C

JR. HIGH UNIT VENT
1956 ADDITION SHEET #1

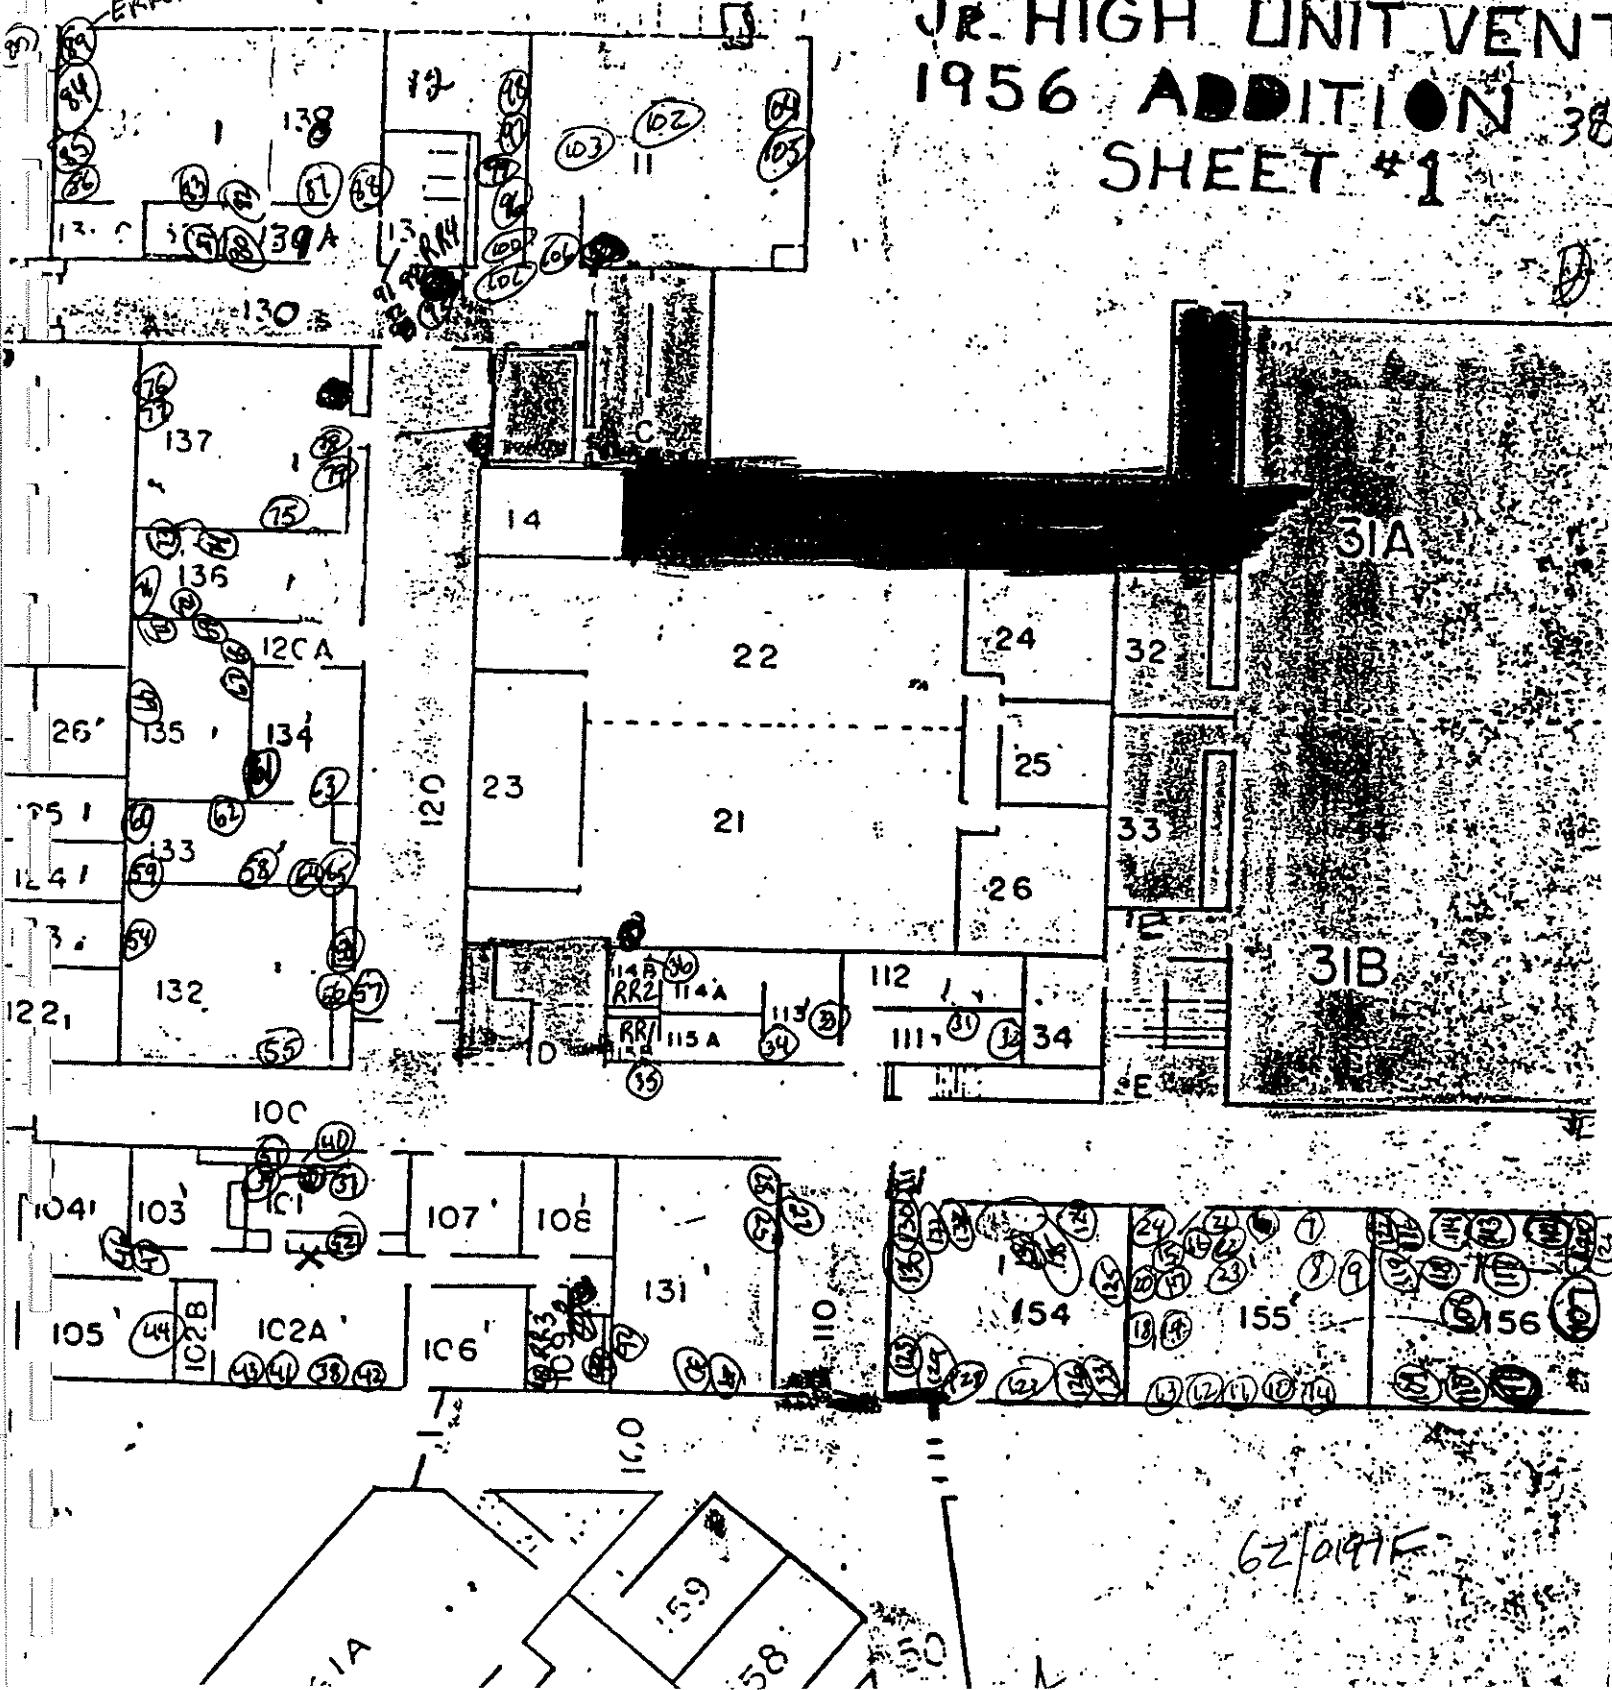

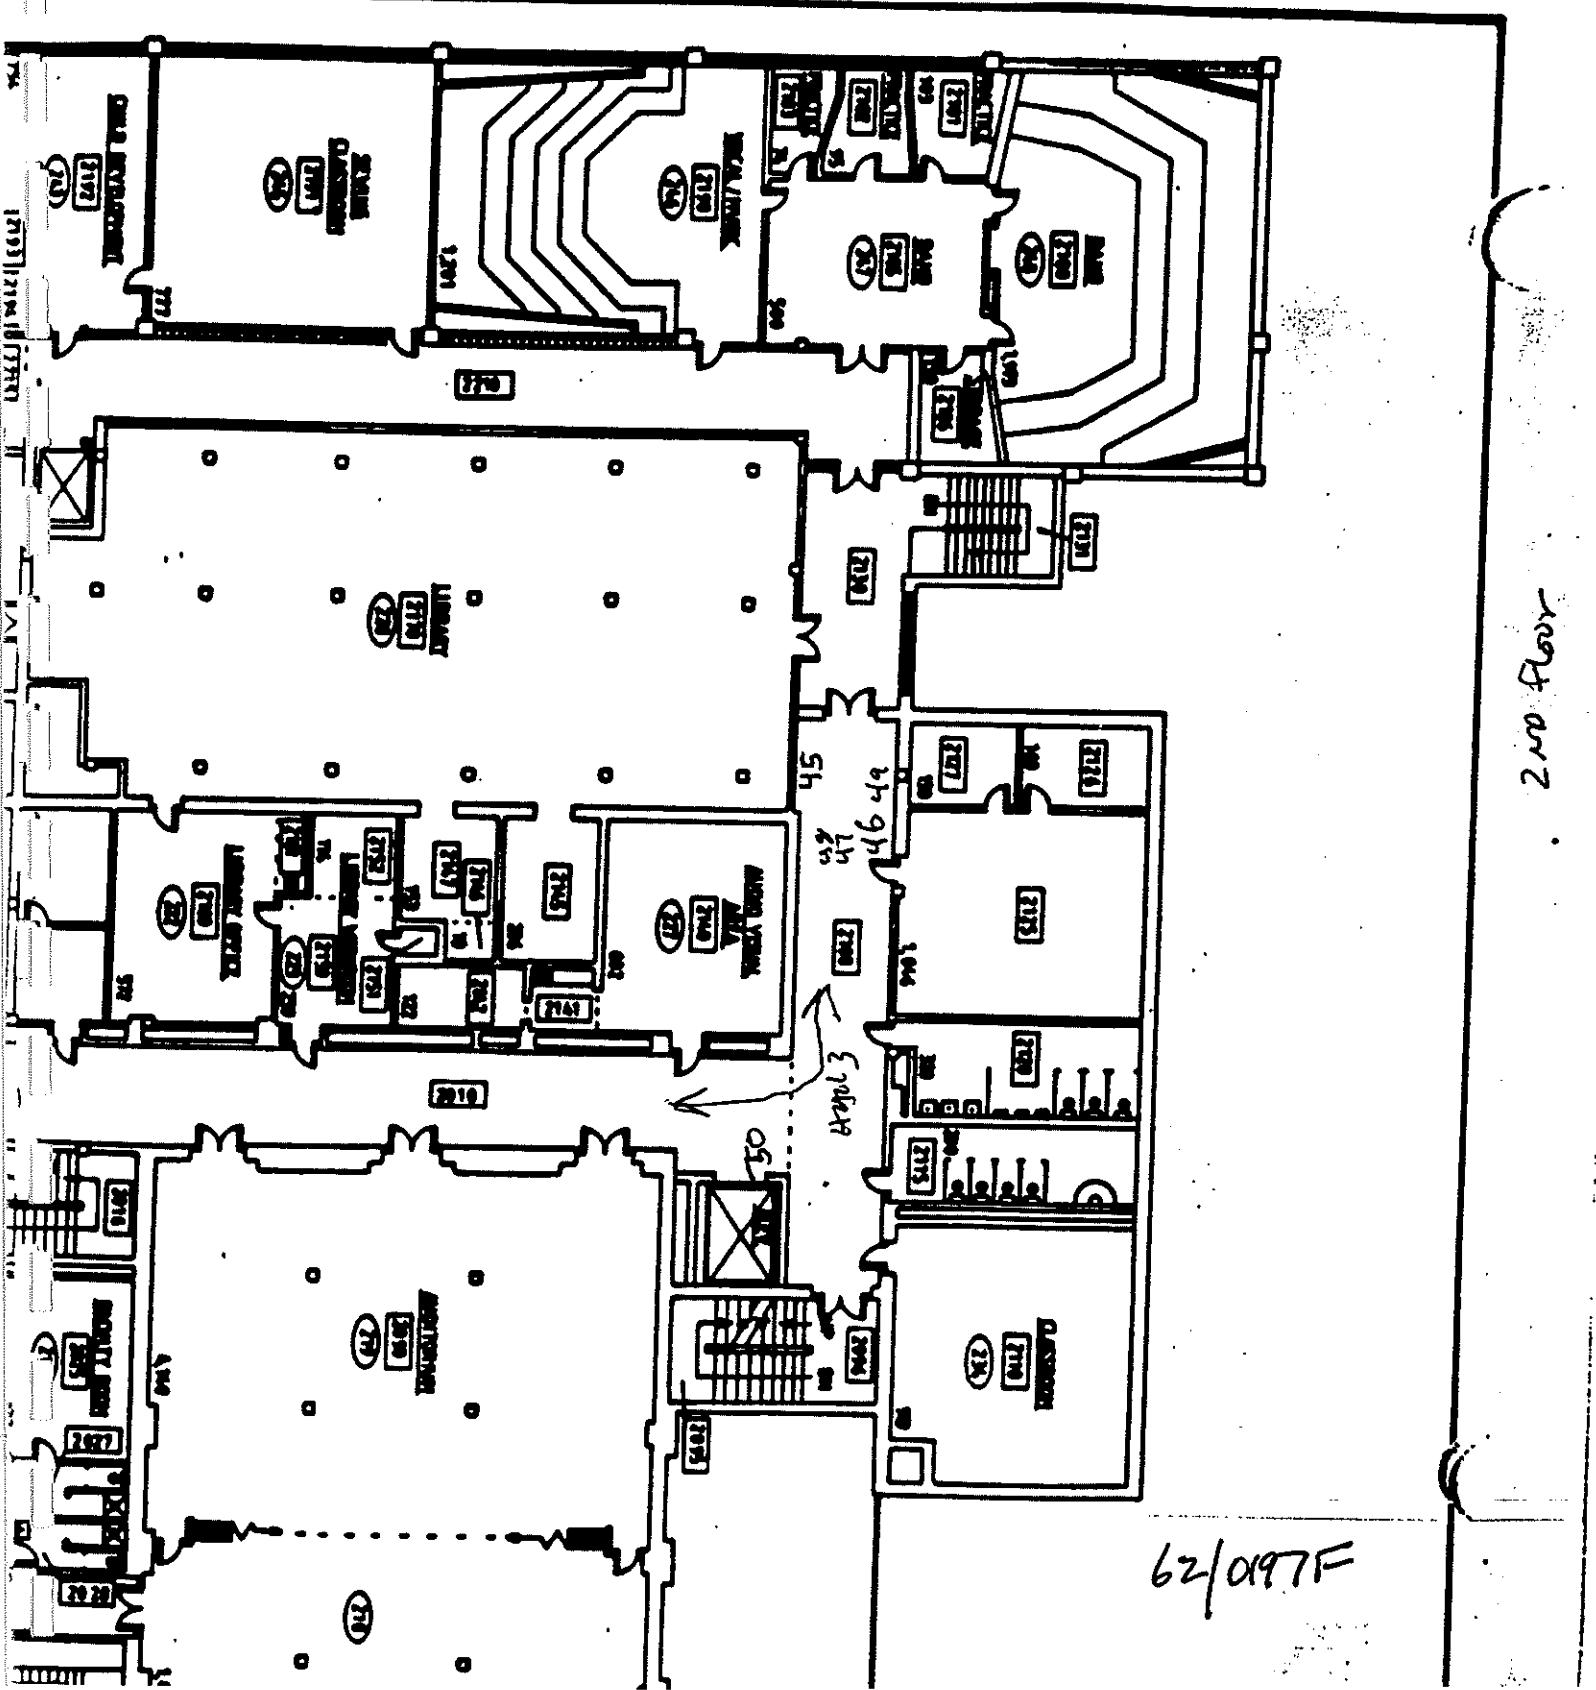




2/19/97
SITE 2

Humboldt
Jr. High

62/0197F

JR
19

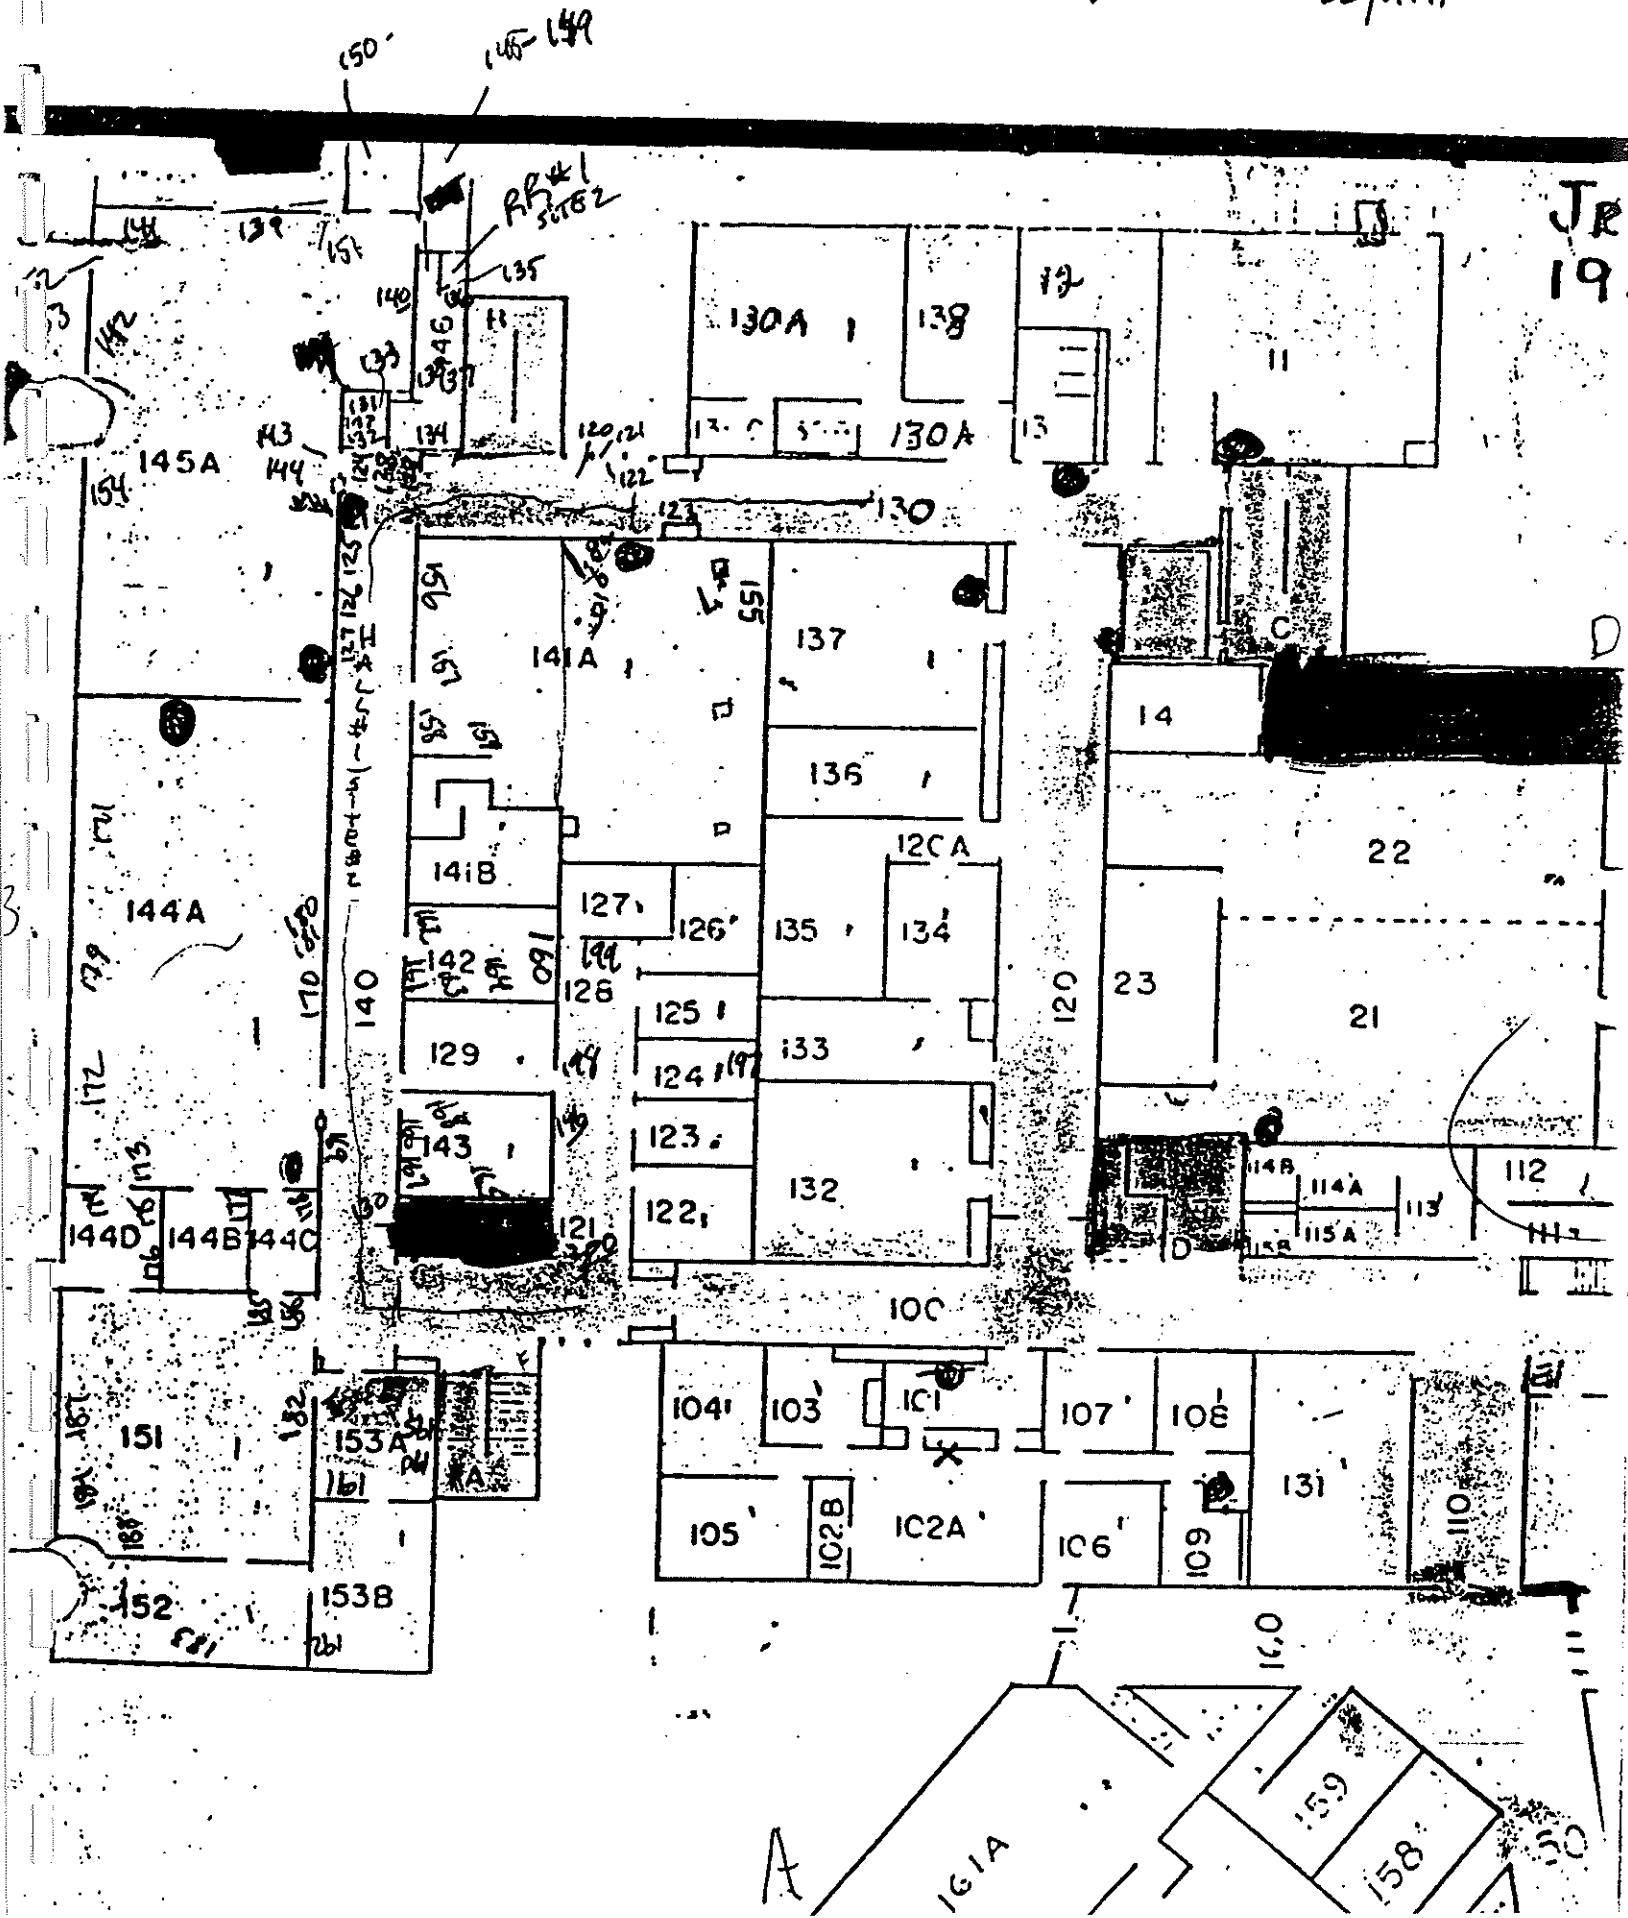

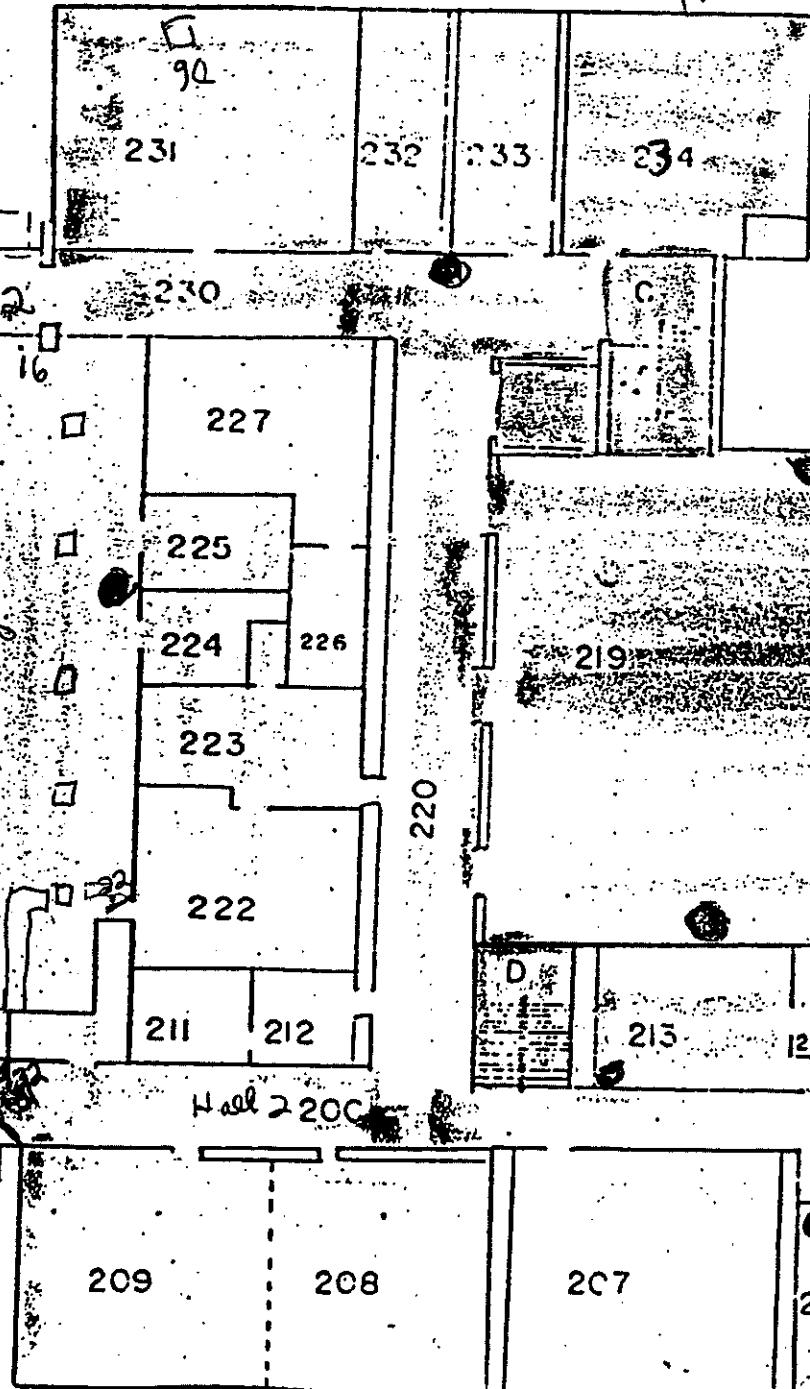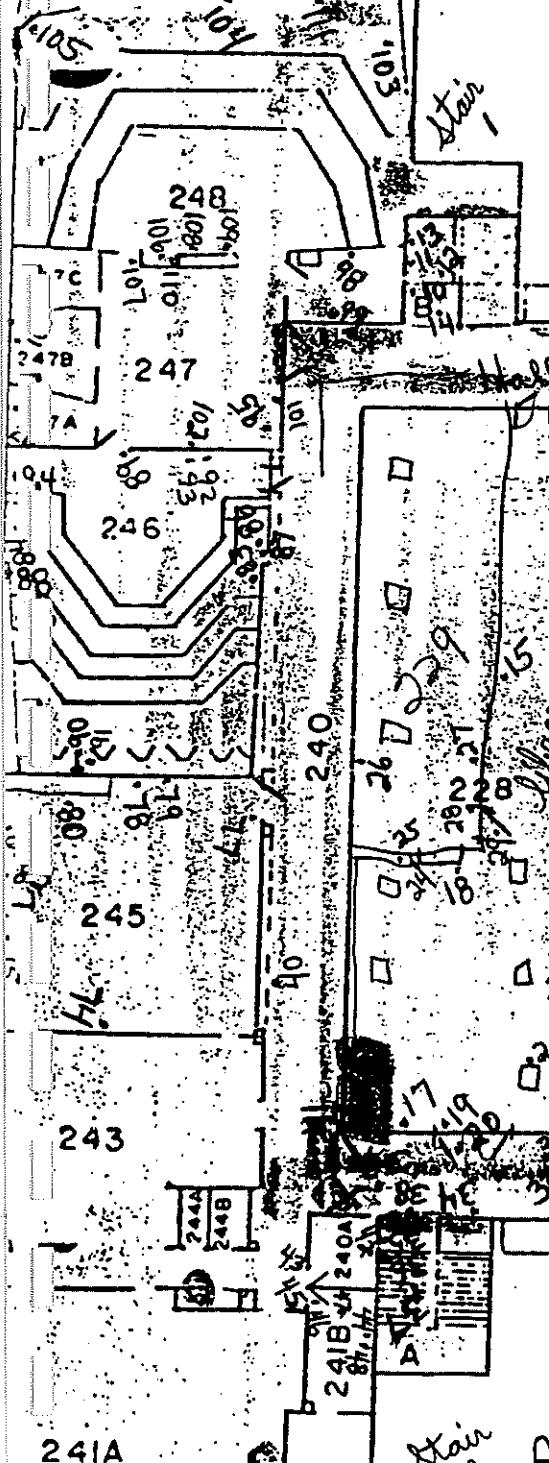

C

62/0197R

JR.

Rubenstein

19

D

ROOF

21

20

21

205

206

207

Government
3 window panel


Chalkboard ledge 4
dash 5

62/0197F

ST. PAUL

MOLDT EDUCATION CENTER

SECOND FLOOR PLAN

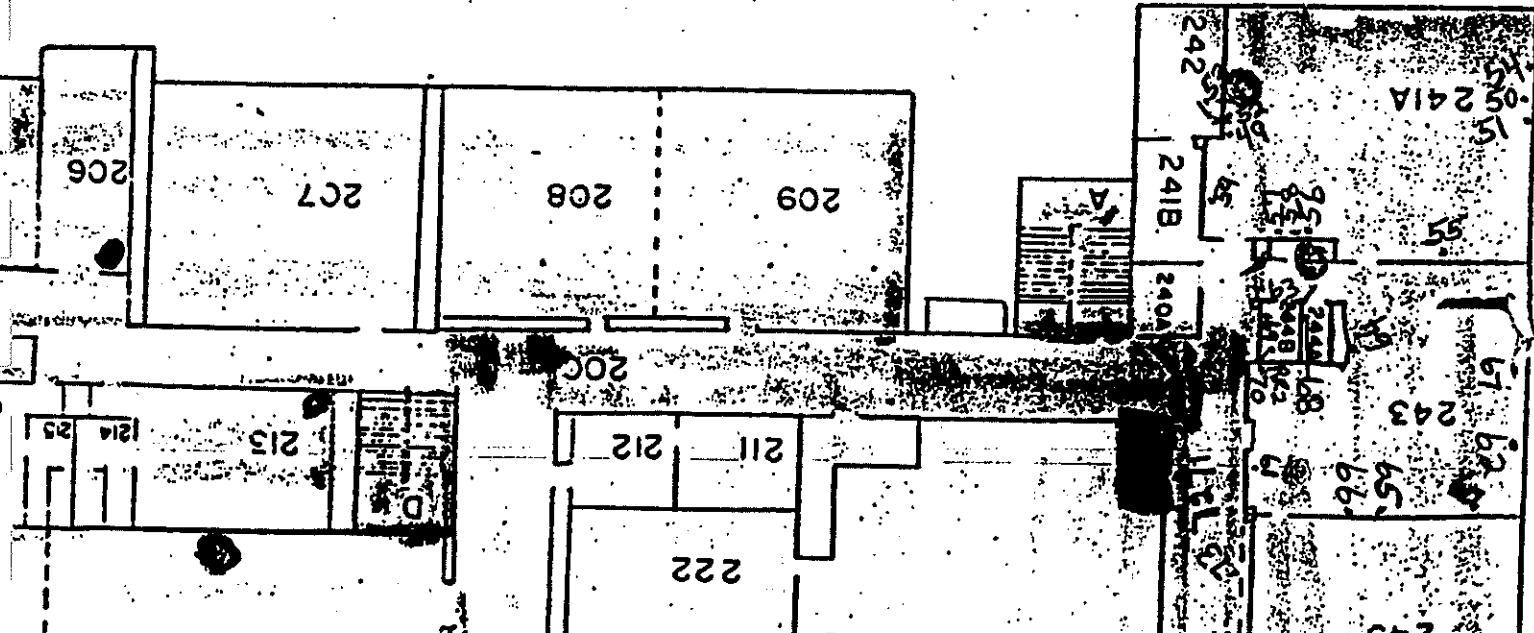

Saint Paul Public Schools
Humboldt Secondary Complex
Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|----------------------------|-----|----------|---------|----------|-------|------------|-------|------------|-------------|-----------|-----------|---------|
| 1 | Humboldt Secondary Complex | | | | | | | | | | | | |
| 2 | | | | | | | | | | | | | |
| 3 | Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 4 | 1909 & 1924 bldg. | 187 | XRF | 2/11/97 | 21:57:04 | 2 | Auditorium | 0 | Ceiling | Crown mold | Cracked | Plaster | 0.34 |
| 5 | 1909 & 1924 bldg. | 186 | XRF | 2/11/97 | 21:55:08 | 2 | Auditorium | 0 | Door | Crown mold | Solid | Plaster | 1.25 |
| 6 | 1909 & 1924 bldg. | 188 | XRF | 2/11/97 | 21:59:56 | 2 | Auditorium | 0 | Door | Door | Solid | Wood | 0.09 |
| 7 | 1909 & 1924 bldg. | 189 | XRF | 2/11/97 | 22:00:47 | 2 | Auditorium | 0 | Door | Jamb | Solid | Wood | 0.06 |
| 8 | 1909 & 1924 bldg. | 192 | XRF | 2/11/97 | 22:04:17 | 2 | Auditorium | 0 | Folding | Chair Frame | Solid | Metal | 0.39 |
| 9 | 1909 & 1924 bldg. | 182 | XRF | 2/11/97 | 21:48:14 | 2 | Auditorium | 0 | Wall | Baseboard | Solid | Wood | 0 |
| 10 | 1909 & 1924 bldg. | 183 | XRF | 2/11/97 | 21:49:16 | 2 | Auditorium | 0 | Wall | Baseboard | Solid | Wood | 5.09 |
| 11 | 1909 & 1924 bldg. | 184 | XRF | 2/11/97 | 21:50:24 | 2 | Auditorium | 0 | Wall | Wall | Solid | Plaster | 5.09 |
| 12 | 1909 & 1924 bldg. | 185 | XRF | 2/11/97 | 21:51:22 | 2 | Auditorium | 0 | Wall | Midle Wall | Solid | Plaster | 0.04 |
| 13 | 1909 & 1924 bldg. | 190 | XRF | 2/11/97 | 22:01:49 | 2 | Auditorium | 0 | Wall | Wall Rgstr | Solid | Metal | 5.09 |
| 14 | 1909 & 1924 bldg. | 191 | XRF | 2/11/97 | 22:03:10 | 2 | Auditorium | 0 | Wall | Radiator | Cracked | Metal | 2.1 |
| 15 | 1909 & 1924 bldg. | 130 | XRF | 2/11/97 | 19:43:18 | 1 | Auditorium | 154 | Door | Door | Solid | Wood | 0 |
| 16 | 1909 & 1924 bldg. | 131 | XRF | 2/11/97 | 19:44:06 | 1 | Auditorium | 154 | Door | Casing | Solid | Wood | 0.05 |
| 17 | 1909 & 1924 bldg. | 132 | XRF | 2/11/97 | 19:44:50 | 1 | Auditorium | 154 | Door | Jamb | Solid | Metal | 0.01 |
| 18 | 1909 & 1924 bldg. | 123 | XRF | 2/11/97 | 19:35:14 | 1 | Auditorium | 154 | Floor | | Cracked | Wood | 0 |
| 19 | 1909 & 1924 bldg. | 124 | XRF | 2/11/97 | 19:36:04 | 1 | Auditorium | 154 | Wall | Baseboard | Solid | Wood | 0.06 |
| 20 | 1909 & 1924 bldg. | 125 | XRF | 2/11/97 | 19:37:00 | 1 | Auditorium | 154 | Wall | Wall | Solid | Plaster | 0.06 |
| 21 | 1909 & 1924 bldg. | 126 | XRF | 2/11/97 | 19:39:23 | 1 | Auditorium | 154 | Window | Apron | Solid | Concrte | 0.02 |
| 22 | 1909 & 1924 bldg. | 127 | XRF | 2/11/97 | 19:40:11 | 1 | Auditorium | 154 | Window | Casing | Solid | Wood | 0.15 |
| 23 | 1909 & 1924 bldg. | 128 | XRF | 2/11/97 | 19:41:20 | 1 | Auditorium | 154 | Window | Sash | Solid | Metal | 0.01 |
| 24 | 1909 & 1924 bldg. | 129 | XRF | 2/11/97 | 19:42:14 | 1 | Auditorium | 154 | Panel | | Solid | Metal | 0.01 |
| 25 | 1909 & 1924 bldg. | 25 | XRF | 2/19/97 | 17:56:57 | | Classroom | 21 | Cabinet | Door | Solid | Wood | 0.01 |
| 26 | 1909 & 1924 bldg. | 26 | XRF | 2/19/97 | 17:57:55 | | Classroom | 21 | Cabinet | Locker | Solid | Metal | 0.57 |
| 27 | 1909 & 1924 bldg. | 27 | XRF | 2/19/97 | 17:58:57 | | Classroom | 21 | Cabinet | Door | Solid | Wood | 0 |
| 28 | 1909 & 1924 bldg. | 19 | XRF | 2/19/97 | 17:50:09 | | Classroom | 21 | Ceiling | | Solid | Wood | 0.57 |
| 29 | 1909 & 1924 bldg. | 28 | XRF | 2/19/97 | 18:00:50 | | Classroom | 21 | Closet | Wall | Solid | Drywall | 0 |
| 30 | 1909 & 1924 bldg. | 29 | XRF | 2/19/97 | 18:01:42 | | Classroom | 21 | Closet | Casing | Solid | Metal | 0.01 |
| 31 | 1909 & 1924 bldg. | 30 | XRF | 2/19/97 | 18:02:32 | | Classroom | 21 | Closet | Wall | Solid | Plaster | 0.1 |
| 32 | 1909 & 1924 bldg. | 31 | XRF | 2/19/97 | 18:03:25 | | Classroom | 21 | Closet | Casing | Solid | Metal | 0.01 |
| 33 | 1909 & 1924 bldg. | 21 | XRF | 2/19/97 | 17:53:04 | | Classroom | 21 | Door | Casing | Solid | Metal | 0.36 |
| 34 | 1909 & 1924 bldg. | 22 | XRF | 2/19/97 | 17:53:56 | | Classroom | 21 | Door | Door | Solid | Wood | 0 |
| 35 | 1909 & 1924 bldg. | 23 | XRF | 2/19/97 | 17:55:09 | | Classroom | 21 | Door | Jamb | Solid | Wood | 0.05 |
| 36 | 1909 & 1924 bldg. | 24 | XRF | 2/19/97 | 17:55:53 | | Classroom | 21 | Door | Door | Solid | Wood | 0.02 |
| 37 | 1909 & 1924 bldg. | 16 | XRF | 2/19/97 | 17:28:25 | | Classroom | 21 | Wall | Midle Wall | Solid | Plaster | 5.09 |
| 38 | 1909 & 1924 bldg. | 17 | XRF | 2/19/97 | 17:46:50 | | Classroom | 21 | Wall | Wall | Solid | Drywall | 0.03 |
| 39 | 1909 & 1924 bldg. | 18 | XRF | 2/19/97 | 17:48:06 | | Classroom | 21 | Wall | Column | Solid | Drywall | 3.01 |
| 40 | 1909 & 1924 bldg. | 20 | XRF | 2/19/97 | 17:52:11 | | Classroom | 21 | Window | Casing | Solid | Wood | 0.01 |
| 41 | 1909 & 1924 bldg. | 42 | XRF | 2/11/97 | 17:29:59 | 1 | Classroom | 101 | Door | Casing | Solid | Wood | 0.08 |
| 42 | 1909 & 1924 bldg. | 38 | XRF | 2/11/97 | 17:26:15 | 1 | Classroom | 101 | Wall | Wall | Solid | Plaster | 5.09 |
| 43 | 1909 & 1924 bldg. | 39 | XRF | 2/11/97 | 17:26:12 | 1 | Classroom | 101 | Wall | Wall | Solid | Drywall | 0.19 |
| 44 | 1909 & 1924 bldg. | 40 | XRF | 2/11/97 | 17:27:17 | 1 | Classroom | 101 | Wall | Baseboard | Solid | Wood | 4.48 |
| 45 | 1909 & 1924 bldg. | 41 | XRF | 2/11/97 | 17:28:34 | 1 | Classroom | 101 | Window | Apron | Solid | | 0.08 |
| 46 | 1909 & 1924 bldg. | 43 | XRF | 2/11/97 | 17:30:56 | 1 | Classroom | 101 | Window | Casing | Solid | Metal | 0.01 |
| 47 | 1909 & 1924 bldg. | 37 | XRF | 2/11/97 | 17:23:31 | 1 | Classroom | 102 | Wall | Wall | Solid | Plaster | 2.94 |
| 48 | 1909 & 1924 bldg. | 29 | XRF | 2/11/97 | 17:06:15 | 1 | Classroom | 131 | Chalkboard | Sill | Peeling | Wood | 0 |
| 49 | 1909 & 1924 bldg. | 30 | XRF | 2/11/97 | 17:07:21 | 1 | Classroom | 131 | Chalkboard | Sash | Solid | Wood | 0.01 |
| 50 | 1909 & 1924 bldg. | 27 | XRF | 2/11/97 | 17:03:56 | 1 | Classroom | 131 | Door | Door | Solid | Wood | 0 |
| 51 | 1909 & 1924 bldg. | 28 | XRF | 2/11/97 | 17:04:43 | 1 | Classroom | 131 | Door | Jamb | Solid | Metal | 0.03 |
| 52 | 1909 & 1924 bldg. | 25 | XRF | 2/11/97 | 17:02:20 | 1 | Classroom | 131 | Wall | Wall | Solid | Plaster | 5.09 |
| 53 | 1909 & 1924 bldg. | 26 | XRF | 2/11/97 | 17:03:09 | 1 | Classroom | 131 | Wall | Wall | Solid | Plaster | 0.23 |
| 54 | 1909 & 1924 bldg. | 58 | XRF | 2/11/97 | 17:51:21 | 1 | Classroom | 133 | Wall | Wall | Solid | Drywall | 0.09 |
| 55 | 1909 & 1924 bldg. | 59 | XRF | 2/11/97 | 17:52:35 | 1 | Classroom | 133 | Wall | Wall | Solid | Plaster | 2.1 |
| 56 | 1909 & 1924 bldg. | 60 | XRF | 2/11/97 | 17:53:22 | 1 | Classroom | 133 | Wall | Baseboard | Peeling | Wood | 0.04 |
| 57 | 1909 & 1924 bldg. | 69 | XRF | 2/11/97 | 18:07:12 | 1 | Classroom | 135 | Chalkboard | Sash | Solid | Wood | 0 |
| 58 | 1909 & 1924 bldg. | 70 | XRF | 2/11/97 | 18:08:34 | 1 | Classroom | 135 | Chalkboard | Sill | Solid | Wood | 0.04 |
| 59 | 1909 & 1924 bldg. | 67 | XRF | 2/11/97 | 18:05:38 | 1 | Classroom | 135 | Door | Door | Solid | Wood | 0 |
| 60 | 1909 & 1924 bldg. | 68 | XRF | 2/11/97 | 18:06:22 | 1 | Classroom | 135 | Door | Jamb | Solid | Metal | 0 |
| 61 | 1909 & 1924 bldg. | 66 | XRF | 2/11/97 | 18:04:28 | 1 | Classroom | 135 | Wall | Wall | Solid | Drywall | 0 |
| 62 | 1909 & 1924 bldg. | 76 | XRF | 2/11/97 | 18:26:51 | 1 | Classroom | 137 | Chalkboard | Sill | Solid | Wood | 0.06 |
| 63 | 1909 & 1924 bldg. | 77 | XRF | 2/11/97 | 18:27:47 | 1 | Classroom | 137 | Chalkboard | Sash | Cracked | Wood | 0.02 |
| 64 | 1909 & 1924 bldg. | 78 | XRF | 2/11/97 | 18:28:57 | 1 | Classroom | 137 | Door | Jamb | Solid | Wood | 0.1 |
| 65 | 1909 & 1924 bldg. | 79 | XRF | 2/11/97 | 18:29:40 | 1 | Classroom | 137 | Door | Door | Solid | Wood | 0.03 |
| 66 | 1909 & 1924 bldg. | 75 | XRF | 2/11/97 | 18:24:57 | 1 | Classroom | 137 | Wall | Wall | Solid | Drywall | 0.11 |
| 67 | 1909 & 1924 bldg. | 87 | XRF | 2/11/97 | 18:43:41 | 1 | Classroom | 138 | Door | Door | Solid | Wood | 0.05 |
| 68 | 1909 & 1924 bldg. | 88 | XRF | 2/11/97 | 18:44:27 | 1 | Classroom | 138 | Door | Casing | Solid | Metal | 0 |
| 69 | 1909 & 1924 bldg. | 83 | XRF | 2/11/97 | 18:38:30 | 1 | Classroom | 138 | Wall | Midle Wall | Solid | Drywall | 0 |

Saint Paul Public Schools
 Humboldt Secondary Complex
 Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | M |
|------|-------------------|----------|---------|----------|-------|-----------|-------|------------|------------|-----------|-----------|---------|
| Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 70 | 1909 & 1924 bldg. | 84 XRF | 2/11/97 | 18:39:40 | 1 | Classroom | 138 | Wall | Wall | Solid | Drywall | 0 |
| 71 | 1909 & 1924 bldg. | 85 XRF | 2/11/97 | 18:40:49 | 1 | Classroom | 138 | Window | Apron | Solid | Wood | 0.11 |
| 72 | 1909 & 1924 bldg. | 86 XRF | 2/11/97 | 18:41:54 | 1 | Classroom | 138 | Window | Casing | Solid | Wood | 0.21 |
| 73 | 1909 & 1924 bldg. | 89 XRF | 2/11/97 | 18:45:37 | 1 | Classroom | 138 | | Radiator | Cracked | Metal | 0.13 |
| 74 | 1909 & 1924 bldg. | 90 XRF | 2/11/97 | 18:46:23 | 1 | Classroom | 138 | | Radiator | Cracked | Metal | 0.01 |
| 75 | 1909 & 1924 bldg. | 134 XRF | 2/11/97 | 19:46:54 | 1 | Classroom | 154 | Cabinet | Door | Solid | Wood | 0.03 |
| 76 | 1909 & 1924 bldg. | 135 XRF | 2/11/97 | 19:47:37 | 1 | Classroom | 154 | Cabinet | Outside | Solid | Wood | 0.07 |
| 77 | 1909 & 1924 bldg. | 136 XRF | 2/11/97 | 19:48:31 | 1 | Classroom | 154 | Wall | Wall Rgstr | Solid | Metal | 0.06 |
| 78 | 1909 & 1924 bldg. | 133 XRF | 2/11/97 | 19:45:56 | 1 | Classroom | 154 | | Radiator | Cracked | Metal | 0.18 |
| 79 | 1909 & 1924 bldg. | 21 XRF | 2/11/97 | 16:55:47 | 1 | Classroom | 155 | Cabinet | Door | Solid | Wood | 0.05 |
| 80 | 1909 & 1924 bldg. | 22 XRF | 2/11/97 | 16:56:27 | 1 | Classroom | 155 | Cabinet | Inside | Solid | Wood | 0 |
| 81 | 1909 & 1924 bldg. | 23 XRF | 2/11/97 | 16:57:14 | 1 | Classroom | 155 | Cabinet | Outside | Solid | Wood | 0 |
| 82 | 1909 & 1924 bldg. | 10 XRF | 2/11/97 | 16:42:29 | 1 | Classroom | 155 | Ceiling | | Solid | Plaster | 0.16 |
| 83 | 1909 & 1924 bldg. | 18 XRF | 2/11/97 | 18:52:12 | 1 | Classroom | 155 | Chalkboard | Sash | Peeling | Wood | 0.06 |
| 84 | 1909 & 1924 bldg. | 19 XRF | 2/11/97 | 16:53:21 | 1 | Classroom | 155 | Chalkboard | Sill | Peeling | Wood | 0.06 |
| 85 | 1909 & 1924 bldg. | 15 XRF | 2/11/97 | 16:49:29 | 1 | Classroom | 155 | Door | Jamb | Solid | Metal | 0.03 |
| 86 | 1909 & 1924 bldg. | 16 XRF | 2/11/97 | 16:50:10 | 1 | Classroom | 155 | Door | Casing | Solid | Wood | 0.11 |
| 87 | 1909 & 1924 bldg. | 17 XRF | 2/11/97 | 16:50:54 | 1 | Classroom | 155 | Door | Door | Solid | Wood | 0 |
| 88 | 1909 & 1924 bldg. | 7 XRF | 2/11/97 | 16:38:40 | 1 | Classroom | 155 | Floor | | Solid | Wood | 0 |
| 89 | 1909 & 1924 bldg. | 6 XRF | 2/11/97 | 16:37:21 | 1 | Classroom | 155 | Wall | Baseboard | Solid | Wood | 0.1 |
| 90 | 1909 & 1924 bldg. | 8 XRF | 2/11/97 | 16:39:27 | 1 | Classroom | 155 | Wall | Solid | Plaster | 4.44 | |
| 91 | 1909 & 1924 bldg. | 9 XRF | 2/11/97 | 16:40:49 | 1 | Classroom | 155 | Wall | Solid | Plaster | 0.07 | |
| 92 | 1909 & 1924 bldg. | 24 XRF | 2/11/97 | 16:58:24 | 1 | Classroom | 155 | Wall | Wall Rgstr | Solid | Metal | 0.19 |
| 93 | 1909 & 1924 bldg. | 11 XRF | 2/11/97 | 16:44:57 | 1 | Classroom | 155 | Window | Casing | Solid | Wood | 0.12 |
| 94 | 1909 & 1924 bldg. | 12 XRF | 2/11/97 | 16:46:18 | 1 | Classroom | 155 | Window | Sash | Solid | Metal | 0 |
| 95 | 1909 & 1924 bldg. | 14 XRF | 2/11/97 | 16:48:18 | 1 | Classroom | 155 | Window | Stool | Solid | Concrete | 0.03 |
| 96 | 1909 & 1924 bldg. | 13 XRF | 2/11/97 | 16:47:35 | 1 | Classroom | 155 | | Panel | Solid | Metal | 0.09 |
| 97 | 1909 & 1924 bldg. | 20 XRF | 2/11/97 | 16:54:26 | 1 | Classroom | 155 | | Radiator | Peeling | Metal | 3.53 |
| 98 | 1909 & 1924 bldg. | 117 XRF | 2/11/97 | 19:27:53 | 1 | Classroom | 156 | Cabinet | Door | Solid | Wood | 0.1 |
| 99 | 1909 & 1924 bldg. | 118 XRF | 2/11/97 | 19:28:40 | 1 | Classroom | 156 | Cabinet | Shelf | Solid | Wood | 0 |
| 100 | 1909 & 1924 bldg. | 108 XRF | 2/11/97 | 19:17:10 | 1 | Classroom | 156 | Ceiling | | Solid | Plaster | 0.11 |
| 101 | 1909 & 1924 bldg. | 120 XRF | 2/11/97 | 19:30:37 | 1 | Classroom | 156 | Chalkboard | Sash | Peeling | Wood | 0.05 |
| 102 | 1909 & 1924 bldg. | 121 XRF | 2/11/97 | 19:31:37 | 1 | Classroom | 156 | Chalkboard | Sill | Solid | Wood | 0.1 |
| 103 | 1909 & 1924 bldg. | 113 XRF | 2/11/97 | 19:23:43 | 1 | Classroom | 156 | Door | Door | Solid | Wood | 0 |
| 104 | 1909 & 1924 bldg. | 114 XRF | 2/11/97 | 19:25:19 | 1 | Classroom | 156 | Door | Jamb | Solid | Metal | 0.01 |
| 105 | 1909 & 1924 bldg. | 107 XRF | 2/11/97 | 19:14:21 | 1 | Classroom | 156 | Wall | Wall | Solid | Plaster | 0.18 |
| 106 | 1909 & 1924 bldg. | 112 XRF | 2/11/97 | 19:22:36 | 1 | Classroom | 156 | Wall | Baseboard | Solid | Wood | 0.06 |
| 107 | 1909 & 1924 bldg. | 122 XRF | 2/11/97 | 19:33:06 | 1 | Classroom | 156 | Wall | Wall Rgstr | Solid | Metal | 0.06 |
| 108 | 1909 & 1924 bldg. | 109 XRF | 2/11/97 | 19:19:44 | 1 | Classroom | 156 | Window | Casing | Solid | Wood | 0.16 |
| 109 | 1909 & 1924 bldg. | 110 XRF | 2/11/97 | 19:20:45 | 1 | Classroom | 156 | Window | Sash | Solid | Metal | 0 |
| 110 | 1909 & 1924 bldg. | 111 XRF | 2/11/97 | 19:21:35 | 1 | Classroom | 156 | Window | Stool | Solid | Concrete | 0.02 |
| 111 | 1909 & 1924 bldg. | 115 XRF | 2/11/97 | 19:26:47 | 1 | Classroom | 156 | | Radiator | Peeling | Metal | 0.07 |
| 112 | 1909 & 1924 bldg. | 116 XRF | 2/11/97 | 19:27:02 | 1 | Classroom | 156 | | Radiator | Peeling | | 3.11 |
| 113 | 1909 & 1924 bldg. | 119 XRF | 2/11/97 | 19:29:41 | 1 | Classroom | 156 | | Panel | Solid | Metal | 0.03 |
| 114 | 1909 & 1924 bldg. | 95 XRF | 2/19/97 | 20:37:37 | 2 | Classroom | 193 | Ceiling | | Solid | Concrete | 0.37 |
| 115 | 1909 & 1924 bldg. | 98 XRF | 2/19/97 | 20:40:59 | 2 | Classroom | 193 | Closet | Wall | Solid | Drywall | 0.04 |
| 116 | 1909 & 1924 bldg. | 93 XRF | 2/19/97 | 20:36:06 | 2 | Classroom | 193 | Door | Jamb | Solid | Metal | 0.01 |
| 117 | 1909 & 1924 bldg. | 94 XRF | 2/19/97 | 20:36:50 | 2 | Classroom | 193 | Door | Door | Solid | Wood | 0 |
| 118 | 1909 & 1924 bldg. | 97 XRF | 2/19/97 | 20:39:36 | 2 | Classroom | 193 | Door | Door | Solid | Wood | 0 |
| 119 | 1909 & 1924 bldg. | 96 XRF | 2/19/97 | 20:38:43 | 2 | Classroom | 193 | Stairs | Hand rail | Solid | Metal | 0.01 |
| 120 | 1909 & 1924 bldg. | 91 XRF | 2/19/97 | 20:34:07 | 2 | Classroom | 193 | Wall | Midle Wall | Solid | Drywall | 0.01 |
| 121 | 1909 & 1924 bldg. | 92 XRF | 2/19/97 | 20:35:09 | 2 | Classroom | 193 | Wall | Wall | Solid | Plaster | 0.01 |
| 122 | 1909 & 1924 bldg. | 13 XRF | 2/18/97 | 17:21:36 | 2 | Classroom | 202 | Door | Casing | Solid | Metal | 0.01 |
| 123 | 1909 & 1924 bldg. | 14 XRF | 2/18/97 | 17:22:21 | 2 | Classroom | 202 | Door | Door | Solid | Wood | 0 |
| 124 | 1909 & 1924 bldg. | 15 XRF | 2/18/97 | 17:23:23 | 2 | Classroom | 202 | Door | Radiator | Solid | Metal | 0.08 |
| 125 | 1909 & 1924 bldg. | 6 XRF | 2/18/97 | 17:13:59 | 2 | Classroom | 202 | Wall | Wall | Solid | Drywall | 0 |
| 126 | 1909 & 1924 bldg. | 7 XRF | 2/18/97 | 17:14:59 | 2 | Classroom | 202 | Wall | Wall | Solid | Plaster | 0.31 |
| 127 | 1909 & 1924 bldg. | 8 XRF | 2/18/97 | 17:15:54 | 2 | Classroom | 202 | Wall | Wall | Solid | | 0.24 |
| 128 | 1909 & 1924 bldg. | 9 XRF | 2/18/97 | 17:16:58 | 2 | Classroom | 202 | Window | Stool | Solid | Concrete | 0.03 |
| 129 | 1909 & 1924 bldg. | 10 XRF | 2/18/97 | 17:18:16 | 2 | Classroom | 202 | Window | Casing | Solid | Metal | 0.09 |
| 130 | 1909 & 1924 bldg. | 11 XRF | 2/18/97 | 17:19:37 | 2 | Classroom | 202 | Window | Sash | Solid | Metal | 0 |
| 131 | 1909 & 1924 bldg. | 12 XRF | 2/18/97 | 17:20:40 | 2 | Classroom | 202 | | Panel | Solid | Metal | 0.14 |
| 132 | 1909 & 1924 bldg. | 23 XRF | 2/18/97 | 17:33:55 | 2 | Classroom | 203 | Chalkboard | Sill | Solid | Wood | 0 |
| 133 | 1909 & 1924 bldg. | 24 XRF | 2/18/97 | 17:34:49 | 2 | Classroom | 203 | Chalkboard | Sash | Solid | Wood | 0.02 |
| 134 | 1909 & 1924 bldg. | 20 XRF | 2/18/97 | 17:31:06 | 2 | Classroom | 203 | Door | Casing | Solid | Metal | 0.07 |
| 135 | 1909 & 1924 bldg. | 21 XRF | 2/18/97 | 17:31:54 | 2 | Classroom | 203 | Door | Door | Solid | Metal | 0 |
| 136 | 1909 & 1924 bldg. | 22 XRF | 2/18/97 | 17:32:48 | 2 | Classroom | 203 | Door | Radiator | Solid | Metal | 0.04 |
| 137 | 1909 & 1924 bldg. | 16 XRF | 2/18/97 | 17:25:38 | 2 | Classroom | 203 | Wall | Wall | Solid | Drywall | 0 |

Saint Paul Public Schools
 Humboldt Secondary Complex
 Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | M |
|-----------------------|-----|----------|---------|----------|-------|-----------|-------|------------|------------|-----------|-----------|---------|
| Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 138 1909 & 1924 bldg. | 17 | XRF | 2/18/97 | 17:27:27 | 2 | Classroom | 203 | Window | Casing | Solid | Wood | 0.1 |
| 139 1909 & 1924 bldg. | 18 | XRF | 2/18/97 | 17:28:28 | 2 | Classroom | 203 | Window | Sash | Solid | Metal | 0 |
| 140 1909 & 1924 bldg. | 19 | XRF | 2/18/97 | 17:30:09 | 2 | Classroom | 203 | Window | Stool | Solid | Concrete | 0.05 |
| 141 1909 & 1924 bldg. | 163 | XRF | 2/11/97 | 21:20:15 | 2 | Classroom | 204 | Cabinet | Door | Solid | Wood | 0.11 |
| 142 1909 & 1924 bldg. | 164 | XRF | 2/11/97 | 21:21:08 | 2 | Classroom | 204 | Cabinet | Inside | Solid | Wood | 0 |
| 143 1909 & 1924 bldg. | 150 | XRF | 2/11/97 | 21:07:47 | 2 | Classroom | 204 | Ceiling | | Solid | Plaster | 0.11 |
| 144 1909 & 1924 bldg. | 160 | XRF | 2/11/97 | 21:17:46 | 2 | Classroom | 204 | Chalkboard | Sill | Solid | Wood | 0.06 |
| 145 1909 & 1924 bldg. | 161 | XRF | 2/11/97 | 21:18:40 | 2 | Classroom | 204 | Chalkboard | Sash | Peeling | Wood | 0.09 |
| 146 1909 & 1924 bldg. | 155 | XRF | 2/11/97 | 21:13:04 | 2 | Classroom | 204 | Door | Casing | Solid | Wood | 0.07 |
| 147 1909 & 1924 bldg. | 156 | XRF | 2/11/97 | 21:13:56 | 2 | Classroom | 204 | Door | Jamb | Solid | Metal | 0.04 |
| 148 1909 & 1924 bldg. | 157 | XRF | 2/11/97 | 21:14:40 | 2 | Classroom | 204 | Door | Door | Solid | Wood | 0 |
| 149 1909 & 1924 bldg. | 147 | XRF | 2/11/97 | 21:03:54 | 2 | Classroom | 204 | Wall | Baseboard | Cracked | Wood | 0.1 |
| 150 1909 & 1924 bldg. | 148 | XRF | 2/11/97 | 21:05:07 | 2 | Classroom | 204 | Wall | Wall | Solid | Plaster | 5.09 |
| 151 1909 & 1924 bldg. | 149 | XRF | 2/11/97 | 21:06:03 | 2 | Classroom | 204 | Wall | Wall | Solid | Plaster | 0.18 |
| 152 1909 & 1924 bldg. | 162 | XRF | 2/11/97 | 21:19:28 | 2 | Classroom | 204 | Wall | Wall Rgstr | Solid | Metal | 0.04 |
| 153 1909 & 1924 bldg. | 151 | XRF | 2/11/97 | 21:09:49 | 2 | Classroom | 204 | Window | Casing | Solid | Wood | 0.09 |
| 154 1909 & 1924 bldg. | 152 | XRF | 2/11/97 | 21:10:33 | 2 | Classroom | 204 | Window | Sash | Solid | Metal | 0 |
| 155 1909 & 1924 bldg. | 153 | XRF | 2/11/97 | 21:10:50 | 2 | Classroom | 204 | Window | Sash | Solid | | 0 |
| 156 1909 & 1924 bldg. | 154 | XRF | 2/11/97 | 21:11:58 | 2 | Classroom | 204 | Window | Stool | Solid | Concrete | 0.03 |
| 157 1909 & 1924 bldg. | 158 | XRF | 2/11/97 | 21:16:08 | 2 | Classroom | 204 | | Radiator | Peeling | Metal | 0.04 |
| 158 1909 & 1924 bldg. | 159 | XRF | 2/11/97 | 21:16:54 | 2 | Classroom | 204 | | Radiator | Peeling | | 3.17 |
| 159 1909 & 1924 bldg. | 165 | XRF | 2/11/97 | 21:22:07 | 2 | Classroom | 204 | | Panel | Solid | Metal | 0.12 |
| 160 1909 & 1924 bldg. | 38 | XRF | 2/18/97 | 17:55:14 | 2 | Classroom | 205 | Cabinet | Door | Solid | Wood | 0.07 |
| 161 1909 & 1924 bldg. | 39 | XRF | 2/18/97 | 17:56:11 | 2 | Classroom | 205 | Cabinet | Inside | Solid | Wood | 0 |
| 162 1909 & 1924 bldg. | 27 | XRF | 2/18/97 | 17:44:12 | 2 | Classroom | 205 | Celling | | Solid | Plaster | 0.04 |
| 163 1909 & 1924 bldg. | 35 | XRF | 2/18/97 | 17:52:15 | 2 | Classroom | 205 | Chalkboard | Sill | Solid | Wood | 0.07 |
| 164 1909 & 1924 bldg. | 36 | XRF | 2/18/97 | 17:53:03 | 2 | Classroom | 205 | Chalkboard | Sash | Solid | Wood | 0.08 |
| 165 1909 & 1924 bldg. | 37 | XRF | 2/18/97 | 17:54:21 | 2 | Classroom | 205 | Chipboard | | Solid | Wood | 0 |
| 166 1909 & 1924 bldg. | 32 | XRF | 2/18/97 | 17:49:55 | 2 | Classroom | 205 | Door | Casing | Solid | Wood | 0.09 |
| 167 1909 & 1924 bldg. | 33 | XRF | 2/18/97 | 17:50:42 | 2 | Classroom | 205 | Door | Jamb | Solid | Wood | 0.09 |
| 168 1909 & 1924 bldg. | 34 | XRF | 2/18/97 | 17:51:28 | 2 | Classroom | 205 | Door | Door | Solid | Wood | 0.07 |
| 169 1909 & 1924 bldg. | 25 | XRF | 2/18/97 | 17:39:37 | 2 | Classroom | 205 | Wall | Baseboard | Solid | Wood | 0.06 |
| 170 1909 & 1924 bldg. | 28 | XRF | 2/18/97 | 17:40:29 | 2 | Classroom | 205 | Wall | Wall | Solid | Plaster | 0.31 |
| 171 1909 & 1924 bldg. | 40 | XRF | 2/18/97 | 17:57:14 | 2 | Classroom | 205 | Wall | Wall Rgstr | Solid | Metal | 0.13 |
| 172 1909 & 1924 bldg. | 28 | XRF | 2/18/97 | 17:46:13 | 2 | Classroom | 205 | Window | Casing | Solid | Wood | 0.12 |
| 173 1909 & 1924 bldg. | 29 | XRF | 2/18/97 | 17:47:05 | 2 | Classroom | 205 | Window | Sash | Solid | Metal | 0 |
| 174 1909 & 1924 bldg. | 31 | XRF | 2/18/97 | 17:49:00 | 2 | Classroom | 205 | Window | Stool | Solid | Concrete | 0.03 |
| 175 1909 & 1924 bldg. | 30 | XRF | 2/18/97 | 17:47:59 | 2 | Classroom | 205 | | Panel | Solid | Metal | 0.13 |
| 176 1909 & 1924 bldg. | 210 | XRF | 2/11/97 | 22:26:41 | 2 | Classroom | 207 | Chalkboard | Sill | Solid | Wood | 0.04 |
| 177 1909 & 1924 bldg. | 211 | XRF | 2/11/97 | 22:27:38 | 2 | Classroom | 207 | Chalkboard | Sash | Solid | Wood | 0.09 |
| 178 1909 & 1924 bldg. | 208 | XRF | 2/11/97 | 22:24:55 | 2 | Classroom | 207 | Door | Jamb | Solid | Metal | 0.1 |
| 179 1909 & 1924 bldg. | 209 | XRF | 2/11/97 | 22:26:30 | 2 | Classroom | 207 | Door | Door | Solid | Wood | 0 |
| 180 1909 & 1924 bldg. | 200 | XRF | 2/11/97 | 22:17:11 | 2 | Classroom | 207 | Wall | Baseboard | Solid | Wood | 5.09 |
| 181 1909 & 1924 bldg. | 201 | XRF | 2/11/97 | 22:18:13 | 2 | Classroom | 207 | Wall | Wall | Cracked | Plaster | 5.09 |
| 182 1909 & 1924 bldg. | 202 | XRF | 2/11/97 | 22:18:59 | 2 | Classroom | 207 | Wall | Midle Wall | Solid | Stucco | 0.08 |
| 183 1909 & 1924 bldg. | 203 | XRF | 2/11/97 | 22:20:34 | 2 | Classroom | 207 | Window | Casing | Solid | Wood | 0.09 |
| 184 1909 & 1924 bldg. | 204 | XRF | 2/11/97 | 22:21:26 | 2 | Classroom | 207 | Window | Sash | Solid | Metal | 0.03 |
| 185 1909 & 1924 bldg. | 205 | XRF | 2/11/97 | 22:22:16 | 2 | Classroom | 207 | Window | Stool | Solid | Wood | 0.21 |
| 186 1909 & 1924 bldg. | 206 | XRF | 2/11/97 | 22:23:03 | 2 | Classroom | 207 | Window | Apron | Solid | Wood | 0.13 |
| 187 1909 & 1924 bldg. | 207 | XRF | 2/11/97 | 22:23:54 | 2 | Classroom | 207 | | Panel | Cracked | Metal | 0.13 |
| 188 1909 & 1924 bldg. | 52 | XRF | 2/18/97 | 18:10:34 | 1 | Classroom | 208 | Chalkboard | Sill | Solid | Wood | 0.02 |
| 189 1909 & 1924 bldg. | 53 | XRF | 2/18/97 | 18:11:20 | 1 | Classroom | 208 | Chalkboard | Sash | Solid | Wood | 0.01 |
| 190 1909 & 1924 bldg. | 49 | XRF | 2/18/97 | 18:07:43 | 1 | Classroom | 208 | Door | Casing | Solid | Wood | 0.07 |
| 191 1909 & 1924 bldg. | 50 | XRF | 2/18/97 | 18:08:34 | 1 | Classroom | 208 | Door | Jamb | Solid | Wood | 0.07 |
| 192 1909 & 1924 bldg. | 51 | XRF | 2/18/97 | 18:09:26 | 1 | Classroom | 208 | Door | Door | Solid | Wood | 0.06 |
| 193 1909 & 1924 bldg. | 41 | XRF | 2/18/97 | 17:59:19 | 2 | Classroom | 208 | Wall | Wall | Solid | Plaster | 1.31 |
| 194 1909 & 1924 bldg. | 42 | XRF | 2/18/97 | 18:00:43 | 2 | Classroom | 208 | Wall | Baseboard | Solid | Wood | 5.09 |
| 195 1909 & 1924 bldg. | 43 | XRF | 2/18/97 | 18:01:36 | 2 | Classroom | 208 | Window | Apron | Solid | Wood | 0.09 |
| 196 1909 & 1924 bldg. | 44 | XRF | 2/18/97 | 18:02:30 | 2 | Classroom | 208 | Window | Stool | Solid | Wood | 0.15 |
| 197 1909 & 1924 bldg. | 45 | XRF | 2/18/97 | 18:03:21 | 2 | Classroom | 208 | Window | Casing | Solid | Wood | 0.12 |
| 198 1909 & 1924 bldg. | 47 | XRF | 2/18/97 | 18:06:16 | 1 | Classroom | 208 | Window | Sash | Solid | Metal | 0 |
| 199 1909 & 1924 bldg. | 48 | XRF | 2/18/97 | 18:06:33 | 1 | Classroom | 208 | Window | Sash | Solid | | 0 |
| 200 1909 & 1924 bldg. | 46 | XRF | 2/18/97 | 18:05:13 | 1 | Classroom | 208 | | Panel | Solid | Metal | 0.12 |
| 201 1909 & 1924 bldg. | 62 | XRF | 2/18/97 | 18:22:26 | 1 | Classroom | 209 | Chalkboard | Sill | Peeling | Wood | 0.04 |
| 202 1909 & 1924 bldg. | 63 | XRF | 2/18/97 | 18:23:15 | 1 | Classroom | 209 | Chalkboard | Sash | Solid | Wood | 0.02 |
| 203 1909 & 1924 bldg. | 60 | XRF | 2/18/97 | 18:20:32 | 1 | Classroom | 209 | Door | Jamb | Solid | Wood | 0.07 |
| 204 1909 & 1924 bldg. | 61 | XRF | 2/18/97 | 18:21:22 | 1 | Classroom | 209 | Door | Door | Solid | Wood | 0.07 |
| 205 1909 & 1924 bldg. | 54 | XRF | 2/18/97 | 18:14:50 | 1 | Classroom | 209 | Wall | Baseboard | Solid | Wood | 3.26 |

Saint Paul Public Schools
Humboldt Secondary Complex
Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | M |
|-----------------------|-----|----------|---------|----------|-------|-----------|-------|------------|------------|-----------|-----------|---------|
| Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 206 1909 & 1924 bldg. | 55 | XRF | 2/18/97 | 18:15:48 | 1 | Classroom | 209 | Wall | Wall | Solid | Plaster | 0.01 |
| 207 1909 & 1924 bldg. | 56 | XRF | 2/18/97 | 18:16:59 | 1 | Classroom | 209 | Window | Casing | Solid | Wood | 0.09 |
| 208 1909 & 1924 bldg. | 57 | XRF | 2/18/97 | 18:17:48 | 1 | Classroom | 209 | Window | Sash | Solid | Metal | 0 |
| 209 1909 & 1924 bldg. | 58 | XRF | 2/18/97 | 18:18:38 | 1 | Classroom | 209 | Window | Stool | Solid | Wood | 0.08 |
| 210 1909 & 1924 bldg. | 59 | XRF | 2/18/97 | 18:19:32 | 1 | Classroom | 209 | Window | Apron | Solid | Wood | 0.15 |
| 211 1909 & 1924 bldg. | 70 | XRF | 2/18/97 | 18:33:54 | 1 | Classroom | 212 | Chalkboard | Sash | Solid | Wood | 0.06 |
| 212 1909 & 1924 bldg. | 68 | XRF | 2/18/97 | 18:30:00 | 1 | Classroom | 212 | Door | Jamb | Solid | Metal | 0.15 |
| 213 1909 & 1924 bldg. | 69 | XRF | 2/18/97 | 18:32:38 | 1 | Classroom | 212 | Door | Door | Solid | Wood | 0.04 |
| 214 1909 & 1924 bldg. | 64 | XRF | 2/18/97 | 18:25:56 | 1 | Classroom | 212 | Wall | Wall | Solid | Plaster | 0.01 |
| 215 1909 & 1924 bldg. | 65 | XRF | 2/18/97 | 18:26:51 | 1 | Classroom | 212 | Wall | Midle Wall | Solid | Plaster | 0.37 |
| 216 1909 & 1924 bldg. | 66 | XRF | 2/18/97 | 18:27:45 | 1 | Classroom | 212 | Wall | Wall | Solid | Plaster | 0.52 |
| 217 1909 & 1924 bldg. | 67 | XRF | 2/18/97 | 18:29:11 | 1 | Classroom | 212 | Window | Casing | Solid | Metal | 0.1 |
| 218 1909 & 1924 bldg. | 88 | XRF | 2/18/97 | 18:59:25 | 1 | Classroom | 222 | Door | Casing | Solid | Metal | 0 |
| 219 1909 & 1924 bldg. | 89 | XRF | 2/18/97 | 19:00:11 | 1 | Classroom | 222 | Door | Door | Solid | Metal | 0.02 |
| 220 1909 & 1924 bldg. | 86 | XRF | 2/18/97 | 18:57:29 | 1 | Classroom | 222 | Wall | Wall | Solid | Plaster | 0.16 |
| 221 1909 & 1924 bldg. | 87 | XRF | 2/18/97 | 18:58:37 | 1 | Classroom | 222 | Wall | Wall | Solid | Plaster | 0.01 |
| 222 1909 & 1924 bldg. | 214 | XRF | 2/11/97 | 22:36:01 | 2 | Classroom | 223 | Door | Door | Solid | Metal | 5.09 |
| 223 1909 & 1924 bldg. | 215 | XRF | 2/11/97 | 22:37:02 | 2 | Classroom | 223 | Door | Door | Solid | Wood | 0.02 |
| 224 1909 & 1924 bldg. | 216 | XRF | 2/11/97 | 22:37:59 | 2 | Classroom | 223 | Door | Casing | Solid | Metal | 0.08 |
| 225 1909 & 1924 bldg. | 217 | XRF | 2/11/97 | 22:38:54 | 2 | Classroom | 223 | Door | Door | Peeling | Wood | 0.34 |
| 226 1909 & 1924 bldg. | 218 | XRF | 2/11/97 | 22:39:41 | 2 | Classroom | 223 | Door | Jamb | Solid | Wood | 0.35 |
| 227 1909 & 1924 bldg. | 219 | XRF | 2/11/97 | 22:40:29 | 2 | Classroom | 223 | Door | Casing | Solid | Wood | 0.29 |
| 228 1909 & 1924 bldg. | 220 | XRF | 2/11/97 | 22:41:27 | 2 | Classroom | 223 | Door | Panel | Solid | Metal | 0.01 |
| 229 1909 & 1924 bldg. | 212 | XRF | 2/11/97 | 22:34:15 | 2 | Classroom | 223 | Wall | Wall | Solid | Drywall | 0.23 |
| 230 1909 & 1924 bldg. | 213 | XRF | 2/11/97 | 22:35:12 | 2 | Classroom | 223 | Wall | Wall | Solid | Drywall | 0 |
| 231 1909 & 1924 bldg. | 80 | XRF | 2/18/97 | 18:50:31 | 1 | Classroom | 224 | Door | Casing | Solid | Metal | 0 |
| 232 1909 & 1924 bldg. | 81 | XRF | 2/18/97 | 18:51:19 | 1 | Classroom | 224 | Door | Door | Solid | Metal | 0 |
| 233 1909 & 1924 bldg. | 78 | XRF | 2/18/97 | 18:48:43 | 1 | Classroom | 224 | Wall | Wall | Solid | Plaster | 0 |
| 234 1909 & 1924 bldg. | 79 | XRF | 2/18/97 | 18:49:33 | 1 | Classroom | 224 | Wall | Wall | Solid | Plaster | 0.03 |
| 235 1909 & 1924 bldg. | 84 | XRF | 2/18/97 | 18:54:52 | 1 | Classroom | 225 | Door | Jamb | Solid | Metal | 0.06 |
| 236 1909 & 1924 bldg. | 85 | XRF | 2/18/97 | 18:55:39 | 1 | Classroom | 225 | Door | Door | Solid | Metal | 0.01 |
| 237 1909 & 1924 bldg. | 82 | XRF | 2/18/97 | 18:53:22 | 1 | Classroom | 225 | Wall | Wall | Solid | Plaster | 0.01 |
| 238 1909 & 1924 bldg. | 83 | XRF | 2/18/97 | 18:54:06 | 1 | Classroom | 225 | Wall | Midle Wall | Solid | Plaster | 0.16 |
| 239 1909 & 1924 bldg. | 76 | XRF | 2/18/97 | 18:44:08 | 1 | Classroom | 227 | Closet | Wall | Solid | Plaster | 0.05 |
| 240 1909 & 1924 bldg. | 77 | XRF | 2/18/97 | 18:45:13 | 1 | Classroom | 227 | Closet | Casing | Solid | Wood | 0.13 |
| 241 1909 & 1924 bldg. | 74 | XRF | 2/18/97 | 18:41:30 | 1 | Classroom | 227 | Door | Casing | Solid | Wood | 0.09 |
| 242 1909 & 1924 bldg. | 75 | XRF | 2/18/97 | 18:42:27 | 1 | Classroom | 227 | Door | Door | Solid | Wood | 0.09 |
| 243 1909 & 1924 bldg. | 71 | XRF | 2/18/97 | 18:38:30 | 1 | Classroom | 227 | Floor | | Peeling | Wood | 0.02 |
| 244 1909 & 1924 bldg. | 72 | XRF | 2/18/97 | 18:39:31 | 1 | Classroom | 227 | Wall | Baseboard | Solid | Wood | 4.14 |
| 245 1909 & 1924 bldg. | 73 | XRF | 2/18/97 | 18:40:39 | 1 | Classroom | 227 | Wall | Wall | Solid | Plaster | 0 |
| 246 1909 & 1924 bldg. | 228 | XRF | 2/11/97 | 22:53:02 | 2 | Classroom | 231 | Door | Jamb | Solid | Wood | 0.14 |
| 247 1909 & 1924 bldg. | 229 | XRF | 2/11/97 | 22:53:51 | 2 | Classroom | 231 | Door | Door | Solid | Wood | 0.1 |
| 248 1909 & 1924 bldg. | 230 | XRF | 2/11/97 | 22:54:45 | 2 | Classroom | 231 | Door | Panel | Solid | Metal | 0.03 |
| 249 1909 & 1924 bldg. | 221 | XRF | 2/11/97 | 22:45:50 | 2 | Classroom | 231 | Wall | Wall | Solid | Plaster | 0.45 |
| 250 1909 & 1924 bldg. | 222 | XRF | 2/11/97 | 22:47:01 | 2 | Classroom | 231 | Wall | Midle Wall | Solid | Drywall | 0.07 |
| 251 1909 & 1924 bldg. | 223 | XRF | 2/11/97 | 22:48:00 | 2 | Classroom | 231 | Window | Apron | Solid | Wood | 0.08 |
| 252 1909 & 1924 bldg. | 224 | XRF | 2/11/97 | 22:49:01 | 2 | Classroom | 231 | Window | Stool | Solid | Wood | 0.14 |
| 253 1909 & 1924 bldg. | 225 | XRF | 2/11/97 | 22:49:51 | 2 | Classroom | 231 | Window | Casing | Solid | Wood | 0.15 |
| 254 1909 & 1924 bldg. | 226 | XRF | 2/11/97 | 22:50:44 | 2 | Classroom | 231 | Window | Sash | Solid | Metal | 0 |
| 255 1909 & 1924 bldg. | 227 | XRF | 2/11/97 | 22:51:55 | 2 | Classroom | 231 | Panel | Solid | Metal | 0.16 | |
| 256 1909 & 1924 bldg. | 250 | XRF | 2/11/97 | 23:17:03 | 1 | Classroom | 234 | Chalkboard | Sill | Cracked | Wood | 0.06 |
| 257 1909 & 1924 bldg. | 251 | XRF | 2/11/97 | 23:17:53 | 1 | Classroom | 234 | Chalkboard | Sash | Solid | Wood | 0.04 |
| 258 1909 & 1924 bldg. | 242 | XRF | 2/11/97 | 23:10:08 | 1 | Classroom | 234 | Door | Crown mold | Solid | Wood | 0.15 |
| 259 1909 & 1924 bldg. | 247 | XRF | 2/11/97 | 23:14:35 | 1 | Classroom | 234 | Door | Door | Solid | Wood | 0.09 |
| 260 1909 & 1924 bldg. | 248 | XRF | 2/11/97 | 23:15:17 | 1 | Classroom | 234 | Door | Casing | Solid | Wood | 0.12 |
| 261 1909 & 1924 bldg. | 249 | XRF | 2/11/97 | 23:16:04 | 1 | Classroom | 234 | Floor | | Cracked | Wood | 0 |
| 262 1909 & 1924 bldg. | 241 | XRF | 2/11/97 | 23:09:02 | 1 | Classroom | 234 | Wall | Wall | Solid | Plaster | 0.14 |
| 263 1909 & 1924 bldg. | 243 | XRF | 2/11/97 | 23:10:58 | 1 | Classroom | 234 | Window | Apron | Solid | Wood | 0.08 |
| 264 1909 & 1924 bldg. | 244 | XRF | 2/11/97 | 23:11:44 | 1 | Classroom | 234 | Window | Stool | Solid | Wood | 0.13 |
| 265 1909 & 1924 bldg. | 245 | XRF | 2/11/97 | 23:12:35 | 1 | Classroom | 234 | Window | Casing | Solid | Wood | 0.08 |
| 266 1909 & 1924 bldg. | 246 | XRF | 2/11/97 | 23:13:31 | 1 | Classroom | 234 | Panel | Solid | Metal | 0.14 | |
| 267 1909 & 1924 bldg. | 99 | XRF | 2/18/97 | 19:13:13 | 3 | Classroom | 301 | Door | Door | Solid | Wood | 0 |
| 268 1909 & 1924 bldg. | 100 | XRF | 2/18/97 | 19:13:57 | 3 | Classroom | 301 | Door | Jamb | Solid | Metal | 0.11 |
| 269 1909 & 1924 bldg. | 90 | XRF | 2/18/97 | 19:04:32 | 3 | Classroom | 301 | Wall | Wall | Solid | Plaster | 0.1 |
| 270 1909 & 1924 bldg. | 91 | XRF | 2/18/97 | 19:05:51 | 3 | Classroom | 301 | Wall | Midle Wall | Solid | Plaster | 2.72 |
| 271 1909 & 1924 bldg. | 92 | XRF | 2/18/97 | 19:06:53 | 3 | Classroom | 301 | Wall | Wall | Solid | Plaster | 0.36 |
| 272 1909 & 1924 bldg. | 93 | XRF | 2/18/97 | 19:07:53 | 3 | Classroom | 301 | Wall | Baseboard | Peeling | Wood | 2.23 |
| 273 1909 & 1924 bldg. | 94 | XRF | 2/18/97 | 19:09:01 | 3 | Classroom | 301 | Window | Apron | Solid | Wood | 0.01 |

Saint Paul Public Schools
Humboldt Secondary Complex
Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | M | |
|-----|-------------------|-----|----------|---------|----------|-------|-----------|-------|------------|------------|-----------|-----------|---------|
| 3 | Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 274 | 1909 & 1924 bldg. | 95 | XRF | 2/18/97 | 19:09:47 | 3 | Classroom | 301 | Window | Stool | Peeling | Wood | 0.24 |
| 275 | 1909 & 1924 bldg. | 96 | XRF | 2/18/97 | 19:10:35 | 3 | Classroom | 301 | Window | Casing | Solid | Wood | 0.1 |
| 276 | 1909 & 1924 bldg. | 97 | XRF | 2/18/97 | 19:11:23 | 3 | Classroom | 301 | Window | Sash | Solid | Metal | 0 |
| 277 | 1909 & 1924 bldg. | 98 | XRF | 2/18/97 | 19:12:09 | 3 | Classroom | 301 | | Panel | Solid | Metal | 0 |
| 278 | 1909 & 1924 bldg. | 101 | XRF | 2/18/97 | 19:14:52 | 3 | Classroom | 301 | | Jamb | Solid | Wood | 0.07 |
| 279 | 1909 & 1924 bldg. | 102 | XRF | 2/18/97 | 19:15:35 | 3 | Classroom | 301 | | Jamb | Solid | Wood | 0.04 |
| 280 | 1909 & 1924 bldg. | 119 | XRF | 2/18/97 | 19:33:23 | 3 | Classroom | 303 | Chalkboard | Sill | Solid | Wood | 0.01 |
| 281 | 1909 & 1924 bldg. | 120 | XRF | 2/18/97 | 19:34:12 | 3 | Classroom | 303 | Chalkboard | Sash | Solid | Wood | 0.02 |
| 282 | 1909 & 1924 bldg. | 117 | XRF | 2/18/97 | 19:31:30 | 3 | Classroom | 303 | Door | Door | Solid | Wood | 0.09 |
| 283 | 1909 & 1924 bldg. | 118 | XRF | 2/18/97 | 19:32:28 | 3 | Classroom | 303 | Door | Jamb | Solid | Wood | 0.1 |
| 284 | 1909 & 1924 bldg. | 109 | XRF | 2/18/97 | 19:24:46 | 3 | Classroom | 303 | Floor | | Solid | Wood | 0.01 |
| 285 | 1909 & 1924 bldg. | 110 | XRF | 2/18/97 | 19:26:29 | 3 | Classroom | 303 | Wall | Baseboard | Solid | Wood | 3.71 |
| 286 | 1909 & 1924 bldg. | 111 | XRF | 2/18/97 | 19:26:30 | 3 | Classroom | 303 | Wall | Wall | Solid | Plaster | 0.16 |
| 287 | 1909 & 1924 bldg. | 112 | XRF | 2/18/97 | 19:27:24 | 3 | Classroom | 303 | Window | Apron | Solid | Wood | 0.12 |
| 288 | 1909 & 1924 bldg. | 113 | XRF | 2/18/97 | 19:28:12 | 3 | Classroom | 303 | Window | Stool | Solid | Wood | 0.11 |
| 289 | 1909 & 1924 bldg. | 114 | XRF | 2/18/97 | 19:28:58 | 3 | Classroom | 303 | Window | Casing | Solid | Wood | 0.08 |
| 290 | 1909 & 1924 bldg. | 115 | XRF | 2/18/97 | 19:29:40 | 3 | Classroom | 303 | Window | Sash | Solid | Metal | 0.01 |
| 291 | 1909 & 1924 bldg. | 116 | XRF | 2/18/97 | 19:30:31 | 3 | Classroom | 303 | | Panel | Solid | Metal | 0.01 |
| 292 | 1909 & 1924 bldg. | 142 | XRF | 2/18/97 | 21:25:45 | 3 | Classroom | 304 | Cabinet | Door | Solid | Wood | 0.18 |
| 293 | 1909 & 1924 bldg. | 143 | XRF | 2/18/97 | 21:26:35 | 3 | Classroom | 304 | Cabinet | Floor | Solid | Wood | 0.01 |
| 294 | 1909 & 1924 bldg. | 144 | XRF | 2/18/97 | 21:27:22 | 3 | Classroom | 304 | Cabinet | Inside | Solid | Wood | 0.19 |
| 295 | 1909 & 1924 bldg. | 140 | XRF | 2/18/97 | 21:24:07 | 3 | Classroom | 304 | Door | Jamb | Solid | Wood | 0.07 |
| 296 | 1909 & 1924 bldg. | 141 | XRF | 2/18/97 | 21:24:49 | 3 | Classroom | 304 | Door | Door | Solid | Wood | 0.09 |
| 297 | 1909 & 1924 bldg. | 133 | XRF | 2/18/97 | 21:16:46 | 3 | Classroom | 304 | Floor | | Solid | Wood | 0.01 |
| 298 | 1909 & 1924 bldg. | 139 | XRF | 2/18/97 | 21:23:09 | 3 | Classroom | 304 | Vinyl | Blinds | Solid | Wood | 0.7 |
| 299 | 1909 & 1924 bldg. | 131 | XRF | 2/18/97 | 21:14:57 | 3 | Classroom | 304 | Wall | Wall | Solid | Plaster | 0.13 |
| 300 | 1909 & 1924 bldg. | 132 | XRF | 2/18/97 | 21:15:57 | 3 | Classroom | 304 | Wall | Baseboard | Solid | Wood | 5.09 |
| 301 | 1909 & 1924 bldg. | 134 | XRF | 2/18/97 | 21:17:43 | 3 | Classroom | 304 | Window | Apron | Solid | Wood | 0.08 |
| 302 | 1909 & 1924 bldg. | 135 | XRF | 2/18/97 | 21:18:47 | 3 | Classroom | 304 | Window | Stool | Solid | Wood | 0.1 |
| 303 | 1909 & 1924 bldg. | 136 | XRF | 2/18/97 | 21:19:49 | 3 | Classroom | 304 | Window | Casing | Solid | Wood | 0.1 |
| 304 | 1909 & 1924 bldg. | 137 | XRF | 2/18/97 | 21:20:40 | 3 | Classroom | 304 | Window | Sash | Solid | Metal | 0.01 |
| 305 | 1909 & 1924 bldg. | 138 | XRF | 2/18/97 | 21:21:33 | 3 | Classroom | 304 | | Panel | Solid | Metal | 0.01 |
| 306 | 1909 & 1924 bldg. | 159 | XRF | 2/18/97 | 21:43:26 | 3 | Classroom | 311 | Chalkboard | Sash | Solid | Wood | 0 |
| 307 | 1909 & 1924 bldg. | 160 | XRF | 2/18/97 | 21:44:15 | 3 | Classroom | 311 | Chalkboard | Sill | Solid | Wood | 0.08 |
| 308 | 1909 & 1924 bldg. | 154 | XRF | 2/18/97 | 21:39:06 | 3 | Classroom | 311 | Door | Door | Solid | Metal | 0.02 |
| 309 | 1909 & 1924 bldg. | 155 | XRF | 2/18/97 | 21:40:03 | 3 | Classroom | 311 | Door | Door | Solid | Wood | 0 |
| 310 | 1909 & 1924 bldg. | 156 | XRF | 2/18/97 | 21:40:46 | 3 | Classroom | 311 | Door | Casing | Solid | Metal | 0.02 |
| 311 | 1909 & 1924 bldg. | 157 | XRF | 2/18/97 | 21:41:42 | 3 | Classroom | 311 | Door | Door | Solid | Wood | 0.08 |
| 312 | 1909 & 1924 bldg. | 158 | XRF | 2/18/97 | 21:42:26 | 3 | Classroom | 311 | Door | Jamb | Solid | Wood | 0.09 |
| 313 | 1909 & 1924 bldg. | 146 | XRF | 2/18/97 | 21:32:25 | 3 | Classroom | 311 | Wall | Baseboard | Solid | Wood | 0.18 |
| 314 | 1909 & 1924 bldg. | 147 | XRF | 2/18/97 | 21:33:18 | 3 | Classroom | 311 | Wall | Midle Wall | Solid | Plaster | 2.43 |
| 315 | 1909 & 1924 bldg. | 148 | XRF | 2/18/97 | 21:34:19 | 3 | Classroom | 311 | Wall | Wall | Solid | Plaster | 1.63 |
| 316 | 1909 & 1924 bldg. | 149 | XRF | 2/18/97 | 21:35:04 | 3 | Classroom | 311 | Window | Apron | Solid | Wood | 0.13 |
| 317 | 1909 & 1924 bldg. | 150 | XRF | 2/18/97 | 21:35:47 | 3 | Classroom | 311 | Window | Stool | Solid | Wood | 0.14 |
| 318 | 1909 & 1924 bldg. | 151 | XRF | 2/18/97 | 21:36:34 | 3 | Classroom | 311 | Window | Sash | Solid | Metal | 0.01 |
| 319 | 1909 & 1924 bldg. | 152 | XRF | 2/18/97 | 21:37:16 | 3 | Classroom | 311 | Window | Casing | Solid | Wood | 0.13 |
| 320 | 1909 & 1924 bldg. | 153 | XRF | 2/18/97 | 21:38:07 | 3 | Classroom | 311 | | Panel | Solid | Metal | 0.11 |
| 321 | 1909 & 1924 bldg. | 173 | XRF | 2/18/97 | 21:58:04 | 3 | Classroom | 313 | Cabinet | Door | Solid | Wood | 0 |
| 322 | 1909 & 1924 bldg. | 174 | XRF | 2/18/97 | 21:58:59 | 3 | Classroom | 313 | Cabinet | Shelf | Solid | Wood | 0 |
| 323 | 1909 & 1924 bldg. | 171 | XRF | 2/18/97 | 21:55:16 | 3 | Classroom | 313 | Chalkboard | Sill | Solid | Wood | 0.05 |
| 324 | 1909 & 1924 bldg. | 172 | XRF | 2/18/97 | 21:56:17 | 3 | Classroom | 313 | Chalkboard | Sash | Solid | Wood | 0.08 |
| 325 | 1909 & 1924 bldg. | 169 | XRF | 2/18/97 | 21:53:33 | 3 | Classroom | 313 | Door | Casing | Solid | Metal | 0.03 |
| 326 | 1909 & 1924 bldg. | 170 | XRF | 2/18/97 | 21:54:23 | 3 | Classroom | 313 | Door | Door | Solid | Wood | 0 |
| 327 | 1909 & 1924 bldg. | 175 | XRF | 2/18/97 | 22:00:12 | 3 | Classroom | 313 | Stairs | Hand rail | Solid | Metal | 0.01 |
| 328 | 1909 & 1924 bldg. | 161 | XRF | 2/18/97 | 21:46:05 | 3 | Classroom | 313 | Wall | Wall | Solid | Plaster | 0.28 |
| 329 | 1909 & 1924 bldg. | 162 | XRF | 2/18/97 | 21:47:52 | 3 | Classroom | 313 | Wall | Baseboard | Solid | Wood | 3.15 |
| 330 | 1909 & 1924 bldg. | 163 | XRF | 2/18/97 | 21:48:47 | 3 | Classroom | 313 | Wall | Midle Wall | Solid | Plaster | 0 |
| 331 | 1909 & 1924 bldg. | 164 | XRF | 2/18/97 | 21:49:34 | 3 | Classroom | 313 | Window | Apron | Solid | Wood | 0.12 |
| 332 | 1909 & 1924 bldg. | 165 | XRF | 2/18/97 | 21:50:18 | 3 | Classroom | 313 | Window | Stool | Solid | Wood | 0.14 |
| 333 | 1909 & 1924 bldg. | 166 | XRF | 2/18/97 | 21:51:01 | 3 | Classroom | 313 | Window | Casing | Solid | Wood | 0.09 |
| 334 | 1909 & 1924 bldg. | 167 | XRF | 2/18/97 | 21:51:42 | 3 | Classroom | 313 | Window | Sash | Solid | Metal | 0 |
| 335 | 1909 & 1924 bldg. | 168 | XRF | 2/18/97 | 21:52:28 | 3 | Classroom | 313 | | Panel | Solid | Metal | 0.06 |
| 336 | 1909 & 1924 bldg. | 182 | XRF | 2/18/97 | 22:10:35 | 3 | Classroom | 315 | Door | Jamb | Solid | Metal | 0.01 |
| 337 | 1909 & 1924 bldg. | 183 | XRF | 2/18/97 | 22:11:19 | 3 | Classroom | 315 | Door | Door | Solid | Wood | 0 |
| 338 | 1909 & 1924 bldg. | 176 | XRF | 2/18/97 | 22:04:01 | 3 | Classroom | 315 | Wall | Midle Wall | Solid | Stucco | 0 |
| 339 | 1909 & 1924 bldg. | 177 | XRF | 2/18/97 | 22:05:12 | 3 | Classroom | 315 | Wall | Baseboard | Peeling | Wood | 0.12 |
| 340 | 1909 & 1924 bldg. | 178 | XRF | 2/18/97 | 22:06:39 | 3 | Classroom | 315 | Window | Apron | Solid | Wood | 0.08 |
| 341 | 1909 & 1924 bldg. | 179 | XRF | 2/18/97 | 22:07:30 | 3 | Classroom | 315 | Window | Stool | Solid | Wood | 0.11 |

Saint Paul Public Schools
 Humboldt Secondary Complex
 Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | M |
|------|-----|----------|---------|----------|-------|-----------|-------|--------------|------------|-----------|-----------|---------|
| Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 3 | 180 | XRF | 2/18/97 | 22:08:18 | 3 | Classroom | 315 | Window | Casing | Solid | Wood | 0.07 |
| 342 | 180 | XRF | 2/18/97 | 22:09:13 | 3 | Classroom | 315 | Panel | Solid | Metal | | 0.03 |
| 343 | 181 | XRF | 2/18/97 | 22:28:33 | 3 | Classroom | 317 | Cabinet | Door | Solid | Wood | 0 |
| 344 | 181 | XRF | 2/18/97 | 22:29:32 | 3 | Classroom | 317 | Cabinet | Shelf | Solid | Wood | 0.05 |
| 345 | 181 | XRF | 2/18/97 | 22:24:45 | 3 | Classroom | 317 | Chalkboard | Sill | Solid | Wood | 0.58 |
| 346 | 184 | XRF | 2/18/97 | 22:25:54 | 3 | Classroom | 317 | Chalkboard | Sash | Solid | Wood | 0.01 |
| 347 | 185 | XRF | 2/18/97 | 22:22:27 | 3 | Classroom | 317 | Door | Jamb | Solid | Metal | 0.04 |
| 348 | 185 | XRF | 2/18/97 | 22:23:42 | 3 | Classroom | 317 | Door | Door | Solid | Wood | 0 |
| 349 | 186 | XRF | 2/18/97 | 22:26:39 | 3 | Classroom | 317 | Unlisted | Door | Solid | | 0.13 |
| 350 | 186 | XRF | 2/18/97 | 22:15:24 | 3 | Classroom | 317 | Wall | Midle Wall | Solid | Drywall | 0.01 |
| 351 | 186 | XRF | 2/18/97 | 22:16:13 | 3 | Classroom | 317 | Wall | Wall | Solid | Plaster | 0.34 |
| 352 | 186 | XRF | 2/18/97 | 22:17:26 | 3 | Classroom | 317 | Wall | Baseboard | Solid | Wood | 3.72 |
| 353 | 187 | XRF | 2/18/97 | 22:18:23 | 3 | Classroom | 317 | Window | Apron | Solid | Wood | 0.07 |
| 354 | 187 | XRF | 2/18/97 | 22:19:07 | 3 | Classroom | 317 | Window | Stool | Solid | Wood | 0.17 |
| 355 | 188 | XRF | 2/18/97 | 22:19:55 | 3 | Classroom | 317 | Window | Casing | Solid | Wood | 0.11 |
| 356 | 189 | XRF | 2/18/97 | 22:21:39 | 3 | Classroom | 317 | Window | Sash | Solid | Metal | 0.01 |
| 357 | 190 | XRF | 2/18/97 | 22:20:52 | 3 | Classroom | 317 | Panel | Solid | Metal | | 0.01 |
| 358 | 190 | XRF | 2/18/97 | 22:27:36 | 3 | Classroom | 317 | Radiator | Solid | Metal | | 0.02 |
| 359 | 191 | XRF | 2/18/97 | 23:00:20 | 3 | Classroom | 323 | Cabinet | Door | Solid | Wood | 0.06 |
| 360 | 191 | XRF | 2/18/97 | 23:01:41 | 3 | Classroom | 323 | Cabinet | Outside | Solid | Wood | 0.02 |
| 361 | 192 | XRF | 2/18/97 | 22:58:24 | 3 | Classroom | 323 | Chalkboard | Sill | Solid | Wood | 0.26 |
| 362 | 192 | XRF | 2/18/97 | 22:59:20 | 3 | Classroom | 323 | Chalkboard | Sash | Solid | Wood | 0.6 |
| 363 | 193 | XRF | 2/18/97 | 22:56:44 | 3 | Classroom | 323 | Door | Door | Solid | Wood | 0.1 |
| 364 | 193 | XRF | 2/18/97 | 22:57:27 | 3 | Classroom | 323 | Door | Jamb | Solid | Wood | 0.62 |
| 365 | 193 | XRF | 2/18/97 | 22:48:39 | 3 | Classroom | 323 | Floor | | Solid | Wood | 0.06 |
| 366 | 194 | XRF | 2/18/97 | 22:49:10 | 3 | Classroom | 323 | Floor | | Solid | | 0 |
| 367 | 194 | XRF | 2/18/97 | 22:55:47 | 3 | Classroom | 323 | Panel | Solid | Metal | | 0 |
| 368 | 195 | XRF | 2/18/97 | 22:50:03 | 3 | Classroom | 323 | Wall | Baseboard | Peeling | Wood | 0.97 |
| 369 | 195 | XRF | 2/18/97 | 22:51:17 | 3 | Classroom | 323 | Wall | Wall | Solid | Plaster | 0.15 |
| 370 | 196 | XRF | 2/18/97 | 22:52:36 | 3 | Classroom | 323 | Window | Apron | Solid | Wood | 0.1 |
| 371 | 196 | XRF | 2/18/97 | 22:53:21 | 3 | Classroom | 323 | Window | Stool | Solid | Wood | 0.07 |
| 372 | 197 | XRF | 2/18/97 | 22:54:07 | 3 | Classroom | 323 | Window | Casing | Solid | Wood | 0.11 |
| 373 | 197 | XRF | 2/18/97 | 22:54:50 | 3 | Classroom | 323 | Window | Sash | Solid | Metal | 0 |
| 374 | 198 | XRF | 2/18/97 | 19:01:41 | 1 | Gym | 1 | Ceiling | | Solid | Plaster | 4.13 |
| 375 | 198 | XRF | 2/19/97 | 19:07:18 | 1 | Gym | 1 | Ceiling | | Solid | Concrete | 0.14 |
| 376 | 199 | XRF | 2/19/97 | 19:12:25 | 1 | Gym | 1 | Chalkboard | Sash | Solid | Wood | 0.11 |
| 377 | 200 | XRF | 2/19/97 | 19:08:14 | 1 | Gym | 1 | Closet | Wall | Solid | Drywall | 0.1 |
| 378 | 200 | XRF | 2/19/97 | 19:04:24 | 1 | Gym | 1 | Door | Casing | Solid | Wood | 0.07 |
| 379 | 201 | XRF | 2/19/97 | 19:05:17 | 1 | Gym | 1 | Door | Jamb | Solid | Wood | 0.1 |
| 380 | 201 | XRF | 2/19/97 | 19:06:01 | 1 | Gym | 1 | Door | Door | Solid | Wood | 0.04 |
| 381 | 202 | XRF | 2/19/97 | 19:10:29 | 1 | Gym | 1 | Door | Panel | Solid | Wood | 0.01 |
| 382 | 202 | XRF | 2/19/97 | 18:47:35 | 1 | Gym | 1 | Floor | | Solid | Wood | 0 |
| 383 | 203 | XRF | 2/19/97 | 19:09:37 | 1 | Gym | 1 | Grill | Wall | Solid | Metal | 0.32 |
| 384 | 203 | XRF | 2/19/97 | 18:53:52 | 1 | Gym | 1 | Unlisted | Wall | Solid | Wood | 0 |
| 385 | 204 | XRF | 2/19/97 | 18:54:46 | 1 | Gym | 1 | Unlisted | Wall | Solid | | 0.01 |
| 386 | 204 | XRF | 2/19/97 | 18:48:20 | 1 | Gym | 1 | Wall | Baseboard | Solid | Wood | 0 |
| 387 | 205 | XRF | 2/19/97 | 18:49:44 | 1 | Gym | 1 | Wall | Wall | Solid | Plaster | 0.97 |
| 388 | 205 | XRF | 2/19/97 | 18:50:33 | 1 | Gym | 1 | Chair rail | Solid | Wood | 0.07 | |
| 389 | 206 | XRF | 2/19/97 | 18:51:55 | 1 | Gym | 1 | Wall | Wall | Solid | Plaster | 2.36 |
| 390 | 206 | XRF | 2/19/97 | 18:57:21 | 1 | Gym | 1 | Wall | Wall | Solid | Concrete | 1.24 |
| 391 | 207 | XRF | 2/19/97 | 18:58:24 | 1 | Gym | 1 | Backboard | Frame | Solid | Wood | 5.09 |
| 392 | 207 | XRF | 2/19/97 | 19:11:24 | 1 | Gym | 1 | Wall Divider | Panel | Solid | Wood | 0.01 |
| 393 | 208 | XRF | 2/8/97 | 14:01:37 | 1 | Hall | 1 | Door | Door | Cracked | Metal | 0.95 |
| 394 | 208 | XRF | 2/8/97 | 14:02:54 | 1 | Hall | 1 | Door | Jamb | Peeling | Wood | 0.13 |
| 395 | 209 | XRF | 2/8/97 | 14:04:57 | 1 | Hall | 1 | Door | Locker | Solid | Metal | 0.36 |
| 396 | 209 | XRF | 2/8/97 | 14:06:11 | 1 | Hall | 1 | Door | Door | Solid | Wood | 0 |
| 397 | 210 | XRF | 2/8/97 | 14:07:03 | 1 | Hall | 1 | Door | Door | Solid | Wood | 0.06 |
| 398 | 210 | XRF | 2/8/97 | 14:07:50 | 1 | Hall | 1 | Door | Casing | Solid | Wood | 0.07 |
| 399 | 211 | XRF | 2/8/97 | 14:08:42 | 1 | Hall | 1 | Door | Elec Panel | Solid | Metal | 0.11 |
| 400 | 211 | XRF | 2/8/97 | 14:11:34 | 1 | Hall | 1 | Door | Casing | Solid | Metal | 0 |
| 401 | 212 | XRF | 2/8/97 | 14:00:42 | 1 | Hall | 1 | Floor | | Peeling | Concrte | 0.05 |
| 402 | 212 | XRF | 2/8/97 | 14:10:04 | 1 | Hall | 1 | Stairs | Hand rail | Solid | Metal | 0.02 |
| 403 | 213 | XRF | 2/8/97 | 13:54:44 | 1 | Hall | 1 | Wall | Wall | Solid | Plaster | 2.34 |
| 404 | 213 | XRF | 2/8/97 | 13:56:16 | 1 | Hall | 1 | Wall | Wall | Solid | Plaster | 0.18 |
| 405 | 214 | XRF | 2/8/97 | 13:57:16 | 1 | Hall | 1 | Wall | Chair rail | Solid | Wood | 0.11 |
| 406 | 214 | XRF | 2/8/97 | 14:12:43 | 1 | Hall | 1 | Wall | Wall | Solid | Plaster | 2.12 |
| 407 | 215 | XRF | 2/8/97 | 14:13:44 | 1 | Hall | 1 | Wall | Wall | Solid | Plaster | 0.06 |
| 408 | 215 | XRF | 2/8/97 | 13:59:35 | 1 | Hall | 1 | Window | Casing | Solid | Wood | 0.08 |

Saint Paul Public Schools
 Humboldt Secondary Complex
 Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | M |
|------|-------------------|----------|---------|----------|-------|--------|-------|-----------|------------|-----------|-----------|---------|
| Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 410 | 1909 & 1924 bldg. | 13 XRF | 2/8/97 | 14:04:18 | 1 | Hall | 1 | Radiator | Peeling | Metal | | 0.09 |
| 411 | 1909 & 1924 bldg. | 25 XRF | 2/8/97 | 14:37:00 | 1 | Hall | 2 | Door | Door | Solid | Wood | 0 |
| 412 | 1909 & 1924 bldg. | 26 XRF | 2/8/97 | 14:37:41 | 1 | Hall | 2 | Door | Jamb | Solid | Metal | 0 |
| 413 | 1909 & 1924 bldg. | 29 XRF | 2/8/97 | 14:40:18 | 1 | Hall | 2 | Door | Door | Solid | Wood | 0.08 |
| 414 | 1909 & 1924 bldg. | 30 XRF | 2/8/97 | 14:41:02 | 1 | Hall | 2 | Door | Plinth | Solid | Wood | 0.09 |
| 415 | 1909 & 1924 bldg. | 32 XRF | 2/8/97 | 14:44:44 | 1 | Hall | 2 | Door | Door | Solid | Metal | 0.08 |
| 416 | 1909 & 1924 bldg. | 35 XRF | 2/8/97 | 14:48:29 | 1 | Hall | 2 | Stairs | Hand rail | Solid | Metal | 0.12 |
| 417 | 1909 & 1924 bldg. | 36 XRF | 2/8/97 | 14:48:52 | 1 | Hall | 2 | Stairs | Hand rail | Solid | | 0.08 |
| 418 | 1909 & 1924 bldg. | 23 XRF | 2/8/97 | 14:35:05 | 1 | Hall | 2 | Wall | Wall | Solid | Plaster | 0 |
| 419 | 1909 & 1924 bldg. | 24 XRF | 2/8/97 | 14:36:00 | 1 | Hall | 2 | Wall | Wall | Solid | Plaster | 0.06 |
| 420 | 1909 & 1924 bldg. | 27 XRF | 2/8/97 | 14:38:38 | 1 | Hall | 2 | Wall | Wall | Solid | Drywall | 0.01 |
| 421 | 1909 & 1924 bldg. | 28 XRF | 2/8/97 | 14:39:31 | 1 | Hall | 2 | Wall | Locker | Solid | Metal | 0.24 |
| 422 | 1909 & 1924 bldg. | 31 XRF | 2/8/97 | 14:44:01 | 1 | Hall | 2 | Wall | Wall | Solid | Concrete | 0.03 |
| 423 | 1909 & 1924 bldg. | 33 XRF | 2/8/97 | 14:46:44 | 1 | Hall | 2 | Wall | Wall | Solid | Plaster | 0.01 |
| 424 | 1909 & 1924 bldg. | 34 XRF | 2/8/97 | 14:47:34 | 1 | Hall | 2 | Wall | Wall | Solid | Plaster | 0.09 |
| 425 | 1909 & 1924 bldg. | 47 XRF | 2/8/97 | 15:10:12 | 2 | Hall | 3 | Door | Door | Solid | Wood | 0.09 |
| 426 | 1909 & 1924 bldg. | 48 XRF | 2/8/97 | 15:10:56 | 2 | Hall | 3 | Door | Casing | Solid | Wood | 0.1 |
| 427 | 1909 & 1924 bldg. | 49 XRF | 2/8/97 | 15:11:54 | 2 | Hall | 3 | Door | Locker | Solid | Metal | 0.33 |
| 428 | 1909 & 1924 bldg. | 50 XRF | 2/8/97 | 15:14:13 | 2 | Hall | 3 | Door | Door | Solid | Metal | 0.12 |
| 429 | 1909 & 1924 bldg. | 51 XRF | 2/8/97 | 15:16:02 | 2 | Hall | 3 | Door | Door | Solid | Wood | 0.03 |
| 430 | 1909 & 1924 bldg. | 45 XRF | 2/8/97 | 15:08:33 | 2 | Hall | 3 | Wall | Wall | Solid | Plaster | 0.48 |
| 431 | 1909 & 1924 bldg. | 46 XRF | 2/8/97 | 15:09:22 | 2 | Hall | 3 | Wall | Wall | Solid | Plaster | 0.06 |
| 432 | 1909 & 1924 bldg. | 54 XRF | 2/8/97 | 15:20:40 | 2 | Hall | 4 | Door | Door | Solid | Wood | 0.07 |
| 433 | 1909 & 1924 bldg. | 55 XRF | 2/8/97 | 15:21:30 | 2 | Hall | 4 | Door | Casing | Solid | Wood | 0.06 |
| 434 | 1909 & 1924 bldg. | 56 XRF | 2/8/97 | 15:22:36 | 2 | Hall | 4 | Door | Locker | Solid | Metal | 0.41 |
| 435 | 1909 & 1924 bldg. | 57 XRF | 2/8/97 | 15:23:43 | 2 | Hall | 4 | Door | Door | Solid | Wood | 0 |
| 436 | 1909 & 1924 bldg. | 58 XRF | 2/8/97 | 15:24:41 | 2 | Hall | 4 | Door | Casing | Solid | Metal | 0.04 |
| 437 | 1909 & 1924 bldg. | 61 XRF | 2/8/97 | 15:27:56 | 2 | Hall | 4 | Door | Casing | Solid | Wood | 0.08 |
| 438 | 1909 & 1924 bldg. | 62 XRF | 2/8/97 | 15:28:52 | 2 | Hall | 4 | Door | Door | Solid | Wood | 0 |
| 439 | 1909 & 1924 bldg. | 52 XRF | 2/8/97 | 15:18:07 | 2 | Hall | 4 | Wall | Wall | Solid | Plaster | 4.44 |
| 440 | 1909 & 1924 bldg. | 53 XRF | 2/8/97 | 15:18:54 | 2 | Hall | 4 | Wall | Wall | Solid | Plaster | 0.39 |
| 441 | 1909 & 1924 bldg. | 59 XRF | 2/8/97 | 15:25:38 | 2 | Hall | 4 | Wall | Wall | Solid | Plaster | 2.33 |
| 442 | 1909 & 1924 bldg. | 60 XRF | 2/8/97 | 15:26:26 | 2 | Hall | 4 | Wall | Chair rail | Solid | Wood | 0.04 |
| 443 | 1909 & 1924 bldg. | 63 XRF | 2/8/97 | 15:29:41 | 2 | Hall | 4 | Wall | Wall | Solid | Plaster | 0.14 |
| 444 | 1909 & 1924 bldg. | 240 XRF | 2/18/97 | 23:26:36 | 3 | Hall | 5 | Ceiling | | Solid | Plaster | 0.38 |
| 445 | 1909 & 1924 bldg. | 244 XRF | 2/18/97 | 23:31:09 | 3 | Hall | 5 | Door | Door | Solid | Concrete | 0.26 |
| 446 | 1909 & 1924 bldg. | 242 XRF | 2/18/97 | 23:29:22 | 3 | Hall | 5 | Door | Door | Solid | Wood | 0.03 |
| 447 | 1909 & 1924 bldg. | 243 XRF | 2/18/97 | 23:30:12 | 3 | Hall | 5 | Door | Casing | Solid | Wood | 0.09 |
| 448 | 1909 & 1924 bldg. | 245 XRF | 2/18/97 | 23:32:25 | 3 | Hall | 5 | Door | Door | Solid | Metal | 0.08 |
| 449 | 1909 & 1924 bldg. | 246 XRF | 2/18/97 | 23:33:26 | 3 | Hall | 5 | Door | Door | Solid | Wood | 0 |
| 450 | 1909 & 1924 bldg. | 247 XRF | 2/18/97 | 23:34:12 | 3 | Hall | 5 | Door | Casing | Solid | Metal | 0.03 |
| 451 | 1909 & 1924 bldg. | 237 XRF | 2/18/97 | 23:22:28 | 3 | Hall | 5 | Wall | Wall | Solid | Plaster | 0.34 |
| 452 | 1909 & 1924 bldg. | 238 XRF | 2/18/97 | 23:23:39 | 3 | Hall | 5 | Wall | Wall | Solid | Stucco | 1.81 |
| 453 | 1909 & 1924 bldg. | 239 XRF | 2/18/97 | 23:24:41 | 3 | Hall | 5 | Wall | Chair rail | Solid | Wood | 0.14 |
| 454 | 1909 & 1924 bldg. | 241 XRF | 2/18/97 | 23:28:17 | 3 | Hall | 5 | Door | Locker | Solid | Metal | 0.18 |
| 455 | 1909 & 1924 bldg. | 49 XRF | 2/19/97 | 18:24:50 | 1 | Hall | 6 | Door | Jamb | Peeling | Wood | 0.17 |
| 456 | 1909 & 1924 bldg. | 50 XRF | 2/19/97 | 18:25:38 | 1 | Hall | 6 | Door | Door | Solid | Wood | 0.09 |
| 457 | 1909 & 1924 bldg. | 51 XRF | 2/19/97 | 18:26:36 | 1 | Hall | 6 | Door | Door | Solid | Wood | 0.03 |
| 458 | 1909 & 1924 bldg. | 46 XRF | 2/19/97 | 18:21:28 | 1 | Hall | 6 | Wall | Wall | Solid | Plaster | 0.8 |
| 459 | 1909 & 1924 bldg. | 47 XRF | 2/19/97 | 18:22:30 | 1 | Hall | 6 | Wall | Wall | Solid | Plaster | 5.09 |
| 460 | 1909 & 1924 bldg. | 48 XRF | 2/19/97 | 18:23:24 | 1 | Hall | 6 | Wall | Midle Wall | Solid | Drywall | 0 |
| 461 | 1909 & 1924 bldg. | 111 XRF | 2/19/97 | 21:00:29 | 2 | Hall | 7 | Ceiling | | Solid | Concrete | 0.02 |
| 462 | 1909 & 1924 bldg. | 112 XRF | 2/19/97 | 21:01:27 | 2 | Hall | 7 | Door | Jamb | Solid | Metal | 0.08 |
| 463 | 1909 & 1924 bldg. | 113 XRF | 2/19/97 | 21:02:21 | 2 | Hall | 7 | Door | Door | Solid | Metal | 0.31 |
| 464 | 1909 & 1924 bldg. | 114 XRF | 2/19/97 | 21:03:13 | 2 | Hall | 7 | Door | Radiator | Peeling | Metal | 0.01 |
| 465 | 1909 & 1924 bldg. | 115 XRF | 2/19/97 | 21:04:16 | 2 | Hall | 7 | Door | Door | Solid | Wood | 0 |
| 466 | 1909 & 1924 bldg. | 109 XRF | 2/19/97 | 20:58:39 | 2 | Hall | 7 | Wall | Wall | Solid | Concrete | 0.01 |
| 467 | 1909 & 1924 bldg. | 110 XRF | 2/19/97 | 20:59:30 | 2 | Hall | 7 | Wall | Baseboard | Solid | Concrete | 0.06 |
| 468 | 1909 & 1924 bldg. | 66 XRF | 2/11/97 | 17:47:03 | 1 | Lounge | 132 | Door | Casing | Solid | Wood | 0.13 |
| 469 | 1909 & 1924 bldg. | 57 XRF | 2/11/97 | 17:48:02 | 1 | Lounge | 132 | Door | Door | Solid | Wood | 0.13 |
| 470 | 1909 & 1924 bldg. | 63 XRF | 2/11/97 | 17:44:01 | 1 | Lounge | 132 | Wall | Baseboard | Solid | Wood | 0.74 |
| 471 | 1909 & 1924 bldg. | 54 XRF | 2/11/97 | 17:45:12 | 1 | Lounge | 132 | Wall | Wall | Solid | Plaster | 3.51 |
| 472 | 1909 & 1924 bldg. | 55 XRF | 2/11/97 | 17:46:04 | 1 | Lounge | 132 | Wall | Wall | Solid | Plaster | 0.19 |
| 473 | 1909 & 1924 bldg. | 103 XRF | 2/11/97 | 19:05:33 | 1 | Other | 11 | Ceiling | | Peeling | Concrete | 0.03 |
| 474 | 1909 & 1924 bldg. | 104 XRF | 2/11/97 | 19:07:53 | 1 | Other | 11 | Door | Door | Peeling | Metal | 0.15 |
| 475 | 1909 & 1924 bldg. | 105 XRF | 2/11/97 | 19:09:34 | 1 | Other | 11 | Door | Jamb | Peeling | Metal | 0.21 |
| 476 | 1909 & 1924 bldg. | 102 XRF | 2/11/97 | 19:03:06 | 1 | Other | 11 | Floor | | Peeling | Concrete | 0.04 |
| 477 | 1909 & 1924 bldg. | 106 XRF | 2/11/97 | 19:10:44 | 1 | Other | 11 | Stairs | Stringer | Peeling | Metal | 0.59 |

Saint Paul Public Schools
Humboldt Secondary Complex
Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | M |
|------|-------------------|----------|---------|----------|-------|-------|-------|------------|------------|-----------|-----------|---------|
| Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 478 | 1909 & 1924 bldg. | 99 XRF | 2/11/97 | 18:58:51 | 1 | Other | 12 | Ceiling | | Peeling | Plaster | 0.21 |
| 479 | 1909 & 1924 bldg. | 100 XRF | 2/11/97 | 18:59:53 | 1 | Other | 12 | Door | Door | Solid | Wood | 0 |
| 480 | 1909 & 1924 bldg. | 101 XRF | 2/11/97 | 19:01:03 | 1 | Other | 12 | Door | Casing | Solid | Metal | 0.01 |
| 481 | 1909 & 1924 bldg. | 96 XRF | 2/11/97 | 18:55:38 | 1 | Other | 12 | Wall | Wall | Solid | Plaster | 0.03 |
| 482 | 1909 & 1924 bldg. | 97 XRF | 2/11/97 | 18:56:40 | 1 | Other | 12 | Wall | Midle Wall | Peeling | Concrete | 0.12 |
| 483 | 1909 & 1924 bldg. | 98 XRF | 2/11/97 | 18:57:36 | 1 | Other | 12 | Wall | Wall | Peeling | Plaster | 5.09 |
| 484 | 1909 & 1924 bldg. | 43 XRF | 2/19/97 | 18:18:06 | 1 | Other | 14 | Wall | Wall | Peeling | Plaster | 5.09 |
| 485 | 1909 & 1924 bldg. | 44 XRF | 2/19/97 | 18:19:05 | 1 | Other | 14 | Wall | Wall | Solid | Drywall | 0.06 |
| 486 | 1909 & 1924 bldg. | 45 XRF | 2/19/97 | 18:19:58 | 1 | Other | 14 | Wall | Wall | Peeling | Plaster | 0.17 |
| 487 | 1909 & 1924 bldg. | 32 XRF | 2/19/97 | 18:04:54 | | Other | 24 | Wall | Wall | Solid | Drywall | 0.11 |
| 488 | 1909 & 1924 bldg. | 33 XRF | 2/19/97 | 18:05:50 | | Other | 24 | Wall | Midle Wall | Solid | Drywall | 0 |
| 489 | 1909 & 1924 bldg. | 34 XRF | 2/19/97 | 18:06:42 | | Other | 24 | Wall | Midle Wall | Solid | Drywall | 0.04 |
| 490 | 1909 & 1924 bldg. | 41 XRF | 2/19/97 | 18:13:47 | 1 | Other | 25 | Door | Casing | Solid | Metal | 0.01 |
| 491 | 1909 & 1924 bldg. | 42 XRF | 2/19/97 | 18:14:32 | 1 | Other | 25 | Door | Door | Solid | Wood | 0 |
| 492 | 1909 & 1924 bldg. | 39 XRF | 2/19/97 | 18:11:51 | 1 | Other | 25 | Wall | Wall | Solid | Drywall | 0.09 |
| 493 | 1909 & 1924 bldg. | 40 XRF | 2/19/97 | 18:12:51 | 1 | Other | 25 | Window | Casing | Solid | Metal | 0 |
| 494 | 1909 & 1924 bldg. | 37 XRF | 2/19/97 | 18:09:52 | | Other | 26 | Door | Jamb | Solid | Metal | 0.01 |
| 495 | 1909 & 1924 bldg. | 38 XRF | 2/19/97 | 18:10:38 | | Other | 26 | Door | Door | Solid | Wood | 0 |
| 496 | 1909 & 1924 bldg. | 35 XRF | 2/19/97 | 18:08:18 | | Other | 26 | Wall | Wall | Solid | Drywall | 0.03 |
| 497 | 1909 & 1924 bldg. | 36 XRF | 2/19/97 | 18:09:06 | | Other | 26 | Window | Casing | Solid | Metal | 0.01 |
| 498 | 1909 & 1924 bldg. | 61 XRF | 2/19/97 | 18:45:26 | 1 | Other | 34 | Door | Jamb | Solid | Metal | 0.11 |
| 499 | 1909 & 1924 bldg. | 62 XRF | 2/19/97 | 18:46:11 | 1 | Other | 34 | Door | Door | Solid | Wood | 0 |
| 500 | 1909 & 1924 bldg. | 58 XRF | 2/19/97 | 18:42:58 | 1 | Other | 34 | Wall | Wall | Peeling | Plaster | 5.09 |
| 501 | 1909 & 1924 bldg. | 59 XRF | 2/19/97 | 18:43:46 | 1 | Other | 34 | Wall | Midle Wall | Solid | Concrete | 0.03 |
| 502 | 1909 & 1924 bldg. | 60 XRF | 2/19/97 | 18:44:40 | 1 | Other | 34 | Wall | Midle Wall | Solid | Plaster | 0.42 |
| 503 | 1909 & 1924 bldg. | 46 XRF | 2/11/97 | 17:34:30 | 1 | Other | 104 | Door | Door | Solid | Wood | 0 |
| 504 | 1909 & 1924 bldg. | 47 XRF | 2/11/97 | 17:35:16 | 1 | Other | 104 | Door | Jamb | Solid | Metal | 0 |
| 505 | 1909 & 1924 bldg. | 44 XRF | 2/11/97 | 17:32:01 | 1 | Other | 105 | Window | Stool | Solid | Wood | 0.11 |
| 506 | 1909 & 1924 bldg. | 45 XRF | 2/11/97 | 17:33:24 | 1 | Other | 105 | Window | Casing | Solid | Wood | 0.13 |
| 507 | 1909 & 1924 bldg. | 34 XRF | 2/11/97 | 17:12:54 | 1 | Other | 111 | Door | Door | Solid | Wood | 0 |
| 508 | 1909 & 1924 bldg. | 31 XRF | 2/11/97 | 17:10:16 | 1 | Other | 111 | Wall | Wall | Solid | Drywall | 0 |
| 509 | 1909 & 1924 bldg. | 32 XRF | 2/11/97 | 17:11:02 | 1 | Other | 111 | Wall | Wall | Solid | Concrte | 0 |
| 510 | 1909 & 1924 bldg. | 33 XRF | 2/11/97 | 17:12:07 | 1 | Other | 111 | Window | Casing | Solid | Metal | 0.09 |
| 511 | 1909 & 1924 bldg. | 64 XRF | 2/11/97 | 17:59:34 | 1 | Other | 134 | Chalkboard | Sill | Solid | Wood | 0.01 |
| 512 | 1909 & 1924 bldg. | 65 XRF | 2/11/97 | 18:00:27 | 1 | Other | 134 | Chalkboard | Sash | Solid | Wood | 0.01 |
| 513 | 1909 & 1924 bldg. | 62 XRF | 2/11/97 | 17:57:40 | 1 | Other | 134 | Door | Casing | Solid | Metal | 0.01 |
| 514 | 1909 & 1924 bldg. | 63 XRF | 2/11/97 | 17:58:35 | 1 | Other | 134 | Door | Door | Solid | Wood | 0 |
| 515 | 1909 & 1924 bldg. | 61 XRF | 2/11/97 | 17:55:05 | 1 | Other | 134 | Wall | Wall | Solid | Drywall | 0.07 |
| 516 | 1909 & 1924 bldg. | 71 XRF | 2/11/97 | 18:10:02 | 1 | Other | 136 | Wall | Wall | Solid | Plaster | 3.97 |
| 517 | 1909 & 1924 bldg. | 72 XRF | 2/11/97 | 18:10:57 | 1 | Other | 136 | Wall | Wall | Solid | Plaster | 5.09 |
| 518 | 1909 & 1924 bldg. | 73 XRF | 2/11/97 | 18:11:48 | 1 | Other | 136 | Wall | Midle Wall | Solid | Drywall | 0.05 |
| 519 | 1909 & 1924 bldg. | 74 XRF | 2/11/97 | 18:12:51 | 1 | Other | 136 | Wall | Baseboard | Solid | Wood | 5.09 |
| 520 | 1909 & 1924 bldg. | 81 XRF | 2/11/97 | 18:36:14 | 1 | Other | 139 | Door | Jamb | Solid | Metal | 0.08 |
| 521 | 1909 & 1924 bldg. | 82 XRF | 2/11/97 | 18:37:14 | 1 | Other | 139 | Door | Door | Solid | Wood | 0 |
| 522 | 1909 & 1924 bldg. | 80 XRF | 2/11/97 | 18:35:19 | 1 | Other | 139 | Wall | Wall | Solid | Drywall | 0 |
| 523 | 1909 & 1924 bldg. | 102 XRF | 2/19/97 | 20:46:42 | 2 | Other | 192 | Ceiling | | Solid | Concrte | 0.05 |
| 524 | 1909 & 1924 bldg. | 99 XRF | 2/19/97 | 20:43:22 | 2 | Other | 192 | Closet | Wall | Solid | Concrete | 0 |
| 525 | 1909 & 1924 bldg. | 106 XRF | 2/19/97 | 20:50:49 | 2 | Other | 192 | Closet | Wall | Solid | Concrte | 0.09 |
| 526 | 1909 & 1924 bldg. | 103 XRF | 2/19/97 | 20:48:09 | 2 | Other | 192 | Door | Door | Solid | Wood | 0 |
| 527 | 1909 & 1924 bldg. | 104 XRF | 2/19/97 | 20:49:01 | 2 | Other | 192 | Door | Jamb | Solid | Metal | 0.01 |
| 528 | 1909 & 1924 bldg. | 105 XRF | 2/19/97 | 20:49:48 | 2 | Other | 192 | Door | Door | Solid | Metal | 0.01 |
| 529 | 1909 & 1924 bldg. | 107 XRF | 2/19/97 | 20:51:57 | 2 | Other | 192 | Door | Casing | Solid | Metal | 0.07 |
| 530 | 1909 & 1924 bldg. | 108 XRF | 2/19/97 | 20:52:55 | 2 | Other | 192 | Door | Door | Solid | Metal | 0.3 |
| 531 | 1909 & 1924 bldg. | 101 XRF | 2/19/97 | 20:44:59 | 2 | Other | 192 | Floor | | Peeling | Concrete | 0 |
| 532 | 1909 & 1924 bldg. | 100 XRF | 2/19/97 | 20:44:09 | 2 | Other | 192 | Wall | Midle Wall | Solid | Concrete | 0.02 |
| 533 | 1909 & 1924 bldg. | 166 XRF | 2/11/97 | 21:26:43 | 2 | Other | 206 | Wall | Wall | Peeling | Plaster | 0.19 |
| 534 | 1909 & 1924 bldg. | 195 XRF | 2/11/97 | 22:10:35 | 2 | Other | 213 | Door | Door | Solid | Wood | 0.02 |
| 535 | 1909 & 1924 bldg. | 196 XRF | 2/11/97 | 22:11:22 | 2 | Other | 213 | Door | Jamb | Solid | Metal | 0.12 |
| 536 | 1909 & 1924 bldg. | 193 XRF | 2/11/97 | 22:07:30 | 2 | Other | 213 | Wall | Wall | Solid | Drywall | 0.37 |
| 537 | 1909 & 1924 bldg. | 194 XRF | 2/11/97 | 22:08:39 | 2 | Other | 213 | Wall | Midle Wall | Solid | Plaster | 0.19 |
| 538 | 1909 & 1924 bldg. | 172 XRF | 2/11/97 | 21:34:57 | 2 | Other | 216 | Door | Door | Solid | Wood | 0.01 |
| 539 | 1909 & 1924 bldg. | 173 XRF | 2/11/97 | 21:35:44 | 2 | Other | 216 | Door | Jamb | Solid | Metal | 0.01 |
| 540 | 1909 & 1924 bldg. | 169 XRF | 2/11/97 | 21:32:26 | 2 | Other | 216 | Stairs | Stringer | Solid | Metal | 0.02 |
| 541 | 1909 & 1924 bldg. | 170 XRF | 2/11/97 | 21:33:10 | 2 | Other | 216 | Stairs | Hand rail | Solid | Metal | 0.01 |
| 542 | 1909 & 1924 bldg. | 171 XRF | 2/11/97 | 21:34:08 | 2 | Other | 216 | Stairs | Wall | Solid | Concrete | 0.03 |
| 543 | 1909 & 1924 bldg. | 167 XRF | 2/11/97 | 21:30:34 | 2 | Other | 216 | Wall | Wall | Solid | Drywall | 0.18 |
| 544 | 1909 & 1924 bldg. | 168 XRF | 2/11/97 | 21:31:26 | 2 | Other | 216 | Wall | Wall | Solid | Plaster | 0.03 |
| 545 | 1909 & 1924 bldg. | 107 XRF | 2/18/97 | 19:21:23 | 3 | Other | 302 | Chalkboard | Sill | Solid | Wood | 0 |

Saint Paul Public Schools
 Humboldt Secondary Complex
 Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | M | |
|-----|-------------------|-----|----------|---------|----------|-------|-----------|-------|------------|------------|-----------|-----------|---------|
| 3 | Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 546 | 1909 & 1924 bldg. | 108 | XRF | 2/18/97 | 19:22:09 | 3 | Other | 302 | Chalkboard | Sash | Solid | Wood | 0.01 |
| 547 | 1909 & 1924 bldg. | 105 | XRF | 2/18/97 | 19:19:35 | 3 | Other | 302 | Door | Casing | Solid | Wood | 0.08 |
| 548 | 1909 & 1924 bldg. | 106 | XRF | 2/18/97 | 19:20:20 | 3 | Other | 302 | Door | Door | Solid | Wood | 0.07 |
| 549 | 1909 & 1924 bldg. | 103 | XRF | 2/18/97 | 19:17:17 | 3 | Other | 302 | Wall | Wall | Solid | Plaster | 5.09 |
| 550 | 1909 & 1924 bldg. | 104 | XRF | 2/18/97 | 19:18:23 | 3 | Other | 302 | Wall | Wall | Solid | Plaster | 4.28 |
| 551 | 1909 & 1924 bldg. | 145 | XRF | 2/18/97 | 21:31:19 | 3 | Other | 305 | Wall | Midle Wall | Solid | Stucco | 0 |
| 552 | 1909 & 1924 bldg. | 231 | XRF | 2/18/97 | 23:10:26 | 3 | Other | 312 | Ceiling | | Solid | Wood | 0 |
| 553 | 1909 & 1924 bldg. | 232 | XRF | 2/18/97 | 23:12:35 | 3 | Other | 312 | Door | Jamb | Solid | Metal | 0 |
| 554 | 1909 & 1924 bldg. | 233 | XRF | 2/18/97 | 23:13:18 | 3 | Other | 312 | Door | Door | Solid | Wood | 0 |
| 555 | 1909 & 1924 bldg. | 234 | XRF | 2/18/97 | 23:14:05 | 3 | Other | 312 | Door | Casing | Solid | Wood | 0.09 |
| 556 | 1909 & 1924 bldg. | 235 | XRF | 2/18/97 | 23:14:51 | 3 | Other | 312 | Door | Door | Solid | Wood | 0.09 |
| 557 | 1909 & 1924 bldg. | 236 | XRF | 2/18/97 | 23:16:39 | 3 | Other | 312 | Door | Panel | Solid | Metal | 0 |
| 558 | 1909 & 1924 bldg. | 228 | XRF | 2/18/97 | 23:07:01 | 3 | Other | 312 | Floor | Outside | Solid | Wood | 0.02 |
| 559 | 1909 & 1924 bldg. | 229 | XRF | 2/18/97 | 23:07:49 | 3 | Other | 312 | Wall | Baseboard | Solid | Wood | 5.09 |
| 560 | 1909 & 1924 bldg. | 230 | XRF | 2/18/97 | 23:08:42 | 3 | Other | 312 | Wall | Wall | Solid | Plaster | 3.49 |
| 561 | 1909 & 1924 bldg. | 175 | XRF | 2/23/97 | 20:02:27 | 1 | Outside | 0 | Door | Door | Solid | Metal | 0.34 |
| 562 | 1909 & 1924 bldg. | 176 | XRF | 2/23/97 | 20:03:29 | 1 | Outside | 0 | Stairs | Hand rail | Peeling | Metal | 0.02 |
| 563 | 1909 & 1924 bldg. | 170 | XRF | 2/23/97 | 19:55:35 | 1 | Outside | 0 | Window | Sash | Solid | Metal | 0 |
| 564 | 1909 & 1924 bldg. | 171 | XRF | 2/23/97 | 19:56:33 | 1 | Outside | 0 | Window | Sill | Chalking | Metal | 0 |
| 565 | 1909 & 1924 bldg. | 172 | XRF | 2/23/97 | 19:57:45 | 1 | Outside | 0 | Panel | Solid | Wood | 0.01 | |
| 566 | 1909 & 1924 bldg. | 35 | XRF | 2/11/97 | 17:14:55 | 1 | Restroom | 1 | Wall | Wall | Solid | Plaster | 0 |
| 567 | 1909 & 1924 bldg. | 36 | XRF | 2/11/97 | 17:16:03 | 1 | Restroom | 1 | Wall | Wall | Solid | Plaster | 0.06 |
| 568 | 1909 & 1924 bldg. | 52 | XRF | 2/11/97 | 17:40:40 | 1 | Restroom | 3 | Cabinet | Door | Solid | Wood | 0 |
| 569 | 1909 & 1924 bldg. | 48 | XRF | 2/11/97 | 17:36:40 | 1 | Restroom | 3 | Wall | Wall | Solid | Plaster | 1.49 |
| 570 | 1909 & 1924 bldg. | 49 | XRF | 2/11/97 | 17:37:29 | 1 | Restroom | 3 | Wall | Wall | Solid | Plaster | 2.2 |
| 571 | 1909 & 1924 bldg. | 50 | XRF | 2/11/97 | 17:38:08 | 1 | Restroom | 3 | Wall | Midle Wall | Solid | Drywall | 0.11 |
| 572 | 1909 & 1924 bldg. | 51 | XRF | 2/11/97 | 17:39:47 | 1 | Restroom | 3 | Wall | Radiator | Cracked | Metal | 0.06 |
| 573 | 1909 & 1924 bldg. | 95 | XRF | 2/11/97 | 18:53:08 | 1 | Restroom | 4 | Door | Door | Solid | Wood | 0 |
| 574 | 1909 & 1924 bldg. | 91 | XRF | 2/11/97 | 18:49:09 | 1 | Restroom | 4 | Wall | Wall | Solid | Concrte | 0.07 |
| 575 | 1909 & 1924 bldg. | 92 | XRF | 2/11/97 | 18:50:14 | 1 | Restroom | 4 | Wall | Wall | Solid | Concrte | 0 |
| 576 | 1909 & 1924 bldg. | 93 | XRF | 2/11/97 | 18:51:23 | 1 | Restroom | 4 | Wall | Midle Wall | Solid | Concrte | 2.94 |
| 577 | 1909 & 1924 bldg. | 94 | XRF | 2/11/97 | 18:52:22 | 1 | Restroom | 4 | Wall | Midle Wall | Solid | Concrte | 0.05 |
| 578 | 1909 & 1924 bldg. | 198 | XRF | 2/11/97 | 22:13:35 | 2 | Restroom | 5 | Ceiling | | Solid | Plaster | 0.11 |
| 579 | 1909 & 1924 bldg. | 197 | XRF | 2/11/97 | 22:12:32 | 2 | Restroom | 5 | Wall | Midle Wall | Solid | Concre | 2.88 |
| 580 | 1909 & 1924 bldg. | 199 | XRF | 2/11/97 | 22:14:46 | 2 | Restroom | 6 | Ceiling | | Solid | Plaster | 0.13 |
| 581 | 1909 & 1924 bldg. | 232 | XRF | 2/11/97 | 22:59:08 | 2 | Restroom | 7 | Ceiling | | Solid | Plaster | 0.05 |
| 582 | 1909 & 1924 bldg. | 235 | XRF | 2/11/97 | 23:02:38 | 2 | Restroom | 7 | Chalkboard | Sash | Solid | Metal | 0.06 |
| 583 | 1909 & 1924 bldg. | 233 | XRF | 2/11/97 | 23:01:01 | 2 | Restroom | 7 | Door | Door | Solid | Wood | 0 |
| 584 | 1909 & 1924 bldg. | 234 | XRF | 2/11/97 | 23:01:42 | 2 | Restroom | 7 | Door | Caslng | Solid | Metal | 0.03 |
| 585 | 1909 & 1924 bldg. | 231 | XRF | 2/11/97 | 22:57:14 | 2 | Restroom | 7 | Wall | Wall | Solid | Drywall | 0.01 |
| 586 | 1909 & 1924 bldg. | 237 | XRF | 2/11/97 | 23:04:49 | 2 | Restroom | 8 | Door | Door | Solid | Wood | 0 |
| 587 | 1909 & 1924 bldg. | 238 | XRF | 2/11/97 | 23:05:41 | 2 | Restroom | 8 | Door | Casing | Solid | Metal | 0.08 |
| 588 | 1909 & 1924 bldg. | 236 | XRF | 2/11/97 | 23:03:54 | 2 | Restroom | 8 | Wall | Wall | Solid | Concrte | 1.95 |
| 589 | 1909 & 1924 bldg. | 239 | XRF | 2/11/97 | 23:06:37 | 2 | Restroom | 8 | Bthrm Stll | | Solid | Metal | 0.07 |
| 590 | 1909 & 1924 bldg. | 240 | XRF | 2/11/97 | 23:07:23 | 2 | Restroom | 8 | Stall Door | Solid | Metal | 0.07 | |
| 591 | 1909 & 1924 bldg. | 206 | XRF | 2/18/97 | 22:38:14 | 3 | Restroom | 9 | Ceiling | | Solid | Plaster | 0.28 |
| 592 | 1909 & 1924 bldg. | 200 | XRF | 2/18/97 | 22:32:05 | 3 | Restroom | 9 | Wall | Wall | Solid | Plaster | 0.15 |
| 593 | 1909 & 1924 bldg. | 201 | XRF | 2/18/97 | 22:32:59 | 3 | Restroom | 9 | Wall | Midle Wall | Solid | Drywall | 0.02 |
| 594 | 1909 & 1924 bldg. | 202 | XRF | 2/18/97 | 22:33:51 | 3 | Restroom | 9 | Wall | Baseboard | Solid | Wood | 0.03 |
| 595 | 1909 & 1924 bldg. | 203 | XRF | 2/18/97 | 22:34:52 | 3 | Restroom | 9 | Wall | Stall Door | Solid | Wood | 0.46 |
| 596 | 1909 & 1924 bldg. | 204 | XRF | 2/18/97 | 22:36:29 | 3 | Restroom | 9 | Wall | Wall | Cracked | Plaster | 0.01 |
| 597 | 1909 & 1924 bldg. | 208 | XRF | 2/18/97 | 22:43:17 | 3 | Restroom | 10 | Ceiling | Diffuser | Solid | Plaster | 0.12 |
| 598 | 1909 & 1924 bldg. | 211 | XRF | 2/18/97 | 22:46:49 | 3 | Restroom | 10 | Door | Jamb | Solid | Metal | 0.11 |
| 599 | 1909 & 1924 bldg. | 212 | XRF | 2/18/97 | 22:47:31 | 3 | Restroom | 10 | Door | Door | Solid | Wood | 0.04 |
| 600 | 1909 & 1924 bldg. | 206 | XRF | 2/18/97 | 22:40:37 | 3 | Restroom | 10 | Wall | Wall | Solid | Plaster | 0.14 |
| 601 | 1909 & 1924 bldg. | 207 | XRF | 2/18/97 | 22:41:27 | 3 | Restroom | 10 | Wall | Wall | Solid | Tile | 2.71 |
| 602 | 1909 & 1924 bldg. | 209 | XRF | 2/18/97 | 22:45:06 | 3 | Restroom | 10 | | Stall Door | Solid | Metal | 0.06 |
| 603 | 1909 & 1924 bldg. | 210 | XRF | 2/18/97 | 22:45:55 | 3 | Restroom | 10 | | Stall Door | Solid | Metal | 0.04 |
| 604 | 1909 & 1924 bldg. | 178 | XRF | 2/11/97 | 21:42:38 | 2 | Stage | 0 | Ceiling | | Solid | Plaster | 0.01 |
| 605 | 1909 & 1924 bldg. | 179 | XRF | 2/11/97 | 21:44:58 | 2 | Stage | 0 | Door | Door | Solid | Metal | 0.01 |
| 606 | 1909 & 1924 bldg. | 180 | XRF | 2/11/97 | 21:45:44 | 2 | Stage | 0 | Door | Jamb | Solid | Metal | 0.03 |
| 607 | 1909 & 1924 bldg. | 181 | XRF | 2/11/97 | 21:46:45 | 2 | Stage | 0 | Stairs | Stringer | Solid | Metal | 0.02 |
| 608 | 1909 & 1924 bldg. | 174 | XRF | 2/11/97 | 21:37:24 | 2 | Stage | 0 | Wall | Wall | Solid | Plaster | 0.42 |
| 609 | 1909 & 1924 bldg. | 175 | XRF | 2/11/97 | 21:37:45 | 2 | Stage | 0 | Wall | Wall | Solid | | 0.26 |
| 610 | 1909 & 1924 bldg. | 176 | XRF | 2/11/97 | 21:38:35 | 2 | Stage | 0 | Wall | Wall | Solid | Drywall | 0.03 |
| 611 | 1909 & 1924 bldg. | 177 | XRF | 2/11/97 | 21:39:28 | 2 | Stage | 0 | Wall | Baseboard | Solid | Wood | 0.23 |
| 612 | 1909 & 1924 bldg. | 41 | XRF | 2/8/97 | 14:55:28 | 1 | Stairwell | 1 | Door | Door | Solid | Wood | 0.01 |
| 613 | 1909 & 1924 bldg. | 43 | XRF | 2/8/97 | 15:02:35 | 3 | Stairwell | 1 | Door | Door | Solid | Metal | 0.01 |

Saint Paul Public Schools
Humboldt Secondary Complex
Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | M |
|------|-------------------|----------|---------|----------|-------|-----------|-------|------------|------------|-----------|-----------|---------|
| Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 614 | 1909 & 1924 bldg. | 44 XRF | 2/8/97 | 15:03:40 | 3 | Stairwell | 1 | Door | Jamb | Solid | Metal | 0.02 |
| 615 | 1909 & 1924 bldg. | 37 XRF | 2/8/97 | 14:51:09 | 1 | Stairwell | 1 | Stairs | Baseboard | Solid | Metal | 0.04 |
| 616 | 1909 & 1924 bldg. | 38 XRF | 2/8/97 | 14:52:08 | 1 | Stairwell | 1 | Stairs | Riser | Solid | Metal | 0.01 |
| 617 | 1909 & 1924 bldg. | 39 XRF | 2/8/97 | 14:53:01 | 1 | Stairwell | 1 | Stairs | Hand rail | Solid | Metal | 0.02 |
| 618 | 1909 & 1924 bldg. | 40 XRF | 2/8/97 | 14:53:49 | 1 | Stairwell | 1 | Stairs | Wall | Solid | Concrete | 0.05 |
| 619 | 1909 & 1924 bldg. | 42 XRF | 2/8/97 | 14:56:31 | 1 | Stairwell | 1 | Wall | Wall | Solid | Brick | 0.11 |
| 620 | 1909 & 1924 bldg. | 14 XRF | 2/19/97 | 17:22:20 | 2 | Stairwell | 2 | Ceiling | | Solid | Plaster | 0.24 |
| 621 | 1909 & 1924 bldg. | 11 XRF | 2/19/97 | 17:14:56 | 2 | Stairwell | 2 | Floor | | Peeling | Concrete | 0.07 |
| 622 | 1909 & 1924 bldg. | 7 XRF | 2/19/97 | 17:10:23 | 2 | Stairwell | 2 | Stairs | Wall | Solid | Plaster | 2.9 |
| 623 | 1909 & 1924 bldg. | 8 XRF | 2/19/97 | 17:11:23 | 2 | Stairwell | 2 | Stairs | Hand rail | Solid | Wood | 0 |
| 624 | 1909 & 1924 bldg. | 9 XRF | 2/19/97 | 17:12:25 | 2 | Stairwell | 2 | Stairs | Riser | Peeling | Concrete | 0.11 |
| 625 | 1909 & 1924 bldg. | 10 XRF | 2/19/97 | 17:13:45 | 2 | Stairwell | 2 | Stairs | Baseboard | Peeling | Concrete | 0.08 |
| 626 | 1909 & 1924 bldg. | 13 XRF | 2/19/97 | 17:19:50 | 2 | Stairwell | 2 | Stairs | Rail cap | Solid | Concrete | 3.5 |
| 627 | 1909 & 1924 bldg. | 12 XRF | 2/19/97 | 17:18:23 | 2 | Stairwell | 2 | Wall | Chair rail | Solid | Wood | 0.06 |
| 628 | 1909 & 1924 bldg. | 15 XRF | 2/19/97 | 17:24:39 | 2 | Stairwell | 2 | Wall | Wall | Solid | Plaster | 0.1 |
| 629 | 1909 & 1924 bldg. | 55 XRF | 2/19/97 | 18:32:10 | 1 | Stairwell | 3 | Ceiling | | Solid | Plaster | 0.28 |
| 630 | 1909 & 1924 bldg. | 56 XRF | 2/19/97 | 18:34:20 | 1 | Stairwell | 3 | Door | Jamb | Solid | Wood | 0.23 |
| 631 | 1909 & 1924 bldg. | 57 XRF | 2/19/97 | 18:35:07 | 1 | Stairwell | 3 | Door | Door | Solid | Metal | 0.68 |
| 632 | 1909 & 1924 bldg. | 52 XRF | 2/19/97 | 18:28:06 | 1 | Stairwell | 3 | Stairs | Wall | Solid | Plaster | 0.2 |
| 633 | 1909 & 1924 bldg. | 53 XRF | 2/19/97 | 18:29:10 | 1 | Stairwell | 3 | Stairs | Hand rail | Peeling | Wood | 0.01 |
| 634 | 1909 & 1924 bldg. | 54 XRF | 2/19/97 | 18:30:03 | 1 | Stairwell | 3 | Wall | Chair rail | Solid | Wood | 0.28 |
| 635 | 1909 & 1924 bldg. | 84 XRF | 2/19/97 | 19:18:55 | 1 | Stairwell | 4 | Stairs | Tread | Solid | Concrete | 0.11 |
| 636 | 1909 & 1924 bldg. | 82 XRF | 2/19/97 | 19:16:57 | 1 | Stairwell | 4 | Wall | Wall | Peeling | Plaster | 2.37 |
| 637 | 1909 & 1924 bldg. | 83 XRF | 2/19/97 | 19:17:53 | 1 | Stairwell | 4 | Wall | Wall | Peeling | Plaster | 5.09 |
| 638 | 1909 & 1924 bldg. | 116 XRF | 2/19/97 | 21:06:27 | 2 | Stairwell | 5 | Stairs | Wall | Solid | Plaster | 0 |
| 639 | 1909 & 1924 bldg. | 117 XRF | 2/19/97 | 21:07:19 | 2 | Stairwell | 5 | Stairs | Hand rail | Solid | Metal | 0.04 |
| 640 | 1909 & 1924 bldg. | 118 XRF | 2/19/97 | 21:08:11 | 2 | Stairwell | 5 | Stairs | Baseboard | Solid | Metal | 0 |
| 641 | 1909 & 1924 bldg. | 119 XRF | 2/19/97 | 21:08:57 | 2 | Stairwell | 5 | Stairs | Riser | Solid | Metal | 0.01 |
| 642 | 1959 bldg. | 198 XRF | 2/19/97 | 22:51:25 | 1 | Classroom | 121 | Door | Jamb | Solid | Metal | 0 |
| 643 | 1959 bldg. | 199 XRF | 2/19/97 | 22:52:18 | 1 | Classroom | 121 | Door | Door | Solid | Wood | 0 |
| 644 | 1959 bldg. | 196 XRF | 2/19/97 | 22:49:10 | 1 | Classroom | 121 | Wall | Wall | Solid | Drywall | 0.06 |
| 645 | 1959 bldg. | 197 XRF | 2/19/97 | 22:50:17 | 1 | Classroom | 121 | Wall | Wall | Solid | Drywall | 0.04 |
| 646 | 1959 bldg. | 200 XRF | 2/19/97 | 22:53:05 | 1 | Classroom | 121 | Wall | Midle Wall | Solid | Concrete | 0.01 |
| 647 | 1959 bldg. | 157 XRF | 2/19/97 | 22:05:09 | 2 | Classroom | 141 | Door | Jamb | Solid | Metal | 0.03 |
| 648 | 1959 bldg. | 158 XRF | 2/19/97 | 22:05:57 | 2 | Classroom | 141 | Door | Door | Solid | Wood | 0 |
| 649 | 1959 bldg. | 159 XRF | 2/19/97 | 22:06:45 | 2 | Classroom | 141 | Door | Column | Solid | Metal | 0 |
| 650 | 1959 bldg. | 8 XRF | 2/23/97 | 15:13:42 | 1 | Classroom | 141 | Door | Casing | Solid | Metal | 0 |
| 651 | 1959 bldg. | 9 XRF | 2/23/97 | 15:14:29 | 1 | Classroom | 141 | Door | Door | Solid | Wood | 0 |
| 652 | 1959 bldg. | 155 XRF | 2/19/97 | 22:02:40 | 2 | Classroom | 141 | Wall | Midle Wall | Solid | Drywall | 0.01 |
| 653 | 1959 bldg. | 156 XRF | 2/19/97 | 22:03:32 | 2 | Classroom | 141 | Wall | Midle Wall | Solid | Concrete | 0 |
| 654 | 1959 bldg. | 6 XRF | 2/23/97 | 15:10:32 | 1 | Classroom | 141 | Wall | Wall | Solid | Drywall | 0.08 |
| 655 | 1959 bldg. | 7 XRF | 2/23/97 | 15:12:28 | 1 | Classroom | 141 | Wall | Column | Solid | Metal | 0 |
| 656 | 1959 bldg. | 162 XRF | 2/19/97 | 22:10:32 | 1 | Classroom | 142 | Door | Door | Solid | Wood | 0 |
| 657 | 1959 bldg. | 163 XRF | 2/19/97 | 22:11:19 | 1 | Classroom | 142 | Door | Jamb | Solid | Metal | 0.08 |
| 658 | 1959 bldg. | 164 XRF | 2/19/97 | 22:12:14 | 1 | Classroom | 142 | Door | Column | Solid | Metal | 0 |
| 659 | 1959 bldg. | 160 XRF | 2/19/97 | 22:09:04 | 1 | Classroom | 142 | Wall | Midle Wall | Solid | Drywall | 0 |
| 660 | 1959 bldg. | 161 XRF | 2/19/97 | 22:09:49 | 1 | Classroom | 142 | Wall | Midle Wall | Solid | Concrete | 0 |
| 661 | 1959 bldg. | 167 XRF | 2/19/97 | 22:15:54 | 1 | Classroom | 143 | Door | Door | Solid | Wood | 0 |
| 662 | 1959 bldg. | 168 XRF | 2/19/97 | 22:16:38 | 1 | Classroom | 143 | Door | Jamb | Solid | Metal | 0.09 |
| 663 | 1959 bldg. | 165 XRF | 2/19/97 | 22:14:16 | 1 | Classroom | 143 | Wall | Midle Wall | Solid | Drywall | 0 |
| 664 | 1959 bldg. | 166 XRF | 2/19/97 | 22:15:07 | 1 | Classroom | 143 | Wall | Midle Wall | Solid | Concrete | 0 |
| 665 | 1959 bldg. | 176 XRF | 2/19/97 | 22:25:02 | 1 | Classroom | 144 | Cabinet | Door | Solid | Wood | 0 |
| 666 | 1959 bldg. | 175 XRF | 2/19/97 | 22:24:06 | 1 | Classroom | 144 | Ceiling | | Solid | Plaster | 0.13 |
| 667 | 1959 bldg. | 180 XRF | 2/19/97 | 22:30:16 | 1 | Classroom | 144 | Chalkboard | Sill | Solid | Wood | 0.03 |
| 668 | 1959 bldg. | 181 XRF | 2/19/97 | 22:31:11 | 1 | Classroom | 144 | Chalkboard | Sash | Solid | Wood | 0.01 |
| 669 | 1959 bldg. | 173 XRF | 2/19/97 | 22:22:25 | 1 | Classroom | 144 | Door | Jamb | Solid | Metal | 0.28 |
| 670 | 1959 bldg. | 174 XRF | 2/19/97 | 22:23:13 | 1 | Classroom | 144 | Door | Door | Solid | Metal | 0.23 |
| 671 | 1959 bldg. | 178 XRF | 2/19/97 | 22:28:00 | 1 | Classroom | 144 | Door | Jamb | Solid | Metal | 0.19 |
| 672 | 1959 bldg. | 170 XRF | 2/19/97 | 22:19:33 | 1 | Classroom | 144 | Wall | Wall | Solid | Plaster | 0.02 |
| 673 | 1959 bldg. | 171 XRF | 2/19/97 | 22:20:40 | 1 | Classroom | 144 | Wall | Wall | Solid | Plaster | 0.05 |
| 674 | 1959 bldg. | 177 XRF | 2/19/97 | 22:26:16 | 1 | Classroom | 144 | Wall | Wall | Cracked | Plaster | 0.13 |
| 675 | 1959 bldg. | 172 XRF | 2/19/97 | 22:21:34 | 1 | Classroom | 144 | Panel | | Solid | Metal | 0 |
| 676 | 1959 bldg. | 179 XRF | 2/19/97 | 22:28:59 | 1 | Classroom | 144 | Radiator | | Solid | Metal | 0.16 |
| 677 | 1959 bldg. | 148 XRF | 2/19/97 | 21:52:12 | 2 | Classroom | 145 | Ceiling | | Solid | Plaster | 1.36 |
| 678 | 1959 bldg. | 150 XRF | 2/19/97 | 21:54:10 | 2 | Classroom | 145 | Ceiling | | Solid | Plaster | 0.29 |
| 679 | 1959 bldg. | 146 XRF | 2/19/97 | 21:50:32 | 2 | Classroom | 145 | Closet | Wall | Solid | Concrete | 0.04 |
| 680 | 1959 bldg. | 147 XRF | 2/19/97 | 21:51:23 | 2 | Classroom | 145 | Closet | Wall | Solid | Concrete | 0.08 |
| 681 | 1959 bldg. | 143 XRF | 2/19/97 | 21:46:36 | 2 | Classroom | 145 | Door | Jamb | Solid | Metal | 0.18 |

Saint Paul Public Schools
Humboldt Secondary Complex
Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | M | |
|-----|------------|-----|----------|---------|----------|-------|-----------|-------|------------|------------|-----------|-----------|---------|
| 3 | Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 682 | 1959 bldg. | 144 | XRF | 2/19/97 | 21:47:22 | 2 | Classroom | 145 | Door | Door | Solid | Metal | 0.24 |
| 683 | 1959 bldg. | 149 | XRF | 2/19/97 | 21:53:06 | 2 | Classroom | 145 | Door | Door | Solid | Metal | 0.39 |
| 684 | 1959 bldg. | 151 | XRF | 2/19/97 | 21:55:31 | 2 | Classroom | 145 | Door | Door | Solid | Metal | 0.23 |
| 685 | 1959 bldg. | 152 | XRF | 2/19/97 | 21:56:18 | 2 | Classroom | 145 | Door | Casing | Solid | Metal | 0.01 |
| 686 | 1959 bldg. | 153 | XRF | 2/19/97 | 21:57:06 | 2 | Classroom | 145 | Door | Door | Solid | Metal | 0.22 |
| 687 | 1959 bldg. | 145 | XRF | 2/19/97 | 21:49:34 | 2 | Classroom | 145 | Floor | | Peeling | Concrete | 0.14 |
| 688 | 1959 bldg. | 142 | XRF | 2/19/97 | 21:45:37 | 2 | Classroom | 145 | Unlisted | Wall | Solid | Wood | 0.03 |
| 689 | 1959 bldg. | 139 | XRF | 2/19/97 | 21:41:24 | 2 | Classroom | 145 | Wall | Wall | Solid | Plaster | 0.1 |
| 690 | 1959 bldg. | 140 | XRF | 2/19/97 | 21:42:19 | 2 | Classroom | 145 | Wall | Midle Wall | Solid | Tile | 0.34 |
| 691 | 1959 bldg. | 141 | XRF | 2/19/97 | 21:43:23 | 2 | Classroom | 145 | Wall | Wall | Solid | Plaster | 0.36 |
| 692 | 1959 bldg. | 154 | XRF | 2/19/97 | 21:57:59 | 2 | Classroom | 145 | Radiator | Solid | Metal | 0.07 | |
| 693 | 1959 bldg. | 188 | XRF | 2/19/97 | 22:38:39 | 1 | Classroom | 151 | Chalkboard | Sash | Solid | Wood | 0 |
| 694 | 1959 bldg. | 189 | XRF | 2/19/97 | 22:39:32 | 1 | Classroom | 151 | Chalkboard | Sill | Solid | Wood | 0 |
| 695 | 1959 bldg. | 185 | XRF | 2/19/97 | 22:36:16 | 1 | Classroom | 151 | Door | Jamb | Solid | Metal | 0.36 |
| 696 | 1959 bldg. | 186 | XRF | 2/19/97 | 22:37:00 | 1 | Classroom | 151 | Door | Door | Solid | Metal | 0.22 |
| 697 | 1959 bldg. | 182 | XRF | 2/19/97 | 22:33:11 | 1 | Classroom | 151 | Wall | Wall | Solid | Plaster | 0.01 |
| 698 | 1959 bldg. | 183 | XRF | 2/19/97 | 22:34:24 | 1 | Classroom | 151 | Wall | Wall | Solid | Plaster | 0.13 |
| 699 | 1959 bldg. | 184 | XRF | 2/19/97 | 22:35:28 | 1 | Classroom | 151 | Panel | Solid | Metal | 0 | |
| 700 | 1959 bldg. | 187 | XRF | 2/19/97 | 22:37:49 | 1 | Classroom | 151 | Radiator | Peeling | Metal | 0.08 | |
| 701 | 1959 bldg. | 193 | XRF | 2/19/97 | 22:43:57 | 1 | Classroom | 153 | Door | Jamb | Solid | Metal | 0.24 |
| 702 | 1959 bldg. | 194 | XRF | 2/19/97 | 22:44:41 | 1 | Classroom | 153 | Door | Door | Solid | Metal | 0.2 |
| 703 | 1959 bldg. | 195 | XRF | 2/19/97 | 22:45:27 | 1 | Classroom | 153 | Door | Radiator | Solid | Metal | 0.1 |
| 704 | 1959 bldg. | 190 | XRF | 2/19/97 | 22:41:07 | 1 | Classroom | 153 | Wall | Wall | Solid | Plaster | 0.07 |
| 705 | 1959 bldg. | 191 | XRF | 2/19/97 | 22:41:58 | 1 | Classroom | 153 | Wall | Midle Wall | Solid | Drywall | 0.08 |
| 706 | 1959 bldg. | 192 | XRF | 2/19/97 | 22:43:02 | 1 | Classroom | 153 | Window | Casing | Solid | Metal | 0 |
| 707 | 1959 bldg. | 28 | XRF | 2/23/97 | 15:39:01 | 2 | Classroom | 229 | Door | Jamb | Solid | Metal | 0 |
| 708 | 1959 bldg. | 29 | XRF | 2/23/97 | 15:39:50 | 2 | Classroom | 229 | Door | Door | Solid | Wood | 0.05 |
| 709 | 1959 bldg. | 26 | XRF | 2/23/97 | 15:37:31 | 2 | Classroom | 229 | Wall | Wall | Solid | Drywall | 0 |
| 710 | 1959 bldg. | 27 | XRF | 2/23/97 | 15:38:17 | 2 | Classroom | 229 | Window | Casing | Solid | Metal | 0.03 |
| 711 | 1959 bldg. | 56 | XRF | 2/23/97 | 16:15:17 | 2 | Classroom | 241 | Bookcase | Shelf | Solid | Wood | 0.01 |
| 712 | 1959 bldg. | 55 | XRF | 2/23/97 | 16:14:21 | 2 | Classroom | 241 | Cabinet | Door | Solid | Wood | 0.01 |
| 713 | 1959 bldg. | 59 | XRF | 2/23/97 | 16:18:00 | 2 | Classroom | 241 | Cabinet | Door | Solid | Wood | 0.02 |
| 714 | 1959 bldg. | 57 | XRF | 2/23/97 | 16:16:11 | 2 | Classroom | 241 | Chalkboard | Sill | Solid | Wood | 0.01 |
| 715 | 1959 bldg. | 58 | XRF | 2/23/97 | 16:17:01 | 2 | Classroom | 241 | Chalkboard | Sash | Solid | Wood | 0.01 |
| 716 | 1959 bldg. | 52 | XRF | 2/23/97 | 16:11:27 | 2 | Classroom | 241 | Door | Jamb | Solid | Metal | 0.11 |
| 717 | 1959 bldg. | 53 | XRF | 2/23/97 | 16:12:20 | 2 | Classroom | 241 | Door | Door | Solid | Metal | 0.28 |
| 718 | 1959 bldg. | 54 | XRF | 2/23/97 | 16:13:22 | 2 | Classroom | 241 | Univent | | Solid | Metal | 0.11 |
| 719 | 1959 bldg. | 49 | XRF | 2/23/97 | 16:07:10 | 2 | Classroom | 241 | Wall | Wall | Solid | Plaster | 0.03 |
| 720 | 1959 bldg. | 50 | XRF | 2/23/97 | 16:08:51 | 2 | Classroom | 241 | Wall | Wall | Solid | Plaster | 0.06 |
| 721 | 1959 bldg. | 51 | XRF | 2/23/97 | 16:10:25 | 2 | Classroom | 241 | Panel | Solid | Metal | 0 | |
| 722 | 1959 bldg. | 64 | XRF | 2/23/97 | 16:25:56 | 2 | Classroom | 243 | Cabinet | Door | Solid | Wood | 0.01 |
| 723 | 1959 bldg. | 65 | XRF | 2/23/97 | 16:28:55 | 2 | Classroom | 243 | Chalkboard | Sill | Solid | Wood | 0 |
| 724 | 1959 bldg. | 66 | XRF | 2/23/97 | 16:29:53 | 2 | Classroom | 243 | Chalkboard | Sash | Solid | Wood | 0.02 |
| 725 | 1959 bldg. | 68 | XRF | 2/23/97 | 16:32:05 | 2 | Classroom | 243 | Closet | Wall | Solid | Plaster | 0 |
| 726 | 1959 bldg. | 63 | XRF | 2/23/97 | 16:24:28 | 2 | Classroom | 243 | Door | Casing | Solid | Metal | 0.14 |
| 727 | 1959 bldg. | 67 | XRF | 2/23/97 | 16:30:52 | 2 | Classroom | 243 | Univent | | Solid | Metal | 0.01 |
| 728 | 1959 bldg. | 60 | XRF | 2/23/97 | 16:20:24 | 2 | Classroom | 243 | Wall | Wall | Solid | Plaster | 0.05 |
| 729 | 1959 bldg. | 61 | XRF | 2/23/97 | 16:21:36 | 2 | Classroom | 243 | Wall | Wall | Solid | Plaster | 0.03 |
| 730 | 1959 bldg. | 62 | XRF | 2/23/97 | 16:23:12 | 2 | Classroom | 243 | Panel | Solid | Metal | 0 | |
| 731 | 1959 bldg. | 81 | XRF | 2/23/97 | 16:45:09 | 2 | Classroom | 245 | Bookcase | Shelf | Solid | Wood | 0.01 |
| 732 | 1959 bldg. | 80 | XRF | 2/23/97 | 16:44:17 | 2 | Classroom | 245 | Cabinet | Door | Solid | Wood | 0 |
| 733 | 1959 bldg. | 78 | XRF | 2/23/97 | 16:42:16 | 2 | Classroom | 245 | Chalkboard | Sill | Solid | Metal | 0.01 |
| 734 | 1959 bldg. | 79 | XRF | 2/23/97 | 16:43:10 | 2 | Classroom | 245 | Chalkboard | Sash | Solid | Wood | 0.02 |
| 735 | 1959 bldg. | 77 | XRF | 2/23/97 | 16:41:24 | 2 | Classroom | 245 | Door | Jamb | Solid | Metal | 0.11 |
| 736 | 1959 bldg. | 82 | XRF | 2/23/97 | 16:46:10 | 2 | Classroom | 245 | Univent | | Solid | Metal | 0.06 |
| 737 | 1959 bldg. | 74 | XRF | 2/23/97 | 16:38:30 | 2 | Classroom | 245 | Wall | Wall | Solid | Plaster | 0.04 |
| 738 | 1959 bldg. | 75 | XRF | 2/23/97 | 16:39:29 | 2 | Classroom | 245 | Wall | Wall | Solid | Plaster | 0.02 |
| 739 | 1959 bldg. | 76 | XRF | 2/23/97 | 16:40:15 | 2 | Classroom | 245 | Panel | Solid | Wood | 0 | |
| 740 | 1959 bldg. | 92 | XRF | 2/23/97 | 16:58:01 | 2 | Classroom | 246 | Chalkboard | Sill | Solid | Wood | 0 |
| 741 | 1959 bldg. | 93 | XRF | 2/23/97 | 16:58:47 | 2 | Classroom | 246 | Chalkboard | Sash | Solid | Wood | 0 |
| 742 | 1959 bldg. | 90 | XRF | 2/23/97 | 16:55:50 | 2 | Classroom | 246 | Closet | Wall | Solid | Plaster | 0.05 |
| 743 | 1959 bldg. | 91 | XRF | 2/23/97 | 16:56:42 | 2 | Classroom | 246 | Closet | Shelf | Solid | Wood | 0.04 |
| 744 | 1959 bldg. | 89 | XRF | 2/23/97 | 16:54:21 | 2 | Classroom | 246 | Door | Jamb | Solid | Metal | 0.13 |
| 745 | 1959 bldg. | 83 | XRF | 2/23/97 | 16:48:15 | 2 | Classroom | 246 | Wall | Wall | Solid | Plaster | 0.01 |
| 746 | 1959 bldg. | 84 | XRF | 2/23/97 | 16:49:34 | 2 | Classroom | 246 | Wall | Wall | Solid | | 0.14 |
| 747 | 1959 bldg. | 85 | XRF | 2/23/97 | 16:50:15 | 2 | Classroom | 246 | Wall | Wall | Solid | | 0.02 |
| 748 | 1959 bldg. | 86 | XRF | 2/23/97 | 16:51:19 | 2 | Classroom | 246 | Wall | Wall | Solid | Metal | 0 |
| 749 | 1959 bldg. | 87 | XRF | 2/23/97 | 16:52:14 | 2 | Classroom | 246 | Wall | Baseboard | Peeling | Wood | 0.04 |

Saint Paul Public Schools
Humboldt Secondary Complex
Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | M |
|------|------------|----------|---------|----------|-------|-----------|-------|------------|------------|-----------|-----------|---------|
| Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 750 | 1959 bldg. | 88 XRF | 2/23/97 | 16:53:24 | 2 | Classroom | 246 | Panel | Solid | Wood | | 0 |
| 751 | 1959 bldg. | 94 XRF | 2/23/97 | 16:59:35 | 2 | Classroom | 246 | Radiator | Solid | Metal | | 0.02 |
| 752 | 1959 bldg. | 110 XRF | 2/23/97 | 17:17:31 | 2 | Classroom | 248 | Bookcase | Shelf | Solid | Wood | 0.02 |
| 753 | 1959 bldg. | 108 XRF | 2/23/97 | 17:16:57 | 2 | Classroom | 248 | Chalkboard | Sill | Solid | Wood | 0 |
| 754 | 1959 bldg. | 109 XRF | 2/23/97 | 17:16:45 | 2 | Classroom | 248 | Chalkboard | Sash | Solid | Wood | 0.01 |
| 755 | 1959 bldg. | 107 XRF | 2/23/97 | 17:15:04 | 2 | Classroom | 248 | Door | Jamb | Solid | Metal | 0.1 |
| 756 | 1959 bldg. | 103 XRF | 2/23/97 | 17:10:53 | 2 | Classroom | 248 | Wall | Wall | Solid | Plaster | 0.08 |
| 757 | 1959 bldg. | 104 XRF | 2/23/97 | 17:11:50 | 2 | Classroom | 248 | Wall | Midle Wall | Solid | Metal | 0 |
| 758 | 1959 bldg. | 105 XRF | 2/23/97 | 17:12:46 | 2 | Classroom | 248 | Wall | Wall | Solid | Plaster | 0.02 |
| 759 | 1959 bldg. | 106 XRF | 2/23/97 | 17:14:10 | 2 | Classroom | 248 | Wall | Wall Rgstr | Solid | Metal | 0.01 |
| 760 | 1959 bldg. | 111 XRF | 2/23/97 | 17:18:28 | 2 | Classroom | 248 | Radiator | Solid | Metal | | 0.01 |
| 761 | 1959 bldg. | 126 XRF | 2/19/97 | 21:25:50 | 2 | Hall | 1 | Ceiling | | Solid | Plaster | 0 |
| 762 | 1959 bldg. | 132 XRF | 2/19/97 | 21:33:11 | 2 | Hall | 1 | Closet | Wall | Peeling | Plaster | 0.22 |
| 763 | 1959 bldg. | 133 XRF | 2/19/97 | 21:34:10 | 2 | Hall | 1 | Closet | Casing | Solid | Metal | 0.11 |
| 764 | 1959 bldg. | 121 XRF | 2/19/97 | 21:19:12 | 2 | Hall | 1 | Door | Casing | Solid | Metal | 0.04 |
| 765 | 1959 bldg. | 122 XRF | 2/19/97 | 21:19:59 | 2 | Hall | 1 | Door | Door | Solid | Metal | 0 |
| 766 | 1959 bldg. | 123 XRF | 2/19/97 | 21:20:55 | 2 | Hall | 1 | Door | Door | Solid | Metal | 0.04 |
| 767 | 1959 bldg. | 128 XRF | 2/19/97 | 21:28:22 | 2 | Hall | 1 | Door | Door | Solid | Metal | 0.21 |
| 768 | 1959 bldg. | 130 XRF | 2/19/97 | 21:31:10 | 2 | Hall | 1 | Door | Door | Solid | Metal | 0.09 |
| 769 | 1959 bldg. | 131 XRF | 2/19/97 | 21:31:55 | 2 | Hall | 1 | Door | Jamb | Solid | Metal | 0.07 |
| 770 | 1959 bldg. | 120 XRF | 2/19/97 | 21:12:39 | 2 | Hall | 1 | Wall | Wall | Solid | Concrete | 0.06 |
| 771 | 1959 bldg. | 124 XRF | 2/19/97 | 21:22:01 | 2 | Hall | 1 | Wall | Wall | Solid | Plaster | 0.02 |
| 772 | 1959 bldg. | 125 XRF | 2/19/97 | 21:22:54 | 2 | Hall | 1 | Wall | Midle Wall | Solid | Tile | 0.25 |
| 773 | 1959 bldg. | 169 XRF | 2/19/97 | 22:18:03 | 1 | Hall | 1 | Window | Casing | Solid | Wood | 0.01 |
| 774 | 1959 bldg. | 127 XRF | 2/19/97 | 21:27:28 | 2 | Hall | 1 | Locker | Solid | Metal | | 0.03 |
| 775 | 1959 bldg. | 129 XRF | 2/19/97 | 21:29:34 | 2 | Hall | 1 | Panel | Solid | Metal | | 0 |
| 776 | 1959 bldg. | 39 XRF | 2/23/97 | 15:52:10 | 2 | Hall | 2 | Ceiling | | Solid | Plaster | 0 |
| 777 | 1959 bldg. | 42 XRF | 2/23/97 | 15:57:32 | 2 | Hall | 2 | Closet | Wall | Solid | Plaster | 0.13 |
| 778 | 1959 bldg. | 43 XRF | 2/23/97 | 15:58:50 | 2 | Hall | 2 | Closet | Casing | Solid | Metal | 0.13 |
| 779 | 1959 bldg. | 32 XRF | 2/23/97 | 15:43:58 | 2 | Hall | 2 | Door | Jamb | Solid | Metal | 0.14 |
| 780 | 1959 bldg. | 33 XRF | 2/23/97 | 15:44:44 | 2 | Hall | 2 | Door | Door | Solid | Metal | 0.3 |
| 781 | 1959 bldg. | 71 XRF | 2/23/97 | 16:35:19 | 2 | Hall | 2 | Door | Door | Solid | Metal | 0.12 |
| 782 | 1959 bldg. | 72 XRF | 2/23/97 | 16:36:02 | 2 | Hall | 2 | Door | Jamb | Solid | Metal | 0.08 |
| 783 | 1959 bldg. | 73 XRF | 2/23/97 | 16:36:58 | 2 | Hall | 2 | Door | Locker | Solid | Metal | 0.01 |
| 784 | 1959 bldg. | 30 XRF | 2/23/97 | 15:41:56 | 2 | Hall | 2 | Wall | Wall | Peeling | Plaster | 0.06 |
| 785 | 1959 bldg. | 31 XRF | 2/23/97 | 15:42:51 | 2 | Hall | 2 | Wall | Wall | Solid | Concrete | 0.03 |
| 786 | 1959 bldg. | 40 XRF | 2/23/97 | 15:53:58 | 2 | Hall | 2 | Wall | Wall | Solid | Tile | 0.23 |
| 787 | 1959 bldg. | 41 XRF | 2/23/97 | 15:55:10 | 2 | Hall | 2 | Window | Casing | Solid | Metal | 0.15 |
| 788 | 1959 bldg. | 24 XRF | 2/23/97 | 15:35:03 | 2 | Library | 1 | Bookcase | Inside | Solid | Wood | 0.01 |
| 789 | 1959 bldg. | 25 XRF | 2/23/97 | 15:36:19 | 2 | Library | 1 | Bookcase | Shelf | Solid | | 0.01 |
| 790 | 1959 bldg. | 23 XRF | 2/23/97 | 15:34:01 | 2 | Library | 1 | Cabinet | Outside | Solid | Wood | 0 |
| 791 | 1959 bldg. | 19 XRF | 2/23/97 | 15:30:20 | 2 | Library | 1 | Door | Jamb | Solid | Metal | 0.03 |
| 792 | 1959 bldg. | 20 XRF | 2/23/97 | 15:31:08 | 2 | Library | 1 | Door | Door | Solid | Wood | 0.01 |
| 793 | 1959 bldg. | 21 XRF | 2/23/97 | 15:31:57 | 2 | Library | 1 | Door | Column | Solid | Metal | 0 |
| 794 | 1959 bldg. | 22 XRF | 2/23/97 | 15:33:00 | 2 | Library | 1 | Door | Door | Solid | Metal | 0.01 |
| 795 | 1959 bldg. | 15 XRF | 2/23/97 | 15:25:58 | 2 | Library | 1 | Wall | Wall | Solid | Drywall | 0.09 |
| 796 | 1959 bldg. | 16 XRF | 2/23/97 | 15:26:57 | 2 | Library | 1 | Wall | Midle Wall | Solid | Drywall | 0 |
| 797 | 1959 bldg. | 17 XRF | 2/23/97 | 15:28:31 | 2 | Library | 1 | Wall | Wall | Solid | Drywall | 0 |
| 798 | 1959 bldg. | 18 XRF | 2/23/97 | 15:29:20 | 2 | Library | 1 | Window | Casing | Solid | Metal | 0 |
| 799 | 1959 bldg. | 47 XRF | 2/23/97 | 16:03:48 | 2 | Other | 241 | Ceiling | | Solid | Plaster | 0 |
| 800 | 1959 bldg. | 45 XRF | 2/23/97 | 16:01:14 | 2 | Other | 241 | Door | Door | Solid | Metal | 0.13 |
| 801 | 1959 bldg. | 46 XRF | 2/23/97 | 16:01:59 | 2 | Other | 241 | Door | Jamb | Solid | Metal | 0.09 |
| 802 | 1959 bldg. | 44 XRF | 2/23/97 | 16:00:16 | 2 | Other | 241 | Wall | Wall | Solid | Plaster | 0.06 |
| 803 | 1959 bldg. | 48 XRF | 2/23/97 | 16:05:33 | 2 | Other | 241 | Radiator | Solid | Metal | | 0.02 |
| 804 | 1959 bldg. | 102 XRF | 2/23/97 | 17:09:16 | 2 | Other | 247 | Cabinet | Door | Solid | Wood | 0.01 |
| 805 | 1959 bldg. | 99 XRF | 2/23/97 | 17:06:20 | 2 | Other | 247 | Closet | Shelf | Solid | Wood | 0.01 |
| 806 | 1959 bldg. | 101 XRF | 2/23/97 | 17:08:29 | 2 | Other | 247 | Door | Casing | Solid | Wood | 0.1 |
| 807 | 1959 bldg. | 100 XRF | 2/23/97 | 17:07:22 | 2 | Other | 247 | Unlisted | Shelf | Solid | Wood | 0 |
| 808 | 1959 bldg. | 95 XRF | 2/23/97 | 17:01:54 | 2 | Other | 247 | Wall | Wall | Solid | Plaster | 0.68 |
| 809 | 1959 bldg. | 96 XRF | 2/23/97 | 17:03:07 | 2 | Other | 247 | Wall | Wall | Cracked | Plaster | 0.03 |
| 810 | 1959 bldg. | 97 XRF | 2/23/97 | 17:04:04 | 2 | Other | 247 | Wall | Midle Wall | Solid | Metal | 0.01 |
| 811 | 1959 bldg. | 98 XRF | 2/23/97 | 17:05:25 | 2 | Other | 247 | Wall | Wall | Peeling | Plaster | 0.05 |
| 812 | 1959 bldg. | 177 XRF | 2/23/97 | 20:05:45 | 1 | Outside | 0 | Door | Door | Solid | Metal | 0 |
| 813 | 1959 bldg. | 179 XRF | 2/23/97 | 20:09:28 | 1 | Outside | 0 | Door | Jamb | Solid | Metal | 0 |
| 814 | 1959 bldg. | 180 XRF | 2/23/97 | 20:56:38 | 1 | Outside | 0 | Door | Jamb | Solid | | 0.01 |
| 815 | 1959 bldg. | 178 XRF | 2/23/97 | 20:07:00 | 1 | Outside | 0 | Ext Wall | Corner brd | Solid | Concrete | 0 |
| 816 | 1959 bldg. | 136 XRF | 2/19/97 | 21:37:45 | 2 | Restroom | 1 | Ceiling | | Solid | Plaster | 0.2 |
| 817 | 1959 bldg. | 138 XRF | 2/19/97 | 21:39:42 | 2 | Restroom | 1 | Door | Door | Solid | Wood | 0 |

Saint Paul Public Schools
Humboldt Secondary Complex
Lead-Based Paint Inspection

| A | B | C | D | E | F | G | H | I | J | K | L | M |
|----------------|------|----------|---------|----------|-------|-----------|-------|-----------|-------------|-----------|-----------|---------|
| Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 818 1959 bldg. | 134 | XRF | 2/19/97 | 21:35:46 | 2 | Restroom | 1 | Wall | Wall | Solid | Tile | 0.35 |
| 819 1959 bldg. | 135 | XRF | 2/19/97 | 21:36:44 | 2 | Restroom | 1 | Wall | Wall | Solid | Plaster | 0.15 |
| 820 1959 bldg. | 137 | XRF | 2/19/97 | 21:38:45 | 2 | Restroom | 1 | | Radiator | Solid | Metal | 0.01 |
| 821 1959 bldg. | 70 | XRF | 2/23/97 | 16:34:12 | 2 | Restroom | 2 | Ceiling | | Solid | Plaster | 0.13 |
| 822 1959 bldg. | 69 | XRF | 2/23/97 | 16:33:19 | 2 | Restroom | 2 | Wall | Middle Wall | Solid | Stucco | 0.55 |
| 823 1959 bldg. | 14 | XRF | 2/23/97 | 15:22:34 | 2 | Stairwell | 1 | Ceiling | | Solid | Drywall | 0 |
| 824 1959 bldg. | 10 | XRF | 2/23/97 | 15:18:06 | 2 | Stairwell | 1 | Stairs | Wall | Solid | Concrte | 0 |
| 825 1959 bldg. | 11 | XRF | 2/23/97 | 15:18:57 | 2 | Stairwell | 1 | Stairs | Baseboard | Solid | Metal | 0.03 |
| 826 1959 bldg. | 12 | XRF | 2/23/97 | 15:19:49 | 2 | Stairwell | 1 | Stairs | Riser | Solid | Metal | 0.01 |
| 827 1959 bldg. | 13 | XRF | 2/23/97 | 15:20:42 | 2 | Stairwell | 1 | Stairs | Hand rail | Solid | Metal | 0.01 |
| 828 1959 bldg. | 38 | XRF | 2/23/97 | 15:50:31 | 2 | Stairwell | 2 | Ceiling | | Solid | Concrte | 0 |
| 829 1959 bldg. | 34 | XRF | 2/23/97 | 15:46:03 | 2 | Stairwell | 2 | Stairs | Hand rail | Solid | Metal | 0.02 |
| 830 1959 bldg. | 35 | XRF | 2/23/97 | 15:47:01 | 2 | Stairwell | 2 | Stairs | Baseboard | Solid | Metal | 0.01 |
| 831 1959 bldg. | 36 | XRF | 2/23/97 | 15:47:45 | 2 | Stairwell | 2 | Stairs | Wall | Solid | Concrte | 0 |
| 832 1959 bldg. | 37 | XRF | 2/23/97 | 15:48:33 | 2 | Stairwell | 2 | Stairs | Riser | Solid | Metal | 0.02 |
| 833 1976 bldg. | 156 | XRF | 2/23/97 | 18:24:39 | 1 | Gym | 1 | Door | Casing | Solid | Metal | 0.04 |
| 834 1976 bldg. | 157 | XRF | 2/23/97 | 18:25:23 | 1 | Gym | 1 | Door | Door | Solid | Wood | 0 |
| 835 1976 bldg. | 158 | XRF | 2/23/97 | 18:26:30 | 1 | Gym | 1 | Door | Door | Solid | Metal | 0.04 |
| 836 1976 bldg. | 159 | XRF | 2/23/97 | 18:31:20 | 1 | Gym | 1 | Door | Backboard | Solid | Metal | 0 |
| 837 1976 bldg. | 152 | XRF | 2/23/97 | 18:21:20 | 1 | Gym | 1 | Floor | | Solid | Wood | 0 |
| 838 1976 bldg. | 153 | XRF | 2/23/97 | 18:22:16 | 1 | Gym | 1 | Wall | Wall | Solid | Concrte | 0.04 |
| 839 1976 bldg. | 154 | XRF | 2/23/97 | 18:22:59 | 1 | Gym | 1 | Wall | Wall | Solid | Concrte | 0 |
| 840 1976 bldg. | 155 | XRF | 2/23/97 | 18:23:44 | 1 | Gym | 1 | Wall | Wall | Solid | Concrte | 0 |
| 841 1976 bldg. | 114 | XRF | 2/23/97 | 17:32:51 | 1 | Hall | 1 | Ceiling | | Solid | Metal | 0 |
| 842 1976 bldg. | 117 | XRF | 2/23/97 | 17:35:35 | 1 | Hall | 1 | Door | Door | Peeling | Metal | 0.01 |
| 843 1976 bldg. | 118 | XRF | 2/23/97 | 17:36:36 | 1 | Hall | 1 | Door | Column | Solid | Concrte | 0.07 |
| 844 1976 bldg. | 112 | XRF | 2/23/97 | 17:31:02 | 1 | Hall | 1 | Wall | Wall | Solid | Concrte | 0.02 |
| 845 1976 bldg. | 113 | XRF | 2/23/97 | 17:31:58 | 1 | Hall | 1 | Wall | Baseboard | Solid | Concrte | 0.09 |
| 846 1976 bldg. | 119 | XRF | 2/23/97 | 17:37:41 | 1 | Hall | 1 | Wall | Midle Wall | Solid | Concrte | 0.09 |
| 847 1976 bldg. | 115 | XRF | 2/23/97 | 17:33:47 | 1 | Hall | 1 | Window | Casing | Solid | Metal | 0.01 |
| 848 1976 bldg. | 116 | XRF | 2/23/97 | 17:34:43 | 1 | Hall | 1 | | Panel | Solid | Wood | 0.01 |
| 849 1976 bldg. | 128 | XRF | 2/23/97 | 17:52:06 | 1 | Other | 161 | Ceiling | | Solid | Plaster | 0.07 |
| 850 1976 bldg. | 129 | XRF | 2/23/97 | 17:53:26 | 1 | Other | 161 | Ceiling | | Solid | Concrte | 0 |
| 851 1976 bldg. | 135 | XRF | 2/23/97 | 18:00:02 | 1 | Other | 161 | Door | Jamb | Solid | Metal | 0 |
| 852 1976 bldg. | 136 | XRF | 2/23/97 | 18:00:58 | 1 | Other | 161 | Door | Door | Solid | Wood | 0 |
| 853 1976 bldg. | 125 | XRF | 2/23/97 | 17:46:21 | 1 | Other | 161 | Wall | Wall | Solid | Concrte | 0 |
| 854 1976 bldg. | 126 | XRF | 2/23/97 | 17:49:49 | 1 | Other | 161 | Wall | Wall | Solid | Tile | 0.24 |
| 855 1976 bldg. | 127 | XRF | 2/23/97 | 17:50:40 | 1 | Other | 161 | Wall | Wall | Solid | Tile | 0 |
| 856 1976 bldg. | 134 | XRF | 2/23/97 | 17:59:00 | 1 | Other | 161 | Wall | Midle Wall | Solid | Concrte | 0.03 |
| 857 1976 bldg. | 130 | XRF | 2/23/97 | 17:55:27 | 1 | Other | 161 | | Locker | Solid | Metal | 0.59 |
| 858 1976 bldg. | 131 | XRF | 2/23/97 | 17:56:13 | 1 | Other | 161 | | Locker | Solid | Metal | 0.03 |
| 859 1976 bldg. | 132 | XRF | 2/23/97 | 17:57:01 | 1 | Other | 161 | | Locker | Solid | Metal | 1.06 |
| 860 1976 bldg. | 133 | XRF | 2/23/97 | 17:57:47 | 1 | Other | 161 | | Locker | Solid | Metal | 0.74 |
| 861 1976 bldg. | 146 | XRF | 2/23/97 | 18:11:46 | 1 | Other | 171 | Ceiling | | Solid | Plaster | 0 |
| 862 1976 bldg. | .147 | XRF | 2/23/97 | 18:13:16 | 1 | Other | 171 | Ceiling | | Solid | Concrte | 0 |
| 863 1976 bldg. | 138 | XRF | 2/23/97 | 18:04:26 | 1 | Other | 171 | Door | Jamb | Solid | Metal | 0.01 |
| 864 1976 bldg. | 139 | XRF | 2/23/97 | 18:05:06 | 1 | Other | 171 | Door | Door | Solid | Wood | 0 |
| 865 1976 bldg. | 137 | XRF | 2/23/97 | 18:03:38 | 1 | Other | 171 | Wall | Wall | Solid | Concrte | 0.01 |
| 866 1976 bldg. | 144 | XRF | 2/23/97 | 18:09:29 | 1 | Other | 171 | Wall | Midle Wall | Solid | Tile | 0 |
| 867 1976 bldg. | 145 | XRF | 2/23/97 | 18:10:20 | 1 | Other | 171 | Wall | Midle Wall | Solid | Tile | 0.2 |
| 868 1976 bldg. | 140 | XRF | 2/23/97 | 18:05:59 | 1 | Other | 171 | | Locker | Solid | Metal | 0.66 |
| 869 1976 bldg. | 141 | XRF | 2/23/97 | 18:06:52 | 1 | Other | 171 | | Locker | Solid | Metal | 0.7 |
| 870 1976 bldg. | 142 | XRF | 2/23/97 | 18:07:41 | 1 | Other | 171 | | Locker | Solid | Metal | 0.02 |
| 871 1976 bldg. | 143 | XRF | 2/23/97 | 18:08:32 | 1 | Other | 171 | | Locker | Solid | Metal | 1.08 |
| 872 1976 bldg. | 173 | XRF | 2/23/97 | 19:59:08 | 1 | Outside | 0 | Door | Door | Cracked | Metal | 0.02 |
| 873 1976 bldg. | 174 | XRF | 2/23/97 | 20:00:10 | 1 | Outside | 0 | Window | Sash | Peeling | Metal | 0.01 |
| 874 1976 bldg. | 122 | XRF | 2/23/97 | 17:42:00 | 1 | Restroom | 1 | Ceiling | | Solid | Plaster | 0.01 |
| 875 1976 bldg. | 120 | XRF | 2/23/97 | 17:39:11 | 1 | Restroom | 1 | Wall | Wall | Solid | Concrte | 0.01 |
| 876 1976 bldg. | 121 | XRF | 2/23/97 | 17:40:03 | 1 | Restroom | 1 | Wall | Midle Wall | Solid | Concrte | 0 |
| 877 1976 bldg. | 123 | XRF | 2/23/97 | 17:43:48 | 1 | Restroom | 1 | | Stall Door | Solid | Metal | 0.46 |
| 878 1976 bldg. | 124 | XRF | 2/23/97 | 17:44:32 | 1 | Restroom | 1 | | Bthrm Stll | Solid | Metal | 0.01 |
| 879 1976 bldg. | 151 | XRF | 2/23/97 | 18:19:00 | 1 | Restroom | 2 | Ceiling | | Solid | Plaster | 0 |
| 880 1976 bldg. | 148 | XRF | 2/23/97 | 18:15:55 | 1 | Restroom | 2 | Wall | Wall | Solid | Concrte | 0.08 |
| 881 1976 bldg. | 149 | XRF | 2/23/97 | 18:16:40 | 1 | Restroom | 2 | Wall | Wall | Solid | Concrte | 0.01 |
| 882 1976 bldg. | 150 | XRF | 2/23/97 | 18:17:29 | 1 | Restroom | 2 | Wall | Stall Door | Solid | Metal | 0.42 |
| 883 1976 bldg. | 183 | XRF | 2/23/97 | 21:00:22 | 1 | Cafeteria | 1 | Door | Jamb | Solid | Metal | 0.02 |
| 884 1976 bldg. | 184 | XRF | 2/23/97 | 21:01:05 | 1 | Cafeteria | 1 | Door | Door | Solid | Wood | 0 |
| 885 1976 bldg. | 187 | XRF | 2/23/97 | 21:06:21 | 1 | Cafeteria | 1 | Rollodown | Door | Peeling | Metal | 0.44 |

Saint Paul Public Schools
 Humboldt Secondary Complex
 Lead-Based Paint Inspection

| | A | B | C | D | E | F | G | H | I | J | K | L | M |
|-----|------------|-----|----------|---------|----------|-------|-----------|-------|-----------|------------|-----------|-----------|---------|
| 3 | Site | No | Analysis | Date | Time | Floor | Area | Room# | Component | Feature | Condition | Substrate | Results |
| 886 | 1976 bldg. | 181 | XRF | 2/23/97 | 20:58:29 | 1 | Cafeteria | 1 | Wall | Wall | Solid | Concrete | 0.02 |
| 887 | 1976 bldg. | 182 | XRF | 2/23/97 | 20:59:19 | 1 | Cafeteria | 1 | Wall | Midle Wall | Solid | Concrete | 0 |
| 888 | 1976 bldg. | 185 | XRF | 2/23/97 | 21:03:29 | 1 | Cafeteria | 1 | Wall | Wall | Solid | Drywall | 0 |
| 889 | 1976 bldg. | 186 | XRF | 2/23/97 | 21:05:27 | 1 | Cafeteria | 1 | Wall | Midle Wall | Solid | Concrete | 0.02 |
| 890 | 1976 bldg. | 195 | XRF | 2/23/97 | 21:18:59 | 1 | Gym | 1 | Closet | Wall | Solid | Concrete | 0.01 |
| 891 | 1976 bldg. | 194 | XRF | 2/23/97 | 21:17:55 | 1 | Gym | 1 | Door | Door | Solid | Metal | 1.73 |
| 892 | 1976 bldg. | 197 | XRF | 2/23/97 | 21:23:30 | 1 | Gym | 1 | Door | Door | Solid | Metal | 1.69 |
| 893 | 1976 bldg. | 190 | XRF | 2/23/97 | 21:12:47 | 1 | Gym | 1 | Wall | Wall | Solid | Concrete | 0.01 |
| 894 | 1976 bldg. | 191 | XRF | 2/23/97 | 21:13:41 | 1 | Gym | 1 | Wall | Midle Wall | Solid | Concrete | 0.01 |
| 895 | 1976 bldg. | 196 | XRF | 2/23/97 | 21:22:31 | 1 | Gym | 1 | Wall | Wall | Solid | Concrete | 0 |
| 896 | 1976 bldg. | 192 | XRF | 2/23/97 | 21:15:21 | 1 | Gym | 1 | Window | Casing | Peeling | Metal | 0 |
| 897 | 1976 bldg. | 193 | XRF | 2/23/97 | 21:16:32 | 1 | Gym | 1 | Window | Stool | Peeling | Concrete | 0.06 |
| 898 | 1976 bldg. | 188 | XRF | 2/23/97 | 21:08:37 | 1 | Other | 39 | Wall | Wall | Solid | Concrete | 0 |
| 899 | 1976 bldg. | 189 | XRF | 2/23/97 | 21:09:32 | 1 | Other | 39 | Wall | Baseboard | Solid | Tile | 0 |
| 900 | 1976 bldg. | 203 | XRF | 2/23/97 | 21:30:54 | 1 | Restroom | 1 | Ceiling | | Solid | Concrete | 0 |
| 901 | 1976 bldg. | 204 | XRF | 2/23/97 | 21:31:24 | 1 | Restroom | 1 | Ceiling | | Solid | | 0 |
| 902 | 1976 bldg. | 198 | XRF | 2/23/97 | 21:25:00 | 1 | Restroom | 1 | Wall | Wall | Solid | Concrete | 0.01 |
| 903 | 1976 bldg. | 199 | XRF | 2/23/97 | 21:26:05 | 1 | Restroom | 1 | Wall | Midle Wall | Solid | Concrete | 0 |
| 904 | 1976 bldg. | 200 | XRF | 2/23/97 | 21:27:20 | 1 | Restroom | 1 | Locker | Solid | Metal | 0.51 | |
| 905 | 1976 bldg. | 201 | XRF | 2/23/97 | 21:28:13 | 1 | Restroom | 1 | Locker | Solid | Metal | 1.01 | |
| 906 | 1976 bldg. | 202 | XRF | 2/23/97 | 21:29:07 | 1 | Restroom | 1 | Locker | Peeling | Metal | 0.01 | |
| 907 | 1976 bldg. | 206 | XRF | 2/23/97 | 21:35:19 | 1 | Restroom | 2 | Ceiling | Peeling | Concrete | 0 | |
| 908 | 1976 bldg. | 207 | XRF | 2/23/97 | 21:36:38 | 1 | Restroom | 2 | Door | Jamb | Solid | Metal | 0.01 |
| 909 | 1976 bldg. | 208 | XRF | 2/23/97 | 21:37:25 | 1 | Restroom | 2 | Door | Door | Solid | Wood | 0 |
| 910 | 1976 bldg. | 205 | XRF | 2/23/97 | 21:34:18 | 1 | Restroom | 2 | Wall | Wall | Solid | Concrete | 0.01 |
| 911 | 1976 bldg. | 209 | XRF | 2/23/97 | 21:38:30 | 1 | Restroom | 2 | Locker | Solid | Metal | 0.43 | |
| 912 | 1976 bldg. | 210 | XRF | 2/23/97 | 21:39:18 | 1 | Restroom | 2 | Locker | Solid | Metal | 1.06 | |
| 913 | 1976 bldg. | 211 | XRF | 2/23/97 | 21:40:07 | 1 | Restroom | 2 | Locker | Peeling | Metal | 0.02 | |

APPENDIX B

LABORATORY SAMPLE ANALYSIS DATA

LABORATORY ANALYSIS REPORT**DATE:** March 11, 1997**PAGE:**

1 Of 2

CLIENT: Midwest Environmental Cons.
5385 401st Ave. NW
Dalbo, MN 55017**PROJECT NO.:** 030697-200888
COLLECTION DATE: 2/11-23/97
COLLECTED BY: Client
RECEIVED DATE: 3/06/97
PROJECT DESCRIPT.: 62/0197F Humbolt S.H.**CONTACT:** Greg Myers/Richard Cox

| SAMPLE # | DESCP. | MDL | LEAD (6010A) | ANALYSIS | DATE |
|-----------------|---------------|------------|------------------------|-----------------|-------------|
| | | | RESULTS | | |
| L971196-1 | 41 | 21 | 10,000 | | 3/10/97 |
| L971196-2 | 42 | 19 | 1500 | | 3/10/97 |
| L971196-3 | 71 | 32 | 7100 | | 3/10/97 |
| L971196-4 | 90 | 19 | 820 | | 3/10/97 |
| L971196-5 | 91 | 66 | 2200 | | 3/10/97 |
| L971196-6 | 154 | 16 | 2800 | | 3/10/97 |
| L971196-7 | 9 | 21 | 2700 | | 3/10/97 |
| L971196-8 | 12 | 31 | 4800 | | 3/10/97 |
| L971196-9 | 73 | 27 | 3600 | | 3/10/97 |
| L971196-10 | 106 | 27 | 1300 | | 3/10/97 |
| L971196-11 | 107 | 24 | 2400 | | 3/10/97 |
| L971196-12 | 10 | 43 | 3500 | | 3/10/97 |
| L971196-13 | 15 | 25 | 380 | | 3/10/97 |
| L971196-14 | 40 | 44 | 2600 | | 3/10/97 |
| L971196-15 | 58 | 29 | 6400 | | 3/10/97 |
| L971196-16 | 70 | 18 | 2400 | | 3/10/97 |
| L971196-17 | 160 | 35 | ND | | 3/10/97 |
| L971196-18 | 172 | 30 | 5500 | | 3/10/97 |
| L971196-19 | 227 | 42 | 1200 | | 3/10/97 |
| L971196-20 | 112 | 23 | 3200 | | 3/10/97 |

*ND means Not Detected or below reported MDL**MDL means Method Detection Limit**mg/kg means Milligrams Per Kilogram which is equivalent to Parts Per Million (ppm)**As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.*

A member of The Marmon Group of Companies

SPECTRUM

L A B O R A T O R Y

301 West County Road E2 • St. Paul, MN 55112
(612) 633-0101 • FAX (612) 633-1402

LABORATORY ANALYSIS REPORT

| | | | |
|----------|--|------------------|-----------------------|
| DATE: | March 11, 1997 | PAGE: | 2 Of 2 |
| CLIENT: | Midwest Environmental Cons. 5385 401st Ave. NW Dalbo, MN 55017 | PROJECT NO.: | 030697-200888 |
| CONTACT: | Greg Myers/Richard Cox | COLLECTION DATE: | 2/11-23/97 |
| | | COLLECTED BY: | Client |
| | | RECEIVED DATE: | 3/06/97 |
| | | PROJECT DESCRP.: | 62/0197F Humbolt S.H. |

This report has been reviewed by me for technical accuracy and completeness. The analyses were performed using EPA or other approved methodologies and the results were reported on an "as received" basis unless otherwise noted. Organic soil analyses were reported on a dry weight basis. The results reported relate only to the items tested. Please contact me if you have any questions or comments regarding this report. Spectrum Labs, Inc. appreciates the opportunity to provide this analytical service for you.

Report Submitted By,

Thomas L. Halverson (Robert Rossini)

Thomas L. Halverson
Laboratory Manager

TLH:wmc
mec070-1

As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.



A member of The Marmon Group of Companies

Midwest Environmental Consulting, L.L.C.

5385 401st Ave. NW, Dalbo, MN 55017
612-689-3612/612-757-5541/FAX-612-689-5209

Client Address St. Paul
Contact Richard G.

CHAIN OF CUSTODY RECORD

Project Number 62/0197F

Client

Project Humboldt S.H. Paint chips.
Phone/Fax _____

| Sample ID | Sample Description | Collection Date/Time | Matrix | Analysis Requested |
|-----------------------|---|----------------------|---------------|--------------------|
| 723/97 62/0197F-41 | Site 2 Floor 2 Hall 2 window brown | 2/23/97 | 2 1/2" X 1" V | 11010-1 |
| 62/0197F-42 | " " " Closet side D white | 2/11 | | |
| 62/0197F-71 | " " " closet door brown | 4 | | 2 |
| 62/0197F-90 | " " " room 246 plaster wall top | 11 | | 3 |
| 62/0197F-91 | " " " room 246 plaster wall top | 4 | | 4 |
| 62/0197F-154 | " " " floor 1 room 145 plaster midline | 2/13/97 | | 5 |
| 62/0197F-9 | Site 1 floor 1-2 Stair 2 concrete | 11 | | 6 |
| 62/0197F-12 | " " " 1st floor 1-2 Stair 2 stair nos. grey | 11 | | 7 |
| 62/0197F-73 | Site 1 Gym 1 wood door casing brown | 11 | | 8 |
| 62/0197F-106 | " " " Gym 2 wood door casing brown | 11 | | 9 |
| 62/0197F-107 | " " " Room 192 metal door | 11 | | 10 |
| 62/0197F-10 | " " " 202B window casing | 11 | | 11 |
| 62/0197F-15 | " " " 202A metal door white | 2/13/97 | | 12 |
| 62/0197F-17 | " " " 203 metal door brown | 11 | | 13 |
| | | | | 14 |

Sampled By: L.G. Date: 3/15/97 Time: _____ Received By: D.C. Date: 3/19/97 Time: _____

Received By: John Date: 3/19/97 Time: _____ Delivered By: _____ Date: _____ Time: _____

Received By Lab: Humboldt Date: 3/19/97 Time: 14:45 Disposition of Samples _____

Notes: _____



Midwest Environmental Consulting, L.L.C.

5385 401st Ave. NW, Dalbo, MN 55017
612-689-3612/612-757-5541/FAX-612-689-5209

Client Address 123 Main St. City, State Zip

Fleming Cor

Client Address _____
Contact _____

CHAIN OF CUSTODY RECORD

Project Number 62/01975

Client -

Project Thunbolt S.H., Robot ship's
Phone/Fax

contract

CHAIN OF CUSTODY RECORD

Project Number 62/01975

Client -

Project Thunbolt S.H., Robot ship's
Phone/Fax

contract

| Sample ID | Sample Description | Collection Date/Time | Matrix (Vol/Area) | Analysis Requested |
|--------------|-----------------------------------|----------------------|-------------------|--------------------|
| 62/0197F-40 | Site 1 floor 205 metal nail brown | 2/18/97 11 | 2 1/2 x 1" | 11919 - 14 |
| 62/0197F-52 | " " 209 wood aged. brown | " | " | 15 |
| 62/0197F-70 | " " 212 chalkboard white | " | " | 160 |
| 62/0197F-160 | " fiber 3 3/16 chalkboard ledge | " | " | 17 |
| 62/0197F-172 | " 313 chalkboard white | " | " | 18 |
| 62/0197F-227 | " 323 wood shelves bottom | " | " | 19 |
| 62/0197F-112 | " floor 156 wood chalkboard white | 2/11/97 11 | " | 20 |

Sampled By: K Cox Date: 3/5/97 Time: _____
Received By: M Hough Date: 3/6/97 Time: _____
Received By Lab: J D Date: 3/6/97 Time: 2010

Disposition of Samples

Delivered By: _____ Date: _____ Time: _____

Nineties

APPENDIX C INSPECTORS

**Richard T. Cox
MDH Lead Inspector # 166**