


Midwest
Environmental
Consulting, L.L.C.

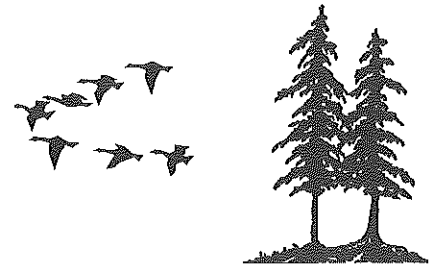

♻️ Printed on Recycled Paper

**J. J. Hill Montessori Magnet School
Saint Paul Public Schools**

Lead-Based Paint Inspection

Inspection Dates: 6/19/98

submitted to:

Saint Paul Public Schools

MEC Project # 62/0197AP

38894 Llama Street NW * Dalbo, Minnesota 55017 * (612) 689-3612
fax (612) 689-5209

INTRODUCTION

At the request of Saint Paul Public Schools Environmental Safety Department, Midwest Environmental Consulting, L.L.C. (MEC), conducted a lead-based paint inspection at J. J. Hill Montessori Magnet School, 998 Selby Avenue, St. Paul, MN. The purpose of this inspection was to identify lead-based painted, varnished, or otherwise coated building components on the interior and exterior of the school building.

The inspection protocol incorporated applicable portions of the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-based Paint Hazards in Housing* (HUD Guidelines, June 1995) and OSHA 1926.62 requirements (Lead in Construction). The HUD guidelines are formulated to guide agencies in conducting random sampling of the interiors and exteriors of dwellings and common areas in public housing. The OSHA requirement is designed to minimize worker exposure when working with material containing lead.

The United States Environmental Protection Agency defines "lead-based paint" as a paint or other surface coating that contains lead equal to or in excess of 1.0 milligrams per square centimeter when analyzed by XRF or more than 0.5% by weight (5000 parts per million) by laboratory analysis of a bulk sample.

No samples were taken for laboratory analysis at this school.

Minnesota Department of Labor and Industry (MN OSHA) adopted the EPA lead levels for the purpose of enforcing OSHA 1926.62 federal regulations. Detection of lead in dried paint film by XRF is a dependable indicator of levels of lead and is accepted by MN OSHA.

For this Saint Paul Public Schools Lead Inspection, all building components were tested on site using a Niton XL® X-ray Fluorescence Spectrum Analyzer⁽¹⁾. Building components included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases. Only painted or glazed surfaces or surfaces which were varnished were tested. Suspended ceilings, structural steel, and corrugated decking were not included in the inspection. Neither anodized (e.g., window sashes) nor plastic (e.g., vinyl baseboard and vinyl mini-blinds) were included in the scope of this inspection.

⁽¹⁾ This is a portable hand held machine that can analyze building components instantly for lead concentrations.

Each building was divided into unique sites based on the year of construction or renovation. Portable classrooms, playgrounds, and other detached buildings were automatically designated as a unique site. Each site was inspected independently assuming differences in painting history and construction characteristics.

SITE DESCRIPTION AND BUILDING HISTORY

According to information provided to MEC by Saint Paul Public Schools, J. J. Hill Montessori Magnet School was constructed in essentially one phase. The building is 65,715 square-feet and dates from 1974.

All room and area designations used in this report are depicted on sampling maps found in Appendix A.

XRF SAMPLE RESULTS TABLE

The results of all samples analyzed are listed in the table at the end of this section. The following is a description of the column headings:

Site	Each school is divided into sites based on their unique construction characteristics. Each site has a unique date of construction or major renovation.	
Sample #	Each sample taken was given a unique number to identify the type and location of the sample. The sampling date is an integral part of the sample number.	
Analysis	This defines the type of analysis which can be categorized into two types: 1) XRF: This is an on-site analysis using a hand held Niton XL® X-ray Fluorescence Spectrum Analyzer; 2) Bulk or Chip: This is a bulk sample where paint is removed from the substrate and sent to a laboratory for analysis;	
Floor	This is the level of the building in which the area tested was found, example, 1 (first floor), 0 (basement), etc.	
Area	This further defines the specific functional space inspected such as a classroom, exterior, playground, gym, kitchen, etc.	

- Room #** This is typically the actual number on the room as identified at the building.
- Component** Building "components" included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases.
- Feature** Identifies more detailed information of the component.
- Condition** This describes condition of the surface, whether it is intact, cracked, peeling, or chalking.
- Substrate** This refers to the material the building component is made of (wood, concrete, drywall, metal, etc.).
- Result** This is the analysis results for lead. Less than 1.0 mg/cm² or less than 0.5% by weight is considered to be non-lead and these building components are below the action levels of EPA and HUD. (All results are in mg/cm² except where noted.)

The table of results is designed for quick information on lead concentrations of tested building components. Generally, all repetitions of a test combination within a given room or area, may be assumed to contain similar concentrations of lead to that of the tested sample. For instance, the lead concentration of a tested wooden window sash was found to be above the action level of 1.0 mg/cm² in a given classroom. The classroom has five windows, all of wood, the same color and appearing to be of the same era. It can be assumed that the remaining four wooden window sashes each contain lead above the action limit.

Other columns identify the component and the component feature tested, condition of the component, type of substrate and the result of the analytical test.

As an example, the following illustration shows that the wooden door jamb in Room 123, first floor in the 1923 building section was in good, solid condition, and had an XRF test result of 0.3 mg/cm², which is below the action level.

Illustration Only

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1923 Bldg.	52		XRF	1	Room	123	Door	Jamb	Solid	Wood	0.3

In a similar manner, the table shows that the plaster walls in room 23, on the second floor has peeling paint with more than 1.0 mg/cm² (shaded).

ILLUSTRATION ONLY

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1910 Bldg.	16		XRF	2	Room	23	Door	Jamb	Peeling	Wood	0.25
1910 Bldg.	17		XRF	2	Room	23	Wall	Wall	Peeling	Plaster	1.2
1910 Bldg.	18		XRF	2	Room	23		Ceiling	Peeling	Plaster	0.25
1910 Bldg.	19		XRF	2	Room	23	Wall	Baseboard	Peeling	Wood	0.002

APPLICABLE REGULATIONS

When building components test above 1.0 mg/cm² of lead by XRF or 0.5% lead by weight from laboratory analysis all employees and contractors who will be working with these components in a construction related activity must be notified. The requirements of OSHA 1926.62, Lead in Construction are enforceable. This regulation defines construction work as "work for construction, alteration and/or repair, including painting and decorating." This regulation further defines monitoring requirements to minimize employee exposure to lead during construction activities.

When work is performed on external painted building structures (i.e. flashing, fire escapes, playground equipment, handrails, etc.), regulations of the Minnesota Pollution Control Agency (MPCA) may also be applicable. For removal of lead based paint from steel structures, MN Rules 7025.0200 - 7025.0380 apply to steel materials on the exterior of a building, or on the property when levels exceed 0.5 mg/cm² based on the average of three XRF spectrum results of the sample tested, or 5,000 ppm by laboratory analysis. If it is other than a steel surface, then MPCA regulates the painted surfaces under MN Rules 7025.010 - 7025.0080, when surfaces are to be disturbed using abrasive blasting methods.

Please contact MEC directly if you have questions about any portion of this report or the lead-based paint inspection itself.

APPENDIX A

XRF TESTING DATA WITH LOCATION MAPS

OXFORD ST.

SELBY AVE.

CHATSWORTH ST.

SITE PLAN






SITE AREAS
 GROSS SQ. FT. 34,400
 PARKING SQ. FT. 4,000
 PLAY SQ. FT. 2,000
 SITE CIRCULAR L&L FT. 1,000
 PUBLIC CIRCULAR L&L FT. 2,000
 PRIVATE L&L FT. 200
 WALKWAY L&L FT. 50
 SITE TREES 40
 BOLLARD TREES 40
 BOLLARD SQ. FT. 25,000
 TOTAL GROSS SQ. FT. 75,400
 PUBLIC CIRCULAR L&L FT. 2,000

INDEPENDENT SCHOOL DIST. #625
 360 COLBORNE STREET
 ST. PAUL, MINNESOTA 55102

J.J. HILL ELEMENTARY SCHOOL
 SELBY AT OXFORD
 ST. PAUL, MINNESOTA 55104

CONSTRUCTED:

1
 4

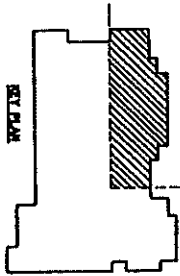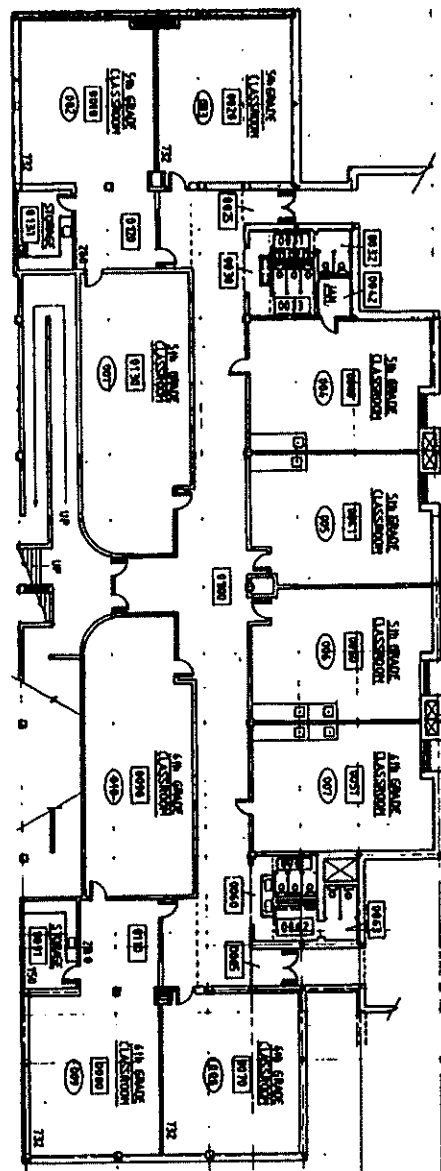


A B C D E F G H I J K L M N O P Q R S T U V W X Y Z 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20

INDEPENDENT SCHOOL DIST #625
360 COLBORNE STREET
ST PAUL, MINNESOTA 55102

J.J. HILL ELEMENTARY SCHOOL
SELBY AT OXFORD
ST. PAUL, MINNESOTA 55104


CONSTRUCTED 1974

2/4

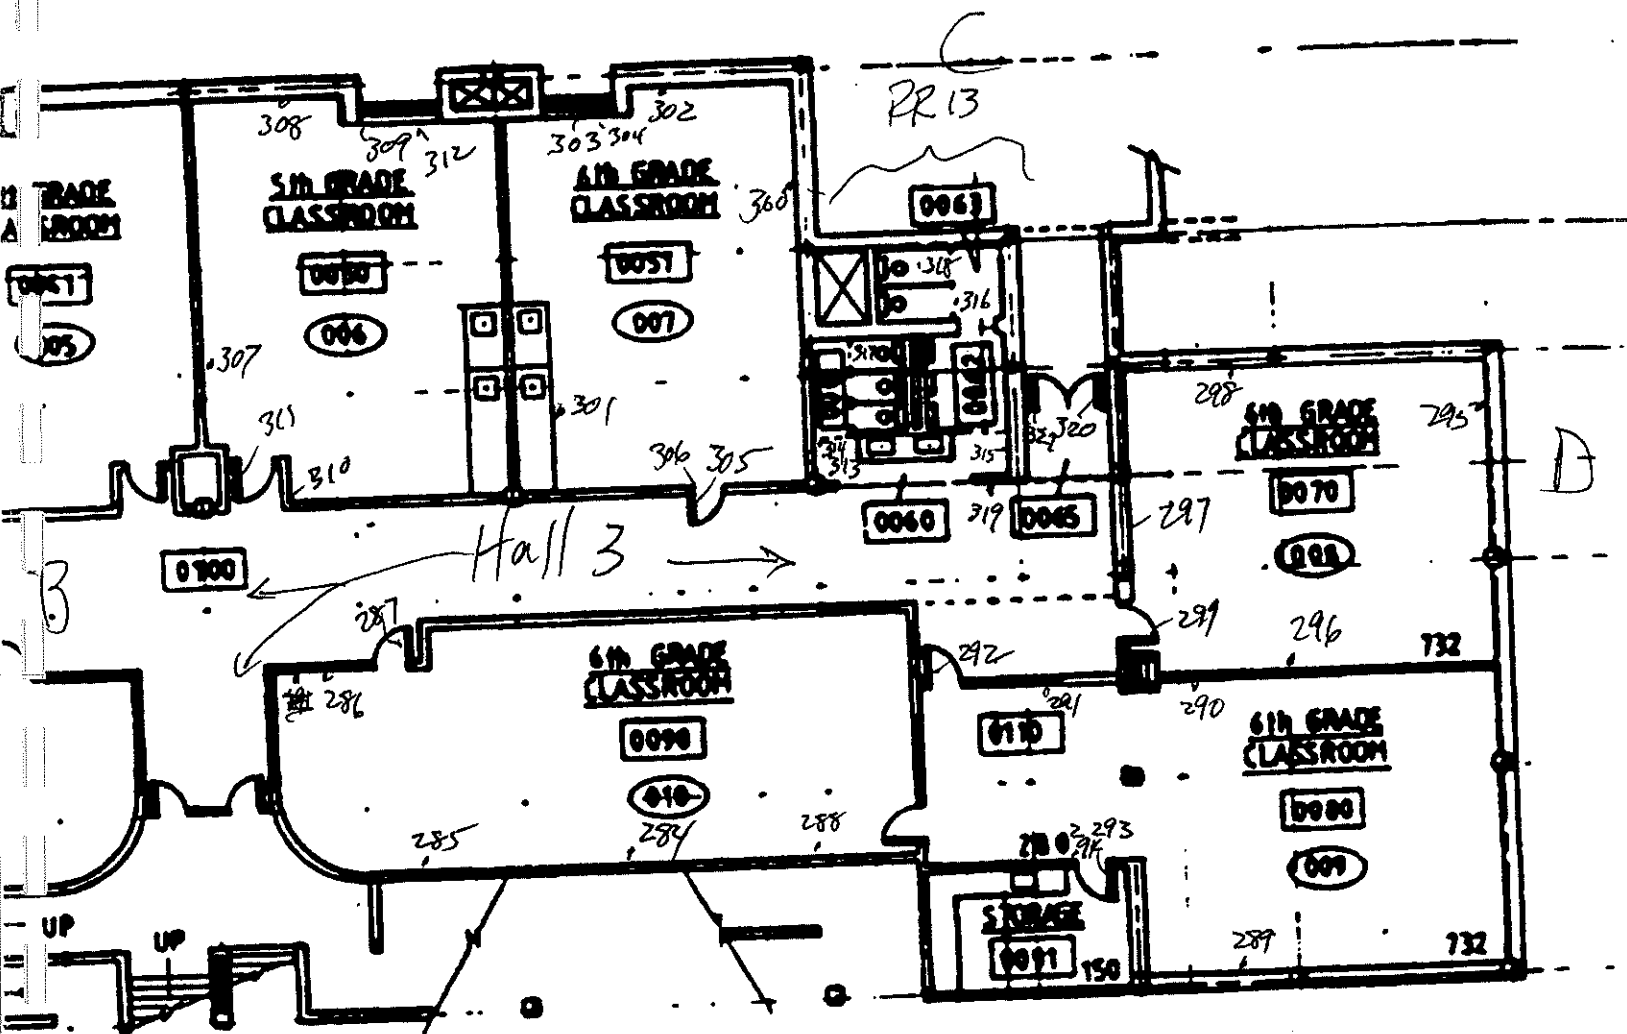

A

1 18 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20

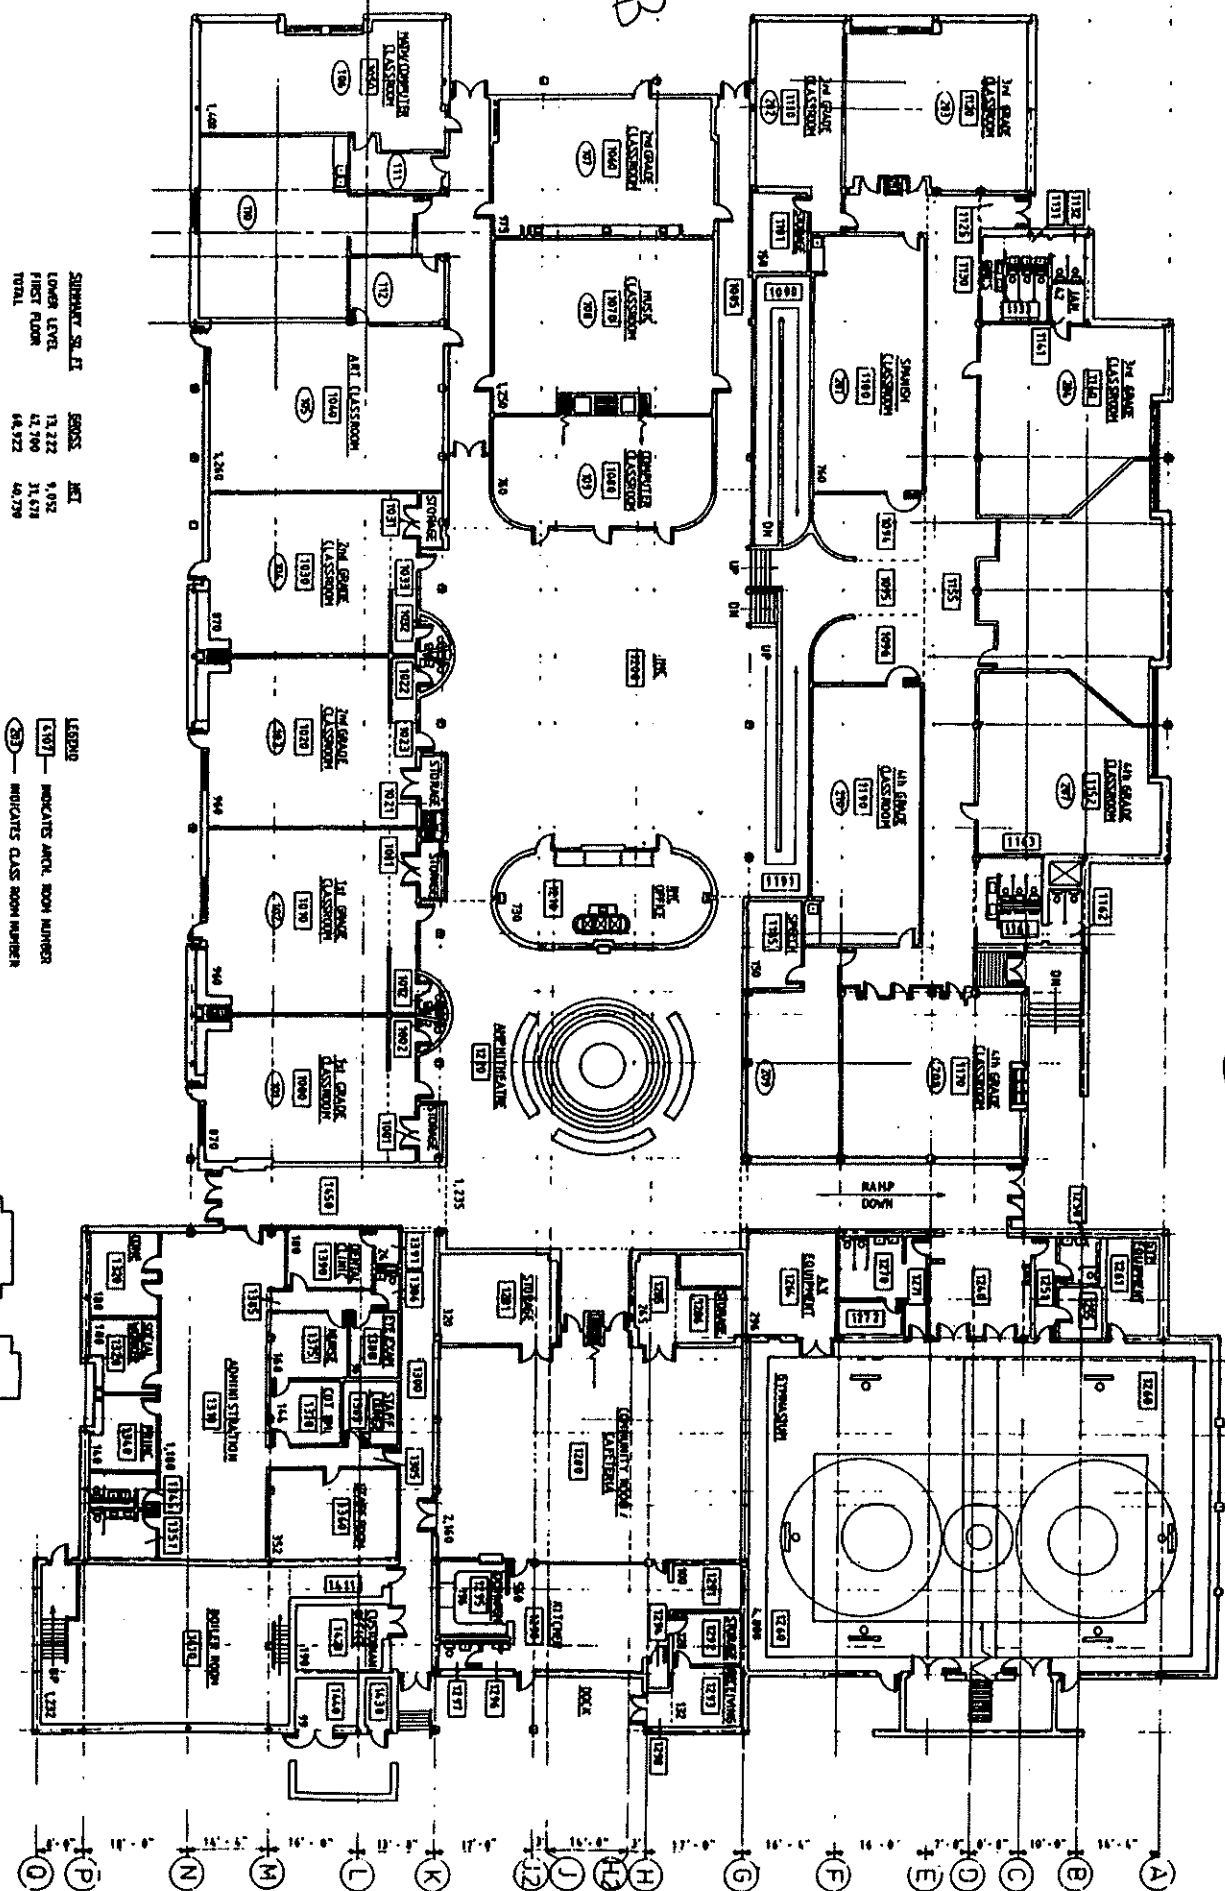

SUMMARY S.F.
 LOWER LEVEL 13,222
 FIRST FLOOR 42,790
 TOTAL 55,912

LEGEND
 (1507) - INDICATES ARCH. ROOM NUMBER
 (20) - INDICATES CLASS ROOM NUMBER
 75 - INDICATES ROOM NO. PROVIDE

FIRST FLOOR

INDEPENDENT SCHOOL DIST #625
 360 COLBORNE STREET
 ST PAUL, MINNESOTA 55102

J.J. HILL ELEMENTARY SCHOOL
 SELBY AT OXFORD
 ST PAUL, MINNESOTA 55104

CONSTRUCTED 1974

3 4

6/20/97

6/19/98

A

SUMMARY OF LT
 LOWER LEVEL
 FIRST FLOOR
 TOTAL

NOSS. NET
 13,232 9,953
 42,740 25,070
 44,722 44,720

LEGEND
 (1197) - INDICATES ACH. ROOM NUMBER
 (21) - INDICATES CLASS ROOM NUMBER
 75 - INDICATES ROOM NO. PORTAL

346 bench.


FIRST FLOOR


INDEPENDENT SCHOOL DIST. #625
 360 COLBORNE STREET
 ST. PAUL, MINNESOTA 55102


11 HILL ELEMENTARY SCHOOL
 SELBY AT OXFORD
 ST. PAUL, MINNESOTA 55104


CONSTRUCTED: 1972


3
4

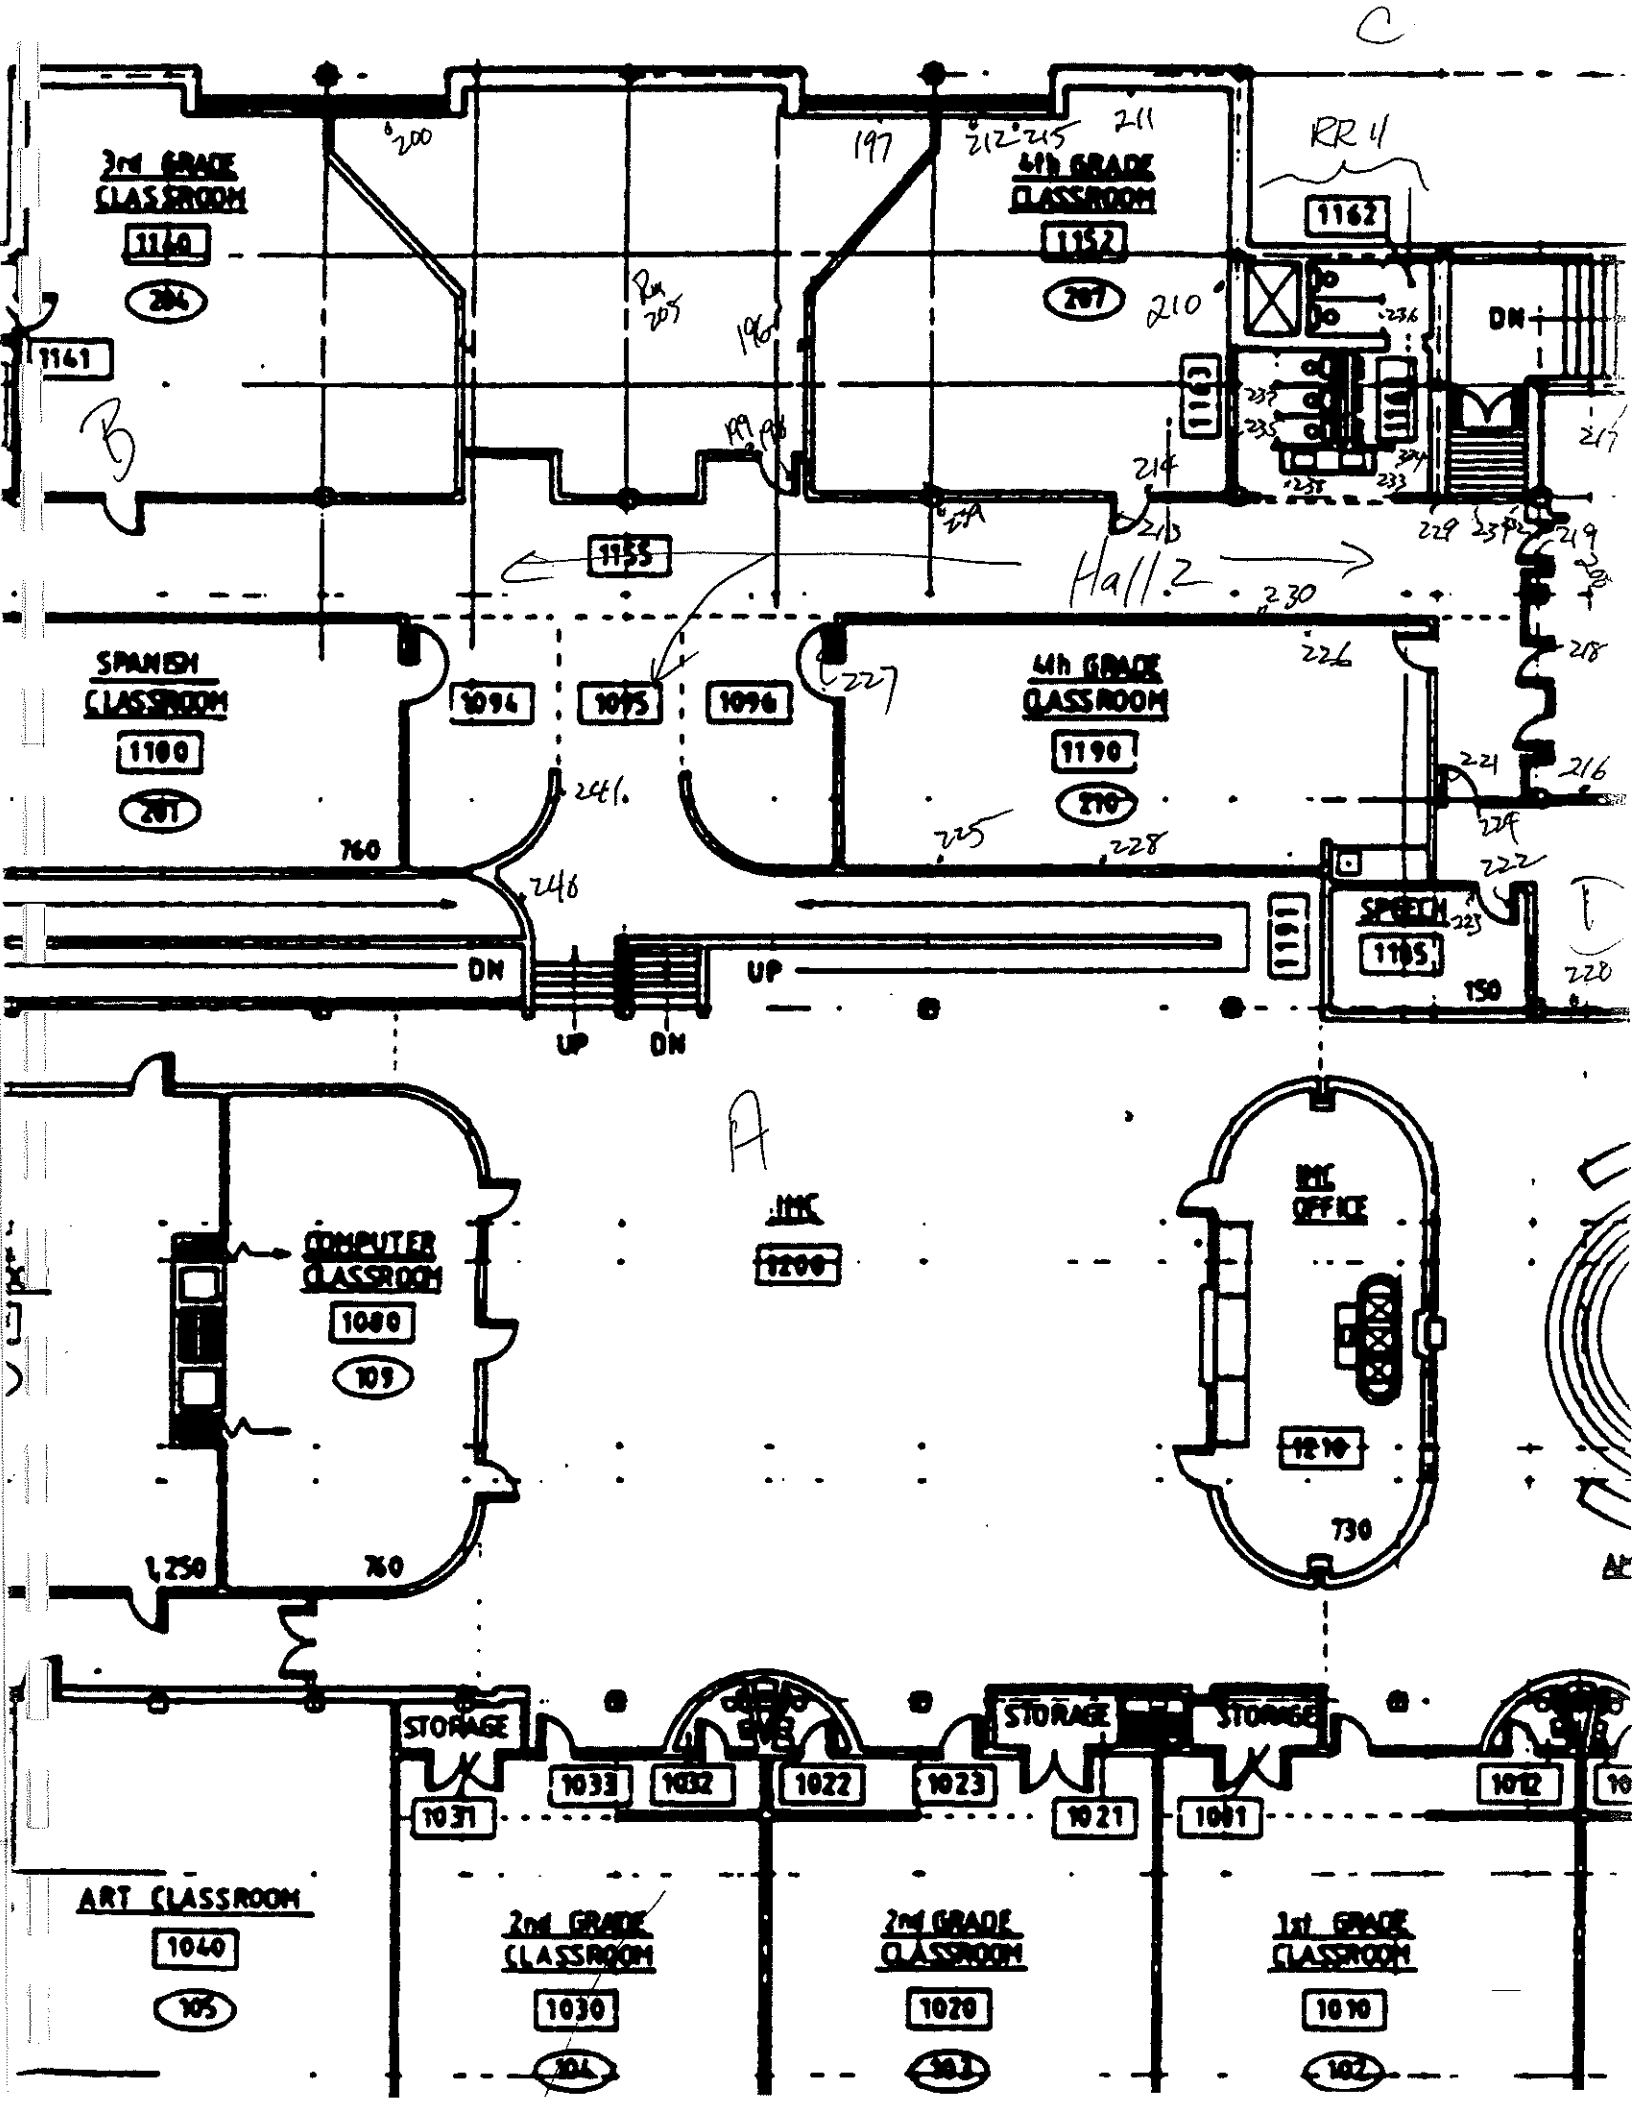

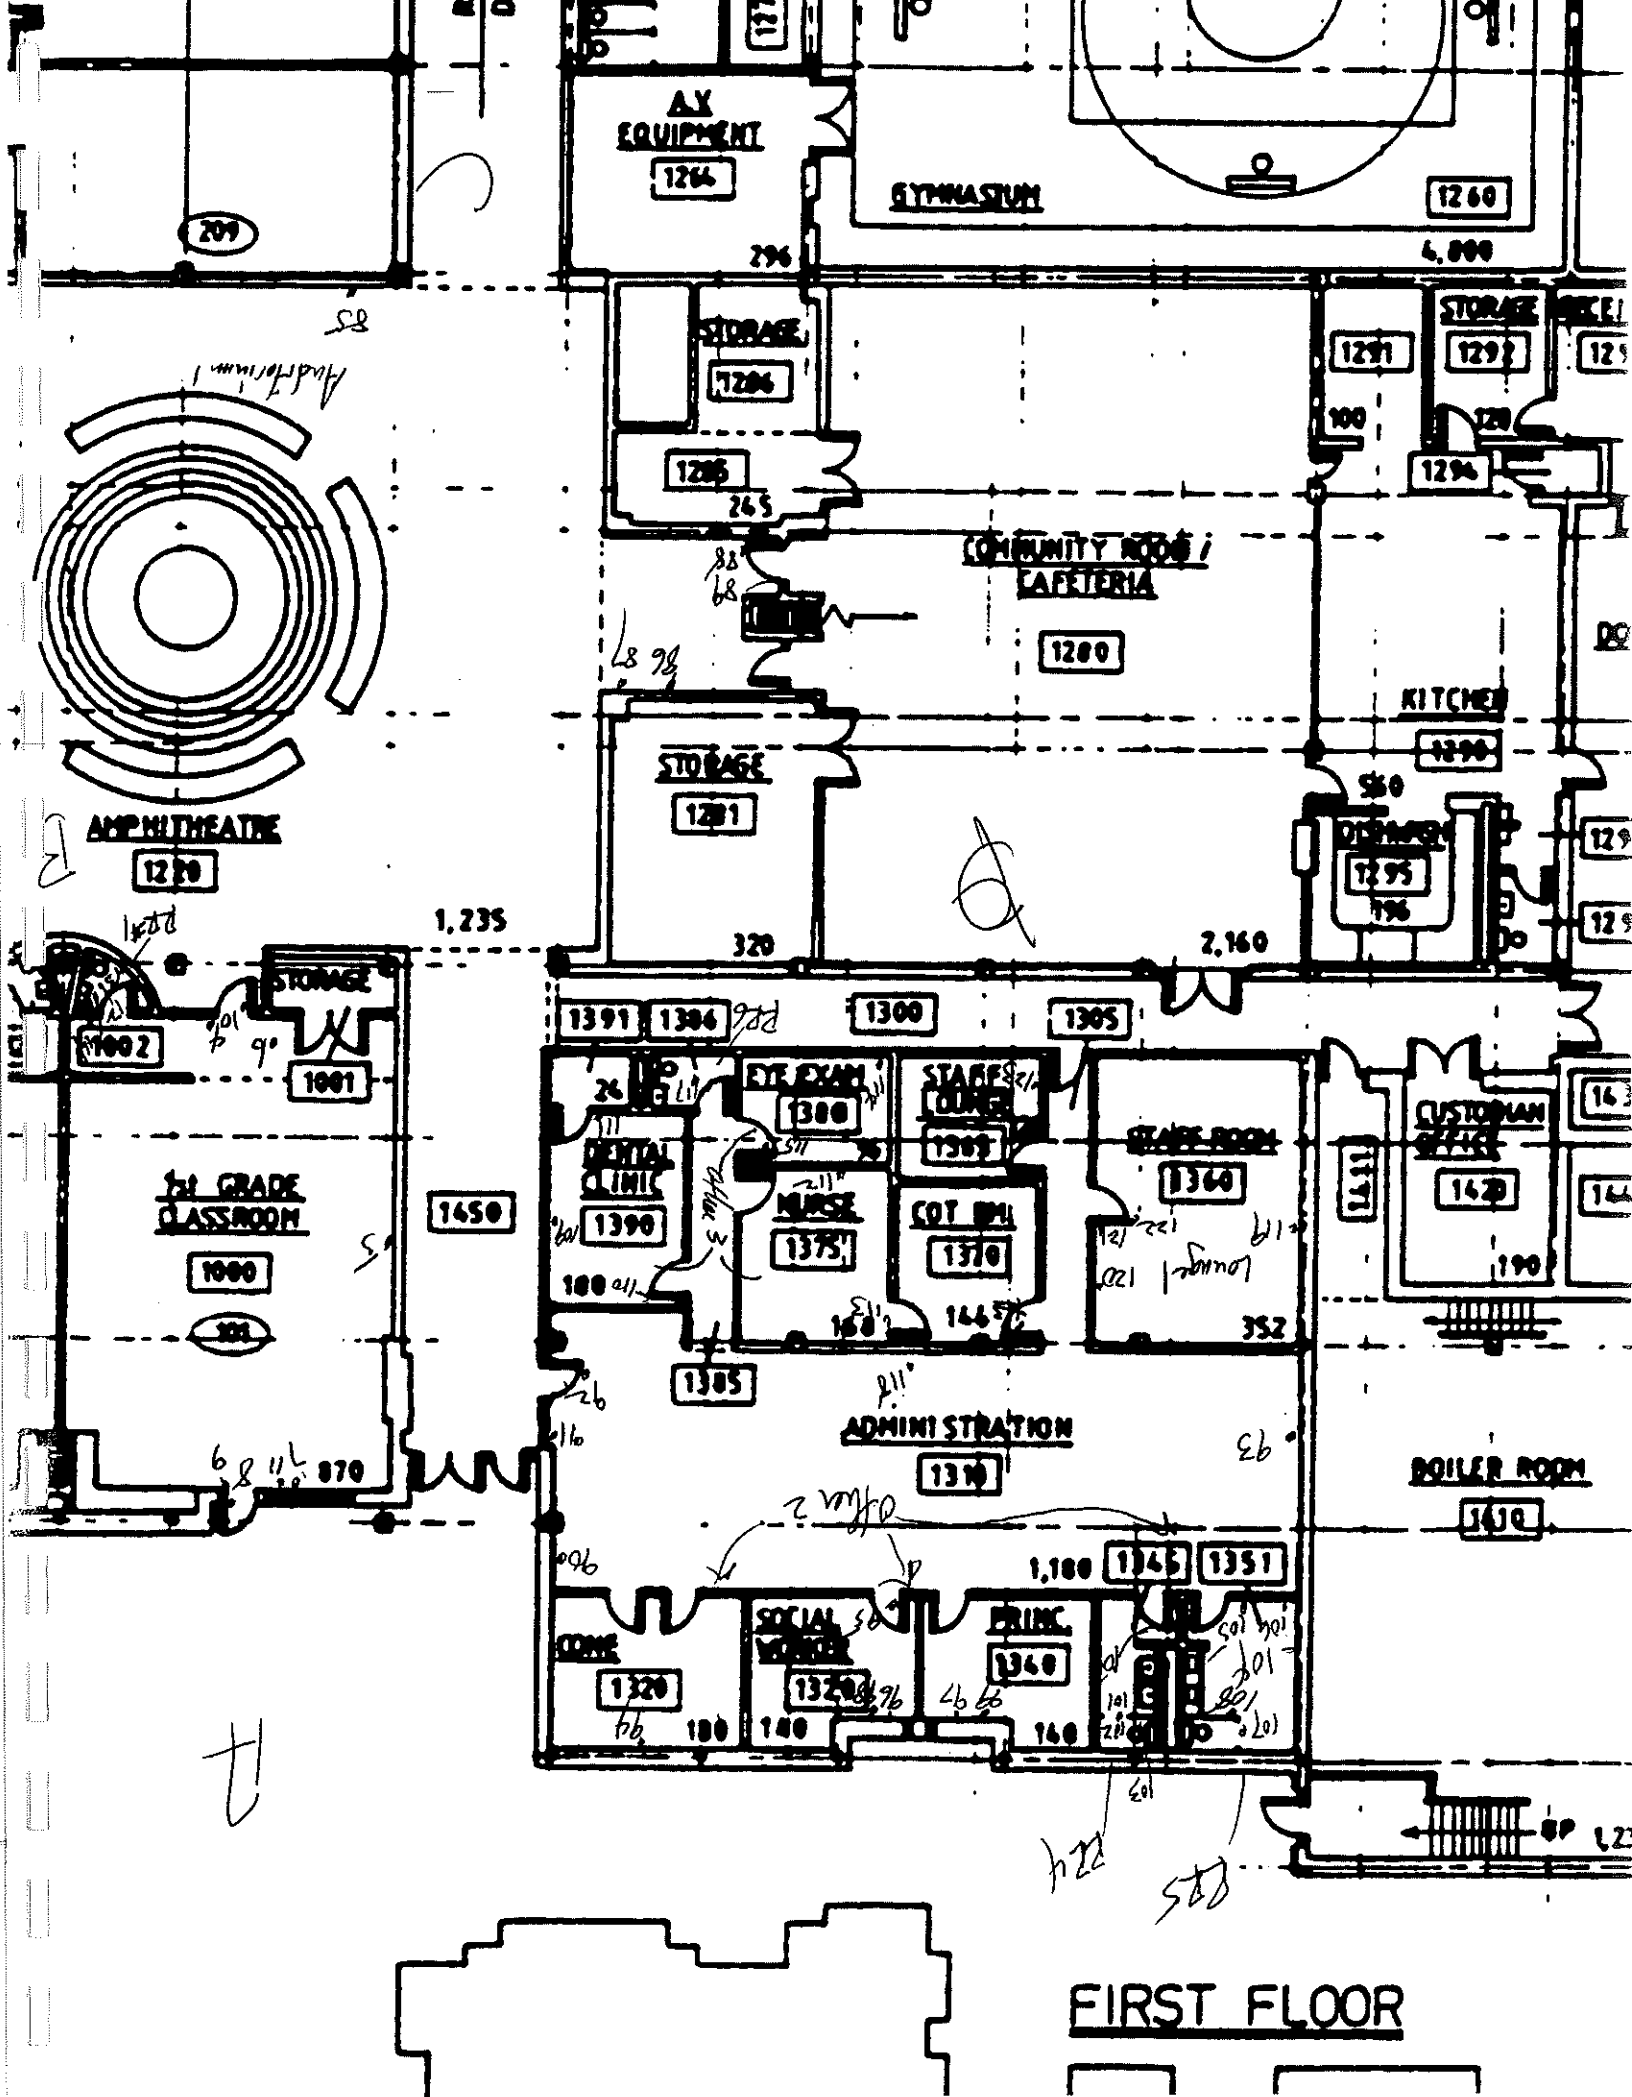

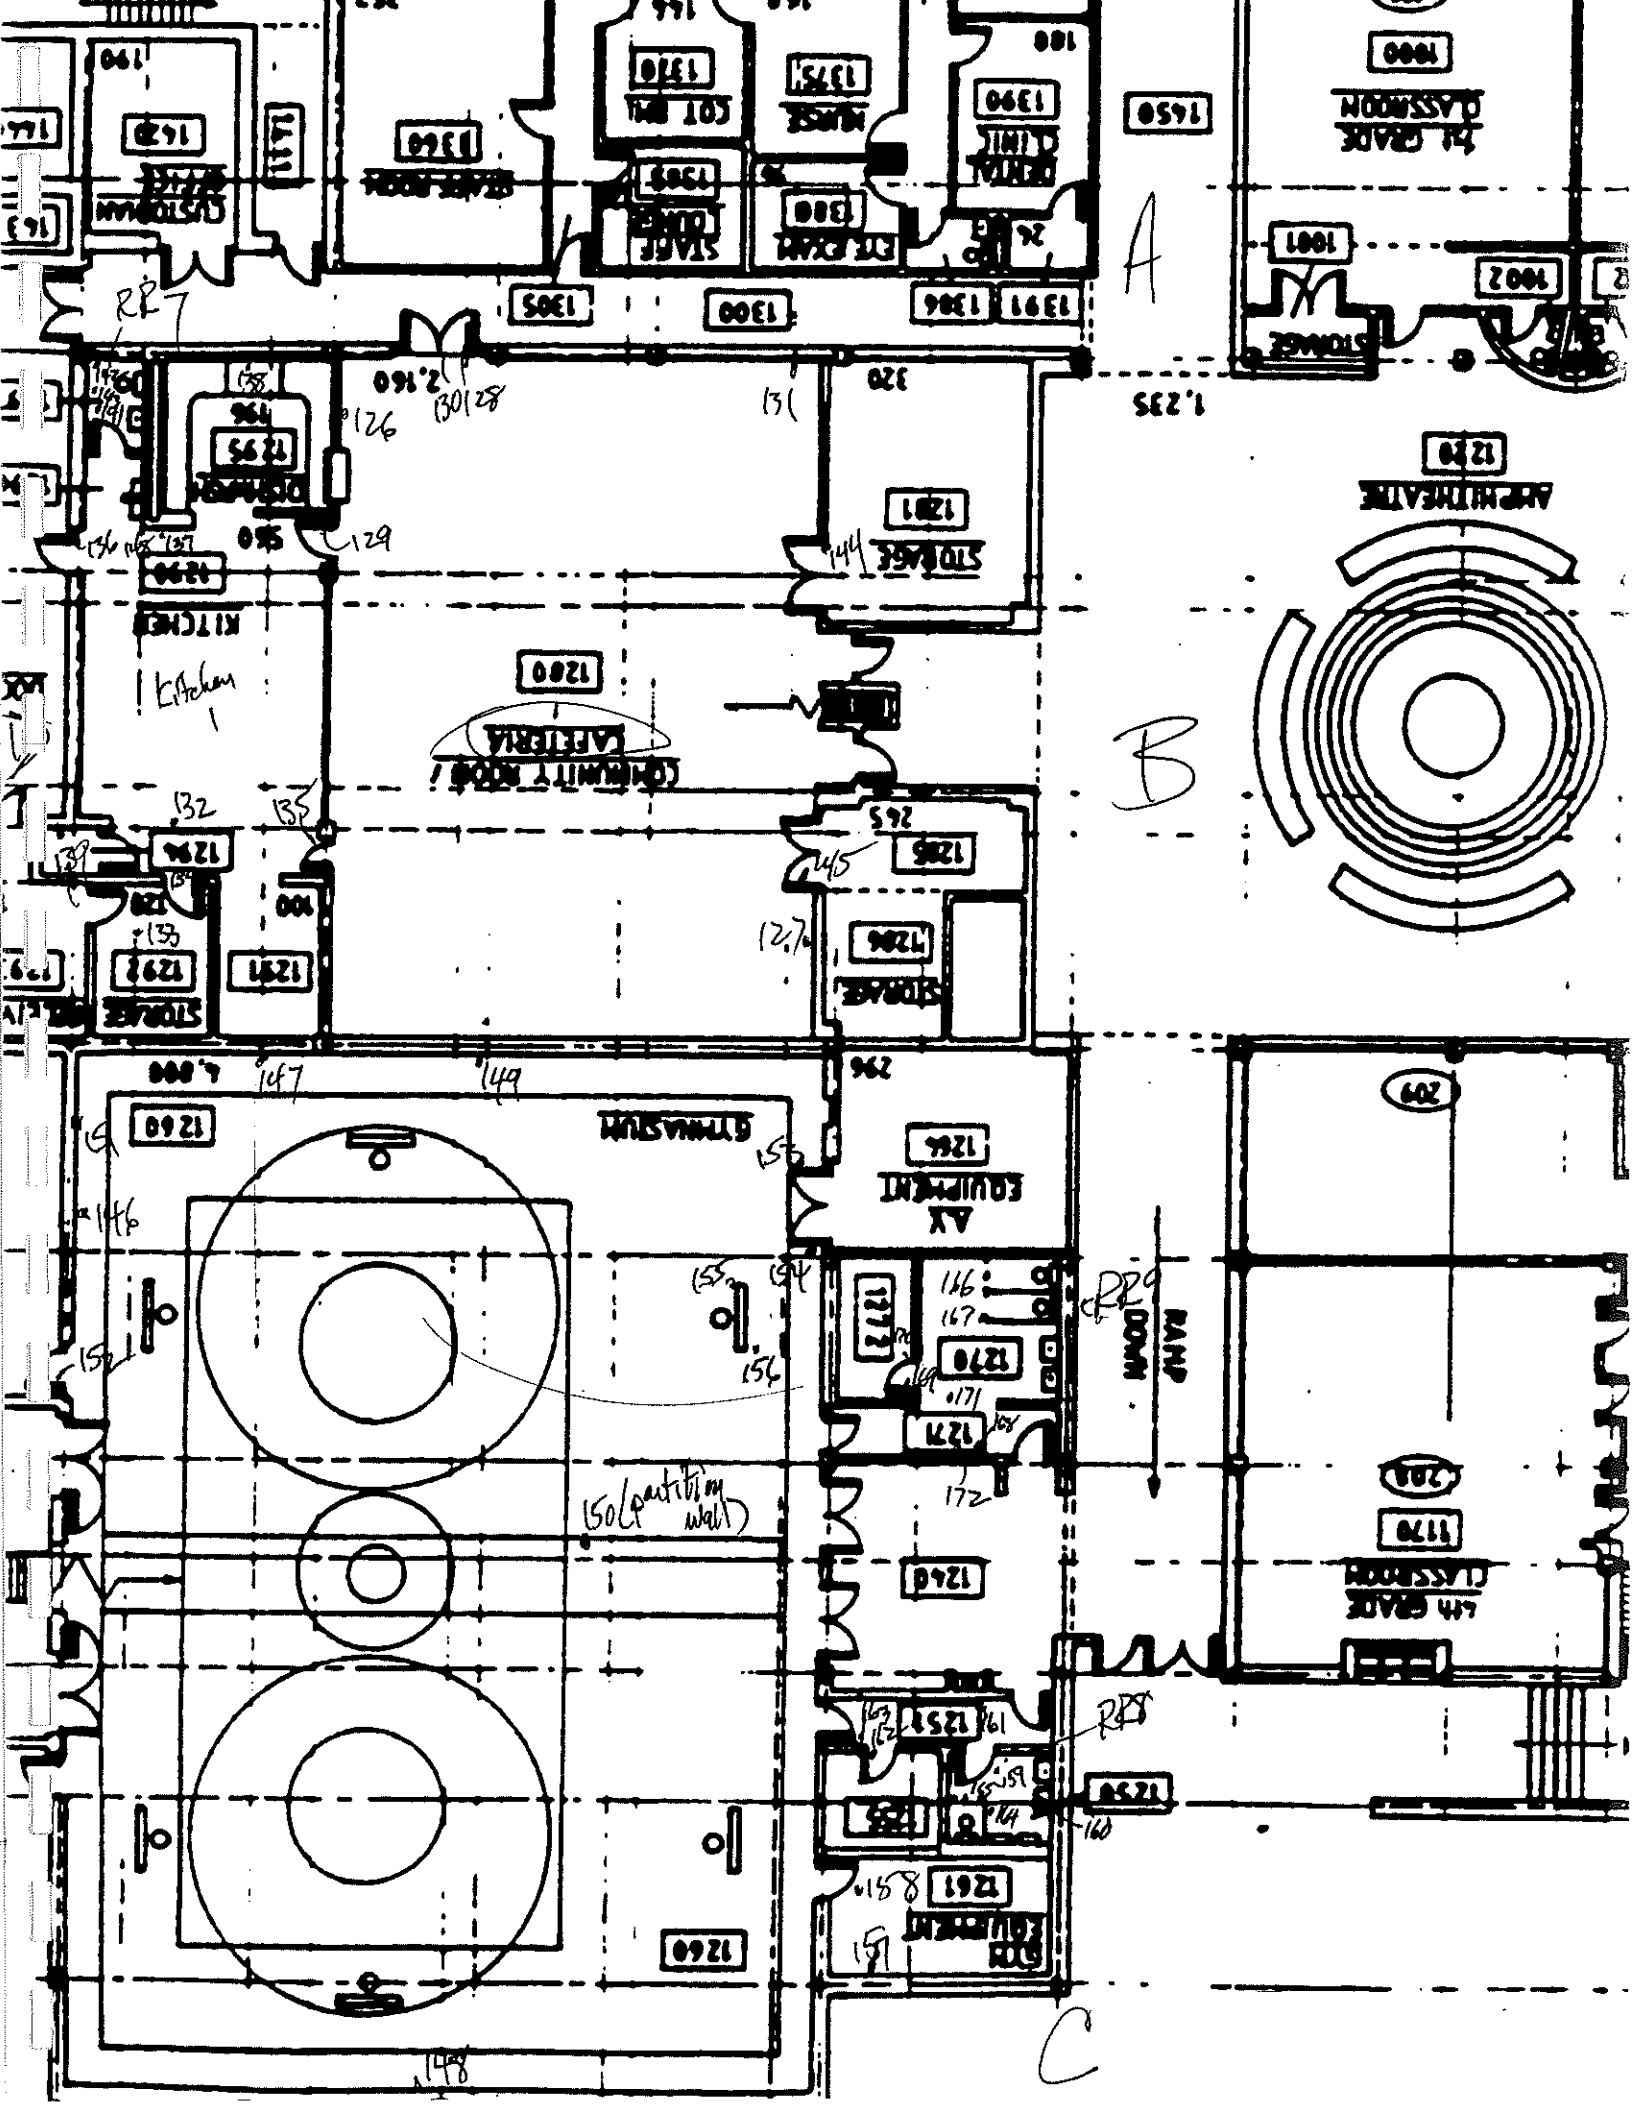

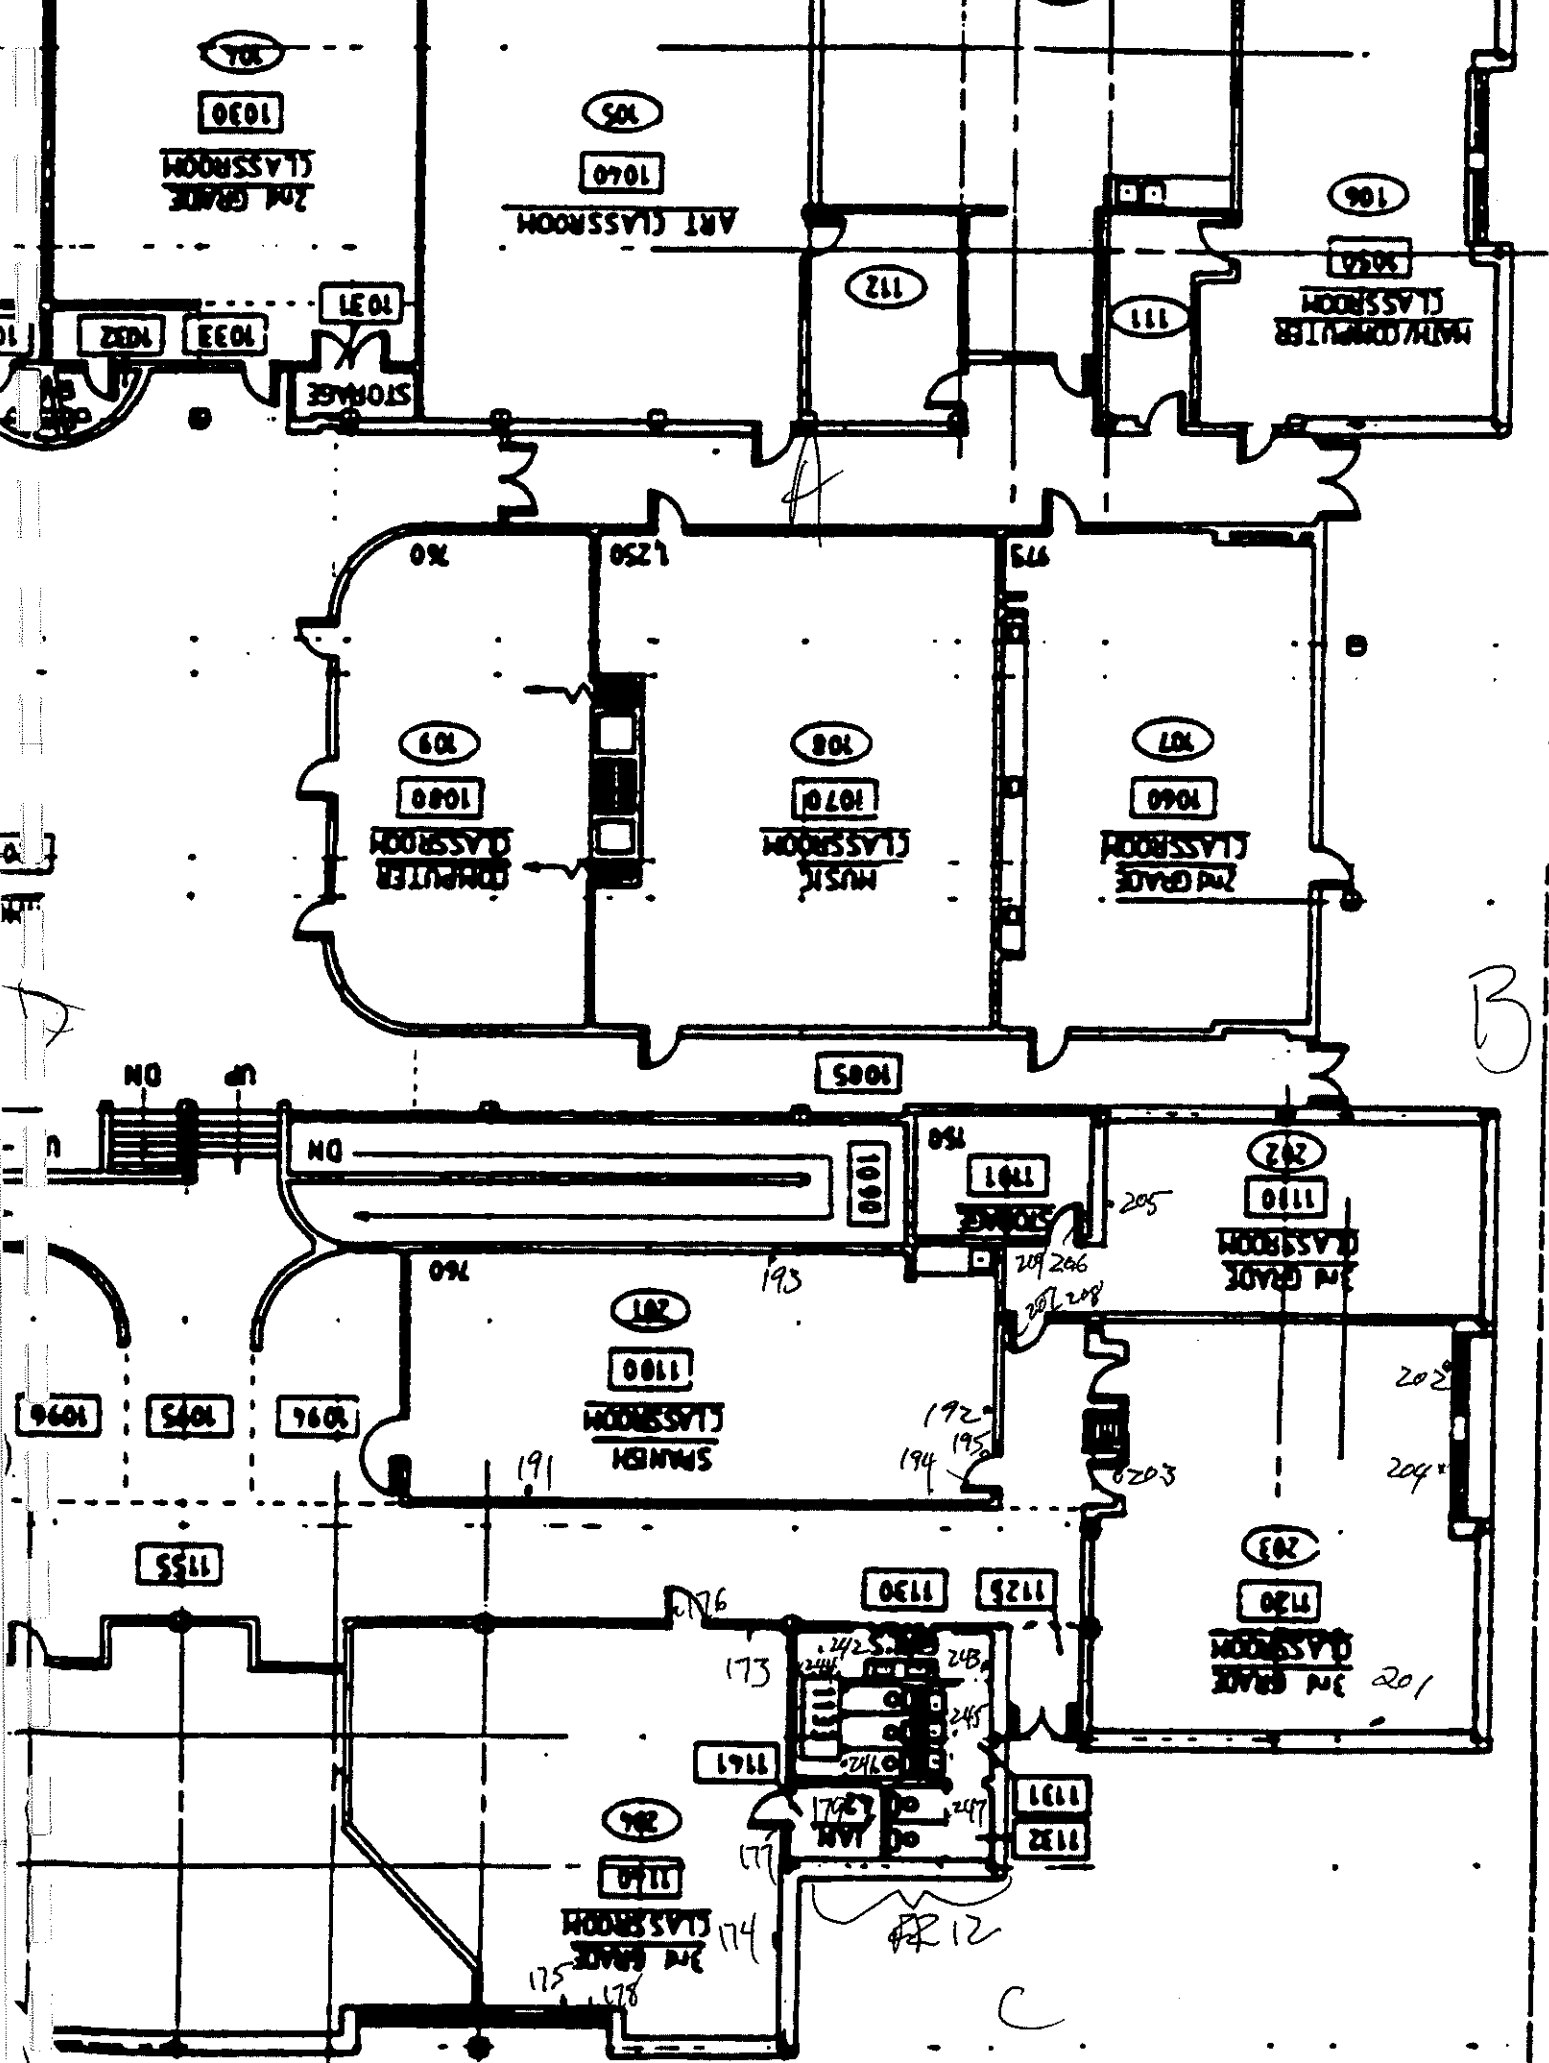


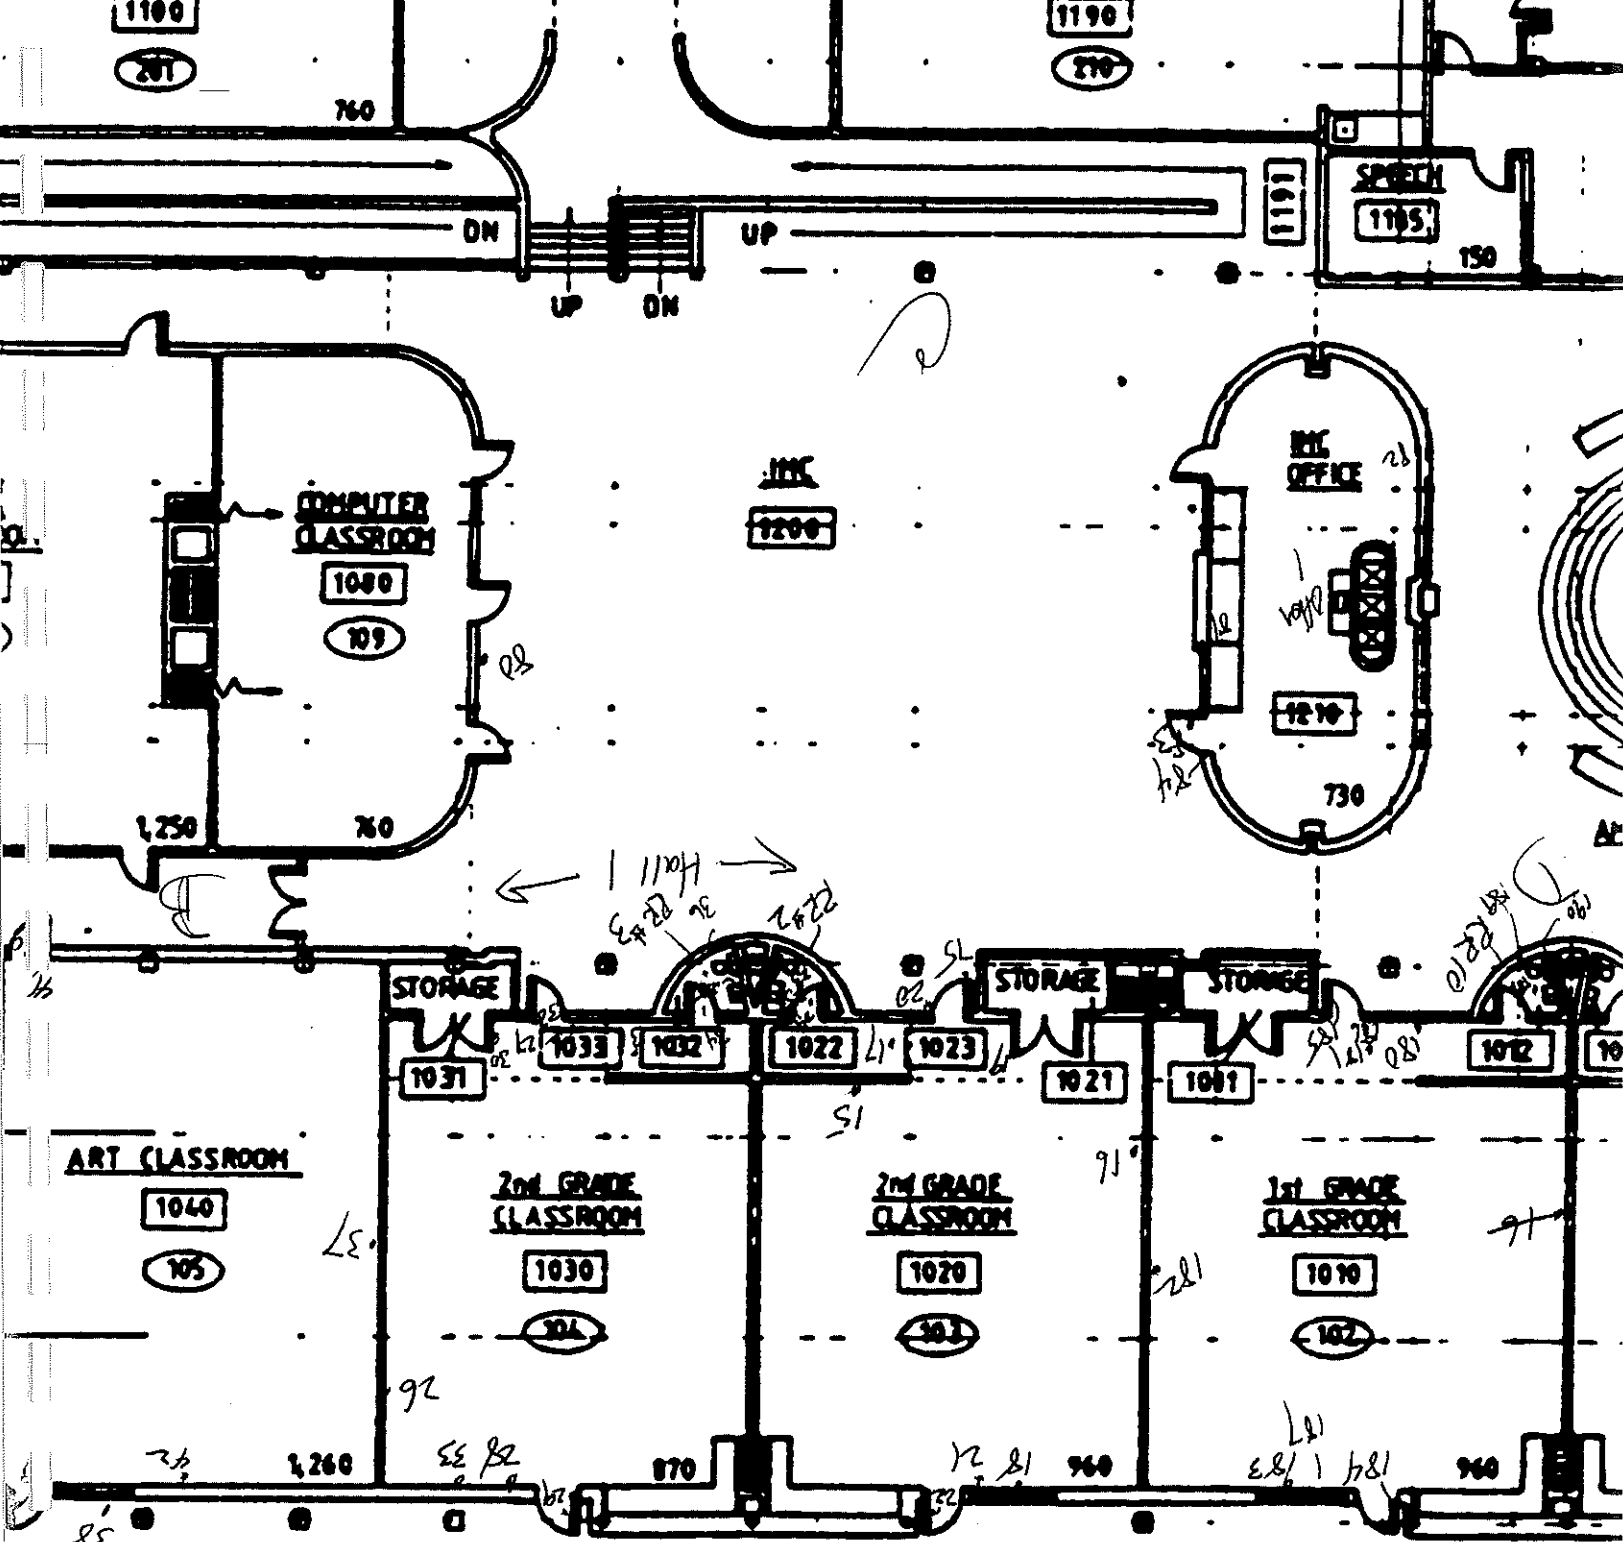


S. F.	GROSS	NET
V.L.	13,222	9,052
OR	47,700	31,678
	60,922	40,730

LEGEND

- 6107 — INDICATES ARCH. ROOM NUMBER
- 203 — INDICATES CLASS ROOM NUMBER
- 705 — INDICATES ROOM SQ. FOOTAGE

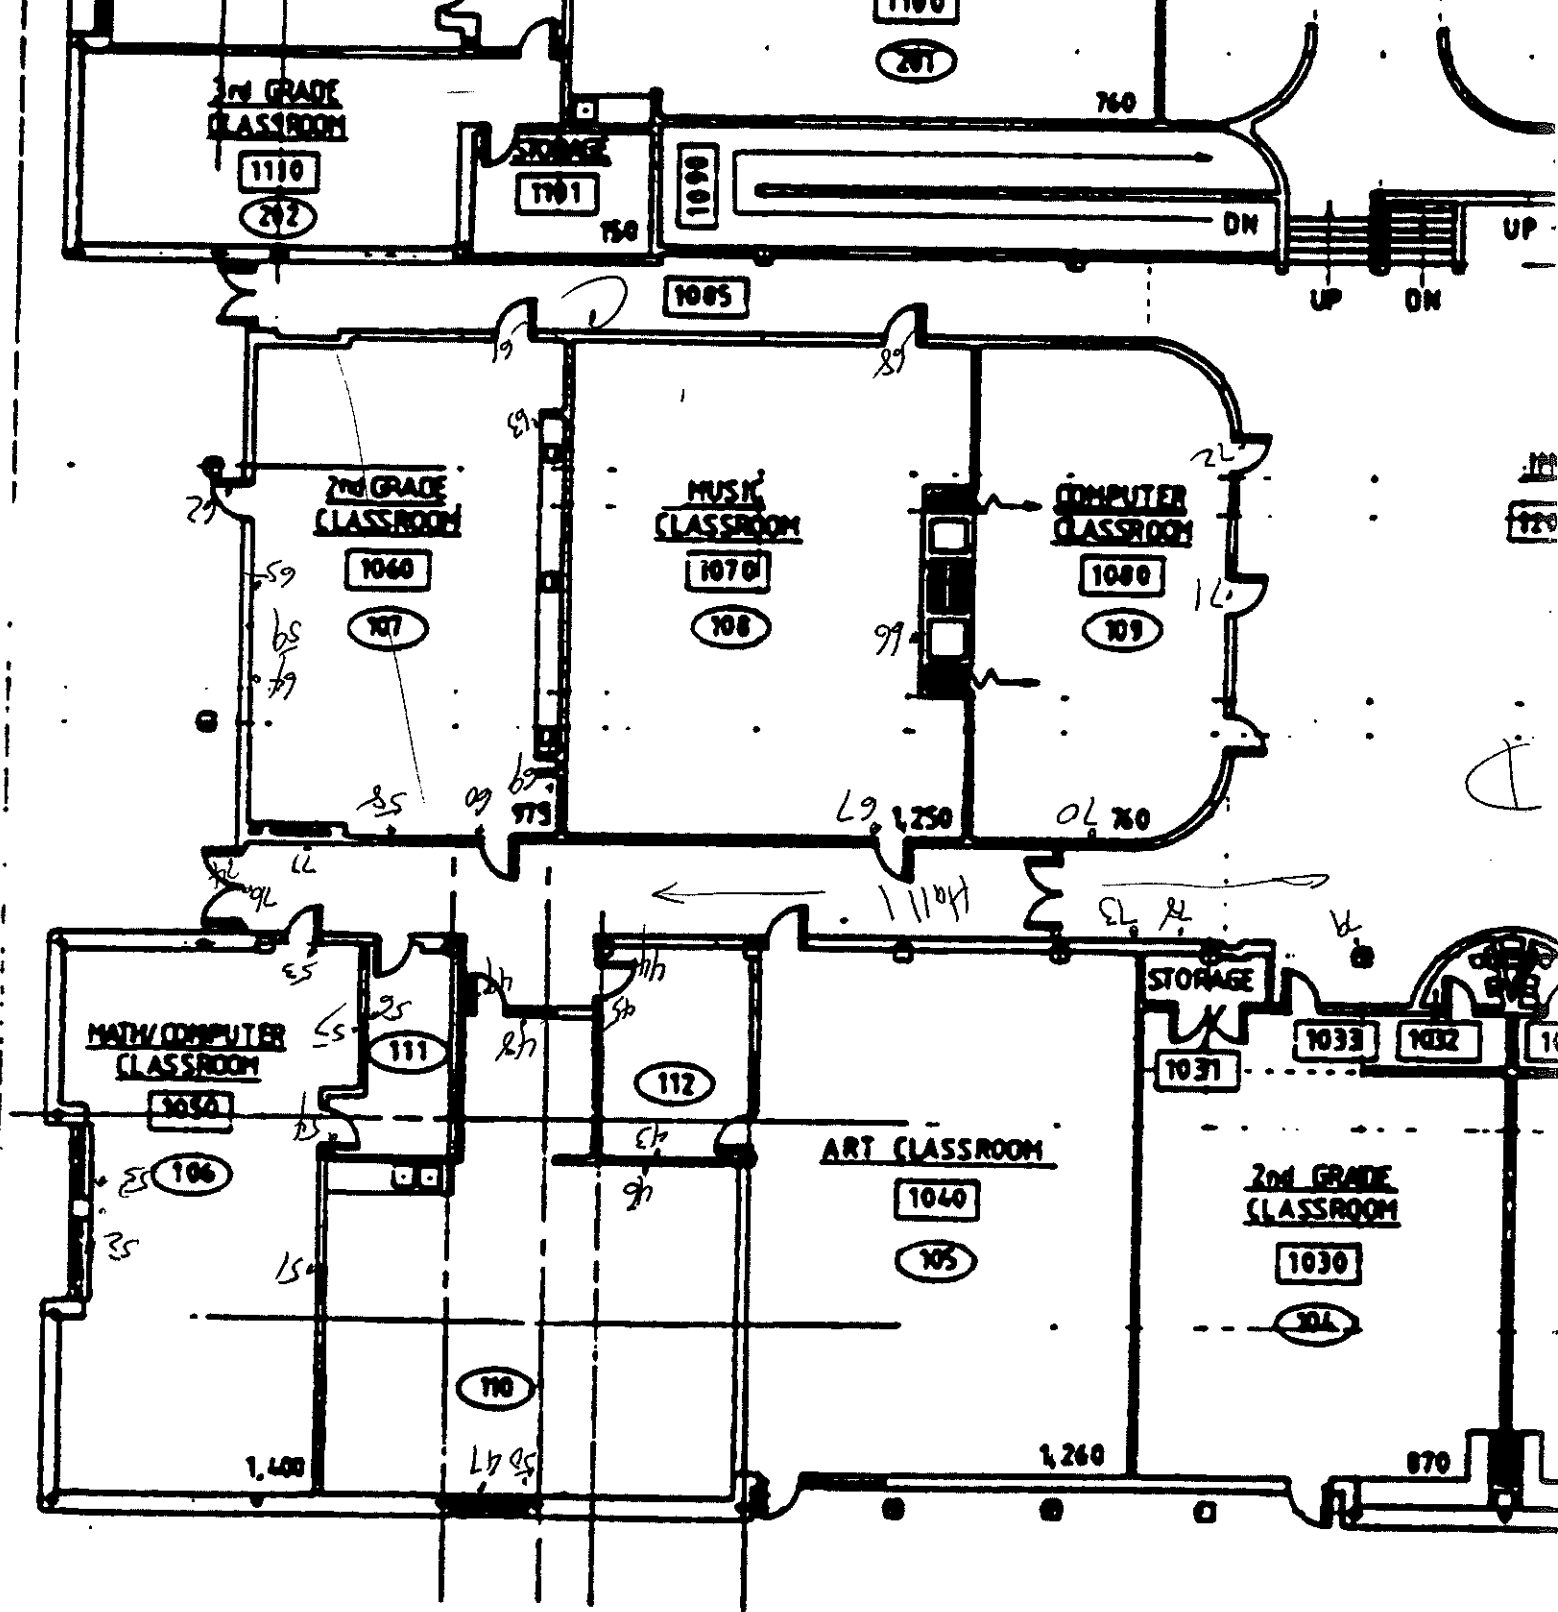

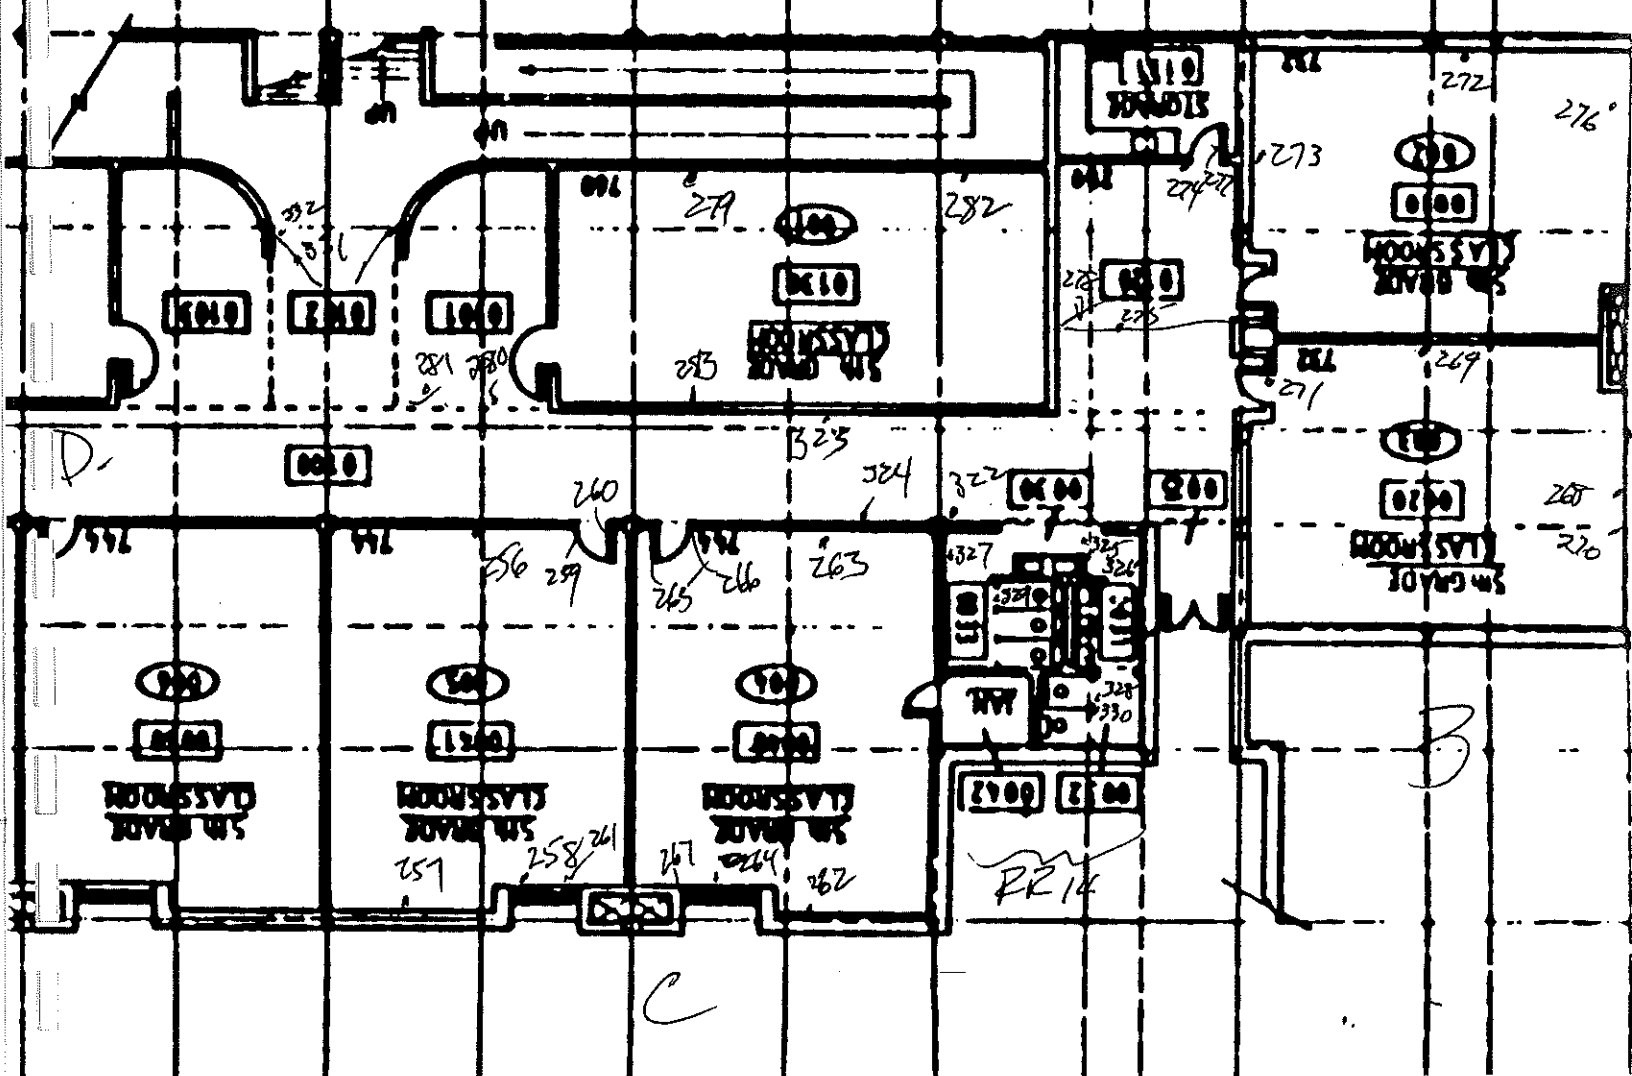

Saint Paul Public Schools
J.J. Hill Montessori Magnet School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K
1	J.J. Hill Montessori Magnet School										
2											
3	Site	Sample #	Date	Analysis	Floor	Area	Component	Feature	Condition	Substrate	Result
4	1974 Bldg.	88	6/19/98	XRF	1	Auditorium-1	Door	Door	Solid	Wood	0.07
5	1974 Bldg.	89	6/19/98	XRF	1	Auditorium-1	Door	Jamb-Lft	Peeling	Metal	0
6	1974 Bldg.	85	6/19/98	XRF	1	Auditorium-1	Wall	Wall-Lwr	Solid	Drywall	0.02
7	1974 Bldg.	86	6/19/98	XRF	1	Auditorium-1	Wall	Midle Wall	Solid	Concrte	>0.07
8	1974 Bldg.	87	6/19/98	XRF	1	Auditorium-1	Wall	Wall-Lwr	Solid	Concrte	0.07
9	1974 Bldg.	128	6/19/98	XRF	1	Cafeteria-0	Door	Door	Solid	Wood	0.07
10	1974 Bldg.	129	6/19/98	XRF	1	Cafeteria-0	Door	Door	Solid	Metal	0
11	1974 Bldg.	130	6/19/98	XRF	1	Cafeteria-0	Door	Jamb-Lft	Cracked	Metal	0.02
12	1974 Bldg.	126	6/19/98	XRF	1	Cafeteria-0	Wall	Wall-Lwr	Solid	Concrte	0.03
13	1974 Bldg.	127	6/19/98	XRF	1	Cafeteria-0	Wall	Wall-Up	Solid	Concrte	0.01
14	1974 Bldg.	131	6/19/98	XRF	1	Cafeteria-0	Wall	Wall Rgstr	Solid	Metal	0
15	1974 Bldg.	281	6/19/98	XRF	0	Classroom-1	Door	Door	Solid	Wood	0
16	1974 Bldg.	282	6/19/98	XRF	0	Classroom-1	Univent		Solid	Metal	0.01
17	1974 Bldg.	279	6/19/98	XRF	0	Classroom-1	Wall	Midle Wall	Solid	Drywall	>0.09
18	1974 Bldg.	283	6/19/98	XRF	0	Classroom-1	Wall	Midle Wall	Solid	Drywall	>0.10
19	1974 Bldg.	280	6/19/98	XRF	0	Classroom-1	Window	Casing-Rht	Solid	Metal	0
20	1974 Bldg.	287	6/19/98	XRF	0	Classroom-10	Door	Door	Solid	Wood	0
21	1974 Bldg.	288	6/19/98	XRF	0	Classroom-10	Univent		Solid	Metal	0
22	1974 Bldg.	284	6/19/98	XRF	0	Classroom-10	Wall	Wall-Lwr	Solid	Drywall	0.38
23	1974 Bldg.	285	6/19/98	XRF	0	Classroom-10	Wall	Wall-Lwr	Solid	Concrte	0
24	1974 Bldg.	286	6/19/98	XRF	0	Classroom-10	Window	Casing-Rht	Solid	Metal	>0.05
25	1974 Bldg.	6	6/19/98	XRF	1	Classroom-101	Ceiling		Solid	Drywall	0.02
26	1974 Bldg.	8	6/19/98	XRF	1	Classroom-101	Door	Door	Solid	Metal	0
27	1974 Bldg.	9	6/19/98	XRF	1	Classroom-101	Door	Jamb-Rht	Solid	Metal	0
28	1974 Bldg.	10	6/19/98	XRF	1	Classroom-101	Door	Door	Solid	Metal	0.06
29	1974 Bldg.	11	6/19/98	XRF	1	Classroom-101	Univent		Solid	Metal	0
30	1974 Bldg.	4	6/19/98	XRF	1	Classroom-101	Wall	Midle Wall	Solid	Drywall	0.01
31	1974 Bldg.	5	6/19/98	XRF	1	Classroom-101	Wall	Wall-Lwr	Solid	Drywall	0.01
32	1974 Bldg.	7	6/19/98	XRF	1	Classroom-101	Window	Casing-Rht	Solid	Metal	0.06
33	1974 Bldg.	181	6/19/98	XRF	1	Classroom-102	Ceiling		Solid	Drywall	0.04
34	1974 Bldg.	184	6/19/98	XRF	1	Classroom-102	Door	Door	Solid	Metal	0
35	1974 Bldg.	185	6/19/98	XRF	1	Classroom-102	Door	Door	Solid	Wood	0.04
36	1974 Bldg.	186	6/19/98	XRF	1	Classroom-102	Door	Casing-Rht	Solid	Metal	0
37	1974 Bldg.	187	6/19/98	XRF	1	Classroom-102	Univent		Solid	Metal	0
38	1974 Bldg.	180	6/19/98	XRF	1	Classroom-102	Wall	Midle Wall	Solid	Drywall	0
39	1974 Bldg.	182	6/19/98	XRF	1	Classroom-102	Wall	Midle Wall	Solid	Wood	0.41
40	1974 Bldg.	183	6/19/98	XRF	1	Classroom-102	Window	Casing-Rht	Solid	Metal	0.05
41	1974 Bldg.	17	6/19/98	XRF	1	Classroom-103	Ceiling		Solid	Drywall	0
42	1974 Bldg.	19	6/19/98	XRF	1	Classroom-103	Door	Door	Solid	Wood	0.06
43	1974 Bldg.	20	6/19/98	XRF	1	Classroom-103	Door	Jamb-Rht	Solid	Metal	0
44	1974 Bldg.	22	6/19/98	XRF	1	Classroom-103	Door	Door	Solid	Metal	0
45	1974 Bldg.	21	6/19/98	XRF	1	Classroom-103	Univent		Cracked	Metal	0
46	1974 Bldg.	15	6/19/98	XRF	1	Classroom-103	Wall	Wall-Lwr	Solid	Drywall	0.01
47	1974 Bldg.	16	6/19/98	XRF	1	Classroom-103	Wall	Midle Wall	Solid	Wood	0.4
48	1974 Bldg.	18	6/19/98	XRF	1	Classroom-103	Window	Casing-Rht	Cracked	Metal	0.12
49	1974 Bldg.	31	6/19/98	XRF	1	Classroom-104	Ceiling		Solid	Drywall	0
50	1974 Bldg.	29	6/19/98	XRF	1	Classroom-104	Door	Door	Solid	Metal	0.01

Saint Paul Public Schools
J.J. Hill Montessori Magnet School
Lead-Based Paint Inspection

3	A	B	C	D	E	F	G	H	I	J	K
	Site	Sample #	Date	Analysis	Floor	Area	Component	Feature	Condition	Substrate	Result
51	1974 Bldg.	30	6/19/98	XRF	1	Classroom-104	Door	Door	Solid	Wood	0.03
52	1974 Bldg.	32	6/19/98	XRF	1	Classroom-104	Door	Casing-Rht	Solid	Metal	0
53	1974 Bldg.	33	6/19/98	XRF	1	Classroom-104	Univent		Cracked	Metal	0
54	1974 Bldg.	26	6/19/98	XRF	1	Classroom-104	Wall	Wall-Lwr	Solid	Drywall	0.01
55	1974 Bldg.	27	6/19/98	XRF	1	Classroom-104	Wall	Wall-Uprr	Solid	Drywall	0.02
56	1974 Bldg.	28	6/19/98	XRF	1	Classroom-104	Window	Casing-Lft	Solid	Metal	0.08
57	1974 Bldg.	39	6/19/98	XRF	1	Classroom-105	Door	Door	Solid	Metal	0.01
58	1974 Bldg.	40	6/19/98	XRF	1	Classroom-105	Door	Door	Solid	Wood	0.15
59	1974 Bldg.	41	6/19/98	XRF	1	Classroom-105	Door	Jamb-Lft	Solid	Metal	0
60	1974 Bldg.	42	6/19/98	XRF	1	Classroom-105	Univent		Cracked	Metal	0
61	1974 Bldg.	37	6/19/98	XRF	1	Classroom-105	Wall	Midle Wall	Solid	Drywall	0.03
62	1974 Bldg.	38	6/19/98	XRF	1	Classroom-105	Window	Casing-Rht	Solid	Metal	0.08
63	1974 Bldg.	53	6/19/98	XRF	1	Classroom-106	Door	Jamb-Lft	Solid	Metal	0
64	1974 Bldg.	54	6/19/98	XRF	1	Classroom-106	Door	Door	Solid	Wood	0
65	1974 Bldg.	55	6/19/98	XRF	1	Classroom-106	Univent		Solid	Metal	0.03
66	1974 Bldg.	51	6/19/98	XRF	1	Classroom-106	Wall	Wall-Uprr	Cracked	Drywall	0.01
67	1974 Bldg.	52	6/19/98	XRF	1	Classroom-106	Window	Casing-Rht	Solid	Metal	0.04
68	1974 Bldg.	63	6/19/98	XRF	1	Classroom-107	Cabinet	Door	Solid	Metal	0
69	1974 Bldg.	60	6/19/98	XRF	1	Classroom-107	Door	Casing-Rht	Solid	Metal	0.01
70	1974 Bldg.	61	6/19/98	XRF	1	Classroom-107	Door	Door	Solid	Wood	0.02
71	1974 Bldg.	62	6/19/98	XRF	1	Classroom-107	Door	Door	Solid	Metal	0
72	1974 Bldg.	65	6/19/98	XRF	1	Classroom-107	Mini-blinds		Solid	Vinyl	0.61
73	1974 Bldg.	64	6/19/98	XRF	1	Classroom-107	Univent		Solid	Metal	0
74	1974 Bldg.	58	6/19/98	XRF	1	Classroom-107	Wall	Wall-Uprr	Solid	Drywall	0.01
75	1974 Bldg.	59	6/19/98	XRF	1	Classroom-107	Window	Casing-Rht	Solid	Metal	0.05
76	1974 Bldg.	69	6/19/98	XRF	1	Classroom-108	Coat	Rack	Solid	Metal	0.02
77	1974 Bldg.	67	6/19/98	XRF	1	Classroom-108	Door	Casing-Rht	Solid	Metal	0
78	1974 Bldg.	68	6/19/98	XRF	1	Classroom-108	Door	Door	Solid	Wood	0.03
79	1974 Bldg.	66	6/19/98	XRF	1	Classroom-108	Wall	Midle Wall	Solid	Drywall	0.01
80	1974 Bldg.	71	6/19/98	XRF	1	Classroom-109	Door	Header	Solid	Metal	0
81	1974 Bldg.	72	6/19/98	XRF	1	Classroom-109	Door	Door	Solid	Metal	0.07
82	1974 Bldg.	70	6/19/98	XRF	1	Classroom-109	Wall	Midle Wall	Solid	Drywall	0.01
83	1974 Bldg.	48	6/19/98	XRF	1	Classroom-110	Door	Jamb-Lft	Solid	Metal	0
84	1974 Bldg.	49	6/19/98	XRF	1	Classroom-110	Door	Door	Solid	Wood	0
85	1974 Bldg.	50	6/19/98	XRF	1	Classroom-110	Univent		Solid	Metal	>0.06
86	1974 Bldg.	46	6/19/98	XRF	1	Classroom-110	Wall	Wall-Lwr	Solid	Drywall	0
87	1974 Bldg.	47	6/19/98	XRF	1	Classroom-110	Window	Sash-Lwr	Solid	Metal	0
88	1974 Bldg.	274	6/19/98	XRF	0	Classroom-2	Door	Jamb-Lft	Solid	Metal	0.02
89	1974 Bldg.	275	6/19/98	XRF	0	Classroom-2	Door	Casing-Rht	Solid	Metal	>0.06
90	1974 Bldg.	277	6/19/98	XRF	0	Classroom-2	Door	Door	Solid	Wood	0.02
91	1974 Bldg.	278	6/19/98	XRF	0	Classroom-2	Door	Door	Solid	Wood	0
92	1974 Bldg.	276	6/19/98	XRF	0	Classroom-2	Univent		Solid	Metal	0.01
93	1974 Bldg.	272	6/19/98	XRF	0	Classroom-2	Wall	Wall-Lwr	Solid	Concrte	0.01
94	1974 Bldg.	273	6/19/98	XRF	0	Classroom-2	Wall	Midle Wall	Solid	Drywall	0.01
95	1974 Bldg.	194	6/19/98	XRF	2	Classroom-201	Door	Door	Solid	Wood	0
96	1974 Bldg.	195	6/19/98	XRF	2	Classroom-201	Door	Jamb-Rht	Solid	Metal	>0.02
97	1974 Bldg.	191	6/19/98	XRF	2	Classroom-201	Wall	Wall-Lwr	Solid	Drywall	0
98	1974 Bldg.	192	6/19/98	XRF	2	Classroom-201	Wall	Wall-Uprr	Solid	Drywall	0
99	1974 Bldg.	193	6/19/98	XRF	2	Classroom-201	Wall	Wall-Lwr	Solid	Concrte	0

Saint Paul Public Schools
J.J. Hill Montessori Magnet School
Lead-Based Paint Inspection

3	A	B	C	D	E	F	G	H	I	J	K
	Site	Sample #	Date	Analysis	Floor	Area	Component	Feature	Condition	Substrate	Result
100	1974 Bldg.	206	6/19/98	XRF	2	Classroom-202	Door	Door	Solid	Wood	0.05
101	1974 Bldg.	207	6/19/98	XRF	2	Classroom-202	Door	Door	Solid	Wood	0
102	1974 Bldg.	208	6/19/98	XRF	2	Classroom-202	Door	Jamb-Lft	Solid	Metal	0
103	1974 Bldg.	209	6/19/98	XRF	2	Classroom-202	Door	Jamb-Lft	Solid	Metal	0
104	1974 Bldg.	205	6/19/98	XRF	2	Classroom-202	Wall	Wall-Upr	Solid	Drywall	0.01
105	1974 Bldg.	203	6/19/98	XRF	2	Classroom-203	Door	Door	Solid	Metal	0
106	1974 Bldg.	204	6/19/98	XRF	2	Classroom-203	Univent		Solid	Metal	0
107	1974 Bldg.	201	6/19/98	XRF	2	Classroom-203	Wall	Wall-Upr	Solid	Drywall	0
108	1974 Bldg.	202	6/19/98	XRF	2	Classroom-203	Window	Casing-Rht	Solid	Metal	0.07
109	1974 Bldg.	179	6/19/98	XRF	2	Classroom-204	Closet	Wall	Solid	Concrte	0
110	1974 Bldg.	176	6/19/98	XRF	2	Classroom-204	Door	Door	Solid	Wood	0.03
111	1974 Bldg.	177	6/19/98	XRF	2	Classroom-204	Door	Jamb-Lft	Solid	Metal	0
112	1974 Bldg.	178	6/19/98	XRF	2	Classroom-204	Univent		Solid	Metal	0
113	1974 Bldg.	173	6/19/98	XRF	2	Classroom-204	Wall	Wall-Lwr	Solid	Concrte	0.04
114	1974 Bldg.	174	6/19/98	XRF	2	Classroom-204	Wall	Midle Wall	Solid	Drywall	0.01
115	1974 Bldg.	175	6/19/98	XRF	2	Classroom-204	Window	Casing-Rht	Solid	Metal	0.04
116	1974 Bldg.	198	6/19/98	XRF	2	Classroom-205	Door	Door	Solid	Wood	0
117	1974 Bldg.	199	6/19/98	XRF	2	Classroom-205	Door	Casing-Rht	Solid	Metal	>0.03
118	1974 Bldg.	200	6/19/98	XRF	2	Classroom-205	Univent		Solid	Metal	0.01
119	1974 Bldg.	196	6/19/98	XRF	2	Classroom-205	Wall	Midle Wall	Solid	Drywall	0
120	1974 Bldg.	197	6/19/98	XRF	2	Classroom-205	Window	Casing-Rht	Solid	Metal	0.06
121	1974 Bldg.	213	6/19/98	XRF	2	Classroom-207	Door	Door	Solid	Wood	0.07
122	1974 Bldg.	214	6/19/98	XRF	2	Classroom-207	Door	Jamb-Lft	Solid	Plaster	0
123	1974 Bldg.	215	6/19/98	XRF	2	Classroom-207	Univent		Solid	Metal	0.04
124	1974 Bldg.	210	6/19/98	XRF	2	Classroom-207	Wall	Midle Wall	Solid	Concrte	0.02
125	1974 Bldg.	211	6/19/98	XRF	2	Classroom-207	Wall	Wall-Upr	Solid	Drywall	0.01
126	1974 Bldg.	212	6/19/98	XRF	2	Classroom-207	Window	Casing-Rht	Solid	Metal	0.02
127	1974 Bldg.	218	6/19/98	XRF	2	Classroom-208	Door	Casing-Rht	Solid	Metal	0.01
128	1974 Bldg.	219	6/19/98	XRF	2	Classroom-208	Door	Door	Solid	Wood	0.05
129	1974 Bldg.	216	6/19/98	XRF	2	Classroom-208	Wall	Midle Wall	Solid	Drywall	0
130	1974 Bldg.	217	6/19/98	XRF	2	Classroom-208	Window	Casing-Rht	Solid	Metal	0.03
131	1974 Bldg.	221	6/19/98	XRF	2	Classroom-209	Door	Door	Solid	Wood	0
132	1974 Bldg.	222	6/19/98	XRF	2	Classroom-209	Door	Door	Solid	Wood	0.03
133	1974 Bldg.	223	6/19/98	XRF	2	Classroom-209	Door	Jamb-Lft	Solid	Metal	0
134	1974 Bldg.	224	6/19/98	XRF	2	Classroom-209	Door	Jamb-Rht	Solid	Metal	>0.03
135	1974 Bldg.	220	6/19/98	XRF	2	Classroom-209	Wall	Midle Wall	Solid	Drywall	0.03
136	1974 Bldg.	227	6/19/98	XRF	2	Classroom-210	Door	Door	Solid	Wood	0
137	1974 Bldg.	228	6/19/98	XRF	2	Classroom-210	Univent		Solid	Metal	0.01
138	1974 Bldg.	225	6/19/98	XRF	2	Classroom-210	Wall	Wall-Lwr	Solid	Concrte	0.04
139	1974 Bldg.	226	6/19/98	XRF	2	Classroom-210	Wall	Midle Wall	Solid	Drywall	>0.11
140	1974 Bldg.	271	6/19/98	XRF	0	Classroom-3	Door	Door	Solid	Wood	0
141	1974 Bldg.	270	6/19/98	XRF	0	Classroom-3	Univent		Solid	Metal	0
142	1974 Bldg.	268	6/19/98	XRF	0	Classroom-3	Wall	Midle Wall	Solid	Concrte	0.02
143	1974 Bldg.	269	6/19/98	XRF	0	Classroom-3	Wall	Midle Wall	Solid	Drywall	0
144	1974 Bldg.	265	6/19/98	XRF	0	Classroom-4	Door	Door	Solid	Wood	0.02
145	1974 Bldg.	266	6/19/98	XRF	0	Classroom-4	Door	Jamb-Lft	Solid	Metal	0
146	1974 Bldg.	267	6/19/98	XRF	0	Classroom-4	Univent		Solid	Metal	0.02
147	1974 Bldg.	262	6/19/98	XRF	0	Classroom-4	Wall	Wall-Upr	Solid	Concrte	0
148	1974 Bldg.	263	6/19/98	XRF	0	Classroom-4	Wall	Wall-Upr	Solid	Drywall	0.01

Saint Paul Public Schools
J.J. Hill Montessori Magnet School
Lead-Based Paint Inspection

3	A	B	C	D	E	F	G	H	I	J	K
	Site	Sample #	Date	Analysis	Floor	Area	Component	Feature	Condition	Substrate	Result
149	1974 Bldg.	264	6/19/98	XRF	0	Classroom-4	Window	Casing-Rht	Solid	Metal	0.06
150	1974 Bldg.	259	6/19/98	XRF	0	Classroom-5	Door	Casing-Lft	Solid	Metal	0
151	1974 Bldg.	260	6/19/98	XRF	0	Classroom-5	Door	Door	Solid	Wood	0.09
152	1974 Bldg.	261	6/19/98	XRF	0	Classroom-5	Univent		Solid	Metal	0.01
153	1974 Bldg.	256	6/19/98	XRF	0	Classroom-5	Wall	Midle Wall	Solid	Drywall	0.02
154	1974 Bldg.	257	6/19/98	XRF	0	Classroom-5	Wall	Midle Wall	Solid	Concrte	0
155	1974 Bldg.	258	6/19/98	XRF	0	Classroom-5	Window	Casing-Rht	Solid	Metal	0.04
156	1974 Bldg.	310	6/19/98	XRF	0	Classroom-6	Door	Casing-Rht	Solid	Metal	0.01
157	1974 Bldg.	311	6/19/98	XRF	0	Classroom-6	Door	Door	Solid	Wood	0.02
158	1974 Bldg.	312	6/19/98	XRF	0	Classroom-6	Univent		Solid	Metal	0.01
159	1974 Bldg.	307	6/19/98	XRF	0	Classroom-6	Wall	Wall-Lwr	Solid	Drywall	0.03
160	1974 Bldg.	308	6/19/98	XRF	0	Classroom-6	Wall	Wall-Lwr	Solid	Concrte	0.02
161	1974 Bldg.	309	6/19/98	XRF	0	Classroom-6	Window	Casing-Rht	Solid	Metal	0.05
162	1974 Bldg.	305	6/19/98	XRF	0	Classroom-7	Door	Door	Solid	Wood	0.04
163	1974 Bldg.	306	6/19/98	XRF	0	Classroom-7	Door	Casing-Rht	Solid	Metal	0
164	1974 Bldg.	304	6/19/98	XRF	0	Classroom-7	Univent		Solid	Metal	0
165	1974 Bldg.	300	6/19/98	XRF	0	Classroom-7	Wall	Midle Wall	Solid	Concrte	>0.07
166	1974 Bldg.	301	6/19/98	XRF	0	Classroom-7	Wall	Midle Wall	Solid	Drywall	0.02
167	1974 Bldg.	302	6/19/98	XRF	0	Classroom-7	Wall	Wall-Up	Solid	Concrte	0.02
168	1974 Bldg.	303	6/19/98	XRF	0	Classroom-7	Window	Casing-Rht	Solid	Metal	0.03
169	1974 Bldg.	299	6/19/98	XRF	0	Classroom-8	Door	Door	Solid	Wood	0
170	1974 Bldg.	298	6/19/98	XRF	0	Classroom-8	Univent		Solid	Metal	0.01
171	1974 Bldg.	295	6/19/98	XRF	0	Classroom-8	Wall	Wall-Lwr	Solid	Concrte	0
172	1974 Bldg.	296	6/19/98	XRF	0	Classroom-8	Wall	Wall-Up	Solid	Drywall	0
173	1974 Bldg.	297	6/19/98	XRF	0	Classroom-8	Window	Casing-Rht	Solid	Metal	>0.04
174	1974 Bldg.	292	6/19/98	XRF	0	Classroom-9	Door	Door	Solid	Wood	0
175	1974 Bldg.	293	6/19/98	XRF	0	Classroom-9	Door	Door	Solid	Wood	0.06
176	1974 Bldg.	294	6/19/98	XRF	0	Classroom-9	Door	Jamb-Rht	Solid	Metal	0
177	1974 Bldg.	289	6/19/98	XRF	0	Classroom-9	Wall	Midle Wall	Solid	Concrte	0
178	1974 Bldg.	290	6/19/98	XRF	0	Classroom-9	Wall	Wall-Up	Solid	Drywall	0.01
179	1974 Bldg.	291	6/19/98	XRF	0	Classroom-9	Window	Casing-Rht	Solid	Metal	>0.03
180	1974 Bldg.	158	6/19/98	XRF	1	Gym-0	Ceiling		Solid	Drywall	0.01
181	1974 Bldg.	157	6/19/98	XRF	1	Gym-0	Closet	Wall	Solid	Concrte	0
182	1974 Bldg.	152	6/19/98	XRF	1	Gym-0	Door	Door	Solid	Metal	0.01
183	1974 Bldg.	153	6/19/98	XRF	1	Gym-0	Door	Door	Solid	Wood	0.04
184	1974 Bldg.	154	6/19/98	XRF	1	Gym-0	Door	Casing-Rht	Solid	Metal	0
185	1974 Bldg.	146	6/19/98	XRF	1	Gym-0	Wall	Wall-Lwr	Solid	Concrte	0
186	1974 Bldg.	147	6/19/98	XRF	1	Gym-0	Wall	Midle Wall	Solid	Concrte	0
187	1974 Bldg.	148	6/19/98	XRF	1	Gym-0	Wall	Wall-Up	Solid	Concrte	0.02
188	1974 Bldg.	149	6/19/98	XRF	1	Gym-0	Wall	Midle Wall	Solid	Wood	0.01
189	1974 Bldg.	150	6/19/98	XRF	1	Gym-0	Wall	Midle Wall	Solid	Wood	0
190	1974 Bldg.	151	6/19/98	XRF	1	Gym-0	Wall	Wall Rgstr	Solid	Metal	0.01
191	1974 Bldg.	155	6/19/98	XRF	1	Gym-0		Backboard	Solid	Wood	0.01
192	1974 Bldg.	156	6/19/98	XRF	1	Gym-0		Transom	Solid	Metal	0.01
193	1974 Bldg.	78	6/19/98	XRF	1	Hall-1	Cabinet	Door	Solid	Metal	0.03
194	1974 Bldg.	74	6/19/98	XRF	1	Hall-1	Door	Door	Solid	Metal	0.02
195	1974 Bldg.	75	6/19/98	XRF	1	Hall-1	Door	Door	Solid	Wood	0.03
196	1974 Bldg.	76	6/19/98	XRF	1	Hall-1	Door	Casing-Rht	Peeling	Metal	0
197	1974 Bldg.	73	6/19/98	XRF	1	Hall-1	Wall	Midle Wall	Solid	Drywall	0.01

Saint Paul Public Schools
J.J. Hill Montessori Magnet School
Lead-Based Paint Inspection

3	A	B	C	D	E	F	G	H	I	J	K
	Site	Sample #	Date	Analysis	Floor	Area	Component	Feature	Condition	Substrate	Result
198	1974 Bldg.	77	6/19/98	XRF	1	Hall-1		Radiator	Solid	Metal	>0.02
199	1974 Bldg.	79	6/19/98	XRF	1	Hall-1		Column	Solid	Metal	0
200	1974 Bldg.	231	6/19/98	XRF	2	Hall-2	Door	Door	Solid	Metal	0
201	1974 Bldg.	232	6/19/98	XRF	2	Hall-2	Door	Jamb-Lft	Solid	Metal	0.01
202	1974 Bldg.	240	6/19/98	XRF	2	Hall-2	Stairs	Hand rail	Peeling	Metal	0.02
203	1974 Bldg.	241	6/19/98	XRF	2	Hall-2	Stairs	Hand rail	Solid	Concrte	0.01
204	1974 Bldg.	229	6/19/98	XRF	2	Hall-2	Wall	Midle Wall	Solid	Concrte	0
205	1974 Bldg.	230	6/19/98	XRF	2	Hall-2	Wall	Wall-Upr	Solid	Drywall	>0.08
206	1974 Bldg.	239	6/19/98	XRF	2	Hall-2		Column	Solid	Concrte	0
207	1974 Bldg.	320	6/19/98	XRF	0	Hall-3	Door	Door	Solid	Metal	0.01
208	1974 Bldg.	321	6/19/98	XRF	0	Hall-3	Door	Jamb-Lft	Solid	Metal	0
209	1974 Bldg.	331	6/19/98	XRF	0	Hall-3	Door	Door	Solid	Metal	0
210	1974 Bldg.	332	6/19/98	XRF	0	Hall-3	Door	Jamb-Lft	Solid	Metal	0.01
211	1974 Bldg.	319	6/19/98	XRF	0	Hall-3	Wall	Midle Wall	Solid	Concrte	>0.11
212	1974 Bldg.	322	6/19/98	XRF	0	Hall-3	Wall	Midle Wall	Solid	Concrte	0
213	1974 Bldg.	323	6/19/98	XRF	0	Hall-3	Wall	Wall-Upr	Solid	Drywall	0
214	1974 Bldg.	324	6/19/98	XRF	0	Hall-3	Wall	Column	Solid	Drywall	0.03
215	1974 Bldg.	140	6/19/98	XRF	1	Kitchen-1	Cabinet	Door	Solid	Metal	0.01
216	1974 Bldg.	133	6/19/98	XRF	1	Kitchen-1	Ceiling		Solid	Drywall	0
217	1974 Bldg.	139	6/19/98	XRF	1	Kitchen-1	Closet	Wall	Solid	Concrte	0.01
218	1974 Bldg.	134	6/19/98	XRF	1	Kitchen-1	Door	Door	Solid	Metal	0
219	1974 Bldg.	135	6/19/98	XRF	1	Kitchen-1	Door	Casing-Rht	Solid	Metal	0
220	1974 Bldg.	136	6/19/98	XRF	1	Kitchen-1	Door	Casing-Rht	Solid	Metal	0
221	1974 Bldg.	132	6/19/98	XRF	1	Kitchen-1	Wall	Wall-Lwr	Solid	Concrte	0.01
222	1974 Bldg.	138	6/19/98	XRF	1	Kitchen-1	Wall	Wall-Upr	Solid	Concrte	0
223	1974 Bldg.	137	6/19/98	XRF	1	Kitchen-1		Radiator	Solid	Metal	0
224	1974 Bldg.	80	6/19/98	XRF	1	Library-0	Wall	Midle Wall	Solid	Drywall	0.03
225	1974 Bldg.	81	6/19/98	XRF	1	Library-0	Window	Casing-Rht	Solid	Metal	0
226	1974 Bldg.	121	6/19/98	XRF	1	Lounge-1	Door	Casing-Rht	Solid	Metal	0
227	1974 Bldg.	122	6/19/98	XRF	1	Lounge-1	Door	Door	Solid	Wood	0.04
228	1974 Bldg.	119	6/19/98	XRF	1	Lounge-1	Wall	Midle Wall	Solid	Concrte	0
229	1974 Bldg.	120	6/19/98	XRF	1	Lounge-1	Wall	Wall-Lwr	Solid	Drywall	0.01
230	1974 Bldg.	83	6/19/98	XRF	1	Other-1	Door	Door	Solid	Wood	0.03
231	1974 Bldg.	82	6/19/98	XRF	1	Other-1	Wall	Wall-Upr	Solid	Drywall	0.09
232	1974 Bldg.	84	6/19/98	XRF	1	Other-1	Window	Casing-Rht	Solid	Metal	0.02
233	1974 Bldg.	118	6/19/98	XRF	1	Other-2	Bookcase	Shelf	Solid	Wood	0
234	1974 Bldg.	92	6/19/98	XRF	1	Other-2	Door	Door	Solid	Wood	0.06
235	1974 Bldg.	95	6/19/98	XRF	1	Other-2	Door	Casing-Rht	Solid	Metal	0
236	1974 Bldg.	97	6/19/98	XRF	1	Other-2	Mini-blinds		Solid	Vinyl	0.72
237	1974 Bldg.	98	6/19/98	XRF	1	Other-2	Mini-blinds		Solid	Vinyl	0
238	1974 Bldg.	90	6/19/98	XRF	1	Other-2	Wall	Midle Wall	Solid	Drywall	0.03
239	1974 Bldg.	93	6/19/98	XRF	1	Other-2	Wall	Wall-Upr	Solid	Concrte	0.02
240	1974 Bldg.	94	6/19/98	XRF	1	Other-2	Wall	Midle Wall	Solid	Drywall	0.01
241	1974 Bldg.	91	6/19/98	XRF	1	Other-2	Window	Casing-Rht	Solid	Metal	0
242	1974 Bldg.	96	6/19/98	XRF	1	Other-2	Window	Casing-Rht	Solid	Metal	0.04
243	1974 Bldg.	99	6/19/98	XRF	1	Other-2		Radiator	Solid	Metal	0.02
244	1974 Bldg.	110	6/19/98	XRF	1	Other-3	Door	Door	Solid	Wood	0.05
245	1974 Bldg.	111	6/19/98	XRF	1	Other-3	Door	Casing-Rht	Solid	Metal	0
246	1974 Bldg.	113	6/19/98	XRF	1	Other-3	Door	Door	Solid	Wood	0.02

Saint Paul Public Schools
J.J. Hill Montessori Magnet School
Lead-Based Paint Inspection

3	A	B	C	D	E	F	G	H	I	J	K
	Site	Sample #	Date	Analysis	Floor	Area	Component	Feature	Condition	Substrate	Result
247	1974 Bldg.	115	6/19/98	XRF	1	Other-3	Door	Door	Solid	Wood	0.04
248	1974 Bldg.	109	6/19/98	XRF	1	Other-3	Wall	Midle Wall	Solid	Drywall	0.01
249	1974 Bldg.	114	6/19/98	XRF	1	Other-3	Wall	Wall-Upr	Solid	Drywall	0.02
250	1974 Bldg.	123	6/19/98	XRF	1	Other-3	Wall	Midle Wall	Solid	Drywall	0.01
251	1974 Bldg.	112	6/19/98	XRF	1	Other-3	Window	Casing-Rht	Solid	Metal	0.01
252	1974 Bldg.	253	6/19/98	XRF	1	Other-9	Ceiling		Solid	Drywall	0.01
253	1974 Bldg.	254	6/19/98	XRF	1	Other-9	Door	Door	Solid	Metal	0.01
254	1974 Bldg.	255	6/19/98	XRF	1	Other-9	Door	Jamb-Rht	Solid	Metal	0
255	1974 Bldg.	248	6/19/98	XRF	1	Other-9	Floor		Peeling	Concrte	0.01
256	1974 Bldg.	249	6/19/98	XRF	1	Other-9	Stairs	Hand rail	Solid	Metal	0.01
257	1974 Bldg.	250	6/19/98	XRF	1	Other-9	Stairs	Hand rail	Cracked	Metal	0.23
258	1974 Bldg.	251	6/19/98	XRF	1	Other-9	Stairs	Tread	Solid	Metal	0.05
259	1974 Bldg.	252	6/19/98	XRF	1	Other-9	Stairs	Column	Cracked	Metal	0
260	1974 Bldg.	334	6/19/98	XRF	0	Other-10	Ceiling		Solid	Drywall	0.01
261	1974 Bldg.	336	6/19/98	XRF	0	Other-10	Door	Door	Solid	Metal	0.01
262	1974 Bldg.	337	6/19/98	XRF	0	Other-10	Door	Casing-Rht	Solid	Metal	0
263	1974 Bldg.	335	6/19/98	XRF	0	Other-10	Floor		Peeling	Concrte	0.02
264	1974 Bldg.	333	6/19/98	XRF	0	Other-10	Wall	Midle Wall	Solid	Concrte	0
265	1974 Bldg.	342	6/19/98	XRF	0	Outside-0	Ceiling		Solid	Stucco	0
266	1974 Bldg.	338	6/19/98	XRF	0	Outside-0	Door	Door	Solid	Metal	0
267	1974 Bldg.	339	6/19/98	XRF	0	Outside-0	Door	Jamb	Solid	Metal	0
268	1974 Bldg.	344	6/19/98	XRF	0	Outside-0	Ext Wall	Siding	Solid	Wood	0
269	1974 Bldg.	345	6/19/98	XRF	0	Outside-0	Ext Wall	Siding	Solid	Metal	0.33
270	1974 Bldg.	340	6/19/98	XRF	0	Outside-0	Stairs	Hand rail	Solid	Metal	0.31
271	1974 Bldg.	341	6/19/98	XRF	0	Outside-0	Stairs	Column	Solid	Metal	0
272	1974 Bldg.	343	6/19/98	XRF	0	Outside-0	Window	Sash-Ext	Solid	Wood	0.07
273	1974 Bldg.	346	6/19/98	XRF	0	Outside-0		Siding	Peeling	Wood	0.02
274	1974 Bldg.	14	6/19/98	XRF	1	Restroom-1	Ceiling		Solid	Drywall	>0.03
275	1974 Bldg.	12	6/19/98	XRF	1	Restroom-1	Floor		Solid	Tile	>0.13
276	1974 Bldg.	13	6/19/98	XRF	1	Restroom-1	Wall	Wall-Upr	Solid	Drywall	0
277	1974 Bldg.	190	6/19/98	XRF	1	Restroom-10	Ceiling		Solid	Drywall	0
278	1974 Bldg.	188	6/19/98	XRF	1	Restroom-10	Floor		Solid	Tile	0.07
279	1974 Bldg.	189	6/19/98	XRF	1	Restroom-10	Wall	Midle Wall	Solid	Drywall	0
280	1974 Bldg.	238	6/19/98	XRF	2	Restroom-11	Ceiling		Solid	Drywall	0.01
281	1974 Bldg.	233	6/19/98	XRF	2	Restroom-11	Floor		Solid	Tile	0.04
282	1974 Bldg.	234	6/19/98	XRF	2	Restroom-11	Wall	Wall-Upr	Solid	Tile	0.02
283	1974 Bldg.	235	6/19/98	XRF	2	Restroom-11	Wall	Midle Wall	Solid	Concrte	0.05
284	1974 Bldg.	236	6/19/98	XRF	2	Restroom-11	Wall	Stall Door	Solid	Metal	0.59
285	1974 Bldg.	237	6/19/98	XRF	2	Restroom-11	Wall	Bthrm Stil	Solid	Metal	0.01
286	1974 Bldg.	245	6/19/98	XRF	2	Restroom-12	Ceiling		Solid	Drywall	0
287	1974 Bldg.	246	6/19/98	XRF	2	Restroom-12	Door	Stall Door	Solid	Metal	0.57
288	1974 Bldg.	242	6/19/98	XRF	2	Restroom-12	Floor		Solid	Tile	0.03
289	1974 Bldg.	243	6/19/98	XRF	2	Restroom-12	Wall	Midle Wall	Solid	Concrte	0.01
290	1974 Bldg.	244	6/19/98	XRF	2	Restroom-12	Wall	Midle Wall	Peeling	Concrte	0
291	1974 Bldg.	247	6/19/98	XRF	2	Restroom-12	Wall	Bthrm Stil	Solid	Metal	0
292	1974 Bldg.	318	6/19/98	XRF	0	Restroom-13	Ceiling		Solid	Drywall	0.13
293	1974 Bldg.	313	6/19/98	XRF	0	Restroom-13	Floor		Solid	Tile	0.01
294	1974 Bldg.	314	6/19/98	XRF	0	Restroom-13	Wall	Midle Wall	Solid	Concrte	0.02
295	1974 Bldg.	315	6/19/98	XRF	0	Restroom-13	Wall	Midle Wall	Solid	Concrte	0

Saint Paul Public Schools
J.J. Hill Montessori Magnet School
Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K
3	Site	Sample #	Date	Analysis	Floor	Area	Component	Feature	Condition	Substrate	Result
296	1974 Bldg.	316	6/19/98	XRF	0	Restroom-13	Wall	Stall Door	Solid	Metal	0.69
297	1974 Bldg.	317	6/19/98	XRF	0	Restroom-13	Wall	Bthrm Still	Solid	Metal	0
298	1974 Bldg.	328	6/19/98	XRF	0	Restroom-14	Ceiling		Solid	Drywall	>0.27
299	1974 Bldg.	329	6/19/98	XRF	0	Restroom-14	Door	Stall Door	Solid	Metal	0.64
300	1974 Bldg.	325	6/19/98	XRF	0	Restroom-14	Floor		Solid	Tile	0.02
301	1974 Bldg.	326	6/19/98	XRF	0	Restroom-14	Wall	Midle Wall	Solid	Concrte	0.01
302	1974 Bldg.	327	6/19/98	XRF	0	Restroom-14	Wall	Midle Wall	Solid	Concrte	0
303	1974 Bldg.	330	6/19/98	XRF	0	Restroom-14	Wall	Bthrm Still	Solid	Metal	0.21
304	1974 Bldg.	25	6/19/98	XRF	1	Restroom-2	Ceiling		Solid	Drywall	0
305	1974 Bldg.	23	6/19/98	XRF	1	Restroom-2	Floor		Solid	Tile	0.09
306	1974 Bldg.	24	6/19/98	XRF	1	Restroom-2	Wall	Midle Wall	Solid	Drywall	>0.07
307	1974 Bldg.	36	6/19/98	XRF	1	Restroom-3	Ceiling		Solid	Drywall	0
308	1974 Bldg.	34	6/19/98	XRF	1	Restroom-3	Floor		Solid	Tile	0.01
309	1974 Bldg.	35	6/19/98	XRF	1	Restroom-3	Wall	Wall-Lwr	Solid	Drywall	>0.09
310	1974 Bldg.	101	6/19/98	XRF	1	Restroom-4	Floor		Solid	Tile	>0.16
311	1974 Bldg.	100	6/19/98	XRF	1	Restroom-4	Wall	Midle Wall	Solid	Drywall	0.02
312	1974 Bldg.	102	6/19/98	XRF	1	Restroom-4		Stall Door	Solid	Metal	0.62
313	1974 Bldg.	103	6/19/98	XRF	1	Restroom-4		Bthrm Still	Solid	Metal	0
314	1974 Bldg.	107	6/19/98	XRF	1	Restroom-5	Door	Stall Door	Solid	Metal	0.72
315	1974 Bldg.	104	6/19/98	XRF	1	Restroom-5	Wall	Wall-Lwr	Solid	Concrte	0.08
316	1974 Bldg.	105	6/19/98	XRF	1	Restroom-5	Wall	Wall-Upr	Solid	Drywall	0.02
317	1974 Bldg.	108	6/19/98	XRF	1	Restroom-5	Wall	Bthrm Still	Solid	Metal	0
318	1974 Bldg.	106	6/19/98	XRF	1	Restroom-5		Radiator	Solid	Metal	0
319	1974 Bldg.	117	6/19/98	XRF	1	Restroom-6	Floor		Solid	Tile	0.03
320	1974 Bldg.	116	6/19/98	XRF	1	Restroom-6	Wall	Wall-Lwr	Solid	Drywall	0.01
321	1974 Bldg.	143	6/19/98	XRF	1	Restroom-7	Ceiling		Solid	Drywall	0
322	1974 Bldg.	144	6/19/98	XRF	1	Restroom-7	Door	Casing-Rht	Solid	Metal	0
323	1974 Bldg.	145	6/19/98	XRF	1	Restroom-7	Door	Door	Solid	Wood	0.01
324	1974 Bldg.	141	6/19/98	XRF	1	Restroom-7	Floor		Solid	Tile	0.01
325	1974 Bldg.	142	6/19/98	XRF	1	Restroom-7	Wall	Midle Wall	Solid	Concrte	0
326	1974 Bldg.	162	6/19/98	XRF	1	Restroom-8	Door	Door	Solid	Wood	0.01
327	1974 Bldg.	163	6/19/98	XRF	1	Restroom-8	Door	Casing-Rht	Solid	Metal	0.01
328	1974 Bldg.	165	6/19/98	XRF	1	Restroom-8	Door	Stall Door	Solid	Metal	0.6
329	1974 Bldg.	159	6/19/98	XRF	1	Restroom-8	Floor		Solid	Tile	>0.13
330	1974 Bldg.	160	6/19/98	XRF	1	Restroom-8	Wall	Wall-Lwr	Solid	Concrte	0
331	1974 Bldg.	161	6/19/98	XRF	1	Restroom-8	Wall	Wall-Upr	Solid	Concrte	0
332	1974 Bldg.	164	6/19/98	XRF	1	Restroom-8	Wall	Bthrm Still	Solid	Metal	>0.12
333	1974 Bldg.	166	6/19/98	XRF	1	Restroom-9	Door	Stall Door	Solid	Metal	0.68
334	1974 Bldg.	169	6/19/98	XRF	1	Restroom-9	Door	Door	Solid	Wood	0.05
335	1974 Bldg.	170	6/19/98	XRF	1	Restroom-9	Door	Casing-Rht	Solid	Metal	0
336	1974 Bldg.	171	6/19/98	XRF	1	Restroom-9	Floor		Solid	Tile	0.11
337	1974 Bldg.	167	6/19/98	XRF	1	Restroom-9	Wall	Bthrm Still	Solid	Metal	>0.14
338	1974 Bldg.	168	6/19/98	XRF	1	Restroom-9	Wall	Midle Wall	Solid	Concrte	0
339	1974 Bldg.	172	6/19/98	XRF	1	Restroom-9		Radiator	Solid	Metal	0.01
340	1974 Bldg.	57	6/19/98	XRF	1	Room-111	Coat	Rack	Solid	Metal	0.05
341	1974 Bldg.	56	6/19/98	XRF	1	Room-111	Wall	Wall-Lwr	Solid	Drywall	0
342	1974 Bldg.	44	6/19/98	XRF	1	Room-112	Door	Door	Solid	Wood	0
343	1974 Bldg.	45	6/19/98	XRF	1	Room-112	Door	Jamb-Rht	Solid	Metal	0
344	1974 Bldg.	43	6/19/98	XRF	1	Room-112	Wall	Wall-Lwr	Solid	Drywall	0

APPENDIX B INSPECTOR

**Richard T. Cox
MDH Lead Inspector # 166**