


Midwest  
Environmental  
Consulting, L.L.C.

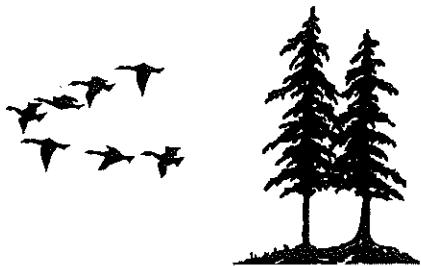

Printed on Recycled Paper

**Ames Elementary  
Saint Paul Public Schools**

**Lead-Based Paint Inspection**

**Inspection Dates: 2/3/97, 2/4/97, 2/5/97, 2/9/97, 2/10/97**

**submitted to:**

**Saint Paul Public Schools**

**MEC Project # 62/0197C**

## INTRODUCTION

At the request of Saint Paul Public Schools Environmental Safety Department, Midwest Environmental Consulting, L.L.C. (MEC), conducted a lead-based paint inspection at Ames Elementary, 1760 Ames Place, St. Paul, MN. The purpose of this inspection was to identify lead-based painted, varnished, or otherwise coated building components on the interior and exterior of the school building.

The inspection protocol incorporated applicable portions of the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-based Paint Hazards in Housing* (HUD Guidelines, June 1995) and OSHA 1926.62 requirements (Lead in Construction). The HUD guidelines are formulated to guide agencies in conducting random sampling of the interiors and exteriors of dwellings and common areas in public housing. The OSHA requirement is designed to minimize worker exposure when working with material containing lead.

Confirmatory testing was conducted when inconclusive XRF results were encountered. Inconclusive refers to XRF readings less than 0.2 mg/cm<sup>2</sup> (milligrams per square centimeter). Inconclusive results were confirmed with laboratory analysis of paint chip samples (Appendix B). This report contains a list of such results.

The United States Environmental Protection Agency defines "lead-based paint" as a paint or other surface coating that contains lead equal to or in excess of 1.0 milligrams per square centimeter when analyzed by XRF or more than 0.5% by weight (5000 parts per million) by laboratory analysis of a bulk sample.

Minnesota Department of Labor and Industry (MN OSHA) adopted the EPA lead levels for the purpose of enforcing OSHA 1926.62 federal regulations. Detection of lead in dried paint film by XRF is a dependable indicator of levels of lead and is accepted by MN OSHA.

For this Saint Paul Public Schools Lead Inspection, all building components were tested on site using a Niton XL® X-ray Fluorescence Spectrum Analyzer<sup>(1)</sup>. Building components included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases. Only painted or glazed surfaces or surfaces which were varnished were tested. Suspended ceilings, structural steel, and corrugated decking were not included in the inspection. Neither anodized (e.g., window sashes) nor plastic (e.g., vinyl baseboard and vinyl mini-blinds) were included in the scope of this inspection.

---

<sup>(1)</sup> This is a portable hand held machine that can analyze building components instantly for lead concentrations.

Each building was divided into unique sites based on the year of construction or renovation. Portable classrooms, playgrounds, and other detached buildings were automatically designated as a unique site. Each site was inspected independently assuming differences in painting history and construction characteristics.

## SITE DESCRIPTION AND BUILDING HISTORY

According to information provided to MEC by Saint Paul Public Schools, Harriet Bishop Center was constructed in essentially three phases. The initial phase includes the 22,423 square-foot older section of the building and dates from 1916. The second phase of 15,445 square feet dates from 1924. A 18,140 square foot addition from 1954 is the third addition for the purpose of this inspection.

All room and area designations used in this report are depicted on sampling maps found in Appendix A.

## XRF SAMPLE RESULTS TABLE

The results of all samples analyzed are listed in the table at the end of this section. The following is a description of the column headings:

<b>Site</b>	Each school is divided into sites based on their unique construction characteristics. Each site has a unique date of construction or major renovation.
<b>Sample #</b>	Each sample taken was given a unique number to identify the type and location of the sample. The sampling date is an integral part of the sample number.
<b>Analysis</b>	This defines the type of analysis which can be categorized into two types:  1) XRF: This is an on-site analysis using a hand held Niton XL® X-ray Fluorescence Spectrum Analyzer; 2) Bulk or Chip: This is a bulk sample where paint is removed from the substrate and sent to a laboratory for analysis;
<b>Floor</b>	This is the level of the building in which the area tested was found, example, 1 (first floor), 0 (basement), etc.
<b>Area</b>	This further defines the specific functional space inspected such as a classroom, exterior, playground, gym, kitchen, etc.

<b>Room #</b>	This is typically the actual number on the room as identified at the building.
<b>Component</b>	Building "components" included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases.
<b>Feature</b>	Identifies more detailed information of the component.
<b>Condition</b>	This describes condition of the surface, whether it is intact, cracked, peeling, or chalking.
<b>Substrate</b>	This refers to the material the building component is made of (wood, concrete, drywall, metal, etc.).
<b>Result</b>	This is the analysis results for lead. Less than 1.0 mg/cm <sup>2</sup> or less than 0.5% by weight is considered to be non-lead and these building components are below the action levels of EPA and HUD. (All results are in mg/cm <sup>2</sup> except where noted.)

The table of results is designed for quick information on lead concentrations of tested building components. Generally, all repetitions of a test combination within a given room or area, may be assumed to contain similar concentrations of lead to that of the tested sample. For instance, the lead concentration of a tested wooden window sash was found to be above the action level of 1.0 mg/cm<sup>2</sup> in a given classroom. The classroom has five windows, all of wood, the same color and appearing to be of the same era. It can be assumed that the remaining four wooden window sashes each contain lead above the action limit.

Other columns identify the component and the component feature tested, condition of the component, type of substrate and the result of the analytical test.

As an example, the following illustration shows that the wooden door jamb in Room 123, first floor in the 1923 building section was in good, solid condition, and had an XRF test result of 0.3 mg/cm<sup>2</sup>, which is below the action level.

#### Illustration Only

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1923 Bldg.	52		XRF	1	Room	123	Door	Jamb	Solid	Wood	0.3

In a similar manner, the table shows that the plaster walls in room 23, on the second floor has peeling paint with more than 1.0 mg/cm<sup>2</sup> (shaded).

**ILLUSTRATION ONLY**

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1910 Bldg.	16		XRF	2	Room	23	Door	Jamb	Peeling	Wood	0.25
1910 Bldg.	17		XRF	2	Room	23	Wall	Wall	Peeling	Plaster	1.2
1910 Bldg.	18		XRF	2	Room	23	Ceiling	Peeling	Plaster		0.25
1910 Bldg.	19		XRF	2	Room	23	Wall	Baseboard	Peeling	Wood	0.002

**APPLICABLE REGULATIONS**

When building components test above 1.0 mg/cm<sup>2</sup> of lead by XRF or 0.5% lead by weight from laboratory analysis all employees and contractors who will be working with these components in a construction related activity must be notified. The requirements of OSHA 1926.62, Lead in Construction are enforceable. This regulation defines construction work as "work for construction, alteration and/or repair, including painting and decorating." This regulation further defines monitoring requirements to minimize employee exposure to lead during construction activities.

When work is performed on external painted building structures (i.e. flashing, fire escapes, playground equipment, handrails, etc.), regulations of the Minnesota Pollution Control Agency (MPCA) may also be applicable. For removal of lead based paint from steel structures, MN Rules 7025.0200 - 7025.0380 apply to steel materials on the exterior of a building, or on the property when levels exceed 0.5 mg/cm<sup>2</sup> based on the average of three XRF spectrum results of the sample tested, or 5,000 ppm by laboratory analysis. If it is other than a steel surface, then MPCA regulates the painted surfaces under MN Rules 7025.010 - 7025.0080, when surfaces are to be disturbed using abrasive blasting methods.


Please contact MEC directly if you have questions about any portion of this report or the lead-based paint inspection itself.

**APPENDIX A**

**XRF TESTING DATA**

**WITH**

**LOCATION MAPS**


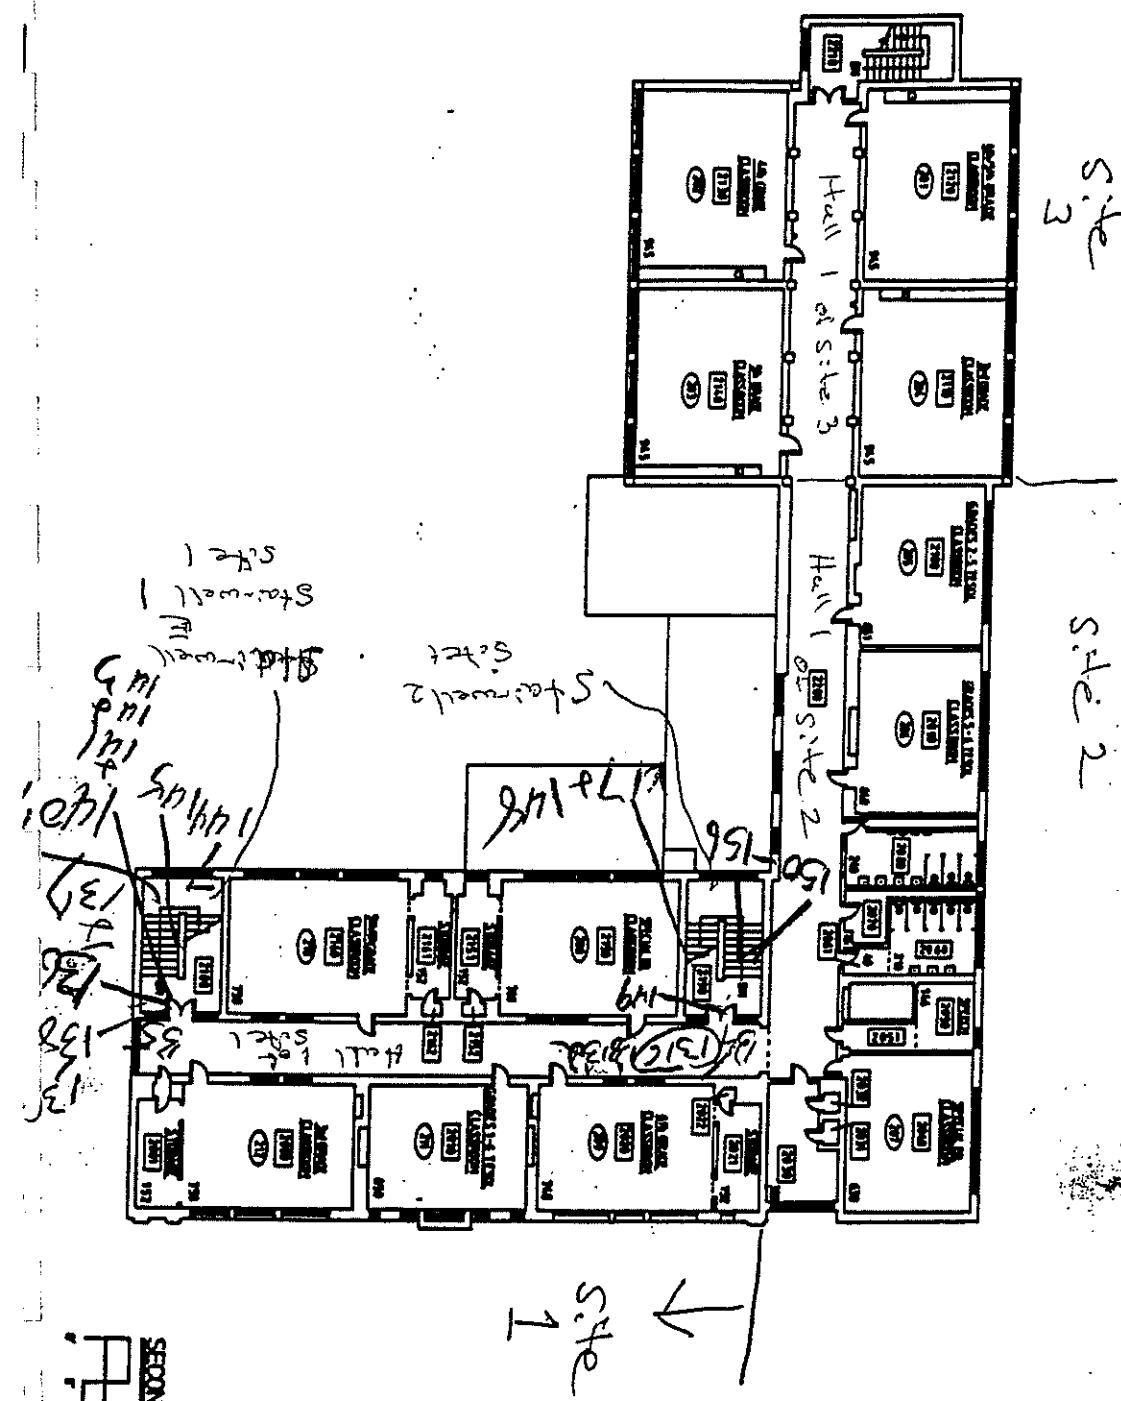


INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

AMES ELEMENTARY  
1760 AMES PLACE  
ST. PAUL, MINNESOTA

CONSTRUCTED: 1916, 24, 54

4  
5

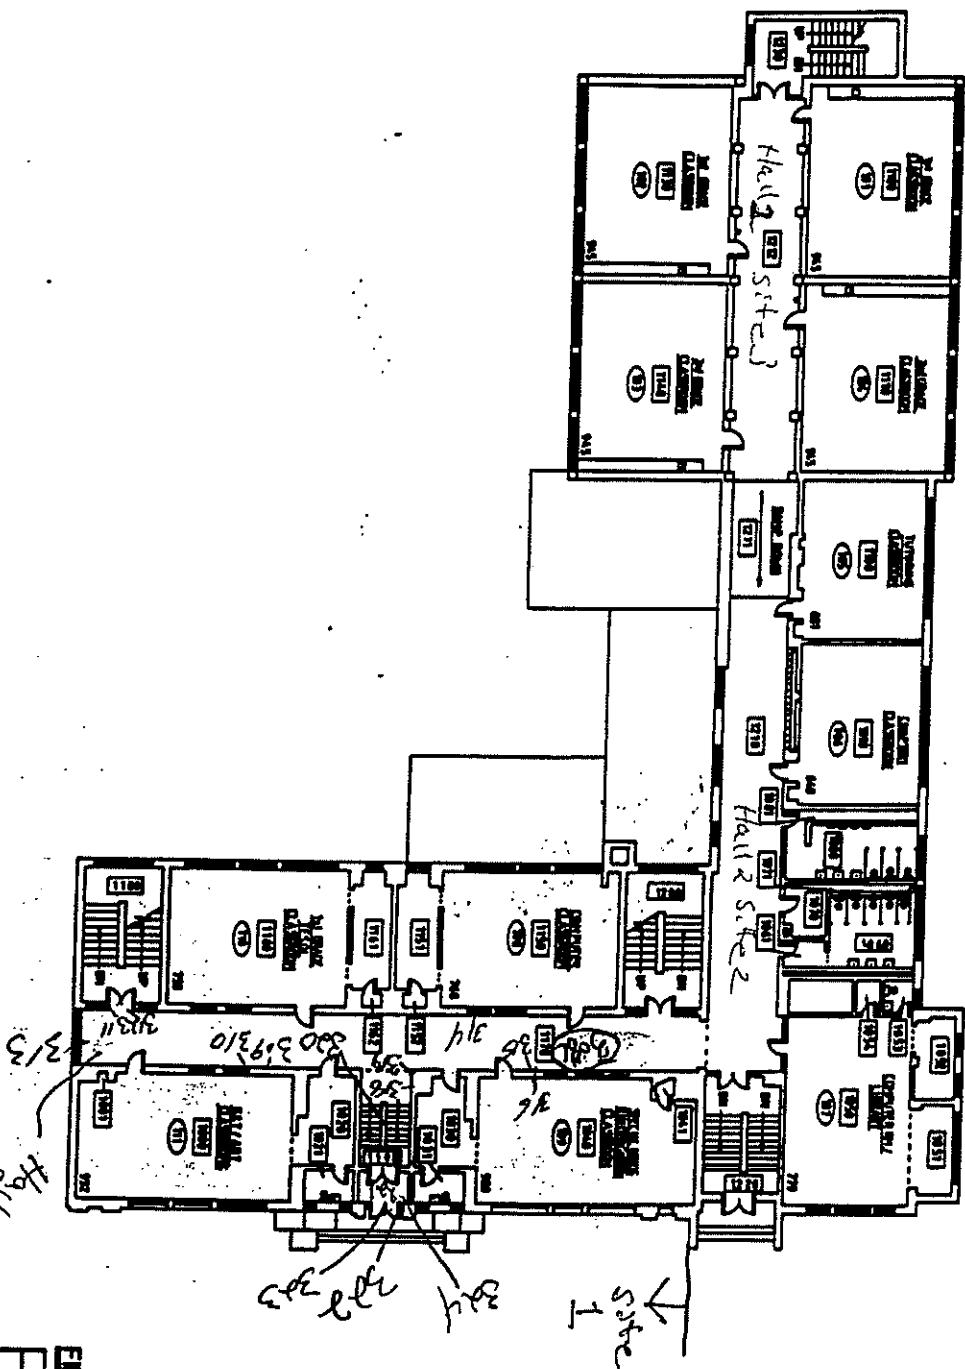

INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

AMES ELEMENTARY  
1760 AMES PLACE  
ST. PAUL, MINNESOTA

CONSTRUCTED: 1916, 24, 56


DET  
3  
5

INDEPENDENT SCHOOL DIST. #625  
300 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102


AMES ELEMENTARY  
1780 AMES PLACE  
ST. PAUL, MINNESOTA

CONSTRUCTED: 1916, 24,5%

25

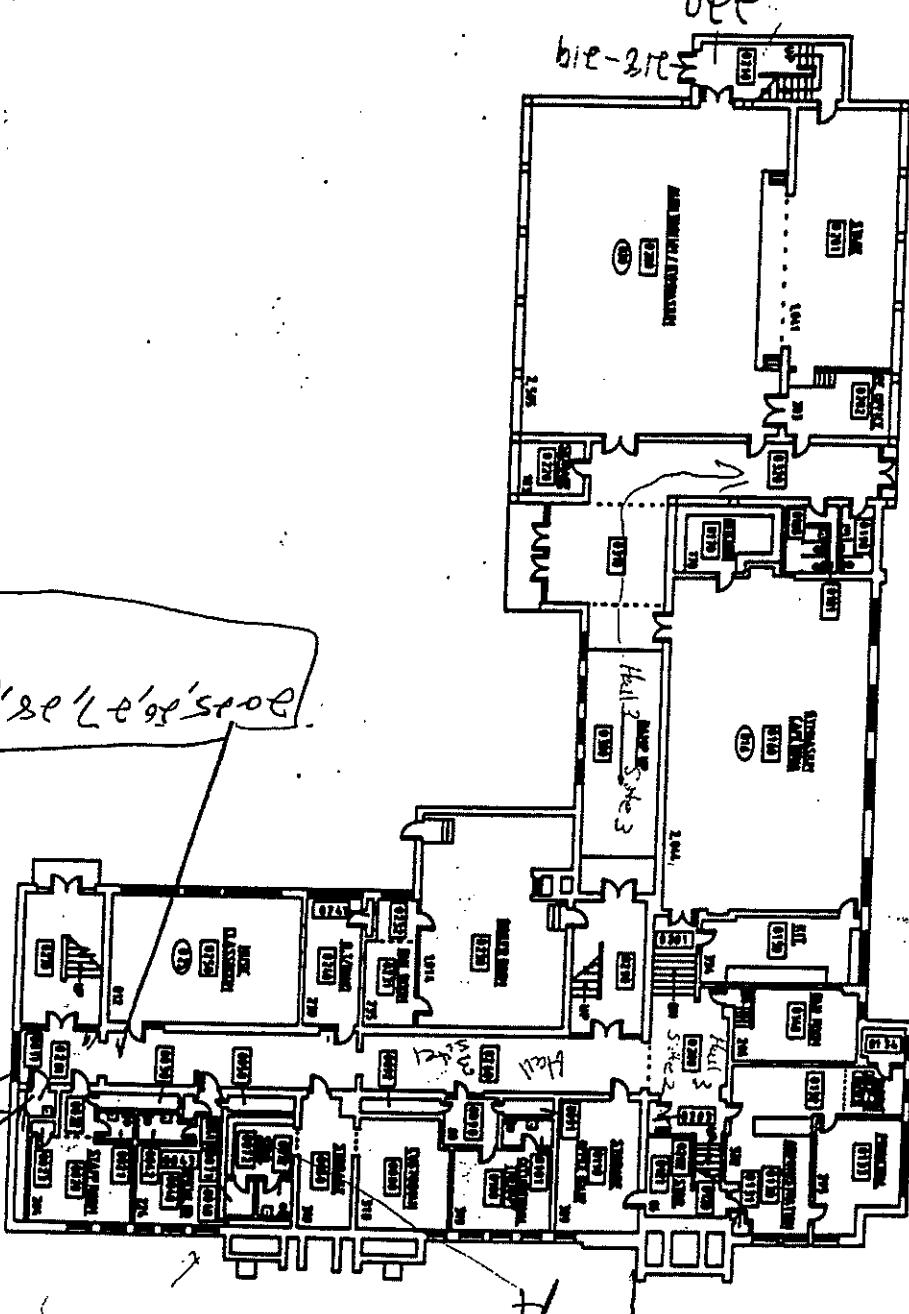

BASEMENT FLOOR PLAN

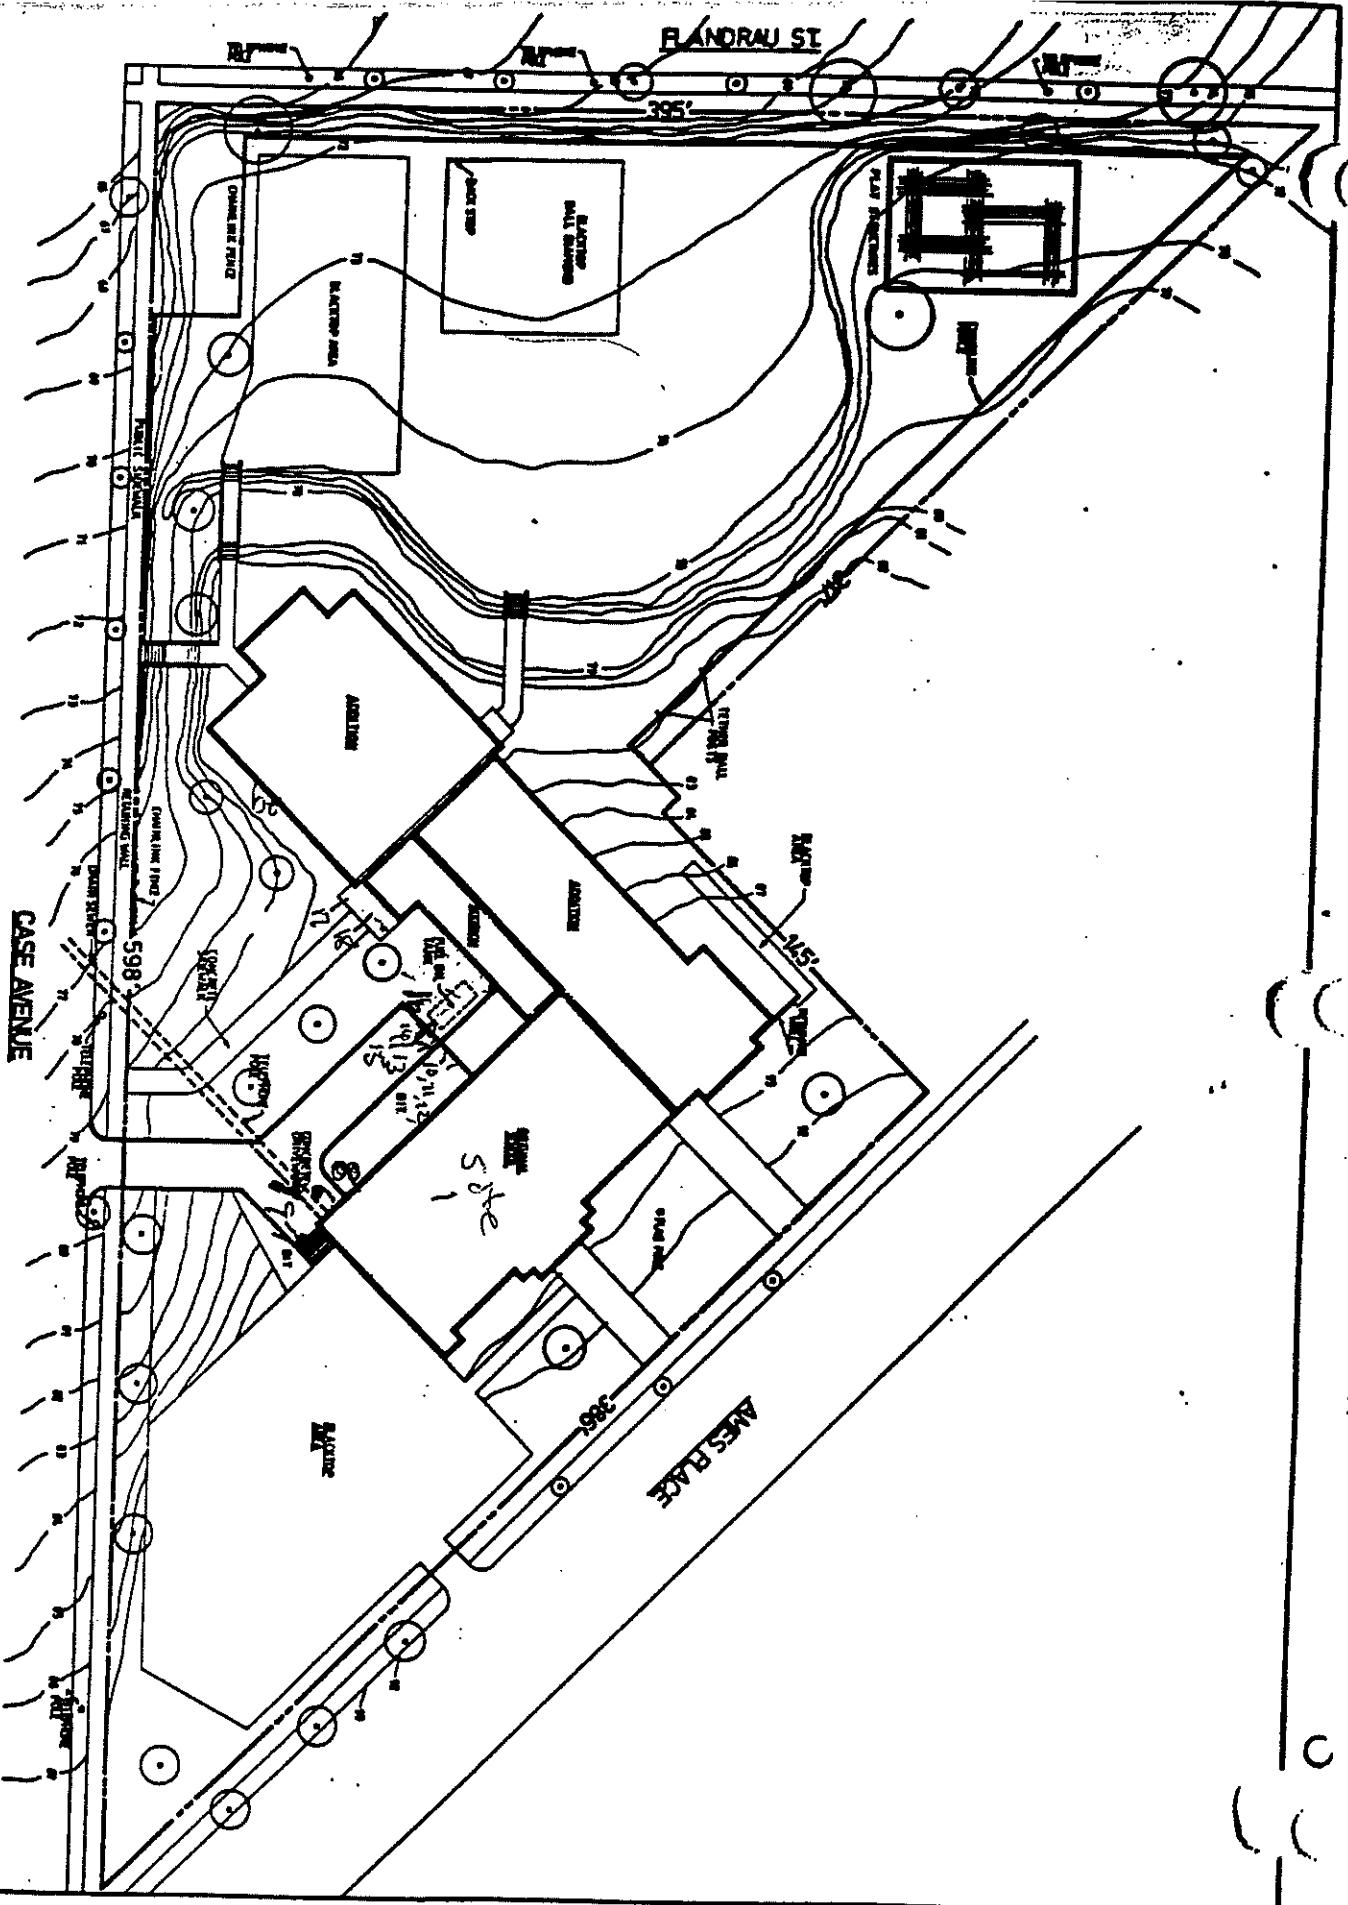

SITE PLAN




INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102


## **Ames Elementary**


---

**CONSTRUCTED:**



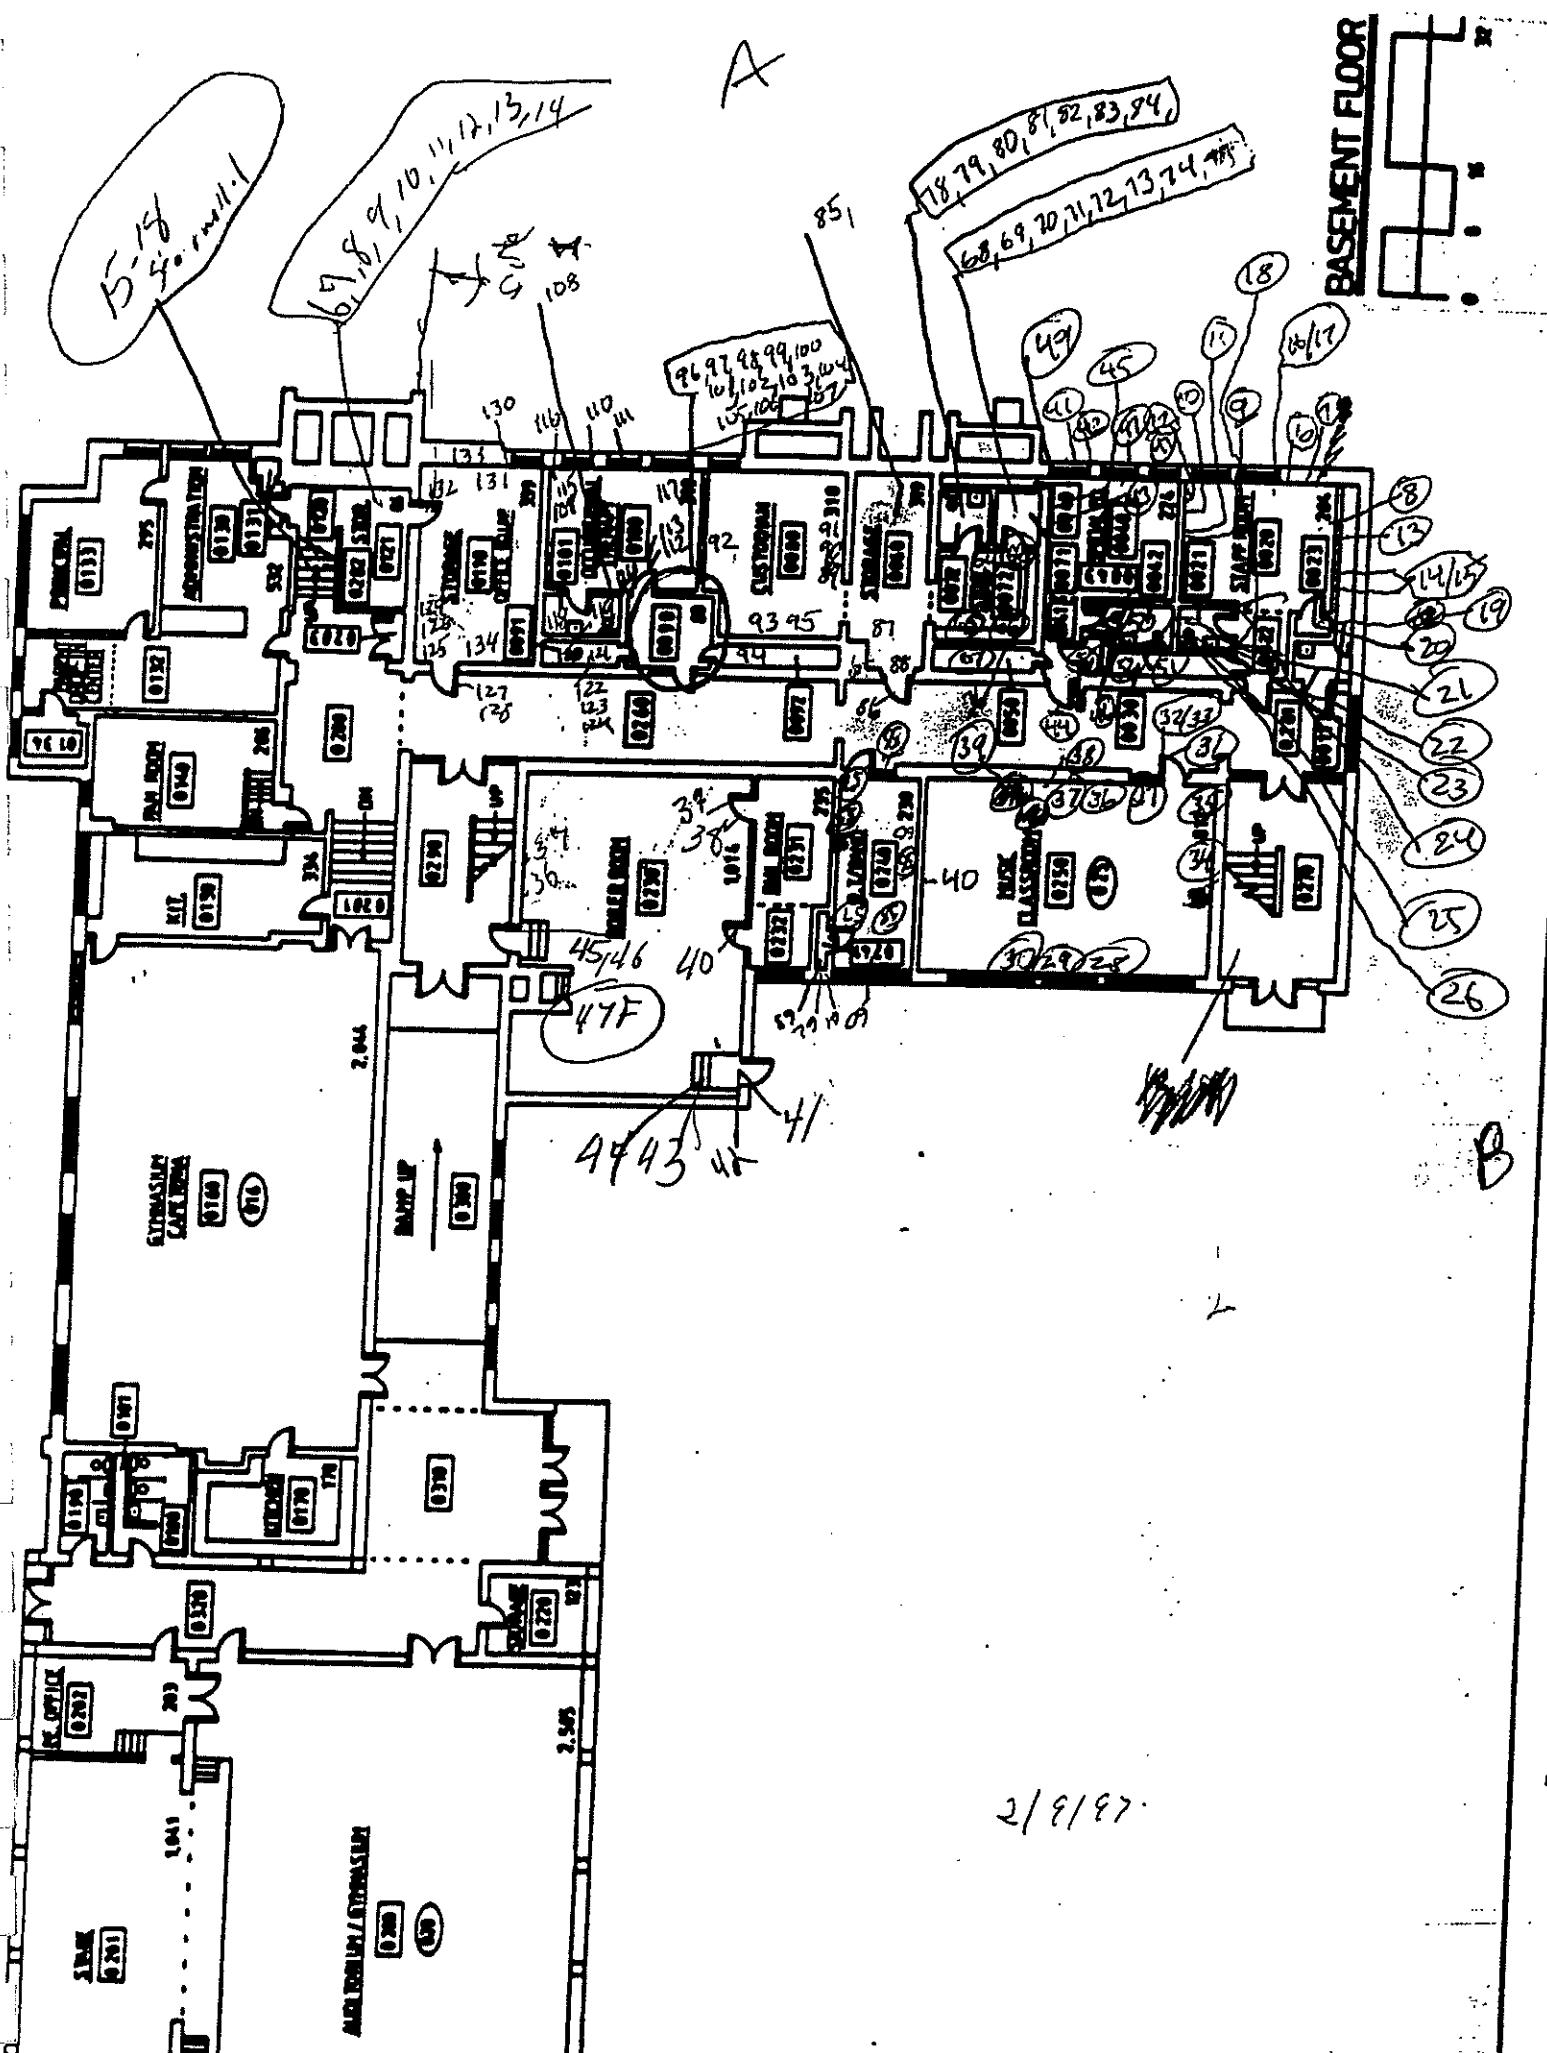

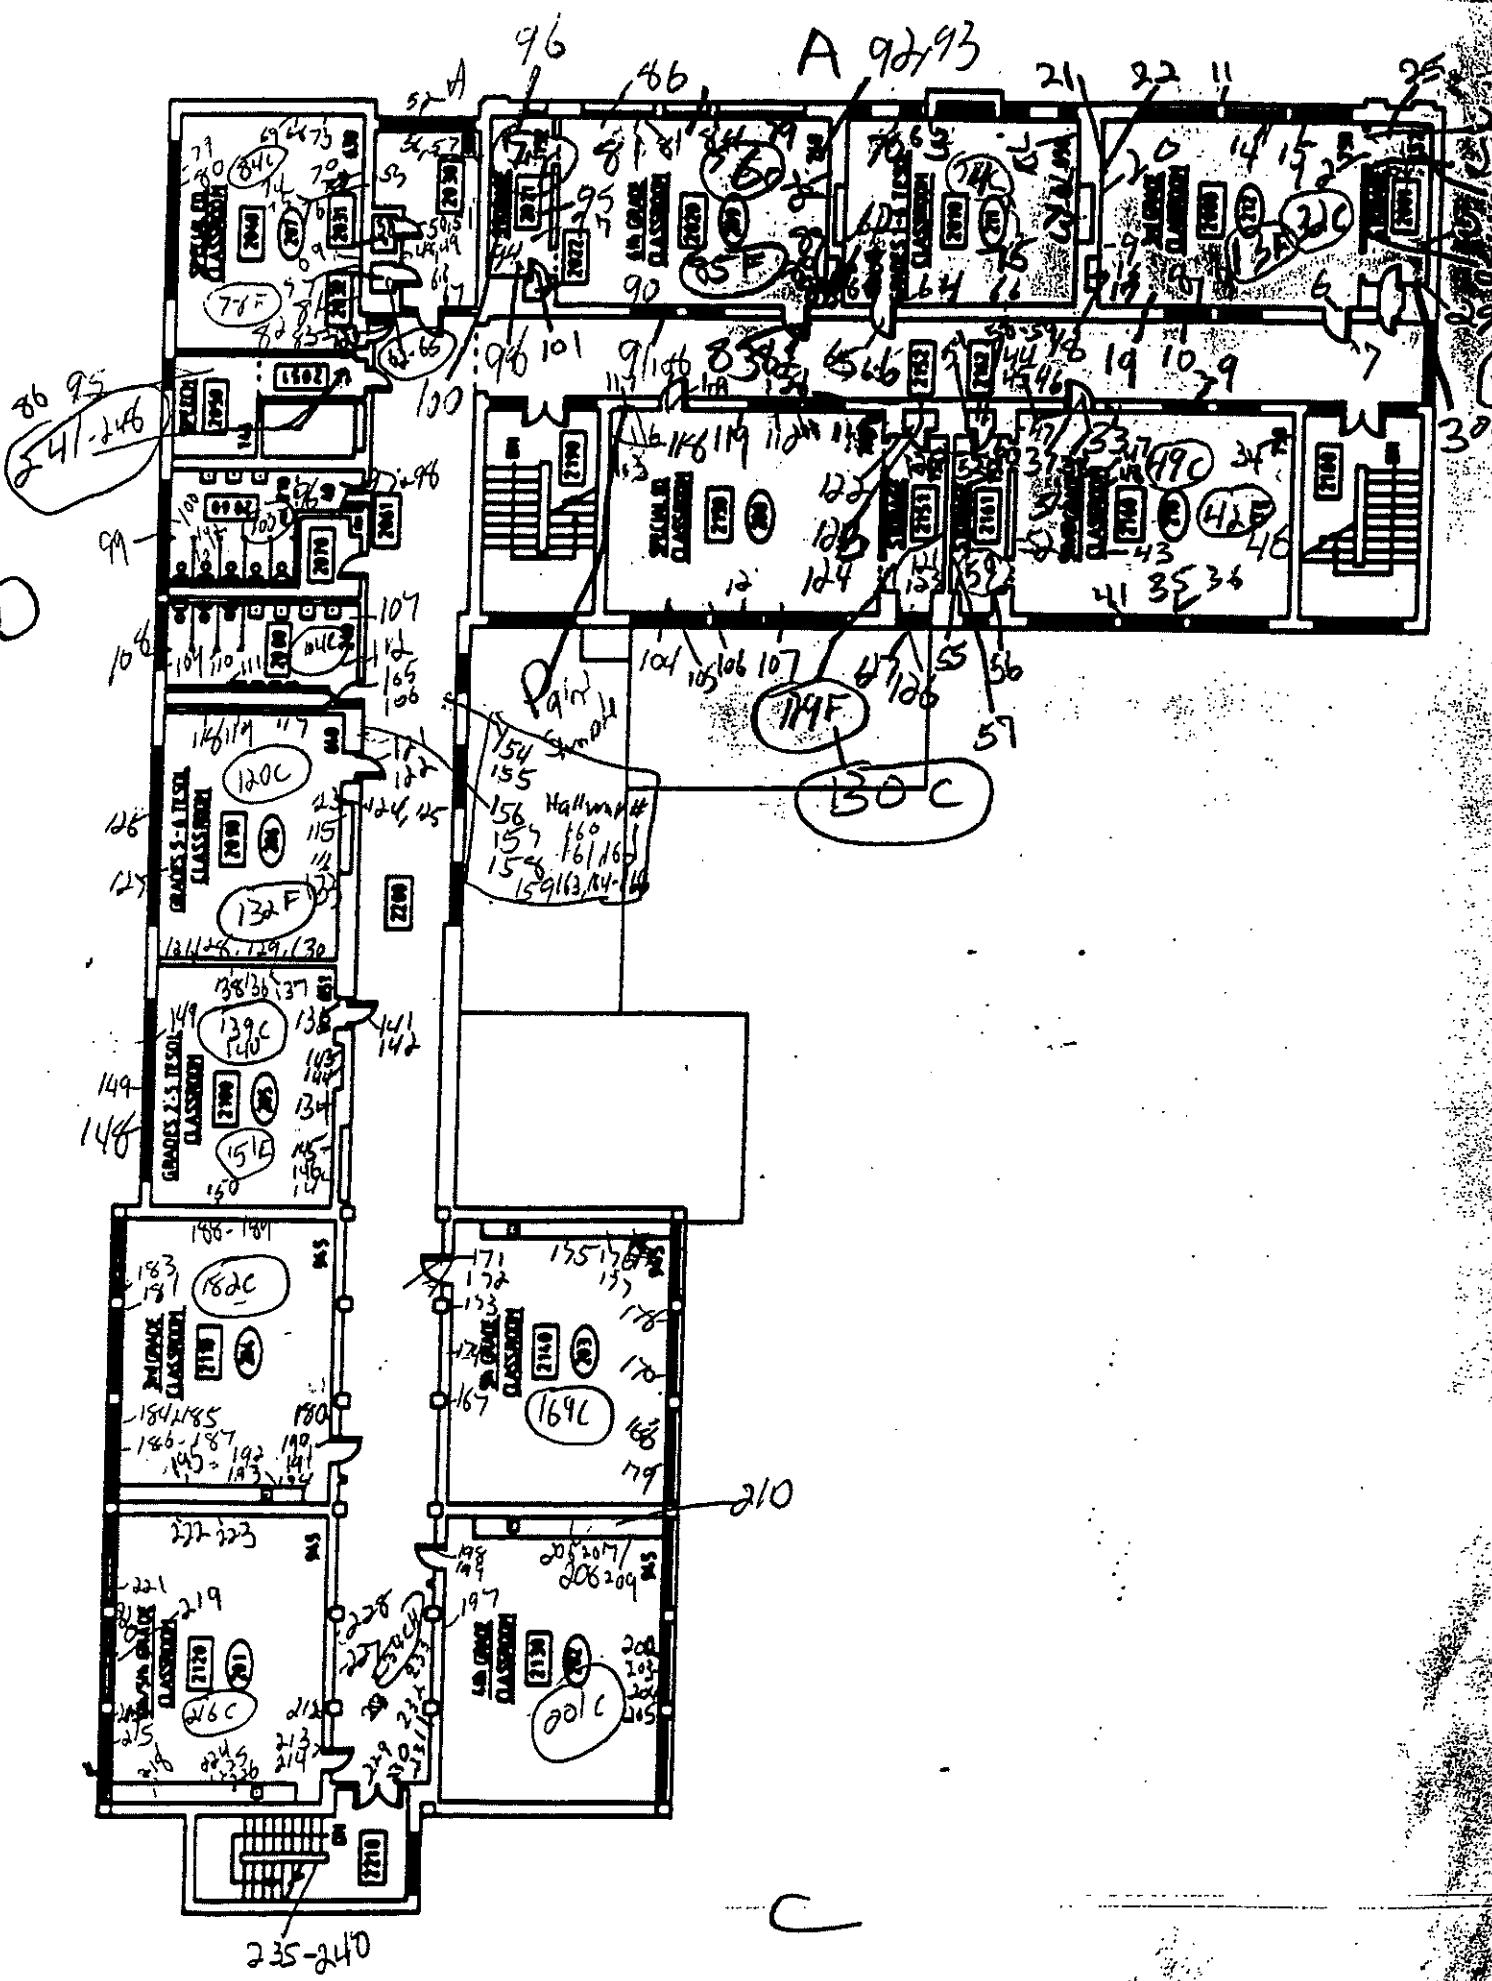

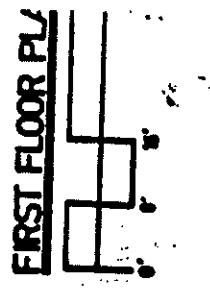

FIRST FLOOR PU

354-370

A  
273C

203-206

201, 202

192

190, 191

259, 269

760P, 61

214

250

253

252

255

266

251

249

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

253

254

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L	
1	Ames Elementary School												
2													
3	Site	No	Analysis	Date	Floor	Area	Room#	Componen	Feature	Condition	Substrate	PbL	
4	1916 bldg.	27	XRF	2/5/97	0	Classroo	1	Wall	Midle Wall	Cracked	Plaster	0.03	
5	1916 bldg.	28	XRF	2/5/97	0	Classroo	1	Wall	Wall	Cracked	Tile	3.65	
6	1916 bldg.	29	XRF	2/5/97	0	Classroo	1	Wall	Midle Wall	Cracked	Tile	5.09	
7	1916 bldg.	30	XRF	2/5/97	0	Classroo	1	Wall	Wall	Cracked	Plaster	5.09	
8	1916 bldg.	31	XRF	2/5/97	0	Classroo	1	Door	Door	Solid	Wood	0.05	
9	1916 bldg.	32	XRF	2/5/97	0	Classroo	1	Door	Jamb	Cracked	Wood	0.03	
10	1916 bldg.	33	XRF	2/5/97	0	Classroo	1	Door	Jamb	Cracked	Wood	0.02	
11	1916 bldg.	34	XRF	2/5/97	0	Classroo	1	Cabinet	Door	Cracked	Wood	0.02	
12	1916 bldg.	35	XRF	2/5/97	0	Classroo	1	Cabinet	Shelf	Solid	Wood	0.37	
13	1916 bldg.	36	XRF	2/5/97	0	Classroo	1	Floor		Cracked	Wood	0	
14	1916 bldg.	37	XRF	2/5/97	0	Classroo	1	Wall	Baseboar	Cracked	Wood	0	
15	1916 bldg.	38	XRF	2/5/97	0	Classroo	1	Bulletin B	Chalk Boa	Cracked	Metal	0.04	
16	1916 bldg.	39	XRF	2/5/97	0	Classroo	1	Ceiling	Diffuser	Solid	Metal	0.01	
17	1916 bldg.	40	XRF	2/5/97	0	Classroo	1		Radiator	Solid	Metal	0.07	
18	1916 bldg.	280	XRF	2/4/97	1	Classroo	108	Wall	Wall	Solid	Tile	3.59	
19	1916 bldg.	281	XRF	2/4/97	1	Classroo	108	Wall	Midle Wall	Solid	Plaster	0.12	
20	1916 bldg.	282	XRF	2/4/97	1	Classroo	108	Wall	Wall	Solid	Plaster	0.18	
21	1916 bldg.	283	XRF	2/4/97	1	Classroo	108	Door	Door	Solid	Wood	0.04	
22	1916 bldg.	284	XRF	2/4/97	1	Classroo	108	Door	Casing	Solid	Wood	0.04	
23	1916 bldg.	285	XRF	2/4/97	1	Classroo	108	Window	Casing	Solid	Wood	0.03	
24	1916 bldg.	286	XRF	2/4/97	1	Classroo	108	Upper Wal	Crown mo	Solid	Wood	0.05	
25	1916 bldg.	287	XRF	2/4/97	1	Classroo	108	Bulletin	Board	Solid	Wood	0.04	
26	1916 bldg.	288	XRF	2/4/97	1	Classroo	108	Wire	Tray	Solid	Metal	0.04	
27	1916 bldg.	289	XRF	2/4/97	1	Classroo	108	Cabinet	Door	Solid	Wood	0.06	
28	1916 bldg.	290	XRF	2/4/97	1	Classroo	108	Cabinet	Inside	Solid	Wood	0.04	
29	1916 bldg.	297	XRF	2/4/97	1	Classroo	108	Wire Prote	Baseboar	Solid	Wood	0	
30	1916 bldg.	306	XRF	2/4/97	1	Classroo	108	Ceiling		Solid	Plaster	0.1	
31	1916 bldg.	240	XRF	2/4/97	1	Classroo	109	Wall	Wall	Cracked	Tile	0.15	
32	1916 bldg.	241	XRF	2/4/97	1	Classroo	109	Wall	Midle Wall	Solid	Plaster	0.24	
33	1916 bldg.	242	XRF	2/4/97	1	Classroo	109	Wall	Wall	Solid	Plaster	0.29	
34	1916 bldg.	243	XRF	2/4/97	1	Classroo	109	Wall	Midle Wall	Cracked	Plaster	0.27	
35	1916 bldg.	244	XRF	2/4/97	1	Classroo	109	Upper Wal	Crown mo	Solid	Wood	0.18	
36	1916 bldg.	245	XRF	2/4/97	1	Classroo	109	Door	Door	Solid	Wood	0.03	
37	1916 bldg.	246	XRF	2/4/97	1	Classroo	109	Door	Jamb	Solid	Wood	0.02	
38	1916 bldg.	247	XRF	2/4/97	1	Classroo	109	Window	Casing	Solid	Wood	0.02	
39	1916 bldg.	248	XRF	2/4/97	1	Classroo	109	Bulletin B	Chalkbord	Solid	Wood	0.05	
40	1916 bldg.	249	XRF	2/4/97	1	Classroo	109	Cabinet	Door	Cracked	Wood	0.02	
41	1916 bldg.	250	XRF	2/4/97	1	Classroo	109	Cabinet	Shelf	Solid	Wood	0.71	
42	1916 bldg.	251	XRF	2/4/97	1	Classroo	109	Bulletin	Board	Solid	Metal	0.03	
43	1916 bldg.	252	XRF	2/4/97	1	Classroo	109	Wall	Chair rail	Solid	Wood	0.03	
44	1916 bldg.	253	XRF	2/4/97	1	Classroo	109	Bookcase	Shelf	Solid	Wood	1.56	
45	1916 bldg.	254	XRF	2/4/97	1	Classroo	109		Radiator	Cracked	Metal	5.09	
46	1916 bldg.	255	XRF	2/4/97	1	Classroo	109		Radiator	Protector	Cracked	Metal	0.28
47	1916 bldg.	256	XRF	2/4/97	1	Classroo	109		Radiator	Protector	Cracked	Metal	0.43
48	1916 bldg.	257	XRF	2/4/97	1	Classroo	109		Radiator	Protector	Cracked	Metal	0.29
49	1916 bldg.	258	XRF	2/4/97	1	Classroo	109		Cabinet	Door	Cracked	Wood	0.01
50	1916 bldg.	259	XRF	2/4/97	1	Classroo	109		Cabinet	Inside	Solid	Plaster	0.63
51	1916 bldg.	260	XRF	2/4/97	1	Classroo	109		Cabinet	Inside	Solid	Wood	0.85
52	1916 bldg.	261	XRF	2/4/97	1	Classroo	109		Cabinet	Shelf	Solid	Wood	0.28
53	1916 bldg.	262	XRF	2/4/97	1	Classroo	109		Wall	Wall Rgstr	Solid	Metal	5.09
54	1916 bldg.	263	XRF	2/4/97	1	Classroo	109		Floor		Solid	Wood	0.01
55	1916 bldg.	264	XRF	2/4/97	1	Classroo	109		Closet	Wall	Cracked	Plaster	5.09
56	1916 bldg.	265	XRF	2/4/97	1	Classroo	109		Closet	Shelf	Solid	Wood	0
57	1916 bldg.	209	XRF	2/4/97	1	Classroo	110		Wall	Wall	Cracked	Tile	5.09
58	1916 bldg.	210	XRF	2/4/97	1	Classroo	110		Wall	Midle Wall	Cracked	Plaster	0.2
59	1916 bldg.	211	XRF	2/4/97	1	Classroo	110		Wall	Wall	Cracked	Plaster	5.09
60	1916 bldg.	212	XRF	2/4/97	1	Classroo	110		Door	Door	Solid	Wood	0.04
61	1916 bldg.	213	XRF	2/4/97	1	Classroo	110		Door	Jamb	Solid		0.05
62	1916 bldg.	214	XRF	2/4/97	1	Classroo	110		Window	Casing	Solid	Wood	0.03
63	1916 bldg.	215	XRF	2/4/97	1	Classroo	110		Drywall	Crown mo	Solid	Wood	0.05
64	1916 bldg.	216	XRF	2/4/97	1	Classroo	110		Bulletin B	Chalkbord	Solid	Wood	0

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	No	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	PbL
65	1916 bldg.	217	XRF	2/4/97	1	Classroo	110	Floor		Cracked	Wood	0.01
66	1916 bldg.	218	XRF	2/4/97	1	Classroo	110	Radiator	Cracked	Metal		5.09
67	1916 bldg.	219	XRF	2/4/97	1	Classroo	110	Radiator	Protector	Cracked	Wood	0.04
68	1916 bldg.	220	XRF	2/4/97	1	Classroo	110	Bookcase	Shelf	Solid	Wood	0
69	1916 bldg.	221	XRF	2/4/97	1	Classroo	110	Cabinet	Door	Solid	Wood	0.03
70	1916 bldg.	222	XRF	2/4/97	1	Classroo	110	Cabinet	Door	Solid		0.03
71	1916 bldg.	223	XRF	2/4/97	1	Classroo	110	Wall	Wall Rgstr	Solid	Metal	5.09
72	1916 bldg.	224	XRF	2/4/97	1	Classroo	110	Ceiling		Solid	Plaster	0.06
73	1916 bldg.	168	XRF	2/4/97	1	Classroo	111	Wall	Wall	Solid	Tile	2.46
74	1916 bldg.	169	XRF	2/4/97	1	Classroo	111	Wall	Wall	Cracked	Plaster	0.08
75	1916 bldg.	170	XRF	2/4/97	1	Classroo	111	Wall	Wall	Cracked	Plaster	0.19
76	1916 bldg.	171	XRF	2/4/97	1	Classroo	111	Upper Wal	Crown mo	Solid	Wood	0.15
77	1916 bldg.	172	XRF	2/4/97	1	Classroo	111	Wall	Wall	Cracked	Plaster	0.25
78	1916 bldg.	173	XRF	2/4/97	1	Classroo	111	Door	Door	Solid	Wood	0.03
79	1916 bldg.	174	XRF	2/4/97	1	Classroo	111	Door	Jamb	Solid	Wood	0.01
80	1916 bldg.	175	XRF	2/4/97	1	Classroo	111	Window	Casing	Solid	Wood	0.02
81	1916 bldg.	176	XRF	2/4/97	1	Classroo	111	Wall	Chair rail	Solid	Wood	0.11
82	1916 bldg.	177	XRF	2/4/97	1	Classroo	111	Bookcase	Shelf	Cracked	Wood	0
83	1916 bldg.	178	XRF	2/4/97	1	Classroo	111	Cabinet	Door	Solid	Wood	0.04
84	1916 bldg.	179	XRF	2/4/97	1	Classroo	111	Cabinet	Inside	Solid	Plaster	0.21
85	1916 bldg.	180	XRF	2/4/97	1	Classroo	111	Cabinet	Shelf	Cracked	Wood	0.07
86	1916 bldg.	181	XRF	2/4/97	1	Classroo	111	Bulletin B	Chalkbrd	Solid	Wood	0.04
87	1916 bldg.	182	XRF	2/4/97	1	Classroo	111	Bulletin B	Chalkbrd	Solid	Metal	0.03
88	1916 bldg.	183	XRF	2/4/97	1	Classroo	111	Cabinet	Door	Cracked	Wood	0.02
89	1916 bldg.	184	XRF	2/4/97	1	Classroo	111	Cabinet	Shelf	Cracked	Wood	0.08
90	1916 bldg.	185	XRF	2/4/97	1	Classroo	111	Floor		Solid	Wood	0.01
91	1916 bldg.	186	XRF	2/4/97	1	Classroo	111	Wall	Crown mo	Solid	Metal	5.09
92	1916 bldg.	187	XRF	2/4/97	1	Classroo	111	Closet	Wall	Solid	Plaster	5.09
93	1916 bldg.	188	XRF	2/4/97	1	Classroo	111	Closet	Shelf	Solid	Wood	0
94	1916 bldg.	189	XRF	2/4/97	1	Classroo	111	Door	Door	Solid	Wood	0.05
95	1916 bldg.	190	XRF	2/4/97	1	Classroo	111	Radiator	Protector	Solid	Metal	0.5
96	1916 bldg.	191	XRF	2/4/97	1	Classroo	111	Radiator	Cracked	Metal		3.46
97	1916 bldg.	192	XRF	2/4/97	1	Classroo	111	Radiator	Protector	Cracked	Metal	0.38
98	1916 bldg.	193	XRF	2/4/97	1	Classroo	111	Radiator	Protector	Cracked	Metal	0.28
99	1916 bldg.	103	XRF	2/3/97	2	Classroo	208	Wall	Wall	Cracked	Tile	4.31
100	1916 bldg.	104	XRF	2/3/97	2	Classroo	208	Wall	Wall	Cracked	Plaster	0.15
101	1916 bldg.	105	XRF	2/3/97	2	Classroo	208	Wall	Middle Wall	Solid	Tile	5.09
102	1916 bldg.	106	XRF	2/3/97	2	Classroo	208	Wall	Wall	Cracked	Plaster	5.09
103	1916 bldg.	107	XRF	2/3/97	2	Classroo	208	Bookcase	Shelf	Cracked	Wood	0.07
104	1916 bldg.	108	XRF	2/3/97	2	Classroo	208	Door	Door	Solid	Wood	0.05
105	1916 bldg.	109	XRF	2/3/97	2	Classroo	208	Door	Casing	Solid	Wood	0.02
106	1916 bldg.	110	XRF	2/3/97	2	Classroo	208	Window	Casing	Solid	Wood	0.04
107	1916 bldg.	111	XRF	2/3/97	2	Classroo	208	Wall	Crown mo	Solid	Wood	0.04
108	1916 bldg.	112	XRF	2/3/97	2	Classroo	208	Wall	Wall Rgstr	Solid	Metal	5.09
109	1916 bldg.	114	XRF	2/3/97	2	Classroo	208	Wall	Wall Rgstr	Solid	Metal	5.09
110	1916 bldg.	115	XRF	2/3/97	2	Classroo	208	Wall	Wall Rgstr	Solid	Metal	5.09
111	1916 bldg.	116	XRF	2/3/97	2	Classroo	208	Cabinet	Door	Solid	Wood	0.06
112	1916 bldg.	117	XRF	2/3/97	2	Classroo	208	Cabinet	Inside	Solid	Wood	0.03
113	1916 bldg.	118	XRF	2/3/97	2	Classroo	208	Bookcase	Shelf	Solid	Wood	0.01
114	1916 bldg.	119	XRF	2/3/97	2	Classroo	208	Chalkbrd	Bulletin B	Solid	Wood	0.08
115	1916 bldg.	76	XRF	2/3/97	2	Classroo	209	Ceiling		Cracked	Plaster	0.05
116	1916 bldg.	78	XRF	2/3/97	2	Classroo	209	Wall	Wall	Solid	Tile	4.46
117	1916 bldg.	79	XRF	2/3/97	2	Classroo	209	Wall	Wall	Cracked	Plaster	0.06
118	1916 bldg.	80	XRF	2/3/97	2	Classroo	209	Wall	Middle Wall	Solid	Tile	5.09
119	1916 bldg.	81	XRF	2/3/97	2	Classroo	209	Wall	Wall	Cracked	Plaster	2.16
120	1916 bldg.	82	XRF	2/3/97	2	Classroo	209	Door	Door	Solid	Wood	0.06
121	1916 bldg.	83	XRF	2/3/97	2	Classroo	209	Door	Jamb	Solid	Wood	0.04
122	1916 bldg.	84	XRF	2/3/97	2	Classroo	209	Radiator	Peeling	Metal		5.09
123	1916 bldg.	85	XRF	2/3/97	2	Classroo	209	Floor		Solid	Wood	0
124	1916 bldg.	86	XRF	2/3/97	2	Classroo	209	Bookcase	Shelf	Cracked	Wood	0.02
125	1916 bldg.	87	XRF	2/3/97	2	Classroo	209	Cabinet	Door	Solid	Wood	0.04
126	1916 bldg.	88	XRF	2/3/97	2	Classroo	209	Cabinet	Inside	Solid	Plaster	0.06
127	1916 bldg.	89	XRF	2/3/97	2	Classroo	209	Cabinet	Shelf	Solid	Wood	0.09

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	No	Analysis	Date	Floor	Area	Room#	Componen	Feature	Condition	Substrate	PbL
128	1916 bldg.	90	XRF	2/3/97	2	Classroo	209	Bulletin B	Chalkbrd	Cracked	Wood	0.04
129	1916 bldg.	91	XRF	2/3/97	2	Classroo	209	Window	Casing	Solid	Wood	0.02
130	1916 bldg.	92	XRF	2/3/97	2	Classroo	209	Upper Wal	Crown mo	Solid	Wood	0.11
131	1916 bldg.	93	XRF	2/3/97	2	Classroo	209	Wall	Wall Rgstr	Solid	Metal	5.09
132	1916 bldg.	33	XRF	2/3/97	2	Classroo	210	Wall	Wall	Solid	Tile	5.09
133	1916 bldg.	34	XRF	2/3/97	2	Classroo	210	Wall	Wall	Cracked	Plaster	0.06
134	1916 bldg.	35	XRF	2/3/97	2	Classroo	210	Wall	Midle Wall	Solid	Tile	0.05
135	1916 bldg.	36	XRF	2/3/97	2	Classroo	210	Wall	Wall	Cracked	Plaster	0.14
136	1916 bldg.	37	XRF	2/3/97	2	Classroo	210	Door	Door	Solid	Wood	0.06
137	1916 bldg.	38	XRF	2/3/97	2	Classroo	210	Door	Jamb	Solid	Wood	0.03
138	1916 bldg.	39	XRF	2/3/97	2	Classroo	210	Window	Sash	Solid	Wood	0.02
139	1916 bldg.	40	XRF	2/3/97	2	Classroo	210	Bookcase	Shelf	Cracked	Wood	0
140	1916 bldg.	41	XRF	2/3/97	2	Classroo	210		Radiator	Peeling	Metal	0.33
141	1916 bldg.	42	XRF	2/3/97	2	Classroo	210	Floor		Cracked	Wood	0.01
142	1916 bldg.	43	XRF	2/3/97	2	Classroo	210	Bulletin B	Chalkbrd	Cracked	Wood	0.05
143	1916 bldg.	44	XRF	2/3/97	2	Classroo	210	Cabinet	Door	Solid	Wood	0.04
144	1916 bldg.	45	XRF	2/3/97	2	Classroo	210	Cabinet	Inside	Solid	Wood	0.19
145	1916 bldg.	46	XRF	2/3/97	2	Classroo	210	Cabinet	Shelf	Solid	Wood	0.19
146	1916 bldg.	47	XRF	2/3/97	2	Classroo	210	Wall	Wall Rgstr	Cracked	Metal	0.09
147	1916 bldg.	48	XRF	2/3/97	2	Classroo	210	Wall	Crown mo	Peeling	Wood	0.07
148	1916 bldg.	49	XRF	2/3/97	2	Classroo	210	Ceiling		Solid	Plaster	0.1
149	1916 bldg.	62	XRF	2/3/97	2	Classroo	211	Wall	Wall	Cracked	Plaster	0.12
150	1916 bldg.	63	XRF	2/3/97	2	Classroo	211	Wall	Wall	Cracked	Plaster	5.09
151	1916 bldg.	64	XRF	2/3/97	2	Classroo	211	Wall	Murlel	Cracked	Plaster	0.07
152	1916 bldg.	65	XRF	2/3/97	2	Classroo	211	Door	Door	Solid	Wood	0.03
153	1916 bldg.	66	XRF	2/3/97	2	Classroo	211	Door	Jamb	Solid	Wood	0.03
154	1916 bldg.	67	XRF	2/3/97	2	Classroo	211	Window	Casing	Solid	Wood	0.07
155	1916 bldg.	68	XRF	2/3/97	2	Classroo	211	Cabinet	Door	Solid	Wood	0.02
156	1916 bldg.	69	XRF	2/3/97	2	Classroo	211	Cabinet	Inside	Solid	Wood	0.06
157	1916 bldg.	70	XRF	2/3/97	2	Classroo	211		Radiator	Cracked	Metal	2.96
158	1916 bldg.	71	XRF	2/3/97	2	Classroo	211	Bulletin B	Chalkbrd	Solid	Metal	0.03
159	1916 bldg.	72	XRF	2/3/97	2	Classroo	211	Wall	Wall Rgstr	Solid	Metal	0.62
160	1916 bldg.	73	XRF	2/3/97	2	Classroo	211	Wall	Wall	Solid	Plaster	0.04
161	1916 bldg.	74	XRF	2/3/97	2	Classroo	211	Ceiling		Cracked	Plaster	0.08
162	1916 bldg.	75	XRF	2/3/97	2	Classroo	211	Hatch	Ceiling	Solid	Wood	0
163	1916 bldg.	6	XRF	2/3/97	2	Classroo	212	Door	Jamb	Solid	Wood	0.06
164	1916 bldg.	7	XRF	2/3/97	2	Classroo	212	Door	Door	Solid	Wood	0.04
165	1916 bldg.	8	XRF	2/3/97	2	Classroo	212	Wall	Wall	Solid	Plaster	0.09
166	1916 bldg.	9	XRF	2/3/97	2	Classroo	212	Wall	Wall	Solid	Tile	3.69
167	1916 bldg.	10	XRF	2/3/97	2	Classroo	212	Window	Casing	Solid	Wood	0.03
168	1916 bldg.	11	XRF	2/3/97	2	Classroo	212	Wall	Wall	Solid	Plaster	2.97
169	1916 bldg.	12	XRF	2/3/97	2	Classroo	212	Door	Jamb	Solid	Plaster	5.09
170	1916 bldg.	13	XRF	2/3/97	2	Classroo	212	Floor	Wall	Solid	Wood	0
171	1916 bldg.	14	XRF	2/3/97	2	Classroo	212		Radiator	Peeling	Metal	5.09
172	1916 bldg.	15	XRF	2/3/97	2	Classroo	212	Bookcase	Inside	Cracked	Wood	0
173	1916 bldg.	16	XRF	2/3/97	2	Classroo	212	Cabinet	Door	Solid	Wood	0.05
174	1916 bldg.	17	XRF	2/3/97	2	Classroo	212	Cabinet	Inside	Cracked	Plaster	0.09
175	1916 bldg.	18	XRF	2/3/97	2	Classroo	212	Cabinet	Shelf	Cracked	Wood	0.01
176	1916 bldg.	19	XRF	2/3/97	2	Classroo	212	Chalkbrd	Chalkbrd	Cracked	Wood	0.03
177	1916 bldg.	20	XRF	2/3/97	2	Classroo	212	Wire tray	Wire tray	Solid	Metal	0
178	1916 bldg.	21	XRF	2/3/97	2	Classroo	212	Wall	Crown mo	Solid	Wood	0.06
179	1916 bldg.	22	XRF	2/3/97	2	Classroo	212	Wall	Wall	Solid	Plaster	0.13
180	1916 bldg.	131	XRF	2/3/97	2	Hall	1	Ceiling		Solid	Plaster	0.11
181	1916 bldg.	132	XRF	2/3/97	2	Hall	1	Wall	Midle Wall	Solid	Plaster	0.11
182	1916 bldg.	133	XRF	2/3/97	2	Hall	1	Wall	Wall	Solid	Plaster	0.09
183	1916 bldg.	134	XRF	2/3/97	2	Hall	1		Elec Pane	Solid	Metal	0.07
184	1916 bldg.	135	XRF	2/3/97	2	Hall	1		Radiator	Solid	Metal	3.75
185	1916 bldg.	307	XRF	2/4/97	1	Hall	2	Ceiling		Solid	Plaster	0.1
186	1916 bldg.	308	XRF	2/4/97	1	Hall	2	Wall	Middle Wa	Solid	Plaster	0.1
187	1916 bldg.	309	XRF	2/4/97	1	Hall	2	Wall	Upper Wal	Solid	Plaster	0.1
188	1916 bldg.	310	XRF	2/4/97	1	Hall	2	Door	Door	Solid	Metal	5.0+
189	1916 bldg.	311	XRF	2/4/97	1	Hall	2	Door	Casing	Solid	Metal	5.0+
190	1916 bldg.	312	XRF	2/4/97	1	Hall	2	Radiator		Solid	Metal	5.0+

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	No	Analysis	Date	Floor	Area	Room#	Componen	Feature	Condition	Substrate	PbL
191	1916 bldg.	313	XRF	2/4/97	1	Hall	2	Electrical Panel	Solid	Metal		0.1
192	1916 bldg.	314	XRF	2/4/97	1	Hall	2	Wire Tray	Solid	Metal		0
193	1916 bldg.	315	XRF	2/4/97	1	Hall	2	Fountain Board	Solid	Wood		0
194	1916 bldg.	316	XRF	2/4/97	1	Hall	2	Bulletin Board	Solid	Wood		0
195	1916 bldg.	19	XRF	2/9/97	0	Hall	3	Wall Wall	Cracked	Tile		2.97
196	1916 bldg.	20	XRF	2/9/97	0	Hall	3	Wall Wall	Cracked	Plaster		0.22
197	1916 bldg.	21	XRF	2/9/97	0	Hall	3	Wall Chair rail	Solid	Wood		0.07
198	1916 bldg.	22	XRF	2/9/97	0	Hall	3	Wall Midle Wall	Solid	Tile		2.58
199	1916 bldg.	23	XRF	2/9/97	0	Hall	3	Wall Midle Wall	Solid	Tile		0.62
200	1916 bldg.	24	XRF	2/9/97	0	Hall	3	Coat Rack	Solid	Wood		0.04
201	1916 bldg.	25	XRF	2/9/97	0	Hall	3	Boot Rack	Cracked	Wood		0.06
202	1916 bldg.	26	XRF	2/9/97	0	Hall	3	Wall Wall	Solid	Plaster		0.26
203	1916 bldg.	27	XRF	2/9/97	0	Hall	3	Window Stool	Solid	Concrete		5.09
204	1916 bldg.	28	XRF	2/9/97	0	Hall	3	Door Jamb	Solid	Plaster		1.87
205	1916 bldg.	29	XRF	2/9/97	0	Hall	3	Wiretray	Solid	Metal		0.02
206	1916 bldg.	30	XRF	2/9/97	0	Hall	3	Radiator	Solid	Metal		0.02
207	1916 bldg.	31	XRF	2/9/97	0	Hall	3	Ceiling	Cracked	Plaster		0.12
208	1916 bldg.	32	XRF	2/9/97	0	Hall	3	Closet Midle Wall	Cracked	Plaster		5.09
209	1916 bldg.	33	XRF	2/9/97	0	Hall	3	Door Door	Solid	Wood		0.01
210	1916 bldg.	34	XRF	2/9/97	0	Hall	3	Floor	Peeling	Concrete		0.13
211	1916 bldg.	35	XRF	2/9/97	0	Hall	3	Ceiling	Cracked	Metal		5.09
212	1916 bldg.	6	XRF	2/10/97	1	Outside	0	Door Door	Peeling	Metal		1.67
213	1916 bldg.	7	XRF	2/10/97	1	Outside	0	Door Jamb	Cracked	Metal		1.43
214	1916 bldg.	8	XRF	2/10/97	0	Outside	0	Ext Wall	Foundatio	Solid	Concrete	0
215	1916 bldg.	25	XRF	2/10/97	0	Outside	1	Door Door	Cracked	Wood		3.21
216	1916 bldg.	203	XRF	2/4/97	1	Restroom	1	Wall Wall	Peeling	Plaster		0.04
217	1916 bldg.	204	XRF	2/4/97	1	Restroom	1	Wall Wall	Cracked	Plaster		0.2
218	1916 bldg.	205	XRF	2/4/97	1	Restroom	1	Door Door	Solid	Wood		0.03
219	1916 bldg.	206	XRF	2/4/97	1	Restroom	1	Radiator Protector	Solid	Wood		0.01
220	1916 bldg.	207	XRF	2/4/97	1	Restroom	1	Radiator	Solid	Metal		0.11
221	1916 bldg.	208	XRF	2/4/97	1	Restroom	1	Wall Wall Rgstr	Solid	Metal		0.01
222	1916 bldg.	274	XRF	2/4/97	1	Restroom	2	Wall Wall	Cracked	Plaster		0.06
223	1916 bldg.	275	XRF	2/4/97	1	Restroom	2	Wall Wall	Cracked	Plaster		0.2
224	1916 bldg.	276	XRF	2/4/97	1	Restroom	2	Door Door	Cracked	Wood		0.01
225	1916 bldg.	277	XRF	2/4/97	1	Restroom	2	Radiator	Cracked	Wood		5.09
226	1916 bldg.	278	XRF	2/4/97	1	Restroom	2	Radiator Protector	Cracked	Wood		0.01
227	1916 bldg.	21	XRF	2/5/97	0	Restroom	3	Wall Wall	Peeling	Tile		5.09
228	1916 bldg.	22	XRF	2/5/97	0	Restroom	3	Wall Wall	Solid	Plaster		0.13
229	1916 bldg.	23	XRF	2/5/97	0	Restroom	3	Wall Midle Wall	Solid	Plaster		0.02
230	1916 bldg.	24	XRF	2/5/97	0	Restroom	3	Door Door	Solid	Wood		0.05
231	1916 bldg.	25	XRF	2/5/97	0	Restroom	3	Wall Baseboar	Cracked	Wood		1.03
232	1916 bldg.	26	XRF	2/5/97	0	Restroom	3	Wall Wall Rgstr	Solid	Metal		0.01
233	1916 bldg.	49	XRF	2/5/97	0	Restroom	4	Wall Wall	Solid	Plaster		0.13
234	1916 bldg.	50	XRF	2/5/97	0	Restroom	4	Wall Wall	Cracked	Tile		5.09
235	1916 bldg.	51	XRF	2/5/97	0	Restroom	4	Wall Wall Rgstr	Solid	Metal		0.17
236	1916 bldg.	52	XRF	2/5/97	0	Restroom	4	Door Door	Solid	Wood		0.05
237	1916 bldg.	53	XRF	2/5/97	0	Restroom	4	Wall Baseboar	Cracked	Wood		0.11
238	1916 bldg.	76	XRF	2/5/97	0	Restroom	5	Ceiling	Peeling	Plaster		1.24
239	1916 bldg.	68	XRF	2/5/97	0	Restroom	5	Wall Wall	Peeling	Plaster		0.04
240	1916 bldg.	69	XRF	2/5/97	0	Restroom	5	Door Door	Solid	Wood		0.11
241	1916 bldg.	70	XRF	2/5/97	0	Restroom	5	Door Jamb	Solid	Wood		0.04
242	1916 bldg.	71	XRF	2/5/97	0	Restroom	5	Wall Baseboar	Cracked	Wood		0.04
243	1916 bldg.	72	XRF	2/5/97	0	Restroom	5	Floor		Cracked	Concrete	0.03
244	1916 bldg.	73	XRF	2/5/97	0	Restroom	5	Bthrm Stil	Solid	Metal		0.13
245	1916 bldg.	74	XRF	2/5/97	0	Restroom	5	Wall Wall	Cracked	Tile		3.97
246	1916 bldg.	78	XRF	2/5/97	0	Restroom	6	Ceiling	Solid	Plaster		1.79
247	1916 bldg.	79	XRF	2/5/97	0	Restroom	6	Wall Wall	Solid	Tile		3.86
248	1916 bldg.	80	XRF	2/5/97	0	Restroom	6	Wall Wall	Cracked	Plaster		0.53
249	1916 bldg.	81	XRF	2/5/97	0	Restroom	6	Door Door	Solid	Wood		0.03
250	1916 bldg.	82	XRF	2/5/97	0	Restroom	6	Door Jamb	Solid	Wood		0.05
251	1916 bldg.	83	XRF	2/5/97	0	Restroom	6	Mirror Frame	Cracked	Wood		0.06
252	1916 bldg.	84	XRF	2/5/97	0	Restroom	6	Wall Baseboar	Solid	Wood		0.19
253	1916 bldg.	118	XRF	2/5/97	1	Restroom	7	Wall Wall	Cracked	Tile		5.09

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	No	Analysis	Date	Floor	Area	Room#	Compon	Feature	Condition	Substrate	PbL
254	1916 bldg.	119	XRF	2/5/97	1	Restroom	7	Wall	Wall	Cracked	Tile	3.72
255	1916 bldg.	120	XRF	2/5/97	1	Restroom	7	Wall	Wall	Solid	Plaster	0.19
256	1916 bldg.	121	XRF	2/5/97	1	Restroom	7	Wall	Wall	Cracked	Plaster	0.21
257	1916 bldg.	122	XRF	2/5/97	1	Restroom	7	Door	Door	Solid	Wood	0.02
258	1916 bldg.	123	XRF	2/5/97	1	Restroom	7	Wall	Baseboar	Cracked	Wood	0.11
259	1916 bldg.	124	XRF	2/5/97	1	Restroom	7	Wall	Wall Rgstr	Solid	Metal	0.03
260	1916 bldg.	23	XRF	2/3/97	2	Room	1	Wall	Wall	Cracked	Tile	4.02
261	1916 bldg.	24	XRF	2/3/97	2	Room	1	Wall	Wall	Cracked	Tile	3.57
262	1916 bldg.	25	XRF	2/3/97	2	Room	1	Wall	Wall	Cracked	Plaster	0.12
263	1916 bldg.	26	XRF	2/3/97	2	Room	1	Door	Door	Solid	Wood	0.03
264	1916 bldg.	27	XRF	2/3/97	2	Room	1		Radiator	Cracked	Metal	5.09
265	1916 bldg.	28	XRF	2/3/97	2	Room	1	Coat rack	Coat rack	Cracked	Wood	0.03
266	1916 bldg.	29	XRF	2/3/97	2	Room	1	Wall	Wall Rgstr	Cracked	Metal	0.12
267	1916 bldg.	30	XRF	2/3/97	2	Room	1	Closet	Wall	Solid	Plaster	5.09
268	1916 bldg.	31	XRF	2/3/97	2	Room	1	Closet	Shelf	Solid	Wood	0
269	1916 bldg.	32	XRF	2/3/97	2	Room	1	Ceiling		Solid	Plaster	0.05
270	1916 bldg.	50	XRF	2/3/97	2	Room	2	Ceiling		Solid	Plaster	0.14
271	1916 bldg.	51	XRF	2/3/97	2	Room	2	Wall	Wall	Solid	Tile	3.87
272	1916 bldg.	52	XRF	2/3/97	2	Room	2	Wall	Wall	Cracked	Tile	5.09
273	1916 bldg.	53	XRF	2/3/97	2	Room	2	Wall	Wall	Cracked	Plaster	0.15
274	1916 bldg.	54	XRF	2/3/97	2	Room	2	Door	Door	Solid	Wood	0.06
275	1916 bldg.	55	XRF	2/3/97	2	Room	2		Radiator	Cracked	Metal	5.09
276	1916 bldg.	56	XRF	2/3/97	2	Room	2	Wall	Chair rail	Solid	Wood	0.07
277	1916 bldg.	57	XRF	2/3/97	2	Room	2	Coat rack	Coat rack	Solid	Wood	0.04
278	1916 bldg.	58	XRF	2/3/97	2	Room	2	Closet	Wall	Solid	Plaster	0.17
279	1916 bldg.	59	XRF	2/3/97	2	Room	2	Closet	Shelf	Solid	Wood	0
280	1916 bldg.	60	XRF	2/3/97	2	Room	2	Wall	Wall Rgstr	Solid	Metal	0.17
281	1916 bldg.	77	XRF	2/3/97	2	Room	3	Ceiling		Cracked	Plaster	0.12
282	1916 bldg.	94	XRF	2/3/97	2	Room	3	Wall	Wall	Cracked	Tile	5.09
283	1916 bldg.	95	XRF	2/3/97	2	Room	3	Wall	Wall	Cracked	Tile	5.09
284	1916 bldg.	96	XRF	2/3/97	2	Room	3		Radiator	Cracked	Metal	5.09
285	1916 bldg.	97	XRF	2/3/97	2	Room	3	Wall	Chair rail	Solid	Wood	0.11
286	1916 bldg.	98	XRF	2/3/97	2	Room	3	Wall	Wall	Cracked	Plaster	0.12
287	1916 bldg.	99	XRF	2/3/97	2	Room	3	Door	Door	Solid	Wood	0.02
288	1916 bldg.	100	XRF	2/3/97	2	Room	3		Coat rack	Solid	Wood	0.06
289	1916 bldg.	101	XRF	2/3/97	2	Room	3	Closet	Wall	Solid	Plaster	5.09
290	1916 bldg.	120	XRF	2/3/97	2	Room	4	Wall	Wall	Solid	Tile	5.09
291	1916 bldg.	121	XRF	2/3/97	2	Room	4	Wall	Wall	Solid	Tile	4.46
292	1916 bldg.	122	XRF	2/3/97	2	Room	4	Wall	Wall	Cracked	Plaster	0.05
293	1916 bldg.	123	XRF	2/3/97	2	Room	4	Door	Door	Solid	Wood	0.04
294	1916 bldg.	124	XRF	2/3/97	2	Room	4	Wall	Chair rail	Solid	Wood	0.06
295	1916 bldg.	125	XRF	2/3/97	2	Room	4		Coat rack	Solid	Wood	0.09
296	1916 bldg.	126	XRF	2/3/97	2	Room	4		Wire tray	Solid	Metal	0.07
297	1916 bldg.	127	XRF	2/3/97	2	Room	4		Radiator	Cracked	Metal	4.1
298	1916 bldg.	128	XRF	2/3/97	2	Room	4	Closet	Wall	Cracked	Plaster	0.1
299	1916 bldg.	129	XRF	2/3/97	2	Room	4	Floor		Solid	Wood	0.02
300	1916 bldg.	130	XRF	2/3/97	2	Room	4	Ceiling		Solid	Plaster	0.03
301	1916 bldg.	194	XRF	2/4/97	1	Room	5	Wall	Wall	Cracked	Plaster	5.09
302	1916 bldg.	195	XRF	2/4/97	1	Room	5	Wall	Wall	Cracked	Plaster	0.29
303	1916 bldg.	196	XRF	2/4/97	1	Room	5	Door	Door	Solid	Wood	0.03
304	1916 bldg.	197	XRF	2/4/97	1	Room	5	Coat rack		Solid	Wood	0.01
305	1916 bldg.	198	XRF	2/4/97	1	Room	5	Cabinet	Outside	Solid	Wood	0.01
306	1916 bldg.	199	XRF	2/4/97	1	Room	5	Cabinet	Shelf	Cracked	Wood	0.03
307	1916 bldg.	200	XRF	2/4/97	1	Room	5	Door	Casing	Solid	Wood	0.02
308	1916 bldg.	201	XRF	2/4/97	1	Room	5	Ceiling		Cracked	Plaster	0.1
309	1916 bldg.	202	XRF	2/4/97	1	Room	5	Upper Wal	Crown mo	Solid	Wood	0.05
310	1916 bldg.	226	XRF	2/4/97	1	Room	6	Ceiling		Solid	Plaster	0.2
311	1916 bldg.	227	XRF	2/4/97	1	Room	6	Wall	Wall	Cracked	Tile	4.49
312	1916 bldg.	228	XRF	2/4/97	1	Room	6	Wall	Wall	Cracked	Plaster	0.17
313	1916 bldg.	229	XRF	2/4/97	1	Room	6	Wall	Wall	Cracked	Tile	5.09
314	1916 bldg.	230	XRF	2/4/97	1	Room	6	Door	Door	Solid	Wood	0.03
315	1916 bldg.	231	XRF	2/4/97	1	Room	6	Wall	Chair rail	Solid	Wood	0.03
316	1916 bldg.	232	XRF	2/4/97	1	Room	6	Wall	Wall Rgstr	Solid	Metal	0.03

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	No	Analysis	Date	Floor	Area	Room#	Componen	Feature	Condition	Substrate	PbL
317	1916 bldg.	233	XRF	2/4/97	1	Room	6	Radiator	Cracked	Metal	0.13	
318	1916 bldg.	234	XRF	2/4/97	1	Room	6	Closet	Wall	Solid	Plaster	0.08
319	1916 bldg.	235	XRF	2/4/97	1	Room	6	Closet	Shelf	Solid	Wood	0
320	1916 bldg.	236	XRF	2/4/97	1	Room	6	Closet	Shelf	Solid	Wood	0.01
321	1916 bldg.	237	XRF	2/4/97	1	Room	6	Closet	Shelf	Solid	Wood	0
322	1916 bldg.	238	XRF	2/4/97	1	Room	6	Coat rack		Cracked	Wood	0.05
323	1916 bldg.	239	XRF	2/4/97	1	Room	6	Coat rack		Cracked	Metal	5.09
324	1916 bldg.	266	XRF	2/4/97	1	Room	7	Wall	Wall	Cracked	Plaster	0.15
325	1916 bldg.	267	XRF	2/4/97	1	Room	7	Wall	Wall	Cracked	Plaster	0.27
326	1916 bldg.	268	XRF	2/4/97	1	Room	7	Door	Door	Solid	Wood	0.03
327	1916 bldg.	269	XRF	2/4/97	1	Room	7	Bookcase	Shelf	Solid	Wood	0.04
328	1916 bldg.	270	XRF	2/4/97	1	Room	7	Coat rack		Solid	Wood	0.05
329	1916 bldg.	271	XRF	2/4/97	1	Room	7	Door	Casing	Solid	Wood	0.01
330	1916 bldg.	272	XRF	2/4/97	1	Room	7	Upper Wal	Crown mo	Solid	Wood	0.13
331	1916 bldg.	273	XRF	2/4/97	1	Room	7	Ceiling		Cracked	Plaster	0.27
332	1916 bldg.	6	XRF	2/5/97	0	Room	9	Wall	Wall	Cracked	Tile	4.28
333	1916 bldg.	7	XRF	2/5/97	0	Room	9	Wall	Wall	Cracked	Plaster	0.27
334	1916 bldg.	8	XRF	2/5/97	0	Room	9	Wall	Wall	Cracked	Tile	0.22
335	1916 bldg.	9	XRF	2/5/97	0	Room	9	Wall	Wall	Cracked	Plaster	0.08
336	1916 bldg.	10	XRF	2/5/97	0	Room	9	Door	Door	Solid	Wood	0.06
337	1916 bldg.	11	XRF	2/5/97	0	Room	9	Door	Jamb	Solid	Wood	0.06
338	1916 bldg.	12	XRF	2/5/97	0	Room	9	Wall	Baseboar	Cracked	Wood	0.05
339	1916 bldg.	13	XRF	2/5/97	0	Room	9	Bulletin	Board	Solid	Wood	0
340	1916 bldg.	14	XRF	2/5/97	0	Room	9	Wall	Wall Rgstr	Solid	Metal	0.19
341	1916 bldg.	15	XRF	2/5/97	0	Room	9	Wall	Wall Rgstr	Solid	Metal	0.19
342	1916 bldg.	16	XRF	2/5/97	0	Room	9	Ceiling	Radiator	Solid	Metal	0.17
343	1916 bldg.	17	XRF	2/5/97	0	Room	9	Ceiling	Radiator	Solid	Metal	0.2
344	1916 bldg.	18	XRF	2/5/97	0	Room	9	Mural	Solid	Plaster	0.05	
345	1916 bldg.	19	XRF	2/5/97	0	Room	9	Closet	Wall	Solid	Plaster	0.05
346	1916 bldg.	20	XRF	2/5/97	0	Room	9	Closet	Shelf	Solid	Wood	0.07
347	1916 bldg.	41	XRF	2/5/97	0	Room	10	Wall	Wall	Solid	Plaster	0.07
348	1916 bldg.	42	XRF	2/5/97	0	Room	10	Wall	Midle Wall	Solid	Plaster	0.07
349	1916 bldg.	43	XRF	2/5/97	0	Room	10	Door	Door	Cracked	Wood	0.03
350	1916 bldg.	44	XRF	2/5/97	0	Room	10	Door	Door	Solid	Wood	0.05
351	1916 bldg.	45	XRF	2/5/97	0	Room	10	Wall	Baseboar	Cracked	Wood	0.1
352	1916 bldg.	46	XRF	2/5/97	0	Room	10	Wall	Wall Rgstr	Solid	Metal	0
353	1916 bldg.	47	XRF	2/5/97	0	Room	10	Ceiling	Radiator	Solid	Metal	0.14
354	1916 bldg.	48	XRF	2/5/97	0	Room	10	Pipe chas	Door	Solid	Wood	0.04
355	1916 bldg.	54	XRF	2/5/97	0	Room	11	Wall	Wall	Cracked	Tile	3.43
356	1916 bldg.	55	XRF	2/5/97	0	Room	11	Wall	Wall	Cracked	Plaster	0.13
357	1916 bldg.	56	XRF	2/5/97	0	Room	11	Door	Door	Solid	Wood	0.04
358	1916 bldg.	57	XRF	2/5/97	0	Room	11	Door	Jamb	Cracked	Wood	0.03
359	1916 bldg.	58	XRF	2/5/97	0	Room	11	Floor		Cracked	Wood	0
360	1916 bldg.	59	XRF	2/5/97	0	Room	11	Wall	Baseboar	Cracked	Wood	0.13
361	1916 bldg.	60	XRF	2/5/97	0	Room	11	Radiator	Solid	Metal	0.09	
362	1916 bldg.	61	XRF	2/5/97	0	Room	11	Closet	Wall	Solid	Plaster	0.15
363	1916 bldg.	62	XRF	2/5/97	0	Room	11	Closet	Shelf	Solid	Wood	0.02
364	1916 bldg.	63	XRF	2/5/97	0	Room	11	Closet	Floor	Cracked	Concrete	0.04
365	1916 bldg.	64	XRF	2/5/97	0	Room	12	Wall	Wall	Cracked	Tile	0.27
366	1916 bldg.	65	XRF	2/5/97	0	Room	12	Wall	Wall	Solid	Plaster	0.3
367	1916 bldg.	66	XRF	2/5/97	0	Room	12	Wall	Wall Rgstr	Solid	Metal	0.03
368	1916 bldg.	67	XRF	2/5/97	0	Room	12	Floor		Peeling	Concrete	0.04
369	1916 bldg.	77	XRF	2/5/97	0	Room	12	Ceiling		Solid	Plaster	0.17
370	1916 bldg.	85	XRF	2/5/97	0	Room	13	Wall	Midle Wall	Solid	Concrete	0.12
371	1916 bldg.	86	XRF	2/5/97	0	Room	13	Door	Door	Cracked	Metal	0.28
372	1916 bldg.	87	XRF	2/5/97	0	Room	13	Door	Jamb	Cracked	Metal	0.46
373	1916 bldg.	88	XRF	2/5/97	0	Room	13	Floor		Peeling	Concrete	0.03
374	1916 bldg.	89	XRF	2/5/97	0	Room	14	Wall	Wall	Solid	Tile	5.09
375	1916 bldg.	90	XRF	2/5/97	0	Room	14	Wall	Wall	Solid	Plaster	0.22
376	1916 bldg.	91	XRF	2/5/97	0	Room	14	Wall	Chair rail	Solid	Wood	0.03
377	1916 bldg.	92	XRF	2/5/97	0	Room	14		Shelf	Solid	Wood	0
378	1916 bldg.	93	XRF	2/5/97	0	Room	14	Floor		Cracked	Concrete	0.44
379	1916 bldg.	94	XRF	2/5/97	0	Room	14		Locker	Solid	Metal	0.19

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	No	Analysis	Date	Floor	Area	Room#	Compon	Feature	Condition	Substrate	PbL
380	1916 bldg.	95	XRF	2/5/97	0	Room	14	Ceiling		Solid	Plaster	0.12
381	1916 bldg.	96	XRF	2/5/97	0	Room	15	Wall	Wall	Cracked	Tile	2.53
382	1916 bldg.	97	XRF	2/5/97	1	Room	15	Wall	Wall	Cracked	Plaster	0.28
383	1916 bldg.	98	XRF	2/5/97	1	Room	15	Wall	Midle Wall	Cracked	Plaster	0.23
384	1916 bldg.	99	XRF	2/5/97	1	Room	15	Wall	Wall	Cracked	Plaster	0.29
385	1916 bldg.	100	XRF	2/5/97	1	Room	15	Door	Door	Solid	Wood	0.02
386	1916 bldg.	101	XRF	2/5/97	1	Room	15	Door	Casing	Cracked	Wood	0.07
387	1916 bldg.	102	XRF	2/5/97	1	Room	15	Door	Door	Solid	Wood	0.13
388	1916 bldg.	103	XRF	2/5/97	1	Room	15	Door	Jamb	Cracked	Wood	0.08
389	1916 bldg.	104	XRF	2/5/97	1	Room	15	Door	Jamb	Cracked	Wood	0.1
390	1916 bldg.	105	XRF	2/5/97	1	Room	15	Door	Door	Solid	Wood	0.06
391	1916 bldg.	106	XRF	2/5/97	1	Room	15	Wall	Baseboar	Cracked	Wood	0.13
392	1916 bldg.	107	XRF	2/5/97	1	Room	15	Wall	Baseboar	Cracked	Wood	0.1
393	1916 bldg.	108	XRF	2/5/97	1	Room	16	Wall	Wall	Peeling	Plaster	0.09
394	1916 bldg.	109	XRF	2/5/97	1	Room	16	Wall	Wall	Solid	Tile	5.09
395	1916 bldg.	110	XRF	2/5/97	1	Room	16	Wall	Wall	Cracked	Tile	5.09
396	1916 bldg.	111	XRF	2/5/97	1	Room	16	Wall	Wall	Peeling	Plaster	5.09
397	1916 bldg.	112	XRF	2/5/97	1	Room	16	Door	Door	Solid	Wood	0.07
398	1916 bldg.	113	XRF	2/5/97	1	Room	16	Door	Casing	Solid	Wood	0.02
399	1916 bldg.	114	XRF	2/5/97	1	Room	16	Wall	Baseboar	Cracked	Wood	0.07
400	1916 bldg.	115	XRF	2/5/97	1	Room	16	Cabinet	Door	Solid	Wood	0.02
401	1916 bldg.	116	XRF	2/5/97	1	Room	16	Cabinet	Shelf	Solid	Wood	0.01
402	1916 bldg.	117	XRF	2/5/97	1	Room	16	Bulletin Board		Solid	Wood	0.03
403	1916 bldg.	125	XRF	2/5/97	1	Room	17	Wall	Wall	Cracked	Plaster	5.09
404	1916 bldg.	126	XRF	2/5/97	1	Room	17	Wall	Wall	Cracked	Plaster	0.24
405	1916 bldg.	127	XRF	2/5/97	1	Room	17	Door	Door	Solid	Wood	0.03
406	1916 bldg.	128	XRF	2/5/97	1	Room	17	Door	Jamb	Solid	Wood	0.11
407	1916 bldg.	129	XRF	2/5/97	1	Room	17	Cabinet	Door	Solid	Wood	0.04
408	1916 bldg.	130	XRF	2/5/97	1	Room	17	Bulletin Board		Solid	Wood	0.03
409	1916 bldg.	131	XRF	2/5/97	1	Room	17	Floor		Peeling	Concrete	4.24
410	1916 bldg.	132	XRF	2/5/97	1	Room	17	Ceiling	Radiator	Solid	Metal	4.09
411	1916 bldg.	133	XRF	2/5/97	1	Room	17	Wall	Wall Rgstr	Cracked	Metal	0.23
412	1916 bldg.	134	XRF	2/5/97	1	Room	17	Ceiling		Cracked	Plaster	0.12
413	1916 bldg.	135	XRF	2/5/97	1	Room	17	Ceiling		Cracked	Plaster	0.41
414	1916 bldg.	136	XRF	2/5/97	1	Room	17	Ceiling		Cracked	Plaster	0.2
415	1916 bldg.	6	XRF	2/9/97	0	Room	18	Wall	Wall	Cracked	Plaster	0.26
416	1916 bldg.	36	XRF	2/9/97	0	Room	19	Wall	Wall	Peeling	Concrete	0.15
417	1916 bldg.	37	XRF	2/9/97	1	Room	19	Wall	Wall	Peeling	Concrete	0.35
418	1916 bldg.	38	XRF	2/9/97	0	Room	19	Door	Door	Cracked	Metal	0.67
419	1916 bldg.	39	XRF	2/9/97	0	Room	19	Door	Casing	Cracked	Metal	0.37
420	1916 bldg.	40	XRF	2/9/97	0	Room	19	Door	Door	Cracked	Metal	0.66
421	1916 bldg.	41	XRF	2/9/97	0	Room	19	Door	Door	Cracked	Metal	0.01
422	1916 bldg.	42	XRF	2/9/97	0	Room	19	Door	Jamb	Cracked	Metal	0.15
423	1916 bldg.	43	XRF	2/9/97	0	Room	19	Stalrs	Stringer	Cracked	Metal	0.04
424	1916 bldg.	44	XRF	2/9/97	0	Room	19	Stairs	Hand rail	Peeling	Metal	0.07
425	1916 bldg.	45	XRF	2/9/97	0	Room	19	Door	Door	Peeling	Metal	0.36
426	1916 bldg.	46	XRF	2/9/97	0	Room	19	Door	Casing	Cracked	Metal	0.44
427	1916 bldg.	47	XRF	2/9/97	0	Room	19	Floor		Peeling	Concrete	0
428	1916 bldg.	298	XRF	2/4/97	1	Room	82	Wall	Wall	Solid	Plaster	4
429	1916 bldg.	299	XRF	2/4/97	1	Room	82	Wall	Middle Wa	Solid	Plaster	2.2
430	1916 bldg.	300	XRF	2/4/97	1	Room	82	Chair Rail		Solid	Wood	0
431	1916 bldg.	301	XRF	2/4/97	1	Room	82	Wall	Upper Wal	Cracked	Plaster	0.1
432	1916 bldg.	302	XRF	2/4/97	1	Room	82	Door		Solid	Wood	0
433	1916 bldg.	303	XRF	2/4/97	1	Room	82			Solid	Metal	0.1
434	1916 bldg.	304	XRF	2/4/97	1	Room	82	Radiator	Protector	Solid	Wood	0
435	1916 bldg.	305	XRF	2/4/97	1	Room	82	Ceiling		Solid	Plaster	0.2
436	1916 bldg.	291	XRF	2/4/97	1	Room	108	Wall	Chair rali	Solid	Wood	0.04
437	1916 bldg.	292	XRF	2/4/97	1	Room	108		Radiator	Cracked	Metal	5.0+
438	1916 bldg.	293	XRF	2/4/97	1	Room	108	Radiator	Protector	Cracked	Wood	0
439	1916 bldg.	294	XRF	2/4/97	1	Room	108		Bookshelf	Cracked	Wood	0
440	1916 bldg.	295	XRF	2/4/97	1	Room	108		Floor	Solid	Wood	0
441	1916 bldg.	296	XRF	2/4/97	1	Room	108		Wall Rgstr	Solid	Metal	5.0+
442	1916 bldg.	136	XRF	2/3/97	2	Stairwell	1	Door	Door	Solid	Metal	5.09

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	No	Analysis	Date	Floor	Area	Room#	Componen	Feature	Condition	Substrate	PbL
443	1916 bldg.	137	XRF	2/3/97	2	Stairwell	1	Door	Jamb	Solid	Metal	5.09
444	1916 bldg.	138	XRF	2/3/97	2	Stairwell	1	Stairs	Wall	Solid	Tile	5.09
445	1916 bldg.	139	XRF	2/3/97	2	Stairwell	1	Stairs	Wall	Solid	Tile	5.09
446	1916 bldg.	140	XRF	2/3/97	2	Stairwell	1	Stairs	Baseboar	Cracked	Concrete	0.29
447	1916 bldg.	141	XRF	2/3/97	2	Stairwell	1	Stairs	Rail cap	Cracked	Concrete	0.31
448	1916 bldg.	142	XRF	2/3/97	2	Stairwell	1	Bulletin B		Cracked	Wood	0.04
449	1916 bldg.	143	XRF	2/3/97	2	Stairwell	1	Wall	Wall	Peeling	Plaster	0.15
450	1916 bldg.	144	XRF	2/3/97	2	Stairwell	1	Wall	Radiator	Peeling	Metal	5.09
451	1916 bldg.	145	XRF	2/3/97	2	Stairwell	1	Stairs	Hand rail	Cracked	Wood	0.01
452	1916 bldg.	146	XRF	2/3/97	2	Stairwell	1	Wall	Chair rail	Solid	Wood	0.03
453	1916 bldg.	15	XRF	2/9/97	0	Stairwell	1		Radiator	Cracked	Metal	0.07
454	1916 bldg.	16	XRF	2/9/97	0	Stairwell	1	Door	Door	Peeling	Metal	0.39
455	1916 bldg.	17	XRF	2/9/97	0	Stairwell	1	Door	Casing	Cracked	Metal	5.09
456	1916 bldg.	18	XRF	2/9/97	0	Stairwell	1	Ceiling	Casing	Cracked	Plaster	5.09
457	1916 bldg.	9	XRF	2/10/97	0	Stairwell	1	Stairs	Hand rail	Cracked	Metal	0.03
458	1916 bldg.	147	XRF	2/3/97	2	Stairwell	2	Wall	Wall	Solid	Tile	3.37
459	1916 bldg.	148	XRF	2/3/97	2	Stairwell	2	Wall	Wall	Cracked	Tile	3.28
460	1916 bldg.	149	XRF	2/3/97	2	Stairwell	2	Door	Door	Cracked	Metal	5.09
461	1916 bldg.	150	XRF	2/3/97	2	Stairwell	2	Wall	Chair rail	Solid	Wood	0.05
462	1916 bldg.	151	XRF	2/3/97	2	Stairwell	2	Wall	Wall	Cracked	Plaster	0.14
463	1916 bldg.	152	XRF	2/3/97	2	Stairwell	2	Bulletin B	Solid	Wood	0.04	
464	1916 bldg.	153	XRF	2/3/97	2	Stairwell	2	Stairs	Rail cap	Cracked	Concrete	0.27
465	1916 bldg.	154	XRF	2/3/97	2	Stairwell	2	Stairs	Baseboar	Cracked	Concrete	0.18
466	1916 bldg.	155	XRF	2/3/97	2	Stairwell	2	Stairs	Hand rail	Cracked	Wood	0.05
467	1916 bldg.	156	XRF	2/3/97	2	Stairwell	2		Radiator	Cracked	Metal	4.21
468	1916 bldg.	157	XRF	2/3/97	2	Stairwell	2	Wall	Wall	Solid	Tile	5.09
469	1916 bldg.	317	XRF	2/4/97	1	Stairwell	3	Wall	Upper Wal	Solid	Plaster	0.1
470	1916 bldg.	318	XRF	2/4/97	1	Stairwell	3	Handrail		Solid	Wood	0
471	1916 bldg.	319	XRF	2/4/97	1	Stairwell	3	Handrail		Cracked	Metal	0
472	1916 bldg.	320	XRF	2/4/97	1	Stairwell	3	Door	Casing	Solid	Wood	0
473	1916 bldg.	321	XRF	2/4/97	1	Stairwell	3	Door	Door	Cracked	Wood	1.5
474	1924 bldg.	314	XRF	2/9/97	1	Classroo	105	Wall	Wall	Cracked	Plaster	0.15
475	1924 bldg.	315	XRF	2/9/97	1	Classroo	105	Wall	Wall	Cracked	Plaster	0.14
476	1924 bldg.	316	XRF	2/9/97	1	Classroo	105	Wall	Midle Wall	Solid	Plaster	0.1
477	1924 bldg.	317	XRF	2/9/97	1	Classroo	105	Wall	Wall	Solid	Plaster	4.42
478	1924 bldg.	318	XRF	2/9/97	1	Classroo	105	Wall	Wall	Cracked	Plaster	5.09
479	1924 bldg.	319	XRF	2/9/97	1	Classroo	105	Door	Door	Solid	Wood	0.04
480	1924 bldg.	320	XRF	2/9/97	1	Classroo	105	Door	Casing	Solid	Wood	0.07
481	1924 bldg.	321	XRF	2/9/97	1	Classroo	105	Bulletin Board		Solid	Wood	0.08
482	1924 bldg.	322	XRF	2/9/97	1	Classroo	105	Cabinet	Door	Cracked	Wood	0.08
483	1924 bldg.	323	XRF	2/9/97	1	Classroo	105	Cabinet	Inside	Cracked	Wood	0.09
484	1924 bldg.	324	XRF	2/9/97	1	Classroo	105	Cabinet	Shelf	Cracked	Wood	0.05
485	1924 bldg.	325	XRF	2/9/97	1	Classroo	105	Wall	Wall Rgstr	Solid	Metal	5.09
486	1924 bldg.	326	XRF	2/9/97	1	Classroo	105	Wall	Crown mo	Solid	Wood	0
487	1924 bldg.	327	XRF	2/9/97	1	Classroo	105	Ceiling		Solid	Plaster	0.14
488	1924 bldg.	328	XRF	2/9/97	1	Classroo	105	Bulletin Board		Solid	Wood	0.03
489	1924 bldg.	329	XRF	2/9/97	1	Classroo	105	Window	Casing	Solid	Wood	0.18
490	1924 bldg.	330	XRF	2/9/97	1	Classroo	105		Radiator	Cracked	Metal	1.81
491	1924 bldg.	331	XRF	2/9/97	1	Classroo	105		Radiator	Cracked	Metal	3.94
492	1924 bldg.	332	XRF	2/9/97	1	Classroo	105	Wall	Baseboar	Solid	Wood	0.05
493	1924 bldg.	333	XRF	2/9/97	1	Classroo	105	Floor		Solid	Wood	0
494	1924 bldg.	294	XRF	2/9/97	1	Classroo	106	Wall	Wall	Cracked	Plaster	4.49
495	1924 bldg.	295	XRF	2/9/97	1	Classroo	106	Wall	Wall	Solid	Plaster	3.36
496	1924 bldg.	296	XRF	2/9/97	1	Classroo	106	Wall	Midle Wall	Solid	Plaster	0.08
497	1924 bldg.	297	XRF	2/9/97	1	Classroo	106	Wall	Wall	Cracked	Plaster	0.26
498	1924 bldg.	298	XRF	2/9/97	1	Classroo	106	Door	Door	Solid	Wood	0.06
499	1924 bldg.	299	XRF	2/9/97	1	Classroo	106	Door	Jamb	Cracked	Wood	0.06
500	1924 bldg.	300	XRF	2/9/97	1	Classroo	106	Bulletin Board		Cracked	Wood	0.06
501	1924 bldg.	301	XRF	2/9/97	1	Classroo	106	Bulletin Board		Cracked	Wood	0.12
502	1924 bldg.	302	XRF	2/9/97	1	Classroo	106	Cabinet	Door	Solid	Wood	0.06
503	1924 bldg.	303	XRF	2/9/97	1	Classroo	106	Cabinet	Inside	Solid	Wood	0.01
504	1924 bldg.	304	XRF	2/9/97	1	Classroo	106	Cabinet	Shelf	Solid	Wood	0.07
505	1924 bldg.	305	XRF	2/9/97	1	Classroo	106	Wall	Wall Rgstr	Solid	Metal	3.99

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	No	Analysis	Date	Floor	Area	Room#	Componen	Feature	Condition	Substrate	PbL
506	1924 bldg.	306	XRF	2/9/97	1	Classroo	106	Wall	Crown mo	Solid	Wood	0.04
507	1924 bldg.	307	XRF	2/9/97	1	Classroo	106	Celling		Solid	Plaster	0.1
508	1924 bldg.	308	XRF	2/9/97	1	Classroo	106	Wall	Baseboar	Solid	Wood	0.04
509	1924 bldg.	309	XRF	2/9/97	1	Classroo	106	Floor		Solid	Wood	0.01
510	1924 bldg.	310	XRF	2/9/97	1	Classroo	106		Radiator	Peeling	Metal	5.09
511	1924 bldg.	311	XRF	2/9/97	1	Classroo	106		Radiator	Peeling	Metal	4.23
512	1924 bldg.	312	XRF	2/9/97	1	Classroo	106	Bookcase	Inside	Solid	Wood	0.01
513	1924 bldg.	313	XRF	2/9/97	1	Classroo	106	Window	Casing	Solid	Wood	0.12
514	1924 bldg.	134	XRF	2/9/97	2	Classroo	205	Wall	Wall	Cracked	Plaster	2.34
515	1924 bldg.	135	XRF	2/9/97	2	Classroo	205	Wall	Wall	Cracked	Plaster	5.09
516	1924 bldg.	136	XRF	2/9/97	2	Classroo	205	Wall	Midle Wall	Cracked	Plaster	0.42
517	1924 bldg.	137	XRF	2/9/97	2	Classroo	205	Wall	Wall	Cracked	Plaster	0.32
518	1924 bldg.	138	XRF	2/9/97	2	Classroo	205	Wall	Crown mo	Solid	Wood	0.02
519	1924 bldg.	139	XRF	2/9/97	2	Classroo	205	Celling		Cracked	Plaster	0.3
520	1924 bldg.	140	XRF	2/9/97	2	Classroo	205	Celling		Cracked	Plaster	0.11
521	1924 bldg.	141	XRF	2/9/97	2	Classroo	205	Door	Door	Solid	Wood	0.07
522	1924 bldg.	142	XRF	2/9/97	2	Classroo	205	Door	Casing	Cracked	Wood	0.04
523	1924 bldg.	143	XRF	2/9/97	2	Classroo	205	Bulletin Board		Solid	Wood	0.08
524	1924 bldg.	144	XRF	2/9/97	2	Classroo	205	Bulletin Board		Solid	Wood	0.06
525	1924 bldg.	145	XRF	2/9/97	2	Classroo	205	Cabinet	Door	Solid	Wood	0.05
526	1924 bldg.	146	XRF	2/9/97	2	Classroo	205	Cabinet	Inside	Solid	Wood	0.24
527	1924 bldg.	147	XRF	2/9/97	2	Classroo	205	Cabinet	Shelf	Solid	Wood	0.22
528	1924 bldg.	148	XRF	2/9/97	2	Classroo	205	Window	Casing	Solid	Wood	0.14
529	1924 bldg.	149	XRF	2/9/97	2	Classroo	205		Radiator	Peeling	Metal	5.09
530	1924 bldg.	150	XRF	2/9/97	2	Classroo	205	Wall	Baseboar	Solid	Wood	0.05
531	1924 bldg.	151	XRF	2/9/97	2	Classroo	205	Floor		Solid	Wood	0.01
532	1924 bldg.	152	XRF	2/9/97	2	Classroo	205	Wall	Wall Rgstr	Solid	Metal	4
533	1924 bldg.	153	XRF	2/9/97	2	Classroo	205	Wall	Wall Rgstr	Solid	Metal	3.5
534	1924 bldg.	115	XRF	2/9/97	2	Classroo	206	Wall	Wall	Cracked	Plaster	4.16
535	1924 bldg.	116	XRF	2/9/97	2	Classroo	206	Wall	Midle Wall	Cracked	Plaster	0.52
536	1924 bldg.	117	XRF	2/9/97	2	Classroo	206	Wall	Wall	Cracked	Plaster	5.09
537	1924 bldg.	118	XRF	2/9/97	2	Classroo	206	Wall	Wall	Cracked	Plaster	0.33
538	1924 bldg.	119	XRF	2/9/97	2	Classroo	206	Wall	Crown mo	Solid	Wood	0.16
539	1924 bldg.	120	XRF	2/9/97	2	Classroo	206	Celling		Solid	Plaster	0.19
540	1924 bldg.	121	XRF	2/9/97	2	Classroo	206	Door	Door	Solid	Wood	0.06
541	1924 bldg.	122	XRF	2/9/97	2	Classroo	206	Door	Casing	Solid	Wood	0.03
542	1924 bldg.	123	XRF	2/9/97	2	Classroo	206	Cabinet	Door	Solid	Wood	0.04
543	1924 bldg.	124	XRF	2/9/97	2	Classroo	206	Cabinet	Inside	Solid	Wood	0.72
544	1924 bldg.	125	XRF	2/9/97	2	Classroo	206	Cabinet	Shelf	Solid	Wood	0.34
545	1924 bldg.	126	XRF	2/9/97	2	Classroo	206	Window	Casing	Solid	Wood	0.06
546	1924 bldg.	127	XRF	2/9/97	2	Classroo	206		Radiator	Peeling	Metal	5.09
547	1924 bldg.	128	XRF	2/9/97	2	Classroo	206	Bulletin B	Trim	Cracked	Wood	0.05
548	1924 bldg.	129	XRF	2/9/97	2	Classroo	206	Bulletin B	Trim	Cracked	Wood	0.1
549	1924 bldg.	130	XRF	2/9/97	2	Classroo	206	Bulletin B	Cork	Solid	Wood	1.23
550	1924 bldg.	131	XRF	2/9/97	2	Classroo	206	Wall	Baseboar	Cracked	Wood	0.04
551	1924 bldg.	132	XRF	2/9/97	2	Classroo	206	Floor		Solid	Wood	0
552	1924 bldg.	133	XRF	2/9/97	2	Classroo	206	Wall	Wall Rgstr	Solid	Metal	4.18
553	1924 bldg.	67	XRF	2/9/97	2	Classroo	207	Wall	Wall	Cracked	Plaster	5.09
554	1924 bldg.	68	XRF	2/9/97	2	Classroo	207	Wall	Wall	Cracked	Plaster	0.27
555	1924 bldg.	69	XRF	2/9/97	2	Classroo	207	Wall	Wall	Cracked	Plaster	5.09
556	1924 bldg.	70	XRF	2/9/97	2	Classroo	207	Door	Door	Solid	Wood	0.07
557	1924 bldg.	71	XRF	2/9/97	2	Classroo	207	Door	Casing	Solid	Wood	0.03
558	1924 bldg.	72	XRF	2/9/97	2	Classroo	207	Bulletin B	Chalk Boa	Solid	Wood	0.06
559	1924 bldg.	73	XRF	2/9/97	2	Classroo	207	Bulletin B	Chalk Boa	Solid	Wood	0.05
560	1924 bldg.	74	XRF	2/9/97	2	Classroo	207	Cabinet	Door	Solid	Wood	0.05
561	1924 bldg.	75	XRF	2/9/97	2	Classroo	207	Cabinet	Inside	Solid	Wood	0.24
562	1924 bldg.	76	XRF	2/9/97	2	Classroo	207	Wall	Baseboar	Solid	Wood	0.07
563	1924 bldg.	77	XRF	2/9/97	2	Classroo	207	Floor	Baseboar	Solid	Wood	0
564	1924 bldg.	78	XRF	2/9/97	2	Classroo	207		Radiator	Cracked	Metal	3.66
565	1924 bldg.	79	XRF	2/9/97	2	Classroo	207	Bookcase	Shelf	Cracked	Wood	0.04
566	1924 bldg.	80	XRF	2/9/97	2	Classroo	207	Window	Casing	Solid	Wood	0.12
567	1924 bldg.	81	XRF	2/9/97	2	Classroo	207	Wall	Crown mo	Solid	Wood	0.12
568	1924 bldg.	82	XRF	2/9/97	2	Classroo	207	Wall	Wall Rgstr	Solid	Metal	0

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	No	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	PbL
569	1924 bldg.	83	XRF	2/9/97	2	Classroo	207	Ceiling		Solid	Plaster	0.16
570	1924 bldg.	154	XRF	2/9/97	2	Hall		1 Wall	Wall	Cracked	Plaster	0.04
571	1924 bldg.	155	XRF	2/9/97	2	Hall		1 Wall	Wall	Cracked	Plaster	0.17
572	1924 bldg.	156	XRF	2/9/97	2	Hall		1 Wall	Wall	Solid	Tile	0.96
573	1924 bldg.	157	XRF	2/9/97	2	Hall		1 Wall	Wall	Solid	Plaster	0.04
574	1924 bldg.	158	XRF	2/9/97	2	Hall		1 Wall	Wall	Solid	Plaster	0.29
575	1924 bldg.	159	XRF	2/9/97	2	Hall		1 Window	Casing	Solid	Wood	0.12
576	1924 bldg.	160	XRF	2/9/97	2	Hall		1 Wall	Chair rail	Solid	Wood	0.05
577	1924 bldg.	161	XRF	2/9/97	2	Hall		1 Radiator		Peeling	Metal	5.09
578	1924 bldg.	162	XRF	2/9/97	2	Hall		1 Wall	Crown mo	Solid	Wood	0.14
579	1924 bldg.	163	XRF	2/9/97	2	Hall		1 Ceiling		Cracked	Plaster	0.21
580	1924 bldg.	164	XRF	2/9/97	2	Hall		1 Coat Rack		Solid	Wood	0
581	1924 bldg.	165	XRF	2/9/97	2	Hall		1 Boot Rack		Solid	Wood	0.01
582	1924 bldg.	166	XRF	2/9/97	2	Hall		1 Cabinet	Door	Solid	Wood	0.04
583	1924 bldg.	241	XRF	2/9/97	2	Hall		1 Closet	Wall	Solid	Tile	1.44
584	1924 bldg.	242	XRF	2/9/97	2	Hall		1 Closet	Wall	Solid	Tile	2.4
585	1924 bldg.	243	XRF	2/9/97	2	Hall		1 Door	Door	Cracked	Wood	0.04
586	1924 bldg.	244	XRF	2/9/97	2	Hall		1 Floor		Peeling	Concrete	0.01
587	1924 bldg.	245	XRF	2/9/97	2	Hall		1 Cabinet	Door	Cracked	Metal	0.76
588	1924 bldg.	246	XRF	2/9/97	2	Hall		1 Shelf	Solid	Wood	1.01	
589	1924 bldg.	247	XRF	2/9/97	2	Hall		1 Bulletin Board		Solid	Wood	0.1
590	1924 bldg.	248	XRF	2/9/97	2	Hall		1 Ceiling		Solid	Plaster	0.05
591	1924 bldg.	334	XRF	2/9/97	1	Hall		2 Closet	Wall	Solid	Tile	1.01
592	1924 bldg.	335	XRF	2/9/97	1	Hall		2 Closet	Wall	Solid	Tile	3.69
593	1924 bldg.	336	XRF	2/9/97	1	Hall		2 Closet	Door	Solid	Wood	0.07
594	1924 bldg.	337	XRF	2/9/97	1	Hall		2 Closet	Casing	Solid	Wood	0.07
595	1924 bldg.	338	XRF	2/9/97	1	Hall		2 Floor		Cracked	Concrete	0.02
596	1924 bldg.	339	XRF	2/9/97	1	Hall		2 Cabinet	Door	Cracked	Metal	0.51
597	1924 bldg.	340	XRF	2/9/97	1	Hall		2 Shelf		Cracked	Wood	0.89
598	1924 bldg.	341	XRF	2/9/97	1	Hall		2 Bulletin Board		Cracked	Wood	0.04
599	1924 bldg.	342	XRF	2/9/97	1	Hall		2 Ceiling		Cracked	Plaster	0.02
600	1924 bldg.	343	XRF	2/9/97	1	Hall		2 Wall	Wall	Cracked	Plaster	1.44
601	1924 bldg.	344	XRF	2/9/97	1	Hall		2 Wall	Wall	Cracked	Plaster	0.12
602	1924 bldg.	345	XRF	2/9/97	1	Hall		2 Wall	Middle Wall	Solid	Tile	0.84
603	1924 bldg.	346	XRF	2/9/97	1	Hall		2 Wall	Wall	Solid	Plaster	0
604	1924 bldg.	347	XRF	2/9/97	1	Hall		2 Coat Rack		Solid	Wood	0.02
605	1924 bldg.	348	XRF	2/9/97	1	Hall		2 Boot Rack		Solid	Wood	0
606	1924 bldg.	349	XRF	2/9/97	1	Hall		2 Wall	Chair rail	Solid	Wood	0.05
607	1924 bldg.	350	XRF	2/9/97	1	Hall		2 Wall	Elec Pane	Solid	Metal	0.01
608	1924 bldg.	351	XRF	2/9/97	1	Hall		2 Wall	Wall	Solid	Plaster	0.08
609	1924 bldg.	352	XRF	2/9/97	1	Hall		2 Wall	Crown mo	Solid	Wood	0.05
610	1924 bldg.	353	XRF	2/9/97	1	Hall		2 Ceiling		Cracked	Plaster	0.26
611	1924 bldg.	354	XRF	2/9/97	1	Hall		2 Window	Casing	Solid	Wood	0.1
612	1924 bldg.	355	XRF	2/9/97	1	Hall		2 Radiator		Cracked	Metal	0.03
613	1924 bldg.	53	XRF	2/10/97	0	Hall		2 Wall	Wall	Solid	Plaster	0.16
614	1924 bldg.	54	XRF	2/10/97	0	Hall		2 Wall	Middle Wall	Cracked	Plaster	0.32
615	1924 bldg.	55	XRF	2/10/97	0	Hall		2 Wall	Middle Wall	Cracked		0.31
616	1924 bldg.	56	XRF	2/10/97	0	Hall		2 Wall	Wall	Cracked	Plaster	0.45
617	1924 bldg.	57	XRF	2/10/97	0	Hall		2 Wall	Middle Wall	Cracked	Plaster	0.26
618	1924 bldg.	58	XRF	2/10/97	0	Hall		2 Door	Door	Cracked	Wood	0.02
619	1924 bldg.	59	XRF	2/10/97	0	Hall		2 Door	Casing	Cracked	Wood	0.02
620	1924 bldg.	60	XRF	2/10/97	0	Hall		2 Window	Casing	Cracked	Wood	0.07
621	1924 bldg.	61	XRF	2/10/97	0	Hall		2 Radiator		Cracked	Metal	5.09
622	1924 bldg.	62	XRF	2/10/97	0	Hall		2 Wall	Baseboar	Solid	Wood	0.02
623	1924 bldg.	109	XRF	2/10/97	1	Hall		3 Wall	Wall	Cracked	Plaster	5.09
624	1924 bldg.	110	XRF	2/10/97	1	Hall		3 Wall	Wall	Cracked	Plaster	0.26
625	1924 bldg.	111	XRF	2/10/97	1	Hall		3 Wall	Elec Pane	Solid	Metal	0.01
626	1924 bldg.	112	XRF	2/10/97	1	Hall		3 Wall	Chair rali	Solid	Wood	0.05
627	1924 bldg.	113	XRF	2/10/97	1	Hall		3 Wall	Baseboar	Cracked	Plaster	0.16
628	1924 bldg.	114	XRF	2/10/97	1	Hall		3 Door	Door	Solid	Wood	0
629	1924 bldg.	115	XRF	2/10/97	1	Hall		3 Door	Casing	Solid	Wood	0
630	1924 bldg.	116	XRF	2/10/97	1	Hall		3 Closet	Wall	Cracked		5.09
631	1924 bldg.	117	XRF	2/10/97	1	Hall		3 Closet	Coat Rack	Solid	Wood	0.04

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	No	Analysis	Date	Floor	Area	Room#	Componen	Feature	Condition	Substrate	Pbl.
632	1924 bldg.	118	XRF	2/10/97	1	Hall	3	Ceiling	Wall	Cracked	Plaster	0.18
633	1924 bldg.	119	XRF	2/10/97	1	Hall	3	Ceiling	Hatch	Solid	Wood	0.02
634	1924 bldg.	131	XRF	2/10/97	1	Kitchen	0	Door	Door	Cracked	Wood	0.03
635	1924 bldg.	102	XRF	2/10/97	1	Kitchen	0	Door	Casing	Cracked	Wood	0.04
636	1924 bldg.	103	XRF	2/10/97	1	Kitchen	0	Window	Casing	Solid	Wood	0.09
637	1924 bldg.	104	XRF	2/10/97	1	Kitchen	0	Wall	Baseboar	Cracked	Plaster	0.05
638	1924 bldg.	105	XRF	2/10/97	1	Kitchen	0	Ceiling		Peeling	Plaster	1.17
639	1924 bldg.	106	XRF	2/10/97	1	Kitchen	0	Cooling Rack		Solid	Wood	0.03
640	1924 bldg.	107	XRF	2/10/97	1	Kitchen	0	Elec Pane	Solid	Metal	0.2	
641	1924 bldg.	108	XRF	2/10/97	1	Kitchen	0	Elec Pane	Solid	Metal	0.01	
642	1924 bldg.	127	XRF	2/10/97	1	Kitchen	1	Wall	Wall	Cracked	Plaster	0.33
643	1924 bldg.	128	XRF	2/10/97	1	Kitchen	1	Wall	Wall	Solid	Plaster	0.37
644	1924 bldg.	129	XRF	2/10/97	1	Kitchen	1	Door	Serving	Solid	Wood	0.01
645	1924 bldg.	130	XRF	2/10/97	1	Kitchen	1	Door	Casing	Solid		0.02
646	1924 bldg.	249	XRF	2/9/97	1	Library	1	Wall	Wall	Cracked	Plaster	5.09
647	1924 bldg.	250	XRF	2/9/97	1	Library	1	Wall	Wall	Cracked	Plaster	0.13
648	1924 bldg.	251	XRF	2/9/97	1	Library	1	Wall	Wall	Cracked	Plaster	0.07
649	1924 bldg.	252	XRF	2/9/97	1	Library	1	Wall	Crown mo	Solid	Wood	0.02
650	1924 bldg.	253	XRF	2/9/97	1	Library	1	Door	Door	Solid	Wood	0.05
651	1924 bldg.	254	XRF	2/9/97	1	Library	1	Door	Casing	Solid	Wood	0.05
652	1924 bldg.	255	XRF	2/9/97	1	Library	1		Casing	Solid	Wood	0.11
653	1924 bldg.	256	XRF	2/9/97	1	Library	1	Radiator	Protector	Cracked	Metal	5.09
654	1924 bldg.	257	XRF	2/9/97	1	Library	1	Unlisted	Radiator	Solid	Metal	0.05
655	1924 bldg.	258	XRF	2/9/97	1	Library	1	Wall	Baseboar	Solid	Wood	0.08
656	1924 bldg.	259	XRF	2/9/97	1	Library	1	Cabinet	Door	Solid	Wood	0.06
657	1924 bldg.	260	XRF	2/9/97	1	Library	1	Cabinet	Inside	Solid	Wood	0.53
658	1924 bldg.	261	XRF	2/9/97	1	Library	1	Cabinet	Shelf	Solid	Wood	0.99
659	1924 bldg.	262	XRF	2/9/97	1	Library	1	Bookcase	Shelf	Solid	Wood	0.01
660	1924 bldg.	263	XRF	2/9/97	1	Library	1	Bulletin Board		Solid	Wood	0.01
661	1924 bldg.	264	XRF	2/9/97	1	Library	1	Wall	Wall Rgstr	Solid	Metal	3.48
662	1924 bldg.	265	XRF	2/9/97	1	Library	1	Bulletin B	Midle Wall	Solid	Wood	0.06
663	1924 bldg.	266	XRF	2/9/97	1	Library	1	Celling		Solid	Plaster	0.09
664	1924 bldg.	109	XRF	2/10/97	1	Lunch Are	0	Wall	Midle Wall	Solid	Tile	0.11
665	1924 bldg.	110	XRF	2/10/97	1	Lunch Are	0		Radiator	Solid	Metal	0.28
666	1924 bldg.	111	XRF	2/10/97	1	Lunch Are	0	Window	Casing	Solid	Wood	0.15
667	1924 bldg.	112	XRF	2/10/97	1	Lunch Are	0	Door	Door	Solid	Wood	0
668	1924 bldg.	114	XRF	2/10/97	1	Lunch Are	0	Door	Casing	Cracked	Wood	0.01
669	1924 bldg.	115	XRF	2/10/97	1	Lunch Are	0	Door	Door	Cracked	Wood	0.04
670	1924 bldg.	116	XRF	2/10/97	1	Lunch Are	0	Door	Door	Solid	Wood	0.01
671	1924 bldg.	117	XRF	2/10/97	1	Lunch Are	0	Door	Casing	Cracked	Metal	0.07
672	1924 bldg.	118	XRF	2/10/97	1	Lunch Are	0	Pipe	Guard	Cracked	Metal	0.05
673	1924 bldg.	22	XRF	2/10/97	0	Outside	1	Fountain		Solid	Concrete	0
674	1924 bldg.	23	XRF	2/10/97	0	Outside	1	Window	Grate	Cracked	Metal	
675	1924 bldg.	24	XRF	2/10/97	0	Outside	1	Handrail		Cracked	Metal	0
676	1924 bldg.	61	XRF	2/9/97	2	Restroom	1	Wall	Wall	Solid	Tile	0.28
677	1924 bldg.	62	XRF	2/9/97	2	Restroom	1	Wall	Wall	Solid	Plaster	0.31
678	1924 bldg.	63	XRF	2/9/97	2	Restroom	1	Window	Casing	Solid	Wood	0.03
679	1924 bldg.	64	XRF	2/9/97	2	Restroom	1	Floor	Casing	Cracked	Concrete	0.36
680	1924 bldg.	96	XRF	2/9/97	2	Restroom	2	Wall	Midle Wall	Solid	Tile	1.28
681	1924 bldg.	97	XRF	2/9/97	2	Restroom	2	Door	Door	Solid	Wood	0.03
682	1924 bldg.	98	XRF	2/9/97	2	Restroom	2	Door	Casing	Cracked	Wood	0.03
683	1924 bldg.	99	XRF	2/9/97	2	Restroom	2	Window	Casing	Solid	Wood	0.09
684	1924 bldg.	100	XRF	2/9/97	2	Restroom	2		Radiator	Cracked	Metal	5.09
685	1924 bldg.	101	XRF	2/9/97	2	Restroom	2	Wall	Wall Rgstr	Solid	Metal	0.04
686	1924 bldg.	102	XRF	2/9/97	2	Restroom	2	Wall	Bthrm Stl	Solid	Metal	0.05
687	1924 bldg.	103	XRF	2/9/97	2	Restroom	2	Soffit		Solid	Plaster	0.14
688	1924 bldg.	104	XRF	2/9/97	2	Restroom	3	Soffit		Cracked	Plaster	0.06
689	1924 bldg.	105	XRF	2/9/97	2	Restroom	3	Door	Door	Solid	Wood	0.03
690	1924 bldg.	106	XRF	2/9/97	2	Restroom	3	Door	Jamb	Cracked	Wood	0.03
691	1924 bldg.	107	XRF	2/9/97	2	Restroom	3	Wall	Midle Wall	Solid	Tile	2.23
692	1924 bldg.	108	XRF	2/9/97	2	Restroom	3	Window	Casing	Solid	Wood	0.09
693	1924 bldg.	109	XRF	2/9/97	2	Restroom	3		Radiator	Peeling	Metal	5.09
694	1924 bldg.	110	XRF	2/9/97	2	Restroom	3	Bthrm Stl	Solid	Metal		0.07

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

3	A	B	C	D	E	F	G	H	I	J	K	L
	Site	No	Analysis	Date	Floor	Area	Room#	Componen	Feature	Condition	Substrate	PbL
695	1924 bldg.	111	XRF	2/9/97	2	Restroom	3	Wall	Wall Rgstr	Solid	Metal	0.03
696	1924 bldg.	112	XRF	2/9/97	2	Restroom	3	Mirror Frame		Cracked	Wood	0
697	1924 bldg.	267	XRF	2/9/97	1	Restroom	4	Wall	Wall	Cracked	Tile	1.97
698	1924 bldg.	268	XRF	2/9/97	2	Restroom	4	Wall	Wall	Cracked	Plaster	5.09
699	1924 bldg.	269	XRF	2/9/97	2	Restroom	4	Door	Door	Solid	Wood	0.07
700	1924 bldg.	270	XRF	2/9/97	2	Restroom	4	Door	Casing	Solid	Wood	0.06
701	1924 bldg.	271	XRF	2/9/97	2	Restroom	4	Window	Casing	Solid	Wood	0.12
702	1924 bldg.	272	XRF	2/9/97	2	Restroom	4		Radiator	Cracked	Metal	0.17
703	1924 bldg.	273	XRF	2/9/97	2	Restroom	4	Wall	Chair rail	Solid	Wood	0.04
704	1924 bldg.	274	XRF	2/9/97	2	Restroom	4	Wall	Wall Rgstr	Solid	Metal	2.97
705	1924 bldg.	275	XRF	2/9/97	2	Restroom	4	Wall	Baseboar	Cracked	Concrete	0.17
706	1924 bldg.	276	XRF	2/9/97	2	Restroom	5	Wall	Midle Wall	Cracked	Tile	1.08
707	1924 bldg.	277	XRF	2/9/97	2	Restroom	5	Door	Door	Solid	Wood	0.05
708	1924 bldg.	278	XRF	2/9/97	2	Restroom	5	Door	Casing	Solid	Wood	0.04
709	1924 bldg.	279	XRF	2/9/97	2	Restroom	5	Window	Casing	Solid	Wood	0.06
710	1924 bldg.	280	XRF	2/9/97	2	Restroom	5		Radiator	Cracked	Metal	4.47
711	1924 bldg.	281	XRF	2/9/97	2	Restroom	5	Wall	Wall Rgstr	Cracked	Metal	0.01
712	1924 bldg.	282	XRF	2/9/97	2	Restroom	5		Bthrm Stll	Solid	Metal	0.2
713	1924 bldg.	283	XRF	2/9/97	2	Restroom	5	Wall	Wall	Solid	Plaster	0.07
714	1924 bldg.	285	XRF	2/9/97	1	Restroom	6	Wall	Midle Wall	Solid	Tile	2.1
715	1924 bldg.	286	XRF	2/9/97	1	Restroom	6	Door	Door	Solid	Wood	0.04
716	1924 bldg.	287	XRF	2/9/97	1	Restroom	6	Door	Casing	Solid	Wood	0.08
717	1924 bldg.	288	XRF	2/9/97	1	Restroom	6	Window	Casing	Solid	Wood	0.04
718	1924 bldg.	289	XRF	2/9/97	1	Restroom	6		Radiator	Peeling	Metal	5.09
719	1924 bldg.	290	XRF	2/9/97	1	Restroom	6		Bthrm Stll	Solid	Metal	0.02
720	1924 bldg.	291	XRF	2/9/97	1	Restroom	6		Stall Door	Solid	Metal	0.02
721	1924 bldg.	292	XRF	2/9/97	1	Restroom	6	Wall	Wall Rgstr	Solid	Metal	0.04
722	1924 bldg.	293	XRF	2/9/97	1	Restroom	6	Wall	Wall	Solid	Plaster	0.05
723	1924 bldg.	127	XRF	2/10/97	0	Restroom	6	Wall	Wall	Solid	Tile	2.65
724	1924 bldg.	128	XRF	2/10/97	0	Restroom	6	Door	Door	Solid	Wood	0
725	1924 bldg.	129	XRF	2/10/97	0	Restroom	6	Door	Casing	Solid	Wood	0.06
726	1924 bldg.	130	XRF	2/10/97	0	Restroom	6	Door	Door	Solid	Wood	0
727	1924 bldg.	131	XRF	2/10/97	0	Restroom	6	Door	Casing	Solid	Metal	0.03
728	1924 bldg.	132	XRF	2/10/97	0	Restroom	6		Bthrm Stll	Solid	Metal	0.1
729	1924 bldg.	133	XRF	2/10/97	0	Restroom	6	Wall	Wall Rgstr	Solid	Metal	0.06
730	1924 bldg.	134	XRF	2/10/97	0	Restroom	7	Wall	Midle Wall	Solid	Tile	2.76
731	1924 bldg.	135	XRF	2/10/97	0	Restroom	7	Door	Door	Solid	Wood	0
732	1924 bldg.	136	XRF	2/10/97	0	Restroom	7	Door	Casing	Cracked	Metal	0.02
733	1924 bldg.	137	XRF	2/10/97	0	Restroom	7		Bthrm Stll	Solid	Metal	0.07
734	1924 bldg.	138	XRF	2/10/97	0	Restroom	7	Wall	Wall Rgstr	Solid	Metal	0.06
735	1924 bldg.	139	XRF	2/10/97	0	Restroom	7	Ceiling	Radiator	Solid	Metal	4.47
736	1924 bldg.	140	XRF	2/10/97	0	Restroom	7	Ceiling	Radiator	Solid	Metal	5.09
737	1924 bldg.	65	XRF	2/9/97	2	Room	2	Wall Uppe	Crown mo	Cracked	Wood	0.09
738	1924 bldg.	66	XRF	2/9/97	2	Room	2	Wall	Wall Rgstr	Solid	Metal	5.09
739	1924 bldg.	59	XRF	2/9/97	2	Room	2	Closet	Wall	Solid	Plaster	0.29
740	1924 bldg.	60	XRF	2/9/97	2	Room	2	Closet	Shelf	Solid	Wood	0.05
741	1924 bldg.	48	XRF	2/9/97	2	Room	2	Wall	Wall	Cracked	Tile	0.2
742	1924 bldg.	49	XRF	2/9/97	2	Room	2	Wall	Wall	Cracked	Plaster	0.35
743	1924 bldg.	50	XRF	2/9/97	2	Room	2	Door	Casing	Solid	Wood	0.05
744	1924 bldg.	51	XRF	2/9/97	2	Room	2	Door	Door	Solid	Wood	0.03
745	1924 bldg.	52	XRF	2/9/97	2	Room	2	Window	Casing	Solid	Wood	0.13
746	1924 bldg.	53	XRF	2/9/97	2	Room	2	Cabinet	Door	Solid	Wood	0.04
747	1924 bldg.	54	XRF	2/9/97	2	Room	2		Radiator	Cracked	Metal	0.22
748	1924 bldg.	55	XRF	2/9/97	2	Room	2	Floor		Solid	Wood	0
749	1924 bldg.	56	XRF	2/9/97	2	Room	2	Wall	Chair rail	Solid	Wood	0.03
750	1924 bldg.	57	XRF	2/9/97	2	Room	2	Wall	Baseboar	Solid	Wood	0.04
751	1924 bldg.	58	XRF	2/9/97	2	Room	2	Bulletin Board		Solid	Wood	0.02
752	1924 bldg.	85	XRF	2/9/97	2	Room	3	Wall	Wall	Cracked	Plaster	3.46
753	1924 bldg.	86	XRF	2/9/97	2	Room	3	Wall	Wall	Cracked	Plaster	3.86
754	1924 bldg.	87	XRF	2/9/97	2	Room	3	Wall	Midle Wall	Cracked	Plaster	3.81
755	1924 bldg.	88	XRF	2/9/97	2	Room	3	Wall	Wall	Cracked	Plaster	0.36
756	1924 bldg.	89	XRF	2/9/97	2	Room	3	Door	Door	Solid	Wood	0.06
757	1924 bldg.	90	XRF	2/9/97	2	Room	3	Door	Casng	Solid	Wood	0.05

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	No	Analysis	Date	Floor	Area	Room#	Componen	Feature	Condition	Substrate	PbL
758	1924 bldg.	91	XRF	2/9/97	2	Room	3	Window	Casing	Solid	Wood	0.1
759	1924 bldg.	92	XRF	2/9/97	2	Room	3	Radiator	Solid	Metal		3.9
760	1924 bldg.	93	XRF	2/9/97	2	Room	3	Wall	Baseboar	Solid	Wood	0.02
761	1924 bldg.	94	XRF	2/9/97	2	Room	3	Floor		Solid	Wood	0.01
762	1924 bldg.	95	XRF	2/9/97	2	Room	3		Ladder	Solid	Metal	5.09
763	1924 bldg.	63	XRF	2/10/97	1	Room	4	Cabinet	Door	Cracked	Wood	0.03
764	1924 bldg.	65	XRF	2/10/97	1	Room	4	Cabinet	Inside	Solid	Wood	0.04
765	1924 bldg.	66	XRF	2/10/97	1	Room	4	Cabinet	Shelf	Solid	Wood	0.02
766	1924 bldg.	67	XRF	2/10/97	1	Room	4	Bulletin Board		Solid	Wood	0.03
767	1924 bldg.	68	XRF	2/10/97	1	Room	4	Wall	Radiator	Cracked	Metal	5.09
768	1924 bldg.	69	XRF	2/10/97	1	Room	4	Wall	Baseboar	Solid	Wood	0.05
769	1924 bldg.	70	XRF	2/10/97	1	Room	4	Bookcase	Shelf	Solid	Wood	0.01
770	1924 bldg.	71	XRF	2/10/97	1	Room	4	Closet	Wall	Peeling	Plaster	5.09
771	1924 bldg.	72	XRF	2/10/97	1	Room	4	Closet	Floor	Solid	Wood	0
772	1924 bldg.	73	XRF	2/10/97	1	Room	4	Closet	Wire Tray	Solid	Metal	0.01
773	1924 bldg.	74	XRF	2/10/97	1	Room	4	Ceiling	Grid	Solid	Wood	0.3
774	1924 bldg.	75	XRF	2/10/97	1	Room	4	Wall	Crown mo	Solid	Wood	0.06
775	1924 bldg.	76	XRF	2/10/97	1	Room	4	Ceiling		Cracked	Plaster	0.44
776	1924 bldg.	77	XRF	2/10/97	1	Room	5	Wall	Wall	Cracked	Plaster	5.09
777	1924 bldg.	78	XRF	2/10/97	1	Room	5	Wall	Midle Wall	Cracked	Plaster	0.19
778	1924 bldg.	79	XRF	2/10/97	1	Room	5	Wall	Wall	Cracked	Plaster	0.13
779	1924 bldg.	80	XRF	2/10/97	1	Room	5	Ceiling	Grid	Solid	Wood	0
780	1924 bldg.	81	XRF	2/10/97	1	Room	5	Door	Door	Solid	Wood	0.02
781	1924 bldg.	82	XRF	2/10/97	1	Room	5	Door	Casing	Solid	Wood	0.01
782	1924 bldg.	83	XRF	2/10/97	1	Room	5	Wall	Baseboar	Solid	Wood	0.09
783	1924 bldg.	84	XRF	2/10/97	1	Room	5	Window	Casing	Solid	Wood	0.1
784	1924 bldg.	85	XRF	2/10/97	1	Room	5	Bookcase	Shelf	Solid	Wood	0.01
785	1924 bldg.	86	XRF	2/10/97	1	Room	5		Radiator	Cracked	Metal	5.09
786	1924 bldg.	87	XRF	2/10/97	1	Room	5	Radiator	Protector	Solid	Wood	0
787	1924 bldg.	88	XRF	2/10/97	1	Room	5	Bulletin Board		Solid	Wood	0
788	1924 bldg.	89	XRF	2/10/97	1	Room	5	Ceiling		Cracked	Plaster	0.25
789	1924 bldg.	90	XRF	2/10/97	1	Room	5	Wall	Wall Rgstr	Solid	Metal	0.22
790	1924 bldg.	91	XRF	2/10/97	1	Room	5	Wall	Crown mo	Solid	Wood	0.04
791	1924 bldg.	92	XRF	2/10/97	1	Room	6	Wall	Wall	Cracked	Plaster	5.09
792	1924 bldg.	93	XRF	2/10/97	1	Room	6	Wall	Wall	Cracked	Plaster	0.33
793	1924 bldg.	94	XRF	2/10/97	1	Room	6	Door	Door	Solid	Wood	0.05
794	1924 bldg.	95	XRF	2/10/97	1	Room	6	Window	Casing	Solid	Wood	0.08
795	1924 bldg.	96	XRF	2/10/97	1	Room	6		Radiator	Cracked	Metal	3.47
796	1924 bldg.	97	XRF	2/10/97	1	Room	6	Wall	Baseboar	Solid	Wood	0.08
797	1924 bldg.	98	XRF	2/10/97	1	Room	6	Cabinet	Door	Solid	Wood	0.02
798	1924 bldg.	99	XRF	2/10/97	1	Room	6	Cabinet	Inside	Solid	Wood	0.06
799	1924 bldg.	100	XRF	2/10/97	1	Room	6	Cabinet	Shelf	Cracked	Wood	0.02
800	1924 bldg.	101	XRF	2/10/97	1	Room	6	Ceiling		Cracked	Plaster	0.31
801	1924 bldg.	102	XRF	2/10/97	1	Room	7	Wall	Midle Wall	Cracked	Plaster	0.25
802	1924 bldg.	103	XRF	2/10/97	1	Room	7	Door	Door	Solid	Metal	0.43
803	1924 bldg.	104	XRF	2/10/97	1	Room	7	Door	Casing	Cracked	Metal	0.22
804	1924 bldg.	105	XRF	2/10/97	1	Room	7	Stairs	Hand rail	Cracked	Metal	1.63
805	1924 bldg.	106	XRF	2/10/97	1	Room	7	Stairs	Tread	Peeling	Concrte	0.84
806	1924 bldg.	107	XRF	2/10/97	1	Room	7		Wire Tray	Solid	Metal	0.01
807	1924 bldg.	108	XRF	2/10/97	1	Room	7	Mounting	Wall	Solid	Wood	0
808	1924 bldg.	119	XRF	2/10/97	1	Room	8	Wall	Midle Wall	Cracked	Plaster	0.7
809	1924 bldg.	120	XRF	2/10/97	1	Room	8	Door	Door	Solid	Wood	0.02
810	1924 bldg.	121	XRF	2/10/97	1	Room	8	Cabinet	Door	Solid	Wood	0.01
811	1924 bldg.	122	XRF	2/10/97	1	Room	8	Cabinet	Inside	Solid	Wood	0.62
812	1924 bldg.	123	XRF	2/10/97	1	Room	8	Cabinet	Shelf	Solid	Wood	0.72
813	1924 bldg.	124	XRF	2/10/97	1	Room	8	Wall	Baseboar	Cracked	Wood	0.05
814	1924 bldg.	125	XRF	2/10/97	1	Room	8	Wall	Elec Pane	Solid	Metal	0.02
815	1924 bldg.	126	XRF	2/10/97	0	Room	8	Ceiling		Cracked	Plaster	0.04
816	1924 bldg.	7	XRF	2/9/97	0	Room	18	Wall	Wall	Cracked	Plaster	0.24
817	1924 bldg.	8	XRF	2/9/97	0	Room	18	Ceiling		Solid	Plaster	0.21
818	1924 bldg.	9	XRF	2/9/97	0	Room	18	Door	Door	Solid	Wood	0.01
819	1924 bldg.	10	XRF	2/9/97	0	Room	18	Door	Casing	Solid	Wood	0
820	1924 bldg.	11	XRF	2/9/97	0	Room	18		Radiator	Solid	Metal	0.19

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

3	A Site	B No	C Analysis	D Date	E Floor	F Area	G Room#	H Componen	I Feature	J Condition	K Substrate	L PbL
821	1924 bldg.	12	XRF	2/9/97	0	Room	18	Floor	Fir Registr	Cracked	Metal	0.56
822	1924 bldg.	13	XRF	2/9/97	0	Room	18	Floor	Fir Registr	Peeling	Concrete	1.01
823	1924 bldg.	14	XRF	2/9/97	0	Room	18	Bookcase	Shelf	Solid	Wood	0
824	1924 bldg.	356	XRF	2/9/97	1	Stairwell	2	Door	Door	Solid	Wood	0
825	1924 bldg.	357	XRF	2/9/97	1	Stairwell	2	Door	Casing	Solid	Wood	0.05
826	1924 bldg.	358	XRF	2/9/97	1	Stairwell	2	Wall	Wall	Solid	Plaster	3.67
827	1924 bldg.	359	XRF	2/9/97	1	Stairwell	2	Wall	Wall	Solid	Plaster	0.2
828	1924 bldg.	360	XRF	2/9/97	1	Stairwell	2	Wall	Midle Wall	Solid	Plaster	2.38
829	1924 bldg.	361	XRF	2/9/97	1	Stairwell	2	Wall	Midle Wall	Cracked	Plaster	0.16
830	1924 bldg.	362	XRF	2/9/97	1	Stairwell	2	Stairs	Hand rail	Cracked	Wood	0.01
831	1924 bldg.	363	XRF	2/9/97	1	Stairwell	2	Stairs	Hand rail	Cracked	Metal	0.04
832	1924 bldg.	364	XRF	2/9/97	1	Stairwell	2	Stairs	Baseboar	Cracked	Wood	0.13
833	1924 bldg.	365	XRF	2/9/97	1	Stairwell	2	Stairs	Rail cap	Cracked	Metal	0.03
834	1924 bldg.	366	XRF	2/9/97	1	Stairwell	2	Door	Door	Cracked	Wood	0.88
835	1924 bldg.	367	XRF	2/9/97	1	Stairwell	2	Door	Jamb	Cracked	Metal	0.14
836	1924 bldg.	368	XRF	2/9/97	1	Stairwell	2		Radiator	Peeling	Metal	5.09
837	1924 bldg.	369	XRF	2/9/97	1	Stairwell	2	Stairs	Riser	Cracked	Metal	0.12
838	1924 bldg.	370	XRF	2/9/97	1	Stairwell	2	Ceiling		Solid	Plaster	0.09
839	1924 bldg.	120	XRF	2/10/97	1	Stairwell	2	Stairs	Wall	Cracked	Plaster	5.09
840	1924 bldg.	121	XRF	2/10/97	1	Stairwell	2	Stairs	Wall	Cracked	Plaster	0.92
841	1924 bldg.	122	XRF	2/10/97	1	Stairwell	2	Stairs	Hand rail	Solid	Wood	0
842	1924 bldg.	123	XRF	2/10/97	1	Stairwell	2	Wall	Chair rail	Solid	Wood	0.03
843	1924 bldg.	124	XRF	2/10/97	1	Stairwell	2	Stairs	Baseboar	Solid	Plaster	0.14
844	1924 bldg.	125	XRF	2/10/97	1	Stairwell	2	Door	Door	Cracked	Wood	0.03
845	1924 bldg.	126	XRF	2/10/97	1	Stairwell	2	Door	Casing	Cracked	Wood	0.03
846	1954 bldg.	30	XRF	2/10/97	0	Classroo	101	Wall	Wall	Cracked	Plaster	0.14
847	1954 bldg.	31	XRF	2/10/97	1	Classroo	101	Wall	Wall	Cracked	Plaster	0.14
848	1954 bldg.	32	XRF	2/10/97	1	Classroo	101	Wall	Wall	Cracked	Plaster	0.1
849	1954 bldg.	33	XRF	2/10/97	1	Classroo	101	Ceiling	Wall	Solid	Plaster	0.01
850	1954 bldg.	34	XRF	2/10/97	1	Classroo	101	Ceiling	Wire tray	Cracked	Metal	0.29
851	1954 bldg.	35	XRF	2/10/97	1	Classroo	101	Door	Door	Solid	Wood	0.02
852	1954 bldg.	36	XRF	2/10/97	1	Classroo	101	Door	Jamb	Solid	Metal	0.02
853	1954 bldg.	37	XRF	2/10/97	1	Classroo	101	Wall	Baseboar	Cracked	Wood	0.01
854	1954 bldg.	38	XRF	2/10/97	1	Classroo	101	Cabinet	Door	Solid	Wood	0.02
855	1954 bldg.	39	XRF	2/10/97	1	Classroo	101	Cabinet	Inside	Solid	Wood	0.22
856	1954 bldg.	40	XRF	2/10/97	1	Classroo	101	Cabinet	Shelf	Solid	Wood	0.4
857	1954 bldg.	41	XRF	2/10/97	1	Classroo	101	Bookcase	Shelf	Cracked	Wood	0
858	1954 bldg.	42	XRF	2/10/97	1	Classroo	101	Bookcase	Wall Rgstr	Solid	Metal	0.02
859	1954 bldg.	43	XRF	2/10/97	1	Classroo	101		Univent	Solid	Metal	0.02
860	1954 bldg.	44	XRF	2/10/97	1	Classroo	101	Bulletin B	Midle Wall	Solid	Metal	0.02
861	1954 bldg.	45	XRF	2/10/97	1	Classroo	101	Cabinet	Door	Solid	Metal	0.14
862	1954 bldg.	400	XRF	2/9/97	1	Classroo	102	Wall	Midle Wall	Cracked	Plaster	0.15
863	1954 bldg.	401	XRF	2/9/97	1	Classroo	102	Door	Door	Solid	Wood	0.02
864	1954 bldg.	402	XRF	2/9/97	1	Classroo	102	Door	Jamb	Solid	Metal	0.01
865	1954 bldg.	403	XRF	2/9/97	1	Classroo	102	Wall	Wall	Cracked	Plaster	0.07
866	1954 bldg.	404	XRF	2/9/97	1	Classroo	102	Ceiling		Solid	Plaster	0.05
867	1954 bldg.	405	XRF	2/9/97	1	Classroo	102	Ceiling	Wire tray	Solid	Metal	0.3
868	1954 bldg.	406	XRF	2/9/97	1	Classroo	102	Bookcase	Shelf	Solid	Wood	0.01
869	1954 bldg.	407	XRF	2/9/97	1	Classroo	102		Univent	Solid	Metal	0.01
870	1954 bldg.	408	XRF	2/9/97	1	Classroo	102	Bookcase	Wall Rgstr	Solid	Metal	0.04
871	1954 bldg.	409	XRF	2/9/97	1	Classroo	102	Bulletin Board		Solid	Metal	0.03
872	1954 bldg.	410	XRF	2/9/97	1	Classroo	102	Cabinet	Door	Solid	Wood	0.01
873	1954 bldg.	411	XRF	2/9/97	1	Classroo	102	Cabinet	Inside	Solid	Wood	0.15
874	1954 bldg.	412	XRF	2/9/97	1	Classroo	102	Cabinet	Shelf	Solid	Wood	0.28
875	1954 bldg.	413	XRF	2/9/97	1	Classroo	102	Wall	Baseboar	Cracked	Wood	0.01
876	1954 bldg.	371	XRF	2/9/97	1	Classroo	103	Wall	Wall	Solid	Plaster	0.08
877	1954 bldg.	372	XRF	2/9/97	1	Classroo	103	Door	Door	Solid	Wood	0.01
878	1954 bldg.	373	XRF	2/9/97	1	Classroo	103	Door	Jamb	Solid	Metal	0.04
879	1954 bldg.	374	XRF	2/9/97	1	Classroo	103	Wall	Wall	Cracked	Plaster	0.19
880	1954 bldg.	375	XRF	2/9/97	1	Classroo	103	Ceiling		Cracked	Plaster	0.01
881	1954 bldg.	376	XRF	2/9/97	1	Classroo	103	Ceiling	Wire tray	Cracked	Metal	0.12
882	1954 bldg.	377	XRF	2/9/97	1	Classroo	103		Univent	Solid	Metal	0.02
883	1954 bldg.	378	XRF	2/9/97	1	Classroo	103	Bookcase	Wall Rgstr	Solid	Metal	0.02

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	No	Analysis	Date	Floor	Area	Room#	Componen	Feature	Condition	Substrate	PbL
884	1954 bldg.	379	XRF	2/9/97	1	Classroo	103	Bookcase	Shelf	Cracked	Wood	0.01
885	1954 bldg.	380	XRF	2/9/97	1	Classroo	103	Bulletin B	Midle Wall	Solid	Metal	0.06
886	1954 bldg.	381	XRF	2/9/97	1	Classroo	103	Wall	Baseboar	Cracked	Wood	0.01
887	1954 bldg.	382	XRF	2/9/97	1	Classroo	103	Cabinet	Door	Solid	Wood	0
888	1954 bldg.	383	XRF	2/9/97	1	Classroo	103	Cabinet	Inside	Solid	Wood	0.19
889	1954 bldg.	384	XRF	2/9/97	1	Classroo	103	Cabinet	Shelf	Solid	Wood	0.22
890	1954 bldg.	385	XRF	2/9/97	1	Classroo	104	Wall	Wall	Cracked	Plaster	0.13
891	1954 bldg.	386	XRF	2/9/97	1	Classroo	104	Wall	Wall	Solid	Plaster	0.33
892	1954 bldg.	387	XRF	2/9/97	1	Classroo	104	Ceiling		Solid	Plaster	0.01
893	1954 bldg.	388	XRF	2/9/97	1	Classroo	104	Ceiling		Solid	Metal	0.19
894	1954 bldg.	389	XRF	2/9/97	1	Classroo	104	Wall	Baseboar	Cracked	Wood	0.05
895	1954 bldg.	390	XRF	2/9/97	1	Classroo	104	Bulletin Board		Solid	Metal	0.03
896	1954 bldg.	391	XRF	2/9/97	1	Classroo	104	Bulletin Board		Solid		0.02
897	1954 bldg.	392	XRF	2/9/97	1	Classroo	104	Cabinet	Door	Solid	Wood	0.02
898	1954 bldg.	393	XRF	2/9/97	1	Classroo	104	Cabinet	Inside	Solid	Wood	0.4
899	1954 bldg.	394	XRF	2/9/97	1	Classroo	104	Cabinet	Shelf	Solid	Wood	0.71
900	1954 bldg.	395	XRF	2/9/97	1	Classroo	104	Bookcase	Shelf	Cracked	Wood	0.02
901	1954 bldg.	396	XRF	2/9/97	1	Classroo	104	Bookcase	Wall Rgstr	Solid	Metal	0.02
902	1954 bldg.	397	XRF	2/9/97	1	Classroo	104		Univent	Solid	Metal	0.01
903	1954 bldg.	398	XRF	2/9/97	1	Classroo	104	Door	Door	Solid	Wood	0.02
904	1954 bldg.	399	XRF	2/9/97	1	Classroo	104	Door	Casing	Cracked	Metal	0.02
905	1954 bldg.	212	XRF	2/9/97	2	Classroo	201	Wall	Wall	Cracked	Plaster	0.08
906	1954 bldg.	213	XRF	2/9/97	2	Classroo	201	Door	Door	Solid	Wood	0.02
907	1954 bldg.	214	XRF	2/9/97	2	Classroo	201	Door	Casing	Cracked	Metal	0.03
908	1954 bldg.	215	XRF	2/9/97	2	Classroo	201	Wall	Wall	Cracked	Plaster	0.09
909	1954 bldg.	216	XRF	2/9/97	2	Classroo	201	Ceiling		Cracked	Plaster	0.01
910	1954 bldg.	217	XRF	2/9/97	2	Classroo	201	Ceiling	Wiretray	Cracked	Metal	0.14
911	1954 bldg.	218	XRF	2/9/97	2	Classroo	201	Wall	Crown mo	Cracked	Wood	0.02
912	1954 bldg.	219	XRF	2/9/97	2	Classroo	201	Bookcase	Wall Rgstr	Solid	Metal	0.03
913	1954 bldg.	220	XRF	2/9/97	2	Classroo	201	Bookcase	Shelf	Cracked	Wood	0.01
914	1954 bldg.	221	XRF	2/9/97	2	Classroo	201	Wall	Univent	Solid	Metal	0.01
915	1954 bldg.	222	XRF	2/9/97	2	Classroo	201	Bulletin Board		Cracked	Metal	0.04
916	1954 bldg.	223	XRF	2/9/97	2	Classroo	201	Wall	Baseboar	Cracked	Wood	0.01
917	1954 bldg.	224	XRF	2/9/97	2	Classroo	201	Cabinet	Door	Solid	Wood	0.01
918	1954 bldg.	225	XRF	2/9/97	2	Classroo	201	Cabinet	Inside	Solid	Wood	0.08
919	1954 bldg.	226	XRF	2/9/97	2	Classroo	201	Cabinet	Shelf	Solid	Wood	0.06
920	1954 bldg.	197	XRF	2/9/97	2	Classroo	202	Wall	Wall	Cracked	Plaster	0.1
921	1954 bldg.	198	XRF	2/9/97	2	Classroo	202	Door	Door	Cracked	Wood	0.01
922	1954 bldg.	199	XRF	2/9/97	2	Classroo	202	Door	Casing	Cracked	Metal	0.03
923	1954 bldg.	200	XRF	2/9/97	2	Classroo	202	Wall	Wall	Cracked	Plaster	0.11
924	1954 bldg.	201	XRF	2/9/97	2	Classroo	202	Ceiling		Solid	Plaster	0.01
925	1954 bldg.	202	XRF	2/9/97	2	Classroo	202	Ceiling	Wiretray	Peeling	Metal	0
926	1954 bldg.	203	XRF	2/9/97	2	Classroo	202	Bookcase	Shelf	Cracked	Wood	0.05
927	1954 bldg.	204	XRF	2/9/97	2	Classroo	202		Univent	Solid	Metal	0.01
928	1954 bldg.	205	XRF	2/9/97	2	Classroo	202	Bookcase		Solid	Metal	0.02
929	1954 bldg.	206	XRF	2/9/97	2	Classroo	202	Cabinet	Door	Cracked	Wood	0.02
930	1954 bldg.	207	XRF	2/9/97	2	Classroo	202	Cabinet	Inside	Cracked	Wood	0.01
931	1954 bldg.	208	XRF	2/9/97	2	Classroo	202	Cabinet	Shelf	Solid	Wood	0.02
932	1954 bldg.	209	XRF	2/9/97	2	Classroo	202	Bulletin Board		Solid	Metal	0.06
933	1954 bldg.	210	XRF	2/9/97	2	Classroo	202	Wall	Crown mo	Solid	Wood	0
934	1954 bldg.	211	XRF	2/9/97	2	Classroo	202	Wall	Baseboar	Cracked	Wood	0.01
935	1954 bldg.	167	XRF	2/9/97	2	Classroo	203	Wall	Wall	Solid	Plaster	0.05
936	1954 bldg.	168	XRF	2/9/97	2	Classroo	203	Wall	Wall	Solid	Plaster	0.1
937	1954 bldg.	169	XRF	2/9/97	2	Classroo	203	Ceiling		Solid	Plaster	0.01
938	1954 bldg.	170	XRF	2/9/97	2	Classroo	203	Wire Tray		Solid	Metal	0.01
939	1954 bldg.	171	XRF	2/9/97	2	Classroo	203	Door	Door	Solid	Wood	0.01
940	1954 bldg.	172	XRF	2/9/97	2	Classroo	203	Door	Jamb	Cracked	Metal	0.06
941	1954 bldg.	173	XRF	2/9/97	2	Classroo	203	Wall	Baseboar	Cracked	Wood	0.01
942	1954 bldg.	174	XRF	2/9/97	2	Classroo	203	Bulletin Board		Solid	Metal	0.04
943	1954 bldg.	175	XRF	2/9/97	2	Classroo	203	Cabinet	Door	Solid	Wood	0
944	1954 bldg.	176	XRF	2/9/97	2	Classroo	203	Cabinet	Inside	Solid	Wood	0.25
945	1954 bldg.	177	XRF	2/9/97	2	Classroo	203	Cabinet	Shelf	Solid	Wood	0.12
946	1954 bldg.	178	XRF	2/9/97	2	Classroo	203	Bookcase	Inside	Solid	Wood	0.01

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

3	A	B	C	D	E	F	G	H	I	J	K	L
	Site	No	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	PbL
947	1954 bldg.	179	XRF	2/9/97	2	Classroo	203	Bookcase	Wall Rgstr	Cracked	Metal	0.02
948	1954 bldg.	180	XRF	2/9/97	2	Classroo	204	Wall	Wall	Solid	Plaster	0.02
949	1954 bldg.	181	XRF	2/9/97	2	Classroo	204	Wall	Wall	Solid	Plaster	0.05
950	1954 bldg.	182	XRF	2/9/97	2	Classroo	204	Ceiling	Wall	Solid	Plaster	0.01
951	1954 bldg.	183	XRF	2/9/97	2	Classroo	204	Celling	Wiretray	Solid	Metal	0.06
952	1954 bldg.	184	XRF	2/9/97	2	Classroo	204	Bookcase	Shelf	Cracked	Wood	0.03
953	1954 bldg.	185	XRF	2/9/97	2	Classroo	204	Bookcase	Shelf	Cracked		0
954	1954 bldg.	186	XRF	2/9/97	2	Classroo	204		Univent	Solid	Metal	0.02
955	1954 bldg.	187	XRF	2/9/97	2	Classroo	204	Bookcase	Wall Rgstr	Solid	Metal	0.03
956	1954 bldg.	188	XRF	2/9/97	2	Classroo	204	Wall	Baseboar	Cracked		0.01
957	1954 bldg.	189	XRF	2/9/97	2	Classroo	204	Bulletin B	Midle Wall	Cracked	Metal	0.08
958	1954 bldg.	190	XRF	2/9/97	2	Classroo	204	Door	Door	Solid	Wood	0.02
959	1954 bldg.	191	XRF	2/9/97	2	Classroo	204	Door	Casing	Cracked	Metal	0.04
960	1954 bldg.	192	XRF	2/9/97	2	Classroo	204	Cabinet	Door	Solid	Wood	0.02
961	1954 bldg.	193	XRF	2/9/97	2	Classroo	204	Cabinet	Inside	Solid	Wood	0.07
962	1954 bldg.	194	XRF	2/9/97	2	Classroo	204	Cabinet	Shelf	Solid	Wood	0.03
963	1954 bldg.	195	XRF	2/9/97	2	Classroo	204	Wall	Crown mo	Solid	Wood	0.03
964	1954 bldg.	181	XRF	2/10/97	0	Gym	1	Wall	Wall	Solid	Tile	0.11
965	1954 bldg.	182	XRF	2/10/97	0	Gym	1	Wall	Wall	Solid	Concrte	0.01
966	1954 bldg.	183	XRF	2/10/97	0	Gym	1		Backboar	Solid	Metal	0
967	1954 bldg.	184	XRF	2/10/97	0	Gym	1	Ceiling		Solid	Concrte	0.05
968	1954 bldg.	185	XRF	2/10/97	0	Gym	1	Door	Door	Solid	Wood	0
969	1954 bldg.	186	XRF	2/10/97	0	Gym	1	Door	Casing	Solid	Metal	0.11
970	1954 bldg.	187	XRF	2/10/97	0	Gym	1	Wall	Wall Rgstr	Solid	Metal	0.01
971	1954 bldg.	188	XRF	2/10/97	0	Gym	1	Wall	Wall	Solid	Concrte	0.05
972	1954 bldg.	227	XRF	2/9/97	2	Hall	1	Wall	Midle Wall	Solid	Tile	2.78
973	1954 bldg.	228	XRF	2/9/97	2	Hall	1	Wall	Midle Wall	Solid	Tile	0.99
974	1954 bldg.	229	XRF	2/9/97	2	Hall	1	Door	Door	Cracked	Wood	0.02
975	1954 bldg.	230	XRF	2/9/97	2	Hall	1	Door	Casing	Solid	Metal	0.01
976	1954 bldg.	231	XRF	2/9/97	2	Hall	1	Wall	Wall Rgstr	Solid	Metal	0.02
977	1954 bldg.	232	XRF	2/9/97	2	Hall	1	Coat Rack		Solid	Wood	0.02
978	1954 bldg.	233	XRF	2/9/97	2	Hall	1	Boot Rack		Solid	Wood	0
979	1954 bldg.	234	XRF	2/9/97	2	Hall	1	Ceiling	Hatch	Solid	Metal	0
980	1954 bldg.	46	XRF	2/10/97	1	Hall	2	Wall	Midle Wall	Solid	Tile	2.88
981	1954 bldg.	47	XRF	2/10/97	1	Hall	2	Wall	Midle Wall	Solid	Tile	0.8
982	1954 bldg.	48	XRF	2/10/97	1	Hall	2	Door	Door	Solid	Wood	0.04
983	1954 bldg.	49	XRF	2/10/97	1	Hall	2	Door	Jamb	Solid	Metal	0.08
984	1954 bldg.	50	XRF	2/10/97	1	Hall	2	Wall	Wall Rgstr	Solid	Metal	0.02
985	1954 bldg.	51	XRF	2/10/97	1	Hall	2	Coat Rack		Solid	Wood	0
986	1954 bldg.	52	XRF	2/10/97	1	Hall	2	Boot Rack		Solid	Wood	0
987	1954 bldg.	141	XRF	2/10/97	0	Hall	3	Wall	Midle Wall	Solid	Tile	0.98
988	1954 bldg.	142	XRF	2/10/97	0	Hall	3	Door	Door	Solid	Wood	0.9
989	1954 bldg.	143	XRF	2/10/97	0	Hall	3	Door	Jamb	Solid	Metal	0.02
990	1954 bldg.	144	XRF	2/10/97	0	Hall	3	Door	Door	Solid	Wood	0
991	1954 bldg.	145	XRF	2/10/97	0	Hall	3	Door	Casing	Cracked	Metal	0.03
992	1954 bldg.	146	XRF	2/10/97	0	Hall	3		Radiator	Solid	Metal	0.14
993	1954 bldg.	147	XRF	2/10/97	0	Hall	3	Door	Door	Cracked	Wood	0.69
994	1954 bldg.	148	XRF	2/10/97	0	Hall	3	Door	Jamb	Cracked	Metal	0.11
995	1954 bldg.	149	XRF	2/10/97	0	Hall	3		Radiator	Cracked	Metal	0.28
996	1954 bldg.	150	XRF	2/10/97	0	Hall	3	Door	Door	Cracked	Wood	0
997	1954 bldg.	151	XRF	2/10/97	0	Hall	3	Door	Casing	Solid	Metal	0.12
998	1954 bldg.	152	XRF	2/10/97	0	Hall	3	Coat Rack		Solid	Wood	0
999	1954 bldg.	153	XRF	2/10/97	0	Hall	3	Ceiling		Cracked	Plaster	0.01
1000	1954 bldg.	154	XRF	2/10/97	0	Hall	3	Ceiling	Hatch	Solid	Metal	0
1001	1954 bldg.	10	XRF	2/10/97	0	Outside	0	Door	Door	Cracked	Wood	0.02
1002	1954 bldg.	29	XRF	2/10/97	0	Outside	0	Ext Wall	Trim	Peeling	Wood	0
1003	1954 bldg.	19	XRF	2/10/97	0	Outside	1	Door	Door	Solid	Wood	0
1004	1954 bldg.	20	XRF	2/10/97	0	Outside	1	Door	Door	Cracked	Wood	0.68
1005	1954 bldg.	21	XRF	2/10/97	0	Outside	1	Ext Wall		Solid	Concrte	0
1006	1954 bldg.	155	XRF	2/10/97	0	Room	1	Wall	Midle Wall	Solid	Concrte	0.03
1007	1954 bldg.	156	XRF	2/10/97	0	Room	1	Door	Door	Solid	Wood	0
1008	1954 bldg.	157	XRF	2/10/97	0	Room	1	Door	Casing	Solid	Metal	0.06
1009	1954 bldg.	158	XRF	2/10/97	0	Room	1		Radiator	Solid	Metal	0.02

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	No	Analysis	Date	Floor	Area	Room#	Compon	Feature	Condition	Substrate	PbL
1010	1954 bldg.	159	XRF	2/10/97	0	Room	1	Wall	Baseboar	Solid	Wood	0.01
1011	1954 bldg.	160	XRF	2/10/97	0	Room	1	Wall	Wall Rgstr	Solid	Metal	0.03
1012	1954 bldg.	161	XRF	2/10/97	0	Room	1	Ceiling		Cracked	Plaster	0.05
1013	1954 bldg.	162	XRF	2/10/97	0	Room	1	Ceiling	Hatch	Solid	Metal	0.03
1014	1954 bldg.	163	XRF	2/10/97	0	Room	2	Wall	Midle Wall	Solid	Concrete	0.1
1015	1954 bldg.	164	XRF	2/10/97	0	Room	2	Door	Door	Cracked	Wood	0
1016	1954 bldg.	165	XRF	2/10/97	0	Room	2	Door	Casing	Cracked	Metal	0.07
1017	1954 bldg.	166	XRF	2/10/97	0	Room	2	Stairs	Rail cap	Solid	Wood	0.01
1018	1954 bldg.	167	XRF	2/10/97	0	Room	2	Stairs	Hand rail	Solid	Wood	0.01
1019	1954 bldg.	168	XRF	2/10/97	0	Room	2	Stairs	Tread	Solid	Wood	0
1020	1954 bldg.	169	XRF	2/10/97	0	Room	2	Wall	Baseboar	Solid	Wood	0.03
1021	1954 bldg.	170	XRF	2/10/97	0	Room	2		Radiator	Solid	Metal	0.02
1022	1954 bldg.	171	XRF	2/10/97	0	Room	2	Ceiling		Solid	Concrete	0.05
1023	1954 bldg.	172	XRF	2/10/97	0	Stage	1	Wall	Midle Wall	Solid	Concrete	0.33
1024	1954 bldg.	173	XRF	2/10/97	0	Stage	1	Wall	Midle Wall	Solid	Concrete	0.06
1025	1954 bldg.	174	XRF	2/10/97	0	Stage	1	Wall	Baseboar	Solid	Wood	0.03
1026	1954 bldg.	175	XRF	2/10/97	0	Stage	1	Floor		Solid	Wood	0
1027	1954 bldg.	176	XRF	2/10/97	0	Stage	1	Door	Door	Solid	Wood	0.01
1028	1954 bldg.	177	XRF	2/10/97	0	Stage	1	Door	Casing	Solid	Metal	0.07
1029	1954 bldg.	178	XRF	2/10/97	0	Stage	1		Elec Pane	Solid	Metal	0.01
1030	1954 bldg.	179	XRF	2/10/97	0	Stage	1	Ceiling		Solid	Plaster	0.11
1031	1954 bldg.	180	XRF	2/10/97	0	Stage	1	Stairs	Tread	Solid	Wood	0.01
1032	1954 bldg.	235	XRF	2/9/97	2	Stairwell	1	Wall		Solid	Tile	1.34
1033	1954 bldg.	236	XRF	2/9/97	2	Stairwell	1		Radiator	Solid	Metal	0.19
1034	1954 bldg.	237	XRF	2/9/97	2	Stairwell	1	Stairs	Rail cap	Solid	Wood	0.01
1035	1954 bldg.	238	XRF	2/9/97	2	Stairwell	1	Stairs	Baluster	Solid	Metal	0.01
1036	1954 bldg.	239	XRF	2/9/97	2	Stairwell	1	Stairs	Riser	Solid	Metal	0.46
1037	1954 bldg.	240	XRF	2/9/97	2	Stairwell	1	Stairs	Baseboar	Cracked	Metal	0.47
1038	1954 bldg.	189	XRF	2/10/97	0	Stairwell	1	Door	Door	Solid	Wood	0
1039	1954 bldg.	190	XRF	2/10/97	0	Stairwell	1	Door	Jamb	Cracked	Metal	0.13
1040	1954 bldg.	191	XRF	2/10/97	0	Stairwell	1		Radiator	Solid	Metal	0.2
1041	1954 bldg.	18	XRF	2/10/97	0	Stairwell	2	Stairs	Hand rail	Cracked	Metal	0.04
1042	Outside	11	XRF	2/10/97	0	Outside	0	Door	Header	Peeling	Metal	0.04
1043	Outside	12	XRF	2/10/97	0	Outside	0	Wall	Wall Rgstr	Peeling	Metal	0.04
1044	Outside	13	XRF	2/10/97	0	Outside	1	Door	Jamb	Cracked	Metal	0.26
1045	Outside	14	XRF	2/10/97	0	Outside	1	Door	Jamb	Cracked		0.32
1046	Outside	15	XRF	2/10/97	0	Outside	1	Door	Fuel Oil Bl	Cracked	Metal	0.14
1047	Outside	16	XRF	2/10/97	0	Outside	1	Canopy	Column	Cracked	Metal	0.23
1048	Outside	17	XRF	2/10/97	0	Outside	1	Door	Door	Solid	Wood	0.94

**APPENDIX B**

**LABORATORY SAMPLE ANALYSIS DATA**

**LABORATORY ANALYSIS REPORT**

**DATE:** February 19, 1997      **PAGE:** 1 Of 2

**CLIENT:** Midwest Environmental Cons.  
5385 401st Ave. NW  
Dalbo, MN 55017      **PROJECT NO.:** 021297-200888  
**COLLECTION DATE:** 2/03/11/97  
**COLLECTED BY:** Client  
**RECEIVED DATE:** 2/12/97  
**PROJECT DESCRIPT.:** 62/0197 Ames Elementary

**CONTACT:** Greg Myers/Richard Cox

<b>SAMPLE #</b>	<b>DESCR.</b>	<b>MDL</b>	<b>LEAD</b> (6010A)	<b>ANALYSIS</b>	<b>DATE</b>
			<b>Units=mg/kg</b>		
L970747-1	B-1	26	6600		2/18/97
L970747-2	B-2	7.0	1300		2/18/97
L970747-3	B-3	13	3400		2/18/97
L970747-4	B-4	6.0	950		2/18/97
L970747-5	B-5	20	4400		2/18/97
L970747-6	B-6	20	910		2/18/97
L970747-7	B-7	12	2500		2/18/97
L970747-8	B-8	19	ND		2/18/97
L970747-9	B-9	700	43,000		2/18/97
L970747-10	B-10	12	160		2/18/97
L970747-11	B-11	13	14		2/18/97
L970747-12	B-12	7.1	1500		2/18/97
L970747-13	B-13	15	900		2/18/97
L970747-14	B-14	310	68,000		2/18/97
L970747-15	B-15	5.5	470		2/18/97
L970747-16	B-16	1600	170,000		2/18/97
L970747-17	B-17	11	130		2/18/97
L970747-18	B-18	71	5000		2/18/97
L970747-19	B-19	170	12,000		2/18/97
L970747-20	B-20	13	89		2/18/97
L970747-21	B-21	15	1600		2/18/97
L970747-22	B-22	160	13,500		2/18/97
L970747-23	B-23	6.6	940		2/18/97
L970747-24	B-24	110	40,000		2/18/97
L970747-25	B-25	5.6	620		2/18/97
L970747-26	B-26	11	720		2/18/97
L970747-27	B-27	12	1100		2/18/97
L970747-28	B-28	270	170		2/18/97

ND means Not Detected or below reported MDL

MDL means Method Detection Limit

mg/kg means Milligrams Per Kilogram which is equivalent to Parts Per Million (ppm)

As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.



A member of The Marmon Group of Companies

**LABORATORY ANALYSIS REPORT****DATE:** February 19, 1997**PAGE:**

2 Of 2

**CLIENT:** Midwest Environmental Cons.  
5385 401st Ave. NW  
Dalbo, MN 55017**PROJECT NO.:** 021297-200888  
**COLLECTION DATE:** 2/03-11/97  
**COLLECTED BY:** Client  
**RECEIVED DATE:** 2/12/97  
**PROJECT DESCRIPT.:** 62/0197 Ames Elementary**CONTACT:** Greg Myers/Richard Cox

<b>SAMPLE #</b>	<b>DESCP.</b>	<b>MDL</b>	<b>LEAD</b> (6010A)	<b>ANALYSIS</b>	<b>DATE</b>
			<b>RESULTS</b>		
L970747-29	B-29	32	9900		2/18/97
L970747-30	B-30	7.7	1300		2/18/97
L970747-31	B-31	9.3	14		2/18/97
L970747-32	B-32	72	24,000		2/18/97
L970747-33	B-33	12	1400		2/18/97
L970747-34	B-34	170	59,000		2/18/97
L970747-35	B-35	22	3200		2/18/97
L970747-36	B-36	13	77		2/18/97
L970747-37	B-37	7.9	1000		2/18/97

*ND means Not Detected or below reported MDL**MDL means Method Detection Limit**mg/kg means Milligrams Per Kilogram which is equivalent to Parts Per Million (ppm)*

This report has been reviewed by me for technical accuracy and completeness. The analyses were performed using EPA or other approved methodologies and the results were reported on an "as received" basis unless otherwise noted. Organic soil analyses were reported on a dry weight basis. The results reported relate only to the items tested. Please contact me if you have any questions or comments regarding this report. Spectrum Labs, Inc. appreciates the opportunity to provide this analytical service for you.

Report Submitted By,

Thomas L. Halverson  
Laboratory ManagerTLH:wmc  
mec050-1*As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.*

A member of The Marion Group of Companies

**Midwest Environmental Consulting, L.L.C.**

5385 401st Ave. NW, Dalbo, MN 55017

612-689-3612/612-757-5541/FAX-612-689-5209

Client Address \_\_\_\_\_

Contact Greg Myers/Richard Cox



**CHAIN OF CUSTODY RECORD**

Project Number 62/6197C

Client S.A.W.T. Paul T.S.D.

Project Ames Elementary

Phone/Fax \_\_\_\_\_

Sample ID	Sample Description	Collection Date/Time	Matrix (Vol/Area)	Analysis Requested
62/6197C-B-1	Qtr 216 cabinet inside kitchen wall	2/3/97 5:40 p	1" sq	Pb 747-1
62/H 97C-B-2	Beige 2x20 (PVC) coat closet plaster	2/3/97 5:45 p	1" sq	Pb 2
62/H 97C-B-3	Ames coat closet plaster	2/3/97 5:50 p	2" sq	Pb 3
62/H 97C-B-4	Qtr 2x8 side A big cabinet white	2/3/97 7:40 p	1" sq	Pb 4
62/H 01 97C-B-5	West Second floor bowed beam	2/3/97 8:40 p	1" sq	Pb 5
62/H 01 97C-B-6	Blue metal radiator collector inside A Bay III	2/4/97 4:50 p	2" sq	Pb 6
62/H 01 97C-B-7	Bm #1 Side D white plastic in cabinet	2/4/97 11:55 p	2" sq	Pb 7
62/H 01 97C-B-8	Bm #1 white wood radiator collector side A	2/4/97 5:00 p	2" sq	Pb 8
62/H 01 97C-B-9	brown balsa wood upper kitchen wall side A	2/4/97 5:03 p	2" sq	Pb 9
62/H 01 97C-B-10	Am dog upper kitchen wall side A	2/4/97 5:25 p	2" sq	Pb 10
62/H 01 97C-B-11	brown balsa wood side C	2/4/97 6:00 p	2" sq	Pb 11
62/H 01 97C-B-12	Balsa side C white with wall	2/4/97 6:45 p	2" sq	Pb 12
62/H 01 97C-B-13	brown side C upper wall plaster	2/4/97 8:00 p	2" sq	Pb 13
62/H 01 97C-B-14	brown office side B lower wall plaster white	2/10/97 8:10 p	2" sq	Pb 14

Sampled By: Greg Myers Date: 2/11/97 Time: \_\_\_\_\_ Delivered By: Greg Myers Date: 2/12/97 Time: 12:57 p

Received By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_ Delivered By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_

Received By Lab: Christie Radl Date: 2/12/97 Time: \_\_\_\_\_ Disposition of Samples \_\_\_\_\_

Notes: Report in parts permill. by

**Midwest Environmental Consulting, L.L.C.**  
 5385 401st Ave. NW, Dalbo, MN 55017  
 612-689-3612/612-757-5541/FAX-612-689-5209



**CHAIN OF CUSTODY RECORD**

Project Number	62/0/97C
Client	St. Paul ISD
Project	Anes Elementar
Phone/Fax	

Client Address Greg Myers / Richard Cox

Sample ID	Sample Description	Collection Date/Time	Matrix (Vol/Area)	Analysis Requested
62/0/97C-B-15	middle w/11 light blue plaster	2/10/97 8:55P	2" sq	Pb 747 - 15
62/0/97C-B-16	metal register dark gray side D	2/10/97 8:50P	1" sq	Pb
62/0/97C-B-17	green column back side B	3/11/97 4:05P	1sq "	Pb
62/0/97C-B-18	Stairwell ceiling Brown plaster pink	2/11/97 4:10P	2sq "	Pb
62/0/97C-B-19	Rm 203 Side 2 ceiling inside	2/11/97 4:45P	2sq	Pb
62/0/97C-B-20	Rm 207 ceiling white plaster	2/11/97 4:50P	2sq	Pb
62/0/97C-B-21	Side 1A shelf/silves	2/11/97 5:15P	2sq	Pb
62/0/97C-B-22	ceiling off-white wood	2/11/97 5:25P	2sq	Pb
62/0/97C-B-23	Rm 206 Side A ceiling wood	2/11/97 5:41P	2sq	Pb
C-B-24	Rm 206 Side A register metal	2/11/97 5:40P	2sq	Pb
C-B-25	Rm 206 middle wall white	2/11/97 5:50P	2sq	Pb
C-B-26	wire in permanent plaster floor side 1	2/11/97 5:55P	2sq	Pb
C-B-27	Hallway ceiling plaster metal	2/11/97 5:59P	2sq	Pb
C-B-28	ceiling wire frame	2/11/97 6:20P	2sq	Pb

Sampled By: Greg A. Myers Date: 2/10/97 Time: \_\_\_\_\_ Delivered By: Greg A. Myers Date: 2/12/97 Time: 12:57P  
 Received By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_ Delivered By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_

Received By Lab: Oklahoma Date: 2-12-97 Time: \_\_\_\_\_ Disposition of Samples \_\_\_\_\_

Notes: Report in parts per million



*Midwest Environmental Consulting, L.L.C.*

55385 401st Ave. NW, Dalbo, MN 55017  
612-689-3612/612-757-5541/FAX-612-689-5209

### Client Address

*Midwest Environmental Consulting, L.L.C.*

55385 401st Ave. NW, Dalbo, MN 55017  
612-689-3612/612-757-5541/FAX-612-689-5209

### Client Address

## **CHAIN OF CUSTODY RECORD**

Project Number 62/0197 C  
Client Saint Paul

卷之三

Project Ames Elementary

Sampled By: Greg A. Myers Date: 2/11/97 Time: 4:15 - 8:30

Received By: \_\_\_\_\_

卷之三

## Disposition of Samples

Notes: 10

Report in parts per million. ppm

## **APPENDIX C INSPECTORS**

**Greg A. Myers  
MDH Lead Inspector # 116**

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

Ames Elementary School

Site	No	Any	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	PbL
1916 bldg.	6	XRF	2/3/97	2	Classroom	212	Door	Jamb	Solid	Wood	0.06
1916 bldg.	7	XRF	2/3/97	2	Classroom	212	Door	Door	Solid	Wood	0.04
1916 bldg.	8	XRF	2/3/97	2	Classroom	212	Wall	Wall	Solid	Plaster	0.09
1916 bldg.	9	XRF	2/3/97	2	Classroom	212	Wall	Wall	Solid	Tile	3.69
1916 bldg.	10	XRF	2/3/97	2	Classroom	212	Window	Casing	Solid	Wood	0.03
1916 bldg.	11	XRF	2/3/97	2	Classroom	212	Wall	Wall	Solid	Plaster	2.97
1916 bldg.	12	XRF	2/3/97	2	Classroom	212	Door	Jamb	Solid	Plaster	5.09
1916 bldg.	13	XRF	2/3/97	2	Classroom	212	Floor	Wall	Solid	Wood	0
1916 bldg.	14	XRF	2/3/97	2	Classroom	212		Radiator	Peeling	Metal	5.09
1916 bldg.	15	XRF	2/3/97	2	Classroom	212	Bookcase	Inside	Cracked	Wood	0
1916 bldg.	16	XRF	2/3/97	2	Classroom	212	Cabinet	Door	Solid	Wood	0.05
1916 bldg.	17	XRF	2/3/97	2	Classroom	212	Cabinet	Inside	Cracked	Plaster	0.09
1916 bldg.	18	XRF	2/3/97	2	Classroom	212	Cabinet	Shelf	Cracked	Wood	0.01
1916 bldg.	19	XRF	2/3/97	2	Classroom	212	Chalkbrd	Chalkbrd	Cracked	Wood	0.03
1916 bldg.	20	XRF	2/3/97	2	Classroom	212	Wire tray	Wire tray	Solid	Metal	0
1916 bldg.	21	XRF	2/3/97	2	Classroom	212	Wall	Crown mold	Solid	Wood	0.06
1916 bldg.	22	XRF	2/3/97	2	Classroom	212	Wall	Wall	Solid	Plaster	0.13
1916 bldg.	23	XRF	2/3/97	2	Room	1	Wall	Wall	Cracked	Tile	4.02
1916 bldg.	24	XRF	2/3/97	2	Room	1	Wall	Wall	Cracked	Tile	3.57
1916 bldg.	25	XRF	2/3/97	2	Room	1	Wall	Wall	Cracked	Plaster	0.12
1916 bldg.	26	XRF	2/3/97	2	Room	1	Door	Door	Solid	Wood	0.03
1916 bldg.	27	XRF	2/3/97	2	Room	1		Radiator	Cracked	Metal	5.09
1916 bldg.	28	XRF	2/3/97	2	Room	1	Coat rack	Coat rack	Cracked	Wood	0.03
1916 bldg.	29	XRF	2/3/97	2	Room	1	Wall	Wall Rgstr	Cracked	Metal	0.12
1916 bldg.	30	XRF	2/3/97	2	Room	1	Closet	Wall	Solid	Plaster	5.09
1916 bldg.	31	XRF	2/3/97	2	Room	1	Closet	Shelf	Solid	Wood	0
1916 bldg.	32	XRF	2/3/97	2	Room	1	Ceiling		Solid	Plaster	0.05
1916 bldg.	33	XRF	2/3/97	2	Classroom	210	Wall	Wall	Solid	Tile	5.09
1916 bldg.	34	XRF	2/3/97	2	Classroom	210	Wall	Wall	Cracked	Plaster	0.06
1916 bldg.	35	XRF	2/3/97	2	Classroom	210	Wall	Midle Wall	Solid	Tile	0.05
1916 bldg.	36	XRF	2/3/97	2	Classroom	210	Wall	Wall	Cracked	Plaster	0.14
1916 bldg.	37	XRF	2/3/97	2	Classroom	210	Door	Door	Solid	Wood	0.06
1916 bldg.	38	XRF	2/3/97	2	Classroom	210	Door	Jamb	Solid	Wood	0.03
1916 bldg.	39	XRF	2/3/97	2	Classroom	210	Window	Sash	Solid	Wood	0.02
1916 bldg.	40	XRF	2/3/97	2	Classroom	210	Bookcase	Shelf	Cracked	Wood	0
1916 bldg.	41	XRF	2/3/97	2	Classroom	210		Radiator	Peeling	Metal	0.33
1916 bldg.	42	XRF	2/3/97	2	Classroom	210	Floor		Cracked	Wood	0.01
1916 bldg.	43	XRF	2/3/97	2	Classroom	210	Bulletin B	Chalkbrd	Cracked	Wood	0.05
1916 bldg.	44	XRF	2/3/97	2	Classroom	210	Cabinet	Door	Solid	Wood	0.04
1916 bldg.	45	XRF	2/3/97	2	Classroom	210	Cabinet	Inside	Solid	Wood	0.19
1916 bldg.	46	XRF	2/3/97	2	Classroom	210	Cabinet	Shelf	Solid	Wood	0.19
1916 bldg.	47	XRF	2/3/97	2	Classroom	210	Wall	Wall Rgstr	Cracked	Metal	0.09
1916 bldg.	48	XRF	2/3/97	2	Classroom	210	Wall	Crown mold	Peeling	Wood	0.07
1916 bldg.	49	XRF	2/3/97	2	Classroom	210	Ceiling		Solid	Plaster	0.1
1916 bldg.	50	XRF	2/3/97	2	Room	2	Ceiling		Solid	Plaster	0.14
1916 bldg.	51	XRF	2/3/97	2	Room	2	Wall	Wall	Solid	Tile	3.87
1916 bldg.	52	XRF	2/3/97	2	Room	2	Wall	Wall	Cracked	Tile	5.09
1916 bldg.	53	XRF	2/3/97	2	Room	2	Wall	Wall	Cracked	Plaster	0.15
1916 bldg.	54	XRF	2/3/97	2	Room	2	Door	Door	Solid	Wood	0.06
1916 bldg.	55	XRF	2/3/97	2	Room	2		Radiator	Cracked	Metal	5.09
1916 bldg.	56	XRF	2/3/97	2	Room	2	Wall	Chair rail	Solid	Wood	0.07
1916 bldg.	57	XRF	2/3/97	2	Room	2	Coat rack	Coat rack	Solid	Wood	0.04
1916 bldg.	58	XRF	2/3/97	2	Room	2	Closet	Wall	Solid	Plaster	0.17
1916 bldg.	59	XRF	2/3/97	2	Room	2	Closet	Shelf	Solid	Wood	0
1916 bldg.	60	XRF	2/3/97	2	Room	2	Wall	Wall Rgstr	Solid	Metal	0.17
1916 bldg.	62	XRF	2/3/97	2	Classroom	211	Wall	Wall	Cracked	Plaster	0.12
1916 bldg.	63	XRF	2/3/97	2	Classroom	211	Wall	Wall	Cracked	Plaster	5.09
1916 bldg.	64	XRF	2/3/97	2	Classroom	211	Wall	Muriel	Cracked	Plaster	0.07
1916 bldg.	65	XRF	2/3/97	2	Classroom	211	Door	Door	Solid	Wood	0.03
1916 bldg.	66	XRF	2/3/97	2	Classroom	211	Door	Jamb	Solid	Wood	0.03
1916 bldg.	67	XRF	2/3/97	2	Classroom	211	Window	Casing	Solid	Wood	0.07
1916 bldg.	68	XRF	2/3/97	2	Classroom	211	Cabinet	Door	Solid	Wood	0.02
1916 bldg.	69	XRF	2/3/97	2	Classroom	211	Cabinet	Inside	Solid	Wood	0.06
1916 bldg.	70	XRF	2/3/97	2	Classroom	211		Radiator	Cracked	Metal	2.96
1916 bldg.	71	XRF	2/3/97	2	Classroom	211	Bulletin B	Chalkbrd	Solid	Metal	0.03

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1916 bldg.	72	XRF	2/3/97	2	Classroom	211	Wall	Wall Rgstr	Solid	Metal	0.62
1916 bldg.	73	XRF	2/3/97	2	Classroom	211	Wall	Wall	Solid	Plaster	0.04
1916 bldg.	74	XRF	2/3/97	2	Classroom	211	Ceiling		Cracked	Plaster	0.08
1916 bldg.	75	XRF	2/3/97	2	Classroom	211	Hatch	Ceiling	Solid	Wood	0
1916 bldg.	76	XRF	2/3/97	2	Classroom	209	Ceiling		Cracked	Plaster	0.05
1916 bldg.	77	XRF	2/3/97	2	Room	3	Ceiling		Cracked	Plaster	0.12
1916 bldg.	78	XRF	2/3/97	2	Classroom	209	Wall	Wall	Solid	Tile	4.46
1916 bldg.	79	XRF	2/3/97	2	Classroom	209	Wall	Wall	Cracked	Plaster	0.06
1916 bldg.	80	XRF	2/3/97	2	Classroom	209	Wall	Midle Wall	Solid	Tile	5.09
1916 bldg.	81	XRF	2/3/97	2	Classroom	209	Wall	Wall	Cracked	Plaster	2.16
1916 bldg.	82	XRF	2/3/97	2	Classroom	209	Door	Door	Solid	Wood	0.06
1916 bldg.	83	XRF	2/3/97	2	Classroom	209	Door	Jamb	Solid	Wood	0.04
1916 bldg.	84	XRF	2/3/97	2	Classroom	209		Radiator	Peeling	Metal	5.09
1916 bldg.	85	XRF	2/3/97	2	Classroom	209	Floor		Solid	Wood	0
1916 bldg.	86	XRF	2/3/97	2	Classroom	209	Bookcase	Shelf	Cracked	Wood	0.02
1916 bldg.	87	XRF	2/3/97	2	Classroom	209	Cabinet	Door	Solid	Wood	0.04
1916 bldg.	88	XRF	2/3/97	2	Classroom	209	Cabinet	Inside	Solid	Plaster	0.06
1916 bldg.	89	XRF	2/3/97	2	Classroom	209	Cabinet	Shelf	Solid	Wood	0.09
1916 bldg.	90	XRF	2/3/97	2	Classroom	209	Bulletin B	Chalkbrd	Cracked	Wood	0.04
1916 bldg.	91	XRF	2/3/97	2	Classroom	209	Window	Casing	Solid	Wood	0.02
1916 bldg.	92	XRF	2/3/97	2	Classroom	209	Upper Wall	Crown mold	Solid	Wood	0.11
1916 bldg.	93	XRF	2/3/97	2	Classroom	209	Wall	Wall Rgstr	Solid	Metal	5.09
1916 bldg.	94	XRF	2/3/97	2	Room	3	Wall	Wall	Cracked	Tile	5.09
1916 bldg.	95	XRF	2/3/97	2	Room	3	Wall	Wall	Cracked	Tile	5.09
1916 bldg.	96	XRF	2/3/97	2	Room	3		Radiator	Cracked	Metal	5.09
1916 bldg.	97	XRF	2/3/97	2	Room	3	Wall	Chair rail	Solid	Wood	0.11
1916 bldg.	98	XRF	2/3/97	2	Room	3	Wall	Wall	Cracked	Plaster	0.12
1916 bldg.	99	XRF	2/3/97	2	Room	3	Door	Door	Solid	Wood	0.02
1916 bldg.	100	XRF	2/3/97	2	Room	3		Coat rack	Solid	Wood	0.06
1916 bldg.	101	XRF	2/3/97	2	Room	3	Closet	Wall	Solid	Plaster	5.09
1916 bldg.	103	XRF	2/3/97	2	Classroom	208	Wall	Wall	Cracked	Tile	4.31
1916 bldg.	104	XRF	2/3/97	2	Classroom	208	Wall	Wall	Cracked	Plaster	0.15
1916 bldg.	105	XRF	2/3/97	2	Classroom	208	Wall	Midle Wall	Solid	Tile	5.09
1916 bldg.	106	XRF	2/3/97	2	Classroom	208	Wall	Wall	Cracked	Plaster	5.09
1916 bldg.	107	XRF	2/3/97	2	Classroom	208	Bookcase	Shelf	Cracked	Wood	0.07
1916 bldg.	108	XRF	2/3/97	2	Classroom	208	Door	Door	Solid	Wood	0.05
1916 bldg.	109	XRF	2/3/97	2	Classroom	208	Door	Casing	Solid	Wood	0.02
1916 bldg.	110	XRF	2/3/97	2	Classroom	208	Window	Casing	Solid	Wood	0.04
1916 bldg.	111	XRF	2/3/97	2	Classroom	208	Wall	Crown mold	Solid	Wood	0.04
1916 bldg.	112	XRF	2/3/97	2	Classroom	208	Wall	Wall Rgstr	Solid	Metal	5.09
1916 bldg.	114	XRF	2/3/97	2	Classroom	208	Wall	Wall Rgstr	Solid	Metal	5.09
1916 bldg.	115	XRF	2/3/97	2	Classroom	208	Wall	Wall Rgstr	Solid	Metal	5.09
1916 bldg.	116	XRF	2/3/97	2	Classroom	208	Cabinet	Door	Solid	Wood	0.06
1916 bldg.	117	XRF	2/3/97	2	Classroom	208	Cabinet	Inside	Solid	Wood	0.03
1916 bldg.	118	XRF	2/3/97	2	Classroom	208	Bookcase	Shelf	Solid	Wood	0.01
1916 bldg.	119	XRF	2/3/97	2	Classroom	208	Chalkbrd	Bulletin B	Solid	Wood	0.08
1916 bldg.	120	XRF	2/3/97	2	Room	4	Wall	Wall	Solid	Tile	5.09
1916 bldg.	121	XRF	2/3/97	2	Room	4	Wall	Wall	Solid	Tile	4.46
1916 bldg.	122	XRF	2/3/97	2	Room	4	Wall	Wall	Cracked	Plaster	0.05
1916 bldg.	123	XRF	2/3/97	2	Room	4	Door	Door	Solid	Wood	0.04
1916 bldg.	124	XRF	2/3/97	2	Room	4	Wall	Chair rail	Solid	Wood	0.06
1916 bldg.	125	XRF	2/3/97	2	Room	4		Coat rack	Solid	Wood	0.09
1916 bldg.	126	XRF	2/3/97	2	Room	4		Wire tray	Solid	Metal	0.07
1916 bldg.	127	XRF	2/3/97	2	Room	4		Radiator	Cracked	Metal	4.1
1916 bldg.	128	XRF	2/3/97	2	Room	4	Closet	Wall	Cracked	Plaster	0.1
1916 bldg.	129	XRF	2/3/97	2	Room	4	Floor		Solid	Wood	0.02
1916 bldg.	130	XRF	2/3/97	2	Room	4	Ceiling		Solid	Plaster	0.03
1916 bldg.	131	XRF	2/3/97	2	Hall	1	Ceiling		Solid	Plaster	0.11
1916 bldg.	132	XRF	2/3/97	2	Hall	1	Wall	Midle Wall	Solid	Plaster	0.11
1916 bldg.	133	XRF	2/3/97	2	Hall	1	Wall	Wall	Solid	Plaster	0.09
1916 bldg.	134	XRF	2/3/97	2	Hall	1		Elec Panel	Solid	Metal	0.07
1916 bldg.	135	XRF	2/3/97	2	Hall	1		Radiator	Solid	Metal	3.75
1916 bldg.	136	XRF	2/3/97	2	Stairwell	1	Door	Door	Solid	Metal	5.09
1916 bldg.	137	XRF	2/3/97	2	Stairwell	1	Door	Jamb	Solid	Metal	5.09
1916 bldg.	138	XRF	2/3/97	2	Stairwell	1	Stairs	Wall	Solid	Tile	5.09
1916 bldg.	139	XRF	2/3/97	2	Stairwell	1	Stairs	Wall	Solid	Tile	5.09
1916 bldg.	140	XRF	2/3/97	2	Stairwell	1	Stairs	Baseboard	Cracked	Concrete	0.29
1916 bldg.	141	XRF	2/3/97	2	Stairwell	1	Stairs	Rail cap	Cracked	Concrete	0.31

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1916 bldg.	142	XRF	2/3/97	2	Stairwell	1	Bulletin B		Cracked	Wood	0.04
1916 bldg.	143	XRF	2/3/97	2	Stairwell	1	Wall	Wall	Peeling	Plaster	0.15
1916 bldg.	144	XRF	2/3/97	2	Stairwell	1	Wall	Radiator	Peeling	Metal	5.09
1916 bldg.	145	XRF	2/3/97	2	Stairwell	1	Stairs	Hand rail	Cracked	Wood	0.01
1916 bldg.	146	XRF	2/3/97	2	Stairwell	1	Wall	Chair rail	Solid	Wood	0.03
1916 bldg.	147	XRF	2/3/97	2	Stairwell	2	Wall	Wall	Solid	Tile	3.37
1916 bldg.	148	XRF	2/3/97	2	Stairwell	2	Wall	Wall	Cracked	Tile	3.28
1916 bldg.	149	XRF	2/3/97	2	Stairwell	2	Door	Door	Cracked	Metal	5.09
1916 bldg.	150	XRF	2/3/97	2	Stairwell	2	Wall	Chair rail	Solid	Wood	0.05
1916 bldg.	151	XRF	2/3/97	2	Stairwell	2	Wall	Wall	Cracked	Plaster	0.14
1916 bldg.	152	XRF	2/3/97	2	Stairwell	2		Bulletin Board	Solid	Wood	0.04
1916 bldg.	153	XRF	2/3/97	2	Stairwell	2	Stairs	Rail cap	Cracked	Concrete	0.27
1916 bldg.	154	XRF	2/3/97	2	Stairwell	2	Stairs	Baseboard	Cracked	Concrete	0.18
1916 bldg.	155	XRF	2/3/97	2	Stairwell	2	Stairs	Hand rail	Cracked	Wood	0.05
1916 bldg.	156	XRF	2/3/97	2	Stairwell	2		Radiator	Cracked	Metal	4.21
1916 bldg.	157	XRF	2/3/97	2	Stairwell	2	Wall	Wall	Solid	Tile	5.09
1916 bldg.	168	XRF	2/4/97	1	Classroom	111	Wall	Wall	Solid	Tile	2.46
1916 bldg.	169	XRF	2/4/97	1	Classroom	111	Wall	Wall	Cracked	Plaster	0.08
1916 bldg.	170	XRF	2/4/97	1	Classroom	111	Wall	Wall	Cracked	Plaster	0.19
1916 bldg.	171	XRF	2/4/97	1	Classroom	111	Upper Wall	Crown mold	Solid	Wood	0.15
1916 bldg.	172	XRF	2/4/97	1	Classroom	111	Wall	Wall	Cracked	Plaster	0.25
1916 bldg.	173	XRF	2/4/97	1	Classroom	111	Door	Door	Solid	Wood	0.03
1916 bldg.	174	XRF	2/4/97	1	Classroom	111	Door	Jamb	Solid	Wood	0.01
1916 bldg.	175	XRF	2/4/97	1	Classroom	111	Window	Casing	Solid	Wood	0.02
1916 bldg.	176	XRF	2/4/97	1	Classroom	111	Wall	Chair rail	Solid	Wood	0.11
1916 bldg.	177	XRF	2/4/97	1	Classroom	111	Bookcase	Shelf	Cracked	Wood	0
1916 bldg.	178	XRF	2/4/97	1	Classroom	111	Cabinet	Door	Solid	Wood	0.04
1916 bldg.	179	XRF	2/4/97	1	Classroom	111	Cabinet	Inside	Solid	Plaster	0.21
1916 bldg.	180	XRF	2/4/97	1	Classroom	111	Cabinet	Shelf	Cracked	Wood	0.07
1916 bldg.	181	XRF	2/4/97	1	Classroom	111	Bulletin B	Chalkbrd	Solid	Wood	0.04
1916 bldg.	182	XRF	2/4/97	1	Classroom	111	Bulletin B	Chalkbrd	Solid	Metal	0.03
1916 bldg.	183	XRF	2/4/97	1	Classroom	111	Cabinet	Door	Cracked	Wood	0.02
1916 bldg.	184	XRF	2/4/97	1	Classroom	111	Cabinet	Shelf	Cracked	Wood	0.08
1916 bldg.	185	XRF	2/4/97	1	Classroom	111	Floor		Solid	Wood	0.01
1916 bldg.	186	XRF	2/4/97	1	Classroom	111	Wall	Wall Rgstr	Solid	Metal	5.09
1916 bldg.	187	XRF	2/4/97	1	Classroom	111	Closet	Wall	Solid	Plaster	5.09
1916 bldg.	188	XRF	2/4/97	1	Classroom	111	Closet	Shelf	Solid	Wood	0
1916 bldg.	189	XRF	2/4/97	1	Classroom	111	Door	Door	Solid	Wood	0.05
1916 bldg.	190	XRF	2/4/97	1	Classroom	111	Radiator	Protector	Solid	Metal	0.5
1916 bldg.	191	XRF	2/4/97	1	Classroom	111		Radiator	Cracked	Metal	3.46
1916 bldg.	192	XRF	2/4/97	1	Classroom	111	Radiator	Protector	Cracked	Metal	0.38
1916 bldg.	193	XRF	2/4/97	1	Classroom	111	Radiator	Protector	Cracked	Metal	0.28
1916 bldg.	194	XRF	2/4/97	1	Room	5	Wall	Wall	Cracked	Plaster	5.09
1916 bldg.	195	XRF	2/4/97	1	Room	5	Wall	Wall	Cracked	Plaster	0.29
1916 bldg.	196	XRF	2/4/97	1	Room	5	Door	Door	Solid	Wood	0.03
1916 bldg.	197	XRF	2/4/97	1	Room	5	Coat rack		Solid	Wood	0.01
1916 bldg.	198	XRF	2/4/97	1	Room	5	Cabinet	Outside	Solid	Wood	0.01
1916 bldg.	199	XRF	2/4/97	1	Room	5	Cabinet	Shelf	Cracked	Wood	0.03
1916 bldg.	200	XRF	2/4/97	1	Room	5	Door	Casing	Solid	Wood	0.02
1916 bldg.	201	XRF	2/4/97	1	Room	5	Ceiling		Cracked	Plaster	0.1
1916 bldg.	202	XRF	2/4/97	1	Room	5	Upper Wall	Crown mold	Solid	Wood	0.05
1916 bldg.	203	XRF	2/4/97	1	Restroom	1	Wall	Wall	Peeling	Plaster	0.04
1916 bldg.	204	XRF	2/4/97	1	Restroom	1	Wall	Wall	Cracked	Plaster	0.2
1916 bldg.	205	XRF	2/4/97	1	Restroom	1	Door	Door	Solid	Wood	0.03
1916 bldg.	206	XRF	2/4/97	1	Restroom	1	Radiator	Protector	Solid	Wood	0.01
1916 bldg.	207	XRF	2/4/97	1	Restroom	1		Radiator	Solid	Metal	0.11
1916 bldg.	208	XRF	2/4/97	1	Restroom	1	Wall	Wall Rgstr	Solid	Metal	0.01
1916 bldg.	209	XRF	2/4/97	1	Classroom	110	Wall	Wall	Cracked	Tile	5.09
1916 bldg.	210	XRF	2/4/97	1	Classroom	110	Wall	Midle Wall	Cracked	Plaster	0.2
1916 bldg.	211	XRF	2/4/97	1	Classroom	110	Wall	Wall	Cracked	Plaster	5.09
1916 bldg.	212	XRF	2/4/97	1	Classroom	110	Door	Door	Solid	Wood	0.04
1916 bldg.	213	XRF	2/4/97	1	Classroom	110	Door	Jamb	Solid		0.05
1916 bldg.	214	XRF	2/4/97	1	Classroom	110	Window	Casing	Solid	Wood	0.03
1916 bldg.	215	XRF	2/4/97	1	Classroom	110	Drywall	Crown mold	Solid	Wood	0.05
1916 bldg.	216	XRF	2/4/97	1	Classroom	110	Bulletin Board	Chalkbrd	Solid	Wood	0
1916 bldg.	217	XRF	2/4/97	1	Classroom	110	Floor		Cracked	Wood	0.01
1916 bldg.	218	XRF	2/4/97	1	Classroom	110		Radiator	Cracked	Metal	5.09
1916 bldg.	219	XRF	2/4/97	1	Classroom	110	Radiator	Protector	Cracked	Wood	0.04

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1916 bldg.	220	XRF	2/4/97	1	Classroom	110	Bookcase	Shelf	Solid	Wood	0
1916 bldg.	221	XRF	2/4/97	1	Classroom	110	Cabinet	Door	Solid	Wood	0.03
1916 bldg.	222	XRF	2/4/97	1	Classroom	110	Cabinet	Door	Solid		0.03
1916 bldg.	223	XRF	2/4/97	1	Classroom	110	Wall	Wall Rgstr	Solid	Metal	5.09
1916 bldg.	224	XRF	2/4/97	1	Classroom	110	Ceiling		Solid	Plaster	0.06
1916 bldg.	226	XRF	2/4/97	1	Room	6	Ceiling		Solid	Plaster	0.2
1916 bldg.	227	XRF	2/4/97	1	Room	6	Wall	Cracked	Tile		4.49
1916 bldg.	228	XRF	2/4/97	1	Room	6	Wall	Cracked	Plaster		0.17
1916 bldg.	229	XRF	2/4/97	1	Room	6	Wall	Cracked	Tile		5.09
1916 bldg.	230	XRF	2/4/97	1	Room	6	Door	Door	Solid	Wood	0.03
1916 bldg.	231	XRF	2/4/97	1	Room	6	Wall	Chair rail	Solid	Wood	0.03
1916 bldg.	232	XRF	2/4/97	1	Room	6	Wall	Wall Rgstr	Solid	Metal	0.03
1916 bldg.	233	XRF	2/4/97	1	Room	6		Radiator	Cracked	Metal	0.13
1916 bldg.	234	XRF	2/4/97	1	Room	6	Closet	Wall	Solid	Plaster	0.08
1916 bldg.	235	XRF	2/4/97	1	Room	6	Closet	Shelf	Solid	Wood	0
1916 bldg.	236	XRF	2/4/97	1	Room	6	Closet	Shelf	Solid	Wood	0.01
1916 bldg.	237	XRF	2/4/97	1	Room	6	Closet	Shelf	Solid	Wood	0
1916 bldg.	238	XRF	2/4/97	1	Room	6	Coat rack		Cracked	Wood	0.05
1916 bldg.	239	XRF	2/4/97	1	Room	6	Coat rack		Cracked	Metal	5.09
1916 bldg.	240	XRF	2/4/97	1	Classroom	109	Wall	Wall	Cracked	Tile	0.15
1916 bldg.	241	XRF	2/4/97	1	Classroom	109	Wall	Midle Wall	Solid	Plaster	0.24
1916 bldg.	242	XRF	2/4/97	1	Classroom	109	Wall	Wall	Solid	Plaster	0.29
1916 bldg.	243	XRF	2/4/97	1	Classroom	109	Wall	Midle Wall	Cracked	Plaster	0.27
1916 bldg.	244	XRF	2/4/97	1	Classroom	109	Upper Wall	Crown mold	Solid	Wood	0.18
1916 bldg.	245	XRF	2/4/97	1	Classroom	109	Door	Door	Solid	Wood	0.03
1916 bldg.	246	XRF	2/4/97	1	Classroom	109	Door	Jamb	Solid	Wood	0.02
1916 bldg.	247	XRF	2/4/97	1	Classroom	109	Window	Casing	Solid	Wood	0.02
1916 bldg.	248	XRF	2/4/97	1	Classroom	109	Bulletin B	Chalkbrd	Solid	Wood	0.05
1916 bldg.	249	XRF	2/4/97	1	Classroom	109	Cabinet	Door	Cracked	Wood	0.02
1916 bldg.	250	XRF	2/4/97	1	Classroom	109	Cabinet	Shelf	Solid	Wood	0.71
1916 bldg.	251	XRF	2/4/97	1	Classroom	109	Bulletin	Board	Solid	Metal	0.03
1916 bldg.	252	XRF	2/4/97	1	Classroom	109	Wall	Chair rail	Solid	Wood	0.03
1916 bldg.	253	XRF	2/4/97	1	Classroom	109	Bookcase	Shelf	Solid	Wood	1.56
1916 bldg.	254	XRF	2/4/97	1	Classroom	109		Radiator	Cracked	Metal	5.09
1916 bldg.	255	XRF	2/4/97	1	Classroom	109	Radiator	Protector	Cracked	Metal	0.28
1916 bldg.	256	XRF	2/4/97	1	Classroom	109	Radiator	Protector	Cracked	Metal	0.43
1916 bldg.	257	XRF	2/4/97	1	Classroom	109	Radiator	Protector	Cracked	Metal	0.29
1916 bldg.	258	XRF	2/4/97	1	Classroom	109	Cabinet	Door	Cracked	Wood	0.01
1916 bldg.	259	XRF	2/4/97	1	Classroom	109	Cabinet	Inside	Solid	Plaster	0.63
1916 bldg.	260	XRF	2/4/97	1	Classroom	109	Cabinet	Inside	Solid	Wood	0.85
1916 bldg.	261	XRF	2/4/97	1	Classroom	109	Cabinet	Shelf	Solid	Wood	0.28
1916 bldg.	262	XRF	2/4/97	1	Classroom	109	Wall	Wall Rgstr	Solid	Metal	5.09
1916 bldg.	263	XRF	2/4/97	1	Classroom	109	Floor		Solid	Wood	0.01
1916 bldg.	264	XRF	2/4/97	1	Classroom	109	Closet	Wall	Cracked	Plaster	5.09
1916 bldg.	265	XRF	2/4/97	1	Classroom	109	Closest	Shelf	Solid	Wood	0
1916 bldg.	266	XRF	2/4/97	1	Room	7	Wall	Wall	Cracked	Plaster	0.15
1916 bldg.	267	XRF	2/4/97	1	Room	7	Wall	Wall	Cracked	Plaster	0.27
1916 bldg.	268	XRF	2/4/97	1	Room	7	Door	Door	Solid	Wood	0.03
1916 bldg.	269	XRF	2/4/97	1	Room	7	Bookcase	Shelf	Solid	Wood	0.04
1916 bldg.	270	XRF	2/4/97	1	Room	7	Coat rack		Solid	Wood	0.05
1916 bldg.	271	XRF	2/4/97	1	Room	7	Door	Casing	Solid	Wood	0.01
1916 bldg.	272	XRF	2/4/97	1	Room	7	Upper Wall	Crown mold	Solid	Wood	0.13
1916 bldg.	273	XRF	2/4/97	1	Room	7	Ceiling		Cracked	Plaster	0.27
1916 bldg.	274	XRF	2/4/97	1	Restroom	2	Wall	Wall	Cracked	Plaster	0.06
1916 bldg.	275	XRF	2/4/97	1	Restroom	2	Wall	Wall	Cracked	Plaster	0.2
1916 bldg.	276	XRF	2/4/97	1	Restroom	2	Door	Door	Cracked	Wood	0.01
1916 bldg.	277	XRF	2/4/97	1	Restroom	2		Radiator	Cracked	Metal	5.09
1916 bldg.	278	XRF	2/4/97	1	Restroom	2	Radiator	Protector	Cracked	Wood	0.01
1916 bldg.	279	XRF	2/4/97	1	Classroom	108	Wall	Wall	Solid	Tile	3.59
1916 bldg.	280	XRF	2/4/97	1	Classroom	108	Wall	Midle Wall	Solid	Plaster	0.12
1916 bldg.	281	XRF	2/4/97	1	Classroom	108	Wall	Wall	Solid	Plaster	0.18
1916 bldg.	282	XRF	2/4/97	1	Classroom	108	Door	Door	Solid	Wood	0.04
1916 bldg.	283	XRF	2/4/97	1	Classroom	108	Door	Casing	Solid	Wood	0.04
1916 bldg.	284	XRF	2/4/97	1	Classroom	108	Door	Casing	Solid	Wood	0.04
1916 bldg.	285	XRF	2/4/97	1	Classroom	108	Window	Casing	Solid	Wood	0.03
1916 bldg.	286	XRF	2/4/97	1	Classroom	108	Upper Wall	Crown mold	Solid	Wood	0.05
1916 bldg.	287	XRF	2/4/97	1	Classroom	108	Bulletin	Board	Solid	Wood	0.04
1916 bldg.	288	XRF	2/4/97	1	Classroom	108	Wire	Tray	Solid	Metal	0.04
1916 bldg.	289	XRF	2/4/97	1	Classroom	108	Cabinet	Door	Solid	Wood	0.06

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1916 bldg.	290	XRF	2/4/97	1	Classroom	108	Cabinet	Inside	Solid	Wood	0.04
1916 bldg.	291	XRF	2/4/97	1	Room	108	Wall	Chair rail	Solid	Wood	0.04
1916 bldg.	292	XRF	2/4/97	1	Room	108		Radiator	Cracked	Metal	5.0+
1916 bldg.	293	XRF	2/4/97	1	Room	108	Radiator	Protector	Cracked	Wood	0
1916 bldg.	294	XRF	2/4/97	1	Room	108		Bookshelf	Cracked	Wood	0
1916 bldg.	295	XRF	2/4/97	1	Room	108		Floor	Solid	Wood	0
1916 bldg.	296	XRF	2/4/97	1	Room	108		Wall Rgstr	Solid	Metal	5.0+
1916 bldg.	297	XRF	2/4/97	1	Classroom	108	Wire Protector	Baseboard	Solid	Wood	0
1916 bldg.	298	XRF	2/4/97	1	Room	82	Wall	Wall	Solid	Plaster	4
1916 bldg.	299	XRF	2/4/97	1	Room	82	Wall	Middle Wall	Solid	Plaster	2.2
1916 bldg.	300	XRF	2/4/97	1	Room	82	Chair Rail		Solid	Wood	0
1916 bldg.	301	XRF	2/4/97	1	Room	82	Wall	Upper Wall	Cracked	Plaster	0.1
1916 bldg.	302	XRF	2/4/97	1	Room	82	Door		Solid	Wood	0
1916 bldg.	303	XRF	2/4/97	1	Room	82			Solid	Metal	0.1
1916 bldg.	304	XRF	2/4/97	1	Room	82	Radiator	Protector	Solid	Wood	0
1916 bldg.	305	XRF	2/4/97	1	Room	82	Ceiling		Solid	Plaster	0.2
1916 bldg.	306	XRF	2/4/97	1	Classroom	108	Ceiling		Solid	Plaster	0.1
1916 bldg.	307	XRF	2/4/97	1	Hall	2	Ceiling		Solid	Plaster	0.1
1916 bldg.	308	XRF	2/4/97	1	Hall	2	Wall	Middle Wall	Solid	Plaster	0.1
1916 bldg.	309	XRF	2/4/97	1	Hall	2	Wall	Upper Wall	Solid	Plaster	0.1
1916 bldg.	310	XRF	2/4/97	1	Hall	2	Door	Door	Solid	Metal	5.0+
1916 bldg.	311	XRF	2/4/97	1	Hall	2	Door	Casing	Solid	Metal	5.0+
1916 bldg.	312	XRF	2/4/97	1	Hall	2	Radiator		Solid	Metal	5.0+
1916 bldg.	313	XRF	2/4/97	1	Hall	2	Electrical	Panel	Solid	Metal	0.1
1916 bldg.	314	XRF	2/4/97	1	Hall	2	Wire	Tray	Solid	Metal	0
1916 bldg.	315	XRF	2/4/97	1	Hall	2	Fountain	Board	Solid	Wood	0
1916 bldg.	316	XRF	2/4/97	1	Hall	2	Bulletin	Board	Solid	Wood	0
1916 bldg.	317	XRF	2/4/97	1	Stairwell	3	Wall	Upper Wall	Solid	Plaster	0.1
1916 bldg.	318	XRF	2/4/97	1	Stairwell	3	Handrail		Solid	Wood	0
1916 bldg.	319	XRF	2/4/97	1	Stairwell	3	Handrail		Cracked	Metal	0
1916 bldg.	320	XRF	2/4/97	1	Stairwell	3	Door	Casing	Solid	Wood	0
1916 bldg.	321	XRF	2/4/97	1	Stairwell	3	Door	Door	Cracked	Wood	1.5
1916 bldg.	6	XRF	2/5/97	0	Room	9	Wall	Wall	Cracked	Tile	4.28
1916 bldg.	7	XRF	2/5/97	0	Room	9	Wall	Wall	Cracked	Plaster	0.27
1916 bldg.	8	XRF	2/5/97	0	Room	9	Wall	Wall	Cracked	Tile	0.22
1916 bldg.	9	XRF	2/5/97	0	Room	9	Wall	Wall	Cracked	Plaster	0.08
1916 bldg.	10	XRF	2/5/97	0	Room	9	Door	Door	Solid	Wood	0.06
1916 bldg.	11	XRF	2/5/97	0	Room	9	Door	Jamb	Solid	Wood	0.06
1916 bldg.	12	XRF	2/5/97	0	Room	9	Wall	Baseboard	Cracked	Wood	0.05
1916 bldg.	13	XRF	2/5/97	0	Room	9	Bulletin	Board	Solid	Wood	0
1916 bldg.	14	XRF	2/5/97	0	Room	9	Wall	Wall Rgstr	Solid	Metal	0.19
1916 bldg.	15	XRF	2/5/97	0	Room	9	Wall	Wall Rgstr	Solid	Metal	0.19
1916 bldg.	16	XRF	2/5/97	0	Room	9	Ceiling	Radiator	Solid	Metal	0.17
1916 bldg.	17	XRF	2/5/97	0	Room	9	Ceiling	Radiator	Solid	Metal	0.2
1916 bldg.	18	XRF	2/5/97	0	Room	9		Mural	Solid	Plaster	0.05
1916 bldg.	19	XRF	2/5/97	0	Room	9	Closet	Wall	Solid	Plaster	0.05
1916 bldg.	20	XRF	2/5/97	0	Room	9	Closet	Shelf	Solid	Wood	0.07
1916 bldg.	21	XRF	2/5/97	0	Restroom	3	Wall	Wall	Peeling	Tile	5.09
1916 bldg.	22	XRF	2/5/97	0	Restroom	3	Wall	Wall	Solid	Plaster	0.13
1916 bldg.	23	XRF	2/5/97	0	Restroom	3	Wall	Midle Wall	Solid	Plaster	0.02
1916 bldg.	24	XRF	2/5/97	0	Restroom	3	Door	Door	Solid	Wood	0.05
1916 bldg.	25	XRF	2/5/97	0	Restroom	3	Wall	Baseboard	Cracked	Wood	1.03
1916 bldg.	26	XRF	2/5/97	0	Restroom	3	Wall	Wall Rgstr	Solid	Metal	0.01
1916 bldg.	27	XRF	2/5/97	0	Classroom	1	Wall	Midle Wall	Cracked	Plaster	0.03
1916 bldg.	28	XRF	2/5/97	0	Classroom	1	Wall	Wall	Cracked	Tile	3.65
1916 bldg.	29	XRF	2/5/97	0	Classroom	1	Wall	Midle Wall	Cracked	Tile	5.09
1916 bldg.	30	XRF	2/5/97	0	Classroom	1	Wall	Wall	Cracked	Plaster	5.09
1916 bldg.	31	XRF	2/5/97	0	Classroom	1	Door	Door	Solid	Wood	0.05
1916 bldg.	32	XRF	2/5/97	0	Classroom	1	Door	Jamb	Cracked	Wood	0.03
1916 bldg.	33	XRF	2/5/97	0	Classroom	1	Door	Jamb	Cracked	Wood	0.02
1916 bldg.	34	XRF	2/5/97	0	Classroom	1	Cabinet	Door	Cracked	Wood	0.02
1916 bldg.	35	XRF	2/5/97	0	Classroom	1	Cabinet	Shelf	Solid	Wood	0.37
1916 bldg.	36	XRF	2/5/97	0	Classroom	1	Floor		Cracked	Wood	0
1916 bldg.	37	XRF	2/5/97	0	Classroom	1	Wall	Baseboard	Cracked	Wood	0
1916 bldg.	38	XRF	2/5/97	0	Classroom	1	Bulletin Board	Chalk Board	Cracked	Metal	0.04
1916 bldg.	39	XRF	2/5/97	0	Classroom	1	Ceiling	Diffuser	Solid	Metal	0.01
1916 bldg.	40	XRF	2/5/97	0	Classroom	1		Radiator	Solid	Metal	0.07
1916 bldg.	41	XRF	2/5/97	0	Room	10	Wall	Wall	Solid	Plaster	0.07

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1916 bldg.	42	XRF	2/5/97	0	Room	10	Wall	Midle Wall	Solid	Plaster	0.07
1916 bldg.	43	XRF	2/5/97	0	Room	10	Door	Door	Cracked	Wood	0.03
1916 bldg.	44	XRF	2/5/97	0	Room	10	Door	Door	Solid	Wood	0.05
1916 bldg.	45	XRF	2/5/97	0	Room	10	Wall	Baseboard	Cracked	Wood	0.1
1916 bldg.	46	XRF	2/5/97	0	Room	10	Wall	Wall Rgstr	Solid	Metal	0
1916 bldg.	47	XRF	2/5/97	0	Room	10	Ceiling	Radiator	Solid	Metal	0.14
1916 bldg.	48	XRF	2/5/97	0	Room	10	Pipe chase	Door	Solid	Wood	0.04
1916 bldg.	49	XRF	2/5/97	0	Restroom	4	Wall	Wall	Solid	Plaster	0.13
1916 bldg.	50	XRF	2/5/97	0	Restroom	4	Wall	Wall	Cracked	Tile	5.09
1916 bldg.	51	XRF	2/5/97	0	Restroom	4	Wall	Wall Rgstr	Solid	Metal	0.17
1916 bldg.	52	XRF	2/5/97	0	Restroom	4	Door	Door	Solid	Wood	0.05
1916 bldg.	53	XRF	2/5/97	0	Restroom	4	Wall	Baseboard	Cracked	Wood	0.11
1916 bldg.	54	XRF	2/5/97	0	Room	11	Wall	Wall	Cracked	Tile	3.43
1916 bldg.	55	XRF	2/5/97	0	Room	11	Wall	Wall	Cracked	Plaster	0.13
1916 bldg.	56	XRF	2/5/97	0	Room	11	Door	Door	Solid	Wood	0.04
1916 bldg.	57	XRF	2/5/97	0	Room	11	Door	Jamb	Cracked	Wood	0.03
1916 bldg.	58	XRF	2/5/97	0	Room	11	Floor		Cracked	Wood	0
1916 bldg.	59	XRF	2/5/97	0	Room	11	Wall	Baseboard	Cracked	Wood	0.13
1916 bldg.	60	XRF	2/5/97	0	Room	11		Radiator	Solid	Metal	0.09
1916 bldg.	61	XRF	2/5/97	0	Room	11	Closet	Wall	Solid	Plaster	0.15
1916 bldg.	62	XRF	2/5/97	0	Room	11	Closet	Shelf	Solid	Wood	0.02
1916 bldg.	63	XRF	2/5/97	0	Room	11	Closet	Floor	Cracked	Concrete	0.04
1916 bldg.	64	XRF	2/5/97	0	Room	12	Wall	Wall	Cracked	Tile	0.27
1916 bldg.	65	XRF	2/5/97	0	Room	12	Wall	Wall	Solid	Plaster	0.3
1916 bldg.	66	XRF	2/5/97	0	Room	12	Wall	Wall Rgstr	Solid	Metal	0.03
1916 bldg.	67	XRF	2/5/97	0	Room	12	Floor		Peeling	Concrete	0.04
1916 bldg.	68	XRF	2/5/97	0	Restroom	5	Wall	Wall	Peeling	Plaster	0.04
1916 bldg.	69	XRF	2/5/97	0	Restroom	5	Door	Door	Solid	Wood	0.11
1916 bldg.	70	XRF	2/5/97	0	Restroom	5	Door	Jamb	Solid	Wood	0.04
1916 bldg.	71	XRF	2/5/97	0	Restroom	5	Wall	Baseboard	Cracked	Wood	0.04
1916 bldg.	72	XRF	2/5/97	0	Restroom	5	Floor		Cracked	Concrete	0.03
1916 bldg.	73	XRF	2/5/97	0	Restroom	5		Bthrm Stl	Solid	Metal	0.13
1916 bldg.	74	XRF	2/5/97	0	Restroom	5	Wall	Wall	Cracked	Tile	3.97
1916 bldg.	76	XRF	2/5/97		Bath 5		Ceiling		Peeling	Plaster	1.24
1916 bldg.	77	XRF	2/5/97	0	Room	12	Ceiling		Solid	Plaster	0.17
1916 bldg.	78	XRF	2/5/97	0	Restroom	6	Ceiling		Solid	Plaster	1.79
1916 bldg.	79	XRF	2/5/97	0	Restroom	6	Wall	Wall	Solid	Tile	3.86
1916 bldg.	80	XRF	2/5/97	0	Restroom	6	Wall	Wall	Cracked	Plaster	0.53
1916 bldg.	81	XRF	2/5/97	0	Restroom	6	Door	Door	Solid	Wood	0.03
1916 bldg.	82	XRF	2/5/97	0	Restroom	6	Door	Jamb	Solid	Wood	0.05
1916 bldg.	83	XRF	2/5/97	0	Restroom	6	Mirror	Frame	Cracked	Wood	0.06
1916 bldg.	84	XRF	2/5/97	0	Restroom	6	Wall	Baseboard	Solid	Wood	0.19
1916 bldg.	85	XRF	2/5/97	0	Room	13	Wall	Midle Wall	Solid	Concrete	0.12
1916 bldg.	86	XRF	2/5/97	0	Room	13	Door	Door	Cracked	Metal	0.28
1916 bldg.	87	XRF	2/5/97	0	Room	13	Door	Jamb	Cracked	Metal	0.46
1916 bldg.	88	XRF	2/5/97	0	Room	13	Floor		Peeling	Concrete	0.03
1916 bldg.	89	XRF	2/5/97	0	Room	14	Wall	Wall	Solid	Tile	5.09
1916 bldg.	90	XRF	2/5/97	0	Room	14	Wall	Wall	Solid	Plaster	0.22
1916 bldg.	91	XRF	2/5/97	0	Room	14	Wall	Chair rail	Solid	Wood	0.03
1916 bldg.	92	XRF	2/5/97	0	Room	14		Shelf	Solid	Wood	0
1916 bldg.	93	XRF	2/5/97	0	Room	14	Floor		Cracked	Concrete	0.44
1916 bldg.	94	XRF	2/5/97	0	Room	14		Locker	Solid	Metal	0.19
1916 bldg.	95	XRF	2/5/97	0	Room	14	Ceiling		Solid	Plaster	0.12
1916 bldg.	96	XRF	2/5/97	0	Room	15	Wall	Wall	Cracked	Tile	2.53
1916 bldg.	97	XRF	2/5/97	1	Room	15	Wall	Wall	Cracked	Plaster	0.28
1916 bldg.	98	XRF	2/5/97	1	Room	15	Wall	Midle Wall	Cracked	Plaster	0.23
1916 bldg.	99	XRF	2/5/97	1	Room	15	Wall	Wall	Cracked	Plaster	0.29
1916 bldg.	100	XRF	2/5/97	1	Room	15	Door	Door	Solid	Wood	0.02
1916 bldg.	101	XRF	2/5/97	1	Room	15	Door	Casing	Cracked	Wood	0.07
1916 bldg.	102	XRF	2/5/97	1	Room	15	Door	Door	Solid	Wood	0.13
1916 bldg.	103	XRF	2/5/97	1	Room	15	Door	Jamb	Cracked	Wood	0.08
1916 bldg.	104	XRF	2/5/97	1	Room	15	Door	Jamb	Cracked	Wood	0.1
1916 bldg.	105	XRF	2/5/97	1	Room	15	Door	Door	Solid	Wood	0.06
1916 bldg.	106	XRF	2/5/97	1	Room	15	Wall	Baseboard	Cracked	Wood	0.13
1916 bldg.	107	XRF	2/5/97	1	Room	15	Wall	Baseboard	Cracked	Wood	0.1
1916 bldg.	108	XRF	2/5/97	1	Room	16	Wall	Wall	Peeling	Plaster	0.09
1916 bldg.	109	XRF	2/5/97	1	Room	16	Wall	Wall	Solid	Tile	5.09
1916 bldg.	110	XRF	2/5/97	1	Room	16	Wall	Wall	Cracked	Tile	5.09

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1916 bldg.	111	XRF	2/5/97	1	Room	16	Wall	Wall	Peeling	Plaster	5.09
1916 bldg.	112	XRF	2/5/97	1	Room	16	Door	Door	Solid	Wood	0.07
1916 bldg.	113	XRF	2/5/97	1	Room	16	Door	Casing	Solid	Wood	0.02
1916 bldg.	114	XRF	2/5/97	1	Room	16	Wall	Baseboard	Cracked	Wood	0.07
1916 bldg.	115	XRF	2/5/97	1	Room	16	Cabinet	Door	Solid	Wood	0.02
1916 bldg.	116	XRF	2/5/97	1	Room	16	Cabinet	Shelf	Solid	Wood	0.01
1916 bldg.	117	XRF	2/5/97	1	Room	16	Bulletin Board		Solid	Wood	0.03
1916 bldg.	118	XRF	2/5/97	1	Restroom	7	Wall	Wall	Cracked	Tile	5.09
1916 bldg.	119	XRF	2/5/97	1	Restroom	7	Wall	Wall	Cracked	Tile	3.72
1916 bldg.	120	XRF	2/5/97	1	Restroom	7	Wall	Wall	Solid	Plaster	0.19
1916 bldg.	121	XRF	2/5/97	1	Restroom	7	Wall	Wall	Cracked	Plaster	0.21
1916 bldg.	122	XRF	2/5/97	1	Restroom	7	Door	Door	Solid	Wood	0.02
1916 bldg.	123	XRF	2/5/97	1	Restroom	7	Wall	Baseboard	Cracked	Wood	0.11
1916 bldg.	124	XRF	2/5/97	1	Restroom	7	Wall	Wall Rgstr	Solid	Metal	0.03
1916 bldg.	125	XRF	2/5/97	1	Room	17	Wall	Wall	Cracked	Plaster	5.09
1916 bldg.	126	XRF	2/5/97	1	Room	17	Wall	Wall	Cracked	Plaster	0.24
1916 bldg.	127	XRF	2/5/97	1	Room	17	Door	Door	Solid	Wood	0.03
1916 bldg.	128	XRF	2/5/97	1	Room	17	Door	Jamb	Solid	Wood	0.11
1916 bldg.	129	XRF	2/5/97	1	Room	17	Cabinet	Door	Solid	Wood	0.04
1916 bldg.	130	XRF	2/5/97	1	Room	17	Bulletin Board		Solid	Wood	0.03
1916 bldg.	131	XRF	2/5/97	1	Room	17	Floor		Peeling	Concrete	4.24
1916 bldg.	132	XRF	2/5/97	1	Room	17	Ceiling	Radiator	Solid	Metal	4.09
1916 bldg.	133	XRF	2/5/97	1	Room	17	Wall	Wall Rgstr	Cracked	Metal	0.23
1916 bldg.	134	XRF	2/5/97	1	Room	17	Ceiling		Cracked	Plaster	0.12
1916 bldg.	135	XRF	2/5/97	1	Room	17	Ceiling		Cracked	Plaster	0.41
1916 bldg.	136	XRF	2/5/97	1	Room	17	Ceiling		Cracked	Plaster	0.2
1916 bldg.	6	XRF	2/9/97	0	Room	18	Wall	Wall	Cracked	Plaster	0.26
1924 bldg.	7	XRF	2/9/97	0	Room	18	Wall	Wall	Cracked	Plaster	0.24
1924 bldg.	8	XRF	2/9/97	0	Room	18	Ceiling		Solid	Plaster	0.21
1924 bldg.	9	XRF	2/9/97	0	Room	18	Door	Door	Solid	Wood	0.01
1924 bldg.	10	XRF	2/9/97	0	Room	18	Door	Casing	Solid	Wood	0
1924 bldg.	11	XRF	2/9/97	0	Room	18		Radiator	Solid	Metal	0.19
1924 bldg.	12	XRF	2/9/97	0	Room	18	Floor	Flr Registr	Cracked	Metal	0.56
1924 bldg.	13	XRF	2/9/97	0	Room	18	Floor	Flr Registr	Peeling	Concrete	1.01
1924 bldg.	14	XRF	2/9/97	0	Room	18	Bookcase	Shelf	Solid	Wood	0
1916 bldg.	15	XRF	2/9/97	0	Stairwell	1		Radiator	Cracked	Metal	0.07
1916 bldg.	16	XRF	2/9/97	0	Stairwell	1	Door	Door	Peeling	Metal	0.39
1916 bldg.	17	XRF	2/9/97	0	Stairwell	1	Door	Casing	Cracked	Metal	5.09
1916 bldg.	18	XRF	2/9/97	0	Stairwell	1	Ceiling	Casing	Cracked	Plaster	5.09
1916 bldg.	19	XRF	2/9/97	0	Hall	3	Wall	Wall	Cracked	Tile	2.97
1916 bldg.	20	XRF	2/9/97	0	Hall	3	Wall	Wall	Cracked	Plaster	0.22
1916 bldg.	21	XRF	2/9/97	0	Hall	3	Wall	Chair rail	Solid	Wood	0.07
1916 bldg.	22	XRF	2/9/97	0	Hall	3	Wall	Middle Wall	Solid	Tile	2.58
1916 bldg.	23	XRF	2/9/97	0	Hall	3	Wall	Middle Wall	Solid	Tile	0.62
1916 bldg.	24	XRF	2/9/97	0	Hall	3	Coat Rack		Solid	Wood	0.04
1916 bldg.	25	XRF	2/9/97	0	Hall	3	Boot Rack		Cracked	Wood	0.06
1916 bldg.	26	XRF	2/9/97	0	Hall	3	Wall	Wall	Solid	Plaster	0.26
1916 bldg.	27	XRF	2/9/97	0	Hall	3	Window	Stool	Solid	Concrete	5.09
1916 bldg.	28	XRF	2/9/97	0	Hall	3	Door	Jamb	Solid	Plaster	1.87
1916 bldg.	29	XRF	2/9/97	0	Hall	3	Wiretray		Solid	Metal	0.02
1916 bldg.	30	XRF	2/9/97	0	Hall	3		Radiator	Solid	Metal	0.02
1916 bldg.	31	XRF	2/9/97	0	Hall	3	Ceiling		Cracked	Plaster	0.12
1916 bldg.	32	XRF	2/9/97	0	Hall	3	Closet	Middle Wall	Cracked	Plaster	5.09
1916 bldg.	33	XRF	2/9/97	0	Hall	3	Door	Door	Solid	Wood	0.01
1916 bldg.	34	XRF	2/9/97	0	Hall	3	Floor		Peeling	Concrete	0.13
1916 bldg.	35	XRF	2/9/97	0	Hall	3	Ceiling		Cracked	Metal	5.09
1916 bldg.	36	XRF	2/9/97	0	Room	19	Wall	Wall	Peeling	Concrete	0.15
1916 bldg.	37	XRF	2/9/97	1	Room	19	Wall	Wall	Peeling	Concrete	0.35
1916 bldg.	38	XRF	2/9/97	0	Room	19	Door	Door	Cracked	Metal	0.67
1916 bldg.	39	XRF	2/9/97	0	Room	19	Door	Casing	Cracked	Metal	0.37
1916 bldg.	40	XRF	2/9/97	0	Room	19	Door	Door	Cracked	Metal	0.66
1916 bldg.	41	XRF	2/9/97	0	Room	19	Door	Door	Cracked	Metal	0.01
1916 bldg.	42	XRF	2/9/97	0	Room	19	Door	Jamb	Cracked	Metal	0.15
1916 bldg.	43	XRF	2/9/97	0	Room	19	Stairs	Stringer	Cracked	Metal	0.04
1916 bldg.	44	XRF	2/9/97	0	Room	19	Stairs	Hand rail	Peeling	Metal	0.07
1916 bldg.	45	XRF	2/9/97	0	Room	19	Door	Door	Peeling	Metal	0.36
1916 bldg.	46	XRF	2/9/97	0	Room	19	Door	Casing	Cracked	Metal	0.44
1916 bldg.	47	XRF	2/9/97	0	Room	19	Floor		Peeling	Concrete	0

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1924 bldg.	48	XRF	2/9/97	2	Room	2	Wall	Wall	Cracked	Tile	0.2
1924 bldg.	49	XRF	2/9/97	2	Room	2	Wall	Wall	Cracked	Plaster	0.35
1924 bldg.	50	XRF	2/9/97	2	Room	2	Door	Casing	Solid	Wood	0.05
1924 bldg.	51	XRF	2/9/97	2	Room	2	Door	Door	Solid	Wood	0.03
1924 bldg.	52	XRF	2/9/97	2	Room	2	Window	Casing	Solid	Wood	0.13
1924 bldg.	53	XRF	2/9/97	2	Room	2	Cabinet	Door	Solid	Wood	0.04
1924 bldg.	54	XRF	2/9/97	2	Room	2		Radiator	Cracked	Metal	0.22
1924 bldg.	55	XRF	2/9/97	2	Room	2	Floor		Solid	Wood	0
1924 bldg.	56	XRF	2/9/97	2	Room	2	Wall	Chair rail	Solid	Wood	0.03
1924 bldg.	57	XRF	2/9/97	2	Room	2	Wall	Baseboard	Solid	Wood	0.04
1924 bldg.	58	XRF	2/9/97	2	Room	2	Bulletin Board		Solid	Wood	0.02
1924 bldg.	59	XRF	2/9/97	2	Room	2	Closest	Wall	Solid	Plaster	0.29
1924 bldg.	60	XRF	2/9/97	2	Room	2	Closest	Shelf	Solid	Wood	0.05
1924 bldg.	61	XRF	2/9/97	2	Restroom	1	Wall	Wall	Solid	Tile	0.28
1924 bldg.	62	XRF	2/9/97	2	Restroom	1	Wall	Wall	Solid	Plaster	0.31
1924 bldg.	63	XRF	2/9/97	2	Restroom	1	Window	Casing	Solid	Wood	0.03
1924 bldg.	64	XRF	2/9/97	2	Restroom	1	Floor	Casing	Cracked	Concrete	0.36
1924 bldg.	65	XRF	2/9/97	2	Room	2	Wall Upper	Crown mold	Cracked	Wood	0.09
1924 bldg.	66	XRF	2/9/97	2	Room	2	Wall	Wall Rgstr	Solid	Metal	5.09
1924 bldg.	67	XRF	2/9/97	2	Classroom	207	Wall	Wall	Cracked	Plaster	5.09
1924 bldg.	68	XRF	2/9/97	2	Classroom	207	Wall	Wall	Cracked	Plaster	0.27
1924 bldg.	69	XRF	2/9/97	2	Classroom	207	Wall	Wall	Cracked	Plaster	5.09
1924 bldg.	70	XRF	2/9/97	2	Classroom	207	Door	Door	Solid	Wood	0.07
1924 bldg.	71	XRF	2/9/97	2	Classroom	207	Door	Casing	Solid	Wood	0.03
1924 bldg.	72	XRF	2/9/97	2	Classroom	207	Bulletin Board	Chalk Board	Solid	Wood	0.06
1924 bldg.	73	XRF	2/9/97	2	Classroom	207	Bulletin Board	Chalk Board	Solid	Wood	0.05
1924 bldg.	74	XRF	2/9/97	2	Classroom	207	Cabinet	Door	Solid	Wood	0.05
1924 bldg.	75	XRF	2/9/97	2	Classroom	207	Cabinet	Inside	Solid	Wood	0.24
1924 bldg.	76	XRF	2/9/97	2	Classroom	207	Wall	Baseboard	Solid	Wood	0.07
1924 bldg.	77	XRF	2/9/97	2	Classroom	207	Floor	Baseboard	Solid	Wood	0
1924 bldg.	78	XRF	2/9/97	2	Classroom	207		Radiator	Cracked	Metal	3.66
1924 bldg.	79	XRF	2/9/97	2	Classroom	207	Bookcase	Shelf	Cracked	Wood	0.04
1924 bldg.	80	XRF	2/9/97	2	Classroom	207	Window	Casing	Solid	Wood	0.12
1924 bldg.	81	XRF	2/9/97	2	Classroom	207	Wall	Crown mold	Solid	Wood	0.12
1924 bldg.	82	XRF	2/9/97	2	Classroom	207	Wall	Wall Rgstr	Solid	Metal	0
1924 bldg.	83	XRF	2/9/97	2	Classroom	207	Ceiling		Solid	Plaster	0.16
1924 bldg.	85	XRF	2/9/97	2	Room	3	Wall	Wall	Cracked	Plaster	3.46
1924 bldg.	86	XRF	2/9/97	2	Room	3	Wall	Wall	Cracked	Plaster	3.86
1924 bldg.	87	XRF	2/9/97	2	Room	3	Wall	Midle Wall	Cracked	Plaster	3.81
1924 bldg.	88	XRF	2/9/97	2	Room	3	Wall	Wall	Cracked	Plaster	0.36
1924 bldg.	89	XRF	2/9/97	2	Room	3	Door	Door	Solid	Wood	0.06
1924 bldg.	90	XRF	2/9/97	2	Room	3	Door	Casing	Solid	Wood	0.05
1924 bldg.	91	XRF	2/9/97	2	Room	3	Window	Casing	Solid	Wood	0.1
1924 bldg.	92	XRF	2/9/97	2	Room	3		Radiator	Solid	Metal	3.9
1924 bldg.	93	XRF	2/9/97	2	Room	3	Wall	Baseboard	Solid	Wood	0.02
1924 bldg.	94	XRF	2/9/97	2	Room	3	Floor		Solid	Wood	0.01
1924 bldg.	95	XRF	2/9/97	2	Room	3		Ladder	Solid	Metal	5.09
1924 bldg.	96	XRF	2/9/97	2	Restroom	2	Wall	Midle Wall	Solid	Tile	1.28
1924 bldg.	97	XRF	2/9/97	2	Restroom	2	Door	Door	Solid	Wood	0.03
1924 bldg.	98	XRF	2/9/97	2	Restroom	2	Door	Casing	Cracked	Wood	0.03
1924 bldg.	99	XRF	2/9/97	2	Restroom	2	Window	Casing	Solid	Wood	0.09
1924 bldg.	100	XRF	2/9/97	2	Restroom	2		Radiator	Cracked	Metal	5.09
1924 bldg.	101	XRF	2/9/97	2	Restroom	2	Wall	Wall Rgstr	Solid	Metal	0.04
1924 bldg.	102	XRF	2/9/97	2	Restroom	2	Wall	Bthrm Sll	Solid	Metal	0.05
1924 bldg.	103	XRF	2/9/97	2	Restroom	2	Soffit		Solid	Plaster	0.14
1924 bldg.	104	XRF	2/9/97	2	Restroom	3	Soffit		Cracked	Plaster	0.06
1924 bldg.	105	XRF	2/9/97	2	Restroom	3	Door	Door	Solid	Wood	0.03
1924 bldg.	106	XRF	2/9/97	2	Restroom	3	Door	Jamb	Cracked	Wood	0.03
1924 bldg.	107	XRF	2/9/97	2	Restroom	3	Wall	Midle Wall	Solid	Tile	2.23
1924 bldg.	108	XRF	2/9/97	2	Restroom	3	Window	Casing	Solid	Wood	0.09
1924 bldg.	109	XRF	2/9/97	2	Restroom	3		Radiator	Peeling	Metal	5.09
1924 bldg.	110	XRF	2/9/97	2	Restroom	3		Bthrm Sll	Solid	Metal	0.07
1924 bldg.	111	XRF	2/9/97	2	Restroom	3	Wall	Wall Rgstr	Solid	Metal	0.03
1924 bldg.	112	XRF	2/9/97	2	Restroom	3	Mirror Frame		Cracked	Wood	0
1924 bldg.	115	XRF	2/9/97	2	Classroom	206	Wall	Wall	Cracked	Plaster	4.16
1924 bldg.	116	XRF	2/9/97	2	Classroom	206	Wall	Midle Wall	Cracked	Plaster	0.52
1924 bldg.	117	XRF	2/9/97	2	Classroom	206	Wall	Wall	Cracked	Plaster	5.09
1924 bldg.	118	XRF	2/9/97	2	Classroom	206	Wall	Wall	Cracked	Plaster	0.33

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1924 bldg.	119	XRF	2/9/97	2	Classroom	206	Wall	Crown mold	Solid	Wood	0.16
1924 bldg.	120	XRF	2/9/97	2	Classroom	206	Ceiling		Solid	Plaster	0.19
1924 bldg.	121	XRF	2/9/97	2	Classroom	206	Door	Door	Solid	Wood	0.06
1924 bldg.	122	XRF	2/9/97	2	Classroom	206	Door	Casing	Solid	Wood	0.03
1924 bldg.	123	XRF	2/9/97	2	Classroom	206	Cabinet	Door	Solid	Wood	0.04
1924 bldg.	124	XRF	2/9/97	2	Classroom	206	Cabinet	Inside	Solid	Wood	0.72
1924 bldg.	125	XRF	2/9/97	2	Classroom	206	Cabinet	Shelf	Solid	Wood	0.34
1924 bldg.	126	XRF	2/9/97	2	Classroom	206	Window	Casing	Solid	Wood	0.06
1924 bldg.	127	XRF	2/9/97	2	Classroom	206		Radiator	Peeling	Metal	5.09
1924 bldg.	128	XRF	2/9/97	2	Classroom	206	Bulletin Board	Trim	Cracked	Wood	0.05
1924 bldg.	129	XRF	2/9/97	2	Classroom	206	Bulletin Board	Trim	Cracked	Wood	0.1
1924 bldg.	130	XRF	2/9/97	2	Classroom	206	Bulletin Board	Cork	Solid	Wood	1.23
1924 bldg.	131	XRF	2/9/97	2	Classroom	206	Wall	Baseboard	Cracked	Wood	0.04
1924 bldg.	132	XRF	2/9/97	2	Classroom	206	Floor		Solid	Wood	0
1924 bldg.	133	XRF	2/9/97	2	Classroom	206	Wall	Wall Rgstr	Solid	Metal	4.18
1924 bldg.	134	XRF	2/9/97	2	Classroom	205	Wall	Wall	Cracked	Plaster	2.34
1924 bldg.	135	XRF	2/9/97	2	Classroom	205	Wall	Wall	Cracked	Plaster	5.09
1924 bldg.	136	XRF	2/9/97	2	Classroom	205	Wall	Midle Wall	Cracked	Plaster	0.42
1924 bldg.	137	XRF	2/9/97	2	Classroom	205	Wall	Wall	Cracked	Plaster	0.32
1924 bldg.	138	XRF	2/9/97	2	Classroom	205	Wall	Crown mold	Solid	Wood	0.02
1924 bldg.	139	XRF	2/9/97	2	Classroom	205	Ceiling		Cracked	Plaster	0.3
1924 bldg.	140	XRF	2/9/97	2	Classroom	205	Ceiling		Cracked	Plaster	0.11
1924 bldg.	141	XRF	2/9/97	2	Classroom	205	Door	Door	Solid	Wood	0.07
1924 bldg.	142	XRF	2/9/97	2	Classroom	205	Door	Casing	Cracked	Wood	0.04
1924 bldg.	143	XRF	2/9/97	2	Classroom	205	Bulletin Board		Solid	Wood	0.08
1924 bldg.	144	XRF	2/9/97	2	Classroom	205	Bulletin Board		Solid	Wood	0.06
1924 bldg.	145	XRF	2/9/97	2	Classroom	205	Cabinet	Door	Solid	Wood	0.05
1924 bldg.	146	XRF	2/9/97	2	Classroom	205	Cabinet	Inside	Solid	Wood	0.24
1924 bldg.	147	XRF	2/9/97	2	Classroom	205	Cabinet	Shelf	Solid	Wood	0.22
1924 bldg.	148	XRF	2/9/97	2	Classroom	205	Window	Casing	Solid	Wood	0.14
1924 bldg.	149	XRF	2/9/97	2	Classroom	205		Radiator	Peeling	Metal	5.09
1924 bldg.	150	XRF	2/9/97	2	Classroom	205	Wall	Baseboard	Solid	Wood	0.05
1924 bldg.	151	XRF	2/9/97	2	Classroom	205	Floor		Solid	Wood	0.01
1924 bldg.	152	XRF	2/9/97	2	Classroom	205	Wall	Wall Rgstr	Solid	Metal	4
1924 bldg.	153	XRF	2/9/97	2	Classroom	205	Wall	Wall Rgstr	Solid	Metal	3.5
1924 bldg.	154	XRF	2/9/97	2	Hall	1	Wall	Wall	Cracked	Plaster	0.04
1924 bldg.	155	XRF	2/9/97	2	Hall	1	Wall	Wall	Cracked	Plaster	0.17
1924 bldg.	156	XRF	2/9/97	2	Hall	1	Wall	Wall	Solid	Tile	0.96
1924 bldg.	157	XRF	2/9/97	2	Hall	1	Wall	Wall	Solid	Plaster	0.04
1924 bldg.	158	XRF	2/9/97	2	Hall	1	Wall	Wall	Solid	Plaster	0.29
1924 bldg.	159	XRF	2/9/97	2	Hall	1	Window	Casing	Solid	Wood	0.12
1924 bldg.	160	XRF	2/9/97	2	Hall	1	Wall	Chair rail	Solid	Wood	0.05
1924 bldg.	161	XRF	2/9/97	2	Hall	1		Radiator	Peeling	Metal	5.09
1924 bldg.	162	XRF	2/9/97	2	Hall	1	Wall	Crown mold	Solid	Wood	0.14
1924 bldg.	163	XRF	2/9/97	2	Hall	1	Ceiling		Cracked	Plaster	0.21
1924 bldg.	164	XRF	2/9/97	2	Hall	1	Coat Rack		Solid	Wood	0
1924 bldg.	165	XRF	2/9/97	2	Hall	1	Boot Rack		Solid	Wood	0.01
1924 bldg.	166	XRF	2/9/97	2	Hall	1	Cabinet	Door	Solid	Wood	0.04
1954 bldg.	167	XRF	2/9/97	2	Classroom	203	Wall	Wall	Solid	Plaster	0.05
1954 bldg.	168	XRF	2/9/97	2	Classroom	203	Wall	Wall	Solid	Plaster	0.1
1954 bldg.	169	XRF	2/9/97	2	Classroom	203	Ceiling		Solid	Plaster	0.01
1954 bldg.	170	XRF	2/9/97	2	Classroom	203	Wire Tray		Solid	Metal	0.01
1954 bldg.	171	XRF	2/9/97	2	Classroom	203	Door	Door	Solid	Wood	0.01
1954 bldg.	172	XRF	2/9/97	2	Classroom	203	Door	Jamb	Cracked	Metal	0.06
1954 bldg.	173	XRF	2/9/97	2	Classroom	203	Wall	Baseboard	Cracked	Wood	0.01
1954 bldg.	174	XRF	2/9/97	2	Classroom	203	Bulletin Board		Solid	Metal	0.04
1954 bldg.	175	XRF	2/9/97	2	Classroom	203	Cabinet	Door	Solid	Wood	0
1954 bldg.	176	XRF	2/9/97	2	Classroom	203	Cabinet	Inside	Solid	Wood	0.25
1954 bldg.	177	XRF	2/9/97	2	Classroom	203	Cabinet	Shelf	Solid	Wood	0.12
1954 bldg.	178	XRF	2/9/97	2	Classroom	203	Bookcase	Inside	Solid	Wood	0.01
1954 bldg.	179	XRF	2/9/97	2	Classroom	203	Bookcase	Wall Rgstr	Cracked	Metal	0.02
1954 bldg.	180	XRF	2/9/97	2	Classroom	204	Wall	Wall	Solid	Plaster	0.02
1954 bldg.	181	XRF	2/9/97	2	Classroom	204	Wall	Wall	Solid	Plaster	0.05
1954 bldg.	182	XRF	2/9/97	2	Classroom	204	Ceiling	Wall	Solid	Plaster	0.01
1954 bldg.	183	XRF	2/9/97	2	Classroom	204	Ceiling	Wiretray	Solid	Metal	0.06
1954 bldg.	184	XRF	2/9/97	2	Classroom	204	Bookcase	Shelf	Cracked	Wood	0.03
1954 bldg.	185	XRF	2/9/97	2	Classroom	204	Bookcase	Shelf	Cracked		0
1954 bldg.	186	XRF	2/9/97	2	Classroom	204		Univent	Solid	Metal	0.02

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1954 bldg.	187	XRF	2/9/97	2	Classroom	204	Bookcase	Wall Rgstr	Solid	Metal	0.03
1954 bldg.	188	XRF	2/9/97	2	Classroom	204	Wall	Baseboard	Cracked		0.01
1954 bldg.	189	XRF	2/9/97	2	Classroom	204	Bulletin Board	Midle Wall	Cracked	Metal	0.08
1954 bldg.	190	XRF	2/9/97	2	Classroom	204	Door	Door	Solid	Wood	0.02
1954 bldg.	191	XRF	2/9/97	2	Classroom	204	Door	Casing	Cracked	Metal	0.04
1954 bldg.	192	XRF	2/9/97	2	Classroom	204	Cabinet	Door	Solid	Wood	0.02
1954 bldg.	193	XRF	2/9/97	2	Classroom	204	Cabinet	Inside	Solid	Wood	0.07
1954 bldg.	194	XRF	2/9/97	2	Classroom	204	Cabinet	Shelf	Solid	Wood	0.03
1954 bldg.	195	XRF	2/9/97	2	Classroom	204	Wall	Crown mold	Solid	Wood	0.03
1954 bldg.	197	XRF	2/9/97	2	Classroom	202	Wall	Wall	Cracked	Plaster	0.1
1954 bldg.	198	XRF	2/9/97	2	Classroom	202	Door	Door	Cracked	Wood	0.01
1954 bldg.	199	XRF	2/9/97	2	Classroom	202	Door	Casing	Cracked	Metal	0.03
1954 bldg.	200	XRF	2/9/97	2	Classroom	202	Wall	Wall	Cracked	Plaster	0.11
1954 bldg.	201	XRF	2/9/97	2	Classroom	202	Ceiling		Solid	Plaster	0.01
1954 bldg.	202	XRF	2/9/97	2	Classroom	202	Ceiling	Wiretray	Peeling	Metal	0
1954 bldg.	203	XRF	2/9/97	2	Classroom	202	Bookcase	Shelf	Cracked	Wood	0.05
1954 bldg.	204	XRF	2/9/97	2	Classroom	202		Univent	Solid	Metal	0.01
1954 bldg.	205	XRF	2/9/97	2	Classroom	202	Bookcase		Solid	Metal	0.02
1954 bldg.	206	XRF	2/9/97	2	Classroom	202	Cabinet	Door	Cracked	Wood	0.02
1954 bldg.	207	XRF	2/9/97	2	Classroom	202	Cabinet	Inside	Cracked	Wood	0.01
1954 bldg.	208	XRF	2/9/97	2	Classroom	202	Cabinet	Shelf	Solid	Wood	0.02
1954 bldg.	209	XRF	2/9/97	2	Classroom	202	Bulletin Board		Solid	Metal	0.06
1954 bldg.	210	XRF	2/9/97	2	Classroom	202	Wall	Crown mold	Solid	Wood	0
1954 bldg.	211	XRF	2/9/97	2	Classroom	202	Wall	Baseboard	Cracked	Wood	0.01
1954 bldg.	212	XRF	2/9/97	2	Classroom	201	Wall	Wall	Cracked	Plaster	0.08
1954 bldg.	213	XRF	2/9/97	2	Classroom	201	Door	Door	Solid	Wood	0.02
1954 bldg.	214	XRF	2/9/97	2	Classroom	201	Door	Casing	Cracked	Metal	0.03
1954 bldg.	215	XRF	2/9/97	2	Classroom	201	Wall	Wall	Cracked	Plaster	0.09
1954 bldg.	216	XRF	2/9/97	2	Classroom	201	Ceiling		Cracked	Plaster	0.01
1954 bldg.	217	XRF	2/9/97	2	Classroom	201	Ceiling	Wiretray	Cracked	Metal	0.14
1954 bldg.	218	XRF	2/9/97	2	Classroom	201	Wall	Crown mold	Cracked	Wood	0.02
1954 bldg.	219	XRF	2/9/97	2	Classroom	201	Bookcase	Wall Rgstr	Solid	Metal	0.03
1954 bldg.	220	XRF	2/9/97	2	Classroom	201	Bookcase	Shelf	Cracked	Wood	0.01
1954 bldg.	221	XRF	2/9/97	2	Classroom	201	Wall	Univent	Solid	Metal	0.01
1954 bldg.	222	XRF	2/9/97	2	Classroom	201	Bulletin Board		Cracked	Metal	0.04
1954 bldg.	223	XRF	2/9/97	2	Classroom	201	Wall	Baseboard	Cracked	Wood	0.01
1954 bldg.	224	XRF	2/9/97	2	Classroom	201	Cabinet	Door	Solid	Wood	0.01
1954 bldg.	225	XRF	2/9/97	2	Classroom	201	Cabinet	Inside	Solid	Wood	0.08
1954 bldg.	226	XRF	2/9/97	2	Classroom	201	Cabinet	Shelf	Solid	Wood	0.06
1954 bldg.	227	XRF	2/9/97	2	Hall	1	Wall	Midle Wall	Solid	Tile	2.78
1954 bldg.	228	XRF	2/9/97	2	Hall	1	Wall	Midle Wall	Solid	Tile	0.99
1954 bldg.	229	XRF	2/9/97	2	Hall	1	Door	Door	Cracked	Wood	0.02
1954 bldg.	230	XRF	2/9/97	2	Hall	1	Door	Casing	Solid	Metal	0.01
1954 bldg.	231	XRF	2/9/97	2	Hall	1	Wall	Wall Rgstr	Solid	Metal	0.02
1954 bldg.	232	XRF	2/9/97	2	Hall	1	Coat Rack		Solid	Wood	0.02
1954 bldg.	233	XRF	2/9/97	2	Hall	1	Boot Rack		Solid	Wood	0
1954 bldg.	234	XRF	2/9/97	2	Hall	1	Ceiling	Hatch	Solid	Metal	0
1954 bldg.	235	XRF	2/9/97	2	Stairwell	1	Wall		Solid	Tile	1.34
1954 bldg.	236	XRF	2/9/97	2	Stairwell	1		Radiator	Solid	Metal	0.19
1954 bldg.	237	XRF	2/9/97	2	Stairwell	1	Stairs	Rail cap	Solid	Wood	0.01
1954 bldg.	238	XRF	2/9/97	2	Stairwell	1	Stairs	Baluster	Solid	Metal	0.01
1954 bldg.	239	XRF	2/9/97	2	Stairwell	1	Stairs	Riser	Solid	Metal	0.46
1954 bldg.	240	XRF	2/9/97	2	Stairwell	1	Stairs	Baseboard	Cracked	Metal	0.47
1924 bldg.	241	XRF	2/9/97	2	Hall	1	Closet	Wall	Solid	Tile	1.44
1924 bldg.	242	XRF	2/9/97	2	Hall	1	Closet	Wall	Solid	Tile	2.4
1924 bldg.	243	XRF	2/9/97	2	Hall	1	Door	Door	Cracked	Wood	0.04
1924 bldg.	244	XRF	2/9/97	2	Hall	1	Floor		Peeling	Concrete	0.01
1924 bldg.	245	XRF	2/9/97	2	Hall	1	Cabinet	Door	Cracked	Metal	0.76
1924 bldg.	246	XRF	2/9/97	2	Hall	1		Shelf	Solid	Wood	1.01
1924 bldg.	247	XRF	2/9/97	2	Hall	1	Bulletin Board		Solid	Wood	0.1
1924 bldg.	248	XRF	2/9/97	2	Hall	1	Ceiling		Solid	Plaster	0.05
1924 bldg.	249	XRF	2/9/97	1	Library	1	Wall	Wall	Cracked	Plaster	5.09
1924 bldg.	250	XRF	2/9/97	1	Library	1	Wall	Wall	Cracked	Plaster	0.13
1924 bldg.	251	XRF	2/9/97	1	Library	1	Wall	Wall	Cracked	Plaster	0.07
1924 bldg.	252	XRF	2/9/97	1	Library	1	Wall	Crown mold	Solid	Wood	0.02
1924 bldg.	253	XRF	2/9/97	1	Library	1	Door	Door	Solid	Wood	0.05
1924 bldg.	254	XRF	2/9/97	1	Library	1	Door	Casing	Solid	Wood	0.05
1924 bldg.	255	XRF	2/9/97	1	Library	1		Casing	Solid	Wood	0.11

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1924 bldg.	256	XRF	2/9/97	1	Library	1	Radiator	Protector	Cracked	Metal	5.09
1924 bldg.	257	XRF	2/9/97	1	Library	1	Unlisted	Radiator	Solid	Metal	0.05
1924 bldg.	258	XRF	2/9/97	1	Library	1	Wall	Baseboard	Solid	Wood	0.08
1924 bldg.	259	XRF	2/9/97	1	Library	1	Cabinet	Door	Solid	Wood	0.06
1924 bldg.	260	XRF	2/9/97	1	Library	1	Cabinet	Inside	Solid	Wood	0.53
1924 bldg.	261	XRF	2/9/97	1	Library	1	Cabinet	Shelf	Solid	Wood	0.99
1924 bldg.	262	XRF	2/9/97	1	Library	1	Bookcase	Shelf	Solid	Wood	0.01
1924 bldg.	263	XRF	2/9/97	1	Library	1	Bulletin Board		Solid	Wood	0.01
1924 bldg.	264	XRF	2/9/97	1	Library	1	Wall	Wall Rgstr	Solid	Metal	3.48
1924 bldg.	265	XRF	2/9/97	1	Library	1	Bulletin Board	Midle Wall	Solid	Wood	0.06
1924 bldg.	266	XRF	2/9/97	1	Library	1	Ceiling		Solid	Plaster	0.09
1924 bldg.	267	XRF	2/9/97	1	Restroom	4	Wall	Wall	Cracked	Tile	1.97
1924 bldg.	268	XRF	2/9/97	2	Restroom	4	Wall	Wall	Cracked	Plaster	5.09
1924 bldg.	269	XRF	2/9/97	2	Restroom	4	Door	Door	Solid	Wood	0.07
1924 bldg.	270	XRF	2/9/97	2	Restroom	4	Door	Casing	Solid	Wood	0.06
1924 bldg.	271	XRF	2/9/97	2	Restroom	4	Window	Casing	Solid	Wood	0.12
1924 bldg.	272	XRF	2/9/97	2	Restroom	4		Radiator	Cracked	Metal	0.17
1924 bldg.	273	XRF	2/9/97	2	Restroom	4	Wall	Chair rail	Solid	Wood	0.04
1924 bldg.	274	XRF	2/9/97	2	Restroom	4	Wall	Wall Rgstr	Solid	Metal	2.97
1924 bldg.	275	XRF	2/9/97	2	Restroom	4	Wall	Baseboard	Cracked	Concrete	0.17
1924 bldg.	276	XRF	2/9/97	2	Restroom	5	Wall	Midle Wall	Cracked	Tile	1.08
1924 bldg.	277	XRF	2/9/97	2	Restroom	5	Door	Door	Solid	Wood	0.05
1924 bldg.	278	XRF	2/9/97	2	Restroom	5	Door	Casing	Solid	Wood	0.04
1924 bldg.	279	XRF	2/9/97	2	Restroom	5	Window	Casing	Solid	Wood	0.06
1924 bldg.	280	XRF	2/9/97	2	Restroom	5		Radiator	Cracked	Metal	4.47
1924 bldg.	281	XRF	2/9/97	2	Restroom	5	Wall	Wall Rgstr	Cracked	Metal	0.01
1924 bldg.	282	XRF	2/9/97	2	Restroom	5		Bthrm Stll	Solid	Metal	0.2
1924 bldg.	283	XRF	2/9/97	2	Restroom	5	Wall	Wall	Solid	Plaster	0.07
1924 bldg.	285	XRF	2/9/97	1	Restroom	6	Wall	Midle Wall	Solid	Tile	2.1
1924 bldg.	286	XRF	2/9/97	1	Restroom	6	Door	Door	Solid	Wood	0.04
1924 bldg.	287	XRF	2/9/97	1	Restroom	6	Door	Casing	Solid	Wood	0.08
1924 bldg.	288	XRF	2/9/97	1	Restroom	6	Window	Casing	Solid	Wood	0.04
1924 bldg.	289	XRF	2/9/97	1	Restroom	6		Radiator	Peeling	Metal	5.09
1924 bldg.	290	XRF	2/9/97	1	Restroom	6		Bthrm Stll	Solid	Metal	0.02
1924 bldg.	291	XRF	2/9/97	1	Restroom	6		Stall Door	Solid	Metal	0.02
1924 bldg.	292	XRF	2/9/97	1	Restroom	6	Wall	Wall Rgstr	Solid	Metal	0.04
1924 bldg.	293	XRF	2/9/97	1	Restroom	6	Wall	Wall	Solid	Plaster	0.05
1924 bldg.	294	XRF	2/9/97	1	Classroom	106	Wall	Wall	Cracked	Plaster	4.49
1924 bldg.	295	XRF	2/9/97	1	Classroom	106	Wall	Wall	Solid	Plaster	3.36
1924 bldg.	296	XRF	2/9/97	1	Classroom	106	Wall	Midle Wall	Solid	Plaster	0.08
1924 bldg.	297	XRF	2/9/97	1	Classroom	106	Wall	Wall	Cracked	Plaster	0.26
1924 bldg.	298	XRF	2/9/97	1	Classroom	106	Door	Door	Solid	Wood	0.06
1924 bldg.	299	XRF	2/9/97	1	Classroom	106	Door	Jamb	Cracked	Wood	0.06
1924 bldg.	300	XRF	2/9/97	1	Classroom	106	Bulletin Board		Cracked	Wood	0.06
1924 bldg.	301	XRF	2/9/97	1	Classroom	106	Bulletin Board		Cracked	Wood	0.12
1924 bldg.	302	XRF	2/9/97	1	Classroom	106	Cabinet	Door	Solid	Wood	0.06
1924 bldg.	303	XRF	2/9/97	1	Classroom	106	Cabinet	Inside	Solid	Wood	0.01
1924 bldg.	304	XRF	2/9/97	1	Classroom	106	Cabinet	Shelf	Solid	Wood	0.07
1924 bldg.	305	XRF	2/9/97	1	Classroom	106	Wall	Wall Rgstr	Solid	Metal	3.99
1924 bldg.	306	XRF	2/9/97	1	Classroom	106	Wall	Crown mold	Solid	Wood	0.04
1924 bldg.	307	XRF	2/9/97	1	Classroom	106	Ceiling		Solid	Plaster	0.1
1924 bldg.	308	XRF	2/9/97	1	Classroom	106	Wall	Baseboard	Solid	Wood	0.04
1924 bldg.	309	XRF	2/9/97	1	Classroom	106	Floor		Solid	Wood	0.01
1924 bldg.	310	XRF	2/9/97	1	Classroom	106		Radiator	Peeling	Metal	5.09
1924 bldg.	311	XRF	2/9/97	1	Classroom	106		Radiator	Peeling	Metal	4.23
1924 bldg.	312	XRF	2/9/97	1	Classroom	106	Bookcase	Inside	Solid	Wood	0.01
1924 bldg.	313	XRF	2/9/97	1	Classroom	106	Window	Casing	Solid	Wood	0.12
1924 bldg.	314	XRF	2/9/97	1	Classroom	105	Wall	Wall	Cracked	Plaster	0.15
1924 bldg.	315	XRF	2/9/97	1	Classroom	105	Wall	Wall	Cracked	Plaster	0.14
1924 bldg.	316	XRF	2/9/97	1	Classroom	105	Wall	Midle Wall	Solid	Plaster	0.1
1924 bldg.	317	XRF	2/9/97	1	Classroom	105	Wall	Wall	Solid	Plaster	4.42
1924 bldg.	318	XRF	2/9/97	1	Classroom	105	Wall	Wall	Cracked	Plaster	5.09
1924 bldg.	319	XRF	2/9/97	1	Classroom	105	Door	Door	Solid	Wood	0.04
1924 bldg.	320	XRF	2/9/97	1	Classroom	105	Door	Casing	Solid	Wood	0.07
1924 bldg.	321	XRF	2/9/97	1	Classroom	105	Bulletin Board		Solid	Wood	0.08
1924 bldg.	322	XRF	2/9/97	1	Classroom	105	Cabinet	Door	Cracked	Wood	0.08
1924 bldg.	323	XRF	2/9/97	1	Classroom	105	Cabinet	Inside	Cracked	Wood	0.09
1924 bldg.	324	XRF	2/9/97	1	Classroom	105	Cabinet	Shelf	Cracked	Wood	0.05

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1924 bldg.	325	XRF	2/9/97	1	Classroom	105	Wall	Wall Rgstr	Solid	Metal	5.09
1924 bldg.	326	XRF	2/9/97	1	Classroom	105	Wall	Crown mold	Solid	Wood	0
1924 bldg.	327	XRF	2/9/97	1	Classroom	105	Ceiling		Solid	Plaster	0.14
1924 bldg.	328	XRF	2/9/97	1	Classroom	105	Bulletin Board		Solid	Wood	0.03
1924 bldg.	329	XRF	2/9/97	1	Classroom	105	Window	Casing	Solid	Wood	0.18
1924 bldg.	330	XRF	2/9/97	1	Classroom	105		Radiator	Cracked	Metal	1.81
1924 bldg.	331	XRF	2/9/97	1	Classroom	105		Radiator	Cracked	Metal	3.94
1924 bldg.	332	XRF	2/9/97	1	Classroom	105	Wall	Baseboard	Solid	Wood	0.05
1924 bldg.	333	XRF	2/9/97	1	Classroom	105	Floor		Solid	Wood	0
1924 bldg.	334	XRF	2/9/97	1	Hall	2	Closet	Wall	Solid	Tile	1.01
1924 bldg.	335	XRF	2/9/97	1	Hall	2	Closet	Wall	Solid	Tile	3.69
1924 bldg.	336	XRF	2/9/97	1	Hall	2	Closet	Door	Solid	Wood	0.07
1924 bldg.	337	XRF	2/9/97	1	Hall	2	Closet	Casing	Solid	Wood	0.07
1924 bldg.	338	XRF	2/9/97	1	Hall	2	Floor		Cracked	Concrete	0.02
1924 bldg.	339	XRF	2/9/97	1	Hall	2	Cabinet	Door	Cracked	Metal	0.51
1924 bldg.	340	XRF	2/9/97	1	Hall	2		Shelf	Cracked	Wood	0.89
1924 bldg.	341	XRF	2/9/97	1	Hall	2	Bulletin Board		Cracked	Wood	0.04
1924 bldg.	342	XRF	2/9/97	1	Hall	2	Ceiling		Cracked	Plaster	0.02
1924 bldg.	343	XRF	2/9/97	1	Hall	2	Wall	Wall	Cracked	Plaster	1.44
1924 bldg.	344	XRF	2/9/97	1	Hall	2	Wall	Wall	Cracked	Plaster	0.12
1924 bldg.	345	XRF	2/9/97	1	Hall	2	Wall	Midle Wall	Solid	Tile	0.84
1924 bldg.	346	XRF	2/9/97	1	Hall	2	Wall	Wall	Solid	Plaster	0
1924 bldg.	347	XRF	2/9/97	1	Hall	2	Coat Rack		Solid	Wood	0.02
1924 bldg.	348	XRF	2/9/97	1	Hall	2	Boot Rack		Solid	Wood	0
1924 bldg.	349	XRF	2/9/97	1	Hall	2	Wall	Chair rail	Solid	Wood	0.05
1924 bldg.	350	XRF	2/9/97	1	Hall	2	Wall	Elec Panel	Solid	Metal	0.01
1924 bldg.	351	XRF	2/9/97	1	Hall	2	Wall	Wall	Solid	Plaster	0.08
1924 bldg.	352	XRF	2/9/97	1	Hall	2	Wall	Crown mold	Solid	Wood	0.05
1924 bldg.	353	XRF	2/9/97	1	Hall	2	Ceiling		Cracked	Plaster	0.26
1924 bldg.	354	XRF	2/9/97	1	Hall	2	Window	Casing	Solid	Wood	0.1
1924 bldg.	355	XRF	2/9/97	1	Hall	2		Radiator	Cracked	Metal	0.03
1924 bldg.	356	XRF	2/9/97	1	Stairwell	2	Door	Door	Solid		0
1924 bldg.	357	XRF	2/9/97	1	Stairwell	2	Door	Casing	Solid	Wood	0.05
1924 bldg.	358	XRF	2/9/97	1	Stairwell	2	Wall	Wall	Solid	Plaster	3.67
1924 bldg.	359	XRF	2/9/97	1	Stairwell	2	Wall	Wall	Solid	Plaster	0.2
1924 bldg.	360	XRF	2/9/97	1	Stairwell	2	Wall	Midle Wall	Solid	Plaster	2.38
1924 bldg.	361	XRF	2/9/97	1	Stairwell	2	Wall	Midle Wall	Cracked	Plaster	0.16
1924 bldg.	362	XRF	2/9/97	1	Stairwell	2	Stairs	Hand rail	Cracked	Wood	0.01
1924 bldg.	363	XRF	2/9/97	1	Stairwell	2	Stairs	Hand rail	Cracked	Metal	0.04
1924 bldg.	364	XRF	2/9/97	1	Stairwell	2	Stairs	Baseboard	Cracked	Wood	0.13
1924 bldg.	365	XRF	2/9/97	1	Stairwell	2	Stairs	Rail cap	Cracked	Metal	0.03
1924 bldg.	366	XRF	2/9/97	1	Stairwell	2	Door	Door	Cracked	Wood	0.88
1924 bldg.	367	XRF	2/9/97	1	Stairwell	2	Door	Jamb	Cracked	Metal	0.14
1924 bldg.	368	XRF	2/9/97	1	Stairwell	2		Radiator	Peeling	Metal	5.09
1924 bldg.	369	XRF	2/9/97	1	Stairwell	2	Stairs	Riser	Cracked	Metal	0.12
1924 bldg.	370	XRF	2/9/97	1	Stairwell	2	Ceiling		Solid	Plaster	0.09
1954 bldg.	371	XRF	2/9/97	1	Classroom	103	Wall	Wall	Solid	Plaster	0.08
1954 bldg.	372	XRF	2/9/97	1	Classroom	103	Door	Door	Solid	Wood	0.01
1954 bldg.	373	XRF	2/9/97	1	Classroom	103	Door	Jamb	Solid	Metal	0.04
1954 bldg.	374	XRF	2/9/97	1	Classroom	103	Wall	Wall	Cracked	Plaster	0.19
1954 bldg.	375	XRF	2/9/97	1	Classroom	103	Ceiling		Cracked	Plaster	0.01
1954 bldg.	376	XRF	2/9/97	1	Classroom	103	Ceiling	Wire tray	Cracked	Metal	0.12
1954 bldg.	377	XRF	2/9/97	1	Classroom	103		Univent	Solid	Metal	0.02
1954 bldg.	378	XRF	2/9/97	1	Classroom	103	Bookcase	Wall Rgstr	Solid	Metal	0.02
1954 bldg.	379	XRF	2/9/97	1	Classroom	103	Bookcase	Shelf	Cracked	Wood	0.01
1954 bldg.	380	XRF	2/9/97	1	Classroom	103	Bulletin Board	Midle Wall	Solid	Metal	0.06
1954 bldg.	381	XRF	2/9/97	1	Classroom	103	Wall	Baseboard	Cracked	Wood	0.01
1954 bldg.	382	XRF	2/9/97	1	Classroom	103	Cabinet	Door	Solid	Wood	0
1954 bldg.	383	XRF	2/9/97	1	Classroom	103	Cabinet	Inside	Solid	Wood	0.19
1954 bldg.	384	XRF	2/9/97	1	Classroom	103	Cabinet	Shelf	Solid	Wood	0.22
1954 bldg.	385	XRF	2/9/97	1	Classroom	104	Wall	Wall	Cracked	Plaster	0.13
1954 bldg.	386	XRF	2/9/97	1	Classroom	104	Wall	Wall	Solid	Plaster	0.33
1954 bldg.	387	XRF	2/9/97	1	Classroom	104	Ceiling		Solid	Plaster	0.01
1954 bldg.	388	XRF	2/9/97	1	Classroom	104	Ceiling		Solid	Metal	0.19
1954 bldg.	389	XRF	2/9/97	1	Classroom	104	Wall	Baseboard	Cracked	Wood	0.05
1954 bldg.	390	XRF	2/9/97	1	Classroom	104	Bulletin Board		Solid	Metal	0.03
1954 bldg.	391	XRF	2/9/97	1	Classroom	104	Bulletin Board		Solid		0.02
1954 bldg.	392	XRF	2/9/97	1	Classroom	104	Cabinet	Door	Solid	Wood	0.02

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1954 bldg.	393	XRF	2/9/97	1	Classroom	104	Cabinet	Inside	Solid	Wood	0.4
1954 bldg.	394	XRF	2/9/97	1	Classroom	104	Cabinet	Shelf	Solid	Wood	0.71
1954 bldg.	395	XRF	2/9/97	1	Classroom	104	Bookcase	Shelf	Cracked	Wood	0.02
1954 bldg.	396	XRF	2/9/97	1	Classroom	104	Bookcase	Wall Rgstr	Solid	Metal	0.02
1954 bldg.	397	XRF	2/9/97	1	Classroom	104		Univent	Solid	Metal	0.01
1954 bldg.	398	XRF	2/9/97	1	Classroom	104	Door	Door	Solid	Wood	0.02
1954 bldg.	399	XRF	2/9/97	1	Classroom	104	Door	Casing	Cracked	Metal	0.02
1954 bldg.	400	XRF	2/9/97	1	Classroom	102	Wall	Midle Wall	Cracked	Plaster	0.15
1954 bldg.	401	XRF	2/9/97	1	Classroom	102	Door	Door	Solid	Wood	0.02
1954 bldg.	402	XRF	2/9/97	1	Classroom	102	Door	Jamb	Solid	Metal	0.01
1954 bldg.	403	XRF	2/9/97	1	Classroom	102	Wall	Wall	Cracked	Plaster	0.07
1954 bldg.	404	XRF	2/9/97	1	Classroom	102	Ceiling		Solid	Plaster	0.05
1954 bldg.	405	XRF	2/9/97	1	Classroom	102	Ceiling	Wire tray	Solid	Metal	0.3
1954 bldg.	406	XRF	2/9/97	1	Classroom	102	Bookcase	Shelf	Solid	Wood	0.01
1954 bldg.	407	XRF	2/9/97	1	Classroom	102		Univent	Solid	Metal	0.01
1954 bldg.	408	XRF	2/9/97	1	Classroom	102	Bookcase	Wall Rgstr	Solid	Metal	0.04
1954 bldg.	409	XRF	2/9/97	1	Classroom	102	Bulletin Board		Solid	Metal	0.03
1954 bldg.	410	XRF	2/9/97	1	Classroom	102	Cabinet	Door	Solid	Wood	0.01
1954 bldg.	411	XRF	2/9/97	1	Classroom	102	Cabinet	Inside	Solid	Wood	0.15
1954 bldg.	412	XRF	2/9/97	1	Classroom	102	Cabinet	Shelf	Solid	Wood	0.28
1954 bldg.	413	XRF	2/9/97	1	Classroom	102	Wall	Baseboard	Cracked	Wood	0.01
1916 bldg.	6	XRF	2/10/97	1	Outside	0	Door	Door	Peeling	Metal	1.67
1916 bldg.	7	XRF	2/10/97	1	Outside	0	Door	Jamb	Cracked	Metal	1.43
1916 bldg.	8	XRF	2/10/97	0	Outside	0	Ext Wall	Foundation	Solid	Concrete	0
1916 bldg.	9	XRF	2/10/97	0	Stairwell	1	Stairs	Hand rail	Cracked	Metal	0.03
1954 bldg.	10	XRF	2/10/97	0	Outside	0	Door	Door	Cracked	Wood	0.02
Outside	11	XRF	2/10/97	0	Outside	0	Door	Header	Peeling	Metal	0.04
Outside	12	XRF	2/10/97	0	Outside	0	Wall	Wall Rgstr	Peeling	Metal	0.04
Outside	13	XRF	2/10/97	0	Outside	1	Door	Jamb	Cracked	Metal	0.26
Outside	14	XRF	2/10/97	0	Outside	1	Door	Jamb	Cracked		0.32
Outside	15	XRF	2/10/97	0	Outside	1	Door	Fuel Oil Bldg.	Cracked	Metal	0.14
Outside	16	XRF	2/10/97	0	Outside	1	Canopy	Column	Cracked	Metal	0.23
Outside	17	XRF	2/10/97	0	Outside	1	Door	Door	Solid	Wood	0.94
1954 bldg.	18	XRF	2/10/97	0	Stairwell	2	Stairs	Hand rail	Cracked	Metal	0.04
1954 bldg.	19	XRF	2/10/97	0	Outside	1	Door	Door	Solid	Wood	0
1954 bldg.	20	XRF	2/10/97	0	Outside	1	Door	Door	Cracked	Wood	0.68
1954 bldg.	21	XRF	2/10/97	0	Outside	1	Ext Wall		Solid	Concrete	0
1924 bldg.	22	XRF	2/10/97	0	Outside	1	Fountain		Solid	Concrete	0
1924 bldg.	23	XRF	2/10/97	0	Outside	1	Window	Grate	Cracked	Metal	
1924 bldg.	24	XRF	2/10/97	0	Outside	1	Handrail		Cracked	Metal	0
1916 bldg.	25	XRF	2/10/97	0	Outside	1	Door	Door	Cracked	Wood	3.21
1954 bldg.	29	XRF	2/10/97	0	Outside	0	Ext Wall	Trim	Peeling	Wood	0
1954 bldg.	30	XRF	2/10/97	0	Classroom	101	Wall	Wall	Cracked	Plaster	0.14
1954 bldg.	31	XRF	2/10/97	1	Classroom	101	Wall	Wall	Cracked	Plaster	0.14
1954 bldg.	32	XRF	2/10/97	1	Classroom	101	Wall	Wall	Cracked	Plaster	0.1
1954 bldg.	33	XRF	2/10/97	1	Classroom	101	Ceiling	Wall	Solid	Plaster	0.01
1954 bldg.	34	XRF	2/10/97	1	Classroom	101	Ceiling	Wire tray	Cracked	Metal	0.29
1954 bldg.	35	XRF	2/10/97	1	Classroom	101	Door	Door	Solid	Wood	0.02
1954 bldg.	36	XRF	2/10/97	1	Classroom	101	Door	Jamb	Solid	Metal	0.02
1954 bldg.	37	XRF	2/10/97	1	Classroom	101	Wall	Baseboard	Cracked	Wood	0.01
1954 bldg.	38	XRF	2/10/97	1	Classroom	101	Cabinet	Door	Solid	Wood	0.02
1954 bldg.	39	XRF	2/10/97	1	Classroom	101	Cabinet	Inside	Solid	Wood	0.22
1954 bldg.	40	XRF	2/10/97	1	Classroom	101	Cabinet	Shelf	Solid	Wood	0.4
1954 bldg.	41	XRF	2/10/97	1	Classroom	101	Bookcase	Shelf	Cracked	Wood	0
1954 bldg.	42	XRF	2/10/97	1	Classroom	101	Bookcase	Wall Rgstr	Solid	Metal	0.02
1954 bldg.	43	XRF	2/10/97	1	Classroom	101		Univent	Solid	Metal	0.02
1954 bldg.	44	XRF	2/10/97	1	Classroom	101	Bulletin Board	Midle Wall	Solid	Metal	0.02
1954 bldg.	45	XRF	2/10/97	1	Classroom	101	Cabinet	Door	Solid	Metal	0.14
1954 bldg.	46	XRF	2/10/97	1	Hall	2	Wall	Midle Wall	Solid	Tile	2.88
1954 bldg.	47	XRF	2/10/97	1	Hall	2	Wall	Midle Wall	Solid	Tile	0.8
1954 bldg.	48	XRF	2/10/97	1	Hall	2	Door	Door	Solid	Wood	0.04
1954 bldg.	49	XRF	2/10/97	1	Hall	2	Door	Jamb	Solid	Metal	0.08
1954 bldg.	50	XRF	2/10/97	1	Hall	2	Wall	Wall Rgstr	Solid	Metal	0.02
1954 bldg.	51	XRF	2/10/97	1	Hall	2	Coat Rack		Solid	Wood	0
1954 bldg.	52	XRF	2/10/97	1	Hall	2	Boot Rack		Solid	Wood	0
1924 bldg.	53	XRF	2/10/97	0	Hall	2	Wall	Wall	Solid	Plaster	0.16
1924 bldg.	54	XRF	2/10/97	0	Hall	2	Wall	Midle Wall	Cracked	Plaster	0.32
1924 bldg.	55	XRF	2/10/97	0	Hall	2	Wall	Midle Wall	Cracked		0.31

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1924 bldg.	56	XRF	2/10/97	0	Hall	2	Wall	Wall	Cracked	Plaster	0.45
1924 bldg.	57	XRF	2/10/97	0	Hall	2	Wall	Midle Wall	Cracked	Plaster	0.26
1924 bldg.	58	XRF	2/10/97	0	Hall	2	Door	Door	Cracked	Wood	0.02
1924 bldg.	59	XRF	2/10/97	0	Hall	2	Door	Casing	Cracked	Wood	0.02
1924 bldg.	60	XRF	2/10/97	0	Hall	2	Window	Casing	Cracked	Wood	0.07
1924 bldg.	61	XRF	2/10/97	0	Hall	2		Radiator	Cracked	Metal	5.09
1924 bldg.	62	XRF	2/10/97	0	Hall	2	Wall	Baseboard	Solid	Wood	0.02
1924 bldg.	63	XRF	2/10/97	1	Room	4	Cabinet	Door	Cracked	Wood	0.03
1924 bldg.	65	XRF	2/10/97	1	Room	4	Cabinet	Inside	Solid	Wood	0.04
1924 bldg.	66	XRF	2/10/97	1	Room	4	Cabinet	Shelf	Solid	Wood	0.02
1924 bldg.	67	XRF	2/10/97	1	Room	4	Bulletin Board		Solid	Wood	0.03
1924 bldg.	68	XRF	2/10/97	1	Room	4	Wall	Radiator	Cracked	Metal	5.09
1924 bldg.	69	XRF	2/10/97	1	Room	4	Wall	Baseboard	Solid	Wood	0.05
1924 bldg.	70	XRF	2/10/97	1	Room	4	Bookcase	Shelf	Solid	Wood	0.01
1924 bldg.	71	XRF	2/10/97	1	Room	4	Closet	Wall	Peeling	Plaster	5.09
1924 bldg.	72	XRF	2/10/97	1	Room	4	Closet	Floor	Solid	Wood	0
1924 bldg.	73	XRF	2/10/97	1	Room	4	Closet	Wire Tray	Solid	Metal	0.01
1924 bldg.	74	XRF	2/10/97	1	Room	4	Ceiling	Grid	Solid	Wood	0.3
1924 bldg.	75	XRF	2/10/97	1	Room	4	Wall	Crown mold	Solid	Wood	0.06
1924 bldg.	76	XRF	2/10/97	1	Room	4	Ceiling		Cracked	Plaster	0.44
1924 bldg.	77	XRF	2/10/97	1	Room	5	Wall	Wall	Cracked	Plaster	5.09
1924 bldg.	78	XRF	2/10/97	1	Room	5	Wall	Midle Wall	Cracked	Plaster	0.19
1924 bldg.	79	XRF	2/10/97	1	Room	5	Wall	Wall	Cracked	Plaster	0.13
1924 bldg.	80	XRF	2/10/97	1	Room	5	Ceiling	Grid	Solid	Wood	0
1924 bldg.	81	XRF	2/10/97	1	Room	5	Door	Door	Solid	Wood	0.02
1924 bldg.	82	XRF	2/10/97	1	Room	5	Door	Casing	Solid	Wood	0.01
1924 bldg.	83	XRF	2/10/97	1	Room	5	Wall	Baseboard	Solid	Wood	0.09
1924 bldg.	84	XRF	2/10/97	1	Room	5	Window	Casing	Solid	Wood	0.1
1924 bldg.	85	XRF	2/10/97	1	Room	5	Bookcase	Shelf	Solid	Wood	0.01
1924 bldg.	86	XRF	2/10/97	1	Room	5		Radiator	Cracked	Metal	5.09
1924 bldg.	87	XRF	2/10/97	1	Room	5	Radiator	Protector	Solid	Wood	0
1924 bldg.	88	XRF	2/10/97	1	Room	5	Bulletin Board		Solid	Wood	0
1924 bldg.	89	XRF	2/10/97	1	Room	5	Ceiling		Cracked	Plaster	0.25
1924 bldg.	90	XRF	2/10/97	1	Room	5	Wall	Wall Rgstr	Solid	Metal	0.22
1924 bldg.	91	XRF	2/10/97	1	Room	5	Wall	Crown mold	Solid	Wood	0.04
1924 bldg.	92	XRF	2/10/97	1	Room	6	Wall	Wall	Cracked	Plaster	5.09
1924 bldg.	93	XRF	2/10/97	1	Room	6	Wall	Wall	Cracked	Plaster	0.33
1924 bldg.	94	XRF	2/10/97	1	Room	6	Door	Door	Solid	Wood	0.05
1924 bldg.	95	XRF	2/10/97	1	Room	6	Window	Casing	Solid	Wood	0.08
1924 bldg.	96	XRF	2/10/97	1	Room	6		Radiator	Cracked	Metal	3.47
1924 bldg.	97	XRF	2/10/97	1	Room	6	Wall	Baseboard	Solid	Wood	0.08
1924 bldg.	98	XRF	2/10/97	1	Room	6	Cabinet	Door	Solid	Wood	0.02
1924 bldg.	99	XRF	2/10/97	1	Room	6	Cabinet	Inside	Solid	Wood	0.06
1924 bldg.	100	XRF	2/10/97	1	Room	6	Cabinet	Shelf	Cracked	Wood	0.02
1924 bldg.	101	XRF	2/10/97	1	Room	6	Ceiling		Cracked	Plaster	0.31
1924 bldg.	102	XRF	2/10/97	1	Kitchen	0	Door	Casing	Cracked	Wood	0.04
1924 bldg.	102	XRF	2/10/97	1	Room	7	Wall	Midle Wall	Cracked	Plaster	0.25
1924 bldg.	103	XRF	2/10/97	1	Kitchen	0	Window	Casing	Solid	Wood	0.09
1924 bldg.	103	XRF	2/10/97	1	Room	7	Door	Door	Solid	Metal	0.43
1924 bldg.	104	XRF	2/10/97	1	Kitchen	0	Wall	Baseboard	Cracked	Plaster	0.05
1924 bldg.	104	XRF	2/10/97	1	Room	7	Door	Casing	Cracked	Metal	0.22
1924 bldg.	105	XRF	2/10/97	1	Kitchen	0	Ceiling		Peeling	Plaster	1.17
1924 bldg.	105	XRF	2/10/97	1	Room	7	Stairs	Hand rail	Cracked	Metal	1.63
1924 bldg.	106	XRF	2/10/97	1	Kitchen	0	Cooling Rack		Solid	Wood	0.03
1924 bldg.	106	XRF	2/10/97	1	Room	7	Stairs	Tread	Peeling	Concrete	0.84
1924 bldg.	107	XRF	2/10/97	1	Kitchen	0		Elec Panel	Solid	Metal	0.2
1924 bldg.	107	XRF	2/10/97	1	Room	7		Wire Tray	Solid	Metal	0.01
1924 bldg.	108	XRF	2/10/97	1	Kitchen	0		Elec Panel	Solid	Metal	0.01
1924 bldg.	108	XRF	2/10/97	1	Room	7	Mounting Bracket	Wall	Solid	Wood	0
1924 bldg.	109	XRF	2/10/97	1	Lunch Area	0	Wall	Midle Wall	Solid	Tile	0.11
1924 bldg.	109	XRF	2/10/97	1	Hall	3	Wall	Wall	Cracked	Plaster	5.09
1924 bldg.	110	XRF	2/10/97	1	Lunch Area	0		Radiator	Solid	Metal	0.28
1924 bldg.	110	XRF	2/10/97	1	Hall	3	Wall	Wall	Cracked	Plaster	0.26
1924 bldg.	111	XRF	2/10/97	1	Lunch Area	0	Window	Casing	Solid	Wood	0.15
1924 bldg.	111	XRF	2/10/97	1	Hall	3	Wall	Elec Panel	Solid	Metal	0.01
1924 bldg.	112	XRF	2/10/97	1	Lunch Area	0	Door	Door	Solid	Wood	0
1924 bldg.	112	XRF	2/10/97	1	Hall	3	Wall	Chair rail	Solid	Wood	0.05
1924 bldg.	113	XRF	2/10/97	1	Hall	3	Wall	Baseboard	Cracked	Plaster	0.16

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1924 bldg.	114	XRF	2/10/97	1	Lunch Area	0	Door	Casing	Cracked	Wood	0.01
1924 bldg.	114	XRF	2/10/97	1	Hall	3	Door	Door	Solid	Wood	0
1924 bldg.	115	XRF	2/10/97	1	Lunch Area	0	Door	Door	Cracked	Wood	0.04
1924 bldg.	115	XRF	2/10/97	1	Hall	3	Door	Casing	Solid	Wood	0
1924 bldg.	116	XRF	2/10/97	1	Lunch Area	0	Door	Door	Solid	Wood	0.01
1924 bldg.	116	XRF	2/10/97	1	Hall	3	Closet	Wall	Cracked		5.09
1924 bldg.	117	XRF	2/10/97	1	Lunch Area	0	Door	Casing	Cracked	Metal	0.07
1924 bldg.	117	XRF	2/10/97	1	Hall	3	Closet	Coat Rack	Solid	Wood	0.04
1924 bldg.	118	XRF	2/10/97	1	Lunch Area	0	Pipe	Guard	Cracked	Metal	0.05
1924 bldg.	118	XRF	2/10/97	1	Hall	3	Ceiling	Wall	Cracked	Plaster	0.18
1924 bldg.	119	XRF	2/10/97	1	Hall	3	Ceiling	Hatch	Solid	Wood	0.02
1924 bldg.	119	XRF	2/10/97	1	Room	8	Wall	Midle Wall	Cracked	Plaster	0.7
1924 bldg.	120	XRF	2/10/97	1	Stairwell	2	Stairs	Wall	Cracked	Plaster	5.09
1924 bldg.	120	XRF	2/10/97	1	Room	8	Door	Door	Solid	Wood	0.02
1924 bldg.	121	XRF	2/10/97	1	Stairwell	2	Stairs	Wall	Cracked	Plaster	0.92
1924 bldg.	121	XRF	2/10/97	1	Room	8	Cabinet	Door	Solid	Wood	0.01
1924 bldg.	122	XRF	2/10/97	1	Stairwell	2	Stairs	Hand rail	Solid	Wood	0
1924 bldg.	122	XRF	2/10/97	1	Room	8	Cabinet	Inside	Solid	Wood	0.62
1924 bldg.	123	XRF	2/10/97	1	Stairwell	2	Wall	Chair rail	Solid	Wood	0.03
1924 bldg.	123	XRF	2/10/97	1	Room	8	Cabinet	Shelf	Solid	Wood	0.72
1924 bldg.	124	XRF	2/10/97	1	Stairwell	2	Stairs	Baseboard	Solid	Plaster	0.14
1924 bldg.	124	XRF	2/10/97	1	Room	8	Wall	Baseboard	Cracked	Wood	0.05
1924 bldg.	125	XRF	2/10/97	1	Stairwell	2	Door	Door	Cracked	Wood	0.03
1924 bldg.	125	XRF	2/10/97	1	Room	8	Wall	Elec Panel	Solid	Metal	0.02
1924 bldg.	126	XRF	2/10/97	0	Room	8	Ceiling		Cracked	Plaster	0.04
1924 bldg.	126	XRF	2/10/97	1	Stairwell	2	Door	Casing	Cracked	Wood	0.03
1924 bldg.	127	XRF	2/10/97	0	Restroom	6	Wall	Wall	Solid	Tile	2.65
1924 bldg.	127	XRF	2/10/97	1	Kitchen	1	Wall	Wall	Cracked	Plaster	0.33
1924 bldg.	128	XRF	2/10/97	0	Restroom	6	Door	Door	Solid	Wood	0
1924 bldg.	128	XRF	2/10/97	1	Kitchen	1	Wall	Wall	Solid	Plaster	0.37
1924 bldg.	129	XRF	2/10/97	0	Restroom	6	Door	Casing	Solid	Wood	0.06
1924 bldg.	129	XRF	2/10/97	1	Kitchen	1	Door	Serving	Solid	Wood	0.01
1924 bldg.	130	XRF	2/10/97	0	Restroom	6	Door	Door	Solid	Wood	0
1924 bldg.	130	XRF	2/10/97	1	Kitchen	1	Door	Casing	Solid		0.02
1924 bldg.	131	XRF	2/10/97	0	Restroom	6	Door	Casing	Solid	Metal	0.03
1924 bldg.	131	XRF	2/10/97	1	Kitchen	0	Door	Door	Cracked	Wood	0.03
1924 bldg.	132	XRF	2/10/97	0	Restroom	6		Bthrm Stll	Solid	Metal	0.1
1924 bldg.	133	XRF	2/10/97	0	Restroom	6	Wall	Wall Rgstr	Solid	Metal	0.06
1924 bldg.	134	XRF	2/10/97	0	Restroom	7	Wall	Midle Wall	Solid	Tile	2.76
1924 bldg.	135	XRF	2/10/97	0	Restroom	7	Door	Door	Solid	Wood	0
1924 bldg.	136	XRF	2/10/97	0	Restroom	7	Door	Casing	Cracked	Metal	0.02
1924 bldg.	137	XRF	2/10/97	0	Restroom	7		Bthrm Stll	Solid	Metal	0.07
1924 bldg.	138	XRF	2/10/97	0	Restroom	7	Wall	Wall Rgstr	Solid	Metal	0.06
1924 bldg.	139	XRF	2/10/97	0	Restroom	7	Ceiling	Radiator	Solid	Metal	4.47
1924 bldg.	140	XRF	2/10/97	0	Restroom	7	Ceiling	Radiator	Solid	Metal	5.09
1954 bldg.	141	XRF	2/10/97	0	Hall	3	Wall	Midle Wall	Solid	Tile	0.98
1954 bldg.	142	XRF	2/10/97	0	Hall	3	Door	Door	Solid	Wood	0.9
1954 bldg.	143	XRF	2/10/97	0	Hall	3	Door	Jamb	Solid	Metal	0.02
1954 bldg.	144	XRF	2/10/97	0	Hall	3	Door	Door	Solid	Wood	0
1954 bldg.	145	XRF	2/10/97	0	Hall	3	Door	Casing	Cracked	Metal	0.03
1954 bldg.	146	XRF	2/10/97	0	Hall	3		Radiator	Solid	Metal	0.14
1954 bldg.	147	XRF	2/10/97	0	Hall	3	Door	Door	Cracked	Wood	0.69
1954 bldg.	148	XRF	2/10/97	0	Hall	3	Door	Jamb	Cracked	Metal	0.11
1954 bldg.	149	XRF	2/10/97	0	Hall	3		Radiator	Cracked	Metal	0.28
1954 bldg.	150	XRF	2/10/97	0	Hall	3	Door	Door	Cracked	Wood	0
1954 bldg.	151	XRF	2/10/97	0	Hall	3	Door	Casing	Solid	Metal	0.12
1954 bldg.	152	XRF	2/10/97	0	Hall	3	Coat Rack		Solid	Wood	0
1954 bldg.	153	XRF	2/10/97	0	Hall	3	Ceiling		Cracked	Plaster	0.01
1954 bldg.	154	XRF	2/10/97	0	Hall	3	Ceiling	Hatch	Solid	Metal	0
1954 bldg.	155	XRF	2/10/97	0	Room	1	Wall	Midle Wall	Solid	Concrete	0.03
1954 bldg.	156	XRF	2/10/97	0	Room	1	Door	Door	Solid	Wood	0
1954 bldg.	157	XRF	2/10/97	0	Room	1	Door	Casing	Solid	Metal	0.06
1954 bldg.	158	XRF	2/10/97	0	Room	1		Radiator	Solid	Metal	0.02
1954 bldg.	159	XRF	2/10/97	0	Room	1	Wall	Baseboard	Solid	Wood	0.01
1954 bldg.	160	XRF	2/10/97	0	Room	1	Wall	Wall Rgstr	Solid	Metal	0.03
1954 bldg.	161	XRF	2/10/97	0	Room	1	Ceiling		Cracked	Plaster	0.05
1954 bldg.	162	XRF	2/10/97	0	Room	1	Ceiling	Hatch	Solid	Metal	0.03
1954 bldg.	163	XRF	2/10/97	0	Room	2	Wall	Midle Wall	Solid	Concrete	0.1

Saint Paul Public Schools  
 Ames Elementary School  
 Lead-Based Paint Inspection

1954 bldg.	164	XRF	2/10/97	0	Room	2	Door	Door	Cracked	Wood	0
1954 bldg.	165	XRF	2/10/97	0	Room	2	Door	Casing	Cracked	Metal	0.07
1954 bldg.	166	XRF	2/10/97	0	Room	2	Stairs	Rail cap	Solid	Wood	0.01
1954 bldg.	167	XRF	2/10/97	0	Room	2	Stairs	Hand rail	Solid	Wood	0.01
1954 bldg.	168	XRF	2/10/97	0	Room	2	Stairs	Tread	Solid	Wood	0
1954 bldg.	169	XRF	2/10/97	0	Room	2	Wall	Baseboard	Solid	Wood	0.03
1954 bldg.	170	XRF	2/10/97	0	Room	2		Radiator	Solid	Metal	0.02
1954 bldg.	171	XRF	2/10/97	0	Room	2	Ceiling		Solid	Concrete	0.05
1954 bldg.	172	XRF	2/10/97	0	Stage	1	Wall	Midle Wall	Solid	Concrete	0.33
1954 bldg.	173	XRF	2/10/97	0	Stage	1	Wall	Midle Wall	Solid	Concrete	0.06
1954 bldg.	174	XRF	2/10/97	0	Stage	1	Wall	Baseboard	Solid	Wood	0.03
1954 bldg.	175	XRF	2/10/97	0	Stage	1	Floor		Solid	Wood	0
1954 bldg.	176	XRF	2/10/97	0	Stage	1	Door	Door	Solid	Wood	0.01
1954 bldg.	177	XRF	2/10/97	0	Stage	1	Door	Casing	Solid	Metal	0.07
1954 bldg.	178	XRF	2/10/97	0	Stage	1		Elec Panel	Solid	Metal	0.01
1954 bldg.	179	XRF	2/10/97	0	Stage	1	Ceiling		Solid	Plaster	0.11
1954 bldg.	180	XRF	2/10/97	0	Stage	1	Stairs	Tread	Solid	Wood	0.01
1954 bldg.	181	XRF	2/10/97	0	Gym	1	Wall	Wall	Solid	Tile	0.11
1954 bldg.	182	XRF	2/10/97	0	Gym	1	Wall	Wall	Solid	Concrete	0.01
1954 bldg.	183	XRF	2/10/97	0	Gym	1		Backboard	Solid	Metal	0
1954 bldg.	184	XRF	2/10/97	0	Gym	1	Ceiling		Solid	Concrete	0.05
1954 bldg.	185	XRF	2/10/97	0	Gym	1	Door	Door	Solid	Wood	0
1954 bldg.	186	XRF	2/10/97	0	Gym	1	Door	Casing	Solid	Metal	0.11
1954 bldg.	187	XRF	2/10/97	0	Gym	1	Wall	Wall Rgstr	Solid	Metal	0.01
1954 bldg.	188	XRF	2/10/97	0	Gym	1	Wall	Wall	Solid	Concrete	0.05
1954 bldg.	189	XRF	2/10/97	0	Stairwell	1	Door	Door	Solid	Wood	0
1954 bldg.	190	XRF	2/10/97	0	Stairwell	1	Door	Jamb	Cracked	Metal	0.13
1954 bldg.	191	XRF	2/10/97	0	Stairwell	1		Radiator	Solid	Metal	0.2