


Midwest
Environmental
Consulting, L.L.C.

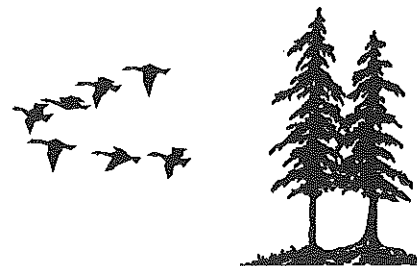

♻️ Printed on Recycled Paper

**Randolph Heights Elementary
Saint Paul Public Schools**

Lead-Based Paint Inspection

Inspection Dates: 4/8/97, 4/9/97, 4/15/97, 4/17/97, 4/19/97

submitted to:

Saint Paul Public Schools

MEC Project # 62/0197W

38894 Llama Street NW * Dalbo, Minnesota 55017 * (612) 689-3612
fax (612) 689-5209

INTRODUCTION

At the request of Saint Paul Public Schools Environmental Safety Department, Midwest Environmental Consulting, L.L.C. (MEC), conducted a lead-based paint inspection at Randolph Heights Elementary, 348 Hamline Ave. So., St. Paul, MN. The purpose of this inspection was to identify lead-based painted, varnished, or otherwise coated building components on the interior and exterior of the school building.

The inspection protocol incorporated applicable portions of the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-based Paint Hazards in Housing* (HUD Guidelines, June 1995) and OSHA 1926.62 requirements (Lead in Construction). The HUD guidelines are formulated to guide agencies in conducting random sampling of the interiors and exteriors of dwellings and common areas in public housing. The OSHA requirement is designed to minimize worker exposure when working with material containing lead.

Confirmatory testing was conducted when inconclusive XRF results were encountered. Inconclusive refers to XRF readings less than 0.2 mg/cm² (milligrams per square centimeter). Inconclusive results were confirmed with laboratory analysis of paint chip samples (Appendix B). This report contains a list of such results.

The United States Environmental Protection Agency defines "lead-based paint" as a paint or other surface coating that contains lead equal to or in excess of 1.0 milligrams per square centimeter when analyzed by XRF or more than 0.5% by weight (5000 parts per million) by laboratory analysis of a bulk sample.

Minnesota Department of Labor and Industry (MN OSHA) adopted the EPA lead levels for the purpose of enforcing OSHA 1926.62 federal regulations. Detection of lead in dried paint film by XRF is a dependable indicator of levels of lead and is accepted by MN OSHA.

For this Saint Paul Public Schools Lead Inspection, all building components were tested on site using a Niton XL® X-ray Fluorescence Spectrum Analyzer⁽¹⁾. Building components included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases. Only painted or glazed surfaces or surfaces which were varnished were tested. Suspended ceilings, structural steel, and corrugated decking were not included in the inspection. Neither anodized (e.g., window sashes) nor plastic (e.g., vinyl baseboard and vinyl mini-blinds) were included in the scope of this inspection.

⁽¹⁾ This is a portable hand held machine that can analyze building components instantly for lead concentrations.

Each building was divided into unique sites based on the year of construction or renovation. Portable classrooms, playgrounds, and other detached buildings were automatically designated as a unique site. Each site was inspected independently assuming differences in painting history and construction characteristics.

SITE DESCRIPTION AND BUILDING HISTORY

According to information provided to MEC by Saint Paul Public Schools, Randolph Heights Elementary was constructed in essentially three phases. The initial phase, site 1, includes the 24,802 square-foot older section of the building and dates from 1916. The second phase is a 11,998 square foot addition dating from 1921. Phase three is a 11,698 square foot addition dating from 1923. Because of the ages of this second and third phases, they were designated as site 2 for the purpose of this inspection.

All room and area designations used in this report are depicted on sampling maps found in Appendix A.

XRF SAMPLE RESULTS TABLE

The results of all samples analyzed are listed in the table at the end of this section. The following is a description of the column headings:

Site	Each school is divided into sites based on their unique construction characteristics. Each site has a unique date of construction or major renovation.
Sample #	Each sample taken was given a unique number to identify the type and location of the sample. The sampling date is an integral part of the sample number.
Analysis	This defines the type of analysis which can be categorized into two types: 1) XRF: This is an on-site analysis using a hand held Niton XL® X-ray Fluorescence Spectrum Analyzer; 2) Bulk or Chip: This is a bulk sample where paint is removed from the substrate and sent to a laboratory for analysis;
Floor	This is the level of the building in which the area tested was found, example, 1 (first floor), 0 (basement), etc.

- Area** This further defines the specific functional space inspected such as a classroom, exterior, playground, gym, kitchen, etc.
- Room #** This is typically the actual number on the room as identified at the building.
- Component** Building "components" included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases.
- Feature** Identifies more detailed information of the component.
- Condition** This describes condition of the surface, whether it is intact, cracked, peeling, or chalking.
- Substrate** This refers to the material the building component is made of (wood, concrete, drywall, metal, etc.).
- Result** This is the analysis results for lead. Less than 1.0 mg/cm² or less than 0.5% by weight is considered to be non-lead and these building components are below the action levels of EPA and HUD. (All results are in mg/cm² except where noted.)

The table of results is designed for quick information on lead concentrations of tested building components. Generally, all repetitions of a test combination within a given room or area, may be assumed to contain similar concentrations of lead to that of the tested sample. For instance, the lead concentration of a tested wooden window sash was found to be above the action level of 1.0 mg/cm² in a given classroom. The classroom has five windows, all of wood, the same color and appearing to be of the same era. It can be assumed that the remaining four wooden window sashes each contain lead above the action limit.

Other columns identify the component and the component feature tested, condition of the component, type of substrate and the result of the analytical test.

As an example, the following illustration shows that the wooden door jamb in Room 123, first floor in the 1923 building section was in good, solid condition, and had an XRF test result of 0.3 mg/cm², which is below the action level.

Illustration Only

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1923 Bldg.	52		XRF	1	Room	123	Door	Jamb	Solid	Wood	0.3

In a similar manner, the table shows that the plaster walls in room 23, on the second floor has peeling paint with more than 1.0 mg/cm² (shaded).

ILLUSTRATION ONLY

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1910 Bldg.	16		XRF	2	Room	23	Door	Jamb	Peeling	Wood	0.25
1910 Bldg.	17		XRF	2	Room	23	Wall	Wall	Peeling	Plaster	1.2
1910 Bldg.	18		XRF	2	Room	23		Ceiling	Peeling	Plaster	0.25
1910 Bldg.	19		XRF	2	Room	23	Wall	Baseboard	Peeling	Wood	0.002

APPLICABLE REGULATIONS

When building components test above 1.0 mg/cm² of lead by XRF or 0.5% lead by weight from laboratory analysis all employees and contractors who will be working with these components in a construction related activity must be notified. The requirements of OSHA 1926.62, Lead in Construction are enforceable. This regulation defines construction work as "work for construction, alteration and/or repair, including painting and decorating." This regulation further defines monitoring requirements to minimize employee exposure to lead during construction activities.

When work is performed on external painted building structures (i.e. flashing, fire escapes, playground equipment, handrails, etc.), regulations of the Minnesota Pollution Control Agency (MPCA) may also be applicable. For removal of lead based paint from steel structures, MN Rules 7025.0200 - 7025.0380 apply to steel materials on the exterior of a building, or on the property when levels exceed 0.5 mg/cm² based on the average of three XRF spectrum results of the sample tested, or 5,000 ppm by laboratory analysis. If it is other than a steel surface, then MPCA regulates the painted surfaces under MN Rules 7025.010 - 7025.0080, when surfaces are to be disturbed using abrasive blasting methods.

Please contact MEC directly if you have questions about any portion of this report or the lead-based paint inspection itself.

APPENDIX A


**XRF TESTING DATA
WITH
LOCATION MAPS**


SUMMARY 29.71
PAGE 11.000

11.000

77.7

19.2

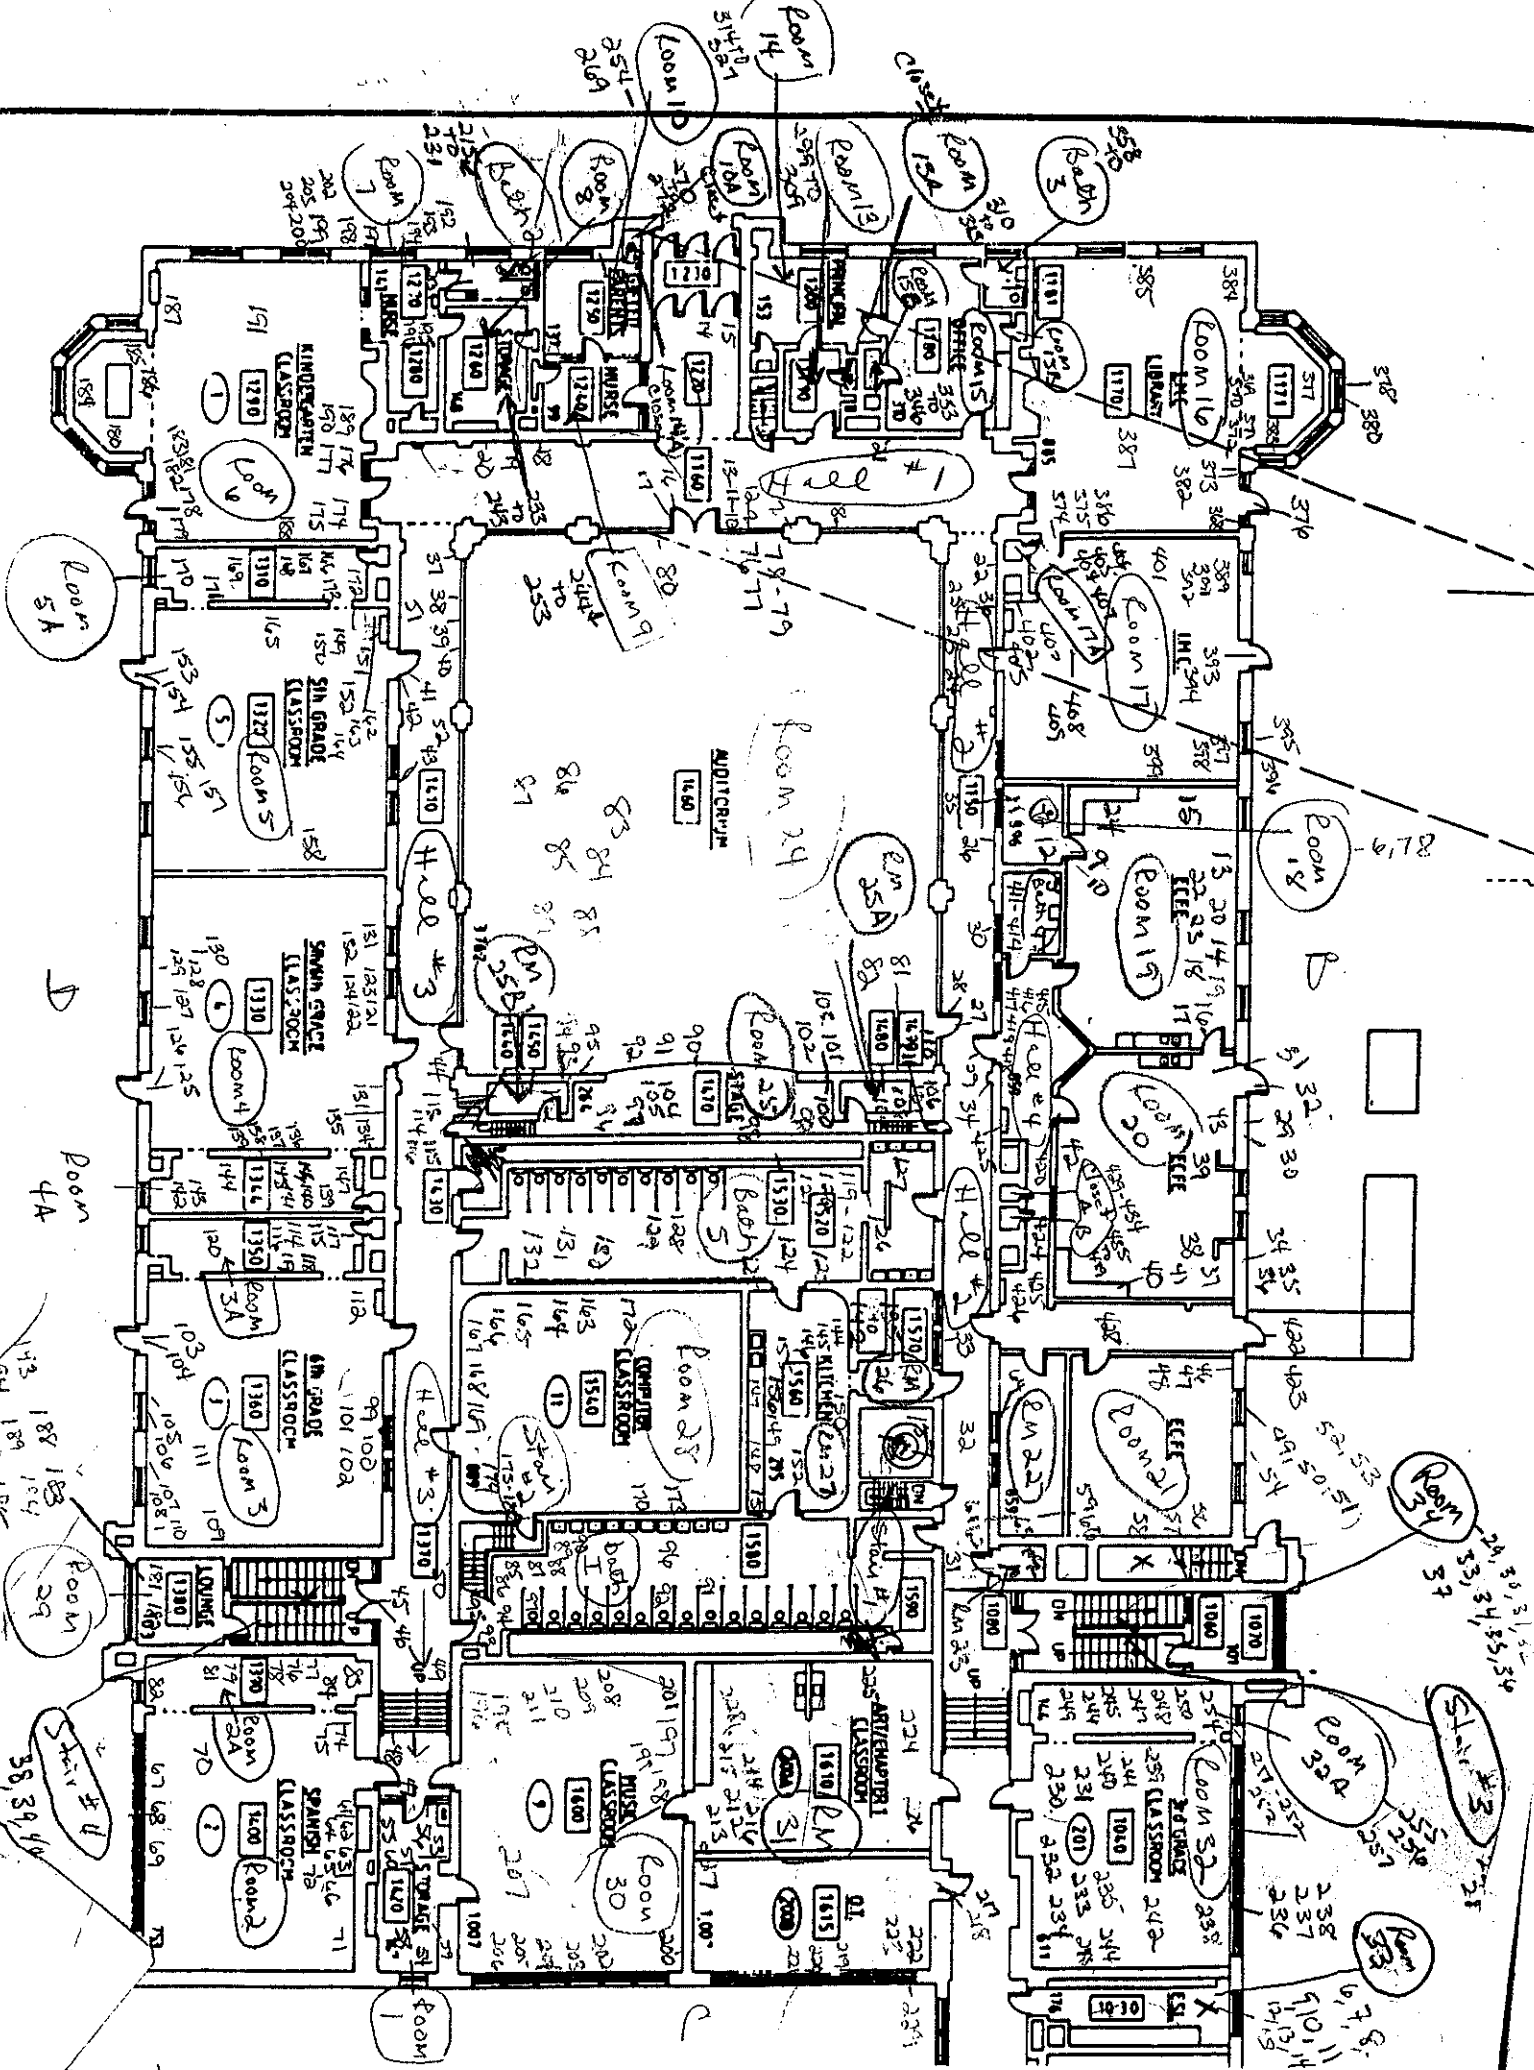

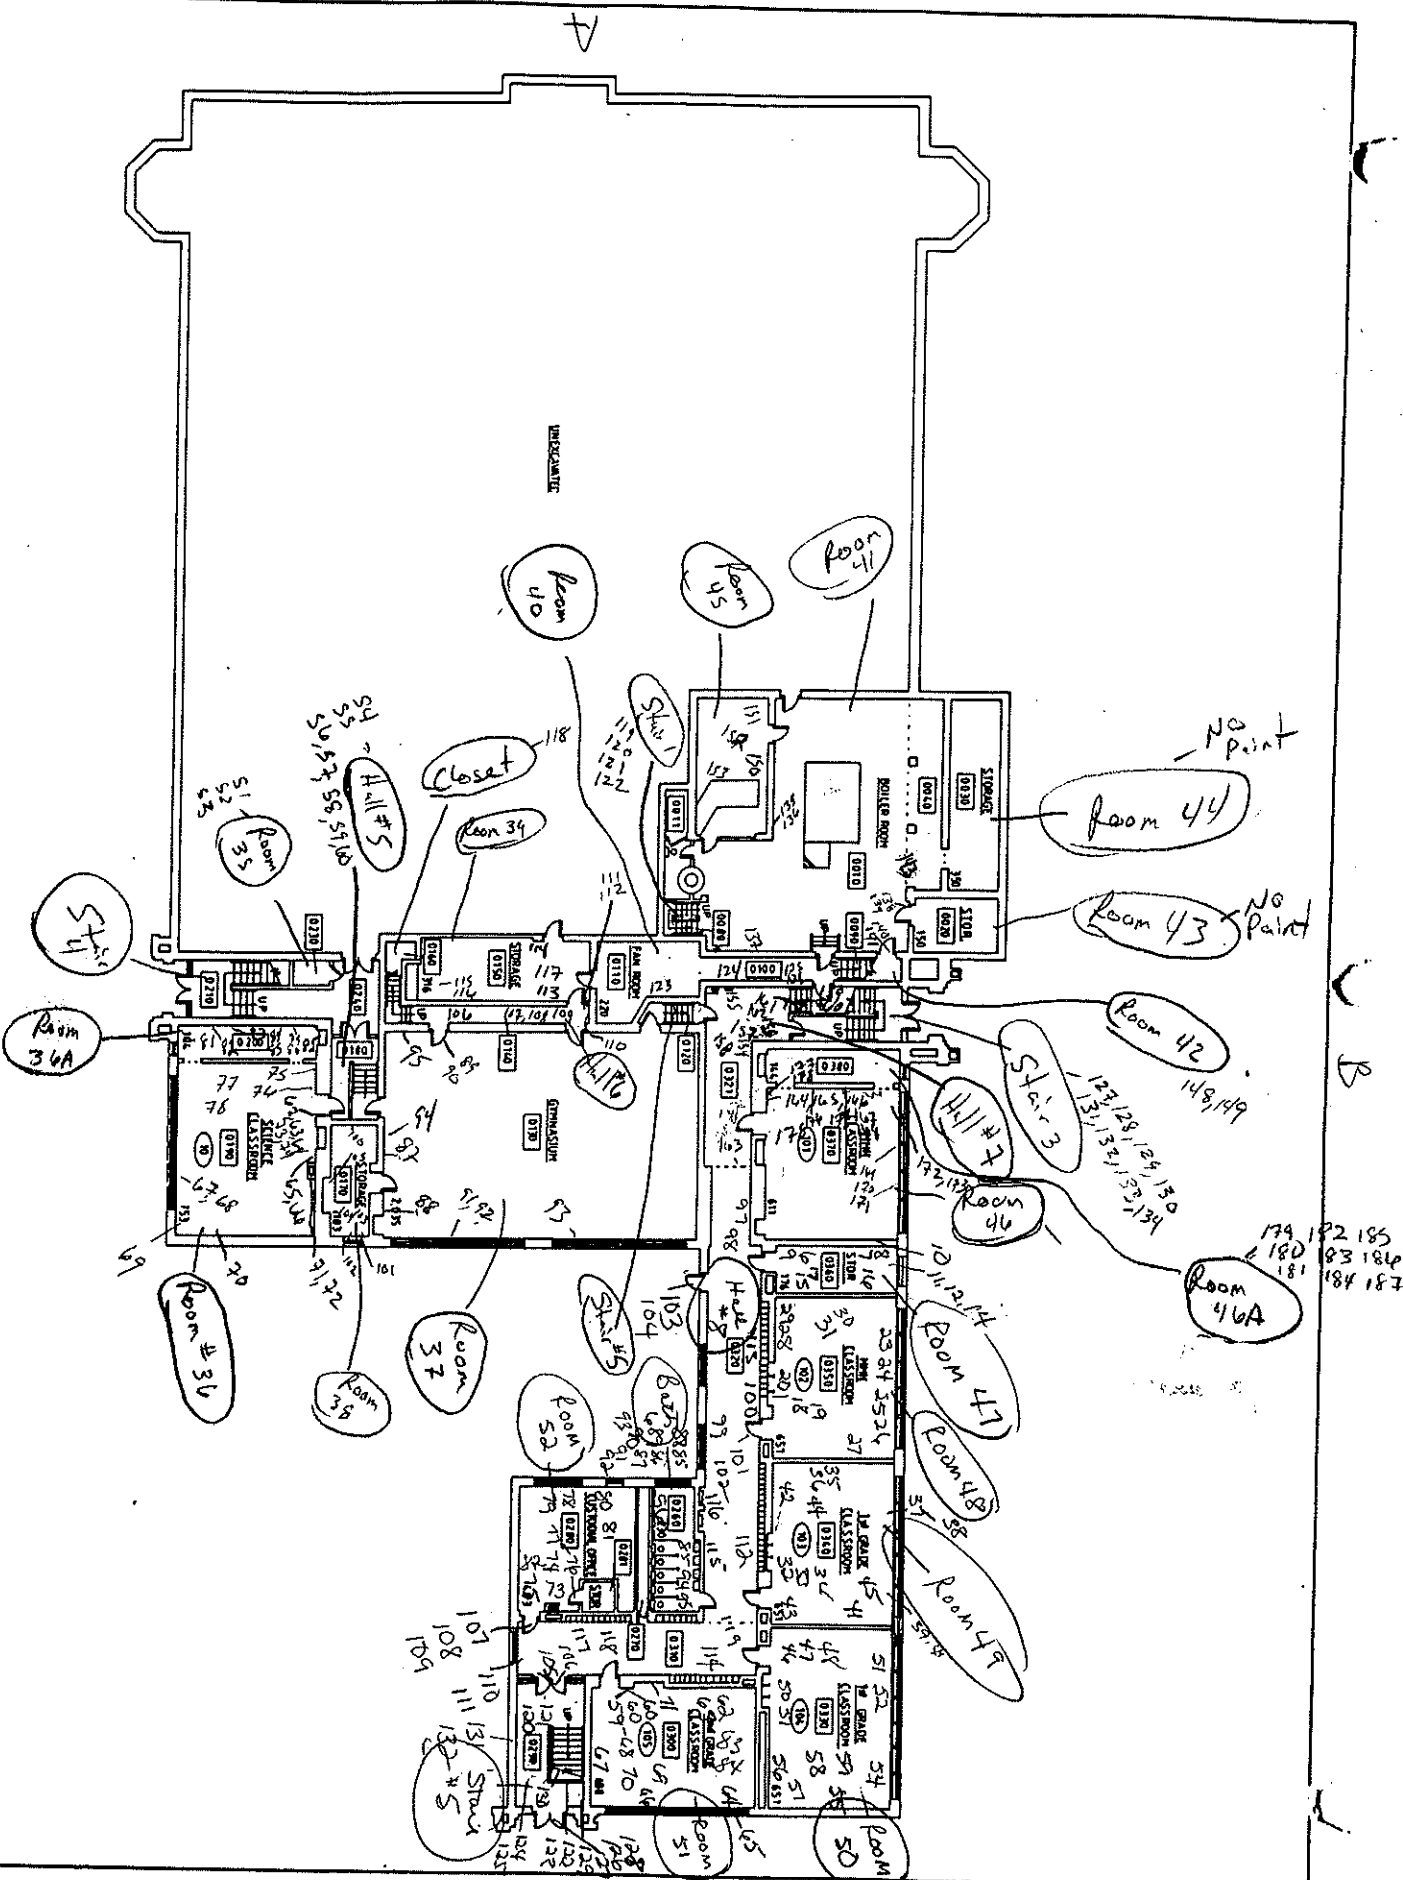


INDEPENDENT SCHOOL DIST. *625
360 COLBORNE STREET
ST. PAUL, MINNESOTA 55102

RANDOLPH HEIGHTS ELEMENTARY
348 HAMLINE AVE. S
ST. PAUL, MINNESOTA

CONSTRUCTED: 1916, 21, 23

9617
2
4

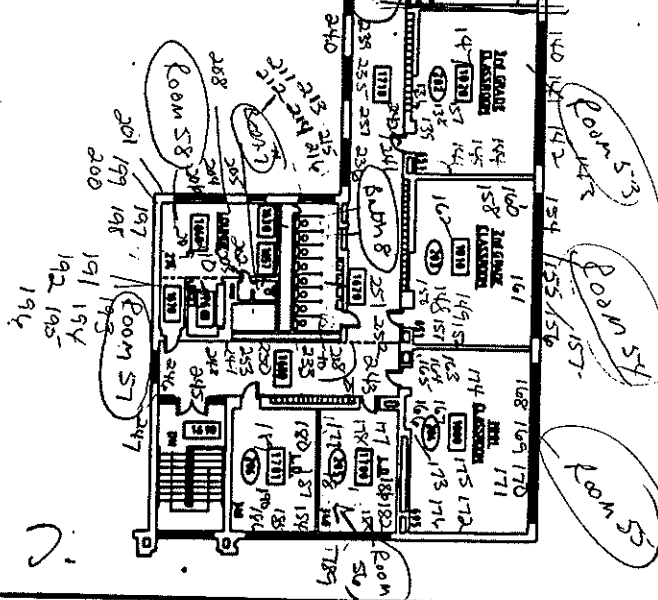

FIRST FLOOR PLAN



INDEPENDENT SCHOOL DIST. #625
380 COLBORNE STREET
ST. PAUL, MINNESOTA 55102

RANDOLPH HEIGHTS ELEMENTARY
348 HAMLINE AVE. S.
ST. PAUL, MINNESOTA

CONSTRUCTED: 1916, 21, 23

3

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1	Randolph Heights Elementary											
2												
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
4	1916 Bldg.	215	XRF	4/9/97	1	Bath	2	Wall	Wall	Solid	Plaster	5.09
5	1916 Bldg.	216	XRF	4/9/97	1	Bath	2	Wall	Wall	Solid	Tile	5.09
6	1916 Bldg.	217	XRF	4/9/97	1	Bath	2	Wall	Baseboard	Solid	Tile	2.85
7	1916 Bldg.	218	XRF	4/9/97	1	Bath	2	Door	Door	Solid	Wood	0.03
8	1916 Bldg.	219	XRF	4/9/97	1	Bath	2	Door	Jamb	Solid	Wood	0.02
9	1916 Bldg.	220	XRF	4/9/97	1	Bath	2	Window	Stool	Solid	Wood	2.38
10	1916 Bldg.	221	XRF	4/9/97	1	Bath	2	Window	Casing	Solid	Wood	0.23
11	1916 Bldg.	222	XRF	4/9/97	1	Bath	2	Window	Sash	Solid	Wood	0.04
12	1916 Bldg.	223	XRF	4/9/97	1	Bath	2	Window	Casing	Solid	Wood	0.38
13	1916 Bldg.	224	XRF	4/9/97	1	Bath	2	Wall	Chair rail	Solid	Wood	0.06
14	1916 Bldg.	225	XRF	4/9/97	1	Bath	2		Radiator	Solid	Metal	5.09
15	1916 Bldg.	226	XRF	4/9/97	1	Bath	2	Radiator	Board	Solid	Wood	0
16	1916 Bldg.	227	XRF	4/9/97	1	Bath	2		Stall Door	Solid	Wood	0.05
17	1916 Bldg.	228	XRF	4/9/97	1	Bath	2	Floor		Solid	Concrcte	0.02
18	1916 Bldg.	229	XRF	4/9/97	1	Bath	2	Wall	Wall Rgstr	Cracked	Metal	0.09
19	1916 Bldg.	230	XRF	4/9/97	1	Bath	2	Cabinet	Shelf	Solid	Wood	0.34
20	1916 Bldg.	231	XRF	4/9/97	1	Bath	2	Ceiling		Solid	Plaster	5.09
21	1916 Bldg.	358	XRF	4/9/97	1	Bath	3	Wall	Wall	Solid	Plaster	3.19
22	1916 Bldg.	359	XRF	4/9/97	1	Bath	3	Wall	Wall	Solid	Tile	5.09
23	1916 Bldg.	360	XRF	4/9/97	1	Bath	3	Window	Stool	Solid	Wood	4.13
24	1916 Bldg.	361	XRF	4/9/97	1	Bath	3	Window	Casing	Solid	Wood	0.16
25	1916 Bldg.	362	XRF	4/9/97	1	Bath	3		Radiator	Cracked	Metal	0.01
26	1916 Bldg.	363	XRF	4/9/97	1	Bath	3	Wall	Stall Door	Solid	Wood	0.08
27	1916 Bldg.	364	XRF	4/9/97	1	Bath	3	Wall	Wall Rgstr	Solid	Metal	0.02
28	1916 Bldg.	365	XRF	4/9/97	1	Bath	3	Floor		Solid	Concrcte	0.17
29	1916 Bldg.	366	XRF	4/9/97	1	Bath	3	Ceiling		Solid	Plaster	2.49
30	1916 Bldg.	410	XRF	4/9/97	1	Bath	4	Wall	Wall	Solid	Drywall	0.04
31	1916 Bldg.	411	XRF	4/9/97	1	Bath	4	Wall	Wall	Solid	Tile	0.12
32	1916 Bldg.	412	XRF	4/9/97	1	Bath	4	Wall	Wall	Solid	Plaster	0.07
33	1916 Bldg.	413	XRF	4/9/97	1	Bath	4	Wall	Wall	Solid	Tile	5.09
34	1916 Bldg.	414	XRF	4/9/97	1	Bath	4	Cabinet	Door	Solid	Wood	0
35	1916 Bldg.	69	XRF	4/15/97	1	Closet	23	Wall	Wall	Solid	Plaster	5.09
36	1916 Bldg.	270	XRF	4/9/97	1	Closet	10A	Wall	Wall	Solid	Plaster	0.03
37	1916 Bldg.	271	XRF	4/9/97	1	Closet	10A		Shelf	Solid	Wood	0.02
38	1916 Bldg.	272	XRF	4/9/97	1	Closet	10A	Ceiling		Solid	Plaster	0.03
39	1916 Bldg.	310	XRF	4/9/97	1	Closet	13A	Wall	Midle Wall	Solid	Plaster	5.09
40	1916 Bldg.	311	XRF	4/9/97	1	Closet	13A		Shelf	Solid	Wood	0
41	1916 Bldg.	312	XRF	4/9/97	1	Closet	13A	Ceiling		Solid	Plaster	0.2
42	1916 Bldg.	313	XRF	4/9/97	1	Closet	13A	Floor		Solid	Wood	0.03
43	1916 Bldg.	328	XRF	4/9/97	1	Closet	14A	Wall	Midle Wall	Solid	Plaster	5.09
44	1916 Bldg.	329	XRF	4/9/97	1	Closet	14A	Coat	Rack	Solid	Wood	0.03
45	1916 Bldg.	330	XRF	4/9/97	1	Closet	14A		Shelf	Solid	Wood	2.82
46	1916 Bldg.	331	XRF	4/9/97	1	Closet	14A	Ceiling		Solid	Plaster	0.52
47	1916 Bldg.	332	XRF	4/9/97	1	Closet	14A	Floor		Solid	Concrcte	0.53
48	1916 Bldg.	347	XRF	4/9/97	1	Closet	15A	Wall	Midle Wall	Solid	Plaster	5.09
49	1916 Bldg.	348	XRF	4/9/97	1	Closet	15A	Wall	Baseboard	Solid	Wood	0.06
50	1916 Bldg.	349	XRF	4/9/97	1	Closet	15A	Coat	Rack	Solid	Wood	0.04
51	1916 Bldg.	350	XRF	4/9/97	1	Closet	15A		Shelf	Solid	Wood	0
52	1916 Bldg.	351	XRF	4/9/97	1	Closet	15A	Ceiling		Solid	Plaster	0.25
53	1916 Bldg.	352	XRF	4/9/97	1	Closet	15A	Floor		Solid	Wood	0.03
54	1916 Bldg.	353	XRF	4/9/97	1	Closet	15B	Wall	Midle Wall	Solid	Plaster	5.09
55	1916 Bldg.	354	XRF	4/9/97	1	Closet	15B	Coat	Rack	Solid	Wood	0.05
56	1916 Bldg.	355	XRF	4/9/97	1	Closet	15B		Shelf	Solid	Wood	0.03
57	1916 Bldg.	356	XRF	4/9/97	1	Closet	15B	Ceiling		Solid	Plaster	0.16
58	1916 Bldg.	357	XRF	4/9/97	1	Closet	15B	Floor		Solid	Wood	0.02
59	1916 Bldg.	404	XRF	4/9/97	1	Closet	17A	Wall	Midle Wall	Solid	Plaster	5.09
60	1916 Bldg.	405	XRF	4/9/97	1	Closet	17A	Wall	Wall	Solid	Plaster	0.15
61	1916 Bldg.	406	XRF	4/9/97	1	Closet	17A	Coat	Rack	Solid	Wood	0.05
62	1916 Bldg.	407	XRF	4/9/97	1	Closet	17A	Cabinet	Shelf	Solid	Wood	0.02
63	1916 Bldg.	408	XRF	4/9/97	1	Closet	17A	Wall	Baseboard	Solid	Wood	0.03
64	1916 Bldg.	409	XRF	4/9/97	1	Closet	17A	Floor		Solid	Wood	0.02

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
65	1916 Bldg.	429	XRF	4/9/97	1	Closet	4A	Wall	Wall	Solid	Plaster	5.09
66	1916 Bldg.	430	XRF	4/9/97	1	Closet	4A	Wall	Wall	Solid	Plaster	0.1
67	1916 Bldg.	431	XRF	4/9/97	1	Closet	4A	Coat	Rack	Solid	Wood	0.83
68	1916 Bldg.	432	XRF	4/9/97	1	Closet	4A		Shelf	Solid	Wood	0.03
69	1916 Bldg.	433	XRF	4/9/97	1	Closet	4A	Wall	Baseboard	Solid	Tile	0.04
70	1916 Bldg.	434	XRF	4/9/97	1	Closet	4A	Floor		Solid	Wood	0.01
71	1916 Bldg.	435	XRF	4/9/97	1	Closet	4B	Wall	Wall	Solid	Plaster	0.06
72	1916 Bldg.	436	XRF	4/9/97	1	Closet	4B	Wall	Wall	Solid	Plaster	5.09
73	1916 Bldg.	437	XRF	4/9/97	1	Closet	4B	Coat	Rack	Solid	Wood	0.74
74	1916 Bldg.	438	XRF	4/9/97	1	Closet	4B		Shelf	Solid	Wood	0.02
75	1916 Bldg.	439	XRF	4/9/97	1	Closet	4B	Floor		Solid	Wood	0.04
76	1916 Bldg.	76	XRF	4/15/97	1	Gym	24	Wall	Wall	Solid	Plaster	0.12
77	1916 Bldg.	77	XRF	4/15/97	1	Gym	24	Wall	Wall	Solid	Wood	0
78	1916 Bldg.	78	XRF	4/15/97	1	Gym	24	Wall	Midle Wall	Solid	Concrte	0.02
79	1916 Bldg.	79	XRF	4/15/97	1	Gym	24	Wall	Wall	Solid	Concrte	0.13
80	1916 Bldg.	80	XRF	4/15/97	1	Gym	24	Wall	Wall	Solid	Stucco	0.03
81	1916 Bldg.	81	XRF	4/15/97	1	Gym	24		Radiator	Solid	Metal	0.18
82	1916 Bldg.	82	XRF	4/15/97	1	Gym	24	Wall	Diffuser	Solid	Metal	0.06
83	1916 Bldg.	83	XRF	4/15/97	1	Gym	24	Floor		Solid	Wood	0.02
84	1916 Bldg.	84	XRF	4/15/97	1	Gym	24	Floor		Solid	Wood	0.04
85	1916 Bldg.	85	XRF	4/15/97	1	Gym	24	Floor		Solid	Wood	0.01
86	1916 Bldg.	86	XRF	4/15/97	1	Gym	24	Floor		Solid	Wood	0.01
87	1916 Bldg.	87	XRF	4/15/97	1	Gym	24	Floor		Solid	Wood	0.02
88	1916 Bldg.	88	XRF	4/15/97	1	Gym	24	Floor		Solid	Wood	0.01
89	1916 Bldg.	89	XRF	4/15/97	1	Gym	24	Floor		Solid	Wood	0.02
90	1916 Bldg.	7	XRF	4/8/97	1	Hall	1	Wall	Wall	Solid	Plaster	0.07
91	1916 Bldg.	8	XRF	4/8/97	1	Hall	1	Wall	Wall	Solid	Concrte	0.03
92	1916 Bldg.	9	XRF	4/8/97	1	Hall	1	Wall	Midle Wall	Solid	Concrte	0.29
93	1916 Bldg.	10	XRF	4/8/97	1	Hall	1	Wall	Midle Wall	Solid	Concrte	0.27
94	1916 Bldg.	11	XRF	4/8/97	1	Hall	1	Wall	Midle Wall	Solid	Concrte	0.34
95	1916 Bldg.	12	XRF	4/8/97	1	Hall	1	Wall	Midle Wall	Solid	Concrte	0.01
96	1916 Bldg.	13	XRF	4/8/97	1	Hall	1	Wall	Wall	Solid	Concrte	0.41
97	1916 Bldg.	14	XRF	4/8/97	1	Hall	1	Door	Door	Solid	Wood	0.06
98	1916 Bldg.	15	XRF	4/8/97	1	Hall	1	Door	Casing	Solid	Wood	0.05
99	1916 Bldg.	16	XRF	4/8/97	1	Hall	1	Door	Door	Solid	Metal	0.06
100	1916 Bldg.	17	XRF	4/8/97	1	Hall	1	Door	Casing	Solid	Metal	0.07
101	1916 Bldg.	18	XRF	4/8/97	1	Hall	1	Wall	Wall Rgstr	Solid	Metal	0.03
102	1916 Bldg.	19	XRF	4/8/97	1	Hall	1		Radiator	Solid	Metal	0.16
103	1916 Bldg.	20	XRF	4/8/97	1	Hall	1	Bulletin	Board	Solid	Wood	0.02
104	1916 Bldg.	21	XRF	4/8/97	1	Hall	1	Mounting	Board	Solid	Wood	0.03
105	1916 Bldg.	22	XRF	4/8/97	1	Hall	2	Wall	Wall	Cracked	Plaster	0.04
106	1916 Bldg.	23	XRF	4/8/97	1	Hall	2	Wall	Wall	Solid	Concrte	0.02
107	1916 Bldg.	24	XRF	4/8/97	1	Hall	2	Wall	Midle Wall	Solid	Concrte	0.03
108	1916 Bldg.	25	XRF	4/8/97	1	Hall	2	Wall	Wall	Solid	Concrte	0.18
109	1916 Bldg.	26	XRF	4/8/97	1	Hall	2	Wall	Wall	Solid	Concrte	0.1
110	1916 Bldg.	27	XRF	4/8/97	1	Hall	2	Door	Door	Solid	Metal	0.08
111	1916 Bldg.	28	XRF	4/8/97	1	Hall	2	Door	Casing	Solid	Metal	0.08
112	1916 Bldg.	29	XRF	4/8/97	1	Hall	2	Door	Door	Solid	Wood	0.04
113	1916 Bldg.	30	XRF	4/8/97	1	Hall	2	Window	Sash	Solid	Wood	0.07
114	1916 Bldg.	31	XRF	4/8/97	1	Hall	2	Door	Door	Solid	Wood	0.02
115	1916 Bldg.	32	XRF	4/8/97	1	Hall	2	Ceiling		Cracked	Plaster	0.09
116	1916 Bldg.	33	XRF	4/8/97	1	Hall	2	Wall	Wall Rgstr	Solid	Metal	0.08
117	1916 Bldg.	34	XRF	4/8/97	1	Hall	2	Unlisted	Wall	Solid	Wood	0.02
118	1916 Bldg.	35	XRF	4/8/97	1	Hall	2		Radiator	Solid	Metal	0.08
119	1916 Bldg.	36	XRF	4/8/97	1	Hall	2		Elec Panel	Solid	Metal	0.01
120	1916 Bldg.	37	XRF	4/8/97	1	Hall	3	Wall	Wall	Solid	Plaster	0.06
121	1916 Bldg.	38	XRF	4/8/97	1	Hall	3	Wall	Wall	Solid	Concrte	0.03
122	1916 Bldg.	39	XRF	4/8/97	1	Hall	3	Wall	Midle Wall	Solid	Concrte	0.04
123	1916 Bldg.	40	XRF	4/8/97	1	Hall	3	Wall	Wall	Solid	Concrte	0.29
124	1916 Bldg.	41	XRF	4/8/97	1	Hall	3	Door	Door	Solid	Wood	0.05
125	1916 Bldg.	42	XRF	4/8/97	1	Hall	3	Door	Jamb	Solid	Wood	0.04
126	1916 Bldg.	43	XRF	4/8/97	1	Hall	3	Window	Casing	Solid	Wood	0.04
127	1916 Bldg.	44	XRF	4/8/97	1	Hall	3	Door	Door	Solid	Metal	0.08

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
128	1916 Bldg.	45	XRF	4/8/97	1	Hall	3	Door	Door	Peeling	Wood	0.22
129	1916 Bldg.	46	XRF	4/8/97	1	Hall	3	Door	Casing	Peeling	Wood	0.21
130	1916 Bldg.	47	XRF	4/8/97	1	Hall	3		Elec Panel	Solid	Metal	0.01
131	1916 Bldg.	48	XRF	4/8/97	1	Hall	3	Stairs	Hand rail	Solid	Metal	0.03
132	1916 Bldg.	49	XRF	4/8/97	1	Hall	3	Pole	Columns	Peeling	Metal	3.22
133	1916 Bldg.	50	XRF	4/8/97	1	Hall	3		Radiator	Peeling	Metal	5.09
134	1916 Bldg.	51	XRF	4/8/97	1	Hall	3	Wall	Wall Rgstr	Solid	Metal	0.2
135	1916 Bldg.	52	XRF	4/8/97	1	Hall	3	Ceiling		Cracked	Plaster	0.05
136	1916 Bldg.	415	XRF	4/9/97	1	Hall	4	Wall	Wall	Solid	Drywall	0
137	1916 Bldg.	416	XRF	4/9/97	1	Hall	4	Wall	Wall	Solid	Drywall	0
138	1916 Bldg.	417	XRF	4/9/97	1	Hall	4	Wall	Wall	Solid	Plaster	0.15
139	1916 Bldg.	418	XRF	4/9/97	1	Hall	4	Wall	Wall	Solid	Tile	5.09
140	1916 Bldg.	419	XRF	4/9/97	1	Hall	4	Wall	Baseboard	Solid	Tile	2.15
141	1916 Bldg.	420	XRF	4/9/97	1	Hall	4	Door	Door	Solid	Wood	0
142	1916 Bldg.	421	XRF	4/9/97	1	Hall	4	Door	Casing	Solid	Metal	0.04
143	1916 Bldg.	422	XRF	4/9/97	1	Hall	4	Door	Door	Solid	Wood	0.37
144	1916 Bldg.	423	XRF	4/9/97	1	Hall	4	Door	Casing	Solid	Wood	0.39
145	1916 Bldg.	424	XRF	4/9/97	1	Hall	4	Window	Casing	Solid	Metal	0.02
146	1916 Bldg.	425	XRF	4/9/97	1	Hall	4	Cabinet	Door	Solid	Wood	0.04
147	1916 Bldg.	426	XRF	4/9/97	1	Hall	4	Unlisted	Midle Wall	Solid	Wood	0.05
148	1916 Bldg.	427	XRF	4/9/97	1	Hall	4	Wall	Wall Rgstr	Solid	Metal	5.09
149	1916 Bldg.	428	XRF	4/9/97	1	Hall	4	Floor		Solid	Wood	0.02
150	1916 Bldg.	54	XRF	4/17/97	0	Hall	5	Wall	Midle Wall	Solid	Drywall	0.01
151	1916 Bldg.	55	XRF	4/17/97	0	Hall	5	Door	Door	Solid	Wood	0.03
152	1916 Bldg.	56	XRF	4/17/97	0	Hall	5	Door	Casing	Solid	Wood	0.16
153	1916 Bldg.	57	XRF	4/17/97	0	Hall	5	Ceiling		Solid	Plaster	0.08
154	1916 Bldg.	58	XRF	4/17/97	0	Hall	5	Floor		Peeling	Concrte	0.04
155	1916 Bldg.	59	XRF	4/17/97	0	Hall	5	Door	Door	Solid	Wood	0.02
156	1916 Bldg.	60	XRF	4/17/97	0	Hall	5	Door	Casing	Solid	Wood	0.02
157	1916 Bldg.	106	XRF	4/17/97	0	Hall	6	Wall	Wall	Solid	Plaster	5.09
158	1916 Bldg.	107	XRF	4/17/97	0	Hall	6		Elec Panel	Solid	Metal	0.13
159	1916 Bldg.	108	XRF	4/17/97	0	Hall	6		Elec Panel	Solid	Metal	0.02
160	1916 Bldg.	109	XRF	4/17/97	0	Hall	6	Floor		Peeling	Concrte	0.31
161	1916 Bldg.	110	XRF	4/17/97	0	Hall	6	Wall	Midle Wall	Peeling	Plaster	5.09
162	1916 Bldg.	111	XRF	4/17/97	0	Hall	6	Door	Door	Peeling	Wood	1.46
163	1916 Bldg.	112	XRF	4/17/97	0	Hall	6	Door	Jamb	Peeling	Wood	5.09
164	1916 Bldg.	154	XRF	4/17/97	0	Hall	7	Wall	Midle Wall	Peeling	Drywall	0
165	1916 Bldg.	155	XRF	4/17/97	0	Hall	7	Wall	Wall	Solid	Concrte	0.03
166	1916 Bldg.	156	XRF	4/17/97	0	Hall	7	Wall	Wall	Solid	Tile	5.09
167	1916 Bldg.	157	XRF	4/17/97	0	Hall	7	Wall	Wall	Peeling	Concrte	5.09
168	1916 Bldg.	158	XRF	4/17/97	0	Hall	7	Ceiling		Solid	Plaster	0.1
169	1916 Bldg.	159	XRF	4/17/97	0	Hall	7	Door	Door	Solid	Wood	0.02
170	1916 Bldg.	160	XRF	4/17/97	0	Hall	7	Door	Casing	Solid	Wood	0.02
171	1916 Bldg.	161	XRF	4/17/97	0	Hall	7	Stairs	Hand rail	Solid	Metal	0.06
172	1916 Bldg.	162	XRF	4/17/97	0	Hall	7	Stairs	Baseboard	Peeling	Concrte	0.03
173	1916 Bldg.	163	XRF	4/17/97	0	Hall	7	Wall	Hatch	Solid	Wood	0.34
174	1916 Bldg.	1	XRF	4/19/97	1	Outside	0	Door	Door	Solid	Wood	5.09
175	1916 Bldg.	2	XRF	4/19/97	1	Outside	0	Door	Jamb	Solid	Wood	5.09
176	1916 Bldg.	3	XRF	4/19/97	1	Outside	0	Ext Wall	Siding	Solid	Stucco	0
177	1916 Bldg.	4	XRF	4/19/97	1	Outside	0	Door	Door	Peeling	Wood	1.63
178	1916 Bldg.	5	XRF	4/19/97	1	Outside	0	Door	Jamb	Solid	Metal	0.04
179	1916 Bldg.	6	XRF	4/19/97	1	Outside	0	Flag	Pole	Solid	Metal	0.02
180	1916 Bldg.	7	XRF	4/19/97	1	Outside	0	Door	Door	Solid	Wood	5.09
181	1916 Bldg.	8	XRF	4/19/97	1	Outside	0	Door	Jamb	Solid	Wood	5.09
182	1916 Bldg.	9	XRF	4/19/97	1	Outside	0		Column	Solid	Concrte	0.09
183	1916 Bldg.	85	XRF	4/8/97	1	Restroom	1	Wall	Wall	Solid	Plaster	0.11
184	1916 Bldg.	86	XRF	4/8/97	1	Restroom	1	Wall	Wall	Solid	Tile	0.74
185	1916 Bldg.	87	XRF	4/8/97	1	Restroom	1	Wall	Wall	Solid	Tile	5.09
186	1916 Bldg.	88	XRF	4/8/97	1	Restroom	1	Wall	Wall	Solid	Tile	5.09
187	1916 Bldg.	89	XRF	4/8/97	1	Restroom	1	Wall	Wall	Solid	Tile	3.34
188	1916 Bldg.	90	XRF	4/8/97	1	Restroom	1		Radiator	Peeling	Metal	0.02
189	1916 Bldg.	91	XRF	4/8/97	1	Restroom	1	Wall	Stall Door	Solid	Wood	0.05
190	1916 Bldg.	92	XRF	4/8/97	1	Restroom	1	Wall	Hatch	Solid	Wood	0.11

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
191	1916 Bldg.	93	XRF	4/8/97	1	Restroom	1	Ceiling		Solid	Wood	5.09
192	1916 Bldg.	94	XRF	4/8/97	1	Restroom	1	Ceiling		Cracked	Plaster	0.14
193	1916 Bldg.	95	XRF	4/8/97	1	Restroom	1		Transom	Solid	Wood	0.01
194	1916 Bldg.	96	XRF	4/8/97	1	Restroom	1	Floor		Peeling	Concrte	0.03
195	1916 Bldg.	97	XRF	4/8/97	1	Restroom	1	Wall	Wall Rgstr	Solid	Metal	0
196	1916 Bldg.	119	XRF	4/15/97	1	Restroom	5	Wall	Wall	Solid	Plaster	0.2
197	1916 Bldg.	120	XRF	4/15/97	1	Restroom	5	Wall	Wall	Solid	Wood	0.13
198	1916 Bldg.	121	XRF	4/15/97	1	Restroom	5	Wall	Midle Wall	Solid	Tile	1.52
199	1916 Bldg.	122	XRF	4/15/97	1	Restroom	5	Wall	Midle Wall	Solid	Tile	1.42
200	1916 Bldg.	123	XRF	4/15/97	1	Restroom	5	Wall	Wall	Solid	Plaster	0.06
201	1916 Bldg.	124	XRF	4/15/97	1	Restroom	5	Wall	Wall	Solid	Metal	5.09
202	1916 Bldg.	125	XRF	4/15/97	1	Restroom	5	Wall	Baseboard	Solid	Tile	2.53
203	1916 Bldg.	126	XRF	4/15/97	1	Restroom	5	Wall	Midle Wall	Solid	Wood	0.05
204	1916 Bldg.	127	XRF	4/15/97	1	Restroom	5		Radiator	Solid	Metal	0.01
205	1916 Bldg.	128	XRF	4/15/97	1	Restroom	5		Bthrm Still	Solid	Tile	0.09
206	1916 Bldg.	129	XRF	4/15/97	1	Restroom	5		Stall Door	Solid	Wood	0.02
207	1916 Bldg.	130	XRF	4/15/97	1	Restroom	5	Wall	Diffuser	Solid	Metal	0
208	1916 Bldg.	131	XRF	4/15/97	1	Restroom	5	Floor		Cracked	Concrte	0.06
209	1916 Bldg.	132	XRF	4/15/97	1	Restroom	5	Ceiling		Solid	Plaster	0.11
210	1916 Bldg.	133	XRF	4/15/97	1	Restroom	5	Ceiling		Solid	Wood	5.09
211	1916 Bldg.	134	XRF	4/15/97	1	Restroom	5	Window	Panel	Solid	Wood	0.03
212	1916 Bldg.	53	XRF	4/8/97	1	Room	1	Wall	Wall	Solid	Plaster	5.09
213	1916 Bldg.	54	XRF	4/8/97	1	Room	1	Window	Stool	Peeling	Wood	0.29
214	1916 Bldg.	55	XRF	4/8/97	1	Room	1	Coat	Rack	Solid	Wood	0.02
215	1916 Bldg.	56	XRF	4/8/97	1	Room	1	Wall	Midle Wall	Solid	Concrte	0.33
216	1916 Bldg.	57	XRF	4/8/97	1	Room	1	Pole	Columns	Peeling	Metal	5.09
217	1916 Bldg.	58	XRF	4/8/97	1	Room	1	Floor		Peeling	Wood	0.02
218	1916 Bldg.	59	XRF	4/8/97	1	Room	1	Solance	Quarters	Solid	Wood	0.04
219	1916 Bldg.	60	XRF	4/8/97	1	Room	1	Ceiling		Solid	Plaster	0.06
220	1916 Bldg.	61	XRF	4/8/97	1	Room	2	Wall	Wall	Solid	Plaster	0.1
221	1916 Bldg.	62	XRF	4/8/97	1	Room	2	Wall	Wall	Solid	Plaster	0.15
222	1916 Bldg.	63	XRF	4/8/97	1	Room	2	Wall	Chair rail	Solid	Wood	0.09
223	1916 Bldg.	64	XRF	4/8/97	1	Room	2	Wall	Chair rail	Solid	Wood	0.02
224	1916 Bldg.	65	XRF	4/8/97	1	Room	2	Wall	Wall	Solid	Tile	5.09
225	1916 Bldg.	66	XRF	4/8/97	1	Room	2	Wall	Baseboard	Solid	Tile	4.23
226	1916 Bldg.	67	XRF	4/8/97	1	Room	2	Window	Stool	Peeling	Wood	0.04
227	1916 Bldg.	68	XRF	4/8/97	1	Room	2	Window	Casing	Solid	Wood	0.03
228	1916 Bldg.	69	XRF	4/8/97	1	Room	2		Radiator	Solid	Metal	5.09
229	1916 Bldg.	70	XRF	4/8/97	1	Room	2	Floor		Solid	Wood	0.01
230	1916 Bldg.	71	XRF	4/8/97	1	Room	2	Chalk	Board	Peeling	Wood	0.03
231	1916 Bldg.	72	XRF	4/8/97	1	Room	2	Cabinet	Door	Solid	Wood	0.02
232	1916 Bldg.	73	XRF	4/8/97	1	Room	2	Ceiling		Solid	Plaster	0.05
233	1916 Bldg.	74	XRF	4/8/97	1	Room	2	Wall	Wall Rgstr	Solid	Metal	0.92
234	1916 Bldg.	75	XRF	4/8/97	1	Room	2	Bulletin	Board	Solid	Wood	0.2
235	1916 Bldg.	99	XRF	4/8/97	1	Room	3	Wall	Wall	Cracked	Plaster	0.14
236	1916 Bldg.	100	XRF	4/8/97	1	Room	3	Wall	Wall	Cracked	Plaster	0.17
237	1916 Bldg.	101	XRF	4/8/97	1	Room	3	Wall	Wall	Solid	Tile	5.09
238	1916 Bldg.	102	XRF	4/8/97	1	Room	3	Wall	Baseboard	Solid	Tile	2.85
239	1916 Bldg.	103	XRF	4/8/97	1	Room	3	Door	Door	Peeling	Wood	0.26
240	1916 Bldg.	104	XRF	4/8/97	1	Room	3	Door	Casing	Peeling	Wood	0.58
241	1916 Bldg.	105	XRF	4/8/97	1	Room	3	Window	Stool	Peeling	Wood	0.04
242	1916 Bldg.	106	XRF	4/8/97	1	Room	3	Window	Casing	Solid	Wood	0.27
243	1916 Bldg.	107	XRF	4/8/97	1	Room	3		Radiator	Peeling	Metal	0.01
244	1916 Bldg.	108	XRF	4/8/97	1	Room	3	Radiator	Panel	Solid	Metal	0
245	1916 Bldg.	109	XRF	4/8/97	1	Room	3	Chalk	Board	Solid	Wood	0.04
246	1916 Bldg.	110	XRF	4/8/97	1	Room	3	Wall	Chair rail	Solid	Wood	0.05
247	1916 Bldg.	111	XRF	4/8/97	1	Room	3	Floor		Solid	Wood	0.02
248	1916 Bldg.	112	XRF	4/8/97	1	Room	3	Wall	Wall Rgstr	Solid	Metal	0.15
249	1916 Bldg.	113	XRF	4/8/97	1	Room	3	Wall	Crown mold	Solid	Wood	0.12
250	1916 Bldg.	121	XRF	4/8/97	1	Room	4	Wall	Wall	Cracked	Plaster	0.25
251	1916 Bldg.	122	XRF	4/8/97	1	Room	4	Wall	Wall	Cracked	Plaster	0.13
252	1916 Bldg.	123	XRF	4/8/97	1	Room	4	Wall	Wall	Cracked	Tile	5.09
253	1916 Bldg.	124	XRF	4/8/97	1	Room	4	Wall	Baseboard	Cracked	Tile	2.67

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
254	1916 Bldg.	125	XRF	4/8/97	1	Room	4	Door	Door	Peeling	Wood	0.38
255	1916 Bldg.	126	XRF	4/8/97	1	Room	4	Door	Casing	Peeling	Wood	5.09
256	1916 Bldg.	127	XRF	4/8/97	1	Room	4	Window	Stool	Peeling	Wood	0.04
257	1916 Bldg.	128	XRF	4/8/97	1	Room	4	Window	Casing	Solid	Wood	0.24
258	1916 Bldg.	129	XRF	4/8/97	1	Room	4		Radiator	Peeling	Metal	0
259	1916 Bldg.	130	XRF	4/8/97	1	Room	4	Radiator	Board	Solid	Wood	0
260	1916 Bldg.	131	XRF	4/8/97	1	Room	4	Wall	Chair rail	Peeling	Wood	0.04
261	1916 Bldg.	132	XRF	4/8/97	1	Room	4	Chalk	Board	Peeling		0.06
262	1916 Bldg.	133	XRF	4/8/97	1	Room	4	Floor		Solid	Wood	0.01
263	1916 Bldg.	134	XRF	4/8/97	1	Room	4	Wall	Wall Rgstr	Solid	Metal	0.08
264	1916 Bldg.	135	XRF	4/8/97	1	Room	4	Wall	Crown mold	Solid	Wood	0.07
265	1916 Bldg.	136	XRF	4/8/97	1	Room	4	Wall	Mural	Solid	Wood	0.11
266	1916 Bldg.	137	XRF	4/8/97	1	Room	4	Wall	Mural	Solid	Wood	0.12
267	1916 Bldg.	138	XRF	4/8/97	1	Room	4	Wall	Mural	Solid	Wood	0.08
268	1916 Bldg.	149	XRF	4/8/97	1	Room	5	Wall	Wall	Cracked	Plaster	0.15
269	1916 Bldg.	150	XRF	4/8/97	1	Room	5	Wall	Wall	Cracked	Plaster	0.15
270	1916 Bldg.	151	XRF	4/8/97	1	Room	5	Wall	Wall	Cracked	Tile	5.09
271	1916 Bldg.	152	XRF	4/8/97	1	Room	5	Wall	Baseboard	Cracked	Tile	2.16
272	1916 Bldg.	153	XRF	4/8/97	1	Room	5	Door	Door	Peeling	Wood	0.36
273	1916 Bldg.	154	XRF	4/8/97	1	Room	5	Door	Jamb	Peeling	Wood	5.09
274	1916 Bldg.	155	XRF	4/8/97	1	Room	5	Window	Stool	Peeling	Wood	0.31
275	1916 Bldg.	156	XRF	4/8/97	1	Room	5		Radiator	Peeling	Metal	0.01
276	1916 Bldg.	157	XRF	4/8/97	1	Room	5	Radiator	Board	Solid	Wood	0
277	1916 Bldg.	158	XRF	4/8/97	1	Room	5	Coat	Rack	Peeling	Wood	0.03
278	1916 Bldg.	159	XRF	4/8/97	1	Room	5	Floor		Solid	Wood	0
279	1916 Bldg.	160	XRF	4/8/97	1	Room	5	Floor		Solid	Wood	0.02
280	1916 Bldg.	161	XRF	4/8/97	1	Room	5	Floor		Solid	Wood	0.03
281	1916 Bldg.	162	XRF	4/8/97	1	Room	5	Wall	Chair rail	Solid	Wood	0.05
282	1916 Bldg.	163	XRF	4/8/97	1	Room	5	Wall	Wall Rgstr	Solid	Metal	0.07
283	1916 Bldg.	164	XRF	4/8/97	1	Room	5	Wall	Crown mold	Solid	Wood	0.16
284	1916 Bldg.	165	XRF	4/8/97	1	Room	5	Wall	Midle Wall	Solid	Wood	0.21
285	1916 Bldg.	174	XRF	4/8/97	1	Room	6	Wall	Wall	Cracked	Plaster	0.18
286	1916 Bldg.	175	XRF	4/8/97	1	Room	6	Wall	Wall	Cracked	Plaster	0.26
287	1916 Bldg.	176	XRF	4/8/97	1	Room	6	Wall	Wall	Solid	Tile	5.09
288	1916 Bldg.	177	XRF	4/8/97	1	Room	6	Wall	Baseboard	Solid	Tile	2.64
289	1916 Bldg.	178	XRF	4/8/97	1	Room	6	Door	Door	Peeling	Wood	0.29
290	1916 Bldg.	179	XRF	4/8/97	1	Room	6	Door	Casing	Solid	Wood	0.03
291	1916 Bldg.	180	XRF	4/8/97	1	Room	6	Window	Stool	Peeling	Wood	0.26
292	1916 Bldg.	181	XRF	4/8/97	1	Room	6	Window	Casing	Peeling	Wood	0.71
293	1916 Bldg.	182	XRF	4/8/97	1	Room	6		Radiator	Peeling	Metal	0.03
294	1916 Bldg.	183	XRF	4/8/97	1	Room	6	Radiator	Board	Solid	Wood	0
295	1916 Bldg.	184	XRF	4/8/97	1	Room	6	Bench		Peeling	Wood	0.12
296	1916 Bldg.	185	XRF	4/8/97	1	Room	6	Wall	Wall	Peeling	Wood	0.04
297	1916 Bldg.	186	XRF	4/8/97	1	Room	6	Pole		Peeling	Metal	5.09
298	1916 Bldg.	187	XRF	4/8/97	1	Room	6	Cabinet	Door	Solid	Wood	0.04
299	1916 Bldg.	188	XRF	4/8/97	1	Room	6	Bulletin	Board	Solid	Wood	0.04
300	1916 Bldg.	189	XRF	4/8/97	1	Room	6	Wall	Chair rail	Solid	Wood	0.2
301	1916 Bldg.	190	XRF	4/8/97	1	Room	6	Wall	Wall Rgstr	Solid	Metal	0.16
302	1916 Bldg.	191	XRF	4/8/97	1	Room	6	Floor		Solid	Wood	0.06
303	1916 Bldg.	192	XRF	4/8/97	1	Room	7	Wall	Wall	Cracked	Plaster	0.25
304	1916 Bldg.	193	XRF	4/8/97	1	Room	7	Wall	Wall	Solid	Tile	5.09
305	1916 Bldg.	194	XRF	4/8/97	1	Room	7	Wall	Baseboard	Solid	Tile	3.02
306	1916 Bldg.	195	XRF	4/8/97	1	Room	7	Door	Door	Solid	Wood	0.03
307	1916 Bldg.	196	XRF	4/8/97	1	Room	7	Door	Jamb	Solid	Wood	0.03
308	1916 Bldg.	197	XRF	4/8/97	1	Room	7	Window	Stool	Peeling	Wood	2.37
309	1916 Bldg.	198	XRF	4/8/97	1	Room	7	Window	Casing	Peeling	Wood	0.61
310	1916 Bldg.	199	XRF	4/8/97	1	Room	7		Radiator	Peeling	Metal	0.05
311	1916 Bldg.	200	XRF	4/8/97	1	Room	7	Radiator	Board	Solid	Wood	0
312	1916 Bldg.	201	XRF	4/8/97	1	Room	7	Fountain	Backing	Solid	Wood	0.01
313	1916 Bldg.	202	XRF	4/8/97	1	Room	7	Wall	Chair rail	Solid	Wood	0.04
314	1916 Bldg.	203	XRF	4/8/97	1	Room	7	Ceiling		Cracked	Plaster	0.17
315	1916 Bldg.	204	XRF	4/8/97	1	Room	7	Floor		Solid	Wood	0.05
316	1916 Bldg.	232	XRF	4/9/97	1	Room	8	Wall	Wall	Solid	Plaster	0.12

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
317	1916 Bldg.	233	XRF	4/9/97	1	Room	8	Wall	Wall	Solid	Plaster	0.16
318	1916 Bldg.	234	XRF	4/9/97	1	Room	8	Wall	Wall	Solid	Plaster	5.09
319	1916 Bldg.	235	XRF	4/9/97	1	Room	8	Wall	Chair rail	Solid	Wood	0.88
320	1916 Bldg.	236	XRF	4/9/97	1	Room	8	Door	Casing	Solid	Wood	0.03
321	1916 Bldg.	237	XRF	4/9/97	1	Room	8	Wall	Baseboard	Solid	Tile	1.96
322	1916 Bldg.	238	XRF	4/9/97	1	Room	8		Radiator	Solid	Metal	0.03
323	1916 Bldg.	239	XRF	4/9/97	1	Room	8	Wall	Wall Rgstr	Solid	Metal	5.09
324	1916 Bldg.	240	XRF	4/9/97	1	Room	8	Duct		Solid	Metal	0.12
325	1916 Bldg.	241	XRF	4/9/97	1	Room	8	Cabinet	Door	Solid	Wood	0.08
326	1916 Bldg.	242	XRF	4/9/97	1	Room	8	Closet	Casing	Solid	Wood	0.04
327	1916 Bldg.	243	XRF	4/9/97	1	Room	8	Ceiling		Solid	Plaster	0.08
328	1916 Bldg.	244	XRF	4/9/97	1	Room	9	Wall	Wall	Solid	Plaster	0.35
329	1916 Bldg.	245	XRF	4/9/97	1	Room	9	Wall	Wall	Solid	Plaster	0.28
330	1916 Bldg.	246	XRF	4/9/97	1	Room	9	Wall	Wall	Solid	Plaster	5.09
331	1916 Bldg.	247	XRF	4/9/97	1	Room	9	Wall	Baseboard	Solid	Tile	3.56
332	1916 Bldg.	248	XRF	4/9/97	1	Room	9	Wall	Crown mold	Solid	Wood	0.33
333	1916 Bldg.	249	XRF	4/9/97	1	Room	9	Door	Door	Solid	Wood	0.05
334	1916 Bldg.	250	XRF	4/9/97	1	Room	9	Door	Casing	Solid	Wood	0.06
335	1916 Bldg.	251	XRF	4/9/97	1	Room	9		Radiator	Solid	Metal	0.84
336	1916 Bldg.	252	XRF	4/9/97	1	Room	9	Wall	Wall Rgstr	Solid	Metal	5.09
337	1916 Bldg.	253	XRF	4/9/97	1	Room	9	Ceiling		Solid	Plaster	0.04
338	1916 Bldg.	254	XRF	4/9/97	1	Room	10	Wall	Wall	Solid	Plaster	0.42
339	1916 Bldg.	255	XRF	4/9/97	1	Room	10	Wall	Wall	Solid	Plaster	5.09
340	1916 Bldg.	256	XRF	4/9/97	1	Room	10	Wall	Wall	Solid	Plaster	0.13
341	1916 Bldg.	257	XRF	4/9/97	1	Room	10	Wall	Crown mold	Solid	Wood	0.21
342	1916 Bldg.	258	XRF	4/9/97	1	Room	10	Wall	Baseboard	Solid	Tile	2.57
343	1916 Bldg.	259	XRF	4/9/97	1	Room	10	Door	Door	Solid	Wood	0.06
344	1916 Bldg.	260	XRF	4/9/97	1	Room	10	Door	Casing	Solid	Wood	0.04
345	1916 Bldg.	261	XRF	4/9/97	1	Room	10	Window	Stool	Solid	Wood	0.48
346	1916 Bldg.	262	XRF	4/9/97	1	Room	10	Window	Casing	Solid	Wood	0.35
347	1916 Bldg.	263	XRF	4/9/97	1	Room	10		Radiator	Solid	Metal	0.09
348	1916 Bldg.	264	XRF	4/9/97	1	Room	10		Radiator	Solid		5.09
349	1916 Bldg.	265	XRF	4/9/97	1	Room	10	Wall	Wall Rgstr	Solid	Metal	5.09
350	1916 Bldg.	266	XRF	4/9/97	1	Room	10	Duct		Solid	Metal	5.09
351	1916 Bldg.	267	XRF	4/9/97	1	Room	10		Elec Panel	Solid	Metal	0.35
352	1916 Bldg.	268	XRF	4/9/97	1	Room	10	Ceiling		Solid	Plaster	0.03
353	1916 Bldg.	269	XRF	4/9/97	1	Room	10	Mini-blind	Wall	Solid	Vinyl	0.12
354	1916 Bldg.	273	XRF	4/9/97	2	Room	11	Wall	Wall	Solid	Plaster	0.2
355	1916 Bldg.	274	XRF	4/9/97	2	Room	11	Wall	Wall	Solid	Plaster	5.09
356	1916 Bldg.	275	XRF	4/9/97	2	Room	11	Wall	Wall	Solid	Concrte	0.02
357	1916 Bldg.	276	XRF	4/9/97	2	Room	11	Wall	Wall	Solid	Concrte	0.01
358	1916 Bldg.	277	XRF	4/9/97	2	Room	11	Wall	Baseboard	Solid	Wood	0.04
359	1916 Bldg.	278	XRF	4/9/97	2	Room	11	Door	Door	Solid	Wood	0.04
360	1916 Bldg.	279	XRF	4/9/97	2	Room	11	Door	Casing	Solid	Wood	0.04
361	1916 Bldg.	280	XRF	4/9/97	2	Room	11		Radiator	Solid	Metal	0.21
362	1916 Bldg.	281	XRF	4/9/97	2	Room	11	Chalk	Board	Solid	Wood	0.03
363	1916 Bldg.	282	XRF	4/9/97	2	Room	11	Duct		Solid	Metal	0
364	1916 Bldg.	283	XRF	4/9/97	2	Room	11	Stairs	Newal post	Solid	Wood	0.04
365	1916 Bldg.	284	XRF	4/9/97	2	Room	11	Stairs	Hand rail	Solid	Wood	0.03
366	1916 Bldg.	285	XRF	4/9/97	2	Room	11	Ceiling		Solid	Plaster	0.11
367	1916 Bldg.	286	XRF	4/9/97	2	Room	11	Floor		Solid	Wood	0.01
368	1916 Bldg.	287	XRF	4/9/97	2	Room	12	Wall	Wall	Solid	Plaster	0.12
369	1916 Bldg.	288	XRF	4/9/97	2	Room	12	Wall	Wall	Solid	Plaster	5.09
370	1916 Bldg.	289	XRF	4/9/97	2	Room	12	Wall	Wall	Solid	Concrte	0.02
371	1916 Bldg.	290	XRF	4/9/97	2	Room	12	Wall	Wall	Solid	Concrte	0
372	1916 Bldg.	291	XRF	4/9/97	2	Room	12	Wall	Baseboard	Solid	Wood	0.04
373	1916 Bldg.	292	XRF	4/9/97	2	Room	12		Radiator	Solid	Metal	0.05
374	1916 Bldg.	293	XRF	4/9/97	2	Room	12		Elec Panel	Solid	Metal	5.09
375	1916 Bldg.	294	XRF	4/9/97	2	Room	12	Wall	Hatch	Solid	Wood	0.08
376	1916 Bldg.	295	XRF	4/9/97	2	Room	12	Coat	Rack	Solid	Wood	4.22
377	1916 Bldg.	296	XRF	4/9/97	2	Room	12	Ceiling	Wall	Solid	Plaster	0.16
378	1916 Bldg.	297	XRF	4/9/97	2	Room	12	Floor	Wall	Solid	Wood	0.03
379	1916 Bldg.	299	XRF	4/9/97	1	Room	13	Wall	Wall	Solid	Plaster	0.37

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
380	1916 Bldg.	300	XRF	4/9/97	1	Room	13	Wall	Wall	Solid	Plaster	0.49
381	1916 Bldg.	301	XRF	4/9/97	1	Room	13	Wall	Crown mold	Solid	Wood	0.11
382	1916 Bldg.	302	XRF	4/9/97	1	Room	13	Wall	Wall	Solid	Plaster	5.09
383	1916 Bldg.	303	XRF	4/9/97	1	Room	13	Wall	Baseboard	Solid	Tile	3.16
384	1916 Bldg.	304	XRF	4/9/97	1	Room	13	Door	Door	Solid	Wood	0.03
385	1916 Bldg.	305	XRF	4/9/97	1	Room	13	Door	Casing	Solid	Wood	0.05
386	1916 Bldg.	306	XRF	4/9/97	1	Room	13	Wall	Wall Rgstr	Solid	Metal	5.09
387	1916 Bldg.	307	XRF	4/9/97	1	Room	13	Duct		Solid	Metal	5.09
388	1916 Bldg.	308	XRF	4/9/97	1	Room	13	Mini-blinds		Solid	Vinyl	0.72
389	1916 Bldg.	309	XRF	4/9/97	1	Room	13	Ceiling		Solid	Plaster	0.25
390	1916 Bldg.	314	XRF	4/9/97	1	Room	14	Wall	Wall	Solid	Plaster	0.12
391	1916 Bldg.	315	XRF	4/9/97	1	Room	14	Wall	Wall	Solid	Plaster	0.4
392	1916 Bldg.	316	XRF	4/9/97	1	Room	14	Wall	Crown mold	Solid	Wood	0.12
393	1916 Bldg.	317	XRF	4/9/97	1	Room	14	Wall	Wall	Solid	Plaster	5.09
394	1916 Bldg.	318	XRF	4/9/97	1	Room	14	Wall	Baseboard	Solid	Tile	3.1
395	1916 Bldg.	319	XRF	4/9/97	1	Room	14	Door	Door	Solid	Wood	0.05
396	1916 Bldg.	320	XRF	4/9/97	1	Room	14	Door	Jamb	Solid	Wood	0.05
397	1916 Bldg.	321	XRF	4/9/97	1	Room	14	Window	Stool	Solid	Wood	0.45
398	1916 Bldg.	322	XRF	4/9/97	1	Room	14	Window	Casing	Solid	Wood	5.09
399	1916 Bldg.	323	XRF	4/9/97	1	Room	14	Mini-blinds		Solid	Metal	0.01
400	1916 Bldg.	324	XRF	4/9/97	1	Room	14		Radiator	Solid	Metal	0.01
401	1916 Bldg.	325	XRF	4/9/97	1	Room	14	Wall	Wall Rgstr	Solid	Metal	5.09
402	1916 Bldg.	326	XRF	4/9/97	1	Room	14	Wall	Midle Wall	Solid	Wood	0
403	1916 Bldg.	327	XRF	4/9/97	1	Room	14	Ceiling		Solid	Plaster	0.12
404	1916 Bldg.	333	XRF	4/9/97	1	Room	15	Wall	Wall	Solid	Plaster	0.23
405	1916 Bldg.	334	XRF	4/9/97	1	Room	15	Wall	Wall	Solid	Plaster	0.36
406	1916 Bldg.	335	XRF	4/9/97	1	Room	15	Wall	Crown mold	Solid	Wood	0.16
407	1916 Bldg.	336	XRF	4/9/97	1	Room	15	Wall	Wall	Solid	Plaster	5.09
408	1916 Bldg.	337	XRF	4/9/97	1	Room	15	Wall	Baseboard	Solid	Tile	3.01
409	1916 Bldg.	338	XRF	4/9/97	1	Room	15	Door	Door	Solid	Wood	0.06
410	1916 Bldg.	339	XRF	4/9/97	1	Room	15	Door	Jamb	Solid	Wood	0.06
411	1916 Bldg.	340	XRF	4/9/97	1	Room	15	Window	Stool	Solid	Wood	0.5
412	1916 Bldg.	341	XRF	4/9/97	1	Room	15	Window	Casing	Solid	Wood	0.22
413	1916 Bldg.	342	XRF	4/9/97	1	Room	15	Mini-blinds		Solid	Metal	0.02
414	1916 Bldg.	343	XRF	4/9/97	1	Room	15		Radiator	Solid	Metal	0.2
415	1916 Bldg.	344	XRF	4/9/97	1	Room	15	Bulletin	Board	Solid	Wood	0.07
416	1916 Bldg.	345	XRF	4/9/97	1	Room	15	Duct		Solid	Metal	5.09
417	1916 Bldg.	346	XRF	4/9/97	1	Room	15	Ceiling		Solid	Plaster	0.27
418	1916 Bldg.	368	XRF	4/9/97	1	Room	16	Wall	Wall	Solid	Plaster	5.09
419	1916 Bldg.	369	XRF	4/9/97	1	Room	16	Wall	Wall	Solid	Plaster	1.07
420	1916 Bldg.	370	XRF	4/9/97	1	Room	16	Wall	Wall	Solid	Plaster	2.19
421	1916 Bldg.	371	XRF	4/9/97	1	Room	16	Wall	Wall	Solid	Plaster	1.79
422	1916 Bldg.	372	XRF	4/9/97	1	Room	16	Wall	Crown mold	Solid	Wood	0.17
423	1916 Bldg.	373	XRF	4/9/97	1	Room	16	Wall	Baseboard	Solid	Tile	1.91
424	1916 Bldg.	374	XRF	4/9/97	1	Room	16	Door	Door	Solid	Wood	0.01
425	1916 Bldg.	375	XRF	4/9/97	1	Room	16	Door	Casing	Solid	Wood	0.01
426	1916 Bldg.	376	XRF	4/9/97	1	Room	16	Door	Door	Solid	Wood	0.39
427	1916 Bldg.	377	XRF	4/9/97	1	Room	16	Window	Stool	Solid	Wood	0.57
428	1916 Bldg.	378	XRF	4/9/97	1	Room	16	Window	Casing	Solid	Wood	0.35
429	1916 Bldg.	379	XRF	4/9/97	1	Room	16	Wall	Wall Rgstr	Solid	Metal	0.02
430	1916 Bldg.	380	XRF	4/9/97	1	Room	16	Wall	Chair rail	Solid	Wood	0.07
431	1916 Bldg.	381	XRF	4/9/97	1	Room	16	Pole		Solid	Metal	2.16
432	1916 Bldg.	382	XRF	4/9/97	1	Room	16		Radiator	Solid	Metal	5.09
433	1916 Bldg.	383	XRF	4/9/97	1	Room	16	Bench		Solid	Wood	0.03
434	1916 Bldg.	384	XRF	4/9/97	1	Room	16	Cabinet	Door	Solid	Wood	0.04
435	1916 Bldg.	385	XRF	4/9/97	1	Room	16	Radiator	Board	Solid	Wood	0
436	1916 Bldg.	386	XRF	4/9/97	1	Room	16	Wall	Wall Rgstr	Solid	Metal	1.82
437	1916 Bldg.	387	XRF	4/9/97	1	Room	16	Ceiling		Solid	Plaster	2.11
438	1916 Bldg.	388	XRF	4/9/97	1	Room	16		Elec Panel	Solid	Metal	2.95
439	1916 Bldg.	389	XRF	4/9/97	1	Room	17	Wall	Wall	Solid	Plaster	0.08
440	1916 Bldg.	390	XRF	4/9/97	1	Room	17	Wall	Wall	Solid	Tile	5.09
441	1916 Bldg.	391	XRF	4/9/97	1	Room	17	Wall	Wall	Solid		5.09
442	1916 Bldg.	392	XRF	4/9/97	1	Room	17	Wall	Baseboard	Solid	Tile	2.84

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
443	1916 Bldg.	393	XRF	4/9/97	1	Room	17	Door	Door	Solid	Wood	0.45
444	1916 Bldg.	394	XRF	4/9/97	1	Room	17	Door	Casing	Solid	Wood	0.4
445	1916 Bldg.	395	XRF	4/9/97	1	Room	17	Window	Stool	Solid	Wood	0.18
446	1916 Bldg.	396	XRF	4/9/97	1	Room	17	Window	Casing	Solid	Wood	0.21
447	1916 Bldg.	397	XRF	4/9/97	1	Room	17	Radiator	Radiator	Solid	Metal	0.04
448	1916 Bldg.	398	XRF	4/9/97	1	Room	17	Radiator	Board	Solid	Wood	0
449	1916 Bldg.	399	XRF	4/9/97	1	Room	17	Wall	Midle Wall	Solid	Drywall	0.03
450	1916 Bldg.	400	XRF	4/9/97	1	Room	17	Pole		Solid	Metal	5.09
451	1916 Bldg.	401	XRF	4/9/97	1	Room	17	Wall	Chair rail	Solid	Wood	0.05
452	1916 Bldg.	402	XRF	4/9/97	1	Room	17	Cabinet	Door	Solid	Wood	0.05
453	1916 Bldg.	403	XRF	4/9/97	1	Room	17	Wall	Wall Rgstr	Solid	Metal	0.06
454	1916 Bldg.	6	XRF	4/15/97	1	Room	18	Wall	Wall	Solid	Drywall	0
455	1916 Bldg.	7	XRF	4/15/97	1	Room	18	Wall	Wall	Solid	Plaster	0.18
456	1916 Bldg.	8	XRF	4/15/97	1	Room	18	Wall	Wall	Solid	Plaster	0.11
457	1916 Bldg.	9	XRF	4/15/97	1	Room	18	Door	Door	Solid	Wood	0
458	1916 Bldg.	10	XRF	4/15/97	1	Room	18	Door	Casing	Solid	Metal	0.03
459	1916 Bldg.	11	XRF	4/15/97	1	Room	18	Window	Stool	Solid	Wood	0.03
460	1916 Bldg.	12	XRF	4/15/97	1	Room	18	Floor		Solid	Wood	0.01
461	1916 Bldg.	13	XRF	4/15/97	1	Room	19	Wall	Wall	Solid	Plaster	0.09
462	1916 Bldg.	14	XRF	4/15/97	1	Room	19	Wall	Wall	Solid	Tile	5.09
463	1916 Bldg.	15	XRF	4/15/97	1	Room	19	Wall	Wall	Solid	Drywall	0.02
464	1916 Bldg.	16	XRF	4/15/97	1	Room	19	Door	Door	Solid	Wood	0
465	1916 Bldg.	17	XRF	4/15/97	1	Room	19	Door	Casing	Solid	Metal	0.04
466	1916 Bldg.	18	XRF	4/15/97	1	Room	19	Window	Sash	Solid	Metal	0.01
467	1916 Bldg.	19	XRF	4/15/97	1	Room	19	Window	Casing	Solid	Wood	0.28
468	1916 Bldg.	20	XRF	4/15/97	1	Room	19	Window	Stool	Solid	Wood	0.04
469	1916 Bldg.	21	XRF	4/15/97	1	Room	19	Bulletin	Board	Solid	Wood	0.02
470	1916 Bldg.	22	XRF	4/15/97	1	Room	19		Radiator	Solid	Metal	0.01
471	1916 Bldg.	23	XRF	4/15/97	1	Room	19	Wall	Wall	Solid	Wood	0
472	1916 Bldg.	24	XRF	4/15/97	1	Room	19	Cabinet	Door	Solid	Wood	0
473	1916 Bldg.	25	XRF	4/15/97	1	Room	19	Bulletin	Board	Solid	Metal	0
474	1916 Bldg.	26	XRF	4/15/97	1	Room	19	Window	Casing	Solid	Metal	0
475	1916 Bldg.	27	XRF	4/15/97	1	Room	19	Wall	Baseboard	Solid	Tile	2.99
476	1916 Bldg.	28	XRF	4/15/97	1	Room	19	Wall	Baseboard	Solid	Metal	0.01
477	1916 Bldg.	29	XRF	4/15/97	1	Room	20	Wall	Wall	Solid	Plaster	0.14
478	1916 Bldg.	30	XRF	4/15/97	1	Room	20	Wall	Wall	Solid	Tile	5.09
479	1916 Bldg.	31	XRF	4/15/97	1	Room	20	Wall	Wall	Solid	Drywall	0.06
480	1916 Bldg.	32	XRF	4/15/97	1	Room	20	Door	Door	Solid	Wood	0.34
481	1916 Bldg.	33	XRF	4/15/97	1	Room	20	Door	Casing	Solid	Wood	1.38
482	1916 Bldg.	34	XRF	4/15/97	1	Room	20	Window	Sash	Solid	Metal	0.03
483	1916 Bldg.	35	XRF	4/15/97	1	Room	20	Window	Casing	Solid	Wood	0.15
484	1916 Bldg.	36	XRF	4/15/97	1	Room	20	Window	Stool	Solid	Wood	0.12
485	1916 Bldg.	37	XRF	4/15/97	1	Room	20		Radiator	Solid	Metal	0.01
486	1916 Bldg.	38	XRF	4/15/97	1	Room	20	Radiator	Board	Solid	Wood	0
487	1916 Bldg.	39	XRF	4/15/97	1	Room	20	Wall	Midle Wall	Solid	Metal	5.09
488	1916 Bldg.	40	XRF	4/15/97	1	Room	20	Cabinet	Door	Solid	Wood	0
489	1916 Bldg.	41	XRF	4/15/97	1	Room	20	Chalk	Board	Solid	Metal	0
490	1916 Bldg.	42	XRF	4/15/97	1	Room	20	Window	Casing	Solid	Metal	0.04
491	1916 Bldg.	43	XRF	4/15/97	1	Room	20	Wall	Baseboard	Solid	Tile	2.06
492	1916 Bldg.	44	XRF	4/15/97	1	Room	20	Wall	Baseboard	Solid	Metal	0.55
493	1916 Bldg.	46	XRF	4/15/97	1	Room	21	Wall	Wall	Solid	Plaster	3.84
494	1916 Bldg.	47	XRF	4/15/97	1	Room	21	Wall	Wall	Solid	Tile	0.02
495	1916 Bldg.	48	XRF	4/15/97	1	Room	21	Wall	Wall	Solid	Drywall	0.04
496	1916 Bldg.	49	XRF	4/15/97	1	Room	21	Window	Sash	Solid	Metal	0.05
497	1916 Bldg.	50	XRF	4/15/97	1	Room	21	Window	Casing	Solid	Wood	0.15
498	1916 Bldg.	51	XRF	4/15/97	1	Room	21	Window	Stool	Solid	Wood	0.03
499	1916 Bldg.	52	XRF	4/15/97	1	Room	21		Radiator	Solid	Metal	0.03
500	1916 Bldg.	53	XRF	4/15/97	1	Room	21	Wall	Wall	Solid	Wood	0
501	1916 Bldg.	54	XRF	4/15/97	1	Room	21	Bulletin	Board	Solid	Wood	0.03
502	1916 Bldg.	55	XRF	4/15/97	1	Room	21	Bulletin	Board	Solid	Metal	0
503	1916 Bldg.	56	XRF	4/15/97	1	Room	21	Wall	Baseboard	Solid	Tile	2.79
504	1916 Bldg.	57	XRF	4/15/97	1	Room	21	Wall	Baseboard	Solid	Metal	0.02
505	1916 Bldg.	58	XRF	4/15/97	1	Room	21	Floor		Solid	Wood	0.02

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
506	1916 Bldg.	59	XRF	4/15/97	1	Room	22	Wall	Wall	Solid	Plaster	5.09
507	1916 Bldg.	60	XRF	4/15/97	1	Room	22	Wall	Wall	Solid	Tile	5.09
508	1916 Bldg.	61	XRF	4/15/97	1	Room	22	Wall	Baseboard	Solid	Tile	3.03
509	1916 Bldg.	62	XRF	4/15/97	1	Room	22	Wall	Baseboard	Solid	Metal	0.01
510	1916 Bldg.	63	XRF	4/15/97	1	Room	22	Wall	Wall	Solid	Drywall	0.01
511	1916 Bldg.	64	XRF	4/15/97	1	Room	22	Window	Casing	Solid	Wood	0.03
512	1916 Bldg.	65	XRF	4/15/97	1	Room	22	Bulletin	Board	Solid	Wood	0.05
513	1916 Bldg.	66	XRF	4/15/97	1	Room	22	Bulletin	Board	Solid	Wood	0.04
514	1916 Bldg.	67	XRF	4/15/97	1	Room	22	Bulletin	Board	Solid	Metal	0
515	1916 Bldg.	68	XRF	4/15/97	1	Room	22	Floor		Solid	Wood	0.03
516	1916 Bldg.	70	XRF	4/15/97	1	Room	23	Wall	Wall	Solid	Plaster	5.09
517	1916 Bldg.	71	XRF	4/15/97	1	Room	23	Ceiling		Solid	Plaster	5.09
518	1916 Bldg.	72	XRF	4/15/97	1	Room	23		Shelf	Solid	Wood	0.05
519	1916 Bldg.	73	XRF	4/15/97	1	Room	23		Shelf	Solid	Wood	0.12
520	1916 Bldg.	74	XRF	4/15/97	1	Room	23		Elec Panel	Solid	Metal	0.07
521	1916 Bldg.	75	XRF	4/15/97	1	Room	23	Floor		Solid	Concrte	0.03
522	1916 Bldg.	105	XRF	4/15/97	1	Room	25	Floor		Solid	Wood	0.39
523	1916 Bldg.	135	XRF	4/15/97	1	Room	26	Wall	Wall	Solid	Plaster	0.21
524	1916 Bldg.	136	XRF	4/15/97	1	Room	26	Wall	Wall	Solid		5.09
525	1916 Bldg.	137	XRF	4/15/97	1	Room	26	Wall	Midle Wall	Solid	Wood	0.3
526	1916 Bldg.	138	XRF	4/15/97	1	Room	26	Stairs	Hand rail	Solid	Wood	0
527	1916 Bldg.	139	XRF	4/15/97	1	Room	26	Wall	Diffuser	Solid	Metal	3.57
528	1916 Bldg.	140	XRF	4/15/97	1	Room	26	Wall	Baseboard	Solid	Tile	5.09
529	1916 Bldg.	141	XRF	4/15/97	1	Room	26	Wall	Wall	Solid	Wood	0
530	1916 Bldg.	142	XRF	4/15/97	1	Room	26	Ceiling		Solid	Plaster	0.27
531	1916 Bldg.	144	XRF	4/15/97	1	Room	27	Wall	Wall	Solid	Wood	0.06
532	1916 Bldg.	145	XRF	4/15/97	1	Room	27	Wall	Wall	Solid	Tile	1.12
533	1916 Bldg.	146	XRF	4/15/97	1	Room	27	Wall	Wall	Solid		0.92
534	1916 Bldg.	147	XRF	4/15/97	1	Room	27	Wall	Wall	Solid	Plaster	0
535	1916 Bldg.	148	XRF	4/15/97	1	Room	27	Wall	Wall	Solid	Plaster	0.01
536	1916 Bldg.	149	XRF	4/15/97	1	Room	27	Wall	Wall	Solid	Plaster	0.14
537	1916 Bldg.	150	XRF	4/15/97	1	Room	27	Wall	Baseboard	Solid	Concrte	5.09
538	1916 Bldg.	151	XRF	4/15/97	1	Room	27	Wall	Baseboard	Solid	Wood	5.09
539	1916 Bldg.	152	XRF	4/15/97	1	Room	27	Wall	Wall	Solid	Wood	0.02
540	1916 Bldg.	153	XRF	4/15/97	1	Room	27		Radiator	Solid	Metal	0.02
541	1916 Bldg.	154	XRF	4/15/97	1	Room	27	Floor		Solid	Wood	0
542	1916 Bldg.	155	XRF	4/15/97	1	Room	27	Cabinet	Door	Solid	Wood	0.01
543	1916 Bldg.	156	XRF	4/15/97	1	Room	27	Cabinet	Inside	Solid	Plaster	0.05
544	1916 Bldg.	163	XRF	4/15/97	1	Room	28	Wall	Wall	Solid	Wood	0.04
545	1916 Bldg.	164	XRF	4/15/97	1	Room	28	Wall	Wall	Solid	Tile	1.01
546	1916 Bldg.	165	XRF	4/15/97	1	Room	28	Wall	Wall	Solid	Tile	5.09
547	1916 Bldg.	166	XRF	4/15/97	1	Room	28	Wall	Baseboard	Solid	Concrte	5.09
548	1916 Bldg.	167	XRF	4/15/97	1	Room	28	Wall	Baseboard	Solid	Wood	2.57
549	1916 Bldg.	168	XRF	4/15/97	1	Room	28	Wall	Diffuser	Solid	Metal	0.01
550	1916 Bldg.	169	XRF	4/15/97	1	Room	28	Coat	Rack	Solid	Wood	0
551	1916 Bldg.	170	XRF	4/15/97	1	Room	28		Radiator	Solid	Metal	5.09
552	1916 Bldg.	171	XRF	4/15/97	1	Room	28	Wall	Elec. Tray	Solid	Metal	0.01
553	1916 Bldg.	172	XRF	4/15/97	1	Room	28	Chalk	Board	Solid	Metal	0
554	1916 Bldg.	173	XRF	4/15/97	1	Room	28	Wall	Midle Wall	Solid	Metal	0.04
555	1916 Bldg.	174	XRF	4/15/97	1	Room	28	Wall	Baseboard	Solid	Wood	3.88
556	1916 Bldg.	181	XRF	4/15/97	1	Room	29	Wall	Wall	Solid	Plaster	0.06
557	1916 Bldg.	182	XRF	4/15/97	1	Room	29	Wall	Wall	Solid	Wood	0.1
558	1916 Bldg.	183	XRF	4/15/97	1	Room	29	Wall	Wall	Solid	Plaster	0.07
559	1916 Bldg.	184	XRF	4/15/97	1	Room	29	Wall	Wall	Solid	Plaster	5.09
560	1916 Bldg.	185	XRF	4/15/97	1	Room	29	Wall	Baseboard	Solid	Tile	5.09
561	1916 Bldg.	186	XRF	4/15/97	1	Room	29	Wall	Baseboard	Solid	Metal	0.02
562	1916 Bldg.	187	XRF	4/15/97	1	Room	29	Door	Door	Solid	Wood	0.05
563	1916 Bldg.	188	XRF	4/15/97	1	Room	29	Door	Casing	Solid	Wood	0.03
564	1916 Bldg.	189	XRF	4/15/97	1	Room	29	Window	Sash	Solid	Metal	0
565	1916 Bldg.	190	XRF	4/15/97	1	Room	29	Window	Casing	Solid	Wood	0.13
566	1916 Bldg.	191	XRF	4/15/97	1	Room	29	Window	Stool	Solid	Wood	0.09
567	1916 Bldg.	192	XRF	4/15/97	1	Room	29	Chalk	Board	Solid	Wood	0.01
568	1916 Bldg.	193	XRF	4/15/97	1	Room	29	Floor		Solid	Wood	0.01

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
569	1916 Bldg.	194	XRF	4/15/97	1	Room	29	Ceiling		Solid	Plaster	0.07
570	1916 Bldg.	195	XRF	4/15/97	1	Room	30	Wall	Wall	Solid	Plaster	0.07
571	1916 Bldg.	196	XRF	4/15/97	1	Room	30	Wall	Wall	Solid	Plaster	0.1
572	1916 Bldg.	197	XRF	4/15/97	1	Room	30	Wall	Wall	Solid	Plaster	5.09
573	1916 Bldg.	198	XRF	4/15/97	1	Room	30	Door	Door	Solid	Wood	0.04
574	1916 Bldg.	199	XRF	4/15/97	1	Room	30	Door	Casing	Solid	Wood	0.02
575	1916 Bldg.	200	XRF	4/15/97	1	Room	30	Wall	Wall	Solid	Plaster	0.06
576	1916 Bldg.	201	XRF	4/15/97	1	Room	30	Wall	Baseboard	Solid	Wood	0.2
577	1916 Bldg.	202	XRF	4/15/97	1	Room	30	Window	Sash	Solid	Metal	0.02
578	1916 Bldg.	203	XRF	4/15/97	1	Room	30	Window	Casing	Solid	Wood	0.03
579	1916 Bldg.	204	XRF	4/15/97	1	Room	30	Window	Stool	Solid	Wood	0.22
580	1916 Bldg.	205	XRF	4/15/97	1	Room	30		Radiator	Solid	Metal	5.09
581	1916 Bldg.	206	XRF	4/15/97	1	Room	30		Radiator	Solid		4.45
582	1916 Bldg.	207	XRF	4/15/97	1	Room	30	Wall	Midle Wall	Solid	Wood	0.06
583	1916 Bldg.	208	XRF	4/15/97	1	Room	30	Floor		Solid	Wood	0.01
584	1916 Bldg.	209	XRF	4/15/97	1	Room	30	Floor		Solid	Wood	0.01
585	1916 Bldg.	210	XRF	4/15/97	1	Room	30	Cabinet	Shelf	Solid	Wood	0
586	1916 Bldg.	211	XRF	4/15/97	1	Room	30	Wall	Diffuser	Solid	Metal	0.12
587	1916 Bldg.	212	XRF	4/15/97	1	Room	31	Wall	Wall	Solid	Plaster	0.34
588	1916 Bldg.	213	XRF	4/15/97	1	Room	31	Wall	Midle Wall	Solid	Wood	0.26
589	1916 Bldg.	214	XRF	4/15/97	1	Room	31	Wall	Wall	Solid	Tile	4.5
590	1916 Bldg.	215	XRF	4/15/97	1	Room	31	Wall	Baseboard	Solid	Tile	5.09
591	1916 Bldg.	216	XRF	4/15/97	1	Room	31	Wall	Baseboard	Solid	Metal	0.02
592	1916 Bldg.	217	XRF	4/15/97	1	Room	31	Door	Door	Solid	Wood	0.35
593	1916 Bldg.	218	XRF	4/15/97	1	Room	31	Door	Casing	Solid	Wood	0.46
594	1916 Bldg.	219	XRF	4/15/97	1	Room	31	Window	Sash	Solid	Metal	0.01
595	1916 Bldg.	220	XRF	4/15/97	1	Room	31	Door	Casing	Solid	Wood	0.03
596	1916 Bldg.	221	XRF	4/15/97	1	Room	31	Window	Stool	Solid	Wood	0.04
597	1916 Bldg.	222	XRF	4/15/97	1	Room	31		Radiator	Solid	Metal	0.06
598	1916 Bldg.	223	XRF	4/15/97	1	Room	31	Bulletin	Board	Solid	Wood	0.64
599	1916 Bldg.	224	XRF	4/15/97	1	Room	31	Bulletin	Board	Solid	Wood	0.04
600	1916 Bldg.	225	XRF	4/15/97	1	Room	31	Floor		Solid	Wood	0.01
601	1916 Bldg.	226	XRF	4/15/97	1	Room	31	Coat	Rack	Solid	Wood	0
602	1916 Bldg.	227	XRF	4/15/97	1	Room	31	Wall	Diffuser	Solid	Metal	0.03
603	1916 Bldg.	228	XRF	4/15/97	1	Room	31	Cabinet	Door	Solid	Wood	0.04
604	1916 Bldg.	229	XRF	4/15/97	1	Room	31	Wall	Wall	Solid	Plaster	0.12
605	1916 Bldg.	230	XRF	4/15/97	1	Room	32	Wall	Wall	Solid	Plaster	0.04
606	1916 Bldg.	231	XRF	4/15/97	1	Room	32	Wall	Wall	Solid	Wood	0.04
607	1916 Bldg.	232	XRF	4/15/97	1	Room	32	Wall	Wall	Solid	Tile	5.09
608	1916 Bldg.	233	XRF	4/15/97	1	Room	32	Wall	Midle Wall	Solid	Wood	0.05
609	1916 Bldg.	234	XRF	4/15/97	1	Room	32	Wall	Baseboard	Solid	Tile	4.22
610	1916 Bldg.	235	XRF	4/15/97	1	Room	32	Wall	Baseboard	Solid	Metal	0.03
611	1916 Bldg.	236	XRF	4/15/97	1	Room	32	Window	Sash	Solid	Metal	0.02
612	1916 Bldg.	237	XRF	4/15/97	1	Room	32	Window	Casing	Solid	Wood	0.04
613	1916 Bldg.	238	XRF	4/15/97	1	Room	32		Radiator	Solid	Metal	4.44
614	1916 Bldg.	239	XRF	4/15/97	1	Room	32	Wall	Wall	Solid	Wood	0
615	1916 Bldg.	240	XRF	4/15/97	1	Room	32	Bulletin	Board	Solid	Wood	0.03
616	1916 Bldg.	241	XRF	4/15/97	1	Room	32	Wall	Diffuser	Solid	Metal	0.07
617	1916 Bldg.	242	XRF	4/15/97	1	Room	32	Ceiling		Solid	Plaster	0.06
618	1916 Bldg.	243	XRF	4/15/97	1	Room	32	Floor		Solid	Wood	0
619	1916 Bldg.	244	XRF	4/15/97	1	Room	32	Bookcase	Shelf	Solid	Wood	0.1
620	1916 Bldg.	6	XRF	4/17/97	1	Room	33	Wall	Wall	Cracked	Plaster	0.13
621	1916 Bldg.	7	XRF	4/17/97	1	Room	33	Wall	Wall	Cracked	Plaster	0.14
622	1916 Bldg.	8	XRF	4/17/97	1	Room	33	Wall	Wall	Solid	Tile	5.09
623	1916 Bldg.	9	XRF	4/17/97	1	Room	33	Window	Stool	Solid	Wood	0.18
624	1916 Bldg.	10	XRF	4/17/97	1	Room	33	Window	Casing	Solid	Wood	0.07
625	1916 Bldg.	11	XRF	4/17/97	1	Room	33		Radiator	Solid	Metal	5.09
626	1916 Bldg.	12	XRF	4/17/97	1	Room	33	Wall	Baseboard	Solid	Wood	0.04
627	1916 Bldg.	13	XRF	4/17/97	1	Room	33	Wall	Chair rail	Solid	Wood	0.05
628	1916 Bldg.	14	XRF	4/17/97	1	Room	33	Cabinet	Door	Solid	Wood	0
629	1916 Bldg.	15	XRF	4/17/97	1	Room	33	Ceiling		Solid	Plaster	0.14
630	1916 Bldg.	29	XRF	4/17/97	1	Room	34	Wall	Wall	Solid	Plaster	0.11
631	1916 Bldg.	30	XRF	4/17/97	1	Room	34	Wall	Wall	Solid	Plaster	0.07

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compon	Feature	Condition	Substrate	Result
632	1916 Bldg.	31	XRF	4/17/97	1	Room	34	Door	Door	Solid	Wood	0.03
633	1916 Bldg.	32	XRF	4/17/97	1	Room	34	Window	Stool	Solid	Wood	0.07
634	1916 Bldg.	33	XRF	4/17/97	1	Room	34	Wall	Wall	Cracked	Plaster	5.09
635	1916 Bldg.	34	XRF	4/17/97	1	Room	34		Radiator	Peeling	Metal	5.09
636	1916 Bldg.	35	XRF	4/17/97	1	Room	34	Floor		Solid	Wood	0.02
637	1916 Bldg.	36	XRF	4/17/97	1	Room	34	Wall	Chair rail	Solid	Wood	0.07
638	1916 Bldg.	37	XRF	4/17/97	1	Room	34	Ceiling		Solid	Plaster	0.12
639	1916 Bldg.	51	XRF	4/17/97	1	Room	35	Wall	Wall	Solid	Drywall	0.02
640	1916 Bldg.	52	XRF	4/17/97	1	Room	35	Door	Door	Solid	Wood	0.2
641	1916 Bldg.	53	XRF	4/17/97	1	Room	35	Door	Casing	Solid	Wood	0.2
642	1916 Bldg.	62	XRF	4/17/97	0	Room	36	Wall	Wall	Solid	Plaster	0.04
643	1916 Bldg.	63	XRF	4/17/97	0	Room	36	Wall	Wall	Solid	Plaster	0.1
644	1916 Bldg.	64	XRF	4/17/97	0	Room	36	Wall	Wall	Solid	Tile	5.09
645	1916 Bldg.	65	XRF	4/17/97	0	Room	36	Wall	Wall	Solid	Tile	5.09
646	1916 Bldg.	66	XRF	4/17/97	0	Room	36	Wall	Middle Wall	Solid	Wood	0.01
647	1916 Bldg.	67	XRF	4/17/97	0	Room	36	Window	Stool	Solid	Wood	0.06
648	1916 Bldg.	68	XRF	4/17/97	0	Room	36	Window	Casing	Solid	Wood	0.03
649	1916 Bldg.	69	XRF	4/17/97	0	Room	36		Radiator	Peeling	Metal	5.09
650	1916 Bldg.	70	XRF	4/17/97	0	Room	36	Chalk	Board	Solid	Wood	0.02
651	1916 Bldg.	71	XRF	4/17/97	0	Room	36	Bookcase	Shelf	Peeling	Wood	1.21
652	1916 Bldg.	72	XRF	4/17/97	0	Room	36	Cabinet	Inside	Solid	Wood	0.97
653	1916 Bldg.	73	XRF	4/17/97	0	Room	36	Wall	Chair rail	Solid	Wood	0.04
654	1916 Bldg.	74	XRF	4/17/97	0	Room	36	Wall	Chair rail	Solid	Wood	0.04
655	1916 Bldg.	75	XRF	4/17/97	0	Room	36	Wall	Wall Rgstr	Solid	Metal	0.13
656	1916 Bldg.	76	XRF	4/17/97	0	Room	36	Wall	Baseboard	Solid	Tile	3.87
657	1916 Bldg.	77	XRF	4/17/97	0	Room	36	Floor		Solid	Wood	0.02
658	1916 Bldg.	78	XRF	4/17/97	0	Room	36	Ceiling		Solid	Plaster	0.07
659	1916 Bldg.	87	XRF	4/17/97	0	Room	37	Wall	Middle Wall	Solid	Concrte	0.03
660	1916 Bldg.	88	XRF	4/17/97	0	Room	37	Wall	Middle Wall	Solid	Concrte	1.43
661	1916 Bldg.	89	XRF	4/17/97	0	Room	37	Door	Door	Solid	Wood	0.05
662	1916 Bldg.	90	XRF	4/17/97	0	Room	37	Door	Casing	Solid	Wood	0.02
663	1916 Bldg.	91	XRF	4/17/97	0	Room	37	Window	Stool	Solid	Wood	0.07
664	1916 Bldg.	92	XRF	4/17/97	0	Room	37	Window	Casing	Solid	Wood	0.02
665	1916 Bldg.	93	XRF	4/17/97	0	Room	37	Wall	Wall Rgstr	Solid	Metal	0.06
666	1916 Bldg.	94	XRF	4/17/97	0	Room	37	Wall	Backboard	Solid	Wood	0.03
667	1916 Bldg.	95	XRF	4/17/97	0	Room	37	Wall	Middle Wall	Peeling	Wood	0
668	1916 Bldg.	96	XRF	4/17/97	0	Room	37	Floor		Solid	Wood	0.01
669	1916 Bldg.	97	XRF	4/17/97	0	Room	37	Floor		Solid	Wood	0.01
670	1916 Bldg.	98	XRF	4/17/97	0	Room	37	Floor		Solid	Wood	0
671	1916 Bldg.	99	XRF	4/17/97	0	Room	37	Floor		Solid	Wood	1.79
672	1916 Bldg.	100	XRF	4/17/97	0	Room	38	Wall	Wall	Solid	Concrte	0.2
673	1916 Bldg.	101	XRF	4/17/97	0	Room	38	Window	Stool	Solid	Wood	0.06
674	1916 Bldg.	102	XRF	4/17/97	0	Room	38		Radiator	Peeling	Metal	4.38
675	1916 Bldg.	103	XRF	4/17/97	0	Room	38	Floor		Peeling	Concrte	0.29
676	1916 Bldg.	104	XRF	4/17/97	0	Room	38	Coat	Rack	Solid	Wood	0.04
677	1916 Bldg.	105	XRF	4/17/97	0	Room	38		Ball Box	Solid	Wood	0
678	1916 Bldg.	113	XRF	4/17/97	0	Room	39	Wall	Wall	Peeling	Concrte	0.08
679	1916 Bldg.	114	XRF	4/17/97	0	Room	39	Wall	Middle Wall	Peeling	Concrte	0.03
680	1916 Bldg.	115	XRF	4/17/97	0	Room	39	Wall	Middle Wall	Solid	Wood	0.04
681	1916 Bldg.	116	XRF	4/17/97	0	Room	39	Door	Door	Solid	Wood	0.05
682	1916 Bldg.	117	XRF	4/17/97	0	Room	39	Ceiling		Solid	Concrte	0.01
683	1916 Bldg.	118	XRF	4/17/97	0	Room	39	Closet	Wall	Solid	Concrte	0.02
684	1916 Bldg.	123	XRF	4/17/97	0	Room	40	Wall	Middle Wall	Solid	Concrte	0.02
685	1916 Bldg.	124	XRF	4/17/97	0	Room	40		Elec Panel	Solid	Metal	0.06
686	1916 Bldg.	125	XRF	4/17/97	0	Room	40	Door	Door	Solid	Wood	5.09
687	1916 Bldg.	126	XRF	4/17/97	0	Room	40	Door	Jamb	Solid	Wood	5.09
688	1916 Bldg.	135	XRF	4/17/97	0	Room	41	Wall	Wall	Peeling	Concrte	0
689	1916 Bldg.	136	XRF	4/17/97	0	Room	41	Wall	Wall	Peeling	Concrte	0.04
690	1916 Bldg.	137	XRF	4/17/97	0	Room	41	Wall	Wall	Peeling	Concrte	0.01
691	1916 Bldg.	138	XRF	4/17/97	0	Room	41	Door	Door	Peeling	Metal	3.71
692	1916 Bldg.	139	XRF	4/17/97	0	Room	41	Door	Casing	Solid	Metal	3.71
693	1916 Bldg.	140	XRF	4/17/97	0	Room	41	Door	Door	Peeling	Wood	5.09
694	1916 Bldg.	141	XRF	4/17/97	0	Room	41	Door	Jamb	Solid	Wood	3.78

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compon	Feature	Condition	Substrate	Result
695	1916 Bldg.	142	XRF	4/17/97	0	Room	41	Window	Sash	Peeling	Wood	0.04
696	1916 Bldg.	143	XRF	4/17/97	0	Room	41	Window	Sash	Peeling	Wood	0.01
697	1916 Bldg.	144	XRF	4/17/97	0	Room	41	Ceiling		Peeling	Concrte	0.02
698	1916 Bldg.	145	XRF	4/17/97	0	Room	41	Door	Door	Peeling	Wood	0.01
699	1916 Bldg.	146	XRF	4/17/97	0	Room	41	Wall	Midle Wall	Peeling	Wood	5.09
700	1916 Bldg.	147	XRF	4/17/97	0	Room	41	Stairs	Riser	Peeling	Concrte	0.27
701	1916 Bldg.	148	XRF	4/17/97	0	Room	42	Wall	Midle Wall	Peeling	Concrte	0.02
702	1916 Bldg.	149	XRF	4/17/97	0	Room	42	Bookcase	Inside	Peeling	Wood	0.01
703	1916 Bldg.	150	XRF	4/17/97	0	Room	45	Wall	Wall	Peeling	Concrte	0.03
704	1916 Bldg.	151	XRF	4/17/97	0	Room	45	Wall	Midle Wall	Peeling	Wood	0.08
705	1916 Bldg.	152	XRF	4/17/97	0	Room	45	Floor		Peeling	Concrte	0.89
706	1916 Bldg.	153	XRF	4/17/97	0	Room	45	Wall	Hatch	Peeling	Wood	3.25
707	1916 Bldg.	164	XRF	4/17/97	0	Room	46	Wall	Wall	Solid	Plaster	0.07
708	1916 Bldg.	165	XRF	4/17/97	0	Room	46	Wall	Wall	Solid	Plaster	0.06
709	1916 Bldg.	166	XRF	4/17/97	0	Room	46	Wall	Wall	Solid	Tile	5.09
710	1916 Bldg.	167	XRF	4/17/97	0	Room	46	Wall	Wall	Solid	Tile	5.09
711	1916 Bldg.	168	XRF	4/17/97	0	Room	46	Wall	Baseboard	Solid	Tile	4.1
712	1916 Bldg.	169	XRF	4/17/97	0	Room	46	Window	Stool	Solid	Wood	0.04
713	1916 Bldg.	170	XRF	4/17/97	0	Room	46	Window	Casing	Solid	Wood	0.04
714	1916 Bldg.	171	XRF	4/17/97	0	Room	46		Radiator	Peeling	Metal	5.09
715	1916 Bldg.	172	XRF	4/17/97	0	Room	46	Radiator	Board	Solid	Wood	0
716	1916 Bldg.	173	XRF	4/17/97	0	Room	46	Wall	Chair rail	Solid	Wood	0.03
717	1916 Bldg.	174	XRF	4/17/97	0	Room	46	Chalk	Board	Solid	Wood	0.02
718	1916 Bldg.	175	XRF	4/17/97	0	Room	46	Floor		Solid	Wood	0.01
719	1916 Bldg.	176	XRF	4/17/97	0	Room	46	Wall	Chair rail	Solid	Wood	0.17
720	1916 Bldg.	177	XRF	4/17/97	0	Room	46	Wall	Wall Rgstr	Solid	Metal	0.11
721	1916 Bldg.	178	XRF	4/17/97	0	Room	46	Ceiling		Solid	Plaster	0.07
722	1916 Bldg.	106	XRF	4/15/97	1	Room	25A	Wall	Wall	Solid	Plaster	0.12
723	1916 Bldg.	107	XRF	4/15/97	1	Room	25A	Wall	Wall	Solid	Plaster	5.09
724	1916 Bldg.	108	XRF	4/15/97	1	Room	25A	Wall	Baseboard	Solid	Wood	0.02
725	1916 Bldg.	109	XRF	4/15/97	1	Room	25A	Ceiling		Solid	Plaster	0.13
726	1916 Bldg.	110	XRF	4/15/97	1	Room	25A	Floor		Solid	Wood	0.01
727	1916 Bldg.	111	XRF	4/15/97	1	Room	25A	Wall	Midle Wall	Solid	Wood	0
728	1916 Bldg.	112	XRF	4/15/97	1	Room	25B	Wall	Wall	Solid	Plaster	3.03
729	1916 Bldg.	113	XRF	4/15/97	1	Room	25B	Wall	Wall	Solid	Plaster	5.09
730	1916 Bldg.	114	XRF	4/15/97	1	Room	25B	Wall	Baseboard	Solid	Wood	0.19
731	1916 Bldg.	115	XRF	4/15/97	1	Room	25B	Ceiling		Solid	Plaster	0.05
732	1916 Bldg.	116	XRF	4/15/97	1	Room	25B		Shelf	Solid	Wood	0
733	1916 Bldg.	117	XRF	4/15/97	1	Room	25B	Floor		Solid	Wood	0.01
734	1916 Bldg.	76	XRF	4/8/97	1	Room	2A	Wall	Wall	Solid	Plaster	0.08
735	1916 Bldg.	77	XRF	4/8/97	1	Room	2A	Wall	Wall	Solid	Tile	5.09
736	1916 Bldg.	78	XRF	4/8/97	1	Room	2A	Wall	Baseboard	Solid	Tile	3.69
737	1916 Bldg.	79	XRF	4/8/97	1	Room	2A	Wall	Chair rail	Solid	Wood	0.02
738	1916 Bldg.	80	XRF	4/8/97	1	Room	2A	Floor		Solid	Wood	0.02
739	1916 Bldg.	81	XRF	4/8/97	1	Room	2A	Coat	Rack	Solid	Metal	0.06
740	1916 Bldg.	82	XRF	4/8/97	1	Room	2A	Window	Stool	Solid	Wood	0.02
741	1916 Bldg.	83	XRF	4/8/97	1	Room	2A	Cabinet	Inside	Solid	Wood	0.01
742	1916 Bldg.	84	XRF	4/8/97	1	Room	2A	Ceiling		Solid	Plaster	0.03
743	1916 Bldg.	245	XRF	4/15/97	1	Room	32A	Wall	Wall	Solid	Plaster	0.03
744	1916 Bldg.	246	XRF	4/15/97	1	Room	32A	Wall	Midle Wall	Solid	Wood	0.04
745	1916 Bldg.	247	XRF	4/15/97	1	Room	32A	Wall	Wall	Solid	Plaster	0.2
746	1916 Bldg.	248	XRF	4/15/97	1	Room	32A	Wall	Wall	Solid	Tile	5.09
747	1916 Bldg.	249	XRF	4/15/97	1	Room	32A	Wall	Baseboard	Solid	Tile	2.66
748	1916 Bldg.	250	XRF	4/15/97	1	Room	32A	Wall	Baseboard	Solid	Metal	0.02
749	1916 Bldg.	251	XRF	4/15/97	1	Room	32A	Window	Sash	Solid	Metal	0.01
750	1916 Bldg.	252	XRF	4/15/97	1	Room	32A	Window	Casing	Solid	Wood	0.03
751	1916 Bldg.	253	XRF	4/15/97	1	Room	32A	Coat	Rack	Solid	Wood	0.01
752	1916 Bldg.	254	XRF	4/15/97	1	Room	32A	Wall	Midle Wall	Solid	Metal	0.06
753	1916 Bldg.	255	XRF	4/15/97	1	Room	32A	Cabinet	Door	Solid	Wood	0.02
754	1916 Bldg.	256	XRF	4/15/97	1	Room	32A	Floor		Solid	Wood	0.01
755	1916 Bldg.	257	XRF	4/15/97	1	Room	32A	Ceiling		Solid	Plaster	0.03
756	1916 Bldg.	79	XRF	4/17/97	0	Room	36A	Wall	Wall	Solid	Plaster	0.07
757	1916 Bldg.	80	XRF	4/17/97	0	Room	36A	Wall	Wall	Solid	Tile	5.09

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
758	1916 Bldg.	81	XRF	4/17/97	0	Room	36A	Window	Stool	Solid	Wood	0.05
759	1916 Bldg.	82	XRF	4/17/97	0	Room	36A	Cabinet	Door	Solid	Wood	0.02
760	1916 Bldg.	83	XRF	4/17/97	0	Room	36A	Wall	Baseboard	Solid	Tile	5.09
761	1916 Bldg.	84	XRF	4/17/97	0	Room	36A	Wall	Chair rail	Solid	Wood	0.07
762	1916 Bldg.	85	XRF	4/17/97	0	Room	36A	Floor		Solid	Wood	0.01
763	1916 Bldg.	86	XRF	4/17/97	0	Room	36A	Ceiling		Solid	Plaster	0.09
764	1916 Bldg.	114	XRF	4/8/97	1	Room	3A	Wall	Wall	Solid	Plaster	0.1
765	1916 Bldg.	115	XRF	4/8/97	1	Room	3A	Wall	Wall	Solid	Tile	5.09
766	1916 Bldg.	116	XRF	4/8/97	1	Room	3A	Wall	Baseboard	Solid	Tile	2.24
767	1916 Bldg.	117	XRF	4/8/97	1	Room	3A	Door	Door	Solid	Wood	0.04
768	1916 Bldg.	118	XRF	4/8/97	1	Room	3A	Wall	Chair rail	Solid	Wood	0.03
769	1916 Bldg.	119	XRF	4/8/97	1	Room	3A	Coat	Rack	Solid	Wood	0.05
770	1916 Bldg.	120	XRF	4/8/97	1	Room	3A	Ceiling		Cracked	Plaster	0.09
771	1916 Bldg.	179	XRF	4/17/97	0	Room	46A	Wall	Wall	Solid	Plaster	0.16
772	1916 Bldg.	180	XRF	4/17/97	0	Room	46A	Wall	Wall	Solid	Tile	5.09
773	1916 Bldg.	181	XRF	4/17/97	0	Room	46A	Wall	Baseboard	Solid	Tile	4.21
774	1916 Bldg.	182	XRF	4/17/97	0	Room	46A	Window	Stool	Solid	Wood	0.04
775	1916 Bldg.	183	XRF	4/17/97	0	Room	46A	Wall	Chair rail	Solid	Wood	0.03
776	1916 Bldg.	184	XRF	4/17/97	0	Room	46A	Coat	Rack	Solid	Metal	0.07
777	1916 Bldg.	185	XRF	4/17/97	0	Room	46A	Closet	Wall	Solid	Wood	0.01
778	1916 Bldg.	186	XRF	4/17/97	0	Room	46A	Cabinet	Door	Solid	Wood	0.04
779	1916 Bldg.	187	XRF	4/17/97	0	Room	46A	Ceiling		Solid	Plaster	0.07
780	1916 Bldg.	139	XRF	4/8/97	1	Room	4A	Wall	Wall	Cracked	Plaster	0.08
781	1916 Bldg.	140	XRF	4/8/97	1	Room	4A	Wall	Wall	Solid	Tile	5.09
782	1916 Bldg.	141	XRF	4/8/97	1	Room	4A	Wall	Baseboard	Solid	Tile	2.1
783	1916 Bldg.	142	XRF	4/8/97	1	Room	4A	Window	Stool	Solid	Wood	0.04
784	1916 Bldg.	143	XRF	4/8/97	1	Room	4A	Window	Casing	Solid	Wood	0.19
785	1916 Bldg.	144	XRF	4/8/97	1	Room	4A	Pole	Casing	Peeling	Metal	5.09
786	1916 Bldg.	145	XRF	4/8/97	1	Room	4A	Coat	Rack	Solid	Wood	0.11
787	1916 Bldg.	146	XRF	4/8/97	1	Room	4A	Wall	Chair rail	Solid	Wood	0.08
788	1916 Bldg.	147	XRF	4/8/97	1	Room	4A	Ceiling		Cracked	Plaster	0.07
789	1916 Bldg.	166	XRF	4/8/97	1	Room	5A	Wall	Wall	Cracked	Plaster	0.07
790	1916 Bldg.	167	XRF	4/8/97	1	Room	5A	Wall	Wall	Cracked	Tile	5.09
791	1916 Bldg.	168	XRF	4/8/97	1	Room	5A	Wall	Baseboard	Cracked	Tile	1.9
792	1916 Bldg.	169	XRF	4/8/97	1	Room	5A	Wall	Chair rail	Solid	Wood	0.03
793	1916 Bldg.	170	XRF	4/8/97	1	Room	5A	Window	Stool	Solid	Wood	0.05
794	1916 Bldg.	171	XRF	4/8/97	1	Room	5A	Coat	Rack	Solid	Wood	0.06
795	1916 Bldg.	172	XRF	4/8/97	1	Room	5A	Door	Door	Solid	Wood	0.04
796	1916 Bldg.	173	XRF	4/8/97	1	Room	5A	Ceiling		Cracked	Plaster	0.06
797	1916 Bldg.	90	XRF	4/15/97	1	Stage	25	Wall	Wall	Solid	Wood	0.05
798	1916 Bldg.	91	XRF	4/15/97	1	Stage	25	Wall	Wall	Solid	Stucco	0.04
799	1916 Bldg.	92	XRF	4/15/97	1	Stage	25	Wall	Baseboard	Solid	Metal	0.01
800	1916 Bldg.	93	XRF	4/15/97	1	Stage	25	Stairs	Tread	Cracked	Wood	0.07
801	1916 Bldg.	94	XRF	4/15/97	1	Stage	25	Wall	Wall	Solid	Plaster	3.02
802	1916 Bldg.	95	XRF	4/15/97	1	Stage	25	Wall	Baseboard	Solid	Wood	0.06
803	1916 Bldg.	96	XRF	4/15/97	1	Stage	25	Wall	Wall	Solid	Plaster	5.09
804	1916 Bldg.	97	XRF	4/15/97	1	Stage	25	Wall	Wall	Solid	Plaster	3.51
805	1916 Bldg.	98	XRF	4/15/97	1	Stage	25	Wall	Wall	Solid	Wood	0.15
806	1916 Bldg.	99	XRF	4/15/97	1	Stage	25	Wall	Wall	Solid	Plaster	5.09
807	1916 Bldg.	100	XRF	4/15/97	1	Stage	25	Wall	Wall	Solid	Plaster	5.09
808	1916 Bldg.	101	XRF	4/15/97	1	Stage	25		Elec Panel	Solid	Metal	0.02
809	1916 Bldg.	102	XRF	4/15/97	1	Stage	25	Door	Door	Solid	Wood	0.03
810	1916 Bldg.	103	XRF	4/15/97	1	Stage	25	Door	Casing	Solid	Wood	0.03
811	1916 Bldg.	104	XRF	4/15/97	1	Stage	25	Floor		Solid	Wood	0.01
812	1916 Bldg.	157	XRF	4/15/97	1	Stairwell	1	Wall	Wall	Peeling	Concrte	0.05
813	1916 Bldg.	158	XRF	4/15/97	1	Stairwell	1	Door	Door	Peeling	Metal	0.21
814	1916 Bldg.	159	XRF	4/15/97	1	Stairwell	1	Door	Header	Peeling	Metal	0.18
815	1916 Bldg.	160	XRF	4/15/97	1	Stairwell	1	Window	Casing	Peeling	Wood	2.77
816	1916 Bldg.	161	XRF	4/15/97	1	Stairwell	1	Window	Casing	Peeling	Wood	5.09
817	1916 Bldg.	162	XRF	4/15/97	1	Stairwell	1	Wall	Wall	Peeling	Concrte	0
818	1916 Bldg.	175	XRF	4/15/97	1	Stairwell	2	Wall	Wall	Solid	Wood	0.05
819	1916 Bldg.	176	XRF	4/15/97	1	Stairwell	2	Wall	Wall	Solid	Plaster	0.15
820	1916 Bldg.	177	XRF	4/15/97	1	Stairwell	2	Wall	Wall	Solid	Plaster	5.09

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
821	1916 Bldg.	178	XRF	4/15/97	1	Stairwell	2	Celling		Solid	Plaster	0.11
822	1916 Bldg.	179	XRF	4/15/97	1	Stairwell	2	Stairs	Hand rail	Solid	Wood	0.02
823	1916 Bldg.	180	XRF	4/15/97	1	Stairwell	2	Floor		Cracked	Concrte	0.49
824	1916 Bldg.	16	XRF	4/17/97	1	Stairwell	3	Wall	Midle Wall	Solid	Tile	5.09
825	1916 Bldg.	17	XRF	4/17/97	1	Stairwell	3	Wall	Midle Wall	Solid	Plaster	5.09
826	1916 Bldg.	18	XRF	4/17/97	1	Stairwell	3	Wall	Wall	Solid	Drywall	0.01
827	1916 Bldg.	19	XRF	4/17/97	1	Stairwell	3	Stairs	Hand rail	Solid	Metal	0.06
828	1916 Bldg.	20	XRF	4/17/97	1	Stairwell	3		Radiator	Solid	Metal	5.09
829	1916 Bldg.	21	XRF	4/17/97	1	Stairwell	3	Door	Door	Peeling	Wood	0.9
830	1916 Bldg.	22	XRF	4/17/97	1	Stairwell	3	Door	Jamb	Peeling	Metal	0.06
831	1916 Bldg.	23	XRF	4/17/97	1	Stairwell	3	Ceiling		Solid	Plaster	0.19
832	1916 Bldg.	24	XRF	4/17/97	1	Stairwell	3	Window	Sash	Solid	Wood	0.27
833	1916 Bldg.	25	XRF	4/17/97	1	Stairwell	3	Wall	Midle Wall	Solid	Drywall	0.01
834	1916 Bldg.	26	XRF	4/17/97	1	Stairwell	3	Wall	Wall Rgstr	Solid	Metal	0.14
835	1916 Bldg.	27	XRF	4/17/97	1	Stairwell	3	Ceiling		Solid	Plaster	0.16
836	1916 Bldg.	28	XRF	4/17/97	1	Stairwell	3	Floor		Peeling	Concrte	0.05
837	1916 Bldg.	38	XRF	4/17/97	1	Stairwell	4	Wall	Wall	Solid	Drywall	0.22
838	1916 Bldg.	39	XRF	4/17/97	1	Stairwell	4	Wall	Wall	Solid	Drywall	0
839	1916 Bldg.	40	XRF	4/17/97	1	Stairwell	4	Wall	Wall	Solid	Plaster	0.23
840	1916 Bldg.	41	XRF	4/17/97	1	Stairwell	4	Stairs	Wall	Solid	Tile	5.09
841	1916 Bldg.	42	XRF	4/17/97	1	Stairwell	4	Stairs	Wall	Solid	Tile	5.09
842	1916 Bldg.	43	XRF	4/17/97	1	Stairwell	4	Ceiling		Solid	Plaster	0.06
843	1916 Bldg.	44	XRF	4/17/97	1	Stairwell	4	Stairs	Hand rail	Peeling	Metal	0.02
844	1916 Bldg.	45	XRF	4/17/97	1	Stairwell	4	Door	Door	Peeling	Wood	0.35
845	1916 Bldg.	46	XRF	4/17/97	1	Stairwell	4	Door	Jamb	Peeling	Metal	0.04
846	1916 Bldg.	47	XRF	4/17/97	1	Stairwell	4	Window	Sash	Solid	Wood	0.23
847	1916 Bldg.	48	XRF	4/17/97	1	Stairwell	4	Door	Casing	Solid	Wood	0.04
848	1916 Bldg.	49	XRF	4/17/97	1	Stairwell	4		Radiator	Peeling	Metal	0.47
849	1916 Bldg.	50	XRF	4/17/97	1	Stairwell	4	Stairs	Baseboard	Peeling	Concrte	0.03
850	1916 Bldg.	119	XRF	4/17/97	0	Stairwell	5	Wall	Wall	Solid	Plaster	0.2
851	1916 Bldg.	120	XRF	4/17/97	0	Stairwell	5	Floor		Peeling	Concrte	0.14
852	1916 Bldg.	121	XRF	4/17/97	0	Stairwell	5	Stairs	Hand rail	Solid	Metal	0.03
853	1916 Bldg.	122	XRF	4/17/97	0	Stairwell	5	Ceiling		Peeling	Plaster	0.22
854	1916 Bldg.	127	XRF	4/17/97	0	Stairwell	6	Wall	Midle Wall	Peeling	Concrte	0.01
855	1916 Bldg.	128	XRF	4/17/97	0	Stairwell	6	Stairs	Tread	Peeling	Concrte	0.3
856	1916 Bldg.	129	XRF	4/17/97	0	Stairwell	6	Stairs	Hand rail	Peeling	Metal	0.66
857	1916 Bldg.	130	XRF	4/17/97	0	Stairwell	6	Wall	Wall	Peeling	Tile	0.02
858	1916 Bldg.	131	XRF	4/17/97	0	Stairwell	6	Door	Door	Solid	Wood	0.61
859	1916 Bldg.	132	XRF	4/17/97	0	Stairwell	6	Door	Jamb	Solid	Wood	5.09
860	1916 Bldg.	133	XRF	4/17/97	0	Stairwell	6	Ceiling		Peeling	Wood	0.02
861	1916 Bldg.	134	XRF	4/17/97	0	Stairwell	6	Ceiling		Peeling	Concrte	0.02
862	1921 & 1923 Bldgs.	96	XRF	4/19/97	0	Hall	8	Wall	Wall	Solid	Plaster	0.29
863	1921 & 1923 Bldgs.	97	XRF	4/19/97	0	Hall	8	Wall	Wall	Solid	Plaster	3.24
864	1921 & 1923 Bldgs.	98	XRF	4/19/97	0	Hall	8	Wall	Wall	Solid	Plaster	5.09
865	1921 & 1923 Bldgs.	99	XRF	4/19/97	0	Hall	8	Wall	Chair rail	Solid	Wood	0.02
866	1921 & 1923 Bldgs.	100	XRF	4/19/97	0	Hall	8	Door	Door	Solid	Wood	0.03
867	1921 & 1923 Bldgs.	101	XRF	4/19/97	0	Hall	8	Door	Casing	Solid	Wood	0.04
868	1921 & 1923 Bldgs.	102	XRF	4/19/97	0	Hall	8	Door	Door	Solid	Wood	0.57
869	1921 & 1923 Bldgs.	103	XRF	4/19/97	0	Hall	8	Door	Casing	Solid	Wood	0.06
870	1921 & 1923 Bldgs.	104	XRF	4/19/97	0	Hall	8	Door	Door	Solid	Metal	0.41
871	1921 & 1923 Bldgs.	105	XRF	4/19/97	0	Hall	8	Door	Casing	Solid	Metal	0.13
872	1921 & 1923 Bldgs.	106	XRF	4/19/97	0	Hall	8	Door	Door	Solid	Metal	1.01
873	1921 & 1923 Bldgs.	107	XRF	4/19/97	0	Hall	8	Door	Casing	Solid	Wood	0.03
874	1921 & 1923 Bldgs.	108	XRF	4/19/97	0	Hall	8	Door	Jamb	Solid	Metal	0.92
875	1921 & 1923 Bldgs.	109	XRF	4/19/97	0	Hall	8	Window	Stool	Solid	Wood	0.32
876	1921 & 1923 Bldgs.	110	XRF	4/19/97	0	Hall	8	Window	Casing	Solid	Wood	0.05
877	1921 & 1923 Bldgs.	111	XRF	4/19/97	0	Hall	8		Radiator	Solid	Metal	0.01
878	1921 & 1923 Bldgs.	112	XRF	4/19/97	0	Hall	8		Locker	Solid	Metal	0.35
879	1921 & 1923 Bldgs.	113	XRF	4/19/97	0	Hall	8		Locker	Solid	Metal	0.35
880	1921 & 1923 Bldgs.	114	XRF	4/19/97	0	Hall	8		Elec Panel	Solid	Metal	0.02
881	1921 & 1923 Bldgs.	115	XRF	4/19/97	0	Hall	8	Cabinet	Door	Solid	Wood	0.03
882	1921 & 1923 Bldgs.	116	XRF	4/19/97	0	Hall	8	Bulletin	Board	Solid	Wood	0.04
883	1921 & 1923 Bldgs.	117	XRF	4/19/97	0	Hall	8	Ceiling	Diffuser	Solid	Metal	0.13

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
884	1921 & 1923 Bldgs.	118	XRF	4/19/97	0	Hall	8	Ceiling		Solid	Plaster	0.27
885	1921 & 1923 Bldgs.	234	XRF	4/19/97	0	Hall	8	Wall	Wall	Solid	Plaster	0.24
886	1921 & 1923 Bldgs.	235	XRF	4/19/97	0	Hall	8	Wall	Wall	Solid	Plaster	5.09
887	1921 & 1923 Bldgs.	236	XRF	4/19/97	0	Hall	8	Wall	Wall	Solid	Plaster	5.09
888	1921 & 1923 Bldgs.	237	XRF	4/19/97	0	Hall	8	Wall	Chair rail	Solid	Wood	0.05
889	1921 & 1923 Bldgs.	238	XRF	4/19/97	0	Hall	8	Window	Stool	Solid	Wood	0.03
890	1921 & 1923 Bldgs.	239	XRF	4/19/97	0	Hall	8	Window	Casing	Solid	Wood	0.05
891	1921 & 1923 Bldgs.	240	XRF	4/19/97	0	Hall	8	Door	Door	Solid	Wood	0.04
892	1921 & 1923 Bldgs.	241	XRF	4/19/97	0	Hall	8	Door	Casing	Solid	Wood	0.05
893	1921 & 1923 Bldgs.	242	XRF	4/19/97	0	Hall	8	Door	Door	Solid	Wood	0
894	1921 & 1923 Bldgs.	243	XRF	4/19/97	0	Hall	8	Door	Casing	Solid	Metal	0.02
895	1921 & 1923 Bldgs.	244	XRF	4/19/97	0	Hall	8	Door	Door	Solid	Metal	0.38
896	1921 & 1923 Bldgs.	245	XRF	4/19/97	0	Hall	8	Door	Casing	Solid	Metal	0.1
897	1921 & 1923 Bldgs.	246	XRF	4/19/97	1	Hall	8		Radiator	Solid	Metal	1.2
898	1921 & 1923 Bldgs.	247	XRF	4/19/97	1	Hall	8	Bulletin	Board	Solid	Wood	0.05
899	1921 & 1923 Bldgs.	248	XRF	4/19/97	1	Hall	8		Locker	Solid	Metal	0.64
900	1921 & 1923 Bldgs.	249	XRF	4/19/97	1	Hall	8		Locker	Solid	Metal	0.31
901	1921 & 1923 Bldgs.	250	XRF	4/19/97	1	Hall	8		Elec Panel	Solid	Metal	0.02
902	1921 & 1923 Bldgs.	251	XRF	4/19/97	1	Hall	8	Cabinet	Door	Solid	Wood	0.06
903	1921 & 1923 Bldgs.	252	XRF	4/19/97	1	Hall	8	Ceiling	Diffuser	Solid	Metal	0.13
904	1921 & 1923 Bldgs.	253	XRF	4/19/97	1	Hall	8	Ceiling		Solid	Plaster	0.17
905	1921 & 1923 Bldgs.	254	XRF	4/19/97	1	Outside	0	Door	Door	Solid	Wood	1.31
906	1921 & 1923 Bldgs.	255	XRF	4/19/97	1	Outside	0	Door	Jamb	Solid	Wood	5.09
907	1921 & 1923 Bldgs.	256	XRF	4/19/97	1	Outside	0	Ext Wall	Siding	Solid	Stucco	0
908	1921 & 1923 Bldgs.	257	XRF	4/19/97	1	Outside	0	Ext Wall	Bulkhead	Solid	Metal	0.04
909	1921 & 1923 Bldgs.	258	XRF	4/19/97	1	Outside	0	Door	Door	Solid	Wood	0
910	1921 & 1923 Bldgs.	259	XRF	4/19/97	1	Outside	0	Door	Jamb	Solid	Wood	5.09
911	1921 & 1923 Bldgs.	260	XRF	4/19/97	1	Outside	0	Ext Wall	Siding	Solid	Concrte	0.07
912	1921 & 1923 Bldgs.	84	XRF	4/19/97	0	Restroom	6	Wall	Wall	Solid	Plaster	5.09
913	1921 & 1923 Bldgs.	85	XRF	4/19/97	0	Restroom	6	Wall	Wall	Solid	Plaster	5.09
914	1921 & 1923 Bldgs.	86	XRF	4/19/97	0	Restroom	6	Wall	Chair rail	Solid	Wood	0.04
915	1921 & 1923 Bldgs.	87	XRF	4/19/97	0	Restroom	6	Window	Stool	Solid	Wood	0.03
916	1921 & 1923 Bldgs.	88	XRF	4/19/97	0	Restroom	6	Window	Casing	Solid	Wood	0.04
917	1921 & 1923 Bldgs.	89	XRF	4/19/97	0	Restroom	6		Radiator	Solid	Metal	0.11
918	1921 & 1923 Bldgs.	90	XRF	4/19/97	0	Restroom	6		Stall Door	Solid	Wood	0.04
919	1921 & 1923 Bldgs.	91	XRF	4/19/97	0	Restroom	6		Stall Door	Solid	Wood	0
920	1921 & 1923 Bldgs.	92	XRF	4/19/97	0	Restroom	6	Wall	Wall Rgstr	Solid	Metal	0.01
921	1921 & 1923 Bldgs.	93	XRF	4/19/97	0	Restroom	6	Ceiling		Solid	Plaster	5.09
922	1921 & 1923 Bldgs.	94	XRF	4/19/97	0	Restroom	6	Floor		Solid	Concrte	0.05
923	1921 & 1923 Bldgs.	95	XRF	4/19/97	0	Restroom	6		Bthrm Stil	Solid	Wood	0
924	1921 & 1923 Bldgs.	210	XRF	4/19/97	0	Restroom	7	Wall	Wall	Solid	Plaster	5.09
925	1921 & 1923 Bldgs.	211	XRF	4/19/97	0	Restroom	7	Wall	Wall	Solid	Plaster	5.09
926	1921 & 1923 Bldgs.	212	XRF	4/19/97	0	Restroom	7	Wall	Chair rail	Solid	Wood	0.03
927	1921 & 1923 Bldgs.	213	XRF	4/19/97	0	Restroom	7		Stall Door	Solid	Wood	0.02
928	1921 & 1923 Bldgs.	214	XRF	4/19/97	0	Restroom	7	Wall	Wall Rgstr	Solid	Metal	0.03
929	1921 & 1923 Bldgs.	215	XRF	4/19/97	0	Restroom	7	Ceiling		Solid	Plaster	5.09
930	1921 & 1923 Bldgs.	216	XRF	4/19/97	0	Restroom	7	Floor		Solid	Concrte	0.25
931	1921 & 1923 Bldgs.	217	XRF	4/19/97	0	Restroom	8	Wall	Wall	Solid	Plaster	5.09
932	1921 & 1923 Bldgs.	218	XRF	4/19/97	0	Restroom	8	Wall	Wall	Solid	Plaster	4.11
933	1921 & 1923 Bldgs.	219	XRF	4/19/97	0	Restroom	8	Wall	Chair rail	Solid	Wood	0.05
934	1921 & 1923 Bldgs.	220	XRF	4/19/97	0	Restroom	8	Wall	Wall	Solid	Drywall	0.01
935	1921 & 1923 Bldgs.	221	XRF	4/19/97	0	Restroom	8	Door	Door	Solid	Wood	0.04
936	1921 & 1923 Bldgs.	222	XRF	4/19/97	0	Restroom	8	Door	Casing	Solid	Wood	0.02
937	1921 & 1923 Bldgs.	223	XRF	4/19/97	0	Restroom	8	Window	Stool	Solid	Wood	0.04
938	1921 & 1923 Bldgs.	224	XRF	4/19/97	0	Restroom	8	Window	Casing	Solid	Wood	0.03
939	1921 & 1923 Bldgs.	225	XRF	4/19/97	0	Restroom	8		Radiator	Solid	Wood	0
940	1921 & 1923 Bldgs.	226	XRF	4/19/97	0	Restroom	8	Wall	Wall	Solid	Wood	0
941	1921 & 1923 Bldgs.	227	XRF	4/19/97	0	Restroom	8	Wall	Wall Rgstr	Solid	Metal	0
942	1921 & 1923 Bldgs.	228	XRF	4/19/97	0	Restroom	8	Bench		Solid	Wood	0
943	1921 & 1923 Bldgs.	229	XRF	4/19/97	0	Restroom	8	Wall	Hatch	Solid	Metal	0.01
944	1921 & 1923 Bldgs.	230	XRF	4/19/97	0	Restroom	8	Ceiling		Solid	Plaster	5.09
945	1921 & 1923 Bldgs.	231	XRF	4/19/97	0	Restroom	8	Floor		Solid	Concrte	0.08
946	1921 & 1923 Bldgs.	232	XRF	4/19/97	0	Restroom	8		Stall Door	Solid	Wood	0.03

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
947	1921 & 1923 Bldgs.	233	XRF	4/19/97	0	Restroom	8		Stall Door	Solid	Wood	0
948	1921 & 1923 Bldgs.	5	XRF	4/19/97	0	Room	47	Wall	Wall		Plaster	0.07
949	1921 & 1923 Bldgs.	6	XRF	4/19/97	0	Room	47	Wall	Wall		Plaster	0.04
950	1921 & 1923 Bldgs.	7	XRF	4/19/97	0	Room	47	Wall	Wall		Plaster	3.81
951	1921 & 1923 Bldgs.	8	XRF	4/19/97	0	Room	47	Wall	Chair rail	Solid	Wood	0.29
952	1921 & 1923 Bldgs.	9	XRF	4/19/97	0	Room	47	Wall	Baseboard	Solid	Wood	0.03
953	1921 & 1923 Bldgs.	10	XRF	4/19/97	0	Room	47	Window	Stool	Solid	Wood	0.03
954	1921 & 1923 Bldgs.	11	XRF	4/19/97	0	Room	47	Window	Mullion	Solid	Wood	0.03
955	1921 & 1923 Bldgs.	12	XRF	4/19/97	0	Room	47		Radiator	Solid	Metal	0.49
956	1921 & 1923 Bldgs.	13	XRF	4/19/97	0	Room	47		Radiator	Solid	Metal	0.52
957	1921 & 1923 Bldgs.	14	XRF	4/19/97	0	Room	47	Wall	Wall Rgstr	Solid	Metal	4.01
958	1921 & 1923 Bldgs.	15	XRF	4/19/97	0	Room	47	Ceiling		Solid	Plaster	0.06
959	1921 & 1923 Bldgs.	16	XRF	4/19/97	0	Room	47	Floor		Solid	Wood	0.02
960	1921 & 1923 Bldgs.	17	XRF	4/19/97	0	Room	48	Wall	Wall	Solid	Plaster	0.09
961	1921 & 1923 Bldgs.	18	XRF	4/19/97	0	Room	48	Wall	Wall	Solid	Plaster	0.12
962	1921 & 1923 Bldgs.	19	XRF	4/19/97	0	Room	48	Wall	Crown mold	Solid	Wood	0.06
963	1921 & 1923 Bldgs.	20	XRF	4/19/97	0	Room	48	Wall	Wall	Solid	Plaster	5.09
964	1921 & 1923 Bldgs.	21	XRF	4/19/97	0	Room	48	Wall	Baseboard	Solid	Wood	0.05
965	1921 & 1923 Bldgs.	22	XRF	4/19/97	0	Room	48	Window	Stool	Solid	Wood	0.26
966	1921 & 1923 Bldgs.	23	XRF	4/19/97	0	Room	48	Window	Casing	Solid	Wood	0.07
967	1921 & 1923 Bldgs.	24	XRF	4/19/97	0	Room	48		Radiator	Solid	Metal	5.09
968	1921 & 1923 Bldgs.	25	XRF	4/19/97	0	Room	48	Radiator	Board	Solid	Wood	0
969	1921 & 1923 Bldgs.	26	XRF	4/19/97	0	Room	48	Chalk	Board	Solid	Wood	0.06
970	1921 & 1923 Bldgs.	27	XRF	4/19/97	0	Room	48	Cabinet	Door	Solid	Wood	0.04
971	1921 & 1923 Bldgs.	28	XRF	4/19/97	0	Room	48	Wall	Wall Rgstr	Solid	Metal	3.92
972	1921 & 1923 Bldgs.	29	XRF	4/19/97	0	Room	48	Ceiling		Solid	Plaster	0.07
973	1921 & 1923 Bldgs.	30	XRF	4/19/97	0	Room	48	Floor		Solid	Wood	0.02
974	1921 & 1923 Bldgs.	31	XRF	4/19/97	0	Room	49	Wall	Wall	Solid	Plaster	0.1
975	1921 & 1923 Bldgs.	32	XRF	4/19/97	0	Room	49	Wall	Wall	Solid	Plaster	0.11
976	1921 & 1923 Bldgs.	33	XRF	4/19/97	0	Room	49	Wall	Crown mold	Solid	Wood	0.14
977	1921 & 1923 Bldgs.	34	XRF	4/19/97	0	Room	49	Wall	Wall	Solid	Plaster	5.09
978	1921 & 1923 Bldgs.	35	XRF	4/19/97	0	Room	49	Wall	Baseboard	Solid	Wood	0.04
979	1921 & 1923 Bldgs.	36	XRF	4/19/97	0	Room	49	Window	Stool	Solid	Wood	0.04
980	1921 & 1923 Bldgs.	37	XRF	4/19/97	0	Room	49	Window	Casing	Solid	Wood	0.07
981	1921 & 1923 Bldgs.	38	XRF	4/19/97	0	Room	49	Wall	Radiator	Solid	Metal	0.32
982	1921 & 1923 Bldgs.	39	XRF	4/19/97	0	Room	49	Radiator	Board	Solid	Wood	0
983	1921 & 1923 Bldgs.	40	XRF	4/19/97	0	Room	49	Chalk	Board	Solid	Wood	0.09
984	1921 & 1923 Bldgs.	41	XRF	4/19/97	0	Room	49	Cabinet	Door	Solid	Wood	0.05
985	1921 & 1923 Bldgs.	42	XRF	4/19/97	0	Room	49	Wall	Wall Rgstr	Solid	Metal	5.09
986	1921 & 1923 Bldgs.	43	XRF	4/19/97	0	Room	49	Ceiling		Solid	Plaster	0.06
987	1921 & 1923 Bldgs.	44	XRF	4/19/97	0	Room	49	Floor		Solid	Wood	0.01
988	1921 & 1923 Bldgs.	45	XRF	4/19/97	0	Room	50	Wall	Wall	Solid	Plaster	0.16
989	1921 & 1923 Bldgs.	46	XRF	4/19/97	0	Room	50	Wall	Wall	Solid	Plaster	0.27
990	1921 & 1923 Bldgs.	47	XRF	4/19/97	0	Room	50	Wall	Crown mold	Solid	Wood	0.04
991	1921 & 1923 Bldgs.	48	XRF	4/19/97	0	Room	50	Wall	Wall	Solid	Plaster	5.09
992	1921 & 1923 Bldgs.	49	XRF	4/19/97	0	Room	50	Wall	Baseboard	Solid	Wood	0.03
993	1921 & 1923 Bldgs.	50	XRF	4/19/97	0	Room	50	Window	Stool	Solid	Wood	0.27
994	1921 & 1923 Bldgs.	51	XRF	4/19/97	0	Room	50	Window	Casing	Solid	Wood	0.05
995	1921 & 1923 Bldgs.	52	XRF	4/19/97	0	Room	50		Radiator	Solid	Metal	0.4
996	1921 & 1923 Bldgs.	53	XRF	4/19/97	0	Room	50		Radiator	Solid	Metal	0.58
997	1921 & 1923 Bldgs.	54	XRF	4/19/97	0	Room	50	Chalk	Board	Solid	Wood	0.04
998	1921 & 1923 Bldgs.	55	XRF	4/19/97	0	Room	50	Cabinet	Door	Solid	Wood	0.04
999	1921 & 1923 Bldgs.	56	XRF	4/19/97	0	Room	50	Wall	Wall Rgstr	Solid	Metal	0.07
1000	1921 & 1923 Bldgs.	57	XRF	4/19/97	0	Room	50	Ceiling		Solid	Plaster	0.28
1001	1921 & 1923 Bldgs.	58	XRF	4/19/97	0	Room	51	Wall	Wall	Solid	Plaster	0.08
1002	1921 & 1923 Bldgs.	59	XRF	4/19/97	0	Room	51	Wall	Wall	Solid	Plaster	0.09
1003	1921 & 1923 Bldgs.	60	XRF	4/19/97	0	Room	51	Wall	Crown mold	Solid	Wood	0.21
1004	1921 & 1923 Bldgs.	61	XRF	4/19/97	0	Room	51	Wall	Wall	Solid	Plaster	5.09
1005	1921 & 1923 Bldgs.	62	XRF	4/19/97	0	Room	51	Wall	Baseboard	Solid	Wood	0.05
1006	1921 & 1923 Bldgs.	63	XRF	4/19/97	0	Room	51	Window	Stool	Solid	Wood	0.19
1007	1921 & 1923 Bldgs.	64	XRF	4/19/97	0	Room	51	Window	Casing	Solid	Wood	0.1
1008	1921 & 1923 Bldgs.	65	XRF	4/19/97	0	Room	51		Radiator	Solid	Metal	5.09
1009	1921 & 1923 Bldgs.	66	XRF	4/19/97	0	Room	51	Chalk	Board	Solid	Wood	0.07

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
1010	1921 & 1923 Bldgs.	67	XRF	4/19/97	0	Room	51	Wall	Wall Rgstr	Solid	Metal	0.13
1011	1921 & 1923 Bldgs.	68	XRF	4/19/97	0	Room	51	Ceiling		Solid	Plaster	0.06
1012	1921 & 1923 Bldgs.	69	XRF	4/19/97	0	Room	51	Floor		Solid	Wood	0.02
1013	1921 & 1923 Bldgs.	70	XRF	4/19/97	0	Room	51	Cabinet	Door	Solid	Wood	0.03
1014	1921 & 1923 Bldgs.	72	XRF	4/19/97	0	Room	52	Wall	Wall	Solid	Tile	0.12
1015	1921 & 1923 Bldgs.	73	XRF	4/19/97	0	Room	52	Wall	Wall	Solid	Tile	3.44
1016	1921 & 1923 Bldgs.	74	XRF	4/19/97	0	Room	52	Wall	Baseboard	Solid	Concrcte	0.04
1017	1921 & 1923 Bldgs.	75	XRF	4/19/97	0	Room	52	Door	Door	Solid	Metal	0.16
1018	1921 & 1923 Bldgs.	76	XRF	4/19/97	0	Room	52	Door	Casing	Solid	Metal	0.29
1019	1921 & 1923 Bldgs.	77	XRF	4/19/97	0	Room	52	Window	Stool	Solid	Wood	0.51
1020	1921 & 1923 Bldgs.	78	XRF	4/19/97	0	Room	52	Window	Casing	Solid	Wood	0.7
1021	1921 & 1923 Bldgs.	79	XRF	4/19/97	0	Room	52		Radiator	Solid	Metal	0.41
1022	1921 & 1923 Bldgs.	80	XRF	4/19/97	0	Room	52	Air	Return	Solid	Metal	0.29
1023	1921 & 1923 Bldgs.	81	XRF	4/19/97	0	Room	52	Cabinet	Door	Solid	Wood	2.33
1024	1921 & 1923 Bldgs.	82	XRF	4/19/97	0	Room	52	Ceiling		Solid	Tile	0.04
1025	1921 & 1923 Bldgs.	83	XRF	4/19/97	0	Room	52	Floor		Solid	Concrcte	0.18
1026	1921 & 1923 Bldgs.	134	XRF	4/19/97	0	Room	53	Wall	Wall	Solid	Plaster	0.08
1027	1921 & 1923 Bldgs.	135	XRF	4/19/97	0	Room	53	Wall	Wall	Solid	Plaster	0.08
1028	1921 & 1923 Bldgs.	136	XRF	4/19/97	0	Room	53	Wall	Crown mold	Solid	Wood	0.11
1029	1921 & 1923 Bldgs.	137	XRF	4/19/97	0	Room	53	Wall	Wall	Solid	Plaster	5.09
1030	1921 & 1923 Bldgs.	138	XRF	4/19/97	0	Room	53	Wall	Baseboard	Solid	Wood	0.1
1031	1921 & 1923 Bldgs.	139	XRF	4/19/97	0	Room	53	Window	Stool	Solid	Wood	0.06
1032	1921 & 1923 Bldgs.	140	XRF	4/19/97	0	Room	53	Window	Casing	Solid	Wood	0.06
1033	1921 & 1923 Bldgs.	141	XRF	4/19/97	0	Room	53		Radiator	Solid	Metal	0.44
1034	1921 & 1923 Bldgs.	142	XRF	4/19/97	0	Room	53	Radiator	Board	Solid	Wood	0
1035	1921 & 1923 Bldgs.	143	XRF	4/19/97	0	Room	53	Bulletin	Board	Solid	Wood	0.07
1036	1921 & 1923 Bldgs.	144	XRF	4/19/97	0	Room	53	Cabinet	Door	Solid	Wood	0.09
1037	1921 & 1923 Bldgs.	145	XRF	4/19/97	0	Room	53	Wall	Wall Rgstr	Solid	Metal	0.09
1038	1921 & 1923 Bldgs.	146	XRF	4/19/97	0	Room	53	Floor		Solid	Wood	0.01
1039	1921 & 1923 Bldgs.	147	XRF	4/19/97	0	Room	54	Wall	Wall	Solid	Plaster	0.06
1040	1921 & 1923 Bldgs.	148	XRF	4/19/97	0	Room	54	Wall	Wall	Solid	Plaster	0.1
1041	1921 & 1923 Bldgs.	149	XRF	4/19/97	0	Room	54	Wall	Crown mold	Solid	Wood	0.08
1042	1921 & 1923 Bldgs.	150	XRF	4/19/97	0	Room	54	Wall	Wall	Solid	Plaster	0.12
1043	1921 & 1923 Bldgs.	151	XRF	4/19/97	0	Room	54	Wall	Baseboard	Solid	Wood	0.07
1044	1921 & 1923 Bldgs.	152	XRF	4/19/97	0	Room	54	Window	Stool	Solid	Wood	0.11
1045	1921 & 1923 Bldgs.	153	XRF	4/19/97	0	Room	54	Window	Stool	Solid		0.13
1046	1921 & 1923 Bldgs.	154	XRF	4/19/97	0	Room	54	Window	Casing	Solid	Wood	0.11
1047	1921 & 1923 Bldgs.	155	XRF	4/19/97	0	Room	54		Radiator	Solid	Metal	0.88
1048	1921 & 1923 Bldgs.	156	XRF	4/19/97	0	Room	54	Radiator	Board	Solid	Wood	0
1049	1921 & 1923 Bldgs.	157	XRF	4/19/97	0	Room	54	Bulletin	Board	Solid	Wood	0.08
1050	1921 & 1923 Bldgs.	158	XRF	4/19/97	0	Room	54	Cabinet	Door	Solid	Wood	0.07
1051	1921 & 1923 Bldgs.	159	XRF	4/19/97	0	Room	54	Wall	Wall Rgstr	Solid	Metal	0.11
1052	1921 & 1923 Bldgs.	160	XRF	4/19/97	0	Room	54	Ceiling		Solid	Plaster	0.07
1053	1921 & 1923 Bldgs.	161	XRF	4/19/97	0	Room	54	Floor		Solid	Wood	0
1054	1921 & 1923 Bldgs.	162	XRF	4/19/97	0	Room	55	Wall	Wall	Solid	Plaster	0.09
1055	1921 & 1923 Bldgs.	163	XRF	4/19/97	0	Room	55	Wall	Wall	Solid	Plaster	0.1
1056	1921 & 1923 Bldgs.	164	XRF	4/19/97	0	Room	55	Wall	Crown mold	Solid	Wood	0.1
1057	1921 & 1923 Bldgs.	165	XRF	4/19/97	0	Room	55	Wall	Wall	Solid	Plaster	5.09
1058	1921 & 1923 Bldgs.	166	XRF	4/19/97	0	Room	55	Wall	Baseboard	Solid	Wood	0.07
1059	1921 & 1923 Bldgs.	167	XRF	4/19/97	0	Room	55	Window	Stool	Solid	Wood	0.23
1060	1921 & 1923 Bldgs.	168	XRF	4/19/97	0	Room	55	Window	Casing	Solid	Wood	0.06
1061	1921 & 1923 Bldgs.	169	XRF	4/19/97	0	Room	55		Radiator	Solid	Metal	5.09
1062	1921 & 1923 Bldgs.	170	XRF	4/19/97	0	Room	55	Radiator	Board	Solid	Wood	0
1063	1921 & 1923 Bldgs.	171	XRF	4/19/97	0	Room	55	Chalk	Board	Solid	Wood	0.08
1064	1921 & 1923 Bldgs.	172	XRF	4/19/97	0	Room	55	Cabinet	Door	Solid	Wood	0.08
1065	1921 & 1923 Bldgs.	173	XRF	4/19/97	0	Room	55	Wall	Wall Rgstr	Solid	Metal	0.1
1066	1921 & 1923 Bldgs.	174	XRF	4/19/97	0	Room	55	Ceiling		Solid	Plaster	0.06
1067	1921 & 1923 Bldgs.	175	XRF	4/19/97	0	Room	55	Floor		Solid	Wood	0.01
1068	1921 & 1923 Bldgs.	176	XRF	4/19/97	0	Room	56	Wall	Wall	Solid	Plaster	0.09
1069	1921 & 1923 Bldgs.	177	XRF	4/19/97	0	Room	56	Wall	Wall	Solid	Plaster	0.11
1070	1921 & 1923 Bldgs.	178	XRF	4/19/97	0	Room	56	Wall	Crown mold	Solid	Wood	0.03
1071	1921 & 1923 Bldgs.	179	XRF	4/19/97	0	Room	56	Wall	Wall	Solid	Plaster	0.06
1072	1921 & 1923 Bldgs.	180	XRF	4/19/97	0	Room	56	Wall	Baseboard	Solid	Wood	0.05

Saint Paul Public Schools
 Randolph Heights Elementary School
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Compone	Feature	Condition	Substrate	Result
1073	1921 & 1923 Bldgs.	181	XRF	4/19/97	0	Room	56	Window	Stool	Solid	Wood	0.19
1074	1921 & 1923 Bldgs.	182	XRF	4/19/97	0	Room	56	Window	Casing	Solid	Wood	0.08
1075	1921 & 1923 Bldgs.	183	XRF	4/19/97	0	Room	56		Radiator	Solid	Metal	0.08
1076	1921 & 1923 Bldgs.	184	XRF	4/19/97	0	Room	56	Radiator	Board	Solid	Wood	0
1077	1921 & 1923 Bldgs.	185	XRF	4/19/97	0	Room	56	Bulletin	Board	Solid	Wood	0.09
1078	1921 & 1923 Bldgs.	186	XRF	4/19/97	0	Room	56	Cabinet	Door	Solid	Wood	0.06
1079	1921 & 1923 Bldgs.	187	XRF	4/19/97	0	Room	56	Duct	Wall	Solid	Metal	0.04
1080	1921 & 1923 Bldgs.	188	XRF	4/19/97	0	Room	56	Ceiling		Solid	Plaster	0.06
1081	1921 & 1923 Bldgs.	189	XRF	4/19/97	0	Room	56	Floor		Solid	Wood	0
1082	1921 & 1923 Bldgs.	190	XRF	4/19/97	0	Room	57	Wall	Wall	Solid	Plaster	0.28
1083	1921 & 1923 Bldgs.	191	XRF	4/19/97	0	Room	57	Wall	Wall	Solid	Plaster	3.85
1084	1921 & 1923 Bldgs.	192	XRF	4/19/97	0	Room	57	Wall	Chair rail	Solid	Wood	0.03
1085	1921 & 1923 Bldgs.	193	XRF	4/19/97	0	Room	57	Cabinet	Door	Solid	Wood	0.04
1086	1921 & 1923 Bldgs.	194	XRF	4/19/97	0	Room	57	Ceiling		Solid	Plaster	0.14
1087	1921 & 1923 Bldgs.	195	XRF	4/19/97	0	Room	57	Floor		Solid	Concrte	0.05
1088	1921 & 1923 Bldgs.	196	XRF	4/19/97	0	Room	58	Wall	Wall	Solid	Plaster	0.04
1089	1921 & 1923 Bldgs.	197	XRF	4/19/97	0	Room	58	Wall	Wall	Solid	Plaster	3.57
1090	1921 & 1923 Bldgs.	198	XRF	4/19/97	0	Room	58	Wall	Crown mold	Solid	Wood	0.15
1091	1921 & 1923 Bldgs.	199	XRF	4/19/97	0	Room	58	Wall	Chair rail	Solid	Wood	0.03
1092	1921 & 1923 Bldgs.	200	XRF	4/19/97	0	Room	58	Wall	Baseboard	Solid	Wood	0.06
1093	1921 & 1923 Bldgs.	201	XRF	4/19/97	0	Room	58	Door	Door	Solid	Wood	0.04
1094	1921 & 1923 Bldgs.	202	XRF	4/19/97	0	Room	58	Door	Casing	Solid	Wood	0.04
1095	1921 & 1923 Bldgs.	203	XRF	4/19/97	0	Room	58	Window	Stool	Solid	Wood	0.03
1096	1921 & 1923 Bldgs.	204	XRF	4/19/97	0	Room	58	Window	Casing	Solid	Wood	0.06
1097	1921 & 1923 Bldgs.	205	XRF	4/19/97	0	Room	58		Radiator	Solid	Metal	2.32
1098	1921 & 1923 Bldgs.	206	XRF	4/19/97	0	Room	58	Wall	Wall Rgstr	Solid	Metal	0.13
1099	1921 & 1923 Bldgs.	207	XRF	4/19/97	0	Room	58	Wall	Wall	Solid	Plaster	0.25
1100	1921 & 1923 Bldgs.	208	XRF	4/19/97	0	Room	58	Ceiling		Solid	Plaster	0.05
1101	1921 & 1923 Bldgs.	209	XRF	4/19/97	0	Room	58	Floor		Solid	Wood	0
1102	1921 & 1923 Bldgs.	119	XRF	4/19/97	0	Stairwell	5	Wall	Wall	Solid	Plaster	0.07
1103	1921 & 1923 Bldgs.	120	XRF	4/19/97	0	Stairwell	5	Wall	Wall	Solid	Plaster	4.4
1104	1921 & 1923 Bldgs.	121	XRF	4/19/97	0	Stairwell	5	Wall	Wall	Solid	Plaster	0
1105	1921 & 1923 Bldgs.	122	XRF	4/19/97	0	Stairwell	5	Wall	Wall	Solid	Plaster	0.01
1106	1921 & 1923 Bldgs.	123	XRF	4/19/97	0	Stairwell	5	Wall	Chair rail	Solid	Wood	0.04
1107	1921 & 1923 Bldgs.	124	XRF	4/19/97	0	Stairwell	5	Wall	Baseboard	Solid	Concrte	0.05
1108	1921 & 1923 Bldgs.	125	XRF	4/19/97	0	Stairwell	5	Door	Door	Solid	Wood	0
1109	1921 & 1923 Bldgs.	126	XRF	4/19/97	0	Stairwell	5	Door	Casing	Solid	Wood	0.01
1110	1921 & 1923 Bldgs.	127	XRF	4/19/97	0	Stairwell	5	Door	Casing	Solid	Metal	0.07
1111	1921 & 1923 Bldgs.	128	XRF	4/19/97	0	Stairwell	5		Radiator	Solid	Metal	0.13
1112	1921 & 1923 Bldgs.	129	XRF	4/19/97	0	Stairwell	5	Stairs	Hand rail	Solid	Wood	0
1113	1921 & 1923 Bldgs.	130	XRF	4/19/97	0	Stairwell	5	Window	Stool	Solid	Wood	0.06
1114	1921 & 1923 Bldgs.	131	XRF	4/19/97	0	Stairwell	5	Window	Casing	Solid	Wood	0.09
1115	1921 & 1923 Bldgs.	132	XRF	4/19/97	0	Stairwell	5	Ceiling		Solid	Plaster	0.03

APPENDIX B

LABORATORY SAMPLE ANALYSIS DATA

LABORATORY ANALYSIS REPORT**DATE:** June 24, 1997**PAGE:**

1 Of 2

CLIENT: Midwest Environmental Cons.
5385 401st Ave. NW
Dalbo, MN 55017**PROJECT NO.:** 051597-200888
COLLECTION DATE: 4/19/97
COLLECTED BY: Client
RECEIVED DATE: 5/15/97
PROJECT DESCRP.: 62/0197W**CONTACT:** Greg Myers/Richard Cox

<u>ANALYSIS</u>	<u>UNITS</u>	<u>Sample No.:</u> <u>Sample ID.:</u>	<u>MDL</u>	<u>RESULT</u>	<u>ANALYSIS</u> <u>DATE</u>
Lead (6010A)	mg/kg	L972932-1 1	15	57	6/23/97
<u>ANALYSIS</u>	<u>UNITS</u>	<u>Sample No.:</u> <u>Sample ID.:</u>	<u>MDL</u>	<u>RESULT</u>	<u>ANALYSIS</u> <u>DATE</u>
Lead (6010A)	mg/kg	L972932-2 16	24	900	6/23/97
<u>ANALYSIS</u>	<u>UNITS</u>	<u>Sample No.:</u> <u>Sample ID.:</u>	<u>MDL</u>	<u>RESULT</u>	<u>ANALYSIS</u> <u>DATE</u>
Lead (6010A)	mg/kg	L972932-3 19	33	1700	6/23/97
<u>ANALYSIS</u>	<u>UNITS</u>	<u>Sample No.:</u> <u>Sample ID.:</u>	<u>MDL</u>	<u>RESULT</u>	<u>ANALYSIS</u> <u>DATE</u>
Lead (6010A)	mg/kg	L972932-4 60	20	1500	6/23/97
<u>ANALYSIS</u>	<u>UNITS</u>	<u>Sample No.:</u> <u>Sample ID.:</u>	<u>MDL</u>	<u>RESULT</u>	<u>ANALYSIS</u> <u>DATE</u>
Lead (6010A)	mg/kg	L972932-5 90	19	3000	6/23/97
<u>ANALYSIS</u>	<u>UNITS</u>	<u>Sample No.:</u> <u>Sample ID.:</u>	<u>MDL</u>	<u>RESULT</u>	<u>ANALYSIS</u> <u>DATE</u>
Lead (6010A)	mg/kg	L972932-6 128	38	6500	6/23/97
<u>ANALYSIS</u>	<u>UNITS</u>	<u>Sample No.:</u> <u>Sample ID.:</u>	<u>MDL</u>	<u>RESULT</u>	<u>ANALYSIS</u> <u>DATE</u>
Lead (6010A)	mg/kg	L972932-7 131	48	3300	6/23/97

ND means Not Detected or below reported MDL

MDL means Method Detection Limit

mg/kg means Milligrams Per Kilogram which is equivalent to Parts Per Million (ppm)

As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.



LABORATORY ANALYSIS REPORT**DATE:** June 24, 1997**PAGE:** 2 Of 2**CLIENT:** Midwest Environmental Cons.
5385 401st Ave. NW
Dalbo, MN 55017**PROJECT NO.:** 051597-200888
COLLECTION DATE: Unidentified
COLLECTED BY: Client
RECEIVED DATE: 5/15/97
PROJECT DESCRP.: 62/0197W**CONTACT:** Greg Myers/Richard Cox

<u>ANALYSIS</u>	<u>UNITS</u>	<u>Sample No.:</u> <u>Sample ID.:</u>	<u>MDL</u>	<u>RESULT</u>	<u>ANALYSIS</u> <u>DATE</u>
Lead (6010A)	mg/kg		390	84000	6/23/97


<u>ANALYSIS</u>	<u>UNITS</u>	<u>Sample No.:</u> <u>Sample ID.:</u>	<u>MDL</u>	<u>RESULT</u>	<u>ANALYSIS</u> <u>DATE</u>
Lead (6010A)	mg/kg		24	250	6/23/97

<u>ANALYSIS</u>	<u>UNITS</u>	<u>Sample No.:</u> <u>Sample ID.:</u>	<u>MDL</u>	<u>RESULT</u>	<u>ANALYSIS</u> <u>DATE</u>
Lead (6010A)	mg/kg		30	130	6/23/97

*ND means Not Detected or below reported MDL**MDL means Method Detection Limit**mg/kg means Milligrams Per Kilogram which is equivalent to Parts Per Million (ppm)**ug/ft² means Micrograms Per Square Foot*

This report has been reviewed by me for technical accuracy and completeness. The analyses were performed using EPA or other approved methodologies and the results were reported on an "as received" basis unless otherwise noted. Organic soil analyses were reported on a dry weight basis. The results reported relate only to the items tested. Please contact me if you have any questions or comments regarding this report. Spectrum Labs, Inc. appreciates the opportunity to provide this analytical service for you.

Report Submitted By,


Thomas L. Halverson
Laboratory ManagerTLH:wmc
mec175-1

As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.



A member of The Marmon Group of Companies

Contact Greg Myers / Richard Cox

24/5 2# 2

CHAIN OF CUSTODY RECORD

Project Number

Client St. Paul School District

Project Randolph Heights

Phone/Fax

[illegible]

Sampled By: mw.b

Date:

Time:

Received By: Greg Moore

Date: 5/5/97

Time: 4:30

Received By Lab *Adrian H. H.*

15

11/17

Notes:

Paint chips

Sampled By: MWB

Date:

Time:

Received By: Greg Moore

Date: 5/5/97

Time: 4:30

Received By Lab *Adrian H. H.*

15

11/17

Notes:

Paint chips

APPENDIX C INSPECTORS

**Patrick Leahy
MDH Lead Inspector # 237**

**John Allen
MDH Lead Inspector # 236**

**Michael Buck
MDH Lead Inspector # 140**