


Midwest
Environmental
Consulting, L.L.C.

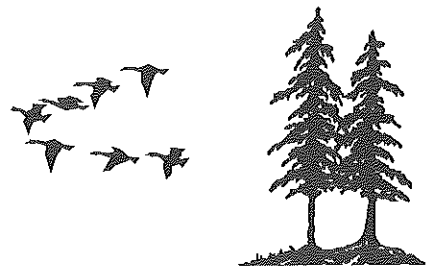

 Printed on Recycled Paper

**Washington Technology Middle School
Saint Paul Public Schools**

Lead-Based Paint Inspection

**Inspection Dates: 6/17/97, 9/4/97, 9/10/97, 9/11/97, 10/14/97,
10/15/97, 4/13/98, 4/14/98, 6/1/98, 6/2/98, 6/3/98**

submitted to:

Saint Paul Public Schools

MEC Project # 62/0197AL

INTRODUCTION

At the request of Saint Paul Public Schools Environmental Safety Department, Midwest Environmental Consulting, L.L.C. (MEC), conducted a lead-based paint inspection at Washington Technology Middle School, 1041 Marion Street, St. Paul, MN. The purpose of this inspection was to identify lead-based painted, varnished, or otherwise coated building components on the interior and exterior of the school building.

The inspection protocol incorporated applicable portions of the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-based Paint Hazards in Housing* (HUD Guidelines, June 1995) and OSHA 1926.62 requirements (Lead in Construction). The HUD guidelines are formulated to guide agencies in conducting random sampling of the interiors and exteriors of dwellings and common areas in public housing. The OSHA requirement is designed to minimize worker exposure when working with material containing lead.

Confirmatory testing was conducted when inconclusive XRF results were encountered. Inconclusive refers to XRF readings less than 0.2 mg/cm^2 (milligrams per square centimeter). Inconclusive results were confirmed with laboratory analysis of paint chip samples (Appendix B). This report contains a list of such results.

The United States Environmental Protection Agency defines "lead-based paint" as a paint or other surface coating that contains lead equal to or in excess of 1.0 milligrams per square centimeter when analyzed by XRF or more than 0.5% by weight (5000 parts per million) by laboratory analysis of a bulk sample.

Minnesota Department of Labor and Industry (MN OSHA) adopted the EPA lead levels for the purpose of enforcing OSHA 1926.62 federal regulations. Detection of lead in dried paint film by XRF is a dependable indicator of levels of lead and is accepted by MN OSHA.

For this Saint Paul Public Schools Lead Inspection, all building components were tested on site using a Niton XL® X-ray Fluorescence Spectrum Analyzer⁽¹⁾. Building components included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases. Only painted or glazed surfaces or surfaces which were varnished were tested. Suspended ceilings, structural steel, and corrugated decking were not included in the inspection. Neither anodized (e.g., window sashes) nor plastic (e.g., vinyl baseboard and vinyl mini-blinds) were included in the scope of this inspection.

⁽¹⁾ This is a portable hand held machine that can analyze building components instantly for lead concentrations.

Each building was divided into unique sites based on the year of construction or renovation. Portable classrooms, playgrounds, and other detached buildings were automatically designated as a unique site. Each site was inspected independently assuming differences in painting history and construction characteristics.

SITE DESCRIPTION AND BUILDING HISTORY

According to information provided to MEC by Saint Paul Public Schools, Washington Technology Middle School was constructed in essentially three phases. The initial phase includes the 95,964 square-foot older section of the building and dates from 1924. The second phase is a 74,958 square foot addition dating from 1970. The third phase is a 2,636 square foot addition from 1979.

The 1979 addition was not inspected.

All room and area designations used in this report are depicted on sampling maps found in Appendix A.

XRF SAMPLE RESULTS TABLE

The results of all samples analyzed are listed in the table at the end of this section. The following is a description of the column headings:

Site	Each school is divided into sites based on their unique construction characteristics. Each site has a unique date of construction or major renovation.		
Sample #	Each sample taken was given a unique number to identify the type and location of the sample. The sampling date is an integral part of the sample number.		
Analysis	This defines the type of analysis which can be categorized into two types:		
	1) XRF:	This is an on-site analysis using a hand held Niton XL® X-ray Fluorescence Spectrum Analyzer;	
	2) Bulk or Chip:	This is a bulk sample where paint is removed from the substrate and sent to a laboratory for analysis;	
Floor	This is the level of the building in which the area tested was found, example, 1 (first floor), 0 (basement), etc.		

- Area** This further defines the specific functional space inspected such as a classroom, exterior, playground, gym, kitchen, etc.
- Room #** This is typically the actual number on the room as identified at the building.
- Component** Building "components" included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases.
- Feature** Identifies more detailed information of the component.
- Condition** This describes condition of the surface, whether it is intact, cracked, peeling, or chalking.
- Substrate** This refers to the material the building component is made of (wood, concrete, drywall, metal, etc.).
- Result** This is the analysis results for lead. Less than 1.0 mg/cm² or less than 0.5% by weight is considered to be non-lead and these building components are below the action levels of EPA and HUD. (All results are in mg/cm² except where noted.)

The table of results is designed for quick information on lead concentrations of tested building components. Generally, all repetitions of a test combination within a given room or area, may be assumed to contain similar concentrations of lead to that of the tested sample. For instance, the lead concentration of a tested wooden window sash was found to be above the action level of 1.0 mg/cm² in a given classroom. The classroom has five windows, all of wood, the same color and appearing to be of the same era. It can be assumed that the remaining four wooden window sashes each contain lead above the action limit.

Other columns identify the component and the component feature tested, condition of the component, type of substrate and the result of the analytical test.

As an example, the following illustration shows that the wooden door jamb in Room 123, first floor in the 1923 building section was in good, solid condition, and had an XRF test result of 0.3 mg/cm², which is below the action level.

Illustration Only

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1923 Bldg.	52		XRF	1	Room	123	Door	Jamb	Solid	Wood	0.3

In a similar manner, the table shows that the plaster walls in room 23, on the second floor has peeling paint with more than 1.0 mg/cm² (shaded).

ILLUSTRATION ONLY

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1910 Bldg.	16		XRF	2	Room	23	Door	Jamb	Peeling	Wood	0.25
1910 Bldg.	17		XRF	2	Room	23	Wall	Wall	Peeling	Plaster	1.2
1910 Bldg.	18		XRF	2	Room	23		Ceiling	Peeling	Plaster	0.25
1910 Bldg.	19		XRF	2	Room	23	Wall	Baseboard	Peeling	Wood	0.002

APPLICABLE REGULATIONS

When building components test above 1.0 mg/cm² of lead by XRF or 0.5% lead by weight from laboratory analysis all employees and contractors who will be working with these components in a construction related activity must be notified. The requirements of OSHA 1926.62, Lead in Construction are enforceable. This regulation defines construction work as "work for construction, alteration and/or repair, including painting and decorating." This regulation further defines monitoring requirements to minimize employee exposure to lead during construction activities.

When work is performed on external painted building structures (i.e. flashing, fire escapes, playground equipment, handrails, etc.), regulations of the Minnesota Pollution Control Agency (MPCA) may also be applicable. For removal of lead based paint from steel structures, MN Rules 7025.0200 - 7025.0380 apply to steel materials on the exterior of a building, or on the property when levels exceed 0.5 mg/cm² based on the average of three XRF spectrum results of the sample tested, or 5,000 ppm by laboratory analysis. If it is other than a steel surface, then MPCA regulates the painted surfaces under MN Rules 7025.010 - 7025.0080, when surfaces are to be disturbed using abrasive blasting methods.

Please contact MEC directly if you have questions about any portion of this report or the lead-based paint inspection itself.

APPENDIX A

XRF TESTING DATA WITH LOCATION MAPS

GALTIER STREET

LAWSON AVENUE

COOK AVENUE

MARION STREET

EXTERIOR LIGHT LOCATIONS

9-41-97

[illegible]

SITE PLAN

INDEPENDENT SCHOOL DIST. #625
360 COLBORNE STREET
ST. PAUL, MINNESOTA 55102

WASHINGTON JR. HIGH SCHOOL
1041 MARION STREET
ST. PAUL, MN 55117

CONSTRUCTED: 1924, 70, 78, 79


NE

CONSTRUCTED: 1924

WASHINGTON JR. HIGH SCHOOL
1041 MARION STREET
ST. PAUL, MINNESOTA

INDEPENDENT SCHOOL DIST. #625
360 COLBORNE STREET
ST. PAUL, MINNESOTA 55102

BASEMENT FLOOR PLAN - SOUTH

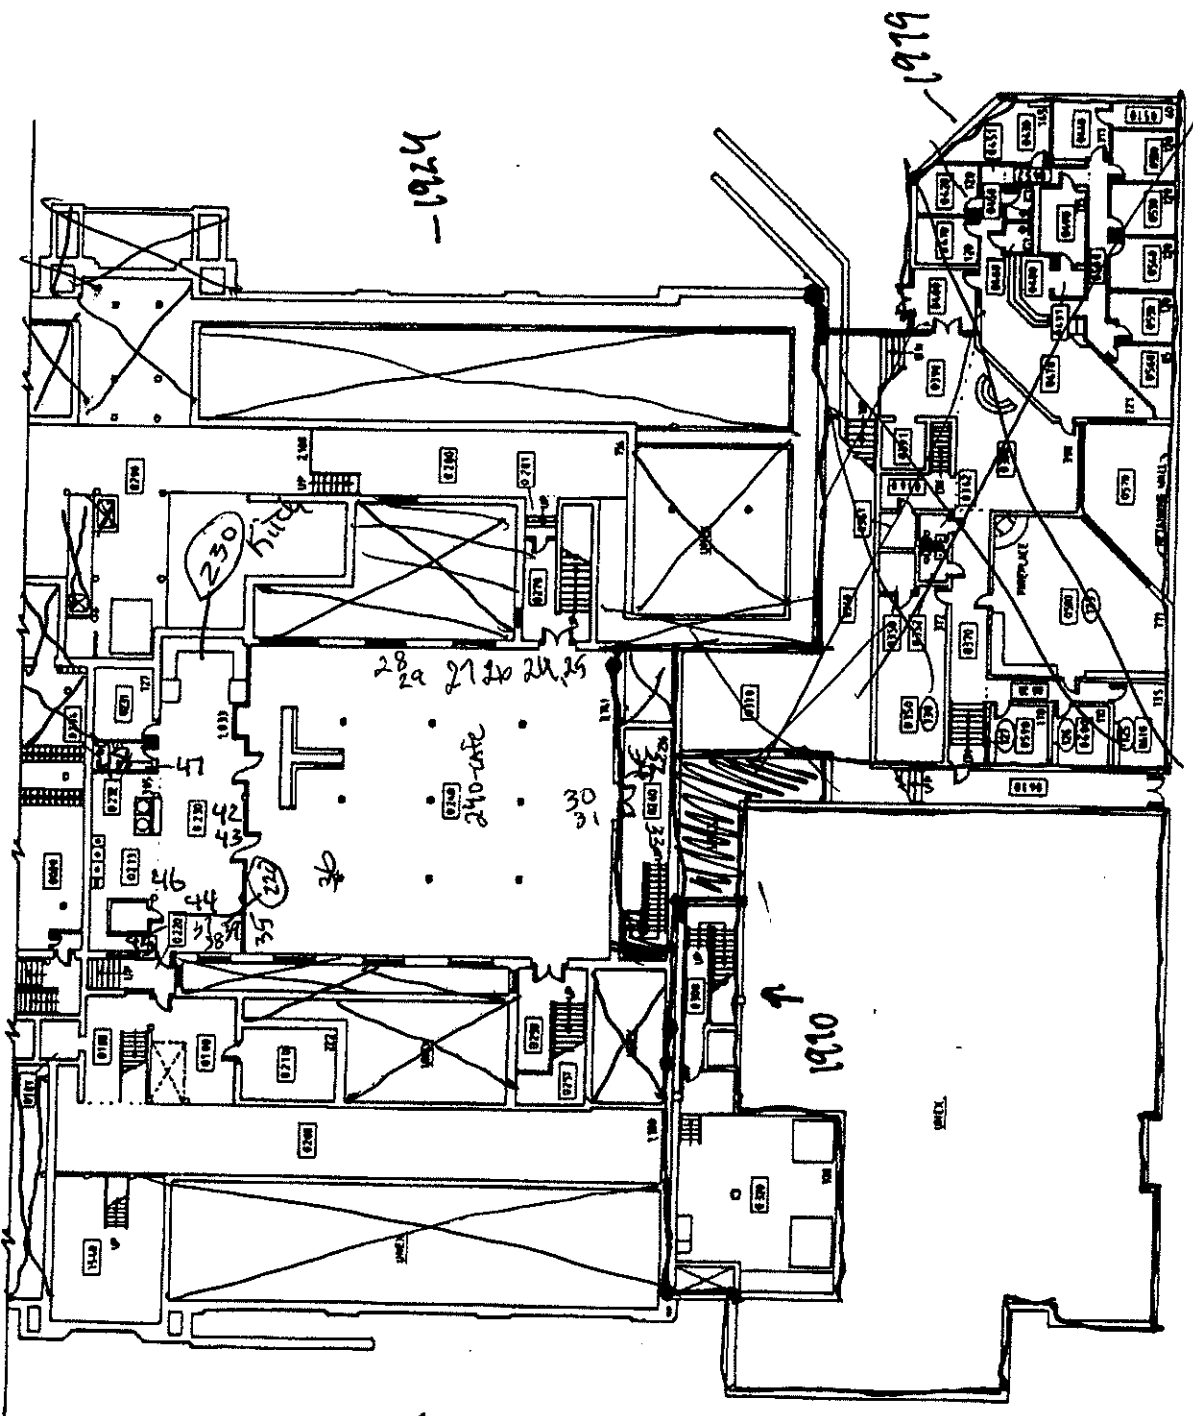

1924



1919

1910

1911

1912

1913

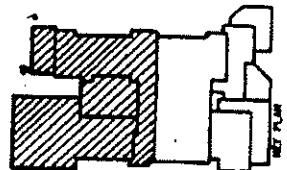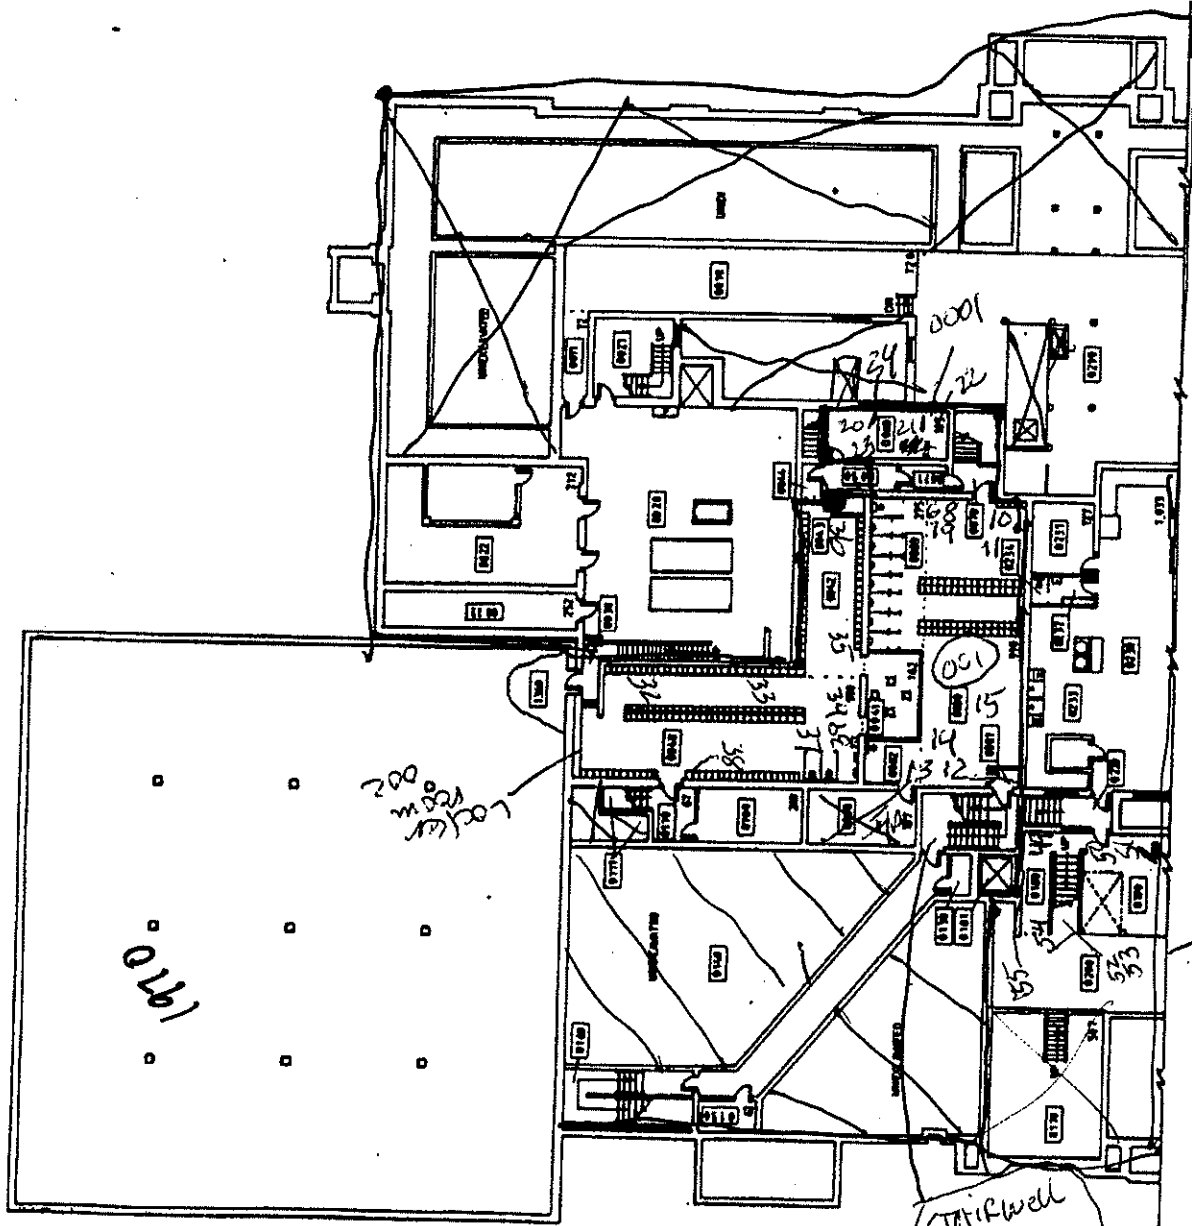


B


C

D

4-13-28
 4-14-28 =  Keckamp
 6-1-28

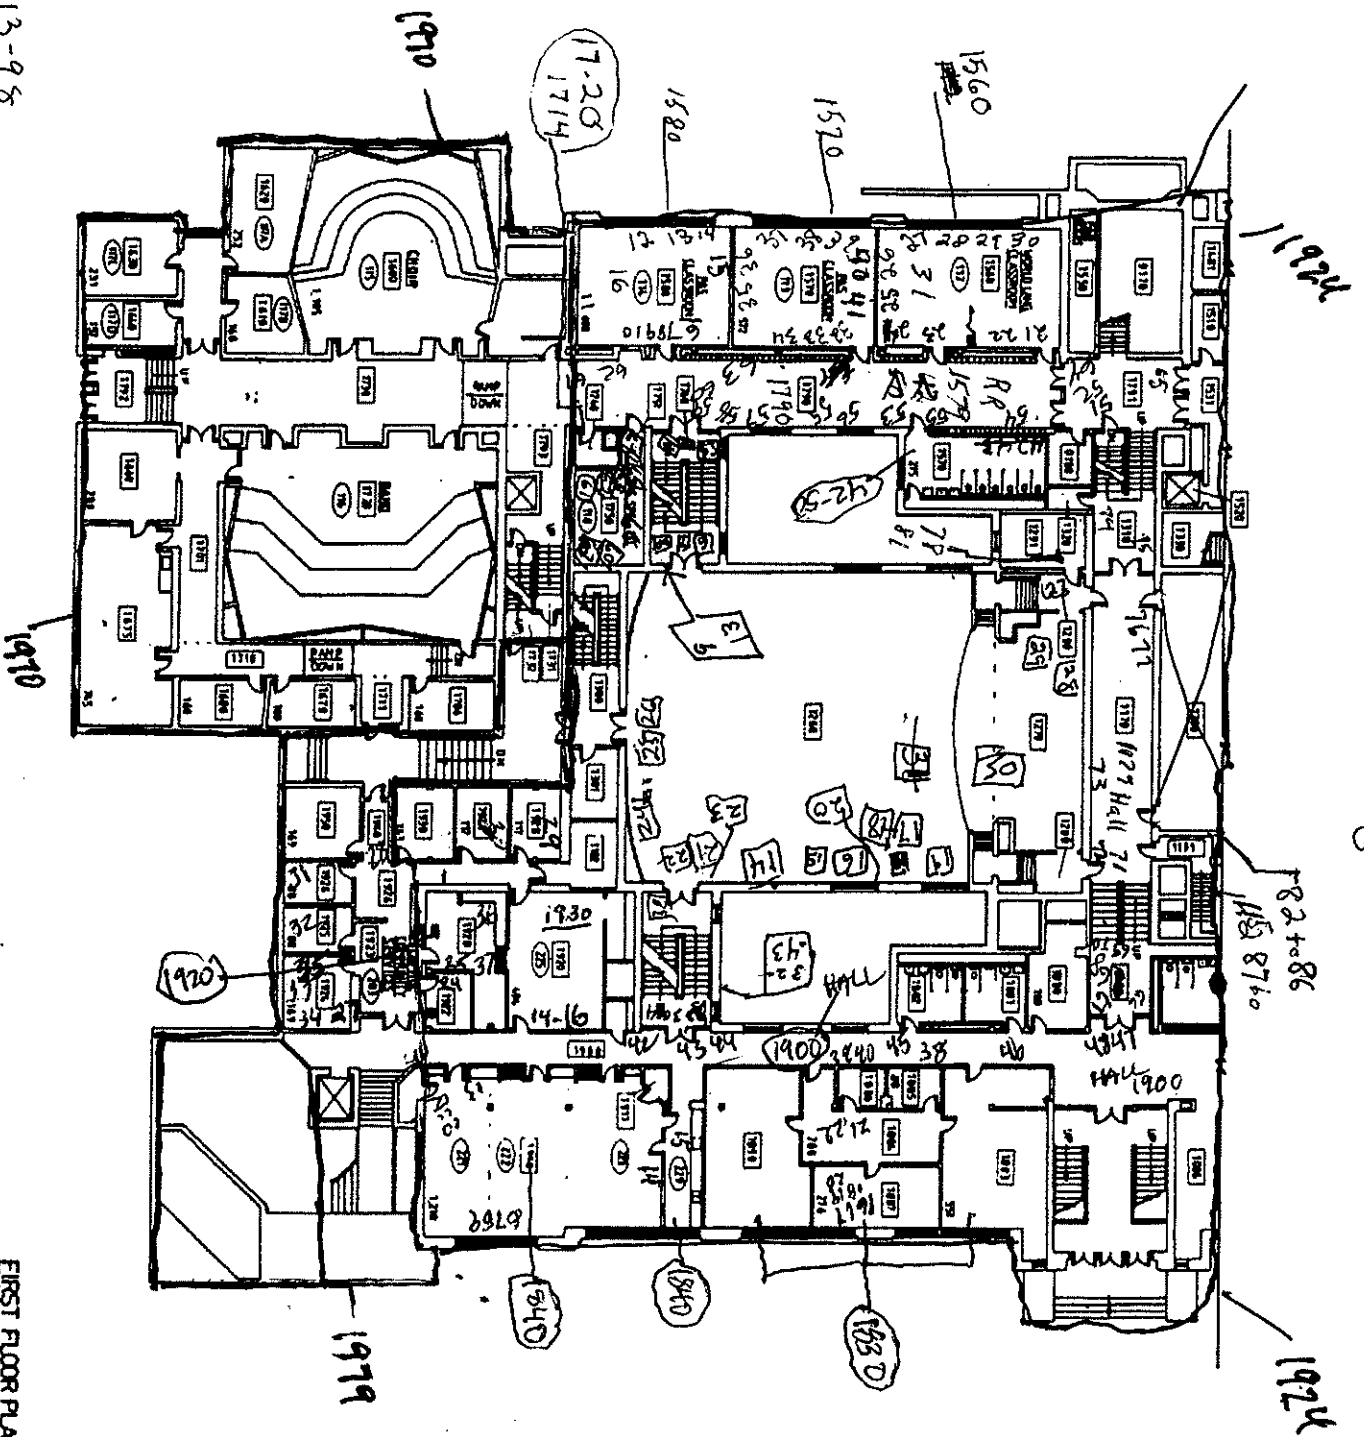


FIRST FLOOR PLAN-SOUTH

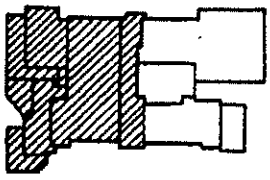

INDEPENDENT SCHOOL DIST. #625
 360 COLBORNE STREET
 ST. PAUL, MINNESOTA 55102

WASHINGTON JR. HIGH SCHOOL
 1041 MARION STREET
 ST. PAUL, MINNESOTA


CONSTRUCTED: 1924

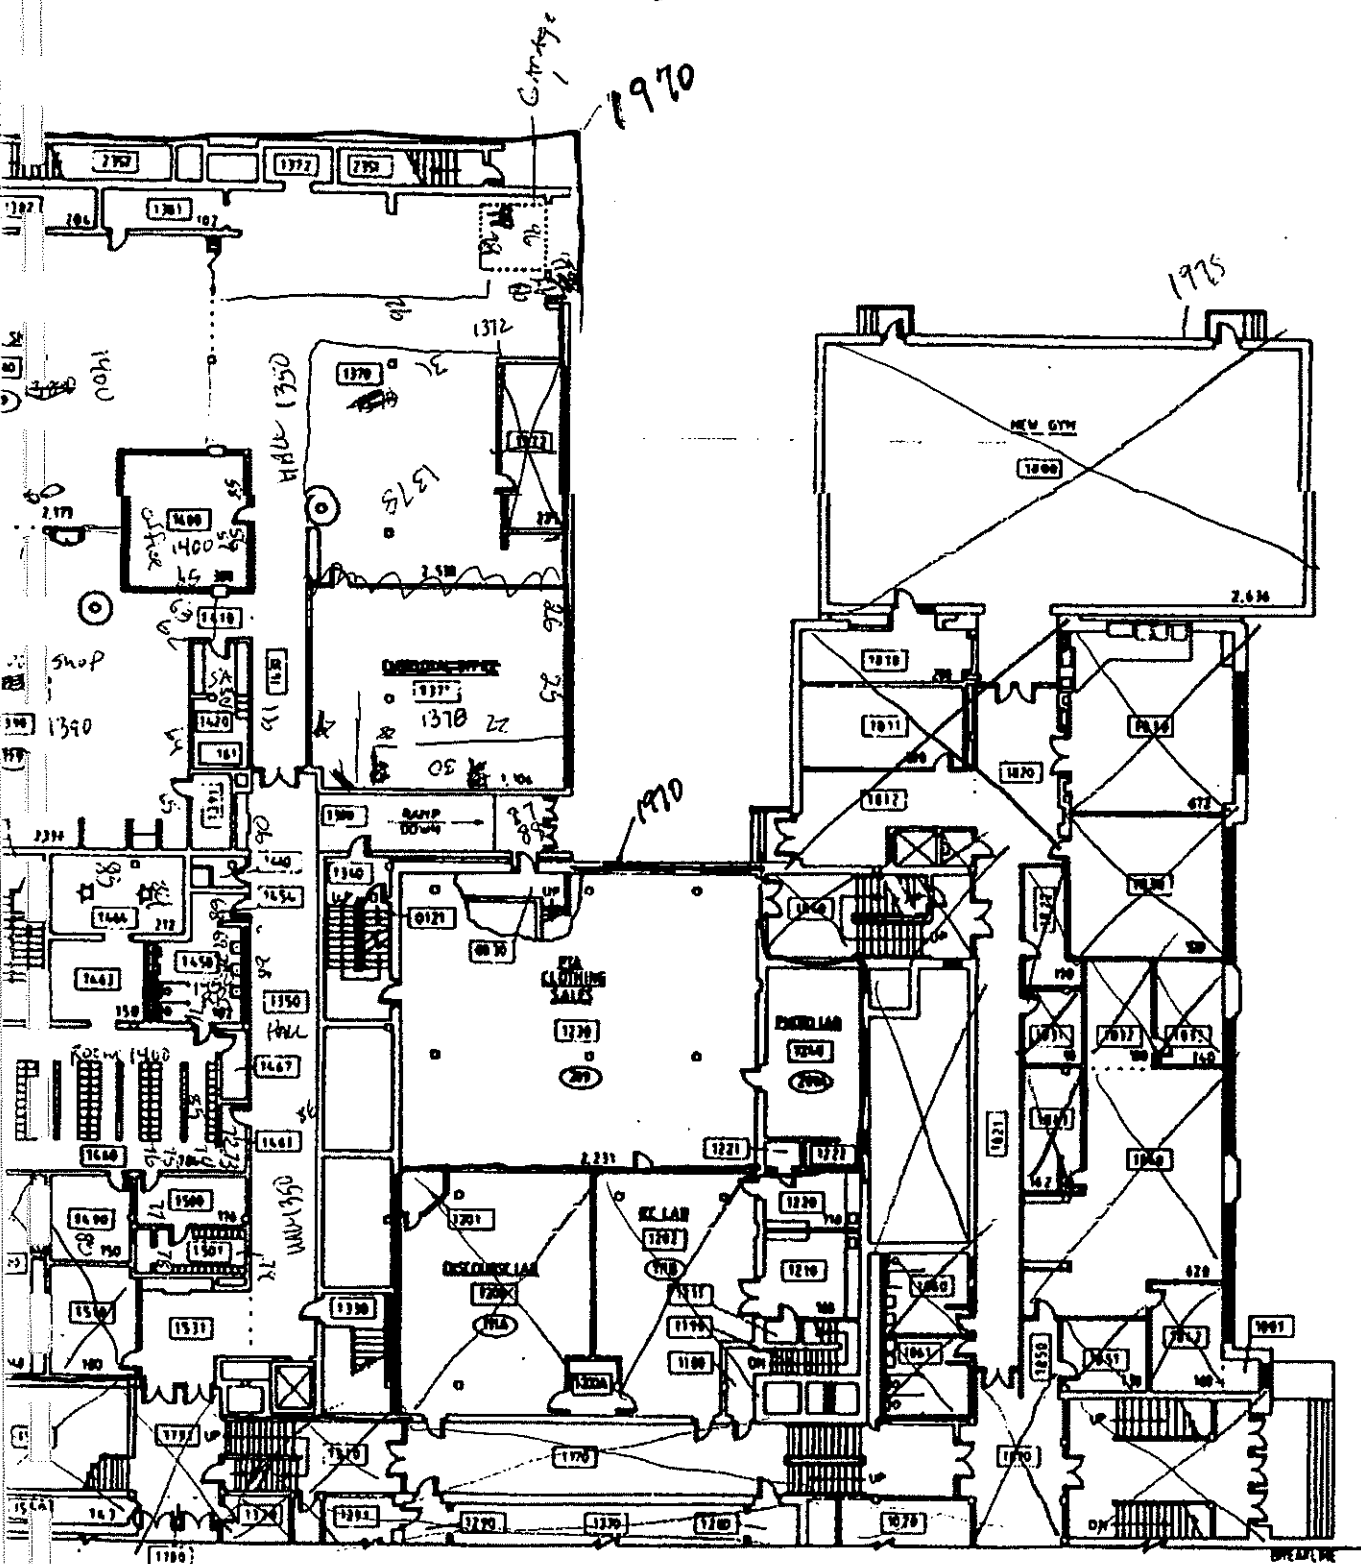

FIRST FLOOR PLAN - NORTH




D

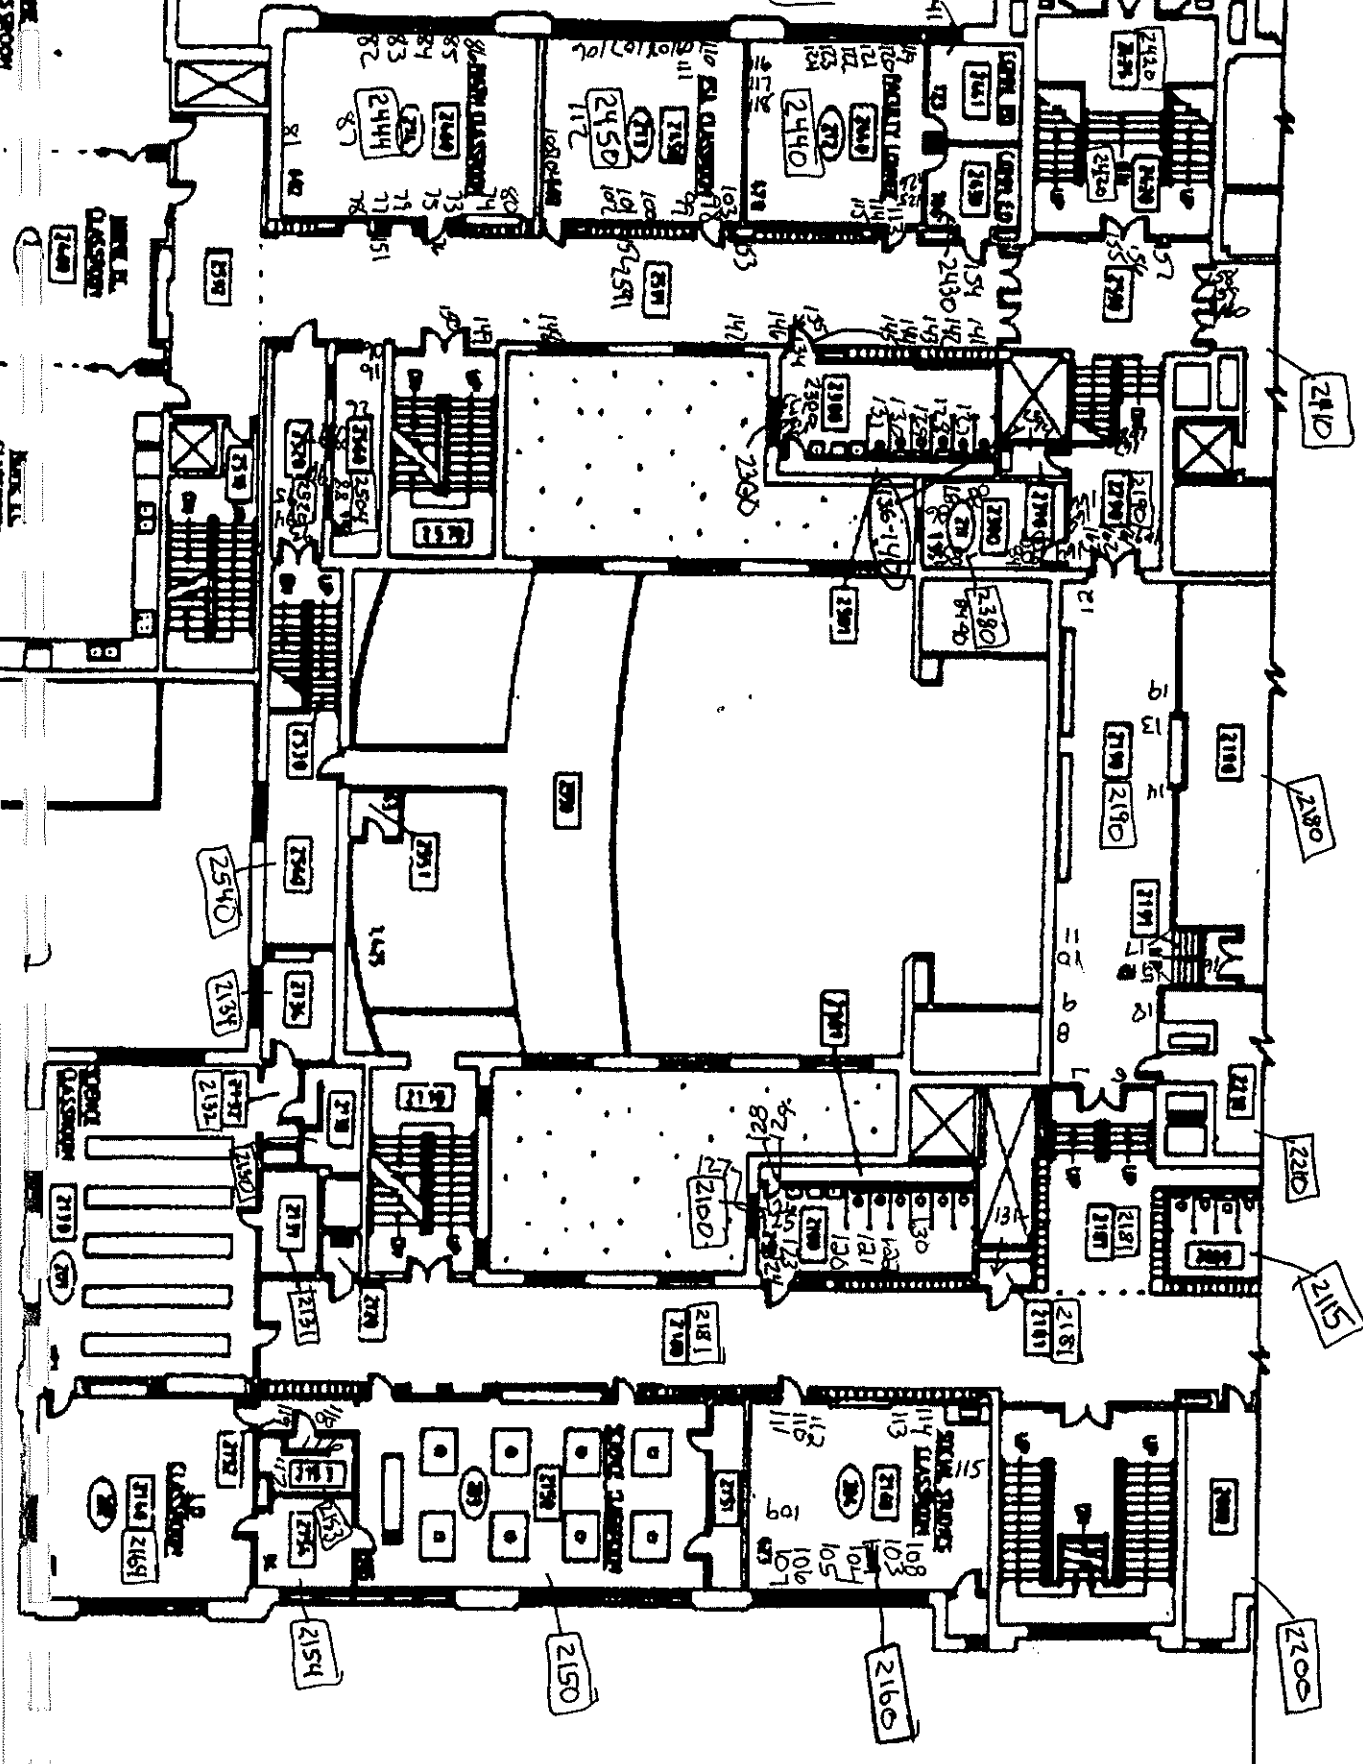


A

2nd Floor South

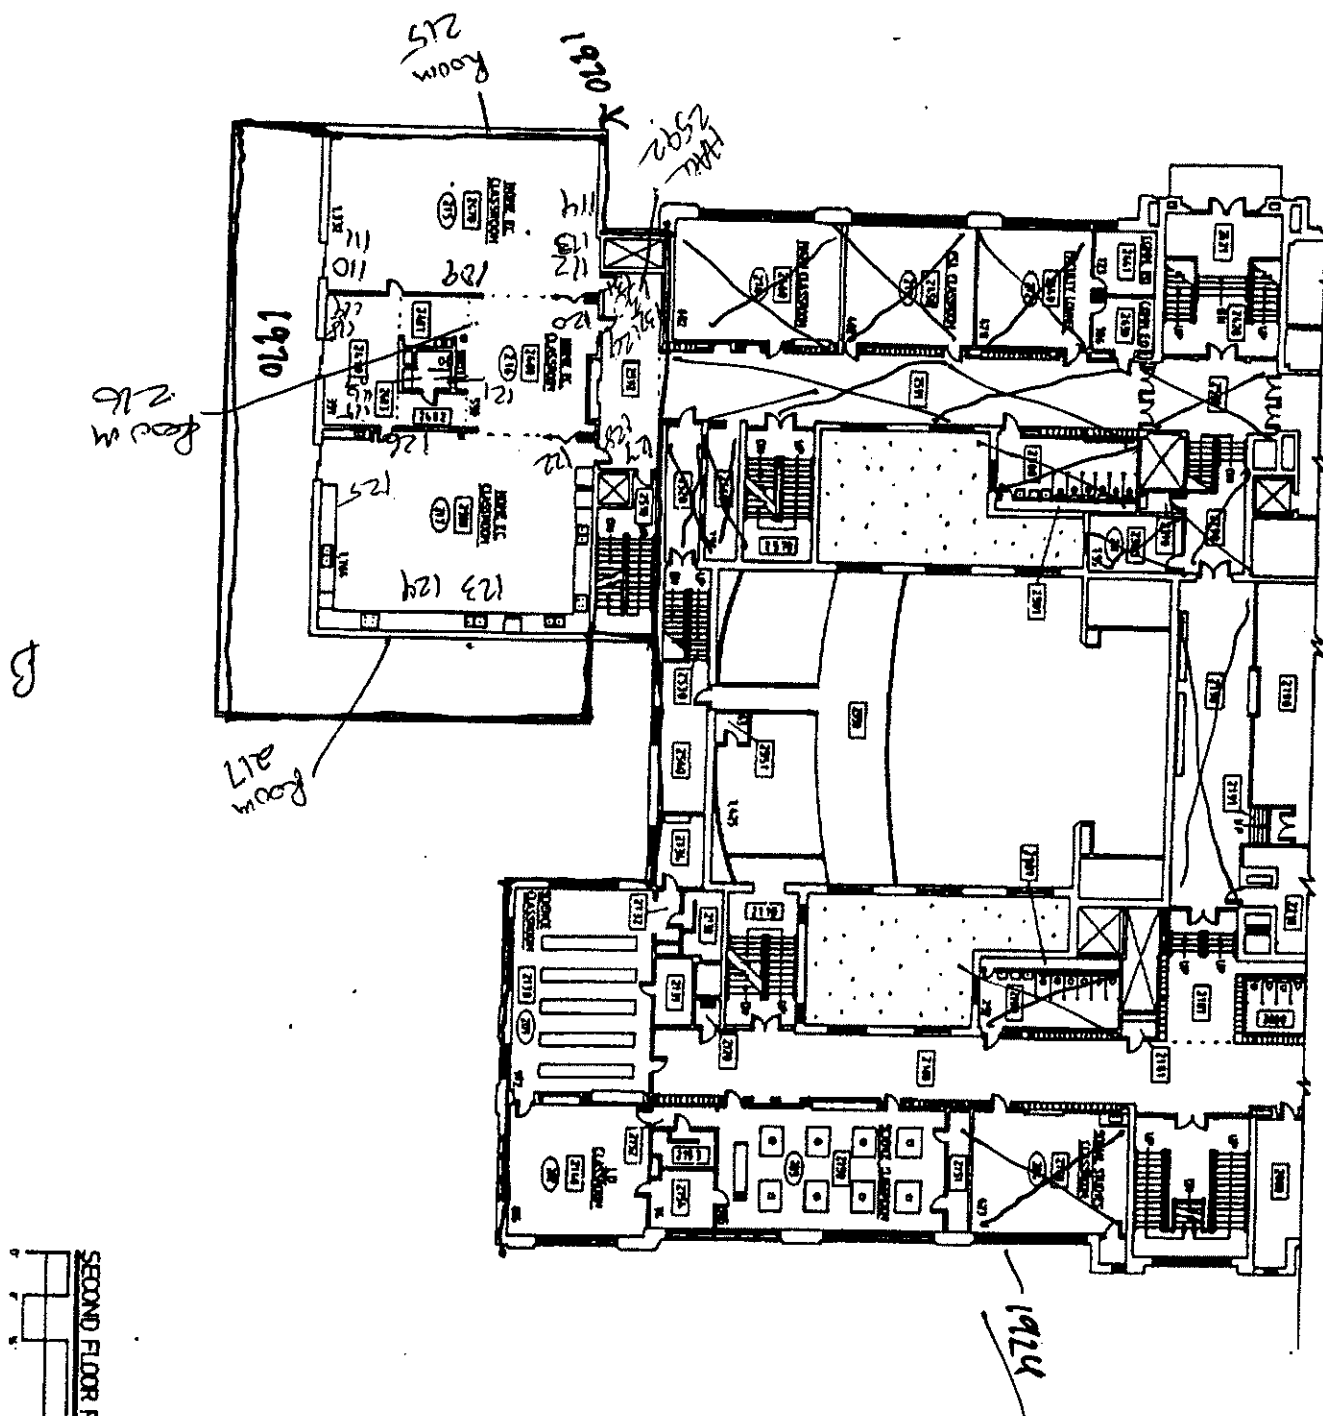

SECOND FLOOR PLAN - SOUTH


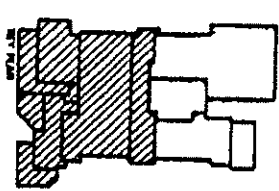


INDEPENDENT SCHOOL DIST. #625
300 COLBORNE STREET
ST. PAUL, MINNESOTA 55102


WASHINGTON JR. HIGH SCHOOL
1041 MARION STREET
ST. PAUL, MINNESOTA



CONSTRUCTED: 1924

SHEET
8
12

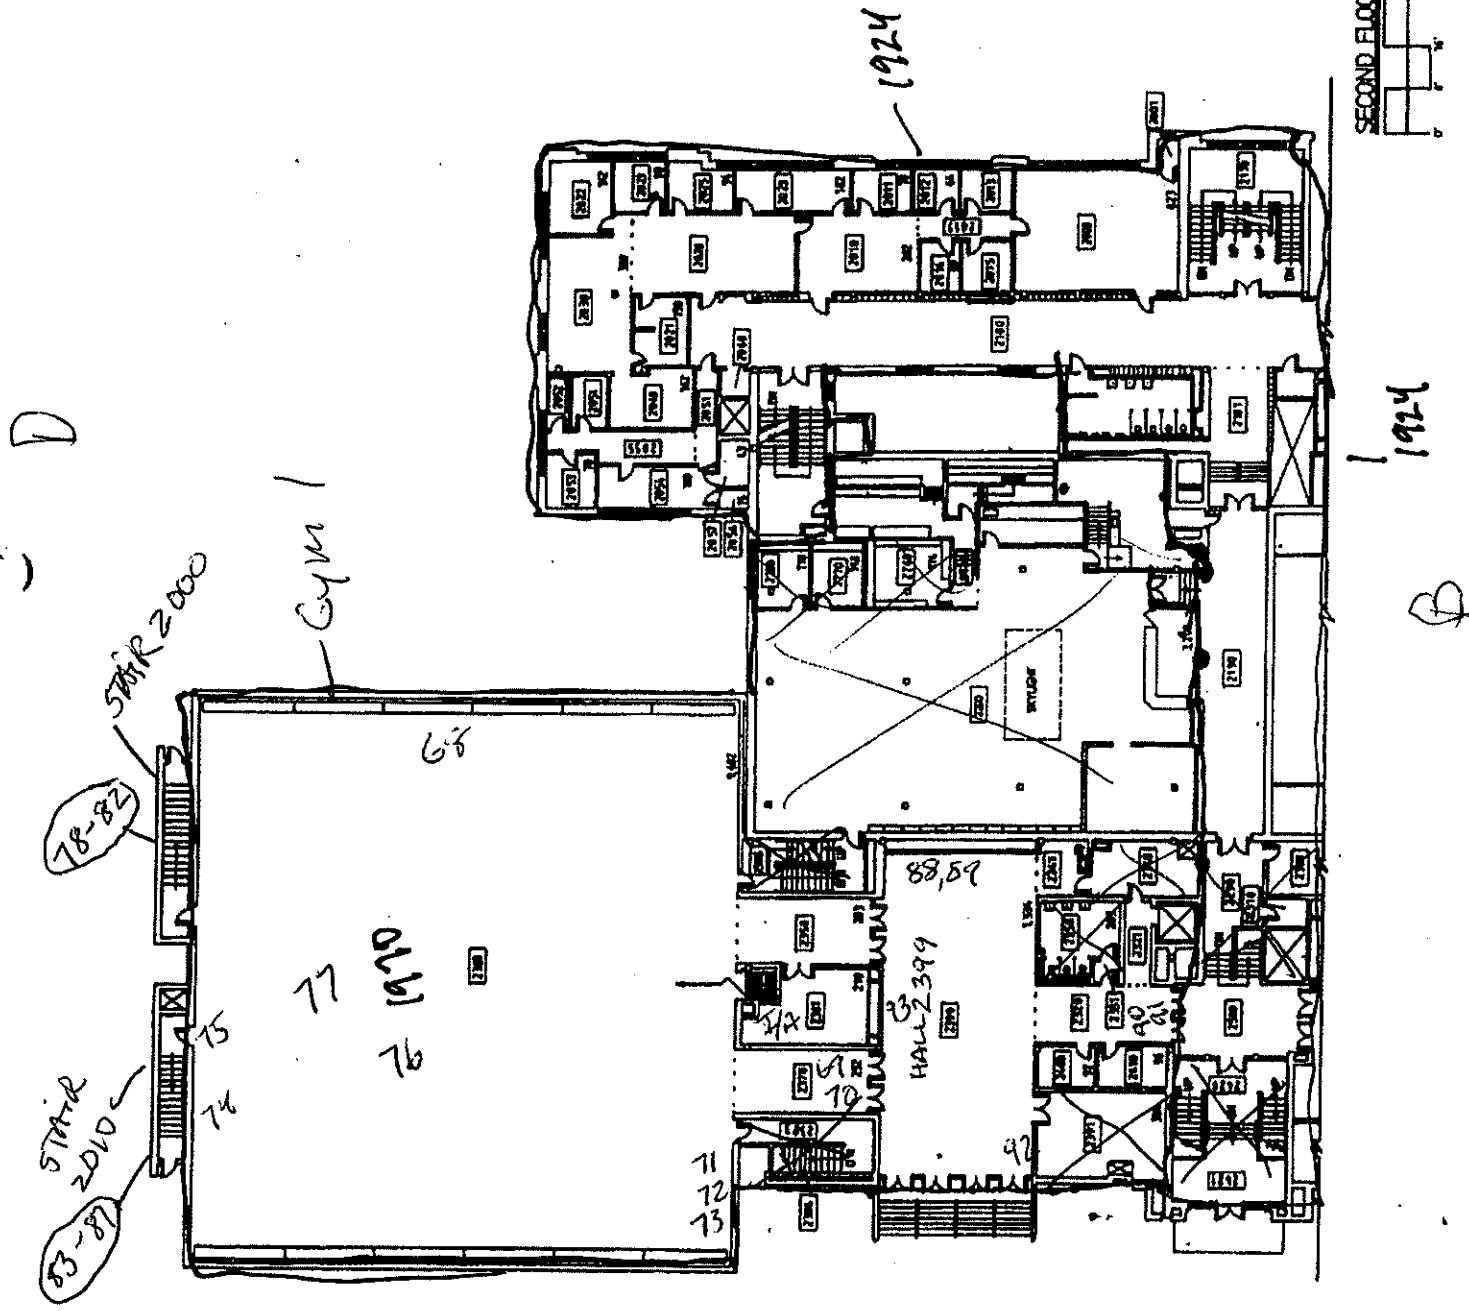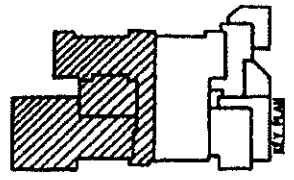


10/15/97

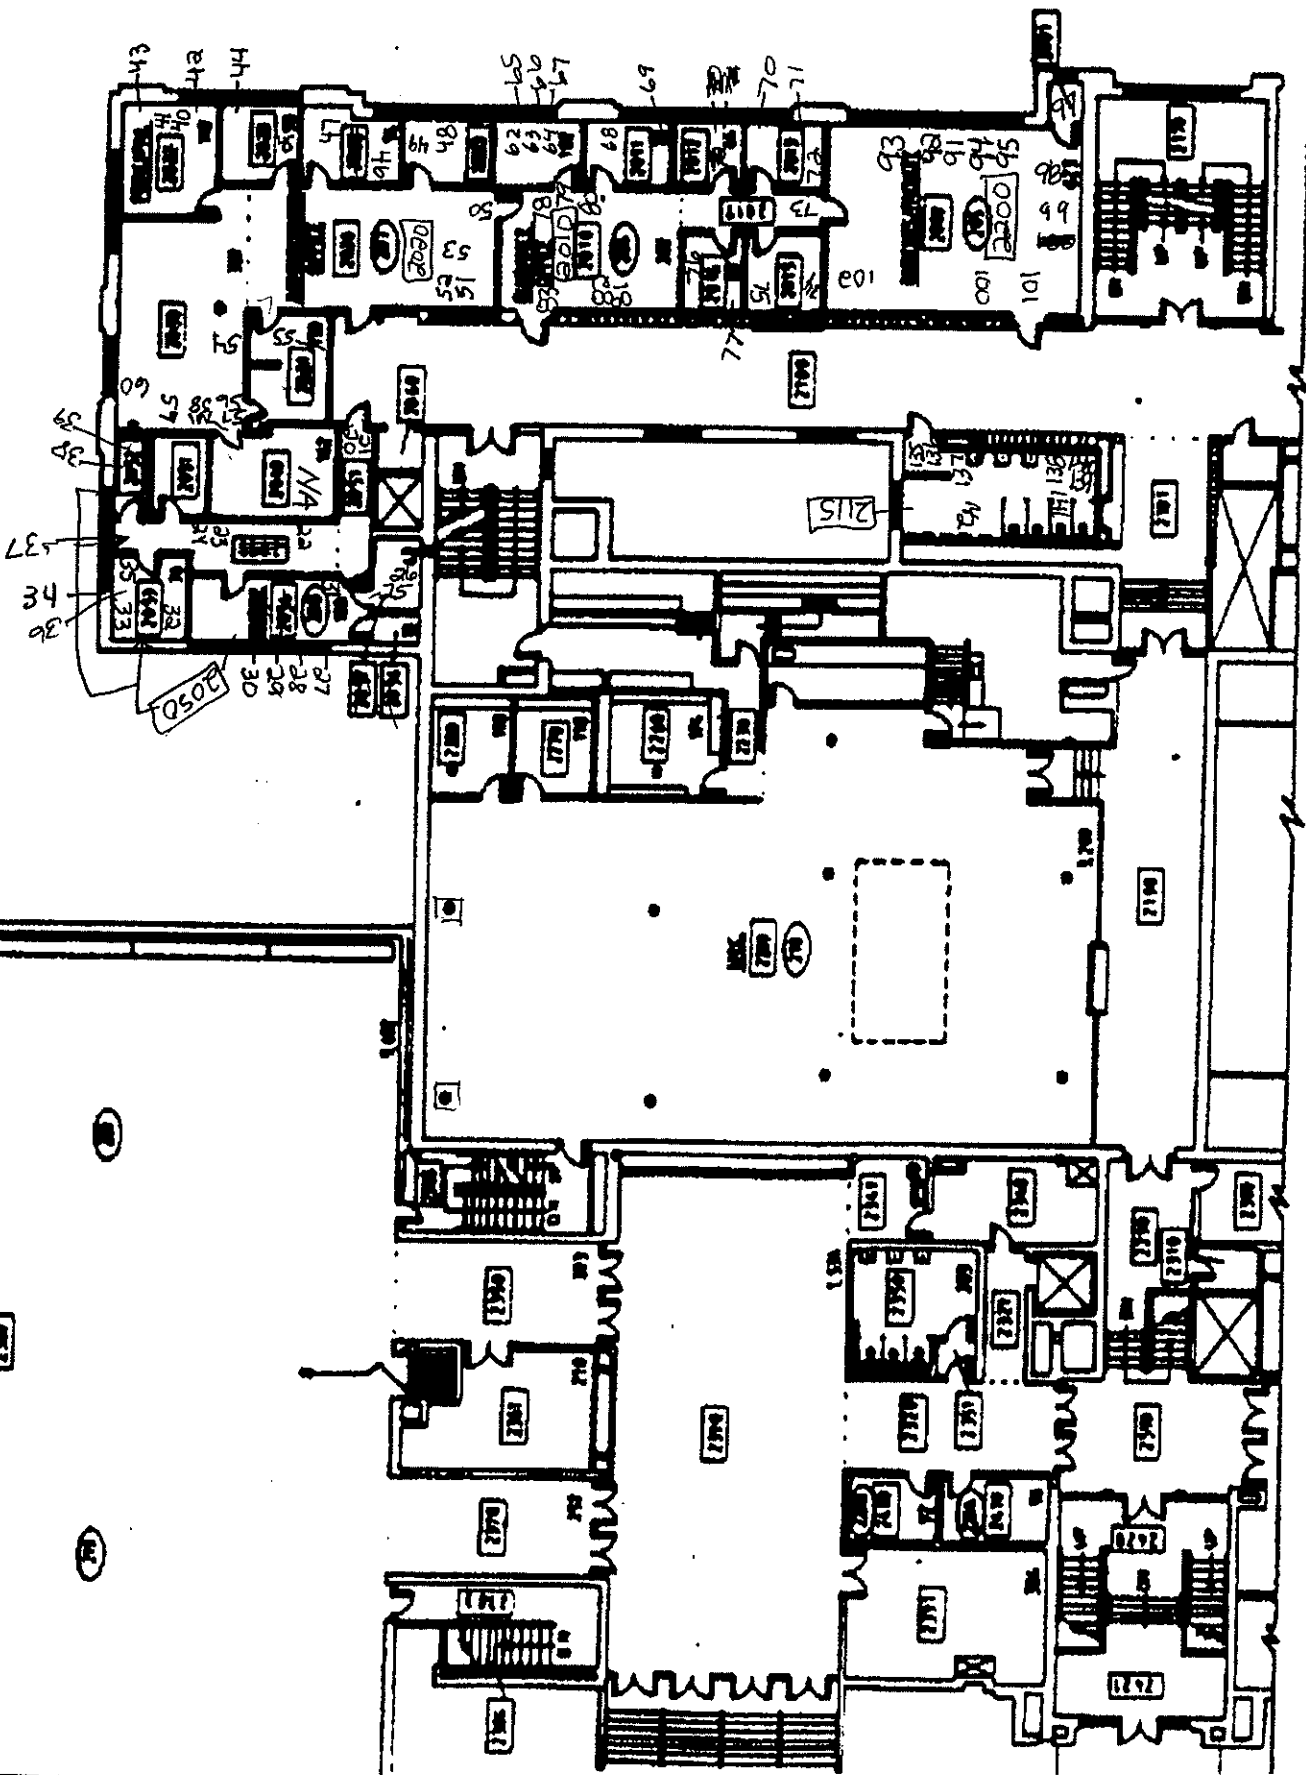

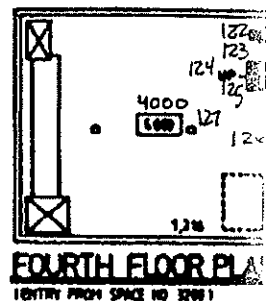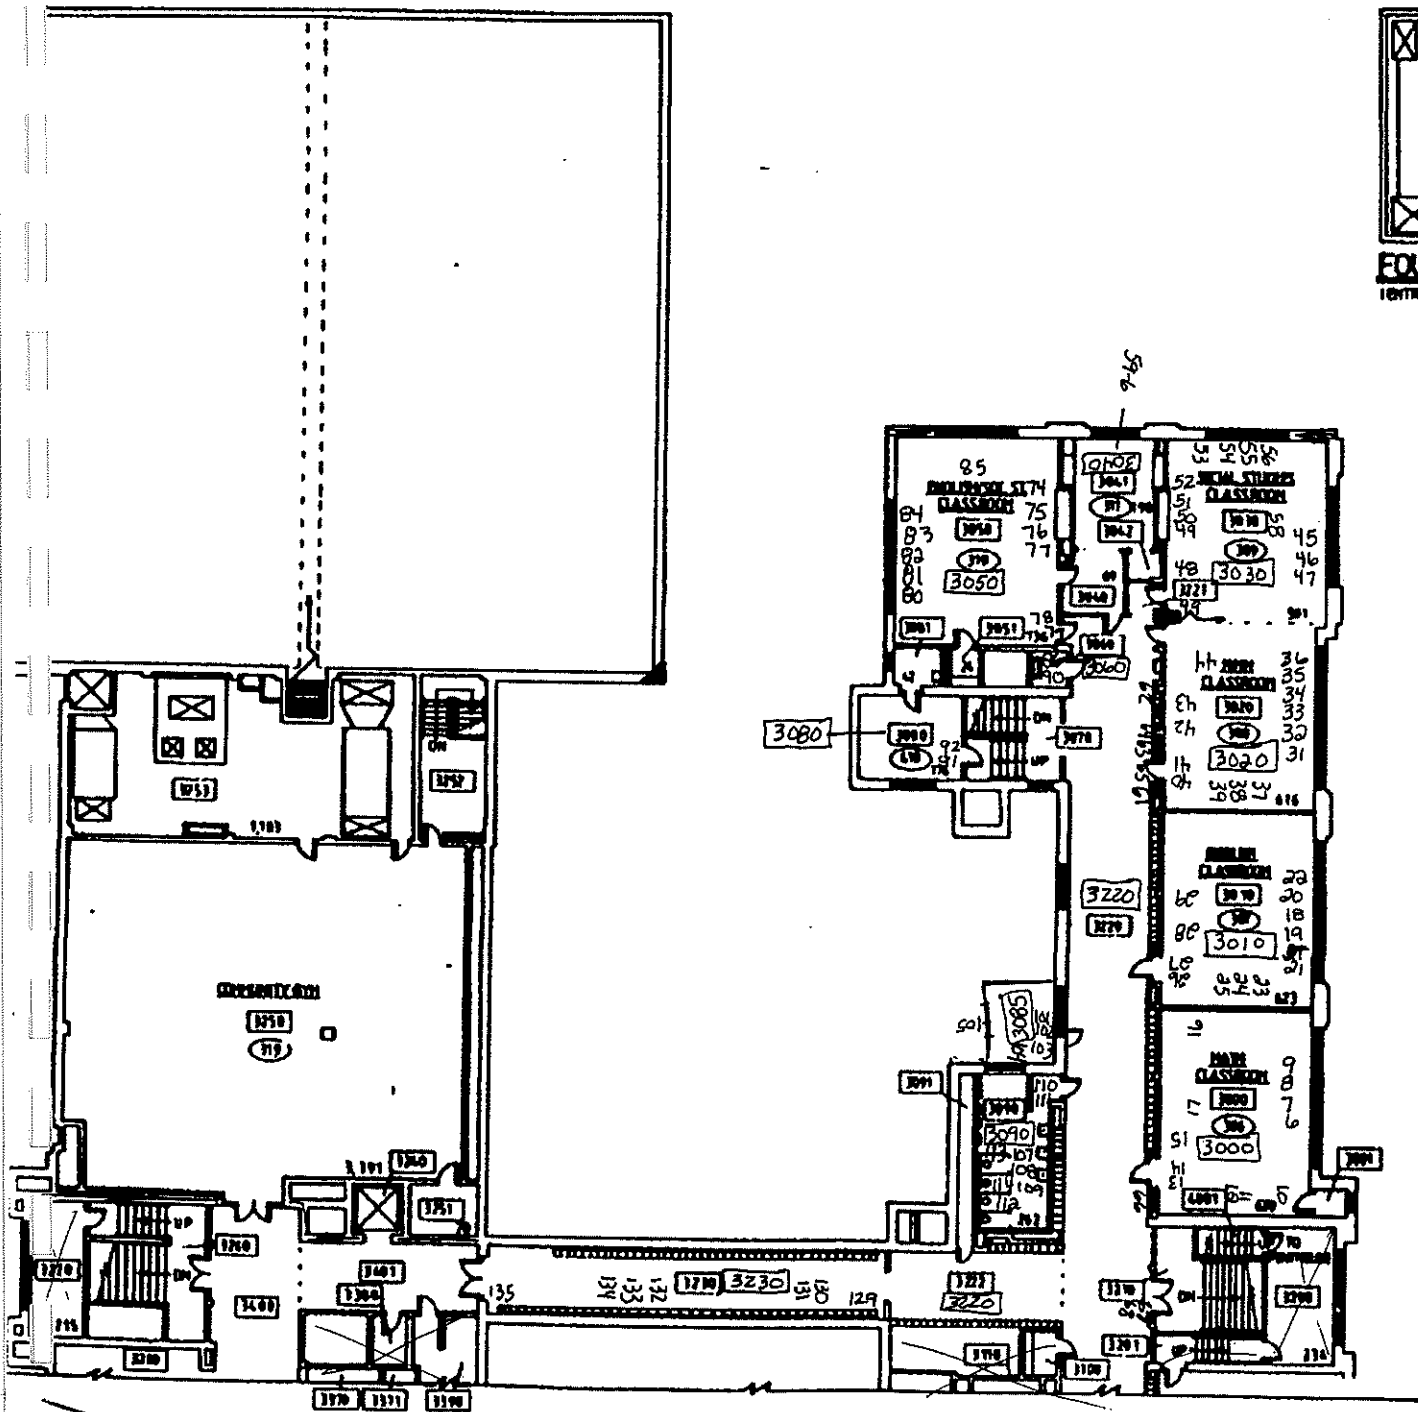


THIRD FLOOR PLAN-M

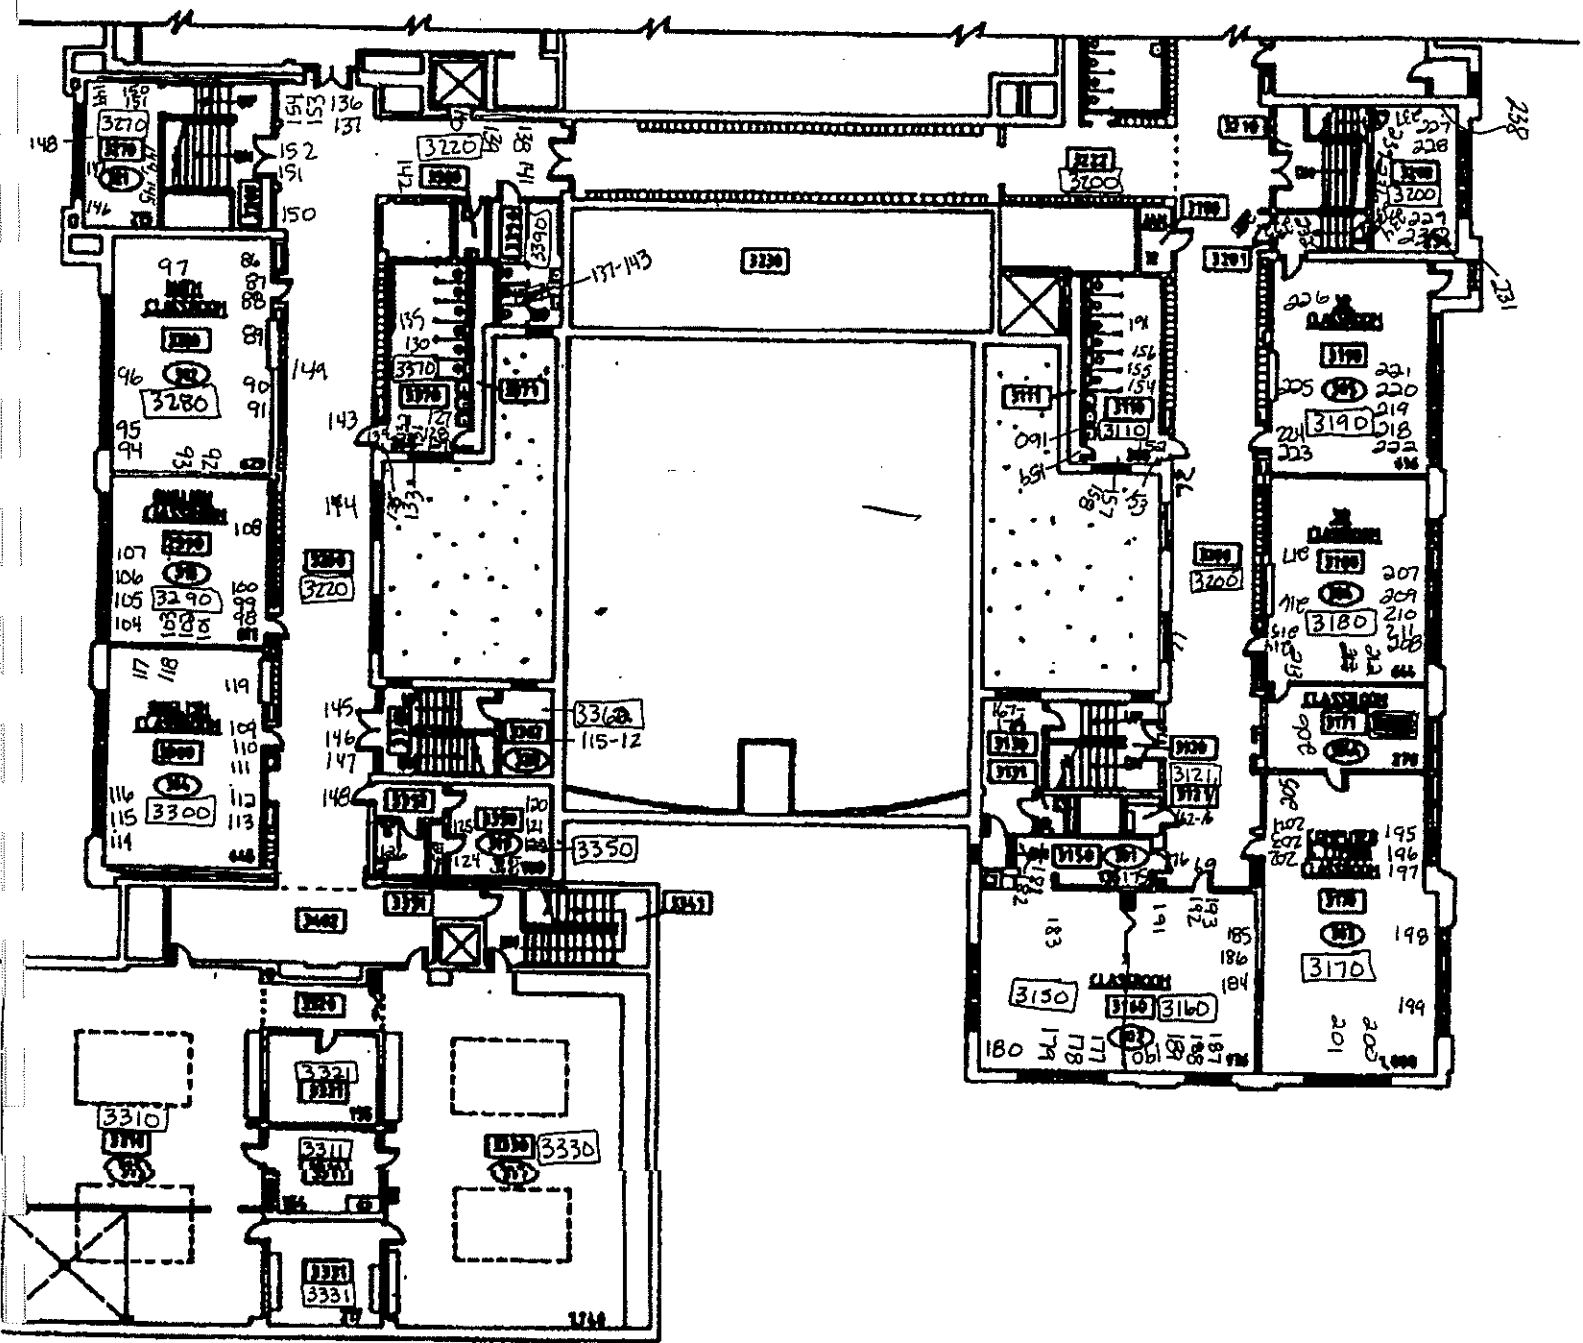



B

9-11-97
9-10-97

THIRD FLOOR



THIRD FLOOR PLAN - SOUTH


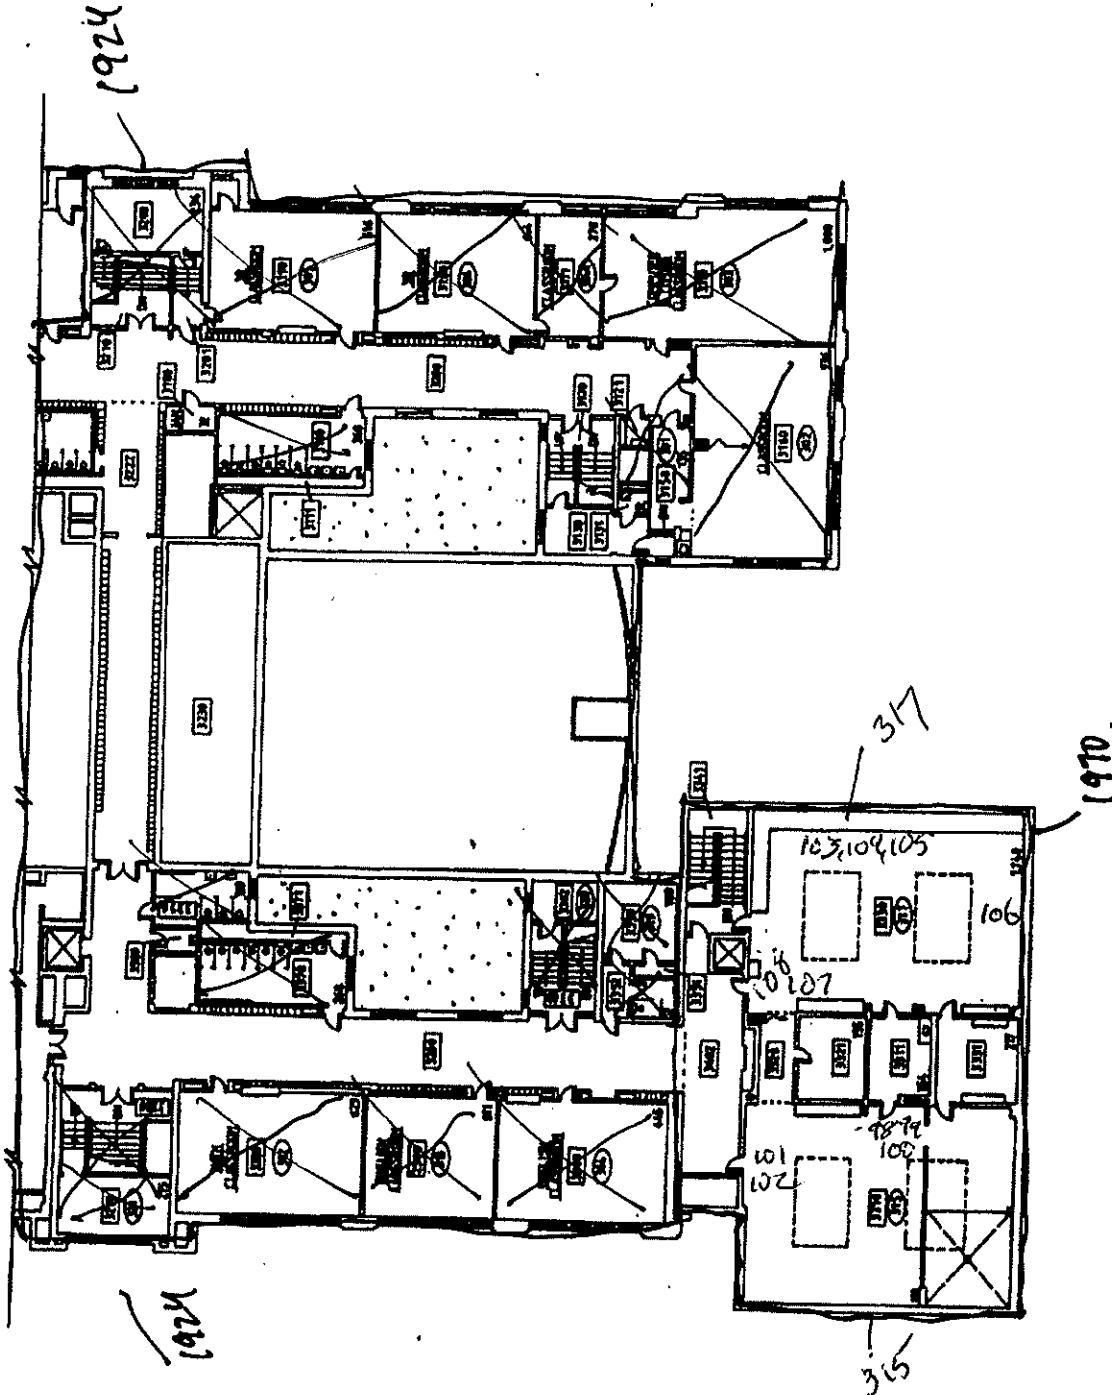
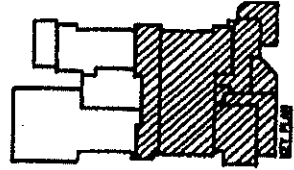


1924-7




1924

B

THIRD FLOOR PLAN-NORTH

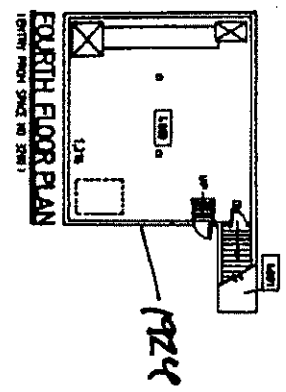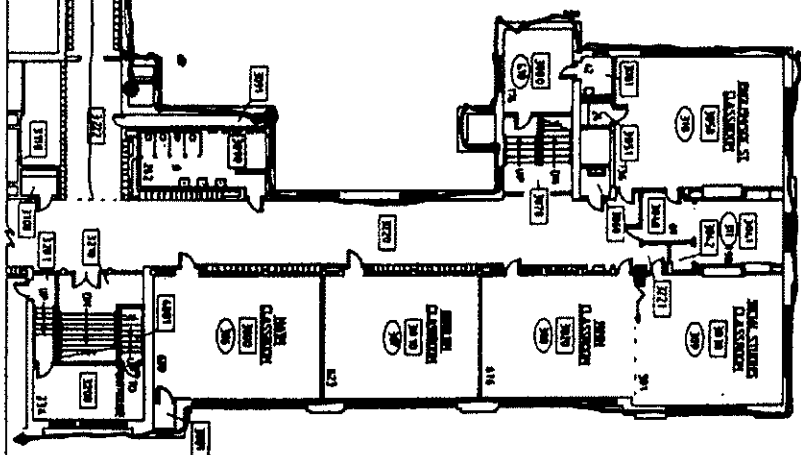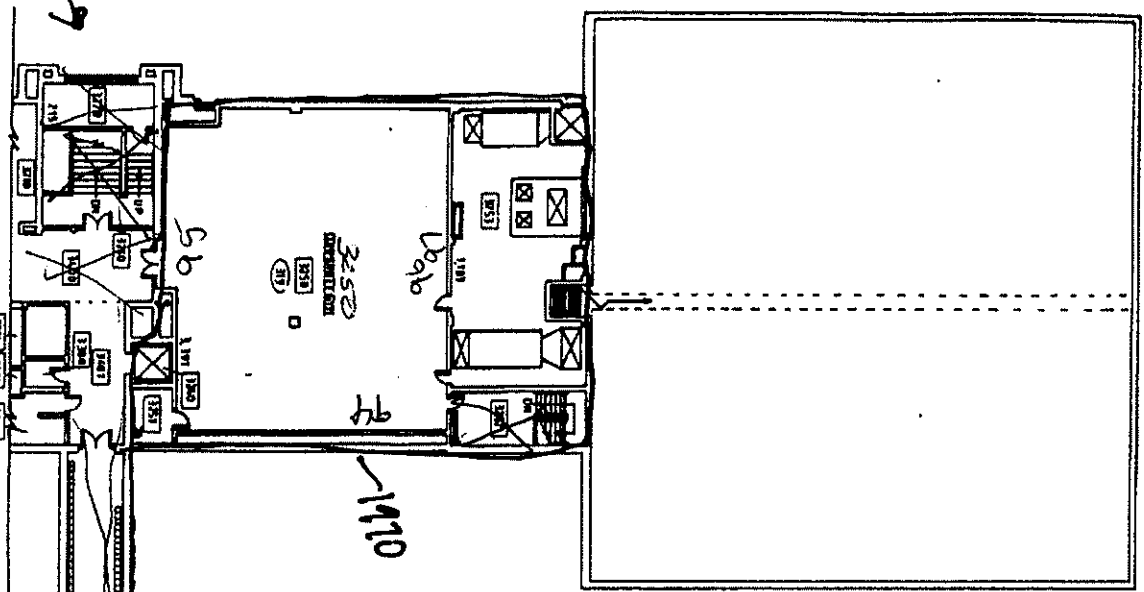

GALTIER STREET

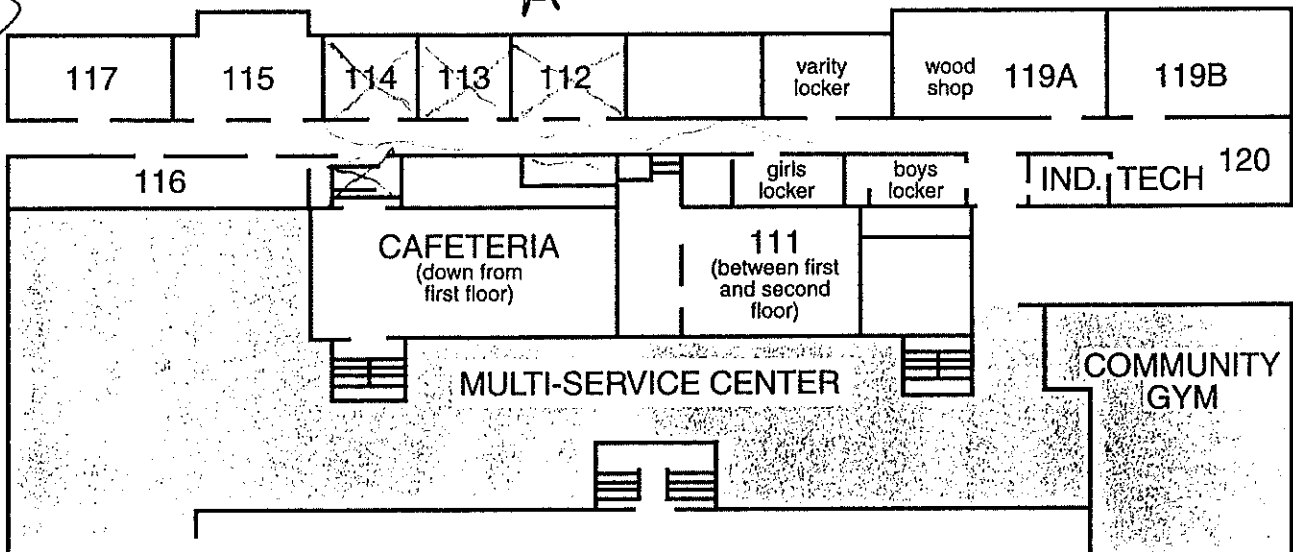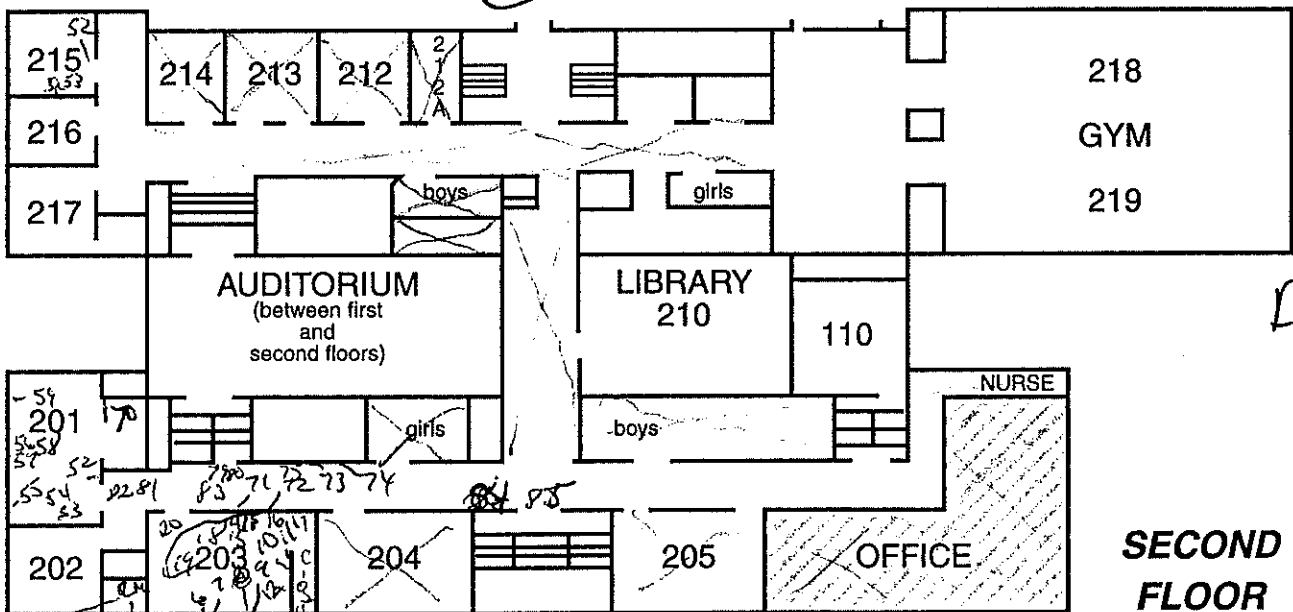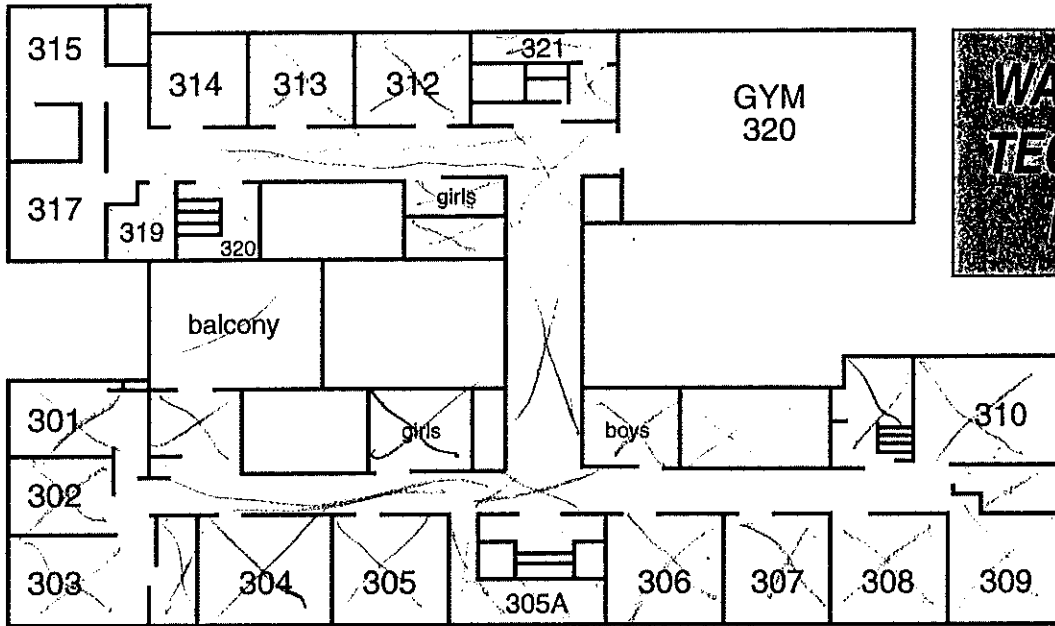

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Washington Junior High School, 1041 Marion Street, St. Paul, MN											
Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	14	XRF	4/14/98	1	Auditorium	1	Wall	Wall	Solid	Plaster	5.09
1924 Bldg.	15	XRF	4/14/98	1	Auditorium	1	Wall	Wall	Solid	Plaster	5.09
1924 Bldg.	16	XRF	4/14/98	1	Auditorium	1	Wall	Baseboard	Solid	Plaster	0.57
1924 Bldg.	17	XRF	4/14/98	1	Auditorium	1	Wall	Chair rail	Solid	Wood	0.08
1924 Bldg.	18	XRF	4/14/98	1	Auditorium	1	Wall	Chair rail	Solid	Wood	0.1
1924 Bldg.	19	XRF	4/14/98	1	Auditorium	1		Radiator	Solid	Metal	0.46
1924 Bldg.	20	XRF	4/14/98	1	Auditorium	1	Window	Casing	Solid	Wood	5.09
1924 Bldg.	21	XRF	4/14/98	1	Auditorium	1	Wall	Midle Wall	Solid	Plaster	5.09
1924 Bldg.	22	XRF	4/14/98	1	Auditorium	1	Door	Door	Solid	Metal	0.02
1924 Bldg.	23	XRF	4/14/98	1	Auditorium	1	Door	Jamb	Solid	Metal	0.25
1924 Bldg.	24	XRF	4/14/98	1	Auditorium	1	Wall	Wall Rgstr	Solid	Metal	0.1
1924 Bldg.	25	XRF	4/14/98	1	Auditorium	1	Door	Door	Solid	Metal	0.3
1924 Bldg.	26	XRF	4/14/98	1	Auditorium	1	Door	Jamb	Solid	Metal	0.2
1924 Bldg.	27	XRF	4/14/98	1	Auditorium	1	Door	Door	Solid	Metal	0.02
1924 Bldg.	28	XRF	4/14/98	1	Auditorium	1	Wall	Midle Wall	Solid	Plaster	0.15
1924 Bldg.	29	XRF	4/14/98	1	Auditorium	1		Radiator	Solid	Metal	1.31
1924 Bldg.	30	XRF	4/14/98	1	Auditorium	1	Floor		Solid	Wood	0
1924 Bldg.	31	XRF	4/14/98	1	Auditorium	1	Chair		Solid	Metal	0
1924 Bldg.	52	XRF	6/17/97	2	Classroom	201	Wall	Wall	Solid	Plaster	5.09
1924 Bldg.	53	XRF	6/17/97	2	Classroom	201	Cabinet	Door	Solid	Wood	0.05
1924 Bldg.	54	XRF	6/17/97	2	Classroom	201	Cabinet	Inside	Solid	Wood	0.02
1924 Bldg.	55	XRF	6/17/97	2	Classroom	201		Radiator	Peeling	Metal	2.78
1924 Bldg.	56	XRF	6/17/97	2	Classroom	201	Window	Casing	Solid	Wood	0.07
1924 Bldg.	57	XRF	6/17/97	2	Classroom	201	Cabinet	Top	Cracked	Wood	0
1924 Bldg.	58	XRF	6/17/97	2	Classroom	201	Window	Panel	Solid	Metal	0
1924 Bldg.	59	XRF	6/17/97	2	Classroom	201	Wall	Crown Mold	Solid	Wood	0.06
1924 Bldg.	60	XRF	6/17/97	2	Classroom	201	Blackboard	Casing	Solid	Wood	0.07
1924 Bldg.	61	XRF	6/17/97	2	Classroom	201	Blackboard	Casing	Cracked	Wood	0.05
1924 Bldg.	62	XRF	6/17/97	2	Classroom	201	Wall	Baseboard	Solid	Wood	0.05
1924 Bldg.	63	XRF	6/17/97	2	Classroom	201	Wall	Wall Rgstr	Solid	Metal	0.05
1924 Bldg.	64	XRF	6/17/97	2	Classroom	201	Ceiling		Solid	Plaster	0.09
1924 Bldg.	65	XRF	6/17/97	2	Classroom	201	Closet	Wall	Solid	Plaster	1.78
1924 Bldg.	66	XRF	6/17/97	2	Classroom	201	Closet	Shelf	Solid	Wood	0.03
1924 Bldg.	67	XRF	6/17/97	2	Classroom	201	Closet	Baseboard	Solid	Wood	0.05
1924 Bldg.	68	XRF	6/17/97	2	Classroom	201	Closet	Floor	Cracked	Wood	0
1924 Bldg.	69	XRF	6/17/97	2	Classroom	201	Closet	Ceiling	Solid	Plaster	0.16
1924 Bldg.	36	XRF	6/17/97	2	Classroom	202	Wall	Midle Wall	Solid	Plaster	0.26
1924 Bldg.	37	XRF	6/17/97	2	Classroom	202	Blackboard	Casing	Solid	Wood	0.09
1924 Bldg.	38	XRF	6/17/97	2	Classroom	202	Blackboard	Casing	Cracked	Wood	0.03
1924 Bldg.	39	XRF	6/17/97	2	Classroom	202	Wall	Baseboard	Solid	Wood	0.05
1924 Bldg.	40	XRF	6/17/97	2	Classroom	202	Cabinet	Door	Solid	Wood	0.05
1924 Bldg.	41	XRF	6/17/97	2	Classroom	202	Cabinet	Shelf	Solid	Wood	0.02
1924 Bldg.	43	XRF	6/17/97	2	Classroom	202	Door	Door	Cracked	Wood	0
1924 Bldg.	44	XRF	6/17/97	2	Classroom	202	Door	Casing	Cracked	Wood	0.03
1924 Bldg.	45	XRF	6/17/97	2	Classroom	202	Wall	Wall Rgstr	Solid	Metal	0.02
1924 Bldg.	46	XRF	6/17/97	2	Classroom	202	Wall	Crown Mold	Cracked	Wood	0.02
1924 Bldg.	47	XRF	6/17/97	2	Classroom	202	Ceiling		Solid	Plaster	0.15
1924 Bldg.	48	XRF	6/17/97	2	Classroom	202	Window	Casing	Solid	Wood	0.06
1924 Bldg.	49	XRF	6/17/97	2	Classroom	202		Radiator	Cracked	Metal	0.51
1924 Bldg.	50	XRF	6/17/97	2	Classroom	202	Floor		Solid	Wood	0
1924 Bldg.	51	XRF	6/17/97	2	Classroom	202	Wall	Wall	Solid	Plaster	5.09
1924 Bldg.	6	XRF	6/17/97	2	Classroom	203	Wall	Midle Wall	Cracked	Plaster	5.09
1924 Bldg.	7	XRF	6/17/97	2	Classroom	203	Window	Casing	Cracked	Wood	0.05
1924 Bldg.	8	XRF	6/17/97	2	Classroom	203	Window	Stool	Peeling	Wood	0
1924 Bldg.	9	XRF	6/17/97	2	Classroom	203	Window	Panel	Solid	Metal	0
1924 Bldg.	10	XRF	6/17/97	2	Classroom	203	Wall	Baseboard	Cracked	Wood	0.06
1924 Bldg.	11	XRF	6/17/97	2	Classroom	203	Blackboard	Casing	Cracked	Wood	0.09
1924 Bldg.	12	XRF	6/17/97	2	Classroom	203	Blackboard	Casing	Solid	Wood	0.11

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	13	XRF	6/17/97	2	Classroom	203	Cabinet	Door	Solid	Wood	0
1924 Bldg.	14	XRF	6/17/97	2	Classroom	203	Cabinet	Bottom Shel	Cracked	Wood	0
1924 Bldg.	16	XRF	6/17/97	2	Classroom	203	Cabinet	Door	Cracked	Wood	1.84
1924 Bldg.	17	XRF	6/17/97	2	Classroom	203	Cabinet	Inside	Cracked	Wood	0
1924 Bldg.	18	XRF	6/17/97	2	Classroom	203	Wire Tray		Solid	Metal	0.02
1924 Bldg.	20	XRF	6/17/97	2	Classroom	203	Ceiling		Solid	Plaster	0.09
1924 Bldg.	21	XRF	6/17/97	2	Classroom	203	Closet	Wall	Peeling	Plaster	2.52
1924 Bldg.	22	XRF	6/17/97	2	Classroom	203	Closet	Shelf	Cracked	Wood	0.03
1924 Bldg.	23	XRF	6/17/97	2	Classroom	203	Closet	Shelf	Cracked	Wood	0.02
1924 Bldg.	24	XRF	6/17/97	2	Classroom	203	Closet	Baseboard	Cracked	Wood	0.03
1924 Bldg.	25	XRF	6/17/97	2	Classroom	203	Closet	Floor	Cracked	Wood	0.01
1924 Bldg.	26	XRF	6/17/97	2	Classroom	203	Closet	Wall	Solid	Wood	0.02
1924 Bldg.	27	XRF	6/17/97	2	Classroom	203	Closet	Ceiling	Peeling	Plaster	0.29
1924 Bldg.	21	XRF	4/13/98	1	Classroom	1560	Wall	Midle Wall	Solid	Concrte	0.33
1924 Bldg.	22	XRF	4/13/98	1	Classroom	1560	Door	Door	Solid	Wood	0
1924 Bldg.	23	XRF	4/13/98	1	Classroom	1560	Door	Jamb	Solid	Wood	0
1924 Bldg.	24	XRF	4/13/98	1	Classroom	1560	Cabinet	Door	Solid	Wood	0.03
1924 Bldg.	25	XRF	4/13/98	1	Classroom	1560	Chalkboard	Rail	Solid	Wood	0
1924 Bldg.	26	XRF	4/13/98	1	Classroom	1560	Wall	Baseboard	Solid	Wood	0.04
1924 Bldg.	27	XRF	4/13/98	1	Classroom	1560		Radiator	Cracked	Metal	0.12
1924 Bldg.	28	XRF	4/13/98	1	Classroom	1560	Window	Panel	Solid	Wood	0
1924 Bldg.	29	XRF	4/13/98	1	Classroom	1560	Window	Casing	Solid	Metal	0
1924 Bldg.	30	XRF	4/13/98	1	Classroom	1560	Window	Mullion	Solid	Wood	0.02
1924 Bldg.	31	XRF	4/13/98	1	Classroom	1560	Floor		Cracked	Wood	0
1924 Bldg.	32	XRF	4/13/98	1	Classroom	1570	Door	Door	Solid	Wood	0.08
1924 Bldg.	33	XRF	4/13/98	1	Classroom	1570	Door	Casing	Solid	Wood	0.03
1924 Bldg.	34	XRF	4/13/98	1	Classroom	1570	Wall	Midle Wall	Solid	Plaster	0.23
1924 Bldg.	35	XRF	4/13/98	1	Classroom	1570	Wall	Wall	Solid	Drywall	0.02
1924 Bldg.	36	XRF	4/13/98	1	Classroom	1570	Wall	Baseboard	Solid	Wood	0.03
1924 Bldg.	37	XRF	4/13/98	1	Classroom	1570	Window	Panel	Solid	Wood	0
1924 Bldg.	38	XRF	4/13/98	1	Classroom	1570	Window	Mullion	Solid	Wood	0.02
1924 Bldg.	39	XRF	4/13/98	1	Classroom	1570	Window	Casing	Solid	Wood	0
1924 Bldg.	40	XRF	4/13/98	1	Classroom	1570	Chalkboard	Rail	Solid	Wood	0
1924 Bldg.	41	XRF	4/13/98	1	Classroom	1570	Floor		Solid	Wood	0
1924 Bldg.	103	XRF	10/15/97	2	Classroom	2160	Wall	Baseboard	Solid	Wood	0.1
1924 Bldg.	104	XRF	10/15/97	2	Classroom	2160	Wall	Wall	Solid	Concrte	0.04
1924 Bldg.	105	XRF	10/15/97	2	Classroom	2160		Radiator	Solid	Metal	0.07
1924 Bldg.	106	XRF	10/15/97	2	Classroom	2160	Window	Casing	Solid	Metal	0
1924 Bldg.	107	XRF	10/15/97	2	Classroom	2160	Window	Mullion	Solid	Wood	0.09
1924 Bldg.	108	XRF	10/15/97	2	Classroom	2160	Window	Panel	Solid	Wood	0
1924 Bldg.	109	XRF	10/15/97	2	Classroom	2160	Cabinet	Door	Solid	Wood	0.03
1924 Bldg.	110	XRF	10/15/97	2	Classroom	2160	Door	Door	Solid	Wood	0.09
1924 Bldg.	111	XRF	10/15/97	2	Classroom	2160	Door	Casing	Solid	Wood	0.04
1924 Bldg.	112	XRF	10/15/97	2	Classroom	2160	Wall	Midle Wall	Solid	Concrte	5.09
1924 Bldg.	113	XRF	10/15/97	2	Classroom	2160	Chalkboard	Rail	Solid	Wood	0.03
1924 Bldg.	114	XRF	10/15/97	2	Classroom	2160	Wall	Wall Rgstr	Solid	Metal	0.06
1924 Bldg.	115	XRF	10/15/97	2	Classroom	2160	Wall	Wall	Solid	Concrte	0.25
1924 Bldg.	91	XRF	10/15/97	2	Classroom	2200	Wall	Baseboard	Solid	Wood	0.06
1924 Bldg.	92	XRF	10/15/97	2	Classroom	2200	Wall	Wall	Solid	Concrte	0.18
1924 Bldg.	93	XRF	10/15/97	2	Classroom	2200	Door	Casing	Solid	Metal	0
1924 Bldg.	94	XRF	10/15/97	2	Classroom	2200	Window	Mullion	Solid	Wood	0.17
1924 Bldg.	95	XRF	10/15/97	2	Classroom	2200	Window	Panel	Solid	Wood	0
1924 Bldg.	96	XRF	10/15/97	2	Classroom	2200	Door	Door	Solid	Wood	0.08
1924 Bldg.	97	XRF	10/15/97	2	Classroom	2200	Wall	Midle Wall	Peeling	Concrte	0.27
1924 Bldg.	98	XRF	10/15/97	2	Classroom	2200	Chalkboard	Rail	Solid	Wood	0.11
1924 Bldg.	99	XRF	10/15/97	2	Classroom	2200	Wall	Wall	Solid	Concrte	0.32
1924 Bldg.	100	XRF	10/15/97	2	Classroom	2200	Cabinet	Door	Solid	Wood	0.06
1924 Bldg.	101	XRF	10/15/97	2	Classroom	2200	Door	Casing	Solid	Wood	0.11
1924 Bldg.	102	XRF	10/15/97	2	Classroom	2200	Window	Casing	Solid	Wood	0
1924 Bldg.	113	XRF	10/14/97	2	Classroom	2440	Door	Door	Solid	Wood	0.05

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	114	XRF	10/14/97	2	Classroom	2440	Door	Casing	Solid	Wood	0.01
1924 Bldg.	115	XRF	10/14/97	2	Classroom	2440	Wall	Wall	Solid	Concrte	0.06
1924 Bldg.	116	XRF	10/14/97	2	Classroom	2440	Chalkboard	Rail	Solid	Wood	0
1924 Bldg.	117	XRF	10/14/97	2	Classroom	2440	Wall	Wall	Solid	Drywall	0.01
1924 Bldg.	118	XRF	10/14/97	2	Classroom	2440	Wall	Baseboard	Solid	Metal	0.05
1924 Bldg.	119	XRF	10/14/97	2	Classroom	2440		Radiator	Cracked	Wood	0
1924 Bldg.	120	XRF	10/14/97	2	Classroom	2440	Wall	Wall	Cracked	Concrte	0.15
1924 Bldg.	121	XRF	10/14/97	2	Classroom	2440		Radiator	Peeling	Metal	0.13
1924 Bldg.	122	XRF	10/14/97	2	Classroom	2440	Window	Stool	Solid	Metal	0
1924 Bldg.	123	XRF	10/14/97	2	Classroom	2440	Window	Mullion	Solid	Wood	0.05
1924 Bldg.	124	XRF	10/14/97	2	Classroom	2440	Window	Panel	Solid	Metal	0
1924 Bldg.	125	XRF	10/14/97	2	Classroom	2440	Wall	Wall Rgstr	Solid	Metal	0
1924 Bldg.	126	XRF	10/14/97	2	Classroom	2440	Floor		Solid	Wood	0
1924 Bldg.	73	XRF	10/14/97	2	Classroom	2444	Wall	Midle Wall	Solid	Concrte	0.06
1924 Bldg.	74	XRF	10/14/97	2	Classroom	2444	Cabinet	Door	Solid	Wood	0.03
1924 Bldg.	75	XRF	10/14/97	2	Classroom	2444	Door	Door	Solid	Wood	0.08
1924 Bldg.	76	XRF	10/14/97	2	Classroom	2444	Door	Jamb	Solid	Wood	0.01
1924 Bldg.	77	XRF	10/14/97	2	Classroom	2444	Chalkboard	Rail	Cracked	Wood	0.01
1924 Bldg.	78	XRF	10/14/97	2	Classroom	2444	Wall	Baseboard	Peeling	Wood	3.74
1924 Bldg.	79	XRF	10/14/97	2	Classroom	2444	Wall	Wall	Solid	Concrte	0.1
1924 Bldg.	80	XRF	10/14/97	2	Classroom	2444	Wall	Wall	Solid	Concrte	0.07
1924 Bldg.	81	XRF	10/14/97	2	Classroom	2444	Wall	Wall	Solid	Concrte	0.05
1924 Bldg.	82	XRF	10/14/97	2	Classroom	2444	Window	Casing	Solid	Metal	0
1924 Bldg.	83	XRF	10/14/97	2	Classroom	2444	Window	Mullion	Solid	Wood	0.04
1924 Bldg.	84	XRF	10/14/97	2	Classroom	2444	Wall	Wall	Solid	Concrte	0.13
1924 Bldg.	85	XRF	10/14/97	2	Classroom	2444		Radiator	Solid	Metal	0
1924 Bldg.	86	XRF	10/14/97	2	Classroom	2444	Window	Panel	Solid	Metal	0
1924 Bldg.	87	XRF	10/14/97	2	Classroom	2444	Floor		Solid	Wood	0
1924 Bldg.	98	XRF	10/14/97	2	Classroom	2450	Door	Door	Solid	Wood	0.1
1924 Bldg.	99	XRF	10/14/97	2	Classroom	2450	Door	Casing	Solid	Wood	0.02
1924 Bldg.	100	XRF	10/14/97	2	Classroom	2450	Wall	Wall	Solid	Metal	0.03
1924 Bldg.	101	XRF	10/14/97	2	Classroom	2450	Wall	Midle Wall	Solid	Drywall	0.06
1924 Bldg.	102	XRF	10/14/97	2	Classroom	2450	Wall	Wall Rgstr	Solid	Metal	0.04
1924 Bldg.	103	XRF	10/14/97	2	Classroom	2450	Wall	Wall	Solid	Drywall	0.02
1924 Bldg.	104	XRF	10/14/97	2	Classroom	2450	Wall	Wall	Solid	Drywall	0.07
1924 Bldg.	105	XRF	10/14/97	2	Classroom	2450	Chalkboard	Rail	Solid	Wood	0
1924 Bldg.	106	XRF	10/14/97	2	Classroom	2450		Radiator	Cracked	Metal	0
1924 Bldg.	107	XRF	10/14/97	2	Classroom	2450	Window	Casing	Solid	Metal	0
1924 Bldg.	108	XRF	10/14/97	2	Classroom	2450	Window	Mullion	Solid	Wood	0.03
1924 Bldg.	109	XRF	10/14/97	2	Classroom	2450	Window	Panel	Solid	Metal	0
1924 Bldg.	110	XRF	10/14/97	2	Classroom	2450	Wall	Wall	Solid	Concrte	0.05
1924 Bldg.	111	XRF	10/14/97	2	Classroom	2450		Radiator	Solid	Wood	0
1924 Bldg.	112	XRF	10/14/97	2	Classroom	2450	Floor		Cracked	Wood	0
1924 Bldg.	6	XRF	9/11/97	3	Classroom	3000		Radiator	Solid	Metal	0
1924 Bldg.	7	XRF	9/11/97	3	Classroom	3000	Window	Casing	Solid	Metal	0
1924 Bldg.	8	XRF	9/11/97	3	Classroom	3000	Window	Header	Solid	Wood	0.12
1924 Bldg.	9	XRF	9/11/97	3	Classroom	3000	Window	Panel	Solid	Wood	0.01
1924 Bldg.	10	XRF	9/11/97	3	Classroom	3000	Chalkboard	Rail	Solid	Wood	0.05
1924 Bldg.	11	XRF	9/11/97	3	Classroom	3000	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	12	XRF	9/11/97	3	Classroom	3000	Wall	Baseboard	Solid	Wood	0.09
1924 Bldg.	13	XRF	9/11/97	3	Classroom	3000	Door	Door	Solid	Wood	0.08
1924 Bldg.	14	XRF	9/11/97	3	Classroom	3000	Door	Casing	Solid	Wood	0.08
1924 Bldg.	15	XRF	9/11/97	3	Classroom	3000	Cabinet	Door	Solid	Wood	0.11
1924 Bldg.	16	XRF	9/11/97	3	Classroom	3000	Wall	Wall	Solid	Concrte	0.16
1924 Bldg.	17	XRF	9/11/97	3	Classroom	3000	Floor		Solid	Wood	0
1924 Bldg.	18	XRF	9/11/97	3	Classroom	3010		Radiator	Solid	Metal	0.15
1924 Bldg.	19	XRF	9/11/97	3	Classroom	3010	Wall	Wall	Solid	Concrte	0.21
1924 Bldg.	20	XRF	9/11/97	3	Classroom	3010	Window	Casing	Solid	Metal	0
1924 Bldg.	21	XRF	9/11/97	3	Classroom	3010	Window	Mullion	Solid	Wood	0.09
1924 Bldg.	22	XRF	9/11/97	3	Classroom	3010	Window	Panel	Solid	Wood	0

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	23	XRF	9/11/97	3	Classroom	3010	Chalkboard	Rail	Solid	Wood	0.02
1924 Bldg.	24	XRF	9/11/97	3	Classroom	3010	Wall	Baseboard	Solid	Wood	0.08
1924 Bldg.	25	XRF	9/11/97	3	Classroom	3010	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	26	XRF	9/11/97	3	Classroom	3010	Door	Door	Solid	Wood	0.08
1924 Bldg.	27	XRF	9/11/97	3	Classroom	3010	Door	Casing	Solid	Wood	0.05
1924 Bldg.	28	XRF	9/11/97	3	Classroom	3010	Cabinet	Door	Solid	Wood	0.07
1924 Bldg.	29	XRF	9/11/97	3	Classroom	3010	Wall	Wall	Solid	Concrte	0.1
1924 Bldg.	30	XRF	9/11/97	3	Classroom	3010	Floor		Solid	Wood	0
1924 Bldg.	31	XRF	9/11/97	3	Classroom	3020		Radiator	Solid	Metal	0.04
1924 Bldg.	32	XRF	9/11/97	3	Classroom	3020	Wall	Wall	Solid	Concrte	0.07
1924 Bldg.	33	XRF	9/11/97	3	Classroom	3020	Window	Casing	Solid	Metal	0
1924 Bldg.	34	XRF	9/11/97	3	Classroom	3020	Window	Mullion	Solid	Wood	0.14
1924 Bldg.	35	XRF	9/11/97	3	Classroom	3020	Window	Panel	Solid	Wood	0
1924 Bldg.	36	XRF	9/11/97	3	Classroom	3020	Wall	Midle Wall	Peeling	Concrte	5.09
1924 Bldg.	37	XRF	9/11/97	3	Classroom	3020	Chalkboard	Rail	Solid	Wood	0.05
1924 Bldg.	38	XRF	9/11/97	3	Classroom	3020	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	39	XRF	9/11/97	3	Classroom	3020	Wall	Baseboard	Solid	Wood	0.06
1924 Bldg.	40	XRF	9/11/97	3	Classroom	3020	Door	Door	Solid	Wood	0.08
1924 Bldg.	41	XRF	9/11/97	3	Classroom	3020	Door	Casing	Solid	Wood	0.06
1924 Bldg.	42	XRF	9/11/97	3	Classroom	3020	Cabinet	Door	Solid	Wood	0.06
1924 Bldg.	43	XRF	9/11/97	3	Classroom	3020	Wall	Wall	Solid	Concrte	0.02
1924 Bldg.	44	XRF	9/11/97	3	Classroom	3020	Floor		Solid	Wood	0
1924 Bldg.	45	XRF	9/11/97	3	Classroom	3030		Radiator	Solid	Metal	0
1924 Bldg.	46	XRF	9/11/97	3	Classroom	3030	Wall	Midle Wall	Solid	Concrte	0.17
1924 Bldg.	47	XRF	9/11/97	3	Classroom	3030	Door	Door	Solid	Wood	0.07
1924 Bldg.	48	XRF	9/11/97	3	Classroom	3030	Door	Casing	Solid	Wood	0.05
1924 Bldg.	49	XRF	9/11/97	3	Classroom	3030	Cabinet	Door	Solid	Wood	0.07
1924 Bldg.	50	XRF	9/11/97	3	Classroom	3030	Wall	Baseboard	Solid	Wood	0.03
1924 Bldg.	51	XRF	9/11/97	3	Classroom	3030	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	52	XRF	9/11/97	3	Classroom	3030	Chalkboard	Rail	Solid	Wood	0.1
1924 Bldg.	53	XRF	9/11/97	3	Classroom	3030	Wall	Wall	Solid	Concrte	0.36
1924 Bldg.	54	XRF	9/11/97	3	Classroom	3030	Window	Casing	Solid	Metal	0
1924 Bldg.	55	XRF	9/11/97	3	Classroom	3030	Window	Mullion	Solid	Wood	0.11
1924 Bldg.	56	XRF	9/11/97	3	Classroom	3030	Window	Panel	Solid	Wood	0
1924 Bldg.	57	XRF	9/11/97	3	Classroom	3030	Floor		Solid	Wood	0
1924 Bldg.	58	XRF	9/11/97	3	Classroom	3030	Floor		Solid	Wood	0
1924 Bldg.	59	XRF	9/11/97	3	Classroom	3040	Wall	Wall	Solid	Concrte	2.93
1924 Bldg.	60	XRF	9/11/97	3	Classroom	3040	Wall	Chair rail	Solid	Wood	2.17
1924 Bldg.	61	XRF	9/11/97	3	Classroom	3040	Wall	Wall	Solid	Concrte	3.11
1924 Bldg.	62	XRF	9/11/97	3	Classroom	3040	Door	Door	Solid	Wood	2.13
1924 Bldg.	63	XRF	9/11/97	3	Classroom	3040	Wall	Midle Wall	Solid	Wood	4.01
1924 Bldg.	64	XRF	9/11/97	3	Classroom	3040	Wall	Wall	Solid	Concrte	2.89
1924 Bldg.	65	XRF	9/11/97	3	Classroom	3040	Door	Casing	Solid	Wood	2.92
1924 Bldg.	66	XRF	9/11/97	3	Classroom	3040	Wall	Baseboard	Solid	Wood	0
1924 Bldg.	67	XRF	9/11/97	3	Classroom	3040	Door	Door	Solid	Wood	0.01
1924 Bldg.	68	XRF	9/11/97	3	Classroom	3040	Window	Casing	Solid	Metal	0
1924 Bldg.	69	XRF	9/11/97	3	Classroom	3040	Window	Mullion	Solid	Wood	2.38
1924 Bldg.	70	XRF	9/11/97	3	Classroom	3040	Window	Panel	Solid	Wood	0
1924 Bldg.	71	XRF	9/11/97	3	Classroom	3040		Radiator	Solid	Metal	0.03
1924 Bldg.	72	XRF	9/11/97	3	Classroom	3040	Floor		Solid	Wood	0.01
1924 Bldg.	73	XRF	9/11/97	3	Classroom	3040	Floor		Solid	Concrte	0
1924 Bldg.	74	XRF	9/11/97	3	Classroom	3050	Wall	Baseboard	Solid	Wood	0.04
1924 Bldg.	75	XRF	9/11/97	3	Classroom	3050	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	76	XRF	9/11/97	3	Classroom	3050	Chalkboard	Rail	Solid	Wood	0.04
1924 Bldg.	77	XRF	9/11/97	3	Classroom	3050	Cabinet	Door	Solid	Wood	0.1
1924 Bldg.	78	XRF	9/11/97	3	Classroom	3050	Door	Door	Solid	Wood	0.1
1924 Bldg.	79	XRF	9/11/97	3	Classroom	3050	Door	Casing	Solid	Wood	0.08
1924 Bldg.	80	XRF	9/11/97	3	Classroom	3050	Wall	Wall	Solid	Concrte	0.24
1924 Bldg.	81	XRF	9/11/97	3	Classroom	3050		Radiator	Peeling	Metal	0.05
1924 Bldg.	82	XRF	9/11/97	3	Classroom	3050	Window	Casing	Solid	Metal	0

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	83	XRF	9/11/97	3	Classroom	3050	Window	Mullion	Solid	Wood	0.12
1924 Bldg.	84	XRF	9/11/97	3	Classroom	3050	Window	Panel	Solid	Wood	0
1924 Bldg.	85	XRF	9/11/97	3	Classroom	3050	Floor		Solid	Wood	0.03
1924 Bldg.	175	XRF	9/10/97	3	Classroom	3150	Door	Door	Solid	Wood	0.07
1924 Bldg.	176	XRF	9/10/97	3	Classroom	3150	Door	Casing	Solid	Wood	0.04
1924 Bldg.	177	XRF	9/10/97	3	Classroom	3150	Window	Casing	Solid	Metal	0
1924 Bldg.	178	XRF	9/10/97	3	Classroom	3150	Window	Mullion	Solid	Wood	0.08
1924 Bldg.	179	XRF	9/10/97	3	Classroom	3150		Radiator	Peeling	Metal	0.18
1924 Bldg.	180	XRF	9/10/97	3	Classroom	3150	Wall	Wall	Solid	Concrte	0.01
1924 Bldg.	181	XRF	9/10/97	3	Classroom	3150	Wall	Wall	Solid	Concrte	0.2
1924 Bldg.	182	XRF	9/10/97	3	Classroom	3150	Stairs	Newal post	Solid	Wood	0.02
1924 Bldg.	183	XRF	9/10/97	3	Classroom	3150	Floor		Solid	Wood	0
1924 Bldg.	184	XRF	9/10/97	3	Classroom	3160	Chalkboard	Rail	Solid	Wood	0
1924 Bldg.	185	XRF	9/10/97	3	Classroom	3160	Wall	Wall	Solid	Concrte	0.01
1924 Bldg.	186	XRF	9/10/97	3	Classroom	3160	Wall	Baseboard	Solid	Wood	0
1924 Bldg.	187	XRF	9/10/97	3	Classroom	3160		Radiator	Peeling	Metal	1.22
1924 Bldg.	188	XRF	9/10/97	3	Classroom	3160	Window	Casing	Solid	Metal	0
1924 Bldg.	189	XRF	9/10/97	3	Classroom	3160	Window	Mullion	Solid	Wood	0.11
1924 Bldg.	190	XRF	9/10/97	3	Classroom	3160	Window	Casing	Solid	Wood	0.28
1924 Bldg.	191	XRF	9/10/97	3	Classroom	3160	Wall	Midle Wall	Solid	Concrte	0.35
1924 Bldg.	192	XRF	9/10/97	3	Classroom	3160	Door	Door	Solid	Wood	0.08
1924 Bldg.	193	XRF	9/10/97	3	Classroom	3160	Door	Casing	Solid	Wood	0.09
1924 Bldg.	194	XRF	9/10/97	3	Classroom	3160	Floor		Cracked	Wood	0
1924 Bldg.	195	XRF	9/10/97	3	Classroom	3170		Radiator	Cracked	Metal	0.09
1924 Bldg.	196	XRF	9/10/97	3	Classroom	3170	Window	Casing	Cracked	Metal	0
1924 Bldg.	197	XRF	9/10/97	3	Classroom	3170	Window	Mullion	Cracked	Wood	0.14
1924 Bldg.	198	XRF	9/10/97	3	Classroom	3170	Wall	Midle Wall	Solid	Concrte	0.44
1924 Bldg.	199	XRF	9/10/97	3	Classroom	3170	Chalkboard	Rail	Solid	Wood	0
1924 Bldg.	200	XRF	9/10/97	3	Classroom	3170	Wall	Wall	Solid	Concrte	0.09
1924 Bldg.	201	XRF	9/10/97	3	Classroom	3170	Wall	Baseboard	Solid	Wood	0.03
1924 Bldg.	202	XRF	9/10/97	3	Classroom	3170	Door	Door	Solid	Wood	0.04
1924 Bldg.	203	XRF	9/10/97	3	Classroom	3170	Door	Door	Solid	Metal	0
1924 Bldg.	204	XRF	9/10/97	3	Classroom	3170	Door	Casing	Solid	Wood	0.07
1924 Bldg.	205	XRF	9/10/97	3	Classroom	3170	Bookcase	Shelf	Solid	Wood	0.03
1924 Bldg.	206	XRF	9/10/97	3	Classroom	3170	Floor		Solid	Wood	0.03
1924 Bldg.	207	XRF	9/10/97	3	Classroom	3180	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	208	XRF	9/10/97	3	Classroom	3180	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	209	XRF	9/10/97	3	Classroom	3180		Radiator	Cracked	Metal	0.17
1924 Bldg.	210	XRF	9/10/97	3	Classroom	3180	Window	Casing	Solid	Metal	0
1924 Bldg.	211	XRF	9/10/97	3	Classroom	3180	Window	Mullion	Solid	Wood	0.08
1924 Bldg.	212	XRF	9/10/97	3	Classroom	3180	Chalkboard	Rail	Solid	Wood	0.05
1924 Bldg.	213	XRF	9/10/97	3	Classroom	3180	Door	Door	Solid	Wood	0.02
1924 Bldg.	214	XRF	9/10/97	3	Classroom	3180	Door	Door	Solid	Metal	0
1924 Bldg.	215	XRF	9/10/97	3	Classroom	3180	Cabinet	Door	Solid	Wood	0.08
1924 Bldg.	216	XRF	9/10/97	3	Classroom	3180	Wall	Baseboard	Solid	Wood	0.06
1924 Bldg.	217	XRF	9/10/97	3	Classroom	3180	Floor		Solid	Wood	0.01
1924 Bldg.	218	XRF	9/10/97	3	Classroom	3190	Window	Casing	Solid	Metal	0
1924 Bldg.	219	XRF	9/10/97	3	Classroom	3190	Window	Mullion	Solid	Wood	0.12
1924 Bldg.	220	XRF	9/10/97	3	Classroom	3190		Radiator	Solid	Metal	0.12
1924 Bldg.	221	XRF	9/10/97	3	Classroom	3190	Wall	Wall	Solid	Concrte	0.05
1924 Bldg.	222	XRF	9/10/97	3	Classroom	3190	Wall	Baseboard	Solid	Wood	0.09
1924 Bldg.	223	XRF	9/10/97	3	Classroom	3190	Door	Door	Solid	Wood	0.11
1924 Bldg.	224	XRF	9/10/97	3	Classroom	3190	Door	Casing	Solid	Wood	0.03
1924 Bldg.	225	XRF	9/10/97	3	Classroom	3190	Cabinet	Door	Solid	Wood	0.07
1924 Bldg.	226	XRF	9/10/97	3	Classroom	3190	Floor		Solid	Wood	0.01
1924 Bldg.	86	XRF	9/10/97	3	Classroom	3280	Wall	Midle Wall	Solid	Concrte	0.24
1924 Bldg.	87	XRF	9/10/97	3	Classroom	3280	Door	Door	Solid	Wood	0.05
1924 Bldg.	88	XRF	9/10/97	3	Classroom	3280	Door	Casing	Solid	Wood	0.04
1924 Bldg.	89	XRF	9/10/97	3	Classroom	3280	Cabinet	Door	Solid	Wood	0.11
1924 Bldg.	90	XRF	9/10/97	3	Classroom	3280	Chalkboard	Rail	Cracked	Wood	0.05

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	91	XRF	9/10/97	3	Classroom	3280	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	92	XRF	9/10/97	3	Classroom	3280	Wall	Midle Wall	Solid	Drywall	0.03
1924 Bldg.	93	XRF	9/10/97	3	Classroom	3280	Wall	Baseboard	Cracked	Wood	0.05
1924 Bldg.	94	XRF	9/10/97	3	Classroom	3280		Radiator	Cracked	Metal	0.01
1924 Bldg.	95	XRF	9/10/97	3	Classroom	3280	Window	Casing	Solid	Metal	0
1924 Bldg.	96	XRF	9/10/97	3	Classroom	3280	Window	Mullion	Solid	Wood	0.03
1924 Bldg.	97	XRF	9/10/97	3	Classroom	3280	Floor		Solid	Wood	0
1924 Bldg.	98	XRF	9/10/97	3	Classroom	3290	Door	Door	Solid	Wood	0.05
1924 Bldg.	99	XRF	9/10/97	3	Classroom	3290	Door	Casing	Solid	Wood	0.05
1924 Bldg.	100	XRF	9/10/97	3	Classroom	3290	Wall	Midle Wall	Solid	Concrte	0.28
1924 Bldg.	101	XRF	9/10/97	3	Classroom	3290	Chalkboard	Rail	Cracked	Wood	0
1924 Bldg.	102	XRF	9/10/97	3	Classroom	3290	Wall	Wall	Solid	Drywall	0.1
1924 Bldg.	103	XRF	9/10/97	3	Classroom	3290	Wall	Baseboard	Cracked	Metal	0.03
1924 Bldg.	104	XRF	9/10/97	3	Classroom	3290		Radiator	Cracked	Metal	0
1924 Bldg.	105	XRF	9/10/97	3	Classroom	3290	Window	Casing	Solid	Metal	0
1924 Bldg.	106	XRF	9/10/97	3	Classroom	3290	Window	Mullion	Solid	Wood	0.01
1924 Bldg.	107	XRF	9/10/97	3	Classroom	3290	Wall	Wall	Solid	Concrte	0.02
1924 Bldg.	108	XRF	9/10/97	3	Classroom	3290	Wall	Wall	Solid	Wood	0.03
1924 Bldg.	109	XRF	9/10/97	3	Classroom	3300	Door	Door	Solid	Wood	0.04
1924 Bldg.	110	XRF	9/10/97	3	Classroom	3300	Door	Casing	Solid	Wood	0.01
1924 Bldg.	111	XRF	9/10/97	3	Classroom	3300	Wall	Wall	Solid	Concrte	0.2
1924 Bldg.	112	XRF	9/10/97	3	Classroom	3300	Chalkboard	Rail	Solid	Wood	0.07
1924 Bldg.	113	XRF	9/10/97	3	Classroom	3300	Wall	Wall	Solid	Concrte	1.46
1924 Bldg.	114	XRF	9/10/97	3	Classroom	3300		Radiator	Cracked	Metal	0.02
1924 Bldg.	115	XRF	9/10/97	3	Classroom	3300	Window	Casing	Solid	Metal	0
1924 Bldg.	116	XRF	9/10/97	3	Classroom	3300	Window	Mullion	Solid	Wood	0.04
1924 Bldg.	117	XRF	9/10/97	3	Classroom	3300	Wall	Midle Wall	Solid	Drywall	0.03
1924 Bldg.	118	XRF	9/10/97	3	Classroom	3300	Wall	Baseboard	Solid	Metal	0.03
1924 Bldg.	119	XRF	9/10/97	3	Classroom	3300	Bookcase	Shelf	Cracked	Wood	0
1924 Bldg.	15	XRF	6/17/97	2	Classroom	203	Cabinet	Inside	Cracked	Metal	0.84
1924 Bldg.	19	XRF	6/17/97	2	Classroom	203	Wall	Crown Mold	Solid	Wood	0.08
1924 Bldg.	71	XRF	6/17/97	2	Hall	1	Wall	Wall	Cracked	Plaster	2.83
1924 Bldg.	72	XRF	6/17/97	2	Hall	1	Wall	Chair rail	Solid	Wood	0.11
1924 Bldg.	73	XRF	6/17/97	2	Hall	1	Wall	Wall	Solid	Plaster	0.24
1924 Bldg.	74	XRF	6/17/97	2	Hall	1	Window	Sash	Cracked	Metal	5.09
1924 Bldg.	75	XRF	6/17/97	2	Hall	1	Window	Stool	Cracked	Concrte	0.03
1924 Bldg.	76	XRF	6/17/97	2	Hall	1		Radiator	Cracked	Metal	2.75
1924 Bldg.	77	XRF	6/17/97	2	Hall	1	Door	Door	Solid	Metal	0.2
1924 Bldg.	78	XRF	6/17/97	2	Hall	1	Door	Casing	Solid	Metal	0.1
1924 Bldg.	79	XRF	6/17/97	2	Hall	1	Cabinet	Door	Solid	Wood	0.08
1924 Bldg.	80	XRF	6/17/97	2	Hall	1		Locker	Cracked	Metal	0.06
1924 Bldg.	81	XRF	6/17/97	2	Hall	1	Wall	Crown Mold	Cracked	Wood	1.49
1924 Bldg.	82	XRF	6/17/97	2	Hall	1	Ceiling		Cracked	Plaster	0.04
1924 Bldg.	83	XRF	6/17/97	2	Hall	1	Ceiling	Hatch	Solid	Metal	0
1924 Bldg.	84	XRF	6/17/97	2	Hall	1	Casing	Panel	Solid	Wood	0
1924 Bldg.	85	XRF	6/17/97	2	Hall	1	Door	Door	Solid	Metal	0.18
1924 Bldg.	82	XRF	4/13/98	1	Hall	1151	Wall	Wall	Solid	Plaster	5.09
1924 Bldg.	83	XRF	4/13/98	1	Hall	1151	Door	Door	Solid	Metal	0.03
1924 Bldg.	84	XRF	4/13/98	1	Hall	1151	Door	Jamb	Solid	Metal	0.02
1924 Bldg.	85	XRF	4/13/98	1	Hall	1151	Wall	Midle Wall	Solid	Drywall	0
1924 Bldg.	86	XRF	4/13/98	1	Hall	1151	Floor		Cracked	Wood	0
1924 Bldg.	66	XRF	4/13/98	1	Hall	1179	Door	Door	Solid	Metal	0
1924 Bldg.	67	XRF	4/13/98	1	Hall	1179	Door	Casing	Solid	Metal	0
1924 Bldg.	68	XRF	4/13/98	1	Hall	1179	Wall	Wall	Solid	Plaster	2.93
1924 Bldg.	69	XRF	4/13/98	1	Hall	1179	Stairs	Hand rail	Solid	Wood	0.02
1924 Bldg.	70	XRF	4/13/98	1	Hall	1179	Stairs	Baseboard	Cracked	Concrte	0.39
1924 Bldg.	71	XRF	4/13/98	1	Hall	1179	Stairs	Hand rail	Cracked	Metal	4.01
1924 Bldg.	72	XRF	4/13/98	1	Hall	1179	Door	Door	Solid	Metal	0
1924 Bldg.	73	XRF	4/13/98	1	Hall	1179	Wall	Chair rail	Solid	Wood	0.09
1924 Bldg.	74	XRF	4/13/98	1	Hall	1179	Wall	Wall	Solid	Concrte	0.46

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	75	XRF	4/13/98	1	Hall	1179		Radiator	Solid	Metal	0
1924 Bldg.	76	XRF	4/13/98	1	Hall	1179	Door	Door	Solid	Wood	0
1924 Bldg.	77	XRF	4/13/98	1	Hall	1179	Door	Casing	Solid	Metal	0.01
1924 Bldg.	51	XRF	4/13/98	1	Hall	1790	Door	Door	Solid	Wood	0.42
1924 Bldg.	52	XRF	4/13/98	1	Hall	1790	Door	Casing	Solid	Metal	5.09
1924 Bldg.	53	XRF	4/13/98	1	Hall	1790	Wall	Wall	Solid	Plaster	0.04
1924 Bldg.	54	XRF	4/13/98	1	Hall	1790		Locker	Solid	Metal	0.28
1924 Bldg.	55	XRF	4/13/98	1	Hall	1790		Elec Panel	Solid	Metal	0
1924 Bldg.	56	XRF	4/13/98	1	Hall	1790	Window	Casing	Peeling	Metal	0.03
1924 Bldg.	57	XRF	4/13/98	1	Hall	1790		Radiator	Peeling	Metal	0.23
1924 Bldg.	58	XRF	4/13/98	1	Hall	1790	Wall	Wall	Solid	Plaster	0.05
1924 Bldg.	59	XRF	4/13/98	1	Hall	1790	Door	Door	Solid	Metal	0.17
1924 Bldg.	60	XRF	4/13/98	1	Hall	1790	Window	Casing	Solid	Metal	0.24
1924 Bldg.	61	XRF	4/13/98	1	Hall	1790	Wall	Wall	Solid	Plaster	0.18
1924 Bldg.	62	XRF	4/13/98	1	Hall	1790	Wall	Wall	Solid	Plaster	0.12
1924 Bldg.	63	XRF	4/13/98	1	Hall	1790		Locker	Solid	Metal	0.27
1924 Bldg.	64	XRF	4/13/98	1	Hall	1790	Door	Door	Solid	Metal	5.09
1924 Bldg.	65	XRF	4/13/98	1	Hall	1790	Door	Door	Solid	Metal	0.04
1924 Bldg.	38	XRF	6/1/98	1	Hall	1900	Wall	Midle Wall	Solid	Drywall	0.03
1924 Bldg.	39	XRF	6/1/98	1	Hall	1900	Door	Door	Solid	Wood	0
1924 Bldg.	40	XRF	6/1/98	1	Hall	1900	Door	Casing	Solid	Metal	0
1924 Bldg.	41	XRF	6/1/98	1	Hall	1900	Stairs	Hand rail	Solid	Wood	0
1924 Bldg.	42	XRF	6/1/98	1	Hall	1900	Door	Door	Solid	Wood	0.05
1924 Bldg.	43	XRF	6/1/98	1	Hall	1900	Door	Door	Solid	Metal	0.18
1924 Bldg.	44	XRF	6/1/98	1	Hall	1900	Window	Sash	Solid	Metal	0.16
1924 Bldg.	45	XRF	6/1/98	1	Hall	1900	Door	Door	Solid	Metal	0
1924 Bldg.	46	XRF	6/1/98	1	Hall	1900	Door	Casing	Solid	Metal	0.01
1924 Bldg.	47	XRF	6/1/98	1	Hall	1900	Door	Door	Solid	Metal	0
1924 Bldg.	48	XRF	6/1/98	1	Hall	1900	Door	Casing	Solid	Metal	0
1924 Bldg.	49	XRF	6/1/98	1	Hall	1900	Door	Door	Solid	Metal	0.01
1924 Bldg.	50	XRF	6/1/98	1	Hall	1900	Door	Casing	Solid	Metal	0
1924 Bldg.	51	XRF	6/1/98	1	Hall	1900	Door	Door	Solid	Wood	0
1924 Bldg.	52	XRF	6/1/98	1	Hall	1900	Wall	Midle Wall	Solid	Drywall	0.02
1924 Bldg.	53	XRF	6/1/98	1	Hall	1900	Wall	Midle Wall	Solid	Concrte	0.01
1924 Bldg.	54	XRF	6/1/98	1	Hall	1900	Door	Door	Solid	Metal	0.12
1924 Bldg.	55	XRF	6/1/98	1	Hall	1900		Radiator	Solid	Metal	0
1924 Bldg.	56	XRF	6/1/98	1	Hall	1900	Door	Door	Solid	Metal	0.14
1924 Bldg.	57	XRF	6/1/98	1	Hall	1900	Wall	Midle Wall	Solid	Concrte	2.31
1924 Bldg.	161	XRF	10/14/97	2	Hall	2190	Door	Door	Solid	Metal	0.03
1924 Bldg.	162	XRF	10/14/97	2	Hall	2190	Door	Jamb	Solid	Metal	0.04
1924 Bldg.	163	XRF	10/14/97	2	Hall	2190	Wall	Wall	Solid	Concrte	0.04
1924 Bldg.	164	XRF	10/14/97	2	Hall	2190	Door	Door	Solid	Wood	0.07
1924 Bldg.	165	XRF	10/14/97	2	Hall	2190	Door	Casing	Solid	Wood	0.05
1924 Bldg.	166	XRF	10/14/97	2	Hall	2190	Wall	Wall	Solid	Concrte	2.25
1924 Bldg.	167	XRF	10/14/97	2	Hall	2190	Stairs	Rail cap	Cracked	Concrte	1.24
1924 Bldg.	168	XRF	10/14/97	2	Hall	2190	Stairs	Hand rail	Solid	Wood	0.01
1924 Bldg.	169	XRF	10/14/97	2	Hall	2190		Radiator	Solid	Metal	0.57
1924 Bldg.	6	XRF	10/15/97	2	Hall	2190	Door	Casing	Solid	Metal	0.11
1924 Bldg.	7	XRF	10/15/97	2	Hall	2190	Window	Casing	Solid	Metal	0.29
1924 Bldg.	8	XRF	10/15/97	2	Hall	2190	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	9	XRF	10/15/97	2	Hall	2190	Wall	Chair rail	Solid	Wood	0.08
1924 Bldg.	10	XRF	10/15/97	2	Hall	2190	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	11	XRF	10/15/97	2	Hall	2190	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	12	XRF	10/15/97	2	Hall	2190	Door	Door	Solid	Metal	0.03
1924 Bldg.	13	XRF	10/15/97	2	Hall	2190	Cabinet	Outside	Solid	Wood	0.01
1924 Bldg.	14	XRF	10/15/97	2	Hall	2190	Cabinet	Outside	Solid	Wood	0
1924 Bldg.	15	XRF	10/15/97	2	Hall	2190	Stairs	Hand rail	Solid	Metal	0.03
1924 Bldg.	16	XRF	10/15/97	2	Hall	2190	Door	Door	Solid	Wood	0.01
1924 Bldg.	17	XRF	10/15/97	2	Hall	2190	Stairs	Baseboard	Solid	Metal	0.02
1924 Bldg.	18	XRF	10/15/97	2	Hall	2190	Wall	Baseboard	Solid	Concrte	0.21

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	19	XRF	10/15/97	2	Hall	2190	Window	Casing	Solid	Wood	0.04
1924 Bldg.	93	XRF	10/14/97	2	Hall	2520	Door	Door	Solid	Metal	0.37
1924 Bldg.	94	XRF	10/14/97	2	Hall	2520	Door	Casing	Solid	Wood	5.09
1924 Bldg.	95	XRF	10/14/97	2	Hall	2520	Wall	Midle Wall	Solid	Concrte	0.07
1924 Bldg.	96	XRF	10/14/97	2	Hall	2520	Window	Casing	Solid	Wood	0.03
1924 Bldg.	97	XRF	10/14/97	2	Hall	2520	Wall	Wall	Solid	Concrte	0
1924 Bldg.	141	XRF	10/14/97	2	Hall	2591	Wall	Wall	Solid	Concrte	2.33
1924 Bldg.	142	XRF	10/14/97	2	Hall	2591	Wall	Wall	Solid	Concrte	0.03
1924 Bldg.	143	XRF	10/14/97	2	Hall	2591		Locker	Solid	Metal	0.4
1924 Bldg.	144	XRF	10/14/97	2	Hall	2591		Elec Panel	Solid	Metal	0.01
1924 Bldg.	145	XRF	10/14/97	2	Hall	2591	Door	Door	Solid	Wood	0.06
1924 Bldg.	146	XRF	10/14/97	2	Hall	2591		Radiator	Cracked	Metal	0.05
1924 Bldg.	147	XRF	10/14/97	2	Hall	2591	Window	Casing	Cracked	Metal	5.09
1924 Bldg.	148	XRF	10/14/97	2	Hall	2591	Window	Casing	Solid	Metal	0.15
1924 Bldg.	149	XRF	10/14/97	2	Hall	2591	Door	Casing	Solid	Metal	5.09
1924 Bldg.	150	XRF	10/14/97	2	Hall	2591	Door	Door	Solid	Metal	0.14
1924 Bldg.	151	XRF	10/14/97	2	Hall	2591	Wall	Wall	Solid	Concrte	0.08
1924 Bldg.	152	XRF	10/14/97	2	Hall	2591		Locker	Solid	Metal	0.29
1924 Bldg.	153	XRF	10/14/97	2	Hall	2591	Wall	Midle Wall	Solid	Metal	0
1924 Bldg.	154	XRF	10/14/97	2	Hall	2591	Door	Casing	Solid	Wood	0.03
1924 Bldg.	155	XRF	10/14/97	2	Hall	2591	Door	Door	Solid	Metal	1.72
1924 Bldg.	156	XRF	10/14/97	2	Hall	2591	Door	Casing	Solid	Metal	5.09
1924 Bldg.	157	XRF	10/14/97	2	Hall	2591	Wall	Midle Wall	Solid	Wood	0
1924 Bldg.	158	XRF	10/14/97	2	Hall	2591	Door	Door	Solid	Metal	0.03
1924 Bldg.	159	XRF	10/14/97	2	Hall	2591	Door	Jamb	Solid	Metal	0.01
1924 Bldg.	160	XRF	10/14/97	2	Hall	2591	Wall	Wall	Solid	Concrte	0.15
1924 Bldg.	61	XRF	10/14/97	3	Hall	3200		Locker	Solid	Metal	0.1
1924 Bldg.	62	XRF	10/14/97	3	Hall	3200	Wall	Wall	Solid	Concrte	0.14
1924 Bldg.	63	XRF	10/14/97	3	Hall	3200	Wall	Wall	Solid	Concrte	3.73
1924 Bldg.	64	XRF	10/14/97	3	Hall	3200	Wall	Chair rail	Solid	Wood	0.08
1924 Bldg.	65	XRF	10/14/97	3	Hall	3200	Door	Door	Solid	Wood	0.07
1924 Bldg.	66	XRF	10/14/97	3	Hall	3200	Wall	Wall	Solid	Concrte	0.12
1924 Bldg.	67	XRF	10/14/97	3	Hall	3200	Door	Door	Solid	Metal	0.23
1924 Bldg.	68	XRF	10/14/97	3	Hall	3200	Door	Casing	Solid	Metal	0.12
1924 Bldg.	69	XRF	10/14/97	3	Hall	3200	Door	Door	Solid	Metal	0.02
1924 Bldg.	70	XRF	10/14/97	3	Hall	3200	Window	Casing	Solid	Metal	0.13
1924 Bldg.	71	XRF	10/14/97	3	Hall	3200	Window	Casing	Solid	Metal	5.09
1924 Bldg.	72	XRF	10/14/97	3	Hall	3200		Mural	Solid	Wood	0
1924 Bldg.	129	XRF	9/11/97	3	Hall	3230	Door	Casing	Solid	Wood	0.03
1924 Bldg.	130	XRF	9/11/97	3	Hall	3230	Wall	Wall	Solid	Concrte	0.07
1924 Bldg.	131	XRF	9/11/97	3	Hall	3230	Wall	Chair rail	Solid	Wood	0.01
1924 Bldg.	132	XRF	9/11/97	3	Hall	3230	Wall	Wall	Solid	Concrte	0.74
1924 Bldg.	133	XRF	9/11/97	3	Hall	3230	Wall	Wall	Solid	Concrte	0.86
1924 Bldg.	134	XRF	9/11/97	3	Hall	3230	Wall	Wall	Solid	Concrte	0.98
1924 Bldg.	135	XRF	9/11/97	3	Hall	3230	Door	Casing	Solid	Metal	0.06
1924 Bldg.	42	XRF	6/2/98	0	Kitchen	230	Wall	Midle Wall	Solid	Plaster	5.09
1924 Bldg.	43	XRF	6/2/98	0	Kitchen	230	Door	Door	Solid	Wood	0.07
1924 Bldg.	44	XRF	6/2/98	0	Kitchen	230	Wall	Midle Wall	Cracked	Drywall	0
1924 Bldg.	45	XRF	6/2/98	0	Kitchen	230	Door	Jamb	Solid	Metal	0.03
1924 Bldg.	46	XRF	6/2/98	0	Kitchen	230	Wall	Column	Solid	Concrte	4.14
1924 Bldg.	47	XRF	6/2/98	0	Kitchen	230		Locker	Solid	Metal	0.16
1924 Bldg.	48	XRF	6/2/98	0	Kitchen	230	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	24	XRF	6/2/98	0	Lunch Area	240	Door	Door	Solid	Metal	0.15
1924 Bldg.	25	XRF	6/2/98	0	Lunch Area	240	Door	Casing	Solid	Metal	0.13
1924 Bldg.	26	XRF	6/2/98	0	Lunch Area	240	Wall	Wall	Solid	Concrte	3.77
1924 Bldg.	27	XRF	6/2/98	0	Lunch Area	240	Wall	Wall	Solid	Concrte	2.73
1924 Bldg.	28	XRF	6/2/98	0	Lunch Area	240		Radiator	Solid	Metal	0
1924 Bldg.	29	XRF	6/2/98	0	Lunch Area	240	Window	Sash	Solid	Metal	2.9
1924 Bldg.	30	XRF	6/2/98	0	Lunch Area	240	Door	Door	Solid	Wood	0.03
1924 Bldg.	31	XRF	6/2/98	0	Lunch Area	240	Door	Jamb	Solid	Wood	0.03

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	32	XRF	6/2/98	0	Lunch Area	240		Radiator	Solid	Metal	0.71
1924 Bldg.	33	XRF	6/2/98	0	Lunch Area	240	Wall	Wall	Solid	Concrte	4.22
1924 Bldg.	34	XRF	6/2/98	0	Lunch Area	240	Wall	Wall	Solid	Plaster	0.07
1924 Bldg.	35	XRF	6/2/98	0	Lunch Area	240	Door	Door	Solid	Metal	0
1924 Bldg.	36	XRF	6/2/98	0	Lunch Area	240	Wall	Column	Solid	Concrte	5.09
1924 Bldg.	62	XRF	10/15/97	2	Main	2010	Window	Casing	Solid	Metal	0
1924 Bldg.	63	XRF	10/15/97	2	Main	2010	Window	Mullion	Solid	Wood	0.12
1924 Bldg.	64	XRF	10/15/97	2	Main	2010	Window	Panel	Solid	Metal	0
1924 Bldg.	65	XRF	10/15/97	2	Main	2010		Radiator	Solid	Metal	0.01
1924 Bldg.	66	XRF	10/15/97	2	Main	2010	Wall	Wall	Cracked	Concrte	5.09
1924 Bldg.	67	XRF	10/15/97	2	Main	2010	Wall	Baseboard	Solid	Wood	0.07
1924 Bldg.	68	XRF	10/15/97	2	Main	2010		Radiator	Peeling	Metal	5.09
1924 Bldg.	69	XRF	10/15/97	2	Main	2010	Wall	Wall	Solid	Drywall	0.01
1924 Bldg.	70	XRF	10/15/97	2	Main	2010		Radiator	Peeling	Metal	5.09
1924 Bldg.	71	XRF	10/15/97	2	Main	2010	Wall	Wall	Solid	Concrte	0.22
1924 Bldg.	72	XRF	10/15/97	2	Main	2010	Wall	Wall	Solid	Drywall	0.03
1924 Bldg.	73	XRF	10/15/97	2	Main	2010	Door	Door	Solid	Wood	0
1924 Bldg.	74	XRF	10/15/97	2	Main	2010	Wall	Midle Wall	Solid	Concrte	0.05
1924 Bldg.	75	XRF	10/15/97	2	Main	2010	Wall	Midle Wall	Solid	Plaster	0.08
1924 Bldg.	76	XRF	10/15/97	2	Main	2010	Floor		Cracked	Wood	0
1924 Bldg.	77	XRF	10/15/97	2	Main	2010	Wall	Midle Wall	Solid	Drywall	0.02
1924 Bldg.	78	XRF	10/15/97	2	Main	2010	Wall	Midle Wall	Solid	Drywall	0.03
1924 Bldg.	79	XRF	10/15/97	2	Main	2010	Door	Door	Solid	Wood	0.01
1924 Bldg.	80	XRF	10/15/97	2	Main	2010	Door	Casing	Solid	Wood	0
1924 Bldg.	81	XRF	10/15/97	2	Main	2010	Wall	Wall	Solid	Concrte	0.04
1924 Bldg.	82	XRF	10/15/97	2	Main	2010	Wall	Chair rail	Solid	Wood	0
1924 Bldg.	83	XRF	10/15/97	2	Main	2010	Wall	Wall	Solid	Concrte	0.05
1924 Bldg.	40	XRF	10/15/97	2	Main	2020	Window	Casing	Solid	Metal	0
1924 Bldg.	41	XRF	10/15/97	2	Main	2020	Window	Panel	Solid	Metal	0
1924 Bldg.	42	XRF	10/15/97	2	Main	2020		Radiator	Solid	Metal	0.29
1924 Bldg.	43	XRF	10/15/97	2	Main	2020	Wall	Midle Wall	Solid	Concrte	0.61
1924 Bldg.	44	XRF	10/15/97	2	Main	2020	Window	Mullion	Solid	Wood	0.17
1924 Bldg.	45	XRF	10/15/97	2	Main	2020	Wall	Midle Wall	Solid	Drywall	0.01
1924 Bldg.	46	XRF	10/15/97	2	Main	2020	Wall	Midle Wall	Solid	Drywall	0.04
1924 Bldg.	47	XRF	10/15/97	2	Main	2020		Radiator	Peeling	Metal	0.28
1924 Bldg.	48	XRF	10/15/97	2	Main	2020		Radiator	Peeling	Metal	0
1924 Bldg.	49	XRF	10/15/97	2	Main	2020	Wall	Midle Wall	Solid	Drywall	0.04
1924 Bldg.	50	XRF	10/15/97	2	Main	2020	Door	Door	Solid	Wood	0.01
1924 Bldg.	51	XRF	10/15/97	2	Main	2020	Wall	Midle Wall	Solid	Concrte	0.01
1924 Bldg.	52	XRF	10/15/97	2	Main	2020	Wall	Baseboard	Solid	Wood	0
1924 Bldg.	53	XRF	10/15/97	2	Main	2020	Cabinet	Outside	Solid	Wood	0
1924 Bldg.	54	XRF	10/15/97	2	Main	2020	Wall	Wall	Solid	Drywall	0.02
1924 Bldg.	55	XRF	10/15/97	2	Main	2020	Wall	Midle Wall	Solid	Concrte	0.04
1924 Bldg.	56	XRF	10/15/97	2	Main	2020	Door	Door	Solid	Wood	0.01
1924 Bldg.	57	XRF	10/15/97	2	Main	2020	Door	Casing	Solid	Wood	0
1924 Bldg.	58	XRF	10/15/97	2	Main	2020	Door	Door	Solid	Metal	0.07
1924 Bldg.	59	XRF	10/15/97	2	Main	2020	Cabinet	Door	Solid	Wood	0.06
1924 Bldg.	60	XRF	10/15/97	2	Main	2020	Wall	Midle Wall	Solid	Concrte	3
1924 Bldg.	61	XRF	10/15/97	2	Main	2020	Door	Casing	Cracked	Metal	0.06
1924 Bldg.	136	XRF	9/11/97	3	Main	3220	Wall	Wall	Solid	Concrte	1.64
1924 Bldg.	137	XRF	9/11/97	3	Main	3220	Wall	Wall	Solid	Concrte	0.08
1924 Bldg.	138	XRF	9/11/97	3	Main	3220		Radiator	Solid	Metal	0.52
1924 Bldg.	139	XRF	9/11/97	3	Main	3220	Door	Door	Solid	Metal	0.08
1924 Bldg.	140	XRF	9/11/97	3	Main	3220	Door	Casing	Solid	Metal	0.12
1924 Bldg.	141	XRF	9/11/97	3	Main	3220	Door	Door	Solid	Wood	0.04
1924 Bldg.	142	XRF	9/11/97	3	Main	3220		Locker	Cracked	Metal	0.36
1924 Bldg.	143	XRF	9/11/97	3	Main	3220	Door	Casing	Solid	Wood	0.07
1924 Bldg.	144	XRF	9/11/97	3	Main	3220	Window	Casing	Peeling	Metal	0
1924 Bldg.	145	XRF	9/11/97	3	Main	3220	Door	Door	Solid	Wood	0.16
1924 Bldg.	146	XRF	9/11/97	3	Main	3220	Door	Jamb	Solid	Metal	5.09

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	147	XRF	9/11/97	3	Main	3220	Window	Casing	Solid	Metal	0.22
1924 Bldg.	148	XRF	9/11/97	3	Main	3220	Window	Casing	Solid	Metal	0.03
1924 Bldg.	149	XRF	9/11/97	3	Main	3220	Locker		Solid	Metal	0.48
1924 Bldg.	150	XRF	9/11/97	3	Main	3220	Wall	Midle Wall	Solid	Wood	0
1924 Bldg.	151	XRF	9/11/97	3	Main	3220	Door	Door	Cracked	Wood	0.17
1924 Bldg.	152	XRF	9/11/97	3	Main	3220	Door	Casing	Solid	Metal	5.09
1924 Bldg.	153	XRF	9/11/97	3	Main	3220	Door	Door	Solid	Wood	0
1924 Bldg.	154	XRF	9/11/97	3	Main	3220	Door	Casing	Solid	Wood	0.02
1924 Bldg.	44	XRF	9/4/97	1	Outside	0	Stairs	Hand rail	Cracked	Metal	0.03
1924 Bldg.	45	XRF	9/4/97	1	Outside	0	Grounds	Fence	Solid	Metal	0.01
1924 Bldg.	46	XRF	9/4/97	1	Outside	0	Stairs	Hand rail	Cracked	Metal	0.02
1924 Bldg.	47	XRF	9/4/97	1	Outside	0	Door	Door	Solid	Metal	0.04
1924 Bldg.	48	XRF	9/4/97	1	Outside	0	Door	Casing	Solid	Metal	0.01
1924 Bldg.	49	XRF	9/4/97	1	Outside	0	Door	Header	Cracked	Wood	5.09
1924 Bldg.	50	XRF	9/4/97	1	Outside	0	Window	Panel	Solid	Metal	0
1924 Bldg.	51	XRF	9/4/97	1	Outside	0	Window	Sill	Solid	Metal	0.03
1924 Bldg.	52	XRF	9/4/97	1	Outside	0	Window	Mullion	Solid	Metal	0.06
1924 Bldg.	53	XRF	9/4/97	1	Outside	0	Window	Casing	Solid	Metal	0
1924 Bldg.	54	XRF	9/4/97	1	Outside	0	Window	Casing	Solid	Metal	0
1924 Bldg.	55	XRF	9/4/97	1	Outside	0	Door	Door	Solid	Metal	0
1924 Bldg.	56	XRF	9/4/97	1	Outside	0	Window	Sill	Solid	Metal	0
1924 Bldg.	57	XRF	9/4/97	1	Outside	0	Door	Door	Solid	Metal	0
1924 Bldg.	58	XRF	9/4/97	1	Outside	0	Door	Casing	Solid	Metal	0.03
1924 Bldg.	59	XRF	9/4/97	1	Outside	0	Door	Door	Solid	Metal	0.02
1924 Bldg.	60	XRF	9/4/97	1	Outside	0	Door	Casing	Solid	Metal	0.02
1924 Bldg.	61	XRF	9/4/97	1	Outside	0	Window	Panel	Solid	Wood	0.04
1924 Bldg.	62	XRF	9/4/97	1	Outside	0	Window	Panel	Solid	Metal	0
1924 Bldg.	63	XRF	9/4/97	1	Outside	0	Door	Door	Cracked	Wood	0.01
1924 Bldg.	64	XRF	9/4/97	1	Outside	0	Window	Panel	Solid	Wood	0.17
1924 Bldg.	65	XRF	9/4/97	1	Outside	0	Window	Casing	Solid	Wood	0.54
1924 Bldg.	66	XRF	9/4/97	1	Outside	0	Wall	Wall Rgstr	Solid	Metal	0.02
1924 Bldg.	67	XRF	9/4/97	1	Outside	0	Stairs	Hand rail	Solid	Metal	0.02
1924 Bldg.	68	XRF	9/4/97	1	Outside	0	Door	Door	Solid	Metal	0.03
1924 Bldg.	69	XRF	9/4/97	1	Outside	0	Door	Casing	Solid	Metal	0.02
1924 Bldg.	70	XRF	9/4/97	1	Outside	0	Door	Door	Solid	Metal	0.02
1924 Bldg.	71	XRF	9/4/97	1	Outside	0	Door	Casing	Solid	Metal	0.01
1924 Bldg.	72	XRF	9/4/97	1	Outside	0	Window	Panel	Solid	Metal	0.02
1924 Bldg.	73	XRF	9/4/97	1	Outside	0	Window	Casing	Solid	Metal	0.03
1924 Bldg.	74	XRF	9/4/97	1	Outside	0	Door	Door	Solid	Metal	0.04
1924 Bldg.	75	XRF	9/4/97	1	Outside	0	Door	Door	Solid	Metal	0.05
1924 Bldg.	76	XRF	9/4/97	1	Outside	0	Door	Jamb	Cracked	Metal	0.02
1924 Bldg.	77	XRF	9/4/97	1	Outside	0	Wall	Wall Rgstr	Solid	Metal	0.01
1924 Bldg.	78	XRF	9/4/97	1	Outside	0	Window	Panel	Solid	Wood	0
1924 Bldg.	79	XRF	9/4/97	1	Outside	0	Door	Door	Solid	Metal	0
1924 Bldg.	80	XRF	9/4/97	1	Outside	0	Door	Casing	Solid	Metal	0.05
1924 Bldg.	42	XRF	4/13/98	1	Restroom	1579	Wall	Wall	Solid	Plaster	0.4
1924 Bldg.	43	XRF	4/13/98	1	Restroom	1579	Door	Door	Solid	Wood	0.05
1924 Bldg.	44	XRF	4/13/98	1	Restroom	1579	Door	Casing	Solid	Wood	0.04
1924 Bldg.	45	XRF	4/13/98	1	Restroom	1579		Radiator	Cracked	Metal	0
1924 Bldg.	46	XRF	4/13/98	1	Restroom	1579	Wall	Wall	Solid	Concrte	0
1924 Bldg.	47	XRF	4/13/98	1	Restroom	1579	Window	Casing	Solid	Metal	1.5
1924 Bldg.	48	XRF	4/13/98	1	Restroom	1579	Door	Door	Solid	Wood	0.08
1924 Bldg.	49	XRF	4/13/98	1	Restroom	1579	Door	Jamb	Solid	Wood	0.05
1924 Bldg.	50	XRF	4/13/98	1	Restroom	1579	Door	Stall Door	Solid	Wood	0.05
1924 Bldg.	6	XRF	6/2/98	1	Restroom	1861	Door	Door	Solid	Metal	0
1924 Bldg.	7	XRF	6/2/98	1	Restroom	1861	Door	Jamb	Solid	Metal	0
1924 Bldg.	8	XRF	6/2/98	1	Restroom	1861	Wall	Midle Wall	Solid	Concrte	0.12
1924 Bldg.	9	XRF	6/2/98	1	Restroom	1861	Wall	Midle Wall	Solid	Concrte	0.12
1924 Bldg.	10	XRF	6/2/98	1	Restroom	1870	Door	Door	Solid	Metal	0
1924 Bldg.	11	XRF	6/2/98	1	Restroom	1870	Door	Casing	Solid	Metal	0

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	12	XRF	6/2/98	1	Restroom	1870	Wall	Midle Wall	Solid	Concrte	0.02
1924 Bldg.	13	XRF	6/2/98	1	Restroom	1870	Wall	Midle Wall	Solid	Concrte	0.03
1924 Bldg.	120	XRF	10/15/97	2	Restroom	2100	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	121	XRF	10/15/97	2	Restroom	2100	Wall	Chair rail	Solid	Wood	0.03
1924 Bldg.	122	XRF	10/15/97	2	Restroom	2100	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	123	XRF	10/15/97	2	Restroom	2100	Door	Door	Solid	Wood	0.09
1924 Bldg.	124	XRF	10/15/97	2	Restroom	2100	Door	Casing	Solid	Wood	0.1
1924 Bldg.	125	XRF	10/15/97	2	Restroom	2100	Window	Casing	Solid	Metal	1.84
1924 Bldg.	126	XRF	10/15/97	2	Restroom	2100		Radiator	Peeling	Metal	1
1924 Bldg.	127	XRF	10/15/97	2	Restroom	2100	Wall	Midle Wall	Solid	Concrte	0.01
1924 Bldg.	128	XRF	10/15/97	2	Restroom	2100	Door	Door	Solid	Wood	0.06
1924 Bldg.	129	XRF	10/15/97	2	Restroom	2100	Door	Casing	Solid	Wood	0.09
1924 Bldg.	130	XRF	10/15/97	2	Restroom	2100	Door	Stall Door	Solid	Wood	0
1924 Bldg.	135	XRF	10/15/97	2	Restroom	2115	Door	Door	Solid	Wood	0.08
1924 Bldg.	136	XRF	10/15/97	2	Restroom	2115	Door	Casing	Solid	Wood	0.11
1924 Bldg.	137	XRF	10/15/97	2	Restroom	2115	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	138	XRF	10/15/97	2	Restroom	2115	Wall	Frame	Solid	Wood	0.13
1924 Bldg.	139	XRF	10/15/97	2	Restroom	2115	Wall	Chair rail	Solid	Wood	0.03
1924 Bldg.	140	XRF	10/15/97	2	Restroom	2115	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	141	XRF	10/15/97	2	Restroom	2115	Door	Stall Door	Solid	Wood	0
1924 Bldg.	142	XRF	10/15/97	2	Restroom	2115	Floor		Solid	Concrte	0.04
1924 Bldg.	127	XRF	10/14/97	2	Restroom	2300	Wall	Wall	Solid	Concrte	0.06
1924 Bldg.	128	XRF	10/14/97	2	Restroom	2300	Wall	Wall	Solid	Concrte	0.14
1924 Bldg.	129	XRF	10/14/97	2	Restroom	2300	Door	Door	Solid	Wood	0.06
1924 Bldg.	130	XRF	10/14/97	2	Restroom	2300	Door	Casing	Solid	Wood	0.05
1924 Bldg.	131	XRF	10/14/97	2	Restroom	2300	Door	Stall Door	Solid	Wood	0
1924 Bldg.	132	XRF	10/14/97	2	Restroom	2300	Wall	Midle Wall	Solid	Concrte	0.02
1924 Bldg.	133	XRF	10/14/97	2	Restroom	2300	Window	Casing	Solid	Metal	1.13
1924 Bldg.	134	XRF	10/14/97	2	Restroom	2300	Door	Door	Solid	Wood	0.07
1924 Bldg.	135	XRF	10/14/97	2	Restroom	2300	Door	Casing	Solid	Wood	0.05
1924 Bldg.	107	XRF	9/11/97	3	Restroom	3090	Wall	Wall	Solid	Concrte	1.84
1924 Bldg.	108	XRF	9/11/97	3	Restroom	3090	Wall	Chair rail	Solid	Wood	0.09
1924 Bldg.	109	XRF	9/11/97	3	Restroom	3090	Wall	Frame	Solid	Wood	0.12
1924 Bldg.	110	XRF	9/11/97	3	Restroom	3090	Door	Door	Solid	Wood	0.05
1924 Bldg.	111	XRF	9/11/97	3	Restroom	3090	Door	Casing	Solid	Wood	0.06
1924 Bldg.	112	XRF	9/11/97	3	Restroom	3090	Door	Stall Door	Solid	Wood	0
1924 Bldg.	113	XRF	9/11/97	3	Restroom	3090	Wall	Bthrm Stil	Solid	Wood	0
1924 Bldg.	114	XRF	9/11/97	3	Restroom	3090	Wall	Bthrm Stil	Solid	Metal	0.07
1924 Bldg.	152	XRF	9/10/97	3	Restroom	3110	Door	Door	Solid	Wood	0.08
1924 Bldg.	153	XRF	9/10/97	3	Restroom	3110	Door	Casing	Solid	Wood	0.06
1924 Bldg.	154	XRF	9/10/97	3	Restroom	3110	Wall	Wall	Solid	Concrte	3.08
1924 Bldg.	155	XRF	9/10/97	3	Restroom	3110	Wall	Chair rail	Solid	Wood	0.03
1924 Bldg.	156	XRF	9/10/97	3	Restroom	3110	Wall	Wall	Solid	Concrte	2.56
1924 Bldg.	157	XRF	9/10/97	3	Restroom	3110	Wall	Midle Wall	Solid	Concrte	0.04
1924 Bldg.	158	XRF	9/10/97	3	Restroom	3110		Radiator	Peeling	Metal	0.18
1924 Bldg.	159	XRF	9/10/97	3	Restroom	3110	Door	Door	Solid	Wood	0.03
1924 Bldg.	160	XRF	9/10/97	3	Restroom	3110	Window	Casing	Solid	Wood	0.06
1924 Bldg.	161	XRF	9/10/97	3	Restroom	3110	Door	Stall Door	Solid	Wood	0.07
1924 Bldg.	137	XRF	9/10/97	3	Restroom	3390	Door	Stall Door	Solid	Wood	0.06
1924 Bldg.	138	XRF	9/10/97	3	Restroom	3390	Wall	Wall	Solid	Concrte	0.06
1924 Bldg.	139	XRF	9/10/97	3	Restroom	3390	Wall	Wall	Solid	Concrte	0.11
1924 Bldg.	140	XRF	9/10/97	3	Restroom	3390	Wall	Midle Wall	Solid	Concrte	0
1924 Bldg.	141	XRF	9/10/97	3	Restroom	3390		Radiator	Solid	Metal	0
1924 Bldg.	142	XRF	9/10/97	3	Restroom	3390	Door	Door	Solid	Wood	0.06
1924 Bldg.	143	XRF	9/10/97	3	Restroom	3390	Door	Casing	Solid	Wood	0.05
1924 Bldg.	28	XRF	6/17/97	0	Room	1	Wall	Wall	Cracked	Plaster	5.09
1924 Bldg.	29	XRF	6/17/97	0	Room	1	Cabinet	Door	Solid	Wood	0.05
1924 Bldg.	30	XRF	6/17/97	0	Room	1	Door	Door	Solid	Wood	0.06
1924 Bldg.	31	XRF	6/17/97	0	Room	1	Door	Casing	Solid	Wood	0.09
1924 Bldg.	32	XRF	6/17/97	0	Room	1	Window	Casing	Solid	Wood	0.06

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	33	XRF	6/17/97	0	Room	1		Radiator	Cracked	Metal	1.3
1924 Bldg.	34	XRF	6/17/97	0	Room	1	Wall	Crown Mold	Solid	Wood	0.07
1924 Bldg.	35	XRF	6/17/97	0	Room	1	Ceiling		Solid	Plaster	0.26
1924 Bldg.	8	XRF	6/3/98	0	Room	1	Door	Door	Solid	Metal	0.04
1924 Bldg.	9	XRF	6/3/98	0	Room	1	Door	Casing	Solid	Metal	0.03
1924 Bldg.	10	XRF	6/3/98	0	Room	1		Locker	Solid	Metal	0.5
1924 Bldg.	11	XRF	6/3/98	0	Room	1	Wall	Frame	Solid	Wood	0.15
1924 Bldg.	12	XRF	6/3/98	0	Room	1		Radiator	Solid	Metal	5.09
1924 Bldg.	13	XRF	6/3/98	0	Room	1	Window	Casing	Solid	Metal	0.03
1924 Bldg.	14	XRF	6/3/98	0	Room	1	Window	Column	Solid	Concrte	5.09
1924 Bldg.	15	XRF	6/3/98	0	Room	1	Ceiling		Solid	Plaster	5.09
1924 Bldg.	70	XRF	6/17/97	0	Room	2	Wall	Midle Wall	Solid	Plaster	0.09
1924 Bldg.	32	XRF	6/3/98	0	Room	2		Locker	Solid	Metal	0.05
1924 Bldg.	33	XRF	6/3/98	0	Room	2		Locker	Solid	Metal	0.08
1924 Bldg.	34	XRF	6/3/98	0	Room	2	Wall	Midle Wall	Solid	Concrte	0.09
1924 Bldg.	35	XRF	6/3/98	0	Room	2		Locker	Solid	Metal	0.23
1924 Bldg.	36	XRF	6/3/98	0	Room	2	Door	Door	Solid	Metal	0.04
1924 Bldg.	37	XRF	6/3/98	0	Room	2	Door	Stall Door	Solid	Metal	0
1924 Bldg.	38	XRF	6/3/98	0	Room	2	Ceiling		Solid	Concrte	3.56
1924 Bldg.	39	XRF	6/3/98	0	Room	2	Floor		Solid	Concrte	0
1924 Bldg.	49	XRF	6/2/98	0	Room	200	Wall	Midle Wall	Solid	Concrte	0
1924 Bldg.	50	XRF	6/2/98	0	Room	200	Door	Jamb	Cracked	Wood	0.07
1924 Bldg.	51	XRF	6/2/98	0	Room	200	Door	Door	Cracked	Wood	5.09
1924 Bldg.	52	XRF	6/2/98	0	Room	200	Door	Door	Cracked	Metal	0.42
1924 Bldg.	53	XRF	6/2/98	0	Room	200	Door	Casing	Cracked	Wood	3.2
1924 Bldg.	54	XRF	6/2/98	0	Room	200	Stairs	Hand rail	Cracked	Metal	0.71
1924 Bldg.	55	XRF	6/2/98	0	Room	200	Door	Door	Solid	Metal	0.24
1924 Bldg.	37	XRF	6/2/98	0	Room	220	Wall	Midle Wall	Solid	Drywall	0
1924 Bldg.	38	XRF	6/2/98	0	Room	220	Door	Door	Solid	Metal	0
1924 Bldg.	39	XRF	6/2/98	0	Room	220	Door	Casing	Solid	Metal	0
1924 Bldg.	40	XRF	6/2/98	0	Room	220	Wall	Midle Wall	Solid	Concrte	3.64
1924 Bldg.	41	XRF	6/2/98	0	Room	220	Window	Sash	Cracked	Metal	3.75
1924 Bldg.	78	XRF	4/13/98	1	Room	1200	Wall	Midle Wall	Solid	Plaster	0.29
1924 Bldg.	79	XRF	4/13/98	1	Room	1200	Wall	Chair rail	Solid	Wood	0.03
1924 Bldg.	80	XRF	4/13/98	1	Room	1320	Door	Casing	Solid	Wood	0.05
1924 Bldg.	81	XRF	4/13/98	1	Room	1320	Door	Door	Solid	Wood	0.04
1924 Bldg.	6	XRF	4/13/98	1	Room	1580	Wall	Wall	Solid	Plaster	0.17
1924 Bldg.	7	XRF	4/13/98	1	Room	1580	Wall	Baseboard	Cracked	Wood	3.07
1924 Bldg.	8	XRF	4/13/98	1	Room	1580	Chalkboard	Rail	Solid	Wood	0.02
1924 Bldg.	9	XRF	4/13/98	1	Room	1580	Door	Door	Solid	Wood	0.06
1924 Bldg.	10	XRF	4/13/98	1	Room	1580	Door	Casing	Solid	Wood	0.03
1924 Bldg.	11	XRF	4/13/98	1	Room	1580	Wall	Wall	Solid	Plaster	0.16
1924 Bldg.	12	XRF	4/13/98	1	Room	1580	Window	Panel	Solid	Metal	0
1924 Bldg.	13	XRF	4/13/98	1	Room	1580	Window	Mullion	Solid	Metal	0.03
1924 Bldg.	14	XRF	4/13/98	1	Room	1580	Window	Casing	Solid	Metal	0
1924 Bldg.	15	XRF	4/13/98	1	Room	1580	Wall	Wall Rgstr	Solid	Metal	0.04
1924 Bldg.	16	XRF	4/13/98	1	Room	1580	Floor		Cracked	Wood	0
1924 Bldg.	17	XRF	4/13/98	1	Room	1714	Wall	Midle Wall	Solid	Plaster	0.09
1924 Bldg.	18	XRF	4/13/98	1	Room	1714	Door	Door	Solid	Wood	0
1924 Bldg.	19	XRF	4/13/98	1	Room	1714	Door	Casing	Solid	Wood	0.03
1924 Bldg.	20	XRF	4/13/98	1	Room	1714		Radiator	Solid	Metal	0.49
1924 Bldg.	60	XRF	4/14/98	1	Room	1730	Wall	Midle Wall	Solid	Plaster	0.35
1924 Bldg.	61	XRF	4/14/98	1	Room	1730	Wall	Chair rail	Solid	Wood	0
1924 Bldg.	62	XRF	4/14/98	1	Room	1730	Wall	Baseboard	Solid	Wood	4.24
1924 Bldg.	63	XRF	4/14/98	1	Room	1730	Wall	Wall	Solid	Plaster	0.31
1924 Bldg.	64	XRF	4/14/98	1	Room	1730	Door	Casing	Solid	Wood	0.06
1924 Bldg.	65	XRF	4/14/98	1	Room	1730	Door	Door	Solid	Wood	0.02
1924 Bldg.	66	XRF	4/14/98	1	Room	1730	Chalkboard	Rail	Solid	Wood	0.04
1924 Bldg.	67	XRF	4/14/98	1	Room	1730	Floor		Solid	Wood	0
1924 Bldg.	58	XRF	6/1/98	1	Room	1810	Wall	Midle Wall	Solid	Concrte	5.09

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	59	XRF	6/1/98	1	Room	1810		Radiator	Solid	Metal	0
1924 Bldg.	60	XRF	6/1/98	1	Room	1810	Wall	Baseboard	Solid	Wood	0.09
1924 Bldg.	61	XRF	6/1/98	1	Room	1810	Window	Casing	Solid	Wood	0.16
1924 Bldg.	62	XRF	6/1/98	1	Room	1810	Window	Casing	Solid	Metal	0
1924 Bldg.	63	XRF	6/1/98	1	Room	1810	Window	Panel	Solid	Wood	0
1924 Bldg.	64	XRF	6/1/98	1	Room	1810	Wall	Midle Wall	Solid	Wood	0
1924 Bldg.	65	XRF	6/1/98	1	Room	1810	Door	Door	Solid	Wood	0
1924 Bldg.	66	XRF	6/1/98	1	Room	1810	Door	Jamb	Solid	Metal	0
1924 Bldg.	67	XRF	6/1/98	1	Room	1810	Bulletin Board	Trim	Solid	Wood	0.08
1924 Bldg.	16	XRF	6/1/98	1	Room	1830	Wall	Wall	Solid	Plaster	0.27
1924 Bldg.	17	XRF	6/1/98	1	Room	1830		Radiator	Solid	Metal	0
1924 Bldg.	18	XRF	6/1/98	1	Room	1830	Window	Mullion	Solid	Wood	0.13
1924 Bldg.	19	XRF	6/1/98	1	Room	1830	Window	Panel	Solid	Wood	0
1924 Bldg.	20	XRF	6/1/98	1	Room	1830	Window	Casing	Solid	Metal	0
1924 Bldg.	21	XRF	6/1/98	1	Room	1830	Wall	Midle Wall	Solid	Drywall	1.03
1924 Bldg.	22	XRF	6/1/98	1	Room	1830	Door	Door	Solid	Wood	0
1924 Bldg.	23	XRF	6/1/98	1	Room	1830	Door	Casing	Solid	Metal	0
1924 Bldg.	6	XRF	6/1/98	1	Room	1840	Wall	Wall	Solid	Plaster	0
1924 Bldg.	7	XRF	6/1/98	1	Room	1840		Radiator	Solid	Metal	0
1924 Bldg.	8	XRF	6/1/98	1	Room	1840	Window	Mullion	Solid	Wood	0.09
1924 Bldg.	9	XRF	6/1/98	1	Room	1840	Window	Casing	Solid	Metal	0
1924 Bldg.	10	XRF	6/1/98	1	Room	1840	Window	Panel	Solid	Wood	0
1924 Bldg.	11	XRF	6/1/98	1	Room	1840	Door	Door	Solid	Wood	0
1924 Bldg.	12	XRF	6/1/98	1	Room	1840	Door	Casing	Solid	Metal	0
1924 Bldg.	13	XRF	6/1/98	1	Room	1840	Cabinet	Door	Solid	Wood	0.06
1924 Bldg.	14	XRF	6/1/98	1	Room	1840	Wall	Wall	Solid	Vinyl	0.59
1924 Bldg.	15	XRF	6/1/98	1	Room	1840	Wall	Midle Wall	Solid	Drywall	0
1924 Bldg.	24	XRF	6/1/98	1	Room	1920	Door	Door	Solid	Wood	0
1924 Bldg.	26	XRF	6/1/98	1	Room	1920	Door	Casing	Solid	Metal	0
1924 Bldg.	27	XRF	6/1/98	1	Room	1920	Wall	Midle Wall	Solid	Drywall	1.35
1924 Bldg.	28	XRF	6/1/98	1	Room	1920	Wall	Midle Wall	Solid	Drywall	0
1924 Bldg.	29	XRF	6/1/98	1	Room	1920	Door	Door	Solid	Metal	0
1924 Bldg.	30	XRF	6/1/98	1	Room	1920	Wall	Midle Wall	Solid	Drywall	0.01
1924 Bldg.	31	XRF	6/1/98	1	Room	1920	Wall	Midle Wall	Solid	Drywall	0
1924 Bldg.	32	XRF	6/1/98	1	Room	1920	Wall	Midle Wall	Solid	Drywall	0.01
1924 Bldg.	33	XRF	6/1/98	1	Room	1920	Wall	Midle Wall	Solid	Drywall	0
1924 Bldg.	34	XRF	6/1/98	1	Room	1920	Window	Casing	Solid	Metal	0
1924 Bldg.	35	XRF	6/1/98	1	Room	1920	Wall	Midle Wall	Solid	Drywall	0.54
1924 Bldg.	36	XRF	6/1/98	1	Room	1920	Cabinet	Door	Solid	Wood	0.06
1924 Bldg.	37	XRF	6/1/98	1	Room	1920	Wall	Midle Wall	Solid	Drywall	0
1924 Bldg.	68	XRF	6/1/98	1	Room	1930	Wall	Midle Wall	Solid	Drywall	0
1924 Bldg.	69	XRF	6/1/98	1	Room	1930	Window	Casing	Solid	Wood	0
1924 Bldg.	70	XRF	6/1/98	1	Room	1930	Door	Casing	Solid	Metal	0
1924 Bldg.	14	XRF	6/2/98	1	Room	1930	Door	Door	Solid	Wood	0
1924 Bldg.	15	XRF	6/2/98	1	Room	1930	Door	Casing	Solid	Metal	0
1924 Bldg.	16	XRF	6/2/98	1	Room	1930	Wall	Midle Wall	Solid	Concrte	0.01
1924 Bldg.	17	XRF	6/2/98	1	Room	1930	Wall	Midle Wall	Solid	Drywall	0.02
1924 Bldg.	71	XRF	6/1/98	1	Room	1940	Wall	Midle Wall	Solid	Drywall	0
1924 Bldg.	72	XRF	6/1/98	1	Room	1940	Door	Casing	Solid	Metal	0
1924 Bldg.	73	XRF	6/1/98	1	Room	1940		Radiator	Solid	Metal	0
1924 Bldg.	74	XRF	6/1/98	1	Room	1940	Wall	Wall	Solid	Concrte	0.52
1924 Bldg.	75	XRF	6/1/98	1	Room	1940	Window	Mullion	Solid	Wood	0.13
1924 Bldg.	76	XRF	6/1/98	1	Room	1940	Window	Panel	Solid	Wood	0
1924 Bldg.	77	XRF	6/1/98	1	Room	1940	Window	Casing	Solid	Metal	0
1924 Bldg.	78	XRF	6/1/98	1	Room	1940	Wall	Midle Wall	Solid	Drywall	0.9
1924 Bldg.	20	XRF	10/15/97	2	Room	2050	Door	Door	Solid	Wood	0.04
1924 Bldg.	21	XRF	10/15/97	2	Room	2050	Door	Casing	Solid	Wood	0.07
1924 Bldg.	22	XRF	10/15/97	2	Room	2050	Wall	Midle Wall	Solid	Concrte	0.15
1924 Bldg.	23	XRF	10/15/97	2	Room	2050	Wall	Wall	Solid	Concrte	0.08
1924 Bldg.	24	XRF	10/15/97	2	Room	2050	Wall	Baseboard	Solid	Wood	0.05

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	25	XRF	10/15/97	2	Room	2050	Door	Casing	Solid	Metal	5.09
1924 Bldg.	26	XRF	10/15/97	2	Room	2050	Wall	Midle Wall	Solid	Concrte	0.1
1924 Bldg.	27	XRF	10/15/97	2	Room	2050	Window	Casing	Solid	Metal	0
1924 Bldg.	28	XRF	10/15/97	2	Room	2050	Window	Mullion	Solid	Wood	0.15
1924 Bldg.	29	XRF	10/15/97	2	Room	2050	Wall	Wall	Solid	Metal	0
1924 Bldg.	30	XRF	10/15/97	2	Room	2050		Radiator	Peeling	Metal	0.28
1924 Bldg.	31	XRF	10/15/97	2	Room	2050	Wall	Midle Wall	Solid	Drywall	0.08
1924 Bldg.	32	XRF	10/15/97	2	Room	2050		Radiator	Solid	Metal	0.06
1924 Bldg.	33	XRF	10/15/97	2	Room	2050	Wall	Wall	Solid	Concrte	0.15
1924 Bldg.	34	XRF	10/15/97	2	Room	2050	Wall	Midle Wall	Solid	Drywall	0.02
1924 Bldg.	35	XRF	10/15/97	2	Room	2050	Door	Door	Solid	Wood	0.01
1924 Bldg.	36	XRF	10/15/97	2	Room	2050		Radiator	Solid	Metal	0
1924 Bldg.	37	XRF	10/15/97	2	Room	2050	Wall	Midle Wall	Solid	Concrte	0.05
1924 Bldg.	38	XRF	10/15/97	2	Room	2050		Radiator	Solid	Metal	1.58
1924 Bldg.	39	XRF	10/15/97	2	Room	2050	Wall	Midle Wall	Solid	Concrte	0.01
1924 Bldg.	116	XRF	10/15/97	2	Room	2153	Wall	Midle Wall	Solid	Concrte	0.6
1924 Bldg.	117	XRF	10/15/97	2	Room	2153	Wall	Baseboard	Solid	Wood	0.11
1924 Bldg.	118	XRF	10/15/97	2	Room	2153	Door	Door	Solid	Wood	0.06
1924 Bldg.	119	XRF	10/15/97	2	Room	2153	Door	Casing	Solid	Wood	0.04
1924 Bldg.	131	XRF	10/15/97	2	Room	2181	Door	Door	Solid	Wood	0.12
1924 Bldg.	132	XRF	10/15/97	2	Room	2181	Door	Casing	Solid	Wood	0.08
1924 Bldg.	133	XRF	10/15/97	2	Room	2181	Wall	Midle Wall	Solid	Concrte	1.74
1924 Bldg.	134	XRF	10/15/97	2	Room	2181	Floor		Cracked	Concrte	0.01
1924 Bldg.	84	XRF	10/15/97	2	Room	2380	Wall	Midle Wall	Solid	Concrte	0.22
1924 Bldg.	85	XRF	10/15/97	2	Room	2380		Radiator	Solid	Metal	0.03
1924 Bldg.	86	XRF	10/15/97	2	Room	2380	Window	Casing	Solid	Metal	3.21
1924 Bldg.	87	XRF	10/15/97	2	Room	2380	Wall	Wall	Solid	Concrte	0.22
1924 Bldg.	88	XRF	10/15/97	2	Room	2380	Wall	Chair rail	Solid	Wood	0.15
1924 Bldg.	89	XRF	10/15/97	2	Room	2380	Door	Door	Solid	Wood	0.03
1924 Bldg.	90	XRF	10/15/97	2	Room	2380	Door	Casing	Solid	Wood	0.02
1924 Bldg.	136	XRF	10/14/97	2	Room	2394	Wall	Wall	Solid	Concrte	0.08
1924 Bldg.	137	XRF	10/14/97	2	Room	2394	Wall	Wall	Solid	Concrte	0.18
1924 Bldg.	138	XRF	10/14/97	2	Room	2394	Wall	Chair rail	Solid	Wood	0.05
1924 Bldg.	139	XRF	10/14/97	2	Room	2394	Door	Door	Solid	Wood	0.03
1924 Bldg.	140	XRF	10/14/97	2	Room	2394	Door	Jamb	Solid	Wood	0.05
1924 Bldg.	88	XRF	10/14/97	2	Room	2504	Bookcase	Shelf	Solid	Wood	0.02
1924 Bldg.	89	XRF	10/14/97	2	Room	2504	Wall	Midle Wall	Solid	Concrte	0.21
1924 Bldg.	90	XRF	10/14/97	2	Room	2504	Door	Door	Solid	Wood	0.04
1924 Bldg.	91	XRF	10/14/97	2	Room	2504	Door	Casing	Solid	Wood	0.05
1924 Bldg.	92	XRF	10/14/97	2	Room	2504	Floor		Solid	Wood	0
1924 Bldg.	86	XRF	9/11/97	3	Room	3060	Door	Door	Solid	Wood	0.07
1924 Bldg.	87	XRF	9/11/97	3	Room	3060	Door	Jamb	Solid	Wood	0.05
1924 Bldg.	88	XRF	9/11/97	3	Room	3060	Wall	Wall	Solid	Concrte	3.19
1924 Bldg.	89	XRF	9/11/97	3	Room	3060	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	90	XRF	9/11/97	3	Room	3060	Floor		Peeling	Concrte	0
1924 Bldg.	91	XRF	9/11/97	3	Room	3080	Door	Door	Solid	Wood	0.06
1924 Bldg.	92	XRF	9/11/97	3	Room	3080	Door	Jamb	Solid	Wood	0.05
1924 Bldg.	93	XRF	9/11/97	3	Room	3080	Wall	Wall	Solid	Concrte	0.09
1924 Bldg.	94	XRF	9/11/97	3	Room	3080		Radiator	Solid	Metal	1.86
1924 Bldg.	95	XRF	9/11/97	3	Room	3080	Window	Casing	Solid	Metal	5.09
1924 Bldg.	96	XRF	9/11/97	3	Room	3080	Bookcase	Shelf	Solid	Wood	0.04
1924 Bldg.	97	XRF	9/11/97	3	Room	3080	Wall	Wall	Solid	Concrte	1.89
1924 Bldg.	98	XRF	9/11/97	3	Room	3080	Wall	Chair rail	Solid	Wood	0.07
1924 Bldg.	99	XRF	9/11/97	3	Room	3080	Floor		Solid	Wood	0.04
1924 Bldg.	100	XRF	9/11/97	3	Room	3080	Floor		Solid	Concrte	0.02
1924 Bldg.	101	XRF	9/11/97	3	Room	3085	Door	Door	Solid	Wood	0
1924 Bldg.	102	XRF	9/11/97	3	Room	3085	Door	Casing	Solid	Metal	0.02
1924 Bldg.	103	XRF	9/11/97	3	Room	3085	Wall	Midle Wall	Solid	Drywall	0
1924 Bldg.	104	XRF	9/11/97	3	Room	3085		Radiator	Solid	Metal	0
1924 Bldg.	105	XRF	9/11/97	3	Room	3085	Door	Door	Solid	Metal	0

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	106	XRF	9/11/97	3	Room	3085	Door	Casing	Solid	Metal	0.01
1924 Bldg.	162	XRF	9/10/97	3	Room	3121	Door	Door	Solid	Wood	0.07
1924 Bldg.	163	XRF	9/10/97	3	Room	3121	Door	Jamb	Solid	Wood	0.05
1924 Bldg.	164	XRF	9/10/97	3	Room	3121	Wall	Wall	Solid	Concrte	3.95
1924 Bldg.	165	XRF	9/10/97	3	Room	3121	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	166	XRF	9/10/97	3	Room	3121	Floor		Cracked	Concrte	0
1924 Bldg.	167	XRF	9/10/97	3	Room	3130	Door	Door	Solid	Wood	0.07
1924 Bldg.	168	XRF	9/10/97	3	Room	3130	Door	Jamb	Solid	Wood	0.03
1924 Bldg.	169	XRF	9/10/97	3	Room	3130	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	170	XRF	9/10/97	3	Room	3130	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	171	XRF	9/10/97	3	Room	3130	Cabinet	Door	Solid	Wood	0.07
1924 Bldg.	172	XRF	9/10/97	3	Room	3130	Bookcase	Shelf	Solid	Wood	0.03
1924 Bldg.	173	XRF	9/10/97	3	Room	3130	Window	Stops	Solid	Metal	4.17
1924 Bldg.	174	XRF	9/10/97	3	Room	3130	Floor		Solid	Wood	0
1924 Bldg.	227	XRF	9/10/97	3	Room	3200	Window	Casing	Solid	Metal	0.01
1924 Bldg.	228	XRF	9/10/97	3	Room	3200	Window	Panel	Solid	Wood	0
1924 Bldg.	229	XRF	9/10/97	3	Room	3200	Window	Mullion	Solid	Wood	5.09
1924 Bldg.	230	XRF	9/10/97	3	Room	3200		Radiator	Peeling	Metal	0.07
1924 Bldg.	231	XRF	9/10/97	3	Room	3200	Wall	Midle Wall	Solid	Concrte	3.59
1924 Bldg.	232	XRF	9/10/97	3	Room	3200	Stairs	Hand rail	Solid	Wood	0.05
1924 Bldg.	233	XRF	9/10/97	3	Room	3200	Stairs	Hand rail	Solid	Wood	0
1924 Bldg.	234	XRF	9/10/97	3	Room	3200	Stairs	Hand rail	Solid	Wood	5.09
1924 Bldg.	235	XRF	9/10/97	3	Room	3200	Window	Casing	Solid	Metal	0
1924 Bldg.	236	XRF	9/10/97	3	Room	3200	Door	Casing	Solid	Wood	5.09
1924 Bldg.	237	XRF	9/10/97	3	Room	3200	Door	Door	Solid	Wood	5.09
1924 Bldg.	238	XRF	9/10/97	3	Room	3200	Wall	Midle Wall	Solid	Concrte	3.98
1924 Bldg.	239	XRF	9/10/97	3	Room	3200	Floor		Solid	Concrte	0
1924 Bldg.	144	XRF	9/10/97	3	Room	3270	Wall	Midle Wall	Solid	Concrte	5.09
1924 Bldg.	145	XRF	9/10/97	3	Room	3270	Window	Casing	Solid	Wood	0.09
1924 Bldg.	146	XRF	9/10/97	3	Room	3270		Radiator	Solid	Metal	0.06
1924 Bldg.	147	XRF	9/10/97	3	Room	3270	Window	Casing	Solid	Metal	0
1924 Bldg.	148	XRF	9/10/97	3	Room	3270	Window	Panel	Solid	Wood	0
1924 Bldg.	149	XRF	9/10/97	3	Room	3270	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	150	XRF	9/10/97	3	Room	3270	Door	Door	Solid	Wood	0.06
1924 Bldg.	151	XRF	9/10/97	3	Room	3270	Window	Casing	Solid	Metal	0.02
1924 Bldg.	120	XRF	9/10/97	3	Room	3350	Wall	Midle Wall	Solid	Concrte	2.96
1924 Bldg.	121	XRF	9/10/97	3	Room	3350	Window	Casing	Solid	Wood	0.02
1924 Bldg.	122	XRF	9/10/97	3	Room	3350		Radiator	Solid	Metal	1.71
1924 Bldg.	123	XRF	9/10/97	3	Room	3350	Wall	Midle Wall	Solid	Concrte	0.05
1924 Bldg.	124	XRF	9/10/97	3	Room	3350	Door	Door	Solid	Wood	0.07
1924 Bldg.	125	XRF	9/10/97	3	Room	3350	Door	Casing	Solid	Wood	0.05
1924 Bldg.	126	XRF	9/10/97	3	Room	3350	Wall	Transom	Solid	Wood	0
1924 Bldg.	127	XRF	9/10/97	3	Room	3350	Wall	Wall	Solid	Concrte	0.05
1924 Bldg.	128	XRF	9/10/97	3	Room	3350	Door	Door	Solid	Wood	0.05
1924 Bldg.	129	XRF	9/10/97	3	Room	3350	Door	Casing	Solid	Wood	0.05
1924 Bldg.	130	XRF	9/10/97	3	Room	3350	Door	Stall Door	Solid	Wood	0.04
1924 Bldg.	131	XRF	9/10/97	3	Room	3350	Wall	Midle Wall	Solid	Concrte	0
1924 Bldg.	132	XRF	9/10/97	3	Room	3350		Radiator	Solid	Metal	0.08
1924 Bldg.	133	XRF	9/10/97	3	Room	3350		Radiator	Solid	Metal	0.02
1924 Bldg.	134	XRF	9/10/97	3	Room	3350	Door	Door	Solid	Wood	0.07
1924 Bldg.	135	XRF	9/10/97	3	Room	3350	Wall	Wall	Solid	Concrte	0.06
1924 Bldg.	136	XRF	9/10/97	3	Room	3350	Door	Casing	Solid	Wood	0.05
1924 Bldg.	115	XRF	9/11/97	3	Room	3362	Wall	Midle Wall	Solid	Concrte	4.24
1924 Bldg.	116	XRF	9/11/97	3	Room	3362	Door	Door	Solid	Wood	0.05
1924 Bldg.	117	XRF	9/11/97	3	Room	3362	Window	Casing	Solid	Metal	0
1924 Bldg.	118	XRF	9/11/97	3	Room	3362	Door	Casing	Solid	Wood	0.05
1924 Bldg.	119	XRF	9/11/97	3	Room	3362	Window	Casing	Cracked	Metal	5.09
1924 Bldg.	120	XRF	9/11/97	3	Room	3362		Radiator	Cracked	Metal	0.09
1924 Bldg.	121	XRF	9/11/97	3	Room	3362	Wall	Midle Wall	Chalking	Concrte	0.02
1924 Bldg.	122	XRF	9/11/97	4	Room	4000	Door	Door	Solid	Metal	2.68

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1924 Bldg.	123	XRF	9/11/97	4	Room	4000	Door	Casing	Solid	Metal	3.24
1924 Bldg.	124	XRF	9/11/97	4	Room	4000	Stairs	Hand rail	Solid	Metal	3.53
1924 Bldg.	125	XRF	9/11/97	4	Room	4000	Door	Door	Peeling	Metal	3.05
1924 Bldg.	126	XRF	9/11/97	4	Room	4000	Window	Casing	Solid	Metal	0.72
1924 Bldg.	127	XRF	9/11/97	4	Room	4000	Ceiling		Solid	Concrte	0
1924 Bldg.	128	XRF	9/11/97	4	Room	4000	Stairs	Hand rail	Solid	Wood	0
1924 Bldg.	16	XRF	6/3/98	0	Stairwell	1	Wall	Midle Wall	Solid	Concrte	0.01
1924 Bldg.	17	XRF	6/3/98	0	Stairwell	1	Door	Door	Solid	Metal	0.02
1924 Bldg.	18	XRF	6/3/98	0	Stairwell	1	Stairs	Hand rail	Solid	Metal	0.03
1924 Bldg.	87	XRF	4/13/98	1	Stairwell	1152	Wall	Wall	Solid	Plaster	0.21
1924 Bldg.	88	XRF	4/13/98	1	Stairwell	1152	Stairs	Hand rail	Solid	Wood	0.08
1924 Bldg.	89	XRF	4/13/98	1	Stairwell	1152	Stairs	Baseboard	Solid	Concrte	1.89
1924 Bldg.	90	XRF	4/13/98	1	Stairwell	1152	Wall	Chair rail	Solid	Wood	0.01
1924 Bldg.	18	XRF	6/2/98	1	Stairwell	1340	Door	Door	Solid	Metal	0.55
1924 Bldg.	19	XRF	6/2/98	1	Stairwell	1340	Door	Casing	Solid	Metal	4.37
1924 Bldg.	20	XRF	6/2/98	1	Stairwell	1340	Wall	Midle Wall	Solid	Concrte	0.09
1924 Bldg.	21	XRF	6/2/98	1	Stairwell	1340		Radiator	Solid	Metal	0.02
1924 Bldg.	22	XRF	6/2/98	1	Stairwell	1340	Wall	Wall	Solid	Concrte	1.96
1924 Bldg.	23	XRF	6/2/98	1	Stairwell	1340	Stairs	Hand rail	Solid	Wood	0
1924 Bldg.	6	XRF	4/14/98	1	Stairwell	1764	Door	Door	Solid	Metal	0.01
1924 Bldg.	7	XRF	4/14/98	1	Stairwell	1764	Wall	Wall	Solid	Plaster	2.15
1924 Bldg.	8	XRF	4/14/98	1	Stairwell	1764	Stairs	Hand rail	Solid	Wood	0
1924 Bldg.	9	XRF	4/14/98	1	Stairwell	1764	Wall	Wall	Solid	Plaster	2.14
1924 Bldg.	10	XRF	4/14/98	1	Stairwell	1764	Door	Door	Solid	Metal	0.16
1924 Bldg.	11	XRF	4/14/98	1	Stairwell	1764	Window	Casing	Solid	Metal	0.2
1924 Bldg.	12	XRF	4/14/98	1	Stairwell	1764	Window	Casing	Solid	Metal	0
1924 Bldg.	13	XRF	4/14/98	1	Stairwell	1764		Radiator	Solid	Metal	2.53
1924 Bldg.	32	XRF	4/14/98	1	Stairwell	1901	Door	Door	Solid	Metal	0.32
1924 Bldg.	33	XRF	4/14/98	1	Stairwell	1901	Door	Jamb	Solid	Metal	0.18
1924 Bldg.	34	XRF	4/14/98	1	Stairwell	1901	Window	Casing	Solid	Metal	0.14
1924 Bldg.	35	XRF	4/14/98	1	Stairwell	1901	Wall	Wall	Solid	Concrte	3.15
1924 Bldg.	36	XRF	4/14/98	1	Stairwell	1901	Wall	Wall	Solid	Concrte	5.09
1924 Bldg.	37	XRF	4/14/98	1	Stairwell	1901	Stairs	Hand rail	Solid	Wood	0
1924 Bldg.	38	XRF	4/14/98	1	Stairwell	1901	Wall	Baseboard	Solid	Concrte	0.29
1924 Bldg.	39	XRF	4/14/98	1	Stairwell	1901	Door	Door	Solid	Metal	0.14
1924 Bldg.	40	XRF	4/14/98	1	Stairwell	1901	Wall	Chair rail	Solid	Wood	0.03
1924 Bldg.	41	XRF	4/14/98	1	Stairwell	1901		Radiator	Solid	Metal	0
1924 Bldg.	42	XRF	4/14/98	1	Stairwell	1901	Window	Casing	Cracked	Metal	4.25
1924 Bldg.	43	XRF	4/14/98	1	Stairwell	1901	Floor		Solid	Concrte	0
1970 Bldg.	109	XRF	6/3/98	2	Classroom	215	Wall	Midle Wall	Solid	Drywall	0.02
1970 Bldg.	110	XRF	6/3/98	2	Classroom	215	Window	Casing	Solid	Wood	0.01
1970 Bldg.	111	XRF	6/3/98	2	Classroom	215	Window	Column	Solid	Plaster	0.08
1970 Bldg.	112	XRF	6/3/98	2	Classroom	215	Door	Door	Solid	Wood	0
1970 Bldg.	113	XRF	6/3/98	2	Classroom	215	Door	Casing	Solid	Metal	0.02
1970 Bldg.	114	XRF	6/3/98	2	Classroom	215	Wall	Midle Wall	Solid	Concrte	0.02
1970 Bldg.	122	XRF	6/3/98	2	Classroom	217	Door	Door	Solid	Wood	0
1970 Bldg.	123	XRF	6/3/98	2	Classroom	217	Wall	Midle Wall	Solid	Concrte	0.01
1970 Bldg.	124	XRF	6/3/98	2	Classroom	217	Wall	Column	Solid	Plaster	0.05
1970 Bldg.	125	XRF	6/3/98	2	Classroom	217	Window	Casing	Solid	Wood	0.02
1970 Bldg.	126	XRF	6/3/98	2	Classroom	217	Door	Casing	Solid	Metal	0.01
1970 Bldg.	98	XRF	6/3/98	3	Classroom	315	Wall	Midle Wall	Solid	Concrte	0.04
1970 Bldg.	99	XRF	6/3/98	3	Classroom	315	Wall	Wall	Solid	Concrte	0.05
1970 Bldg.	100	XRF	6/3/98	3	Classroom	315	Wall	Midle Wall	Solid	Plaster	0.09
1970 Bldg.	101	XRF	6/3/98	3	Classroom	315	Door	Door	Solid	Wood	0
1970 Bldg.	102	XRF	6/3/98	3	Classroom	315	Door	Casing	Solid	Metal	0.01
1970 Bldg.	103	XRF	6/3/98	3	Classroom	317	Wall	Midle Wall	Solid	Concrte	0.04
1970 Bldg.	104	XRF	6/3/98	3	Classroom	317	Cabinet	Door	Solid	Wood	0
1970 Bldg.	105	XRF	6/3/98	3	Classroom	317	Wall	Wall	Solid	Concrte	0.03
1970 Bldg.	106	XRF	6/3/98	3	Classroom	317	Wall	Column	Solid	Plaster	0.01
1970 Bldg.	107	XRF	6/3/98	3	Classroom	317	Door	Door	Solid	Wood	0

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1970 Bldg.	108	XRF	6/3/98	3	Classroom	317	Door	Casing	Solid	Metal	0.01
1970 Bldg.	44	XRF	4/14/98	1	Classroom	1200	Wall	Midle Wall	Solid	Drywall	0
1970 Bldg.	45	XRF	4/14/98	1	Classroom	1200	Door	Casing	Solid	Metal	0.03
1970 Bldg.	46	XRF	4/14/98	1	Classroom	1200	Door	Door	Solid	Wood	0
1970 Bldg.	47	XRF	4/14/98	1	Classroom	1200	Door	Casing	Solid	Metal	0
1970 Bldg.	48	XRF	4/14/98	1	Classroom	1200	Door	Column	Solid	Plaster	0.05
1970 Bldg.	49	XRF	4/14/98	1	Classroom	1200	Door	Column	Solid	Metal	0.08
1970 Bldg.	50	XRF	4/14/98	1	Classroom	1200	Wall	Wall	Solid	Drywall	0.03
1970 Bldg.	51	XRF	4/14/98	1	Classroom	1200	Wall	Wall Rgstr	Solid	Metal	0.03
1970 Bldg.	52	XRF	4/14/98	1	Classroom	1202	Wall	Midle Wall	Solid	Drywall	0
1970 Bldg.	53	XRF	4/14/98	1	Classroom	1202	Door	Door	Solid	Wood	0
1970 Bldg.	54	XRF	4/14/98	1	Classroom	1202	Door	Casing	Solid	Metal	0.04
1970 Bldg.	55	XRF	4/14/98	1	Classroom	1202	Window	Casing	Solid	Metal	0.01
1970 Bldg.	56	XRF	4/14/98	1	Classroom	1202	Wall	Wall Rgstr	Solid	Metal	0
1970 Bldg.	57	XRF	4/14/98	1	Classroom	1202	Wall	Column	Solid	Metal	0.13
1970 Bldg.	58	XRF	4/14/98	1	Classroom	1202	Wall	Column	Solid	Drywall	0.04
1970 Bldg.	59	XRF	4/14/98	1	Classroom	1202	Floor		Solid	Wood	0.01
1970 Bldg.	25	XRF	6/3/98	1	Classroom	1378	Wall	Midle Wall	Solid	Concrte	0.06
1970 Bldg.	26	XRF	6/3/98	1	Classroom	1378	Wall	Midle Wall	Solid	Drywall	0
1970 Bldg.	27	XRF	6/3/98	1	Classroom	1378	Window	Casing	Solid	Metal	0.22
1970 Bldg.	28	XRF	6/3/98	1	Classroom	1378	Door	Casing	Solid	Metal	0.12
1970 Bldg.	29	XRF	6/3/98	1	Classroom	1378	Stairs	Hand rail	Solid	Metal	0
1970 Bldg.	30	XRF	6/3/98	1	Classroom	1378	Floor		Cracked	Concrte	0
1970 Bldg.	31	XRF	6/3/98	1	Classroom	1378	Wall	Midle Wall	Solid	Concrte	0
1970 Bldg.	40	XRF	6/3/98	1	Classroom	1720	Wall	Midle Wall	Solid	Concrte	0.05
1970 Bldg.	41	XRF	6/3/98	1	Classroom	1720	Wall	Midle Wall	Solid	Wood	0.02
1970 Bldg.	42	XRF	6/3/98	1	Classroom	1720	Wall	Midle Wall	Solid		0
1970 Bldg.	43	XRF	6/3/98	1	Classroom	1720	Door	Door	Solid	Wood	0
1970 Bldg.	44	XRF	6/3/98	1	Classroom	1720	Door	Casing	Solid	Metal	0.02
1970 Bldg.	95	XRF	6/2/98	1	Garage	1	Door	Door	Solid	Metal	0.36
1970 Bldg.	96	XRF	6/2/98	1	Garage	1	Door	Door	Cracked	Metal	0.04
1970 Bldg.	97	XRF	6/2/98	1	Garage	1	Door	Jamb	Cracked	Metal	0.03
1970 Bldg.	98	XRF	6/2/98	1	Garage	1	Door	Door	Solid	Metal	0
1970 Bldg.	99	XRF	6/2/98	1	Garage	1	Wall	Midle Wall	Solid	Concrte	0.1
1970 Bldg.	68	XRF	6/3/98	2	Gym	1	Bleachers		Solid	Wood	0
1970 Bldg.	69	XRF	6/3/98	2	Gym	1	Door	Door	Solid	Wood	0
1970 Bldg.	70	XRF	6/3/98	2	Gym	1	Door	Casing	Solid	Metal	0
1970 Bldg.	71	XRF	6/3/98	2	Gym	1	Wall	Wall	Solid	Concrte	0
1970 Bldg.	72	XRF	6/3/98	2	Gym	1	Wall	Wall	Solid	Concrte	0
1970 Bldg.	73	XRF	6/3/98	2	Gym	1		Elec Panel	Solid	Metal	0.02
1970 Bldg.	74	XRF	6/3/98	2	Gym	1	Wall	Midle Wall	Solid	Concrte	0
1970 Bldg.	75	XRF	6/3/98	2	Gym	1	Door	Door	Solid	Metal	0.02
1970 Bldg.	76	XRF	6/3/98	2	Gym	1	Floor		Solid	Wood	0
1970 Bldg.	77	XRF	6/3/98	2	Gym	1	Ceiling		Solid	Concrte	0.02
1970 Bldg.	94	XRF	6/3/98	3	Gym	3250	Wall	Midle Wall	Solid	Concrte	0.02
1970 Bldg.	95	XRF	6/3/98	3	Gym	3250	Door	Door	Solid	Wood	0
1970 Bldg.	96	XRF	6/3/98	3	Gym	3250	Door	Door	Solid	Metal	0.03
1970 Bldg.	97	XRF	6/3/98	3	Gym	3250	Door	Casing	Solid	Metal	0.02
1970 Bldg.	86	XRF	6/2/98	1	Hall	1350	Wall	Midle Wall	Solid	Concrte	0.01
1970 Bldg.	87	XRF	6/2/98	1	Hall	1350	Door	Door	Solid	Metal	0.03
1970 Bldg.	88	XRF	6/2/98	1	Hall	1350	Door	Casing	Solid	Metal	0.04
1970 Bldg.	89	XRF	6/2/98	1	Hall	1350	Wall	Midle Wall	Solid	Concrte	0
1970 Bldg.	90	XRF	6/2/98	1	Hall	1350	Wall	Wall	Solid	Wood	0
1970 Bldg.	91	XRF	6/2/98	1	Hall	1350	Stairs	Hand rail	Solid	Metal	0
1970 Bldg.	92	XRF	6/2/98	1	Hall	1350	Wall	Wall	Solid	Concrte	0
1970 Bldg.	93	XRF	6/2/98	1	Hall	1350	Door	Door	Solid	Metal	0
1970 Bldg.	94	XRF	6/2/98	1	Hall	1350	Door	Door	Solid	Metal	0.01
1970 Bldg.	45	XRF	6/3/98	1	Hall	1701	Wall	Midle Wall	Solid	Concrte	0
1970 Bldg.	46	XRF	6/3/98	1	Hall	1701	Door	Door	Solid	Metal	0
1970 Bldg.	47	XRF	6/3/98	1	Hall	1701	Door	Casing	Solid	Metal	0

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1970 Bldg.	48	XRF	6/3/98	1	Hall	1701	Door	Door	Solid	Wood	0
1970 Bldg.	61	XRF	6/3/98	1	Hall	1730	Wall	Midle Wall	Solid	Concrte	0.03
1970 Bldg.	62	XRF	6/3/98	1	Hall	1730	Window	Casing	Solid	Wood	0
1970 Bldg.	63	XRF	6/3/98	1	Hall	1730	Door	Door	Cracked	Metal	0.02
1970 Bldg.	64	XRF	6/3/98	1	Hall	1730	Door	Casing	Solid	Metal	0.02
1970 Bldg.	65	XRF	6/3/98	1	Hall	1730		Radiator	Cracked	Metal	0
1970 Bldg.	66	XRF	6/3/98	1	Hall	1730	Door	Door	Solid	Wood	0
1970 Bldg.	67	XRF	6/3/98	1	Hall	1730	Window	Casing	Solid	Metal	0.03
1970 Bldg.	88	XRF	6/3/98	2	Hall	2399	Wall	Midle Wall	Solid	Concrte	0.01
1970 Bldg.	89	XRF	6/3/98	2	Hall	2399	Bench		Solid	Wood	0
1970 Bldg.	90	XRF	6/3/98	2	Hall	2399	Door	Door	Solid	Metal	0.03
1970 Bldg.	91	XRF	6/3/98	2	Hall	2399	Door	Jamb	Solid	Metal	0.03
1970 Bldg.	92	XRF	6/3/98	2	Hall	2399		Radiator	Solid	Metal	0
1970 Bldg.	93	XRF	6/3/98	2	Hall	2399	Window	Casing	Solid	Metal	0.02
1970 Bldg.	127	XRF	6/3/98	2	Hall	2592	Door	Door	Solid	Metal	0.03
1970 Bldg.	128	XRF	6/3/98	2	Hall	2592	Wall	Wall Rgstr	Solid	Metal	0
1970 Bldg.	129	XRF	6/3/98	2	Hall	2592	Wall	Midle Wall	Solid	Concrte	0.03
1970 Bldg.	130	XRF	6/3/98	2	Hall	2592	Window	Casing	Solid	Metal	0.02
1970 Bldg.	131	XRF	6/3/98	2	Hall	2592	Door	Door	Solid	Wood	0
1970 Bldg.	132	XRF	6/3/98	2	Hall	2592		Elec Panel	Solid	Metal	0.08
1970 Bldg.	68	XRF	6/2/98	1	Restroom	1450	Door	Door	Solid	Wood	0
1970 Bldg.	69	XRF	6/2/98	1	Restroom	1450	Door	Casing	Solid	Metal	0.02
1970 Bldg.	70	XRF	6/2/98	1	Restroom	1450	Wall	Midle Wall	Solid	Concrte	0
1970 Bldg.	71	XRF	6/2/98	1	Restroom	1450	Door	Door	Solid	Metal	0.05
1970 Bldg.	51	XRF	6/3/98	1	Restroom	1630	Wall	Midle Wall	Solid	Concrte	0.01
1970 Bldg.	52	XRF	6/3/98	1	Restroom	1630	Door	Casing	Solid	Metal	0.03
1970 Bldg.	53	XRF	6/3/98	1	Restroom	1630	Door	Door	Solid	Wood	0
1970 Bldg.	6	XRF	6/3/98	0	Room	1	Wall	Midle Wall	Solid	Concrte	0
1970 Bldg.	7	XRF	6/3/98	0	Room	1		Radiator	Peeling	Metal	0.08
1970 Bldg.	20	XRF	6/3/98	0	Room	1	Door	Door	Solid	Metal	0
1970 Bldg.	21	XRF	6/3/98	0	Room	1	Wall	Midle Wall	Solid	Drywall	0
1970 Bldg.	22	XRF	6/3/98	0	Room	1	Wall	Midle Wall	Cracked	Concrte	5.09
1970 Bldg.	23	XRF	6/3/98	0	Room	1	Wall	Midle Wall	Solid	Concrte	0
1970 Bldg.	24	XRF	6/3/98	0	Room	1	Ceiling		Peeling	Plaster	0.03
1970 Bldg.	115	XRF	6/3/98	2	Room	216	Wall	Midle Wall	Solid	Concrte	0.03
1970 Bldg.	116	XRF	6/3/98	2	Room	216	Door	Door	Solid	Wood	0
1970 Bldg.	117	XRF	6/3/98	2	Room	216	Door	Casing	Solid	Metal	0.04
1970 Bldg.	118	XRF	6/3/98	2	Room	216	Window	Casing	Solid	Wood	0.01
1970 Bldg.	119	XRF	6/3/98	2	Room	216	Window	Column	Solid	Plaster	0.08
1970 Bldg.	120	XRF	6/3/98	2	Room	216	Wall	Midle Wall	Solid	Drywall	0
1970 Bldg.	121	XRF	6/3/98	2	Room	216	Wall	Midle Wall	Solid	Concrte	0.01
1970 Bldg.	62	XRF	6/2/98	1	Room	1390	Door	Door	Solid	Wood	0
1970 Bldg.	63	XRF	6/2/98	1	Room	1390	Door	Jamb	Solid	Metal	0.02
1970 Bldg.	64	XRF	6/2/98	1	Room	1390	Wall	Midle Wall	Solid	Concrte	0.01
1970 Bldg.	65	XRF	6/2/98	1	Room	1390	Door	Door	Solid	Metal	0.02
1970 Bldg.	66	XRF	6/2/98	1	Room	1390	Wall	Wall	Solid	Concrte	0.02
1970 Bldg.	67	XRF	6/2/98	1	Room	1390	Wall	Midle Wall	Solid	Drywall	0
1970 Bldg.	56	XRF	6/2/98	1	Room	1400	Door	Door	Solid	Wood	0
1970 Bldg.	57	XRF	6/2/98	1	Room	1400	Window	Casing	Solid	Metal	0.15
1970 Bldg.	58	XRF	6/2/98	1	Room	1400	Wall	Midle Wall	Solid	Concrte	0
1970 Bldg.	59	XRF	6/2/98	1	Room	1400	Window	Casing	Solid	Metal	0.03
1970 Bldg.	60	XRF	6/2/98	1	Room	1400	Wall	Midle Wall	Solid	Concrte	0
1970 Bldg.	61	XRF	6/2/98	1	Room	1400	Wall	Wall	Solid	Metal	0
1970 Bldg.	72	XRF	6/2/98	1	Room	1460	Door	Door	Solid	Wood	0
1970 Bldg.	73	XRF	6/2/98	1	Room	1460	Door	Jamb	Solid	Metal	0.02
1970 Bldg.	74	XRF	6/2/98	1	Room	1460	Wall	Midle Wall	Solid	Concrte	0.02
1970 Bldg.	75	XRF	6/2/98	1	Room	1460	Window	Casing	Solid	Metal	0.02
1970 Bldg.	76	XRF	6/2/98	1	Room	1460	Door	Door	Solid	Metal	0.04
1970 Bldg.	77	XRF	6/2/98	1	Room	1460	Wall	Midle Wall	Solid	Concrte	0.06
1970 Bldg.	78	XRF	6/2/98	1	Room	1460	Wall	Midle Wall	Solid	Concrte	0.03

Saint Paul Public Schools
Washington Technology Middle School
Lead-Based Paint Inspection

Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1970 Bldg.	79	XRF	6/2/98	1	Room	1460		Locker	Solid	Metal	0
1970 Bldg.	80	XRF	6/2/98	1	Room	1460	Wall	Midle Wall	Solid	Concrte	0.03
1970 Bldg.	81	XRF	6/2/98	1	Room	1460		Locker	Solid	Metal	0.12
1970 Bldg.	82	XRF	6/2/98	1	Room	1460		Locker	Solid	Metal	0.07
1970 Bldg.	83	XRF	6/2/98	1	Room	1460	Wall	Midle Wall	Solid	Tile	0.25
1970 Bldg.	84	XRF	6/2/98	1	Room	1460	Ceiling		Solid	Plaster	0
1970 Bldg.	85	XRF	6/2/98	1	Room	1460	Bench		Solid	Wood	0
1970 Bldg.	100	XRF	6/2/98	1	Room	1600	Door	Door	Solid	Wood	0
1970 Bldg.	101	XRF	6/2/98	1	Room	1600	Door	Casing	Solid	Metal	0.04
1970 Bldg.	102	XRF	6/2/98	1	Room	1600	Wall	Midle Wall	Solid	Concrte	0.01
1970 Bldg.	103	XRF	6/2/98	1	Room	1600	Wall	Midle Wall	Solid	Wood	0.01
1970 Bldg.	104	XRF	6/2/98	1	Room	1600	Wall	Wall	Solid	Concrte	0.01
1970 Bldg.	49	XRF	6/3/98	1	Room	1614	Wall	Midle Wall	Solid	Concrte	0.06
1970 Bldg.	50	XRF	6/3/98	1	Room	1614	Door	Casing	Solid	Metal	0.02
1970 Bldg.	54	XRF	6/3/98	1	Room	1619	Wall	Midle Wall	Solid	Concrte	0.04
1970 Bldg.	55	XRF	6/3/98	1	Room	1619	Door	Door	Solid	Wood	0
1970 Bldg.	56	XRF	6/3/98	1	Room	1619	Door	Casing	Solid	Metal	0.01
1970 Bldg.	57	XRF	6/3/98	1	Room	1619	Wall	Midle Wall	Solid	Concrte	0.03
1970 Bldg.	58	XRF	6/3/98	1	Room	1620	Wall	Midle Wall	Solid	Concrte	0.05
1970 Bldg.	59	XRF	6/3/98	1	Room	1620	Door	Door	Solid	Wood	0
1970 Bldg.	60	XRF	6/3/98	1	Room	1620	Door	Casing	Solid	Metal	0.01
1970 Bldg.	19	XRF	6/3/98	0	Stairwell	1	Stairs	Baseboard		Metal	0.03
1970 Bldg.	78	XRF	6/3/98	2	Stairwell	2000	Wall	Midle Wall	Solid	Concrte	0
1970 Bldg.	79	XRF	6/3/98	2	Stairwell	2000	Door	Door	Solid	Metal	0.03
1970 Bldg.	80	XRF	6/3/98	2	Stairwell	2000	Door	Jamb	Solid	Metal	0.03
1970 Bldg.	81	XRF	6/3/98	2	Stairwell	2000	Stairs	Hand rail	Solid	Metal	0.03
1970 Bldg.	82	XRF	6/3/98	2	Stairwell	2000	Ceiling		Solid	Concrte	0
1970 Bldg.	83	XRF	6/3/98	2	Stairwell	2010	Wall	Midle Wall	Solid	Concrte	0
1970 Bldg.	84	XRF	6/3/98	2	Stairwell	2010	Door	Door	Solid	Metal	0.03
1970 Bldg.	85	XRF	6/3/98	2	Stairwell	2010	Door	Jamb	Solid	Metal	0.01
1970 Bldg.	86	XRF	6/3/98	2	Stairwell	2010	Stairs	Hand rail	Solid	Metal	0.1
1970 Bldg.	87	XRF	6/3/98	2	Stairwell	2010	Ceiling		Solid	Concrte	0

APPENDIX B

LABORATORY SAMPLE ANALYSIS DATA


LABORATORY ANALYSIS REPORT**DATE:** June 18, 1997**PAGE:** 1 Of 1**CLIENT:** Midwest Environmental Cons.
5385 401st Ave. NW
Dalbo, MN 55017**PROJECT NO.:** 061797-200888
COLLECTION DATE: 6/17/97
COLLECTED BY: Client
RECEIVED DATE: 6/17/97
PROJECT DESCRP.: 62/0197AL**CONTACT:** Greg Myers/Richard Cox

			LEAD (6010A) Units=mg/kg	ANALYSIS
<u>SAMPLE #</u>	<u>DESCP.</u>	<u>MDL</u>	<u>RESULTS</u>	<u>DATE</u>
L973762-1	B-1	73	2700	6/18/97
L973762-2	B-2	39	2600	6/18/97
L973762-3	B-3	21	400	6/18/97
L973762-4	B-4	18	380	6/18/97
L973762-5	B-5	21	1400	6/18/97
L973762-6	B-6	42	3800	6/18/97
L973762-7	B-7	22	2100	6/18/97
L973762-8	B-8	35	3100	6/18/97
L973762-9	B-9	35	2700	6/18/97
L973762-10	B-10	18	3200	6/18/97

ND means Not Detected or below reported MDL**MDL** means Method Detection Limit**mg/kg** means Milligrams Per Kilogram which is equivalent to Parts Per Million (ppm)

This report has been reviewed by me for technical accuracy and completeness. The analyses were performed using EPA or other approved methodologies and the results were reported on an "as received" basis unless otherwise noted. Organic soil analyses were reported on a dry weight basis. The results reported relate only to the items tested. Please contact me if you have any questions or comments regarding this report. Spectrum Labs, Inc. appreciates the opportunity to provide this analytical service for you.

Report Submitted By,

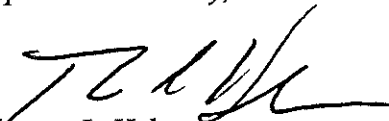
Thomas L. Halverson
Laboratory ManagerTLH:wmc
mec169-2

As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.

Notes: please have results by 6/18/97 a.m. if possible

APPENDIX C INSPECTORS

**Greg A. Myers
MDH Lead Inspector # 116**

**William Sloan
MDH Lead Inspector # 476**