

Half Hollow Hills CSD
Six Month AHERA Surveillance
Half Hollow Hills High School East & Garage
May 2023



2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project #23546

Six Month AHERA Surveillance

Performed at

Half Hollow Hills High School East & Garage
50 Vanderbilt Parkway
Dix Hills, NY 11746

for

Half Hollow Hills CSD
Administration Building
525 Half Hollow Road
Dix Hills, NY 11746

May 2023

Prepared by:

Enviroscience Consultants, LLC
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #23546

Inspector & Management
Planner:


Bartley Gallagher

NYSDOL #92-13892

Inspectors:


Alexis Bruno

NYSDOL #21-08575


Pamela Chadderton

NYSDOL #15-10408

Six Month AHERA Surveillance

Table of Contents

- I. Summary**
- II. Inspection and Recommendations**
- III. Bulk Sampling Protocol**
- IV. Hazard Rank Determination**
- V. AHERA Reassessment Category**

Appendix A - Inventory of Damaged Asbestos Containing Materials

Appendix B - Inventory of Asbestos Containing Materials

Appendix C - Drawings - Functional Space Number Floor Plans

Appendix D - Certifications

Appendix E - Notice to Short Term Workers

Appendix F - Bulk Sample Results

I. Summary

A six month AHERA surveillance for the Half Hollow Hills High School East and Garage of the Half Hollow Hills CSD was performed by Ms. Alexis Bruno and Mrs. Pamela Chadderton of Enviroscience Consultants, LLC on June 1, 2023.

The six month surveillance was performed in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Ms. Bruno and Mrs. Chadderton are certified AHERA Inspectors.

Ms. Bruno and Mrs. Chadderton performed the on-site investigation, which included examining existing ACBM, evaluating the condition of the ACBM, and determining if originally non-friable materials have become friable. The physical condition of most of the ACBM found in this building did not change.

After studying the inspection reports, Mr. Bartley M. Gallagher, a certified EPA/AHERA Inspector and Management Planner, developed the recommendations for response actions depending on his evaluation of the hazard that each material may cause.

An Inventory of Asbestos Containing Materials by location, including the AHERA Functional Space identification number is in Appendix B. This inventory includes the material, quantity, amount damaged, the hazard level, the AHERA Reassessment category, and recommended response actions. A remarks column includes sampling and abatement action and other pertinent information.

Floor plans correlating the AHERA Functional Space ID number with the current common location names are in Appendix C.

II. Inspection and Recommendations

The inspector entered all accessible spaces to inspect and physically assess the condition and friability of all previously known or assumed ACBM. The inspector noted any change in condition of remaining materials, materials that have been abated since the last reinspection, and any materials that were either not identified, or may have been improperly classified.

Unless otherwise stated, a recommendation for removal is a suggestion that the materials be removed as soon as the school's budget will allow.

During this inspection there was damage noted, repairs should be made. Please reference your Summary of Damaged Asbestos Containing Materials found in Appendix A.

Since the last surveillance, the following asbestos abatement activities were performed:

In June 2023, bulk samples were collected of terrazzo floor at various locations throughout the Building Interior. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #35245 for detailed sample location information and results.

In April 2023, asbestos containing exterior window caulk and transite fascia panels (ACM) were removed from the following areas:

- Room 705 (AHERA Space #1176)
- Room 707 (AHERA Space #1175)
- Room 709 (AHERA Space #1173)
- Room 725 (AHERA Space #2036)

- Room 727 (AHERA Space #2034)
- Room 729 (AHERA Space #2033)
- Room 729 Prep A (AHERA Space #2033A)
- Room 731 (AHERA Space #2029)
- Room 733 & 731 Prep (AHERA Space #2026)
- Corridor Storage 7B - Room 815 (1192)
- Room 812 (AHERA Space #1193)
- Room 812 Office (AHERA Space #1193A)
- Girl's Bathroom Near Cafeteria (1199)
- Boy's Bathroom Near Cafeteria (1202)
- Faculty Dining Room (1203)
- Corridor Cafeteria B to Room 705 (1207)
- Room 818 (AHERA Space #1189)
- Room 819 (AHERA Space #1188)
- Room 823 (AHERA Space #1195)
- Room 825 (AHERA Space #1194)

Please reference Enviroscience Consultants job #23444.

In February 2023, approximately three (3) linear feet of asbestos containing pipe fitting insulation were removed from the Basement Custodial Closet (AHERA space #023). Please reference Enviroscience Consultants job #22334.

In February 2023, bulk samples were collected of the drywall and joint compound in the Basement Custodial Closet (AHERA space #023). Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #34656 for detailed sample location information and results.

In December 2022, asbestos containing materials (ACM) were removed from the following areas:

- Approximately 40 thermal pipe insulation fittings and 160 square feet of hot water tank insulation were removed from the Water Tank Storage Room (AHERA #001)
- Approximately 4 thermal pipe insulation fittings were removed from the Plumbing Department (AHERA #016)
- Approximately 8 thermal pipe insulation fittings were removed from the Shipping & Receiving Area (AHERA #020)
- Approximately 5 thermal pipe insulation fittings were removed from the Main Electric Vault Room (AHERA #030)
- Approximately 3 thermal pipe insulation fittings were removed from the Main Electric Vault Vestibule (AHERA #031)
- Approximately 3 thermal pipe insulation fittings were removed from Room 907 (AHERA #0038)
- Approximately 4 thermal pipe insulation fittings were removed from the Print Shop Break Room (AHERA #1001A)
- Approximately 16 thermal pipe insulation fittings were removed from the Art Office 4 (AHERA #1002H)
- Approximately 13 thermal pipe insulation fittings were removed from the Custodial Office (AHERA #1006)
- Approximately 2 thermal pipe insulation fittings were removed from the Girls Locker Room Bathroom (AHERA #1021E)
- Approximately 40 thermal pipe insulation fittings were removed and 7 linear feet of duct cloth insulation was repaired from the Room 511 Storage Fan Room (AHERA #1022A)
- Approximately 12 thermal pipe insulation fittings were removed from the Room 404 Storage

- Closet (AHERA #1037A)
- Approximately 2 thermal pipe insulation fittings were removed from Room 301/Study Room (AHERA #1049)
- Approximately 3 thermal pipe insulation fittings were removed from the Custodial Closet Near Room 211 (AHERA #1055)
- Approximately 6 linear feet of thermal pipe insulation was removed from the East Health Office Supply Closet (AHERA #1084F)
- Approximately 12 thermal pipe insulation fittings were removed from the Kitchen Storage (AHERA #1204B)
- Approximately 15 thermal pipe insulation fittings were removed from the Fan Room (AHERA #2047)
- Approximately 6 thermal pipe insulation fittings were removed from the Library Storage (AHERA #1091E1)

Please reference Enviroscience Consultants job #23078.

History:

In September 2022, approximately 408 square feet of asbestos containing floor tiles and mastic, and pipe fitting insulation from six (6) fittings (ACM) were removed from the East Side Gym Locker Rooms as follows:

- ACM floor tiles and mastic were removed from the Boys Locker Room Entrance Hallway (AHERA Space #1019A)
- ACM floor tiles and mastic and pipe fitting insulation were removed from the Boys Locker Room Office and closet (AHERA Spaces #1019C and #1019C1)
- ACM floor tiles and mastic were removed from the Girls Locker Room Entrance Hallway (AHERA Space #1021A)
- ACM floor tiles and mastic were removed from the Girls Locker Room Office (AHERA Space #1021C)

Please reference Enviroscience Consultants job #22745.

In August 2022, approximately 4,300 square feet of asbestos containing floor tiles and mastic (ACM) were removed from the following areas:

- Custodial Closets (AHERA #1011, 1035, 1055)
- Locker Room Offices (AHERA Boys - #003A, Girls - 024B)
- The 900 Office (AHERA #1153)
- Room 607 (AHERA #1120) and Room 609 (AHERA #1121)
- Lobby Closet (AHERA #1104)
- Fencing Closet (AHERA #1205A)

Please reference Enviroscience Consultants job #22536.

In June 2022, asbestos containing exterior window caulk and transite panels (ACM) were removed from the following areas:

- Auditorium Near Entrance Corridor East & West windows
- South Corridor & East Corridor of Main Gym windows
- Boy's Locker Room, Stairwell to Boys & Girls Locker Room Coach Office windows
- Guidance Offices, 900 Wing upper and lower level windows

- Both Connecting Corridors between 700 and 900 Wings
- Rooms 743, 741-733, 723, 721, 719, 717, 715, 703, 701 windows
- Room 725 Front Windows & Copy Room next to room 721 & Hallway windows
- Storage Room near room 715, Boiler Room, ESL B & ESL A (Room 818) windows

Please reference Enviroscience Consultants job #22414.

In May 2022, bulk samples were collected of the wall covering in the West Auditorium Ramp at Door #2. Results confirmed the material sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #32837 for detailed sample location information and results.

In May 2022, bulk samples were collected of the mirror mastic in the Weight Room (AHERA space #1008). Results confirmed the material sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #32772 for detailed sample location information and results.

In May 2022, bulk samples were collected of interior panel insulation at various locations throughout the Building Interior. Results confirmed the materials sampled to be asbestos containing. Please reference Enviroscience Consultants chain of custody #32704 for detailed sample location information and results.

In April 2022, asbestos containing pipe insulation was removed from the Pipe Tunnel Off the Boys' Team Locker Room (AHERA space #028). Please reference Enviroscience Consultants job #22171.

In April 2022, bulk samples were collected of the 9'x9' floor tile and floor tile mastic in the Café Storage Room. Results confirmed the materials sampled to be asbestos containing. Please reference Enviroscience Consultants chain of custody #32616 for detailed sample location information and results.

In March 2022, bulk samples were collected of the pipe fitting insulation in the Pipe Tunnel Off the Boys' Team Locker Room (AHERA space #028). Results confirmed the materials sampled to be asbestos containing. Please reference Enviroscience Consultants chain of custody #32526 for detailed sample location information and results.

In November 2021, Enviroscience Consultants was retained by the Half Hollow Hills Central School District to perform the surveillance inspections and three year reinspections in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Any information pertaining to the assessment and changes in condition of ACBM prior to November 2021 must be obtained from the records maintained by the Half Hollow Hills Central School District.

In October 2021, asbestos containing pipe fitting insulation was removed from one fitting in the wall chase in Room 909. Please reference Enviroscience Consultants job #21574.

In October 2021, bulk samples were collected of pipe fitting insulation in the wall chase in Room 909. Results confirmed the material sampled to be asbestos containing. Please reference Enviroscience Consultants chain of custody #31578 for detailed sample location information and results.

In October 2021, bulk samples were collected of the wall plaster, ceiling plaster, terrazzo flooring, ceramic wall tile glue, ceramic wall tile grout, and ceramic wall tile backing in the Boy's Gang Toilet (AHERA space #1202) and Girl's Gang Toilet (AHERA space #1199). Results confirmed all the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #31558 for detailed sample location information and results.

In September 2021, a small amount of asbestos containing pipe fitting insulation was removed from the Hallway Ceiling Plenum Outside Room 709. Please reference Enviroscience Consultants job #21463.

In August 2021, bulk samples were collected of the pipe fitting insulation in the Hallway Outside Room 709. Results confirmed the materials sampled to be asbestos containing. Please reference Enviroscience Consultants chain of custody #31280 for detailed sample location information and results.

In August 2021, asbestos containing floor tile and floor tile mastic were removed from Room 711 (AHERA space #1169), Room 713 (AHERA space #1168), Room 715 (AHERA space #1162), and Room 900 (AHERA space #0048). A small amount of asbestos containing pipe fitting insulation was removed from the 200/300 Corridor Intersection. Please reference Enviroscience Consultants job #21263.

In July 2021, bulk samples were collected of the 9"x9" floor tile and floor tile mastic in Room 711 (AHERA space #1169), Room 715 (AHERA space #1162), and Room 900 (AHERA space #0048). Results confirmed the materials sampled to be asbestos containing. Please reference Enviroscience Consultants chain of custody #30593 for detailed sample location information and results.

In July 2021, bulk samples were collected of the floor tile and floor tile mastic in Room 609 (AHERA space #1121), Room 607 (AHERA space #1120), Room 605 (AHERA space #1113), Room 605 Office (AHERA space #1113A), Room 603 (AHERA space #1112), and Room 603 Office (AHERA space #1112A). Bulk samples were collected of the wall paper in the Guidance Department. Results confirmed the floor tile in Room 609 (AHERA space #1121), Room 607 (AHERA space #1120), Room 605 (AHERA space #1113), and Room 605 Office (AHERA space #1113A) to be asbestos containing materials; all the other materials sampled were confirmed to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #30847 for detailed sample location information and results.

Any damaged material that is assumed to be asbestos containing should be sampled to confirm that it is identified as ACBM before initiating repair procedures.

The inspector did not access any flooring materials located under carpeting or new tiles because obtaining access would damage the carpet or new tiles. Prior to disturbing any carpets or removing new floor tiles, the school should ascertain whether floor tiles are located beneath them. Repair or replace damaged floor tiles as noted. We have prepared an inventory of asbestos containing materials for the building. These pages list the current damage category, changes in physical condition, current priority levels, changes in response actions, and bulk sampling and abatement information (see Appendix B).

All materials are currently classified as non-friable in their present condition, except for damaged thermal insulation materials, gypsum board, joint compound, fire door insulation, and ceramic wall base grout.

III. Bulk Sampling Protocol

Thermal System Insulation - Three (3) samples are randomly collected for each homogeneous material of Thermal System Insulation (TSI). AHERA states that for each area of patched TSI at least one (1) sample be collected.

Surfacing Materials - a minimum of three (3), five (5) or seven (7) samples based upon the amount of suspect material present.

Miscellaneous Materials - require a minimum of two (2) samples.

New York State Revisions to Analytical Methods

Over the years, the New York State Department of Health has made several revisions to testing requirements that affect suspect asbestos materials in school buildings. These changes have resulted in the requirement to re-sample and analyze certain materials to comply with the revised analytical methods:

Surfacing Materials - In May 2016, the New York State Department of Health (NYSDOH) finalized testing requirements and approved a new analytical method for analysis of surfacing materials that contain vermiculite. Surfacing materials that could contain vermiculite include spray-on fireproofing, wall plaster, and ceiling plaster. Unfortunately, the previous analysis method for fireproofing and plasters did not specifically require that the vermiculite percentage be reported. The District must now consider any spray or troweled fireproofing or plaster materials to be presumed asbestos containing materials (PACM) until they are re-tested to conform to the new requirements. As a result, we have added any plaster previously classified as non-asbestos to the Inventory of Asbestos Containing Materials. Re-testing of any fireproofing or plaster materials will be noted in the narrative and will be shown in the Inventory.

Ceiling Tile - In August 2012, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in ceiling tiles that contain cellulose. Any ceiling tiles that have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Any re-testing of ceiling tiles will be noted in the narrative and will be shown in the Inventory. The District should keep records for any new non-asbestos ceiling tiles that are installed, including the location, brand, model number, date of manufacture, and date of installation.

Floor Tile and Other NOB Materials - In 1992, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in non-friable organically bound (NOB) materials such as floor tiles and roofing materials. As such, any floor tiles and mastic which have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Re-testing of any floor tile, mastic or other NOB materials will be noted in the narrative and will be shown in the Inventory.

During this surveillance, bulk samples were collected of terrazzo floor at various locations throughout the Building Interior. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #35245 in Appendix F for detailed sample location information and results.

IV. Hazard Rank Determination

For each homogeneous material, a response action priority level is determined depending on its physical condition, location, and potential for future damage. Materials were classified into seven categories, based upon the type, condition, and potential for damage of the ACBM. The categories are as follows:

Hazard Rank	ACBM Condition	ACBM Disturbance Potential
1	Significantly Damaged	Any Potential for Damage
2	Damaged	Potential for Significant Damage
3	Damaged	Potential for Damage
4	Damaged	Low Potential for Damage
5	Good	Potential for Significant Damage
6	Good	Potential for Damage
7	Good	Low Potential for Damage

The district shall select and implement in a timely manner the appropriate response actions consistent with the assessment category. The response actions selected shall be sufficient to protect human health and the environment. The district may then select, from the response actions which protect human health and the environment, that action which is the least burdensome method. Nothing in this section shall be construed to prohibit removal of ACBM from a school building at any time, should removal be the preferred response action of the district.

If damaged or significantly damaged thermal system insulation ACM is present in a building, the district shall:

- (1) At least repair the damaged area.
- (2) Remove the damaged material if it is not feasible, due to technological factors, to repair the damage.
- (3) Maintain all thermal system insulation ACM and its covering in an intact state and undamaged condition.

If damaged friable surfacing ACM or damaged friable miscellaneous ACM is present in a building, the district shall select from among the following response actions: encapsulation, enclosure, removal, or repair of the damaged material.

In selecting the response action from among those which meet the definitional standards in §763.83, the district shall determine which of these response actions protects human health and the environment. For purposes of determining which of these response actions are the least burdensome, the district may then consider local circumstances, including occupancy and use patterns within the school building, and its economic concerns, including short and long-term costs.

V. AHERA Reassessment Category

The Management Planner is also required to classify each friable and thermal system insulation (TSI) ACBM and suspected ACBM assumed to be ACM in the school building into one of the following AHERA 1 through 7 reassessment categories based on damage, potential for damage, and material category:

- (1) Damaged or significantly damaged thermal system insulation ACM.
- (2) Damaged friable surfacing ACM.

- (3) Significantly damaged friable surfacing ACM.
 - (4) Damaged or significantly damaged friable miscellaneous ACM.
 - (5) ACBM with potential for damage.
 - (6) ACBM with potential for significant damage.
 - (7) Any remaining friable ACBM or friable suspected ACBM.
- N/A Not Applicable

Appendix A

INVENTORY OF DAMAGED ASBESTOS CONTAINING MATERIALS

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
001A1	WATER TANK STORAGE PHONE ROOM STORAGE	GYPSUM BOARD		70 SF	< 1 SF	3	4	REPAIR	MINOR DAMAGE
001A	WATER TANK STORAGE PHONE ROOM	9X9 FLOOR TILE & MASTIC MAROON		120 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
003	BOY'S LOCKER ROOM	CERAMIC FLOOR TILE GROUT & GLUE BLUE CERAMIC WALL BASE GROUT & GLUE GREY		2795 SF 463 SF	9 SF 30 LF	4 4	N/A NON FRIABLE N/A NON FRIABLE	REPAIR REPAIR	MISSING AND CHIPPED CRACKED, CHIPPED WITH MASTIC EXPOSED
003A1	BOY'S LOCKER COACH OFFICE BATHROOM	CERAMIC WALL TILE GROUT & GLUE BLUE		314 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND HOLES W/ GLUE EXPOSED
003B	BOY'S LOCKER EQUIPMENT ROOM	FIRE DOOR INSULATION WOOD		1 DOOR	< 1 SF	3	4	REPAIR	PEELING
004	CUSTODIAL CLOSET	FIRE DOOR INSULATION WOOD CEILING GYPSUM BOARD & COMPOUND		1 DOOR 80 SF	4 SF < 1 SF	3 3	4 4	REPAIR REPAIR	PEELING CHIPPED
006	WRESTLING STORAGE ROOM	FIRE DOOR INSULATION WOOD		1 DOOR	< 1 SF	3	4	REPAIR	PEELING.
008	TRAINING ROOM	FIRE DOOR INSULATION WOOD		1 DOOR	< 1 SF	3	4	REPAIR	PEELING.
009	LACROSSE COACH OFFICE	CERAMIC FLOOR TILE GROUT & GLUE BLUE CERAMIC WALL BASE GROUT & GLUE BLUE		190 SF 50 SF	3 SF 10 TILES	4 4	N/A NON FRIABLE N/A NON FRIABLE	REPAIR REPAIR	CRACKED CRACKED AND MISSING
009A	LACROSSE COACH OFFICE BATHROOM	CERAMIC WALL TILE GROUT & GLUE BLUE		288 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
010	TEAM LOCKER ROOM	CERAMIC FLOOR TILE GROUT & GLUE BLUE CERAMIC WALL BASE GROUT & GLUE BLUE CERAMIC WALL TILE GROUT & GLUE BLUE		1650 SF 315 SF 805 SF	1 SF 18 TILES 5 TILES	4 4 4	N/A NON FRIABLE N/A NON FRIABLE N/A NON FRIABLE	REPAIR REPAIR REPAIR	MISSING AND CHIPPED SECTIONS ARE PATCHED CRACKED AND CHIPPED SECTIONS ARE PATCHED CRACKED AND CHIPPED SECTIONS ARE PATCHED
012	MAINTENANCE LOCKER ROOM	GYPSUM BOARD & COMPOUND		171 SF	< 1 SF	3	4	REPAIR	HOLES
013	MAINTENANCE STORAGE AREA	GYPSUM BOARD & COMPOUND		1560 SF	3 SF	3	4	REPAIR	CHIPPED.
014	HEATER & FREEZER SHOP	GYPSUM BOARD		520 SF	1 SF	3	4	REPAIR	CHIPPED.

Half Hollow Hills CSD
Half Hollow Hills High School East and Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
018	LIGHTING AND WIRING ROOM	GYPSUM BOARD		700 SF	NOT QUANTIFIED	3	4	REPAIR	NO ACCESS (PREVIOUSLY MINOR DAMAGE)
019	ELECTRICIAN ROOM	GYPSUM BOARD		720 SF	NOT QUANTIFIED	3	4	REPAIR	NO ACCESS (PREVIOUSLY MINOR DAMAGE)
021	RECORDS MANAGEMENT ADMINISTRATION DEPT.	GYPSUM BOARD & COMPOUND		1120 SF	<1 SF	3	4	REPAIR	HOLES
021A	BLUEPRINTS ARCHIVE ROOM	GYPSUM BOARD & COMPOUND		520 SF	<1 SF	3	4	REPAIR	HOLE
022	CORRIDOR PIPE TUNNEL STORAGE TO WRESTLING ROOM	12X12 FLOOR TILE & MASTIC WHITE WITH SPECKLES		678 SF	20 TILES	4	N/A NON FRIABLE	REPAIR	TAPED TILES AND CRACKED SECTIONS ARE PATCHED
24	GIRL'S LOCKER ROOM	CERAMIC WALL BASE GROUT & GLUE PINK		460 SF	12 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
024B1	GIRL'S LOCKER ROOM COACH OFFICE BATHROOM	CERAMIC WALL TILE GROUT & GLUE PINK		314 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
025CP	GIRL'S LOCKER ROOM EXIT VESTIBULE CEILING PLENUM	MUD JOINT PACKING		20 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
026	WRESTLING ROOM	9X9 FLOOR TILE & MASTIC CREAM/BROWN		3366 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED WITH MASTIC EXPOSED; CONF ACM ECL JOB #18976
027	SOCCER & BASKETBALL STORAGE	FIRE DOOR INSULATION WOOD		1 DOOR	1 SF	3	4	REPAIR	PEELING.
034	CORRIDOR PIPE TUNNEL STORAGE TO ELEVATOR MECHANICAL ROOM	12X12 FLOOR TILE & MASTIC WHITE WITH SPECKLES		100 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	LOOSE
		COVE BASE & MASTIC GREY		58 LF	3 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING
0035	BASEMENT STAIRWELL TO ROOM 909	GLAZED BLOCK MORTAR		300 SF	1 SF	4	N/A NON FRIABLE	REPAIR	HOLES
0036	ROOM 909	COVE BASE & MASTIC BROWN		111 LF	15 LF	4	N/A NON FRIABLE	REPAIR	MISSING & DELAMINATING W/ MASTIC EXPOSED
0037	ROOM 908	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED; MOST TILES ARE CUPPING
		COVE BASE & MASTIC BROWN		111 LF	6 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING, MISSING WITH MASTIC EXPOSED - SOME REPLACED

Haft Hollow Hills CSD
Haft Hollow Hills High School East and Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
0039	WOMEN'S FACULTY BATHROOM NEAR ROOM 907	CERAMIC WALL TILE GROUT & GLUE BROWN		687 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
0040	CUSTODIAL CLOSET NEAR ROOM 906	CERAMIC WALL BASE GROUT & GLUE OFF WHITE		33 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
0041	MEN'S FACULTY BATHROOM NEAR 906	CERAMIC WALL TILE GROUT & GLUE GREEN		687 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
0042	ROOM 906	12X12 FLOOR TILE & MASTIC WHITE WITH GREY		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED; SOME PATCHED
0043	ROOM 905	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED; SOME PATCHED
		COVE BASE & MASTIC BLACK		111 LF	10 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING W/ MASTIC EXPOSED
0044	ROOM 904 (COMBINED W/ SPACE 0046)	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	80 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED AND CUPPING.
		COVE BASE & MASTIC BROWN		81 LF	7 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		FIRE DOOR INSULATION WOOD		1 DOOR	2 SF	3	4	REPAIR	PEELING, CRACKED AND MISSING.
0045	ROOM 903	9X9 FLOOR TILE & MASTIC LIGHT GREEN		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CUPPING, CHIPPED WITH MASTIC EXPOSED - SOME PATCHED
0046	ROOM 902	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED; 7 TILES PATCHED & CUPPING PROBLEM
		COVE BASE & MASTIC BROWN		81 LF	30 LF	4	N/A NON FRIABLE	REPAIR	OLD COVE BASE IS DELAMINATING. NEW COVE BASE IS ALSO OBSERVED
0047	ROOM 9A/BOOK STORAGE	9X9 FLOOR TILE & MASTIC PINK		240 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED.
0047CP	ROOM 9A/BOOK STORAGE CEILING PLENUM	MUD JOINT PACKING		22 UNITS	NOT QUANTIFIED	3	1	REPAIR	DAMAGED WITH DEBRIS
1001	PRINT SHOP/MAINTENANCE GARAGE	GYPSUM BOARD		450 SF	<1 SF	3	4	REPAIR	HOLE.
1001C	PRINT SHOP	ROOF TAR		N/A	<1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED AND DRIPPING.

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1002	ART COMMON AREA	9X9 FLOOR TILE & MASTIC GREEN		252 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED; CONF ACM ECL JOB #18040
		COVE BASE & MASTIC BROWN		108 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED.
1002A	FASHION STORAGE/DRESSING ROOM D	9X9 FLOOR TILE & MASTIC GREEN		99 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED; CONF ACM ECL JOB #18040
1002B	ART STORAGE C	COVE BASE & MASTIC BROWN		27 LF	1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		1X1 WALL TILE & MASTIC FISSURE		180 SF	20 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, HOLES & MISSING W/ MASTIC EXPOSED
1002C	ART STORAGE B	1X1 WALL TILE & MASTIC FISSURE		180 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED - MASTIC IS COVERED
1002D	700 THE ARTS	1X1 WALL TILE & MASTIC FISSURE		180 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED WITH MASTIC EXPOSED
1002E	ROOM 554	12X12 FLOOR TILE & MASTIC BROWN WITH WHITE		900 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	CUPPING & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		114 LF	10 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		1X1 ACOUSTICAL WALL TILE & MASTIC		300 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & WATER STAINED
1002G	ROOM 556	9X9 FLOOR TILE & MASTIC WHITE		320 SF	18 TILES	4	N/A NON FRIABLE	REPAIR	CUPPING, CHIPPED, CRACKED & MISSING W/ MASTIC EXPOSED
		12X12 FLOOR TILE & MASTIC BROWN WITH WHITE		1280 SF	30 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED W/ MASTIC & 9X9 FT EXPOSED
		1X1 ACOUSTICAL WALL TILE & MASTIC		260 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY (PREVIOUSLY CHIPPED)
		FIBERBOARD		95 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1002H	ART OFFICE 4	METAL SINK UNDERCOATING BLACK		1 UNIT	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		LINOLEUM FLOORING		88 SF	6 LF	4	N/A NON FRIABLE	REPAIR	CRACKED.

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1003	ROOM 555/553 VESTIBULE	COVE BASE & MASTIC BLACK		18 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		GYP SUM BOARD & COMPOUND		180 SF	1 SF	3	4	REPAIR	SCRAPED
		WALL/CHALK-BOARD MASTIC		2 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
1003A	ROOM 555	GYP SUM BOARD & COMPOUND		360 SF	< 1 SF	3	4	REPAIR	HOLES
1003B	ROOM 553	GYP SUM BOARD & COMPOUND		360 SF	< 1 SF	3	4	REPAIR	CHIPPED/ HOLE
1004	STORAGE CLOSET NEAR ROOM 552	9X9 FLOOR TILE & MASTIC BEIGE		125 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED - SOME PATCHED
		12X12 FLOOR TILE & MASTIC BROWN WATERCOLOR		15 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	WORN
		12X12 FLOOR TILE & MASTIC WHITE/BROWN		810 SF	18 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED
1005	ROOM 552	COVE BASE & MASTIC BROWN		63 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & CHIPPED W/ MASTIC EXPOSED
1005CP	ROOM 552 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1005A	ROOM 552 TV ROOM	9X9 FLOOR TILE & MASTIC GREEN		135 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED; CONF ACM ECL JOB # 18040
1007	BOILER ROOM	CEMENTITIOUS WALL PLASTER		1375 SF	2 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED AND MISSING.
1008	WEIGHT ROOM	GYP SUM BOARD & COMPOUND		170 SF	1 SF	3	4	REPAIR	HOLES
		SKYLIGHT PLASTER		40 SF	4 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
1008CP	WEIGHT ROOM CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1008C	WEIGHT ROOM OFFICE	12X12 FLOOR TILE & MASTIC BROWN WATERCOLOR		84 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
		COVE BASE & MASTIC BLACK		35 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING

Half Hollow Hills CSD
Half Hollow Hills High School East and Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1009CP	CORRIDOR WEIGHT ROOM TO PRINT SHOP CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1010	BOY'S BATHROOM NEAR WEIGHT ROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		80 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
1012	GIRL'S BATHROOM NEAR WEIGHT ROOM	CERAMIC WALL TILE GROUT & GLUE PINK		200 SF	40 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING W/ MASTIC EXPOSED
1013	ROOM 550	12X12 FLOOR TILE & MASTIC WHITE		210 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1014	ROOM 548	12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		210 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED.
1015	ROOM 546	12X12 FLOOR TILE & MASTIC BEIGE WATERCOLOR		210 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		210 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		12X12 FLOOR TILE & MASTIC YELLOW		210 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1015SCP	ROOM 546 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1016CP	CORRIDOR ROOMS 546-550 CEILING PLENUM	MUD JOINT PACKING		6 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1017CP	ROOM 544 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1018	ROOM 517 STORAGE	9X9 FLOOR TILE & MASTIC GREEN		72 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED & MISSING; CONF ACM ECL JOB #18040
1019	BOY'S LOCKER ROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		1584 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		410 LF	3 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CERAMIC WALL TILE GROUT & GLUE YELLOW		36 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
1019C2	BOY'S LOCKER ROOM COACH ROOM BATHROOM	CERAMIC WALL TILE GROUT & GLUE GREEN		265 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	HOLES

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1019D	BOY'S LOCKER ROOM BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREY		112 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL TILE GROUT & GLUE GREY		200 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1019F	BOY'S LOCKER ROOM SHOWER/STORAGE	CERAMIC FLOOR TILE GROUT & GLUE TEAL & WHITE		410 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
		CERAMIC WALL TILE GROUT & GLUE YELLOW		710 SF	12 TILES	4	N/A NON FRIABLE	REPAIR	MISSING TILES
		WALL PLASTER (BEHIND CERAMIC TILE)		710 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
1020A	EAST GYMNASIUM STORAGE 1	ROOF TAR		N/A	< 1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1020A1	EAST GYMNASIUM TRACK OFFICE	9X9 FLOOR TILE & MASTIC BEIGE		126 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED WITH MASTIC EXPOSED.
1020B	OUTDOOR STORAGE	ROOF TAR		N/A	1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1020C	EAST GYMNASIUM ELECTRICAL	ROOF TAR		2 SF	1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1021	GIRL'S LOCKER ROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		1300 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL BASE GROUT & GLUE PINK		109 SF	22 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1021B	GIRL'S LOCKER ROOM SLOP SINK	CERAMIC WALL TILE GROUT & GLUE PINK		172 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING TILES
		CEILING GYPSUM BOARD & COMPOUND		70 SF	< 1 SF	3	4	REPAIR	WATER STAINED
1021D	GIRL'S LOCKER ROOM SHOWER AREA	CERAMIC WALL TILE GROUT & GLUE PINK		820 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	MISSING TILES, LIMITED VISIBILITY
1021E	GIRL'S LOCKER ROOM BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		91 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1021E	GIRL'S LOCKER ROOM BATHROOM	CERAMIC WALL TILE GROUT & GLUE PINK		220 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	MISSING & CHIPPED
		CERAMIC WALL TILE GROUT & GLUE PINK		220 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	MISSING & CHIPPED
1022	ROOM 511 STORAGE	9X9 FLOOR TILE GREY		96 SF	11 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED W/ MASTIC EXPOSED; CONF ACM (ECI JOB #18040)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1022A	ROOM 511 STORAGE FAN ROOM	VIBRATION REDUCER CLOTH GREEN		7 UNITS	1	4	N/A NON FRIABLE	REPAIR	SIGNIFICANTLY DAMAGED, SPLIT OPEN
		CEMENTITIOUS CEILING MATERIAL		1675 SF	15 LF	4	N/A NON FRIABLE	REPAIR	CRACKED DUE TO WATER DAMAGE
1023	GENDER NEUTRAL BATHROOM (PREVIOUSLY MEN'S BATHROOM)	CERAMIC WALL TILE GROUT & GLUE BLUE		284 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED & 1 TILE PATCHED
1024	CUSTODIAN 509 CLOSET	COVE BASE & MASTIC BLACK		29 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINTAED, MASTIC EXPOSED
1025	WOMEN'S ROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		96 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
		CERAMIC WALL TILE GROUT & GLUE PINK		284 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED GROUT & MISSING W/ MASTIC EXPOSED
1026	ART PHOTO ROOM 543	9X9 FLOOR TILE & MASTIC GREEN		12 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	NOT OBSERVED; CONF ACM ECL JOB #18040
1026A	ART PHOTO ROOM 543 DARK ROOM	COVE BASE & MASTIC BROWN		102 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		12X12 FLOOR TILE & MASTIC WHITE/BROWN		264 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
1026B	ART PHOTO ROOM 543 CLOSET	COVE BASE & MASTIC BROWN		49 LF	5 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC PAINTED OVER
1027ACP	ROOM 541 STORAGE CEILING PLENUM	GYPSUM BOARD		22 SF	< 1 SF	3	4	REPAIR	MINOR DAMAGE
1029	YEAR BOOK ROOM 539	COVE BASE & MASTIC BROWN		80 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1032CP	CORRIDOR BOY'S LOCKER ROOM LECTURE HALL CEILING PLENUM	MUD JOINT PACKING		88 UNITS	NOT QUANTIFIED	3	1	REPAIR	DEBRIS
1034CP	GIRLS BATHROOM CEILING PLENUM	MUD JOINT PACKING		5 UNITS	1	3	1	REPAIR	DAMAGED
1035	ROOM 403 CUSTODIAL CLOSET	ROOF TAR		N/A	< 1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1037	ROOM 404	9X9 FLOOR TILE & MASTIC GREY		912 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1039CP	ROOM 405 CEILING PLENUM	MUD JOINT PACKING		4 UNITS	NOT QUANTIFIED	3	1	REPAIR	DAMAGED WITH DEBRIS; CONF ACM JCB#18-39291
1039A	ROOM 405/407 PREP ROOM	12x12 FLOOR TILE & MASTIC PEACH		392 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
1039ACP	ROOM 405/407 PREP ROOM CEILING PLENUM	MUD JOINT PACKING		4 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1041CP	ROOM 407 CEILING PLENUM	ROOF TAR		N/A	< 1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1042CP	CORRIDOR ROOM 408 TO CONTINUING ED OFFICE CEILING PLENUM	MUD JOINT PACKING		44 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE; CONF ACM ECL JOB #18105
1043	ROOM 309	COVE BASE & MASTIC BROWN		49 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
1044	ROOM 306	9x9 FLOOR TILE & MASTIC GREY		810 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	UNDER 12x12 FLOOR TILE; EXPOSED - TILES CHIPPED W/ HOLES
		12x12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED W/ MASTIC & 9x9 FT EXPOSED - SOME PATCHED
1045	FACULTY ROOM	12x12 FLOOR TILE & MASTIC WHITE/BROWN		672 SF	11 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED WITH MASTIC EXPOSED. 9x9 TILE CONFIRMED UNDERNEATH
1045B	FACULTY KITCHEN AREA	12x12 FLOOR TILE & MASTIC WHITE/BROWN		140 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED
1045B1	FACULTY MEN'S BATHROOM	CERAMIC WALL TILE GROUT & GLUE BLUE		145 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & HOLE
1046	ROOM 307	12x12 FLOOR TILE & MASTIC WHITE WITH BLACK		810 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED, 9x9 ARE EXPOSED
1047	ROOM 305	12x12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	30 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED, 9x9 ARE EXPOSED
		COVE BASE & MASTIC BLACK		111 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DENTED
1048	ROOM 303	12x12 FLOOR TILE & MASTIC WHITE/BROWN		810 SF	50 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED

Summary of Damaged Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1049	ROOM 301/STUDY ROOM	2X4 WALL TILE FISSURE		28 SF	6	4	N/A NON FRIABLE	REPAIR	CHIPPED
		9X9 FLOOR TILE & MASTIC GREEN		324 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	LIFTING, CRACKED & CHIPPED; CONF ACM ECL JOB #18040
		COVE BASE & MASTIC BLACK		72 LF	20 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATIONING & MISSING W/ MASTIC EXPOSED
1051	ROOM 209	9X9 FLOOR TILE GREY		810 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING W/ MASTIC EXPOSED; CONF ACM ECL JOB #18040
1052	ROOM 212	2X4 WALL TILE FISSURE		28 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY (PREVIOUSLY CHIPPED)
		9X9 FLOOR TILE & MASTIC GREEN		700 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED- SOME PATCHED; CONF ACM (ECL JOB #18040)
		COVE BASE & MASTIC BLACK		100 LF	2 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATION MASTIC EXPOSED
1053	ROOM 211	9X9 FLOOR TILE & MASTIC GREY		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	UNDER 12X12 FLOOR TILE - CHIPPED AND EXPOSED
1054	MEN'S BATHROOM NEXT TO ROOM 212	12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ 9X9 EXPOSED
		CEILING PLASTER TEXTURED		230 SF	< 1 SF	3	N/A NON FRIABLE	REPAIR	WATER DAMAGE
		CERAMIC WALL TILE GROUT & GLUE WHITE		586 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1056	WOMEN'S BATHROOM NEAR 211	CEILING PLASTER TEXTURED		230 SF	5 SF	4	N/A NON FRIABLE	REPAIR	PAINT PEELING
1057	ROOM 213	12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED 9X9 TILE UNDERNEATH
1057CP	ROOM 213 CEILING PLENUM	GYPSUM BOARD		56 SF	< 1SF	3	4	REPAIR	MINOR DAMAGE
1058	ROOM 214	12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	4	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		COVE BASE & MASTIC BLACK		111 LF	11 LF	4	N/A NON FRIABLE	REPAIR	MISSING MASTIC EXPOSED

Half Hollow Hills CSD
Half Hollow Hills High School East and Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1058CP	Room 214 CEILING PLENUM	GYPSUM BOARD		56 SF	< 1 SF	3	4	REPAIR	MINOR DAMAGE
1059CP	Room 215 CEILING PLENUM	GYPSUM BOARD		56 SF	< 1 SF	3	4	REPAIR	MINOR DAMAGE
1060CP	Room 216 CEILING PLENUM	ROOF TAR		N/A	< 1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1061	Room 217	9X9 FLOOR TILE GREY		810 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED - SOME PATCHED; CONF ACM ECL JOB #18040
1062	Room 218	12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	4 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
1062CP	Room 218 CEILING PLENUM	ROOF TAR		N/A	< 1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1064	Room 208	COVE BASE & MASTIC BLACK		121 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING MASTIC EXPOSED
1065	Room 207	9X9 FLOOR TILE GREY		810 SF	10	4	N/A NON FRIABLE	REPAIR	CRACKED CHIPPED MASTIC EXPOSED; CONF ACM ECL JOB #18040
1066	Room 206/ENGLISH OFFICE	9X9 FLOOR TILE GREY		476 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED, LOOSE & LIFTED; CONF ACM ECL JOB #18040
		COVE BASE & MASTIC BLACK		87 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	
1067CP	Room 205 CEILING PLENUM	GYPSUM BOARD		56 SF	< 1 SF	3	4	REPAIR	MINOR DAMAGE
		ROOF TAR		N/A	<1 SF	4	N/A NON FRIABLE	REPAIR	
1068	Room 204	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		960 SF	14 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED W/ MASTIC EXPOSED
1069	Room 203	9X9 FLOOR TILE GREY		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED CHIPPED MASTIC EXPOSED; CONF ACM ECL JOB #18040
1069CP	Room 203 CEILING PLENUM	GYPSUM BOARD		56 SF	< 1 SF	3	4	REPAIR	MINOR DAMAGE
1070	Room 201	12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	WORN AND MISSING MASTIC EXPOSED - 9X9S UNDERNEATH

Half Hollow Hills CSD
Half Hollow Hills High School East and Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1071CP	CORRIDOR ROOMS 201 - 208 CEILING PLENUM	MUD JOINT PACKING		38 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1072CP	ROOM 111 CEILING PLENUM	MUD JOINT PACKING		2 UNITS	1	3	1	REPAIR	MINOR DAMAGE
1078CP	CORRIDOR FROM ROOM 101 TO ROOM 111 CEILING PLENUM	MUD JOINT PACKING		66 UNITS	2	3	1	REPAIR	MINOR DAMAGE
1079	EAST OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		640 SF	9 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED CHIPPED MASTIC EXPOSED; 9X9 EXPOSED UNDERNEATH
1079A	EAST OFFICE COPY ROOM	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		90 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
1079D	EAST OFFICE SECURITY	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		64 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
1079E	EAST OFFICE SUPPLY STORAGE	JOINT COMPOUND		45 SF	7 SF	4	4	REPAIR	MISSING DRY WALL EXPOSED EDGES, CONF ACM JCB# 17-36668
1079F	EAST OFFICE ASST. PRINCIPAL OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		90 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
1080	WOMEN'S FACULTY BATHROOM NEAR EAST OFFICE (NOW GENDER NEUTRAL LEFT)	CERAMIC WALL TILE GROUT & GLUE PINK		130 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ GLUE EXPOSED
1081	MEN'S FACULTY BATHROOM NEAR EAST OFFICE (NOW GNERER NEUTRAL RIGHT)	CERAMIC WALL TILE GROUT & GLUE GREEN		130 SF	9 TILES	4	N/A NON FRIABLE	REPAIR	MISSING TILES W/ GLUE EXPOSED
1082	ASSISTANT PRINCIPAL'S OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		350 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED & WORN W/ MASTIC EXPOSED
1082B	ASSISTANT PRINCIPAL'S CLOSET	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		15 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
1083	READING CENTER 551	9X9 FLOOR TILE & MASTIC GREEN		525 SF	13 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED W/ MASTIC EXPOSED - SOME PATCHED; CONF ACM ECL JOB # 18040
		COVE BASE & MASTIC BLACK		88 LF	9 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED

Half Hollow Hills CSD
Half Hollow Hills High School East and Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1084A	EAST HEALTH OFFICE BATHROOM	CERAMIC WALL TILE GROUT & GLUE BLUE		160 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED/ SOME PATCHED
1084F	EAST HEALTH OFFICE SUPPLY CLOSET	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		66 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	LIFTING
		JOINT COMPOUND		66 SF	< 1 SF	3	4	REPAIR	PATCHED; CONF AGM JCB#17-36668
1088CP	WOMEN'S BATHROOM NEAR LECTURE HALL CEILING PLENUM	MUD JOINT PACKING		1 UNIT	1	3	1	REPAIR	MINOR DAMAGE
1090	CORRIDOR LECTURE HALL - EAST OFFICE	WALL PATCH MATERIAL		14 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
1091	LIBRARY	12X12 FLOOR TILE & MASTIC BEIGE		2340 SF	15 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		COVE BASE & MASTIC BLACK		186 LF	60 LF	4	N/A NON FRIABLE	REPAIR	MISSING, DELAMINATING W/ MASTIC EXPOSED, SOME ENCAPSULATED IN PAINT ¹
1091ACP	LIBRARY REFERENCE ROOM CEILING PLENUM	GYPSUM BOARD		40 SF	< 1 SF	3	4	REPAIR	WATER STAINED
1091A1	LIBRARY REFERENCE ROOM SERVER ROOM	9X9 FLOOR TILE & MASTIC PINK		198 SF	13 TILES	4	N/A NON FRIABLE	REPAIR	MISSING CRACKED ANDNNMASTIC EXPOSED
		COVE BASE & MASTIC BROWN		59 LF	10 LF	4	N/A NON FRIABLE	REPAIR	MISSING
1091B	LIBRARY COMP ROOM 102	COVE BASE & MASTIC BROWN		108 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1091C	LIBRARY OFFICE	COVE BASE & MASTIC BROWN		19 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1091E	LIBRARY STAFF ROOM	9X9 FLOOR TILE & MASTIC PINK		360 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1091E1	LIBRARY STORAGE	9X9 FLOOR TILE & MASTIC PINK		120 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
1092CP	NORTH CORRIDOR MAIN GYM CEILING PLENUM	MUD JOINT PACKING		2 UNITS	1	3	1	REPAIR	MINOR DAMAGE
1100B	ELEVATOR	12X12 FLOOR TILE & MASTIC WHITE/MULTICOLOR		30 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	WORN.

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1103	GIRL'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREY		228 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED.
		CERAMIC WALL TILE GROUT & GLUE WHITE		531 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	NEW MATERIAL. CRACKED AND CHIPPED
1105	MENS ROOM NEAR WEST GYM	CERAMIC FLOOR TILE GROUT & GLUE GREY		180 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED
		CERAMIC WALL TILE GROUT & GLUE WHITE		460 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED.
1106CP	AUDITORIUM STAIRWELL NORTH CEILING PLENUM	GYPSUM BOARD & COMPOUND		176 SF	<1 SF	3	4	REPAIR	CHIPPED
1108/0052	BASEMENT STAIRWELL	COVE BASE & MASTIC BROWN		19 LF	6 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED
		CEMENTITIOUS WALL PLASTER		162 SF	20 SF	4	N/A NON FRIABLE	REPAIR	WATER DAMAGED
1110	FACULTY MEN'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BLUE		36 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	MISSING AND CHIPPED.
		CERAMIC WALL TILE GROUT & GLUE WHITE		186 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED.
1111	FACULTY WOMEN'S BATHROOM	CERAMIC WALL TILE GROUT & GLUE PINK		189 SF	5 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ GLUE EXPOSED
1113	ROOM 605	9X9 FLOOR TILE & MASTIC		NOT QUANTIFIED	3 TILES	4	N/A NON FRIABLE	REPAIR	UNDER 12X12 FLOOR TILE - CONFIRMED ACM (ECI JOB #21149)
1113A	ROOM 605 OFFICE	9X9 FLOOR TILE & MASTIC		NOT QUANTIFIED	1 TILE	4	N/A NON FRIABLE	REPAIR	EXPOSED UNDER 12X12 FLOOR TILE - CONFIRMED ACM (ECI JOB #21149)
1114	CORRIDOR CLOSET 1	12X12 FLOOR TILE MASTIC		18 SF	18 SF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED
1120	ROOM 607	GYPSUM BOARD & COMPOUND		260 SF	2 SF	3	4	REPAIR	DENTED AND CHIPPED.
		PEGBOARD		260 SF	20 LF	4	N/A NON FRIABLE	REPAIR	SCRAPED
1121	ROOM 609 BAND ROOM	GYPSUM BOARD & COMPOUND		260 SF	<1 SF	3	4	REPAIR	DENTED
		CEILING GYPSUM BOARD		1419 SF	3 SF	3	4	REPAIR	DENTED.

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1125	ROOM 611/613/615	12X12 FLOOR TILE & MASTIC PEACH		656 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED WITH MASTIC EXPOSED.
		COVE BASE & MASTIC BLACK		105 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		GYPSUM BOARD & COMPOUND		915 SF	1 SF	3	4	REPAIR	MINOR DAMAGE
1126ACP	601 TO MARCHING BAND STORAGE CORRIDOR CEILING PLENUM	MUD JOINT PACKING		60 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1127B	WEST CATWALK 2	TRANSITE BOARD		40 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	NO ACCESS (PREVIOUSLY DAMAGED)
1128	AUDITORIUM	CARPET MASTIC		890 SF	4 LF	4	N/A NON FRIABLE	REPAIR	PEELED BACK.
1129	WEST MAIN GYM	COVE BASE & MASTIC BROWN		428 LF	20 LF	4	N/A NON FRIABLE	REPAIR	MISSING, DENTED WITH MASTIC EXPOSED.
1129A	WEST MAIN GYM EQUIPMENT STORAGE	COVE BASE & MASTIC BLACK		47 LF	14 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		CEILING GYPSUM BOARD & COMPOUND		290 SF	4 SF	3	4	REPAIR	MISCELLANEOUSLY DENTED
1129B	WEST MAIN GYM TRAINER'S ROOM	COVE BASE & MASTIC BLACK		65 LF	2 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		JOINT COMPOUND		290 SF	8 LF	3	4	REPAIR	WATER DAMAGE; CONF ACM JCB# 17-36668
1131	MAIN OFFICE	12X12 FLOOR TILE & MASTIC LIGHT BROWN		800 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1131B	MAIN OFFICE COPY ROOM	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		90 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	LIFTING; CONF ACM ENVIROSCIENCE# 18040
		COVE BASE & MASTIC BLACK		32 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
1131D	MAIN OFFICE BREAK ROOM	COVE BASE & MASTIC BLACK		69 LF	6 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1136	STAIRWELL NEAR CONFERENCE ROOM	GLAZED BLOCK MORTAR		2044 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1138	CUSTODIAL CLOSET	CERAMIC WALL BASE GROUT & GLUE GREY		19 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
1139CP	WEST HEALTH OFFICE CEILING PLENUM	MUD JOINT PACKING		8 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE

Half Hollow Hills CSD
Half Hollow Hills High School East and Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1139B	WEST HEALTH OFFICE SICK ROOM 2	COVE BASE & MASTIC BLACK		22 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
1140	FACULTY MEN'S ROOM NEAR WEST HEALTH OFFICE	CERAMIC WALL TILE GROUT & GLUE GREEN		442 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED TILES
1141	GUIDANCE OFFICE	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		956 SF	52 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		COVE BASE & MASTIC BLACK		88 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING MASTIC EXPOSED
1141A	GUIDANCE COUNSELOR OFFICE 1	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		100 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
1141ACP	GUIDANCE COUNSELOR OFFICE 1 CEILING PLENUM	GYPSUM BOARD		10 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
1141B	GUIDANCE COUNSELOR OFFICE 2	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		130 SF	12 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		INDUSTRIAL WALL PAPER		234 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	WATER STAINED
1141C	GUIDANCE COUNSELOR OFFICE 3	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		80 SF	15 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		INDUSTRIAL WALL PAPER		72 SF	4 SF	4	N/A NON FRIABLE	REPAIR	WATER STAINED
1141CCP	GUIDANCE COUNSELOR OFFICE 3 CEILING PLENUM	MUD JOINT PACKING		9 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1141E	GUIDANCE COUNSELOR OFFICE 4	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		80 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
1141ECP	GUIDANCE COUNSELOR OFFICE 4 CEILING PLENUM	MUD JOINT PACKING		6 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1141F	GUIDANCE COUNSELOR OFFICE 5	12X12 FLOOR TILE & MASTIC MAROON		80 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1141G	GUIDANCE COUNSELOR OFFICE 6	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		80 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
1141H	GUIDANCE COUNSELOR OFFICE 7	INDUSTRIAL WALL PAPER		40 SF	5 SF	4	N/A NON FRIABLE	REPAIR	WATER STAINED & PEELING
1141I	GUIDANCE COUNSELOR OFFICE 8	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		120 SF	12 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		INDUSTRIAL WALL PAPER		140 SF	1 SF	4	N/A NON FRIABLE	REPAIR	WATER STAINED
1141J	GUIDANCE COUNSELOR OFFICE 9	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		80 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
1141JCP	GUIDANCE COUNSELOR OFFICE 9 CEILING PLENUM	MUD JOINT PACKING		2 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1141K	GUIDANCE COUNSELOR OFFICE 10	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		80 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		COVE BASE & MASTIC BLACK		18 LF	10 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1141KCP	GUIDANCE COUNSELOR OFFICE 10 CEILING PLENUM	MUD JOINT PACKING		2 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1142CP	CORRIDOR MAIN OFFICE GUIDANCE OFFICE CEILING PLENUM	MUD JOINT PACKING		31 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE; 24 UNITS ABATED ENVIROSCIENCE#20417
1144	STAIRWELL NEAR ROOM 918	GLAZED BLOCK MORTAR		1250 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE w PURPOSEFUL HOLE
1145	ROOM 917	9X9 FLOOR TILE & MASTIC GREY		810 SF	70 TILES	4	N/A NON FRIABLE	REPAIR	CRACKS DUE TO CUPPING
1146	ROOM 918	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	67 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED w/ MASTIC EXPOSED & CRACKS DUE TO CUPPING ; CONF ACM
		COVE BASE & MASTIC BROWN		111 LF	14 LF	4	N/A NON FRIABLE	REPAIR	ENVIROSCIENCE#18040 MASTIC EXPOSED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1146A	ROOM 918 STORAGE	COVE BASE & MASTIC BROWN		43 LF	2 LF	4	N/A NON FRIABLE	REPAIR	MISSING
1146ACP	ROOM 918 STORAGE CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1147	GIRL'S BATHROOM NEAR ROOM 918	CERAMIC WALL TILE GROUT & GLUE PINK		687 SF	30 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
1148	CUSTODIAL CLOSET NEAR ROOM 916	CERAMIC WALL BASE GROUT & GLUE OFF WHITE		33 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY - CRACKED, CHIPPED & MISSING TILES
1149	BOY'S BATHROOM NEAR ROOM 916	CERAMIC WALL TILE GROUT & GLUE GREEN		687 SF	24 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
1150	ROOM 916	9X9 FLOOR TILE & MASTIC LIGHT GREEN		810 SF	810 SF	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED W/ MASTIC EXPOSED DUE TO CUPPING. ALL TILES IMPACTED
		COVE BASE & MASTIC BROWN		111 LF	15 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1151	ROOM 915	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		480 SF	380 SF	1	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED W/ MASTIC EXPOSED DUE TO CUPPING; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		49 LF	22 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING COVE BASE W/ MASTIC EXPOSED
1152	ROOM 914	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	600 SF	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED TILES W/ MASTIC EXPOSED DUE TO CUPPING ; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		81 LF	9 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING W/ MASTIC EXPOSED
1154	ROOM 913	9X9 FLOOR TILE & MASTIC LIGHT GREEN		810 SF	240 SF	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED DUE TO CUPPING; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BLACK		111 LF	60 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING, MISSING, & PAINTED OVER

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1155	ROOM 912	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	400 SF	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED WITH MASTIC EXPOSED DUE TO CUPPING; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		81 LF	20 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING, MISSING WITH MASTIC EXPOSED.
1156	ROOM 910	9X9 FLOOR TILE & MASTIC GREY		810 SF	600 SF	1	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED WITH MASTIC EXPOSED DUE TO CUPPING;
		COVE BASE & MASTIC BLACK		111 LF	40 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1156A	ROOM 910 STORAGE	9X9 FLOOR TILE & MASTIC PINK		120 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED; CONF ACM ENVIROSCIENCE#18040
1156ACP	ROOM 910 STORAGE CEILING PLENUM	ROOF TAR		N/A	< 1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1157	ROOM 911	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	500 SF	1	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED WITH MASTIC EXPOSED DUE TO CUPPING; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		111 LF	26 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING AND MISSING W/ MASTIC EXPOSED
1160CP	CHIEF CUSTODIAN'S OFFICE CEILING PLENUM	MUD JOINT PACKING		11 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1161	STAIRWELL NEAR ROOM 713	GLAZED BLOCK MORTAR		650 SF	1 SF	4	N/A NON FRIABLE	REPAIR	HOLES
1164	ROOM 717	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	400 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED WITH MASTIC EXPOSED DUE TO CUPPING; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		111 LF	6 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1166	FACULTY WOMEN'S BATHROOM NEAR ROOM 719	CERAMIC WALL TILE GROUT & GLUE BEIGE		490 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED/ GROUT MISSING
1169CP	ROOM 711 CEILING PLENUM	GYPSUM BOARD		90 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE

Haft Hollow Hills CSD
Haft Hollow Hills High School East and Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1170	MEN'S FACULTY BATHROOM NEAR ROOM 711	CERAMIC WALL TILE GROUT & GLUE GREEN		442 SF	14 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
1171	CUSTODIAL CLOSET NEAR ROOM 711	CERAMIC WALL BASE GROUT & GLUE WHITE		37 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED.
1172	STUDENT CENTER	GYPSUM BOARD & COMPOUND		830 SF	< 1 SF	3	4	REPAIR	DENTED
1172B	STUDENT CENTER FISH BOWL	GYPSUM BOARD & COMPOUND		450 SF	< 1 SF	3	4	REPAIR	CHIPPED AND BULGING.
1173	ROOM 709	9X9 FLOOR TILE & MASTIC CREAM/BROWN		1200 SF	35 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED W/ MASTIC EXPOSED; CONF ACM ENVIROSCIENCE#18040
1174	ROOM 708	COVE BASE & MASTIC BLACK		107 LF	2 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1175	ROOM 707	12X12 FLOOR TILE & MASTIC GREY WATERCOLOR		1200 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED WITH MASTIC EXPOSED
1176CP	ROOM 705 CEILING PLENUM	MUD JOINT PACKING		7 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1177	CORRIDOR ROOMS 705- 715	GLAZED BLOCK MORTAR		1390 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED.
1177CP	CORRIDOR ROOMS 705- 715 CEILING PLENUM	MUD JOINT PACKING		34 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1180	ROOM 703	FIRE DOOR INSULATION WOOD		1 DOOR	3 LF	3	4	REPAIR	PEELING
1183	CORRIDOR BUSINESS ED STORAGE ROOM 701	GLAZED BLOCK MORTAR		1000 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED.
		WINDOW GLAZING/CAULKING		150 LF	3 LF	4	N/A NON FRIABLE	REPAIR	DENTED; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	3 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED; CONF ACM ENVIROSCIENCE#17592
1184CP	STORAGE 7B CEILING PLENUM	FIRE BRICK & MORTAR		10 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1186	ROOM 821	12X12 FLOOR TILE & MASTIC BROWN		118 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		12X12 FLOOR TILE & MASTIC MOCHA		118 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		118 SF	3 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
1187	ROOM 820	12X12 FLOOR TILE & MASTIC BEIGE		75 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED
		12X12 FLOOR TILE & MASTIC BROWN		75 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED
		12X12 FLOOR TILE & MASTIC MOCHA		75 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		75 SF	17 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED
1188	ROOM 819	12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		300 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED & MISSING W/ MASTIC EXPOSED
1189	ROOM 818	12X12 FLOOR TILE & MASTIC BLUE		900 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		300 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
1192	CORRIDOR STORAGE 7B-ROOM 815	GLAZED BLOCK MORTAR		1100 SF	<1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED.
1193	ROOM 812	12X12 FLOOR TILE MASTIC		1000 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED & DENTED
		COVE BASE & MASTIC BLACK		124 LF	6 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		9X9 FLOOR TILE & MASTIC BEIGE/BROWN		128 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED; CONF ACM ENVIROSCIENCE#18040
1193A	ROOM 812 OFFICE	COVE BASE & MASTIC BROWN		37 LF	26 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
1193ACP	ROOM 812 OFFICE CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1194	ROOM 825	COVE BASE & MASTIC BLACK		144 LF	2 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1194CP	Room 825 Ceiling Plenum	MUD JOINT PACKING		2 UNITS	NOT QUANTIFIED	3	1	REPAIR	DUCT TAPED
1194A	Room 825 Closet	WALL/CHALK-BOARD MASTIC		5 SF	1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1195	Room 823	12X12 FLOOR TILE & MASTIC PEACH		1000 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED WITH MASTIC EXPOSED.
1195A	Room 823 Closet	GYPSUM BOARD & COMPOUND		270 SF	<1 SF	3	4	REPAIR	CHIPPED.
1197	STORAGE ACROSS FROM CAFÉ A (PREVIOUSLY FENCING STORAGE)	CERAMIC WALL BASE GROUT & GLUE OFF WHITE		38 SF	1 TILE	3	4	REPAIR	CHIPPED
		FIRE DOOR INSULATION WOOD		1 DOOR	2 SF	3	4	REPAIR	PEELING
1197A	STORAGE 2 ACROSS FROM CAFÉ A (PREVIOUSLY FENCING STORAGE 2)	CERAMIC WALL TILE GROUT & GLUE BEIGE		436 SF	1 TILE	3	4	REPAIR	CHIPPED
1198	WOMEN'S FACULTY BATHROOM NEAR CAFETERIA	CERAMIC WALL TILE GROUT & GLUE BEIGE		43 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
1200	CUSTODIAL CLOSET NEAR CAFETERIA	CERAMIC WALL BASE GROUT & GLUE OFF WHITE		24 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED.
1201	MEN'S FACULTY BATHROOM NEAR CAFETERIA	CERAMIC WALL TILE GROUT & GLUE WHITE		288 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED.
1201CP	MEN'S FACULTY BATHROOM NEAR CAFETERIA CEILING PLENUM	MUD JOINT PACKING		11 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1203	FACULTY DINING ROOM	METAL SINK UNDERCOATING BLACK		1 UNIT	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED.
1204	KITCHEN	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		2219 SF	35 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED AND MISSING
		CERAMIC WALL BASE GROUT & GLUE TAN		250 SF	23 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED AND MISSING
1204B	KITCHEN STORAGE	CERAMIC WALL BASE GROUT & GLUE OFF WHITE		N/A	NOT QUANTIFIED	3	4	REPAIR	GOOD CONDITION

Half Hollow Hills CSD
Half Hollow Hills High School East and Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1204C	KITCHEN WASH-BIN ROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		49 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
1204E	KITCHEN BREAK ROOM	CERAMIC FLOOR TILE GROUT & GLUE BEIGE & RED		120 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
1205CP	CAFETERIA B CEILING PLENUM	ROOF TAR		N/A	<1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1207	CORRIDOR CAFETERIA B TO ROOM 705	GLAZED BLOCK MORTAR		640 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	HOLES.
2006CP	ELECTRONIC STORAGE CLOSET CEILING PLENUM	ROOF TAR		N/A	<1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
2009	STAIRWELL ADJ. TO ROOM 745	GLAZED BLOCK MORTAR		192 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	HOLE.
2011	ASSISTANT PRINCIPAL OFFICE	COVE BASE & MASTIC BROWN		23 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
2011A	ASSISTANT PRINCIPAL BREAK ROOM	COVE BASE & MASTIC BROWN		27 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
2011B	ASSISTANT PRINCIPAL SECRETARY AREA	9X9 FLOOR TILE & MASTIC BEIGE/BROWN COVE BASE & MASTIC BROWN		170 SF 46 LF	2 TILES 2 LF	4 4	N/A NON FRIABLE N/A NON FRIABLE	REPAIR REPAIR	CRACKED; CONF ACM ENVIROSCIENCE#18040 DELAMINATING
2012	ROOM 743	9X9 FLOOR TILE & MASTIC CREAM/BROWN COVE BASE & MASTIC BROWN		1176 SF 290 LF	6 TILES 24 LF	4 4	N/A NON FRIABLE N/A NON FRIABLE	REPAIR REPAIR	CHIPPED, CRACKED WITH MASTIC EXPOSED; CONF ACM ENVIROSCIENCE#18040 DELAMINATING
2012A	ROOM 743 & 741 PREP	COVE BASE & MASTIC BROWN		52 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
2012A1	ROOM 743 & 741 STORAGE CLOSET	9X9 FLOOR TILE & MASTIC CREAM/BROWN COVE BASE & MASTIC BROWN		80 SF 33 LF	4 TILES 4 LF	4 4	N/A NON FRIABLE N/A NON FRIABLE	REPAIR REPAIR	POPPING & MISSING TILES; CONF ACM ENVIROSCIENCE#18040 DELAMINATING & MISSING W/ MASTIC EXPOSED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2013	ROOM 741	9X9 FLOOR TILE & MASTIC CREAM/BROWN		1036 SF	9 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, MISSING WITH MASTIC EXPOSED; CONF ACM ENVIROSCIENCE# 18040
		COVE BASE & MASTIC BROWN		121 LF	2 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		LABORATORY TABLE TOPS		224 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
2014	CORRIDOR ROOM 741 TO FACULTY COPY ROOM	GLAZED BLOCK MORTAR		704 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED.
2014CP	CORRIDOR ROOM 741 TO FACULTY COPY ROOM CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
2019	GIRLS BATHROOM	CERAMIC WALL TILE GROUT & GLUE PINK		395 SF	30 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED.
		FIRE DOOR INSULATION WOOD		1 DOOR	<1 SF	3	4	REPAIR	PEELING
2020	ROOM 735	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		1344 SF	37 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED CRACKED, LOOSE WITH MASTIC EXPOSED AND 9X9 FLOOR TILE EXPOSED.
		COVE BASE & MASTIC BLACK		248 LF	4 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		GYPSUM BOARD & COMPOUND		232 SF	<1 SF	3	4	REPAIR	DENTED
		LABORATORY TABLE TOPS		224 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
2020A	ROOM 735 STORAGE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		96 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED CRACKED WITH MASTIC EXPOSED
2020A1	ROOM 735 OFFICE	COVE BASE & MASTIC BLACK		31 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		196 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED WITH MASTIC EXPOSED.
2020B	ROOM 735 PREP ROOM	COVE BASE & MASTIC BLACK		62 LF	2 LF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
		GYPSUM BOARD & COMPOUND		232 SF	<1 SF	3	4	REPAIR	DENTED & HOLE

Summary of Damaged Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2021CP	CORRIDOR STORAGE CLOSET TO ROOM 735 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
2023	ROOM 733	WALL/CHALK-BOARD MASTIC		120 SF	4 SF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED AND PAINTED OVER.
2024	BOY'S BATHROOM	CERAMIC WALL TILE GROUT & GLUE GREEN		480 SF	17 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		FIRE DOOR INSULATION WOOD		1 DOOR	<1 SF	3	4	REPAIR	HOLES.
2025	CUSTODIAL CLOSET	CERAMIC WALL BASE GROUT & GLUE OFF WHITE		21 SF	12 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED.
		FIRE DOOR INSULATION WOOD		1 DOOR	<1 SF	3	4	REPAIR	PEELING
2028	ROOM 730	CEILING GYPSUM BOARD & COMPOUND		150 SF	5 LF	3	4	REPAIR	CRACKED & JOINT COMPOUND IS SPLITTING
2029	ROOM 731	WALL/CHALK-BOARD MASTIC		120 SF	4 SF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED AND PAINTED OVER
2032	ROOM 728	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		230 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED; CONF ACM ENVIROSCIENCE#18040
2033	ROOM 729	12X12 FLOOR TILE & MASTIC WHITE/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED
		COVE BASE & MASTIC BLACK		108 LF	7 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING
2033A	ROOM 729 PREP A	9X9 FLOOR TILE & MASTIC LIGHT GREEN		300 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		41 LF	4 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
2034	ROOM 727	COVE BASE & MASTIC BLACK		178 LF	10 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		LABORATORY TABLE TOPS		225 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
2035CP	CORRIDOR ROOM 727 - 733 CEILING PLENUM	FIRE BRICK & MORTAR		6 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2036	ROOM 725	12X12 FLOOR TILE & MASTIC GREEN		1050 SF	11 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		360 SF	36 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC WHITE		153 LF	6 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED
2038	ROOM 723	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED - SOME PATCHED; CONF ACM ENVIROSCIENCE# 18040
		COVE BASE & MASTIC BROWN		111 LF	6 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		WALL/CHALK-BOARD MASTIC		100 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
2040	MEN'S FACULTY BATH NEAR ROOM 721	CERAMIC WALL TILE GROUT & GLUE WHITE		334 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	NEW MATERIAL OBSERVED. CRACKED
2044	CUSTODIAL CLOSET	CEILING GYPSUM BOARD & COMPOUND		126 SF	44 SF	3	4	REPAIR	WATER STAINED AND MISSING.
2047	FAN ROOM	VIBRATION REDUCER CLOTH WHITE		25 UNITS	8 UNITS	4	N/A NON FRIABLE	REPAIR	TORN
		VIBRATION REDUCER CLOTH GREEN		4 UNITS	2 UNITS	4	N/A NON FRIABLE	REPAIR	TORN
		DUCT INSULATION CLOTH		2100 SF	4 LF	4	N/A NON FRIABLE	REPAIR	TORN
2048	BALCONY	STAIR TREAD MASTIC		550 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
		CEMENTITIOUS WALL PLASTER		1300 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	DENTED
		GYPSUM BOARD & COMPOUND		75 SF	<1 SF	3	4	REPAIR	DENTED
		PEGBORD		576 SF	5 SF	4	N/A NON FRIABLE	REPAIR	BULGING.

Appendix B

INVENTORY OF ASBESTOS CONTAINING MATERIALS

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
001	WATER TANK STORAGE	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION METAL		3 DOORS	0	6	5	O&M	GOOD CONDITION
		VIBRATION REDUCER CLOTH GREEN		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		35 UNITS	0	6	5	O&M	CONF ACM ORIGINAL AMP; PARTIAL REMOVAL (ECL JOB #23078)
		HOT WATER TANK INSULATION		0					REMOVED DEC 2022 (ECL JOB #23078)
001A1	WATER TANK STORAGE PHONE ROOM STORAGE	9X9 FLOOR TILE & MASTIC MAROON		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		28 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD		70 SF	< 1 SF	3	4	REPAIR	MINOR DAMAGE
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
001A	WATER TANK STORAGE PHONE ROOM	9X9 FLOOR TILE & MASTIC MAROON		120 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
		COVE BASE & MASTIC BLACK		35 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD		70 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		PIPE INSULATION		1 LF	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
002	BASEMENT BOY'S LOCKER ROOM EXIT VESTIBULE	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		325 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		6 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14-28692 TEM
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
002CP	BASEMENT BOY'S LOCKER ROOM EXIT VESTIBULE CEILING PLENUM	MUD JOINT PACKING		12 UNITS	0	6	5	O&M	GOOD CONDITION
003	BOY'S LOCKER ROOM	CERAMIC FLOOR TILE GROUT & GLUE BLUE		2795 SF	9 SF	4	N/A NON FRIABLE	REPAIR	MISSING AND CHIPPED
		CERAMIC WALL BASE GROUT & GLUE GREY		463 SF	30 LF	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED WITH MASTIC EXPOSED
		CERAMIC WALL TILE GROUT & GLUE GREY		1412 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING (ABOVE PLASTER)		5 UNITS	0	6	5	O&M	CONF ACM ORIGINAL AMP
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
003A	BOYS LOCKER COACH OFFICE	9X9 FLOOR TILE GREY		0					REMOVED JULY 2022 ECL JOB #22536
		9X9 FLOOR TILE MASTIC		0					CONFIRMED NON-ACM (ECL JOB #18040)
		12X12 FLOOR TILE & MASTIC GREY PEBBLED		0					REMOVED JULY 2022 ECL JOB #22536
		COVE BASE & MASTIC BROWN		0					RENOVATED JULY 2022
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14- 28692 TEM
003ACP	BOYS LOCKER COACH OFFICE CEILING PLENUM	MUD JOINT PACKING		18 UNITS	0	6	5	O&M	GOOD CONDITION
		FIRE BRICK & MORTAR		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
003A1	BOYS LOCKER COACH OFFICE BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BLUE		70 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE BLUE		314 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND HOLES W/ GLUE EXPOSED
		MIRROR MASTIC		6 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
003B	BOYS LOCKER EQUIPMENT ROOM	FIRE DOOR INSULATION WOOD		1 DOOR	<1 SF	3	4	REPAIR	PEELING
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14- 28692 TEM
003BCP	BOYS LOCKER EQUIPMENT ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
004	CUSTODIAL CLOSET	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	4 SF	3	4	REPAIR	PEELING
		CEILING GYPSUM BOARD & COMPOUND		80 SF	< 1 SF	3	4	REPAIR	CHIPPED
005	LACROSSE STORAGE ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE		0					NON ACM JCB#14-28692 TEM
005A	LACROSSE INNER STORAGE ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD		300 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE BRICK & MORTAR		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
005CP	LACROSSE STORAGE ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
006	WRESTLING STORAGE ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	< 1 SF	3	4	REPAIR	PEELING.
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
006CP	WRESTLING STORAGE ROOM CEILING PLENUM	MUD JOINT PACKING		17 UNITS	0	6	5	O&M	GOOD CONDITION; CONF ACM ORIGINAL AMP
		FIRE BRICK & MORTAR		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
007	UNIFORM ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
007CP	UNIFORM ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
008	TRAINING ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	<1 SF	3	4	REPAIR	PEELING.
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
009	LACROSSE COACH OFFICE	CERAMIC FLOOR TILE GROUT & GLUE BLUE		190 SF	3 SF	4	N/A NON FRIABLE	REPAIR	CRACKED
		CERAMIC WALL BASE GROUT & GLUE BLUE		50 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND MISSING
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
009A	LACROSSE COACH OFFICE BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BLUE		63 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE BLUE		288 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
010	TEAM LOCKER ROOM	CERAMIC FLOOR TILE GROUT & GLUE BLUE		1650 SF	1 SF	4	N/A NON FRIABLE	REPAIR	MISSING AND CHIPPED SECTIONS ARE PATCHED
		CERAMIC WALL BASE GROUT & GLUE BLUE		315 SF	18 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED SECTIONS ARE PATCHED
		CERAMIC WALL TILE GROUT & GLUE BLUE		805 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED SECTIONS ARE PATCHED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL PLASTER		0					CONFIRMED NON-ACM (ECL JOB #17185)
		WALL/CHALK-BOARD MASTIC		6 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER TEXTURED		0					CONFIRMED NON-ACM (ECL JOB #17185)
011	CORRIDOR BOY'S LOCKER ROOM TO LACROSSE COACH OFFICE	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		COVE BASE & MASTIC BLACK		19 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
012	MAINTENANCE LOCKER ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		171 SF	<1 SF	3	4	REPAIR	HOLES
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
012CP	MAINTENANCE LOCKER ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
013	MAINTENANCE STORAGE AREA	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		1560 SF	3 SF	3	4	REPAIR	CHIPPED.
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION (STORED)
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION (STORED)
		VIBRATION REDUCER CLOTH GREEN		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		19 UNITS	0	6	5	O&M	GOOD CONDITION; CONF ACM ORIGINAL AMP
014	HEATER & FREEZER SHOP	2X2 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD		520 SF	1 SF	3	4	REPAIR	CHIPPED.
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
015	WOOD SHOP	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		500 SF	0	6	5	O&M	GOOD CONDITION.
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION.
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION; ACM ORIGINAL AMP
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
016	PLUMBING DEPT.	GYPSUM BOARD & COMPOUND		870 SF	0	6	5	O&M	COMBINED W/ SPACE 013
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		MUD JOINT PACKING		19 UNITS	0	6	5	O&M	COMBINED W/ SPACE 013; CONF ACM ORIGINAL AMP; PARTIAL ABATEMENT (ECL JOB #23078)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
017	ALARM SHOP	GYPSUM BOARD		700 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
018	LIGHTING AND WIRING ROOM	GYPSUM BOARD		700 SF	NOT QUANTIFIED	3	4	REPAIR	NO ACCESS (PREVIOUSLY MINOR DAMAGE)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
019	ELECTRICIAN ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD		720 SF	NOT QUANTIFIED	3	4	REPAIR	NO ACCESS (PREVIOUSLY MINOR DAMAGE)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
020	SHIPPING & RECEIVING AREA	GYPSUM BOARD & COMPOUND		99 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		VIBRATION REDUCER CLOTH GREEN		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		19 UNITS	0	6	5	O&M	CONF ACM ORIGINAL AMP; PARTIAL ABATEMENT (ECL JOB #23078)
021	RECORDS MANAGEMENT ADMINISTRATION DEPT.	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		1120 SF	< 1 SF	3	4	REPAIR	HOLES
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		33 UNITS	0	6	5	O&M	MAJORITY WRAPPED IN DUCT TAPE: CONF ACM ORIGINAL AMP

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
021A	BLUEPRINTS ARCHIVE ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		520 SF	<1 SF	3	4	REPAIR	HOLE
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
022	CORRIDOR PIPE TUNNEL STORAGE TO WRESTLING ROOM	12X12 FLOOR TILE & MASTIC WHITE WITH SPECKLES		678 SF	20 TILES	4	N/A NON FRIABLE	REPAIR	TAPED TILES AND CRACKED SECTIONS ARE PATCHED
		COVE BASE & MASTIC BLACK		208 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
022CP	CORRIDOR PIPE TUNNEL STORAGE TO WRESTLING ROOM CEILING PLENUM	MUD JOINT PACKING		5 UNITS	0	6	5	O&M	LIMITED VISUAL ACCESS
023	CUSTODIAL CLOSET	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					REMOVED FEB 2023 (ECL JOB #23334)
		CEILING GYPSUM BOARD & COMPOUND		0					CONFIRMED NON-ACM (ECL JOB #23260)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
024	GIRL'S LOCKER ROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		2755 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE PINK		460 SF	12 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		CERAMIC WALL TILE GROUT & GLUE PINK		1212 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		72 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14- 28692 TEM
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		MUD JOINT PACKING		8 UNITS	0	6	5	O&M	LIMITED VISUAL ACCESS
024CP	GIRL'S LOCKER ROOM CEILING PLENUM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
024A	GIRL'S LOCKER EQUIPMENT ROOM STORAGE	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14- 28692 TEM
024ACP	GIRL'S LOCKER EQUIPMENT ROOM STORAGE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
024B	GIRL'S LOCKER ROOM COACH OFFICE	9X9 FLOOR TILE GREY		0					REMOVED JULY 2022 (ECL JOB #22536)
		9X9 FLOOR TILE MASTIC		0					CONFIRMED NON-ACM (ECL JOB #18040)
		COVE BASE & MASTIC BROWN		0					RENOVATED JULY 2022
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
024BCP	GIRL'S LOCKER ROOM COACH OFFICE CEILING PLENUM	MUD JOINT PACKING		18 UNITS	0	6	5	O&M	GOOD CONDITION
		FIRE BRICK & MORTAR		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
024B1	GIRL'S LOCKER ROOM COACH OFFICE BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		70 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		314 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		MIRROR MASTIC		6 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
024B1CP	GIRL'S LOCKER ROOM COACH OFFICE BATHROOM CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	6	5	O&M	LIMITED VISUAL ACCESS
025	GIRL'S LOCKER ROOM EXIT VESTIBULE	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECL JOB #23546)
		GLAZED BLOCK MORTAR		325 SF	0	7	N/A NON FRIABLE	O&M	PATCHED
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14- 28692 TEM
025CP	GIRL'S LOCKER ROOM EXIT VESTIBULE CEILING PLENUM	MUD JOINT PACKING		20 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
026	WRESTLING ROOM	9X9 FLOOR TILE & MASTIC CREAM/BROWN		3366 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED WITH MASTIC EXPOSED; CONF ACM ECL JOB #18976
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL PLASTER		0					CONFIRMED NON-ACM (ECL JOB #17185)
		WALL/CHALK-BOARD MASTIC		1080 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
027	SOCCER & BASKETBALL STORAGE	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	1 SF	3	4	REPAIR	PEELING.
		2x4 CEILING TILE FISSURE DOT		0					NON ACM JCB #14-28692 TEM
027CP	SOCCER & BASKETBALL STORAGE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
028	BOY'S LOCKER ROOM PIPE TUNNEL STORAGE	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		MUD JOINT PACKING		0					REMOVED APRIL 2022 (ECI JOB #22171)
029	MAIN ELECTRICAL VAULT STORAGE ROOM	CONTAMINATED SAND		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
030	MAIN ELECTRICAL VAULT ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		MUD JOINT PACKING		0					REMOVED DEC 2022 (ECL JOB #23078)
031	MAIN ELECTRICAL VAULT VESTIBULE	FIRE BRICK & MORTAR		2 SF	0	7	N/A NON FRIABLE	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
031	MAIN ELECTRICAL VAULT VESTIBULE	MUD JOINT PACKING		9 UNITS	0	6	5	O&M	CONF ACM ORIGINAL AMP; PARTIAL ABATEMENT (ECL JOB #23078)
		FIRE BRICK & MORTAR		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION (STORED)

Summary of Asbestos Containing Materials

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
031A	ELEVATOR MECHANICAL ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	7	O&M	GOOD CONDITION
031B	MAIN ELECTRICAL VAULT VESTIBULE CRAWLSPACE ACCESS	SEE SPACE ID 061 FOR ASSESSMENT							
032	LAUNDRY ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
033	ELEVATOR MECHANICAL ROOM	GYP SUM BOARD & COMPOUND		45 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
034	CORRIDOR PIPE TUNNEL STORAGE TO ELEVATOR MECHANICAL ROOM	12X12 FLOOR TILE & MASTIC WHITE WITH SPECKLES		100 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	LOOSE
		COVE BASE & MASTIC BLACK		22 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC GREY		58 LF	3 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		CEMENTITIOUS WALL PLASTER		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ACM JCB#14-28692 TEM
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
034CP	CORRIDOR PIPE TUNNEL STORAGE TO ELEVATOR MECHANICAL ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
0035	BASEMENT STAIRWELL TO ROOM 909	TERRAZZO FLOORING BROWN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		300 SF	1 SF	4	N/A NON FRIABLE	REPAIR	HOLES
		WALL PLASTER		0					CONFIRMED NON-ACM (ECL JOB #17185)
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE TEXTURED		0					NON ACM JCB#14- 28692 TEM
0035CP	BASEMENT STAIRWELL TO ROOM 909 CEILING PLENUM	MUD JOINT PACKING		6 UNITS	0	6	5	O&M	GOOD CONDITION
0036	ROOM 909	9x9 FLOOR TILE & MASTIC GREY		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION - PATCHED
		COVE BASE & MASTIC BROWN		111 LF	15 LF	4	N/A NON FRIABLE	REPAIR	MISSING & DELAMINATING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2x2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
		MUD JOINT PACKING		4 UNITS	0	6	5	O&M	GOOD CONDITION
0036CP	ROOM 909 CEILING PLENUM								

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
0037	ROOM 908	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED; MOST TILES ARE CUPPING
		COVE BASE & MASTIC BROWN		111 LF	6 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING, MISSING WITH MASTIC EXPOSED - SOME REPLACED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		370 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECL JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
0037CP	ROOM 908 CEILING PLENUM	MUD JOINT PACKING		6 UNITS	0	6	5	O&M	GOOD CONDITION
0037A	ROOM 908 STORAGE	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
0037ACP	ROOM 908 STORAGE CEILING PLENUM	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		360 SF	0	7	N/A NON FRIABLE	O&M	PATCHED. GOOD CONDITION.
0038	ROOM 907	COVE BASE & MASTIC BROWN		89 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECL JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					REMOVED DEC 2022 (ECL JOB #23078)
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
0038CP	Room 907 CEILING PLENUM	MUD JOINT PACKING		27 UNITS	0	6	5	O&M	GOOD CONDITION
0039	WOMEN'S FACULTY BATHROOM NEAR ROOM 907	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE BROWN		687 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					CONFIRMED NON-ACM (ECL JOB #20036)
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		TERRAZZO FLOORING BROWN		0					CONFIRMED NON-ACM (ECI JOB #23546)
0040	CUSTODIAL CLOSET NEAR ROOM 906	CERAMIC WALL BASE GROUT & GLUE OFF WHITE		33 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14- 28692 TEM
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
0040CP	CUSTODIAL CLOSET NEAR ROOM 906 CEILING PLENUM	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
0041	MEN'S FACULTY BATHROOM NEAR 906	CERAMIC WALL TILE GROUT & GLUE GREEN		687 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
0042	ROOM 906	12X12 FLOOR TILE & MASTIC WHITE WITH GREY		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED; SOME PATCHED
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
		9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED; SOME PATCHED
		COVE BASE & MASTIC BLACK		111 LF	10 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING W/ MASTIC EXPOSED
0043	ROOM 905	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
0043CP	ROOM 905 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
0044	ROOM 904 (COMBINED W/ SPACE 0046)	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	80 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED AND CUPPING.
		COVE BASE & MASTIC BROWN		81 LF	7 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	2 SF	3	4	REPAIR	PEELING, CRACKED AND MISSING.
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
0044CP	ROOM 904 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
0045	ROOM 903	9X9 FLOOR TILE & MASTIC LIGHT GREEN		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CUPPING, CHIPPED WITH MASTIC EXPOSED - SOME PATCHED
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #20329)
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
0045CP	ROOM 903 CEILING PLENUM	MUD JOINT PACKING		4 UNITS	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
0046	ROOM 902	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED; 7 TILES PATCHED & CURPING PROBLEM
		COVE BASE & MASTIC BROWN		81 LF	30 LF	4	N/A NON FRIABLE	REPAIR	OLD COVE BASE IS DELAMINATING. NEW COVE BASE IS ALSO OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
0046CP	ROOM 902 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
0047	ROOM 9A/BOOK STORAGE	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		9X9 FLOOR TILE & MASTIC PINK		240 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED.
		COVE BASE & MASTIC BROWN		0					COVE BASE REMOVED
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
0047CP	ROOM 9A/BOOK STORAGE CEILING PLENUM	MUD JOINT PACKING		22 UNITS	NOT QUANTIFIED	3	1	REPAIR	DAMAGED WITH DEBRIS

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
0048	Room 900	9X9 FLOOR TILE & MASTIC GREY		0					REMOVED AUG 2021 (ECL JOB #21263)
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECL JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		7 UNITS	0	6	5	O&M	GOOD CONDITION
0048CP	Room 900 CEILING PLENUM	FIRE BRICK & MORTAR		5 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
0048A	Room 900 STORAGE	9X9 FLOOR TILE & MASTIC PINK		0					AREA RENOVATED SUMMER 2021
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
0048ACP	Room 900 STORAGE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
0049	Room 901	9X9 FLOOR TILE & MASTIC CREAM/BROWN		0					ABATED ECL JOB #19400
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECL JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
0049CP	ROOM 901 CEILING PLENUM	MUD JOINT PACKING		4 UNITS	0	6	5	O&M	GOOD CONDITION
0050	BASEMENT STAIRWELL NEAR ROOM 900	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECL JOB #23546)
		GLAZED BLOCK MORTAR		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL PLASTER		0					CONFIRMED NON-ACM (ECL JOB #17185)
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14- 28692 TEM
0050CP	BASEMENT STAIRWELL NEAR ROOM 900 CEILING PLENUM	MUD JOINT PACKING		7 UNITS	0	6	5	O&M	GOOD CONDITION
0051	BASEMENT CORRIDOR ROOM 900-908	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL PLASTER		0					CONFIRMED NON-ACM (ECL JOB #17185)
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14- 28692 TEM
0051CP	BASEMENT CORRIDOR ROOM 900-908 CEILING PLENUM	MUD JOINT PACKING		64 UNITS	0	6	5	O&M	GOOD CONDITION
053	ORCHESTRA BASEMENT CORRIDOR	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
054	MECHANICAL ROOM	FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
055	ORCHESTRA PIT ALCOVE	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
056	ORCHESTRA PIT	FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
057	ORCHESTRA PIT STORAGE	FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
0058	BASEMENT OPEN STORAGE UNDER CHIEF CUSTODIAN'S OFFICE	CONTAMINATED SAND		N/A	0	6	5	O&M	ASSUMED (NOT HOMOGENOUS AND CANNOT BE TESTED)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
0059	WEST BOILER ROOM	WINDOW GLAZING/CAULKING		100 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ECL JOB #17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ECL JOB #17592
		FIRE DOOR INSULATION METAL		3 DOORS	0	6	5	O&M	GOOD CONDITION
		HOT WATER TANK INSULATION		0					CONFIRMED NON-ACM (ECL JOB #18977)
		MUD JOINT PACKING		0					ABATED ECL JOB , 2002
		BOILER BREECHING		0					ABATED ECL JOB , 2002
		BOILER INSULATION		0					ABATED ECL JOB , 2002

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
0060	AC COMPRESSOR ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		14 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ECL JOB #17592
		FIRE DOOR INSULATION METAL		3 DOORS	0	6	5	O&M	GOOD CONDITION
0061	PIPE TUNNEL UNDER 700/800 WINGS	FIRE BRICK & MORTAR		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WOOD FLOOR TAR/VAPOR BARRIER		156 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD		450 SF	<1 SF	3	4	REPAIR	HOLE.
1001	PRINT SHOP/MAINTENANCE GARAGE	FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		0					REMOVED
		MUD JOINT PACKING		12 UNITS	0	6	5	O&M	MATERIAL NOT OBSERVED
		TECTUM DECKING		0					NON ACM JCB #17-36668 TEM
1001A	PRINT SHOP BREAK ROOM	WOOD FLOOR TAR/VAPOR BARRIER		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		60 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		48 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					REMOVED DEC 2022 (ECL JOB #23078)
		TECTUM DECKING		0					NON ACM JCB #17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1001 B	PRINT SHOP STORAGE	WOOD FLOOR TAR/VAPOR BARRIER		336 SF	0	7	N/A NON FRIABLE	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYP SUM BOARD & COMPOUND		168 SF	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		PIPE INSULATION		84 LF	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		TECTUM DECKING		0					NON ACM JCB #17-36668 TEM
		WOOD FLOOR TAR/VAPOR BARRIER		924 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB #17-36668
		JOINT COMPOUND		441 SF	0	6	5	O&M	GOOD CONDITION; CONF ACM JCB #17-36668
1001 C	PRINT SHOP	GYP SUM BOARD		0					NON ACM JCB #17-36668
		WALL/CHALK-BOARD MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		96 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					ABATED JCB #17-36341
		TECTUM DECKING		0					NON ACM JCB #17-36668 TEM
		ROOF TAR		N/A	<1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED AND DRIPPING.

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1002	ART COMMON AREA	9X9 FLOOR TILE & MASTIC GREEN		252 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED; CONF ACM ECL JOB #18040
		COVE BASE & MASTIC BROWN		108 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED.
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
1002CP	ART COMMON AREA CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1002A	FASHION STORAGE/DRESSING ROOM D	9X9 FLOOR TILE & MASTIC GREEN		99 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED; CONF ACM ECL JOB #18040
		COVE BASE & MASTIC BROWN		37 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		PEGBOARD		168 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		1X1 CEILING TILE SPLINE		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1002B	ART STORAGE C	9X9 FLOOR TILE & MASTIC GREEN		56 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ECL JOB #18040
		COVE BASE & MASTIC BROWN		27 LF	1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		1X1 WALL TILE & MASTIC FISSURE		180 SF	20 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, HOLES & MISSING W/ MASTIC EXPOSED
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1002C	ART STORAGE B	1X1 CEILING TILE SPLINE		0					NON ACM JCB#14-28692 TEM
		9X9 FLOOR TILE & MASTIC GREEN		56 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ECL JOB #18040
		COVE BASE & MASTIC BROWN		27 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		1X1 WALL TILE & MASTIC FISSURE		180 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED - MASTIC IS COVERED
1002D	700 THE ARTS	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE SPLINE		0					NON ACM JCB#14-28692 TEM
		9X9 FLOOR TILE & MASTIC GREEN		56 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ECL JOB #18040
		COVE BASE & MASTIC BROWN		27 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
1002D	700 THE ARTS	1X1 WALL TILE & MASTIC FISSURE		180 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED WITH MASTIC EXPOSED
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE SPLINE		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1002E	ROOM 554	12X12 FLOOR TILE & MASTIC BROWN WITH WHITE		900 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	CUPPING & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		114 LF	10 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		1X1 ACOUSTICAL WALL TILE & MASTIC		300 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & WATER STAINED
		WINDOW GLAZING/CAULKING		100 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6		O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1002ECP	ROOM 554 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1002E1	ROOM 554 KILN ROOM	12X12 FLOOR TILE & MASTIC BROWN WITH WHITE		162 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		45 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		48 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		REFRACTORY/KILN/FIRE BRICK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		1X1 CEILING TILE		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1002F	ART KITCHEN AREA	12X12 FLOOR TILE & MASTIC BROWN WITH WHITE		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE SPLINE		0					NON ACM JCB#14-28692 TEM
		9X9 FLOOR TILE & MASTIC WHITE		320 SF	18 TILES	4	N/A NON FRIABLE	REPAIR	CUPPING, CHIPPED, CRACKED & MISSING W/ MASTIC EXPOSED
		12X12 FLOOR TILE & MASTIC BROWN WITH WHITE		1280 SF	30 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED W/ MASTIC & 9X9 FT EXPOSED
		COVE BASE & MASTIC BROWN		260 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		1X1 ACOUSTICAL WALL TILE & MASTIC		260 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY (PREVIOUSLY CHIPPED)
1002G	ROOM 556	WALL/CHALK-BOARD MASTIC		425 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIBERBOARD		95 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING PINK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		2X4 CEILING TILE TEXTURED PIN HOLE		0					NON ACM JCB#14-28692 TEM
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1002GCP	ROOM 556 CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	6	5	O&M	LIMITED VISUAL ACCESS
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1002H	ART OFFICE 4	LINOLEUM FLOORING		88 SF	6 LF	4	N/A NON FRIABLE	REPAIR	CRACKED.
		COVE BASE & MASTIC BROWN		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		VIBRATION REDUCER CLOTH WHITE		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					REMOVED DEC 2022 (ECL JOB #23078)
		REFRACTORY/KILN/FIRE BRICK		0					REMOVED
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		WOOD FLOOR TAR/VAPOR BARRIER		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		18 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
1003	ROOM 555/553 VESTIBULE	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		180 SF	1 SF	3	4	REPAIR	SCRAPED
		WALL/CHALK-BOARD MASTIC		2 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1003CP	ROOM 555/553 VESTIBULE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1003A	ROOM 555	WOOD FLOOR TAR/VAPOR BARRIER		1080 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYP SUM BOARD & COMPOUND		360 SF	< 1 SF	3	4	REPAIR	HOLES
		WINDOW GLAZING/CAULKING		70 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		0					SINK REPLACED
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
1003ACP	ROOM 555 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17- 36668 TEM
1003A1	ROOM 555 STORAGE	WOOD FLOOR TAR/VAPOR BARRIER		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		16 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17- 36668 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1003B	ROOM 553	WOOD FLOOR TAR/VAPOR BARRIER		880 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPNUM BOARD & COMPOUND		360 SF	<1 SF	3	4	REPAIR	CHIPPED/ HOLE
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2x2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		5 UNITS	0	6	5	O&M	GOOD CONDITION
1003BCP	ROOM 553 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1004	STORAGE CLOSET NEAR ROOM 552	9x9 FLOOR TILE & MASTIC BEIGE		125 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED - SOME PATCHED
		12x12 FLOOR TILE & MASTIC BROWN WATERCOLOR		15 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	WORN
		COVE BASE & MASTIC BLACK		45 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1005	ROOM 552	12X12 FLOOR TILE & MASTIC WHITE/BROWN		810 SF	18 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED
		COVE BASE & MASTIC BROWN		63 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & CHIPPED w/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1005CP	ROOM 552 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1005A	ROOM 552 TV ROOM	9X9 FLOOR TILE & MASTIC GREEN		135 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED; CONF ACM ECL JOB #18040
		COVE BASE & MASTIC BROWN		42 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1006	CUSTODIAL OFFICE	COVE BASE & MASTIC BLACK		130 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		70 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					REMOVED DEC 2022 (ECL JOB #23078)
1006A	CUSTODIAL OFFICE STORAGE	CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		6 UNITS	0	6	5	O&M	GOOD CONDITION; CONF ACM ORIGINAL AMP; 3 UNITS ABATED ECL JOB #19947
1006B	CUSTODIAL OFFICE BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREY		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE BLUE		270 SF	0	7	N/A NON FRIABLE	O&M	PATCHED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1007	BOILER ROOM	CEMENTITIOUS WALL PLASTER		1375 SF	2 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED AND MISSING.
		WINDOW GLAZING/CAULKING		88 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		3 DOORS	0	6	5	O&M	GOOD CONDITION
		HOT WATER TANK INSULATION		N/A	0	6	5	O&M	LIMITED VISUAL ACCESS; CONF ACM ECL JOB #18977
		MUD JOINT PACKING		0					ABATED ECL JOB , 2002; CONF ACM ECL JOB #18977
		BOILER BREECHING		0					ABATED ECL JOB , 2002
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CERAMIC FLOOR TILE GROUT & GLUE		2250 SF	0	6	5	O&M	UNDER RUBBER FLOORING
		COVE BASE & MASTIC BLACK		324 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1008	WEIGHT ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		170 SF	1 SF	3	4	REPAIR	HOLES
		SKYLIGHT CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		5 DOORS	0	6	5	O&M	GOOD CONDITION
		MIRROR MASTIC		0					CONFIRMED NON-ACM (ECL JOB #22303)
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		SKYLIGHT PLASTER		40 SF	4 LF	4	N/A NON FRIABLE	REPAIR	CRACKED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1008CP	WEIGHT ROOM CEILING PLENUM	MUD JOINT PACKING		3 UNITS	0	6	5	O&M	LIMITED VISUAL ACCESS
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1008A	WEIGHT ROOM FREEZER	SPACE NO LONGER EXIST, FREEZER REMOVED							
1008B	WEIGHT ROOM ELECTRICAL CLOSET	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1008C	WEIGHT ROOM OFFICE	12X12 FLOOR TILE & MASTIC BROWN WATERCOLOR		84 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
		CERAMIC FLOOR TILE GROUT & GLUE BLUE & WHITE		84 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		COVE BASE & MASTIC BLACK		35 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
1008CCP	WEIGHT ROOM OFFICE CEILING PLENUM	CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1009	CORRIDOR WEIGHT ROOM TO PRINT SHOP	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		168 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
1009CP	CORRIDOR WEIGHT ROOM TO PRINT SHOP CEILING PLENUM	2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		CEILING GYPSUM BOARD & COMPOUND		40 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		56 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1010	BOY'S BATHROOM NEAR WEIGHT ROOM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		80 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL TILE GROUT & GLUE BLUE		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1011	CUSTODIAL CLOSET NEAR WEIGHT ROOM	9X9 FLOOR TILE & MASTIC GREEN		0					REMOVED JULY 2022 (ECL JOB #22536)
		COVE BASE & MASTIC BLACK		0					RENOVATED JULY 2022
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1011CP	CUSTODIAL CLOSET NEAR WEIGHT ROOM CEILING PLENUM	CEILING GYPSUM BOARD & COMPOUND		40 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
		CERAMIC FLOOR TILE GROUT & GLUE PINK		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		200 SF	40 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING W/ MASTIC EXPOSED
1012	GIRL'S BATHROOM NEAR WEIGHT ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1013	ROOM 550	12X12 FLOOR TILE & MASTIC BEIGE		210 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC GOLD WATERCOLOR		210 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC WHITE		210 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		12X12 FLOOR TILE & MASTIC YELLOW		210 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC WHITE		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		40 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
1013CP	ROOM 550 CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		4 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1014	ROOM 548	12X12 FLOOR TILE & MASTIC BEIGE WATERCOLOR		210 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC GOLD WATERCOLOR		210 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		210 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED.
		12X12 FLOOR TILE & MASTIC YELLOW		210 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC WHITE		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		98 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1014CP	ROOM 548 CEILING PLENUM								

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1015	ROOM 546	12X12 FLOOR TILE & MASTIC BEIGE WATERCOLOR		210 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		12X12 FLOOR TILE & MASTIC GOLD WATERCOLOR		210 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		210 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		12X12 FLOOR TILE & MASTIC YELLOW		210 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC WHITE		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		40 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
1015CP	ROOM 546 CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1016	CORRIDOR ROOMS 546-550	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPNUM BOARD & COMPOUND		138 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
1016CP	CORRIDOR ROOMS 546-550 CEILING PLENUM	CEILING GYPNUM BOARD		30 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		6 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
		CEILING GYPNUM BOARD		64 SF	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		WOOD FLOOR TAR/VAPOR BARRIER		784 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1017	ROOM 544	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
1017CP	ROOM 544 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1018	ROOM 517 STORAGE	9X9 FLOOR TILE & MASTIC GREEN		72 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED & MISSING; CONF ACM ECL JOB #18040
		COVE BASE & MASTIC BROWN		34 LF	0	7	N/A NON FRIABLE	O&M	BLACK COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
1019	BOY'S LOCKER ROOM	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		0					NON ACM JCB#14-29584
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		1584 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		410 LF	3 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		COVE BASE & MASTIC BROWN		0					NON ACM JCB#14-29584
		CERAMIC WALL TILE GROUT & GLUE YELLOW		36 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		72 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1019A	BOY'S LOCKER ROOM VESTIBULE	9X9 FLOOR TILE BEIGE		0					REMOVED SEP 2022 (ECI JOB #22745)
		9X9 FLOOR TILE MASTIC		0					REMOVED SEP 2022 (ECI JOB #22745)
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1019B	BOY'S LOCKER ROOM SLOP SINK	CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		9X9 FLOOR TILE GREY		0					REMOVED SEP 2022 (ECI JOB #22745)
		9X9 FLOOR TILE MASTIC		0					REMOVED SEP 2022 (ECI JOB #22745)
1019C	BOY'S LOCKER ROOM COACH ROOM	9X9 FLOOR TILE MULTICOLOR		0					REMOVED SEP 2022 (ECI JOB #22745)
		9X9 FLOOR TILE MASTIC		0					REMOVED SEP 2022 (ECI JOB #22745)
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		1 X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB #14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1019C1	BOY'S LOCKER ROOM COACH ROOM CLOSET	9X9 FLOOR TILE GREY		0					REMOVED SEP 2022 (ECL JOB #22745)
		9X9 FLOOR TILE MASTIC		0					REMOVED SEP 2022 (ECL JOB #22745)
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
1019C2	BOY'S LOCKER ROOM COACH ROOM BATHROOM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		45 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE GREEN		265 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	HOLES
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
1019D	BOY'S LOCKER ROOM BATHROOM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		CERAMIC FLOOR TILE GROUT & GLUE GREY		112 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL TILE GROUT & GLUE GREY		200 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1019D	BOY'S LOCKER ROOM BATHROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		36 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1019E	BOY'S LOCKER ROOM TEAM LOCKER ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		72 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1019F	BOY'S LOCKER ROOM SHOWER/STORAGE	CERAMIC FLOOR TILE GROUT & GLUE TEAL & WHITE		410 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
		CERAMIC WALL TILE GROUT & GLUE YELLOW		710 SF	12 TILES	4	N/A NON FRIABLE	REPAIR	MISSING TILES
		WALL PLASTER (BEHIND CERAMIC TILE)		710 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
		FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1020	EAST GYMNASIUM	WOOD FLOOR TAR/VAPOR BARRIER		7500 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		350 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		6 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		6 DOORS	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		6 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB #11-21877

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1020A	EAST GYMNASIUM STORAGE 1	WOOD FLOOR TAR/VAPOR BARRIER		162 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		ROOF TAR		N/A	<1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1020A1	EAST GYMNASIUM TRACK OFFICE	9X9 FLOOR TILE & MASTIC BEIGE		126 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED WITH MASTIC EXPOSED.
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
1020B	OUTDOOR STORAGE	WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		FIRE DOOR INSULATION METAL		3 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1020C	EAST GYMNASIUM ELECTRICAL	ROOF TAR		N/A	1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
		WOOD FLOOR TAR/VAPOR BARRIER		380 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		ROOF TAR		2 SF	1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1021	GIRL'S LOCKER ROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		1300 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL BASE GROUT & GLUE PINK		109 SF	22 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		CERAMIC WALL TILE GROUT & GLUE PINK		172 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING TILES
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		9X9 FLOOR TILE GREY		0					REMOVED SEP 2022 (ECI JOB #22745)
1021A	GIRL'S LOCKER ROOM ENTRANCE VESTIBULE	9X9 FLOOR TILE MASTIC		0					REMOVED SEP 2022 (ECI JOB #22745)
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1021B	GIRL'S LOCKER ROOM SLOP SINK	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		70 SF	< 1 SF	3	4	REPAIR	WATER STAINED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1021C	GIRL'S LOCKER ROOM COACH OFFICE	9X9 FLOOR TILE GREY		0					REMOVED SEP 2022 (ECL JOB #22745)
		9X9 FLOOR TILE MASTIC		0					REMOVED SEP 2022 (ECL JOB #22745)
		COVE BASE & MASTIC WHITE		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1021C1	GIRL'S LOCKER ROOM COACH OFFICE BATHROOM	1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14- 28692 TEM
		CERAMIC FLOOR TILE GROUT & GLUE PINK		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		220 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		CERAMIC FLOOR TILE GROUT & GLUE PINK		400 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		820 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	MISSING TILES, LIMITED VISIBILITY
1021D	GIRL'S LOCKER ROOM SHOWER AREA	CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1021 E	GIRLS LOCKER ROOM BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		91 SF	< 1SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL TILE GROUT & GLUE PINK		220 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	MISSING & CHIPPED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		MIRROR MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1022	ROOM 511 STORAGE	MUD JOINT PACKING		0					REMOVED DEC 2022 (ECL JOB #23078)
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		9X9 FLOOR TILE GREY		96 SF	11 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED W/ MASTIC EXPOSED; CONF ACM (ECL JOB #18040)
		9X9 FLOOR TILE MASTIC		0					CONFIRMED NON-ACM (ECL JOB #18040)
		COVE BASE & MASTIC BLACK		33 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1022A	ROOM 511 STORAGE FAN ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		VIBRATION REDUCER CLOTH GREEN		7 UNITS	1	4	N/A NON FRIABLE	REPAIR	SIGNIFICANTLY DAMAGED. SPLIT OPEN
		MUD JOINT PACKING		41 UNITS	0	6	5	O&M	40 UNITS REMOVED (ECL JOB #23078); GOOD CONDITION
		DUCT INSULATION CLOTH		518 SF	0	6	5	O&M	PARTIAL ABATEMENT 7 LF (ECL JOB #23078)
1023	GENDER NEUTRAL BATHROOM (PREVIOUSLY MEN'S BATHROOM)	CEMENTITIOUS CEILING MATERIAL		1675 SF	15 LF	4	N/A NON FRIABLE	REPAIR	CRACKED DUE TO WATER DAMAGE
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		96 SF	0	7	N/A NON FRIABLE	O&M	PATCHED
		CERAMIC WALL TILE GROUT & GLUE BLUE		284 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED & 1 TILE PATCHED
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1024	CUSTODIAN 509 CLOSET	CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		COVE BASE & MASTIC BLACK		29 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATED, MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		45 SF	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1025	WOMEN'S ROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		96 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
		CERAMIC WALL TILE GROUT & GLUE PINK		284 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED GROUT & MISSING W/ MASTIC EXPOSED
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1026	ART PHOTO ROOM 543	9X9 FLOOR TILE & MASTIC GREEN		12 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	NOT OBSERVED: CONF ACM ECL JOB #18040
		12X12 FLOOR TILE & MASTIC WHITE/BROWN		720 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		102 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIBERBOARD		240 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1026CP	ART PHOTO ROOM 543 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1026A	ART PHOTO ROOM 543 DARK ROOM	12X12 FLOOR TILE & MASTIC WHITE/BROWN		264 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BROWN		49 LF	5 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC PAINTED OVER
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1026B	ART PHOTO ROOM 543 CLOSET	MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM
		9X9 FLOOR TILE & MASTIC GREEN		16 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	UNDER 12X12; CONF ACM ECL JOB #18040
		12X12 FLOOR TILE & MASTIC WHITE/BROWN		25 SF	0	7	N/A NON FRIABLE	O&M	NEW 12X12 PINK/BROWN FLOOR TILE OBSERVED
		COVE BASE & MASTIC BROWN		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1026B	ART PHOTO ROOM 543 CLOSET	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1027	ROOM 541	9X9 FLOOR TILE & MASTIC GREEN		960 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE/BROWN		980 SF	0	7	N/A NON FRIABLE	O&M	MISSING TILES
		COVE BASE & MASTIC BROWN		54 LF	0	7	N/A NON FRIABLE	O&M	BLACK COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYP SUM BOARD & COMPOUND		200 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
1027CP	ROOM 541 CEILING PLENUM	GYP SUM BOARD & COMPOUND		36 SF	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1027A	ROOM 541 STORAGE	9X9 FLOOR TILE & MASTIC GREEN		20 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12; CONF ACM ECL JOB #18040
		12X12 FLOOR TILE & MASTIC WHITE/BROWN		60 SF	0	7	N/A NON FRIABLE	O&M	BLACK COVE BASE OBSERVED
		COVE BASE & MASTIC BROWN		9 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYP SUM BOARD & COMPOUND		123 SF	0	6	5	O&M	GOOD CONDITION
		FIBERBOARD		56 SF	0	7	N/A NON FRIABLE	O&M	MINOR DAMAGE
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ACM JCB#14-28692 TEM

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1027ACP	ROOM 541 STORAGE CEILING PLENUM	GYPSUM BOARD		22 SF	< 1 SF	3	4	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					NON ACM JCB#17- 36668 TEM
1027B	ROOM 541 CLOSET	12X12 FLOOR TILE & MASTIC WHITE/BROWN		36 SF	0	7	N/A NON FRIABLE	O&M	MINOR DAMAGE
		COVE BASE & MASTIC BROWN		24 LF	0	7	N/A NON FRIABLE	O&M	BLACK COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
1027BCP	ROOM 541 CLOSET CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17- 36668 TEM
1028	SUPPLY CLOSET NEAR YEAR BOOK ROOM	9X9 FLOOR TILE GREY		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ECL JOB #18040
		9X9 FLOOR TILE MASTIC		0					CONFIRMED NON-ACM (ECL JOB #18040)
		COVE BASE & MASTIC BROWN		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1029	YEAR BOOK ROOM 539	TECTUM DECKING		0					NON ACM JCB#17- 36668 TEM
		9X9 FLOOR TILE & MASTIC GREY		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		80 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14- 28692 TEM

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1030	ART DISPLAY ROOM	9X9 FLOOR TILE & MASTIC TAN		81 SF	0	7	N/A NON FRIABLE	O&M	UNDER LINOLEUM FLOORING
		LINOLEUM FLOORING		81 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIBERBOARD		162 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		162 SF	0	7	N/A NON FRIABLE	O&M	NEW WALL PAPER OBSERVED
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM
1031	CONTINUING EDUCATION OFFICE	9X9 FLOOR TILE & MASTIC GREY		81 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		18 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		81 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1032	CORRIDOR BOY'S LOCKER ROOM LECTURE HALL	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPNUM BOARD & COMPOUND		80 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		15 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		WINDOW GLAZING/CAULKING		210 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		6 DOORS	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2x4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		88 UNITS	NOT QUANTIFIED	3	1	REPAIR	DEBRIS
1032CP	CORRIDOR BOY'S LOCKER ROOM LECTURE HALL CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1033	ROOM 401 BOOK ROOM	9x9 FLOOR TILE & MASTIC PINK		225 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		51 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		1x1 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1034	GIRL'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREY		252 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		550 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		36 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		5 UNITS	1	3	1	REPAIR	DAMAGED
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1034CP	GIRL'S BATHROOM CEILING PLENUM	9X9 FLOOR TILE & MASTIC GREEN		0					REMOVED JULY 2022 (ECL JOB #22536)
		COVE BASE & MASTIC BLACK		0					RENOVATED JULY 2022
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1035	ROOM 403 CUSTODIAL CLOSET	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		ROOF TAR		N/A	< 1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
		CERAMIC FLOOR TILE GROUT & GLUE GREY		252 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		550 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1036	BOY'S BATHROOM	WINDOW GLAZING/CAULKING		36 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1036CP	BOY'S BATHROOM CEILING PLENUM	MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1037	ROOM 404	9X9 FLOOR TILE & MASTIC GREY		912 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		9X9 FLOOR TILE & MASTIC BEIGE/BROWN		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		112 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		48 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1037CP	ROOM 404 CEILING PLENUM	9X9 FLOOR TILE & MASTIC GREY		252 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1037A	ROOM 404 STORAGE CLOSET	COVE BASE & MASTIC BROWN		71 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		VIBRATION REDUCER CLOTH WHITE		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					REMOVED DEC 2022 (ECL JOB #23078)
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1038	ROOM 406	12X12 FLOOR TILE & MASTIC PEACH		1008 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		78 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		48 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
1038CP	ROOM 406 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1038A	ROOM 406 PREP ROOM	12X12 FLOOR TILE & MASTIC PEACH		168 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		29 LF	0	7	N/A NON FRIABLE	O&M	MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
1038ACP	ROOM 406 PREP ROOM CEILING PLENUM	GYPSUM BOARD		24 SF	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1038A1	ROOM 406/408 OFFICE	12X12 FLOOR TILE & MASTIC PEACH		84 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		33 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		24 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		GYPSUM BOARD		16 SF	0	6	5	O&M	GOOD CONDITION
1038A1 CP	ROOM 406/408 OFFICE CEILING PLENUM	MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
1038A2	STORAGE ROOM 1	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		12X12 FLOOR TILE & MASTIC PEACH		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1038A2CP	STORAGE ROOM 1 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1038A3	STORAGE ROOM 2	12X12 FLOOR TILE & MASTIC PEACH		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
1038A3CP	STORAGE ROOM 2 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1039	ROOM 405	12X12 FLOOR TILE & MASTIC PEACH		1008 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		78 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		4 UNITS	NOT QUANTIFIED	3	1	REPAIR	DAMAGED WITH DEBRIS; CONF ACM JCB#18-39291
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1039CP	ROOM 405 CEILING PLENUM								

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1039A	ROOM 405/407 PREP ROOM	12X12 FLOOR TILE & MASTIC PEACH		392 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		78 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
1039ACP	ROOM 405/407 PREP ROOM CEILING PLENUM	MUD JOINT PACKING		4 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1040	ROOM 408	12X12 FLOOR TILE & MASTIC PEACH		1120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		222 LF	0	7	N/A NON FRIABLE	O&M	MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		32 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
1040CP	ROOM 408 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1041	ROOM 407	12X12 FLOOR TILE & MASTIC PEACH		1 120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		222 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		72 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		32 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2x2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1041CP	ROOM 407 CEILING PLENUM	ROOF TAR		N/A	< 1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1042	CORRIDOR ROOM 408 TO CONTINUING ED O OFFICE	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYP SUM BOARD & COMPOUND		140 SF	0	6	5	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2x4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1042CP	CORRIDOR ROOM 408 TO CONTINUING ED OFFICE CEILING PLENUM	MUD JOINT PACKING		44 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE; CONF ACM ECL JOB #18105
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1043	ROOM 309	9X9 FLOOR TILE & MASTIC PINK		187 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		49 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM
1044	ROOM 306	9X9 FLOOR TILE & MASTIC GREY		810 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	UNDER 12X12 FLOOR TILE; EXPOSED - TILES CHIPPED W/ HOLES
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED W/ MASTIC & 9X9 FT EXPOSED - SOME PATCHED
		COVE BASE & MASTIC BROWN		108 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1045	FACULTY ROOM	12X12 FLOOR TILE & MASTIC WHITE/BROWN		672 SF	11 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED WITH MASTIC EXPOSED. 9X9 TILE CONFIRMED UNDERNEATH
		COVE BASE & MASTIC BLACK		95 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		35 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ACM JCB#14-28692 TEM
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		12X12 FLOOR TILE & MASTIC WHITE/BROWN		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1045CP	FACULTY ROOM CEILING PLENUM	COVE BASE & MASTIC BLACK		48 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		0					BOARD REMOVED, NO MASTIC
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING PINK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1045A	FACULTY KITCHEN AREA								

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1045A1	FACULTY WOMEN'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		72 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		145 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION PATCHED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1045B	FACULTY KITCHEN AREA	12X12 FLOOR TILE & MASTIC WHITE/BROWN		140 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		48 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		0					BOARD REMOVED, NO MASTIC
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
1045B1	FACULTY MEN'S BATHROOM	METAL SINK UNDERCOATING PINK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		72 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE BLUE		145 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & HOLE
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1046	ROOM 307	9X9 FLOOR TILE & MASTIC BEIGE		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE WITH BLACK		810 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED, 9X9 ARE EXPOSED
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		GYPNUM BOARD		28 SF	0	6	5	O&M	GOOD CONDITION
1046CP	ROOM 307 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1047	ROOM 305	9X9 FLOOR TILE & MASTIC TAN		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	30 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED, 9X9 ARE EXPOSED
		COVE BASE & MASTIC BLACK		111 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DENTED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1047CP	ROOM 305 CEILING PLENUM	GYPSUM BOARD		28 SF	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1048	ROOM 303	12X12 FLOOR TILE & MASTIC WHITE/BROWN		810 SF	50 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		GYPSUM BOARD		28 SF	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1048CP	ROOM 303 CEILING PLENUM	2X4 WALL TILE FISSURE		28 SF	6	4	N/A NON FRIABLE	REPAIR	CHIPPED
		9X9 FLOOR TILE & MASTIC GREEN		324 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	LIFTING, CRACKED & CHIPPED; CONF ACM ECL JOB #18040
1049	ROOM 301/STUDY ROOM	COVE BASE & MASTIC BLACK		72 LF	20 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATIONING & MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		GYPSUM BOARD		0					NON ACM JCB#17-36668
		SKYLIGHT CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					REMOVED DEC 2022 (ECL JOB #23078)
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1050	CORRIDOR FROM ROOM 303 TO ROOM 309	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		WHITE WITH BLACK CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPNUM BOARD & COMPOUND		252 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		240 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1050CP	CORRIDOR FROM ROOM 303 TO ROOM 309	FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		GYPNUM BOARD & COMPOUND		20 SF	0	6	5	O&M	LIMITED VISUAL ACCESS
		MUD JOINT PACKING		53 UNITS	0	6	5	O&M	GOOD CONDITION; CONF ACM ECL JOB #20329; 4 UNITS ABATED ECL JOB #20417
1051	ROOM 209	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		9X9 FLOOR TILE GREY		810 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING W/ MASTIC EXPOSED; CONF ACM ECL JOB #18040
		9X9 FLOOR TILE MASTIC		0					CONFIRMED NON-ACM (ECL JOB #18040)
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1051CP	Room 209 CEILING PLENUM	GYPSUM BOARD		28 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		2X4 WALL TILE FISSURE		28 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY (PREVIOUSLY CHIPPED)
1052	Room 212	9X9 FLOOR TILE & MASTIC GREEN		700 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED- SOME PATCHED; CONF ACM (ECL JOB #18040)
		COVE BASE & MASTIC BLACK		100 LF	2 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATION MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		18 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
1052CP	Room 212 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1053	ROOM 211	9X9 FLOOR TILE & MASTIC GREY		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	UNDER 12X12 FLOOR TILE - CHIPPED AND EXPOSED
		12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ 9X9 EXPOSED
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		230 LF	0	7	N/A NON FRIABLE	O&M	UNDER WHITE CERAMIC WALL TILE
		CERAMIC WALL TILE GROUT & GLUE WHITE		586 SF	0	6	5	O&M	BEHIND NEW CERAMIC TILE
1054	MEN'S BATHROOM NEXT TO ROOM 212	MIRROR MASTIC		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		36 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER TEXTURED		230 SF	< 1 SF	3	N/A NON FRIABLE	REPAIR	WATER DAMAGE

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1055	CUSTODIAL CLOSET NEAR ROOM 211	9X9 FLOOR TILE & MASTIC GREEN		0					REMOVED JULY 2022 (ECL JOB #22536)
		COVE BASE & MASTIC BLACK		0					RENOVATED JULY 2022
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					REMOVED DEC 2022 (ECL JOB #23078)
		TECTUM DECKING		0					NON ACM JCB #17- 36668 TEM
1056	WOMEN'S BATHROOM NEAR 211	CERAMIC FLOOR TILE GROUT & GLUE PINK		230 SF	0	7	N/A NON FRIABLE	O&M	PATCHED
		CERAMIC WALL TILE GROUT & GLUE WHITE		586 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		WINDOW GLAZING/CAULKING		36 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1057	ROOM 213	CEILING PLASTER TEXTURED		230 SF	5 SF	4	N/A NON FRIABLE	REPAIR	PAINT PEELING
		12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED 9X9 TILE UNDERNEATH
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1057CP	ROOM 213 CEILING PLENUM	GYPSUM BOARD		56 SF	< 1SF	3	4	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1058	ROOM 214	12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	4	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		COVE BASE & MASTIC BLACK		111 LF	11 LF	4	N/A NON FRIABLE	REPAIR	MISSING MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		GYPSUM BOARD		56 SF	< 1SF	3	4	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1058CP	ROOM 214 CEILING PLENUM	12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1059	ROOM 215	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1059CP	ROOM 215 CEILING PLENUM	GYPSUM BOARD		56 SF	< 1 SF	3	4	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1060	ROOM 216	12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1060CP	ROOM 216 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		GYPSUM BOARD		56 SF	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		ROOF TAR		N/A	< 1SF	4	N/A NON FRIABLE	REPAIR	EXPOSED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1061	ROOM 217	9X9 FLOOR TILE GREY		810 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED - SOME PATCHED; CONF ACM ECL JOB #18040
		9X9 FLOOR TILE MASTIC		0					CONFIRMED NON-ACM (ECL JOB #18040)
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6		O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		GYPSUM BOARD		28 SF	0	6		O&M	GOOD CONDITION
1061CP	ROOM 217 CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	6		O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1062	ROOM 218	12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	4 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6		O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1062CP	ROOM 218 CEILING PLENUM	GYPSUM BOARD		28 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		ROOF TAR		N/A	< 1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1063	CORRIDOR ROOMS 209-218	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		192 SF	0	6	5	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
1063CP	CORRIDOR ROOMS 209-218 CEILING PLENUM	2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		GYPSUM BOARD		32 SF	0	6	5	O&M	LIMITED VISUAL ACCESS
		MUD JOINT PACKING		27 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1064	ROOM 208	12X12 FLOOR TILE & MASTIC LIGHT BLUE		960 SF	0	7	N/A NON FRIABLE	O&M	PATCHED
		COVE BASE & MASTIC BLACK		121 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		72 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING PINK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		GYPNUM BOARD		28 SF	0	6	5	O&M	GOOD CONDITION
1064CP	ROOM 208 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1065	ROOM 207	9X9 FLOOR TILE GREY		810 SF	10	4	N/A NON FRIABLE	REPAIR	CRACKED CHIPPED MASTIC EXPOSED; CONF ACM ECL JOB #18040
		9X9 FLOOR TILE MASTIC		0					CONFIRMED NON-ACM (ECL JOB #18040)
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		1000 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1065CP	ROOM 207 CEILING PLENUM	GYPSUM BOARD		28 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		5 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		9X9 FLOOR TILE GREY		476 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED, LOOSE & LIFTED; CONF ACM ECL JOB #18040
1066	ROOM 206/ENGLISH OFFICE	9X9 FLOOR TILE MASTIC		0					CONFIRMED NON-ACM (ECL JOB #18040)
		COVE BASE & MASTIC BLACK		87 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		30 SF	0	6	5	O&M	NOT OBSERVED, WOOD DOOR
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM
		9X9 FLOOR TILE & MASTIC BEIGE		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1067	ROOM 205	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1067CP	ROOM 205 CEILING PLENUM	GYPSUM BOARD		56 SF	< 1 SF	3	4	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		ROOF TAR		N/A	< 1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
		9X9 FLOOR TILE GREY		960 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE: CONF ACM ECL JOB #18040
1068	ROOM 204	9X9 FLOOR TILE MASTIC		0					CONFIRMED NON-ACM (ECL JOB #18040)
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		960 SF	14 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		121 LF		7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		30 SF	0	6	5	O&M	NOT OBSERVED
		WALL/CHALK-BOARD MASTIC		24 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING WHITE		12 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1068CP	ROOM 204 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1068A	ROOM 204 OFFICIAL WASH ROOM	FLOOR TILE & MASTIC		0					ABATED ECL JOB , 2010
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		9X9 FLOOR TILE GREY		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED CHIPPED MASTIC EXPOSED: CONF ACM ECL JOB #18040
		9X9 FLOOR TILE MASTIC		0					CONFIRMED NON-ACM (ECL JOB #18040)
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1069	ROOM 203	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		GYPSUM BOARD		56 SF	< 1 SF	3	4	REPAIR	MINOR DAMAGE
1069CP	ROOM 203 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1070	ROOM 201	12X12 FLOOR TILE & MASTIC LIGHT BLUE		810 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	WORN AND MISSING MASTIC EXPOSED - 9X9S UNDERNEATH
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6		O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		GYPSUM BOARD		28 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
1070CP	ROOM 201 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD & COMPOUND		168 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		3 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
1071	CORRIDOR ROOMS 201-208								

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1071CP	CORRIDOR ROOMS 201 - 208 CEILING PLENUM	GYPSUM BOARD		32 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		38 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		9X9 FLOOR TILE & MASTIC GREY		0					ABATED ECL JOB #19947
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
1072	ROOM 111	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		28 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1072CP	ROOM 111 CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		GYPSUM BOARD		28 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		2 UNITS	1	3	1	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1073	ROOM 109	9X9 FLOOR TILE GREY		0					CONF ACM ECL JOB #18040; ABATED ECL JOB #19947
		9X9 FLOOR TILE MASTIC		0					CONFIRMED NON-ACM (ECL JOB #18040)
		FLOOR LEVELING COMPOUND		0					CONFIRMED NON-ACM (ECL JOB #18040)
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		28 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1073CP	ROOM 109 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		GYPSUM BOARD		56 SF	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1074	ROOM 107	FLOOR TILE & MASTIC		0					ABATED ECL JOB , 2010
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		28 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		GYPSUM BOARD		28 SF	0	6	5	O&M	GOOD CONDITION
1074CP	ROOM 107 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1075	ROOM 105	9X9 FLOOR TILE GREY		0					CONF ACM ECL JOB #18040; ABATED ECL JOB #19947
		9X9 FLOOR TILE MASTIC		0					CONFIRMED NON-ACM (ECL JOB #18040)
		FLOOR LEVELING COMPOUND		0					CONFIRMED NON-ACM (ECL JOB #18040)
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		28 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
1075	ROOM 105	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1076	ROOM 103	9X9 FLOOR TILE & MASTIC GREY		0					ABATED ECL JOB #19947
		9X9 FLOOR TILE & MASTIC PINK		0					ABATED ECL JOB #19947
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1076CP	ROOM 103 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1076A	ROOM 103 SOCIAL STUDIES LOUNGE	9X9 FLOOR TILE & MASTIC PINK		0					ABATED ECL JOB #19947
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WINDOW GLAZING/CAULKING		36 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM
1077	ROOM 101	9X9 FLOOR TILE & MASTIC PINK		0					ABATED ECL JOB #19947
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		110 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1077CP	ROOM 101 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1078	CORRIDOR FROM ROOM 101 TO ROOM 111	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPNUM BOARD & COMPOUND		227 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		240 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
1078CP	CORRIDOR FROM ROOM 101 TO ROOM 111 CEILING PLENUM	2X2 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		66 UNITS	2	3	1	REPAIR	MINOR DAMAGE
1079	EAST OFFICE	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		640 SF	9 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED CHIPPED MASTIC EXPOSED; 9X9 EXPOSED UNDERNEATH
		COVE BASE & MASTIC BLACK		107 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1079CP	EAST OFFICE CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1079A	EAST OFFICE COPY ROOM	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		90 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
1079B	EAST OFFICE SAFE	1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		CEMENTITIOUS CEILING MATERIAL		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1079C	EAST OFFICE BREAK ROOM	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		70 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		27 LF		7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING PINK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		1X1 CEILING TILE DECORATIVE/SPLINE		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1079D	EAST OFFICE SECURITY	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		64 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		29 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB #17-36668
		WINDOW GLAZING/CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1079E	EAST OFFICE SUPPLY STORAGE	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB #14-28692 TEM
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		45 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		19 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB #17-36668
1079F	EAST OFFICE ASST. PRINCIPAL OFFICE	JOINT COMPOUND		45 SF	7 SF	4	4	REPAIR	MISSING DRY WALL EXPOSED EDGES; CONF ACM JCB #17-36668
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ACM JCB #17-36668
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		90 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		35 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1079F	EAST OFFICE ASST. PRINCIPAL OFFICE	CONCRETE BLOCK & MORTAR		0					NON ACM JCB #17-36668
		WINDOW GLAZING/CAULKING		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB #14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1079G	EAST MAIN OFFICE SUPPLIES CLOSET	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		45 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		19 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		JOINT COMPOUND		45 SF	0	6	5	O&M	GOOD CONDITION; CONF ACM JCB#17-36668
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
1080	WOMEN'S FACULTY BATHROOM NEAR EAST OFFICE (NOW GENDER NEUTRAL LEFT)	CEILING GYPSUM BOARD		0					NON ACM JCB#17-36668
		CERAMIC FLOOR TILE GROUT & GLUE PINK		36 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		130 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ GLUE EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1081	MEN'S FACULTY BATHROOM NEAR EAST OFFICE (NOW GENDER NEUTRAL RIGHT)	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		36 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE GREEN		130 SF	9 TILES	4	N/A NON FRIABLE	REPAIR	MISSING TILES W/ GLUE EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1082	ASSISTANT PRINCIPAL'S OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		350 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED & WORN W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		57 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1082A	ASSISTANT PRINCIPAL'S BATHROOM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB #14-28692 TEM
		CERAMIC FLOOR TILE GROUT & GLUE BLUE		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE BLUE		110 SF	0	7	N/A NON FRIABLE	O&M	PATCHED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
1082B	ASSISTANT PRINCIPAL'S CLOSET	MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		15 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		11 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1083	READING CENTER S51	9X9 FLOOR TILE & MASTIC GREEN		525 SF	13 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED W/ MASTIC EXPOSED - SOME PATCHED; CONF ACM ECL JOB # 18040
		COVE BASE & MASTIC BLACK		88 LF	9 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		70 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM
		9X9 FLOOR TILE & MASTIC GREEN		168 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ECL JOB # 18040
1083A	READING CENTER OFFICE	COVE BASE & MASTIC BLACK		53 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1083B	READING CENTER GAME ROOM	9X9 FLOOR TILE & MASTIC GREEN		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ECL JOB #18040
		COVE BASE & MASTIC BLACK		41 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		PIPE INSULATION		0					REMOVED
		1 X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM
1084	EAST HEALTH OFFICE	12X12 FLOOR TILE & MASTIC MAROON		294 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		76 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1084CP	EAST HEALTH OFFICE CEILING PLENUM	2X2 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1084A	EAST HEALTH OFFICE BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BLUE		55 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE BLUE		160 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED/ SOME PATCHED
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17- 36668
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1084B	EAST HEALTH OFFICE EXAM ROOM	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		64 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		26 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17- 36668
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE FISSURE		0					NON ACM JCB#14- 28692 TEM
1084BCP	EAST HEALTH OFFICE EXAM ROOM CEILING PLENUM	MUD JOINT PACKING		1 UNIT	0	6	5	O&M	LIMITED VISUAL ACCESS
		TECTUM DECKING		0					NON ACM JCB#17- 36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1084C	EAST HEALTH OFFICE SICK ROOM 1	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		25 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB #17-36668
		WINDOW GLAZING/CAULKING		25 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE FISSURE		0					NON ACM JCB #14-28692 TEM
1084CCP	EAST HEALTH OFFICE SICK ROOM 1 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB #17-36668 TEM
1084D	EAST HEALTH OFFICE SICK ROOM 2	12X12 FLOOR TILE & MASTIC MAROON		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		25 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB #17-36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE FISSURE		0					NON ACM JCB #14-28692 TEM
1084DCP	EAST HEALTH OFFICE SICK ROOM 2 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB #17-36668 TEM
1084E	EAST HEALTH OFFICE SICK ROOM 3	12X12 FLOOR TILE & MASTIC MAROON		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		25 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB #17-36668
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE FISSURE		0					NON ACM JCB #14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1084ECP	EAST HEALTH OFFICE SICK ROOM 3 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1084F	EAST HEALTH OFFICE SUPPLY CLOSET	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		66 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	LIFTING
		COVE BASE & MASTIC BLACK		30 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		JOINT COMPOUND		66 SF	< 1 SF	3	4	REPAIR	PATCHED; CONF ACM JCB#17-36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		PIPE INSULATION		0					REMOVED DEC 2022 (ECL JOB #23078)
1085	CORRIDOR EAST OFFICE - WEIGHT ROOM	CEILING GYPSUM BOARD		0					NON ACM JCB#17-36668
		TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		190 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		5 DOORS	0	6	5	O&M	GOOD CONDITION
1085CP	CORRIDOR EAST OFFICE - WEIGHT ROOM CEILING PLENUM	2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		51 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1086	LECTURE HALL STAGE	WOOD FLOOR TAR/VAPOR BARRIER		1500 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPNUM BOARD & COMPOUND		150 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		FIRE CURTAINS RED		400 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
1086A	LECTURE HALL STAGE STORAGE	MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		WOOD FLOOR TAR/VAPOR BARRIER		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1087	LECTURE HALL	12X12 FLOOR TILE & MASTIC GOLD WATERCOLOR		940 SF	0	7	N/A NON FRIABLE	O&M	NEW 18X18 GRAY FLOOR TILE
		COVE BASE & MASTIC BEIGE		400 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		150 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		FIRE CURTAINS RED		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		PEGBORD		704 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
1087CP	LECTURE HALL CEILING PLENUM	CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		CERAMIC FLOOR TILE GROUT & GLUE		0					NEW MATERIAL, NOT SUSPECT
		CERAMIC WALL TILE GROUT & GLUE		0					NEW MATERIAL, NOT SUSPECT
1088	WOMEN'S BATHROOM NEAR LECTURE HALL	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		1 UNIT	1	3	1	REPAIR	MINOR DAMAGE
1088CP	WOMEN'S BATHROOM NEAR LECTURE HALL CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1089	MEN'S ROOM NEAR LECTURE HALL	CERAMIC FLOOR TILE GROUT & GLUE		0					NEW MATERIAL, NOT SUSPECT
		CERAMIC WALL TILE GROUT & GLUE		0					NEW MATERIAL, NOT SUSPECT
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
1089CP	MEN'S ROOM NEAR LECTURE HALL CEILING PLENUM	MUD JOINT PACKING		1 UNIT	0	6	5	O&M	LIMITED VISUAL ACCESS
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1090	CORRIDOR LECTURE HALL - EAST OFFICE	12X12 FLOOR TILE & MASTIC GOLD WATERCOLOR		63 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		COVE BASE & MASTIC BLACK		63 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL PATCH MATERIAL		14 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		GYPNUM BOARD & COMPOUND		28 SF	0	6	5	O&M	GOOD CONDITION
1090CP	CORRIDOR LECTURE HALL - EAST OFFICE CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1091	LIBRARY	9X9 FLOOR TILE & MASTIC		2340 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BEIGE		2340 SF	15 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		COVE BASE & MASTIC BLACK		186 LF	60 LF	4	N/A NON FRIABLE	REPAIR	MISSING, DELAMINATING W/ MASTIC EXPOSED, SOME ENCAPSULATED IN PAINT ¹
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYP SUM BOARD & COMPOUND		200 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		250 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
		TECTUM CEILING PLENUM		0					NON ACM JCB#17-36668 TEM
		12X12 FLOOR TILE & MASTIC BEIGE		372 SF	0	7	N/A NON FRIABLE	O&M	CARPET OBSERVED
1091A	LIBRARY REFERENCE ROOM	COVE BASE & MASTIC BROWN		75 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM
1091ACP	LIBRARY REFERENCE ROOM CEILING PLENUM	GYP SUM BOARD		40 SF	< 1 SF	3	4	REPAIR	WATER STAINED
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1091A1	LIBRARY REFERENCE ROOM SERVER ROOM	9X9 FLOOR TILE & MASTIC PINK		198 SF	13 TILES	4	N/A NON FRIABLE	REPAIR	MISSING CRACKED ANDNNMASTIC EXPOSED
		COVE BASE & MASTIC BROWN		59 LF	10 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING PINK		0					REMOVED
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1091A1A	LIBRARY REFERENCE ROOM SERVER ROOM STORAGE	9X9 FLOOR TILE & MASTIC TAN		126 SF	0	7	N/A NON FRIABLE	O&M	CARPET OBSERVED
		COVE BASE & MASTIC BROWN		36 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPSUM BOARD		56 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1091A1ACP	LIBRARY REFERENCE ROOM SERVER ROOM STORAGE CEILING PLENUM	FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE		0					NON ACM JCB#14-28692 TEM
1091A1ACP	LIBRARY REFERENCE ROOM SERVER ROOM STORAGE CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1091B	LIBRARY COMP ROOM 102	12X12 FLOOR TILE & MASTIC BEIGE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		108 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		70 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
1091C	LIBRARY OFFICE	1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM
		12X12 FLOOR TILE & MASTIC BEIGE		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		19 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
1091D	LIBRARY BREAK ROOM	1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM
		12X12 FLOOR TILE & MASTIC BEIGE		240 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		53 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING PINK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1091E	LIBRARY STAFF ROOM	9X9 FLOOR TILE & MASTIC PINK		360 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		70 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1091E1	LIBRARY STORAGE	9X9 FLOOR TILE & MASTIC PINK		120 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		COVE BASE & MASTIC BROWN		43 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		VIBRATION REDUCER CLOTH WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					REMOVED DEC 2022 (ECL JOB #23078)
		TECTUM DECKING		0					NON ACM JCB#17- 36668 TEM
1092	NORTH CORRIDOR MAIN GYM	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECL JOB #23546)
		GLAZED BLOCK MORTAR		584 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL PLASTER		0					CONFIRMED NON-ACM (ECL JOB #17185)
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECL JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECL JOB #22414)
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE ROUGH		0					NON ACM JCB#14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1092CP	NORTH CORRIDOR MAIN GYM CEILING PLENUM	MUD JOINT PACKING		2 UNITS	1	3	1	REPAIR	MINOR DAMAGE
1092A	BREEZEWAY OFF NORTH CORRIDOR MAIN GYM	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION METAL		16 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
1092ACP	BREEZEWAY OFF NORTH CORRIDOR MAIN GYM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1093	STAIRWELL TO BOY'S LOCKER ROOM	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		648 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1093CP	STAIRWELL TO BOY'S LOCKER ROOM CEILING PLENUM	FIRE BRICK & MORTAR		14 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1094	NORTH CORRIDOR 2 OFF OF MAIN GYM	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		236 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYP SUM BOARD & COMPOUND		258 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION METAL		0					REMOVED
		2X2 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		FIRE BRICK & MORTAR		12 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
1095	STAIRWELL TO BOY'S LOCKER ROOM COACH OFFICE	GLAZED BLOCK MORTAR		772 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL PLASTER		0					CONFIRMED NON-ACM (ECI JOB #17185)
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION METAL		3 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
		STAIRWELL TO BOY'S LOCKER ROOM COACH OFFICE CEILING PLENUM							
1095CP	STAIRWELL TO BOY'S LOCKER ROOM COACH OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1096	CORRIDOR EAST OF WEST GYM	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #20329)
		GLAZED BLOCK MORTAR		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYPNUM BOARD & COMPOUND		212 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION METAL		0					REMOVED
		FIRE DOOR INSULATION WOOD		0					REMOVED
		2X4 CEILING TILE ROUGH		0					NON ACM JCB #14-28692 TEM
		FIBERBOARD		40 SF	0	6	5	O&M	LIMITED VISUAL ACCESS
1096CP	CORRIDOR EAST OF WEST GYM CEILING PLENUM	NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE BRICK & MORTAR		12 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1097	STAIRWELL TO GIRLS LOCKER ROOM OFFICE	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		772 SF	0	7	N/A NON FRIABLE	O&M	PATCHED. GOOD CONDITION.
		WALL PLASTER		0					CONFIRMED NON-ACM (ECL JOB #17185)
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION METAL		3 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB #14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1097CP	STAIRWELL TO GIRL'S LOCKER ROOM OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1098	CORRIDOR STAIR 1097 TO 700 WING	TERRAZZO FLOORING WHITE WITH BLACK, TAN CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #23546)
		WALL PLASTER		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WINDOW GLAZING/CAULKING		210 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
1098CP	CORRIDOR STAIR 1097 TO 700 WING CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1099	CORRIDOR SOUTH OF WEST GYM	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		584 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		126 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		10 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1099CP	CORRIDOR SOUTH OF WEST GYM CEILING PLENUM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		MUD JOINT PACKING		11 UNITS	0	6	5	O&M	GOOD CONDITION
		FIRE BRICK & MORTAR		14 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECL JOB #23546)
1099A	CORRIDOR FROM MEN'S BATHROOM TO WOMEN'S BATHROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL PLASTER		0					CONFIRMED NON-ACM (ECL JOB #17185)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB #14-28692 TEM
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
1099ACP	CORRIDOR FROM MEN'S BATHROOM TO WOMEN'S BATHROOM CEILING PLENUM	GYPNUM BOARD & COMPOUND		98 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		9 UNITS	0	6	5	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC WHITE WITH SPECKLES		150 SF	0	7	N/A NON FRIABLE	O&M	NEW 12X12 FLOOR TILE OBSERVED
		COVE BASE & MASTIC GREY		13 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1100	ELEVATOR VESTIBULE	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPNUM BOARD & COMPOUND		40 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE ROUGH		0					NON ACM JCB #14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1100CP	ELEVATOR VESTIBULE CEILING PLENUM	NON-GLASS WINDOW PANEL TRANSITE		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE BRICK & MORTAR		8 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1100A	ELEVATOR MECHANICAL ROOM	12X12 FLOOR TILE & MASTIC WHITE WITH SPECKLES		40 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		COVE BASE & MASTIC GREY		31 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1100B	ELEVATOR	12X12 FLOOR TILE & MASTIC WHITE/MULTICOLOR		30 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	WORN. CONFIRMED NON-ACM (ECL JOB #23546)
		TERRAZZO FLOORING TAN		0					
		GLAZED BLOCK MORTAR		648 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1101	STAIRWELL TO GIRLS LOCKER ROOM	FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14- 28692 TEM
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1101CP	STAIRWELL TO GIRLS LOCKER ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1102	AUDITORIUM STAIRWELL SOUTH	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECL JOB #23546)
		WALL PLASTER		0					CONFIRMED NON-ACM (ECL JOB #17185)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE ROUGH		0					NON ACM JCB#14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1102CP	AUDITORIUM STAIRWELL SOUTH CEILING PLENUM	GYPSUM BOARD & COMPOUND		176 SF	0	6	5	O&M	GOOD CONDITION
1103	GIRL'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREY		228 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED.
		CERAMIC WALL TILE GROUT & GLUE WHITE		531 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	NEW MATERIAL. CRACKED AND CHIPPED
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ACM JCB#14-28692 TEM
1103CP	GIRL'S BATHROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1104	EXCHANGE (PREVIOUSLY CUSTODIAL STORAGE)	9X9 FLOOR TILE & MASTIC BEIGE		0					REMOVED JULY 2022 (EC1 JOB #22536)
		COVE BASE & MASTIC BROWN		0					RENOVATED JULY 2022
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1104CP	CUSTODIAL STORAGE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1105	MEN'S ROOM NEAR WEST GYM	CERAMIC FLOOR TILE GROUT & GLUE GREY		180 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED
		CERAMIC WALL TILE GROUT & GLUE WHITE		460 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED.
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
1105CP	MEN'S ROOM NEAR WEST GYM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1105A	MEN'S ROOM NEAR WEST GYM CUSTODIAL CLOSET	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CERAMIC WALL BASE GROUT & GLUE WHITE		14 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1106	AUDITORIUM STAIRWELL NORTH	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECL JOB #23546)
		WALL PLASTER		0					CONFIRMED NON-ACM (ECL JOB #17185)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		GYPSUM BOARD & COMPOUND		176 SF	<1 SF	3	4	REPAIR	CHIPPED
1106CP	AUDITORIUM STAIRWELL NORTH CEILING PLENUM	12X12 FLOOR TILE & MASTIC GREY PEBBLED		0					NON ACM JCB#18-39291
1107	AUDITORIUM NEAR ENTRANCE CORRIDOR EAST	FLOOR LEVELING COMPOUND		0					NON ACM JCB#18-39291
		COVE BASE & MASTIC BROWN		400 LF	0	7	N/A NON FRIABLE	O&M	BLACK COVE BASE OBSERVED
		WALL PLASTER		0					CONFIRMED NON-ACM (ECL JOB #17185)
		WINDOW GLAZING/CAULKING		0					INT. & EXT. CAULKING & GLAZING NON ACM ECL JOB #17592
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECL JOB #22414)
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		EXTERIOR DOOR CAULKING		0					CONFIRMED NON-ACM (ECL JOB #17592)
		2X2 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1107CP	AUDITORIUM NEAR ENTRANCE CORRIDOR EAST CEILING PLENUM	NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		MUD JOINT PACKING		47 UNITS	0	6	5	O&M	GOOD CONDITION
1108/0052	BASEMENT STAIRWELL	9X9 FLOOR TILE & MASTIC BEIGE		28 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		19 LF	6 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		CEMENTITIOUS WALL PLASTER		162 SF	20 SF	4	N/A NON FRIABLE	REPAIR	WATER DAMAGED
		SKYLIGHT CAULKING		8 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB #14-28692 TEM
1108/0052 CP	BASEMENT STAIRWELL CEILING PLENUM								NO ACCESS
1109	STAGE STORAGE ROOM 601	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
1109A	STAGE STORAGE ROOM 601 CLOSET	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
1110	FACULTY MEN'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BLUE		36 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	MISSING AND CHIPPED.
		CERAMIC WALL TILE GROUT & GLUE WHITE		186 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED.
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1110CP	FACULTY MEN'S BATHROOM CEILING PLENUM	CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECL JOB #17185)
1111	FACULTY WOMEN'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE WHITE		36 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		189 SF	5 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ GLUE EXPOSED
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1111CP	FACULTY WOMEN'S BATHROOM CEILING PLENUM	2X2 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		CEILING PLASTER SMOOTH		0					NON ACM JCB#15-30822
		LINOLEUM FLOORING		1222 SF	0	7	N/A NON FRIABLE	O&M	NEW 12X12 FLOOR TILE OBSERVED
		COVE BASE & MASTIC BLACK		131 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
1112	ROOM 603	CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WALL/CHALK-BOARD MASTIC		108 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					INT. & EXT. CAULKING & GLAZING NON ACM ECL JOB #17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1112CP	ROOM 603 CEILING PLENUM								NO ACCESS

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1112A	ROOM 603/605 OFFICE	9X9 FLOOR TILE & MASTIC		0					ABATED 2007 REINSPECTION
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WINDOW GLAZING/CAULKING		0					INT. & EXT. CAULKING & GLAZING NON ACM ECL JOB #17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1112ACP	ROOM 603/605 OFFICE CEILING PLENUM								NO ACCESS
1112B	ROOM 603 OFFICE	9X9 FLOOR TILE & MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC PEACH		0					NEW MATERIAL, NOT SUSPECT
		COVE BASE & MASTIC BLACK		0					NEW MATERIAL, NOT SUSPECT
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1112BCP	ROOM 603 OFFICE CEILING PLENUM	MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1113	Room 605	9X9 FLOOR TILE & MASTIC		NOT QUANTIFIED	3 TILES	4	N/A NON FRIABLE	REPAIR	UNDER 12X12 FLOOR TILE - CONFIRMED ACM (ECL JOB #21149)
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					INT. & EXT. CAULKING & GLAZING NON ACM ECL JOB #17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1113A	Room 605 OFFICE	9X9 FLOOR TILE & MASTIC		NOT QUANTIFIED	1 TILE	4	N/A NON FRIABLE	REPAIR	EXPOSED UNDER 12X12 FLOOR TILE - CONFIRMED ACM (ECL JOB #21149)
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1113ACP	ROOM 605 OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1114	CORRIDOR CLOSET 1	12X12 FLOOR TILE MASTIC		18 SF	18 SF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1115	CORRIDOR CLOSET 2	12X12 FLOOR TILE & MASTIC PEACH		27 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		COVE BASE & MASTIC BLACK		21 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC PEACH		60 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
1116	CORRIDOR CLOSET 3	COVE BASE & MASTIC BLACK		36 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
1117	CORRIDOR CLOSET 4	SEE SPACE ID 1116 FOR ASSESSMENT							
1118	CORRIDOR CLOSET 5	SEE SPACE ID 1116 FOR ASSESSMENT							
1119	CORRIDOR CLOSET 6	12X12 FLOOR TILE & MASTIC PEACH		18 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		COVE BASE & MASTIC BLACK		15 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1120	ROOM 607	9X9 FLOOR TILE & MASTIC GREY		0					REMOVED JULY 2022 (ECI JOB #22536)
		9X9 FLOOR TILE & MASTIC LIGHT TAN		0					REMOVED JULY 2022 (ECI JOB #22536)
		COVE BASE & MASTIC BROWN		0					REMOVED JULY 2022
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		GYPNUM BOARD & COMPOUND		260 SF	2 SF	3	4	REPAIR	DENTED AND CHIPPED.
		WINDOW GLAZING/CAULKING		0					INT. & EXT. CAULKING & GLAZING NON ACM ECL JOB #17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		PEGBOARD		260 SF	20 LF	4	N/A NON FRIABLE	REPAIR	SCRAPED
		1X1 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM
1121	ROOM 609 BAND ROOM	9X9 FLOOR TILE & MASTIC GREY		0					REMOVED JULY 2022 (ECI JOB #22536)
		9X9 FLOOR TILE & MASTIC LIGHT TAN		0					REMOVED JULY 2022 (ECI JOB #22536)
		COVE BASE & MASTIC BROWN		0					REMOVED JULY 2022 (ECI JOB #22536)
		CONCRETE BLOCK & MORTAR		0					REMOVED JULY 2022
		GYPNUM BOARD & COMPOUND		260 SF	<1 SF	3	4	REPAIR	CONFIRMED NON-ACM (ECL JOB #20329)
		WALL/CHALK-BOARD MASTIC		110 SF	0	7	N/A NON FRIABLE	O&M	DENTED
		SKYLIGHT CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		PEGBOARD		572 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM
		CEILING GYPNUM BOARD		1419 SF	3 SF	3	4	REPAIR	DENTED.

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1122	GENDER NEUTRAL BATHROOM (PREVIOUSLY BOY'S BATHROOM)	CERAMIC FLOOR TILE GROUT & GLUE GREY		121 SF	0	7	N/A NON FRIABLE	O&M	NEW MATERIAL
		CERAMIC WALL TILE GROUT & GLUE GREY		352 SF	0	7	N/A NON FRIABLE	O&M	NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
1122CP	BOY'S BATHROOM CEILING PLENUM	SKYLIGHT CAULKING		8 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		8 UNITS	0	6	5	O&M	GOOD CONDITION
		TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL BASE GROUT & GLUE OFF WHITE		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1123	CUSTODIAL CLOSET	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #20329)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
1124	GIRL'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREY		117 SF	0	7	N/A NON FRIABLE	O&M	NEW MATERIAL
		CERAMIC WALL TILE GROUT & GLUE WHITE		349 SF	0	7	N/A NON FRIABLE	O&M	NEW MATERIAL
		MIRROR MASTIC		3 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1124CP	GIRL'S BATHROOM CEILING PLENUM	2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
		SKYLIGHT CAULKING		8 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1125	ROOM 611/613/615	12X12 FLOOR TILE & MASTIC PEACH		656 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED WITH MASTIC EXPOSED.
		COVE BASE & MASTIC BLACK		105 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		GYPSUM BOARD & COMPOUND		915 SF	1 SF	3	4	REPAIR	MINOR DAMAGE
		FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ACM JCB#14-28692 TEM
1125CP	ROOM 611/613/615 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1126	RECORDING STUDIO (FORMER MARCHING BAND STORAGE)	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC BEIGE		0					ABATED JCB#11-21423
		12X12 FLOOR TILE & MASTIC BEIGE		0					ABATED ENVIROSCIENCE, 2010
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
1126A	601 TO MARCHING BAND STORAGE CORRIDOR	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL PLASTER		0					NON ACM ENVIROSCIENCE#17185
		FIRE DOOR INSULATION METAL		5 DOORS	0	6	5	O&M	GOOD CONDITION
		EXTERIOR DOOR CAULKING		0					NON ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1126ACP	601 TO MARCHING BAND STORAGE CORRIDOR CEILING PLENUM	GYPSON BOARD & COMPOUND		48 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		60 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1126B	AUDITORIUM NEAR ENTRANCE CORRIDOR WEST	12X12 FLOOR TILE & MASTIC GREY PEBBLED		1568 SF		7	N/A NON FRIABLE	O&M	18X18 GRAY FLOOR TILE OBSERVED
		COVE BASE & MASTIC BROWN		400 LF		7	N/A NON FRIABLE	O&M	BLACK COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL PLASTER		0					NON ACM ENVIROSCIENCE#17185
		WINDOW GLAZING/CAULKING		0					INT. & EXT. CAULKING & GLAZING NON ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		EXTERIOR DOOR CAULKING		0					NON ACM ENVIROSCIENCE#17592
		2X2 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
1126BCP	AUDITORIUM NEAR ENTRANCE CORRIDOR WEST CEILING PLENUM	MUD JOINT PACKING		50 UNITS	0	6	5	O&M	GOOD CONDITION
1127	AUDITORIUM STAGE	WOOD FLOOR TAR/VAPOR BARRIER		5320 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE CURTAINS RED & BLACK		4200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		3 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		0					REPLACED
		INDUSTRIAL WALL PAPER		1350 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		17 UNITS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1127A	WEST CATWALK 1	NONE OBSERVED							NONE OBSERVED
1127B	WEST CATWALK 2	TRANSITE BOARD		40 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	NO ACCESS (PREVIOUSLY DAMAGED)
1128	AUDITORIUM	CARPET MASTIC		890 SF	4 LF	4	N/A NON FRIABLE	REPAIR	PEELED BACK.
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL PLASTER		0					NON ACM ENVIROSCIENCE#17185; NON ACM ENVIROSCIENCE#18040
		FIRE DOOR INSULATION WOOD		18 DOORS	0	6	5	O&M	GOOD CONDITION; 1 DOOR REPLACED; 17 DOORS REMAIN
		INDUSTRIAL WALL PAPER		0					REMOVED
		WALL COVERING & MASTIC BLACK		N/A	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS; CONF ACM ENVIROSCIENCE#18040
		2X4 CEILING TILE		0					NON ACM JCB#14-28692 TEM
		CEILING PLASTER SMOOTH		0					NON ACM JCB#15-32498

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1129	WEST MAIN GYM	WOOD FLOOR TAR/VAPOR BARRIER		3340 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC FLOOR TILE GROUT & GLUE PINK		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		428 LF	20 LF	4	N/A NON FRIABLE	REPAIR	MISSING, DENTED WITH MASTIC EXPOSED.
		CERAMIC WALL TILE GROUT & GLUE BROWN		245 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM
		FIRE DOOR INSULATION WOOD		22 DOORS	0	6	5	O&M	ENVIROSCIENCE#20329 GOOD CONDITION
		MUD JOINT PACKING		5 UNITS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1129A	WEST MAIN GYM EQUIPMENT STORAGE	WOOD FLOOR TAR/VAPOR BARRIER		290 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		47 LF	14 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		CONCRETE BLOCK & MORTAR		0					NON ACM
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		290 SF	4 SF	3	4	REPAIR	MISCELLANEOUSLY DENTED
1129B	WEST MAIN GYM TRAINER'S ROOM	12X12 FLOOR TILE & MASTIC PEACH		290 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		65 LF	2 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		JOINT COMPOUND		290 SF	8 LF	3	4	REPAIR	WATER DAMAGE; CONF ACM JCB#17-36668
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ACM JCB#17-36668

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1130	STAIRWELL NEAR MAIN OFFICE	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		410 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYPSUM BOARD & COMPOUND		110 SF	0	6	5	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		22 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING (INTERIOR WINDOW SYSTEM)		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
1130CP	STAIRWELL NEAR MAIN OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1130A	STAIRWELL NEAR MAIN OFFICE CEILING PLENUM	SEE SPACE ID 031 FOR ASSESSMENT							

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1131	MAIN OFFICE	12X12 FLOOR TILE & MASTIC BROWN WATERCOLOR		40 SF		7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC LIGHT BROWN		800 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WINDOW GLAZING/CAULKING		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		0					NON ACM JCB#17-36668
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
1131CP	MAIN OFFICE CEILING PLENUM	MUD JOINT PACKING		4 UNITS	0	6	5	O&M	GOOD CONDITION
1131A	MAIN OFFICE HALLWAY	12X12 FLOOR TILE & MASTIC BROWN WATERCOLOR		4 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC LIGHT BROWN		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		22 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		2X4 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
1131ACP	MAIN OFFICE HALLWAY CEILING PLENUM	FIRE BRICK & MORTAR		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1131B	MAIN OFFICE COPY ROOM	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		90 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	LIFTING; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BLACK		32 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		JOINT COMPOUND		40 SF	0	6	5	O&M	GOOD CONDITION; CONF ACM JCB#17-36668
		GYPSUM BOARD		0					NON ACM JCB#17-36668
		WALL/CHALK-BOARD MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		10 UNITS	0	6	5	O&M	GOOD CONDITION
1131BCP	MAIN OFFICE COPY ROOM CEILING PLENUM	12X12 FLOOR TILE & MASTIC BROWN WATERCOLOR		30 SF		7	N/A NON FRIABLE	O&M	GOOD CONDITION
1131C	MAIN OFFICE ASSISTANT PRINCIPAL'S OFFICE	12X12 FLOOR TILE & MASTIC LIGHT BROWN		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		55 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		JOINT COMPOUND		495 SF	0	6	5	O&M	GOOD CONDITION; CONF ACM JCB#17-36669
		GYPSUM BOARD		0					NON ACM JCB#17-36668
		WINDOW GLAZING/CAULKING		24 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1131CCP	MAIN OFFICE ASSISTANT PRINCIPAL'S OFFICE CEILING PLENUM	MUD JOINT PACKING		8 UNITS	0	6	5	O&M	GOOD CONDITION
1131D	MAIN OFFICE BREAK ROOM	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		280 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BLACK		69 LF	6 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17- 36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		4 UNITS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14- 28692 TEM
1131DCP	MAIN OFFICE BREAK ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1131E	MAIN OFFICE PRINCIPAL SECRETARY AREA	12X12 FLOOR TILE & MASTIC BROWN WATERCOLOR		40 SF	0	7	N/A NON FRIABLE	O&M	CARPET OBSERVED
		12X12 FLOOR TILE & MASTIC LIGHT BROWN		200 SF	0	7	N/A NON FRIABLE	O&M	CARPET OBSERVED
		COVE BASE & MASTIC BLACK		58 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17- 36668
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE SPLASH		0					NON ACM JCB#14- 28692 TEM

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1131ECP	MAIN OFFICE PRINCIPAL SECRETARY AREA CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1132	BOY'S BATHROOM NEAR MAIN OFFICE	CERAMIC FLOOR TILE GROUT & GLUE		172 SF	0	7	N/A NON FRIABLE	O&M	NEW MATERIAL, NOT SUSPECT
		CERAMIC WALL TILE GROUT & GLUE		504 SF	0	7	N/A NON FRIABLE	O&M	NEW MATERIAL, NOT SUSPECT
		WINDOW GLAZING/CAULKING		18 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
1132CP	BOY'S BATHROOM NEAR MAIN OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1133	STORAGE 7C	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1133CP	STORAGE 7C CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1134	PRINCIPAL'S OFFICE	12X12 FLOOR TILE & MASTIC BROWN WATERCOLOR		30 SF	0	7	N/A NON FRIABLE	O&M	CARPET OBSERVED
		12X12 FLOOR TILE & MASTIC LIGHT BROWN		190 SF	0	7	N/A NON FRIABLE	O&M	CARPET OBSERVED
		COVE BASE & MASTIC BLACK		60 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
1134CP	PRINCIPAL'S OFFICE CEILING PLENUM	FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
		CARPET MASTIC		9 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
1134A	PRINCIPAL'S OFFICE CLOSET	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM
		TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE BEIGE		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1134B	PRINCIPAL'S OFFICE BATHROOM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1135	CONFERENCE ROOM	12X12 FLOOR TILE & MASTIC WHITE/BROWN		0					CONF ACM ENVIROSCIENCE#18705; ABATED ENVIROSCIENCE#19947
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		WALL PANEL MASTIC		0					NON ACM ENVIROSCIENCE#18705
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		5 UNITS	0	6	5	O&M	GOOD CONDITION
1135CP	CONFERENCE ROOM CEILING PLENUM	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
1136	STAIRWELL NEAR CONFERENCE ROOM	GLAZED BLOCK MORTAR		2044 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		WALL PLASTER		0					NON ACM ENVIROSCIENCE#17185
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
1136CP	STAIRWELL NEAR CONFERENCE ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1137	BASEMENT STORAGE ENT./STAIR	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1138	CUSTODIAL CLOSET	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL BASE GROUT & GLUE GREY		19 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1138CP	CUSTODIAL CLOSET CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1139	WEST HEALTH OFFICE	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		400 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		79 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
1139CP	WEST HEALTH OFFICE CEILING PLENUM	MUD JOINT PACKING		8 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1139A	WEST HEALTH OFFICE SICK ROOM 1	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		36 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		22 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1139ACP	WEST HEALTH OFFICE SICK ROOM 1 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1139B	WEST HEALTH OFFICE SICK ROOM 2	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		36 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		22 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1139BCP	WEST HEALTH OFFICE SICK ROOM 2 CEILING PLENUM								NO ACCESS
1139C	WEST HEALTH OFFICE SICK ROOM 3	12X12 FLOOR TILE & MASTIC MAROON		36 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		22 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1139CCP	WEST HEALTH OFFICE SICK ROOM 3 CEILING PLENUM								NO ACCESS
1139D	WEST HEALTH OFFICE SICK ROOM 4	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		36 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		22 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB #17- 36668
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB #14- 28692 TEM
1139DCP	WEST HEALTH OFFICE SICK ROOM 4 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1139E	WEST HEALTH OFFICE BATHROOM	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE BEIGE		135 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
1139F	WEST HEALTH OFFICE CLOSET	12X12 FLOOR TILE & MASTIC MAROON		12 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		COVE BASE & MASTIC BLACK		10 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB #17- 36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE		0					NON ACM JCB #14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1140	FACULTY MEN'S ROOM NEAR WEST HEALTH OFFICE	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE GREEN		442 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED TILES
		WALL/CHALK-BOARD MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		25 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE# 17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE# 17185
		12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		956 SF	52 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		COVE BASE & MASTIC BLACK		88 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE# 20329
1141	GUIDANCE OFFICE	FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		988 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14- 28692 TEM
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE SPLASH		0					NON ACM JCB#14- 28692 TEM
1141CP	GUIDANCE OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1141A	GUIDANCE COUNSELOR OFFICE 1	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		100 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		COVE BASE & MASTIC BLACK		37 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		339 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14-28692 TEM
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM
1141ACP	GUIDANCE COUNSELOR OFFICE 1 CEILING PLENUM	GYPSUM BOARD		10 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
1141B	GUIDANCE COUNSELOR OFFICE 2	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		130 SF	12 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		COVE BASE & MASTIC BLACK		43 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		234 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	WATER STAINED
		2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14-28692 TEM
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1141BCP	GUIDANCE COUNSELOR OFFICE 2 CEILING PLENUM	MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
1141C	GUIDANCE COUNSELOR OFFICE 3	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		80 SF	15 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		COVE BASE & MASTIC BLACK		8 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		72 SF	4 SF	4	N/A NON FRIABLE	REPAIR	WATER STAINED
		2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14- 28692 TEM
1141CCP	GUIDANCE COUNSELOR OFFICE 3 CEILING PLENUM	MUD JOINT PACKING		9 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1141D	GUIDANCE OFFICE FILE/BREAK ROOM	12X12 FLOOR TILE & MASTIC BEIGE		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		47 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14- 28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1141DCP	GUIDANCE OFFICE FILE/BREAK ROOM CEILING PLENUM	MUD JOINT PACKING		8 UNITS	0	6	5	O&M	GOOD CONDITION
1141E	GUIDANCE COUNSELOR OFFICE 4	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		80 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		COVE BASE & MASTIC BLACK		8 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		32 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14- 28692 TEM
1141ECP	GUIDANCE COUNSELOR OFFICE 4 CEILING PLENUM	MUD JOINT PACKING		6 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1141F	GUIDANCE COUNSELOR OFFICE 5	12X12 FLOOR TILE & MASTIC MAROON		80 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		COVE BASE & MASTIC BLACK		8 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		72 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		80 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
1141G	GUIDANCE COUNSELOR OFFICE 6	COVE BASE & MASTIC BLACK		8 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		72 SF		7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1141GCP	GUIDANCE COUNSELOR OFFICE 6 CEILING PLENUM	GYPSUM BOARD		15 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		10 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		40 SF	5 SF	4	N/A NON FRIABLE	REPAIR	WATER STAINED & PEELING
		2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14- 28692 TEM
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		MUD JOINT PACKING		1 UNIT	0	6	5	O&M	LIMITED VISUAL ACCESS
1141HCP	GUIDANCE COUNSELOR OFFICE 7 CEILING PLENUM								

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
11411	GUIDANCE COUNSELOR OFFICE 8	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		120 SF	12 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		COVE BASE & MASTIC BLACK		22 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		140 SF	1 SF	4	N/A NON FRIABLE	REPAIR	WATER STAINED
		2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14-28692 TEM
11411CP	GUIDANCE COUNSELOR OFFICE 8 CEILING PLENUM	2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		80 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		COVE BASE & MASTIC BLACK		8 LF		7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
1141J	GUIDANCE COUNSELOR OFFICE 9	NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		72 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14-28692 TEM
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		MUD JOINT PACKING		2 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1141K	GUIDANCE COUNSELOR OFFICE 10	12X12 FLOOR TILE & MASTIC MAROON WATERCOLOR		80 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	WORN BY THE CHAIR
		COVE BASE & MASTIC BLACK		18 LF	10 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INDUSTRIAL WALL PAPER		144 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1141KCP	GUIDANCE COUNSELOR OFFICE 10 CEILING PLENUM	2X4 CEILING TILE DEEP SPLASH		0					NON ACM JCB#14-28692 TEM
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		MUD JOINT PACKING		2 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1142	CORRIDOR MAIN OFFICE- GUIDANCE OFFICE	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
1142CP	CORRIDOR MAIN OFFICE GUIDANCE OFFICE CEILING PLENUM	MUD JOINT PACKING		31 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE; 24 UNITS ABATED ENVIROSCIENCE#20417

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1143	CORRIDOR GUIDANCE OFFICE - ROOM 917	TERRAZZO FLOORING WHITE WITH BLACK		0					NON ACM JCB #16-34359
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB #16-34359
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		EXTERIOR DOOR CAULKING		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
1143CP	CORRIDOR GUIDANCE OFFICE - ROOM 917 CEILING PLENUM	2x4 CEILING TILE TEXTURED		0					NON ACM JCB #14-28692 TEM
		MUD JOINT PACKING		4 UNITS	0	6	5	O&M	GOOD CONDITION
		TERRAZZO FLOORING BROWN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		1250 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE W PURPOSEFUL HOLE
1144	STAIRWELL NEAR ROOM 918	FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE TEXTURED		0					NON ACM JCB #14-28692 TEM
		FIRE BRICK & MORTAR		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1145	ROOM 917	9X9 FLOOR TILE & MASTIC GREY		810 SF	70 TILES	4	N/A NON FRIABLE	REPAIR	CRACKS DUE TO CUPPING
		COVE BASE & MASTIC BLACK		111 LF		7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		FIRE BRICK & MORTAR		3 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1145CP	ROOM 917 CEILING PLENUM								

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1146	ROOM 918	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	67 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED W/ MASTIC EXPOSED & CRACKS DUE TO CURPING ; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		111 LF	14 LF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		250 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		FIRE BRICK & MORTAR		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		9X9 FLOOR TILE & MASTIC CREAM/BROWN		132 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS; CONF ACM ENVIROSCIENCE#18040
1146A	ROOM 918 STORAGE	COVE BASE & MASTIC BROWN		43 LF	2 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1146ACP	ROOM 918 STORAGE CEILING PLENUM	FIRE BRICK & MORTAR		5 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1147	GIRL'S BATHROOM NEAR ROOM 918	TERRAZZO FLOORING RED		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE PINK		687 SF	30 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
1148	CUSTODIAL CLOSET NEAR ROOM 916	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
		TERRAZZO FLOORING BROWN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL BASE GROUT & GLUE OFF WHITE		33 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY - CRACKED, CHIPPED & MISSING TILES
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1148CP	CUSTODIAL CLOSET NEAR ROOM 916 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1149	BOY'S BATHROOM NEAR ROOM 916	TERRAZZO FLOORING WHITE WITH BLUE		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE GREEN		687 SF	24 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
1150	ROOM 916	9X9 FLOOR TILE & MASTIC LIGHT GREEN		810 SF	810 SF	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED W/ MASTIC EXPOSED DUE TO CUPPING. ALL TILES IMPACTED
		COVE BASE & MASTIC BROWN		111 LF	15 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1150CP	ROOM 916 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1151	ROOM 915	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		480 SF	380 SF	1	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED W/ MASTIC EXPOSED DUE TO CUPPING; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		49 LF	22 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING COVE BASE W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		75 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6		O&M	GOOD CONDITION
1151CP	ROOM 915 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	600 SF	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED TILES W/ MASTIC EXPOSED DUE TO CUPPING ; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		81 LF	9 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
1152	ROOM 914	NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6		O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1152CP	Room 914 CEILING PLENUM	FIRE BRICK & MORTAR		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1153	FACULTY ROOM NEAR ROOM 914	9X9 FLOOR TILE & MASTIC PINK		0					REMOVED JULY 2022 (ECI JOB #22536)
		COVE BASE & MASTIC BROWN		0					RENOVATED JULY 2022
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1153CP	FACULTY ROOM NEAR ROOM 914 CEILING PLENUM	FIRE BRICK & MORTAR		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1154	Room 913	9X9 FLOOR TILE & MASTIC LIGHT GREEN		810 SF	240 SF	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED DUE TO CURPING; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BLACK		111 LF	60 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING, MISSING, & PAINTED OVER
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1154CP	ROOM 913 CEILING PLENUM	FIRE BRICK & MORTAR		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1155	ROOM 912	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	400 SF	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED WITH MASTIC EXPOSED DUE TO CUPPING; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		81 LF	20 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING, MISSING WITH MASTIC EXPOSED.
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
1155CP	ROOM 912 CEILING PLENUM	FIRE BRICK & MORTAR		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1156	ROOM 910	9X9 FLOOR TILE & MASTIC GREY		810 SF	600 SF	1	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED WITH MASTIC EXPOSED DUE TO CUPPING;
		COVE BASE & MASTIC BLACK		111 LF	40 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1156CP	ROOM 910 CEILING PLENUM	FIRE BRICK & MORTAR		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1156A	ROOM 910 STORAGE	9X9 FLOOR TILE & MASTIC PINK		120 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED; CONF ACM ENVIROSCIENCE#18040
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1156ACP	ROOM 910 STORAGE CEILING PLENUM	FIRE BRICK & MORTAR		5 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		ROOF TAR		N/A	<1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1157	ROOM 911	9X9 FLOOR TILE & MASTIC CREAM/BROWN		810 SF	500 SF	1	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED WITH MASTIC EXPOSED DUE TO CUPPING; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		111 LF	26 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING AND MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1157CP	ROOM 911 CEILING PLENUM	FIRE BRICK & MORTAR		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1158	STAIRWELL NEAR ROOM 910	TERRAZZO FLOORING BROWN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		1250 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
1158CP	STAIRWELL NEAR ROOM 910 CEILING PLENUM	2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		FIRE BRICK & MORTAR		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		TERRAZZO FLOORING BROWN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
1159	CORRIDOR ROOMS 715-918	WALL PLASTER		0					NON ACM ENVIROSCIENCE#17185
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		EXTERIOR DOOR CAULKING		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
1159CP	CORRIDOR ROOMS 715-918 CEILING PLENUM	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1160	CHIEF CUSTODIAN'S OFFICE	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1160CP	CHIEF CUSTODIAN'S OFFICE CEILING PLENUM	MUD JOINT PACKING		11 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
		FIRE BRICK & MORTAR		5 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE BEIGE		144 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1160A	CHIEF CUSTODIAN'S OFFICE BATHROOM	MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
1160B	CHIEF CUSTODIAN'S OFFICE STAIRS	FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1161	STAIRWELL NEAR ROOM 713	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		650 SF	1 SF	4	N/A NON FRIABLE	REPAIR	HOLES
		WALL PLASTER		0					NON ACM ENVIROSCIENCE#17185
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
		NONE OBSERVED							NONE OBSERVED
1161CP	STAIRWELL NEAR ROOM 713 CEILING PLENUM	9X9 FLOOR TILE & MASTIC GREY WITH BLUE		0					REMOVED AUG 2021 (ECI JOB #21263)
1162	ROOM 715	COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1162CP	ROOM 715 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1163	WOMEN'S FACULTY BATHROOM NEAR 715	TERRAZZO FLOORING RED		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE BEIGE		490 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
1164	ROOM 717	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	400 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED WITH MASTIC EXPOSED DUE TO CURPING; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		111 LF	6 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1164CP	ROOM 717 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
		NONE OBSERVED							NONE OBSERVED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1165	ROOM 719	CARPET MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	NEW CARPET OBSERVED
		COVE BASE & MASTIC BLACK		108 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	PAINTED OVER
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
1165CP	ROOM 719 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		TERRAZZO FLOORING RED		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE BEIGE		490 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED/ GROUT MISSING
1166	FACULTY WOMEN'S BATHROOM NEAR ROOM 719	MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1167	CORRIDOR ROOM 715 - ROOM 719	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		780 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL PLASTER		0					NON ACM ENVIROSCIENCE# 17185
		WINDOW GLAZING/CAULKING		200 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE# 17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 17592
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		EXTERIOR DOOR CAULKING		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 17592
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14- 28692 TEM
		GYPNUM BOARD & COMPOUND		36 SF	0	6	5	O&M	GOOD CONDITION
1167CP	CORRIDOR ROOM 715 - ROOM 719 CEILING PLENUM	MUD JOINT PACKING		9 UNITS	0	6	5	O&M	GOOD CONDITION
1168	ROOM 713	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		0					REMOVED AUG 2021 (ECI JOB #21269)
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE SPECKLED		0					NON ACM JCB#14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1168CP	ROOM 713 CEILING PLENUM	MUD JOINT PACKING		4 UNITS	0	6	5	O&M	GOOD CONDITION
1169	ROOM 711	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		0					REMOVED AUG 2021 (ECI JOB #21263)
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE SPECKLED		0					NON ACM JCB#14- 28692 TEM
1169CP	ROOM 711 CEILING PLENUM	GYPSUM BOARD		90 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
1170	MEN'S FACULTY BATHROOM NEAR ROOM 711	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE GREEN		442 SF	14 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		MIRROR MASTIC		0					ATTACHED WITH SCREWS, NO MASTIC
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NEW MATERIAL, 2017

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1170CP	MEN'S FACULTY BATHROOM NEAR ROOM 711 CEILING PLENUM	CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
		TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL BASE GROUT & GLUE WHITE		37 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED.
1171	CUSTODIAL CLOSET NEAR ROOM 711	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1171CP	CUSTODIAL CLOSET NEAR ROOM 711 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
		9X9 FLOOR TILE BEIGE/BROWN		0					CONF ACM JCB#15-32413; ABATED ENVIROSCIENCE#17497
		9X9 FLOOR TILE MASTIC		0					NON ACM JCB#15-32413
		COVE BASE & MASTIC BLACK		0					NON ACM JCB#15-32413
		WALL PLASTER		0					NON ACM ENVIROSCIENCE#17185
		GYP SUM BOARD & COMPOUND		830 SF	< 1 SF	3	4	REPAIR	DENTED
1172	STUDENT CENTER	WINDOW GLAZING/CAULKING		100 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1172CP	STUDENT CENTER CEILING PLENUM	VIBRATION REDUCER CLOTH GREEN		1 UNIT	0	6	5	O&M	LIMITED VISUAL ACCESS
1172A	STUDENT CENTER OFFICE (INTERIOR WALL REMOVED)	SEE SPACE ID 1174 FOR ASSESSMENT							
1172B	STUDENT CENTER FISH BOWL	9X9 FLOOR TILE BEIGE/BROWN		0					CONF ACM JCB#15- 32413; ABATED ENVIROSCIENCE#17497
		9X9 FLOOR TILE MASTIC		0					NON ACM JCB#15- 32413
		COVE BASE & MASTIC BLACK		0					NON ACM JCB#15- 32413
		GYPSUM BOARD & COMPOUND		450 SF	<1 SF	3	4	REPAIR	CHIPPED AND BULGING.
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14- 28692 TEM
1172BCP	STUDENT CENTER FISH BOWL CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1172B1	STUDENT CENTER DETENTION OFFICE (NOW PART OF 1172B)	9X9 FLOOR TILE BEIGE/BROWN		0					CONF ACM JCB#15- 32413; ABATED ENVIROSCIENCE#17497
		9X9 FLOOR TILE MASTIC		0					NON ACM JCB#15- 32413
		COVE BASE & MASTIC BLACK		0					NON ACM JCB#15- 32413
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14- 28692 TEM
1172B1CP	STUDENT CENTER DETENTION OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1172C	STUDENT CENTER ATTENDANCE OFFICE	9X9 FLOOR TILE BEIGE/BROWN		0					CONF ACM JCB#15-32413; ABATED ENVIROSCIENCE#17497
		9X9 FLOOR TILE MASTIC		0					NON ACM JCB#15-32413
		COVE BASE & MASTIC BLACK		0					NON ACM JCB#15-32413
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
1172CP	STUDENT CENTER ATTENDANCE OFFICE CEILING PLENUM	2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
		9X9 FLOOR TILE BEIGE/BROWN		0					CONF ACM JCB#15-32413; ABATED ENVIROSCIENCE#17497
		9X9 FLOOR TILE MASTIC		0					NON ACM JCB#15-32413
		COVE BASE & MASTIC BLACK		0					NON ACM JCB#15-32413
1172D	STUDENT CENTER ATTENDANCE OFFICE 2	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					NOT SUSPECT
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1172DCP	STUDENT CENTER ATTENDANCE OFFICE 2 CEILING PLENUM	FIRE BRICK & MORTAR		5 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1172E	STUDENT CENTER OFFICE 1	9x9 FLOOR TILE BEIGE/BROWN		0					CONF ACM & ABATED JCB#15- 32413
		9x9 FLOOR TILE MASTIC		0					NON ACM JCB#15- 32413
		COVE BASE & MASTIC BLACK		0					NON ACM JCB#15- 32413
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE# 17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1172ECP	STUDENT CENTER OFFICE 1 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1172F	STUDENT CENTER OFFICE 2	9X9 FLOOR TILE BEIGE/BROWN		0					CONF ACM JCB#15-32413; ABATED ENVIROSCIENCE#17497
		9X9 FLOOR TILE MASTIC		0					NON ACM JCB#15-32413
		COVE BASE & MASTIC BLACK		0					NON ACM JCB#15-32413
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL PLASTER		0					NON ACM ENVIROSCIENCE#17185
		GYPSUM BOARD & COMPOUND		260 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1172FCP	STUDENT CENTER OFFICE 2 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1172G	STUDENT CENTER OFFICE 3	9X9 FLOOR TILE BEIGE/BROWN		0					ABATED ENVIROSCIENCE#17497
		9X9 FLOOR TILE MASTIC		0					NON ACM JCB#15-32413
		COVE BASE & MASTIC BLACK		0					NON ACM JCB#15-32413
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIBERBOARD		0					REMOVED
		WINDOW GLAZING/CAULKING		30 L.F	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM
1172GCP	STUDENT CENTER OFFICE 3 CEILING PLENUM	FIRE BRICK & MORTAR		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1172H	STUDENT CENTER OFFICE 4	9X9 FLOOR TILE BEIGE/BROWN		0					CONF ACM JCB#15-32413; ABATED ENVIROSCIENCE#17497
		9X9 FLOOR TILE MASTIC		0					NON ACM JCB#15-32413
		COVE BASE & MASTIC BLACK		0					NON ACM JCB#15-32413
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1172HCP	STUDENT CENTER OFFICE 4 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1173	ROOM 709	9X9 FLOOR TILE & MASTIC CREAM/BROWN		1200 SF	35 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED W/ MASTIC EXPOSED; CONF ACM ENVIROSCIENCE# 18040
		COVE BASE & MASTIC BLACK		107 LF	2 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE# 20329
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	NOT OBSERVED.
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
		NONE OBSERVED							NONE OBSERVED
1173CP	ROOM 709 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1174	ROOM 708	9X9 FLOOR TILE BEIGE/BROWN		0					ABATED ENVIROSCIENCE# 17497
		9X9 FLOOR TILE MASTIC		0					NON ACM JCB#15-32413
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GYPSUM BOARD & COMPOUND		174 SF	2 LF	3	4	REPAIR	SCRAPED
		WINDOW GLAZING/CAULKING		48 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE# 17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM
1174CP	ROOM 708 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1175	ROOM 707	9X9 FLOOR TILE & MASTIC GREY		1200 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC GREY WATERCOLOR		1200 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED WITH MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		107 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		9 UNITS	0	6	5	O&M	GOOD CONDITION
1175CP	ROOM 707 CEILING PLENUM								

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1176	ROOM 705	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		0					ABATED JCB #14-29588
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB #17- 36668
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB #14- 28692 TEM
1176CP	ROOM 705 CEILING PLENUM	MUD JOINT PACKING		7 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
		TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		1390 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED.
		GYPSUM BOARD & COMPOUND		420 SF	0	6	5	O&M	GOOD CONDITION
1177	CORRIDOR ROOMS 705- 715	WINDOW GLAZING/CAULKING (INTERIOR WINDOW SYSTEMS)		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		EXTERIOR DOOR CAULKING		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION METAL		3 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB #14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1177CP	CORRIDOR ROOMS 705-715 CEILING PLENUM	MUD JOINT PACKING		34 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
		TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		1720 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1178	STAIRWELL ACROSS ROOM 705	WALL PLASTER		0					NON ACM
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
1178CP	STAIRWELL NEAR ROOM 705 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
		CONCRETE BLOCK & MORTAR		0					NON ACM
1179	BUSINESS EDUCATION STORAGE	FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
1179CP	BUSINESS EDUCATION STORAGE CEILING PLENUM	FIRE BRICK & MORTAR		5 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		9X9 FLOOR TILE & MASTIC BEIGE/BROWN		0					ABATED JCB#14-29588
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM
1179A	BUSINESS EDUCATION STORAGE OFFICE	WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	ENVIROSCIENCE#17592
		2X2 CEILING TILE LINEAR FISSURE DOT		0					GOOD CONDITION
									NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1179ACP	BUSINESS EDUCATION STORAGE OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1180	ROOM 703	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		0					ABATED JCB #14-29588
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		72 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
1180CP	ROOM 703 CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	3 LF	3	4	REPAIR	PEELING
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
		NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1181	ROOM 701	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		0					ABATED JCB #14-29588
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		108 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
		MUD JOINT PACKING		10 UNITS	0	6	5	O&M	GOOD CONDITION
1181CP	ROOM 701 CEILING PLENUM	CEMENTITIOUS CEILING MATERIAL		0					POURED CONCRETE, NOT SUSPECT
1182	GIRL'S BATHROOM NEAR ROOM 701	CERAMIC FLOOR TILE GROUT & GLUE GREY		172 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		504 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14- 28692 TEM
1182CP	GIRL'S BATHROOM NEAR ROOM 701 CEILING PLENUM	MUD JOINT PACKING		6 UNITS	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1183	CORRIDOR BUSINESS ED STORAGE ROOM 701	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		1000 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED.
		GYP SUM BOARD & COMPOUND		56 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		150 LF	3 LF	4	N/A NON FRIABLE	REPAIR	DENTED; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE# 17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	3 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED; CONF ACM ENVIROSCIENCE# 17592
1184	STORAGE 7B	FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		EXTERIOR DOOR CAULKING		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 17592
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14- 28692 TEM
		MUD JOINT PACKING		25 UNITS	0	6	5	O&M	GOOD CONDITION
1183CP	CORRIDOR BUSINESS ED STORAGE ROOM 701 CEILING PLENUM	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14- 28692 TEM
		2X4 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1184CP	STORAGE 7B CEILING PLENUM	MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
		FIRE BRICK & MORTAR		10 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
1185	STORAGE ADJ. STORAGE 7B	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEMENTITIOUS CEILING MATERIAL		0					NON ACM ENVIROSCIENCE# 17185
		12X12 FLOOR TILE & MASTIC BEIGE		118 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1186	ROOM 821	12X12 FLOOR TILE & MASTIC BROWN		118 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		12X12 FLOOR TILE & MASTIC MOCHA		118 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		118 SF	3 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC WHITE		88 LF	0	7	N/A NON FRIABLE	O&M	PATCHED
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
1186CP	ROOM 821 CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1187	ROOM 820	12X12 FLOOR TILE & MASTIC BEIGE		75 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED
		12X12 FLOOR TILE & MASTIC BROWN		75 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED
		12X12 FLOOR TILE & MASTIC MOCHA		75 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		75 SF	17 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED
		COVE BASE & MASTIC WHITE		57 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1187CP	ROOM 820 CEILING PLENUM								

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1188	ROOM 819	12x12 FLOOR TILE & MASTIC BLUE		900 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12x12 FLOOR TILE & MASTIC WHITE WATERCOLOR		300 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED & MISSING W/ MASTIC EXPOSED
		COVE BASE & MASTIC WHITE		121 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1188CP	ROOM 819 CEILING PLENUM	FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		CEILING GYPSUM BOARD & COMPOUND		300 SF		6	5	O&M	PATCHED
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1189	ROOM 818	12X12 FLOOR TILE & MASTIC BLUE		900 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		300 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		COVE BASE & MASTIC WHITE		121 LF	0	7	N/A NON FRIABLE	O&M	PATCHED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		CEILING GYPSUM BOARD & COMPOUND		300 SF	0	7	N/A NON FRIABLE	O&M	PATCHED
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1189CP	ROOM 818 CEILING PLENUM								

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1190	ROOM 817	12X12 FLOOR TILE & MASTIC BEIGE		75 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC BROWN		75 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC MOCHA		75 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		75 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC WHITE		57 LF	0	7	N/A NON FRIABLE	O&M	PATCHED
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
1190CP	ROOM 817 CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1191	ROOM 815	FLOOR TILE & MASTIC		0					ABATED 2010 REINSPECTION
		COVE BASE & MASTIC WHITE		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
1191CP	ROOM 815 CEILING PLENUM	MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1192	CORRIDOR STORAGE 7B- ROOM 815	TERRAZZO FLOORING BROWN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GLAZED BLOCK MORTAR		1100 SF	< 1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED.
		WALL PLASTER		0					NON ACM ENVIROSCIENCE# 17185
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		EXTERIOR DOOR CAULKING		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 17592
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14- 28692 TEM
1192CP	CORRIDOR STORAGE 7B- ROOM 815 CEILING PLENUM	MUD JOINT PACKING		21 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17- 36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1193	ROOM 812	12X12 FLOOR TILE BEIGE/BROWN		0					NON ACM ENVIROSCIENCE#18040
		12X12 FLOOR TILE MASTIC		1000 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED & DENTED
		FLOOR LEVELING COMPOUND		0					NON ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BLACK		124 LF	6 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		LABORATORY TABLE TOPS		250 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1193CP	ROOM 812 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
		NON-GLASS WINDOW PANEL TRANSITE		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1193A	ROOM 812 OFFICE	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		128 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED; CONF ACM ENVIROSCIENCE# 18040
		COVE BASE & MASTIC BROWN		37 LF	26 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE# 20329
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14- 28692 TEM
1193ACP	ROOM 812 OFFICE CEILING PLENUM	NON-GLASS WINDOW PANEL TRANSITE		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1194	ROOM 825	12X12 FLOOR TILE & MASTIC PEACH		1000 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		144 LF	2 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GYPNUM BOARD & COMPOUND		630 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
1194CP	ROOM 825 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		2 UNITS	NOT QUANTIFIED	3	1	REPAIR	DUCT TAPED
		CEILING GYPSUM BOARD & COMPOUND		80 SF	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1194A	ROOM 825 CLOSET	12X12 FLOOR TILE & MASTIC PEACH		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GYPNUM BOARD & COMPOUND		270 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		5 SF	1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1194ACP	ROOM 825 CLOSET CEILING PLENUM	TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
1195	ROOM 823	12X12 FLOOR TILE & MASTIC PEACH		1000 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED WITH MASTIC EXPOSED.
		COVE BASE & MASTIC BLACK		144 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GYPNUM BOARD & COMPOUND		630 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1195CP	ROOM 823 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1195A	ROOM 823 CLOSET	12X12 FLOOR TILE & MASTIC PEACH		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GYP SUM BOARD & COMPOUND		270 SF	<1 SF	3	4	REPAIR	CHIPPED.
		WALL/CHALK-BOARD MASTIC		6 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1195ACP	ROOM 823 CLOSET CEILING PLENUM	FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					NON ACM JCB#17-36668 TEM
		TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
1196	CAFETERIA A	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
1196CP	CAFETERIA A CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		MUD JOINT PACKING		5 UNITS	0	6	5	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1196A	CAFETERIA A STORAGE	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
1196ACP	CAFETERIA A STORAGE CEILING PLENUM								NO ACCESS
1197	STORAGE ACROSS FROM CAFÉ A (PREVIOUSLY FENCING STORAGE)	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL BASE GROUT & GLUE OFF WHITE		38 SF	1 TILE	3	4	REPAIR	CHIPPED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GYPSUM BOARD & COMPOUND		28 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	2 SF	3	4	REPAIR	PEELING
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
		TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
1197A	STORAGE 2 ACROSS FROM CAFÉ A (PREVIOUSLY FENCING STORAGE 2)	CERAMIC WALL TILE GROUT & GLUE BEIGE		436 SF	1 TILE	3	4	REPAIR	CHIPPED
		MIRROR MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	NO ACCESS (PREVIOUSLY LIMITED VISUAL ACCESS)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
		TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
1198	WOMEN'S FACULTY BATHROOM NEAR CAFETERIA	CERAMIC WALL TILE GROUT & GLUE BEIGE		43 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		MIRROR MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1199	GIRL'S BATHROOM NEAR CAFETERIA	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #21487)
		CERAMIC WALL TILE GROUT & GLUE WHITE		0					CONFIRMED NON-ACM (ECI JOB #21487)
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1200	CUSTODIAL CLOSET NEAR CAFETERIA	CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
		TERRAZZO FLOORING BROWN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL BASE GROUT & GLUE OFF WHITE		24 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED.
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1201	MEN'S FACULTY BATHROOM NEAR CAFETERIA	2X4 CEILING TILE LINEAR FISSURE DOT		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
		TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE WHITE		288 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED.
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1200CP	CUSTODIAL CLOSET NEAR CAFETERIA CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1201CP	MENS FACULTY BATHROOM NEAR CAFETERIA CEILING PLENUM	MUD JOINT PACKING		11 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1202	BOY'S BATHROOM NEAR CAFETERIA	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #21487)
		CERAMIC WALL TILE GROUT & GLUE GREY		0					CONFIRMED NON-ACM (ECI JOB #21487)
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1203	FACULTY DINING ROOM	CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
		TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
1203CP	FACULTY DINING ROOM CEILING PLENUM	METAL SINK UNDERCOATING BLACK		1 UNIT	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED.
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
1203CP	FACULTY DINING ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1204	KITCHEN	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		2219 SF	35 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED AND MISSING
		CERAMIC WALL BASE GROUT & GLUE TAN		250 SF	23 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED AND MISSING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE #20329
		GYP SUM BOARD & COMPOUND		200 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		9 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK 2X2 CEILING TILE SMOOTH		2 UNITS 0	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1204CP	KITCHEN CEILING PLENUM	MUD JOINT PACKING		31 UNITS	0	6	5	O&M	GOOD CONDITION
		FIRE BRICK & MORTAR		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1204A	KITCHEN WALK-IN 1								NO ACCESS
1204B	KITCHEN STORAGE	CERAMIC FLOOR TILE GROUT & GLUE BEIGE & RED		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE OFF WHITE		N/A	NOT QUANTIFIED	3	4	REPAIR	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		VIBRATION REDUCER CLOTH		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					REMOVED DEC 2022 (ECL JOB #23078)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1204C	KITCHEN WASH-BIN ROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		49 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL BASE GROUT & GLUE TAN		25 SF	0	6	5	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
1204CCP	KITCHEN WASH-BIN ROOM CEILING PLENUM	MUD JOINT PACKING		8 UNITS	0	6	5	O&M	GOOD CONDITION
1204D	KITCHEN STORAGE 2	CERAMIC FLOOR TILE GROUT & GLUE BEIGE & RED		356 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GYP SUM BOARD & COMPOUND		N/A	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		356 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1204DCP	KITCHEN STORAGE 2 CEILING PLENUM								NO ACCESS

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1204E	KITCHEN BREAK ROOM	CERAMIC FLOOR TILE GROUT & GLUE BEIGE & RED		120 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL BASE GROUT & GLUE BEIGE		41 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
1204ECP	KITCHEN BREAK ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1204E1	KITCHEN BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BEIGE & RED		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		29 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
1204E1 CP	KITCHEN BATHROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1204F	KITCHEN WALK-IN 2	CERAMIC FLOOR TILE GROUT & GLUE BEIGE & RED		N/A	0	7	N/A NON FRIABLE	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		CERAMIC FLOOR TILE GROUT & GLUE RED		N/A	0	7	N/A NON FRIABLE	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
1204G	KITCHEN WALK-IN 3	FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
1205	CAFETERIA B	WINDOW GLAZING/CAULKING		160 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE BRICK & MORTAR		10 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		ROOF TAR		N/A	<1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
1205CP	CAFETERIA B CEILING PLENUM	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		0					REMOVED JULY 2022 (ECI JOB #22536)
1205A	FENCING CLOSET	COVE BASE & MASTIC BROWN		0					RENOVATED JULY 2022
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	NO ACCESS (PREVIOUSLY GOOD CONDITION)
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1206	CORRIDOR CAFETERIA B TO ROOM 812	TERRAZZO FLOORING BROWN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		1900 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYPSUM BOARD & COMPOUND		84 SF	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE TEXTURED		0					NON ACM JCB#14- 28692 TEM
1206CP	CORRIDOR CAFETERIA B TO ROOM 812 CEILING PLENUM	FIRE BRICK & MORTAR		5 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		TERRAZZO FLOORING BROWN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		640 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	HOLES.
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		EXTERIOR DOOR CAULKING		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION CONF ACM ENVIROSCIENCE#17592
1207	CORRIDOR CAFETERIA B TO ROOM 705	FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE TEXTURED		0					NON ACM JCB#14- 28692 TEM
		MUD JOINT PACKING		5 UNITS	0	6	5	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2001	FACULTY COPY ROOM	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		0					ABATED ENVIROSCIENCE#19400
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		0					ATTACHED WITH SCREWS, NO MASTIC
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14- 28692 TEM
		NONE OBSERVED							NONE OBSERVED
		FLOOR TILE & MASTIC		0					ABATED 2010 REINSPECTION
2002	ROOM 747	COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		90 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2002CP	ROOM 747 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2002A	ROOM 745 & 747 OFFICE	12X12 FLOOR TILE & MASTIC PEACH		0					ABATED 2010 REINSPECTION
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		12 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
2002ACP	ROOM 745 & 747 OFFICE CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
		12X12 FLOOR TILE & MASTIC PEACH		0					ABATED 2010 REINSPECTION
2002A1	ROOM 745 & 747 CHEMICAL STORAGE	COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
2002A1 CP	ROOM 745 & 747 CHEMICAL STORAGE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2003	BOY'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREY		170 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		446 SF	0	7	N/A NON FRIABLE	O&M	NEW MATERIAL OBSERVED
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE# 17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
2003CP	BOY'S BATHROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2004	CUSTODIAL CLOSET	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL BASE GROUT & GLUE OFF WHITE		36 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
2004CP	CUSTODIAL CLOSET CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2005	ROOM 746	FLOOR TILE & MASTIC		0					ABATED 2010 REINSPECTION
		COVE BASE & MASTIC WHITE		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GYPSUM BOARD & COMPOUND		90 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14- 28692 TEM
2005CP	ROOM 746 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2005A	ROOM 744 & 746 STORAGE	FLOOR TILE & MASTIC		0					ABATED 2010 REINSPECTION
		COVE BASE & MASTIC WHITE		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14- 28692 TEM
2005ACP	ROOM 744 & 746 STORAGE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2006	ELECTRONIC STORAGE CLOSET	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISURE DOT		0					NON ACM JCB#14- 28692 TEM
2006CP	ELECTRONIC STORAGE CLOSET CEILING PLENUM	ROOF TAR		N/A	< 1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2007	CHEMISTRY STORAGE ROOM	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
2007CP	CHEMISTRY STORAGE ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2008	ROOM 745	FLOOR TILE & MASTIC		0					ABATED 2010 REINSPECTION
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
2008CP	ROOM 745 CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2x2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2009	STAIRWELL ADJ. TO ROOM 745	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		192 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	HOLE.
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		6 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
2009CP	STAIRWELL ADJ. TO ROOM 745 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2010	ROOM 744	FLOOR TILE & MASTIC		0					ABATED 2010 REINSPECTION
		COVE BASE & MASTIC WHITE		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GYPSUM BOARD & COMPOUND		96 SF	0	6	5	O&M	PATCHED, GOOD CONDITION.
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
2010CP	ROOM 744 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2011	ASSISTANT PRINCIPAL OFFICE	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		175 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 18040
		COVE BASE & MASTIC BLACK		7 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		23 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		WALL/CHALK-BOARD MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
2011CP	ASSISTANT PRINCIPAL SECRETARY AREA CEILING PLENUM	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#18040
2011A	ASSISTANT PRINCIPAL BREAK ROOM	COVE BASE & MASTIC BLACK		7 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		27 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17-36668
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2011ACP	ASSISTANT PRINCIPAL BREAK ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2011B	ASSISTANT PRINCIPAL SECRETARY AREA	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		170 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		46 LF	2 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM JCB#17- 36668
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14- 28692 TEM
2011BCP	ASSISTANT PRINCIPAL OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2012	ROOM 743	9X9 FLOOR TILE & MASTIC CREAM/BROWN		1176 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED WITH MASTIC EXPOSED; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		290 LF	24 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
2012CP	ROOM 743 CEILING PLENUM	LABORATORY TABLE TOPS		224 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2012A	ROOM 743 & 741 PREP	9X9 FLOOR TILE & MASTIC CREAM/BROWN		136 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 18040
		COVE BASE & MASTIC BROWN		52 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
2012ACP	ROOM 743 & 741 PREP ROOM CEILING PLENUM	LABORATORY TABLE TOPS		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
		9X9 FLOOR TILE & MASTIC CREAM/BROWN		80 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	POPPING & MISSING TILES; CONF ACM ENVIROSCIENCE#18040
2012A1	ROOM 743 & 741 STORAGE CLOSET	COVE BASE & MASTIC BROWN		33 LF	4 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
2012A1CP	ROOM 743 & 741 STORAGE CLOSET CEILING PLENUM	2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2013	ROOM 741	9X9 FLOOR TILE & MASTIC CREAM/BROWN		1036 SF	9 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, MISSING WITH MASTIC EXPOSED; CONF ACM ENVIROSCIENCE# 18040
		COVE BASE & MASTIC BROWN		121 LF	2 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
2013CP	ROOM 741 CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	LIMITED VISUAL ACCESS
		LABORATORY TABLE TOPS		224 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
2014	CORRIDOR ROOM 741 TO FACULTY COPY ROOM	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		704 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED.
		WALL PLASTER		0					NON ACM ENVIROSCIENCE# 17185
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
2014CP	CORRIDOR ROOM 741 TO FACULTY COPY ROOM CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2015	CORRIDOR STORAGE CLOSET	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
2015CP	CORRIDOR STORAGE CLOSET CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2016	ROOM 739	9X9 FLOOR TILE & MASTIC		0					ABATED 2010 REINSPECTION
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		COVE BASE & MASTIC WHITE		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		124 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
2016CP	ROOM 739 CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2016A	ROOM 739 PREP ROOM	9X9 FLOOR TILE & MASTIC		0					ABATED 2010 REINSPECTION
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		COVE BASE & MASTIC WHITE		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14- 28692 TEM
2016ACP	ROOM 739 PREP ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2017	PLANETARIUM 737	9X9 FLOOR TILE GREY		0					CONF ACM JCB#15- 32498; 9 SF ABATED JCB#15-32413; ABATED ENVIROSCIENCE#17497
		12X12 FLOOR TILE BLACK		0					NON ACM JCB#15- 32498
		FLOOR TILE MASTIC		0					NON ACM JCB#15- 32498
		COVE BASE & MASTIC BLACK		0					NON ACM JCB#15- 32498
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2017A	ROOM 723 OFFICE	9X9 FLOOR TILE GREY		0					CONF ACM JCB#15-32498; ABATED ENVIROSCIENCE#17497
		FLOOR TILE MASTIC		0					NON ACM JCB#15-32498
		COVE BASE & MASTIC BROWN		0					NON ACM JCB#15-32498
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		0					ABATED ENVIROSCIENCE#17497
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
2017ACP	ROOM 723 OFFICE CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		12X12 FLOOR TILE & MASTIC BLACK		0					ABATED ENVIROSCIENCE#17497
		9X9 FLOOR TILE & MASTIC		0					ABATED ENVIROSCIENCE#17497
2018	PLANETARIUM OFFICE	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2018CP	PLANETARIUM OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2019	GIRLS BATHROOM	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE PINK		395 SF	30 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED.
		MIRROR MASTIC		6 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE# 17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 17592
		FIRE DOOR INSULATION WOOD		1 DOOR	<1 SF	3	4	REPAIR	PEELING
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE# 17185

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2020	ROOM 735	9X9 FLOOR TILE & MASTIC GREY		1344 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		1344 SF	37 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED CRACKED, LOOSE WITH MASTIC EXPOSED AND 9X9 FLOOR TILE EXPOSED.
		COVE BASE & MASTIC BLACK		248 LF	4 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED.
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GYPNUM BOARD & COMPOUND		232 SF	<1 SF	3	4	REPAIR	DENTED
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		LABORATORY FUME HOOD TRANSITE		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		LABORATORY TABLE TOPS		224 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
		2X2 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
2020CP	ROOM 735 CEILING PLENUM	2X4 CEILING TILE		0					FIBERGLASS, NOT SUSPECT
		CEILING TILE MASTIC		672 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
2020A	ROOM 735 STORAGE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		96 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED CRACKED WITH MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		37 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYPNUM BOARD & COMPOUND		323 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPNUM BOARD & COMPOUND		96 SF	0	6	5	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2020A1	ROOM 735 OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		70 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		31 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
2020A1CP	ROOM 735 OFFICE CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		196 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED WITH MASTIC EXPOSED.
		COVE BASE & MASTIC BLACK		62 LF	2 LF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
2020B	ROOM 735 PREP ROOM	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GYP SUM BOARD & COMPOUND		232 SF	<1 SF	3	4	REPAIR	DENTED & HOLE
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		LABORATORY TABLE TOPS		24 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM
2020BCP	ROOM 735 PREP ROOM CEILING PLENUM	2X4 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185
		NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2021	CORRIDOR STORAGE CLOSET TO ROOM 735	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		693 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL PLASTER		0					NON ACM ENVIROSCIENCE# 17185
		WINDOW GLAZING/CAULKING		220 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE# 17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 17592
2021CP	CORRIDOR STORAGE CLOSET TO ROOM 735 CEILING PLENUM	2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
		TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
2022	STAIRWELL ADJ. TO ROOM 735	GLAZED BLOCK MORTAR		412 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
2022CP	STAIRWELL ADJ. TO ROOM 735 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2023	ROOM 733	9X9 FLOOR TILE & MASTIC		0					ABATED 2007 REINSPECTION
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		120 SF	4 SF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED AND PAINTED OVER.
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
2023	ROOM 733	FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
		NONE OBSERVED							NONE OBSERVED
		TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL TILE GROUT & GLUE GREEN		480 SF	17 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
2024	BOY'S BATHROOM	NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	<1 SF	3	4	REPAIR	HOLES.
		CEILING PLASTER SMOOTH		0					NON ACM ENVIROSCIENCE#17185

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2025	CUSTODIAL CLOSET	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CERAMIC WALL BASE GROUT & GLUE OFF WHITE		21 SF	12 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED AND CHIPPED.
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	<1 SF	3	4	REPAIR	PEELING
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
2025	CUSTODIAL CLOSET CEILING PLENUM	2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
		9X9 FLOOR TILE & MASTIC		0					ABATED 2007 REINSPECTION
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
2026	ROOM 733 & 731 PREP	WALL/CHALK-BOARD MASTIC		16 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
2026CP	ROOM 733 & 731 PREP CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2027	ROOM 732	12X12 FLOOR TILE & MASTIC WHITE & GREY		834 SF	0	7	N/A NON FRIABLE	O&M	NEW 12X12 FLOOR TILE OBSERVED
		COVE BASE & MASTIC WHITE		160 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		GYPNUM BOARD & COMPOUND		96 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
2027CP	ROOM 732 CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
		FIRE BRICK & MORTAR		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		54 SF	0	7	N/A NON FRIABLE	O&M	NEW 12X12 FLOOR TILE OBSERVED
2027A	ROOM 732/730 COMMON AREA	COVE BASE & MASTIC WHITE		24 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
2027ACP	ROOM 732/730 COMMON AREA CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2028	ROOM 730	12X12 FLOOR TILE & MASTIC BLACK WATERCOLOR		225 SF	0	7	N/A NON FRIABLE	O&M	NEW 12X12 FLOOR TILE OBSERVED
		12X12 FLOOR TILE & MASTIC GREY WATERCOLOR		225 SF	0	7	N/A NON FRIABLE	O&M	NEW 12X12 FLOOR TILE OBSERVED
		12X12 FLOOR TILE & MASTIC LIGHT GREY WATERCOLOR		225 SF	0	7	N/A NON FRIABLE	O&M	NEW 12X12 FLOOR TILE OBSERVED
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		225 SF	0	7	N/A NON FRIABLE	O&M	NEW 12X12 FLOOR TILE OBSERVED
		COVE BASE & MASTIC WHITE		128 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
2028CP	ROOM 730 CEILING PLENUM	CEILING GYPSUM BOARD & COMPOUND		150 SF	5 LF	3	4	REPAIR	CRACKED & JOINT COMPOUND IS SPLITTING
		FIRE BRICK & MORTAR		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2029	ROOM 731	9X9 FLOOR TILE & MASTIC		0					ABATED 2007 REINSPECTION
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		120 SF	4 SF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED AND PAINTED OVER
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
2029CP	ROOM 731 CEILING PLENUM	FIRE BRICK & MORTAR		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
2030	STORAGE 7C	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14- 28692 TEM
2030CP	STORAGE 7C CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2031	STORAGE 7D	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14- 28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2031CP	STORAGE 7D CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2032	ROOM 728	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		230 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		53 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE#17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE#17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM
2032CP	ROOM 728 CEILING PLENUM	FIRE BRICK & MORTAR		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2033	ROOM 729	12X12 FLOOR TILE & MASTIC WHITE/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED AND CRACKED
		COVE BASE & MASTIC BLACK		108 LF	7 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
2033CP	ROOM 729 CEILING PLENUM	LABORATORY TABLE TOPS		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2033A	ROOM 729 PREP A	9X9 FLOOR TILE & MASTIC LIGHT GREEN		300 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		41 LF	4 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
		LABORATORY TABLE TOPS		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE		0					NON ACM JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
2033ACP	ROOM 729 PREP A CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2034	ROOM 727	12X12 FLOOR TILE & MASTIC WHITE/BROWN		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		178 LF	10 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		0					REMOVED MARCH 2023 (ECL JOB #23444)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED MARCH 2023 (ECL JOB #23444)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		LABORATORY TABLE TOPS		225 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14-28692 TEM
2034CP	ROOM 727 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2035	CORRIDOR ROOM 727 - 733	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		600 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL PLASTER		0					NON ACM ENVIROSCIENCE#17185
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
2035CP	CORRIDOR ROOM 727 - 733 CEILING PLENUM	FIRE BRICK & MORTAR		6 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2036	ROOM 725	12X12 FLOOR TILE & MASTIC GREEN		1050 SF	11 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		12X12 FLOOR TILE & MASTIC WHITE WATERCOLOR		360 SF	36 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC WHITE		153 LF	6 LF	4	N/A NON FRIABLE	REPAIR	MISSING WITH MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		LABORATORY TABLE TOPS		0					NOT SUSPECT
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
		FIRE BRICK & MORTAR		6 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
2036CP	ROOM 725 CEILING PLENUM	TERRAZZO FLOORING TAN		0					CONFIRMED NON-ACM (ECI JOB #23546)
2037	STAIRWELL NEAR 723	GLAZED BLOCK MORTAR		1100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					NON ACM JCB#14-28692 TEM
2037CP	STAIRWELL NEAR 723 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2038	ROOM 723	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED - SOME PATCHED; CONF ACM ENVIROSCIENCE#18040
		COVE BASE & MASTIC BROWN		111 LF	6 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		100 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		LABORATORY TABLE TOPS		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
2038CP	ROOM 723 CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ACM JCB#14- 28692 TEM
		NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2039	ROOM 721	9X9 FLOOR TILE & MASTIC CREAM/BROWN		0					CONF ACM ENVIROSCIENCE# 18040; ABATED ENVIROSCIENCE# 19400
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		WALL/CHALK-BOARD MASTIC		0					REMOVED
		WINDOW GLAZING/CAULKING		0					REMOVED JUNE 2022 (ECI JOB #22414)
		NON-GLASS WINDOW PANEL TRANSITE		0					REMOVED JUNE 2022 (ECI JOB #22414)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOT		0					NON ACM JCB#14-28692 TEM
2039CP	ROOM 721 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
2040	MEN'S FACULTY BATH NEAR ROOM 721	CERAMIC FLOOR TILE GROUT & GLUE GREY		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		334 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	NEW MATERIAL OBSERVED. CRACKED
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
2040CP	MEN'S FACULTY BATH NEAR ROOM 721 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials


SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2041	GIRLS BATHROOM BY ROOM 721	CERAMIC FLOOR TILE GROUT & GLUE GREY		114 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		450 SF	0	7	N/A NON FRIABLE	O&M	NEW MATERIAL OBSERVED
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE# 17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 17592
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
2041CP	GIRLS BATHROOM BY ROOM 721 CEILING PLENUM	FIRE BRICK & MORTAR		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
2042	WOMEN'S FACULTY BATHROOM NEAR ROOM 721	CERAMIC FLOOR TILE GROUT & GLUE GREY		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		334 SF	0	7	N/A NON FRIABLE	O&M	NEW MATERIAL OBSERVED
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPLASH		0					NON ACM JCB#14-28692 TEM
2042CP	WOMEN'S FACULTY BATHROOM NEAR ROOM 721 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2043	CORRIDOR WOMEN'S BATHROOM TO ROOM 725	TERRAZZO FLOORING WHITE WITH BLACK		0					CONFIRMED NON-ACM (ECI JOB #23546)
		GLAZED BLOCK MORTAR		783 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL PLASTER		0					NON ACM ENVIROSCIENCE# 17185
		WINDOW GLAZING/CAULKING		220 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; INT. & EXT. CAULKING & GLAZING CONF ACM ENVIROSCIENCE# 17592
		NON-GLASS WINDOW PANEL TRANSITE		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; CONF ACM ENVIROSCIENCE# 17592
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		2X4 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
2043CP	CORRIDOR WOMEN'S BATHROOM TO ROOM 725 CEILING PLENUM	FIRE BRICK & MORTAR		28 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
2044	CUSTODIAL CLOSET	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		126 SF	44 SF	3	4	REPAIR	WATER STAINED AND MISSING.
2045	AUDITORIUM 2ND FLOOR STORAGE	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
2046	AUDITORIUM 2ND FLOOR CORRIDOR	9X9 FLOOR TILE & MASTIC BEIGE/BROWN		0					CONF ACM ENVIROSCIENCE#18040; ABATED ENVIROSCIENCE#20417
		WALL PLASTER		0					NON ACM ENVIROSCIENCE#17185
		2X2 CEILING TILE ROUGH		0					NON ACM JCB#14-28692 TEM
2046CP	AUDITORIUM 2ND FLOOR CORRIDOR CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
2047	FAN ROOM	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		VIBRATION REDUCER CLOTH WHITE		25 UNITS	8 UNITS	4	N/A NON FRIABLE	REPAIR	TORN
		VIBRATION REDUCER CLOTH GREEN		4 UNITS	2 UNITS	4	N/A NON FRIABLE	REPAIR	TORN
		MUD JOINT PACKING		97 UNITS	0	6	5	O&M	GOOD CONDITION; CONF ACM ORIGINAL AMP; 1 BLF ABATED JCB # 13-26542. 15 FITTINGS ABATED (ECL # 23078)
		DUCT INSULATION CLOTH		2100 SF	4 LF	4	N/A NON FRIABLE	REPAIR	TORN
		9X9 FLOOR TILE & MASTIC BLACK		24 SF	0	7	N/A NON FRIABLE	O&M	NEW 12X12 FLOOR TILE OBSERVED
		STAIR TREAD MASTIC		550 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	EXPOSED
2048	BALCONY	CARPET MASTIC		440 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		CEMENTITIOUS WALL PLASTER		1300 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	DENTED
		GYPNUM BOARD & COMPOUND		75 SF	< 1 SF	3	4	REPAIR	DENTED
		PEGBOARD		576 SF	5 SF	4	N/A NON FRIABLE	REPAIR	BULGING.
		CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329
		FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					ABATED 2004 REINSPECTION
4000	DETACHED GARAGE	CONCRETE BLOCK & MORTAR		0					NON ACM ENVIROSCIENCE#20329

Appendix C

DRAWINGS

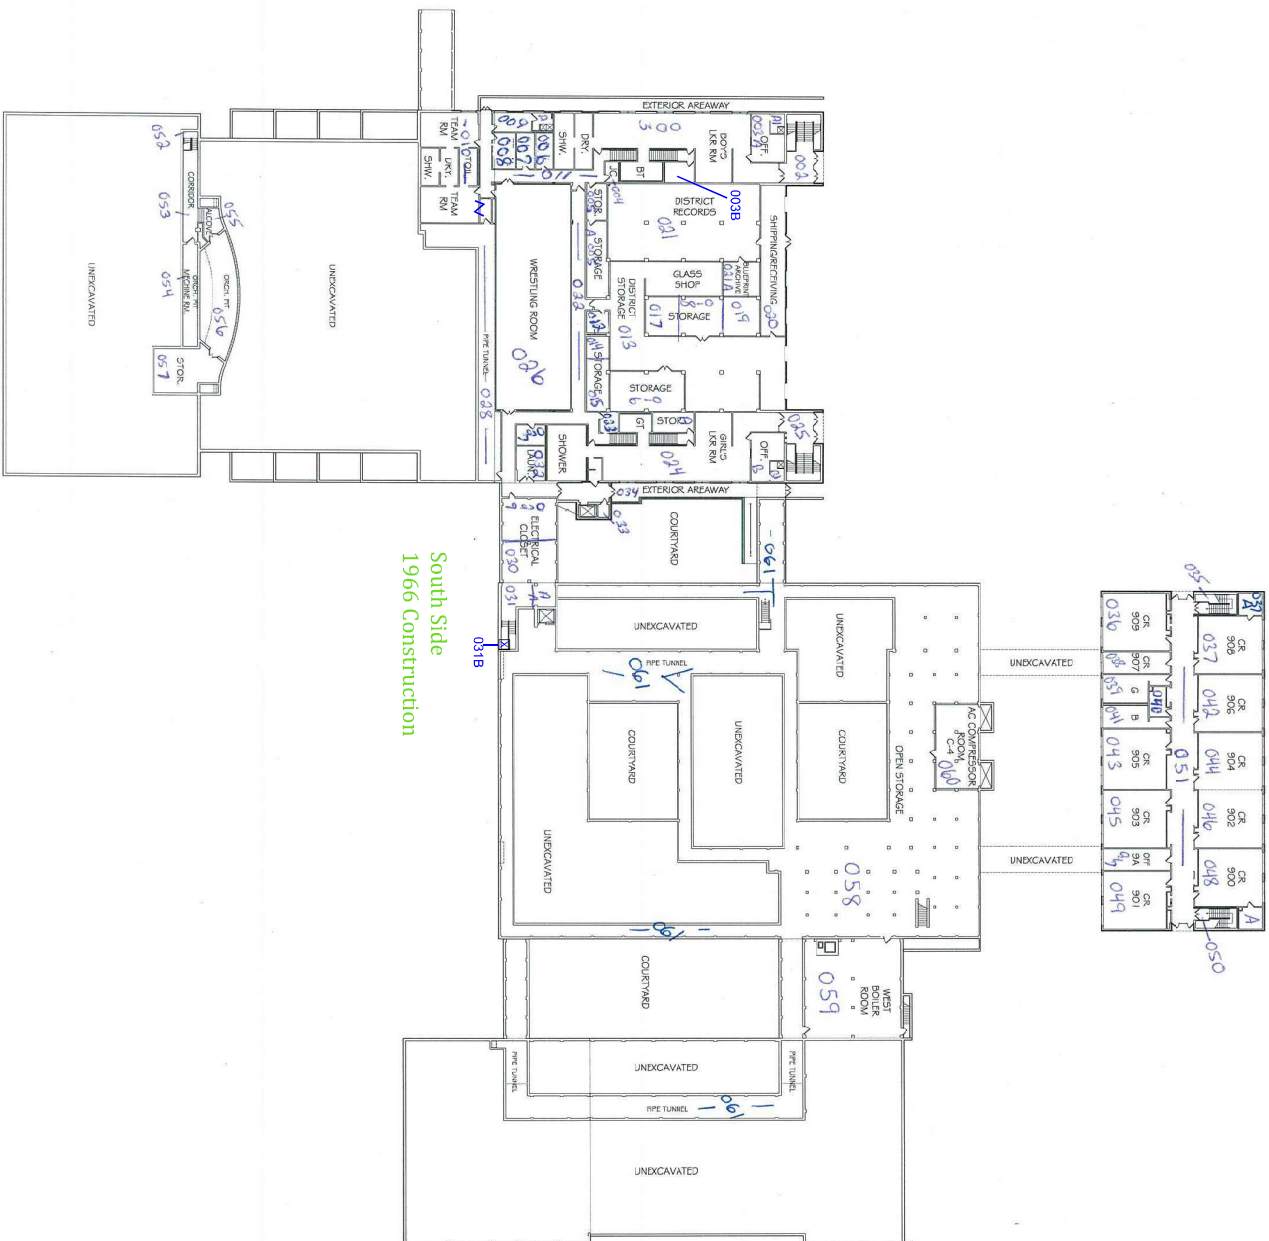

South Side
1966 Construction



**ENVIROSCIENCE
CONSULTANTS**
2150 SMITH TOWN AVENUE
FONKONKOMA, NY 11779
(631) 580-3191
FAX 580-3195
www.envirohealth.org

KEY PLAN
NO SCALE


PROJECT
SIX MONTH AHIRA SURVEILLANCE
HALF HOLLOW HILLS HIGH SCHOOL EAST
LOWER LEVEL FLOOR PLAN


CLIENT
HALF HOLLOW HILLS CENTRAL SCHOOL DISTRICT



PROJECT #: 23546
COMMENTS:
None


NOT TO SCALE
Date: 06/20/2023
By: Robert Cardona
DRAWING 1 of 4

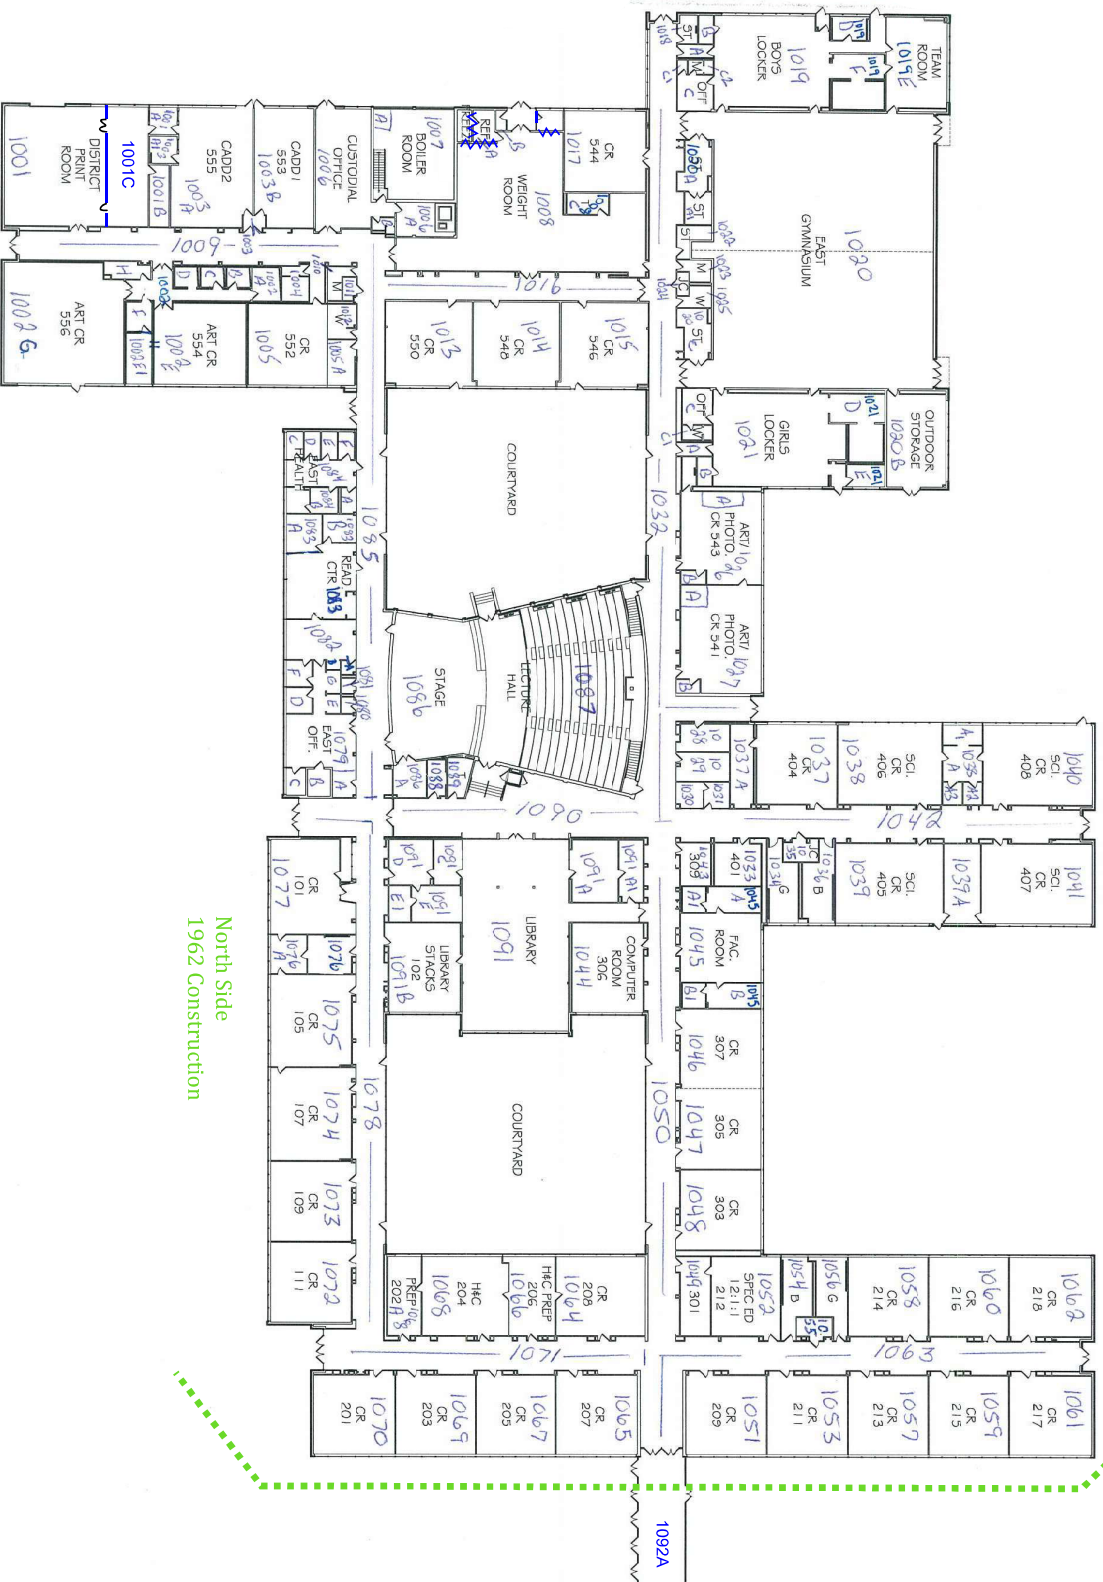

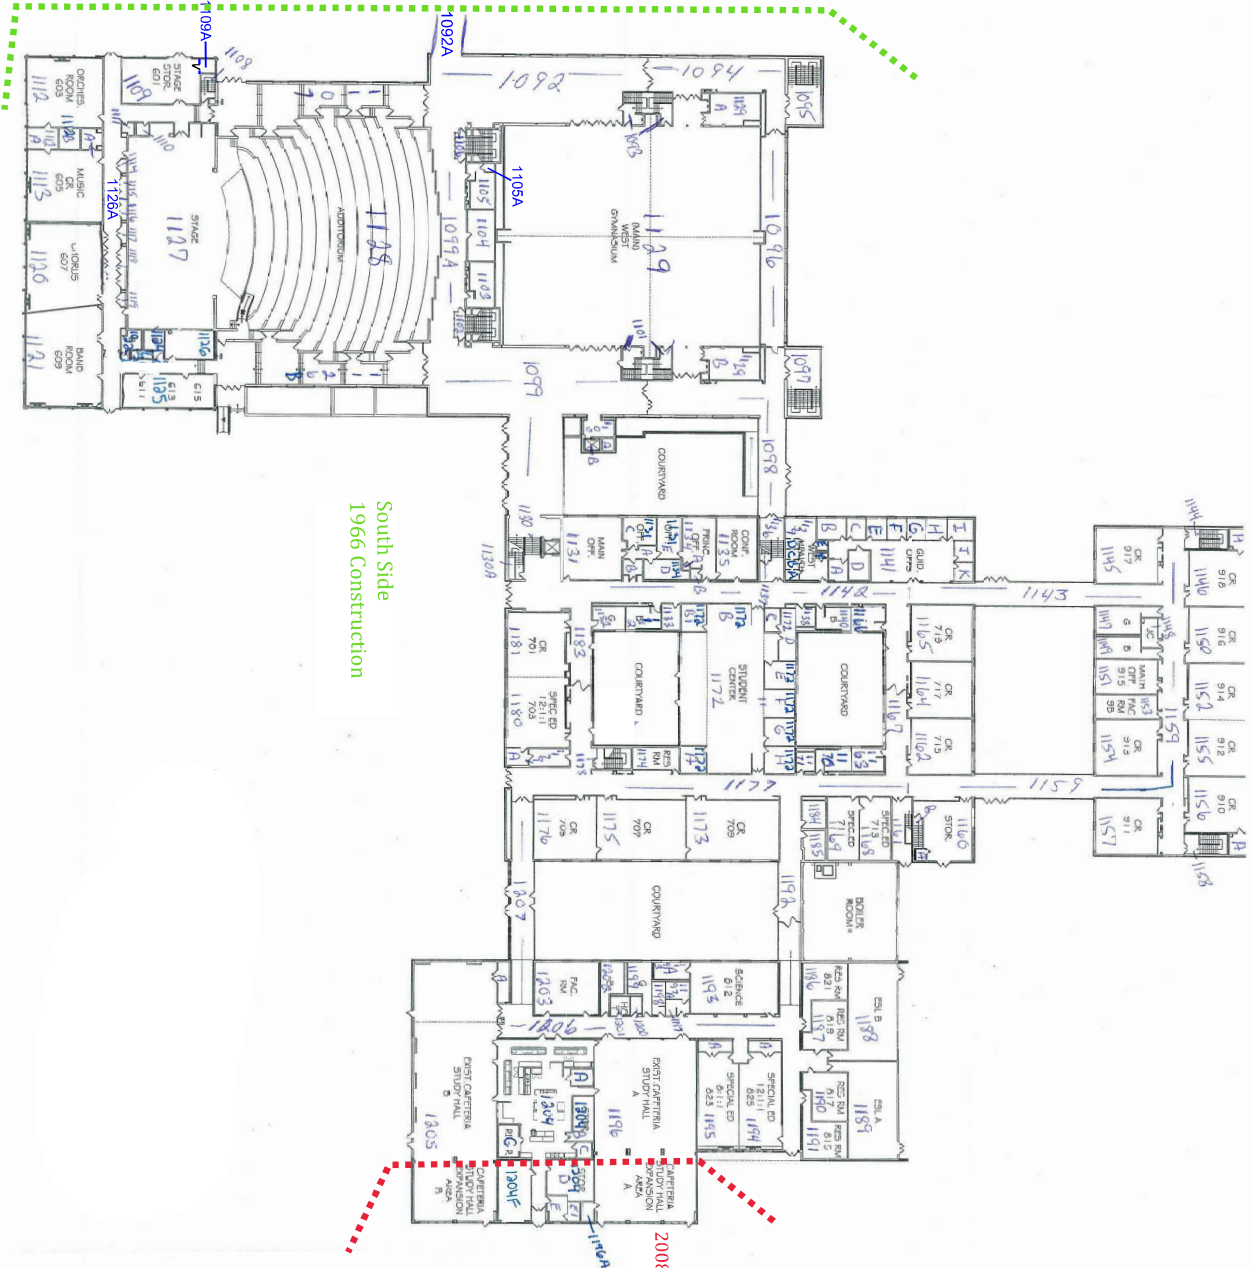

South Side
1966 Construction

2008 New Construction

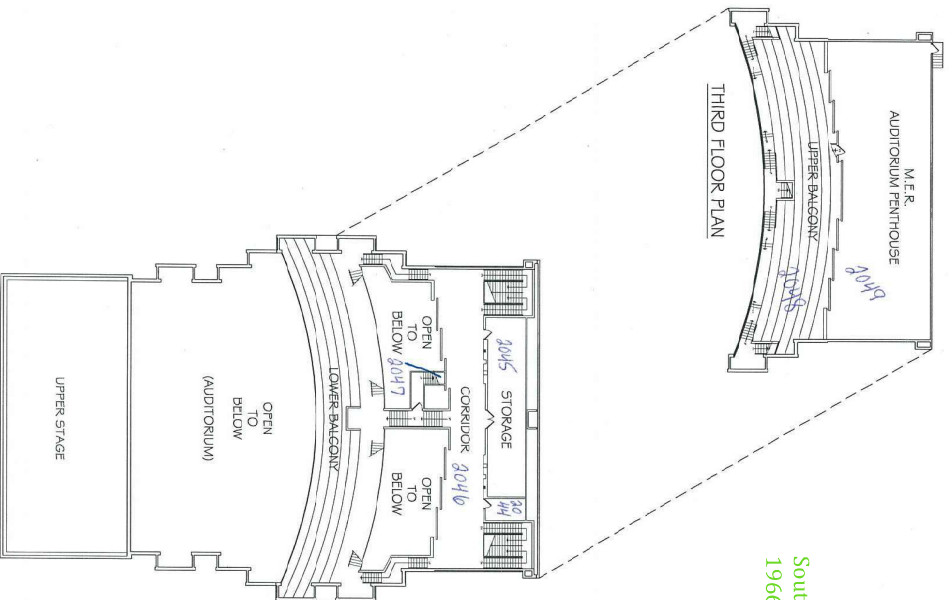

South Side
1966 Construction



ENVIROSCIENCE CONSULTANTS
2150 SMITHTOWN AVENUE
RONKONKOMA, NY 11779
(631) 580-3191
FAX 580-3195
www.envirohealth.org

KEY PLAN
NO SCALE

PROJECT
SIX MONTH AHRA SURVEILLANCE
HALF HOLLOW HILLS HIGH SCHOOL EAST
SECOND FLOOR PLAN
CLIENT
HALF HOLLOW HILLS CENTRAL SCHOOL DISTRICT



PROJECT #: 28546
COMMENTS:
None

NOT TO SCALE
Date: 06/20/2023
By: Robert Cardona
DRAWING 4 of 4

Appendix D

CERTIFICATIONS

WE ARE YOUR DOL

 **NEW YORK STATE** Department of Labor

DIVISION OF SAFETY & HEALTH LICENSE AND CERTIFICATE UNIT, STATE OFFICE CAMPUS, BLDG. 12, ALBANY, NY 12226

ASBESTOS HANDLING LICENSE

Enviroscience Consultants, LLC
2150 Smithtown Avenue, Ronkonkoma, NY, 11779

License Number: 28733
License Class: RESTRICTED
Date of Issue: 11/04/2022
Expiration Date: 11/30/2023
Duly Authorized Representative: Bartley Gallagher

This license has been issued in accordance with applicable provisions of Article 30 of the Labor Law of New York State and of the New York State Codes, Rules and Regulations (12 NYCRR Part 56). It is subject to suspension or revocation for a (1) serious violation of state, federal or local laws with regard to the conduct of an asbestos project, or (2) demonstrated lack of responsibility in the conduct of any job involving asbestos or asbestos material.

This license is valid only for the contractor named above and this license or a photocopy must be prominently displayed at the asbestos project worksite. This license verifies that all persons employed by the licensee on an asbestos project in New York State have been issued an Asbestos Certificate, appropriate for the type of work they perform, by the New York State Department of Labor.


Amy Phillips, Director
For the Commissioner of Labor

EXCELSIOR

Appendix E

NOTICE TO SHORT TERM WORKERS

NOTICE TO SHORT TERM WORKERS

All workers entering Half Hollow Hills High School East and/or the Garage must sign in, thereby acknowledging the presence and locations of asbestos containing building materials in the building. No work will be allowed in the areas listed without prior approval from the AHERA Designated Person for the Half Hollow Hills School District.

Sign in sheets will be picked up at the time of the Six Month AHERA Surveillance and will be placed in the buildings Asbestos Management Plan.

Asbestos containing materials and their locations at Half Hollow Hills High School East and Garage are listed in the AHERA Management Plan, which is available for review, upon request.

[illegible]

Appendix F
BULK SAMPLE RESULTS

ELAP # 11681; NVLAP Lab Code 200531-0

ASBESTOS BULK SAMPLE RESULTS

CLIENT:	Half Hollow Hills CSD 525 Half Hollow Road, Dix Hills, NY 11746		SAMPLE DATE:	6/1/2023	
PROJECT NAME:	AHERA Six-month Surveillance - May 2023		DATE RECEIVED:	6/2/2023	
JOB #:	23546		AREA:	HHH High School East - Terrazzo Throughout Building	
PAGE #:	1 of 2		SAMPLER:	Pamela Chadderton	
			CUSTODY #:	35245	

Lab ID	Sample #	Description	Color	Location	Total Asbestos Result	% Asbestos-type	% Non-asbestos Fibers-type	% Matrix-type
99417	T1	Terrazzo Floor	Red	Women's Faculty Bathroom Near 715 (AHERA #1163)	None Detected	None Detected	None Detected	100.0% cement
99418	T2	Terrazzo Floor	Red	Women's Faculty Bathroom Near Room 907 (AHERA #0039)	None Detected	None Detected	None Detected	100.0% cement
99419	T3	Terrazzo Floor	Tan	Corridor From Men's Bathroom To Women's Bathroom (AHERA #1099A)	None Detected	None Detected	None Detected	100.0% cement
99420	T4	Terrazzo Floor	Tan	Cafeteria B (AHERA #1205)	None Detected	None Detected	None Detected	100.0% cement
99421	T5	Terrazzo Floor	White w/ Black	Corridor Weight Room To Print Shop (AHERA #1009)	None Detected	None Detected	None Detected	100.0% cement
99422	T6	Terrazzo Floor	White w/ Black	Corridor From Room 303 To Room 309 (AHERA #1050)	None Detected	None Detected	None Detected	100.0% cement

Method: EPA 600/M4-82/20, 600/R-93/116, NYS DOH ELAP Item 198.1, 198.4, 198.6, 198.8.

ACM: Asbestos Containing Materials contain more than 1%.

None Detected - No asbestos found in samples using polarized light microscopy (PLM). Trace - Asbestos found is 1% or less, not considered ACM.

None Detected by TEM - No asbestos found in samples using transmission electron microscopy (TEM) and polarized light microscopy (PLM) was found to be negative.

Negative by Weight - After matrix reduction, the remainder is less than 1% and, therefore, cannot fulfill the definition of asbestos containing material.

Inconclusive - No asbestos found in non-friable organically bound samples using polarized light microscopy (PLM).

Method ELAP 198.6 does not remove vermiculite and may underestimate the level of asbestos present in a sample containing greater than 10% vermiculite. Samples of Surface Material that contain Vermiculite are analyzed by ELAP 198.8 for conclusive result.

This report may not be reproduced without the express permission of Enviroscience Consultants, LLC. This report cannot be used to claim endorsement of products by NVLAP or any agency of the U.S. Government. Test results only reflect conditions at the time the samples were taken.

ANALYZED BY:	<i>Valerie Schuyler</i>	PLM DATE:	6/5/2023	ANALYZED BY:		TEM DATE:	
DIRECTOR:	<i>Edward M. Schuyler</i>	DATE:	6/6/2023	REVISION #:	0	REVISION DATE:	6/6/2023

ELAP # 11681; NVLAP Lab Code 200531-0

ASBESTOS BULK SAMPLE RESULTS

CLIENT:	Half Hollow Hills CSD 525 Half Hollow Road, Dix Hills, NY 11746	SAMPLE DATE:	6/1/2023
PROJECT NAME:	AHERA Six-month Surveillance - May 2023	DATE RECEIVED:	6/2/2023
JOB #:	23546	AREA:	HHH High School East - Terrazzo Throughout Building
PAGE #:	2 of 2	SAMPLER:	Pamela Chadderton
		CUSTODY #:	35245

Lab ID	Sample #	Description	Color	Location	Total Asbestos Result	% Asbestos-type	% Non-asbestos Fibers-type	% Matrix-type
99423	T7	Terrazzo Floor	Brown	Stairwell Near Room 910 (AHERA #1158)	None Detected	None Detected	None Detected	100.0% cement
99424	T8	Terrazzo Floor	Brown	Corridor Cafeteria B To Room 705 (AHERA #1207)	None Detected	None Detected	None Detected	100.0% cement

Method: EPA 600/M4-82/20, 600/R-93/116, NYS DOH ELAP Item 198.1, 198.4, 198.6, 198.8.

ACM: Asbestos Containing Materials contain more than 1%.

None Detected - No asbestos found in samples using polarized light microscopy (PLM). Trace - Asbestos found is 1% or less, not considered ACM.

None Detected by TEM - No asbestos found in samples using transmission electron microscopy (TEM) and polarized light microscopy (PLM) was found to be negative.

Negative by Weight - After matrix reduction, the remainder is less than 1% and, therefore, cannot fulfill the definition of asbestos containing material.

Inconclusive - No asbestos found in non-friable organically bound samples using polarized light microscopy (PLM).

Method ELAP 198.6 does not remove vermiculite and may underestimate the level of asbestos present in a sample containing greater than 10% vermiculite. Samples of Surface Material that contain Vermiculite are analyzed by ELAP 198.8 for conclusive result.

This report may not be reproduced without the express permission of EnviroScience Consultants, LLC. This report cannot be used to claim endorsement of products by NVLAP or any agency of the U.S. Government. Test results only reflect conditions at the time the samples were taken.

ANALYZED BY:	<u>Valerie Schifano</u>	PLM DATE:	<u>6/5/2023</u>	ANALYZED BY:	_____	TEM DATE:	_____
DIRECTOR:	<u>Edward Mastaglio</u>	DATE:	<u>6/6/2023</u>	REVISION #:	<u>0</u>	REVISION DATE:	<u>6/6/2023</u>