

Half Hollow Hills CSD  
Six Month AHERA Surveillance  
Forest Park Elementary School & 3 Sheds  
May 2023



2150 Smithtown Avenue  
Ronkonkoma, NY 11779  
(631) 580-3191  
[www.envirohealth.org](http://www.envirohealth.org)

Project #23546

## Six Month AHERA Surveillance

Performed at

Forest Park Elementary School & 3 Sheds  
30 DeForest Road  
Dix Hills, NY 11746

for

Half Hollow Hills CSD  
Administration Building  
525 Half Hollow Road  
Dix Hills, NY 11746

May 2023

Prepared by:

Enviroscience Consultants, LLC  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779  
(631) 580-3191

Project #23546

Inspector & Management  
Planner:

  
Bartley Gallagher

NYSDOL #92-13892

Inspectors:

  
Alexis Bruno

NYSDOL #21-08575

  
Pamela Chadderton

NYSDOL #15-10408

# Six Month AHERA Surveillance

## Table of Contents

- I. Summary
- II. Inspection and Recommendations
- III. Bulk Sampling Protocol
- IV. Hazard Rank Determination
- V. AHERA Reassessment Category

Appendix A - Inventory of Damaged Asbestos Containing Materials

Appendix B - Inventory of Asbestos Containing Materials

Appendix C - Drawings - Functional Space Number Floor Plans

Appendix D - Certifications

Appendix E - Notice to Short Term Workers

Appendix F - Bulk Sample Results

## **I. Summary**

A six month AHERA surveillance for the Forest Park Elementary School and 3 Sheds of the Half Hollow Hills CSD was performed by Ms. Alexis Bruno and Mrs. Pamela Chadderton of Enviroscience Consultants, LLC on June 15, 2023.

The six month surveillance was performed in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Ms. Bruno and Mrs. Chadderton are certified AHERA Inspectors.

Ms. Bruno and Mrs. Chadderton performed the on-site investigation, which included examining existing ACBM, evaluating the condition of the ACBM, and determining if originally non-friable materials have become friable. The physical condition of most of the ACBM found in this building did not change.

After studying the inspection reports, Mr. Bartley M. Gallagher, a certified EPA/AHERA Inspector and Management Planner, developed the recommendations for response actions depending on his evaluation of the hazard that each material may cause.

An Inventory of Asbestos Containing Materials by location, including the AHERA Functional Space identification number is in Appendix B. This inventory includes the material, quantity, amount damaged, the hazard level, the AHERA Reassessment category, and recommended response actions. A remarks column includes sampling and abatement action and other pertinent information.

Floor plans correlating the AHERA Functional Space ID number with the current common location names are in Appendix C.

## **II. Inspection and Recommendations**

The inspector entered all accessible spaces to inspect and physically assess the condition and friability of all previously known or assumed ACBM. The inspector noted any change in condition of remaining materials, materials that have been abated since the last reinspection, and any materials that were either not identified, or may have been improperly classified.

Unless otherwise stated, a recommendation for removal is a suggestion that the materials be removed as soon as the school's budget will allow.

During this inspection there was damage noted, repairs should be made. Please reference your Summary of Damaged Asbestos Containing Materials found in Appendix A.

Since the last surveillance, the following asbestos abatement activities were performed:

In June 2023, bulk samples were collected of the wall panel tectum in Room 200C (AHERA space #1014B) and Reading Room 1 (AHERA space #1013A); terrazzo floor samples were also collected at various locations throughout the Building Interior. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #35346 for detailed sample location information and results.

In May 2023, asbestos containing pipe fitting insulation was removed and the duct insulation cloth was repaired in the Kitchen Storage Room (AHERA space #1006B). Please reference Enviroscience Consultants, LLC job #23597.

In February 2023, bulk samples were collected of the duct insulation in the Boiler Room (AHERA space #1010). Results confirmed the material sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #34638 for detailed sample location information and results.

## **History:**

In April 2022, asbestos containing pipe fitting insulation was removed from the Kitchen Ceiling Plenum (AHERA space #1006CP). Please reference Enviroscience Consultants job #22157.

In March 2022, bulk samples were collected of tectum decking, concrete block, and concrete block mortar at various locations throughout the School Building. Bulk samples were collected of the wall plaster in the Kitchen/Serving Area (AHERA space #1006). Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #32528 for detailed sample location information and results.

In March 2022, bulk samples were collected of the pipe fitting insulation in the Kitchen Ceiling Plenum (AHERA space #1006CP). Results confirmed the material sampled to be asbestos containing. Please reference Enviroscience Consultants chain of custody #32527 for detailed sample location information and results.

In November 2021, Enviroscience Consultants was retained by the Half Hollow Hills Central School District to perform the surveillance inspections and three year reinspections in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Any information pertaining to the assessment and changes in condition of ACBM prior to November 2021 must be obtained from the records maintained by the Half Hollow Hills Central School District.

Any damaged material that is assumed to be asbestos containing should be sampled to confirm that it is identified as ACBM before initiating repair procedures.

The inspector did not access any flooring materials located under carpeting or new tiles because obtaining access would damage the carpet or new tiles. Prior to disturbing any carpets or removing new floor tiles, the school should ascertain whether floor tiles are located beneath them. Repair or replace damaged floor tiles as noted. We have prepared an inventory of asbestos containing materials for the building. These pages list the current damage category, changes in physical condition, current priority levels, changes in response actions, and bulk sampling and abatement information (see Appendix B).

All materials are currently classified as non-friable in their present condition, except for damaged thermal insulation materials, gypsum board, joint compound, wall panel, fire door insulation, and ceiling tile.

## **III. Bulk Sampling Protocol**

**Thermal System Insulation** - Three (3) samples are randomly collected for each homogeneous material of Thermal System Insulation (TSI). AHERA states that for each area of patched TSI at least one (1) sample be collected.

**Surfacing Materials** - a minimum of three (3), five (5) or seven (7) samples based upon the amount of suspect material present.

**Miscellaneous Materials** - require a minimum of two (2) samples.

## New York State Revisions to Analytical Methods

Over the years, the New York State Department of Health has made several revisions to testing requirements that affect suspect asbestos materials in school buildings. These changes have resulted in the requirement to re-sample and analyze certain materials to comply with the revised analytical methods:

**Surfacing Materials** - In May 2016, the New York State Department of Health (NYSDOH) finalized testing requirements and approved a new analytical method for analysis of surfacing materials that contain vermiculite. Surfacing materials that could contain vermiculite include spray-on fireproofing, wall plaster, and ceiling plaster. Unfortunately, the previous analysis method for fireproofing and plasters did not specifically require that the vermiculite percentage be reported. The District must now consider any spray or troweled fireproofing or plaster materials to be presumed asbestos containing materials (PACM) until they are re-tested to conform to the new requirements. As a result, we have added any plaster previously classified as non-asbestos to the Inventory of Asbestos Containing Materials. Re-testing of any fireproofing or plaster materials will be noted in the narrative and will be shown in the Inventory.

**Ceiling Tile** - In August 2012, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in ceiling tiles that contain cellulose. Any ceiling tiles that have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Any re-testing of ceiling tiles will be noted in the narrative and will be shown in the Inventory. The District should keep records for any new non-asbestos ceiling tiles that are installed, including the location, brand, model number, date of manufacture, and date of installation.

**Floor Tile and Other NOB Materials** - In 1992, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in non-friable organically bound (NOB) materials such as floor tiles and roofing materials. As such, any floor tiles and mastic which have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Re-testing of any floor tile, mastic or other NOB materials will be noted in the narrative and will be shown in the Inventory.

During this surveillance, bulk samples were collected of the wall panel tectum in Room 200C (AHERA space #1014B) and Reading Room 1 (AHERA space #1013A); terrazzo floor samples were also collected at various locations throughout the Building Interior. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #35346 in Appendix 'F' for detailed sample location information and results.

## IV. Hazard Rank Determination

For each homogeneous material, a response action priority level is determined depending on its physical condition, location, and potential for future damage. Materials were classified into seven categories, based upon the type, condition, and potential for damage of the ACBM. The categories are as follows:

| Hazard Rank | ACBM Condition        | ACBM Disturbance Potential       |
|-------------|-----------------------|----------------------------------|
| 1           | Significantly Damaged | Any Potential for Damage         |
| 2           | Damaged               | Potential for Significant Damage |
| 3           | Damaged               | Potential for Damage             |
| 4           | Damaged               | Low Potential for Damage         |
| 5           | Good                  | Potential for Significant Damage |
| 6           | Good                  | Potential for Damage             |
| 7           | Good                  | Low Potential for Damage         |

The district shall select and implement in a timely manner the appropriate response actions consistent with the assessment category. The response actions selected shall be sufficient to protect human health and the environment. The district may then select, from the response actions which protect human health and the environment, that action which is the least burdensome method. Nothing in this section shall be construed to prohibit removal of ACBM from a school building at any time, should removal be the preferred response action of the district.

If damaged or significantly damaged thermal system insulation ACM is present in a building, the district shall:

- (1) At least repair the damaged area.
- (2) Remove the damaged material if it is not feasible, due to technological factors, to repair the damage.
- (3) Maintain all thermal system insulation ACM and its covering in an intact state and undamaged condition.

If damaged friable surfacing ACM or damaged friable miscellaneous ACM is present in a building, the district shall select from among the following response actions: encapsulation, enclosure, removal, or repair of the damaged material.

In selecting the response action from among those which meet the definitional standards in §763.83, the district shall determine which of these response actions protects human health and the environment. For purposes of determining which of these response actions are the least burdensome, the district may then consider local circumstances, including occupancy and use patterns within the school building, and its economic concerns, including short and long-term costs.

## V. AHERA Reassessment Category

The Management Planner is also required to classify each friable and thermal system insulation (TSI) ACBM and suspected ACBM assumed to be ACM in the school building into one of the following AHERA 1 through 7 reassessment categories based on damage, potential for damage, and material category:

- (1) Damaged or significantly damaged thermal system insulation ACM.
- (2) Damaged friable surfacing ACM.

- (3) Significantly damaged friable surfacing ACM.
  - (4) Damaged or significantly damaged friable miscellaneous ACM.
  - (5) ACBM with potential for damage.
  - (6) ACBM with potential for significant damage.
  - (7) Any remaining friable ACBM or friable suspected ACBM.
- N/A Not Applicable

## Appendix A

### INVENTORY OF DAMAGED ASBESTOS CONTAINING MATERIALS

Half Hollow Hills CSD  
Forest Park Elementary School and 3 Sheds

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance  
May 2023

| SPACE NO. | LOCATION                          | MATERIAL DESCRIPTION                | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                        |
|-----------|-----------------------------------|-------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------------------|
| 1001      | HEALTH ROOM                       | 9X9 FLOOR TILE & MASTIC GREY        |        | 713 SF   | 8 SF           | 4           | N/A NON FRIABLE             | REPAIR          | UNDER 12X12 FLOOR TILE, CRACKED & CHIPPED      |
| 1001A     | HEALTH ROOM BATHROOM              | FIRE DOOR INSULATION WOOD           |        | 1 DOOR   | NOT QUANTIFIED | 3           | 4                           | REPAIR          | MINOR DAMAGE ASSUMED ACM                       |
| 1001BCP   | HEALTH ROOM OFFICE CEILING PLENUM | GYPSUM BOARD                        |        | 28 SF    | NOT QUANTIFIED | 3           | 4                           | REPAIR          | MINOR DAMAGE ASSUMED ACM                       |
| 1002      | STORAGE CLOSET/ SURVEILLANCE ROOM | 9X9 FLOOR TILE & MASTIC GREY/BLACK  |        | 45 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED                                        |
| 1004      | MAIN OFFICE                       | 12X12 FLOOR TILE MASTIC             |        | 467 SF   | 22 SF          | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED; CONF ACM JCB#13-26541       |
|           |                                   | COVE BASE & MASTIC BLACK            |        | 25 SF    | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING ASSUMED ACM                       |
| 1004E     | MAIN OFFICE WAITING AREA          | COVE BASE & MASTIC BLACK            |        | 34 LF    | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING ASSUMED ACM                       |
| 1005      | CAFETERIA                         | 9X9 FLOOR TILE & MASTIC             |        | 2750 SF  | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | UNDER 12X12 FLOOR TILE, CRACKED & CHIPPED      |
|           |                                   | COVE BASE & MASTIC BLACK            |        | 87 LF    | 1 LF           | 4           | N/A NON FRIABLE             | REPAIR          | MISSING W/ MASTIC PAINTED OVER                 |
| 1005A     | STAGE                             | 9X9 FLOOR TILE & MASTIC GREY        |        | 23 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED, MASTIC EXPOSED; ASSUMED ACM |
| 1006      | KITCHEN/SERVING AREA              | CERAMIC FLOOR TILE GROUT & GLUE RED |        | 1152 SF  | 1 LF           | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                           |
|           |                                   | CERAMIC WALL BASE GROUT & GLUE RED  |        | 200 LF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                           |
| 1006A     | KITCHEN EXIT VESTIBULE            | CERAMIC WALL BASE GROUT & GLUE RED  |        | 18 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM                           |
| 1006B     | KITCHEN STORAGE                   | CEILING GYPSUM BOARD & COMPOUND     |        | 120 SF   | 4 SF           | 3           | 4                           | REPAIR          | WATER STAINED; ASSUMED ACM                     |
|           |                                   | 9X9 FLOOR TILE & MASTIC GREY        |        | 72 SF    | 12 TILES       | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING, MASTIC EXPOSED; ASSUMED ACM |
| 1006C     | KITCHEN LOCKER ROOM               | WINDOW GLAZING/ CAULKING            |        | 16 LF    | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | MINOR DAMAGE; ASSUMED ACM                      |
|           |                                   | FIRE DOOR INSULATION WOOD           |        | 2 DOORS  | NOT QUANTIFIED | 3           | 4                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM                      |

Half Hollow Hills CSD  
Forest Park Elementary School and 3 Sheds

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance  
May 2023

| SPACE No. | LOCATION                    | MATERIAL DESCRIPTION                 | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                         |
|-----------|-----------------------------|--------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|-------------------------------------------------|
| 1008      | BOY'S BATHROOM              | CERAMIC WALL BASE GROUT & GLUE WHITE |        | 30 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                            |
| 1009      | MAINTENANCE ROOM            | COVE BASE & MASTIC BROWN             |        | 99 LF    | < 1 LF         | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING ASSUMED ACM                        |
| 1011A     | ORCHESTRA ROOM              | GYPSUM BOARD (AROUND SKYLIGHT)       |        | 80 SF    | 7 SF           | 3           | 4                           | REPAIR          | CRACKED & CHIPPED; ASSUMED ACM                  |
| 1011A1    | MUSIC CUSTODIAL CLOSET      | CEILING GYPSUM BOARD & COMPOUND      |        | 12 SF    | < 1 SF         | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                            |
| 1011A2    | MUSIC STORAGE ROOM          | CERAMIC WALL TILE GROUT & GLUE       |        | 477 SF   | 4 LF           | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                            |
| 1011BCP   | COACH OFFICE CEILING PLENUM | MUD JOINT PACKING                    |        | 2 UNITS  | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM                       |
| 1012A     | GYM CLOSET 1                | 2X4 CEILING TILE PINHOLE             |        | 112 SF   | 6 TILES        | 3           | 4                           | REPAIR          | MISSING & WATER DAMAGED; CONF ACM JCB #14-28692 |
| 1012B     | GYM CLOSET 2                | CEILING GYPSUM BOARD & COMPOUND      |        | 121 SF   | 2 SF           | 3           | 4                           | REPAIR          | CHIPPED & HOLE; ASSUMED ACM                     |
| 1012C     | GYM CLOSET 3                | 2X4 CEILING TILE PINHOLE             |        | 80 SF    | 6 TILES        | 3           | 4                           | REPAIR          | MISSING & WATER DAMAGED; CONF ACM JCB#14-28692  |
| 1013      | READING ROOM VESTIBULE      | GYPSUM BOARD & COMPOUND              |        | 140 SF   | < 1 SF         | 3           | 4                           | REPAIR          | HOLES; ASSUMED ACM                              |
| 1013A     | READING ROOM 1              | 9X9 GREEN FLOOR TILE & MASTIC        |        | 264 SF   | 6 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED; ASSUMED ACM                  |
| 1013A1    | READING ROOM 1 CLOSET       | 9X9 FLOOR TILE & MASTIC GREY/BLACK   |        | 30 SF    | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                            |
| 1013B     | READING ROOM 2              | GYPSUM BOARD & COMPOUND              |        | 446 SF   | < 1 SF         | 3           | 4                           | REPAIR          | CHIPPED; ASSUMED ACM                            |
| 1014A     | ROOM 200B                   | 9X9 FLOOR TILE GREY                  |        | 180 SF   | 6 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING W/ MASTIC EXPOSED             |
|           |                             | GYPSUM BOARD & COMPOUND              |        | 180 SF   | < 1 SF         | 3           | 4                           | REPAIR          | CHIPPED; ASSUMED ACM                            |
| 1014B     | ROOM 200 C                  | 9X9 FLOOR TILE GREY                  |        | 112 SF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED; ASSUMED ACM                  |
|           |                             | WALL PANEL DEEP FISSURE              |        | 9 SF     | 1 TILE         | 4           | 4                           | REPAIR          | CHIPPED; ASSUMED ACM                            |

Half Hollow Hills CSD  
Forest Park Elementary School and 3 Sheds

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance  
May 2023

| SPACE No. | LOCATION                   | MATERIAL DESCRIPTION                    | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                        |
|-----------|----------------------------|-----------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------------------|
| 1017      | GIRL'S BATHROOM            | CERAMIC WALL BASE<br>GROUT & GLUE PINK  |        | 45 LF    | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING,<br>GLUE EXPOSED, ASSUMED    |
| 1018      | CUSTODIAL CLOSET           | COVE BASE & MASTIC<br>BLACK             |        | 15 LF    | < 1 LF         | 4           | N/A NON FRIABLE             | REPAIR          | NOT OBSERVED;<br>ASSUMED ACM                   |
| 1019      | ROOM 200H                  | 9X9 FLOOR TILE & MASTIC<br>GREY/BLACK   |        | 63 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                           |
| 1020      | BOY'S BATHROOM             | CERAMIC FLOOR TILE<br>GROUT & GLUE BLUE |        | 222 SF   | < 1 SF         | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM                           |
|           |                            | COVE BASE & MASTIC<br>BLACK             |        | 13 LF    | 6 LF           | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING; ASSUMED<br>ACM                   |
|           |                            | CERAMIC WALL BASE<br>GROUT & GLUE WHITE |        | 32 LF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM                           |
|           |                            | CERAMIC WALL TILE<br>GROUT & GLUE WHITE |        | 24 SF    | 2 LF           | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED, ASSUMED ACM                           |
|           |                            | 9X9 FLOOR TILE & MASTIC<br>TAN          |        | 810 SF   | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED, ASSUMED ACM                           |
| 1022      | ROOM 201                   | WALL PANEL SPLASH                       |        | 72 SF    | 3 SF           | 3           | 4                           | REPAIR          | CHIPPED; ASSUMED ACM                           |
| 1023      | ROOM 20                    | 1X1 WALL TILE & MASTIC<br>FISSURE       |        | 110 SF   | 1 SF           | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                           |
|           |                            | 12X12 FLOOR TILE &<br>MASTIC GREEN      |        | 590 SF   | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED, ASSUMED ACM                           |
|           |                            | COVE BASE & MASTIC<br>BLACK             |        | 104 LF   | < 1 LF         | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED;<br>ASSUMED ACM                 |
|           |                            | CERAMIC WALL BASE<br>GROUT & GLUE BEIGE |        | 104 LF   | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                           |
|           |                            | CERAMIC WALL BASE<br>GROUT & GLUE PINK  |        | 12 LF    | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM                           |
| 1023A     | ROOM 211 EXIT<br>VESTIBULE | CERAMIC WALL BASE<br>GROUT & GLUE PINK  |        |          |                | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM                           |
| 1024      | PTA COPY<br>ROOM/STORAGE   | GYPSUM BOARD &<br>COMPOUND              |        | 144 SF   | < 1 SF         | 3           | 4                           | REPAIR          | CHIPPED; ASSUMED ACM                           |
| 1025      | ROOM 202                   | 9X9 FLOOR TILE & MASTIC<br>TAN          |        | 810 SF   | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                           |
| 1026      | ROOM 203                   | WALL PANEL DEEP<br>FISSURE              |        | 72 SF    | 1 SF           | 4           | 4                           | REPAIR          | CHIPPED; ASSUMED ACM                           |
|           |                            | 9X9 FLOOR TILE & MASTIC<br>GREY         |        | 810 SF   | 9 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING W/<br>MASTIC EXPOSED         |
|           |                            | 9X9 FLOOR TILE & MASTIC<br>BROWN        |        | 810 SF   | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED W/ MASTIC<br>EXPOSED                   |
| 1027      | ROOM 204                   | COVE BASE & MASTIC<br>BLACK             |        | 89 LF    | 3 LF           | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING W/ MASTIC<br>EXPOSED, ASSUMED ACM |

Summary of Damaged Asbestos Containing Materials

| SPACE NO. | LOCATION                                      | MATERIAL DESCRIPTION                          | HA/USA | QUANTITY  | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                |
|-----------|-----------------------------------------------|-----------------------------------------------|--------|-----------|----------------|-------------|-----------------------------|-----------------|----------------------------------------|
| 1028      | STORAGE/ SERVER ROOM                          | 9X9 FLOOR TILE & MASTIC GREY/BLACK            |        | 140 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | MISSING w/ MASTIC EXPOSED              |
| 1029      | ROOM 205                                      | 9X9 FLOOR TILE & MASTIC TAN                   |        | 810 SF    | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | MINOR DAMAGE; ASSUMED ACM              |
| 1030      | ROOM 206                                      | 9X9 FLOOR TILE & MASTIC GREY/BLACK            |        | 810 SF    | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED AND CHIPPED                    |
| 1031      | ROOM 207                                      | 9X9 FLOOR TILE & MASTIC BROWN                 |        | 810 SF    | 3 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED w/ MASTIC EXPOSED              |
|           |                                               | WALL/ CHALK- BOARD MASTIC                     |        | 152 SF    | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | EXPOSED, ASSUMED ACM                   |
| 1032      | ROOM 208                                      | 9X9 FLOOR TILE & MASTIC GREY                  |        | 810 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | MISSING & DEBRIS w/ MASTIC EXPOSED     |
|           |                                               | COVE BASE & MASTIC BLACK                      |        | 111 LF    | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED; ASSUMED ACM            |
| 1033      | ROOM 210                                      | 9X9 FLOOR TILE & MASTIC GREY/BLACK            |        | 810 SF    | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED, ASSUMED ACM                   |
| 1034      | ROOM 209                                      | COVE BASE & MASTIC BLACK                      |        | 111 LF    | 1 LF           | 4           | N/A NON FRIABLE             | REPAIR          | MISSING w/ MASTIC EXPOSED; ASSUMED ACM |
| 1035CP    | 200 WING CORRIDOR GYM ROOM 210 CEILING PLENUM | MUD JOINT PACKING                             |        | 101 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM              |
| 1036      | ROOM 211 / CONFERENCE ROOM/ PROFESSIONAL ROOM | 9X9 FLOOR TILE & MASTIC BROWN                 |        | 468 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED AND CHIPPED                    |
| 1038      | BOY'S BATHROOM                                | CERAMIC FLOOR TILE GROUT & GLUE BLUE          |        | 160 SF    | <1 SF          | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM                   |
|           |                                               | CERAMIC WALL TILE GROUT & GLUE WHITE          |        | 488 SF    | 20 LF          | 4           | N/A NON FRIABLE             | REPAIR          | MISSING & CRACKED; ASSUMED ACM         |
| 1039      | ROOM 300/ MECHANICAL ROOM                     | 12X12 FLOOR TILE & MASTIC BEIGE/ MULTI COLORS |        | 180 SF    | 3 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | LOOSE & DEBRIS w/ MASTIC EXPOSED       |
| 1039CP    | ROOM 300/ MECHANICAL ROOM CEILING PLENUM      | MUD JOINT PACKING                             |        | 48 UNITS  | 2 UNITS        | 4           | 1                           | REPAIR          | DAMAGED; ASSUMED ACM                   |
| 1040      | GIRLS BATHROOM                                | CERAMIC FLOOR TILE GROUT & GLUE PINK          |        | 160 SF    | <1 SF          | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM                   |
|           |                                               | CERAMIC WALL TILE GROUT & GLUE WHITE          |        | 488 SF    | 3 LF           | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING GROUT; ASSUMED ACM   |

Half Hollow Hills CSD  
Forest Park Elementary School and 3 Sheds

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance  
May 2023

| SPACE No. | LOCATION                                       | MATERIAL DESCRIPTION                               | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                   |
|-----------|------------------------------------------------|----------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|-------------------------------------------|
| 1042CP    | ROOM 310 CEILING<br>PLENUM                     | MUD JOINT PACKING                                  |        | 18 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | DAMAGED WITH DEBRIS;<br>ASSUMED ACM       |
| 1043      | ROOM 309                                       | 12X12 FLOOR TILE &<br>MASTIC WHITE                 |        | 630 SF   | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED;<br>ASSUMED ACM         |
| 1043CP    | ROOM 309 CEILING<br>PLENUM                     | MUD JOINT PACKING                                  |        | 25 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | DAMAGED WITH DEBRIS;<br>ASSUMED ACM       |
| 1044      | ROOM 308                                       | 12X12 FLOOR TILE &<br>MASTIC WHITE                 |        | 1009 SF  | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED & MISSING;<br>ASSUMED ACM         |
| 1044CP    | ROOM 308 CEILING<br>PLENUM                     | MUD JOINT PACKING                                  |        | 9 UNITS  | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED<br>ACM              |
| 1045      | CUSTODIAL CLOSET                               | GYPSUM BOARD &<br>COMPOUND                         |        | 45 SF    | 3 SF           | 3           | 4                           | REPAIR          | CRACKED & HOLE;<br>ASSUMED ACM            |
| 1046      | ROOM 307                                       | 12X12 FLOOR TILE &<br>MASTIC WHITE                 |        | 630 SF   | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED AND CHIPPED W/<br>MASTIC EXPOSED  |
| 1046CP    | ROOM 307 CEILING<br>PLENUM                     | MUD JOINT PACKING                                  |        | 26 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED<br>ACM              |
| 1047      | ROOM 306                                       | 12X12 FLOOR TILE &<br>MASTIC BEIGE MULTI<br>COLORS |        | 630 SF   | 6 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED,<br>ASSUMED ACM         |
| 1048      | ROOM 305                                       | 12X12 FLOOR TILE &<br>MASTIC BEIGE MULTI<br>COLORS |        | 630 SF   | 3 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED W/ MASTIC<br>EXPOSED; ASSUMED ACM |
| 1048CP    | ROOM 305 CEILING<br>PLENUM                     | MUD JOINT PACKING                                  |        | 10 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED<br>ACM              |
| 1049      | ROOM 304                                       | 12X12 FLOOR TILE &<br>MASTIC WHITE                 |        | 630 SF   | 3 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                      |
| 1051      | COMMON AREA ROOM<br>304- 307                   | 12X12 FLOOR TILE &<br>MASTIC BEIGE/BROWN           |        | 1086 SF  | 3 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED,<br>ASSUMED ACM         |
| 1051CP    | COMMON AREA ROOM<br>304- 307 CEILING<br>PLENUM | MUD JOINT PACKING                                  |        | 65 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | DEBRIS; 8 UNITS ABATED<br>JCB#14-28707    |
| 1052      | STORAGE ROOM<br>OPPOSITE ROOM 303              | 12X12 FLOOR TILE &<br>MASTIC BLACK                 |        | 168 SF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                      |
| 1053      | ROOM 303                                       | 12X12 FLOOR TILE &<br>MASTIC GREEN                 |        | 1009 SF  | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED W/ MASTIC<br>EXPOSED; ASSUMED ACM |
|           |                                                | METAL SINK<br>UNDERCOATING BLACK                   |        | 1 UNIT   | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | MINOR DAMAGE; ASSUMED<br>ACM              |
| 1053CP    | ROOM 303 CEILING<br>PLENUM                     | MUD JOINT PACKING                                  |        | 29 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED<br>ACM              |

Summary of Damaged Asbestos Containing Materials

| SPACE NO. | LOCATION                                           | MATERIAL DESCRIPTION                  | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                          |
|-----------|----------------------------------------------------|---------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|--------------------------------------------------|
| 1054      | FILE ROOM                                          | 12X12 FLOOR TILE & MASTIC BEIGE/BROWN |        | 170 SF   | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                             |
| 1055      | LIBRARY                                            | WALL/CHALK-BOARD MASTIC               |        | 200 SF   | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED; ASSUMED ACM                      |
| 1055CP    | LIBRARY CEILING PLENUM                             | MUD JOINT PACKING                     |        | 45 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM                        |
| 1056      | COMMON AREA LIBRARY, ROOMS 309, 310                | 12X12 FLOOR TILE & MASTIC BEIGE/BROWN |        | 1086 SF  | 3 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED W/ MASTIC EXPOSED; ASSUMED ACM |
| 1056CP    | COMMON AREA LIBRARY, ROOMS 309, 310 CEILING PLENUM | MUD JOINT PACKING                     |        | 25 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM                        |
| 1057      | CORRIDOR LIBRARY-ROOM 304                          | 12X12 FLOOR TILE & MASTIC BEIGE/BROWN |        | 252 SF   | 8 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED, ASSUMED ACM                   |
|           |                                                    | GYPSON BOARD & COMPOUND               |        | 360 SF   | <1 SF          | 3           | 4                           | REPAIR          | DENTED; ASSUMED ACM                              |
|           |                                                    | WALL/CHALK-BOARD MASTIC               |        | 150 SF   | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED; ASSUMED ACM                      |
| 1058      | CORRIDOR ROOM 307-309                              | 12X12 FLOOR TILE & MASTIC BEIGE/BROWN |        | 256 SF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                             |
|           |                                                    | GYPSON BOARD & COMPOUND               |        | 360 SF   | <1 SF          | 3           | 4                           | REPAIR          | DENTED; ASSUMED ACM                              |
|           |                                                    | WALL/CHALK-BOARD MASTIC               |        | 150 SF   | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED; ASSUMED ACM                      |
| 1059      | CORRIDOR 300 WING-BATHROOMS                        | 12X12 FLOOR TILE & MASTIC BEIGE/BROWN |        | 224 SF   | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                             |
| 1060      | CORRIDOR 300 WING-200 WING "BREEZE WAY"            | 12X12 FLOOR TILE & MASTIC GREY PEBBLE |        | 80 SF    | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                             |
| 1062      | BOOK STORAGE                                       | 9X9 FLOOR TILE & MASTIC GREEN         |        | 480 SF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                             |
|           |                                                    | COVE BASE & MASTIC BLACK              |        | 46 LF    | 15 LF          | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED; ASSUMED ACM                      |
| 1063CP    | CORRIDOR MAINTENANCE - ROOM 108 CEILING PLENUM     | MUD JOINT PACKING                     |        | 38 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM                        |
| 1064      | RESOURCE ROOM                                      | 9X9 FLOOR TILE & MASTIC BROWN         |        | 308 SF   | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                             |

| SPACE No. | LOCATION                             | MATERIAL DESCRIPTION                                  | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                              |
|-----------|--------------------------------------|-------------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------------------------|
| 1064CP    | RESOURCE ROOM<br>CEILING PLENUM      | GYPSUM BOARD                                          |        | 44 SF    | NOT QUANTIFIED | 3           | 4                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM                            |
| 1065      | LAPTOP STORAGE<br>CLOSET             | 9X9 FLOOR TILE & MASTIC<br>GREY/BLACK                 |        | 150 SF   | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                                 |
|           |                                      | COVE BASE & MASTIC<br>BLACK                           |        | 50 LF    | 2 LF           | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING W/ MASTIC<br>EXPOSED; ASSUMED ACM       |
| 1066      | ROOM 107                             | 9X9 FLOOR TILE & MASTIC<br>BROWN                      |        | 810 SF   | 58 TILES       | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING W/<br>MASTIC EXPOSED               |
| 1067A     | ROOM 106 BATHROOM                    | CERAMIC FLOOR TILE<br>GROUT & GLUE GREY<br>WITH WHITE |        | 24 SF    | < 1 SF         | 4           | N/A NON FRIABLE             | REPAIR          | HOLE W/ MISSING TILE ;<br>ASSUMED ACM                |
| 1068      | ROOM 105 VESTIBULE                   | 9X9 FLOOR TILE & MASTIC<br>TAN                        |        | 72 SF    | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING,<br>MASTIC EXPOSED;<br>ASSUMED ACM |
|           |                                      | GYPSUM BOARD &<br>COMPOUND                            |        | 162 SF   | < 1 SF         | 3           | 4                           | REPAIR          | DENTED; ASSUMED ACM                                  |
| 1068A     | ROOM 105                             | 9X9 FLOOR TILE & MASTIC<br>TAN                        |        | 252 SF   | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                                 |
| 1068A1    | ROOM 105B                            | 9X9 FLOOR TILE & MASTIC<br>TAN                        |        | 224 SF   | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                                 |
|           |                                      | GYPSUM BOARD &<br>COMPOUND                            |        | 228 SF   | < 1 SF         | 3           | 4                           | REPAIR          | DENTED; ASSUMED ACM                                  |
| 1068B     | ROOM 105A                            | 9X9 FLOOR TILE & MASTIC<br>TAN                        |        | 468 SF   | 18 TILES       | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED,<br>ASSUMED ACM                    |
| 1072      | ROOM 101                             | CEILING GYPSUM BOARD<br>& COMPOUND                    |        | 50 SF    | < 1 SF         | 3           | 4                           | REPAIR          | HOLES; ASSUMED ACM                                   |
| 1074      | ROOM 108                             | 9X9 FLOOR TILE & MASTIC<br>TAN                        |        | 810 SF   | 10 TILES       | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED & MISSING W/<br>MASTIC EXPOSED               |
|           |                                      | COVE BASE & MASTIC<br>BLACK                           |        | 111 LF   | 2 LF           | 4           | N/A NON FRIABLE             | REPAIR          | MISSING W/ MASTIC<br>EXPOSED; ASSUMED ACM            |
| 1076      | FACULTY WOMEN'S<br>BATHROOM 100 WING | CERAMIC WALL BASE<br>GROUT & GLUE WHITE               |        | 23 SF    | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                                 |
| 1078      | BOY'S BATHROOM 100<br>WING           | CERAMIC FLOOR TILE<br>GROUT & GLUE BLUE               |        | 319 SF   | 1 SF           | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM                                 |
|           |                                      | CERAMIC WALL BASE<br>GROUT & GLUE WHITE               |        | 72 SF    | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED,<br>ASSUMED ACM                    |
|           |                                      | CERAMIC WALL TILE<br>GROUT & GLUE WHITE               |        | 28 SF    | 6 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING<br>GROUT; ASSUMED ACM              |

| SPACE No. | LOCATION                                | MATERIAL DESCRIPTION               | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                     |
|-----------|-----------------------------------------|------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------------|
| 1079      | ROOM 109                                | 9X9 FLOOR TILE & MASTIC BROWN      |        | 810 SF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED W/ MASTIC EXPOSED; ASSUMED ACM      |
|           |                                         | COVE BASE & MASTIC BLACK           |        | 111 LF   | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING W/ MASTIC EXPOSED, ASSUMED ACM |
| 1080      | ROOM 110                                | 9X9 FLOOR TILE & MASTIC GREY/BLACK |        | 810 SF   | 6 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED, ASSUMED ACM              |
|           |                                         | WALL/CHALK-BOARD MASTIC            |        | 150 SF   | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED; ASSUMED ACM                 |
| 1082      | ROOM 112                                | 9X9 FLOOR TILE & MASTIC GREY       |        | 810 SF   | 6 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED, LOOSE & CHIPPED W/ MASTIC EXPOSED  |
|           |                                         | COVE BASE & MASTIC BLACK           |        | 111 LF   | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | MISSING W/ MASTIC EXPOSED; ASSUMED ACM      |
| 1083CP    | CORRIDOR ROOMS 101 - 112 CEILING PLENUM | MUD JOINT PACKING                  |        | 51 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM                   |

**Appendix B**

**INVENTORY OF ASBESTOS CONTAINING MATERIALS**

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                   | MATERIAL DESCRIPTION                            | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                   |
|-----------|----------------------------|-------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|-------------------------------------------|
| 1001      | HEALTH ROOM                | 9X9 FLOOR TILE & MASTIC GREY                    |        | 713 SF   | 8 SF           | 4           | N/A NON FRIABLE             | REPAIR          | UNDER 12X12 FLOOR TILE, CRACKED & CHIPPED |
|           |                            | BROWN COVE BASE & MASTIC                        |        | 96 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                            | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)     |
|           |                            | WALL/ CHALK- BOARD MASTIC                       |        | 48 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                            | WOOD PANEL MASTIC                               |        | 129 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                            | WINDOW GLAZING/ CAULKING                        |        | 0        |                |             |                             |                 | ABATED EIC, 2002                          |
|           |                            | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                            | 2X2 CEILING TILE SPECKLED                       |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692                      |
| 1001CP    | HEALTH ROOM CEILING PLENUM | GYPSUM BOARD                                    |        | 28 SF    | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
| 1001A     | HEALTH ROOM BATHROOM       | TECTUM DECKING                                  |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)     |
|           |                            | CERAMIC FLOOR TILE GROUT & GLUE GRAY WITH WHITE |        | 25 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                            | CERAMIC WALL BASE GROUT & GLUE WHITE            |        | 17 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                            | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)     |
|           |                            | MIRROR MASTIC                                   |        | 2 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                            | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | NOT QUANTIFIED | 3           | 4                           | REPAIR          | MINOR DAMAGE<br>ASSUMED ACM               |
|           |                            | CEILING PLASTER SMOOTH                          |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949                      |

| SPACE NO. | LOCATION                          | MATERIAL DESCRIPTION               | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                             |
|-----------|-----------------------------------|------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|-------------------------------------|
| 1001 B    | HEALTH ROOM OFFICE                | 9X9 FLOOR TILE & MASTIC            |        | 84 SF    |                | 7           | N/A NON FRIABLE             | O&M             | UNDER 12X12 FLOOR TILE; ASSUMED ACM |
|           |                                   | BROWN COVE BASE & MASTIC           |        | 23 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM         |
|           |                                   | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (EC1 JOB #22126)  |
|           |                                   | WOOD PANEL MASTIC                  |        | 129 SF   |                | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM         |
|           |                                   | WINDOW GLAZING/ CAULKING           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                    |
| 1001 BCP  | HEALTH ROOM OFFICE CEILING PLENUM | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM         |
|           |                                   | 2X2 CEILING TILE SPECKLED          |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM            |
|           |                                   | GYPNUM BOARD                       |        | 28 SF    | NOT QUANTIFIED | 3           | 4                           | REPAIR          | MINOR DAMAGE ASSUMED ACM            |
|           |                                   | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (EC1 JOB #22126)  |
|           |                                   | 9X9 FLOOR TILE & MASTIC            |        | 35 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | ASSUMED ACM; GOOD CONDITION         |
| 1001 C    | HEALTH ROOM STORAGE               | COVE BASE & MASTIC BLACK           |        | 21 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | ASSUMED ACM; GOOD CONDITION         |
|           |                                   | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (EC1 JOB #22126)  |
|           |                                   | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | ASSUMED ACM; GOOD CONDITION         |
|           |                                   | CEILING GYPNUM BOARD & COMPOUND    |        | 35 SF    | 0              | 6           | 5                           | O&M             | ASSUMED ACM; GOOD CONDITION         |
|           |                                   | 9X9 FLOOR TILE & MASTIC GREY/BLACK |        | 45 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED                             |
| 1002      | STORAGE CLOSET/ SURVEILLANCE ROOM | COVE BASE & MASTIC BLACK           |        | 25 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | ASSUMED ACM; GOOD CONDITION         |
|           |                                   | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (EC1 JOB #22126)  |
|           |                                   | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM         |
|           |                                   | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (EC1 JOB #22126)  |
|           |                                   |                                    |        |          |                |             |                             |                 |                                     |

| SPACE NO. | LOCATION                                     | MATERIAL DESCRIPTION              | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                        |
|-----------|----------------------------------------------|-----------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------------------|
| 1003      | CORRIDOR STORAGE CLOSET/ OLD TELEPHONE BOOTH | TERRAZZO FLOORING GREY WITH WHITE |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECL JOB #23546)             |
|           |                                              | CONCRETE BLOCK & MORTAR           |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
|           |                                              | FIRE DOOR INSULATION WOOD         |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                                              | LIGHT FIXTURE HEAT SHIELD         |        | 3 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                                              | CEILING GYPSUM BOARD & COMPOUND   |        | 18 SF    | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                                              | 12X12 FLOOR TILE WHITE            |        | 0        |                |             |                             |                 | NON ACM JCB #13-26541                          |
|           |                                              | 12X12 FLOOR TILE MASTIC           |        | 467 SF   | 22 SF          | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED; CONF ACM JCB #13-26541      |
| 1004      | MAIN OFFICE                                  | FLOOR TILE GREY                   |        | 467 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | UNDER 12X12 FLOOR TILE; CONF ACM JCB #13-26541 |
|           |                                              | FLOOR TILE MASTIC LOWER LAYER     |        | 0        |                |             |                             |                 | NON ACM JCB #13-26541                          |
|           |                                              | TERRAZZO FLOORING GREY WITH WHITE |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECL JOB #23546)             |
|           |                                              | COVE BASE & MASTIC BLACK          |        | 25 SF    | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING ASSUMED ACM                       |
|           |                                              | COVE BASE & MASTIC BROWN          |        | 44 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                                              | CONCRETE BLOCK & MORTAR           |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
|           |                                              | WINDOW GLAZING/ CAULKING          |        | 0        |                |             |                             |                 | ABATED EIC, 2002                               |
|           |                                              | FIRE DOOR INSULATION WOOD         |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                                              | 2x2 CEILING TILE SPECKLED         |        | 0        |                |             |                             |                 | NON ACM JCB #14-28692 TEM                      |
|           |                                              | NON-GLASS WINDOW PANEL            |        | 80 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
| 1004CP    | MAIN OFFICE CEILING PLENUM                   | TECTUM DECKING                    |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                             | MATERIAL DESCRIPTION               | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                        |
|-----------|--------------------------------------|------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------------------|
| 1004A     | MAIN OFFICE MAIL CLOSET              | 9X9 FLOOR TILE & MASTIC GREY/BLACK |        | 16 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                                      | COVE BASE & MASTIC BLACK           |        | 13 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                                      | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
|           |                                      | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                                      | 1X1 CEILING TILE                   |        | 0        |                |             |                             |                 | METAL, ASSUMED NON-ACM                         |
| 1004B     | MAIN OFFICE COPY ROOM                | 12X12 FLOOR TILE MASTIC            |        | 136 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; CONF ACM JCB #13-26541         |
|           |                                      | 12X12 FLOOR TILE WHITE             |        | 0        |                |             |                             |                 | NON ACM JCB#13-26541                           |
|           |                                      | FLOOR TILE GREY                    |        | 136 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | UNDER 12X12 FLOOR TILE; CONF ACM JCB #13-26541 |
|           |                                      | FLOOR TILE MASTIC UNDER 12X12      |        | 0        |                |             |                             |                 | NON ACM JCB#13-26541                           |
|           |                                      | COVE BASE & MASTIC BROWN           |        | 47 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                                      | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
|           |                                      | WINDOW GLAZING/ CAULKING           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                               |
|           |                                      | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                                      | METAL SINK UNDERCOATING BLACK      |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                                      | 2X2 CEILING TILE SPECKLED          |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                       |
| 1004BCP   | MAIN OFFICE COPY ROOM CEILING PLENUM | NON-GLASS WINDOW PANEL             |        | 40 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                                      | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                            | MATERIAL DESCRIPTION               | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|-------------------------------------|------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1004C     | MAIN OFFICE SUPPLIES ROOM           | 9X9 FLOOR TILE & MASTIC GREY/BLACK |        | 40 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | COVE BASE & MASTIC BLACK           |        | 23 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                     | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
| 1004D     | MAIN OFFICE PRINCIPAL OFFICE        | 9X9 FLOOR TILE & MASTIC            |        | 0        |                |             |                             |                 | NEW WOOD FLOOR<br>OBSERVED            |
|           |                                     | CARPET MASTIC                      |        | 0        |                |             |                             |                 | NEW WOOD FLOOR<br>OBSERVED            |
|           |                                     | COVE BASE & MASTIC BLACK           |        | 82 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                     | WINDOW GLAZING/ CAULKING           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                                     | NON-GLASS WINDOW PANEL             |        | 8 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | FIRE DOOR INSULATION WOOD          |        | 2 DOORS  | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | 2X2 CEILING TILE SPECKLED          |        | 0        |                |             |                             |                 | NON ACM JCB#14-<br>28692 TEM          |
|           |                                     | NON-GLASS WINDOW PANEL             |        | 36 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
| 1004D1    | MAIN OFFICE PRINCIPAL OFFICE CLOSET | 9X9 FLOOR TILE & MASTIC BROWN      |        | 18 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | COVE BASE & MASTIC BLACK           |        | 15 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | CEILING GYPSUM BOARD & COMPOUND    |        | 18 SF    | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     |                                    |        |          |                |             |                             |                 |                                       |

| SPACE NO. | LOCATION                                | MATERIAL DESCRIPTION                            | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                   |
|-----------|-----------------------------------------|-------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|-------------------------------------------|
| 1004D2    | MAIN OFFICE PRINCIPAL OFFICE BATHROOM   | CERAMIC FLOOR TILE GROUT & GLUE GRAY WITH WHITE |        | 25 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM               |
|           |                                         | CERAMIC WALL BASE GROUT & GLUE WHITE            |        | 17 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM               |
|           |                                         | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #221 26)       |
|           |                                         | MIRROR MASTIC                                   |        | 2 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM               |
|           |                                         | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM               |
| 1004E     | MAIN OFFICE WAITING AREA                | CEILING PLASTER SMOOTH                          |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949                      |
|           |                                         | TERRAZZO FLOORING                               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECL JOB #23546)        |
|           |                                         | COVE BASE & MASTIC BLACK                        |        | 34 LF    | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING ASSUMED ACM                  |
|           |                                         | FIRE DOOR INSULATION WOOD                       |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM               |
|           |                                         | 2X2 CEILING TILE SPECKLED                       |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                  |
| 1004ECP   | MAIN OFFICE WAITING AREA CEILING PLENUM | TECTUM DECKING                                  |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #221 26)       |
| 1005      | CAFETERIA                               | 9X9 FLOOR TILE & MASTIC                         |        | 2750 SF  | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | UNDER 12X12 FLOOR TILE. CRACKED & CHIPPED |
|           |                                         | COVE BASE & MASTIC BLACK                        |        | 87 LF    | 1 LF           | 4           | N/A NON FRIABLE             | REPAIR          | MISSING W/ MASTIC PAINTED OVER            |
|           |                                         | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #221 26)       |
|           |                                         | WINDOW GLAZING/ CAULKING                        |        | 0        |                |             |                             |                 | ABATED EIC, 2002                          |
|           |                                         | NON-GLASS WINDOW PANEL                          |        | 180 SF   |                | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM               |
|           |                                         | FIRE DOOR INSULATION WOOD                       |        | 4 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM               |
|           |                                         | FIRE DOOR INSULATION METAL                      |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM               |
|           |                                         | 2X2 CEILING TILE SPECKLED                       |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                  |
|           |                                         |                                                 |        |          |                |             |                             |                 |                                           |
|           |                                         |                                                 |        |          |                |             |                             |                 |                                           |

| SPACE NO. | LOCATION                            | MATERIAL DESCRIPTION                | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                                          |
|-----------|-------------------------------------|-------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------------------------------------|
| 1005A     | STAGE                               | WOOD FLOOR TAR/VAPOR BARRIER        |        | 1 188 SF | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                                      |
|           |                                     | 9X9 FLOOR TILE & MASTIC GREY        |        | 23 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED, MASTIC EXPOSED; ASSUMED ACM                   |
|           |                                     | 12X12 FLOOR TILE & MASTIC WHITE     |        | 23 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                                      |
|           |                                     | COVE BASE& MASTIC BLACK             |        | 1 1 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                                      |
|           |                                     | CONCRETE BLOCK & MORTAR             |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)                               |
|           |                                     | FIRE CURTAINS BLACK/GREEN           |        | 2 SETS   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                                      |
|           |                                     | FIRE DOOR INSULATION METAL          |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                                      |
|           |                                     | WOOD FLOOR TAR/VAPOR BARRIER        |        | 56 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                                      |
|           |                                     | CONCRETE BLOCK & MORTAR             |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)                               |
|           |                                     | FIRE DOOR INSULATION WOOD           |        | 2 DOORS  | 0              | 7           | 7                           | O&M             | GOOD CONDITION; ASSUMED ACM                                      |
| 1006      | KITCHEN/SERVING AREA                | CERAMIC FLOOR TILE GROUT & GLUE RED |        | 1 152 SF | 1 LF           | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                                             |
|           |                                     | CERAMIC WALL BASE GROUT & GLUE RED  |        | 200 LF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                                             |
|           |                                     | WALL PLASTER SMOOTH                 |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)                               |
|           |                                     | WINDOW GLAZING/CAULKING             |        | 108 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                                      |
|           |                                     | FIRE DOOR INSULATION WOOD           |        | 4 DOORS  | 0              | 7           | 7                           | O&M             | GOOD CONDITION; CONF ACM JCB #13-26541                           |
|           |                                     | 1X1 CEILING TILE METAL              |        | 0        |                |             |                             |                 | METAL, NOT SUSPECT                                               |
| 1006CP    | KITCHEN/SERVING AREA CEILING PLENUM | MUD JOINT PACKING                   |        | N/A      | 0              | 7           | 7                           | O&M             | 10 UNITS ABATED JCB #14-28927<br>8 UNITS ABATED (ECI JOB #22157) |

| SPACE NO. | LOCATION                    | MATERIAL DESCRIPTION                | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|-----------------------------|-------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1006A     | KITCHEN EXIT VESTIBULE      | CERAMIC FLOOR TILE GROUT & GLUE RED |        | 54 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | CERAMIC WALL BASE GROUT & GLUE RED  |        | 18 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM               |
|           |                             | WALL PLASTER                        |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                             | WINDOW GLAZING/ CAULKING            |        | 8 LF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | FIRE DOOR INSULATION WOOD           |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | FIRE DOOR INSULATION METAL          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1006A1    | KITCHEN WASTE BIN WASH AREA | 1X1 CEILING TILE METAL              |        | 0        |                |             |                             |                 | METAL, NOT SUSPECT                 |
|           |                             | CERAMIC FLOOR TILE GROUT & GLUE RED |        | 48 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | CERAMIC WALL BASE GROUT & GLUE RED  |        | 25 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | WALL PLASTER                        |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                             | FIRE DOOR INSULATION WOOD           |        | 1 DOOR   | 0              | 7           | 7                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | CEILING PLASTER                     |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949               |
| 1006B     | KITCHEN STORAGE             | CERAMIC FLOOR TILE GROUT & GLUE RED |        | 120 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | CERAMIC WALL BASE GROUT & GLUE RED  |        | 43 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | WALL PLASTER                        |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                             | WINDOW GLAZING/ CAULKING            |        | 16 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | VIBRATION REDUCER CLOTH WHITE       |        | 2 UNITS  | 0              | 6           | 5                           | O&M             | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                             | MUD JOINT PACKING                   |        | 0        |                |             |                             |                 | ABATED MAY 2023 (ECL JOB #23597)   |
|           |                             | DUCT INSULATION                     |        | 0        |                |             |                             |                 | FIBERGLASS                         |
|           |                             | DUCT INSULATION CLOTH               |        | 124 SF   | 0              | 6           | 5                           | O&M             | REPAIRED- GOOD CONDITION; ASSUMED  |
|           |                             | CEILING GYPSUM BOARD & COMPOUND     |        | 120 SF   | 4 SF           | 3           | 4                           | REPAIR          | WATER STAINED; ASSUMED ACM         |

| SPACE NO. | LOCATION                      | MATERIAL DESCRIPTION                | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                        |
|-----------|-------------------------------|-------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------------------|
| 1006C     | KITCHEN LOCKER ROOM           | 9X9 FLOOR TILE & MASTIC GREY        |        | 72 SF    | 12 TILES       | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING, MASTIC EXPOSED; ASSUMED ACM |
|           |                               | CERAMIC FLOOR TILE GROUT & GLUE RED |        | 12 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                               | COVE BASE & MASTIC BLACK            |        | 31 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                               | CONCRETE BLOCK & MORTAR             |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
|           |                               | MIRROR MASTIC                       |        | 6 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                               | WINDOW GLAZING/ CAULKING            |        | 16 LF    | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | MINOR DAMAGE; ASSUMED ACM                      |
| 1007      | FACULTY LOUNGE                | FIRE DOOR INSULATION WOOD           |        | 2 DOORS  | NOT QUANTIFIED | 3           | 4                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM                      |
|           |                               | CEILING PLASTER SMOOTH              |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949                           |
|           |                               | 12X12 FLOOR TILE & MASTIC TAN       |        | 816 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                               | COVE BASE & MASTIC BROWN            |        | 160 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                               | CONCRETE BLOCK & MORTAR             |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
|           |                               | WALL/ CHALK- BOARD MASTIC           |        | 85 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                               | WOOD PANEL MASTIC                   |        | 378 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                               | WINDOW GLAZING/ CAULKING            |        | 0        |                |             |                             |                 | ABATED EIC, 2002                               |
|           |                               | FIRE DOOR INSULATION WOOD           |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                               | METAL SINK UNDERCOATING BLACK       |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
| 1007CP    | FACULTY LOUNGE CEILING PLENUM | 2X2 CEILING TILE SPECKLED           |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                       |
|           |                               | NON-GLASS WINDOW PANEL              |        | 45 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                               | MUD JOINT PACKING                   |        | 6 UNITS  | 0              | 7           | 7                           | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                               | TECTUM DECKING                      |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |

| SPACE NO. | LOCATION                  | MATERIAL DESCRIPTION                                    | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                             |
|-----------|---------------------------|---------------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|-------------------------------------|
| 1007A     | FACULTY LOUNGE PHONE ROOM | 12X12 FLOOR TILE & MASTIC TAN                           |        | 12 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM      |
|           |                           | COVE BASE & MASTIC BROWN                                |        | 10 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM      |
|           |                           | GYPNUM BOARD & COMPOUND                                 |        | 70 SF    | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM      |
|           |                           | FIRE DOOR INSULATION WOOD                               |        | 1 DOOR   | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM      |
|           |                           | 1X1 CEILING TILE UNIFORM DOT                            |        | 12 SF    | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM      |
|           |                           | 1X1 CEILING TILE MASTIC CEILING GYPNUM BOARD & COMPOUND |        | 12 SF    | 0              | 6           | 5                           | O&M             | NO ACCESS                           |
| 1008      | BOY'S BATHROOM            | CERAMIC FLOOR TILE GROUT & GLUE BLUE                    |        | 80 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM      |
|           |                           | CERAMIC WALL BASE GROUT & GLUE WHITE                    |        | 30 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                |
|           |                           | CONCRETE BLOCK & MORTAR                                 |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)  |
|           |                           | MIRROR MASTIC                                           |        | 3 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM      |
|           |                           | FIRE DOOR INSULATION WOOD                               |        | 2 DOORS  | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM      |
| 1009      | MAINTENANCE ROOM          | CEILING PLASTER                                         |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949                |
|           |                           | 9X9 FLOOR TILE & MASTIC                                 |        | 644 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | UNDER 12X12 FLOOR TILE; ASSUMED ACM |
|           |                           | COVE BASE & MASTIC BROWN                                |        | 99 LF    | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING ASSUMED ACM            |
|           |                           | CONCRETE BLOCK & MORTAR                                 |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)  |
|           |                           | WINDOW GLAZING/ CAULKING                                |        | 72 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM      |
|           |                           | FIRE DOOR INSULATION METAL                              |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM      |
|           |                           | FIRE DOOR INSULATION WOOD                               |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM      |
|           |                           | TECTUM DECKING                                          |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)  |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                        | MATERIAL DESCRIPTION                                  | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|---------------------------------|-------------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1009A     | MAINTENANCE ROOM<br>BATHROOM    | CERAMIC FLOOR TILE<br>GROUT & GLUE GRAY<br>WITH WHITE |        | 25 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                 | CERAMIC WALL BASE<br>GROUT & GLUE WHITE               |        | 17 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                 | CONCRETE BLOCK &<br>MORTAR                            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                 | MIRROR MASTIC                                         |        | 2 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                 | FIRE DOOR INSULATION<br>WOOD                          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                 | CEILING PLASTER                                       |        | 0        |                |             |                             |                 | NON ACM JCB#18-<br>39949              |
| 1009B     | MAINTENANCE ROOM<br>STORAGE     | CONCRETE BLOCK &<br>MORTAR                            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                 | FIRE DOOR INSULATION<br>METAL                         |        | 1 DOOR   | 0              | 6           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
| 1010      | BOILER ROOM                     | MUD JOINT PACKING/ PIPE<br>INSULATION                 |        | 0        |                |             |                             |                 | ABATED PEDNEAULT<br>ASSOC., 1989      |
|           |                                 | BOILER INSULATION/<br>BRECHING                        |        | 0        |                |             |                             |                 | ABATED PEDNEAULT<br>ASSOC., 1989      |
|           |                                 | CONCRETE BLOCK &<br>MORTAR                            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                 | WINDOW GLAZING/<br>CAULKING                           |        | 80 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                 | FIRE DOOR INSULATION<br>METAL                         |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                 | INTERNAL BOILER<br>COMPONENTS                         |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                                 | DUCT INSULATION                                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #23004) |
| 1010A     | BOILER ROOM<br>TRANSFORMER ROOM | HOT WATER TANK<br>INSULATION                          |        | 0        |                |             |                             |                 | ABATED PEDNEAULT<br>ASSOC., 1989      |
|           |                                 | FIRE DOOR INSULATION<br>METAL                         |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                                   | MATERIAL DESCRIPTION                 | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|--------------------------------------------|--------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1011      | BOY'S PHYSICAL ED VESTIBULE                | 9X9 FLOOR TILE & MASTIC TAN          |        | 0        |                |             |                             |                 | NEW 12X12 FLOOR TILE OBSERVED      |
|           |                                            | COVE BASE & MASTIC BROWN             |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED             |
|           |                                            | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                            | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1011CP    | BOY'S PHYSICAL ED VESTIBULE CEILING PLENUM | 2X2 CEILING TILE SPECKLED            |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                                            | MUD JOINT PACKING                    |        | 1 UNIT   | 0              | 7           | 7                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                            | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                            | 9X9 FLOOR TILE & MASTIC              |        | 480 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | UNDER 12X12 FLOOR TILE             |
| 1011A     | ORCHESTRA ROOM                             | COVE BASE & MASTIC BLACK             |        | 78 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                            | GYPNUM BOARD (AROUND SKYLIGHT)       |        | 80 SF    | 7 SF           | 3           | 4                           | REPAIR          | CRACKED & CHIPPED; ASSUMED ACM     |
|           |                                            | SKYLIGHT CAULKING                    |        | 32 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                            | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1011A1    | MUSIC CUSTODIAL CLOSET                     | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                            | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                            | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                            | CEILING GYPNUM BOARD & COMPOUND      |        | 12 SF    | <1 SF          | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM               |
| 1011A2    | MUSIC STORAGE ROOM                         | CERAMIC FLOOR TILE GROUT & GLUE BLUE |        | 176 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                            | CERAMIC WALL TILE GROUT & GLUE       |        | 477 SF   | 4 LF           | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM               |
|           |                                            | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                            | CEILING PLASTER SMOOTH               |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949               |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                    | MATERIAL DESCRIPTION                            | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|-----------------------------|-------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1011B     | COACH OFFICE                | 9X9 FLOOR TILE & MASTIC TAN                     |        | 0        |                |             |                             |                 | NEW 12X12 FLOOR TILE OBSERVED      |
|           |                             | COVE BASE & MASTIC BROWN                        |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED             |
|           |                             | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                             | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | 2X2 CEILING TILE SPECKLED                       |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
| 1011BCP   | COACH OFFICE CEILING PLENUM | MUD JOINT PACKING                               |        | 2 UNITS  | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM          |
|           |                             | TECTUM DECKING                                  |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                             | CERAMIC FLOOR TILE GROUT & GLUE GRAY WITH WHITE |        | 35 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | CERAMIC WALL BASE GROUT & GLUE WHITE            |        | 21 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | CERAMIC WALL TILE GROUT & GLUE WHITE            |        | 94 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1011B1    | COACH OFFICE BATHROOM       | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                             | MIRROR MASTIC                                   |        | 2 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                             | CEILING PLASTER                                 |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949               |

Summary of Asbestos Containing Materials

| SPACE No. | LOCATION                    | MATERIAL DESCRIPTION          | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                               |
|-----------|-----------------------------|-------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|-------------------------------------------------------|
| 1012      | GYMNASIUM                   | WOOD FLOOR TAR/VAPOR BARRIER  |        | 3672 SF  | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                        |
|           |                             | COVE BASE & MASTIC BROWN      |        | 195 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                        |
|           |                             | CONCRETE BLOCK & MORTAR       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)                 |
|           |                             | WALL/ CHALK- BOARD MASTIC     |        | 50 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                        |
|           |                             | WINDOW GLAZING/ CAULKING      |        | 0        |                |             |                             |                 | ABATED EIC, 2002                                      |
|           |                             | NON-GLASS WINDOW PANEL        |        | 128 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                        |
|           |                             | FIRE DOOR INSULATION WOOD     |        | 6 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM                        |
|           |                             | FIRE DOOR INSULATION METAL    |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM                        |
|           |                             | TECTUM DECKING                |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)                 |
|           |                             | 9X9 FLOOR TILE GREY           |        | 0        |                |             |                             |                 | REMOVED ECI #16723                                    |
| 1012A     | GYM CLOSET 1                | 9X9 FLOOR TILE MASTIC         |        | 0        |                |             |                             |                 | REMOVED ECI #16723                                    |
|           |                             | COVE BASE & MASTIC BLACK      |        | 0        |                |             |                             |                 | NEW COVE BASE<br>OBSERVED                             |
|           |                             | CONCRETE BLOCK & MORTAR       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)                 |
|           |                             | FIRE DOOR INSULATION WOOD     |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM                        |
|           |                             | 2X4 CEILING TILE PINHOLE      |        | 112 SF   | 6 TILES        | 3           | 4                           | REPAIR          | MISSING & WATER<br>DAMAGED; CONF ACM<br>JCB #14-28692 |
| 1012ACP   | GYM CLOSET 1 CEILING PLENUM | VIBRATION REDUCER CLOTH WHITE |        | 1 UNIT   |                | 6           | 5                           | O&M             | NO ACCESS                                             |

| SPACE NO. | LOCATION               | MATERIAL DESCRIPTION            | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                        |
|-----------|------------------------|---------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------------------|
| 1012B     | GYM CLOSET 2           | 9X9 FLOOR TILE GREY             |        | 0        |                |             |                             |                 | REMOVED ECI #16723                             |
|           |                        | 9X9 FLOOR TILE MASTIC           |        | 0        |                |             |                             |                 | REMOVED ECI #16723                             |
|           |                        | COVE BASE & MASTIC BLACK        |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED                         |
|           |                        | CONCRETE BLOCK & MORTAR         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
|           |                        | FIRE DOOR INSULATION WOOD       |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | ASSUMED ACM; GOOD CONDITION                    |
|           |                        | CEILING GYPSUM BOARD & COMPOUND |        | 121 SF   | 2 SF           | 3           | 4                           | REPAIR          | CHIPPED & HOLE; ASSUMED ACM                    |
|           |                        | 9X9 FLOOR TILE GREY             |        | 0        |                |             |                             |                 | REMOVED ECI #16723                             |
|           |                        | 9X9 FLOOR TILE MASTIC           |        | 0        |                |             |                             |                 | REMOVED ECI #16723                             |
|           |                        | COVE BASE & MASTIC BLACK        |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED                         |
|           |                        | CONCRETE BLOCK & MORTAR         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
| 1012C     | GYM CLOSET 3           | FIRE DOOR INSULATION WOOD       |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | ASSUMED ACM; GOOD CONDITION                    |
|           |                        | 2X4 CEILING TILE PINHOLE        |        | 80 SF    | 6 TILES        | 3           | 4                           | REPAIR          | MISSING & WATER DAMAGED; CONF ACM JCB#14-28692 |
|           |                        | VIBRATION REDUCER CLOTH WHITE   |        | 1 UNIT   | 0              | 6           | 5                           | O&M             | NO ACCESS; ASSUMED ACM                         |
|           |                        | 9X9 FLOOR TILE & MASTIC         |        | 60 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | ASSUMED ACM; UNDER 12X12 FLOOR TILE            |
|           |                        | CONCRETE BLOCK & MORTAR         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
| 1013      | READING ROOM VESTIBULE | GYPSUM BOARD & COMPOUND         |        | 140 SF   | < 1 SF         | 3           | 4                           | REPAIR          | HOLES; ASSUMED ACM                             |
|           |                        | FIRE DOOR INSULATION WOOD       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                        | 2X2 CEILING TILE SPECKLED       |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                       |
|           |                        |                                 |        |          |                |             |                             |                 |                                                |
|           |                        |                                 |        |          |                |             |                             |                 |                                                |

| SPACE NO. | LOCATION                                    | MATERIAL DESCRIPTION                  | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|---------------------------------------------|---------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1013CP    | READING ROOM<br>VESTIBULE CEILING<br>PLENUM | TECTUM DECKING                        |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
| 1013A     | READING ROOM 1                              | 9X9 GREEN FLOOR TILE &<br>MASTIC      |        | 264 SF   | 6 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED;<br>ASSUMED ACM     |
|           |                                             | COVE BASE & MASTIC<br>BLACK           |        | 4 LF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                             | CONCRETE BLOCK &<br>MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                             | GYPSON BOARD &<br>COMPOUND            |        | 208 SF   | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                             | WALL/ CHALK- BOARD<br>MASTIC          |        | 60 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                             | WINDOW GLAZING/<br>CAULKING           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                                             | FIRE DOOR INSULATION<br>WOOD          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                             | METAL SINK<br>UNDERCOATING BLACK      |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                             | 2X2 CEILING TILE<br>SPECKLED          |        | 0        |                |             |                             |                 | NON ACM JCB#14-<br>28692 TEM          |
|           |                                             | WALL PANEL TECTUM                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECL JOB #23546) |
| 1013ACP   | READING ROOM 1<br>CEILING PLENUM            | NON-GLASS WINDOW<br>PANEL             |        | 36 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
| 1013A1    | READING ROOM 1<br>CLOSET                    | TECTUM DECKING                        |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                             | 9X9 FLOOR TILE & MASTIC<br>GREY/BLACK |        | 30 SF    | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                  |
|           |                                             | COVE BASE & MASTIC<br>BLACK           |        | 17 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                             | CONCRETE BLOCK &<br>MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                             | FIRE DOOR INSULATION<br>WOOD          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                             | TECTUM DECKING                        |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                                              | MATERIAL DESCRIPTION          | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|-------------------------------------------------------|-------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1013B     | READING ROOM 2                                        | 9X9 FLOOR TILE & MASTIC GREEN |        | 220 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                                                       | GYPNUM BOARD & COMPOUND       |        | 446 SF   | < 1 SF         | 3           | 4                           | REPAIR          | CHIPPED; ASSUMED ACM               |
|           |                                                       | WINDOW GLAZING/<br>CAULKING   |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                                                       | FIRE DOOR INSULATION WOOD     |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | ASSUMED ACM; GOOD CONDITION        |
|           |                                                       | 2X2 CEILING TILE SPECKLED     |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
| 1013BCP   | READING ROOM 2<br>CEILING PLENUM                      | NON-GLASS WINDOW PANEL        |        | 36 SF    | 0              | 6           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                                                       | TECTUM DECKING                |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
| 1014      | ROOM 200/ TESTING<br>ROOM VESTIBULE                   | 9X9 FLOOR TILE GREY           |        | 54 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | 12X12 OBSERVED                     |
|           |                                                       | COVE BASE & MASTIC BLACK      |        | 23 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | NOT OBSERVED;<br>ASSUMED ACM       |
|           |                                                       | CONCRETE BLOCK & MORTAR       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                                       | GYPNUM BOARD & COMPOUND       |        | 51 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                                                       | FIRE DOOR INSULATION WOOD     |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
| 1014CP    | ROOM 200/ TESTING<br>ROOM VESTIBULE<br>CEILING PLENUM | 2X2 CEILING TILE SPECKLED     |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                                                       | WALL PANEL TECTUM             |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECL JOB #23546) |
|           |                                                       | TECTUM DECKING                |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |

| SPACE NO. | LOCATION                 | MATERIAL DESCRIPTION      | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                             |
|-----------|--------------------------|---------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|-------------------------------------|
| 1014A     | ROOM 200B                | 9X9 FLOOR TILE GREY       |        | 180 SF   | 6 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING W/ MASTIC EXPOSED |
|           |                          | COVE BASE & MASTIC BLACK  |        | 24 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM         |
|           |                          | CONCRETE BLOCK & MORTAR   |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)  |
|           |                          | GYP SUM BOARD & COMPOUND  |        | 180 SF   | <1 SF          | 3           | 4                           | REPAIR          | CHIPPED; ASSUMED ACM                |
|           |                          | WALL/ CHALK- BOARD MASTIC |        | 42 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM         |
|           |                          | WOOD PANEL MASTIC         |        | 29 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM         |
|           |                          | WINDOW GLAZING/ CAULKING  |        | 0        |                |             |                             |                 | ABATED EIC, 2002                    |
|           |                          | FIRE DOOR INSULATION WOOD |        | 1 DOOR   | 0              | 7           | 7                           | O&M             | GOOD CONDITION; ASSUMED ACM         |
|           |                          | 2X2 CEILING TILE SPECKLED |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM            |
|           |                          | TECTUM DECKING            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)  |
| 1014ACP   | ROOM 200B CEILING PLENUM | TECTUM DECKING            |        | 0        |                |             |                             |                 | CRACKED & CHIPPED; ASSUMED ACM      |
| 1014B     | ROOM 200 C               | 9X9 FLOOR TILE GREY       |        | 112 SF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED; ASSUMED ACM      |
|           |                          | CONCRETE BLOCK & MORTAR   |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)  |
|           |                          | WALL PANEL TECTUM         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECL JOB #23546)  |
|           |                          | WALL PANEL DEEP FISSURE   |        | 9 SF     | 1 TILE         | 4           | 4                           | REPAIR          | CHIPPED; ASSUMED ACM                |
|           |                          | GYP SUM BOARD & COMPOUND  |        | 172 SF   | 0              | 6           | 5                           | O&M             | MINOR DAMAGE; ASSUMED ACM           |
|           |                          | WINDOW GLAZING/ CAULKING  |        | 0        |                |             |                             |                 | ABATED EIC, 2002                    |
|           |                          | FIRE DOOR INSULATION WOOD |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM         |
|           |                          | 2X2 CEILING TILE SPECKLED |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM            |

| SPACE NO. | LOCATION                  | MATERIAL DESCRIPTION                            | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                                                              |
|-----------|---------------------------|-------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|--------------------------------------------------------------------------------------|
| 1014BCP   | ROOM 200 C CEILING PLENUM | NON-GLASS WINDOW PANEL                          |        | 24 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | TECTUM DECKING                                  |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)                                                |
| 1015      | FACULTY WOMEN'S BATHROOM  | CERAMIC FLOOR TILE GROUT & GLUE PINK            |        | 77 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | CERAMIC WALL BASE GROUT & GLUE PINK             |        | 33 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)                                                |
|           |                           | MIRROR MASTIC                                   |        | 2 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | CEILING PLASTER                                 |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949                                                                 |
| 1016      | FACULTY MEN'S BATHROOM    | CERAMIC FLOOR TILE GROUT & GLUE GRAY WITH WHITE |        | 77 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | CERAMIC FLOOR TILE GROUT & GLUE WHITE           |        | 33 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)                                                |
|           |                           | MIRROR MASTIC                                   |        | 2 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | CEILING PLASTER                                 |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949                                                                 |
| 1017      | GIRL'S BATHROOM           | CERAMIC FLOOR TILE GROUT & GLUE PINK            |        | 222 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | CERAMIC WALL BASE GROUT & GLUE PINK             |        | 45 LF    | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING,<br>GLUE EXPOSED, ASSUMED<br>CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                           | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | MIRROR MASTIC                                   |        | 12 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | WINDOW GLAZING/CAULKING                         |        | 38 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM                                                       |
|           |                           | CEILING PLASTER                                 |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949                                                                 |

| SPACE NO. | LOCATION         | MATERIAL DESCRIPTION                 | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|------------------|--------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1018      | CUSTODIAL CLOSET | COVE BASE & MASTIC BLACK             |        | 15 LF    | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | NOT OBSERVED; ASSUMED ACM          |
|           |                  | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                  | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                  | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
| 1019      | ROOM 200H        | 9X9 FLOOR TILE & MASTIC GREY/BLACK   |        | 63 SF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM               |
|           |                  | COVE BASE & MASTIC BLACK             |        | 27 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                  | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                  | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1020      | BOY'S BATHROOM   | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                  | CERAMIC FLOOR TILE GROUT & GLUE BLUE |        | 222 SF   | <1 SF          | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM               |
|           |                  | COVE BASE & MASTIC BLACK             |        | 13 LF    | 6 LF           | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING; ASSUMED ACM          |
|           |                  | CERAMIC WALL BASE GROUT & GLUE WHITE |        | 32 LF    | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM               |
|           |                  | CERAMIC WALL TILE GROUT & GLUE WHITE |        | 24 SF    | 2 LF           | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM               |
|           |                  | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                  | MIRROR MASTIC                        |        | 4 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                  | WINDOW GLAZING/ CAULKING             |        | 38 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                  | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                  | CEILING PLASTER SMOOTH               |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949               |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                                             | MATERIAL DESCRIPTION                 | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|------------------------------------------------------|--------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1021      | ROOM 200E/ ASSISTANT PRINCIPAL OFFICE                | 9X9 FLOOR TILE & MASTIC TAN          |        | 90 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | ASSUMED UNDER CARPET; ASSUMED ACM  |
|           |                                                      | CARPET MASTIC                        |        | 90 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                      | COVE BASE & MASTIC BROWN             |        | 32 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                      | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                                      | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                      | 2X2 CEILING TILE SPECKLED            |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
| 1021CP    | ROOM 200E/ ASSISTANT PRINCIPAL OFFICE CEILING PLENUM | MUD JOINT PACKING                    |        | 2 UNITS  |                | 7           | 7                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           | ROOM 200E/ ASSISTANT PRINCIPAL OFFICE BATHROOM       | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                                      | CERAMIC FLOOR TILE GROUT & GLUE PINK |        | 48 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                      | CERAMIC WALL BASE GROUT & GLUE PINK  |        | 25 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                      | CERAMIC WALL TILE GROUT & GLUE PINK  |        | 140 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                      | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                                      | MIRROR MASTIC                        |        | 3 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                      | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                      | CEILING PLASTER                      |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949               |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION                 | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|-------------------------|--------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1022      | ROOM 201                | 9X9 FLOOR TILE & MASTIC TAN          |        | 810 SF   | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED, ASSUMED ACM                  |
|           |                         | COVE BASE & MASTIC BLACK             |        | 111 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                         | WALL PANEL SPLASH                    |        | 72 SF    | 3 SF           | 3           | 4                           | REPAIR          | CHIPPED; ASSUMED ACM                  |
|           |                         | 1X1 WALL TILE & MASTIC FISSURE       |        | 110 SF   | 1 SF           | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                  |
|           |                         | WALL/ CHALK- BOARD MASTIC            |        | 152 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | WINDOW GLAZING/ CAULKING             |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                         | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | METAL SINK UNDERCOATING BLACK        |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | 2X2 CEILING TILE SPECKLED            |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM              |
| 1022CP    | ROOM 201 CEILING PLENUM | NON-GLASS WINDOW PANEL               |        | 52 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
| 1023      | ROOM 20                 | 12X12 FLOOR TILE & MASTIC GREEN      |        | 590 SF   | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED, ASSUMED ACM                  |
|           |                         | COVE BASE & MASTIC BLACK             |        | 104 LF   | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED;<br>ASSUMED ACM        |
|           |                         | CERAMIC WALL BASE GROUT & GLUE BEIGE |        | 104 LF   | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                  |
|           |                         | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                         | WINDOW GLAZING/ CAULKING             |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                         | WINDOW GLAZING/ CAULKING             |        | 72 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | FIRE DOOR INSULATION WOOD            |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | 2X2 CEILING TILE SPECKLED            |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM              |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                               | MATERIAL DESCRIPTION                 | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|----------------------------------------|--------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1023CP    | Room 211 CEILING PLENUM                | MUD JOINT PACKING                    |        | 6 UNITS  | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                        | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
| 1023A     | Room 211 EXIT VESTIBULE                | CERAMIC FLOOR TILE GROUT & GLUE PINK |        | 24 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                        | CERAMIC WALL BASE GROUT & GLUE PINK  |        | 12 LF    | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM                  |
|           |                                        | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                        | WINDOW GLAZING/ CAULKING             |        | 18 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                        | FIRE DOOR INSULATION METAL           |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                        | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                        | 2x2 CEILING TILE SPECKLED            |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM              |
| 1023ACP   | Room 211 EXIT VESTIBULE CEILING PLENUM | MUD JOINT PACKING                    |        | 1 UNIT   | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                        | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
| 1023A1    | Room 211 CLOSET/BATHROOM               | CERAMIC FLOOR TILE GROUT & GLUE PINK |        | 72 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                        | CERAMIC WALL BASE GROUT & GLUE PINK  |        | 26 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                        | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                        | MIRROR MASTIC                        |        | 4 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                        | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                        | CEILING PLASTER                      |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949                  |
|           |                                        |                                      |        |          |                |             |                             |                 |                                       |

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION                 | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|-------------------------|--------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1024      | PTA COPY ROOM/STORAGE   | CARPET MASTIC                        |        | 36 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | CERAMIC FLOOR TILE GROUT & GLUE PINK |        | 36 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | COVE BASE & MASTIC BROWN             |        | 18 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | CERAMIC FLOOR TILE GROUT & GLUE PINK |        | 168 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | GYPSON BOARD & COMPOUND              |        | 144 SF   | <1 SF          | 3           | 4                           | REPAIR          | CHIPPED; ASSUMED ACM               |
|           |                         | FIRE DOOR INSULATION WOOD            |        | 3 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | CEILING PLASTER TEXTURED             |        | 0        |                |             |                             |                 | NON ACM JCB #18-39949              |
| 1025      | ROOM 202                | 9X9 FLOOR TILE & MASTIC TAN          |        | 810 SF   | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM               |
|           |                         | COVE BASE & MASTIC BLACK             |        | 95 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                         | WALL PANEL DEEP FISSURE              |        | 72 SF    | 1 SF           | 4           | 4                           | REPAIR          | CHIPPED; ASSUMED ACM               |
|           |                         | WALL/ CHALK- BOARD MASTIC            |        | 152 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | WINDOW GLAZING/ CAULKING             |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                         | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1025CP    | ROOM 202 CEILING PLENUM | 2X2 CEILING TILE                     |        | 0        |                |             |                             |                 | NON ACM JCB #14-28692 TEM          |
|           |                         | NON-GLASS WINDOW PANEL               |        | 100 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | MUD JOINT PACKING                    |        | 2 UNITS  | 0              | 7           | 7                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION          | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                     |
|-----------|-------------------------|-------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------------|
| 1026      | Room 203                | 9X9 FLOOR TILE & MASTIC GREY  |        | 810 SF   | 9 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING W/ MASTIC EXPOSED         |
|           |                         | COVE BASE & MASTIC BLACK      |        | 111 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | CONCRETE BLOCK & MORTAR       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)          |
|           |                         | WALL/ CHALK- BOARD MASTIC     |        | 108 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | WINDOW GLAZING/ CAULKING      |        | 0        |                |             |                             |                 | ABATED EIC, 2002                            |
|           |                         | FIRE DOOR INSULATION WOOD     |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | METAL SINK UNDERCOATING GREY  |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | REFRACTORY/KILN/FIRE BRICK    |        | 1 UNIT   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | 2X2 CEILING TILE SPECKLED     |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                    |
|           |                         | MUD JOINT PACKING             |        | 8 UNITS  | 0              | 7           | 7                           | O&M             | FIBERGLASS INSULATION OBSERVED              |
| 1026CP    | Room 203 CEILING PLENUM | TECTUM DECKING                |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)          |
| 1027      | Room 204                | 9X9 FLOOR TILE & MASTIC BROWN |        | 810 SF   | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED W/ MASTIC EXPOSED                   |
|           |                         | COVE BASE & MASTIC BLACK      |        | 89 LF    | 3 LF           | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING W/ MASTIC EXPOSED, ASSUMED ACM |
|           |                         | CONCRETE BLOCK & MORTAR       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)          |
|           |                         | WALL/ CHALK- BOARD MASTIC     |        | 152 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | WOOD PANEL MASTIC             |        | 14 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | WINDOW GLAZING/ CAULKING      |        | 0        |                |             |                             |                 | ABATED EIC, 2002                            |
|           |                         | FIRE DOOR INSULATION WOOD     |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | METAL SINK UNDERCOATING GREY  |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | 2X2 CEILING TILE SPECKLED     |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                    |
|           |                         |                               |        |          |                |             |                             |                 |                                             |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                   | MATERIAL DESCRIPTION                  | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|----------------------------|---------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1027CP    | ROOM 204 CEILING<br>PLENUM | TECTUM DECKING                        |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
| 1028      | STORAGE/ SERVER ROOM       | 9X9 FLOOR TILE & MASTIC<br>GREY/BLACK |        | 140 SF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | MISSING W/ MASTIC<br>EXPOSED          |
|           |                            | COVE BASE & MASTIC<br>BLACK           |        | 51 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | CONCRETE BLOCK &<br>MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                            | FIRE DOOR INSULATION<br>WOOD          |        | 1 DOOR   | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | TECTUM DECKING                        |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
| 1029      | ROOM 205                   | 9X9 FLOOR TILE & MASTIC<br>TAN        |        | 810 SF   | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | MINOR DAMAGE; ASSUMED<br>ACM          |
|           |                            | COVE BASE & MASTIC<br>BLACK           |        | 111 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | CONCRETE BLOCK &<br>MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                            | WALL/ CHALK- BOARD<br>MASTIC          |        | 152 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | WINDOW GLAZING/<br>CAULKING           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                            | FIRE DOOR INSULATION<br>WOOD          |        | 3 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | METAL SINK<br>UNDERCOATING GREY       |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
| 1029CP    | ROOM 205 CEILING<br>PLENUM | 2X2 CEILING TILE<br>SPECKLED          |        | 0        |                |             |                             |                 | NON ACM JCB#14-<br>28692 TEM          |
|           |                            | MUD JOINT PACKING                     |        | 1 UNIT   | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | TECTUM DECKING                        |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION               | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|-------------------------|------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1030      | Room 206                | 9X9 FLOOR TILE & MASTIC GREY/BLACK |        | 810 SF   | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED AND CHIPPED                |
|           |                         | COVE BASE & MASTIC BLACK           |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED             |
|           |                         | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                         | WALL/ CHALK- BOARD MASTIC          |        | 200 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | WINDOW GLAZING/ CAULKING           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                         | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1030CP    | Room 206 CEILING PLENUM | 2x2 CEILING TILE SPECKLED          |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                         | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                         | 9X9 FLOOR TILE & MASTIC BROWN      |        | 810 SF   | 3 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED W/ MASTIC EXPOSED          |
|           |                         | COVE BASE & MASTIC BLACK           |        | 105 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                         | WALL/ CHALK- BOARD MASTIC          |        | 152 SF   | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | EXPOSED, ASSUMED ACM               |
| 1031      | Room 207                | WINDOW GLAZING/ CAULKING           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                         | FIRE DOOR INSULATION WOOD          |        | 3 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | METAL SINK UNDERCOATING BLACK      |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | 2x2 CEILING TILE SPECKLED          |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                         | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                         | ROOF TAR                           |        | N/A      | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1031CP    | Room 207 CEILING PLENUM |                                    |        |          |                |             |                             |                 |                                    |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION               | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|-------------------------|------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1032      | ROOM 208                | 9X9 FLOOR TILE & MASTIC GREY       |        | 810 SF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | MISSING & DEBRIS W/ MASTIC EXPOSED |
|           |                         | COVE BASE & MASTIC BLACK           |        | 111 LF   | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED; ASSUMED ACM        |
|           |                         | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (EC1 JOB #22126) |
|           |                         | WALL/ CHALK- BOARD MASTIC          |        | 206 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | WINDOW GLAZING/ CAULKING           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                         | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | METAL SINK UNDERCOATING BLACK      |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | 2X2 CEILING TILE SPECKLED          |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                         | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (EC1 JOB #22126) |
|           |                         | 9X9 FLOOR TILE & MASTIC GREY/BLACK |        | 810 SF   | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED, ASSUMED ACM               |
| 1033      | ROOM 210                | COVE BASE & MASTIC BLACK           |        | 111 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (EC1 JOB #22126) |
|           |                         | WALL/ CHALK- BOARD MASTIC          |        | 170 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | WINDOW GLAZING/ CAULKING           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                         | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | METAL SINK UNDERCOATING WHITE      |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | 2X2 CEILING TILE SPECKLED          |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                         | MUD JOINT PACKING                  |        | 1 UNIT   |                | 7           | 7                           | O&M             | NO ACCESS; ASSUMED ACM             |
|           |                         | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (EC1 JOB #22126) |
|           |                         |                                    |        |          |                |             |                             |                 |                                    |
| 1033CP    | ROOM 210 CEILING PLENUM |                                    |        |          |                |             |                             |                 |                                    |

| SPACE NO. | LOCATION                                      | MATERIAL DESCRIPTION              | HA/USA | QUANTITY  | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                |
|-----------|-----------------------------------------------|-----------------------------------|--------|-----------|----------------|-------------|-----------------------------|-----------------|----------------------------------------|
| 1034      | ROOM 209                                      | 9X9 FLOOR TILE & MASTIC TAN       |        | 810 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
|           |                                               | COVE BASE & MASTIC BLACK          |        | 111 LF    | 1 LF           | 4           | N/A NON FRIABLE             | REPAIR          | MISSING W/ MASTIC EXPOSED; ASSUMED ACM |
|           |                                               | CONCRETE BLOCK & MORTAR           |        | 0         |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)     |
|           |                                               | WALL/ CHALK- BOARD MASTIC         |        | 170 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
|           |                                               | WINDOW GLAZING/ CAULKING          |        | 0         |                |             |                             |                 | ABATED EIC, 2002                       |
|           |                                               | FIRE DOOR INSULATION WOOD         |        | 1 DOOR    | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
|           |                                               | METAL SINK UNDERCOATING WHITE     |        | 1 UNIT    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
| 1034CP    | ROOM 209 CEILING PLENUM                       | 2X2 CEILING TILE SPECKLED         |        | 0         |                |             |                             |                 | NON ACM JCB#14-28692 TEM               |
|           |                                               | MUD JOINT PACKING                 |        | 1 UNIT    | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
|           |                                               | TECTUM DECKING                    |        | 0         |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)     |
|           |                                               | TERRAZZO FLOORING GREY WITH WHITE |        | 0         |                |             |                             |                 | CONFIRMED NON-ACM (ECL JOB #23546)     |
|           |                                               | CONCRETE BLOCK & MORTAR           |        | 0         |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)     |
|           |                                               | WALL/ CHALK- BOARD MASTIC         |        | 100 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
|           |                                               | WINDOW GLAZING/ CAULKING          |        | 32 LF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
| 1035      | 200 WING CORRIDOR GYM ROOM 210                | FIRE DOOR INSULATION METAL        |        | 2 DOORS   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
|           |                                               | 2X2 CEILING TILE SPECKLED         |        | 0         |                |             |                             |                 | NON ACM JCB#14-28692 TEM               |
|           |                                               | 2X4 CEILING TILE HUNG             |        | 0         |                |             |                             |                 | ABATED EIC, 2002                       |
|           |                                               | MUD JOINT PACKING                 |        | 101 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM              |
| 1035CP    | 200 WING CORRIDOR GYM ROOM 210 CEILING PLENUM | TECTUM DECKING                    |        | 0         |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)     |

| SPACE NO. | LOCATION                                                     | MATERIAL DESCRIPTION                 | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|--------------------------------------------------------------|--------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1036      | ROOM 211 / CONFERENCE ROOM/ PROFESSIONAL ROOM                | 9X9 FLOOR TILE & MASTIC BROWN        |        | 468 SF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED AND CHIPPED                |
|           |                                                              | COVE BASE & MASTIC BROWN             |        | 85 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                                                              | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                                              | WALL/ CHALK- BOARD MASTIC            |        | 135 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                                                              | WINDOW GLAZING/ CAULKING             |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                                                              | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                                                              | 2X2 CEILING TILE SPECKLED            |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                                                              | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
| 1036CP    | ROOM 211 / CONFERENCE ROOM/ PROFESSIONAL ROOM CEILING PLENUM |                                      |        | 0        |                |             |                             |                 |                                    |
| 1037      | MEN'S FACULTY BATHROOM                                       | CERAMIC FLOOR TILE GROUT & GLUE BLUE |        | 48 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                                                              | CERAMIC WALL TILE GROUT & GLUE WHITE |        | 160 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                                                              | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                                              | MIRROR MASTIC                        |        | 5 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                                                              | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
| 1038      | BOY'S BATHROOM                                               | CEILING PLASTER SMOOTH               |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707               |
|           |                                                              | CERAMIC FLOOR TILE GROUT & GLUE BLUE |        | 160 SF   | <1 SF          | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM               |
|           |                                                              | CERAMIC WALL TILE GROUT & GLUE WHITE |        | 488 SF   | 20 LF          | 4           | N/A NON FRIABLE             | REPAIR          | MISSING & CRACKED;<br>ASSUMED ACM  |
|           |                                                              | WINDOW GLAZING/ CAULKING             |        | 15 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                                                              | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                                                              | CEILING PLASTER SMOOTH               |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707               |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                                 | MATERIAL DESCRIPTION                          | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                              |
|-----------|------------------------------------------|-----------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|--------------------------------------|
| 1039      | ROOM 300/ MECHANICAL ROOM                | 12X12 FLOOR TILE & MASTIC BEIGE/ MULTI COLORS |        | 180 SF   | 3 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | LOOSE & DEBRIS W/ MASTIC EXPOSED     |
|           |                                          | COVE BASE & MASTIC BROWN                      |        | 56 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                          | CONCRETE BLOCK & MORTAR                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)   |
|           |                                          | WINDOW GLAZING/ CAULKING                      |        | 25 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                          | FIRE DOOR INSULATION WOOD                     |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                          | 2X2 CEILING TILE SPECKLED                     |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM             |
| 1039CP    | ROOM 300/ MECHANICAL ROOM CEILING PLENUM | MUD JOINT PACKING                             |        | 48 UNITS | 2 UNITS        | 4           | 1                           | REPAIR          | DAMAGED; ASSUMED ACM                 |
| 1040      | GIRL'S BATHROOM                          | CERAMIC FLOOR TILE GROUT & GLUE PINK          |        | 160 SF   | <1 SF          | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM                 |
|           |                                          | CERAMIC WALL TILE GROUT & GLUE WHITE          |        | 488 SF   | 3 LF           | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING GROUT; ASSUMED ACM |
|           |                                          | MIRROR MASTIC                                 |        | 25 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                          | SKYLIGHT CAULKING                             |        | 12 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                          | FIRE DOOR INSULATION WOOD                     |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                          | CEILING PLASTER SMOOTH                        |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                 |
| 1041      | FACULTY WOMEN'S BATHROOM                 | CERAMIC FLOOR TILE GROUT & GLUE PINK          |        | 48 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                          | CERAMIC WALL TILE GROUT & GLUE WHITE          |        | 160 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                          | CONCRETE BLOCK & MORTAR                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)   |
|           |                                          | MIRROR MASTIC                                 |        | 5 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                          | FIRE DOOR INSULATION WOOD                     |        | 1 DOOR   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                          | CEILING PLASTER SMOOTH                        |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                 |

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION            | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|-------------------------|---------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1042      | ROOM 310                | 12X12 FLOOR TILE & MASTIC GREEN |        | 630 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | COVE BASE & MASTIC BROWN        |        | 122 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | CONCRETE BLOCK & MORTAR         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                         | WALL/ CHALK- BOARD MASTIC       |        | 100 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | WINDOW GLAZING/ CAULKING        |        | 42 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | FIRE DOOR INSULATION WOOD       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | METAL SINK UNDERCOATING BLACK   |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | 2X4 CEILING TILE HUNG           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                         | 2X2 CEILING TILE SPECKLED       |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM              |
|           |                         | CEILING PLASTER SMOOTH          |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                  |
| 1042CP    | ROOM 310 CEILING PLENUM | MUD JOINT PACKING               |        | 18 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | DAMAGED WITH DEBRIS;<br>ASSUMED ACM   |
| 1043      | ROOM 309                | 12X12 FLOOR TILE & MASTIC WHITE |        | 630 SF   | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED;<br>ASSUMED ACM     |
|           |                         | COVE BASE & MASTIC BROWN        |        | 0        |                |             |                             |                 | NEW COVE BASE<br>OBSERVED             |
|           |                         | CONCRETE BLOCK & MORTAR         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                         | WALL/CHALK-BOARD MASTIC         |        | 100 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | WINDOW/ GLAZING/CAULKING        |        | 63 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | FIRE DOOR INSULATION WOOD       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | METAL SINK UNDERCOATING BLACK   |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | 2X2 CEILING TILE HUNG           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                         | 2X2 CEILING TILE SPECKLED       |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM              |
|           |                         | CEILING PLASTER SMOOTH          |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                  |

| SPACE No. | LOCATION                   | MATERIAL DESCRIPTION                    | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|----------------------------|-----------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1043CP    | ROOM 309 CEILING<br>PLENUM | MUD JOINT PACKING                       |        | 25 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | DAMAGED WITH DEBRIS;<br>ASSUMED ACM   |
|           |                            | 12X12 FLOOR TILE &<br>MASTIC WHITE      |        | 1009 SF  | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED & MISSING;<br>ASSUMED ACM     |
|           |                            | COVE BASE & MASTIC<br>BROWN             |        | 0        |                |             |                             |                 | NEW COVE BASE<br>OBSERVED             |
|           |                            | CONCRETE BLOCK &<br>MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                            | WALL/CHALK-BOARD<br>MASTIC              |        | 200 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | WINDOW<br>GLAZING/CAULKING              |        | 42 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | FIRE DOOR INSULATION<br>WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | METAL SINK<br>UNDERCOATING BLACK        |        | 1 UNIT   | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | 2X2 CEILING TILE<br>SPECKLED            |        | 0        |                |             |                             |                 | NON ACM JCB#14-<br>28692 TEM          |
|           |                            | 2X2 CEILING TILE HUNG                   |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                            | CEILING PLASTER SMOOTH                  |        | 0        |                |             |                             |                 | NON ACM JCB#14-<br>28707              |
|           |                            | MUD JOINT PACKING                       |        | 9 UNITS  | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED<br>ACM          |
| 1044CP    | ROOM 308 CEILING<br>PLENUM | ROOF TAR                                |        | N/A      |                | 7           | N/A NON FRIABLE             | O&M             | NO ACCESS; ASSUMED<br>ACM             |
|           |                            | CERAMIC FLOOR TILE<br>GROUT & GLUE BLUE |        | 40 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | CERAMIC WALL BASE<br>GROUT & GLUE BEIGE |        | 23 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | CONCRETE BLOCK &<br>MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
| 1045      | CUSTODIAL CLOSET           | FIRE DOOR INSULATION<br>WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                            | 2X2 CEILING TILE                        |        | 0        |                |             |                             |                 | NON ACM JCB#14-<br>28692 TEM          |
|           |                            | GYPSUM BOARD &<br>COMPOUND              |        | 45 SF    | 3 SF           | 3           | 4                           | REPAIR          | CRACKED & HOLE;<br>ASSUMED ACM        |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                           | MATERIAL DESCRIPTION               | HA/USA | QUANTITY | AMOUNT DAMAGED    | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                  |
|-----------|------------------------------------|------------------------------------|--------|----------|-------------------|-------------|-----------------------------|-----------------|------------------------------------------|
| 1045CP    | CUSTODIAL CLOSET<br>CEILING PLENUM | MUD JOINT PACKING                  |        | 1 UNIT   | 0                 | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM           |
| 1046      | ROOM 307                           | 12X12 FLOOR TILE &<br>MASTIC WHITE |        | 630 SF   | 5 TILES           | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED AND CHIPPED W/<br>MASTIC EXPOSED |
|           |                                    | COVE BASE & MASTIC<br>BROWN        |        | 0        |                   |             |                             |                 | NEW COVE BASE<br>OBSERVED                |
|           |                                    | CONCRETE BLOCK &<br>MORTAR         |        | 0        |                   |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)    |
|           |                                    | WALL/CHALK-BOARD<br>MASTIC         |        | 100 SF   | 0                 | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM           |
|           |                                    | WINDOW<br>GLAZING/CAULKING         |        | 63 LF    | 0                 | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM           |
|           |                                    | FIRE DOOR INSULATION<br>WOOD       |        | 1 DOOR   | 0                 | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM           |
|           |                                    | METAL SINK<br>UNDERCOATING BLACK   |        | 1 UNIT   | 0                 | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM           |
|           |                                    | 2X2 CEILING TILE HUNG              |        | 0        |                   |             |                             |                 | ABATED EIC, 2002                         |
|           |                                    | 2X2 CEILING TILE<br>SPECKLED       |        | 0        |                   |             |                             |                 | NON ACM JCB#14-<br>28692 TEM             |
|           |                                    | CEILING PLASTER SMOOTH             |        | 0        |                   |             |                             |                 | NON ACM JCB#14-<br>28707                 |
| 1046CP    | ROOM 307 CEILING<br>PLENUM         | MUD JOINT PACKING                  |        | 26 UNITS | NOT<br>QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED<br>ACM             |

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION                         | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                |
|-----------|-------------------------|----------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|----------------------------------------|
| 1047      | ROOM 306                | 12X12 FLOOR TILE & MASTIC BEIGE MULTI COLORS |        | 630 SF   | 6 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED, ASSUMED ACM         |
|           |                         | COVE BASE & MASTIC BROWN                     |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED                 |
|           |                         | CONCRETE BLOCK & MORTAR                      |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)     |
|           |                         | WALL/CHALK-BOARD MASTIC                      |        | 100 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | WINDOW GLAZING/CAULKING                      |        | 42 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | FIRE DOOR INSULATION WOOD                    |        | 1 DOOR   | 0              | 6           |                             | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | METAL SINK UNDERCOATING BLACK                |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | 2X2 CEILING TILE HUNG                        |        | 0        |                |             |                             |                 | ABATED EIC, 2002                       |
|           |                         | 2X2 CEILING TILE                             |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM               |
|           |                         | CEILING PLASTER SMOOTH                       |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                   |
| 1047CP    | ROOM 306 CEILING PLENUM | MUD JOINT PACKING                            |        | 13 UNITS |                | 7           | 7                           | O&M             | GOOD CONDITION; ASSUMED ACM            |
| 1048      | ROOM 305                | 12X12 FLOOR TILE & MASTIC BEIGE MULTI COLORS |        | 630 SF   | 3 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED W/ MASTIC EXPOSED; ASSUMED ACM |
|           |                         | COVE BASE & MASTIC BROWN                     |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED                 |
|           |                         | CONCRETE BLOCK & MORTAR                      |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)     |
|           |                         | WALL/CHALK-BOARD MASTIC                      |        | 100 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | WINDOW GLAZING/CAULKING                      |        | 42 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | FIRE DOOR INSULATION WOOD                    |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | METAL SINK UNDERCOATING BLACK                |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | 2X2 CEILING TILE HUNG                        |        | 0        |                |             |                             |                 | ABATED EIC, 2002                       |
|           |                         | 2X2 CEILING TILE                             |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM               |
|           |                         | CEILING PLASTER SMOOTH                       |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                   |

| SPACE No. | LOCATION                   | MATERIAL DESCRIPTION                  | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|----------------------------|---------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1048CP    | ROOM 305 CEILING<br>PLENUM | MUD JOINT PACKING                     |        | 10 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM          |
| 1049      | ROOM 304                   | 12X12 FLOOR TILE & MASTIC WHITE       |        | 630 SF   | 3 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM               |
|           |                            | COVE BASE & MASTIC BROWN              |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED             |
|           |                            | CONCRETE BLOCK & MORTAR               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                            | WALL/CHALK-BOARD MASTIC               |        | 100 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                            | WINDOW GLAZING/CAULKING               |        | 63 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                            | FIRE DOOR INSULATION WOOD             |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                            | METAL SINK UNDERCOATING BLACK         |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                            | 2X2 CEILING TILE HUNG                 |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                            | 2X2 CEILING TILE                      |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                            | CEILING PLASTER SMOOTH                |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707               |
| 1049CP    | ROOM 304 CEILING<br>PLENUM | MUD JOINT PACKING                     |        | 31 UNITS | 0              | 7           | 7                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1050      | ADMINISTRATION ROOM        | 12X12 FLOOR TILE & MASTIC BEIGE/BROWN |        | 170 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                            | COVE BASE & MASTIC BROWN              |        | 58 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                            | CONCRETE BLOCK & MORTAR               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                            | GYPSUM BOARD & COMPOUND               |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707               |
|           |                            | WALL/CHALK-BOARD MASTIC               |        | 126 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                            | FIRE DOOR INSULATION WOOD             |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                            | 2X2 CEILING TILE                      |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                            | CEILING PLASTER SMOOTH                |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707               |

| SPACE NO. | LOCATION                                            | MATERIAL DESCRIPTION                     | HA/USA | QUANTITY | AMOUNT DAMAGED    | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                |
|-----------|-----------------------------------------------------|------------------------------------------|--------|----------|-------------------|-------------|-----------------------------|-----------------|----------------------------------------|
| 1050CP    | ADMINISTRATION ROOM<br>CEILING PLENUM               | ROOF TAR                                 |        | N/A      | 0                 | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
| 1051      | COMMON AREA ROOM<br>304- 307                        | 12X12 FLOOR TILE &<br>MASTIC BEIGE/BROWN |        | 1086 SF  | 3 TILES           | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED,<br>ASSUMED ACM      |
|           |                                                     | COVE BASE & MASTIC<br>BROWN              |        | 0        |                   |             |                             |                 | NEW COVE BASE<br>OBSERVED              |
|           |                                                     | CONCRETE BLOCK &<br>MORTAR               |        | 0        |                   |             |                             |                 | CONFIRMED NON-ACM<br>(EC1 JOB #22126)  |
|           |                                                     | GYP SUM BOARD &<br>COMPOUND              |        | 55 SF    | 0                 | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
|           |                                                     | WINDOW<br>GLAZING/CAULKING               |        | 30 LF    | 0                 | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
|           |                                                     | FIRE DOOR INSULATION<br>METAL            |        | 2 DOORS  | 0                 | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
|           |                                                     | 2X2 CEILING TILE<br>SPECKLED             |        | 0        |                   |             |                             |                 | NON ACM JCB#14-<br>28692 TEM           |
| 1051CP    | COMMON AREA ROOM<br>304- 307 CEILING<br>PLENUM      | 2X4 CEILING TILE HUNG                    |        | 0        |                   |             |                             |                 | ABATED EIC, 2002                       |
|           |                                                     | CEILING PLASTER SMOOTH                   |        | 0        |                   |             |                             |                 | NON ACM JCB#14-<br>28707               |
|           |                                                     | MUD JOINT PACKING                        |        | 65 UNITS | NOT<br>QUANTIFIED | 4           | 1                           | REPAIR          | DEBRIS; 8 UNITS ABATED<br>JCB#14-28707 |
|           |                                                     | 12X12 FLOOR TILE &<br>MASTIC BLACK       |        | 168 SF   | 2 TILES           | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                   |
| 1052      | STORAGE ROOM<br>OPPOSITE ROOM 303                   | COVE BASE & MASTIC<br>BLACK              |        | 28 LF    | 0                 | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
|           |                                                     | CONCRETE BLOCK &<br>MORTAR               |        | 0        |                   |             |                             |                 | CONFIRMED NON-ACM<br>(EC1 JOB #22126)  |
|           |                                                     | FIRE DOOR INSULATION<br>WOOD             |        | 1 DOOR   | 0                 | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM         |
|           |                                                     | METAL SINK<br>UNDERCOATING BLACK         |        | 0        |                   |             |                             |                 | SINK REMOVED                           |
| 1052CP    | STORAGE ROOM<br>OPPOSITE ROOM 303<br>CEILING PLENUM | CEILING PLASTER SMOOTH                   |        | 0        |                   |             |                             |                 | NON ACM JCB#14-<br>28707               |
|           |                                                     | NONE OBSERVED                            |        | 0        |                   |             |                             |                 |                                        |

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION                  | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                |
|-----------|-------------------------|---------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|----------------------------------------|
| 1053      | ROOM 303                | 12X12 FLOOR TILE & MASTIC GREEN       |        | 1009 SF  | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED W/ MASTIC EXPOSED; ASSUMED ACM |
|           |                         | COVE BASE & MASTIC BLACK              |        | 38 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | CONCRETE BLOCK & MORTAR               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)     |
|           |                         | WALL/CHALK-BOARD MASTIC               |        | 100 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | WINDOW GLAZING/CAULKING               |        | 42 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | FIRE DOOR INSULATION WOOD             |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | METAL SINK UNDERCOATING BLACK         |        | 1 UNIT   | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | MINOR DAMAGE; ASSUMED ACM              |
|           |                         | 2X2 CEILING TILE SPECKLED             |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM               |
|           |                         | CEILING PLASTER SMOOTH                |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                   |
|           |                         | MUD JOINT PACKING                     |        | 29 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM              |
| 1053CP    | ROOM 303 CEILING PLENUM | 12X12 FLOOR TILE & MASTIC BEIGE/BROWN |        | 170 SF   | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                   |
| 1054      | FILE ROOM               | COVE BASE & MASTIC BROWN              |        | 38 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | CONCRETE BLOCK & MORTAR               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)     |
|           |                         | GYPNUM BOARD & COMPOUND               |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                   |
|           |                         | WALL/CHALK-BOARD MASTIC               |        | 16 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | FIRE DOOR INSULATION WOOD             |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM            |
|           |                         | 2X2 CEILING TILE SPECKLED             |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM               |
|           |                         | CEILING PLASTER SMOOTH                |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                   |
|           |                         |                                       |        |          |                |             |                             |                 |                                        |

| SPACE NO. | LOCATION                            | MATERIAL DESCRIPTION                  | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                          |
|-----------|-------------------------------------|---------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|--------------------------------------------------|
| 1054CP    | FILE ROOM CEILING<br>PLENUM         | MUD JOINT PACKING                     |        | 7 UNITS  |                | 7           | 7                           | O&M             | NO ACCESS; ASSUMED ACM                           |
| 1055      | LIBRARY                             | 12X12 FLOOR TILE & MASTIC BEIGE/BROWN |        | 1260 SF  | 0              | 7           | N/A NON FRIABLE             | O&M             | UNDER CARPET; ASSUMED ACM                        |
|           |                                     | CARPET MASTIC                         |        | 1260 SF  | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                      |
|           |                                     | COVE BASE & MASTIC BLUE               |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED                           |
|           |                                     | CONCRETE BLOCK & MORTAR               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)               |
|           |                                     | WALL/CHALK-BOARD MASTIC               |        | 200 SF   | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED; ASSUMED ACM                      |
|           |                                     | WINDOW GLAZING/CAULKING               |        | 105 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; CONF ACM EIC 2002                |
|           |                                     | FIRE DOOR INSULATION WOOD             |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                      |
|           |                                     | 2X2 CEILING TILE SPECKLED             |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                         |
|           |                                     | CEILING PLASTER SMOOTH                |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                             |
|           |                                     |                                       |        |          |                |             |                             |                 |                                                  |
| 1055CP    | LIBRARY CEILING<br>PLENUM           | MUD JOINT PACKING                     |        | 45 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM                        |
| 1056      | COMMON AREA LIBRARY, ROOMS 309, 310 | 12X12 FLOOR TILE & MASTIC BEIGE/BROWN |        | 1086 SF  | 3 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED W/ MASTIC EXPOSED; ASSUMED ACM |
|           |                                     | COVE BASE & MASTIC BROWN              |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED                           |
|           |                                     | CONCRETE BLOCK & MORTAR               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)               |
|           |                                     | GYPSUM BOARD & COMPOUND               |        | 55 SF    | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                      |
|           |                                     | 2X2 CEILING TILE                      |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                         |
|           |                                     | 2X4 CEILING TILE HUNG                 |        | 0        |                |             |                             |                 | ABATED EIC, 2002                                 |
|           |                                     | CEILING PLASTER SMOOTH                |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                             |

| SPACE No. | LOCATION                                              | MATERIAL DESCRIPTION                  | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                |
|-----------|-------------------------------------------------------|---------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|----------------------------------------|
| 1056CP    | COMMON AREA LIBRARY, ROOMS 309, 310<br>CEILING PLENUM | MUD JOINT PACKING                     |        | 25 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM              |
| 1057      | CORRIDOR LIBRARY-<br>ROOM 304                         | 12X12 FLOOR TILE & MASTIC BEIGE/BROWN |        | 252 SF   | 8 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED, ASSUMED ACM         |
|           |                                                       | COVE BASE & MASTIC BROWN              |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED                 |
|           |                                                       | CONCRETE BLOCK & MORTAR               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)     |
|           |                                                       | GYPNUM BOARD & COMPOUND               |        | 360 SF   | <1 SF          | 3           | 4                           | REPAIR          | DENTED; ASSUMED ACM                    |
|           |                                                       | WALL/CHALK-BOARD MASTIC               |        | 150 SF   | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED; ASSUMED ACM            |
| 1057CP    | CORRIDOR LIBRARY-<br>ROOM 304 CEILING PLENUM          | CEILING PLASTER SMOOTH                |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                   |
|           |                                                       | MUD JOINT PACKING                     |        | N/A      |                | 7           | 7                           | O&M             | NO ACCESS; ASSUMED ACM                 |
|           |                                                       | 12X12 FLOOR TILE & MASTIC BEIGE/BROWN |        | 256 SF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                   |
|           |                                                       | COVE BASE & MASTIC BROWN              |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED                 |
|           |                                                       | CONCRETE BLOCK & MORTAR               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)     |
| 1058      | CORRIDOR ROOM 307-<br>309                             | GYPNUM BOARD & COMPOUND               |        | 360 SF   | <1 SF          | 3           | 4                           | REPAIR          | DENTED; ASSUMED ACM                    |
|           |                                                       | WALL/CHALK-BOARD MASTIC               |        | 150 SF   | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED; ASSUMED ACM            |
|           |                                                       | CEILING PLASTER SMOOTH                |        | 0        |                |             |                             |                 | NON ACM JCB#14-28707                   |
|           |                                                       | MUD JOINT PACKING                     |        | N/A      | 0              | 7           | 7                           | O&M             | NO ACCESS; 3 UNITS ABATED JCB#14-28707 |
| 1058CP    | CORRIDOR ROOM 307-<br>309 CEILING PLENUM              | MUD JOINT PACKING                     |        | N/A      | 0              | 7           | 7                           | O&M             | NO ACCESS; 3 UNITS ABATED JCB#14-28707 |

| SPACE NO. | LOCATION                                                      | MATERIAL DESCRIPTION                  | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|---------------------------------------------------------------|---------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1059      | CORRIDOR 300 WING-<br>BATHROOMS                               | 12X12 FLOOR TILE & MASTIC BEIGE/BROWN |        | 224 SF   | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM               |
|           |                                                               | COVE BASE & MASTIC BROWN              |        | 0        |                |             |                             |                 | NEW COVE BASE OBSERVED             |
|           |                                                               | CONCRETE BLOCK & MORTAR               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                                               | GYPNUM BOARD & COMPOUND               |        | 80 SF    | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                               | MIRROR MASTIC                         |        | 72 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                               | FIRE DOOR INSULATION WOOD             |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                               | 2X2 CEILING TILE                      |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                                                               | MUD JOINT PACKING                     |        | 15 UNITS | 0              | 7           | 7                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1059CP    | CORRIDOR 300 WING<br>BATHROOMS CEILING PLENUM                 | 12X12 FLOOR TILE & MASTIC GREY PEBBLE |        | 80 SF    | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM               |
| 1060      | CORRIDOR 300 WING-<br>200 WING "BREEZE WAY"                   | TERRAZZO FLOORING GREY WITH WHITE     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #23546) |
|           |                                                               | CONCRETE BLOCK & MORTAR               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                                               | WINDOW GLAZING/CAULKING               |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                                                               | CAULKING AT BRICKS GREY               |        | 54 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                               | FIRE DOOR INSULATION WOOD             |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                               | FIRE DOOR INSULATION METAL            |        | 4 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                                               | 2X2 CEILING TILE SPECKLED             |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                                                               | 2X4 CEILING TILE HUNG                 |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
| 1060CP    | CORRIDOR 300 WING-<br>200 WING "BREEZE WAY"<br>CEILING PLENUM | TECTUM DECKING                        |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |

| SPACE NO. | LOCATION                                        | MATERIAL DESCRIPTION                 | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|-------------------------------------------------|--------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1061      | CORRIDOR MAIN<br>ENTRANCE-GYM                   | TERRAZZO FLOORING<br>GREY WITH WHITE |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECL JOB #23546) |
|           |                                                 | COVE BASE & MASTIC<br>BLACK          |        | 15 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                 | CONCRETE BLOCK &<br>MORTAR           |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                                 | WALL/CHALK-BOARD<br>MASTIC           |        | 300 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                 | WINDOW<br>GLAZING/CAULKING           |        | 32 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                 | FIRE DOOR INSULATION<br>METAL        |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                 | FIRE DOOR INSULATION<br>WOOD         |        | 2 DOORS  |                | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                 | 2X2 CEILING TILE<br>SPECKLED         |        | 0        |                |             |                             |                 | NON ACM JCB#14-<br>28692 TEM          |
|           |                                                 | 2X4 CEILING TILE HUNG                |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                                                 | MUD JOINT PACKING                    |        | 37 UNITS | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
| 1061CP    | CORRIDOR MAIN<br>ENTRANCE-GYM CEILING<br>PLENUM | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
| 1062      | BOOK STORAGE                                    | 9X9 FLOOR TILE & MASTIC<br>GREEN     |        | 480 SF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                  |
|           |                                                 | COVE BASE & MASTIC<br>BLACK          |        | 46 LF    | 15 LF          | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED;<br>ASSUMED ACM        |
|           |                                                 | CONCRETE BLOCK &<br>MORTAR           |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                                 | GYPNUM BOARD &<br>COMPOUND           |        | 270 SF   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                 | WINDOW<br>GLAZING/CAULKING           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                                                 | FIRE DOOR INSULATION<br>WOOD         |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                 | 2X2 CEILING TILE<br>SPECKLED         |        | 0        |                |             |                             |                 | NON ACM JCB#14-<br>28692 TEM          |
| 1062CP    | BOOK STORAGE CEILING<br>PLENUM                  | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |

| SPACE NO. | LOCATION                                             | MATERIAL DESCRIPTION                 | HA/USA | QUANTITY | AMOUNT DAMAGED    | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|------------------------------------------------------|--------------------------------------|--------|----------|-------------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1063      | CORRIDOR<br>MAINTENANCE - ROOM<br>108                | TERRAZZO FLOORING<br>GREY WITH WHITE |        | 0        |                   |             |                             |                 | CONFIRMED NON-ACM<br>(ECL JOB #23546) |
|           |                                                      | COVE BASE & MASTIC<br>BLACK          |        | 32 LF    | 0                 | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                      | CONCRETE BLOCK &<br>MORTAR           |        | 0        |                   |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                                      | GYP SUM BOARD &<br>COMPOUND          |        | 50 SF    | 0                 | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                      | WALL/CHALK-BOARD<br>MASTIC           |        | 300 SF   | 0                 | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                      | WINDOW<br>GLAZING/CAULKING           |        | 0        |                   |             |                             |                 | ABATED EIC, 2002                      |
|           |                                                      | FIRE DOOR INSULATION<br>METAL        |        | 4 DOORS  | 0                 | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                      | FIRE DOOR INSULATION<br>WOOD         |        | 6 DOORS  | 0                 | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                      | 2X2 CEILING TILE<br>SPECKLED         |        | 0        |                   |             |                             |                 | NON ACM JCB#14-<br>28692 TEM          |
|           |                                                      | 2X4 CEILING TILE HUNG                |        | 0        |                   |             |                             |                 | ABATED EIC, 2002                      |
| 1063CP    | CORRIDOR<br>MAINTENANCE - ROOM<br>108 CEILING PLENUM | MUD JOINT PACKING                    |        | 38 UNITS | NOT<br>QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED<br>ACM          |
|           |                                                      | TECTUM DECKING                       |        | 0        |                   |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
| 1064      | RESOURCE ROOM                                        | 9X9 FLOOR TILE & MASTIC<br>BROWN     |        | 308 SF   | 5 TILES           | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                  |
|           |                                                      | COVE BASE & MASTIC<br>BROWN          |        | 72 LF    | 0                 | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                      | CONCRETE BLOCK &<br>MORTAR           |        | 0        |                   |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                                      | WALL/CHALK-BOARD<br>MASTIC           |        | 100 SF   | 0                 | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                      | WINDOW<br>GLAZING/CAULKING           |        | 0        |                   |             |                             |                 | ABATED EIC, 2002                      |
|           |                                                      | FIRE DOOR INSULATION<br>WOOD         |        | 1 DOOR   | 0                 | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                                      | 2X2 CEILING TILE<br>SPECKLED         |        | 0        |                   |             |                             |                 | NON ACM JCB#14-<br>28692 TEM          |

| SPACE NO. | LOCATION                        | MATERIAL DESCRIPTION               | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                     |
|-----------|---------------------------------|------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------------|
| 1064CP    | RESOURCE ROOM<br>CEILING PLENUM | GYPSUM BOARD                       |        | 44 SF    | NOT QUANTIFIED | 3           | 4                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM                   |
|           |                                 | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)          |
| 1065      | LAPTOP STORAGE<br>CLOSET        | 9X9 FLOOR TILE & MASTIC GREY/BLACK |        | 150 SF   | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED; ASSUMED ACM                        |
|           |                                 | COVE BASE & MASTIC BLACK           |        | 50 LF    | 2 LF           | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING W/ MASTIC EXPOSED, ASSUMED ACM |
|           |                                 | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)          |
|           |                                 | FIRE DOOR INSULATION WOOD          |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                                 | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)          |
| 1066      | ROOM 107                        | 9X9 FLOOR TILE & MASTIC BROWN      |        | 810 SF   | 58 TILES       | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING W/ MASTIC EXPOSED         |
|           |                                 | COVE BASE & MASTIC BLACK           |        | 111 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                                 | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)          |
|           |                                 | WALL/CHALK-BOARD MASTIC            |        | 150 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                                 | WINDOW GLAZING/CAULKING            |        | 0        |                |             |                             |                 | ABATED EIC, 2002                            |
|           |                                 | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                                 | METAL SINK UNDERCOATING WHITE      |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                                 | 2X2 CEILING TILE SPECKLED          |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                    |
| 1066CP    | ROOM 107 CEILING PLENUM         | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)          |

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION                            | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                        |
|-----------|-------------------------|-------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------------------|
| 1067      | ROOM 106                | 9X9 FLOOR TILE & MASTIC                         |        | 786 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | UNDER 12X12 FLOOR TILE                         |
|           |                         | COVE BASE & MASTIC BLACK                        |        | 111 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                         | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
|           |                         | WALL/CHALK-BOARD MASTIC                         |        | 150 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                         | WINDOW GLAZING/CAULKING                         |        | 0        |                |             |                             |                 | ABATED EIC, 2002                               |
| 1067CP    | ROOM 106 CEILING PLENUM | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                         | 2X2 CEILING TILE SPECKLED                       |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                       |
|           |                         | TECTUM DECKING                                  |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
| 1067A     | ROOM 106 BATHROOM       | CERAMIC FLOOR TILE GROUT & GLUE GREY WITH WHITE |        | 24 SF    | < 1 SF         | 4           | N/A NON FRIABLE             | REPAIR          | HOLE W/ MISSING TILE; ASSUMED ACM              |
|           |                         | CERAMIC WALL BASE GROUT & GLUE WHITE            |        | 20 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                         | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
|           |                         | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                         | CEILING PLASTER SMOOTH                          |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949                           |
| 1068      | ROOM 105 VESTIBULE      | 9X9 FLOOR TILE & MASTIC TAN                     |        | 72 SF    | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING, MASTIC EXPOSED; ASSUMED ACM |
|           |                         | COVE BASE & MASTIC BLACK                        |        | 36 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | PATCHED; ASSUMED ACM                           |
|           |                         | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)             |
|           |                         | GYP SUM BOARD & COMPOUND                        |        | 162 SF   | < 1 SF         | 3           | 4                           | REPAIR          | DENTED; ASSUMED ACM                            |
|           |                         | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                    |
|           |                         | 2X2 CEILING TILE SPECKLED                       |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                       |

| SPACE NO. | LOCATION                             | MATERIAL DESCRIPTION             | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|--------------------------------------|----------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1068CP    | ROOM 105 VESTIBULE<br>CEILING PLENUM | TECTUM DECKING                   |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
| 1068A     | ROOM 105                             | 9X9 FLOOR TILE & MASTIC<br>TAN   |        | 252 SF   | 4 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                  |
|           |                                      | COVE BASE & MASTIC<br>BLACK      |        | 32 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                      | CONCRETE BLOCK &<br>MORTAR       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                      | GYP SUM BOARD &<br>COMPOUND      |        | 234 SF   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                      | WALL/CHALK-BOARD<br>MASTIC       |        | 90 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                      | FIRE DOOR INSULATION<br>WOOD     |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                      | METAL SINK<br>UNDERCOATING BLACK |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                      | 2X2 CEILING TILE<br>SPECKLED     |        | 0        |                |             |                             |                 | NON ACM JCB #14-<br>28692 TEM         |
|           |                                      | TECTUM DECKING                   |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                      | 9X9 FLOOR TILE & MASTIC<br>TAN   |        | 224 SF   | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                  |
| 1068ACP   | ROOM 105B                            | COVE BASE & MASTIC<br>BLACK      |        | 30 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                      | CONCRETE BLOCK &<br>MORTAR       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                      | GYP SUM BOARD &<br>COMPOUND      |        | 228 SF   | < 1 SF         | 3           | 4                           | REPAIR          | DENTED; ASSUMED ACM                   |
|           |                                      | WALL/CHALK-BOARD<br>MASTIC       |        | 50 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                      | WINDOW<br>GLAZING/CAULKING       |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                                      | FIRE DOOR INSULATION<br>WOOD     |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                      | 2X2 CEILING TILE<br>SPECKLED     |        | 224 SF   |                |             |                             | O&M             |                                       |
|           |                                      | TECTUM DECKING                   |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                      |                                  |        |          |                |             |                             |                 |                                       |
|           |                                      |                                  |        |          |                |             |                             |                 |                                       |
| 1068A1 CP | ROOM 105B CEILING<br>PLENUM          |                                  |        |          |                |             |                             |                 |                                       |

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION          | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|-------------------------|-------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1068B     | ROOM 105A               | 9X9 FLOOR TILE & MASTIC TAN   |        | 468 SF   | 18 TILES       | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED, ASSUMED ACM     |
|           |                         | COVE BASE & MASTIC BLACK      |        | 70 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | CONCRETE BLOCK & MORTAR       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                         | GYPSUM BOARD & COMPOUND       |        | 412 SF   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | WALL/CHALK-BOARD MASTIC       |        | 100 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | WINDOW GLAZING/CAULKING       |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                         | FIRE DOOR INSULATION WOOD     |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | 2X2 CEILING TILE SPECKLED     |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                         | TECTUM DECKING                |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                         | 9X9 FLOOR TILE & MASTIC       |        | 0        |                |             |                             |                 | ABATED 2004 REINSPECTION           |
| 1069      | ROOM 104                | COVE BASE & MASTIC GREEN      |        | 0        |                |             |                             |                 | NEW MATERIAL                       |
|           |                         | CONCRETE BLOCK & MORTAR       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                         | WALL/CHALK-BOARD MASTIC       |        | 120 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | WINDOW GLAZING/CAULKING       |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                         | FIRE DOOR INSULATION WOOD     |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | FIRE DOOR INSULATION METAL    |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | METAL SINK UNDERCOATING WHITE |        | 2 UNITS  | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                         | 2X2 CEILING TILE SPECKLED     |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                         | TECTUM DECKING                |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                         |                               |        |          |                |             |                             |                 |                                    |
| 1069CP    | ROOM 104 CEILING PLENUM |                               |        |          |                |             |                             |                 |                                    |

| SPACE NO. | LOCATION                            | MATERIAL DESCRIPTION                                   | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|-------------------------------------|--------------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1069A     | ROOM 104 CLOSET                     | 9X9 FLOOR TILE & MASTIC                                |        | 0        |                |             |                             |                 | ABATED 2004<br>REINSPECTION           |
|           |                                     | COVE BASE & MASTIC<br>GREEN                            |        | 0        |                |             |                             |                 | NEW MATERIAL                          |
|           |                                     | CONCRETE BLOCK &<br>MORTAR                             |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                     | FIRE DOOR INSULATION<br>WOOD                           |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
| 1069ACP   | ROOM 104 CLOSET<br>CEILING PLENUM   | 2X2 CEILING TILE<br>SPECKLED                           |        | 0        |                |             |                             |                 | NON ACM JCB#14-<br>28692 TEM          |
|           |                                     |                                                        |        |          |                |             |                             |                 | NO ACCESS                             |
|           |                                     |                                                        |        |          |                |             |                             |                 |                                       |
|           |                                     |                                                        |        |          |                |             |                             |                 |                                       |
| 1069B     | ROOM 104 BATHROOM                   | CERAMIC FLOOR TILE<br>GROUT & GLUE WHITE<br>WITH GREEN |        | 36 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | CERAMIC WALL TILE<br>GROUT & GLUE WHITE                |        | 104 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | CONCRETE BLOCK &<br>MORTAR                             |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                     | FIRE DOOR INSULATION<br>WOOD                           |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
| 1069BCP   | ROOM 104 BATHROOM<br>CEILING PLENUM | 2X2 CEILING TILE<br>SPECKLED                           |        | 0        |                |             |                             |                 | NON ACM JCB#14-<br>28692 TEM          |
|           |                                     | TECTUM DECKING                                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                     | 9X9 FLOOR TILE & MASTIC                                |        | 0        |                |             |                             |                 | ABATED 2004<br>REINSPECTION           |
|           |                                     | COVE BASE & MASTIC<br>GREEN                            |        | 0        |                |             |                             |                 | NEW MATERIAL                          |
| 1070      | ROOM 103                            | CONCRETE BLOCK &<br>MORTAR                             |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                                     | WALL/CHALK-BOARD<br>MASTIC                             |        | 120 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | WINDOW<br>GLAZING/CAULKING                             |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                                     | FIRE DOOR INSULATION<br>WOOD                           |        | 1 DOOR   |                |             |                             | O&M             | DOOR REPLACED                         |
|           |                                     | FIRE DOOR INSULATION<br>METAL                          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | METAL SINK<br>UNDERCOATING WHITE                       |        | 2 UNITS  | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                                     | 2X2 CEILING TILE<br>SPECKLED                           |        | 0        |                |             |                             |                 | NON ACM JCB#14-<br>28692 TEM          |

| SPACE No. | LOCATION                         | MATERIAL DESCRIPTION                             | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|----------------------------------|--------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1070CP    | ROOM 103 CEILING PLENUM          | TECTUM DECKING                                   |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
| 1070A     | ROOM 103 CLOSET                  | 9X9 FLOOR TILE & MASTIC                          |        | 0        |                |             |                             |                 | ABATED 2004 REINSPECTION           |
|           |                                  | COVE BASE & MASTIC GREEN                         |        | 0        |                |             |                             |                 | NEW MATERIAL                       |
|           |                                  | CONCRETE BLOCK & MORTAR                          |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                  | FIRE DOOR INSULATION WOOD                        |        | 1 DOOR   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                  | 2X2 CEILING TILE SPECKLED                        |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
| 1070ACP   | ROOM 103 CLOSET CEILING PLENUM   |                                                  |        |          |                |             |                             |                 | NO ACCESS                          |
| 1070B     | ROOM 103 BATHROOM                | CERAMIC FLOOR TILE GROUT & GLUE WHITE WITH GREEN |        | 36 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                  | CERAMIC WALL TILE GROUT & GLUE WHITE             |        | 104 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                  | CONCRETE BLOCK & MORTAR                          |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                  | FIRE DOOR INSULATION WOOD                        |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                  | 2X2 CEILING TILE SPECKLED                        |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
| 1070BCP   | ROOM 103 BATHROOM CEILING PLENUM | TECTUM DECKING                                   |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION                            | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|-------------------------|-------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1071      | ROOM 102                | 9X9 FLOOR TILE & MASTIC                         |        | 900 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | UNDER 12X12 FLOOR TILE             |
|           |                         | COVE BASE & MASTIC BLACK                        |        | 120 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                         | CERAMIC WALL TILE GROUT & GLUE YELLOW           |        | 12 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                         | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                         | WALL/CHALK-BOARD MASTIC                         |        | 150 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                         | WINDOW GLAZING/CAULKING                         |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                         | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                         | FIRE DOOR INSULATION METAL                      |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                         | METAL SINK UNDERCOATING BLACK                   |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                         | 2X2 CEILING TILE SPECKLED                       |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                         | CEILING GYPSUM BOARD & COMPOUND                 |        | 50 SF    | 0              | 6           | 5                           | O&M             | PATCHED; ASSUMED ACM               |
| 1071CP    | ROOM 102 CEILING PLENUM | TECTUM DECKING                                  |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
| 1071A     | ROOM 102 BATHROOM       | CERAMIC FLOOR TILE GROUT & GLUE GREY WITH WHITE |        | 36 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                         | CERAMIC WALL BASE GROUT & GLUE WHITE            |        | 20 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                         | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                         | MIRROR MASTIC                                   |        | 3 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                         | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM     |
|           |                         | CEILING PLASTER                                 |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949               |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION                  | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                               |
|-----------|-------------------------|---------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------|
| 1071 B    | ROOM 102 CLOSET         | 12X12 FLOOR TILE & MASTIC GREEN       |        | 48 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | COVE BASE & MASTIC BLACK              |        | 32 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | CONCRETE BLOCK & MORTAR               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                         | FIRE DOOR INSULATION WOOD             |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | CEILING PLASTER                       |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949                  |
| 1072      | ROOM 101                | 9X9 FLOOR TILE & MASTIC               |        | 900 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | UNDER 12X12 FLOOR TILE                |
|           |                         | COVE BASE & MASTIC BLACK              |        | 120 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | CERAMIC WALL TILE GROUT & GLUE YELLOW |        | 12 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | CONCRETE BLOCK & MORTAR               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                         | WALL/CHALK-BOARD MASTIC               |        | 150 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | WINDOW/ GLAZING/CAULKING              |        | 0        |                |             |                             |                 | ABATED EIC, 2002                      |
|           |                         | FIRE DOOR INSULATION WOOD             |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | FIRE DOOR INSULATION METAL            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | METAL SINK UNDERCOATING WHITE         |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |
|           |                         | 2X2 CEILING TILE SPECKLED             |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM              |
| 1072CP    | ROOM 101 CEILING PLENUM | CEILING GYPSUM BOARD & COMPOUND       |        | 50 SF    | < 1 SF         | 3           | 4                           | REPAIR          | HOLES; ASSUMED ACM                    |
|           |                         | TECTUM DECKING                        |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126) |
|           |                         | ROOF TAR                              |        | N/A      | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM        |

| SPACE NO. | LOCATION                               | MATERIAL DESCRIPTION                            | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|----------------------------------------|-------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1072A     | ROOM 101 BATHROOM                      | CERAMIC FLOOR TILE GROUT & GLUE GREY WITH WHITE |        | 36 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                        | CERAMIC WALL BASE GROUT & GLUE WHITE            |        | 20 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                        | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                        | MIRROR MASTIC                                   |        | 3 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                        | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1072B     | ROOM 101 CLOSET                        | CEILING PLASTER SMOOTH                          |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949               |
|           |                                        | 12X12 FLOOR TILE & MASTIC GREEN                 |        | 36 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                        | COVE BASE & MASTIC BLACK                        |        | 20 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                        | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                        | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1073      | CORRIDOR SECONDARY ENTRANCE - ROOM 101 | CEILING PLASTER SMOOTH                          |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949               |
|           |                                        | TERRAZZO FLOORING GREY WITH WHITE               |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECL JOB #23546) |
|           |                                        | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                        | WALL/CHALK-BOARD MASTIC                         |        | 20 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                        | WINDOW GLAZING/CAULKING                         |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
|           |                                        | FIRE DOOR INSULATION METAL                      |        | 2 DOORS  | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                        | 2X2 CEILING TILE                                |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                                        | 2X4 CEILING TILE HUNG                           |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |

| SPACE NO. | LOCATION                                                 | MATERIAL DESCRIPTION                 | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                   |
|-----------|----------------------------------------------------------|--------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|-------------------------------------------|
| 1073CP    | CORRIDOR SECONDARY ENTRANCE - ROOM 101<br>CEILING PLENUM | MUD JOINT PACKING                    |        | 20 UNITS | 0              | 7           | 7                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                                                          | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)     |
| 1074      | ROOM 108                                                 | 9X9 FLOOR TILE & MASTIC TAN          |        | 810 SF   | 10 TILES       | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED & MISSING W/<br>MASTIC EXPOSED    |
|           |                                                          | COVE BASE & MASTIC BLACK             |        | 111 LF   | 2 LF           | 4           | N/A NON FRIABLE             | REPAIR          | MISSING w/ MASTIC<br>EXPOSED; ASSUMED ACM |
|           |                                                          | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)     |
|           |                                                          | WALL/CHALK-BOARD MASTIC              |        | 150 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                                                          | WINDOW GLAZING/CAULKING              |        | 0        |                |             |                             |                 | ABATED EIC, 2002                          |
|           |                                                          | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                                                          | METAL SINK UNDERCOATING WHITE        |        | 0        |                |             |                             |                 | SINK REMOVED                              |
|           |                                                          | 2X2 CEILING TILE SPECKLED            |        | 0        |                |             |                             |                 | NON ACM JCB#14-<br>28692 TEM              |
|           |                                                          | TECTUM DECKING                       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)     |
|           |                                                          | CERAMIC FLOOR TILE GROUT & GLUE PINK |        | 319 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
| 1075      | GIRL'S BATHROOM 100<br>WING                              | CERAMIC WALL BASE GROUT & GLUE PINK  |        | 72 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                                                          | CONCRETE BLOCK & MORTAR              |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM<br>(ECI JOB #22126)     |
|           |                                                          | MIRROR MASTIC                        |        | 20 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                                                          | WINDOW GLAZING/CAULKING              |        | 0        |                |             |                             |                 | ABATED EIC, 2002                          |
|           |                                                          | FIRE DOOR INSULATION WOOD            |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION;<br>ASSUMED ACM            |
|           |                                                          | CEILING PLASTER                      |        | 0        |                |             |                             |                 | NON ACM JCB#18-<br>39949                  |
|           |                                                          |                                      |        |          |                |             |                             |                 |                                           |

| SPACE NO. | LOCATION                                         | MATERIAL DESCRIPTION                            | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                              |
|-----------|--------------------------------------------------|-------------------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|--------------------------------------|
| 1076      | FACULTY WOMEN'S BATHROOM 100 WING                | CERAMIC FLOOR TILE GROUT & GLUE GREY WITH WHITE |        | 63 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                                  | CERAMIC WALL BASE GROUT & GLUE WHITE            |        | 23 SF    | 1 TILE         | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED; ASSUMED ACM                 |
|           |                                                  | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)   |
|           |                                                  | MIRROR MASTIC                                   |        | 3 SF     | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                                  | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                                  | CEILING PLASTER SMOOTH                          |        | 0        |                |             |                             |                 | NON ACM JCB#14-28619                 |
| 1076CP    | FACULTY WOMEN'S BATHROOM 100 WING CEILING PLENUM | TECTUM DECKING                                  |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)   |
| 1077      | CUSTODIAL CLOSET 100 WING                        | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)   |
|           |                                                  | GYPSUM BOARD & COMPOUND                         |        | 0        |                |             |                             |                 | NON ACM JCB#14-28619                 |
|           |                                                  | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM          |
| 1077CP    | CUSTODIAL CLOSET 100 WING CEILING PLENUM         | TECTUM DECKING                                  |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)   |
| 1078      | BOY'S BATHROOM 100 WING                          | CERAMIC FLOOR TILE GROUT & GLUE BLUE            |        | 319 SF   | 1 SF           | 4           | N/A NON FRIABLE             | REPAIR          | MISSING; ASSUMED ACM                 |
|           |                                                  | CERAMIC WALL BASE GROUT & GLUE WHITE            |        | 72 SF    | 5 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED, ASSUMED ACM       |
|           |                                                  | CERAMIC WALL TILE GROUT & GLUE WHITE            |        | 28 SF    | 6 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & MISSING GROUT; ASSUMED ACM |
|           |                                                  | CONCRETE BLOCK & MORTAR                         |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)   |
|           |                                                  | MIRROR MASTIC                                   |        | 10 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                                  | WINDOW GLAZING/CAULKING                         |        | 0        |                |             |                             |                 | ABATED EIC, 2002                     |
|           |                                                  | FIRE DOOR INSULATION WOOD                       |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM          |
|           |                                                  | CEILING PLASTER SMOOTH                          |        | 0        |                |             |                             |                 | NON ACM JCB#18-39949                 |

Summary of Asbestos Containing Materials

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION               | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                     |
|-----------|-------------------------|------------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|---------------------------------------------|
| 1079      | ROOM 109                | 9X9 FLOOR TILE & MASTIC BROWN      |        | 810 SF   | 2 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CHIPPED W/ MASTIC EXPOSED; ASSUMED ACM      |
|           |                         | COVE BASE & MASTIC BLACK           |        | 111 LF   | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | DELAMINATING W/ MASTIC EXPOSED, ASSUMED ACM |
|           |                         | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)          |
|           |                         | WALL/CHALK-BOARD MASTIC            |        | 150 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | WINDOW GLAZING/CAULKING            |        | 0        |                |             |                             |                 | ABATED EIC, 2002                            |
|           |                         | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | METAL SINK UNDERCOATING BLACK      |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | 2X2 CEILING TILE SPECKLED          |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                    |
|           |                         | NON-GLASS WINDOW PANEL             |        | 75 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)          |
| 1080      | ROOM 110                | 9X9 FLOOR TILE & MASTIC GREY/BLACK |        | 810 SF   | 6 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED & CHIPPED, ASSUMED ACM              |
|           |                         | COVE BASE & MASTIC BLACK           |        | 111 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | CONCRETE BLOCK & MORTAR            |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)          |
|           |                         | WALL/CHALK-BOARD MASTIC            |        | 150 SF   | NOT QUANTIFIED | 4           | N/A NON FRIABLE             | REPAIR          | MASTIC EXPOSED; ASSUMED ACM                 |
|           |                         | WINDOW GLAZING/CAULKING            |        | 0        |                |             |                             |                 | ABATED EIC, 2002                            |
| 1080CP    | ROOM 110                | FIRE DOOR INSULATION WOOD          |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                 |
|           |                         | 2X2 CEILING TILE SPECKLED          |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                    |
|           |                         | NON-GLASS WINDOW PANEL             |        | 75 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                 |
| 1080CP    | ROOM 110 CEILING PLENUM | TECTUM DECKING                     |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)          |

| SPACE NO. | LOCATION                | MATERIAL DESCRIPTION          | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                                    |
|-----------|-------------------------|-------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|--------------------------------------------|
| 1081      | ROOM 111                | 9X9 FLOOR TILE & MASTIC       |        | 810 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | UNDER 12X12 FLOOR TILE                     |
|           |                         | COVE BASE & MASTIC BLACK      |        | 111 LF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                |
|           |                         | CONCRETE BLOCK & MORTAR       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)         |
|           |                         | WALL/CHALK-BOARD MASTIC       |        | 180 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                |
|           |                         | WINDOW GLAZING/CAULKING       |        | 0        |                |             |                             |                 | ABATED EIC, 2002                           |
|           |                         | FIRE DOOR INSULATION WOOD     |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                |
|           |                         | METAL SINK UNDERCOATING WHITE |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                |
|           |                         | 2X2 CEILING TILE SPECKLED     |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                   |
|           |                         | NON-GLASS WINDOW PANEL        |        | 75 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                |
|           |                         | TECTUM DECKING                |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)         |
| 1081CP    | ROOM 111 CEILING PLENUM | 9X9 FLOOR TILE & MASTIC GREY  |        | 810 SF   | 6 TILES        | 4           | N/A NON FRIABLE             | REPAIR          | CRACKED, LOOSE & CHIPPED W/ MASTIC EXPOSED |
| 1082      | ROOM 112                | COVE BASE & MASTIC BLACK      |        | 111 LF   | <1 LF          | 4           | N/A NON FRIABLE             | REPAIR          | MISSING W/ MASTIC EXPOSED; ASSUMED ACM     |
|           |                         | CONCRETE BLOCK & MORTAR       |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126)         |
|           |                         | WALL/CHALK-BOARD MASTIC       |        | 150 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                |
|           |                         | WINDOW GLAZING/CAULKING       |        | 0        |                |             |                             |                 | ABATED EIC, 2002                           |
|           |                         | FIRE DOOR INSULATION WOOD     |        | 1 DOOR   | 0              | 6           | 5                           | O&M             | GOOD CONDITION; ASSUMED ACM                |
|           |                         | METAL SINK UNDERCOATING WHITE |        | 1 UNIT   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM                |
|           |                         | 2X2 CEILING TILE SPECKLED     |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM                   |
|           |                         |                               |        |          |                |             |                             |                 |                                            |
|           |                         |                               |        |          |                |             |                             |                 |                                            |
|           |                         |                               |        |          |                |             |                             |                 |                                            |

| SPACE NO. | LOCATION                              | MATERIAL DESCRIPTION              | HA/USA | QUANTITY | AMOUNT DAMAGED | HAZARD RANK | AHERA REASSESSMENT CATEGORY | RESPONSE ACTION | REMARKS                            |
|-----------|---------------------------------------|-----------------------------------|--------|----------|----------------|-------------|-----------------------------|-----------------|------------------------------------|
| 1082CP    | ROOM 112 CEILING PLENUM               | NON-GLASS WINDOW PANEL            |        | 75 SF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                       | TECTUM DECKING                    |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                       | TERRAZZO FLOORING GREY WITH WHITE |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECL JOB #23546) |
|           |                                       | CONCRETE BLOCK & MORTAR           |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
|           |                                       | WALL/CHALK-BOARD MASTIC           |        | 200 SF   | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
| 1083      | CORRIDOR ROOMS 101-112                | SKYLIGHT CAULKING                 |        | 16 LF    | 0              | 7           | N/A NON FRIABLE             | O&M             | GOOD CONDITION; ASSUMED ACM        |
|           |                                       | 2X2 CEILING TILE SPECKLED         |        | 0        |                |             |                             |                 | NON ACM JCB#14-28692 TEM           |
|           |                                       | 2X4 CEILING TILE HUNG             |        | 0        |                |             |                             |                 | ABATED EIC, 2002                   |
| 1083CP    | CORRIDOR ROOMS 101-112 CEILING PLENUM | MUD JOINT PACKING                 |        | 51 UNITS | NOT QUANTIFIED | 4           | 1                           | REPAIR          | MINOR DAMAGE; ASSUMED ACM          |
|           |                                       | TECTUM DECKING                    |        | 0        |                |             |                             |                 | CONFIRMED NON-ACM (ECI JOB #22126) |
| 3000      | EXTERIOR SHED 1                       | NONE OBSERVED                     |        |          |                |             |                             |                 |                                    |
| 4000      | EXTERIOR SHED 2                       | NONE OBSERVED                     |        |          |                |             |                             |                 |                                    |
| 5000      | EXTERIOR SHED 3                       | NONE OBSERVED                     |        |          |                |             |                             |                 |                                    |

## Appendix C

### DRAWINGS

**KEY PLAN**

---


**NO SCALE**

|         |                                                                             |
|---------|-----------------------------------------------------------------------------|
| PROJECT | SIX MONTH AHERA SURVEILLANCE<br>FOREST PARK ELEMENTARY SCHOOL<br>FLOOR PLAN |
| CLIENT  | HALE HOLLOW HILLS CENTRAL SCHOOL DISTRICT                                   |



PROJECT #: 23546  
COMMENTS:  
None

NOT TO SCALE  
Date: 07/11/2023  
By: Robert Cardona  
DRAWING 1 of 1

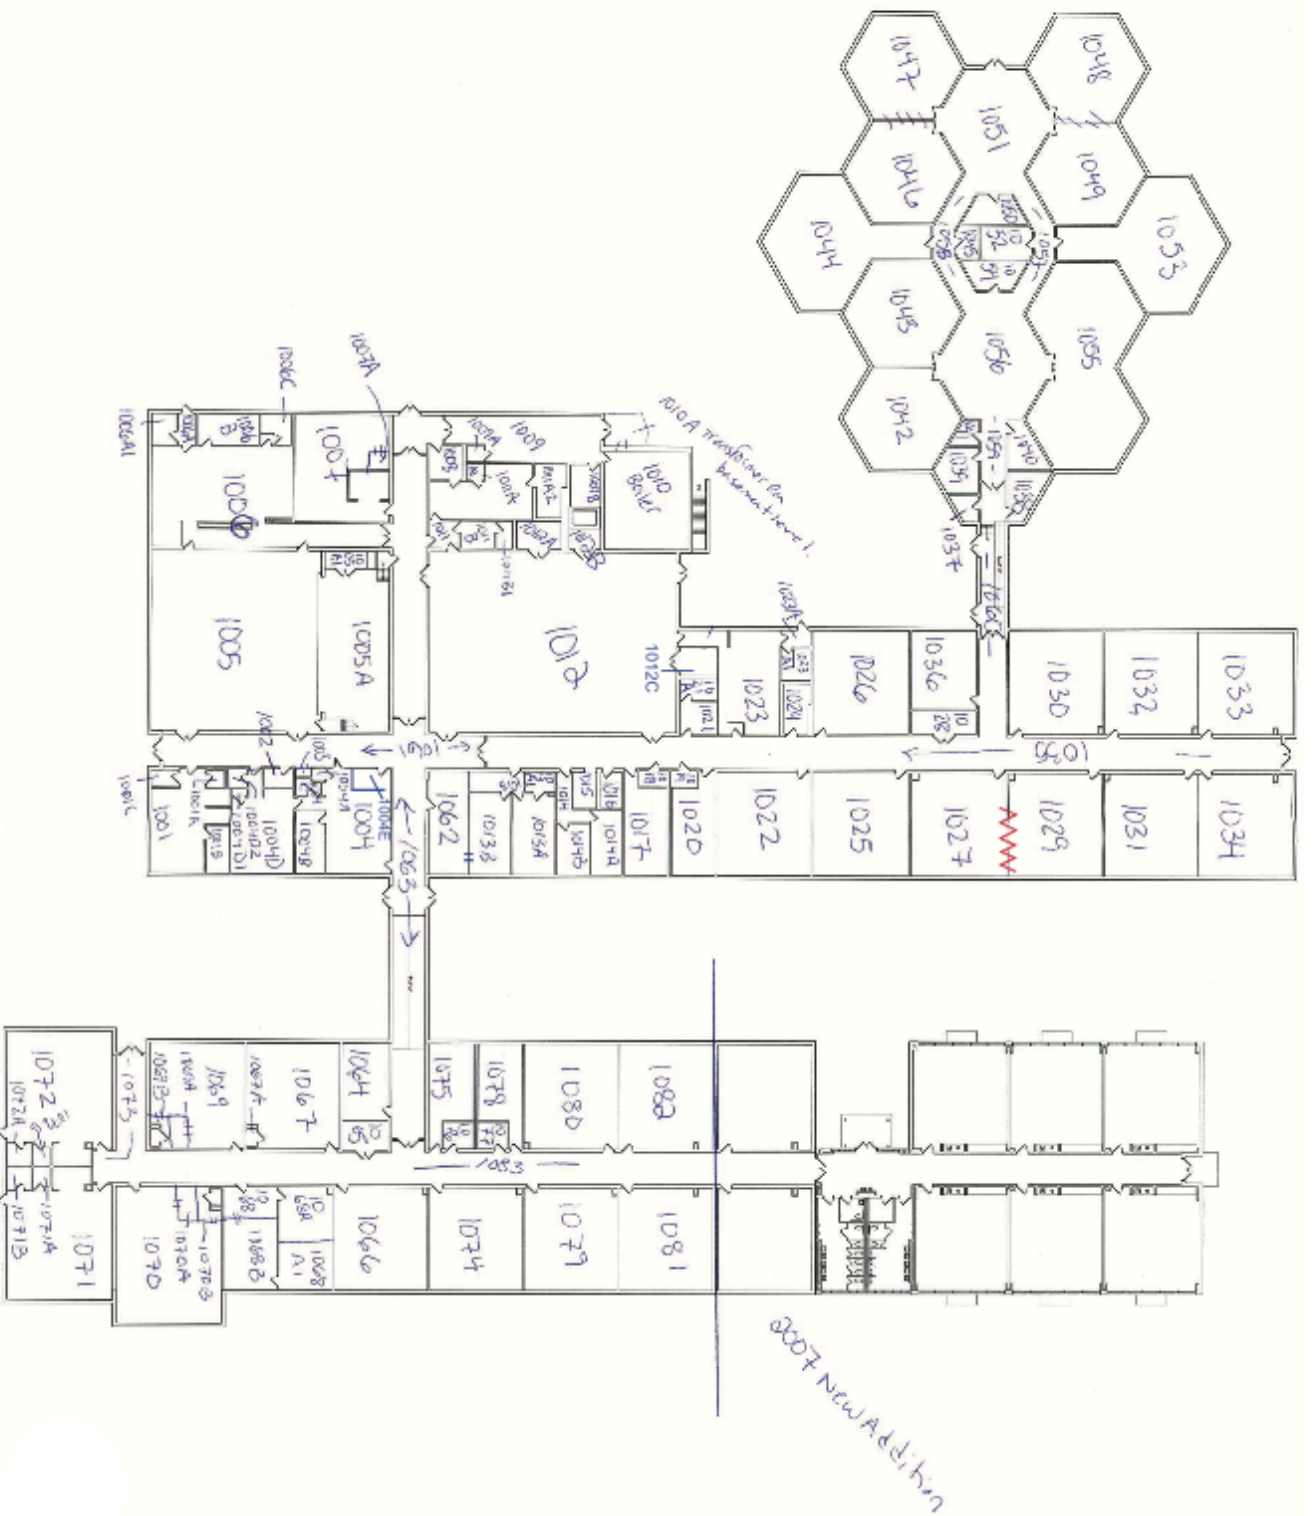

## Appendix D

### CERTIFICATIONS

**WE ARE YOUR DOL**

 **NEW YORK STATE** Department of Labor

DIVISION OF SAFETY & HEALTH LICENSE AND CERTIFICATE UNIT, STATE OFFICE CAMPUS, BLDG. 12, ALBANY, NY 12226

## ASBESTOS HANDLING LICENSE

Enviroscience Consultants, LLC  
2150 Smithtown Avenue, Ronkonkoma, NY, 11779

License Number: 28733  
License Class: RESTRICTED  
Date of Issue: 11/04/2022  
Expiration Date: 11/30/2023  
Duly Authorized Representative: Bartley Gallagher

This license has been issued in accordance with applicable provisions of Article 30 of the Labor Law of New York State and of the New York State Codes, Rules and Regulations (12 NYCRR Part 56). It is subject to suspension or revocation for a (1) serious violation of state, federal or local laws with regard to the conduct of an asbestos project, or (2) demonstrated lack of responsibility in the conduct of any job involving asbestos or asbestos material.

This license is valid only for the contractor named above and this license or a photocopy must be prominently displayed at the asbestos project worksite. This license verifies that all persons employed by the licensee on an asbestos project in New York State have been issued an Asbestos Certificate, appropriate for the type of work they perform, by the New York State Department of Labor.

  
Amy Phillips, Director  
For the Commissioner of Labor

**EXCELSIOR**

**Appendix E**

**NOTICE TO SHORT TERM WORKERS**

## NOTICE TO SHORT TERM WORKERS

All workers entering Forest Park Elementary School and/or the 3 Sheds must sign in, thereby acknowledging the presence and locations of asbestos containing building materials in the building. No work will be allowed in the areas listed without prior approval from the AHERA Designated Person for the Half Hollow Hills School District.

Sign in sheets will be picked up at the time of the Six Month AHERA Surveillance and will be placed in the buildings Asbestos Management Plan.

Asbestos containing materials and their locations at Forest Park Elementary School and the 3 Sheds are listed in the AHERA Management Plan, which is available for review, upon request.

[illegible]

**Appendix F**  
**BULK SAMPLE RESULTS**

ELAP # 11681; NVLAP Lab Code 200531-0

2150 Smithtown Ave., Suite 3, Ronkonkoma, NY 11779  
T: 631.580.3191 • F: 631.580.3195 • W: envirohealth.org

## ASBESTOS BULK SAMPLE RESULTS

|               |                                                                    |            |                   |           |  |
|---------------|--------------------------------------------------------------------|------------|-------------------|-----------|--|
| CLIENT:       | Half Hollow Hills CSD<br>525 Half Hollow Road, Dix Hills, NY 11746 |            | SAMPLE DATE:      | 6/15/2023 |  |
| PROJECT NAME: | AHERA Six-month Surveillance - May 2023                            |            | DATE RECEIVED:    | 6/16/2023 |  |
| JOB #:        | 23546                                                              | SAMPLER:   | Pamela Chadderton |           |  |
| PAGE #:       | 1 of 1                                                             | CUSTODY #: | 35346             |           |  |
| AREA:         | Forest Park Elementary - Terrazzo & Wall Panel Tectum              |            |                   |           |  |

| Lab ID | Sample # | Description       | Color                      | Location                                                | Total Asbestos Result | % Asbestos-type | % Non-asbestos Fibers-type | % Matrix-type |
|--------|----------|-------------------|----------------------------|---------------------------------------------------------|-----------------------|-----------------|----------------------------|---------------|
| 99697  | WPT1     | Wall Panel Tectum | White                      | Room 200C (AHERA #1014B)                                | None Detected         | 70.0% cellulose | 30.0% binders              |               |
| 99698  | WPT2     | Wall Panel Tectum | White                      | Reading Room 1 (AHERA #1013A)                           | None Detected         | 70.0% cellulose | 30.0% binders              |               |
| 99699  | TF3      | Terrazzo Floor    | White w/ Black Large Stone | 200 Wing Corridor Gym Room 210 (AHERA #1035)            | None Detected         | 2.0% cellulose  | 98.0% cement               |               |
| 99700  | TF4      | Terrazzo Floor    | White w/ Black Large Stone | Corridor Maintenance to Room 108 (AHERA #1063)          | None Detected         | 2.0% cellulose  | 98.0% cement               |               |
| 99701  | TF5      | Terrazzo Floor    | White w/ Black Small Stone | Corridor 300 Wing - 200 Wing "Breeze Way" (AHERA #1060) | None Detected         | 5.0% cellulose  | 95.0% cement               |               |
| 99702  | TF6      | Terrazzo Floor    | White w/ Black Small Stone | Corridor 300 Wing - 200 Wing "Breeze Way" (AHERA #1060) | None Detected         | 5.0% cellulose  | 95.0% cement               |               |

Method: EPA 600/M4-82/20, 600/R-93/116, NYS DOH ELAP Item 198.1, 198.4, 198.6, 198.8.

ACM: Asbestos Containing Materials contain more than 1%.

None Detected - No asbestos found in samples using polarized light microscopy (PLM). Trace - Asbestos found is 1% or less, not considered ACM.

None Detected by TEM - No asbestos found in samples using transmission electron microscopy (TEM) and polarized light microscopy (PLM) was found to be negative.

Negative by Weight - After matrix reduction, the remainder is less than 1% and, therefore, cannot fulfill the definition of asbestos containing material.

Inconclusive - No asbestos found in non-friable organically bound samples using polarized light microscopy (PLM).

Method ELAP 198.6 does not remove vermiculite and may underestimate the level of asbestos present in a sample containing greater than 10% vermiculite. Samples of Surface Material that contain Vermiculite are analyzed by ELAP 198.8 for conclusive result.

This report may not be reproduced without the express permission of EnviroScience Consultants, LLC. This report cannot be used to claim endorsement of products by NVLAP or any agency of the U.S. Government. Test results only reflect conditions at the time the samples were taken.

|              |                                                                                   |           |           |              |   |                |           |
|--------------|-----------------------------------------------------------------------------------|-----------|-----------|--------------|---|----------------|-----------|
| ANALYZED BY: |  | PLM DATE: | 6/16/2023 | ANALYZED BY: |   | TEM DATE:      |           |
| DIRECTOR:    |  | DATE:     | 6/19/2023 | REVISION #:  | 0 | REVISION DATE: | 6/19/2023 |