

Half Hollow Hills CSD
Six Month AHERA Surveillance
Chestnut Hill Elementary School & Garage & Portable
May 2023



2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project #23546

Six Month AHERA Surveillance

Performed at

Chestnut Hill Elementary School & Garage & Portable
600 South Service Road
Dix Hills, NY 11746

for

Half Hollow Hills CSD
Administration Building
525 Half Hollow Road
Dix Hills, NY 11746

May 2023

Prepared by:

Enviroscience Consultants, LLC
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #23546


Inspector & Management
Planner:


Bartley Gallagher

NYSDOL #92-13892

Inspectors: 
Alexis Bruno

NYSDOL #21-08575


Pamela Chadderton

NYSDOL #15-10408

Six Month AHERA Surveillance

Table of Contents

- I. Summary**
- II. Inspection and Recommendations**
- III. Bulk Sampling Protocol**
- IV. Hazard Rank Determination**
- V. AHERA Reassessment Category**

Appendix A - Inventory of Damaged Asbestos Containing Materials

Appendix B - Inventory of Asbestos Containing Materials

Appendix C - Drawings - Functional Space Number Floor Plans

Appendix D - Certifications

Appendix E - Notice to Short Term Workers

Appendix F - Bulk Sample Results

I. Summary

A six month AHERA surveillance for the Chestnut Hill Elementary School and Garage and Portable of the Half Hollow Hills CSD was performed by Ms. Alexis Bruno and Mrs. Pamela Chadderton of Enviroscience Consultants, LLC on June 13, 2023.

The six month surveillance was performed in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Ms. Bruno and Mrs. Chadderton are certified AHERA Inspectors.

Ms. Bruno and Mrs. Chadderton performed the on-site investigation, which included examining existing ACBM, evaluating the condition of the ACBM, and determining if originally non-friable materials have become friable. The physical condition of most of the ACBM found in this building did not change.

After studying the inspection reports, Mr. Bartley M. Gallagher, a certified EPA/AHERA Inspector and Management Planner, developed the recommendations for response actions depending on his evaluation of the hazard that each material may cause.

An Inventory of Asbestos Containing Materials by location, including the AHERA Functional Space identification number is in Appendix B. This inventory includes the material, quantity, amount damaged, the hazard level, the AHERA Reassessment category, and recommended response actions. A remarks column includes sampling and abatement action and other pertinent information.

Floor plans correlating the AHERA Functional Space ID number with the current common location names are in Appendix C.

II. Inspection and Recommendations

The inspector entered all accessible spaces to inspect and physically assess the condition and friability of all previously known or assumed ACBM. The inspector noted any change in condition of remaining materials, materials that have been abated since the last reinspection, and any materials that were either not identified, or may have been improperly classified.

Unless otherwise stated, a recommendation for removal is a suggestion that the materials be removed as soon as the school's budget will allow.

During this inspection there was damage noted, repairs should be made. Please reference your Summary of Damaged Asbestos Containing Materials found in Appendix A.

Since the last surveillance, the following asbestos abatement activities were performed:

In June 2023, bulk samples were collected of terrazzo floor at various locations throughout the Building Interior. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #35335 for detailed sample location information and results.

In March 2023, asbestos containing pipe fitting insulation was removed from the Hallway Outside Room 107 (AHERA space #1040). Please reference Enviroscience Consultants, LLC job #23418.

In December 2022, asbestos containing materials (ACM) were removed from the following areas:

- Approximately 10 thermal insulation pipe fittings were removed from the Gymnasium (AHERA #1066)

- Approximately 7 thermal insulation pipe fittings were removed from the Nurse's Mechanical Room (AHERA #1044C).

Please reference Enviroscience Consultants, LLC. job #23001.

History:

In June 2022, bulk samples were collected of vinyl cove base, vinyl cove base mastic, 12"x12" floor tile, 12"x12" floor tile mastic, 9"x9" floor tile, and 9"x9" floor tile mastic at various locations throughout the Building Interior. Results confirmed the 12"x12" floor tile and 12"x12" floor tile mastic in Room 122 (AHERA space #1001) and Room 206 (AHERA space #1075), and the 9"x9" floor tile and 9"x9" floor tile mastic in the Cafeteria Storage (AHERA space #1054A) and the Physical Education Office (AHERA space #1062B) to be asbestos containing materials; all the other materials sampled were confirmed to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #32857 for detailed sample location information and results.

In June 2022, asbestos containing pipe fitting insulation was removed from the Hallway following a leak. Please reference Enviroscience Consultants job #22355.

In May 2022, bulk samples were collected of the acoustical wall tile and wall tile mastic in Room 204 (AHERA space #1069). Bulk samples were collected of pipe fitting insulation in the Corridor from Room 116 to 122 (AHERA space #1018). Results confirmed the acoustical wall tile glue daub in Room 204, and the pipe fitting insulation in the Corridor from Room 116 to 122 to be asbestos containing materials; all the other materials sampled were confirmed to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #32705 for detailed sample location information and results.

In April 2022, bulk samples were collected of the wall board mastic in Room 121 (AHERA space #1002) and Hall by Teacher's Lounge (AHERA space #1050). Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #32680 for detailed sample location information and results.

In April 2022, bulk samples were collected of concrete block, concrete block mortar, and tectum decking at various locations throughout the School Building. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #32599 for detailed sample location information and results.

In April 2022, asbestos containing pipe fitting insulation was removed from the Breezeway above ceiling tiles (AHERA space #1065ACP). Please reference Enviroscience Consultants job #22150.

In April 2022, bulk samples were collected of the pipe fitting insulation in the Breezeway above ceiling tiles (AHERA space #1065ACP). Results confirmed the material sampled to be asbestos containing. Please reference Enviroscience Consultants chain of custody #32558 for detailed sample location information and results.

In November 2021, Enviroscience Consultants was retained by the Half Hollow Hills Central School District to perform the surveillance inspections and three year reinspections in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Any information pertaining to the assessment and changes in condition of ACBM prior to November 2021 must be obtained from the records maintained by the Half Hollow Hills Central School District.

In September 2021, approximately 11 thermal insulation pipe fittings were removed from the Hallway outside of the Nurse's Office. Please reference Enviroscience Consultants job #21462.

Any damaged material that is assumed to be asbestos containing should be sampled to confirm that it is identified as ACBM before initiating repair procedures.

The inspector did not access any flooring materials located under carpeting or new tiles because obtaining access would damage the carpet or new tiles. Prior to disturbing any carpets or removing new floor tiles, the school should ascertain whether floor tiles are located beneath them. Repair or replace damaged floor tiles as noted. We have prepared an inventory of asbestos containing materials for the building. These pages list the current damage category, changes in physical condition, current priority levels, changes in response actions, and bulk sampling and abatement information (see Appendix B).

All materials are currently classified as non-friable in their present condition, except for damaged thermal insulation materials, gypsum board, joint compound, and plaster.

III. Bulk Sampling Protocol

Thermal System Insulation - Three (3) samples are randomly collected for each homogeneous material of Thermal System Insulation (TSI). AHERA states that for each area of patched TSI at least one (1) sample be collected.

Surfacing Materials - a minimum of three (3), five (5) or seven (7) samples based upon the amount of suspect material present.

Miscellaneous Materials - require a minimum of two (2) samples.

New York State Revisions to Analytical Methods

Over the years, the New York State Department of Health has made several revisions to testing requirements that affect suspect asbestos materials in school buildings. These changes have resulted in the requirement to re-sample and analyze certain materials to comply with the revised analytical methods:

Surfacing Materials - In May 2016, the New York State Department of Health (NYSDOH) finalized testing requirements and approved a new analytical method for analysis of surfacing materials that contain vermiculite. Surfacing materials that could contain vermiculite include spray-on fireproofing, wall plaster, and ceiling plaster. Unfortunately, the previous analysis method for fireproofing and plasters did not specifically require that the vermiculite percentage be reported. The District must now consider any spray or troweled fireproofing or plaster materials to be presumed asbestos containing materials (PACM) until they are re-tested to conform to the new requirements. As a result, we have added any plaster previously classified as non-asbestos to the Inventory of Asbestos Containing Materials. Re-testing of any fireproofing or plaster materials will be noted in the narrative and will be shown in the Inventory.

Ceiling Tile - In August 2012, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in ceiling tiles that contain cellulose. Any ceiling tiles that have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Any re-testing of ceiling tiles will be noted in the narrative and will be shown in the Inventory. The District should keep records for any new non-asbestos ceiling tiles that are installed, including the location, brand, model number, date of manufacture, and date of installation.

Floor Tile and Other NOB Materials - In 1992, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in non-friable organically bound (NOB) materials such as floor tiles and roofing materials. As such, any floor tiles and mastic which have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Re-testing of any floor tile, mastic or other NOB materials will be noted in the narrative and will be shown in the Inventory.

During this surveillance, bulk samples were collected of terrazzo floor at various locations throughout the Building Interior. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #35335 in Appendix 'F' for detailed sample location information and results.

IV. Hazard Rank Determination

For each homogeneous material, a response action priority level is determined depending on its physical condition, location, and potential for future damage. Materials were classified into seven categories, based upon the type, condition, and potential for damage of the ACM. The categories are as follows:

Hazard Rank	ACBM Condition	ACBM Disturbance Potential
1	Significantly Damaged	Any Potential for Damage
2	Damaged	Potential for Significant Damage
3	Damaged	Potential for Damage
4	Damaged	Low Potential for Damage
5	Good	Potential for Significant Damage
6	Good	Potential for Damage
7	Good	Low Potential for Damage

The district shall select and implement in a timely manner the appropriate response actions consistent with the assessment category. The response actions selected shall be sufficient to protect human health and the environment. The district may then select, from the response actions which protect human health and the environment, that action which is the least burdensome method. Nothing in this section shall be construed to prohibit removal of ACM from a school building at any time, should removal be the preferred response action of the district.

If damaged or significantly damaged thermal system insulation ACM is present in a building, the district shall:

- (1) At least repair the damaged area.
- (2) Remove the damaged material if it is not feasible, due to technological factors, to repair the damage.
- (3) Maintain all thermal system insulation ACM and its covering in an intact state and undamaged condition.

If damaged friable surfacing ACM or damaged friable miscellaneous ACM is present in a building, the district shall select from among the following response actions: encapsulation, enclosure, removal, or repair of the damaged material.

In selecting the response action from among those which meet the definitional standards in §763.83, the district shall determine which of these response actions protects human health and the environment. For purposes of determining which of these response actions are the least burdensome, the district may then consider local circumstances, including occupancy and use patterns within the school building, and its economic concerns, including short and long-term costs.

V. AHERA Reassessment Category

The Management Planner is also required to classify each friable and thermal system insulation (TSI) ACBM and suspected ACBM assumed to be ACM in the school building into one of the following AHERA 1 through 7 reassessment categories based on damage, potential for damage, and material category:

- (1) Damaged or significantly damaged thermal system insulation ACM.
 - (2) Damaged friable surfacing ACM.
 - (3) Significantly damaged friable surfacing ACM.
 - (4) Damaged or significantly damaged friable miscellaneous ACM.
 - (5) ACBM with potential for damage.
 - (6) ACBM with potential for significant damage.
 - (7) Any remaining friable ACBM or friable suspected ACBM.
- N/A Not Applicable

Appendix A

INVENTORY OF DAMAGED ASBESTOS CONTAINING MATERIALS

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1001	ROOM 122	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED W/ MASTIC EXPOSED CONFIRMED ACM (ECL JOB #22357)
1002	ROOM 121	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED W/ MASTIC EXPOSED
1003	LIBRARY	COVE BASE & MASTIC BLUE		56 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1003CP	LIBRARY CEILING PLENUM	MUD JOINT PACKING		10 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1003B	LIBRARY OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		180 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1004	ROOM 120	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED; LIMITED VISIBILITY
1004CP	ROOM 120 CEILING PLENUM	MUD JOINT PACKING		5 UNITS	NOT QUANTIFIED	3	1	REPAIR	DAMAGED
1005	BOY'S BATHROOM NEAR LIBRARY	CERAMIC FLOOR TILE GROUT & GLUE GREEN		324 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
		CERAMIC WALL TILE GROUT & GLUE GREY		212 SF	<1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
1006	GIRL'S BATHROOM NEAR LIBRARY	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		324 SF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING TILES
1007	ROOM 109	CERAMIC WALL TILE GROUT & GLUE BEIGE		212 SF	<1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED W/ MASTIC EXPOSED
1008	ROOM 119	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	70 TILES	4	N/A NON FRIABLE	REPAIR	LIFTING, CRACKED, & CHIPPED W/ MASTIC EXPOSED. CONFIRMED ACM (ECL JOB #23744)
1010	ROOM 118	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED-LIMITED VISIBILITY; CONFIRMED ACM (ECL JOB #23744)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1013	ROOM 111	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		89 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING W/ MASTIC EXPOSED
1015	ROOM 110	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		81 LF	3 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING W/ MASTIC EXPOSED
1016	ROOM 117	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
1017	ROOM 116	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		81 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
1017CP	ROOM 116 CEILING PLENUM	MUD JOINT PACKING		12 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1018CP	CORRIDOR ROOM 116 - 122 CEILING PLENUM	MUD JOINT PACKING		30 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1019A	ROOM 115 STORAGE	CEILING GYPSUM BOARD & COMPOUND		48 SF	4 SF	3	4	REPAIR	WATER DAMAGE
1019B	ROOM 115 BATHROOM	CEILING GYPSUM BOARD & COMPOUND		18 SF	4 SF	3	4	REPAIR	WATER DAMAGE
1020	ROOM 114	12X12 FLOOR TILE & MASTIC WHITE W. BLUE		1000 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	LOOSE
1020CP	ROOM 114 CEILING PLENUM	MUD JOINT PACKING		6 UNITS	NOT QUANTIFIED	3	1	REPAIR	BULK SAMPLE, IF CONF ASB REPAIR OR REMOVE DAMAGE DURING NEXT SCHOOL BREAK
1020B	ROOM 114 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		18 SF	< 1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	MISSING

Summary of Damaged Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1022	BOY'S BATHROOM NEAR ROOM 114	CERAMIC FLOOR TILE GROUT & GLUE GREEN		85 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	MISSING TILE
1023	WOMEN'S FACULTY BATHROOM NEAR ROOM 114	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		49 SF	4 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		CERAMIC WALL TILE GROUT & GLUE BEIGE		150 SF	8 LF	4	N/A NON FRIABLE	REPAIR	CRACKED w/ MISSING GROUT
1024	CUSTODIAL CLOSET NEAR ROOM 114	COVE BASE & MASTIC BLACK		13 LF	2 LF	4	N/A NON FRIABLE	REPAIR	MISSING
1025	STORAGE ROOM NEAR ROOM 113	COVE BASE & MASTIC BLACK		37 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING-LIMITED VISIBILITY
1026	ROOM 113	PEGBORD		198 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	GOOD CONDITION
1027A	ROOM 112 BATHROOM	CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	MISSING & CRACKED
1030	ROOM 106	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1032	COPY ROOM 108	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED w/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		78 LF	3 LF	4	N/A NON FRIABLE	REPAIR	MISSING & DELAMINATING
1033	ROOM 104	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED w/ MASTIC EXPOSED
1034	ROOM 103	COVE BASE & MASTIC BLACK		81 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1035	MEN'S BATHROOM NEAR COPY ROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		48 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
		CERAMIC WALL TILE GROUT & GLUE GREY		138 SF	2 LF	4	N/A NON FRIABLE	REPAIR	MISSING & CRACKED
1036	WOMEN'S BATHROOM NEAR COPY ROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		48 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
1038	ROOM 102	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED & LIFTING FROM WATER DAMAGE-LIMITED VISIBILITY
1039	ROOM 101	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY (PREVIOUSLY CRACKED & CHIPPED W/ MASTIC EXPOSED)
1041 B	PRINCIPAL STORAGE	COVE BASE & MASTIC BLACK		21 LF	2 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1042	MAIN OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		624 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		110 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1042C	MAIN OFFICE INNER OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		150 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & LIFTING
1043	OFFICE ADJACENT MAIN OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		140 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		45 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
1044	NURSE OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		540 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		112 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1044A	NURSE BATHROOM	CEILING GYPSUM BOARD & COMPOUND		18 SF	1 LF	3	4	REPAIR	CRACKED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1044C	NURSE MECHANICAL ROOM	DUCT INSULATION CLOTH		1 UNIT	1 SF	4	4	REPAIR	TORN
		2X4 CEILING TILE PINHOLE DOTS		20 SF	15 SF	4	N/A NON FRIABLE	REPAIR	MISSING; CONF ASB ORIGINAL AMP
1045	CUSTODIAL CLOSET NEXT TO NURSE	CEILING GYPSUM BOARD & COMPOUND		30 SF	<1 SF	3	4	REPAIR	INTENTIONAL HOLES
1046	STORAGE NEAR NURSE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		112 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		CEILING GYPSUM BOARD & COMPOUND		112 SF	1 SF	3	4	REPAIR	WATER STAINED
1047	ROOM 124	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
1048	ROOM 123	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY - CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		81 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY - DELAMINATING
1051	TEACHER'S LOUNGE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		560 SF	13 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
1052A	CUSTODIAN SLOP SINK	CEILING GYPSUM BOARD & COMPOUND		25 SF	<1 LF	3	4	REPAIR	JOINT COMPOUND PEELING
1052B	CUSTODIAN BATHROOM	CEILING GYPSUM BOARD & COMPOUND		120 SF	32 SF	3	4	REPAIR	WATER DAMAGE
1052C	CUSTODIAN STORAGE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		250 SF	63 TILES	4	N/A NON FRIABLE	REPAIR	MISSING, POPPING, & LIFTING
		CEILING GYPSUM BOARD & COMPOUND		250 SF	2 SF	3	4	REPAIR	CRACKED
1052D	CUSTODIAN OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		120 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	LIFTING & MISSING
1054A	CAFETERIA STORAGE	COVE BASE & MASTIC BLACK		50 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1054B	CAFETERIA STAGE	2X4 CEILING TILE STAR		16 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	TECTUM OBSERVED
1055CP	KITCHEN CEILING PLENUM	MUD JOINT PACKING		32 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1058	BATHROOM #3-BOY'S BATHROOM BY ROOM 201	CERAMIC FLOOR TILE GROUT & GLUE GREEN		200 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
1059	BATHROOM #4-GIRL'S BATHROOM BY ROOM 201	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		200 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
1060A	Room 201 STORAGE/SUPPLY ROOM	CEILING PLASTER SMOOTH		120 SF	4 SF	3	4	REPAIR	WATER DAMAGE
1061	Room 200A	GYP SUM BOARD & JOINT COMPOUND		279 SF	2 SF	3	4	REPAIR	CHIPPED & SCRAPPED
1062	PHYS ED VESTIBULE	CERAMIC WALL BASE GROUT & GLUE BEIGE		14 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
1062A	PHYS ED VESTIBULE BATHROOM	CERAMIC WALL BASE GROUT & GLUE BEIGE		23 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
1062B	PHYS ED OFFICE	9X9 FLOOR TILE & MASTIC BLACK & WHITE		100 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		2X4 CEILING TILE PINHOLE		100 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & WATER DAMAGED; CONF ASB ORIGINAL AMP
1062C	PHYS ED STORAGE	CERAMIC WALL BASE GROUT & GLUE BEIGE		93 SF	3 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
1062CCP	PHYS ED STORAGE CEILING PLENUM	2X4 CEILING TILE PINHOLE		460 SF	14 TILES	4	N/A NON FRIABLE	REPAIR	HOLES, CHIPPED, & WATER DAMAGE; CONF ASB ORIGINAL AMP
		MUD JOINT PACKING		6 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1065CP	GYMNASIUM LOBBY CEILING PLENUM	MUD JOINT PACKING		12 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1066A	GYMNASIUM STORAGE 2	COVE BASE & MASTIC BLACK		41 LF	15 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CEILING GYPSUM BOARD & COMPOUND		120 SF	1 LF	3	4	REPAIR	CRACKED
1067	ROOM 200C VESTIBULE	CERAMIC WALL BASE GROUT & GLUE GREY		12 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
1067A	ROOM 200C BATHROOM	CERAMIC WALL BASE GROUT & GLUE GREY		23 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
1067B	ROOM 200C PHYS ED OFFICE	9X9 FLOOR TILE & MASTIC BLACK & WHITE		100 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		34 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		2X4 CEILING TILE PINHOLE DOTS		100 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	WATER DAMAGE; CONF ASB ORIGINAL AMP
1067C	ROOM 200C LARGE STORAGE	CERAMIC WALL BASE GROUT & GLUE GREY		80 LF	10 LF	4	N/A NON FRIABLE	REPAIR	MISSING
1068	ROOM 200D	2X4 CEILING TILE PINHOLE DOTS		460 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	HOLES, MISSING, & WATER DAMAGE; CONF ASB ORIGINAL AMP
		COVE BASE & MASTIC BLACK		28 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1068A	ROOM 200D STORAGE	CERAMIC FLOOR TILE GROUT & GLUE GREEN		49 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING & CHIPPED
		CERAMIC WALL TILE GROUT & GLUE GREY		252 SF	10 LF	4	N/A NON FRIABLE	REPAIR	CRACKED W/ MISSING GROUT
		CEILING PLASTER TEXTURED		49 SF	< 1 LF	3	4	REPAIR	CRACKED
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED - SOME PATCHED
1069	ROOM 204	COVE BASE & MASTIC BROWN		111 LF	6 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		1X1 WALL TILE & MASTIC FISSURE		160 SF	30 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED; MASTIC CONFIRMED ACM (ECL JOB #22260)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1070	ROOM 205	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BROWN		111 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1070CP	ROOM 205 CEILING PLENUM	MUD JOINT PACKING		8 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1071	CUSTODIAN CLOSET BY ROOM 200E	COVE BASE & MASTIC BLACK		20 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1073	ROOM 200E	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		198 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		55 LF	6 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING w/ MASTIC EXPOSED
1074	ROOM 210	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		111 LF	11 LF	4	N/A NON FRIABLE	REPAIR	MISSING
1075	ROOM 206	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, & LIFTING w/ MASTIC EXPOSED CONFIRMED ACM (ECL JOB #22357)
		COVE BASE & MASTIC BROWN		111 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1075A	ROOM 206 BATHROOM	CERAMIC WALL BASE GROUT & GLUE BEIGE		13 LF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
1076	ROOM 209	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1077	ROOM 207	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
1077A	ROOM 207 BATHROOM	CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED

Summary of Damaged Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1078	ROOM 208	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1078A	ROOM 208 BATHROOM	CERAMIC WALL BASE GROUT & GLUE BEIGE		13 LF	4 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
1079	ROOM 211	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		792 SF	50 TILES	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY (PREVIOUSLY CRACKED, CHIPPED, & LIFTING W/ MASTIC EXPOSED)
		COVE BASE & MASTIC BROWN		113 LF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	NO ACCESS-STORAGE MATERIALS BLOCKING DOOR
		WINDOW GLAZING/CAULKING		68 LF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	NO ACCESS-STORAGE MATERIALS BLOCKING DOOR
1080	STORAGE/ROOM 212	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		792 SF	14 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, & LIFTING-LIMITED VISIBILITY
		COVE BASE & MASTIC BROWN		113 LF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	LIMITED VISUAL ACCESS
		WINDOW GLAZING/CAULKING		68 LF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	LIMITED VISUAL ACCESS
1082	CORRIDOR STORAGE 1 - CUSTODIAL AREA	WALL/CHALK-BOARD MASTIC		450 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	NO ACCESS-STORAGE MATERIALS BLOCKING
1082CP	CORRIDOR STORAGE 1 - CUSTODIAL AREA CEILING PLENUM	MUD JOINT PACKING		41 UNITS	NOT QUANTIFIED	3	1	REPAIR	CONF ASB ENVIROSCIENCE#17188; < 3 LF ABATED BRANCH#18-22423-01

Appendix B

INVENTORY OF ASBESTOS CONTAINING MATERIALS

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1001	ROOM 122	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED W/ MASTIC EXPOSED CONFIRMED ACM (ECL JOB #22357)
		COVE BASE & MASTIC BROWN		0					CONFIRMED NON-ACM (ECL JOB #22357)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1002	ROOM 121	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		0					CONFIRMED NON-ACM (ECL JOB #22231)
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1002CP	ROOM 121 CEILING PLENUM	MUD JOINT PACKING		6 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1003	LIBRARY	CEILING TILE		0					ABATED 2007 REINSPECTION
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		1506 SF	0	7	N/A NON FRIABLE	O&M	UNDER CARPET
		CARPET MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLUE		56 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		1506 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1003CP	LIBRARY CEILING PLENUM	MUD JOINT PACKING		10 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1003A	LIBRARY CONFERENCE ROOM	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		368 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		64 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE		0					NON ASB JCB#14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1003B	LIBRARY OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		180 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		26 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE		0					NON ASB JCB#14- 28692 TEM
		12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED; LIMITED VISIBILITY
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; LIMITED VISIBILITY
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1004	ROOM 120	WINDOW/ GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
1004CP	ROOM 120 CEILING PLENUM	MUD JOINT PACKING		5 UNITS	NOT QUANTIFIED	3	1	REPAIR	DAMAGED
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1005	BOY'S BATHROOM NEAR LIBRARY	CERAMIC FLOOR TILE GROUT & GLUE GREEN		324 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
		CERAMIC WALL TILE GROUT & GLUE GREY		212 SF	< 1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYPSON BOARD (AROUND SKYLIGHT)		30 SF	0	6	5	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE DOTS		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE TEXTURED PINHOLE		0					NON ASB JCB#14-28692 TEM
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1005CP	BOY'S BATHROOM NEAR LIBRARY CEILING PLENUM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		324 SF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING TILES
1006	GIRL'S BATHROOM NEAR LIBRARY	CERAMIC WALL TILE GROUT & GLUE BEIGE		212 SF	< 1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYPSON BOARD (AROUND SKYLIGHT)		30 SF	0	6	5	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE DOTS		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE TEXTURED PINHOLE		0					NON ASB JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1006CP	GIRL'S BATHROOM NEAR LIBRARY CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1007	ROOM 109	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		81 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	70 TILES	4	N/A NON FRIABLE	REPAIR	LIFTING, CRACKED, & CHIPPED W/ MASTIC EXPOSED. CONFIRMED ACM (ECL JOB #23744)
1008	ROOM 119	COVE BASE & MASTIC BROWN		0					CONFIRMED NON-ACM (ECL JOB #23744)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1008CP	Room 119 CEILING PLENUM	MUD JOINT PACKING		10 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1009	STAFF ROOM/ROOM 131	12X12 FLOOR TILE & MASTIC LIGHT BLUE		0					CONFIRMED NON-ACM (ECL JOB #22357)
		COVE BASE & MASTIC BLUE		0					CONFIRMED NON-ACM (ECL JOB #22357)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14-28692 TEM
1009CP	STAFF ROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1010	Room 118	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED-LIMITED VISIBILITY; CONFIRMED ACM (ECL JOB #23744)
		COVE BASE & MASTIC BLACK		0					CONFIRMED NON-ACM (ECL JOB #23744)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1010CP	ROOM 118 CEILING PLENUM	MUD JOINT PACKING		7 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1011	PSYCHOLOGIST OFFICE	12X12 FLOOR TILE & MASTIC LIGHT BLUE		437 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLUE		81 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
1011CP	PSYCHOLOGIST OFFICE CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1012	CORRIDOR ROOM 111- STORAGE CLOSET	CEILING TILE		0					ABATED 2007 REINSPECTION
		12X12 FLOOR TILE & MASTIC LIGHT BLUE		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLUE		59 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1012CP	CORRIDOR ROOM 111- STORAGE CLOSET CEILING PLENUM	CEILING GYPSUM BOARD & COMPOUND		160 SF	0	6	5	O&M	GOOD CONDITION
1013	ROOM 111	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		89 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING w/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
1013CP	ROOM 111 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1014	STORAGE NEAR ROOM 111	12X12 FLOOR TILE & MASTIC LIGHT BLUE		0					CONFIRMED NON-ACM (ECL JOB #22357)
		COVE BASE & MASTIC BLUE		0					CONFIRMED NON-ACM (ECL JOB #22357)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14- 28692 TEM
1014CP	STORAGE NEAR ROOM 111 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1015	ROOM 110	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		81 LF	3 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
1015CP	ROOM 110 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1016	ROOM 117	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		81 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
1016CP	ROOM 117 CEILING PLENUM	MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1017	ROOM 116	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		81 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		MUD JOINT PACKING		12 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1017CP	ROOM 116 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		CEILING TILE		0					ABATED 2007 REINSPECTION
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		0					CONFIRMED NON-ACM (ECL JOB #22357)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYPSUM BOARD (AROUND SKYLIGHT)		60 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		400 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		24 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		55 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	7	O&M	GOOD CONDITION
1018	CORRIDOR ROOM 116 - 122	2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1018CP	CORRIDOR ROOM 116 - 122 CEILING PLENUM	MUD JOINT PACKING		30 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1019	ROOM 115	12X12 FLOOR TILE & MASTIC BLUE		1000 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		131 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		90 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
1019CP	ROOM 115 CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1019A	ROOM 115 STORAGE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION- LIMITED VISIBILITY
		COVE BASE & MASTIC BLACK		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION- LIMITED VISIBILITY
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		48 SF	4 SF	3	4	REPAIR	WATER DAMAGE

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1019B	ROOM 115 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE GREY		14 SF	0	7	N/A NON FRIABLE	O&M	BLACK VINYL COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		18 SF	4 SF	3	4	REPAIR	WATER DAMAGE
1020	ROOM 114	12X12 FLOOR TILE & MASTIC WHITE W. BLUE		1000 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	LOOSE
		COVE BASE & MASTIC BLACK		131 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		90 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
1020CP	ROOM 114 CEILING PLENUM	MUD JOINT PACKING		6 UNITS	NOT QUANTIFIED	3	1	REPAIR	BULK SAMPLE, IF CONF ASB REPAIR OR REMOVE DAMAGE DURING NEXT SCHOOL BREAK
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1020A	ROOM 114 STORAGE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		48 SF	0	7	N/A NON FRIABLE	O&M	FLOOR TILE UNDER
		COVE BASE & MASTIC BROWN		18 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		48 SF	0	6	5	O&M	GOOD CONDITION
1020B	ROOM 114 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		18 SF	< 1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		18 SF	0	6	5	O&M	GOOD CONDITION
1021	GIRL'S BATHROOM NEAR ROOM 114	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		85 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE BEIGE		210 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYPSUM BOARD (AROUND SKYLIGHT)		36 SF	0	6	5	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1021CP	GIRL'S BATHROOM NEAR ROOM 114 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1022	BOY'S BATHROOM NEAR ROOM 114	CERAMIC FLOOR TILE GROUT & GLUE GREEN		85 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	MISSING TILE
		CERAMIC WALL TILE GROUT & GLUE GREY		210 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYPSUM BOARD (AROUND SKYLIGHT)		36 SF	0	6	5	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
1022CP	BOY'S BATHROOM NEAR ROOM 114 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1023	WOMEN'S FACULTY BATHROOM NEAR ROOM 114	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		49 SF	4 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		CERAMIC WALL TILE GROUT & GLUE BEIGE		150 SF	8 LF	4	N/A NON FRIABLE	REPAIR	CRACKED W/ MISSING GROUT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
1023CP	WOMEN'S FACULTY BATHROOM NEAR ROOM 114 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1024	CUSTODIAL CLOSET NEAR ROOM 114	COVE BASE & MASTIC BLACK		13 LF	2 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		54 SF	0	6	5	O&M	GOOD CONDITION
1025	STORAGE ROOM NEAR ROOM 113	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		153 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION- LIMITED VISIBILITY
		COVE BASE & MASTIC BLACK		37 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING-LIMITED VISIBILITY
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		153 SF	0	6	5	O&M	GOOD CONDITION
1026	ROOM 113	12X12 FLOOR TILE & MASTIC BLUE		1000 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		130 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		90 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	7	O&M	GOOD CONDITION
		PEGBBOARD		198 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1026CP	ROOM 113 CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	6	5	O&M	LIMITED VISUAL ACCESS
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1026A	ROOM 113 STORAGE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		18 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		48 SF	0	6	5	O&M	GOOD CONDITION
1026B	ROOM 113 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		18 SF	0	6	5	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1027	ROOM 112	12X12 FLOOR TILE & MASTIC BLUE		1000 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		130 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		90 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	7	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
1027CP	ROOM 112 CEILING PLENUM	MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1027A	ROOM 112 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	MISSING & CRACKED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		18 SF	0	6	5	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1027B	ROOM 112 STORAGE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		18 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		48 SF	0	6	5	O&M	GOOD CONDITION
1028	CORRIDOR ROOM 112 - ROOM 115	CEILING TILE		0					ABATED 2007 REINSPECTION
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		230 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		67 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	7	7	O&M	GOOD CONDITION
1028CP	CORRIDOR ROOM 112 - ROOM 115 CEILING PLENUM	2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
		MUD JOINT PACKING		12 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1029	ROOM 107	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		81 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		MUD JOINT PACKING TECTUM DECKING		10 UNITS	0	6	5	O&M	GOOD CONDITION
1029CP	ROOM 107 CEILING PLENUM	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1030	ROOM 106	COVE BASE & MASTIC BROWN		81 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1030CP	ROOM 106 CEILING PLENUM	MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1031	ROOM 105	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		81 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		MUD JOINT PACKING		6 UNITS	0	6	5	O&M	GOOD CONDITION
1032	COPY ROOM 108	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		78 LF	3 LF	4	N/A NON FRIABLE	REPAIR	MISSING & DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1032CP	COPY ROOM 108 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1033	ROOM 104	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BROWN		81 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1033CP	ROOM 104 CEILING PLENUM	2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		MUD JOINT PACKING		8 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1034	ROOM 103	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		81 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14- 28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		MUD JOINT PACKING		16 UNITS	0	6	5	O&M	GOOD CONDITION
1034CP	ROOM 103 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1035	MEN'S BATHROOM NEAR COPY ROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		48 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
		CERAMIC WALL TILE GROUT & GLUE GREY		138 SF	2 LF	4	N/A NON FRIABLE	REPAIR	MISSING & CRACKED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X4 CEILING TILE SPECKLED		0					ABATED JCB#11-20817
1035CP	MEN'S BATHROOM NEAR COPY ROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1036	WOMEN'S BATHROOM NEAR COPY ROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		48 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
		CERAMIC WALL TILE GROUT & GLUE BEIGE		138 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
1036CP	WOMEN'S BATHROOM NEAR COPY ROOM CEILING PLENUM	2x4 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM
		2x4 CEILING TILE TEXTURED		0					ABATED JCB #11-20817
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		CEILING TILE		0					ABATED JCB#11-20817
		TERRAZZO FLOORING TAN W/ BROWN		0					CONFIRMED NON-ACM (ECL JOB #23546)
1037	CORRIDOR COPY ROOM - ROOM 120	COVE BASE & MASTIC RED		157 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYPSUM BOARD (AROUND SKYLIGHT)		60 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		250 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		24 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	7	7	O&M	GOOD CONDITION
		2x2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1037CP	CORRIDOR COPY ROOM - ROOM 120 CEILING PLENUM	MUD JOINT PACKING		6 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1038	ROOM 102	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED, CRACKED & LIFTING FROM WATER DAMAGE-LIMITED VISIBILITY
		COVE BASE & MASTIC BROWN		75 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM
1038CP	ROOM 102 CEILING PLENUM	2X4 CEILING TILE		0					ABATED JCB#11-20817
		MUD JOINT PACKING		12 UNITS	0	6	5	O&M	LIMITED VISUAL ACCESS
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1039	ROOM 101	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	8 TILES	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY (PREVIOUSLY CRACKED & CHIPPED W/ MASTIC EXPOSED)
		COVE BASE & MASTIC BLACK		104 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		MUD JOINT PACKING		10 UNITS	0	6	5	O&M	GOOD CONDITION
1039CP	ROOM 101 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		ROOF TAR		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1040	CORRIDOR ROOM 101-107	CEILING TILE		0					ABATED 2007 REINSPECTION
		12X12 FLOOR TILE & MASTIC LIGHT BLUE		880 SF	0	7	N/A NON FRIABLE	O&M	NOT OBSERVED
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		334 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLUE		108 LF	0	7	N/A NON FRIABLE	O&M	NOT OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYPSUM BOARD (AROUND SKYLIGHT)		72 SF	0	6	5	O&M	GOOD CONDITION
		GYPSUM BOARD & JOINT COMPOUND		240 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		400 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		24 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1040CP	CORRIDOR ROOM 101-107 CEILING PLENUM	WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		MUD JOINT PACKING		30 UNITS	0	6	5	O&M	5 LF ABATED (ECL JOB #23418) CONFIRMED NON-ACM (ECL JOB #22162)
		TECTUM DECKING		0					
1041	PRINCIPAL OFFICE	CARPET MASTIC		379 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		82 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WINDOW GLAZING/CAULKING		100 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		3 DOORS	0	7	7	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ASB JCB#14-28692 TEM
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1041CP	PRINCIPAL OFFICE CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1041A	PRINCIPAL BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE TAN WITH BROWN		15 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		18 SF	0	6	5	O&M	GOOD CONDITION
1041B	PRINCIPAL STORAGE	CARPET MASTIC		72 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		21 LF	2 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WINDOW GLAZING/CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
1041BCP	PRINCIPAL STORAGE CEILING PLENUM	1X1 CEILING TILE FISSURE SPLINE		0					NON ASB JCB#14- 28692 TEM
		MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		8 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		8 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
1041C	PRINCIPAL CLOSET	FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		8 SF	0	6	5	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1042	MAIN OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		624 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		110 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WINDOW GLAZING/CAULKING		48 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
1042CP	MAIN OFFICE CEILING PLENUM	2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		136 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		28 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
1042A	MAIN OFFICE KITCHEN AREA	WINDOW GLAZING/CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ASB JCB#14- 28692 TEM
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		72 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1042B	MAIN OFFICE STORAGE	COVE BASE & MASTIC BROWN		18 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		72 SF	0	6	5	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1042C	MAIN OFFICE INNER OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		150 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & LIFTING
		COVE BASE & MASTIC BROWN		46 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WINDOW GLAZING/CAULKING		24 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE SPLINE		0					NON ASB JCB#14- 28692 TEM
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		140 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		45 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYPSUM BOARD (AROUND SKYLIGHT)		72 SF	0	6	5	O&M	GOOD CONDITION
1043	OFFICE ADJACENT MAIN OFFICE	SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		540 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		112 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1044	NURSE OFFICE	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WINDOW GLAZING/CAULKING		48 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE		0					NON ASB JCB#14- 28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1044A	NURSE BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE TAN WITH BROWN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		5 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
1044B	NURSE CLOSET	CEILING GYPSUM BOARD & COMPOUND		18 SF	1 LF	3	4	REPAIR	CRACKED
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		12 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		8 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
1044C	NURSE MECHANICAL ROOM	CEILING GYPSUM BOARD & COMPOUND		12 SF	0	6	5	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		33 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					ABATED DEC 2022 (ECL JOB #23001)
		DUCT INSULATION CLOTH		1 UNIT	1 SF	4	4	REPAIR	TORN
		2x4 CEILING TILE PINHOLE DOTS		20 SF	15 SF	4	N/A NON FRIABLE	REPAIR	MISSING; CONF ASB ORIGINAL AMP

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1045	CUSTODIAL CLOSET NEXT TO NURSE	COVE BASE & MASTIC BROWN		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		30 SF	<1 SF	3	4	REPAIR	INTENTIONAL HOLES
1046	STORAGE NEAR NURSE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		112 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		33 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		112 SF	1 SF	3	4	REPAIR	WATER STAINED
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
1047	ROOM 124	COVE BASE & MASTIC BROWN		81 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14- 28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1047CP	ROOM 124 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1048	ROOM 123	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY - CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		81 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY - DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
1048CP	ROOM 123 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1049	CORRIDOR PRINCIPAL-ROOM 123	CEILING TILE		0					ABATED 2007 REINSPECTION
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		107 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		150 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		5 DOORS	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1049CP	CORRIDOR PRINCIPAL - ROOM 123 CEILING PLENUM	MUD JOINT PACKING		61 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1050	WEST BREEZEWAY ROOM 123 TO BOILER ROOM	16X16 FLOOR TILE & MASTIC GOLD & RED		0					NEW MATERIAL
		COVE BASE & MASTIC RED		44 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		0					CONFIRMED NON-ACM (ECL JOB #22231)
		WINDOW GLAZING/CAULKING		408 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					ABATED 2007 REINSPECTION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		560 SF	13 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
1051	TEACHER'S LOUNGE	COVE BASE & MASTIC BROWN		72 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WOOD PANEL MASTIC		162 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1051CP	TEACHER'S LOUNGE CEILING PLENUM	MUD JOINT PACKING		5 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1052	CUSTODIAL AREA	16X16 FLOOR TILE & MASTIC GOLD & RED		0					NEW MATERIAL
		COVE BASE & MASTIC BROWN		0					CONFIRMED NON-ACM (ECL JOB #22357)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION METAL		4 DOORS	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14- 28692 TEM
1052CP	CUSTODIAL AREA CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		ROOF TAR		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1052A	CUSTODIAN SLOP SINK	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		CEILING GYPSUM BOARD & COMPOUND		25 SF	<1 LF	3	4	REPAIR	JOINT COMPOUND PEELING
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1052B	CUSTODIAN BATHROOM	CERAMIC WALL BASE GROUT & GLUE GREY		36 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		120 SF	32 SF	3	4	REPAIR	WATER DAMAGE

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1052C	CUSTODIAN STORAGE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		250 SF	63 TILES	4	N/A NON FRIABLE	REPAIR	MISSING, POPPING, & LIFTING
		COVE BASE & MASTIC BROWN		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WINDOW/ GLAZING/CAULKING		10 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		250 SF	2 SF	3	4	REPAIR	CRACKED
1052CCP	CUSTODIAN STORAGE CEILING PLENUM	MUD JOINT PACKING		6 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1052D	CUSTODIAN OFFICE	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		120 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	LIFTING & MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	7	O&M	GOOD CONDITION
		MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1053	BOILER ROOM	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		3 DOORS	0	7	7	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					NOT SUSPECT
		BOILER BREECHING		0					ABATED 2004 REINSPECTION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1054	CAFETERIA	12X12 FLOOR TILE & MASTIC BEIGE		0					CONFIRMED NON-ACM (ECL JOB #22357)
		COVE BASE & MASTIC BROWN		0					CONFIRMED NON-ACM (ECL JOB #22357)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYP SUM BOARD & JOINT COMPOUND		240 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		160 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		8 DOORS	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					ABATED JCB#11-20817
		2X2 CEILING TILE SPECKLED		0					ABATED JCB#11-20817
		NO ACCESS							NO ACCESS
		CAFETERIA CEILING PLENUM							
1054CP	CAFETERIA CEILING PLENUM	NO ACCESS							NO ACCESS
1054A	CAFETERIA STORAGE	9X9 FLOOR TILE & MASTIC BLACK & WHITE		108 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		50 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		108 SF	0	6	5	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1054B	CAFETERIA STAGE	WOOD FLOOR TAR/VAPOR BARRIER		1200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC BEIGE		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		19 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYPNUM BOARD & JOINT COMPOUND		24 SF	0	6	5	O&M	GOOD CONDITION
		FIRE CURTAINS RED & GOLD		1600 SF	0	7	7	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	7	7	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		MUD JOINT PACKING		18 UNITS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE STAR		16 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	TECTUM OBSERVED
1055	KITCHEN	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		TERRAZZO FLOORING WHITE W/ BLACK		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WINDOW/ GLAZING/CAULKING		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	7	7	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	7	7	O&M	GOOD CONDITION
		2x2 CEILING TILE SMOOTH		0					NON ASB JCB#14-28692 TEM
		MUD JOINT PACKING		32 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1055CP	KITCHEN CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1055A	KITCHEN SLOP SINK	TERRAZZO FLOORING WHITE W/ BLACK		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2x2 CEILING TILE		0					NON ASB JCB#14- 28692 TEM
1055ACP	KITCHEN SLOP SINK CEILING PLENUM	MUD JOINT PACKING		12 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1055B	KITCHEN BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		64 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		15 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		64 SF	0	6	5	O&M	GOOD CONDITION
1055C	KITCHEN REFRIGERATOR	FIRE DOOR INSULATION METAL		2 DOORS	0	7	7	O&M	GOOD CONDITION
1055D	KITCHEN FOOD STORAGE	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		84 SF	0	6	5	O&M	NOT OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1056	BATHROOM #1-MEN'S BATHROOM BY CAFETERIA	CERAMIC FLOOR TILE GROUT & GLUE GREEN		63 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE GREY		435 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE PIN HOLE DOT		0					NON ASB JCB#14- 28692 TEM
1056CP	BATHROOM #1-MEN'S BATHROOM BY CAFETERIA CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1057	BATHROOM #2-WOMEN'S BATHROOM BY CAFETERIA	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		63 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE BEIGE		435 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14- 28692 TEM
1057CP	BATHROOM #2-WOMEN'S BATHROOM BY CAFETERIA CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1058	BATHROOM #3-BOYS BATHROOM BY ROOM 201	CERAMIC FLOOR TILE GROUT & GLUE GREEN		200 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL TILE GROUT & GLUE GREY		440 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X4 CEILING TILE DOTS		0					NON ASB JCB#14- 28692 TEM
		SKYLIGHT PLASTER		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1058CP	BATHROOM #3-BOYS BATHROOM BY ROOM 201 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1059	BATHROOM #4-GIRLS BATHROOM BY ROOM 201	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		200 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL TILE GROUT & GLUE BEIGE		440 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE DOTS		0					NON ASB JCB#14- 28692 TEM
		SKYLIGHT PLASTER		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1059CP	BATHROOM #4-GIRLS BATHROOM BY ROOM 201 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1060	ROOM 201	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		REFRACTORY/KILN/FIRE BRICK		1 UNIT	0	7	7	O&M	GOOD CONDITION
1060CP	ROOM 201 CEILING PLENUM	2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
1060A	ROOM 201 STORAGE/SUPPLY ROOM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		12X12 FLOOR TILE & MASTIC BEIGE/BROWN		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		34 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		120 SF	4 SF	3	4	REPAIR	WATER DAMAGE

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1061	ROOM 200A	CARPET MASTIC		70 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		31 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYPSUM BOARD & JOINT COMPOUND		279 SF	2 SF	3	4	REPAIR	CHIPPED & SCRAPPED
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
1061A	ROOM 200A STORAGE	CEILING PLASTER TEXTURED		70 SF	0	6	5	O&M	GOOD CONDITION
		CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		64 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE BEIGE		288 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
1062	PHYS ED VESTIBULE	CEILING PLASTER TEXTURED		64 SF	0	6	5	O&M	GOOD CONDITION
		CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		24 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		14 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		24 SF	0	6	5	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1062A	PHYS ED VESTIBULE BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		23 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
1062B	PHYS ED OFFICE	CEILING PLASTER SMOOTH		40 SF	0	6	5	O&M	GOOD CONDITION
		9X9 FLOOR TILE & MASTIC BLACK & WHITE		100 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		0					CONFIRMED NON-ACM (ECL JOB #22357)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
1062C	PHYS ED STORAGE	2X4 CEILING TILE PINHOLE		100 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & WATER DAMAGED; CONF ASB ORIGINAL AMP
		12X12 FLOOR TILE & MASTIC BROWN		460 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		93 SF	3 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYPSUM BOARD (AROUND SKYLIGHT)		30 SF	0	6	5	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		460 SF	14 TILES	4	N/A NON FRIABLE	REPAIR	HOLES, CHIPPED, & WATER DAMAGE; CONF ASB ORIGINAL AMP

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1062CCP	PHYS ED STORAGE CEILING PLENUM	MUD JOINT PACKING		6 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1063	ROOM 202	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1063CP	ROOM 202 CEILING PLENUM	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		420 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1064	ROOM 203	COVE BASE & MASTIC BROWN		83 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14- 28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1064CP	ROOM 203 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1065	GYMNASIUM LOBBY	16X16 FLOOR TILE & MASTIC GOLD & RED		0					NEW MATERIAL
		COVE BASE & MASTIC RED		33 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION METAL		4 DOORS	0	7	7	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
1065CP	GYMNASIUM LOBBY CEILING PLENUM	MUD JOINT PACKING		12 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1065A	EAST BREEZEWAY ROOM 119 TO ROOM 202	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		16X16 FLOOR TILE & MASTIC GOLD & RED		0					NEW MATERIAL
		COVE BASE & MASTIC RED		44 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WINDOW GLAZING/CAULKING		260 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	7	7	O&M	GOOD CONDITION
1065ACP	EAST BREEZEWAY ROOM 119 TO ROOM 202 CEILING PLENUM	2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED 2007 REINSPECTION
		MUD JOINT PACKING		0					REMOVED APRIL 2022 (ECL JOB #22150) REMOVED DEC 2021 (ECL JOB #20416)
1065ACP	EAST BREEZEWAY ROOM 119 TO ROOM 202 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1066	GYMNASIUM	WOOD FLOOR TAR/VAPOR BARRIER		3744 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		250 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		168 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	7	7	O&M	GOOD CONDITION
		MUD JOINT PACKING		41 UNITS	0	6	5	O&M	10 UNITS ABATED (ECL JOB #23001); CONF ASB ORIGINAL AMP
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		COVE BASE & MASTIC BLACK		41 LF	15 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
1066A	GYMNASIUM STORAGE 2	CEILING GYPSUM BOARD & COMPOUND		120 SF	1 LF	3	4	REPAIR	CRACKED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		120 SF	1 LF	3	4	REPAIR	CRACKED
1066B	GYMNASIUM STORAGE 1	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		150 SF	0	6	5	O&M	GOOD CONDITION
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		24 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1067	ROOM 200C VESTIBULE	CERAMIC WALL BASE GROUT & GLUE GREY		12 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		24 SF	0	6	5	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1067A	ROOM 200C BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE GREY		23 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
1067B	ROOM 200C PHYS ED OFFICE	CEILING PLASTER SMOOTH		40 SF	0	6	5	O&M	GOOD CONDITION
		9X9 FLOOR TILE & MASTIC BLACK & WHITE		100 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED w/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		34 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING w/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
1067C	ROOM 200C LARGE STORAGE	2X4 CEILING TILE PINHOLE DOTS		100 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	WATER DAMAGE; CONF ASB ORIGINAL AMP
		12X12 FLOOR TILE & MASTIC BROWN		460 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE GREY		80 LF	10 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYPSUM BOARD (AROUND SKYLIGHT)		30 SF	0	6	5	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE DOTS		460 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	HOLES, MISSING, & WATER DAMAGE; CONF ASB ORIGINAL AMP

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1068	ROOM 200D	CARPET MASTIC		70 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		28 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		GYPNUM BOARD & JOINT COMPOUND		252 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING PLASTER TEXTURED		70 SF	0	6	5	O&M	GOOD CONDITION
1068A	ROOM 200D STORAGE	CERAMIC FLOOR TILE GROUT & GLUE GREEN		49 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING & CHIPPED
		CERAMIC WALL TILE GROUT & GLUE GREY		252 SF	10 LF	4	N/A NON FRIABLE	REPAIR	CRACKED w/ MISSING GROUT
		GYPNUM BOARD & JOINT COMPOUND		8 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING PLASTER TEXTURED		49 SF	< 1 LF	3	4	REPAIR	CRACKED
1069	ROOM 204	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED - SOME PATCHED
		COVE BASE & MASTIC BROWN		111 LF	6 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		1X1 WALL TILE & MASTIC FISSURE		160 SF	30 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED; MASTIC CONFIRMED ACM (ECL JOB #22260)
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1069CP	ROOM 204 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1070	ROOM 205	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BROWN		111 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		GYPSUM BOARD & JOINT COMPOUND		215 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		125 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
1070CP	ROOM 205 CEILING PLENUM	MUD JOINT PACKING		8 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1070A	ROOM 205 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYPSUM BOARD & JOINT COMPOUND		15 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1071	CUSTODIAN CLOSET BY ROOM 200E	COVE BASE & MASTIC BLACK		20 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		32 SF	0	6	5	O&M	GOOD CONDITION
		CERAMIC FLOOR TILE GROUT & GLUE TAN WITH BROWN		49 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1072	BATHROOM #5- BATHROOM BY ROOM 200E	CERAMIC WALL TILE GROUT & GLUE BEIGE		190 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
1072CP	BATHROOM #5- BATHROOM BY ROOM 200E	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1073	ROOM 200E	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		198 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		55 LF	6 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		25 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE		0					NON ASB JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1074	ROOM 210	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		111 LF	11 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYP SUM BOARD & JOINT COMPOUND		215 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		125 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
1074CP	ROOM 210 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1074A	ROOM 210 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYP SUM BOARD & JOINT COMPOUND		15 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1075	Room 206	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, & LIFTING W/ MASTIC EXPOSED CONFIRMED ACM (ECL JOB #22357)
		COVE BASE & MASTIC BROWN		111 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYP SUM BOARD & JOINT COMPOUND		215 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		125 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
1075CP	Room 206 CEILING PLENUM	MUD JOINT PACKING		9 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1075A	Room 206 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 LF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYP SUM BOARD & JOINT COMPOUND		15 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1076	ROOM 209	12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYP SUM BOARD & JOINT COMPOUND		215 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		175 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
1076CP	ROOM 209 CEILING PLENUM	MUD JOINT PACKING		6 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1076A	ROOM 209 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYP SUM BOARD & JOINT COMPOUND		15 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1077	Room 207	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		175 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		MUD JOINT PACKING		5 UNITS	0	6	5	O&M	GOOD CONDITION
1077CP	Room 207 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1077A	Room 207 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYPSUM BOARD & JOINT COMPOUND		15 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1078	ROOM 208	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20817
		MUD JOINT PACKING		4 UNITS	0	6	5	O&M	GOOD CONDITION
1078CP	ROOM 208 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
1078A	ROOM 208 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 LF	4 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		GYP SUM BOARD & JOINT COMPOUND		15 SF	0	6	5	O&M	NO ACCESS-STORAGE MATERIALS BLOCKING DOOR
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	NO ACCESS-STORAGE MATERIALS BLOCKING DOOR

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1079	ROOM 211	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		792 SF	50 TILES	4	N/A NON FRIABLE	REPAIR	LIMITED VISIBILITY (PREVIOUSLY CRACKED, CHIPPED, & LIFTING W/ MASTIC EXPOSED)
		COVE BASE & MASTIC BROWN		113 LF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	NO ACCESS-STORAGE MATERIALS BLOCKING DOOR
		WINDOW GLAZING/CAULKING		68 LF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	NO ACCESS-STORAGE MATERIALS BLOCKING DOOR
		FIRE DOOR INSULATION METAL		3 DOORS	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
1079CP	ROOM 211 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1079A	ROOM 211 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		4 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT


Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1080	STORAGE/ROOM 212	12X12 FLOOR TILE & MASTIC BEIGE/BROWN		792 SF	14 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, & LIFTING-LIMITED VISIBILITY
		COVE BASE & MASTIC BROWN		113 LF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	LIMITED VISUAL ACCESS
		WINDOW GLAZING/CAULKING		68 LF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	LIMITED VISUAL ACCESS
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	7	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	7	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
1080CP	STORAGE/ROOM 212 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1080A	STORAGE/ROOM 212 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION-LIMITED VISIBILITY
		WINDOW GLAZING/CAULKING		4 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	7	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS NOT SUSPECT
1081	STORAGE 1	FIRE DOOR INSULATION METAL		1 DOOR	0	7	7	O&M	GOOD CONDITION


SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1082	CORRIDOR STORAGE 1 - CUSTODIAL AREA	CEILING TILE		0					ABATED 2007 REINSPECTION
		TERRAZZO FLOORING TAN W/ BROWN		0					CONFIRMED NON-ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		0					CONFIRMED NON-ACM (ECL JOB #22357)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		WALL/CHALK-BOARD MASTIC		450 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	NO ACCESS-STORAGE MATERIALS BLOCKING
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		8 DOORS	0	7	7	O&M	GOOD CONDITION
1082CP	CORRIDOR STORAGE 1 - CUSTODIAL AREA CEILING PLENUM	2x2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
		CEILING PLASTER SMOOTH		160 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		41 UNITS	NOT QUANTIFIED	3	1	REPAIR	CONF ASB ENVIROSCIENCE#17188; < 3 LF ABATED BRANCH#18-22423-01
3000	EXTERIOR STORAGE	TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22162)
		TECTUM DECKING		0					CONFIRMED NON-ACM (ECL JOB #22162)

Appendix C


DRAWINGS

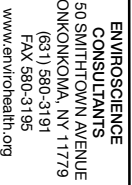

PROJECT	SIX MONTH AHERA SURVEILLANCE CHESTNUT HILL ELEMENTARY SCHOOL FLOOR PLAN
CLIENT	HALE HOLLOW HILLS CENTRAL SCHOOL DISTRICT

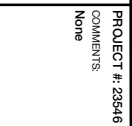

NOT TO SCALE
Date: 07/10/2023
By: Robert Cardona
DRAWING 1 of 1

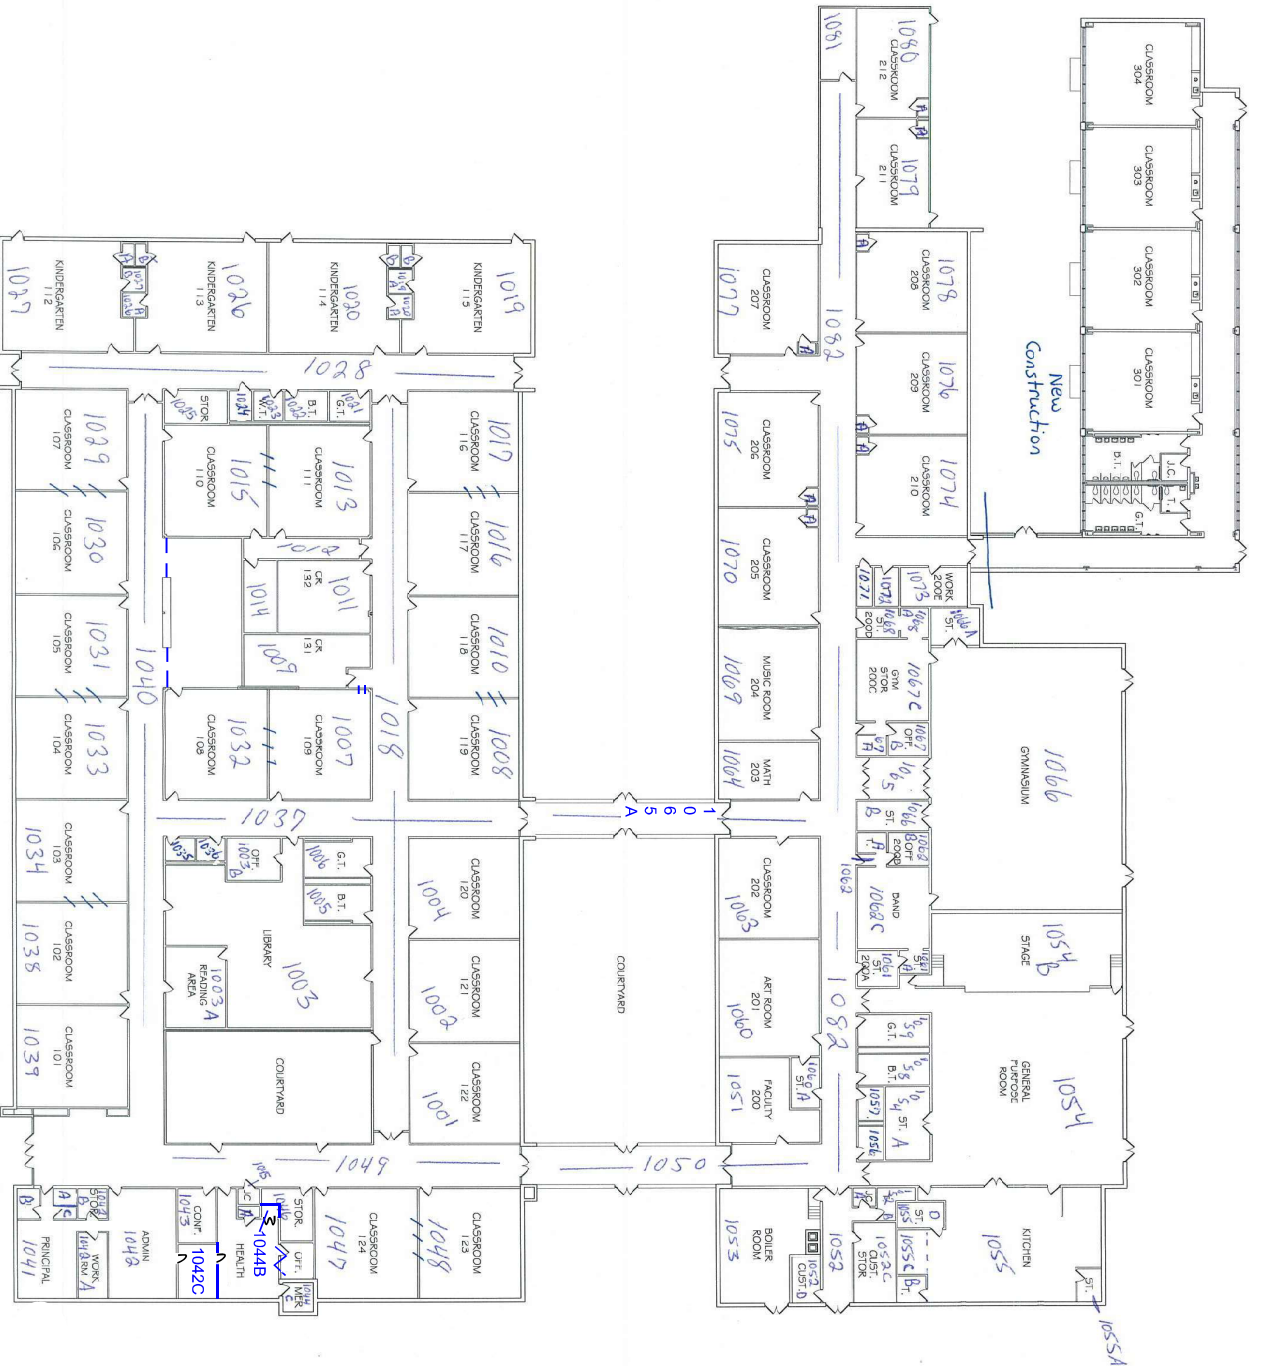

Appendix D

CERTIFICATIONS

WE ARE YOUR DOL

 **Department of Labor**

DIVISION OF SAFETY & HEALTH LICENSE AND CERTIFICATE UNIT, STATE OFFICE CAMPUS, BLDG. 12, ALBANY, NY 12226

ASBESTOS HANDLING LICENSE

Enviroscience Consultants, LLC
2150 Smithtown Avenue, Ronkonkoma, NY, 11779

License Number: 28733
License Class: RESTRICTED
Date of Issue: 11/04/2022
Expiration Date: 11/30/2023
Duly Authorized Representative: Bartley Gallagher

This license has been issued in accordance with applicable provisions of Article 30 of the Labor Law of New York State and of the New York State Codes, Rules and Regulations (12 NYCRR Part 56). It is subject to suspension or revocation for a (1) serious violation of state, federal or local laws with regard to the conduct of an asbestos project, or (2) demonstrated lack of responsibility in the conduct of any job involving asbestos or asbestos material.

This license is valid only for the contractor named above and this license or a photocopy must be prominently displayed at the asbestos project worksite. This license verifies that all persons employed by the licensee on an asbestos project in New York State have been issued an Asbestos Certificate, appropriate for the type of work they perform, by the New York State Department of Labor.


Amy Phillips, Director
For the Commissioner of Labor

EXCELSIOR

Appendix E

NOTICE TO SHORT TERM WORKERS

NOTICE TO SHORT TERM WORKERS

All workers entering Chestnut Hill Elementary School and/or Garage and/or Portable must sign in, thereby acknowledging the presence and locations of asbestos containing building materials in the building. No work will be allowed in the areas listed without prior approval from the AHERA Designated Person for the Half Hollow Hills School District.

Sign in sheets will be picked up at the time of the Six Month AHERA Surveillance and will be placed in the buildings Asbestos Management Plan.

Asbestos containing materials and their locations at Chestnut Hill Elementary School and Garage and Portable are listed in the AHERA Management Plan, which is available for review, upon request.

[illegible]

Appendix F

BULK SAMPLE RESULTS

ELAP # 11681; NVLAP Lab Code 200531-0

ASBESTOS BULK SAMPLE RESULTS

CLIENT: PROJECT NAME: JOB #: PAGE #:	Half Hollow Hills CSD 525 Half Hollow Road, Dix Hills, NY 11746 AHERA Six-month Surveillance - May 2023 23546 1 of 1	SAMPLE DATE: DATE RECEIVED: AREA: SAMPLER: CUSTODY #:	6/13/2023 6/14/2023 Chestnut Hill Elementary School - Terrazzo Pamela Chadderton 35335
--	--	--	--

Lab ID	Sample #	Description	Color	Location	Total Asbestos Result	% Asbestos-type	% Non-asbestos Fibers-type	% Matrix-type
99600	TF1	Terrazzo Floor	White w/ Black	Kitchen Slop Sink (AHERA #1055A)	None Detected	2.0% cellulose	98.0% cement	
99601	TF2	Terrazzo Floor	White w/ Black	Kitchen (AHERA #1055)	None Detected	2.0% cellulose	98.0% cement	
99602	TF3	Terrazzo Floor	Tan w/ Brown	Corridor to Custodial Office (AHERA #1082)	None Detected	2.0% cellulose	98.0% cement	
99603	TF4	Terrazzo Floor	Tan w/ Brown	Corridor Copy Room to Room 120 (AHERA #1037)	None Detected	2.0% cellulose	98.0% cement	

Method: EPA 600/M4-82/20, 600/R-93/116, NYS DOH ELAP Item 198.1, 198.4, 198.6, 198.8.

ACM: Asbestos Containing Materials contain more than 1%.

None Detected - No asbestos found in samples using polarized light microscopy (PLM). Trace - Asbestos found is 1% or less, not considered ACM.

None Detected by TEM - No asbestos found in samples using transmission electron microscopy (TEM) and polarized light microscopy (PLM) was found to be negative.

Negative by Weight - After matrix reduction, the remainder is less than 1% and, therefore, cannot fulfill the definition of asbestos containing material.

Inconclusive - No asbestos found in non-friable organically bound samples using polarized light microscopy (PLM).

Method ELAP 198.6 does not remove vermiculite and may underestimate the level of asbestos present in a sample containing greater than 10% vermiculite. Samples of Surface Material that contain Vermiculite are analyzed by ELAP 198.8 for conclusive result.

This report may not be reproduced without the express permission of Enviroscience Consultants, LLC. This report cannot be used to claim endorsement of products by NVLAP or any agency of the U.S. Government. Test results only reflect conditions at the time the samples were taken.

ANALYZED BY: <u><i>John A. Sullivan</i></u>	PLM DATE: <u>6/15/2023</u>	ANALYZED BY: _____
DIRECTOR: <u><i>Edward A. Sullivan</i></u>	DATE: <u>6/19/2023</u>	REVISION #: <u>0</u>
		REVISION DATE: <u>6/19/2023</u>