

Half Hollow Hills CSD
Six Month AHERA Surveillance
Otsego Elementary School
May 2023



2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project #23546

Six Month AHERA Surveillance

Performed at

Otsego Elementary School
55 Otsego Street
Dix Hills, NY 11746

for

Half Hollow Hills CSD
Administration Building
525 Half Hollow Road
Dix Hills, NY 11746

May 2023

Prepared by:

Enviroscience Consultants, LLC
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #23546

Inspector & Management
Planner:


Bartley Gallagher

NYSDOL #92-13892

Inspectors: 
Alexis Bruno

NYSDOL #21-08575


Pamela Chadderton

NYSDOL #15-10408

Six Month AHERA Surveillance

Table of Contents

- I. Summary**
- II. Inspection and Recommendations**
- III. Bulk Sampling Protocol**
- IV. Hazard Rank Determination**
- V. AHERA Reassessment Category**

Appendix A - Inventory of Damaged Asbestos Containing Materials

Appendix B - Inventory of Asbestos Containing Materials

Appendix C - Drawings - Functional Space Number Floor Plans

Appendix D - Certifications

Appendix E - Notice to Short Term Workers

Appendix F – Bulk Sample Results

I. Summary

A six month AHERA surveillance for the Otsego Elementary School of the Half Hollow Hills CSD was performed by Ms. Alexis Bruno and Mrs. Pamela Chadderton of Enviroscience Consultants, LLC on June 2, 2023.

The six month surveillance was performed in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Ms. Bruno and Mrs. Chadderton are certified AHERA Inspectors.

Ms. Bruno and Mrs. Chadderton performed the on-site investigation, which included examining existing ACBM, evaluating the condition of the ACBM, and determining if originally non-friable materials have become friable. The physical condition of most of the ACBM found in this building did not change.

After studying the inspection reports, Mr. Bartley M. Gallagher, a certified EPA/AHERA Inspector and Management Planner, developed the recommendations for response actions depending on his evaluation of the hazard that each material may cause.

An Inventory of Asbestos Containing Materials by location, including the AHERA Functional Space identification number is in Appendix B. This inventory includes the material, quantity, amount damaged, the hazard level, the AHERA Reassessment category, and recommended response actions. A remarks column includes sampling and abatement action and other pertinent information.

Floor plans correlating the AHERA Functional Space ID number with the current common location names are in Appendix C.

II. Inspection and Recommendations

The inspector entered all accessible spaces to inspect and physically assess the condition and friability of all previously known or assumed ACBM. The inspector noted any change in condition of remaining materials, materials that have been abated since the last reinspection, and any materials that were either not identified, or may have been improperly classified.

Unless otherwise stated, a recommendation for removal is a suggestion that the materials be removed as soon as the school's budget will allow.

During this inspection there was damage noted, repairs should be made. Please reference your Summary of Damaged Asbestos Containing Materials found in Appendix A.

Since the last surveillance, the following asbestos abatement activities were performed:

In June 2023, bulk samples were collected of terrazzo floor at various locations throughout the Building Interior. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #35260 for detailed sample location information and results.

In April 2023, approximately seven (7) linear feet of asbestos containing pipe fitting insulation were removed from the Corridor at the Nurse's Bathroom (AHERA space #1056). Please reference Enviroscience Consultants, LLC job #23422.

In December 2022, asbestos containing pipe fitting insulation was removed from the Stage (AHERA space #1055A). Please reference Enviroscience Consultants, LLC job #23003.

History:

In September 2022, bulk samples were collected of the vinyl cove base, vinyl cove base mastic, and cork board mastic in Room 101 (AHERA space #1073), and Room 211 (AHERA space #1024). Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #34032 for detailed sample location information and results.

In April 2022, bulk samples were collected of ceiling plaster, drywall, joint compound, concrete block, and concrete block mortar at various locations throughout the School Building. Results confirmed the joint compound in the Closet by Boy's Bathroom (AHERA space #1079) to be asbestos containing material; all the other materials sampled were confirmed to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #32595 for detailed sample location information and results.

In March 2022, bulk samples were collected of the pipe fitting insulation in the Boiler Room. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #32499 for detailed sample location information and results.

In February 2022, asbestos containing floor tile and floor tile mastic were removed from the Nurse Office (AHERA space #1054) and the Nurse Storage (AHERA space #1054B). Please reference Enviroscience Consultants job #21959.

In December 2021, bulk samples were collected of the 12"x12" floor tile, floor tile mastic, vinyl cove base, and vinyl cove base mastic in the Nurse Office (AHERA space #1054). Results confirmed the 12"x12" floor tile and floor tile mastic to be asbestos containing materials; all the other materials sampled were confirmed to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #31957 for detailed sample location information and results.

In November 2021, Enviroscience Consultants was retained by the Half Hollow Hills Central School District to perform the surveillance inspections and three year reinspections in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Any information pertaining to the assessment and changes in condition of ACBM prior to November 2021 must be obtained from the records maintained by the Half Hollow Hills Central School District.

Any damaged material that is assumed to be asbestos containing should be sampled to confirm that it is identified as ACBM before initiating repair procedures.

The inspector did not access any flooring materials located under carpeting or new tiles because obtaining access would damage the carpet or new tiles. Prior to disturbing any carpets or removing new floor tiles, the school should ascertain whether floor tiles are located beneath them. Repair or replace damaged floor tiles as noted. We have prepared an inventory of asbestos containing materials for the building. These pages list the current damage category, changes in physical condition, current priority levels, changes in response actions, and bulk sampling and abatement information (see Appendix B).

All materials are currently classified as non-friable in their present condition, except for damaged thermal insulation materials, gypsum board, joint compound, and wall plaster.

III. Bulk Sampling Protocol

Thermal System Insulation - Three (3) samples are randomly collected for each homogeneous material of Thermal System Insulation (TSI). AHERA states that for each area of patched TSI at least one (1) sample be collected.

Surfacing Materials - a minimum of three (3), five (5) or seven (7) samples based upon the amount of suspect material present.

Miscellaneous Materials - require a minimum of two (2) samples.

New York State Revisions to Analytical Methods

Over the years, the New York State Department of Health has made several revisions to testing requirements that affect suspect asbestos materials in school buildings. These changes have resulted in the requirement to re-sample and analyze certain materials to comply with the revised analytical methods:

Surfacing Materials - In May 2016, the New York State Department of Health (NYSDOH) finalized testing requirements and approved a new analytical method for analysis of surfacing materials that contain vermiculite. Surfacing materials that could contain vermiculite include spray-on fireproofing, wall plaster, and ceiling plaster. Unfortunately, the previous analysis method for fireproofing and plasters did not specifically require that the vermiculite percentage be reported. The District must now consider any spray or troweled fireproofing or plaster materials to be presumed asbestos containing materials (PACM) until they are re-tested to conform to the new requirements. As a result, we have added any plaster previously classified as non-asbestos to the Inventory of Asbestos Containing Materials. Re-testing of any fireproofing or plaster materials will be noted in the narrative and will be shown in the Inventory.

Ceiling Tile - In August 2012, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in ceiling tiles that contain cellulose. Any ceiling tiles that have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Any re-testing of ceiling tiles will be noted in the narrative and will be shown in the Inventory. The District should keep records for any new non-asbestos ceiling tiles that are installed, including the location, brand, model number, date of manufacture, and date of installation.

Floor Tile and Other NOB Materials - In 1992, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in non-friable organically bound (NOB) materials such as floor tiles and roofing materials. As such, any floor tiles and mastic which have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Re-testing of any floor tile, mastic or other NOB materials will be noted in the narrative and will be shown in the Inventory.

During this surveillance, bulk samples were collected of terrazzo floor at various locations throughout the Building Interior. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #35260 in Appendix F for detailed sample location information and results.

IV. Hazard Rank Determination

For each homogeneous material, a response action priority level is determined depending on its physical condition, location, and potential for future damage. Materials were classified into seven categories, based upon the type, condition, and potential for damage of the ACBM. The categories are as follows:

Hazard Rank	ACBM Condition	ACBM Disturbance Potential
1	Significantly Damaged	Any Potential for Damage
2	Damaged	Potential for Significant Damage
3	Damaged	Potential for Damage
4	Damaged	Low Potential for Damage
5	Good	Potential for Significant Damage
6	Good	Potential for Damage
7	Good	Low Potential for Damage

The district shall select and implement in a timely manner the appropriate response actions consistent with the assessment category. The response actions selected shall be sufficient to protect human health and the environment. The district may then select, from the response actions which protect human health and the environment, that action which is the least burdensome method. Nothing in this section shall be construed to prohibit removal of ACBM from a school building at any time, should removal be the preferred response action of the district.

If damaged or significantly damaged thermal system insulation ACM is present in a building, the district shall:

- (1) At least repair the damaged area.
- (2) Remove the damaged material if it is not feasible, due to technological factors, to repair the damage.
- (3) Maintain all thermal system insulation ACM and its covering in an intact state and undamaged condition.

If damaged friable surfacing ACM or damaged friable miscellaneous ACM is present in a building, the district shall select from among the following response actions: encapsulation, enclosure, removal, or repair of the damaged material.

In selecting the response action from among those which meet the definitional standards in §763.83, the district shall determine which of these response actions protects human health and the environment. For purposes of determining which of these response actions are the least burdensome, the district may then consider local circumstances, including occupancy and use patterns within the school building, and its economic concerns, including short and long-term costs.

V. AHERA Reassessment Category

The Management Planner is also required to classify each friable and thermal system insulation (TSI) ACBM and suspected ACBM assumed to be ACM in the school building into one of the following AHERA 1 through 7 reassessment categories based on damage, potential for damage, and material category:

- (1) Damaged or significantly damaged thermal system insulation ACM.
- (2) Damaged friable surfacing ACM.

- (3) Significantly damaged friable surfacing ACM.
 - (4) Damaged or significantly damaged friable miscellaneous ACM.
 - (5) ACBM with potential for damage.
 - (6) ACBM with potential for significant damage.
 - (7) Any remaining friable ACBM or friable suspected ACBM.
- N/A Not Applicable

Appendix A

INVENTORY OF DAMAGED ASBESTOS CONTAINING MATERIALS

Summary of Damaged Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1001	ROOM 301 LIBRARY	12X12 FLOOR TILE & MASTIC WHITE WITH BEIGE		780 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	HOLE
1002	OFFICE ADJACENT 302	12X12 FLOOR TILE & MASTIC BLUE		180 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED
1003	ROOM 302	WALL/CHALK-BOARD MASTIC		96 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED, PAINTED OVER
1005	ROOM 304	12X12 FLOOR TILE & MASTIC WHITE		780 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED w/ MASTIC EXPOSED
1005CP	ROOM 304 CEILING PLENUM	GYPSUM BOARD		80 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
1006	ROOM 305	12X12 FLOOR TILE & MASTIC BEIGE WITH WHITE		780 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED w/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		90 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1007	COMMON AREA LIBRARY	12X12 FLOOR TILE & MASTIC WHITE WITH BEIGE		1360 SF	9 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED w/ MASTIC EXPOSED
1008	FACULTY MEN BATHROOM	CERAMIC WALL TILE GROUT & GLUE WHITE		87 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED w/ GLUE EXPOSED
1009	KITCHENETTE	12X12 FLOOR TILE & MASTIC BLACK		180 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, & LOOSE w/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		8 LF	16 LF	4	N/A NON FRIABLE	REPAIR	MISSING w/ MASTIC EXPOSED
1010	300 WING BOY'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BLUE		144 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL TILE GROUT & GLUE WHITE		432 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
1011	ROOM 307	12X12 FLOOR TILE & MASTIC WHITE		780 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED & BULGING
1011CP	ROOM 307 CEILING PLENUM	GYPSUM BOARD		45 SF	NOT QUANTIFIED	3	4	REPAIR	CHIPPED & CRUMBLING
1012	CUSTODIAL CLOSET	CERAMIC FLOOR TILE GROUT & GLUE BLUE		84 SF	1 SF	4	N/A NON FRIABLE	REPAIR	MISSING w/ GLUE EXPOSED
		CERAMIC WALL BASE GROUT & GLUE WHITE		37 LF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED

Summary of Damaged Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1013	ROOM 308	12X12 FLOOR TILE & MASTIC WHITE		786 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		60 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1014	ROOM 309	12X12 FLOOR TILE & MASTIC WHITE		780 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED & HOLE
1014CP	ROOM 309 CEILING PLENUM	GYPSUM BOARD		20 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
1015	GIRL'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		120 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
1016	WOMEN'S FACULTY BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		48 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING & CHIPPED W/ GLUE EXPOSED
1017	CORRIDOR MEN TO WOMEN BATHROOMS	12X12 FLOOR TILE & MASTIC WHITE WITH BEIGE		432 SF	21 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
1018	CORRIDOR 300 WING GIRLS ROOM TO MUSIC ROOM	LINOLEUM FLOORING		200 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		52 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1020	MUSIC ROOM	9X9 FLOOR TILE & MASTIC TAN		437 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	EXPOSED 9X9 TILE- UNDER 12X12
		COVE BASE & MASTIC BROWN		81 LF	6 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		810 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
1021	ROOM 206	COVE BASE & MASTIC BROWN		89 LF	2 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		9X9 FLOOR TILE & MASTIC TAN		90 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1029A	ART ROOM STORAGE	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		105 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	NO ACCESS; PREVIOUSLY CRACKED-LIMITED VISIBILITY
1030	COMPUTER STORAGE ROOM	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		636 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING 9X9 TILE CONFIRMED PRESENT UNDERNEATH
1032	MATH ROOM	COVE BASE & MASTIC BLACK		140 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1032A	MATH ROOM EXIT VESTIBULE	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		45 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	LOOSE, CRACKED & CHIPPED W/ MASTIC EXPOSED

Summary of Damaged Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1032A1	MATH ROOM BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE YELLOW		90 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		CERAMIC WALL TILE GROUT & GLUE YELLOW		405 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
1033	BOY'S BATHROOM NEAR GYM	CERAMIC WALL TILE GROUT & GLUE LIGHT BLUE		596 SF	3 LF	4	N/A NON FRIABLE	REPAIR	MISSING GROUT
1035	GIRL'S BATHROOM NEAR GYM	CERAMIC FLOOR TILE GROUT & GLUE YELLOW		200 SF	1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING W/ GLUE EXPOSED
		CERAMIC WALL TILE GROUT & GLUE YELLOW		596 SF	2 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
1037	GYMNASIUM	TECTUM DECKING		3744 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	HOLES
1037A	GYM CLOSET 1	CEILING GYPSUM BOARD & COMPOUND		200 SF	2 SF	3	4	REPAIR	WATER DAMAGE-LIMITED VISIBILITY
1037B	GYM CLOSET 2	CEILING GYPSUM BOARD & COMPOUND		234 SF	7 SF	3	4	REPAIR	WATER DAMAGE & PAPER PEELING
1038	ROOM 201 MUSIC ROOM	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	21 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1039	ROOM 200A	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		540 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		48 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED. PAINTED OVER
1040CP	LAMINATING ROOM/COPY ROOM VESTIBULE CEILING PLENUM	MUD JOINT PACKING		10 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1040A1	OFFICE ROOM BATHROOM	CERAMIC WALL TILE GROUT & GLUE WHITE		184 SF	1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED GROUT
1040B1	COPY ROOM PAPER STORAGE	CERAMIC WALL TILE GROUT & GLUE BLUE		144 SF	2 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
		GYPSUM BOARD & COMPOUND		256 SF	1 SF	3	4	REPAIR	CHIPPED W/ JOINT COMPOUND MISSING
1041	STORAGE (OLD BOY'S LOCKER ROOM)	CERAMIC FLOOR TILE GROUT & GLUE LIGHT BLUE		100 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED

Summary of Damaged Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1042	RECEIVING ROOM	12X12 FLOOR TILE & MASTIC TAN/WHITE		585 SF	32 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		98 LF	1 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED & DELAMINATING W/ MASTIC EXPOSED
1043	BOILER ROOM	DUCT INSULATION		236 SF	6 SF	1	4	REPAIR	PEELING, CHIPPING, W/ VISIBLE DEBRIS. TEST BEFORE DISTURBING
		HOT WATER TANK INSULATION		275 SF	10 SF	1	4	REPAIR	PEELING, CHIPPING, W/ VISIBLE DEBRIS. TEST BEFORE DISTURBING
1045	WOMENS FACULTY BATHROOM NEAR CAFÉ	CERAMIC FLOOR TILE GROUT & GLUE PINK		84 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1046	MENS FACULTY BATHROOM NEAR CAFÉ	CERAMIC FLOOR TILE GROUT & GLUE LIGHT GREEN		72 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & HOLES
1047	KITCHEN	CERAMIC FLOOR TILE GROUT & GLUE TAN		1330 SF	2 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		CERAMIC WALL BASE GROUT & GLUE TAN		184 SF	1 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING
1047A1	KITCHEN BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		46 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1047B	KITCHEN FOOD STORAGE	2X4 CEILING TILE SMOOTH		128 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	WATER STAINED
1047BCP	KITCHEN FOOD STORAGE CEILING PLENUM	MUD JOINT PACKING		18 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1047C	KITCHEN WASH BIN ROOM VESTIBULE	CERAMIC FLOOR TILE GROUT & GLUE TAN		54 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL BASE GROUT & GLUE TAN		19 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
1047C1	KITCHEN WASH BIN ROOM	CERAMIC WALL BASE GROUT & GLUE TAN		27 LF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1048	FACULTY ROOM	9X9 FLOOR TILE & MASTIC		576 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	9X9 WHITE EXPOSED UNDER 12X12 FLOOR TILE
1049CP	CORRIDOR CUSTODIANS OFFICE - STORAGE (1055A) CEILING PLENUM	MUD JOINT PACKING		18 UNITS	NOT QUANTIFIED	3	1	REPAIR	DAMAGED

Summary of Damaged Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1054A	NURSE BATHROOM	CERAMIC WALL TILE GROUT & GLUE WHITE		153 SF	6 LF	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING
1055	CAFETERIA	COVE BASE & MASTIC BLACK		149 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
1055A	STAGE	WALL PLASTER		40 SF	<1 SF	3	4	REPAIR	CHIPPED
1058CP	CORRIDOR ROOM 200 - READING ROOM CEILING PLENUM	MUD JOINT PACKING		34 UNITS	NOT QUANTIFIED	3	1	REPAIR	DAMAGED WITH DEBRIS
1059	READING ROOM	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		286 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
1060	STORAGE NEAR ROOM 108	9X9 TAN FLOOR TILE & MASTIC		96 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1061	ROOM 108	COVE BASE & MASTIC BLACK		121 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
1063A	ROOM 106 BATHROOM	CERAMIC WALL TILE GROUT & GLUE PINK		135 SF	<1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
1064	ROOM 105	COVE BASE & MASTIC BLACK		89 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1065	STORAGE NEAR ROOM 104	CEILING DRYWALL & JOINT COMPOUND		216 SF	2 SF	3	4	REPAIR	CRACKED, CHIPPED, & WATER DAMAGED; CONF ASB JCB#17-36668
1068	ROOM 104	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		1000 SF	26 TILES	4	N/A NON FRIABLE	REPAIR	HAIRLINE CRACKS & CUPPING THROUGHOUT
1068B	ROOM 104 BATHROOM	CERAMIC WALL TILE GROUT & GLUE PINK		136 SF	3 LF	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
1071	ROOM 103	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		694 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
1071B	ROOM 103 STORAGE	9X9 FLOOR TILE & MASTIC TAN		50 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	LIFTING & CHIPPED W/ MASTIC EXPOSED
1072	ROOM 102	COVE BASE & MASTIC BLACK		100 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
1072A	ROOM 102 BATHROOM	CERAMIC WALL TILE GROUT & GLUE PINK		136 SF	<1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
1072B	ROOM 102 STORAGE	COVE BASE & MASTIC BLACK		30 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CEILING GYPSUM BOARD & COMPOUND		50 SF	3 SF	3	4	REPAIR	WATER DAMAGED

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1073A	ROOM 101 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE WHITE WITH MULTI COLORS		25 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1075CP	CORRIDOR-ROOM 103A TO STORAGE BY 109 CEILING PLENUM	WALL PLASTER		40 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
		MUD JOINT PACKING		45 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1076	ROOM 109	COVE BASE & MASTIC BLACK		89 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
1077	GIRLS ROOM BY ROOM 109	CERAMIC FLOOR TILE GROUT & GLUE YELLOW		317 SF	1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
		CERAMIC WALL TILE GROUT & GLUE YELLOW		689 SF	14 LF	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, & MISSING
1078	FACULTY BATHROOM BY ROOM 109	CERAMIC WALL TILE GROUT & GLUE WHITE		264 SF	<1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
1080	BOY'S BATHROOM NEAR 110	CERAMIC FLOOR TILE GROUT & GLUE LIGHT BLUE		517 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL TILE GROUT & GLUE BLUE		689 SF	8 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
1081	ROOM 110	9X9 FLOOR TILE & MASTIC		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	EXPOSED UNDER 12X12 WHITE FLOOR TILE
		COVE BASE & MASTIC BLACK		89 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
1082	ROOM 111	COVE BASE & MASTIC BLACK		89 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED

Appendix B

INVENTORY OF ASBESTOS CONTAINING MATERIALS

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1001	ROOM 301 LIBRARY	12X12 FLOOR TILE & MASTIC WHITE WITH BEIGE		780 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	HOLE
		COVE BASE & MASTIC BROWN		90 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		64 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20818
		NONE OBSERVED							NONE OBSERVED
		12X12 FLOOR TILE & MASTIC BLUE		180 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED
1002	OFFICE ADJACENT 302	COVE BASE & MASTIC BLACK		53 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WINDOW GLAZING/CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20818
1002CP	OFFICE ADJACENT 302 CEILING PLENUM	ROOF TAR		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1003	ROOM 302	12X12 FLOOR TILE & MASTIC WHITE WITH BEIGE		780 SF	0	7	N/A NON FRIABLE	O&M	CARPET OBSERVED
		COVE BASE & MASTIC BROWN		0					NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		96 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED, PAINTED OVER
		WINDOW GLAZING/CAULKING		64 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20818
1003CP	ROOM 302 CEILING PLENUM	MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
1004	ROOM 303	12X12 FLOOR TILE & MASTIC WHITE WITH BEIGE		780 SF	0	7	N/A NON FRIABLE	O&M	CARPET OBSERVED
		COVE BASE & MASTIC BROWN		60 LF	0	7	N/A NON FRIABLE	O&M	NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		96 SF	0	7	N/A NON FRIABLE	O&M	MASTIC EXPOSED, PAINTED OVER
		WINDOW GLAZING/CAULKING		64 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20818

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1004CP	Room 303 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1005	Room 304	12X12 FLOOR TILE & MASTIC WHITE		780 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		70 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		64 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6		O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20818
1005CP	Room 304 CEILING PLENUM	GYPSUM BOARD		80 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
1006	Room 305	12X12 FLOOR TILE & MASTIC BEIGE WITH WHITE		780 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		90 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		64 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20818
1006CP	Room 305 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1007	COMMON AREA LIBRARY	12X12 FLOOR TILE & MASTIC WHITE WITH BEIGE		1360 SF	9 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		65 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20818
1007CP	COMMON AREA LIBRARY CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1008	FACULTY MEN BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BLUE		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		87 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ GLUE EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		MIRROR MASTIC		3 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
1008CP	FACULTY MEN BATHROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1009	KITCHENETTE	12X12 FLOOR TILE & MASTIC BLACK		180 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, & LOOSE W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		8 LF	16 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (EC1 JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		INSULATION BOARD BEHIND STOVE		0					REMOVED
		METAL SINK UNDERCOATING WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20818
		NONE OBSERVED							NONE OBSERVED
		CERAMIC FLOOR TILE GROUT & GLUE BLUE		144 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1010	300 WING BOY'S BATHROOM	CERAMIC WALL TILE GROUT & GLUE WHITE		432 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		MIRROR MASTIC		6 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYPSUM BOARD (AROUND SKYLIGHT)		40 SF	0	6	5	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
1010CP	300 WING BOY'S BATHROOM CEILING PLENUM	ROOF TAR		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1011	ROOM 307	12X12 FLOOR TILE & MASTIC WHITE		780 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED & BULGING
		COVE BASE & MASTIC BROWN		90 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		64 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20818
1011CP	ROOM 307 CEILING PLENUM	GYPSUM BOARD		45 SF	NOT QUANTIFIED	3	4	REPAIR	CHIPPED & CRUMBLING
1012	CUSTODIAL CLOSET	CERAMIC FLOOR TILE GROUT & GLUE BLUE		84 SF	1 SF	4	N/A NON FRIABLE	REPAIR	MISSING W/ GLUE EXPOSED
		CERAMIC WALL BASE GROUT & GLUE WHITE		37 LF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14-28692 TEM
1012CP	CUSTODIAL CLOSET CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1013	ROOM 308	12X12 FLOOR TILE & MASTIC WHITE		786 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		60 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		64 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20818
		NONE OBSERVED							NONE OBSERVED
		1013CP ROOM 308 CEILING PLENUM							
1014	ROOM 309	12X12 FLOOR TILE & MASTIC WHITE		780 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED & HOLE
		COVE BASE & MASTIC BROWN		90 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20818
		GYPSUM BOARD		20 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
		1014CP ROOM 309 CEILING PLENUM							

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1015	GIRLS BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		120 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL TILE GROUT & GLUE WHITE		218 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		6 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYP SUM BOARD (AROUND SKYLIGHT)		40 SF	0	6	5	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
1015CP	GIRLS BATHROOM CEILING PLENUM	MUD JOINT PACKING		23 UNITS	0	6	5	O&M	GOOD CONDITION
1016	WOMEN'S FACULTY BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		48 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING & CHIPPED W/ GLUE EXPOSED
		CERAMIC WALL TILE GROUT & GLUE WHITE		87 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (EC1 JOB #22163)
		MIRROR MASTIC		3 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14-28692 TEM
1016CP	WOMEN'S FACULTY BATHROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1017	CORRIDOR MEN TO WOMEN BATHROOMS	12X12 FLOOR TILE & MASTIC WHITE WITH BEIGE		432 SF	21 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		54 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22163)
		MIRROR MASTIC		220 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					ABATED 2004 REINSPECTION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
1017CP	CORRIDOR MEN TO WOMEN BATHROOMS CEILING PLENUM	MUD JOINT PACKING		22 UNITS	0	6	5	O&M	GOOD CONDITION
1018	CORRIDOR 300 WING GIRLS ROOM TO MUSIC ROOM	LINOLEUM FLOORING		200 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		COVE BASE & MASTIC BLACK		52 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22163)
		GYPSUM BOARD & COMPOUND		87 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		64 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL		0					NOT SUSPECT
		FIRE DOOR INSULATION METAL		6 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20818
1018CP	CORRIDOR 300 WING GIRLS ROOM TO MUSIC ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1019	SERVER CLOSET	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WINDOW GLAZING/CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ASSESS
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
1019CP	SERVER CLOSET CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1020	MUSIC ROOM	9X9 FLOOR TILE & MASTIC TAN		437 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	EXPOSED 9X9 TILE- UNDER 12X12
		COVE BASE & MASTIC BROWN		81 LF	6 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		76 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED		0					NON ASB JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
1020CP	MUSIC ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1021	Room 206	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		810 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		COVE BASE & MASTIC BROWN		89 LF	2 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1021CP	Room 206 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1022	Room 208	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	12X12 BLUE OBSERVED; GOOD CONDITION
		COVE BASE & MASTIC BLACK		89 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (EC1 JOB #22163)
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
		NONE OBSERVED							NONE OBSERVED
		9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	12X12 BLUE OBSERVED; GOOD CONDITION
1022CP	Room 208 CEILING PLENUM	COVE BASE & MASTIC BLACK		89 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1023	Room 210	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (EC1 JOB #22163)
		WALL/CHALK-BOARD MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
1023CP	Room 210 CEILING PLENUM								

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1024	ROOM 211	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 BLUE FLOOR TILE
		COVE BASE & MASTIC BLACK		0					NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	12X12 WHITE FLOOR TILE OBSERVED
1025	ROOM 209	COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
1025CP	ROOM 209 CEILING PLENUM	NONE OBSERVED							

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1026	ROOM 207	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 BLUE FLOOR TILE
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		ROOM 207 CEILING PLENUM		N/A	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ASSESS
		9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	12X12 WHITE FLOOR TILE OBSERVED
1027	ROOM 205	COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		ROOM 205 CEILING PLENUM		N/A	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ASSESS
		9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	12X12 WHITE FLOOR TILE OBSERVED
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1027CP	ROOM 205 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1028	ROOM 204	12X12 FLOOR TILE & MASTIC WHITE/BLUE		0					ABATED JCB#14-29587
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (EC1 JOB #22163)
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
		9X9 FLOOR TILE & MASTIC		0					ABATED 2004 REINSPECTION
1029	ART ROOM 203	COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (EC1 JOB #22163)
		WALL/CHALK-BOARD MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING PINK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		REFRACTORY/KILN/FIRE BRICK		0					KILN REPLACED
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
1029CP	ART ROOM 203 CEILING PLENUM								

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1029A	ART ROOM STORAGE	9X9 FLOOR TILE & MASTIC TAN		90 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		43 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		90 SF	0	6	5	O&M	GOOD CONDITION-SCUFF MARKS
1030	COMPUTER STORAGE ROOM	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		105 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	NO ACCESS; PREVIOUSLY CRACKED-LIMITED VISIBILITY
		CERAMIC WALL TILE GROUT & GLUE WHITE		331 SF	0	7	N/A NON FRIABLE	O&M	NO ACCESS; PREVIOUSLY GOOD CONDITION-PATCHED
		GYPSUM BOARD & COMPOUND		20 SF	0	6	5	O&M	NO ACCESS; PREVIOUSLY GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	NO ACCESS; PREVIOUSLY GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)
1031	ROOM 202	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 BLUE FLOOR TILE
		COVE BASE & MASTIC		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1031CP	ROOM 202 CEILING PLENUM	MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION
1032	MATH ROOM	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		636 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING 9X9 TILE CONFIRMED PRESENT UNDERNEATH
		COVE BASE & MASTIC BLACK		140 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CERAMIC WALL TILE GROUT & GLUE WHITE		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		GYP SUM BOARD & COMPOUND		20 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		24 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL		0					NOT SUSPECT
		FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
1032A	MATH ROOM EXIT VESTIBULE	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		45 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	LOOSE, CRACKED & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		17 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WINDOW GLAZING/CAULKING		23 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLES		0					NON ASB JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1032ACP	MATH ROOM EXIT VESTIBULE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1032A1	MATH ROOM BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE YELLOW		90 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		CERAMIC WALL TILE GROUT & GLUE YELLOW		405 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		MIRROR MASTIC		5 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYPNUM BOARD		36 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)
1033	BOY'S BATHROOM NEAR GYM	CERAMIC FLOOR TILE GROUT & GLUE LIGHT BLUE		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE LIGHT BLUE		596 SF	3 LF	4	N/A NON FRIABLE	REPAIR	MISSING GROUT
		MIRROR MASTIC		6 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		18 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)
1034	CUSTODIAN CLOSET NEAR GYM	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPNUM BOARD & COMPOUND		40 SF	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1034CP	CUSTODIAN CLOSET NEAR GYM CEILING PLENUM	MUD JOINT PACKING		1 UNIT	0	6	5	O&M	LIMITED VISUAL ASSESS
1035	GIRL'S BATHROOM NEAR GYM	CERAMIC FLOOR TILE GROUT & GLUE YELLOW		200 SF	1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING W/ GLUE EXPOSED
		CERAMIC WALL TILE GROUT & GLUE YELLOW		596 SF	2 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		36 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)
1036	GYM OFFICE	9X9 FLOOR TILE & MASTIC		120 SF	0	7	N/A NON FRIABLE	O&M	12X12 BLUE FLOOR TILE OBSERVED
		12X12 FLOOR TILE & MASTIC BLUE		0					NEW MATERIAL
		COVE BASE & MASTIC BLACK		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLES		0					NON ASB JCB#14- 28692 TEM
1036CP	GYM OFFICE CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
1036A	GYM OFFICE BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE YELLOW		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1037	GYMNASIUM	WOOD FLOOR TAR/VAPOR BARRIER		3744 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC GREY		0					METAL, NOT SUSPECT
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17-36668
		WINDOW GLAZING/CAULKING		328 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		6 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		6 UNITS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		3744 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	HOLES
		WOOD FLOOR TAR/VAPOR BARRIER		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION-LIMITED VISIBILITY
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17-36668
1037A	GYM CLOSET 1	FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		200 SF	2 SF	3	4	REPAIR	WATER DAMAGE-LIMITED VISIBILITY
		WOOD FLOOR TAR/VAPOR BARRIER		87 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION-LIMITED VISIBILITY
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17-36668
1037B	GYM CLOSET 2	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		234 SF	7 SF	3	4	REPAIR	WATER DAMAGE & PAPER PEELING
		WOOD FLOOR TAR/VAPOR BARRIER		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION-LIMITED VISIBILITY
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17-36668
1037C	GYM CLOSET 3	FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		200 SF	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1038	ROOM 201 MUSIC ROOM	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE-LIMITED VISIBILITY
		12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	21 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		125 SF	0	7	N/A NON FRIABLE	O&M	MASTIC EXPOSED, PAINTED OVER
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
1039	ROOM 200A	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		540 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		48 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED. PAINTED OVER
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		75 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WOOD PANEL MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		0					REMOVED
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1039CP	ROOM 200A CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1039A	ROOM 200A STORAGE	12X12 FLOOR TILE & MASTIC WHITE		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION- LIMITED VISIBILITY
		COVE BASE & MASTIC BROWN		31 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION- LIMITED VISIBILITY
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING WHITE CEILING GYPSUM BOARD & COMPOUND		0					REMOVED
1040	LAMINATING ROOM/COPY ROOM VESTIBULE	12X12 FLOOR TILE & MASTIC BLUE		0					NEW MATERIAL
		COVE BASE & MASTIC BLACK		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLES		0					NON ASB JCB#14-28692 TEM
1040CP	LAMINATING ROOM/COPY ROOM VESTIBULE CEILING PLENUM	MUD JOINT PACKING		10 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1040A	OFFICE ROOM	12X12 FLOOR TILE & MASTIC BLUE		0					NEW MATERIAL
		COVE BASE & MASTIC BLACK		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
1040ACP	OFFICE ROOM CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	6	5	O&M	LIMITED VISUAL ASSESS

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1040A1	OFFICE ROOM BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE LIGHT BLUE		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		184 SF	1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED GROUT
		MIRROR MASTIC		3 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #16354)
1040B	COPY ROOM	12X12 FLOOR TILE & MASTIC BLUE		0					NEW MATERIAL
		COVE BASE & MASTIC BLACK		78 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1040B1	COPY ROOM PAPER STORAGE	CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #16354)
		12X12 FLOOR TILE & MASTIC BLUE		0					NEW MATERIAL
		COVE BASE & MASTIC BLACK		0					NEW MATERIAL
		CERAMIC WALL TILE GROUT & GLUE BLUE		144 SF	2 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
		GYPSUM BOARD & COMPOUND		256 SF	1 SF	3	4	REPAIR	CHIPPED W/ JOINT COMPOUND MISSING
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #16354)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1040B2	CUSTODIAL CLOSET	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		20 SF	0	6	5	O&M	GOOD CONDITION
1041	STORAGE (OLD BOY'S LOCKER ROOM)	CERAMIC FLOOR TILE GROUT & GLUE LIGHT BLUE		100 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL TILE GROUT & GLUE LIGHT BLUE		272 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION- LIMITED VISIBILITY
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)
		12X12 FLOOR TILE & MASTIC TAN/WHITE		585 SF	32 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
1042	RECEIVING ROOM	COVE BASE & MASTIC BROWN		98 LF	1 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED & DELAMINATING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		72 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1042A	RECEIVING ROOM BATHROOM	CERAMIC FLOOR TILE		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GROUT & GLUE GREEN							
		CERAMIC WALL TILE		153 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GROUT & GLUE WHITE							
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION		1 DOOR	0	6		O&M	GOOD CONDITION
		WOOD					5		
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION		1 DOOR	0	6		O&M	GOOD CONDITION
		METAL					5		
		CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
		THERMAL SYSTEMS INSULATION		0					ABATED PEDNEAULT, 1989
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION		2 DOORS	0	6	5	O&M	GOOD CONDITION
1043	BOILER ROOM	DUCT INSULATION		236 SF	6 SF	1	4	REPAIR	PEELING, CHIPPING, W/ VISIBLE DEBRIS. TEST BEFORE DISTURBING
		HOT WATER TANK INSULATION		275 SF	10 SF	1	4	REPAIR	PEELING, CHIPPING, W/ VISIBLE DEBRIS. TEST BEFORE DISTURBING
		FIRE DOOR INSULATION		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL							
1043A	BOILER ROOM TRANSFORMER ROOM	12X12 FLOOR TILE & MASTIC BLUE		0					NEW MATERIAL
		COVE BASE & MASTIC BLACK		35 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1044	HEAD CUSTODIAN'S OFFICE	FIRE DOOR INSULATION		1 DOOR	0	6		O&M	GOOD CONDITION
		WOOD					5		
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1045	WOMEN'S FACULTY BATHROOM NEAR CAFÉ	CERAMIC FLOOR TILE GROUT & GLUE PINK		84 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL TILE GROUT & GLUE WHITE		280 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		5 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1046	MEN'S FACULTY BATHROOM NEAR CAFÉ	CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
		CERAMIC FLOOR TILE GROUT & GLUE LIGHT GREEN		72 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & HOLES
		CERAMIC WALL TILE GROUT & GLUE WHITE		264 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		5 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1047	KITCHEN	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
		CERAMIC FLOOR TILE GROUT & GLUE TAN		1330 SF	2 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		CERAMIC WALL BASE GROUT & GLUE TAN		184 SF	1 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING
1048	KITCHEN	CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE METAL		0					METAL, NOT SUSPECT

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1047A	KITCHEN BATHROOM VESTIBULE	CERAMIC FLOOR TILE GROUT & GLUE TAN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE TAN		10 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE METAL		0					METAL, NOT SUSPECT
1047A1	KITCHEN BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE PINK		46 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL TILE GROUT & GLUE WHITE		264 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		4 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		10 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1047B	KITCHEN FOOD STORAGE	CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)
		CERAMIC FLOOR TILE GROUT & GLUE TAN		128 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE TAN		45 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		VIBRATION REDUCER CLOTH GREEN		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE SMOOTH		128 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	WATER STAINED
1047BCP	KITCHEN FOOD STORAGE CEILING PLENUM	MUD JOINT PACKING		18 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1047C	KITCHEN WASH BIN ROOM VESTIBULE	CERAMIC FLOOR TILE GROUT & GLUE TAN		54 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL BASE GROUT & GLUE TAN		19 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WINDOW GLAZING/CAULKING		8 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1047C1	KITCHEN WASH BIN ROOM	1X1 CEILING TILE METAL		0					METAL, NOT SUSPECT
		CERAMIC FLOOR TILE GROUT & GLUE TAN		56 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE TAN		27 LF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)
1048	FACULTY ROOM	9X9 FLOOR TILE & MASTIC		576 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	9X9 WHITE EXPOSED UNDER 12X12 FLOOR TILE
		COVE BASE & MASTIC BLACK		107 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1048CP	FACULTY ROOM CEILING PLENUM	MUD JOINT PACKING		5 UNITS	0	6	5	O&M	GOOD CONDITION
1049	CORRIDOR CUSTODIANS OFFICE - STORAGE (1055A)	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (EC1 JOB #22163)
		GYPSUM BOARD (AROUND SKYLIGHT)		60 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		35 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
		MUD JOINT PACKING		18 UNITS	NOT QUANTIFIED	3	1	REPAIR	DAMAGED
1049CP	CORRIDOR CUSTODIANS OFFICE - STORAGE (1055A) CEILING PLENUM	9X9 FLOOR TILE & MASTIC		0					ABATED ENVIROSCIENCE, 2011
1050	MAIN OFFICE	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17- 36668
		WALL/CHALK-BOARD MASTIC		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
		MUD JOINT PACKING		6 UNITS	0	6	5	O&M	GOOD CONDITION
1050CP	MAIN OFFICE CEILING PLENUM								

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1050A	MAIN OFFICE MAIL AREA CLOSET	9X9 FLOOR TILE & MASTIC		0					ABATED ENVIROSCIENCE, 2011
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17-36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		12 SF	0	6	5	O&M	GOOD CONDITION
1050B	MAIN OFFICE STORAGE ROOM	9X9 FLOOR TILE & MASTIC		0					ABATED ENVIROSCIENCE, 2011
		COVE BASE & MASTIC BLACK		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17-36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1050C	MAIN OFFICE KITCHEN AREA	CEILING GYPSUM BOARD & COMPOUND		40 SF	0	6	5	O&M	GOOD CONDITION
		9X9 FLOOR TILE & MASTIC		0					ABATED ENVIROSCIENCE, 2011
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17-36668
		WINDOW GLAZING/CAULKING		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1050CCP	MAIN OFFICE KITCHEN AREA	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
1051	TELEPHONE ROOM NEAR MAIN OFFICE	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22169)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1051CP	TELEPHONE ROOM NEAR MAIN OFFICE CEILING PLENUM								NO ACCESS
1052	STORAGE ROOM OPPOSITE CAFETERIA	9X9 FLOOR TILE & MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	NO ACCESS (PREVIOUSLY NO DAMAGE OBSERVED)
		COVE BASE & MASTIC		29 LF	0	7	N/A NON FRIABLE	O&M	NO ACCESS (PREVIOUSLY NO DAMAGE OBSERVED)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #221 63)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6		O&M	NO ACCESS (PREVIOUSLY NO DAMAGE OBSERVED)
		CEILING GYPSUM BOARD & COMPOUND		60 SF	0	6	5	O&M	NO ACCESS (PREVIOUSLY NO DAMAGE OBSERVED)
1053	PRINCIPAL'S OFFICE	9X9 FLOOR TILE & MASTIC		524 SF	0	7	N/A NON FRIABLE	O&M	UNDER CARPET
		COVE BASE & MASTIC BLACK		0					NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #221 63)
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
1053CP	PRINCIPAL'S OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1053A	PRINCIPAL'S CLOSET	12X12 FLOOR TILE & MASTIC TAN WITH BROWN		10 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ASSESS
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #221 63)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		10 SF	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1053B	PRINCIPAL'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE YELLOW		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		153 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1054	NURSE OFFICE	CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
		12X12 FLOOR TILE & MASTIC BLUE		0					REMOVED FEB 2022 (ECI JOB #21959)
		COVE BASE & MASTIC BLACK		0					REMOVED FEB 2022 (ECI JOB #21959)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		100 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1054A	NURSE BATHROOM	2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
		CERAMIC FLOOR TILE GROUT & GLUE PINK		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		153 SF	6 LF	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING
1054CP	NURSE OFFICE CEILING PLENUM	MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1054B	NURSE STORAGE	9X9 FLOOR TILE & MASTIC TAN		0					REMOVED FEB 2022 (ECI JOB #21959)
		COVE BASE & MASTIC BROWN		0					REMOVED FEB 2022 (ECI JOB #21959)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		1 UNIT	0	6	5	O&M	LIMITED VISUAL ASSESS
		CEILING GYPSUM BOARD & COMPOUND		40 SF	0	6	5	O&M	GOOD CONDITION
1055	CAFETERIA	9X9 FLOOR TILE & MASTIC		2650 SF	0	7	N/A NON FRIABLE	O&M	12X12 BLUE OBSERVED; GOOD CONDITION
		COVE BASE & MASTIC BLACK		149 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WINDOW GLAZING/CAULKING		220 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL		0					NOT SUSPECT
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TECTUM		0					NON ASB JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1055A	STAGE	WOOD FLOOR TAR/VAPOR BARRIER		1000 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC, BLUE		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		9X9 FLOOR TILE & MASTIC WHITE WITH BROWN		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL PLASTER		40 SF	< 1 SF	3	4	REPAIR	CHIPPED
		FIRE CURTAINS BLUE		7 UNITS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					REMOVED DEC 2022 (ECL JOB #23003)
		CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
1055A1	STAGE STORAGE ROOM	WOOD FLOOR TAR/VAPOR BARRIER		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
1056	CORRIDOR FROM ROOM 211 TO MAIN ENTRANCE	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		GYP SUM BOARD & COMPOUND		32 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		450 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		64 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1056CP	CORRIDOR FROM ROOM 211 TO MAIN ENTRANCE CEILING PLENUM	MUD JOINT PACKING		67 UNITS	0	6	5	O&M	GOOD CONDITION; 7 UNITS REMOVED (ECL JOB #23422)
1057	ASSISTANT PRINCIPAL VESTIBULE/STORAGE	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		234 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		18 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		GYP SUM BOARD & COMPOUND		172 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		25 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ASSESS
		WOOD PANEL MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ASSESS
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
1057CP	ASSISTANT PRINCIPAL OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1057A	ASSISTANT PRINCIPAL OFFICE	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		324 SF	0	7	N/A NON FRIABLE	O&M	CARPET OBSERVED
		COVE BASE & MASTIC BROWN		0					NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		GYP SUM BOARD & COMPOUND		172 SF	0	6	5	O&M	GOOD CONDITION
		WOOD PANEL MASTIC		117 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		100 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1058	CORRIDOR ROOM 200 - READING ROOM	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22163)
		WINDOW GLAZING/CAULKING		186 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		NON-GLASS WINDOW PANEL		0					NOT SUSPECT
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
1058CP	CORRIDOR ROOM 200 - READING ROOM CEILING PLENUM	2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
		MUD JOINT PACKING		34 UNITS	NOT QUANTIFIED	3	1	REPAIR	DAMAGED WITH DEBRIS
1059	READING ROOM	ROOF TAR		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		286 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		COVE BASE & MASTIC BROWN		67 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22163)
		WALL/CHALK-BOARD MASTIC		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1059CP	READING ROOM CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
1059CP	READING ROOM CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1060	STORAGE NEAR ROOM 108	9X9 TAN FLOOR TILE & MASTIC		96 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		96 SF	0	6	5	O&M	GOOD CONDITION
1061	ROOM 108	9X9 FLOOR TILE & MASTIC		960 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 BLUE FLOOR TILE
		COVE BASE & MASTIC BLACK		121 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
		9X9 FLOOR TILE & MASTIC		0					ABATED 2004 REINSPECTION
1062	ROOM 107	COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		130 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1062CP	Room 107 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1062A	Room 107 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE WHITE WITH MULTI COLORS		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		135 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
		9X9 FLOOR TILE & MASTIC		0					ABATED 2004 REINSPECTION
1063	Room 106	COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		130 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
1063CP	Room 106 CEILING PLENUM	MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
1063A	Room 106 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE WHITE WITH MULTI COLORS		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		135 SF	<1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1064	ROOM 105	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 BLUE FLOOR TILE
		COVE BASE & MASTIC BLACK		89 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		130 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
1064CP	ROOM 105 CEILING PLENUM	MUD JOINT PACKING		3 UNITS	0	6	5	O&M	GOOD CONDITION
1064A	ROOM 105 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE WHITE WITH MULTI COLORS		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		135 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
		9X9 FLOOR TILE & MASTIC TAN WITH BROWN		216 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1065	STORAGE NEAR ROOM 104	COVE BASE & MASTIC BLACK		67 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17-36668
		CEILING DRYWALL & JOINT COMPOUND		216 SF	2 SF	3	4	REPAIR	CRACKED, CHIPPED, & WATER DAMAGED; CONF ASB JCB#17-36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#17-36668

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1066	CUSTODIAL CLOSET NEAR ROOM 104	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		70 SF	0	6	5	O&M	GOOD CONDITION
1066CP	CUSTODIAL CLOSET NEAR ROOM 104 CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	6	5	O&M	LIMITED VISUAL ASSESS
1067	ROOM 103C SPEECH	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		WOOD PANEL MASTIC		118 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
1067CP	ROOM 103C SPEECH CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1068	ROOM 104	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		1000 SF	26 TILES	4	N/A NON FRIABLE	REPAIR	HAIRLINE CRACKS & CUPPING THROUGHOUT
		COVE BASE & MASTIC BLACK		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
1068CP	ROOM 104 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1068A	ROOM 104 STORAGE	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1068B	ROOM 104 BATHROOM	CEILING GYPSUM BOARD & COMPOUND		50 SF	0	6	5	O&M	GOOD CONDITION
		CERAMIC FLOOR TILE GROUT & GLUE WHITE WITH MULTI COLORS		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		136 SF	3 LF	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1069	ROOM 103B	CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		WOOD PANEL MASTIC		118 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
1069CP	ROOM 103B CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1070	ROOM 103A	9X9 FLOOR TILE & MASTIC TAN/WHITE		159 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		33 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17-36668
		WALL/CHALK-BOARD MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WOOD PANEL MASTIC		190 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE		0					NON ASB JCB#14-28692 TEM
		ROOF TAR		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		694 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
1071	ROOM 103	COVE BASE & MASTIC BLACK		78 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (EC1 JOB #22163)
		WALL/CHALK-BOARD MASTIC		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WOOD PANEL MASTIC		190 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
1071CP	ROOM 103 CEILING PLENUM								

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1071A	ROOM 103 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE WHITE WITH MULTI COLORS		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		153 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		3 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					ABATED JCB#12-22574
1071B	ROOM 103 STORAGE	CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
		9X9 FLOOR TILE & MASTIC TAN		50 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	LIFTING & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1072	ROOM 102	CEILING GYPSUM BOARD & COMPOUND		50 SF	0	6	5	O&M	GOOD CONDITION
		9X9 FLOOR TILE & MASTIC		972 SF	0	7	N/A NON FRIABLE	O&M	ASSUME UNDER 12X12 WHITE FLOOR TILE
		COVE BASE & MASTIC BLACK		100 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		152 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		140 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1072CP	ROOM 102 CEILING PLENUM	ROOF TAR		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1072A	ROOM 102 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE WHITE WITH MULTI COLORS		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		136 SF	<1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
1072B	ROOM 102 STORAGE	9X9 FLOOR TILE & MASTIC TAN		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		30 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		50 SF	3 SF	3	4	REPAIR	WATER DAMAGED
1073	ROOM 101	12X12 FLOOR TILE & MASTIC BLUE		1124 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		0					CONFIRMED NON-ACM (ECI JOB #22732)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		152 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		200 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1073CP	ROOM 101 CEILING PLENUM	MUD JOINT PACKING		10 UNITS	0	6	5	O&M	GOOD CONDITION
1073A	ROOM 101 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE WHITE WITH MULTI COLORS		25 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL TILE GROUT & GLUE PINK		136 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		3 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1073B	ROOM 101 STORAGE	CEILING PLASTER		0					CONFIRMED NON-ACM (ECL JOB #22163)
		12X12 FLOOR TILE & MASTIC BLUE		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECL JOB #22163)
1074	CORRIDOR ROOM 103A- ROOM 101	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		50 SF	0	6	5	O&M	GOOD CONDITION
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		GLAZED BLOCK MORTAR		611 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1074CP	CORRIDOR ROOM 103A- ROOM 101 CEILING PLENUM	WINDOW GLAZING/CAULKING		340 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		6 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
1074CP	CORRIDOR ROOM 103A- ROOM 101 CEILING PLENUM	MUD JOINT PACKING		15 UNITS	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1075	CORRIDOR-ROOM 103A TO STORAGE BY 109	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL PLASTER		8 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		144 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
1075CP	CORRIDOR-ROOM 103A TO STORAGE BY 109 CEILING PLENUM	WALL PLASTER		40 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
		MUD JOINT PACKING		45 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
		9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 BLUE FLOOR TILE
		COVE BASE & MASTIC BLACK		89 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
1076	ROOM 109	WALL/CHALK-BOARD MASTIC		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
1076CP	ROOM 109 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1077	GIRL'S ROOM BY ROOM 109	CERAMIC FLOOR TILE GROUT & GLUE YELLOW		317 SF	1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING
		CERAMIC WALL TILE GROUT & GLUE YELLOW		689 SF	14 LF	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, & MISSING
		MIRROR MASTIC		12 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		28 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1078	FACULTY BATHROOM BY ROOM 109	CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)
		CERAMIC FLOOR TILE GROUT & GLUE PINK		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		264 SF	< 1 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1079	TV/SERVER CLOSET	CEILING PLASTER		0					CONFIRMED NON-ACM (ECI JOB #22163)
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		80 SF	0	6	5	O&M	PATCHED; CONFIRMED ACM (ECI JOB #22163)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1080	BOY'S BATHROOM NEAR 110	CERAMIC FLOOR TILE GROUT & GLUE LIGHT BLUE		517 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL TILE GROUT & GLUE BLUE		689 SF	8 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		MIRROR MASTIC		12 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		28 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22163)
1081	ROOM 110	9X9 FLOOR TILE & MASTIC		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	EXPOSED UNDER 12X12 WHITE FLOOR TILE
		COVE BASE & MASTIC BLACK		89 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
1081CP	ROOM 110 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1082	ROOM 111	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	ASSUME UNDER 12X12 WHITE FLOOR TILE
		COVE BASE & MASTIC BLACK		89 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
		9X9 FLOOR TILE & MASTIC		0					ABATED 2004 REINSPECTION
1083	ROOM 112	COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		WALL/CHALK-BOARD MASTIC		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
		NONE OBSERVED							NONE OBSERVED
		9X9 FLOOR TILE & MASTIC		0					ABATED 2004 REINSPECTION
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
1083CP	ROOM 112 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1084	ROOM 113	9X9 FLOOR TILE & MASTIC		0					ABATED 2004 REINSPECTION
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #221 63)
		WALL/CHALK-BOARD MASTIC		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
1084CP	ROOM 113 CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	6	5	O&M	GOOD CONDITION
1085	ROOM 114	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	12X12 BLUE OBSERVED; GOOD CONDITION
		COVE BASE & MASTIC BLACK		89 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #221 63)
		WALL/CHALK-BOARD MASTIC		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#14-28692 TEM
1085CP	ROOM 114 CEILING PLENUM	MUD JOINT PACKING		1 UNIT	0	6	5	O&M	LIMITED VISUAL ASSESS

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1086	CORRIDOR ROOM 113 TO GIRL'S BATH	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					CONFIRMED NON-ACM (ECI JOB #22163)
		MIRROR MASTIC		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2x2 CEILING TILE TEXTURED		0					NON ASB JCB#14- 28692 TEM
1086CP	CORRIDOR ROOM 113 TO GIRL'S BATH CEILING PLENUM	MUD JOINT PACKING		19 UNITS	0	6	5	O&M	GOOD CONDITION

Appendix C

DRAWINGS



KEY PLAN

NO SCALE

PROJECT	SIX MONTH AHERA SURVEILLANCE OTSEGO ELEMENTARY SCHOOL FLOOR PLAN
CLIENT	HALF HOLLOW HILLS CENTRAL SCHOOL DISTRICT




PROJECT #: 23546
COMMENTS:
None

NOT TO SCALE

Date: 06/15/2023

By: Robert Cardona

DRAWING 1 of 1

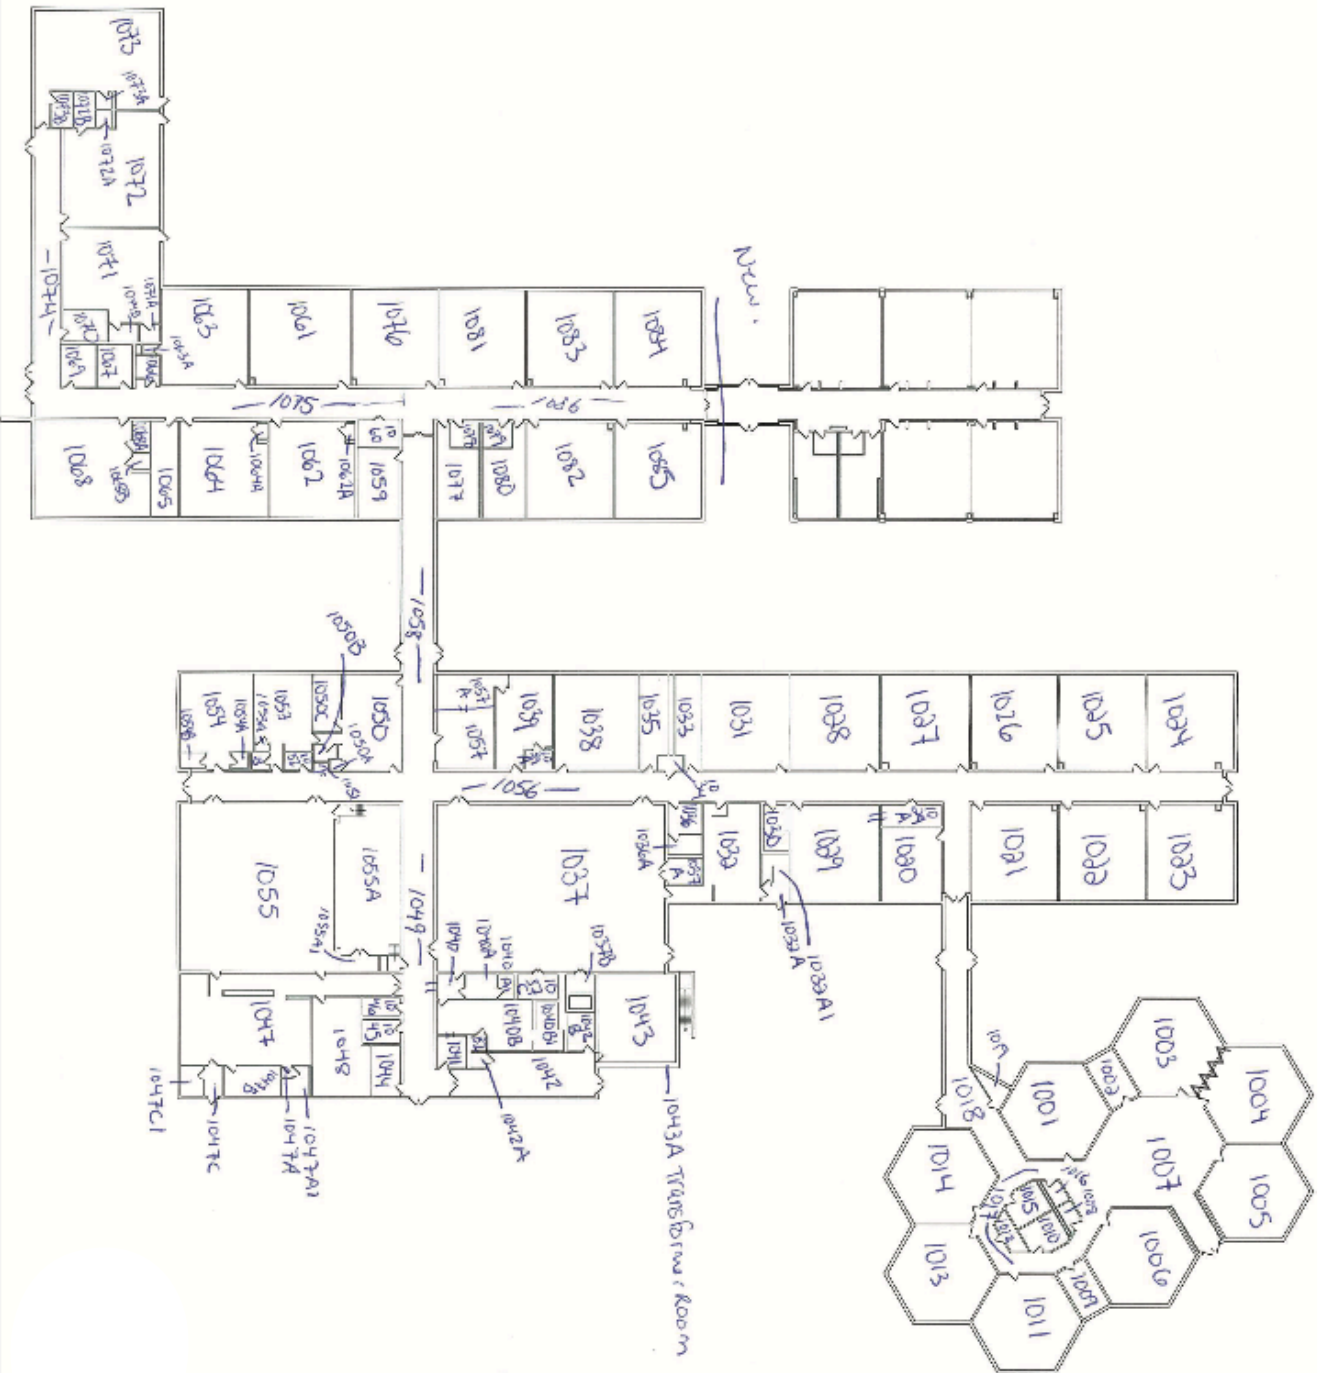

Appendix D

CERTIFICATIONS

WE ARE YOUR DOL

 **NEW YORK STATE Department of Labor**

DIVISION OF SAFETY & HEALTH LICENSE AND CERTIFICATE UNIT, STATE OFFICE CAMPUS, BLDG. 12, ALBANY, NY 12226

ASBESTOS HANDLING LICENSE

Enviroscience Consultants, LLC
2150 Smithtown Avenue, Ronkonkoma, NY, 11779

License Number: 28733
License Class: RESTRICTED
Date of Issue: 11/04/2022
Expiration Date: 11/30/2023
Duly Authorized Representative: Bartley Gallagher

This license has been issued in accordance with applicable provisions of Article 30 of the Labor Law of New York State and of the New York State Codes, Rules and Regulations (12 NYCRR Part 56). It is subject to suspension or revocation for a (1) serious violation of state, federal or local laws with regard to the conduct of an asbestos project, or (2) demonstrated lack of responsibility in the conduct of any job involving asbestos or asbestos material.

This license is valid only for the contractor named above and this license or a photocopy must be prominently displayed at the asbestos project worksite. This license verifies that all persons employed by the licensee on an asbestos project in New York State have been issued an Asbestos Certificate, appropriate for the type of work they perform, by the New York State Department of Labor.


Amy Phillips, Director
For the Commissioner of Labor

EXCELSIOR

Appendix E

NOTICE TO SHORT TERM WORKERS

NOTICE TO SHORT TERM WORKERS

All workers entering the Otsego Elementary School must sign in, thereby acknowledging the presence and locations of asbestos containing building materials in the building. No work will be allowed in the areas listed without prior approval from the AHERA Designated Person for the Half Hollow Hills School District.

Sign in sheets will be picked up at the time of the Six Month AHERA Surveillance and will be placed in the buildings Asbestos Management Plan.

Asbestos containing materials and their locations at Otsego Elementary School are listed in the AHERA Management Plan, which is available for review, upon request.

[illegible]

Appendix F
BULK SAMPLE RESULTS

ELAP # 11681; NVLAP Lab Code 200531-0

ASBESTOS BULK SAMPLE RESULTS

CLIENT:	Half Hollow Hills CSD 525 Half Hollow Road, Dix Hills, NY 11746		SAMPLE DATE:	6/2/2023	
PROJECT NAME:	AHERA Six-month Surveillance - May 2023		DATE RECEIVED:	6/5/2023	
JOB #:	23546	SAMPLER:	Pamela Chadderton		
PAGE #:	1 of 1	CUSTODY #:	35260		
AREA:	Otsego Elementary School - Terrazzo				

Lab ID	Sample #	Description	Color	Location	Total Asbestos Result	% Asbestos-type	% Non-asbestos Fibers-type	% Matrix-type
99465	TF1	Terrazzo Floor	White w/ Black	Corridor 300's Wing Girls Room to Music Room (AHERA #1018)	None Detected	2.0% fiberglass	98.0% cement	
99466	TF2	Terrazzo Floor	White w/ Black	Corridor 300's Wing Girls Room to Music Room (AHERA #1018)	None Detected	3.0% cellulose 2.0% fiberglass	95.0% cement	
99467	TF3	Terrazzo Floor	White w/ Brown	Corridor from Room 211 to Main Entrance (AHERA #1056)	None Detected	5.0% cellulose	95.0% cement	
99468	TF4	Terrazzo Floor	White w/ Brown	Corridor Room 103A to Storage by Room 109 (AHERA #1075)	None Detected	5.0% cellulose	95.0% cement	

Method: EPA 600/M4-82/20, 600/R-93/116, NYS DOH ELAP Item 198.1, 198.4, 198.6, 198.8.

ACM: Asbestos Containing Materials contain more than 1%.

None Detected - No asbestos found in samples using polarized light microscopy (PLM). Trace - Asbestos found is 1% or less, not considered ACM.

None Detected by TEM - No asbestos found in samples using transmission electron microscopy (TEM) and polarized light microscopy (PLM) was found to be negative.

Negative by Weight - After matrix reduction, the remainder is less than 1% and, therefore, cannot fulfill the definition of asbestos containing material.

Inconclusive - No asbestos found in non-friable organically bound samples using polarized light microscopy (PLM).

Method ELAP 198.6 does not remove vermiculite and may underestimate the level of asbestos present in a sample containing greater than 10% vermiculite. Samples of Surface Material that contain Vermiculite are analyzed by ELAP 198.8 for conclusive result.

This report may not be reproduced without the express permission of Enviroscience Consultants, LLC. This report cannot be used to claim endorsement of products by NVLAP or any agency of the U.S. Government. Test results only reflect conditions at the time the samples were taken.

ANALYZED BY:	<i>Valerie Scipione</i>	PLM DATE:	6/7/2023	ANALYZED BY:		TEM DATE:	
DIRECTOR:	<i>Edward M. Scipione</i>	DATE:	6/8/2023	REVISION #:	0	REVISION DATE:	6/8/2023