

Half Hollow Hills CSD
Six Month AHERA Surveillance
Signal Hill Elementary School & 3 Sheds
May 2023



2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project #23546

Six Month AHERA Surveillance

Performed at

Signal Hill Elementary School & 3 Sheds
670 Caledonia Road
Dix Hills, NY 11746

for

Half Hollow Hills CSD
Administration Building
525 Half Hollow Road
Dix Hills, NY 11746

May 2023

Prepared by:

Enviroscience Consultants, LLC
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #23546

Inspector & Management
Planner:


Bartley Gallagher

NYSDOL #92-13892

Inspectors: 
Alexis Bruno

NYSDOL #21-08575


Pamela Chadderton

NYSDOL #15-10408

Six Month AHERA Surveillance

Table of Contents

- I. Summary
- II. Inspection and Recommendations
- III. Bulk Sampling Protocol
- IV. Hazard Rank Determination
- V. AHERA Reassessment Category

Appendix A - Inventory of Damaged Asbestos Containing Materials

Appendix B - Inventory of Asbestos Containing Materials

Appendix C - Drawings - Functional Space Number Floor Plans

Appendix D - Certifications

Appendix E - Notice to Short Term Workers

Appendix F - Bulk Sample Results

I. Summary

A six month AHERA surveillance for the Signal Hill Elementary School and 3 Sheds of the Half Hollow Hills CSD was performed by Ms. Alexis Bruno and Mrs. Pamela Chadderton of Enviroscience Consultants, LLC on June 13, 2023.

The six month surveillance was performed in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Ms. Bruno and Mrs. Chadderton are certified AHERA Inspectors.

Ms. Bruno and Mrs. Chadderton performed the on-site investigation, which included examining existing ACBM, evaluating the condition of the ACBM, and determining if originally non-friable materials have become friable. The physical condition of most of the ACBM found in this building did not change.

After studying the inspection reports, Mr. Bartley M. Gallagher, a certified EPA/AHERA Inspector and Management Planner, developed the recommendations for response actions depending on his evaluation of the hazard that each material may cause.

An Inventory of Asbestos Containing Materials by location, including the AHERA Functional Space identification number is in Appendix B. This inventory includes the material, quantity, amount damaged, the hazard level, the AHERA Reassessment category, and recommended response actions. A remarks column includes sampling and abatement action and other pertinent information.

Floor plans correlating the AHERA Functional Space ID number with the current common location names are in Appendix C.

II. Inspection and Recommendations

The inspector entered all accessible spaces to inspect and physically assess the condition and friability of all previously known or assumed ACBM. The inspector noted any change in condition of remaining materials, materials that have been abated since the last reinspection, and any materials that were either not identified, or may have been improperly classified.

Unless otherwise stated, a recommendation for removal is a suggestion that the materials be removed as soon as the school's budget will allow.

During this inspection there was damage noted, repairs should be made. Please reference your Summary of Damaged Asbestos Containing Materials found in Appendix A.

Since the last surveillance, the following asbestos abatement activities were performed:

In June 2023, bulk samples were collected of terrazzo floor at various locations throughout the Building Interior. Results confirmed the material sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #35333 for detailed sample location information and results.

In November 2022, bulk samples were collected of the cove base mastic, wood floor vapor barrier, and wood floor tar in the Gymnasium (AHERA space #1046). Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #34324 for detailed sample location information and results.

History:

In March 2022, bulk samples were collected of smooth ceiling plaster at various locations throughout the School Building. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #32500 for detailed sample location information and results.

In November 2021, Enviroscience Consultants was retained by the Half Hollow Hills Central School District to perform the surveillance inspections and three year reinspections in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Any information pertaining to the assessment and changes in condition of ACBM prior to November 2021 must be obtained from the records maintained by the Half Hollow Hills Central School District.

In July 2021, asbestos containing roof flashing material was removed from the Roof. Please reference Enviroscience Consultants job #21205.

In July 2021, bulk samples were collected of the cementitious material inside window panels in the Exterior Window Panels. Results confirmed the material sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #30310 for detailed sample location information and results.

Any damaged material that is assumed to be asbestos containing should be sampled to confirm that it is identified as ACBM before initiating repair procedures.

The inspector did not access any flooring materials located under carpeting or new tiles because obtaining access would damage the carpet or new tiles. Prior to disturbing any carpets or removing new floor tiles, the school should ascertain whether floor tiles are located beneath them. Repair or replace damaged floor tiles as noted. We have prepared an inventory of asbestos containing materials for the building. These pages list the current damage category, changes in physical condition, current priority levels, changes in response actions, and bulk sampling and abatement information (see Appendix B).

All materials are currently classified as non-friable in their present condition, except for damaged thermal insulation materials, gypsum board, and joint compound.

III. Bulk Sampling Protocol

Thermal System Insulation - Three (3) samples are randomly collected for each homogeneous material of Thermal System Insulation (TSI). AHERA states that for each area of patched TSI at least one (1) sample be collected.

Surfacing Materials - a minimum of three (3), five (5) or seven (7) samples based upon the amount of suspect material present.

Miscellaneous Materials - require a minimum of two (2) samples.

New York State Revisions to Analytical Methods

Over the years, the New York State Department of Health has made several revisions to testing requirements that affect suspect asbestos materials in school buildings. These changes have resulted in the requirement to re-sample and analyze certain materials to comply with the revised analytical methods:

Surfacing Materials - In May 2016, the New York State Department of Health (NYSDOH) finalized testing requirements and approved a new analytical method for analysis of surfacing materials that contain vermiculite. Surfacing materials that could contain vermiculite include spray-on fireproofing, wall plaster, and ceiling plaster. Unfortunately, the previous analysis method for fireproofing and plasters did not specifically require that the vermiculite percentage be reported. The District must now consider any spray or troweled fireproofing or plaster materials to be presumed asbestos containing materials (PACM) until they are re-tested to conform to the new requirements. As a result, we have added any plaster previously classified as non-asbestos to the Inventory of Asbestos Containing Materials. Re-testing of any fireproofing or plaster materials will be noted in the narrative and will be shown in the Inventory.

Ceiling Tile - In August 2012, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in ceiling tiles that contain cellulose. Any ceiling tiles that have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Any re-testing of ceiling tiles will be noted in the narrative and will be shown in the Inventory. The District should keep records for any new non-asbestos ceiling tiles that are installed, including the location, brand, model number, date of manufacture, and date of installation.

Floor Tile and Other NOB Materials - In 1992, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in non-friable organically bound (NOB) materials such as floor tiles and roofing materials. As such, any floor tiles and mastic which have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Re-testing of any floor tile, mastic or other NOB materials will be noted in the narrative and will be shown in the Inventory.

During this surveillance, bulk samples were collected of terrazzo floor at various locations throughout the Building Interior. Results confirmed the material sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #35333 in Appendix 'F' for detailed sample location information and results.

IV. Hazard Rank Determination

For each homogeneous material, a response action priority level is determined depending on its physical condition, location, and potential for future damage. Materials were classified into seven categories, based upon the type, condition, and potential for damage of the ACBM. The categories are as follows:

Hazard Rank	ACBM Condition	ACBM Disturbance Potential
1	Significantly Damaged	Any Potential for Damage
2	Damaged	Potential for Significant Damage
3	Damaged	Potential for Damage
4	Damaged	Low Potential for Damage
5	Good	Potential for Significant Damage
6	Good	Potential for Damage
7	Good	Low Potential for Damage

The district shall select and implement in a timely manner the appropriate response actions consistent with the assessment category. The response actions selected shall be sufficient to protect human health and the environment. The district may then select, from the response actions which protect human health and the environment, that action which is the least burdensome method. Nothing in this section shall be construed to prohibit removal of ACBM from a school building at any time, should removal be the preferred response action of the district.

If damaged or significantly damaged thermal system insulation ACM is present in a building, the district shall:

- (1) At least repair the damaged area.
- (2) Remove the damaged material if it is not feasible, due to technological factors, to repair the damage.
- (3) Maintain all thermal system insulation ACM and its covering in an intact state and undamaged condition.

If damaged friable surfacing ACM or damaged friable miscellaneous ACM is present in a building, the district shall select from among the following response actions: encapsulation, enclosure, removal, or repair of the damaged material.

In selecting the response action from among those which meet the definitional standards in §763.83, the district shall determine which of these response actions protects human health and the environment. For purposes of determining which of these response actions are the least burdensome, the district may then consider local circumstances, including occupancy and use patterns within the school building, and its economic concerns, including short and long-term costs.

V. AHERA Reassessment Category

The Management Planner is also required to classify each friable and thermal system insulation (TSI) ACBM and suspected ACBM assumed to be ACM in the school building into one of the following AHERA 1 through 7 reassessment categories based on damage, potential for damage, and material category:

- (1) Damaged or significantly damaged thermal system insulation ACM.
- (2) Damaged friable surfacing ACM.

- (3) Significantly damaged friable surfacing ACM.
 - (4) Damaged or significantly damaged friable miscellaneous ACM.
 - (5) ACBM with potential for damage.
 - (6) ACBM with potential for significant damage.
 - (7) Any remaining friable ACBM or friable suspected ACBM.
- N/A Not Applicable

Appendix A

INVENTORY OF DAMAGED ASBESTOS CONTAINING MATERIALS

Half Hollow Hills CSD
Signal Hill Elementary School and 3 Sheds

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1005	BOY'S ROOM NEAR ROOM 110	CERAMIC WALL TILE GROUT & GLUE WHITE		715 SF	10 LF	4	N/A NON FRIABLE	REPAIR	MISSING
1006	CUSTODIAL CLOSET NEAR ROOM 110	CEILING GYPSUM BOARD & COMPOUND		72 SF	2 SF	3	4	REPAIR	HOLE TO RUN WIRING
1008	FACULTY BATHROOM NEAR ROOM 110	CERAMIC FLOOR TILE GROUT & GLUE TAN		72 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL TILE GROUT & GLUE BEIGE		261 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1009	GIRL'S BATHROOM NEAR ROOM 109	CERAMIC FLOOR TILE GROUT & GLUE PINK		289 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	HOLES
		CERAMIC WALL TILE GROUT & GLUE TAN		715 SF	2 LF	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING
1015	ROOM 107	COVE BASE & MASTIC BLACK		89 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1015A	ROOM 107 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		18 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING TILES
1016	ROOM 106	12X12 FLOOR TILE & MASTIC WHITE W. BROWN		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
1017	ROOM 105	12X12 FLOOR TILE & MASTIC WHITE W. BROWN		790 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1017A	ROOM 105 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		18 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
1018	ROOM 104A	12X12 FLOOR TILE & MASTIC WHITE/MULTI COLOR		280 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		75 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
1021	ROOM 104	12X12 FLOOR TILE & MASTIC BLUE		1000 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
1021B	ROOM 104 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		25 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL TILE GROUT & GLUE BEIGE		153 SF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING

Half Hollow Hills CSD
Signal Hill Elementary School and 3 Sheds

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1022	ROOM 110A	12X12 FLOOR TILE & MASTIC GREY		216 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
1024A	ROOM 103 BATHROOM	CERAMIC WALL TILE GROUT & GLUE TAN		153 SF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
1024B	ROOM 103 CLOSET	COVE BASE MASTIC		21 LF	21 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
1025A	ROOM 102 BATHROOM	WALL PLASTER		153 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE-DENTED
1025B	ROOM 102 CLOSET	COVE BASE & MASTIC BLACK		27 LF	6 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
1026	ROOM 101 VESTIBULE	12X12 FLOOR TILE & MASTIC BEIGE		60 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED-9X9 BLACK & RED TILE VISIBLE AT SINK
1026A	ROOM 101 BOOK STORAGE ROOM	COVE BASE & MASTIC BLACK		57 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
1026B	ROOM 101	12X12 FLOOR TILE & MASTIC BEIGE WC		850 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
1026B1	ROOM 101 BATHROOM	CERAMIC WALL TILE GROUT & GLUE TAN		135 SF	12 LF	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING
1028CP	CORRIDOR ROOM 104-114 CEILING PLENUM	MUD JOINT PACKING		78 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1029CP	CORRIDOR CUSTODIAL- ASSISTANT PRINCIPAL CEILING PLENUM	MUD JOINT PACKING		26 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1030	MAIN OFFICE	12X12 FLOOR TILE & MASTIC WHITE		355 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1030A	MAIN OFFICE COAT CLOSET	COVE BASE & MASTIC BLACK		13 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING-LIMITED VISIBILITY
1037A1	KITCHEN SLOP SINK	CERAMIC WALL BASE GROUT & GLUE RED		36 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	MISSING-LIMITED VISIBILITY
1037C	KITCHEN BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		72 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL TILE GROUT & GLUE TAN		228 SF	4 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING GROUT
1041	TEACHERS COPY ROOM	COVE BASE & MASTIC BLACK		54 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING

Summary of Damaged Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1042	MAIN CUSTODIAN AREA	12X12 FLOOR TILE & MASTIC BLUE		675 SF	20 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, & MISSING
		COVE BASE & MASTIC BLACK		135 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		GYPSUM BOARD & COMPOUND		142 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	SOLE & PEELING
1044	PTA CLOSET (OLD BATHROOM/STORAGE BY CUSTODIAN OFFICE)	CERAMIC WALL TILE GROUT & GLUE WHITE		360 SF	5 LF	4	N/A NON FRIABLE	REPAIR	MISSING GROUT
1045	200 VESTIBULE	12X12 FLOOR TILE & MASTIC BLUE		64 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
1045A1	PE OFFICE BATHROOM	CERAMIC WALL TILE GROUT & GLUE WHITE		236 SF	3 LF	4	N/A NON FRIABLE	REPAIR	MISSING GROUT
1045B	MUSIC ROOM	12X12 FLOOR TILE & MASTIC BLUE		512 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
1045B2	MUSIC ROOM STORAGE	CEILING GYPSUM BOARD & COMPOUND		24 SF	4 SF	4	N/A NON FRIABLE	REPAIR	HOLES-CUT
1046A	GYM STORAGE CLOSET 1	COVE BASE & MASTIC BLACK		42 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CEILING GYPSUM BOARD & COMPOUND		104 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
1046B	GYM STORAGE CLOSET 2	CEILING GYPSUM BOARD & COMPOUND		70 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	HOLE
1046C	GYM STORAGE CLOSET 3	COVE BASE & MASTIC BLACK		48 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
1047B1	ROOM 201 EXIT VESTIBULE	12X12 FLOOR TILE & MASTIC WHITE W. BLACK		45 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
1048	LIBRARY	CEILING GYPSUM BOARD & COMPOUND		300 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	NOT OBSERVED; PREVIOUSLY JOINT COMPOUND MISSING
1049	GIRL'S BATHROOM BY ROOM 201	CERAMIC FLOOR TILE GROUT & GLUE PINK		160 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL TILE GROUT & GLUE PINK		486 SF	3 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1052	ROOM 202	12X12 FLOOR TILE & MASTIC BEIGE W. BROWN		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	9X9 EXPOSED, CRACKED & CHIPPED W/ MASTIC EXPOSED
1053	COMPUTER STORAGE	GYPSUM BOARD & COMPOUND		352 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	DENTED

Summary of Damaged Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1054	ROOM 203	12X12 FLOOR TILE & MASTIC WHITE W. BROWN		810 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		89 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
1056	ART STORAGE ROOM	9X9 FLOOR TILE & MASTIC WHITE W/ BLACK		140 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1057	ROOM 205	12X12 FLOOR TILE & MASTIC WHITE		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1058	ROOM 203A	12X12 FLOOR TILE & MASTIC WHITE/MULTI COLOR		480 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1060	ROOM 207	12X12 FLOOR TILE & MASTIC WHITE		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
1063	ROOM 210	COVE BASE & MASTIC BLACK		111 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		12X12 FLOOR TILE & MASTIC WHITE		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
1064	ROOM 211	COVE BASE & MASTIC BLACK		111 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING

Appendix B

INVENTORY OF ASBESTOS CONTAINING MATERIALS

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1001	ROOM 114	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BLUE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		89 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		NONE OBSERVED							NONE OBSERVED
1002	ROOM 113	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BEIGE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		89 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1002CP	ROOM 113 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1003	ROOM 111	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BEIGE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		89 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GLAZING/CAULKING							
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; 30 SF ABATED JCB#14-28391; ABATED JCB#17-37469
1003CP	ROOM 111 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1004	ROOM 112	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE-VISIBLE AT DOOR
		12X12 FLOOR TILE & MASTIC BEIGE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		89 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1004CP	ROOM 112 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1005	BOY'S ROOM NEAR ROOM 110	CERAMIC FLOOR TILE GROUT & GLUE RED		289 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		715 SF	10 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		24 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1006	CUSTODIAL CLOSET NEAR ROOM 110	CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22108)
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		72 SF	2 SF	3	4	REPAIR	HOLE TO RUN WIRING
1007	ROOM 110	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE/GREY		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		89 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13- 27816; ABATED JCB#17- 37469

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1007CP	ROOM 110 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1008	FACULTY BATHROOM NEAR ROOM 110	CERAMIC FLOOR TILE GROUT & GLUE TAN		72 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL TILE GROUT & GLUE BEIGE		261 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
1009	GIRL'S BATHROOM NEAR ROOM 109	CERAMIC FLOOR TILE GROUT & GLUE PINK		289 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	HOLES
		CERAMIC WALL TILE GROUT & GLUE TAN		715 SF	2 LF	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		24 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1010	ROOM 109	CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
		9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BEIGE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		89 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1010CP	ROOM 109 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1011	STORAGE ROOM 107A	9X9 FLOOR TILE & MASTIC		126 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BEIGE		126 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17-36668
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1012	ROOM 107A ASSISTANT PRINCIPAL	CEILING GYPSUM BOARD & COMPOUND		0					NON ASB JCB#17-36668
		9X9 FLOOR TILE & MASTIC		232 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE/GREY		232 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		65 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
1012CP	ROOM 107A ASSISTANT PRINCIPAL CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1013	ROOM 108B	12X12 FLOOR TILE & MASTIC GREY		405 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION- PATCHED
		COVE BASE & MASTIC BLACK		56 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17- 36668
		GYP SUM BOARD & COMPOUND		0					NON ASB JCB#17- 36668
		WALL/CHALK-BOARD MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13- 27816; ABATED JCB#17- 37469
		NONE OBSERVED							NONE OBSERVED
		12X12 FLOOR TILE & MASTIC GREY		405 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1014	ROOM 108A	COVE BASE & MASTIC BLACK		56 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17- 36668
		GYP SUM BOARD & COMPOUND		0					NON ASB JCB#17- 36668
		WALL/CHALK-BOARD MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13- 27816; ABATED JCB#17- 37469
		NONE OBSERVED							NONE OBSERVED
		12X12 FLOOR TILE & MASTIC GREY		405 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1014CP	ROOM 108A CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1015	ROOM 107	9X9 FLOOR TILE & MASTIC		790 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BEIGE WC		790 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		89 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1015A		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
1015CP	ROOM 107 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1015A	ROOM 107 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		18 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING TILES
		CERAMIC WALL TILE GROUT & GLUE BEIGE		135 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1016	ROOM 106	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE W. BROWN		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		86 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		NONE OBSERVED							NONE OBSERVED
1016CP	ROOM 106 CEILING PLENUM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1016A	ROOM 106 BATHROOM	CERAMIC WALL BASE GROUT & GLUE TAN		15 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL PLASTER		135 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1017	ROOM 105	9X9 FLOOR TILE & MASTIC		790 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE W. BROWN		790 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		89 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1017CP	ROOM 105 CEILING PLENUM	METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		NONE OBSERVED							NONE OBSERVED
1017A	ROOM 105 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		18 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL TILE GROUT & GLUE TAN		135 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION- PATCHED
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1018	ROOM 104A	9X9 FLOOR TILE & MASTIC		280 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE/MULTI COLOR		280 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		75 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW GLAZING/CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1019	CUSTODIAL CLOSET NEAR ROOM 104A	FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		280 SF	0	6	5	O&M	GOOD CONDITION
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1020	CLOSET NEXT TO ROOM 110A	CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	NO ACCESS
		1X1 CEILING TILE FISSURE		9 SF	0	7	N/A NON FRIABLE	O&M	NO ACCESS

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1021	ROOM 104	9X9 FLOOR TILE & MASTIC		1000 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BLUE		1000 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
1021CP	ROOM 104 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1021A	ROOM 104 CLOSET	9X9 FLOOR TILE & MASTIC RED		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		27 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		50 SF	0	6	5	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1021B	ROOM 104 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		25 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL TILE GROUT & GLUE BEIGE		153 SF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18- 40128
1022	ROOM 110A	12X12 FLOOR TILE & MASTIC GREY		216 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		57 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17- 36668
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					FIBERGLASS, NOT SUSPECT
1022CP	ROOM 110A CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1023	ROOM 103A	12X12 FLOOR TILE & MASTIC BLUE		154 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		29 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17- 36668
		WOOD PANEL MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13- 27816; ABATED JCB#17- 37469

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1023CP	ROOM 103A CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1024	ROOM 103	12X12 FLOOR TILE & MASTIC BLUE		858 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		67 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WOOD PANEL MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2x4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		NONE OBSERVED							NONE OBSERVED
1024CP	ROOM 103 CEILING PLENUM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1024A	ROOM 103 BATHROOM	CERAMIC WALL TILE GROUT & GLUE TAN		153 SF	<1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		1 UNIT	0	6	5	O&M	GOOD CONDITION-DUCT TAPED
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
102AB	ROOM 103 CLOSET	12X12 FLOOR TILE & MASTIC LIGHT BLUE		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE MASTIC		21 LF	21 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		50 SF	0	6	5	O&M	GOOD CONDITION
1025	ROOM 102	12X12 FLOOR TILE & MASTIC BEIGE WC		910 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION-9X9 BLACK & RED TILE VISIBLE AT SADDLE
		COVE BASE & MASTIC BLACK		108 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		GYPSUM BOARD & COMPOUND		90 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		NONE OBSERVED							NONE OBSERVED
1025CP	ROOM 102 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1025A	ROOM 102 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE TAN		17 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL PLASTER		153 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE-DENTED
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18- 40128
1025B	ROOM 102 CLOSET	9X9 FLOOR TILE & MASTIC RED/BLACK		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		27 LF	6 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		GYPSUM BOARD & COMPOUND		90 SF	0	6	5	O&M	GOOD CONDITION
		WINDOW/ GLAZING/CAULKING		18 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1025BCP	ROOM 102 CLOSET CEILING PLENUM	2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13- 27816; ABATED JCB#17- 37469
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18- 40128
		NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1026	ROOM 101 VESTIBULE	12X12 FLOOR TILE & MASTIC BEIGE		60 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED-9X9 BLACK & RED TILE VISIBLE AT SINK
		COVE BASE & MASTIC BLACK		25 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		GYPNUM BOARD & COMPOUND		29 SF	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE PINHOLE		0					ABATED JCB#17-37469
1026CP	ROOM 101 VESTIBULE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1026A	ROOM 101 BOOK STORAGE ROOM	12X12 FLOOR TILE & MASTIC BLUE		168 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		57 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPNUM BOARD & COMPOUND		168 SF	0	6	5	O&M	GOOD CONDITION
		9X9 FLOOR TILE & MASTIC RED		30 SF	0	7	N/A NON FRIABLE	O&M	UNDER WINDOW CASEWORK
		12X12 FLOOR TILE & MASTIC BEIGE WC		850 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
1026B	ROOM 101	COVE BASE & MASTIC BLACK		100 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		GYPNUM BOARD & COMPOUND		143 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		75 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		260 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2x4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1026BCP	ROOM 101 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1026B1	ROOM 101 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE TAN		135 SF	12 LF	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
1026B2	ROOM 101 CLOSET	9X9 FLOOR TILE & MASTIC RED/WHITE		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		18 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		GYPSUM BOARD & COMPOUND		114 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
1026B2CP	ROOM 101 CLOSET CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1027	CORRIDOR ROOM 101-103A	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		GLAZED BLOCK MORTAR		576 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		340 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		6 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED PINHOLE		0					NON ASB JCB#13-27816 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1027CP	CORRIDOR ROOM 101-103A CEILING PLENUM	MUD JOINT PACKING		36 UNITS	0	6	5	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC PEBBLED		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL PLASTER		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED PINHOLE		0					NON ASB JCB#13-27816 TEM
1028CP	CORRIDOR ROOM 104-114 CEILING PLENUM	MUD JOINT PACKING		78 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		COVE BASE & MASTIC GREEN		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		190 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		200 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		6 DOORS	0	7	7	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	7	7	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED PINHOLE		0					NON ASB JCB#13-27816 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1029CP	CORRIDOR CUSTODIAL- ASSISTANT PRINCIPAL CEILING PLENUM	MUD JOINT PACKING		26 UNITS	NOT QUANTIFIED	3	1	REPAIR	MINOR DAMAGE
1030	MAIN OFFICE	12X12 FLOOR TILE & MASTIC WHITE		355 SF	10 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		COVE BASE & MASTIC BLACK		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					FIBERGLASS, NOT SUSPECT
1030CP	MAIN OFFICE CEILING PLENUM	MUD JOINT PACKING		8 UNITS	0	6	5	O&M	GOOD CONDITION
1030A	MAIN OFFICE COAT CLOSET	9X9 FLOOR TILE & MASTIC WHITE W/BLACK		16 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		13 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING-LIMITED VISIBILITY
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
1030B	MAIN OFFICE SUPPLY CLOSET	12X12 FLOOR TILE & MASTIC WHITE		35 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		17 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1030C	MAIN OFFICE KITCHENETTE	12X12 FLOOR TILE & MASTIC WHITE		190 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		55 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		72 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2x4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
1030CCP	MAIN OFFICE KITCHENETTE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1031	TELEPHONE ROOM (WALL REMOVED PART OF CORRIDOR)	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		FIRE DOOR INSULATION WOOD		0					DOOR REMOVED
		1X1 CEILING TILE FISSURE		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
1032	STORAGE ROOM/SECURITY CLOSET	FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1033	PRINCIPAL'S OFFICE	CARPET MASTIC		0					NEW CARPET OBSERVED
		COVE BASE & MASTIC BLACK		0					NEW COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1033CP	PRINCIPAL'S OFFICE CEILING PLENUM	2X4 CEILING TILE TEXTURED		0					FIBERGLASS, NOT SUSPECT
		NONE OBSERVED							NONE OBSERVED
		CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		49 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE TAN		234 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1033A	PRINCIPAL'S BATHROOM	FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
		CARPET MASTIC		12 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		10 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
1033B	PRINCIPAL'S COAT CLOSET	FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1034	NURSE'S OFFICE	9X9 FLOOR TILE & MASTIC		0					ABATED JCB # 11-20847
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ASB JCB#13-27816 TEM
		2X2 CEILING TILE SPLASH		0					NON ASB JCB#13-27816 TEM
1034CP	NURSE'S OFFICE CEILING PLENUM	2X4 CEILING TILE		0					ABATED JCB # 11-20847
		NONE OBSERVED							NONE OBSERVED
		9X9 FLOOR TILE & MASTIC		0					ABATED JCB # 11-20847
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING-IN SHELF		1 UNIT	0	6	5	O&M	NO ACCESS; PREVIOUSLY GOOD CONDITION
1034ACP	NURSE'S STORAGE CLOSET	2X2 CEILING TILE SMOOTH		0					NON ASB JCB#13-27816 TEM
		2X4 CEILING TILE		0					ABATED JCB # 11-20847
		NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1034B	NURSE'S BATHROOM	CERAMIC FLOOR TILE GLUE		0					NON ASB ENVIROSCIENCE, 2010
		CERAMIC WALL TILE GLUE		0					NON ASB ENVIROSCIENCE, 2010
		MIRROR MASTIC		0					NOT SUSPECT
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SPECKLED/SPLASH		0					NON ASB JCB#13-27816 TEM
		CEILING PLASTER		0					NON ASB ENVIROSCIENCE, 2010
1034BCP	NURSE'S BATHROOM CEILING PLENUM	MUD JOINT PACKING		4 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1034C	NURSE'S SMALL OFFICE	9X9 FLOOR TILE & MASTIC		0					ABATED JCB#11-20847
		COVE BASE & MASTIC BROWN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ASB JCB#13-27816 TEM
		2X4 CEILING TILE		0					ABATED JCB#11-20847
1034CCP	NURSE'S SMALL OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1034D	NURSE'S PSYCHOLOGIST OFFICE	9X9 FLOOR TILE & MASTIC		0					ABATED JCB# 11-20847
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW GLAZING/CAULKING		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1034D	NURSE'S PSYCHOLOGIST OFFICE	2X2 CEILING TILE SMOOTH/SPLASH		0					NON ASB JCB#13-27816 TEM
		2X4 CEILING TILE		0					ABATED JCB# 11-20847
		NONE OBSERVED							NONE OBSERVED
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		WALL/CHALK-BOARD MASTIC		60 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1035	CORRIDOR MAIN ENTRANCE - MAIN OFFICE	WINDOW GLAZING/CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED PINHOLE		0					NON ASB JCB#13-27816 TEM
		GYPSUM BOARD & COMPOUND		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1035CP	CORRIDOR MAIN ENTRANCE - MAIN OFFICE CEILING PLENUM	MUD JOINT PACKING		23 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; 2 ABATED JCB# 11-21121

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1036	CAFETERIA	9X9 FLOOR TILE & MASTIC		2700 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC LIGHT BLUE		2700 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		154 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW GLAZING/CAULKING		456 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		6 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE PINHOLE		0					CONF ASB JCB #13-27816; ABATED JCB #17-37469
		WOOD FLOOR TAR/VAPOR BARRIER		1620 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC TAN W. BROWN		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1036A	STAGE	CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL PLASTER		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE CURTAINS BLUE		1520 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		ELECTRIC WIRE INSULATION BLACK		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER		0					NON ASB JCB #18-40128
1036A1	STAGE CLOSET #1	WOOD FLOOR TAR/VAPOR BARRIER		96 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1036A2	STAGE CLOSET #2	WOOD FLOOR TAR/VAPOR BARRIER		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		96 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1037	KITCHEN	CERAMIC FLOOR TILE GROUT & GLUE RED		1480 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE RED		200 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW GLAZING/CAULKING		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1037CP	KITCHEN CEILING PLENUM	1X2 CEILING TILE METAL PAN		0					METAL, NOT SUSPECT
		MUD JOINT PACKING		1 UNIT	0	6	5	O&M	LIMITED VISUAL ACCESS
		CERAMIC FLOOR TILE GROUT & GLUE RED		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE RED		22 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1037A	KITCHEN EXIT TO SLOP SINK	CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW GLAZING/CAULKING		8 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		1X1 CEILING TILE METAL PAN		0					METAL, NOT SUSPECT

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1037A1	KITCHEN SLOP SINK	CERAMIC FLOOR TILE GROUT & GLUE RED		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE RED		36 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	MISSING-LIMITED VISIBILITY
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
1037B	KITCHEN FOOD STORAGE	CERAMIC FLOOR TILE GROUT & GLUE RED		220 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE RED		61 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW GLAZING/CAULKING		10 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		VIBRATION REDUCER CLOTH		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		14 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		220 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1037C	KITCHEN BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		72 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL BASE GROUT & GLUE TAN		34 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE TAN		228 SF	4 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING GROUT
		MIRROR MASTIC		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYP SUM BOARD & COMPOUND		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		10 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		1X1 CEILING TILE DOT		0					NOT OBSERVED
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
		9X9 FLOOR TILE & MASTIC		570 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
1038	FACULTY ROOM	12X12 FLOOR TILE & MASTIC BLUE		570 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		108 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		32 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING GREY		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1038CP	FACULTY ROOM CEILING PLENUM	MUD JOINT PACKING		3 UNITS	0	6	5	O&M	LIMITED VISUAL ACCESS
1039	MEN'S BATHROOM BY GYM	CERAMIC FLOOR TILE GROUT & GLUE RED		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		324 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		4 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
1040	WOMEN'S BATHROOM BY GYM	CERAMIC FLOOR TILE GROUT & GLUE PINK		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION- PATCHED
		CERAMIC WALL TILE GROUT & GLUE PINK		324 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		5 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
1041	TEACHERS COPY ROOM	12X12 FLOOR TILE & MASTIC WHITE		170 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		54 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW/ GLAZING/CAULKING		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1042	MAIN CUSTODIAN AREA	12X12 FLOOR TILE & MASTIC BLUE		675 SF	20 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, & MISSING
		COVE BASE & MASTIC BLACK		135 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		GYPSUM BOARD & COMPOUND		142 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	HOLE & PEEING
		WOOD PANEL MASTIC		142 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		90 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		3 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER TEXTURED (BROWN COAT ONLY)		0					NON ASB JCB#18-40128
1042A	CUSTODIAN BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE RED		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		4 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1042B	CUSTODIAL CAGE STORAGE ROOM	CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER TEXTURED (BROWN COAT ONLY)		0					NON ASB JCB#18-40128

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1042C	FORMER PTA STORAGE ROOM	CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					POURED CONCRETE, NOT SUSPECT
		RETURN DRUM INSULATION		100 SF	0	6	5	O&M	CONF ORIGINAL AMP; NOT IDENTIFIED DURING SAMPLING JCB#18-39996
1043	BOILER ROOM	WATER TANK MUD PACKING MATERIAL		0					NON ASB JCB#17-36667
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					NON ASB JCB#17-36667; NON ASB JCB#18-39996
1043A	WATER VALVE ROOM/STORAGE	CONCRETE BLOCK & MORTAR		0					POURED CONCRETE, NOT SUSPECT
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		0					ABATED ENVIROSCIENCE, 2010
		PIPE INSULATION		0					ABATED ENVIROSCIENCE, 2010
1043B	MAIN ELECTRIC ROOM	12X12 FLOOR TILE TAN W. BROWN		N/A	0	7	N/A NON FRIABLE	O&M	STORED
		CONCRETE BLOCK & MORTAR		0					POURED CONCRETE, NOT SUSPECT
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1044	PTA CLOSET (OLD BATHROOM/STORAGE BY CUSTODIAN OFFICE)	CERAMIC FLOOR TILE GROUT & GLUE RED		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		360 SF	5 LF	4	N/A NON FRIABLE	REPAIR	MISSING GROUT
		MIRROR MASTIC		0					NO MASTIC, NOT SUSPECT
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1045	200 VESTIBULE	12X12 FLOOR TILE & MASTIC BLUE		64 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					FIBERGLASS, NOT SUSPECT
1045CP	200 VESTIBULE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1045A	PE OFFICE	12X12 FLOOR TILE & MASTIC BLUE		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		36 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE FISSURE		0					NON ASB JCB#13-27816 TEM
1045ACP	PE OFFICE CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1045A1	PE OFFICE BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE RED		49 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		236 SF	3 LF	4	N/A NON FRIABLE	REPAIR	MISSING GROUT
		MIRROR MASTIC		3 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1045B	MUSIC ROOM	CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22108)
		12X12 FLOOR TILE & MASTIC BLUE		512 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		CERAMIC WALL BASE GROUT & GLUE WHITE		96 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17- 36668
		WALL/CHALK-BOARD MASTIC		75 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1045B1	MUSIC ROOM CLOSET	FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#17- 36668
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		12 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING (WALL CHASE)		1 UNITS	0	6	5	O&M	LIMITED VISUAL ACCESS
		CEILING GYPSUM BOARD		16 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1045B2	MUSIC ROOM STORAGE	TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					CONFIRMED NON-ACM (ECI JOB #22108)
1046	GYMNASIUM	CEILING GYPSUM BOARD & COMPOUND		24 SF	4 SF	4	N/A NON FRIABLE	REPAIR	HOLES-CUT
		WOOD FLOOR TAR/VAPOR BARRIER		0					CONFIRMED NON ACM (ECL JOB #22963)
		COVE BASE & MASTIC BLACK		0					CONFIRMED NON ACM (ECL JOB #22963)
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		896 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		6 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		6 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		PIPE INSULATION		66 LF	0	6	5	O&M	GOOD CONDITION
1046A	GYM STORAGE CLOSET 1	TECTUM DECKING		3744 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WOOD FLOOR TAR/VAPOR BARRIER		104 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		42 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		104 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1046B	GYM STORAGE CLOSET 2	WOOD FLOOR TAR/VAPOR BARRIER		70 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		70 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	HOLE
1046C	GYM STORAGE CLOSET 3	WOOD FLOOR TAR/VAPOR BARRIER		108 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		COVE BASE & MASTIC BLACK		48 LF	1 LF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW/ GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		108 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1047	ROOM 201/201A VESTIBULE	9X9 FLOOR TILE & MASTIC		0					ABATED 2004 REINSPECTION
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
		FLOOR TILE & MASTIC		0					ABATED 2004 REINSPECTION
1047A	ROOM 201 A/PC CONSULTANT ROOM	COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		3 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1047ACP	ROOM 201 A/PC CONSULTANT ROOM CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1047A1	ROOM 201 A BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		54 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE TAN		280 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		2 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1047B	ROOM 201	CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
		9X9 FLOOR TILE & MASTIC		0					ABATED 2004 REINSPECTION
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABTAMENT
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17-36668
		GYPSUM BOARD & COMPOUND		0					NON ASB JCB#17-36668
		WALL/CHALK-BOARD MASTIC		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#17-36668

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1047B1	ROOM 201 EXIT VESTIBULE	12X12 FLOOR TILE & MASTIC WHITE W. BLACK		45 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		14 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#17-36668
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1047B2	ROOM 201 EXIT VESTIBULE BATHROOM	FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		NONE OBSERVED							NONE OBSERVED
		CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE TAN		392 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION- PATCHED
1047B1	ROOM 201 EXIT VESTIBULE BATHROOM	MIRROR MASTIC		4 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#17-36668

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1048	LIBRARY	CEILING TILE		0					ABATED EVIROSCIENCE, 2002
		9X9 FLOOR TILE & MASTIC		0					ABATED EVIROSCIENCE, 2002
		COVE BASE & MASTIC BLUE-GREEN		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WINDOW GLAZING/CAULKING		240 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		3 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1048CP	LIBRARY CEILING PLENUM	2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27816 TEM
		CEILING GYPSUM BOARD & COMPOUND		300 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	NOT OBSERVED; PREVIOUSLY JOINT COMPOUND MISSING
		NONE OBSERVED							NONE OBSERVED
		CERAMIC FLOOR TILE GROUT & GLUE PINK		160 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL TILE GROUT & GLUE PINK		486 SF	3 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1049	GIRL'S BATHROOM BY ROOM 201	WINDOW GLAZING/CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (EC1 JOB #23546)
1050	CUSTODIAN SLOP SINK BY ROOM 201	CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		35 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1051	BOYS BATHROOM BY ROOM 201	CERAMIC FLOOR TILE GROUT & GLUE BROWN		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE WHITE		486 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
1052	Room 202	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BEIGE W. BROWN		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	9X9 EXPOSED. CRACKED & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1052CP	Room 202 CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
1052CP	Room 202 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1053	COMPUTER STORAGE	CERAMIC FLOOR TILE GROUT & GLUE TAN WITH WHITE		106 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		GYP SUM BOARD & COMPOUND		352 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	DENTED
		FIRE DOOR INSULATION WOOD		2 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE FIBERGLASS		0					FIBERGLASS, NOT SUSPECT
		CEILING PLASTER SMOOTH		0					NON ASB JCB#18-40128
1053CP	COMPUTER STORAGE CEILING PLENUM	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
1054	ROOM 203	12X12 FLOOR TILE & MASTIC WHITE W. BROWN		810 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		89 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		KILN FIRE BRICK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		2X4 CEILING TILE SPLASH		0					NON ASB JCB#13-27816 TEM
1054CP	ROOM 203 CEILING PLENUM	MUD JOINT PACKING		4 UNITS	0	6	5	O&M	LIMITED VISUAL ACCESS

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1055	ROOM 204	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE-VISIBLE BY SINK
		12X12 FLOOR TILE & MASTIC WHITE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		NONE OBSERVED							NONE OBSERVED
1056	ART STORAGE ROOM	9X9 FLOOR TILE & MASTIC WHITE W/ BLACK		140 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		51 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD & COMPOUND		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1057	ROOM 205	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		2X4 CEILING TILE SPLASH		0					NON ASB JCB#13-27816 TEM
1057CP	ROOM 205 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1058	ROOM 203A	12X12 FLOOR TILE & MASTIC WHITE/MULTI COLOR		480 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		85 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
1058CP	ROOM 203A CEILING PLENUM	NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1059	ROOM 206	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE-VISIBLE BY SINK
		12X12 FLOOR TILE & MASTIC BEIGE W. BROWN		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		NONE OBSERVED							NONE OBSERVED
1059CP	ROOM 206 CEILING PLENUM								
1060	ROOM 207	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		175 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		NONE OBSERVED							

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1060CP	ROOM 207 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1061	ROOM 208	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BLUE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1061CP	ROOM 208 CEILING PLENUM	METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
		NONE OBSERVED							NONE OBSERVED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1062	ROOM 209	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		GYPNUM BOARD & COMPOUND		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		175 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
1062CP	ROOM 209 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1063	ROOM 210	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE-VISIBLE BY DOOR SADDLE
		12X12 FLOOR TILE & MASTIC WHITE		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		111 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					ABATED JCB#17-37469

Summary of Asbestos Containing Materials


SPACE No.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1063CP	ROOM 210 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1064	ROOM 211	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		111 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		GYP SUM BOARD & COMPOUND		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X4 CEILING TILE PINHOLE		0					CONF ASB JCB#13-27816; ABATED JCB#17-37469
1064CP	ROOM 211 CEILING PLENUM	NONE OBSERVED							NONE OBSERVED
1065	CORRIDOR ROOM 210 TO LIBRARY	12X12 FLOOR TILE & MASTIC GREEN		0					NEW MATERIAL
		TERRAZZO FLOORING		0					CONFIRMED NON-ACM (ECI JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ASB ENVIROSCIENCE#20349
		WALL/CHALK-BOARD MASTIC		500 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		48 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		70 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27816 TEM

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
106SCP	CORRIDOR ROOM 210 TO LIBRARY CEILING PLENUM	MUD JOINT PACKING		74 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

Appendix C

DRAWINGS

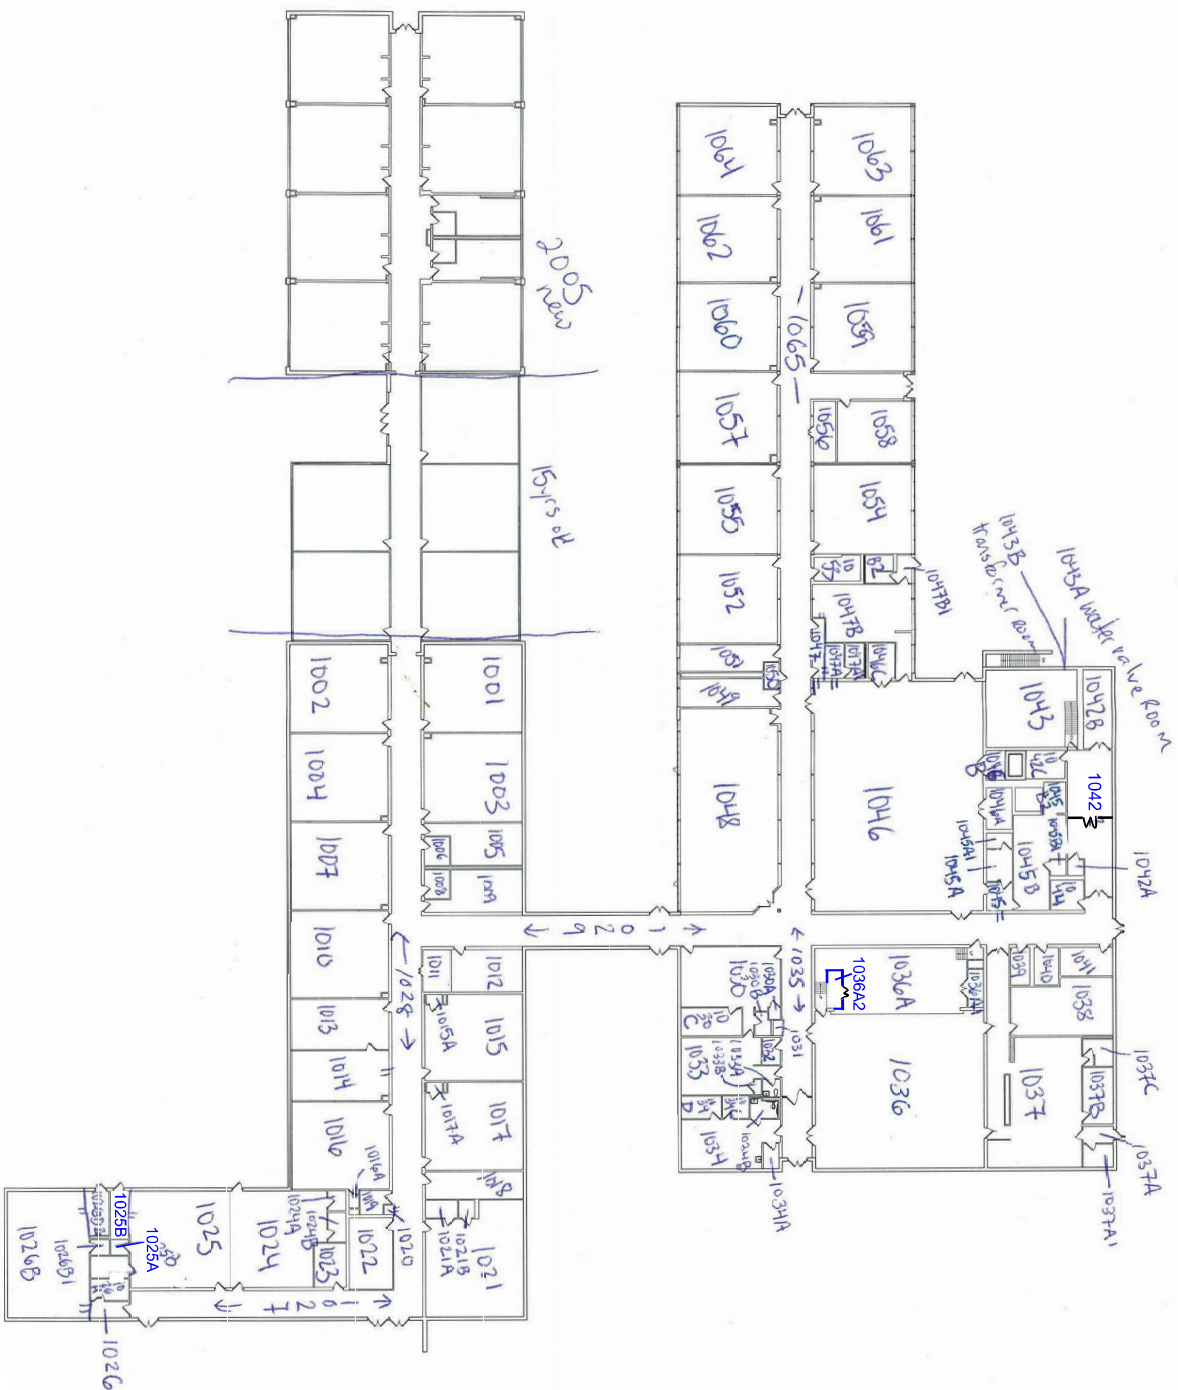

Appendix D

CERTIFICATIONS

WE ARE YOUR DOL

 **NEW YORK STATE** Department of Labor

DIVISION OF SAFETY & HEALTH LICENSE AND CERTIFICATE UNIT, STATE OFFICE CAMPUS, BLDG. 12, ALBANY, NY 12226

ASBESTOS HANDLING LICENSE

Enviroscience Consultants, LLC
2150 Smithtown Avenue, Ronkonkoma, NY, 11779

License Number: 28733
License Class: RESTRICTED
Date of Issue: 11/04/2022
Expiration Date: 11/30/2023
Duly Authorized Representative: Bartley Gallagher

This license has been issued in accordance with applicable provisions of Article 30 of the Labor Law of New York State and of the New York State Codes, Rules and Regulations (12 NYCRR Part 56). It is subject to suspension or revocation for a (1) serious violation of state, federal or local laws with regard to the conduct of an asbestos project, or (2) demonstrated lack of responsibility in the conduct of any job involving asbestos or asbestos material.

This license is valid only for the contractor named above and this license or a photocopy must be prominently displayed at the asbestos project worksite. This license verifies that all persons employed by the licensee on an asbestos project in New York State have been issued an Asbestos Certificate, appropriate for the type of work they perform, by the New York State Department of Labor.


Amy Phillips, Director
For the Commissioner of Labor

EXCELSIOR

Appendix E

NOTICE TO SHORT TERM WORKERS

NOTICE TO SHORT TERM WORKERS

All workers entering the Signal Hill Elementary School and/or the 3 Sheds must sign in, thereby acknowledging the presence and locations of asbestos containing building materials in the building. No work will be allowed in the areas listed without prior approval from the AHERA Designated Person for the Half Hollow Hills School District.

Sign in sheets will be picked up at the time of the Six Month AHERA Surveillance and will be placed in the buildings Asbestos Management Plan.

Asbestos containing materials and their locations at Signal Hill Elementary School and 3 Sheds are listed in the AHERA Management Plan, which is available for review, upon request.

[illegible]

Appendix F
BULK SAMPLE RESULTS

ELAP # 11681; NVLAP Lab Code 200531-0

ASBESTOS BULK SAMPLE RESULTS

CLIENT:	Half Hollow Hills CSD 525 Half Hollow Road, Dix Hills, NY 11746	SAMPLE DATE:	6/13/2023
PROJECT NAME:	AHERA Six-month Surveillance - May 2023	DATE RECEIVED:	6/14/2023
JOB #:	23546	AREA:	Signal Hill Elementary School - Terrazzo
PAGE #:	1 of 1	SAMPLER:	Pamela Chadderton
		CUSTODY #:	35333

Lab ID	Sample #	Description	Color	Location	Total Asbestos Result	% Asbestos-type	% Non-asbestos Fibers-type	% Matrix-type
99598	TF1	Terrazzo Floor	White w/ Brown	Corridor 104 to 114 (AHERA #1028)	None Detected		2.0% cellulose	98.0% cement
99599	TF2	Terrazzo Floor	White w/ Brown	Corridor Room 210 to Library (AHERA #1065)	None Detected		2.0% cellulose	98.0% cement

Method: EPA 600/M4-82/20, 600/R-93/116, NYS DOH ELAP Item 198.1, 198.4, 198.6, 198.8.

ACM: Asbestos Containing Materials contain more than 1%.

None Detected - No asbestos found in samples using polarized light microscopy (PLM). Trace - Asbestos found is 1% or less, not considered ACM.

None Detected by TEM - No asbestos found in samples using transmission electron microscopy (TEM) and polarized light microscopy (PLM) was found to be negative.

Negative by Weight - After matrix reduction, the remainder is less than 1% and, therefore, cannot fulfill the definition of asbestos containing material.

Inconclusive - No asbestos found in non-friable organically bound samples using polarized light microscopy (PLM).

Method ELAP 198.6 does not remove vermiculite and may underestimate the level of asbestos present in a sample containing greater than 10% vermiculite. Samples of Surface Material that contain Vermiculite are analyzed by ELAP 198.8 for conclusive result.

This report may not be reproduced without the express permission of Enviroscience Consultants, LLC. This report cannot be used to claim endorsement of products by NVLAP or any agency of the U.S. Government. Test results only reflect conditions at the time the samples were taken.

ANALYZED BY: *Pamela Chadderton*

PLM DATE: 6/15/2023

ANALYZED BY: _____

TEM DATE: _____

DIRECTOR: *Edward M. Stanton*

DATE: 6/19/2023

REVISION #: 0

REVISION DATE: 6/19/2023