

Half Hollow Hills CSD
Six Month AHERA Surveillance
Vanderbilt Elementary School & 1 Garage
May 2023



2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project #23546

Six Month AHERA Surveillance

Performed at

Vanderbilt Elementary School & 1 Garage
350 Deer Park Avenue
Dix Hills, NY 11746

for

Half Hollow Hills CSD
Administration Building
525 Half Hollow Road
Dix Hills, NY 11746


May 2023

Prepared by:

Enviroscience Consultants, LLC
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #23546

Inspector & Management
Planner:


Bartley Gallagher

NYSDOL #92-13892

Inspectors: 
Alexis Bruno

NYSDOL #21-08575


Pamela Chadderton

NYSDOL #15-10408

Six Month AHERA Surveillance

Table of Contents

- I. Summary**
- II. Inspection and Recommendations**
- III. Bulk Sampling Protocol**
- IV. Hazard Rank Determination**
- V. AHERA Reassessment Category**

Appendix A - Inventory of Damaged Asbestos Containing Materials

Appendix B - Inventory of Asbestos Containing Materials

Appendix C - Drawings - Functional Space Number Floor Plans

Appendix D - Certifications

Appendix E - Notice to Short Term Workers

Appendix F - Bulk Sample Results

I. Summary

A six month AHERA surveillance for the Vanderbilt Elementary School and 1 Garage of the Half Hollow Hills CSD was performed by Ms. Alexis Bruno and Mrs. Pamela Chadderton of Enviroscience Consultants, LLC on June 7, 2023.

The six month surveillance was performed in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Ms. Bruno and Mrs. Chadderton are certified AHERA Inspectors.

Ms. Bruno and Mrs. Chadderton performed the on-site investigation, which included examining existing ACBM, evaluating the condition of the ACBM, and determining if originally non-friable materials have become friable. The physical condition of most of the ACBM found in this building did not change.

After studying the inspection reports, Mr. Bartley M. Gallagher, a certified EPA/AHERA Inspector and Management Planner, developed the recommendations for response actions depending on his evaluation of the hazard that each material may cause.

An Inventory of Asbestos Containing Materials by location, including the AHERA Functional Space identification number is in Appendix B. This inventory includes the material, quantity, amount damaged, the hazard level, the AHERA Reassessment category, and recommended response actions. A remarks column includes sampling and abatement action and other pertinent information.

Floor plans correlating the AHERA Functional Space ID number with the current common location names are in Appendix C.

II. Inspection and Recommendations

The inspector entered all accessible spaces to inspect and physically assess the condition and friability of all previously known or assumed ACBM. The inspector noted any change in condition of remaining materials, materials that have been abated since the last reinspection, and any materials that were either not identified, or may have been improperly classified.

Unless otherwise stated, a recommendation for removal is a suggestion that the materials be removed as soon as the school's budget will allow.

During this inspection there was damage noted, repairs should be made. Please reference your Summary of Damaged Asbestos Containing Materials found in Appendix A.

Since the last surveillance, the following asbestos abatement activities were performed:

In June 2023, bulk samples were collected of tectum decking and terrazzo floor at various locations throughout the Building Interior. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #35290 for detailed sample location information and results.

In May 2023, asbestos containing pipe fitting insulation was removed from the Cafeteria Stage (AHERA space #1070B), and the Gymnasium (AHERA space #1063). Please reference Enviroscience Consultants, LLC job #23162.

In March 2023, bulk samples were collected of the window glazing compound in the Corridor Faculty Room to Gym (AHERA space #1074). Results confirmed the material sampled to be non-asbestos containing.

Please reference Enviroscience Consultants, LLC chain of custody #34850 for detailed sample location information and results.

In September 2022, a small amount of asbestos containing pipe fitting insulation was removed from the ceiling in the Hallway at Room 113 (AHERA space #1010CP). Please reference Enviroscience Consultants, LLC job #22770.

History:

In July 2022, bulk samples were collected of the 1'x1' acoustical wall tile and mastic in Room 204 Music (AHERA space #1050), and the bulletin board field material in Room 203 (AHERA space #1048) and the NE Storage (AHERA space #1060). Results confirmed the 1'x1' acoustical wall tile mastic in Room 204 Music to be asbestos containing material; all the other materials sampled were confirmed to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #33593 for detailed sample location information and results.

In April 2022, bulk samples were collected of the 12"x12" floor tile and floor tile mastic in Room 203 (AHERA space #1048). Results confirmed the materials sampled to be asbestos containing. Please reference Enviroscience Consultants chain of custody #32556 for detailed sample location information and results.

In November 2021, Enviroscience Consultants was retained by the Half Hollow Hills Central School District to perform the surveillance inspections and three year reinspections in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Any information pertaining to the assessment and changes in condition of ACBM prior to November 2021 must be obtained from the records maintained by the Half Hollow Hills Central School District.

Any damaged material that is assumed to be asbestos containing should be sampled to confirm that it is identified as ACBM before initiating repair procedures.

The inspector did not access any flooring materials located under carpeting or new tiles because obtaining access would damage the carpet or new tiles. Prior to disturbing any carpets or removing new floor tiles, the school should ascertain whether floor tiles are located beneath them. Repair or replace damaged floor tiles as noted. We have prepared an inventory of asbestos containing materials for the building. These pages list the current damage category, changes in physical condition, current priority levels, changes in response actions, and bulk sampling and abatement information (see Appendix B).

All materials are currently classified as non-friable in their present condition, except for damaged thermal insulation materials, gypsum board and joint compound.

III. Bulk Sampling Protocol

Thermal System Insulation - Three (3) samples are randomly collected for each homogeneous material of Thermal System Insulation (TSI). AHERA states that for each area of patched TSI at least one (1) sample be collected.

Surfacing Materials - a minimum of three (3), five (5) or seven (7) samples based upon the amount of suspect material present.

Miscellaneous Materials - require a minimum of two (2) samples.

New York State Revisions to Analytical Methods

Over the years, the New York State Department of Health has made several revisions to testing requirements that affect suspect asbestos materials in school buildings. These changes have resulted in the requirement to re-sample and analyze certain materials to comply with the revised analytical methods:

Surfacing Materials - In May 2016, the New York State Department of Health (NYSDOH) finalized testing requirements and approved a new analytical method for analysis of surfacing materials that contain vermiculite. Surfacing materials that could contain vermiculite include spray-on fireproofing, wall plaster, and ceiling plaster. Unfortunately, the previous analysis method for fireproofing and plasters did not specifically require that the vermiculite percentage be reported. The District must now consider any spray or troweled fireproofing or plaster materials to be presumed asbestos containing materials (PACM) until they are re-tested to conform to the new requirements. As a result, we have added any plaster previously classified as non-asbestos to the Inventory of Asbestos Containing Materials. Re-testing of any fireproofing or plaster materials will be noted in the narrative and will be shown in the Inventory.

Ceiling Tile - In August 2012, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in ceiling tiles that contain cellulose. Any ceiling tiles that have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Any re-testing of ceiling tiles will be noted in the narrative and will be shown in the Inventory. The District should keep records for any new non-asbestos ceiling tiles that are installed, including the location, brand, model number, date of manufacture, and date of installation.

Floor Tile and Other NOB Materials - In 1992, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in non-friable organically bound (NOB) materials such as floor tiles and roofing materials. As such, any floor tiles and mastic which have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Re-testing of any floor tile, mastic or other NOB materials will be noted in the narrative and will be shown in the Inventory.

During this surveillance, bulk samples were collected of tectum decking and terrazzo floor at various locations throughout the Building Interior. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #35290 in Appendix 'F' for detailed sample location information and results.

IV. Hazard Rank Determination

For each homogeneous material, a response action priority level is determined depending on its physical condition, location, and potential for future damage. Materials were classified into seven categories, based upon the type, condition, and potential for damage of the ACBM. The categories are as follows:

Hazard Rank	ACBM Condition	ACBM Disturbance Potential
1	Significantly Damaged	Any Potential for Damage
2	Damaged	Potential for Significant Damage
3	Damaged	Potential for Damage
4	Damaged	Low Potential for Damage
5	Good	Potential for Significant Damage
6	Good	Potential for Damage
7	Good	Low Potential for Damage

The district shall select and implement in a timely manner the appropriate response actions consistent with the assessment category. The response actions selected shall be sufficient to protect human health and the environment. The district may then select, from the response actions which protect human health and the environment, that action which is the least burdensome method. Nothing in this section shall be construed to prohibit removal of ACBM from a school building at any time, should removal be the preferred response action of the district.

If damaged or significantly damaged thermal system insulation ACM is present in a building, the district shall:

- (1) At least repair the damaged area.
- (2) Remove the damaged material if it is not feasible, due to technological factors, to repair the damage.
- (3) Maintain all thermal system insulation ACM and its covering in an intact state and undamaged condition.

If damaged friable surfacing ACM or damaged friable miscellaneous ACM is present in a building, the district shall select from among the following response actions: encapsulation, enclosure, removal, or repair of the damaged material.

In selecting the response action from among those which meet the definitional standards in §763.83, the district shall determine which of these response actions protects human health and the environment. For purposes of determining which of these response actions are the least burdensome, the district may then consider local circumstances, including occupancy and use patterns within the school building, and its economic concerns, including short and long-term costs.

V. AHERA Reassessment Category

The Management Planner is also required to classify each friable and thermal system insulation (TSI) ACBM and suspected ACBM assumed to be ACM in the school building into one of the following AHERA 1 through 7 reassessment categories based on damage, potential for damage, and material category:

- (1) Damaged or significantly damaged thermal system insulation ACM.
- (2) Damaged friable surfacing ACM.

- (3) Significantly damaged friable surfacing ACM.
 - (4) Damaged or significantly damaged friable miscellaneous ACM.
 - (5) ACBM with potential for damage.
 - (6) ACBM with potential for significant damage.
 - (7) Any remaining friable ACBM or friable suspected ACBM.
- N/A Not Applicable

Appendix A

INVENTORY OF DAMAGED ASBESTOS CONTAINING MATERIALS

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1001A	ROOM 115 CLOSET	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		36 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
1002	ROOM 114	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		1000 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1002CP	ROOM 114 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1002B	ROOM 114 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BROWN		18 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
1003CP	GIRL'S BATHROOM NEAR ROOM 114 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1006	CUSTODIAL CLOSET NEAR ROOM 114	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		54 SF	26 SF	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, DEBRIS & MISSING W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		20 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING W/ MASTIC EXPOSED
1007	COPY ROOM NEAR ROOM 113	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		155 SF	1 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
1008	ROOM 113	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		1000 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		110 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
1009	ROOM 112	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		1000 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1009CP	ROOM 112 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1010CP	CORRIDOR ROOM 112 - ROOM 115 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1012	ROOM 107	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
1012CP	ROOM 107 CEILING PLENUM	GYPSUM BOARD		16 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
1013	ROOM 106	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1013CP	ROOM 106 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1014	ROOM 105	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1014CP	ROOM 105 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1015	ROOM 104	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED w/ MASTIC EXPOSED
1015CP	ROOM 104 CEILING PLENUM	MUD JOINT PACKING		17 UNITS	NOT QUANTIFIED	4	1	REPAIR	DAMAGED
1016	LIBRARY	COVE BASE & MASTIC BLUE		100 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1016CP	LIBRARY CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1016A	LIBRARY SERVER CLOSET	COVE BASE & MASTIC BROWN		30 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
1018	ROOM 109	12X12 FLOOR TILE & MASTIC BEIGE WITH MULTI COLORS		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED w/ MASTIC EXPOSED
1018CP	ROOM 109 CEILING PLENUM	GYPNUM BOARD & COMPOUND		60 SF	NOT QUANTIFIED	3	4	REPAIR	DAMAGED WITH DEBRIS
1019	MEN'S FACULTY BATHROOM ACROSS ROOM 108	CERAMIC WALL BASE GROUT & GLUE BEIGE		279 SF	5 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING GROUT
1020	WOMEN'S FACULTY BATHROOM NEAR 108	CERAMIC FLOOR TILE GROUT & GLUE BROWN		72 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
1020A	ROOM 109A VESTIBULE	12X12 FLOOR TILE & MASTIC BEIGE WITH MULTI COLORS		72 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED w/ MASTIC EXPOSED
1020B	READING STORAGE ROOM	12X12 FLOOR TILE & MASTIC BEIGE WITH MULTI COLORS		800 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED w/ MASTIC EXPOSED
		FIBERBOARD		300 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
1021	ROOM 103	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1022	ROOM 102	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
1023	ROOM 101	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
1024	CORRIDOR ROOM 101-110	WALL/CHALK-BOARD MASTIC		220 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED, PAINTED OVER
1024CP	CORRIDOR ROOM 101-110 CEILING PLENUM	GYPNUM BOARD & COMPOUND		50 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
1026	MAIN OFFICE	12X12 FLOOR TILE & MASTIC WHITE		510 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
1026A	MAIN OFFICE STORAGE	COVE BASE & MASTIC BLACK		20 LF	3 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
1026B	MAIN OFFICE KITCHEN	COVE BASE & MASTIC BLACK METAL SINK UNDERCOATING BLACK		55 LF 1 UNIT	3 LF NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED MINOR DAMAGE
1027	PSYCHOLOGIST OFFICE	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		140 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		GYPNUM BOARD & COMPOUND		50 SF	< 1 SF	3	4	REPAIR	DENT
1028C	NURSE MECHANICAL ROOM	DUCT INSULATION CLOTH		154 SF	2 LF	4	N/A NON FRIABLE	REPAIR	TORN
1029	CUSTODIAL CLOSET BY NURSE OFFICE	12X12 FLOOR TILE & MASTIC GREY		25 SF	25 SF	4	N/A NON FRIABLE	REPAIR	FLOOR TILE REMOVED, MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		14 LF	14 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
1030	STORAGE ROOM ADJACENT ROOM 124	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		120 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
1030CP	STORAGE ROOM ADJACENT ROOM 124 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1031	ROOM 124	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1032	ROOM 123	12X12 FLOOR TILE & MASTIC WHITE WITH BROWN		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
1034	ROOM 122	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
1035	RESOURCE ROOM	COVE BASE & MASTIC BLACK		85 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		FIBERBOARD		245 SF	2 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & SEPARATING
1038	BOY'S BATHROOM NEAR ROOM 120	CERAMIC FLOOR TILE GROUT & GLUE BEIGE		180 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL GROUT & GLUE BEIGE		318 SF	4 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING GROUT
1039	GIRL'S BATHROOM NEAR ROOM 120	CERAMIC FLOOR TILE GROUT & GLUE BROWN		180 SF	1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL GROUT & GLUE BEIGE		318 SF	< 1 LF	4	N/A NON FRIABLE	REPAIR	GROUT MISSING
1041	ROOM 118	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & LIFTING FROM WATER DAMAGE
1042	ROOM 117	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	DENTED
1043	ROOM 116	12X12 FLOOR TILE & MASTIC BEIGE WITH MULTI COLORS		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
1043CP	ROOM 116 CEILING PLENUM	MUD JOINT PACKING		18 UNITS	NOT QUANTIFIED	4	1	REPAIR	DAMAGED
1044	ROOM 111	12X12 FLOOR TILE & MASTIC WHITE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
1047	CORRIDOR BREEZEWAY TO ROOM 203	WALL/CHALK-BOARD MASTIC		96 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
1048	ROOM 203	COVE BASE & MASTIC BROWN		75 LF	15 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1050	ROOM 204 MUSIC	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	9 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		COVE BASE & MASTIC BROWN		111 LF	7 LF	4	N/A NON FRIABLE	REPAIR	MISSING w/ MASTIC EXPOSED
		1X1 ACOUSTICAL WALL TILE & MASTIC FISSURE		250 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED; CONFIRMED ACM (ECI JOB #22542)
1051	MUSIC ENTRANCE VESTIBULE	CERAMIC WALL BASE GROUT & GLUE BEIGE		16 LF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
1051C	MUSIC ENTRANCE VESTIBULE BATHROOM	CERAMIC WALL BASE GROUT & GLUE BEIGE		21 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
1052	ROOM 205	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
1053A	ROOM 210 BATHROOM	CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
1054	ROOM 206	12X12 FLOOR TILE & MASTIC BEIGE WITH TAN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1054A	ROOM 206 BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		15 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	MISSING
1055	ROOM 207	12X12 FLOOR TILE MASTIC		810 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & LIFTING; CONF ASB ENVIROSCIENCE#20444
1056	ROOM 209	12X12 FLOOR TILE & MASTIC WHITE/BLACK		810 SF	15 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED w/ MASTIC EXPOSED; CONF ACM ECL #20444
1059A	ROOM 208 BATHROOM	CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED w/ MASTIC EXPOSED
1061CP	CORRIDOR ROOM 208 TO GYM CEILING PLENUM	MUD JOINT PACKING		15 UNITS	NOT QUANTIFIED	4	1	REPAIR	DUCT TAPED
1064	SPEECH ENTRANCE VESTIBULE	CERAMIC WALL BASE GROUT & GLUE BEIGE		10 LF	1 TILE	4	N/A NON FRIABLE	REPAIR	MISSING w/ MASTIC EXPOSED
1064A	ENTRANCE VESTIBULE BATHROOM	CERAMIC WALL BASE GROUT & GLUE TAN		21 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	MISSING w/ MASTIC EXPOSED

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Damaged Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1065A	ROOM 201 STORAGE	12X12 FLOOR TILE & MASTIC PEACH WATERCOLOR		114 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
1066	GIRL'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BROWN		180 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL BASE GROUT & GLUE BEIGE		428 SF	2 SF	4	N/A NON FRIABLE	REPAIR	CRACKED W/ MISSING GROUT & SEPARATING FROM WALL
1068	WOMEN'S BATHROOM	CERAMIC WALL TILE GROUT & GLUE TAN		252 SF	3 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
1069	MEN'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		80 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING W/ GLUE EXPOSED
1070	CAFETERIA	COVE BASE & MASTIC BLACK		230 LF	3 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		GYPNUM BOARD & COMPOUND		252 SF	< 1 SF	3	4	REPAIR	DENTED
1071	KITCHEN	COVE BASE & MASTIC BLACK		60 LF	8 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
1071CP	KITCHEN CEILING PLENUM	MUD JOINT PACKING		25 UNITS	NOT QUANTIFIED	4	1	REPAIR	MINOR DAMAGE
1071C	KITCHEN BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BROWN		49 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL BASE GROUT & GLUE TAN		25 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
1072	CUSTODIAL HALLWAY	12X12 FLOOR TILE & MASTIC WHITE WITH BROWN		256 SF	9 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
1072C	CUSTODIAL STORAGE	12X12 FLOOR TILE & MASTIC BEIGE		50 SF	46 TILES	4	N/A NON FRIABLE	REPAIR	MISSING TILES W/ MASTIC EXPOSED
1072D	HEAD CUSTODIAN OFFICE	12X12 FLOOR TILE & MASTIC WHITE WITH BROWN		112 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED/ WORN BY CHAIR
1075	FACULTY ROOM	12X12 FLOOR TILE & MASTIC WHITE WITH BROWN		729 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1080CP	CORRIDOR CUSTODIAL CLOSET TO NEW WING CEILING PLENUM	MUD JOINT PACKING		18 UNITS	NOT QUANTIFIED	4	1	REPAIR	MINOR DAMAGE

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1080A	SPEECH ROOM	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		220 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED

Appendix B

INVENTORY OF ASBESTOS CONTAINING MATERIALS

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1001	ROOM 115	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		1000 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WOOD PANEL MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		0					SINK REPLACED
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
1001CP	ROOM 115 CEILING PLENUM	2X4 CEILING TILE		0					ABATED JCB#11-20838
		MUD JOINT PACKING		6 UNITS	0	7	7	O&M	GOOD CONDITION
1001A	ROOM 115 CLOSET	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		36 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		COVE BASE & MASTIC BLACK		20 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1001B	ROOM 115 BATHROOM	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE BROWN		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
		12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		1000 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
1002	ROOM 114	COVE BASE & MASTIC BLACK		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WOOD PANEL MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		125 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
1002CP	ROOM 114 CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1002A	ROOM 114 CLOSET	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		36 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		COVE BASE & MASTIC BLACK		20 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1002B	ROOM 114 BATHROOM	CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
		CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE BROWN		18 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL BASE GROUT & GLUE BEIGE		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
1002BCP	ROOM 114 BATHROOM CEILING PLENUM								NO ACCESS

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1003	GIRL'S BATHROOM NEAR ROOM 114	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		CERAMIC FLOOR TILE GROUT & GLUE BROWN		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE TAN		186 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		JOINT COMPOUND (AROUND SKYLIGHT)		0					CONF ASB JCB#19- 42858; ABATED JCB#20- 46589
		GYPSUM BOARD (AROUND SKYLIGHT)		0					NON ASB JCB#19- 42858
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1003CP	GIRL'S BATHROOM NEAR ROOM 114 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1004	BOY'S BATHROOM NEAR ROOM 114	CEILING JOINT COMPOUND		0					CONF ASB JCB#19- 42858; ABATED JCB#20- 46589
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		120 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		186 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		CEILING GYPSUM BOARD		0					NON ASB JCB#19- 42858

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1004CP	BOY'S BATHROOM NEAR ROOM 114 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1005	GENDER NEUTRAL BATHROOM (PREVIOUSLY WOMEN'S FACULTY BATHROOM NEAR 114)	CERAMIC FLOOR TILE GROUT & GLUE BROWN		72 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		186 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1005CP	WOMEN'S FACULTY BATHROOM NEAR 114 CEILING PLENUM	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		MUD JOINT PACKING		2 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1006	CUSTODIAL CLOSET NEAR ROOM 114	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		54 SF	26 SF	4	N/A NON FRIABLE	REPAIR	CRACKED, CHIPPED, DEBRIS & MISSING W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		20 LF	1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING & MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1006CP	CUSTODIAL CLOSET NEAR ROOM 114 CEILING PLENUM	CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1007	COPY ROOM NEAR ROOM 113	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		155 SF	1 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1007CP	COPY ROOM NEAR ROOM 113 CEILING PLENUM	CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		1000 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		110 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
1008	ROOM 113	WALL/CHALK-BOARD MASTIC		125 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		0					SINK REPLACED
1008CP	ROOM 113 CEILING PLENUM	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		MUD JOINT PACKING		3 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1008A	ROOM 113 CLOSET	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		36 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		18 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1008B	ROOM 113 BATHROOM	CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
		CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE BROWN		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1009	ROOM 112	12X12 FLOOR TILE & MASTIC WHITE WITH BLUE		1000 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		125 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		PEGBOARD		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		0					SINK REPLACED
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
1009CP	ROOM 112 CEILING PLENUM	2X4 CEILING TILE		0					ABATED JCB#11-20838
		MUD JOINT PACKING		7 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1009A	ROOM 112 BATHROOM	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE BROWN		146 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1009B	ROOM 112 CLOSET	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		366 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		20 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
		TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1010	CORRIDOR ROOM 112 - ROOM 115	WINDOW GLAZING/CAULKING		44 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27843 TEM
		2X4 CEILING TILE		0					ABATED 2007 REINSPECTION
		MUD JOINT PACKING		46 UNITS	0	7	7	O&M	PARTIAL ABATEMENT'S ENVIROSCIENCE#18505 ENVIROSCIENCE #22770
1010CP	CORRIDOR ROOM 112 - ROOM 115 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1011	ROOM 110	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		81 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		GYPNUM BOARD & COMPOUND		162 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		75 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
101CP	ROOM 110 CEILING PLENUM	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
1012	ROOM 107	COVE BASE & MASTIC BROWN		106 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1012CP	ROOM 107 CEILING PLENUM	GYPSUM BOARD		16 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
		MUD JOINT PACKING		26 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1013	ROOM 106	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		125 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1013CP	ROOM 106 CEILING PLENUM	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838
		MUD JOINT PACKING		6 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1014	ROOM 105	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		130 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
1014CP	ROOM 105 CEILING PLENUM	2X4 CEILING TILE		0					ABATED JCB#11-20838
		MUD JOINT PACKING		5 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1015	ROOM 104	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		130 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		MUD JOINT PACKING		17 UNITS	NOT QUANTIFIED	4	1	REPAIR	DAMAGED
1015CP	ROOM 104 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1016	LIBRARY	CARPET MASTIC		2040 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLUE		100 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		GYPNUM BOARD & COMPOUND		252 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		225 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27843 TEM
		2X4 CEILING TILE		0					ABATED 2007 REINSPECTION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1016CP	LIBRARY CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED
1016A	LIBRARY SERVER CLOSET	CARPET MASTIC		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		30 LF	<1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		GYP SUM BOARD & COMPOUND		252 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27843 TEM
		2X4 CEILING TILE		0					ABATED 2007 REINSPECTION
1016ACP	LIBRARY SERVER CLOSET CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1017	ROOM 108	12X12 FLOOR TILE & MASTIC BEIGE WITH MULTI COLORS		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		GYP SUM BOARD & COMPOUND		210 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		0					REMOVED
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1017CP	ROOM 108 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		12X12 FLOOR TILE & MASTIC BEIGE WITH MULTI COLORS		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		30 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
1018	ROOM 109	WALL/CHALK-BOARD MASTIC		130 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		METAL SINK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838
		GYPSPUM BOARD & COMPOUND		60 SF	NOT QUANTIFIED	3	4	REPAIR	DAMAGED WITH DEBRIS
1018CP	ROOM 109 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		ROOF TAR		N/A	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CERAMIC FLOOR TILE GROUT & GLUE BEIGE		72 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		279 SF	5 LF	4	N/A NON FRIABLE	REPAIR	CHIPPED & MISSING GROUT
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
1019	MEN'S FACULTY BATHROOM ACROSS ROOM 108	MIRROR MASTIC		3 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1019CP	MEN'S FACULTY BATHROOM ACROSS ROOM 108 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1020	WOMEN'S FACULTY BATHROOM NEAR 108	CERAMIC FLOOR TILE GROUT & GLUE BROWN		72 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL TILE GROUT & GLUE TAN		279 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		MIRROR MASTIC		12 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
1020CP	WOMEN'S FACULTY BATHROOM NEAR 108 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1020A	ROOM 109A VESTIBULE	12X12 FLOOR TILE & MASTIC BEIGE WITH MULTI COLORS		72 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		GYPNUM BOARD & COMPOUND		30 SF	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
1020ACP	ROOM 109A VESTIBULE CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1020A1	ROOM 109A	12X12 FLOOR TILE & MASTIC GREEN		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		50 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838
		MUD JOINT PACKING		1 UNIT	0	7	7	O&M	GOOD CONDITION
1020A1CP	ROOM 109A CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1020B	READING STORAGE ROOM	12X12 FLOOR TILE & MASTIC BEIGE WITH MULTI COLORS		800 SF	6 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		100 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		GYP SUM BOARD & COMPOUND		39 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIBERBOARD		300 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1020BCP	READING STORAGE ROOM CEILING PLENUM	MUD JOINT PACKING		13 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1020B1	Room 100A	12x12 FLOOR TILE & MASTIC BLUE WATERCOLOR		352 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		65 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2x2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2x4 CEILING TILE		0					ABATED JCB#11-20838
1020B1CP	Room 100A CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1020B1A	READING ROOM	12x12 FLOOR TILE & MASTIC BLUE WATERCOLOR		396 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		60 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		16 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2x2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
1020B1ACP	READING ROOM CEILING PLENUM	2x4 CEILING TILE		0					ABATED JCB#11-20838
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1021	ROOM 103	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		COVE BASE & MASTIC BROWN		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		MUD JOINT PACKING		7 UNITS	0	7	7	O&M	GOOD CONDITION
1021CP	ROOM 103 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1022	ROOM 102	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BROWN		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		130 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1022CP	ROOM 102 CEILING PLENUM	GYPSUM BOARD		20 SF	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		8 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1023	ROOM 101	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1023CP	ROOM 101 CEILING PLENUM	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		MUD JOINT PACKING		15 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1024	CORRIDOR ROOM 101-110	TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		JOINT COMPOUND (AROUND SKYLIGHT)		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		GYPSUM BOARD (AROUND SKYLIGHT)		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		220 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED, PAINTED OVER
		SKYLIGHT CAULKING		24 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		180 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27843 TEM
1024CP	CORRIDOR ROOM 101-110 CEILING PLENUM	GYPSUM BOARD & COMPOUND		50 SF	NOT QUANTIFIED	3	4	REPAIR	MINOR DAMAGE
		VIBRATION REDUCER CLOTH WHITE		2 UNITS	0	6	5	O&M	LIMITED VISUAL ACCESS
		MUD JOINT PACKING		49 UNITS	0	7	7	O&M	GOOD CONDITION. 2 LF ABATED JCB#16-35529; 5 UNITS ABATED ENVIROSCIENCE#18505
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1025	PRINCIPAL OFFICE	CARPET MASTIC		382 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		85 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		256 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		96 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1025CP	PRINCIPAL OFFICE CEILING PLENUM	FIRE DOOR INSULATION WOOD		3 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ASB JCB#13-27843 TEM
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1025A	PRINCIPAL OFFICE BATHROOM	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE BEIGE		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		MIRROR MASTIC		0					NEW MIRROR OBSERVED
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1025ACP	PRINCIPAL OFFICE BATHROOM CEILING PLENUM	CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
									NO ACCESS

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1025B	PRINCIPAL OFFICE STORAGE	CARPET MASTIC		90 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		35 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WINDOW GLAZING/CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1025BCP	PRINCIPAL OFFICE STORAGE CEILING PLENUM	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		MUD JOINT PACKING		4 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1025C	PRINCIPAL OFFICE CLOSET	CARPET MASTIC		6 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		8 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
1026	MAIN OFFICE	12X12 FLOOR TILE & MASTIC WHITE		510 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED W/ MASTIC EXPOSED
		COVE BASE & MASTIC BLACK		88 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WINDOW GLAZING/CAULKING		48 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1026CP	MAIN OFFICE CEILING PLENUM	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1026A	MAIN OFFICE STORAGE	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		12X12 FLOOR TILE & MASTIC WHITE		72 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		20 LF	3 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
1026ACP	MAIN OFFICE STORAGE CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		12X12 FLOOR TILE & MASTIC WHITE		135 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		55 LF	3 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WINDOW GLAZING/CAULKING		16 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1026B	MAIN OFFICE KITCHEN	METAL SINK UNDERCOATING BLACK		1 UNIT	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MINOR DAMAGE
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
1026BCP	MAIN OFFICE KITCHEN CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1026C	MAIN OFFICE ASSISTANT PRINCIPAL OFFICE	12X12 FLOOR TILE & MASTIC WHITE		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WINDOW GLAZING/CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1026D	MAIN OFFICE TELEPHONE ROOM	12X12 FLOOR TILE & MASTIC WHITE		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		7 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WOOD PANEL MASTIC		48 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1026DCP	MAIN OFFICE TELEPHONE ROOM CEILING PLENUM	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1027	PSYCHOLOGIST OFFICE	CEILING JOINT COMPOUND (AROUND SKYLIGHT)		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		140 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BROWN		45 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		GYP SUM BOARD & COMPOUND		50 SF	< 1 SF	3	4	REPAIR	DENT
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		CEILING GYP SUM BOARD (AROUND SKYLIGHT)		0					NON ASB JCB#19-42858
		PSYCHOLOGIST OFFICE CEILING PLENUM		0					CONFIRMED NON ACM (ECL JOB #23546)
		TECTUM DECKING		0					
1028	NURSE OFFICE	12X12 FLOOR TILE & MASTIC WHITE		525 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		122 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WINDOW GLAZING/CAULKING		48 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1028CP	NURSE OFFICE CEILING PLENUM	2X2 CEILING TILE DEEP FISSURE		0					NON ASB JCB#13-25281 TEM
		MUD JOINT PACKING		7 UNITS	0	7	7	O&M	LIMITED VISUAL ACCESS
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1028A	NURSE OFFICE BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BROWN		18 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE TILE GROUT & GLUE TAN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		MIRROR MASTIC		3 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1028B	NURSE CLOSET	2X4 CEILING TILE TEXTURED PINHOLE		0					CONF ASB JCB#13-27843; ABATED JCB#20-46589
		12X12 FLOOR TILE & MASTIC WHITE		10 SF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		COVE BASE & MASTIC BLACK		9 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
1028C	NURSE MECHANICAL ROOM	CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		14 UNITS	0	7	7	O&M	GOOD CONDITION, CONF ASB ORIGINAL AMP
		DUCT INSULATION CLOTH		154 SF	2 LF	4	N/A NON FRIABLE	REPAIR	TORN
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1029	CUSTODIAL CLOSET BY NURSE OFFICE	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		12X12 FLOOR TILE & MASTIC GREY		25 SF	25 SF	4	N/A NON FRIABLE	REPAIR	FLOOR TILE REMOVED, MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		14 LF	14 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1029CP	CUSTODIAL CLOSET BY NURSE OFFICE CEILING PLENUM	CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		120 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	MISSING
		COVE BASE & MASTIC BROWN		28 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1030	STORAGE ROOM ADJACENT ROOM 124	CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1030CP	STORAGE ROOM ADJACENT ROOM 124 CEILING PLENUM	ROOF TAR		N/A	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	EXPOSED

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1031	ROOM 124	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		125 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1031CP	ROOM 124 CEILING PLENUM	ROOF TAR		N/A	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1032	ROOM 123	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE WITH BROWN		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		125 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
1032CP	ROOM 123 CEILING PLENUM	MUD JOINT PACKING		6 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1033	CORRIDOR FACULTY ROOM TO MAIN ENTRANCE	TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		250 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		340 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		9 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27843 TEM
		2X4 CEILING TILE		0					ABATED 2007 REINSPECTION

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1033CP	CORRIDOR FACULTY ROOM TO MAIN ENTRANCE CEILING PLENUM	VIBRATION REDUCER CLOTH WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		61 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	3 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED
1034	ROOM 122	COVE BASE & MASTIC BROWN		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
1034CP	ROOM 122 CEILING PLENUM	2X4 CEILING TILE		0					ABATED JCB# 11-20838
		MUD JOINT PACKING		3 UNIT	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1035	RESOURCE ROOM	12X12 FLOOR TILE & MASTIC BLUE WATERCOLOR		504 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		85 LF	< 1 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WOOD PANEL MASTIC		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIBERBOARD		245 SF	2 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED & SEPARATING
		WINDOW GLAZING/CAULKING		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1035CP	RESOURCE ROOM CEILING PLENUM	12X12 FLOOR TILE & MASTIC BLUE WATERCOLOR		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1036	ROOM 121	COVE BASE & MASTIC BLACK		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1036CP	ROOM 121 CEILING PLENUM	MUD JOINT PACKING		10 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1037	ROOM 120	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE WITH BROWN		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		WALL/CHALK-BOARD MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
1037CP	ROOM 120 CEILING PLENUM	MUD JOINT PACKING		4 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1038	BOY'S BATHROOM NEAR ROOM 120	CERAMIC FLOOR TILE GROUT & GLUE BEIGE		180 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL GROUT & GLUE BEIGE		318 SF	4 SF	4	N/A NON FRIABLE	REPAIR	CRACKED & MISSING GROUT
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		MIRROR MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		JOINT COMPOUND (AROUND SKYLIGHT)		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		GYPSUM BOARD (AROUND SKYLIGHT)		0					NON ASB JCB#19-42858
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
1038CP	BOY'S BATHROOM NEAR ROOM 120 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1039	GIRL'S BATHROOM NEAR ROOM 120	CERAMIC FLOOR TILE		180 SF	1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		GROUT & GLUE BROWN							
		CERAMIC WALL GROUT & GLUE BEIGE		318 SF	< 1 LF	4	N/A NON FRIABLE	REPAIR	GROUT MISSING
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		JOINT COMPOUND (AROUND SKYLIGHT)		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		GYPNUM BOARD (AROUND SKYLIGHT)		0					NON ASB JCB#19-42858
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838
1039CP	GIRL'S BATHROOM NEAR ROOM 120 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1040	ROOM 119	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		110 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1040CP	ROOM 119 CEILING PLENUM	MUD JOINT PACKING		14 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1041	ROOM 118	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & LIFTING FROM WATER DAMAGE
		COVE BASE & MASTIC BROWN		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		110 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1041CP	ROOM 118 CEILING PLENUM	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838
		MUD JOINT PACKING		4 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1042	ROOM 117	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	DENTED
		COVE BASE & MASTIC BROWN		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		110 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		MUD JOINT PACKING		4 UNITS	0	7	7	O&M	GOOD CONDITION
1042CP	ROOM 117 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1043	ROOM 116	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC BEIGE WITH MULTI COLORS		810 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		110 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1043CP	ROOM 116 CEILING PLENUM	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838
		MUD JOINT PACKING		18 UNITS	NOT QUANTIFIED	4	1	REPAIR	DAMAGED
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1044	ROOM 111	12X12 FLOOR TILE & MASTIC WHITE WITH BROWN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		COVE BASE & MASTIC BLACK		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		REFRACTORY/KILN/FIRE BRICK		0					KILN REPLACED
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1044CP	ROOM 111 CEILING PLENUM								

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1045	CORRIDOR ROOM 116-122	TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		JOINT COMPOUND (AROUND SKYLIGHT)		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		GYP SUM BOARD (AROUND SKYLIGHT)		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		220 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		24 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		180 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
1045CP	CORRIDOR ROOM 116-122 CEILING PLENUM	2x2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27843 TEM
		2x4 CEILING TILE CIRCLES		0					NON ASB JCB#19-42858
		MUD JOINT PACKING		44 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1046	CORRIDOR ROOM 108-BREEZEWAY	TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		JOINT COMPOUND (AROUND SKYLIGHT)		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		GYPSUM BOARD (AROUND SKYLIGHT)		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		108 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		SKYLIGHT CAULKING		24 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1046CP	CORRIDOR ROOM 108-BREEZEWAY CEILING PLENUM	2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27843 TEM
		MUD JOINT PACKING		21 UNITS	0	7	7	O&M	GOOD CONDITION
1047	CORRIDOR BREEZEWAY TO ROOM 203	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		96 SF	NOT QUANTIFIED	4	N/A NON FRIABLE	REPAIR	MASTIC EXPOSED
		WINDOW GLAZING/CAULKING		340 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27843 TEM
1047	CORRIDOR BREEZEWAY TO ROOM 203	2X4 CEILING TILE		0					ABATED 2007 REINSPECTION

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1047CP	CORRIDOR BREEZEWAY TO ROOM 203 CEILING PLENUM	MUD JOINT PACKING		15 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1048	ROOM 203	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		450 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		75 LF	15 LF	4	N/A NON FRIABLE	REPAIR	MISSING w/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1048CP	ROOM 203 CEILING PLENUM	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838
		MUD JOINT PACKING		9 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1049	ROOM 202	9X9 FLOOR TILE & MASTIC		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE
		12X12 FLOOR TILE & MASTIC WHITE WITH BROWN		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		100 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1049CP	ROOM 202 CEILING PLENUM	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838
		MUD JOINT PACKING		8 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1050	ROOM 204 MUSIC	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	9 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		COVE BASE & MASTIC BROWN		111 LF	7 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		1X1 ACOUSTICAL WALL TILE & MASTIC FISSURE		250 SF	5 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED; CONFIRMED ACM (ECI JOB #22542)
		WALL/CHALK-BOARD MASTIC		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838
		MUD JOINT PACKING		5 UNITS	0	7	7	O&M	GOOD CONDITION
1050CP	ROOM 204 MUSIC CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1051	MUSIC ENTRANCE VESTIBULE	CERAMIC FLOOR TILE GROUT & GLUE GREEN		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		16 LF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					CONF ASB JCB#13-27843; ABATED JCB#20-46589
1051CP	MUSIC ENTRANCE VESTIBULE CEILING PLENUM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1051A	BAND/ORCHESTRA ROOM	CARPET MASTIC		420 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		82 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		GYP SUM BOARD & COMPOUND		96 SF	0	6	5	O&M	GOOD CONDITION
		WALL/CHALK-BOARD MASTIC		0					NO MASTIC, NOT SUSPECT
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					CONF ASB JCB#13-27843; ABATED JCB#20-46589
		MUD JOINT PACKING		0					ABATED JCB#20-46589
1051ACP	BAND/ORCHESTRA ROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1051A1	BAND/ORCHESTRA ROOM STORAGE ROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		140 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE BEIGE		486 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING PLASTER TEXTURED, WHITE COAT		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CEILING PLASTER TEXTURED, BROWN COAT		0					NON ASB JCB#19-42858
1051A1CP	BAND/ORCHESTRA ROOM STORAGE ROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1051 B	GYM OFFICE	9X9 FLOOR TILE & MASTIC BLACK WITH WHITE		0					ABATED JCB#20-46589
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		0					NO MASTIC, NOT SUSPECT
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
1051 BCP	GYM OFFICE CEILING PLENUM	2X4 CEILING TILE TEXTURED		0					CONF ASB JCB#13-27843; ABATED JCB#20-46589
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		21 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
1051 C	MUSIC ENTRANCE VESTIBULE BATHROOM	CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		0					HOLLOW, NOT SUSPECT
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
1051CCP	MUSIC ENTRANCE VESTIBULE BATHROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1052	ROOM 205	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB# 11-20838
		MUD JOINT PACKING		5 UNITS	0	7	7	O&M	GOOD CONDITION
1052CP	ROOM 205 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1052A	ROOM 205 BATHROOM	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1053	ROOM 210	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION, CONF ASB ENVIROSCIENCE#20444
		COVE BASE & MASTIC BROWN		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		MUD JOINT PACKING		8 UNITS	0	7	7	O&M	GOOD CONDITION
1053CP	ROOM 210 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1053A	ROOM 210 BATHROOM	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CRACKED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1054	ROOM 206	12X12 FLOOR TILE & MASTIC BEIGE WITH TAN		810 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		MUD JOINT PACKING		22 UNITS	0	7	7	O&M	GOOD CONDITION
1054CP	ROOM 206 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1054A	ROOM 206 BATHROOM	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		15 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	MISSING
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1055	ROOM 207	12X12 FLOOR TILE TAN WITH BROWN		0					NON ASB ENVIROSCIENCE#20444
		12X12 FLOOR TILE MASTIC		810 SF	7 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & LIFTING; CONF ASB ENVIROSCIENCE#20444
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
1055CP	ROOM 207 CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1055A	ROOM 207 BATHROOM	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
1055ACP	ROOM 207 BATHROOM CEILING PLENUM								NO ACCESS

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1056	ROOM 209	12X12 FLOOR TILE & MASTIC WHITE/BLACK		810 SF	15 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED & CRACKED W/ MASTIC EXPOSED; CONF ACM ECL #20444
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		MUD JOINT PACKING		5 UNITS	0	7	7	O&M	GOOD CONDITION
1056CP	ROOM 209 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1056A	ROOM 209 BATHROOM	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
1056ACP	ROOM 209 BATHROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1059	ROOM 208	12X12 FLOOR TILE GREY WATER COLOR		0					NON ASB ENVIROSCIENCE#20444
		12X12 FLOOR TILE & MASTIC WHITE/ORANGE		810 SF	0	7	N/A NON FRIABLE	O&M	UNDER 12X12 FLOOR TILE. CONF ASB ENVIROSCIENCE#20444
		COVE BASE & MASTIC BROWN		0					NEW BROWN COVE BASE OBSERVED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		200 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
1059CP	ROOM 208 CEILING PLENUM	MUD JOINT PACKING		2 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		ROOF TAR		N/A	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
1059A	ROOM 208 BATHROOM	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE GREEN		15 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		13 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1059ACP	ROOM 208 BATHROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		CEILING JOINT COMPOUND		0					CONF ASB JCB#19- 42858; ABATED JCB#20- 46589
		CARPET MASTIC		150 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION; FLOOR TILES UNDERNEATH
		COVE BASE & MASTIC BLACK		56 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19- 42858
1060CP	STORAGE ROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		WALL/CHALK-BOARD MASTIC		400 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		32 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13- 27843 TEM
		2X4 CEILING TILE		0					ABATED 2007 REINSPECTION
		MUD JOINT PACKING		15 UNITS	NOT QUANTIFIED	4	1	REPAIR	DUCT TAPED
1061CP	CORRIDOR ROOM 208 TO GYM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1062	GYM ENTRANCE	16X16 FLOOR TILE & MASTIC		0					NEW MATERIAL
		TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
1062CP	GYM ENTRANCE CEILING PLENUM	2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27843 TEM
		MUD JOINT PACKING		4 UNITS	0	7	7	O&M	LIMITED VISUAL ACCESS
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		WOOD FLOOR TAR/VAPOR BARRIER		3621 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BROWN		240 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1063	GYMNASIUM	CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WINDOW GLAZING/CAULKING		150 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		34 UNITS	0	7	7	O&M	PARTIALLY ABATED (ECL JOB #23162); CONF ASB ORIGINAL AMP
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1063A	GYM STORAGE A	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		9X9 FLOOR TILE & MASTIC BLACK WITH WHITE		0					FLOOR TILE REMOVED
		9X9 FLOOR TILE & MASTIC BLACK WITH WHITE (UNDER SHELVING)		0					ABATED JCB#20-46589
		COVE BASE & MASTIC BLACK		0					COVE BASE REMOVED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		9X9 FLOOR TILE & MASTIC BLACK WITH WHITE		0					FLOOR TILE REMOVED
		9X9 FLOOR TILE & MASTIC BLACK WITH WHITE (UNDER SHELVING)		0					ABATED JCB#20-46589
1063B	GYM STORAGE B	COVE BASE & MASTIC BLACK		0					COVE BASE REMOVED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE SMOOTH		0					FIBERGLASS, NOT SUSPECT
		MUD JOINT PACKING		9 UNITS	0	7	7	O&M	GOOD CONDITION
1063BCP	GYM STORAGE B CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		ROOF TAR		N/A	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1064	SPEECH ENTRANCE VESTIBULE	CERAMIC FLOOR TILE GROUT & GLUE BROWN		24 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		10 LF	1 TILE	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2x4 CEILING TILE TEXTURED		0					CONF ASB JCB#13-27843; ABATED JCB#20-46589
1064CP	SPEECH ENTRANCE VESTIBULE CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1064A	ENTRANCE VESTIBULE BATHROOM	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE BROWN		40 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE TAN		21 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		MIRROR MASTIC		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1064ACP	ENTRANCE VESTIBULE BATHROOM CEILING PLENUM	FIRE DOOR INSULATION WOOD		0					HOLLOW, NOT SUSPECT
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1064B	GYM OFFICE	9X9 FLOOR TILE & MASTIC BLACK WITH WHITE		0					ABATED JCB#20-46589
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1064BCP	GYM OFFICE CEILING PLENUM	2X4 CEILING TILE TEXTURED		0					CONF ASB JCB#13-27843; ABATED JCB#20-46589
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		CARPET MASTIC		420 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE TAN		42 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1064C	GYM STORAGE	CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X4 CEILING TILE TEXTURED		0					CONF ASB JCB#13-27843; 24 SF ABATED
									ENVIROSCIENCE#18693; ABATED JCB#20-46589
1064CCP	GYM STORAGE CEILING PLENUM	MUD JOINT PACKING		0					ABATED JCB#20-46589
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		CERAMIC FLOOR TILE GROUT & GLUE BROWN		160 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		504 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1064C1	GYM STORAGE INNER STORAGE	CEILING PLASTER TEXTURED, WHITE COAT		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CEILING PLASTER TEXTURED, BROWN COAT		0					NON ASB JCB#19-42858

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1064C1CP	GYM STORAGE INNER STORAGE CEILING PLENUM	MUD JOINT PACKING		0					ABATED JCB#20-46589
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1065	ROOM 201	12X12 FLOOR TILE & MASTIC PEACH WATERCOLOR		810 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		111 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		75 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		80 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		MUD JOINT PACKING		8 UNITS	0	7	7	O&M	GOOD CONDITION
1065CP	ROOM 201 CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1065A	ROOM 201 STORAGE	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		12X12 FLOOR TILE & MASTIC PEACH WATERCOLOR		114 SF	4 TILES	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		COVE BASE & MASTIC BROWN		42 LF	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1065ACP	ROOM 201 STORAGE CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1066	GIRL'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BROWN		180 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CERAMIC WALL BASE GROUT & GLUE BEIGE		428 SF	2 SF	4	N/A NON FRIABLE	REPAIR	CRACKED W/ MISSING GROUT & SEPARATING FROM WALL
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		JOINT COMPOUND (AROUND SKYLIGHT)		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		GYPSUM BOARD (AROUND SKYLIGHT)		0					NON ASB JCB#19-42858
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1067	BOY'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		180 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		428 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		MIRROR MASTIC		30 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		JOINT COMPOUND (AROUND SKYLIGHT)		0					CONF ASB JCB#19- 42858; ABATED JCB#20- 46589
		GYPSUM BOARD (AROUND SKYLIGHT)		0					NON ASB JCB#19- 42858
		SKYLIGHT CAULKING		12 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
1067CP	BOY'S BATHROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		ROOF TAR		N/A	0	7	N/A NON FRIABLE	O&M	LIMITED VISUAL ACCESS
1068	WOMEN'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE BROWN		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE TAN		252 SF	3 LF	4	N/A NON FRIABLE	REPAIR	CRACKED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		MIRROR MASTIC		4 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1068CP	WOMEN'S BATHROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1069	MEN'S BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		80 SF	< 1 SF	4	N/A NON FRIABLE	REPAIR	MISSING W/ GLUE EXPOSED
		CERAMIC WALL TILE GROUT & GLUE BROWN		252 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		MIRROR MASTIC		25 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
1069CP	MEN'S BATHROOM CEILING PLENUM	2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1070	CAFETERIA	12X12 FLOOR TILE & MASTIC BLUE WATERCOLOR		2864 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		COVE BASE & MASTIC BLACK		230 LF	3 LF	4	N/A NON FRIABLE	REPAIR	DELAMINATING
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		GYP SUM BOARD & COMPOUND		252 SF	<1 SF	3	4	REPAIR	DENTED
		1X1 ACOUSTICAL WALL TILE & MASTIC		0					NON ASB JCB#13-25281 TEM
		WOOD PANEL MASTIC		252 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		110 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		8 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SHARP		0					NON ASB JCB#13-25281 TEM
		2X2 CEILING TILE TEXTURED PINHOLE		0					CONF ASB JCB#13-25281; ABATED JCB#17-36459
		2X2 CEILING TILE ROUGH		0					NON ASB JCB#13-25281 TEM
		2X4 CEILING TILE SPLASH		0					NON ASB JCB#13-25281 TEM
		2X4 CEILING TILE TEXTURED PINHOLE (VESTIBULES)		0					CONF ASB JCB#13-25281; ABATED JCB#17-36459
		MUD JOINT PACKING		N/A	0	6	5	O&M	NO ACCESS (HIGH CEILINGS). 8 ABATED JCB#17-36459
1070CP	CAFETERIA CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1070A	CAFETERIA STORAGE	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		9X9 FLOOR TILE & MASTIC BLACK WITH WHITE		0					ABATED JCB#20-46589
		COVE BASE & MASTIC BLACK		0					REMOVED DURING ABATEMENT
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		2 DOORS	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
1070ACP	CAFETERIA STORAGE CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1070B	CAFETERIA STAGE	WOOD FLOOR TAR/VAPOR BARRIER		900 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		12X12 FLOOR TILE & MASTIC BLUE WATERCOLOR		24 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE CURTAINS RED		300 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE CURTAINS GOLD		0					REPLACED WITH BLACK CURTAINS
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		MUD JOINT PACKING		23 UNITS	0	6	5	O&M	2 UNITS ABATED (ECL JOB #23162) ; GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					CONF ASB JCB#13-25281; ABATED JCB#20-46589
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Summary of Asbestos Containing Materials

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1071	KITCHEN	TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		COVE BASE & MASTIC BLACK		60 LF	8 LF	4	N/A NON FRIABLE	REPAIR	MISSING W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WINDOW GLAZING/CAULKING		120 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		2 DOORS	0	6	5	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		4 DOORS	0	6	5	O&M	GOOD CONDITION
1071CP	KITCHEN CEILING PLENUM	2X2 CEILING TILE SMOOTH		0					NON ASB JCB#13-27843 TEM
		2X4 CEILING TILE		0					ABATED 2007 REINSPECTION
		MUD JOINT PACKING		25 UNITS	NOT QUANTIFIED	4	1	REPAIR	MINOR DAMAGE
1071A	KITCHEN STORAGE (INTERIOR WALL REMOVED)	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		0					DOOR REMOVED
		2X2 CEILING TILE SMOOTH		0					NON ASB JCB#13-27843 TEM
1071B	KITCHEN STORAGE/WASTE BIN WASHROOM	TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE SMOOTH		0					NON ASB JCB#13-27843 TEM
1071BCP	KITCHEN STORAGE/WASTE BIN WASHROOM CEILING PLENUM	MUD JOINT PACKING		10 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1071C	KITCHEN BATHROOM	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CERAMIC FLOOR TILE GROUT & GLUE BROWN		49 SF	<1 SF	4	N/A NON FRIABLE	REPAIR	MISSING
		CERAMIC WALL BASE GROUT & GLUE TAN		25 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		MIRROR MASTIC		10 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		10 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
1071CCP	KITCHEN BATHROOM CEILING PLENUM	FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1071D	KITCHEN FREEZER								NO ACCESS
1071E	KITCHEN STORAGE	CEILING JOINT COMPOUND		0					CONF ASB JCB#19-42858; ABATED JCB#20-46589
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19-42858
1071ECP	KITCHEN STORAGE CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1072	CUSTODIAL HALLWAY	12X12 FLOOR TILE & MASTIC WHITE WITH BROWN		256 SF	9 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED & CHIPPED
		COVE BASE & MASTIC BROWN		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION METAL		4 DOORS	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27843 TEM

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1072CP	CUSTODIAL HALLWAY CEILING PLENUM	MUD JOINT PACKING		17 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1072A	CUSTODIAL SLOP SINK	CEILING JOINT COMPOUND		0					CONF ASB JCB#19- 42858; ABATED JCB#20- 46589
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		CEILING GYPSUM BOARD		0					NON ASB JCB#19- 42858
		CEILING JOINT COMPOUND		0					CONF ASB JCB#19- 42858; ABATED JCB#20- 46589
1072B	CUSTODIAL BATHROOM	CERAMIC FLOOR TILE GROUT & GLUE GREEN		80 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL BASE GROUT & GLUE BEIGE		28 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		MIRROR MASTIC		20 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19- 42858
1072BCP	CUSTODIAL BATHROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		CEILING JOINT COMPOUND		0					CONF ASB JCB#19- 42858; ABATED JCB#20- 46589
1072C	CUSTODIAL STORAGE	12X12 FLOOR TILE & MASTIC BEIGE		50 SF	46 TILES	4	N/A NON FRIABLE	REPAIR	MISSING TILES W/ MASTIC EXPOSED
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		WINDOW GLAZING/CAULKING		10 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CEILING GYPSUM BOARD		0					NON ASB JCB#19- 42858

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1072CCP	CUSTODIAL STORAGE CEILING PLENUM	MUD JOINT PACKING		0					ABATED JCB#20-46589
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1072D	HEAD CUSTODIAN OFFICE	12X12 FLOOR TILE & MASTIC WHITE WITH BROWN		112 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CHIPPED/ WORN BY CHAIR
		COVE BASE & MASTIC BROWN		40 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		FIRE DOOR INSULATION METAL		1 DOOR	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		THERMAL SYSTEMS INSULATION		0					ABATED 2004 REINSPECTION
1073	BOILER ROOM	CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		WINDOW GLAZING/CAULKING		100 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION METAL		3 DOORS	0	6	5	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		16X16 FLOOR TILE & MASTIC		0					NEW MATERIAL
1074	CORRIDOR FACULTY ROOM TO GYM	TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19- 42858
		WALL/CHALK-BOARD MASTIC		250 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING COMPOUND		0					CONFIRMED NON ACM (ECL JOB #23362)
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13- 27843 TEM

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1074CP	CORRIDOR FACULTY ROOM TO GYM CEILING PLENUM	MUD JOINT PACKING		24 UNITS	0	7	7	O&M	GOOD CONDITION, CONF ASB & < 3 LF ABATED ENVIROSCIENCE#17251
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
		2X4 CEILING TILE		0					ABATED JCB#11-20838
		2X2 CEILING TILE SMOOTH PINHOLE		0					NEW MATERIAL, 2011 SEE SDS
1075	FACULTY ROOM	12X12 FLOOR TILE & MASTIC WHITE WITH BROWN		729 SF	2 TILES	4	N/A NON FRIABLE	REPAIR	CRACKED
		COVE BASE & MASTIC BLACK		105 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING WHITE		1 UNIT	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		MUD JOINT PACKING		3 UNITS	0	7	7	O&M	GOOD CONDITION
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1075CP	FACULTY ROOM CEILING PLENUM	16X16 FLOOR TILE & MASTIC		0					NEW MATERIAL
1080	CORRIDOR CUSTODIAL CLOSET TO NEW WING	TERRAZZO FLOORING		0					CONFIRMED NON ACM (ECL JOB #23546)
		COVE BASE & MASTIC RED		0					NEW MATERIAL
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		GYP SUM BOARD & COMPOUND		8 SF	0	6	5	O&M	GOOD CONDITION
		2X2 CEILING TILE TEXTURED		0					NON ASB JCB#13-27843 TEM
		2X4 CEILING TILE		0					ABATED 2007 REINSPECTION

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage

Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1080CP	CORRIDOR CUSTODIAL CLOSET TO NEW WING CEILING PLENUM	MUD JOINT PACKING		18 UNITS	NOT QUANTIFIED	4	1	REPAIR	MINOR DAMAGE
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1080A	SPEECH ROOM	12X12 FLOOR TILE & MASTIC BEIGE WITH BROWN		220 SF	1 TILE	4	N/A NON FRIABLE	REPAIR	CHIPPED
		COVE BASE & MASTIC BROWN		64 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		WALL/CHALK-BOARD MASTIC		50 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		WINDOW GLAZING/CAULKING		20 LF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		1X1 CEILING TILE FISSURE		0					NON ASB JCB#13-27843 TEM
1080ACP	SPEECH ROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
1080B	TELEPHONE ROOM	CERAMIC FLOOR TILE GROUT & GLUE BROWN		35 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CERAMIC WALL TILE GROUT & GLUE PINK		192 SF	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		METAL SINK UNDERCOATING BLACK		2 UNITS	0	7	N/A NON FRIABLE	O&M	GOOD CONDITION
		2X2 CEILING TILE FISSURE/SMOOTH		0					NON ASB JCB#13-27843 TEM
1080BCP	TELEPHONE ROOM CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Half Hollow Hills CSD
Vanderbilt Elementary School and 1 Garage


Summary of Asbestos Containing Materials

AHERA Six Month Surveillance
May 2023

SPACE NO.	LOCATION	MATERIAL DESCRIPTION	HA/USA	QUANTITY	AMOUNT DAMAGED	HAZARD RANK	AHERA REASSESSMENT CATEGORY	RESPONSE ACTION	REMARKS
1080C	CUSTODIAN CLOSET	CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		FIRE DOOR INSULATION WOOD		1 DOOR	0	6	5	O&M	GOOD CONDITION
		2x2 CEILING TILE TEXTURED PINHOLE		0					CONF ASB JCB#13-27843; ABATED JCB#20-46589
1080CCP	CUSTODIAN CLOSET CEILING PLENUM	TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)
3000	DETACHED GARAGE	CONCRETE BLOCK & MORTAR		0					NON ASB JCB#19-42858
		TECTUM DECKING		0					CONFIRMED NON ACM (ECL JOB #23546)

Appendix C

DRAWINGS

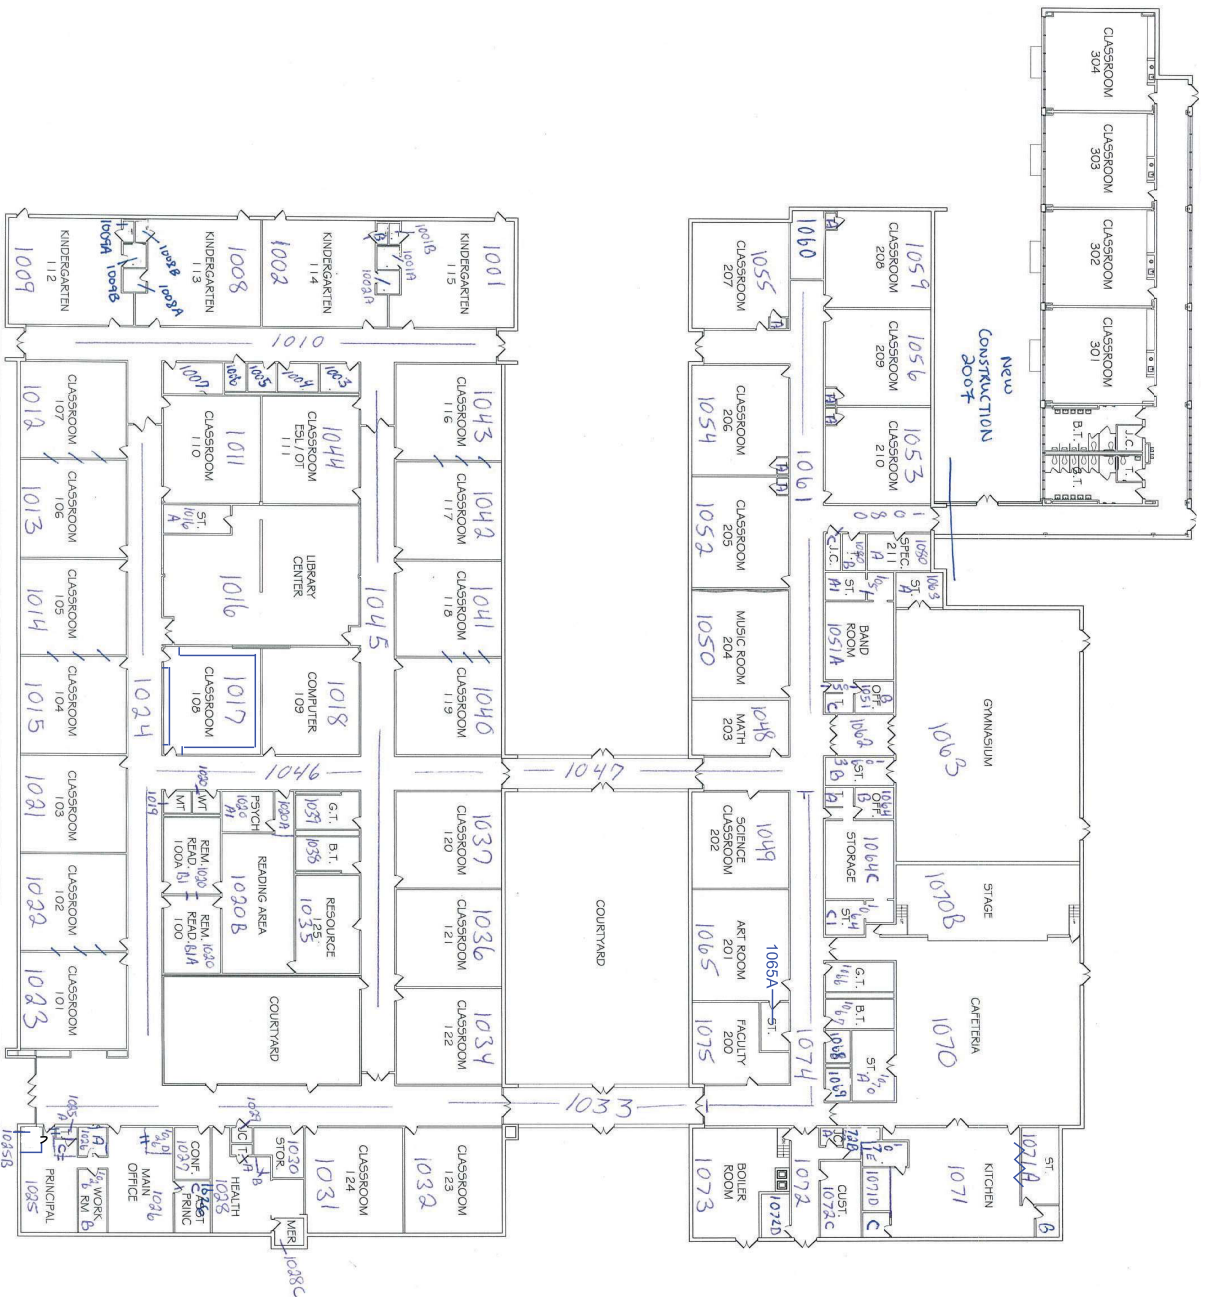

ENVIROSCIENCE CONSULTANTS
2150 SMITH TOWN AVENUE
RONKONKOMA, NY 11779
(631) 580-3191
FAX 580-3195
www.envirohealth.org

KEY PLAN
NO SCALE

PROJECT
SIX MONTH AHERA SURVEILLANCE
VANDERBILT ELEMENTARY SCHOOL
FLOOR PLAN
CLIENT
HALF HOLLOW HILLS CENTRAL SCHOOL DISTRICT




PROJECT #: 28846
COMMENTS:
None

NOT TO SCALE
Date: 07/14/2023
By: Robert Cardona
DRAWING 1 of 1

Appendix D

CERTIFICATIONS

WE ARE YOUR DOL

 **Department of Labor**

DIVISION OF SAFETY & HEALTH LICENSE AND CERTIFICATE UNIT, STATE OFFICE CAMPUS, BLDG. 12, ALBANY, NY 12226


ASBESTOS HANDLING LICENSE

Enviroscience Consultants, LLC
2150 Smithtown Avenue, Ronkonkoma, NY, 11779

License Number: 28733
License Class: RESTRICTED
Date of Issue: 11/04/2022
Expiration Date: 11/30/2023
Duly Authorized Representative: Bartley Gallagher

This license has been issued in accordance with applicable provisions of Article 30 of the Labor Law of New York State and of the New York State Codes, Rules and Regulations (12 NYCRR Part 56). It is subject to suspension or revocation for a (1) serious violation of state, federal or local laws with regard to the conduct of an asbestos project, or (2) demonstrated lack of responsibility in the conduct of any job involving asbestos or asbestos material.

This license is valid only for the contractor named above and this license or a photocopy must be prominently displayed at the asbestos project worksite. This license verifies that all persons employed by the licensee on an asbestos project in New York State have been issued an Asbestos Certificate, appropriate for the type of work they perform, by the New York State Department of Labor.


Amy Phillips, Director
For the Commissioner of Labor

EXCELSIOR

Appendix E

NOTICE TO SHORT TERM WORKERS

NOTICE TO SHORT TERM WORKERS

All workers entering the Vanderbilt Elementary School and/or the Garage must sign in, thereby acknowledging the presence and locations of asbestos containing building materials in the building. No work will be allowed in the areas listed without prior approval from the AHERA Designated Person for the Half Hollow Hills School District.

Sign in sheets will be picked up at the time of the Six Month AHERA Surveillance and will be placed in the buildings Asbestos Management Plan.

Asbestos containing materials and their locations at Vanderbilt Elementary School and the Garage are listed in the AHERA Management Plan, which is available for review, upon request.

[illegible]

Appendix F

BULK SAMPLE RESULTS

ELAP # 11681; NVLAP Lab Code 200531-0

ASBESTOS BULK SAMPLE RESULTS

CLIENT:	Half Hollow Hills CSD 525 Half Hollow Road, Dix Hills, NY 11746			SAMPLE DATE:	6/7/2023		
PROJECT NAME:	AHERA Six-month Surveillance - May 2023			DATE RECEIVED:	6/8/2023		
JOB #:	23546			AREA:	Vanderbilt Elementary School - Terrazzo & Tectum Throughout Building		
PAGE #:	1 of 1			SAMPLER:	Pamela Chadderton		
				CUSTODY #:	35290		

Lab ID	Sample #	Description	Color	Location	Total Asbestos Result	% Asbestos-type	% Non-asbestos Fibers-type	% Matrix-type
99543	TD1	Tectum Decking	Gray	Nurse's Office Mechanical Room (AHERA #1028C)	None Detected	30.0% cellulose	70.0% binders	
99544	TD2	Tectum Decking	Gray	Custodial Hallway (AHERA #1072)	None Detected	35.0% cellulose	65.0% binders	
99545	TF3	Terrazzo Flooring	White w// Black	Kitchen (AHERA #1071)	None Detected	None Detected	100.0% cement	
99546	TF4	Terrazzo Flooring	White w// Black	Kitchen Storage/Waste Bin Washroom (AHERA #1071B)	None Detected	2.0% cellulose	98.0% cement	
99547	TF5	Terrazzo Flooring	White w// Tan	Corridor Room 208 to Gym (AHERA #1061)	None Detected	2.0% cellulose	98.0% cement	
99548	TF6	Terrazzo Flooring	White w// Tan	Corridor Room 101-110 (AHERA #1061)	None Detected	None Detected	100.0% cement	

Method: EPA 600/M4-82/20, 600/R-93/116, NYS DOH ELAP Item 198.1, 198.4, 198.6, 198.8.

ACM: Asbestos Containing Materials contain more than 1%.

None Detected - No asbestos found in samples using polarized light microscopy (PLM). Trace - Asbestos found is 1% or less, not considered ACM.

None Detected by TEM - No asbestos found in samples using transmission electron microscopy (TEM) and polarized light microscopy (PLM) was found to be negative.

Negative by Weight - After matrix reduction, the remainder is less than 1% and, therefore, cannot fulfill the definition of asbestos containing material.

Inconclusive - No asbestos found in non-friable organically bound samples using polarized light microscopy (PLM).

Method ELAP 198.6 does not remove vermiculite and may underestimate the level of asbestos present in a sample containing greater than 10% vermiculite. Samples of Surface Material that contain Vermiculite are analyzed by ELAP 198.8 for conclusive result.

This report may not be reproduced without the express permission of EnviroScience Consultants, LLC. This report cannot be used to claim endorsement of products by NVLAP or any agency of the U.S. Government. Test results only reflect conditions at the time the samples were taken.

ANALYZED BY:	<u>Valerie Schuyler</u>	PLM DATE:	<u>6/9/2023</u>	ANALYZED BY:	_____	TEM DATE:	_____
DIRECTOR:	<u>Edward M. Schuyler</u>	DATE:	<u>6/12/2023</u>	REVISION #:	<u>0</u>	REVISION DATE:	<u>6/12/2023</u>