

December 11, 2024

Mr. Angelus Papageorge
Director of Operations
Fairfield Public Schools
501 Kings Highway East, Suite 210
Fairfield, CT 06825

Via email: apapageorge@fairfieldschools.org

**RE: Limited Indoor Air Quality Assessment
Timothy Dwight Elementary School
1600 Redding Road, Fairfield CT
TRC Project Number: 63856.0000**

Dear Mr. Papageorge:

TRC Environmental Corporation (TRC) conducted a limited indoor air quality assessment at the Timothy Dwight Elementary School located at 1600 Redding Road in Fairfield, Connecticut.

BACKGROUND

On November 1, 2024, TRC conducted a limited IAQ assessment at the site in response to expressed health concerns for a student that occupies Room 18. TRC provided a report summarizing our findings and recommendations. Fairfield Public Schools subsequently requested that TRC conduct a limited IAQ assessment encompassing the entire school building.

This assessment included a visual and olfactory inspection, collection of IAQ comfort parameter measurements of carbon dioxide (CO₂), carbon monoxide (CO), temperature (T), and relative humidity (RH), moisture measurements of select building materials, and respirable particulate matter (PM₁₀) monitoring.

TRC's Industrial Hygienist, Mr. Cole Bova, performed this assessment after school dismissal on December 2 and December 3, 2024. TRC confirmed with Fairfield Public Schools that the HVAC was operational comparative to normal daily functioning modes during the course of our assessment.

The school building is mainly cooled by splitters while the main office and library are cooled by rooftop units. Heating is supplied via radiators in all rooms. All observed intakes/louvers/units on the exterior were free of debris.

Please refer to *Attachment 1* for Site Floor Plan.

INVESTIGATIVE STRATEGY

Visual/Olfactory Assessment

Accessible areas at the above referenced property were visually evaluated for evidence of water staining, water damage, and suspect fungal growth (mold). The inspection also included a screening for malodors that are commonly associated with water and mold-damaged building materials. As fungi colonizes and consumes various food sources, microbial volatile organic compounds (MVOCs) are typically emitted which are commonly identified as musty, or mold-like odors. The presence of such odors is often suggestive of active fungal growth and/or moisture impacts.

A reasonable effort was made to identify fungal-impacted building materials. This does not imply a guarantee that all possible reservoirs (surface or airborne) of microbial growth were identified because microbial or water-impacted building materials may be hidden behind/under walls, flooring, partitions, etc.

Physical Parameter Monitoring

A TSI® IAQ-CALC™ Indoor Air Quality Meter (Q-Trak™ IAQ Monitor Model 7545) was used to monitor relative humidity, temperature, carbon monoxide (CO), and carbon dioxide (CO₂) levels. The measurement results were compared to the levels recommended by the American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE).

- *Carbon Dioxide* - Carbon dioxide is a useful indicator of inadequate make-up (fresh) air and inadequate air supply per occupant. American Society of Heating, Refrigerating, and Air-Conditioning Engineers (ASHRAE) Standard 62.1-2019, *Ventilation for Acceptable Indoor Air Quality*, recommends a delta (difference between inside and outside concentrations) value of 700 parts per million (ppm) or less for CO₂. The delta value of 700 ppm equates to approximately 15 cubic feet per minute of supply air per occupant. By maintaining a steady-state CO₂ concentration in a space no greater than about 700 ppm above outdoor air levels will indicate that a substantial majority of visitors entering a space will be satisfied with respect to human bioeffluents (body odor). Ambient concentrations of carbon dioxide generally range from 300 – 500 ppm.
- *Carbon Monoxide* - Carbon monoxide is a colorless, odorless gas that can cause fatigue or drowsiness, nausea, headache, and difficulty breathing when present at elevated levels. ASHRAE Standard 62.1-2019 recommends carbon monoxide concentrations less than 9 ppm indoors as an eight-hour average.
- *Dry Bulb Temperature* - ASHRAE Standard 55-2020, *Thermal Environmental Conditions for Human Occupancy* bases occupant thermal comfort on a combination of metabolic rate, clothing insulation, air temperature (dry bulb temperature as a substitute for operative temperature), radiant temperature, air speed, and humidity. Conditions are satisfactory when a substantial majority of occupants (80% or more) are not expressing dissatisfaction with thermal comfort. Occupants are generally tolerant of temperatures between 68° – 82° F. ASHRAE Standard 55-2013 *Thermal Environmental Conditions for Human Occupancy* recommends

temperatures be maintained between 75° – 82° F during warmer summer operative conditions and 68° – 78° F in cooler winter operative conditions.

- *Relative Humidity* - Relative humidity below 30% may cause specific physiological effects, which lead to discomfort and dissatisfaction with the indoor environment. Potential symptoms include dry and sore nose and throat, bleeding nose, sinus and tracheal irritation, dry scratchy eyes, inability to wear contact lenses, and dry flaking skin. The number of persons affected generally increases as the RH drops below 30%. Low RH may also contribute to an increase in respiratory illness, by weakening the defenses provided by the mucous membranes. At the other end of the spectrum, discomfort and dissatisfaction is common with RH readings above 60%. Carpets, curtains, furniture, etc., can absorb enough moisture at 60% RH to promote microbial growth. In addition, elevated RH can lead to condensation on materials with cooler surface temperatures and subsequently promote microbial growth. Several industry organizations recommend RH be maintained between 30% - 60%. ASHRAE Standard 55-2013 recommends RH be maintained below 65%. AIHA recommends RH between 30%-50% and ACGIH recommends RH be maintained below 60% to prevent the amplification of microbial growth.

Moisture Content Measurements

Moisture readings were taken from representative building materials using a Delmhorst BD-2100 moisture meter. In measure mode, the moisture meter operates by measuring the electrical conductivity between two pins that are inserted into the sample substrate. Materials containing moisture exhibit increased conductivity compared to a dry sample of the same material.

The meter provides a digital readout in real-time, reported in terms of percent Wood Moisture Equivalent (WME). In wood, the instrument measures the material's actual percent moisture content (% water). When testing material other than wood, the meter measures the WME value of the material. Materials with WME less than 18% are considered dry; WME between 18 and 20% indicate a borderline condition; and WME in excess of 20% are associated with a moisture problem.

The readings were interpreted as follows:

- Less than 17% WME (or 169 REL) - material was considered dry.
- Between 17 and 20% WME (or 170 to 199 REL) - indicated a borderline condition.
- Greater than 20% WME (or 200 to 999 REL) - material was considered to have an elevated moisture content and suggested a moisture problem.

Particulate Matter Measurements

Particles less than 10 µm (PM₁₀) in diameter are referred to as “respirable” particles. Respirable particles with aerodynamic diameters greater than 2.5 micrometers (µm) are commonly referred to as “coarse” and tend to settle in the upper respiratory tract. Particles larger than 10 µm in diameter, or roughly one-sixth the width of a human hair, are generally trapped in the nose, throat and upper bronchioles and then expelled by coughing, sneezing, or swallowing.

To evaluate airborne particulates, TRC utilized a TSI DustTrak II™ Model 8532 to measure particulate matter less than (PM₁₀). Each area was monitored for approximately 5 minutes to screen areas for particulate levels. For workplace exposures the respirable (10 µm diameter) OSHA PEL is 5 mg/m³ 8-hour TWA and is appropriate for exposures to construction workers in construction worksites. The USGBC LEED guidance for PM₁₀ in buildings is 0.05 mg/m³.

RESULTS

Visual/Olfactory Assessment

The following observations were documented and included in the table below:

Area	Date	Visible Water Staining/Damage	Suspect Fungal Growth	Notes
Exterior	12/02/24	N/A	N/A	<ul style="list-style-type: none"> • Surrounding area includes trees, grass, concrete, plants. • Intakes/louvers were not blocked.
Boiler Room	12/02/24	No	No	<ul style="list-style-type: none"> • Floor and ceiling are concrete. • Walls are block. • No odors present. • All insulated pipes appeared new - no visible staining or deterioration. • One louver is closed.
Gymnasium	12/02/24	No	No	<ul style="list-style-type: none"> • Walls are block. • Floor and ceiling are wood. • No odors present.
Gymnasium Office	12/02/24	No	No	<ul style="list-style-type: none"> • Floors are tile • Wall is block. • Ceiling is metal. • No odors present.

Area	Date	Visible Water Staining/Damage	Suspect Fungal Growth	Notes
OT/PT Room 25	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.
Social Worker Office Room 24	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.
Girl's Bathroom By Gym	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.
Boy's Bathroom By Gym	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.
Resource Room 23	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.
Room 21	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present. Splitter.
Faculty Room 22	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.

Area	Date	Visible Water Staining/Damage	Suspect Fungal Growth	Notes
Room 20	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.
Room 19	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.
Room 18	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present. Splitter has been removed from room – suspect growth observed within unit during TRC’s initial investigation - corrective action taken.
Room 17	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.
Room 16	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.
Room 15	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.

Area	Date	Visible Water Staining/Damage	Suspect Fungal Growth	Notes
Room 14	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No visible signs of water staining. No visible signs of suspect mold. No odors present.
Custodial Office	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.
Girl's Bath By Cafe	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.
Boy's Bath By Cafe	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling tile. No odors present.
Kitchen Area	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling is metal. No odors present.
Multi Purpose Room	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Concrete walls. No odors present.

Area	Date	Visible Water Staining/Damage	Suspect Fungal Growth	Notes
Kitchen Office	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile Wall is block. Ceiling is metal. No odors present
Stage	12/02/24	No	No	<ul style="list-style-type: none"> Floors are tile and wood Walls are block No odors present
Library	12/02/24	No	No	<ul style="list-style-type: none"> Floor is carpet Walls are block, Ceiling tile No odors present
Library Office	12/02/24	No	No	<ul style="list-style-type: none"> Floor is carpet Walls are block, Ceiling tile No odors present
Exterior	12/03/24	N/A	N/A	<ul style="list-style-type: none"> Surrounding area includes trees, grass, concrete, plants. Intakes/louvers were not blocked.
Room 12	12/03/24	No	No	<ul style="list-style-type: none"> Floor is carpet Walls are block, partition wall Ceiling tile No odors present

Area	Date	Visible Water Staining/Damage	Suspect Fungal Growth	Notes
Room 13	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block, one partition wall • Ceiling tile • No odors present
Room 31	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Room 32	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Room 33	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Room 11	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present • Room has a splitter
Room 10	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Room 9	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present

Area	Date	Visible Water Staining/Damage	Suspect Fungal Growth	Notes
Room 8	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Room 30	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Room 7	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Room 4	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present • Room has splitter.
Room 5	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present • Room has splitter.
Room 6	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present • Room has splitter.

Area	Date	Visible Water Staining/Damage	Suspect Fungal Growth	Notes
Room 2	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Room 3	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present • Room has splitter.
Room 1	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Boy's Bath By Office	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Girl's Bath By Office	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Main Office/Waiting Room	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Office 44A	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present

Area	Date	Visible Water Staining/Damage	Suspect Fungal Growth	Notes
Office 44B	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Office 44C	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Nurse 44D	12/03/24	No	No	<ul style="list-style-type: none"> • Floor is carpet • Walls are block wall • Ceiling tile • No odors present
Exterior	12/03/24	N/A	N/A	<ul style="list-style-type: none"> • Surrounding area includes trees, grass, concrete, plants. • Intakes/louvers are not blocked

No visible signs of water stained/water damaged building materials or suspect fungal growth were observed during this assessment.

Comfort Parameter Monitoring

Area	Temperature (°F)	Relative Humidity (%)	CO ₂ (ppm)	CO (ppm)
Standards	ASHRAE Summer = 75-82° Fall & Winter = 68-78° F	ACGIH =<60 ASHRAE =30-65	ASHRAE = <700 above ambient OSHA PEL and ACGIH TLV = 5000	LEED = 9 or < 2 above ambient; NAAQS = <9; ACGIH TLV = 25; OSHA PEL = 50
Exterior	39.6	33.4	372	0.7
Boiler Room	58.8	20.7	461	0.7

Area	Temperature (°F)	Relative Humidity (%)	CO ₂ (ppm)	CO (ppm)
Standards	ASHRAE Summer = 75-82° Fall & Winter = 68-78° F	ACGIH =<60 ASHRAE =30-65	ASHRAE = <700 above ambient OSHA PEL and ACGIH TLV = 5000	LEED = 9 or < 2 above ambient; NAAQS = <9; ACGIH TLV = 25; OSHA PEL = 50
Gymnasium	60.1	26.7	501	0.5
Gymnasium Office	75.6	15.1	585	0.4
OT/PT Room 25	69.8	21.3	532	0.6
Social Worker Office Room 24	66.9	19.1	484	0.4
Girl's Bathroom By Gym	65.2	21.2	478	0.3
Boy's Bathroom By Gym	66.7	22.3	539	0.2
Resource Room 23	67.1	17.9	473	0.3
Room 21	68.7	17.9	453	0.2
Faculty Room 22	69	17.2	453	0.2
Room 20	68.5	18.2	453	0.2
Room 19	69.3	17.2	454	0.1
Room 18	69.9	17.7	461	0.2
Room 17	70.2	17	455	0.2
Room 16	69.9	17	454	0.2
Room 15	70.1	19.9	458	0.2
Room 14	69.7	17.8	481	0.2
Custodial Office	68	18.1	481	0.3
Girl's Bath By Cafe	67.1	18.4	452	0.2
Boy's Bath By Cafe	67.3	18.6	461	0.1
Kitchen Area	68.3	16.1	454	0.1
Multi Purpose Room	67.8	15.9	445	0.1
Kitchen Office	67.8	16.8	496	0.1
Stage	65.6	16.8	438	0.1

Area	Temperature (°F)	Relative Humidity (%)	CO ₂ (ppm)	CO (ppm)
Standards	ASHRAE Summer = 75-82° Fall & Winter = 68-78° F	ACGIH =<60 ASHRAE =30-65	ASHRAE = <700 above ambient OSHA PEL and ACGIH TLV = 5000	LEED = 9 or < 2 above ambient; NAAQS = <9; ACGIH TLV = 25; OSHA PEL = 50
Library	68.5	17.3	474	0.1
Library Office	68.4	15.5	461	0.1
Exterior	41.8	32.6	402	0.7
Exterior	44.2	34	364	0.7
Room 12	61.1	29.4	490	0.4
Room 13	66.5	22.8	482	0.6
Room 31	66.4	22.4	508	0.6
Room 32	67.1	21.4	503	0.5
Room 33	67.8	19.4	474	0.3
Room 11	68.1	20.5	484	0.3
Room 10	68.2	21.4	635	0.3
Room 9	68.9	18.5	455	0.2
Room 8	69.8	18.7	486	0.2
Room 30	68	18.7	449	0.3
Room 7	68.1	18.2	441	0.1
Room 4	69.2	18.7	467	0.2
Room 5	69.9	18.8	463	0.1
Room 6	69.8	19	487	0.2
Room 2	69.8	19	456	0.1
Room 3	69.8	17.9	458	0.1
Room 1	69.3	16.9	446	0.1
Boy's Bath By Office	68.2	19.7	439	0.1
Girl's Bath By Office	68.7	24.1	447	0.1

Area	Temperature (°F)	Relative Humidity (%)	CO ₂ (ppm)	CO (ppm)
Standards	ASHRAE Summer = 75-82° Fall & Winter = 68-78° F	ACGIH =<60 ASHRAE =30-65	ASHRAE = <700 above ambient OSHA PEL and ACGIH TLV = 5000	LEED = 9 or < 2 above ambient; NAAQS = <9; ACGIH TLV = 25; OSHA PEL = 50
Main Office/Waiting Room	70.1	17.2	523	0.2
Office 44A	69.9	16.8	495	0.2
Office 44B	70.5	17.1	551	0.1
Office 44C	70.9	16.8	543	0.1
Nurse 44D	71	16.6	508	0.1
Exterior	40.5	35.4	393	0.6

The results from the physical parameter measurements indicated that CO₂, and CO measurements were all within recommended ASHRAE guidelines.

Temperature measurements were relatively within recommended ASHRAE guidelines with exception to some support spaces which had some recorded measurements slightly below ASHRAE guidelines for this time of year.

RH measurements were below the recommended ASHRAE guidelines. These measurements may be attributed to seasonal conditions.

Moisture Content Measurements

Moisture content measurements were collected from representative surfaces/building materials (floors/walls/ceilings) at the site. Collected measurements were documented as follows:

Area	Moisture Content Results
Boiler Room	Dry
Gymnasium	Dry
Gymnasium Office	Dry
OT/PT Room 25	Dry
Social Worker Office Room 24	Dry

Area	Moisture Content Results
Girl's Bathroom By Gym	Dry
Boy's Bathroom By Gym	Dry
Resource Room 23	Dry
Room 21	Dry
Faculty Room 22	Dry
Room 20	Dry
Room 19	Dry
Room 18	Dry
Room 17	Dry
Room 16	Dry
Room 15	Dry
Room 14	Dry
Custodial Office	Dry
Girl's Bath By Cafe	Dry
Boy's Bath By Cafe	Dry
Kitchen Area	Dry
Multi Purpose Room	Dry
Kitchen Office	Dry
Stage	Dry
Library	Dry
Library Office	Dry
Room 12	Dry
Room 13	Dry
Room 31	Dry
Room 32	Dry
Room 33	Dry
Room 11	Dry
Room 10	Dry
Room 9	Dry
Room 8	Dry
Room 30	Dry
Room 7	Dry
Room 4	Dry
Room 5	Dry
Room 6	Dry
Room 2	Dry
Room 3	Dry
Room 1	Dry
Boy's Bath By Office	Dry
Girl's Bath By Office	Dry
Main Office/Waiting Room	Dry

Area	Moisture Content Results
Office 44A	Dry
Office 44B	Dry
Office 44C	Dry
Nurse 44D	Dry

No elevated concentrations of moisture were detected on the representative surfaces/building materials tested during this assessment.

Particulate Matter Measurements

Area	Avg. PM ₁₀ (mg/m ³)
Boiler Room	0.006
Exterior	0.007
Gymnasium	0.003
Gymnasium Office	0.002
OT/PT Room 25	0.002
Social Worker Office Room 24	0.003
Girl's Bathroom By Gym	0.002
Boy's Bathroom By Gym	0.028
Resource Room 23	0.003
Room 21	0.002
Faculty Room 22	0.001
Room 20	0.001
Room 19	0.001
Room 18	0.001
Room 16	0.003
Room 15	0.001
Room 14	0.003
Custodial Office	0.002
Girl's Bath By Cafe	0.002
Boy's Bath By Cafe	0.003
Kitchen Area	0.004
Multi Purpose Room	0.001
Kitchen Office	0.004
Stage	0.001

Area	Avg. PM ₁₀ (mg/m ³)
Exterior	0.008
Exterior	0.01
Room 12	0.004
Room 13	0.005
Room 31	0.007
Room 32	0.007
Room 33	0.003
Room 11	0.01
Room 10	0.006
Room 9	0.002
Room 8	0.003
Room 30	0.002
Room 4	0.001
Room 5	0.002
Room 6	0.001
Room 2	0.002
Room 3	0.002
Room 1	0.001
Boy's Bath By Office	0.001
Girl's Bath By Office	0.003
Office 44C	0.001
Exterior	0.004

The PM₁₀ readings were acceptable and within LEED and OSHA standards.

CONCLUSIONS

- No visible signs of water staining/water damage, or suspect fungal (mold) growth were observed during the time of this assessment.
- No odors were detected by our inspector during the time of this assessment.
- The IAQ measurements collected indicate concentrations of CO₂, and CO levels to be within recommended ASHRAE guidelines.
- Temperature measurements were slightly below the recommended ASHRAE guidelines primarily noted in some support spaces (bathrooms, stage).

- IAQ measurements for RH were below the recommended ASHRAE guidelines. These measurements may be attributed to seasonal conditions.
- Elevated concentrations of moisture were not detected in any of the representative building components/surfaces tested during this assessment.
- The PM₁₀ readings were acceptable and within LEED and OSHA standards.

RECOMMENDATIONS

- Periodic cleaning/HEPA vacuuming of HVAC diffusers to prevent particulate accumulation.
- Continued periodic maintenance of HVAC units, including respective unit filter changes at recommended intervals.
- Increased control of relative humidity during the winter months to decrease discomfort associated with the dry conditions.

CONDITIONS AND LIMITATIONS

The visual inspections performed by TRC were limited to visible/accessible areas. Destructive and/or invasive inspections were not within the scope of our investigation. The olfactory evaluation is subjective in nature and may vary per inspector.

TRC has performed the tasks set forth above in a thorough and professional manner consistent with industry standards.

TRC utilized the following as guides in formulating recommendations provided in this report:

- American Conference of Governmental Industrial Hygienists, *Bioaerosols Assessment and Control*, 1999.
- American Society of Heating, Refrigerating and Air-Conditioning Engineers Standard 62.1-2019, *Ventilation for Acceptable Indoor Air Quality*, 2019.
- American Society of Heating, Refrigerating and Air-Conditioning Engineers Standard 55-2020, *Thermal Environmental Conditions for Human Occupancy*, 2017.
- New York City, Department of Health & Mental Hygiene, Bureau of Environmental & Occupational Disease Epidemiology, *Guidelines on Assessment and Remediation of Fungi in Indoor Environments*, 2008.
- Institute of Inspection Cleaning and Restoration Certification, *ANSI/IICRC S500 Water Damage Restoration (2021)*.

- Institute of Inspection, Cleaning and Restoration Certification (IICRC), Standard and Reference Guide for Professional Mold Remediation, S520.
- United States Environmental Protection Agency, *Mold Remediation in Schools and Commercial Buildings*, 2008.

Please refer to the *Attachment B* for Site Photographs. If you have any questions concerning this report, please call me directly at (860) 937-4370.
or email me at emarques@trccompanies.com.

Sincerely,

TRC Environmental Corporation



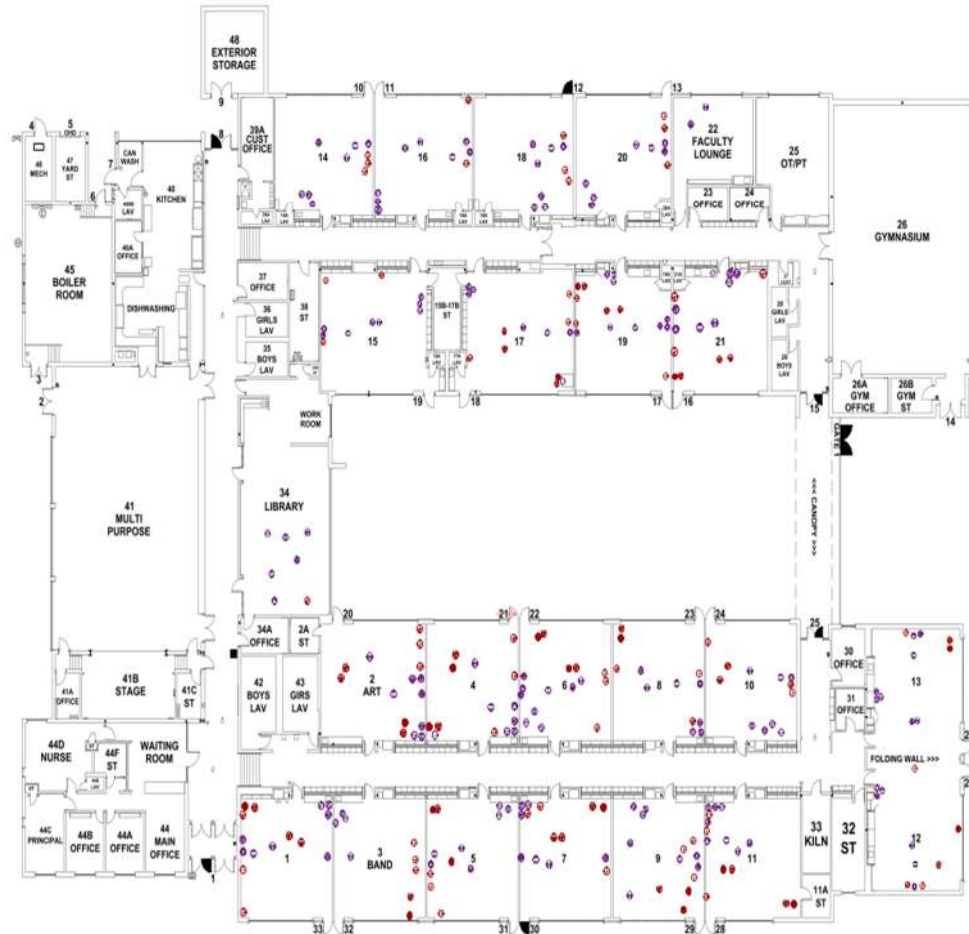
Eduardo Miguel Marques
Project Manager
Safety & Industrial Hygiene





Jonathan Gentile
Office Practice Leader
Safety & Industrial Hygiene



Attachment: Attachment A – Site Floor Plan
Attachment B – Site Photographs




APPENDIX A – SITE FLOOR PLAN









APPENDIX B – SITE PHOTOGRAPHS




PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Boiler Room Description: Initial Observation Image		
Area: Boiler Room Description: Initial Observation Image		




PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Boiler Room Description: Initial Observation Image		
Area: Boiler Room Description: Initial Observation Image		




PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Boiler Room Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Exterior Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		




PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Exterior Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Exterior Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Exterior Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		


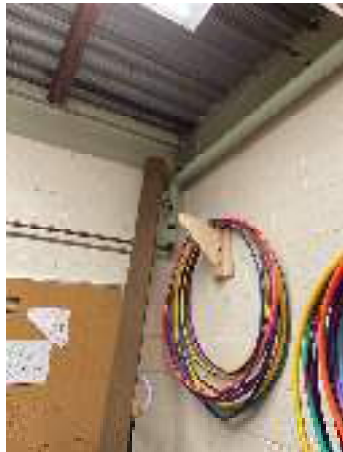
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Exterior Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		
Area: Gymnasium Description: Initial Observation Image		



PHOTOGRAPHIC LOG



Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Gymnasium Description: Initial Observation Image		
Area: Gymnasium Description: Initial Observation Image		
Area: Gymnasium Description: Initial Observation Image		


PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Gymnasium Description: Initial Observation Image		
Area: Gymnasium Description: Initial Observation Image		
Area: Gymnasium Office Description: Initial Observation Image		


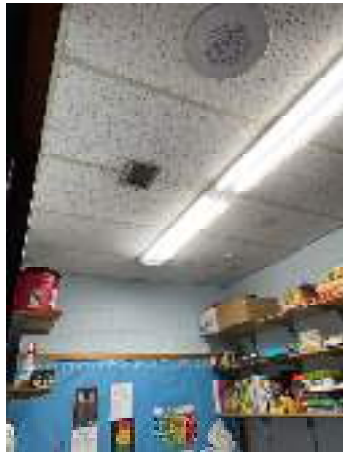
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Gymnasium Office Description: Initial Observation Image		
Area: Gymnasium Office Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Gymnasium Office Description: Initial Observation Image		
Area: Gymnasium Office Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Gymnasium Office Description: Initial Observation Image		
Area: OT/PT Room 25 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: OT/PT Room 25 Description: Initial Observation Image		
Area: OT/PT Room 25 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: OT/PT Room 25 Description: Initial Observation Image		
Area: OT/PT Room 25 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: OT/PT Room 25 Description: Initial Observation Image		
Area: Social Worker Office Room 24 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Social Worker Office Room 24 Description: Initial Observation Image		
Area: Social Worker Office Room 24 Description: Initial Observation Image		

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Social Worker Office Room 24 Description: Initial Observation Image		
Area: Girl's Bathroom By Gym Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Girl's Bathroom By Gym Description: Initial Observation Image		
Area: Girl's Bathroom By Gym Description: Initial Observation Image		
Area: Girl's Bathroom By Gym Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Girl's Bathroom By Gym Description: Initial Observation Image		
Area: Boy's Bathroom By Gym Description: Initial Observation Image		


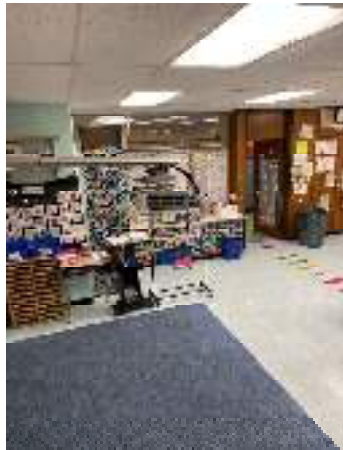
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Boy's Bathroom By Gym Description: Initial Observation Image		
Area: Boy's Bathroom By Gym Description: Initial Observation Image		


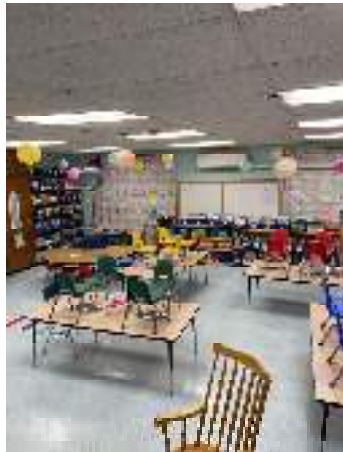
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Boy's Bathroom By Gym Description: Initial Observation Image		
Area: Boy's Bathroom By Gym Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Resource Room 23 Description: Initial Observation Image		
Area: Resource Room 23 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Resource Room 23 Description: Initial Observation Image		
Area: Room 21 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 21 Description: Initial Observation Image		
Area: Room 21 Description: Initial Observation Image		


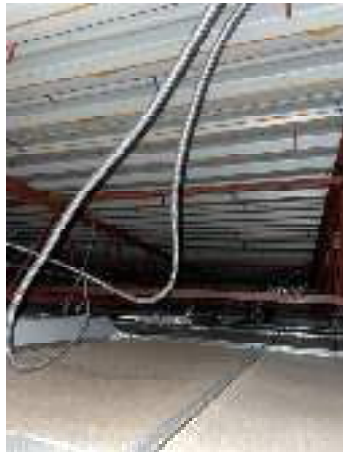
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 21 Description: Initial Observation Image		
Area: Room 21 Description: Initial Observation Image		


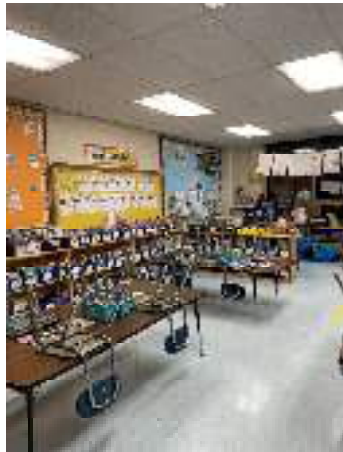
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 21 Description: Initial Observation Image		
Area: Room 21 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 21 Description: Initial Observation Image		
Area: Room 21 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Faculty Room 22 Description: Initial Observation Image		
Area: Faculty Room 22 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Faculty Room 22 Description: Initial Observation Image		
Area: Faculty Room 22 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Faculty Room 22 Description: Initial Observation Image		
Area: Faculty Room 22 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Faculty Room 22 Description: Initial Observation Image		
Area: Room 20 Description: Initial Observation Image		


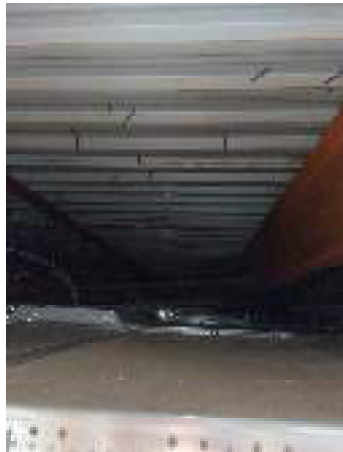
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 20 Description: Initial Observation Image		
Area: Room 20 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 20 Description: Initial Observation Image		
Area: Room 20 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 20 Description: Initial Observation Image		
Area: Room 20 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 19 Description: Initial Observation Image		
Area: Room 19 Description: Initial Observation Image		


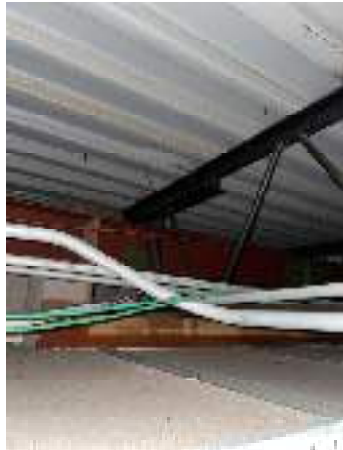
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 19 Description: Initial Observation Image		
Area: Room 19 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 19 Description: Initial Observation Image		
Area: Room 19 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 19 Description: Initial Observation Image		
Area: Room 19 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 18 Description: Initial Observation Image		
Area: Room 18 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 18 Description: Initial Observation Image		
Area: Room 18 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 18 Description: Initial Observation Image		
Area: Room 18 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 18 Description: Initial Observation Image		
Area: Room 18 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 17 Description: Initial Observation Image		
Area: Room 17 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 17 Description: Initial Observation Image		
Area: Room 17 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 17 Description: Initial Observation Image		
Area: Room 17 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 17 Description: Initial Observation Image		
Area: Room 16 Description: Initial Observation Image		

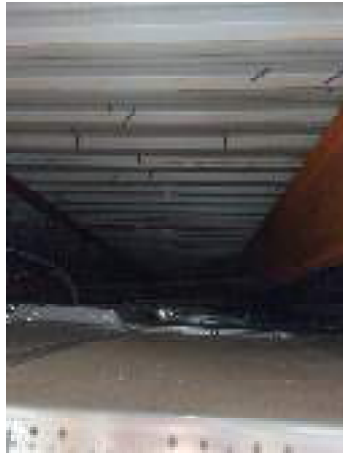

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 16 Description: Initial Observation Image		
Area: Room 16 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 16 Description: Initial Observation Image		
Area: Room 16 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 16 Description: Initial Observation Image		
Area: Room 16 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 15 Description: Initial Observation Image		
Area: Room 15 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 15 Description: Initial Observation Image		
Area: Room 15 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 15 Description: Initial Observation Image		
Area: Room 15 Description: Initial Observation Image		


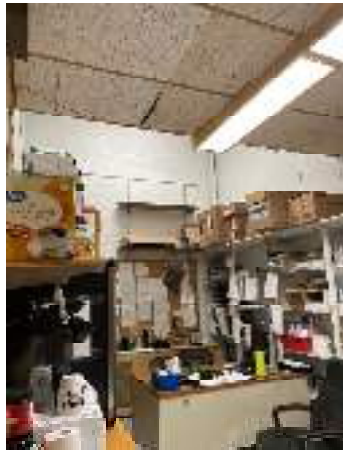
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 15 Description: Initial Observation Image		
Area: Room 15 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 14 Description: Initial Observation Image		
Area: Room 14 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 14 Description: Initial Observation Image		
Area: Room 14 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 14 Description: Initial Observation Image		
Area: Room 14 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 14 Description: Initial Observation Image		
Area: Room 14 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 14 Description: Initial Observation Image		
Area: Custodial Office Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Custodial Office Description: Initial Observation Image		
Area: Custodial Office Description: Initial Observation Image		


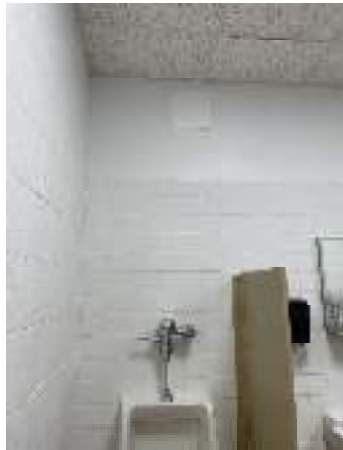
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Custodial Office Description: Initial Observation Image		
Area: Custodial Office Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Custodial Office Description: Initial Observation Image		
Area: Custodial Office Description: Initial Observation Image		

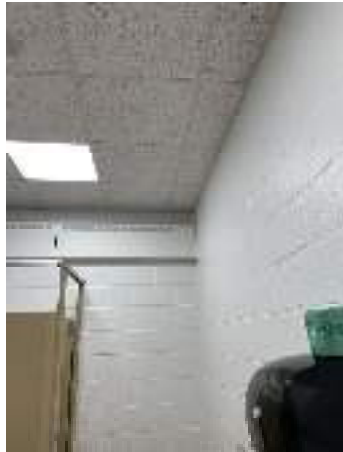

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Custodial Office Description: Initial Observation Image		
Area: Custodial Office Description: Initial Observation Image		


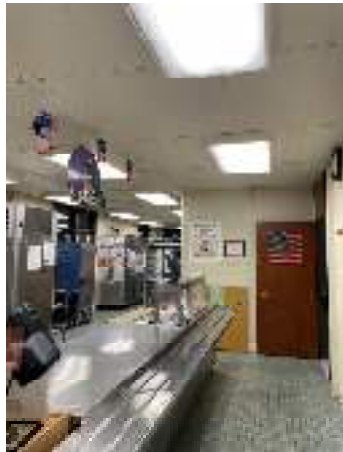
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Girl's Bath By Cafe Description: Initial Observation Image		
Area: Girl's Bath By Cafe Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Girl's Bath By Cafe Description: Initial Observation Image		
Area: Girl's Bath By Cafe Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Girl's Bath By Cafe Description: Initial Observation Image		
Area: Boy's Bath By Cafe Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Boy's Bath By Cafe Description: Initial Observation Image		
Area: Boy's Bath By Cafe Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Boy's Bath By Cafe Description: Initial Observation Image		
Area: Kitchen Area Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Kitchen Area Description: Initial Observation Image		
Area: Kitchen Area Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Kitchen Area Description: Initial Observation Image		
Area: Kitchen Area Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Kitchen Area Description: Initial Observation Image		
Area: Multi Purpose Room Description: Initial Observation Image		

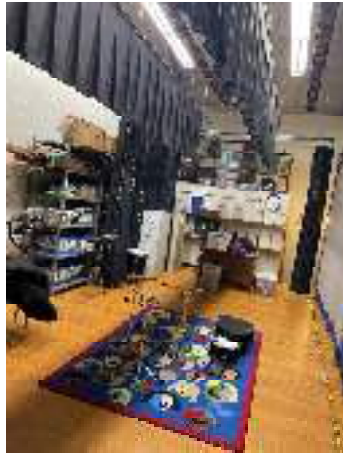

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Multi Purpose Room Description: Initial Observation Image		
Area: Multi Purpose Room Description: Initial Observation Image		

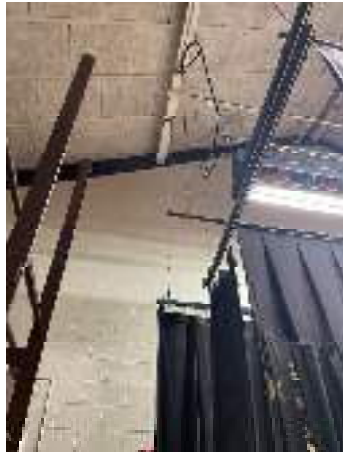

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Multi Purpose Room Description: Initial Observation Image		
Area: Multi Purpose Room Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Kitchen Office Description: Initial Observation Image		
Area: Kitchen Office Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Kitchen Office Description: Initial Observation Image		
Area: Kitchen Office Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Kitchen Office Description: Initial Observation Image		
Area: Stage Description: Initial Observation Image		


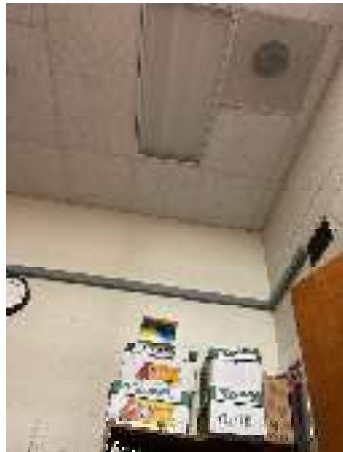
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Stage Description: Initial Observation Image		
Area: Stage Description: Initial Observation Image		

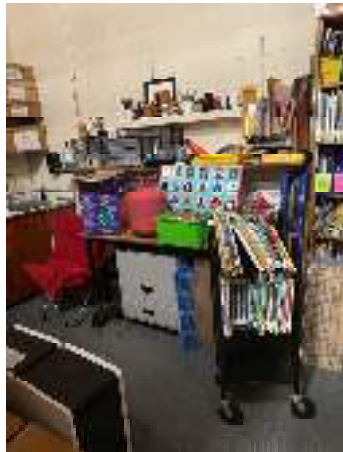


PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Stage Description: Initial Observation Image		
Area: Stage Description: Initial Observation Image		




PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Library Description: Initial Observation Image		
Area: Library Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Library Description: Initial Observation Image		
Area: Library Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Library Description: Initial Observation Image		
Area: Library Office Description: Initial Observation Image		

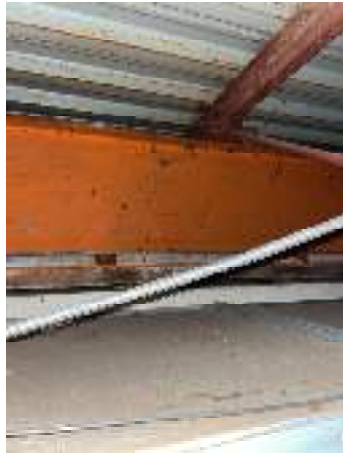
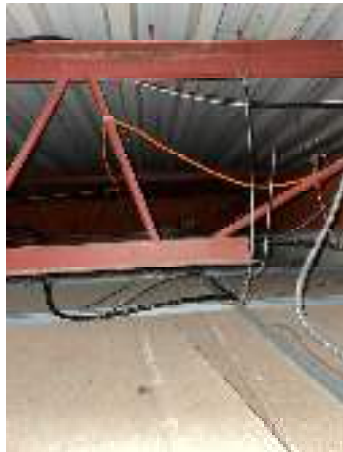
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Library Office Description: Initial Observation Image		
Area: Library Office Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Library Office Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Exterior Description: Initial Observation Image		
Area: Room 12 Description: Initial Observation Image		
Area: Room 12 Description: Initial Observation Image		

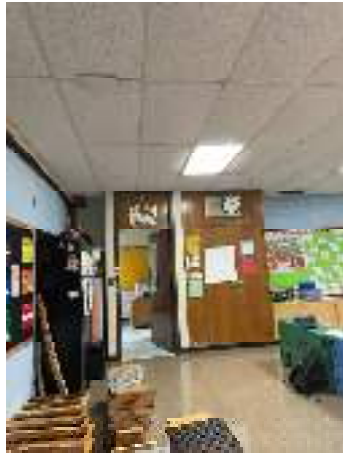

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 12 Description: Initial Observation Image		
Area: Room 12 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 12 Description: Initial Observation Image		
Area: Room 12 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 12 Description: Initial Observation Image		
Area: Room 12 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 13 Description: Initial Observation Image		
Area: Room 13 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 13 Description: Initial Observation Image		
Area: Room 13 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 13 Description: Initial Observation Image		
Area: Room 13 Description: Initial Observation Image		


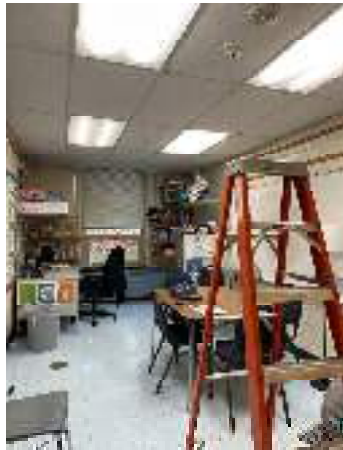
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 13 Description: Initial Observation Image		
Area: Room 13 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 13 Description: Initial Observation Image		
Area: Room 31 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 31 Description: Initial Observation Image		
Area: Room 31 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 31 Description: Initial Observation Image		
Area: Room 31 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 31 Description: Initial Observation Image		
Area: Room 31 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 32 Description: Initial Observation Image		
Area: Room 32 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 32 Description: Initial Observation Image		
Area: Room 32 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 32 Description: Initial Observation Image		
Area: Room 32 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 32 Description: Initial Observation Image		
Area: Room 33 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 33 Description: Initial Observation Image		
Area: Room 33 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 33 Description: Initial Observation Image		
Area: Room 33 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 33 Description: Initial Observation Image		
Area: Room 33 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 11 Description: Initial Observation Image		
Area: Room 11 Description: Initial Observation Image		


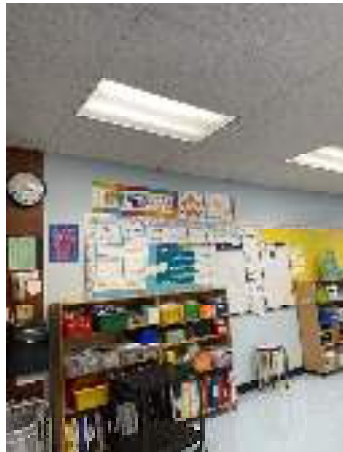
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 11 Description: Initial Observation Image		
Area: Room 11 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 11 Description: Initial Observation Image		
Area: Room 11 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 11 Description: Initial Observation Image		
Area: Room 11 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 11 Description: Initial Observation Image		
Area: Room 11 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 10 Description: Initial Observation Image		
Area: Room 10 Description: Initial Observation Image		


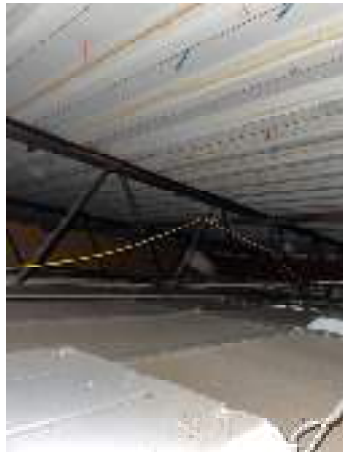
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 10 Description: Initial Observation Image		
Area: Room 10 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 10 Description: Initial Observation Image		
Area: Room 10 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 10 Description: Initial Observation Image		
Area: Room 10 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 9 Description: Initial Observation Image		
Area: Room 9 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 9 Description: Initial Observation Image		
Area: Room 9 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 9 Description: Initial Observation Image		
Area: Room 9 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 9 Description: Initial Observation Image		
Area: Room 9 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 9 Description: Initial Observation Image		
Area: Room 8 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 8 Description: Initial Observation Image		
Area: Room 8 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 8 Description: Initial Observation Image		
Area: Room 8 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 8 Description: Initial Observation Image		
Area: Room 8 Description: Initial Observation Image		


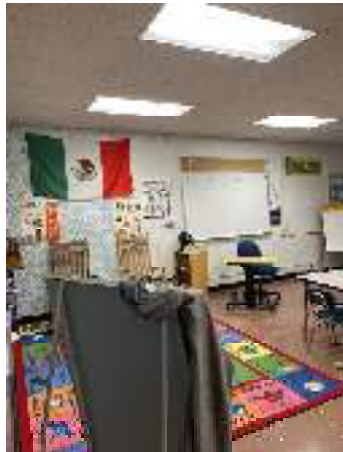
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 8 Description: Initial Observation Image		
Area: Room 8 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 30 Description: Initial Observation Image		
Area: Room 30 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 30 Description: Initial Observation Image		
Area: Room 30 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 30 Description: Initial Observation Image		
Area: Room 30 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 30 Description: Initial Observation Image		
Area: Room 30 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 30 Description: Initial Observation Image		
Area: Room 7 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 7 Description: Initial Observation Image		
Area: Room 7 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 7 Description: Initial Observation Image		
Area: Room 7 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 7 Description: Initial Observation Image		
Area: Room 7 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 7 Description: Initial Observation Image		
Area: Room 7 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 4 Description: Initial Observation Image		
Area: Room 4 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 4 Description: Initial Observation Image		
Area: Room 4 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 4 Description: Initial Observation Image		
Area: Room 4 Description: Initial Observation Image		

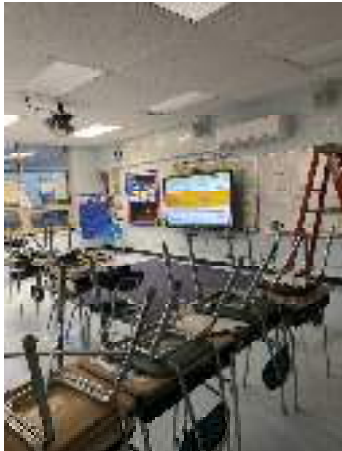
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 4 Description: Initial Observation Image		
Area: Room 4 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 4 Description: Initial Observation Image		
Area: Room 4 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 5 Description: Initial Observation Image		
Area: Room 5 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 5 Description: Initial Observation Image		
Area: Room 5 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 5 Description: Initial Observation Image		
Area: Room 5 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 5 Description: Initial Observation Image		
Area: Room 6 Description: Initial Observation Image		


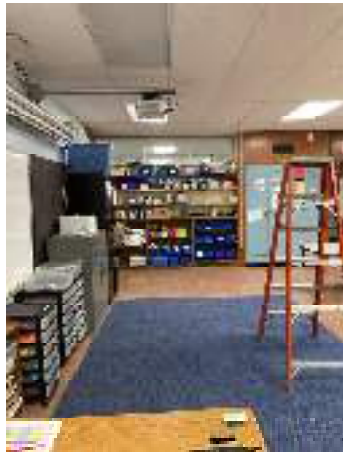
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 6 Description: Initial Observation Image		
Area: Room 6 Description: Initial Observation Image		


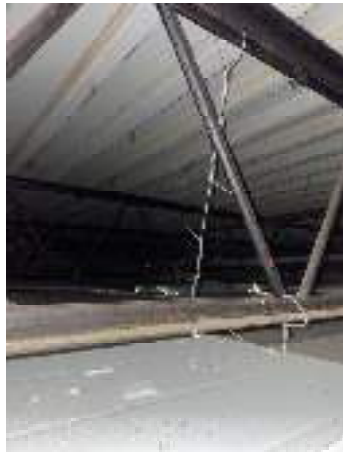
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 6 Description: Initial Observation Image		
Area: Room 6 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 6 Description: Initial Observation Image		
Area: Room 6 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 6 Description: Initial Observation Image		
Area: Room 2 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 2 Description: Initial Observation Image		
Area: Room 2 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 2 Description: Initial Observation Image		
Area: Room 2 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 2 Description: Initial Observation Image		
Area: Room 2 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 2 Description: Initial Observation Image		
Area: Room 2 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 2 Description: Initial Observation Image		
Area: Room 3 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 3 Description: Initial Observation Image		
Area: Room 3 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 3 Description: Initial Observation Image		
Area: Room 3 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 3 Description: Initial Observation Image		
Area: Room 3 Description: Initial Observation Image		

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 3 Description: Initial Observation Image		
Area: Room 1 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 1 Description: Initial Observation Image		
Area: Room 1 Description: Initial Observation Image		

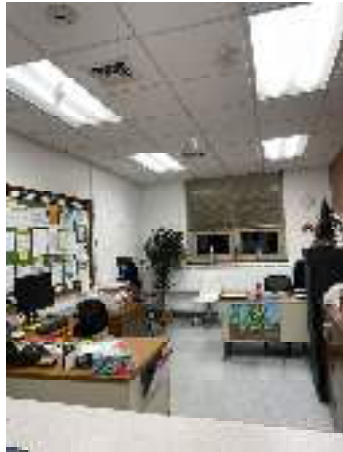

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 1 Description: Initial Observation Image		
Area: Room 1 Description: Initial Observation Image		

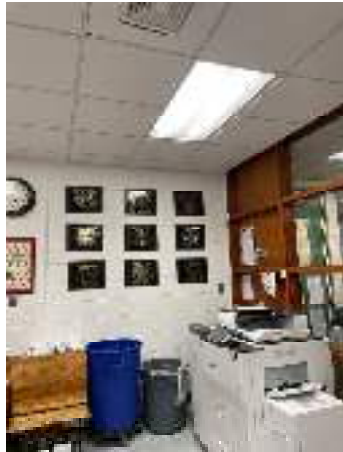

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 1 Description: Initial Observation Image		
Area: Room 1 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Room 1 Description: Initial Observation Image		
Area: Room 1 Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Boy's Bath By Office Description: Initial Observation Image		
Area: Boy's Bath By Office Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Girl's Bath By Office Description: Initial Observation Image		
Area: Girl's Bath By Office Description: Initial Observation Image		

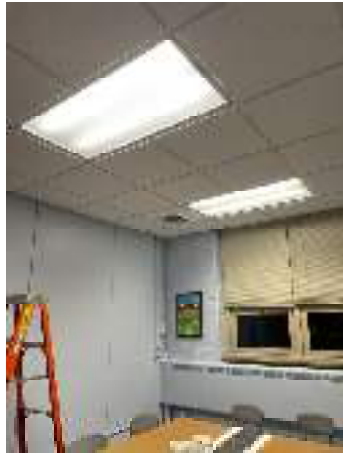

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Main Office/Waiting Room Description: Initial Observation Image		
Area: Main Office/Waiting Room Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Main Office/Waiting Room Description: Initial Observation Image		
Area: Main Office/Waiting Room Description: Initial Observation Image		


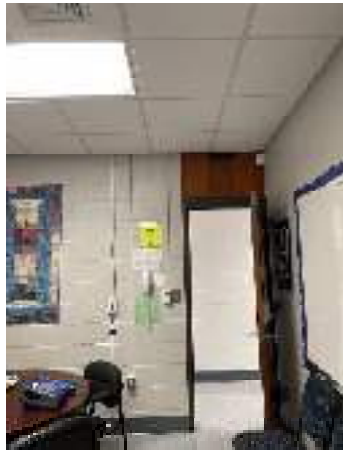
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Main Office/Waiting Room Description: Initial Observation Image		
Area: Main Office/Waiting Room Description: Initial Observation Image		

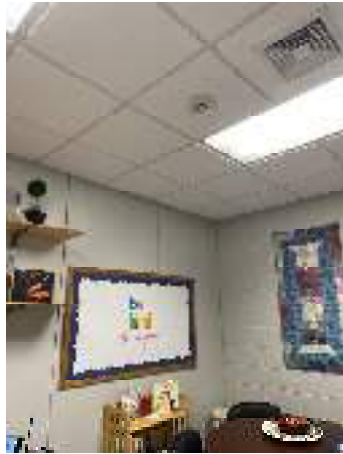

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Main Office/Waiting Room Description: Initial Observation Image		
Area: Main Office/Waiting Room Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Office 44A Description: Initial Observation Image		
Area: Office 44A Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Office 44A Description: Initial Observation Image		
Area: Office 44A Description: Initial Observation Image		


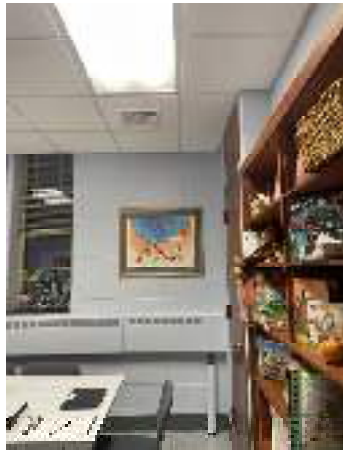
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Office 44A Description: Initial Observation Image		
Area: Office 44A Description: Initial Observation Image		

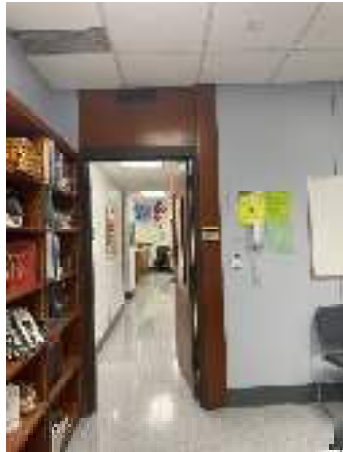

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Office 44A Description: Initial Observation Image		
Area: Office 44B Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Office 44B Description: Initial Observation Image		
Area: Office 44B Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Office 44B Description: Initial Observation Image		
Area: Office 44B Description: Initial Observation Image		



PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Office 44B Description: Initial Observation Image		
Area: Office 44C Description: Initial Observation Image		




PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Office 44C Description: Initial Observation Image		
Area: Office 44C Description: Initial Observation Image		


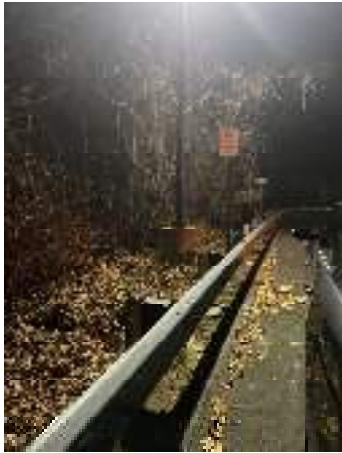
PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Office 44C Description: Initial Observation Image		
Area: Office 44C Description: Initial Observation Image		

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Office 44C Description: Initial Observation Image		
Area: Office 44C Description: Initial Observation Image		

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Nurse 44D Description: Initial Observation Image		
Area: Nurse 44D Description: Initial Observation Image		

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Nurse 44D Description: Initial Observation Image		
Area: Nurse 44D Description: Initial Observation Image		

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Nurse 44D Description: Initial Observation Image		
Area: Nurse 44D Description: Initial Observation Image		
Area: Nurse 44D Description: Initial Observation Image		

PHOTOGRAPHIC LOG		
Client Name: Fairfield Public Schools	Site Location: Timothy Dwight Elementary School 1600 Redding Road Fairfield CT 06824	Project No.: 63856.0000
Area: Nurse 44D Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image		
Area: Exterior Description: Initial Observation Image	