Half Hollow Hills CSD

Six Month AHERA Surveillance

Fran Greenspan Administration Center

May 2023

2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580–3191
www.envirohealth.org

Project #23546

Six Month AHERA Surveillance

Performed at

Fran Greenspan Administration Center
525 Half Hollow Road
Dix Hills, NY 11746

for

Half Hollow Hills CSD
Administration Building
525 Half Hollow Road
Dix Hills, NY 11746

May 2023

Prepared by:

Enviroscience Consultants, LLC
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #23546

Inspector & Management Planner:

Bartley Gallagher — NYSDOL #92-13892

Inspectors:

Alexis Bruno — NYSDOL #21-08575

Pamela Chadderton — NYSDOL #15-10408

ENVIROSCIENCE CONSULTANTS
A Mainline Company

Six Month AHERA Surveillance

Table of Contents

I. Summary

II. Inspection and Recommendations

III. Bulk Sampling Protocol

IV. Hazard Rank Determination

V. AHERA Reassessment Category

Appendix A - Inventory of Damaged Asbestos Containing Materials

Appendix B - Inventory of Asbestos Containing Materials

Appendix C - Drawings - Functional Space Number Floor Plans

Appendix D - Certifications

Appendix E - Notice to Short Term Workers

Appendix F - Bulk Sample Results

I. Summary

A six month AHERA surveillance for the Fran Greenspan Administration Center of the Half Hollow Hills CSD was performed by Ms. Alexis Bruno and Mrs. Pamela Chadderton of Enviroscience Consultants, LLC on June 9, 2023.

The six month surveillance was performed in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Ms. Bruno and Mrs. Chadderton are certified AHERA Inspectors.

Ms. Bruno and Mrs. Chadderton performed the on-site investigation, which included examining existing ACBM, evaluating the condition of the ACBM, and determining if originally non-friable materials have become friable. The physical condition of most of the ACBM found in this building did not change.

After studying the inspection reports, Mr. Bartley M. Gallagher, a certified EPA/AHERA Inspector and Management Planner, developed the recommendations for response actions depending on his evaluation of the hazard that each material may cause.

An Inventory of Asbestos Containing Materials by location, including the AHERA Functional Space identification number is in Appendix B. This inventory includes the material, quantity, amount damaged, the hazard level, the AHERA Reassessment category, and recommended response actions. A remarks column includes sampling and abatement action and other pertinent information.

Floor plans correlating the AHERA Functional Space ID number with the current common location names are in Appendix C.

II. Inspection and Recommendations

The inspector entered all accessible spaces to inspect and physically assess the condition and friability of all previously known or assumed ACBM. The inspector noted any change in condition of remaining materials, materials that have been abated since the last reinspection, and any materials that were either not identified, or may have been improperly classified.

Unless otherwise stated, a recommendation for removal is a suggestion that the materials be removed as soon as the school's budget will allow.

During this inspection there was damage noted, repairs should be made. Please reference your Summary of Damaged Asbestos Containing Materials found in Appendix A.

Since the last surveillance, the following asbestos abatement activities were performed:

In June 2023, bulk samples were collected of tectum decking in Reach/CYA Secretary Area Ceiling Plenum (AHERA space #1026CP), and Room 110 Ceiling Plenum (AHERA space #1048CP). Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #35302 for detailed sample location information and results.

In March 2023, asbestos containing floor tile and floor tile mastic, cove base and mastic, and wall/chalkboard mastic were removed from Room 211 (AHERA space #1001). A small amount of asbestos containing floor tile and mastic, cove base and mastic, and four (4) units of thermal pipe fitting insulation were removed from the Stage (AHERA space #1028). Please reference Enviroscience Consultants, LLC job #23404.

In February 2023, bulk samples were collected of duct insulation, hot water tank insulation, and pipe fitting insulation in the Boiler Room (AHERA space #1024). Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #34640 for detailed sample location information and results.

In February 2023, bulk samples were collected of pipe fitting insulation, pipe saddle insulation, wall/chalkboard mastic, and radiator insulation in Room 211 (AHERA space #1001). Results confirmed the wall/chalkboard mastic to be asbestos containing material; all the other materials sampled were confirmed to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #34639 for detailed sample location information and results.

History:

In April 2022, bulk samples were collected of concrete block and concrete block mortar at various locations throughout the School Building. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #32617 for detailed sample location information and results.

In November 2021, Enviroscience Consultants was retained by the Half Hollow Hills Central School District to perform the surveillance inspections and three year reinspections in full accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations. Any information pertaining to the assessment and changes in condition of ACBM prior to November 2021 must be obtained from the records maintained by the Half Hollow Hills Central School District.

In October 2021, bulk samples were collected of the wood floor mastic in the Gymnasium. Results confirmed the materials sampled to be asbestos containing. Please reference Enviroscience Consultants chain of custody #31529 for detailed sample location information and results.

In July 2021, bulk samples were collected of the insulation inside window panel in the mail Room and Room 203 - Inner Office. Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants chain of custody #30618 for detailed sample location information and results.

Any damaged material that is assumed to be asbestos containing should be sampled to confirm that it is identified as ACBM before initiating repair procedures.

The inspector did not access any flooring materials located under carpeting or new tiles because obtaining access would damage the carpet or new tiles. Prior to disturbing any carpets or removing new floor tiles, the school should ascertain whether floor tiles are located beneath them. Repair or replace damaged floor tiles as noted. We have prepared an inventory of asbestos containing materials for the building. These pages list the current damage category, changes in physical condition, current priority levels, changes in response actions, and bulk sampling and abatement information (see Appendix B).

All materials are currently classified as non-friable in their present condition, except for damaged thermal insulation materials, gypsum board, joint compound, and ceiling plaster.

III. Bulk Sampling Protocol

Thermal System Insulation - Three (3) samples are randomly collected for each homogeneous material of Thermal System Insulation (TSI). AHERA states that for each area of patched TSI at least one (1) sample be collected.

Surfacing Materials - a minimum of three (3), five (5) or seven (7) samples based upon the amount of suspect material present.

Miscellaneous Materials - require a minimum of two (2) samples.

New York State Revisions to Analytical Methods

Over the years, the New York State Department of Health has made several revisions to testing requirements that affect suspect asbestos materials in school buildings. These changes have resulted in the requirement to re-sample and analyze certain materials to comply with the revised analytical methods:

Surfacing Materials - In May 2016, the New York State Department of Health (NYSDOH) finalized testing requirements and approved a new analytical method for analysis of surfacing materials that contain vermiculite. Surfacing materials that could contain vermiculite include spray-on fireproofing, wall plaster, and ceiling plaster. Unfortunately, the previous analysis method for fireproofing and plasters did not specifically require that the vermiculite percentage be reported. The District must now consider any spray or troweled fireproofing or plaster materials to be presumed asbestos containing materials (PACM) until they are re-tested to conform to the new requirements. As a result, we have added any plaster previously classified as non-asbestos to the Inventory of Asbestos Containing Materials. Re-testing of any fireproofing or plaster materials will be noted in the narrative and will be shown in the Inventory.

Ceiling Tile - In August 2012, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in ceiling tiles that contain cellulose. Any ceiling tiles that have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Any re-testing of ceiling tiles will be noted in the narrative and will be shown in the Inventory. The District should keep records for any new non-asbestos ceiling tiles that are installed, including the location, brand, model number, date of manufacture, and date of installation.

Floor Tile and Other NOB Materials - In 1992, the New York State Department of Health stated that Transmission Electron Microscopy (TEM) is the only reliable method for identifying asbestos fibers in non-friable organically bound (NOB) materials such as floor tiles and roofing materials. As such, any floor tiles and mastic which have not been analyzed and found negative using TEM methods must be classified as ACM unless the District has documentation that they are non-ACM. Re-testing of any floor tile, mastic or other NOB materials will be noted in the narrative and will be shown in the Inventory.

During this surveillance, bulk samples were collected of tectum decking in Reach/CYA Secretary Area Ceiling Plenum (AHERA space #1026CP), and Room 110 Ceiling Plenum (AHERA space #1048CP). Results confirmed the materials sampled to be non-asbestos containing. Please reference Enviroscience Consultants, LLC chain of custody #35302 in Appendix 'F" for detailed sample location information and results.

IV. Hazard Rank Determination

For each homogeneous material, a response action priority level is determined depending on its physical condition, location, and potential for future damage. Materials were classified into seven categories, based upon the type, condition, and potential for damage of the ACBM. The categories are as follows:

Hazard Rank	ACBM Condition	ACBM Disturbance Potential
1	Significantly Damaged	Any Potential for Damage
2	Damaged	Potential for Significant Damage
3	Damaged	Potential for Damage
4	Damaged	Low Potential for Damage
5	Good	Potential for Significant Damage
6	Good	Potential for Damage
7	Good	Low Potential for Damage

The district shall select and implement in a timely manner the appropriate response actions consistent with the assessment category. The response actions selected shall be sufficient to protect human health and the environment. The district may then select, from the response actions which protect human health and the environment, that action which is the least burdensome method. Nothing in this section shall be construed to prohibit removal of ACBM from a school building at any time, should removal be the preferred response action of the district.

If damaged or significantly damaged thermal system insulation ACM is present in a building, the district shall:

(1) At least repair the damaged area.
(2) Remove the damaged material if it is not feasible, due to technological factors, to repair the damage.
(3) Maintain all thermal system insulation ACM and its covering in an intact state and undamaged condition.

If damaged friable surfacing ACM or damaged friable miscellaneous ACM is present in a building, the district shall select from among the following response actions: encapsulation, enclosure, removal, or repair of the damaged material.

In selecting the response action from among those which meet the definitional standards in §763.83, the district shall determine which of these response actions protects human health and the environment. For purposes of determining which of these response actions are the least burdensome, the district may then consider local circumstances, including occupancy and use patterns within the school building, and its economic concerns, including short and long-term costs.

V. AHERA Reassessment Category

The Management Planner is also required to classify each friable and thermal system insulation (TSI) ACBM and suspected ACBM assumed to be ACM in the school building into one of the following AHERA 1 through 7 reassessment categories based on damage, potential for damage, and material category:

(1) Damaged or significantly damaged thermal system insulation ACM.
(2) Damaged friable surfacing ACM.
(3) Significantly damaged friable surfacing ACM.
(4) Damaged or significantly damaged friable miscellaneous ACM.
(5) ACBM with potential for damage.
(6) ACBM with potential for significant damage.
(7) Any remaining friable ACBM or friable suspected ACBM.
N/A Not Applicable

Appendix A

INVENTORY OF DAMAGED ASBESTOS CONTAINING MATERIALS

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1002	Room 210 (new Gypsum Walls Installed)	12x12 Floor Tile & Mastic Beige/brown		544 sf	3 Tiles	4	N/A Non Friable	Repair	Chipped mastic exposed
1002A	Room 210 Inner Office (new Gypsum Walls Installed)	12x12 Floor Tile & Mastic Beige/brown		266 sf	1 Tile	4	N/A Non Friable	Repair	Cracked
1003A	Room 208 Left Office (new Gypsum Walls Installed)	12x12 Floor Tile & Mastic Beige/brown		209 sf	2 Tiles	4	N/A Non Friable	Repair	Cracked
1003B	Room 208 Right Office (new Gypsum Walls Installed)	12x12 Floor Tile & Mastic Beige/brown		209 sf	1 Tile	4	N/A Non Friable	Repair	Cracked
1005	Room 207	12x12 Floor Tile & Mastic Beige Water Color		660 sf	1 Tile	4	N/A Non Friable	Repair	Cracked
1006	Room 206	Cove Base & Mastic Brown		111 lf	<1 lf	4	N/A Non Friable	Repair	Missing w/ mastic exposed
1007	Storage Opposite Room 205	9x9 Floor Tile & Mastic Grey		126 sf	7 Tiles	4	N/A Non Friable	Repair	Missing mastic exposed
1009	Room 203	Gypsum Board & Compound		172 sf	< 1 sf	3	4	Repair	Chipped
1010	Room 201	12x12 Floor Tile & Mastic Beige Water Color		810 sf	2 Tiles	4	N/A Non Friable	Repair	Chipped
1011	Room 204	12x12 Floor Tile & Mastic Beige Water Color		650 sf	1 Tile	4	N/A Non Friable	Repair	Chipped
		Wall/chalk-board Mastic		9 sf	< 1 sf	4	N/A Non Friable	Repair	Exposed, encaapsulated by paint
1012A	Room 202 HHH Resource Library	9x9 Floor Tile & Mastic Tan		154 sf	15 Tiles	4	N/A Non Friable	Repair	Chipped with mastic exposed
1012B	Room 202 Conference	Wall Plaster Smooth		360 sf	8 lf	4	N/A Non Friable	Repair	Cracked
		Gypsum Board & Compound		252 sf	< 1 sf	3	4	Repair	Hole
1013A	Phys Ed Storage Bathroom	Ceiling Plaster		91 sf	1 sf	3	4	Repair	Water damage
1015	Cleaning Supply Storage By Room 201	9x9 Floor Tile & Mastic Tan		64 sf	5 Tiles	4	N/A Non Friable	Repair	Cracked and chipped

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1017	Women's Bathroom Near Gym	Ceramic Wall Tile Grout & Glue White		765 sf	1 Tile	4	N/A Non Friable	Repair	Missing Tiles
1018	Storage Near District Clerk	Ceramic Floor Tile Grout & Glue Pink		72 sf	<1 sf	4	N/A Non Friable	Repair	Chipped
1020	District Clerk	Gypsum Board & Compound		248 sf	<1 sf	3	4	Repair	Hole
1021A	Gym Storage 1	Cove Base & Mastic Brown		43 lf	10 LF	4	N/A Non Friable	Repair	Missing mastic exposed limited visibility
		Mud Joint Packing		5 Units	1 Unit	3	1	Repair	Chipped
1021B	Gym Storage 2 By Divider	9x9 Floor Tile & Mastic Tan		80 sf	2	4	N/A Non Friable	Repair	Epoxy Observed (Previously Chipped mastic exposed)
		Cove Base & Mastic Brown		30 lf	10 LF	4	N/A Non Friable	Repair	Missing mastic exposed limited visibility
		Ceiling Plaster Smooth		80 sf	< 1 SF	3	4	Repair	Chipped
1022	Hall from Main Hallway to Breakroom (Previously Paper Storage Hallway)	12x12 Floor Tile & Mastic Beige Water Color		231 sf	1 Tile	4	N/A Non Friable	Repair	Chipped
1023	Security Break Room	Cove Base & Mastic Brown		43 lf	3 Lf	4	N/A Non Friable	Repair	Delaminating & Missing w/ Mastic Exposed
1025	Mail Room	12x12 Floor Tile & Mastic Beige Water Color		640 sf	1 Tile	4	N/A Non Friable	Repair	Chipped w/ mastic exposed
		Cove Base & Mastic Black		81 lf	<1 lf	4	N/A Non Friable	Repair	Delaminating
1025CP	Mail Room Ceiling Plenum	Mud Joint Packing		2 Units	1 Unit	3	1	Repair	Chipped
1025A	Mail Room Office	Gypsum Board & Compound		153 sf	2 lf	3	4	Repair	Cracked
1025B	Mail Room Storage	Gypsum Board		324 sf	<1 sf	3	4	Repair	Holes
1026	Reach/cya Secretary Area	Cove Base & Mastic Blue		59 lf	<1 lf	4	N/A Non Friable	Repair	Delaminating

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1026CP	Reach/CYA Secretary Area Ceiling Plenum	1x1 Ceiling Tile Uniform Dot		280 SF	Not Quantified	4	N/A Non Friable	Repair	Missing Tiles
1026ACP	Reach/CYA Kitchen Ceiling Plenum	1x1 Ceiling Tile Uniform Dot		224 SF	Not Quantified	4	N/A Non Friable	Repair	Missing Tiles
1026BCP	Reach/CYA Office 2 Ceiling Plenum	1x1 Ceiling Tile Uniform Dot		224 SF	Not Quantified	4	N/A Non Friable	Repair	Missing Tiles
1026C	Reach/CYA Office 1	1x1 Acoustical Wall Tile & Mastic Speckled		60 SF	4 Tiles	4	N/A Non Friable	Repair	Chipped
1027A	Kitchen	Ceramic Floor Tile Grout & Glue Red		1250 SF	14 Tiles	4	N/A Non Friable	Repair	Chipped and cracked
1027A3	Kitchen Exterior Entrance Vestibule	Ceramic Wall Base Grout & Glue Red		15 SF	1 Tile	4	N/A Non Friable	Repair	Loose Tile
1027A3A	Kitchen Slop Sink	Ceramic Wall Base Grout & Glue Red		29 SF	4 Tiles	4	N/A Non Friable	Repair	Cracked
		Ceiling Plaster Smooth		63 SF	< 1 SF	3	4	Repair	Hole
1030	Corridor Between Stage & Mail Room	Cove Base & Mastic Black		170 LF	1 LF	4	N/A Non Friable	Repair	Delaminating
1030CP	Corridor Between Stage & Mail Room Ceiling Plenum	Mud Joint Packing		22 Units	Not Quantified	3	1	Repair	Chipped and cracked
1031CP	Corridor Room 211 - 250 Ceiling Plenum	Mud Joint Packing		82 Units	Not Quantified	3	1	Repair	Minor Damage
1032A	Room 250 Storage	9x9 Floor Tile & Mastic Tan		45 SF	1 Tile	4	N/A Non Friable	Repair	Chipped w/ mastic exposed
1034	Pascal Goodness Learning Center	Gypsum Board & Compound		1080 SF	7 LF	3	4	Repair	Cracked
1039	Vestibule To Admin Offices	12x12 Floor Tile & Mastic Beige Water Color		84 SF	5 Tiles	4	N/A Non Friable	Repair	Cracked and chipped
1040	Open Area For District Wide Administration Office	Ceramic Wall Tile Grout & Glue Yellow		18 SF	3 tiles	4	N/A Non Friable	Repair	Hole
1040A	Administration Office Copy Walk Through	Wood Panel Mastic		59 SF	<1 SF	4	N/A Non Friable	Repair	Minor Damage
1040ACP	Administration Office Copy Walk Through Ceiling Plenum	Roof Tar		N/A	< 1 SF	4	N/A Non Friable	Repair	Exposed

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1041A	Asst. Superintendent For District Wide Administration	Gypsum Board & Compound		270 sf	<1 sf	3	4	Repair	Dented
1041A1	Asst. Superintendent For District Wide Administration Bathroom	Ceiling Plaster Smooth		30 sf	< 1 SF	3	4	Repair	Minor Damage
1042A1	Room 101 Asst. Superintendent Closet	Gypsum Board		171 sf	< 1 sf	3	4	Repair	Holes
1042B	Room 101 Closet	Ceramic Floor Tile Grout & Glue Pink		18 sf	1	4	N/A Non Friable	Repair	Cracked
1042C	Room 101 District Data Coordinator Office	Gypsum Board & Compound		351 sf	< 1sf	3	4	Repair	Holes
1043A	Room 105/106 Director Instructional Computing Office	Gypsum Board & Compound		297 sf	< 1 sf	3	4	Repair	Chipped
1043D	Room 105/106 Director Of Management Information Systems Office	Gypsum Board & Compound		315 sf	< 1 sf	3	4	Repair	Dents
1043E	Room 106 Server Room	9x9 Floor Tile & Mastic Tan		403 sf	1 Tile	4	N/A Non Friable	Repair	Chipped
1044A	Room 109 Accounting & Storage (Separated into 2 Spaces)	9x9 Floor Tile & Mastic Tan		405 sf	4 Tiles	4	N/A Non Friable	Repair	Cracked
		Cove Base & Mastic Brown		84 lf	1 lf	4	N/A Non Friable	Repair	Delaminated Mastic Exposed
1045A	Director Of Public Relations Office Inner Office	Gypsum Board & Compound		285 sf	<1 sf	3	4	Repair	Cracked
1048ACP	Room 110 Director Of Social Studies Office Ceiling Plenum	Roof Tar		N/A	Not Quantified	4	N/A Non Friable	Repair	Exposed
1048BCP	Room 110 Director Of Health, Phys Ed Ceiling Plenum	Roof Tar		N/A	Not Quantified	4	N/A Non Friable	Repair	Exposed

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1049	Room 108	Gypsum Board & Compound		308 sf	<1 lf	3	4	Repair	Dented
1049A	Room 108 Director Of Math Office	Gypsum Board & Compound		352 sf	<1 sf	3	4	Repair	Dented
1050	Men's Room	Ceramic Floor Tile Grout & Glue Grey With Green		372 sf	<1 sf	4	N/A Non Friable	Repair	Missing
		Ceramic Wall Base Grout & Glue Green		83 sf	2 Tiles	4	N/A Non Friable	Repair	Cracked and missing
		Ceiling Plaster Smooth		372 sf	2 SF	3	4	Repair	Water damage
1053	Girl's Bathroom	Ceramic Floor Tile Grout & Glue Pink		372 sf	< 1 sf	4	N/A Non Friable	Repair	Missing & Chipped
1055	Corridor Superintendent Office To Phone Booth	12x12 Floor Tile & Mastic Beige Water Color		750 sf	15 Tiles	4	N/A Non Friable	Repair	Water damage, lifting and cracked

Appendix B

INVENTORY OF ASBESTOS CONTAINING MATERIALS

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1001	Room 211	9x9 Floor Tile & Mastic Grey		0					Removed March 2023 (ECL Job #23404)
		Cove Base & Mastic Brown		0					Removed March 2023 (ECL Job #23404)
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Wall/chalk-board Mastic		0					Removed March 2023 (ECL Job #23404)
		Wall Plaster (behind Wall Boards)		0					Non ASB Enviroscience#18978
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Metal Sink Undercoating Black		1 Unit	0	7	N/A Non Friable	O&M	Good Condition
		Radiator Insulation Board		0					Confirmed Non-ACM (ECL Job #23253)
		Pipe Saddle Insulation		0					Confirmed Non-ACM (ECL Job #23253)
		Mud Joint Packing		0					Confirmed Non-ACM (ECL Job #23253)
		Tectum Decking		0					Non ASB JCB#14-28692
1002	Room 210 (new Gypsum Walls Installed)	12x12 Floor Tile & Mastic Beige/brown		544 sf	3 Tiles	4	N/A Non Friable	Repair	Chipped mastic exposed
		Cove Base Brown		87 lf				O&M	Behind New Gypsum Walls
		Cove Base Mastic		0					Non ASB Enviroscience#18978
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #18978)
		Gypsum Board & Compound		0					New Material
		Wall/chalk-board Mastic		0					Non ASB Enviroscience#18978
		Wall Plaster (behind Wall Boards)		0					Non ASB Enviroscience#18978
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1002CP	Room 210 Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1002A	Room 210 Inner Office (new Gypsum Walls Installed)	12x12 Floor Tile & Mastic Beige/brown		266 sf	1 Tile	4	N/A Non Friable	Repair	Cracked
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #18978)
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile		0					Non ASB JCB#14-28692 TEM
1002ACP	Room 210 Inner Office Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1003	Room 208 School Lunch/security (new Gypsum Walls Installed)	12x12 Floor Tile & Mastic Beige/brown		392 sf	0	7	N/A Non Friable	O&M	Patched, good condition
		Cove Base Brown		72 lf				O&M	Behind New Gypsum Walls
		Cove Base Mastic		0					Non ASB Enviroscience#18978
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #18978)
		Wall/chalk-board Mastic		0					Non ASB Enviroscience#18978
		Wall Plaster (behind Wall Boards)		0					Non ASB Enviroscience#18978
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Mud Joint Packing		1 Unit	0	6	5	O&M	Limited Visual Access
		2x2 Ceiling Tile Splash		0					Non ASB JCB#14-28692 TEM
1003CP	Room 208 School Lunch/security Ceiling Plenum	Tectum Decking		0					Non ASB JCB#14-28692
1003A	Room 208 Left Office (new Gypsum Walls Installed)	12x12 Floor Tile & Mastic Beige/brown		209 sf	2 Tiles	4	N/A Non Friable	Repair	Cracked
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	No Access (Previously Good Condition)
		2x2 Ceiling Tile		0					Non ASB JCB#14-28692 TEM

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1003ACP	Room 208 Left Office Ceiling Plenum	Mud Joint Packing		1 Unit	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#18-39325
1003B	Room 208 Right Office (new Gypsum Walls Installed)	12x12 Floor Tile & Mastic Beige/brown		209 sf	1 Tile	4	N/A Non Friable	Repair	Cracked
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #18978)
		Gypsum Board & Compound		0					New Material
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile		0					Non ASB JCB#14-28692 TEM
1003BCP	Room 208 Right Office Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1004	Room 209	12x12 Floor Tile & Mastic Beige/brown		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Brown		0					New Brown Cove Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Wall/chalk-board Mastic		200 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1005	Room 207	12x12 Floor Tile & Mastic Beige Water Color		660 sf	1 Tile	4	N/A Non Friable	Repair	Cracked
		Cove Base & Mastic Brown		72 lf				O&M	Limited Visual Access
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		319 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile		0					Non ASB JCB#14-28692 TEM
1005CP	Room 207 Ceiling Plenum	Mud Joint Packing		1 Unit	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#18-39325
1005A	Room 207 Storage	12x12 Floor Tile & Mastic Beige Water Color		150 sf	0	7	N/A Non Friable	O&M	Good Condition
		Cove Base & Mastic Black		25 lf	0	7	N/A Non Friable	O&M	Limited Visibility - Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Wall/chalk-board Mastic		36 sf	0	7	N/A Non Friable	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1006	Room 206	9x9 Floor Tile & Mastic Tan		810 sf	0	7	N/A Non Friable	O&M	Under 12x12 Floor Tile
		12x12 Floor Tile & Mastic Beige/brown		810 sf	0	7	N/A Non Friable	O&M	Good Condition
		Cove Base & Mastic Brown		111 lf	<1 lf	4	N/A Non Friable	Repair	Missing w/ mastic exposed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Wall/chalk-board Mastic		200 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Mud Joint Packing		1 Unit	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692
1007	Storage Opposite Room 205	9x9 Floor Tile & Mastic Grey		126 sf	7 Tiles	4	N/A Non Friable	Repair	Missing mastic exposed
		Cove Base & Mastic Black		29 lf				O&M	Limited Visual Access
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692
1007A	Room 205 Floor Hatch								No Access

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1008	Room 205	Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Black		0					New Brown Cove Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Wall Panel Mastic		126 sf	0	7	N/A Non Friable	O&M	Good Condition
		Gypsum Board & Compound		396 sf	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x4 Ceiling Tile Deep Fissure		0					Non ASB JCB#14-28692 TEM
1008CP	Room 205 Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1008A	Room 205 Coordinator Of M.S. Special Ed	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		130 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		0					New Brown Cove Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		264 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x4 Ceiling Tile		0					Non ASB JCB#14-28692 TEM
1008ACP	Room 205 Coordinator Of M.S. Special Ed Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1008B	Room 205 Coordinator Of Pre-K Special Ed	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		126 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		0					New Brown Cove Observed
		Gypsum Board & Compound		396 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x4 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1008BCP	Room 205 Coordinator Of Pre-K Special Ed Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1008C	Room 205 Coordinator Of Elementary Special Ed	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		162 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Gypsum Board & Compound		360 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1008CCP	Room 205 Coordinator Of Elementary Special Ed Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1008D	Room 205 Coordinator Of H.S. Special Ed	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		168 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		0					New Cove Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		108 sf	0	6	5	O&M	Good Condition
		Wall/chalk-board Mastic		60 sf	0	7	N/A Non Friable	O&M	Good Condition
		Wood Panel Mastic		126 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1008DCP	Room 205 Coordinator Of H.S. Special Ed Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1009	Room 203	12x12 Floor Tile & Mastic Beige Water Color		660 sf	0	7	N/A Non Friable	O&M	Good Condition
		Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Black		72 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		172 sf	< 1 sf	3	4	Repair	Chipped
		Wood Panel Mastic		252 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1009CP	Room 203 Ceiling Plenum	Mud Joint Packing		0					Fiberglass, Not Suspect
		Tectum Decking		0					Non ASB JCB#18-39325
1009A	Room 203 Director Of Special Ed Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Brown		69 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		387 sf	0	6	5	O&M	Good Condition
		Wood Panel Mastic		200 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1009ACP	Room 203 Director Of Special Ed Office Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1009B	Room 203 Kitchen	12x12 Floor Tile & Mastic Beige Water Color		90 sf	0	7	N/A Non Friable	O&M	Good Condition
		Cove Base & Mastic Brown		40 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		230 sf	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Metal Sink Undercoating White		1 Unit	0	7	N/A Non Friable	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1009BCP	Room 203 Kitchen Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1010	Room 201	12x12 Floor Tile & Mastic Beige Water Color		810 sf	2 Tiles	4	N/A Non Friable	Repair	Chipped
		Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Brown		111 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Wall/chalk-board Mastic		100 sf	0	7	N/A Non Friable	O&M	Good Condition
		Wood Panel Mastic		225 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Metal		1 Door	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1010CP	Room 201 Ceiling Plenum	Mud Joint Packing		0					Fiberglass, Not Suspect
		Tectum Decking		0					Non ASB JCB#18-39325
1011	Room 204	12x12 Floor Tile & Mastic Beige Water Color		650 sf	1 Tile	4	N/A Non Friable	Repair	Chipped
		Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Brown		81 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		216 sf	0	6	5	O&M	Good Condition
		Wall/chalk-board Mastic		9 sf	< 1 sf	4	N/A Non Friable	Repair	Exposed, encaapsulated by paint
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1011CP	Room 204 Ceiling Plenum	Mud Joint Packing		1 Unit	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#18-39325
1011A	Room 204 Storage	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Brown		0					New Cove Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		169 sf	0	6	5	O&M	Good Condition
		Wall/Chalk-board Mastic		42 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile		0					Non ASB JCB#14-28692 TEM
1011ACP	Room 204 Storage Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1012	Room 202 Vestibule	9x9 Floor Tile & Mastic		156 sf	0	7	N/A Non Friable	O&M	Under 12x12 Floor Tile
		Cove Base & Mastic Black		0					New Cove Base Observed
		Wall Plaster Smooth		369 sf	0	7	N/A Non Friable	O&M	Good Condition
		Gypsum Board & Compound		162 sf	0	6	5	O&M	Good Condition
		Wall/Chalk-board Mastic		30 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM
1012CP	Room 202 Vestibule Ceiling Plenum	Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Tectum Decking		0					Non ASB JCB#18-39325

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1012A	Room 202 HHH Resource Library	9x9 Floor Tile & Mastic Tan		154 sf	15 Tiles	4	N/A Non Friable	Repair	Chipped with mastic exposed
		Cove Base & Mastic Brown		0					Material removed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		205 sf	0	6	5	O&M	Good Condition
		Wall/chalk-board Mastic		40 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM
1012ACP	Room 202 HHH Resource Library Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1012B	Room 202 Conference	Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Black		93 lf	0	7	N/A Non Friable	O&M	Good Condition
		Wall Plaster Smooth		360 sf	8 lf	4	N/A Non Friable	Repair	Cracked
		Gypsum Board & Compound		252 sf	< 1 sf	3	4	Repair	Hole
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1012BCP	Room 202 Conference Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1013	Phys Ed Storage	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		110 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		36 lf				O&M	Limited Visual Access
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1013CP	Phys Ed Storage Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1013A	Phys Ed Storage Bathroom	Ceramic Floor Tile Grout & Glue Grey With Green		91 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Base Grout & Glue Green		37 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Tile Grout & Glue Green		120 sf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Mirror Mastic		5 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Ceiling Plaster		91 sf	1 sf	3	4	Repair	Water damage

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1014	Men's Bathroom Near Room 201	Ceramic Floor Tile Grout & Glue Grey		420 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Tile Grout & Glue White		765 sf	0	7	N/A Non Friable	O&M	Good Condition
		Mirror Mastic		30 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Mud Joint Packing		0					Abated JCB#11-21149
		2x2 Ceiling Tile Speckled		0					Non ASB JCB#14-28692 TEM
		Ceiling Plaster		0					Non ASB Enviroscience, 2010, Removed
1014CP	Men's Bathroom Near Room 201 Ceiling Plenum	Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Mud Joint Packing		1 Unit	0	6	5	O&M	Good Condition
1014CP	Men's Bathroom Near Room 201 Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1015	Cleaning Supply Storage By Room 201	9x9 Floor Tile & Mastic Tan		64 sf	5 Tiles	4	N/A Non Friable	Repair	Cracked and chipped
		Cove Base & Mastic Brown		29 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Speckled		0					Non ASB JCB#14-28692 TEM
1015CP	Cleaning Supply Storage By Room 201 Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1016	Custodial Closet By Gym	Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Speckled		0					Non ASB JCB#14-28692 TEM
1016CP	Custodial Closet By Gym Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1017	Women's Bathroom Near Gym	Ceramic Floor Tile Grout & Glue Grey		420 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Tile Grout & Glue White		765 sf	1 Tile	4	N/A Non Friable	Repair	Missing Tiles
		Mirror Mastic		30 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Speckled		0					Non ASB JCB#14-28692 TEM
		Ceiling Plaster		0					Non ASB Enviroscience, 2010, Removed
1017CP	Women's Bathroom Near Gym Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1018	Storage Near District Clerk	Ceramic Floor Tile Grout & Glue Pink		72 sf	<1 sf	4	N/A Non Friable	Repair	Chipped
		Ceramic Wall Base Grout & Glue Pink		31 lf				O&M	Limited Visual Access
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Mirror Mastic		10 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Ceiling Plaster Smooth		72 sf	0	6	5	O&M	Good Condition

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1019	Unisex Bathroom By Gym	Ceramic Floor Tile Grout & Glue Grey		0					New Material Observed
		Ceramic Wall Tile Grout & Glue White		0					New Material Observed
		Mirror Mastic		5 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Speckled		0					Non ASB JCB#14-28692 TEM
1019CP	Unisex Bathroom By Gym Ceiling Plenum	Mud Joint Packing		1 Unit	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#18-39325
1020	District Clerk	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		431 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Brown		0					New Cove Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		248 sf	<1 sf	3	4	Repair	Hole
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x4 Ceiling Tile		0					Non ASB JCB#14-28692 TEM
1020CP	District Clerk Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1020A	District Clerk Closet	9x9 Floor Tile & Mastic Beige		96 sf	0	7	N/A Non Friable	O&M	Good Condition
		Cove Base & Mastic Brown		56 lf	0	7	N/A Non Friable	O&M	Good Condition, limited visibility
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	No Access (Previously Good Condition)
		Tectum Decking		0					Non ASB JCB#18-39325
1021	Gymnasium	Wood Floor Tar/vapor Barrier		3692 sf	0	7	N/A Non Friable	O&M	Confirmed ACM (ECI Job #21514)
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		6 Doors	0	6	5	O&M	Good Condition
		Fire Door Insulation Metal		2 Doors	0	6	5	O&M	Good Condition
		Mud Joint Packing		6 Units	0	6	5	O&M	Painted Over Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692
1021A	Gym Storage 1	9x9 Floor Tile & Mastic Tan		0					Removed Summer 2022
		Cove Base & Mastic Brown		43 lf	10 LF	4	N/A Non Friable	Repair	Missing mastic exposed limited visibility
		Mud Joint Packing		5 Units	1 Unit	3	1	Repair	Chipped
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1021B	Gym Storage 2 By Divider	9x9 Floor Tile & Mastic Tan		80 sf	2	4	N/A Non Friable	Repair	Epoxy Observed (Previously Chipped mastic exposed)
		Cove Base & Mastic Brown		30 lf	10 LF	4	N/A Non Friable	Repair	Missing mastic exposed limited visibility
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		Ceiling Plaster Smooth		80 sf	< 1 SF	3	4	Repair	Chipped
1022	Hall from Main Hallway to Breakroom (Previously Paper Storage Hallway)	12x12 Floor Tile & Mastic Beige Water Color		231 sf	1 Tile	4	N/A Non Friable	Repair	Chipped
		Cove Base & Mastic Black		74 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		1x1 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM
1023	Security Break Room	Cove Base & Mastic Brown		43 lf	3 Lf	4	N/A Non Friable	Repair	Delaminating & Missing w/ Mastic Exposed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Metal		2 Doors	0	6	5	O&M	Good Condition
		Duct Insulation		40 sf	0	6	5	O&M	Good Condition
		Ceiling Gypsum Board & Compound		0					Poured Concrete, Not Suspect
1023A	Security Storage	Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Metal		1 Door	0	6	5	O&M	Good Condition

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1023B	Security Bathroom	Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Mirror Mastic		10 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
1024	Boiler Room	Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Window Glazing/caulking		48 lf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Metal		2 Doors	0	6	5	O&M	Good Condition
		Mud Joint Packing		0					Confirmed Non-ACM (ECL Job #23165)
		Duct Insulation		0					Confirmed Non-ACM (ECL Job #23165)
		Hot Water Tank Insulation		0					Confirmed Non-ACM (ECL Job #23165)
		Cementitious Ceiling Material		750 sf	0	6	5	O&M	Good Condition
1024A	Boiler Room Transformer Room	Fire Door Insulation Metal		1 Door	0	6	5	O&M	Good Condition
1025	Mail Room	12x12 Floor Tile & Mastic Beige Water Color		640 sf	1 Tile	4	N/A Non Friable	Repair	Chipped w/ mastic exposed
		Cove Base & Mastic Black		81 lf	<1 lf	4	N/A Non Friable	Repair	Delaminating
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		288 sf	0	6	5	O&M	Good Condition
		Wall/chalk-board Mastic		100 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1025CP	Mail Room Ceiling Plenum	Mud Joint Packing		2 Units	1 Unit	3	1	Repair	Chipped
		Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1025A	Mail Room Office	12x12 Floor Tile & Mastic Beige Water Color		84 sf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		153 sf	2 lf	3	4	Repair	Cracked
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Metal Sink Undercoating White		1 Unit	0	7	N/A Non Friable	O&M	Good Condition
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM
1025ACP	Mail Room Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1025B	Mail Room Storage	9x9 Floor Tile & Mastic Grey		0					Abated Enviroscience#20506
		Cove Base & Mastic		0					Removed During Abatement
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board		324 sf	<1 sf	3	4	Repair	Holes
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		Fire Door Insulation Metal		1 Door	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692
		Roof Tar		N/A				O&M	Limited Visual Access

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1026	Reach/cya Secretary Area	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		280 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Blue		59 lf	<1 lf	4	N/A Non Friable	Repair	Delaminating
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		270 sf	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM
1026CP	Reach/cya Secretary Area Ceiling Plenum	1x1 Ceiling Tile Uniform Dot		280 sf	Not Quantified	4	N/A Non Friable	Repair	Missing Tiles
		Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1026A	Reach/cya Kitchen	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		224 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Blue		57 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		250 sf	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		1 Door				O&M	Hollow, Not Suspect
		Metal Sink Undercoating Grey		1 Unit	0	7	N/A Non Friable	O&M	Good Condition
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM
1026ACP	Reach/cya Kitchen Ceiling Plenum	1x1 Ceiling Tile Uniform Dot		224 sf	Not Quantified	4	N/A Non Friable	Repair	Missing Tiles
		Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1026B	Reach/CYA Office 2	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		224 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Blue		54 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		230 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM
1026BCP	Reach/CYA Office 2 Ceiling Plenum	1x1 Ceiling Tile Uniform Dot		224 sf	Not Quantified	4	N/A Non Friable	Repair	Missing Tiles
		Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1026C	Reach/CYA Office 1	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		156 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Blue		34 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		216 sf	0	6	5	O&M	Good Condition
		1x1 Acoustical Wall Tile & Mastic Speckled		60 sf	4 Tiles	4	N/A Non Friable	Repair	Chipped
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door				O&M	Hollow, Not Suspect
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM
1026CCP	Reach/CYA Office 1 Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1027	Kitchen Entry Hall	9x9 Floor Tile & Mastic Tan		0					Abated Enviroscience#20506
		Cove Base & Mastic Brown		0					Removed During Abatement
		Wall Plaster		0					Non ASB JCB#16-35472
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		1x1 Ceiling Tile Pan		326 sf	0	7	N/A Non Friable	O&M	Metal, Not Suspect
1027A	Kitchen	Ceramic Floor Tile Grout & Glue Red		1250 sf	14 Tiles	4	N/A Non Friable	Repair	Chipped and cracked
		Wall Plaster Smooth		0					Non ASB JCB#16-35472
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		1x1 Ceiling Tile Pan		1250 sf	0	7	N/A Non Friable	O&M	Metal, Not Suspect
1027A1	Kitchen Bathroom	Ceramic Floor Tile Grout & Glue Pink		81 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Base Grout & Glue Pink		40 sf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Mirror Mastic		10 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Ceiling Plaster Smooth		81 sf	0	6	5	O&M	Good Condition
1027A1CP	Kitchen Bathroom Ceiling Plenum	Mud Joint Packing		2 Units	0	6	5	O&M	Limited Visual Access

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1027A2	Kitchen Storage	Ceramic Floor Tile Grout & Glue		180 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Base Grout & Glue		53 lf	0	7	N/A Non Friable	O&M	Good Condition
		Wall Plaster Smooth		0					Non ASB JCB#16-35472
		Window Glazing/caulking		12 lf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Metal		1 Door	0	6	5	O&M	Good Condition
		Vibration Reducer Cloth White		2 Units	0	7	N/A Non Friable	O&M	Good Condition
		Ceiling Plaster Smooth		180 sf	0	6	5	O&M	Good Condition
1027A3	Kitchen Exterior Entrance Vestibule	Ceramic Floor Tile Grout & Glue Red		45 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Base Grout & Glue Red		15 sf	1 Tile	4	N/A Non Friable	Repair	Loose Tile
		Wall Plaster Smooth		0					Non ASB JCB#16-35472
		Window Glazing/caulking		8 lf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Metal		1 Door	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
1027A3A	Kitchen Slop Sink	Ceramic Floor Tile Grout & Glue Red		63 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Base Grout & Glue Red		29 sf	4 Tiles	4	N/A Non Friable	Repair	Cracked
		Wall Plaster Smooth		0					Non ASB JCB#16-35472
		Mud Joint Packing		0					Conf ASB JCB#16-35472; Abated JCB#18-41729
		Ceiling Plaster Smooth		63 sf	< 1 sf	3	4	Repair	Hole

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1027A4	Kitchen Storage 2	Ceramic Floor Tile Grout & Glue Red		56 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Base Grout & Glue Red		24 sf	0	7	N/A Non Friable	O&M	Good Condition
		Wall Plaster Smooth		0					Non ASB JCB#16-35472
		Gypsum Board & Compound		45 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		1x1 Ceiling Tile Pan		0					Metal, Not Suspect
1027A4CP	Kitchen Storage 2 Ceiling Plenum	Mud Joint Packing		3 Units		7	7	O&M	Limited Visual Access - Ceiling tile missing & exposed
1028	Stage/records Room	9x9 Floor Tile & Mastic Grey		25 sf	0	7	N/A Non Friable	O&M	25 SF Abated (ECL Job #23404) Good Condition
		Wood Floor Tar/vapor Barrier		910 sf	0	7	N/A Non Friable	O&M	Good Condition
		Cove Base & Mastic Black		0					Removed March 2023 (ECL Job #23404)
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Metal		2 Doors	0	6	5	O&M	Good Condition
		Mud Joint Packing		0					Removed March 2023 (ECL Job #23404)
1028A	Stage Storage	Wood Floor Tar/vapor Barrier		90 sf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1029	Cafeteria/general purpose room	9x9 Floor Tile & Mastic Grey		0					Abated Enviroscience #20506
		Cove Base & Mastic Brown		0					Removed During Abatement
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		5 Doors	0	6	5	O&M	Good Condition
		Fire Door Insulation Metal		2 Doors	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692
1030	Corridor Between Stage & Mail Room	12x12 Floor Tile & Mastic Beige/brown		900 sf	0	7	N/A Non Friable	O&M	Good Condition
		Cove Base & Mastic Black		170 lf	1 lf	4	N/A Non Friable	Repair	Delaminating
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Wall/chalk-board Mastic		200 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Metal		2 Doors	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1030CP	Corridor Between Stage & Mail Room Ceiling Plenum	Mud Joint Packing		22 Units	Not Quantified	3	1	Repair	Chipped and cracked
		Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1031	Corridor Room 211 - 250	12x12 Floor Tile & Mastic Beige Water Color		3310 sf	0	7	N/A Non Friable	O&M	Good Condition - Visibly Confirmed 9x9 Under 12x12 by Room 211
		Cove Base & Mastic Black		534 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Wall/chalk-board Mastic		600 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Metal		6 Doors	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1031CP	Corridor Room 211 - 250 Ceiling Plenum	Mud Joint Packing		82 Units	Not Quantified	3	1	Repair	Minor Damage
		Tectum Decking		0					Non ASB JCB#18-39325
1032	Room 250 Conference Room	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		280 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		64 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		333 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Industrial Wall Paper		270 sf	0	7	N/A Non Friable	O&M	Good Condition
		2x2 Ceiling Tile		0					Non ASB JCB#14-28692 TEM

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1032CP	Room 250 Conference Room Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1032A	Room 250 Storage	9x9 Floor Tile & Mastic Tan		45 sf	1 Tile	4	N/A Non Friable	Repair	Chipped w/ mastic exposed
		Cove Base & Mastic Brown		25 lf	0	7	N/A Non Friable	O&M	Good Condition, limited visibility
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Mud Joint Packing		11 Units	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692
1032B	Room 250 Bathroom	Ceramic Floor Tile Grout & Glue Grey With Blue		25 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Base Grout & Glue Blue		17 sf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Mirror Mastic		10 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Ceiling Plaster Smooth		25 sf	0	6	5	O&M	Good Condition
1033	Superintendent Office Reception	Wood Floor Tar/vapor Barrier		400 sf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		260 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Industrial Wall Paper		180 sf	0	7	N/A Non Friable	O&M	Good Condition
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1033CP	Superintendent Office Reception Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1033A	Superintendent Copy Room	Wood Floor Tar/vapor Barrier		140 sf	0	7	N/A Non Friable	O&M	Good Condition
		Gypsum Board & Compound		260 sf	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM
1033ACP	Superintendent Copy Room Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
		Roof Tar		1 sf	0	7	N/A Non Friable	O&M	Good Condition
1033A1	Superintendent Copy Room Closet	Wood Floor Tar/vapor Barrier		10 sf				O&M	Limited Visual Access
		Cove Base & Mastic Brown		6 lf				O&M	Limited Visual Access
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692
1033B	Superintendent Filing Room	9x9 Floor Tile & Mastic Tan		56 sf	0	7	N/A Non Friable	O&M	Good Condition
		Cove Base & Mastic Brown		27 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1033C	Superintendent Office Storage	Wood Floor Tar/Vapor Barrier		125 sf				O&M	Limited Visual Access
		Cove Base & Mastic Black		21 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Metal Sink Undercoating Grey		1 Unit	0	7	N/A Non Friable	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692
1033D	Superintendent Office	Wood Floor Tar/Vapor Barrier		480 sf				O&M	Limited Visual Access
		Gypsum Board & Compound		738 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile		0					Non ASB JCB#14-28692 TEM
1033DCP	Superintendent Office Ceiling Plenum								No Access
1033D1	Superintendent Office Closet	Wood Floor Tar/Vapor Barrier		15 sf	0	7	N/A Non Friable	O&M	Good Condition
		Cove Base & Mastic		13 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#18-39325

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1033D2	Superintendent Office Bathroom	Wood Floor Tar/vapor Barrier		25 sf				O&M	Limited Visual Access
		Ceramic Wall Base Grout & Glue Beige		18 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Ceiling Plaster		25 sf	0	6	5	O&M	Good Condition
1033D3	Superintendent Office Work Room	Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Black		65 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		198 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Industrial Wall Paper		255 sf	0	7	N/A Non Friable	O&M	Good Condition
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM
1033D3CP	Superintendent Office Work Room Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1034	Pascal Goodness Learning Center	12x12 Floor Tile & Mastic Beige Water Color		16 sf	0	7	N/A Non Friable	O&M	Carpet Observed
		Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Black		0					Wood Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		1080 sf	7 lf	3	4	Repair	Cracked
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Fire Door Insulation Metal		1 Door	0	6	5	O&M	Good Condition
		Metal Sink Undercoating Grey		1 Unit	0	7	N/A Non Friable	O&M	Good Condition
		2x2 Ceiling Tile Textured		0					Non ASB JCB#14-28692 TEM
1034CP	Pascal Goodness Learning Center Ceiling Plenum	Tectum Decking		0					Non ASB JCB#18-39325
1035	Asst. Superintendent Office 1	Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Black		78 lf	0	7	N/A Non Friable	O&M	Good Condition
		Gypsum Board & Compound		570 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1035CP	Asst. Superintendent Office 1 Ceiling Plenum	1x1 Ceiling Tile Uniform Dot		332 sf	0	7	N/A Non Friable	O&M	Good Condition
		Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1036	Phone Booth	Linoleum Flooring Red		6 sf	0	7	N/A Non Friable	O&M	Good Condition
1037	Asst. Superintendent Secretary Area	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Black		0					New Cove Base Observed
		Gypsum Board & Compound		594 sf	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1037CP	Asst. Superintendent Secretary Area Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1037A	Asst. Superintendent Copy Room	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Black		0					New Cove Base Observed
		Gypsum Board & Compound		396 sf	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1037ACP	Asst. Superintendent Copy Room Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1037B	Asst. Superintendent Conference Room	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		195 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		53 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		477 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1037BCP	Asst. Superintendent Conference Room Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1037C	Asst. Superintendent 2 Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		260 sf	0	7	N/A Non Friable	O&M	Good Condition
		Cove Base & Mastic Black		63 lf	0	7	N/A Non Friable	O&M	Good Condition
		Gypsum Board & Compound		567 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1037CCP	Asst. Superintendent 2 Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1037D	Asst. Superintendent Kitchen Area	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Black		0					New Cove Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		189 sf	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		1 Door				O&M	Door Removed
		Metal Sink Undercoating White		1 Unit	0	7	N/A Non Friable	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1037DCP	Asst. Superintendent Kitchen Area Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1037D1	Asst. Superintendent Kitchen Bathroom	Ceramic Floor Tile Grout & Glue Pink		18 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Base Grout & Glue Pink		15 sf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Mirror Mastic		5 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Ceiling Plaster Smooth		18 sf	0	6	5	O&M	Good Condition
1037E	Asst. Superintendent Secretary Area Closet	Carpet Mastic		0					Non ASB JCB#16-35044
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		1 Door				O&M	Hollow, Not Suspect
		Tectum Decking		0					Non ASB JCB#14-28692

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1038	Director Of Athletics & Fine Arts Secretary	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Black		0					New Cove Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		680 sf	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1038CP	Director Of Athletics & Fine Arts Secretary Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1038A	Director Of Fine Arts Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		234 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		58 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		522 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door				O&M	Hollow, Not Suspect
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1038ACP	Director Of Fine Arts Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1038B	Director Of Athletics Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		216 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		0					New Cove Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		405 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1038BCP	Director Of Athletics Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1038C	Director Of Athletics/Fine Arts Closet	Ceramic Floor Tile Grout & Glue Pink		18 sf	0	6	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Base Grout & Glue Pink		15 lf	0	6	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Ceiling Plaster Smooth		18 sf	0	6	5	O&M	Good Condition
1039	Vestibule To Admin Offices	12x12 Floor Tile & Mastic Beige Water Color		84 sf	5 Tiles	4	N/A Non Friable	Repair	Cracked and chipped
		Cove Base & Mastic Black		28 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		1x1 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1039CP	Vestibule To Admin Offices Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1040	Open Area For District Wide Administration Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Brown		0					New Cove Base Observed
		Ceramic Wall Tile Grout & Glue Yellow		18 sf	3 tiles	4	N/A Non Friable	Repair	Hole
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Metal		1 Door	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1040CP	Open Area For District Wide Administration Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
		Roof Tar Black		N/A	0	7	N/A Non Friable	O&M	Good Condition
1040A	Administration Office Copy Walk Through	Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Black		0					New Brown Cove Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		117 sf	0	6	5	O&M	Good Condition
		Wood Panel Mastic		59 sf	<1 sf	4	N/A Non Friable	Repair	Minor Damage
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1040ACP	Administration Office Copy Walk Through Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
		Roof Tar		N/A	< 1 sf	4	N/A Non Friable	Repair	Exposed

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1040B	Administration Office Bathroom	Ceramic Floor Tile Grout & Glue Grey With Green		30 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Base Grout & Glue Green		19 sf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Mirror Mastic		20 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Ceiling Plaster Smooth		30 sf	0	6	5	O&M	Good Condition
1040C	Administration Office Kitchen	9x9 Floor Tile & Mastic Tan		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Brown		25 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Metal Sink Undercoating White		1 Unit	0	7	N/A Non Friable	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1040CCP	Administration Office Kitchen Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1041	Secretary To Asst. Superintendent For Administration	Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Black		0					New Brown Cove Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		288 sf	0	6	5	O&M	Good Condition
		Wood Panel Mastic		130 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1041CP	Secretary To Asst. Superintendent For Administration Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
		Roof Tar		N/A	0	7	N/A Non Friable	O&M	Good Condition
1041A	Asst. Superintendent For District Wide Administration	Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Brown		68 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		270 sf	<1 sf	3	4	Repair	Dented
		Wood Panel Mastic		180 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Metal		1 Door	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1041ACP	Asst. Superintendent For District Wide Administration Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1041A1	Asst. Superintendent For District Wide Administration Bathroom	Ceramic Floor Tile Grout & Glue Grey With Blue		30 sf	0	7	N/A Non Friable	O&M	Good Condition
		Ceramic Wall Base Grout & Glue Blue		19 sf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Mirror Mastic		5 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Ceiling Plaster Smooth		30 sf	< 1 SF	3	4	Repair	Minor Damage

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1041A2	Asst. Superintendent For District Wide Administration Storage	9x9 Floor Tile & Mastic Tan		49 sf	0	7	N/A Non Friable	O&M	Good Condition
		Cove Base & Mastic Brown		25 lf	0	7	N/A Non Friable	O&M	Good Condition, limited visibility
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Mud Joint Packing		1 Unit	0	6	5	O&M	Good condition
		Tectum Decking		0					Non ASB JCB#14-28692
1042	Room 101	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic (originally Reported Under Carpet)		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Black		0					New Cove Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		270 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		Metal Sink Undercoating Grey		1 Unit	0	7	N/A Non Friable	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1042CP	Room 101 Ceiling Plenum	Vibration Reducer Cloth Black		0					Rubber, Not Suspect
		Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1042A	Room 101 Asst. Superintendent For Finance, Facilities Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Cove Base & Mastic Black		86 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		342 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1042ACP	Room 101 Asst. Superintendent For Finance, Facilities Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1042A1	Room 101 Asst. Superintendent Closet	Carpet Mastic		69 sf	0	7	N/A Non Friable	O&M	Good condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Wall Panel Mastic		99 sf	0	7	N/A Non Friable	O&M	No Access (Previously Good Condition)
		Gypsum Board		171 sf	< 1 sf	3	4	Repair	Holes
		Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1042B	Room 101 Closet	Ceramic Floor Tile Grout & Glue Pink		18 sf	1	4	N/A Non Friable	Repair	Cracked
		Ceramic Wall Base Grout & Glue Pink		15 lf				O&M	Limited Visual Access
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Ceiling Plaster Smooth		18 sf	0	6	5	O&M	Good Condition

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1042C	Room 101 District Data Coordinator Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Black		0					New Cove Base Observed
		Gypsum Board & Compound		351 sf	< 1sf	3	4	Repair	Holes
		Wood Panel Mastic		110 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1042CCP	Room 101 District Data Coordinator Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1043	Room 105/106	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Black		0					New Cove Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		280 sf	0	6	5	O&M	Good Condition
		Fire Door Insulation Wood		2 Doors	0	6	5	O&M	Good Condition
		Metal Sink Undercoating Grey		1 Unit	0	7	N/A Non Friable	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1043CP	Room 105/106 Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1043A	Room 105/106 Director Instructional Computing Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		130 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Brown		43 lf	0	7	N/A Non Friable	O&M	Good Condition
		Gypsum Board & Compound		297 sf	< 1 sf	3	4	Repair	Chipped
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x4 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1043ACP	Room 105/106 Director Instructional Computing Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1043B	Room 105/106 Telephone Systems Manager Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		110 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Brown		39 lf	0	7	N/A Non Friable	O&M	Good Condition
		Gypsum Board & Compound		270 sf	0	6	5	O&M	Good condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x4 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1043BCP	Room 105/106 Telephone Systems Manager Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1043C	Room 105/106 Kitchen Area	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		0					New 12x12 Floor Tile Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		126 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door				O&M	Hollow, Not Suspect
		2x4 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1043CCP	Room 105/106 Kitchen Area Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1043D	Room 105/106 Director Of Management Information Systems Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		168 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		48 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		315 sf	< 1 sf	3	4	Repair	Dents
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x4 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1043DCP	Room 105/106 Director Of Management Information Systems Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1043E	Room 106 Server Room	9x9 Floor Tile & Mastic Tan		403 sf	1 Tile	4	N/A Non Friable	Repair	Chipped
		Cove Base & Mastic Beige		13 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		239 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692
1044	Room 107	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Brown		0					New Cove Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Wall/chalk-board Mastic		200 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1044CP	Room 107 Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1044A	Room 109 Accounting & Storage (Separated into 2 Spaces)	9x9 Floor Tile & Mastic Tan		405 sf	4 Tiles	4	N/A Non Friable	Repair	Cracked
		Cove Base & Mastic Brown		84 lf	1 lf	4	N/A Non Friable	Repair	Delaminated Mastic Exposed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		270 sf	0	6	5	O&M	Good Condition
		Wall/chalk-board Mastic		120 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fiberboard		35 sf	0	6	5	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile		0					New Material, Originally No Ceiling Tile
1044ACP	Room 109 Accounting & Storage Ceiling Plenum	Mud Joint Packing		1 Unit	0	6	5	O&M	Limited Visual Access
		Tectum Decking		0					Non ASB JCB#14-28692
1045	Director Of Public Relations Office	9x9 Floor Tile & Mastic		225 sf	0	7	N/A Non Friable	O&M	Reported Under 12x12 Floor Tile
		Cove Base & Mastic Brown		0					New Cove Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		270 sf	0	6	5	O&M	Good Condition
		Wall/chalk-board Mastic		100 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Metal Sink Undercoating Black		1 Unit	0	7	N/A Non Friable	O&M	Good Condition
		2x2 Ceiling Tile Speckled		0					Non ASB JCB#14-28692 TEM

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1045CP	Director Of Public Relations Office Ceiling Plenum	Tectum Decking		0					Non ASB JCB#14-28692
1045A	Director Of Public Relations Office Inner Office	12x12 Floor Tile & Mastic Beige Water Color		224 sf	0	7	N/A Non Friable	O&M	Good Condition
		Cove Base & Mastic Brown		58 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		285 sf	<1 sf	3	4	Repair	Cracked
		Wall/chalk-board Mastic		72 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile		0					Non ASB JCB#14-28692 TEM
1045ACP	Director Of Public Relations Office Inner Office Ceiling Plenum	Fiberboard		40 sf	0	6	5	O&M	Limited Visual Access
		Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
		Roof Tar		N/A	0	7	N/A Non Friable	O&M	Good Condition
1046	Portable Director Of Facilities Secretary Area	Carpet Mastic		0					Portable Removed, 2013
		Cove Base & Mastic Brown		0					Portable Removed, 2013
		Fire Door Insulation Metal		0					Portable Removed, 2013
		Fire Door Insulation Wood		0					Portable Removed, 2013
		Metal Sink Undercoating Grey		0					Portable Removed, 2013
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1046A	Portable Secretary Area Women's Bathroom	12x12 Floor Tile & Mastic Grey Water Color		0					Portable Removed, 2013
		Cove Base & Mastic Black		0					Portable Removed, 2013
		Fire Door Insulation Wood		0					Portable Removed, 2013
		2x4 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1046B	Portable Secretary Area Closet	Carpet Mastic		0					Portable Removed, 2013
		Fire Door Insulation Wood		0					Portable Removed, 2013
		2x4 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1046C	Portable Storage Room	Carpet Mastic		0					Portable Removed, 2013
		Cove Base & Mastic Black		0					Portable Removed, 2013
		Fire Door Insulation Wood		0					Portable Removed, 2013
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1046D	Portable Men's Bathroom	12x12 Floor Tile & Mastic Grey Water Color		0					Portable Removed, 2013
		Cove Base & Mastic Black		0					Portable Removed, 2013
		Fire Door Insulation Wood		0					Portable Removed, 2013
		2x4 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1046E	Portable Child Nutrition Program Director Office	Carpet Mastic		0					Portable Removed, 2013
		Cove Base & Mastic Black		0					Portable Removed, 2013
		Fire Door Insulation Metal		0					Portable Removed, 2013
		Fire Door Insulation Wood		0					Portable Removed, 2013
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1046F	Portable Security Supervisor Office	Carpet Mastic		0					Portable Removed, 2013
		Cove Base & Mastic Black		0					Portable Removed, 2013
		Fire Door Insulation Wood		0					Portable Removed, 2013
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1046G	Portable Director Of Facilities Office	Carpet Mastic		0					Portable Removed, 2013
		Cove Base & Mastic Black		0					Portable Removed, 2013
		Fire Door Insulation Metal		0					Portable Removed, 2013
		Fire Door Insulation Wood		0					Portable Removed, 2013
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1046H	Portable Director Of Facilities Hall	Carpet Mastic		0					Portable Removed, 2013
		Cove Base & Mastic Black		0					Portable Removed, 2013
1046H	Portable Director Of Facilities Hall	2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1047	Vestibule Portable (Facilities Office) To Building	Carpet Mastic		0					Portable Removed, 2013
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1048	Room 110	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Black		0					New Cove Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Wall/chalk-board Mastic		72 sf	0	7	N/A Non Friable	O&M	Good Condition
		Wood Panel Mastic		134 sf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Metal Sink Undercoating Grey		1 Unit	0	7	N/A Non Friable	O&M	Good Condition
		2x4 Ceiling Tile Deep Fissure		0					Non ASB JCB#14-28692 TEM
1048CP	Room 110 Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1048A	Room 110 Director Of Social Studies Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		196 sf	0	7	N/A Non Friable	O&M	Confirmed Under Carpet
		Cove Base & Mastic Black		53 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		126 sf	0	6	5	O&M	Good Condition
		Wood Panel Mastic		126 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door				O&M	Hollow, Not Suspect
		2x4 Ceiling Tile Deep Fissure		0					Non ASB JCB#14-28692 TEM

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1048ACP	Room 110 Director Of Social Studies Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
		Roof Tar		N/A	Not Quantified	4	N/A Non Friable	Repair	Exposed
1048B	Room 110 Director Of Health, Phys Ed	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		238 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		45 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		279 sf	0	6	5	O&M	Good Condition
		Wood Panel Mastic		154 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fissure		0					Non ASB JCB#14-28692 TEM
1048BCP	Room 110 Director Of Health, Phys Ed Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
		Roof Tar		N/A	Not Quantified	4	N/A Non Friable	Repair	Exposed

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1048C	Room 110 Coordinator Of Language Arts Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		168 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		24 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		234 sf	0	6	5	O&M	Good Condition
		Wall/Chalk-board Mastic		42 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x4 Ceiling Tile Deep Fissure		0					Non ASB JCB#14-28692 TEM
1048CCP	Room 110 Coordinator Of Language Arts Office Ceiling Plenum	Mud Joint Packing		1 Unit	0	6	5	O&M	Good Condition
		Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1049	Room 108	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		0					New 12x12 Floor Tile Observed
		Cove Base & Mastic Black		0					New Cove Base Observed
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		308 sf	<1 lf	3	4	Repair	Dented
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x4 Ceiling Tile Deep Fissure		0					Non ASB JCB#14-28692 TEM

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1049CP	Room 108 Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1049A	Room 108 Director Of Math Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		196 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		53 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		352 sf	<1 sf	3	4	Repair	Dented
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		2x4 Ceiling Tile Deep Fissure		0					Non ASB JCB#14-28692 TEM
1049ACP	Room 108 Director Of Math Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1049B	Room 108 Director Of Science Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		238 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		57 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		249 sf	0	6	5	O&M	Good Condition
		Wall/chalk-board Mastic		48 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door				O&M	Hollow, Not Suspect
		2x4 Ceiling Tile Speckled		0					Non ASB JCB#14-28692 TEM


Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1049BCP	Room 108 Director Of Science Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
		Roof Tar		N/A	0	7	N/A Non Friable	O&M	Good Condition
1049C	Director L.O.T.E. Office	Carpet Mastic		0					Non ASB JCB#16-35044
		Floor Tile & Mastic		192 sf	0	7	N/A Non Friable	O&M	Reported Under Carpet
		Cove Base & Mastic Black		53 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		252 sf	0	6	5	O&M	Good Condition
		Wall/chalk-board Mastic		16 sf	0	7	N/A Non Friable	O&M	Painted over
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door				O&M	Hollow, Not Suspect
		2x4 Ceiling Tile		0					Non ASB JCB#14-28692 TEM
1049CCP	Director L.O.T.E. Office Ceiling Plenum	Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1050	Men's Room	Ceramic Floor Tile Grout & Glue Grey With Green		372 sf	<1 sf	4	N/A Non Friable	Repair	Missing
		Ceramic Wall Base Grout & Glue Green		83 sf	2 Tiles	4	N/A Non Friable	Repair	Cracked and missing
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Wall/chalk-board Mastic		15 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Ceiling Plaster Smooth		372 sf	2 SF	3	4	Repair	Water damage

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1051	Custodial Closet Near Room 107	Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#14-28692
1052	Storage Room	Ceiling Plaster Smooth		N/A		6	5	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Ceramic Floor Tile Grout & Glue		N/A		6	5	O&M	Good Condition
1053	Girl's Bathroom	Ceramic Floor Tile Grout & Glue Pink		372 sf	< 1 sf	4	N/A Non Friable	Repair	Missing & Chipped
		Ceramic Wall Base Grout & Glue Pink		83 sf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Mirror Mastic		15 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Wood		1 Door	0	6	5	O&M	Good Condition
		Ceiling Plaster		372 sf	0	6	5	O&M	Good Condition
1054	Corridor Room 110 To District Admin Office	12x12 Floor Tile & Mastic Beige Water Color		1908 sf	0	7	N/A Non Friable	O&M	9x9 Confirmed Under
		Cove Base & Mastic Brown		320 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Gypsum Board & Compound		96 sf	0	6	5	O&M	Good Condition
		Wall/chalk-board Mastic		312 sf	0	7	N/A Non Friable	O&M	Good Condition
		Window Glazing/caulking		48 lf	0	7	N/A Non Friable	O&M	Good Condition
		Fire Door Insulation Metal		2 Doors	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect

Space No.	Location	Material Description	HA/USA	Quantity	Amount Damaged	Hazard Rank	AHERA Reassessment Category	Response Action	Remarks
1054CP	Corridor Room 110 To District Admin Office Ceiling Plenum	Mud Joint Packing		41 Units	0	6	5	O&M	Good Condition
		Tectum Decking		0					Confirmed Non-ACM (ECL Job #23546)
1055	Corridor Superintendent Office To Phone Booth	12x12 Floor Tile & Mastic Beige Water Color		750 sf	15 Tiles	4	N/A Non Friable	Repair	Water damage, lifting and cracked
		12x12 Floor Tile & Mastic Textured/on Ramp		450 sf	0	7	N/A Non Friable	O&M	Good Condition
		Cove Base & Mastic Brown		220 lf	0	7	N/A Non Friable	O&M	Good Condition
		Concrete Block & Mortar		0					Confirmed Non-ACM (ECI Job #22164)
		Window Glazing/caulking		0					Abated Enviroscience, 2002
		Fire Door Insulation Metal		4 Doors	0	6	5	O&M	Good Condition
		2x2 Ceiling Tile Fiberglass		0					Fiberglass, Not Suspect
1055CP	Corridor Superintendent Office To Phone Booth Ceiling Plenum	Mud Joint Packing		34 Units	0	6	5	O&M	Good Condition
		Tectum Decking		0					Non ASB JCB#18-39325

Appendix C

DRAWINGS

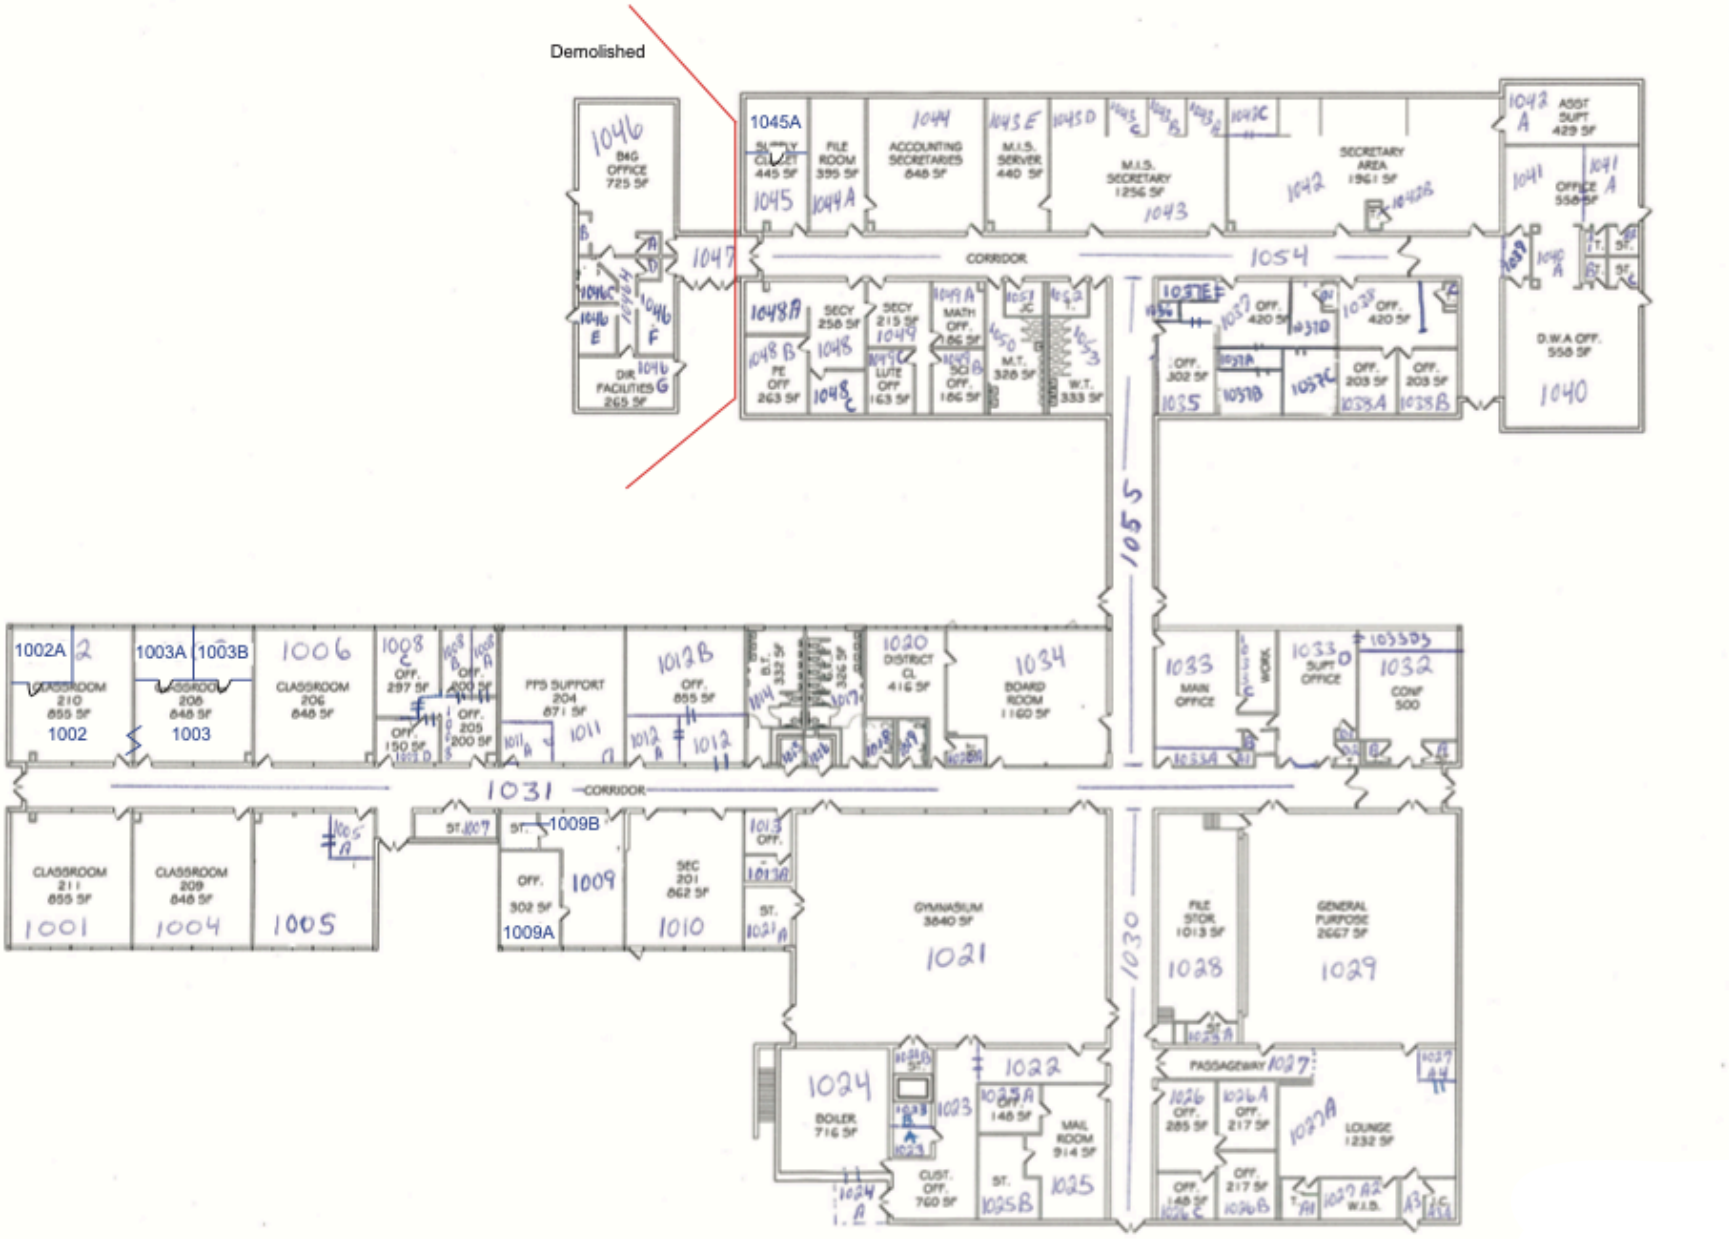

ENVIROSCIENCE CONSULTANTS
2150 SMITHTOWN AVENUE
RONKONKOMA, NY 11779
(631) 580-3191
FAX 580-3195
www.envirohealth.org

KEY PLAN

NO SCALE

PROJECT

SIX MONTH AHERA SURVEILLANCE
FRAN GREENSPAN ADMINISTRATION CENTER
FLOOR PLAN

CLIENT

HALF HOLLOW HILLS CENTRAL SCHOOL DISTRICT

PROJECT #: 23546

COMMENTS:
None

NOT TO SCALE

Date: 07/11/2023

By: Robert Cardona

DRAWING 1 of 1

Appendix D

CERTIFICATIONS

ENVIROSCIENCE CONSULTANTS
A Mainline Company

WE ARE YOUR DOL

NEW YORK STATE | Department of Labor

DIVISION OF SAFETY & HEALTH LICENSE AND CERTIFICATE UNIT, STATE OFFICE CAMPUS, BLDG. 12, ALBANY, NY 12226

ASBESTOS HANDLING LICENSE

Enviroscience Consultants, LLC
2150 Smithtown Avenue, Ronkonkoma, NY, 11779

License Number: 28733
License Class: RESTRICTED
Date of Issue: 11/04/2022
Expiration Date: 11/30/2023
Duly Authorized Representative: Bartley Gallagher

This license has been issued in accordance with applicable provisions of Article 30 of the Labor Law of New York State and of the New York State Codes, Rules and Regulations (12 NYCRR Part 56). It is subject to suspension or revocation for a (1) serious violation of state, federal or local laws with regard to the conduct of an asbestos project, or (2) demonstrated lack of responsibility in the conduct of any job involving asbestos or asbestos material.

This license is valid only for the contractor named above and this license or a photocopy must be prominently displayed at the asbestos project worksite. This license verifies that all persons employed by the licensee on an asbestos project in New York State have been issued an Asbestos Certificate, appropriate for the type of work they perform, by the New York State Department of Labor.

Amy Phillips, Director
For the Commissioner of Labor

EXCELSIOR

SH 432 (12/21)

Appendix E

NOTICE TO SHORT TERM WORKERS

NOTICE TO SHORT TERM WORKERS

All workers entering Fran Greenspan Administration Center must sign in, thereby acknowledging the presence and locations of asbestos containing building materials in the building. No work will be allowed in the areas listed without prior approval from the AHERA Designated Person for the Half Hollow Hills School District.

Sign in sheets will be picked up at the time of the Six Month AHERA Surveillance and will be placed in the buildings Asbestos Management Plan.

Asbestos containing materials and their locations at Fran Greenspan Administration Center are listed in the AHERA Management Plan, which is available for review, upon request.

DATE	NAME	COMPANY	TELEPHONE NUMBER
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			
/ /			

Appendix F

BULK SAMPLE RESULTS

ENVIROSCIENCE CONSULTANTS
A Mainline Company

2150 Smithtown Ave., Suite 3, Ronkonkoma, NY 11779
T: 631.580.3191 • F: 631.580.3195 • W: envirohealth.org

ELAP # 11681; NVLAP Lab Code 200531-0

ASBESTOS BULK SAMPLE RESULTS

CLIENT:	Half Hollow Hills CSD 525 Half Hollow Road, Dix Hills, NY 11746	SAMPLE DATE:	6/9/2023
		DATE RECEIVED:	6/10/2023
PROJECT NAME:	AHERA Six-month Surveillance - May 2023	AREA:	Fran Greenspan Administration Building - Tectum
JOB #:	23546	SAMPLER:	Pamela Chadderton
PAGE #:	1 of 1	CUSTODY #:	35302

Lab ID	Sample #	Description	Color	Location	Total Asbestos Result	% Asbestos-type	% Non-asbestos Fibers-type	% Matrix-type
99554	TD1	Tectum Decking	White/Brown	Reach/cya Secretary Area Ceiling Plenum (#1026CP)	None Detected		80.0% cellulose	20.0% binders
99555	TD2	Tectum Decking	White/Brown	Room 110 Ceiling Plenum (#1048CP)	None Detected		75.0% cellulose	25.0% binders

Method: EPA 600/M4-82/20, 600/R-93/116; NYS DOH ELAP Item 198.1, 198.4, 198.6, 198.8.
ACM: Asbestos Containing Materials contain more than 1%.
None Detected - No asbestos found in samples using polarized light microscopy (PLM). Trace - Asbestos found is 1% or less; not considered ACM.
None Detected by TEM - No asbestos found in samples using transmission electron microscopy (TEM) and polarized light microscopy (PLM) was found to be negative.
Negative by Weight – After matrix reduction, the remainder is less than 1% and, therefore, cannot fulfill the definition of asbestos containing material.
Inconclusive - No asbestos found in non-friable organically bound samples using polarized light microscopy (PLM).
Method ELAP 198.6 does not remove vermiculite and may underestimate the level of asbestos present in a sample containing greater than 10% vermiculite. Samples of Surface Material that contain Vermiculite are analyzed by ELAP 198.8 for conclusive result.
This report may not be reproduced without the express permission of Enviroscience Consultants, LLC. This report cannot be used to claim endorsement of products by NVLAP or any agency of the U.S. Government.Test results only reflect conditions at the time the samples were taken.

ANALYZED BY: Valerie Schiffmer PLM DATE: 6/14/2023 ANALYZED BY: _____ TEM DATE: _____

DIRECTOR: Edward A. Schuster DATE: 6/15/2023 REVISION #: 0 REVISION DATE: 6/15/2023