



Airflow Testing Report

Prepared for

Portland Public Schools

September 2021





9700 SW Capitol Hwy, Suite 110
Portland, OR 97219
ameresco.com

PROJECT OVERVIEW

As part of the continuing process to ensure a safe return to in-person learning, Portland Public Schools has contracted with Ameresco to test the airflow and ventilation of all educational and office spaces in each school. The data is reviewed by both Ameresco and PPS personnel to identify any potential shortcomings in the airflow from the HVAC systems. To accomplish this task, Ameresco has partnered with a local NEBB certified Test-Adjust-Balance (TAB) firm, Neudorfer Engineers, who will measure the airflow to each zone with calibrated measurement equipment in accordance with current testing standards and procedures. As part of this effort, HVAC professionals will review the operation of the HVAC equipment serving every educational and office space in each school.

Ameresco is pleased to have partnered with PPS over the last decade as the district's Energy Services Company (ESCO) on six energy efficiency construction projects, four service projects, and numerous energy audits. Our partnership has resulted in reducing over 3,000 tons of CO₂ and other GHG emissions and over \$1,000,000 in utility cost savings per year. Ameresco appreciates this opportunity to play a small role in the safe reopening of schools.

About Ameresco, Inc.

Founded in 2000, Ameresco, Inc. (NYSE:AMRC) is a leading cleantech integrator and renewable energy asset developer, owner and operator. Our comprehensive portfolio includes energy efficiency, infrastructure upgrades, asset sustainability and renewable energy solutions delivered to clients throughout North America and the United Kingdom. Ameresco's sustainability services in support of clients' pursuit of Net Zero include upgrades to a facility's energy infrastructure and the development, construction, and operation of distributed energy resources. Ameresco has successfully completed energy saving, environmentally responsible projects with Federal, state and local governments, healthcare and educational institutions, housing authorities, and commercial and industrial customers. With its corporate headquarters in Framingham, MA, Ameresco has more than 1,000 employees providing local expertise in the United States, Canada, and the United Kingdom. For more information, visit www.ameresco.com.

Explanation of ASHRAE Total Effective Air Changes per Hour (ACH_e) Calculation

ASHRAE has been updating their Building Readiness document to reflect the most current understanding in the engineering community for how to operate and maintain buildings during the pandemic. Their update on 4/27/2021 provided an explanation of the impact air filters and air cleaning devices have on the air in buildings. They provided the methodology, formulas, and an Excel-based tool for determining the equivalent outside air a space is receiving by having a mix of outside air, filtered recirculated air, and additional air filtration or cleaning devices in the room. Here is the explanation from ASHRAE:

Epidemic Conditions in Place



Equivalent Outdoor Air:

The equivalent outdoor air calculation indicates that the outdoor air can be calculated by using the combination of the actual outdoor air, impact of filtration or air cleaning technologies on recirculated air, and the impact of air cleaning technologies in the space.

This is using the principal of filters in series and the effectiveness at reducing particles. For items in series, the initial item would see the recirculated airflow to clean. The second item in the series would see the “cleaned” air from Item 1 and so the impact of Item 1 must be accounted for in Item 2.

As part of the airflow testing project that Portland Public Schools has partnered with Ameresco to complete, we are including the calculation of the Total Effective Air Changes per Hour (ACH_e) to show the impact of the air filtration that is active in nearly all spaces in the PPS schools. The formula for doing so is:

$$ACH_e = (ACH_{oa} + ACH_f) * E_z + ACH_{ir}$$

where:

- ACH_{oa} = air changes per hour of outside air = outside airflow in cubic feet per minute * 60 minutes per hour / room volume in cubic feet
- ACH_f = air changes per hour of clean air from filtered recirculated air with filters of the specified MERV rating as determined by ASHRAE
- E_z = Zone Air Distribution Effectiveness = how effective the HVAC system is at circulating and mixing the air to distribute the clean air throughout the room
- ACH_{ir} = the air changes per hour of clean air from portable air filters in the room = number of filters * CADR * 60 minutes per hour / room volume in cubic feet
 - CADR = Clear Air Delivery Rate = the CFM of clean air as specified by the manufacturer of the air filter

In order to include these calculations in the airflow testing reports, Ameresco and PPS have made the following assumptions as not all the variables are known:

1. PPS is in process of upgrading the air filters in their HVAC systems to MERV 13 and plans to be complete with that project for the start of the '21-'22 school year. In this report and for the sake of the ACH_e calculation, we are using the filters that are in place at the time of the measurements, so some of them are still MERV 8.
2. ASHRAE has guidelines for what should be used for the Zone Air Distribution Effectiveness (E_z) based on the HVAC system configuration, but they do not provide a value for every HVAC system and room configuration. For the majority of PPS rooms, an E_z of 0.8 – 1.0 would be most appropriate, so we have made the conservative assumption of using 0.8 for every space as that yields the lower ACH_e.
3. The CADR for a given air filter is from manufacturer ratings and is based on certain conditions (fan speed, particulate size, filter cleanliness, etc.) that change with operating conditions.



NEUDORFER ENGINEERS INC.

TEST REPORT TYPE: SURVEY REPORT

**Portland Public Schools Airflow Testing
Sunnyside K-8
3421 SE Salmon St, Portland, OR 97214**

Job Number: 2021-0297

Project Completion Date: September 2021

Revision Date:

-

Revision Number:

-



SEATTLE

5516 1st Avenue South
Seattle, Washington 98108
Phone (206) 621-1810
Fax (206) 343-9820

PORTLAND

2501 SE Columbia Way, Suite 230
Vancouver, Washington 98661
Phone (503) 235-8924
Fax (503) 235-8925



Neudorfer Engineers, Inc.

Consulting Engineers Seattle, Washington - Portland, Oregon



www.NeudorferEngineers.com

**Portland Public Schools Airflow Testing
Sunnyside K-8**

TABLE OF CONTENTS

Title Sheet	3
Report Certification	4
Terms	5
Instrument Calibration	6
Report Summary	7
Airflow Survey Report	8
TAB Notes	11
Floor Layout	12



Neudorfer Engineers, Inc.

Consulting Engineers Seattle, Washington - Portland, Oregon



www.NeudorferEngineers.com

REPORT TITLE

CERTIFIED TEST: SURVEY REPORT

Project: Portland Public Schools Airflow Testing
Sunnyside K-8

NEI Job#: 2021-0297

Mechanical Engineer: NA

Architect: NA

HVAC Contractor: NA

TAB Firm: Neudorfer Engineers Inc
Test Engineer: Tony Davis



5516 1st Ave South
Seattle, Washington 98108
Phone (206) 621-1810
Fax (206) 343-9820



2501 SE Columbia Way, Suite 230
Vancouver, Washington 98661
Phone (503) 235-8924
Fax (503) 235-8925

CERTIFICATION

Portland Public Schools Airflow Testing

The data presented in this report is a record of system measurements and final adjustments that have been obtained in accordance with the current edition of the NEBB Procedural Standards for Testing, Adjusting, and Balancing of Environmental Systems. Any variances from design quantities, which exceed NEBB tolerances, are noted in the Test-Adjust-Balance Report Project Summary.

Significant / Noteworthy Remarks are noted on the General Remarks and General Field Notes pages. Other remarks are noted on individual test sheets.

Noted deficiencies are not the TAB firms responsibility to repair. Prior to issuance of this report, Deficiency Reports are forwarded to our contracted agent.

Warranty is limited to one year from date of this report. Within that time, any discrepancies, ambiguities, or omissions found in this report will be retested, adjusted, or balanced as needed. A written notification will be required.

Submitted and Certified by:

NEBB TAB Firm: **Neudorfer Engineers Inc**

Certification No: **3414**

Expiration Date: **March 31, 2023**

Certification Date: **March 31, 2021**

(Date completed) **Signed and Sealed by:**

NEBB Supervisor: **Mike Vawter P.E.**

NEBB Supervisor: **Eric Stotts**





Neudorfer Engineers, Inc.

Consulting Engineers Seattle, Washington - Portland, Oregon



www.NeudorferEngineers.com

TERMS AND ABBREVIATIONS

Project: Portland Public Schools Airflow Testing

AC or ACU Air Conditioner or Air Conditioning Unit	HEPA High Efficiency Particulate Arrestance
AH or AHU Air Handler or Air Handling Unit	HP Horsepower
AVG Average	HVAC Heating Ventilation and Air Conditioning
BHP Brake Horsepower	HWS Heating Water Supply
CAV Constant Air Volume	HWR Heating Water Return
CBV Calibrated Balancing Valve (Circuit Setter)	HX Heat Exchanger
CC Cooling Coil	HZ Hertz, cycle per second
CD Ceiling Diffuser	in. inches
CFM Cubic Feet per Minute	in.w.g. inches of water gauge
CH Chiller	Kfactor Correction factor to the free area need to calculate CFM.
CHWS Chilled Water Supply	KW Kilowatts
CHWR Chilled Water Return	LAT Leaving Air Temperature
CP Circulating Pump	LWG Low Wall Grille
CR Ceiling Register	LWR Low Wall Register
CRAC Computer Room Air Conditioner	LWT Leaving Water Temperature
CRU Computer Room Unit	MAU Make-up Air Hanging Unit
CT Cooling Tower	MBH 1,000 BTUH
CU Condenser Unit	N/A Not Applicable
CUH Cabinet Unit Heater	OSA Outside Air
CWS Condenser Water Supply	OBD Opposed Blade Damper
CWR Condenser Water Return	ΔP Pressure Drop.
DAT Discharge Air Temperature	PH Phase
DB Dyr Bulb	PSI Pounds per Square Inch
DD Direct Drive	RA Return Air
DDC Direct Digital Controls: EMS Control System for the HVAC	RAD Radiator
Des. Design	RAT Return Air Temperature
Dia. Diameter	RF Return Fan
Disch. Discharge	RH Relative Humidity
EA Exhaust Air	RHC Reheat Coil
EAT Entering Air Temperature	RPM Revolutions per Minute
Economizer Controls and components that allow an air handler to logically utilize outdoor air for cooling as opposed to the use of mechanical cooling.	RTU Roof Top Unit
EF Exhaust Fan	SA Supply Air
EG Exhaust Grille	SAT Supply Air Temperature
EMCS Energy Management Control System	S.F. Service Factor
ERU Energy Recovery Unit	SF Supply Fan
E.S.P. External Static Pressure	SFD Smoke/Fire Damper
HRC Heat Recovery Coil	SP Static Pressure
EWT Entering Water Temperature	sq.ft. square feet
FCU Fan Coil Unit	Suct. Suction
FD Fire Damper	SWG Sidewall Grille
FLA Full Load Amperage: Maximum amperage a motor can draw.	SWR Sidewall Register
Flow Hood Instrument that captures air and converts the reading to CFM.	TAB Test; Adjust; and Balance
FHT Fume Hood Test	TSP Total Static Pressure: Difference between the entering and leaving static pressure of a fan.
FPB Fan Powered Box	UH Unit Heater
FPM Feet per Minute	VAV Variable Air Volume; box that contains a motorized damper that modulates airflow.
FR Field Report	VD Volume Damper
FT Foot, Feet	VFD Variable Frequency Drive
FTU Fan Terminal Unit	Velgrid Instrument that reads used to read velocity in feet per minute.
GPM Gallons per Minute	VVT Variable Volume Terminal
HC Heating Coil	WC Water Column
TDH Pressure Difference across the entering and leaving side of a pump.	W.G. Water Gauge
	WB Wet Bulb

INSTRUMENT CALIBRATIONS

Portland Public Schools Airflow Testing

Instrument Type	Air Data Meter with Flowhood	Instrument Serial #	M00475
Instrument Manufacturer	Shortridge	Calibration Date	11/4/2020
Instrument Model Number	ADM 870	Calibration Due	11/4/2021
Instrument Type	Differential Pressure Water Meter	Instrument Serial #	W14090
Instrument Manufacturer	Shortridge	Calibration Date	10/16/2020
Instrument Model Number	HDM-250	Calibration Due	10/16/2021
Instrument Type	Psychrometer	Instrument Serial #	8084305
Instrument Manufacturer	Extech	Calibration Date	10/13/2020
Instrument Model Number	RH390	Calibration Due	10/13/2021
Instrument Type	Tachometer	Instrument Serial #	B185B5022P
Instrument Manufacturer	Nidec	Calibration Date	10/11/2020
Instrument Model Number	MT-200	Calibration Due	10/11/2021
Instrument Type	Amp Probe	Instrument Serial #	33380179WS
Instrument Manufacturer	Fluke	Calibration Date	10/9/2020
Instrument Model Number	323 Clamp Meter	Calibration Due	10/9/2021
Instrument Type	Digital Thermometer	Instrument Serial #	45400509WS
Instrument Manufacturer	Fluke	Calibration Date	10/9/2020
Instrument Model Number	52 II	Calibration Due	10/9/2021
Instrument Type	Manometer	Instrument Serial #	M00475
Instrument Manufacturer	Shortridge	Calibration Date	11/4/2020
Instrument Model Number	ADM 870	Calibration Due	11/4/2021
Instrument Type	Thermal Anemometer	Instrument Serial #	AVM440742003
Instrument Manufacturer	Alnor Instruments	Calibration Date	11/9/2020
Instrument Model Number	AVM 440	Calibration Due	11/9/2021
Instrument Type	Ultrasonic Flow Meter	Instrument Serial #	N5K1435T
Instrument Manufacturer	Fuji	Calibration Date	10/14/2020
Instrument Model Number	Portaflow-C	Calibration Due	10/14/2021



PROJECT	Portland Public Schools Airflow Testing
LOCATION	Sunnyside K-8; 3421 SE Salmon St, Portland, OR 97214

REPORT SUMMARY

This project has been surveyed per plans and specifications using the National Environmental Balancing Bureau (NEBB) standards and procedures.

The scope of work for this project was to assess the current airflows for each classroom, office, and special purpose space. Air changes per hour were calculated along with the % of OSA for the spaces and any deficiencies found for each piece of equipment has been noted in the following report.

All ventilation equipment was commanded to run by the BMS system. Ventilation units were measured with a flowhood on the supply outlets. Outside air was recorded with a flowhood on the OSA louvre where accessible. AK factors were calculated from flowhood readings. The remaining OSA values were recorded with a velgrid. AHU supply air was recorded by a summation of the outlets as recorded by flowhood or velgrid when appropriate. Outside air was recorded with a velgrid or airfoil and calculated by the free area method.

The measured airflows in this report represent the performance of the equipment at the time of measurement, which vary over time based on operating conditions. There are factors outside the control of Neudorfer that impact airflow, and variance in those factors is expected and normal. One significant factor is the MERV rating and condition of the air filters on the equipment. During the summer of 2021, PPS began upgrading the filters on all their fan systems to MERV 13. Those upgraded filters are more effective at capturing particles but also impact the amount of airflow from the equipment. These filter changes were occurring while the airflow measurement project was happening, so some schools had the new filters, and some had the old filters at the time of measurement. On the data page included this report, there is a line stating whether or not the upgraded filters were in place at the time of measurement.



AIRFLOW SURVEY REPORT

Project: Portland Public Schools Airflow Testing
Location: Sunnyside K-8; 3421 SE Salmon St, Portland, OR 97214
Filter Status: Not Upgraded

Room Floor Plan # (Actual #)	Equipment Info		Room Dimensions					Airflow Measurements			Calculated ACH					Notes
	Served By	Equipment Type	Room Length	Room Width	Room Area	Room Height	Room Volume	Total CFM Supply	OA CFM Supply	OA %	Air Changes per Hour (supply)	Air Changes per Hour (OA)	# of Portable Filters	Total Effective Air Changes per Hour (ACH_e) with Portable Filter	Total Effective Air Changes per Hour (ACH_e) without Portable Filter	
First Floor																
Rm 100	UV	UV	29.9	21.8	653	12.1	7,902	1,560	165	11%	11.8	1.3	1	7.7	5.7	
Rm 102	UV	UV	29.8	21.4	638	12.1	7,716	1,240	135	11%	9.6	1.0	1	6.7	4.7	
Rm 103	UV	UV	31.8	21.7	690	12.1	8,350	399	78	20%	2.9	0.6	1	3.3	1.5	
Rm 104	UV	UV	29.9	21.3	636	12.1	7,692	1,160	250	22%	9.0	2.0	1	6.7	4.7	
Rm 105	Office FC & UV	FCU & UV	33.8	21.8	737	12.1	8,916	1,495	607	41%	10.1	4.1	1	7.7	5.9	260 OSA from UV + 347 OSA from office FC
Rm 106	UV	UV	29.9	21.4	640	12.1	7,742	975	70	7%	7.6	0.5	1	5.6	3.6	
Rm 107	UV	UV	30.6	21.5	658	12.1	7,961	845	0	0%	6.4	0.0	1	4.8	2.8	No flow from OSA louver
Rm 108	UV	UV	29.9	21.4	640	12.1	11,118	1,110	70	6%	6.0	0.4	1	4.2	2.8	
Rm 109	UV	UV	37.2	24.7	919	11.8	10,842	745	50	7%	4.1	0.3	1	3.4	1.9	
Rm 110	UV	UV	37.2	24.7	919	11.8	10,842	1,085	150	14%	6.0	0.8	1	4.4	3.0	
Rm P1	FCU	FCU	31.3	26.7	836	8.9	7,438	1,113	371	33%	9.0	3.0	1	7.2	5.1	
Rm P2	FCU	FCU	31.3	26.6	833	8.9	7,410	1,111	380	34%	9.0	3.1	1	7.2	5.1	
Office 104B	RR- EF	EF	14.7	7.3	107	9.0	964	-85	0	0%	5.3	0.0	1	18.5	2.4	School psychologist office. Ventilation from hall.
Office 106B	Office FC	FCU	12.7	11.2	142	12.1	1,721	74	52	70%	2.6	1.8	1	10.9	1.8	Note #2
Office 105A	Office FC	FCU	12.7	12.7	161	12.1	1,952	90	63	70%	2.8	1.9	1	9.9	1.9	Note #2
Main Office 116	Office FC	FCU	21.9	12.2	266	12.1	3,220	50	35	70%	0.9	0.7	1	5.5	0.6	Note #2
Office 116D	Office FC	FCU	21.5	13.8	297	12.1	3,590	195	137	70%	3.3	2.3	1	6.6	2.3	Note #2
Office 119A	-	-	7.6	6.2	47	15.0	707	-	-	-	0.0	0.0	1	22.1	0.0	Ventilation supplied from the gym
Office 120A	-	-	22.0	14.9	328	10.2	3,344	-	-	-	0.0	0.0	1	4.7	0.0	Ventilation supplied from the auditorium
Office 121	FCU	FCU	18.2	12.0	218	12.2	2,664	20	0	0%	0.5	0.0	1	6.1	0.2	Fan coil that serves bathrooms
Library 101	UV	UV	40.8	37.0	1,510	12.5	18,795	1,485	80	5%	4.7	0.3	1	3.0	2.2	Space is included with Library 101
Library 101A	-	-	-	-	-	-	-	-	-	-						Space is a storage room.
108A	-	-	-	-	-	-	-	-	-	-	0.0	0.0	0	N/A	0.0	Space is a storage room.
115	-	-	-	-	-	-	-	-	-	-	0.0	0.0	0	N/A	0.0	Kitchen ventilation is supplied from hallway

Date: 5/3/2021

Readings By: Davis / Mayer



AIRFLOW SURVEY REPORT

Project: Portland Public Schools Airflow Testing
Location: Sunnyside K-8; 3421 SE Salmon St, Portland, OR 97214
Filter Status: Not Upgraded

Room Floor Plan # (Actual #)	Equipment Info		Room Dimensions					Airflow Measurements			Calculated ACH					Notes
	Served By	Equipment Type	Room Length	Room Width	Room Area	Room Height	Room Volume	Total CFM Supply	OA CFM Supply	OA %	Air Changes per Hour (supply)	Air Changes per Hour (OA)	# of Portable Filters	Total Effective Air Changes per Hour (ACH_e) with Portable Filter	Total Effective Air Changes per Hour (ACH_e) without Portable Filter	
First Floor																
115A	-	-	-	-	-	-	-	-	-	-	0.0	0.0	0	N/A	0.0	This is a kitchen walk-in cooler
Cafeteria 117	AHU	AHU	61.3	39.8	2,440	21.5	52,528	680	0	0%	0.8	0.0	1	0.6	0.3	
Gym 119	AHU	AHU	59.7	39.8	2,377	21.6	51,420	600	0	0%	0.7	0.0	1	0.6	0.3	
Auditorium 120	AHU	AHU	80.0	40.5	3,240	22.4	72,414	2,291	0	0%	1.9	0.0	1	1.1	0.8	
118	AHU	AHU	-	-	-	-	-	-	-	-	0.0	0.0	1	-	0.0	Note #6, Note #7
Second Floor																
Rm 200	UV	UV	29.9	21.8	652	11.8	7,691	422	38	9%	3.3	0.3	1	3.6	1.6	
Rm 201	UV	UV	28.2	37.2	1,049	11.9	12,480	1,125	90	8%	5.4	0.4	1	3.8	2.6	
Rm 202	UV	UV	30.0	27.5	825	11.8	9,735	1,150	188	16%	7.1	1.2	1	5.2	3.6	
Rm 203	UV	UV	30.3	21.9	664	11.8	7,830	965	90	9%	7.4	0.7	1	5.5	3.5	
Rm 204	UV	UV	29.6	23.8	704	11.8	8,313	795	160	20%	5.7	1.2	1	4.8	3.0	
Rm 205	UV	UV	29.9	21.6	646	11.8	7,621	950	110	12%	7.5	0.9	1	5.7	3.6	
Rm 206	UV	UV	29.9	21.4	640	11.8	7,550	1,070	60	6%	8.5	0.5	1	6.0	3.9	
Rm 207	UV	UV	29.9	21.3	637	11.9	7,579	1,190	80	7%	9.4	0.6	1	6.5	4.4	
Rm 208	UV	UV	29.9	21.4	638	11.8	7,533	1,272	0	0%	10.1	0.0	1	6.6	4.5	Clogged OSA Louvre, no airflow
Rm 209	UV	UV	29.4	21.1	620	11.8	7,320	1,030	65	6%	8.4	0.5	1	6.1	3.9	
Rm 210	UV	UV	30.1	20.4	614	11.8	7,246	960	0	0%	7.9	0.0	1	5.7	3.5	Clogged OSA Louvre, no airflow
Rm 211	UV	UV	30.0	21.4	642	11.8	7,576	1,150	70	6%	9.1	0.6	1	6.3	4.2	
Rm 212	UV	UV	37.2	24.5	911	11.8	10,755	1,270	0	0%	7.1	0.0	1	4.6	3.1	Clogged OSA Louvre, no airflow
Rm 213	UV	UV	37.3	24.6	918	11.8	10,827	268	21	8%	1.5	0.1	1	2.1	0.7	
Office 218A	Dual Fan Coils	FCU	91.6	15.2	1,392	11.8	16,429	1,510	0	0%	5.5	0.0	1	1.3	0.3	Note #3, Office 218 A-E are the same space
Office 218B	-	-	-	-	-	-	-	-	-	-						Note #3, Office 218 A-E are the same space
Office 218D	-	-	-	-	-	-	-	-	-	-						Note #3, Office 218 A-E are the same space
Office 218E	-	-	-	-	-	-	-	-	-	-						Note #3, Office 218 A-E are the same space

Date: 5/3/2021

Readings By: Davis / Mayer



Project:	Portland Public Schools Airflow Testing
Location:	Sunnyside K-8; 3421 SE Salmon St, Portland, OR 97214
Filter Status:	Not Upgraded

Date: 5/3/2021

Readings By: Davis / Mayer



Neudorfer Engineers, Inc.

Consulting Engineers Seattle, Washington - Portland, Oregon





www.NeudorferEngineers.com

Project: Portland Public Schools Airflow Testing

Location: Sunnyside K-8; 3421 SE Salmon St, Portland, OR 97214

NOTE #	NOTE DESCRIPTION
1	Pace fan located in Gym storage is pulling from Gym and scheduled to supply rooms 121, 123 and restrooms adjacent.
2	OSA louvre correction factor used = 2.7sq.ft @ 213fpm, 575cfm OSA for Office FC.
3	Shared offices 218A-E: FC-1 = 285 total cfm, 0 OSA cfm & FC-2 = 300 total cfm, 0 OSA cfm. Clogged?
4	All OSA corrections were 2.08 unless otherwise noted.
5	Restrooms on second floor east are served from ductwork that appears to enter from below. Probably the fan coil adjacent to the gym. All ducting is concealed within the walls.
6	OSA damper 100% closed. Angled ceiling both ends subtracting Approx 1512 sq.
7	Stage volume was added to the auditorium.

SUNNYSIDE: Lower Level 1

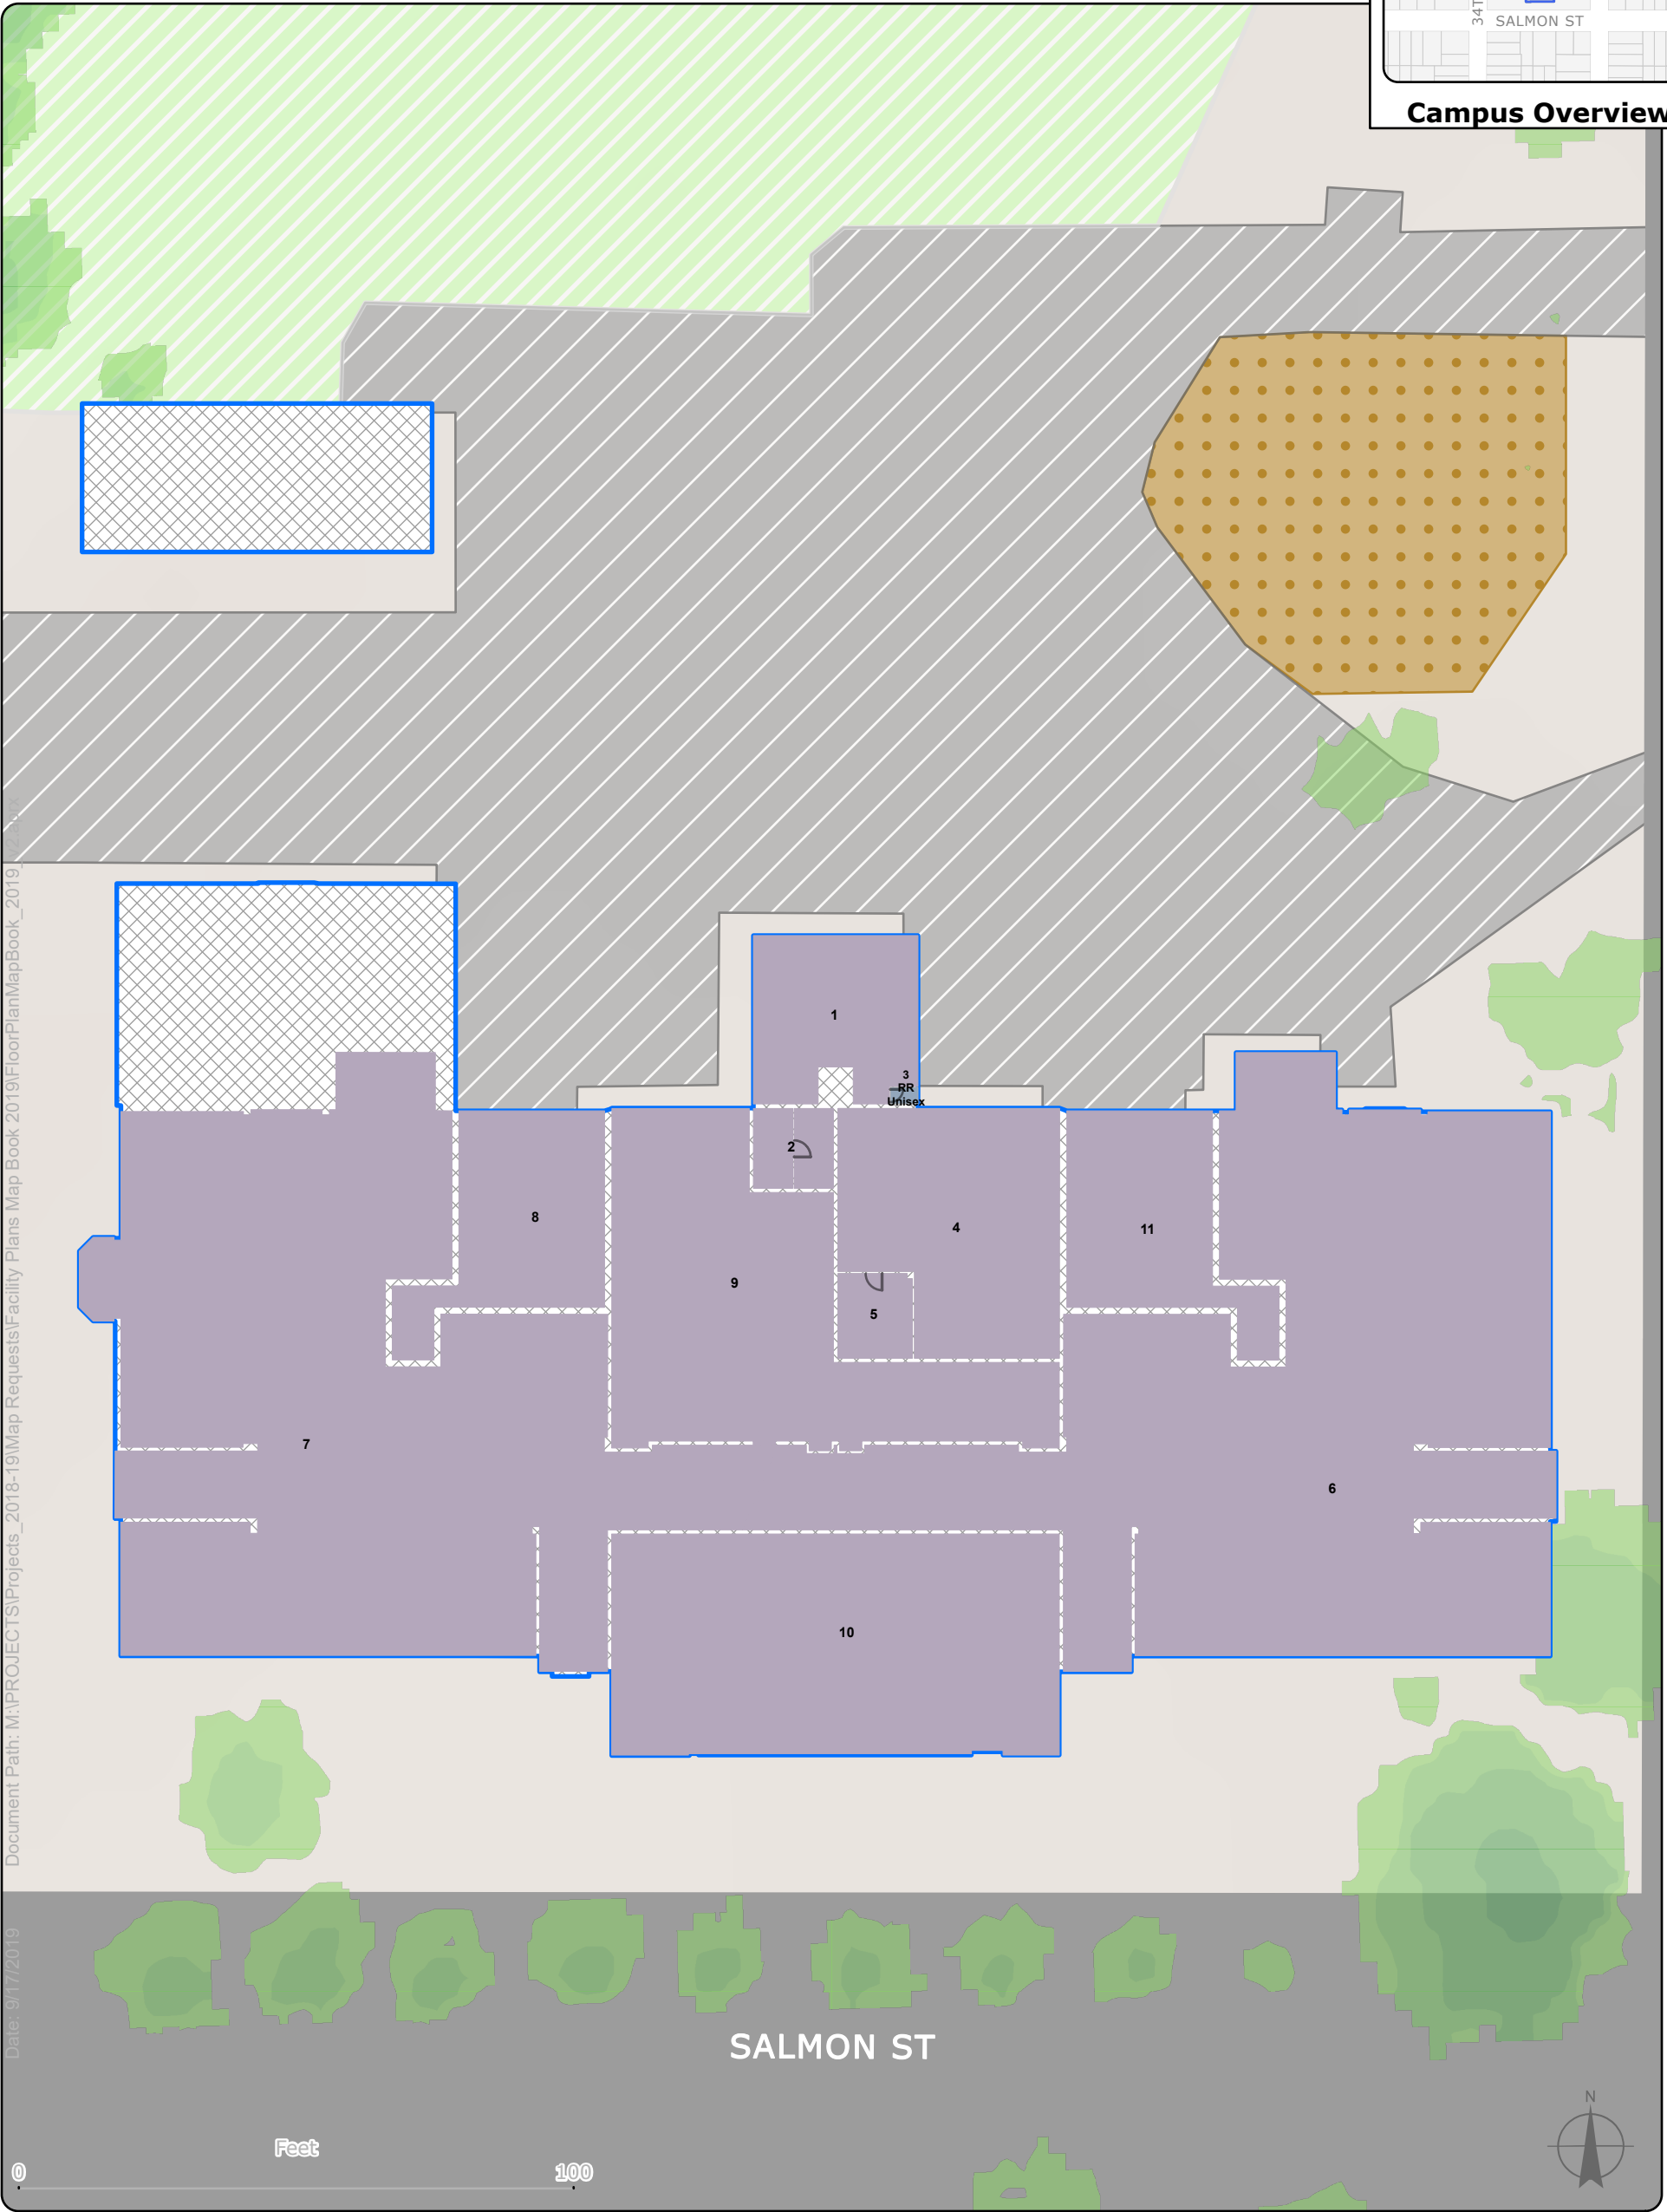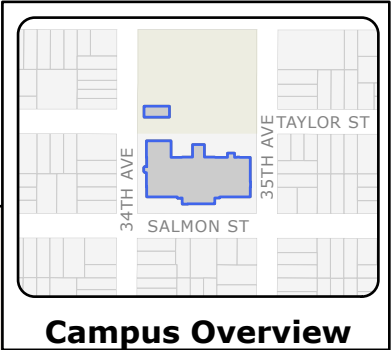

Space Use

Classroom

Office

Rest Room

Special Purpose

Corridor

Other

Stairs/Elevator

School Grounds

Campus Footprints

Athletic Field

Playground: Paved

Playground: Unpaved



Streets

Doors

Total Number Of Rooms By Classification			
Classrooms: 0		Special Purpose: 0	
Office Spaces: 0		Storage: 2	

Page 12 of 14



SUNNYSIDE: First Floor

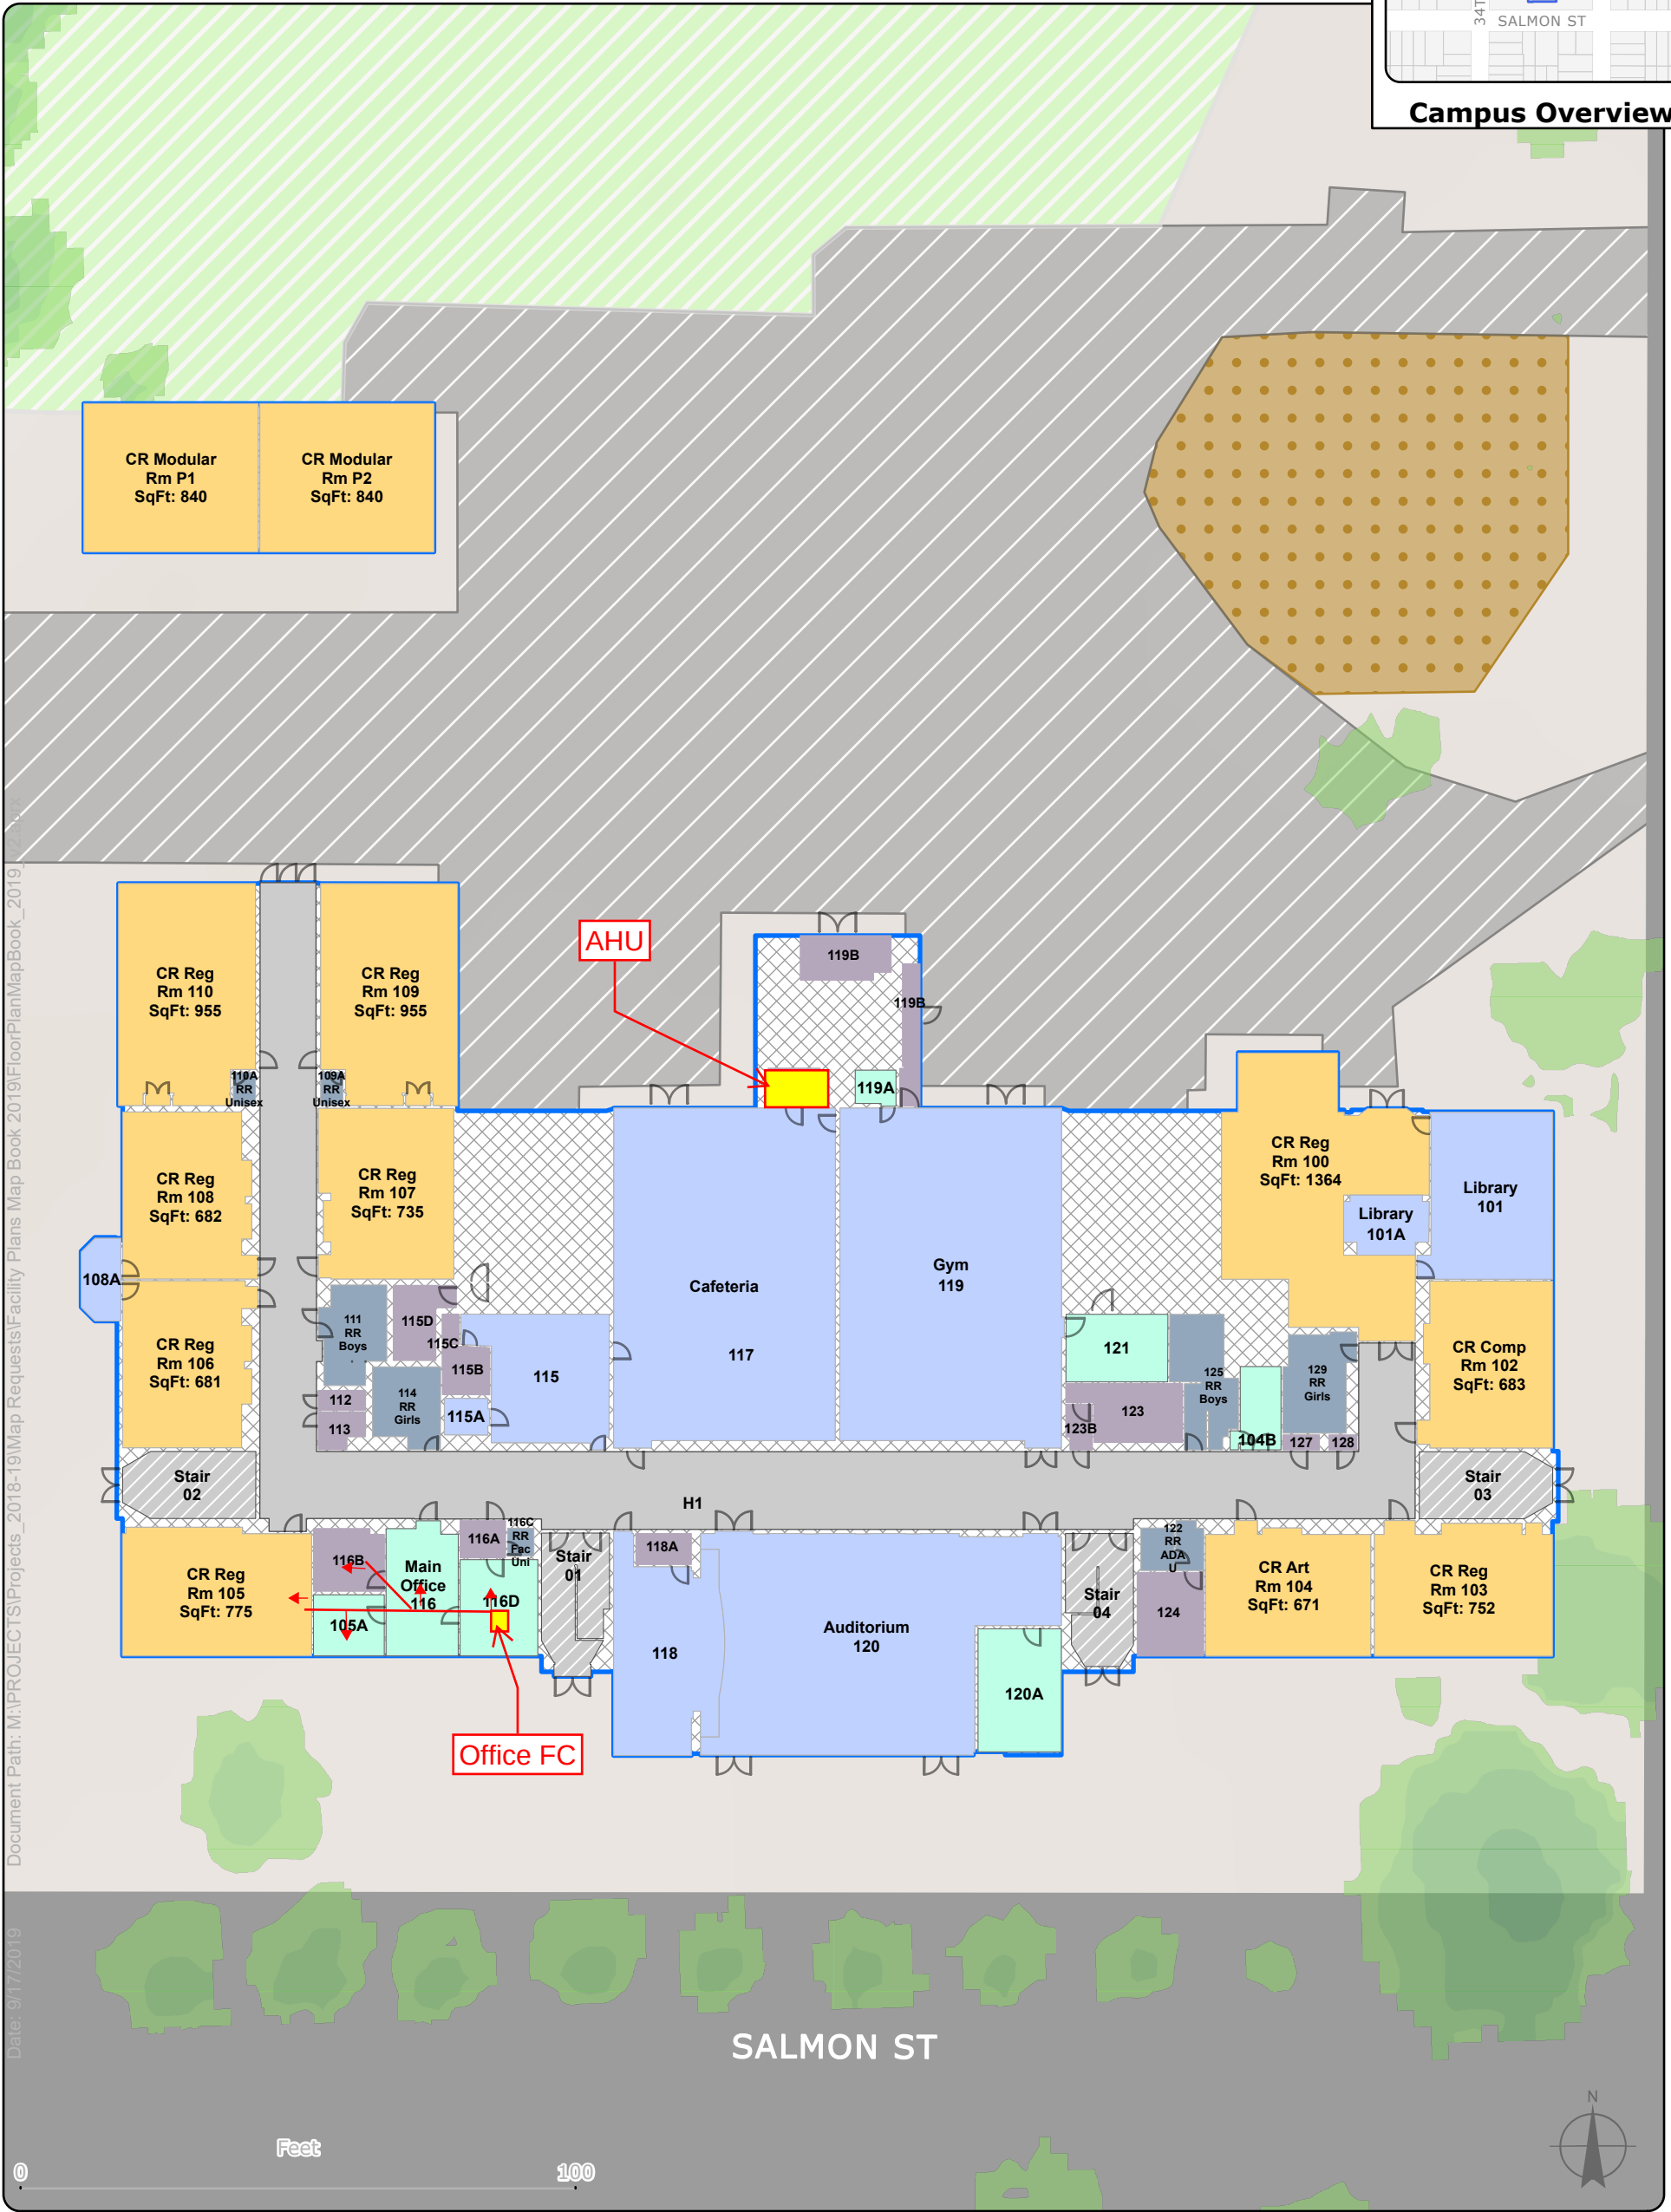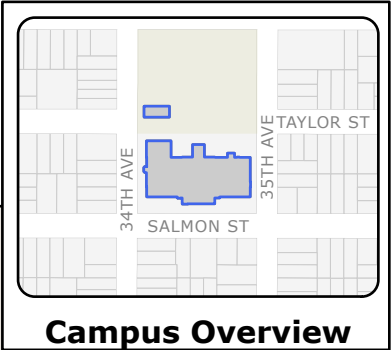

Space Use	School Grounds
Classroom	Campus Footprints
Office	Athletic Field
Rest Room	Playground: Paved
Special Purpose	Playground: Unpaved
Corridor	Streets
Other	Doors
Stairs/Elevator	

Total Number Of Rooms By Classification			
Classrooms: 12		Special Purpose: 9	
Office Spaces: 7		Storage: 12	

SUNNYSIDE: Second Floor

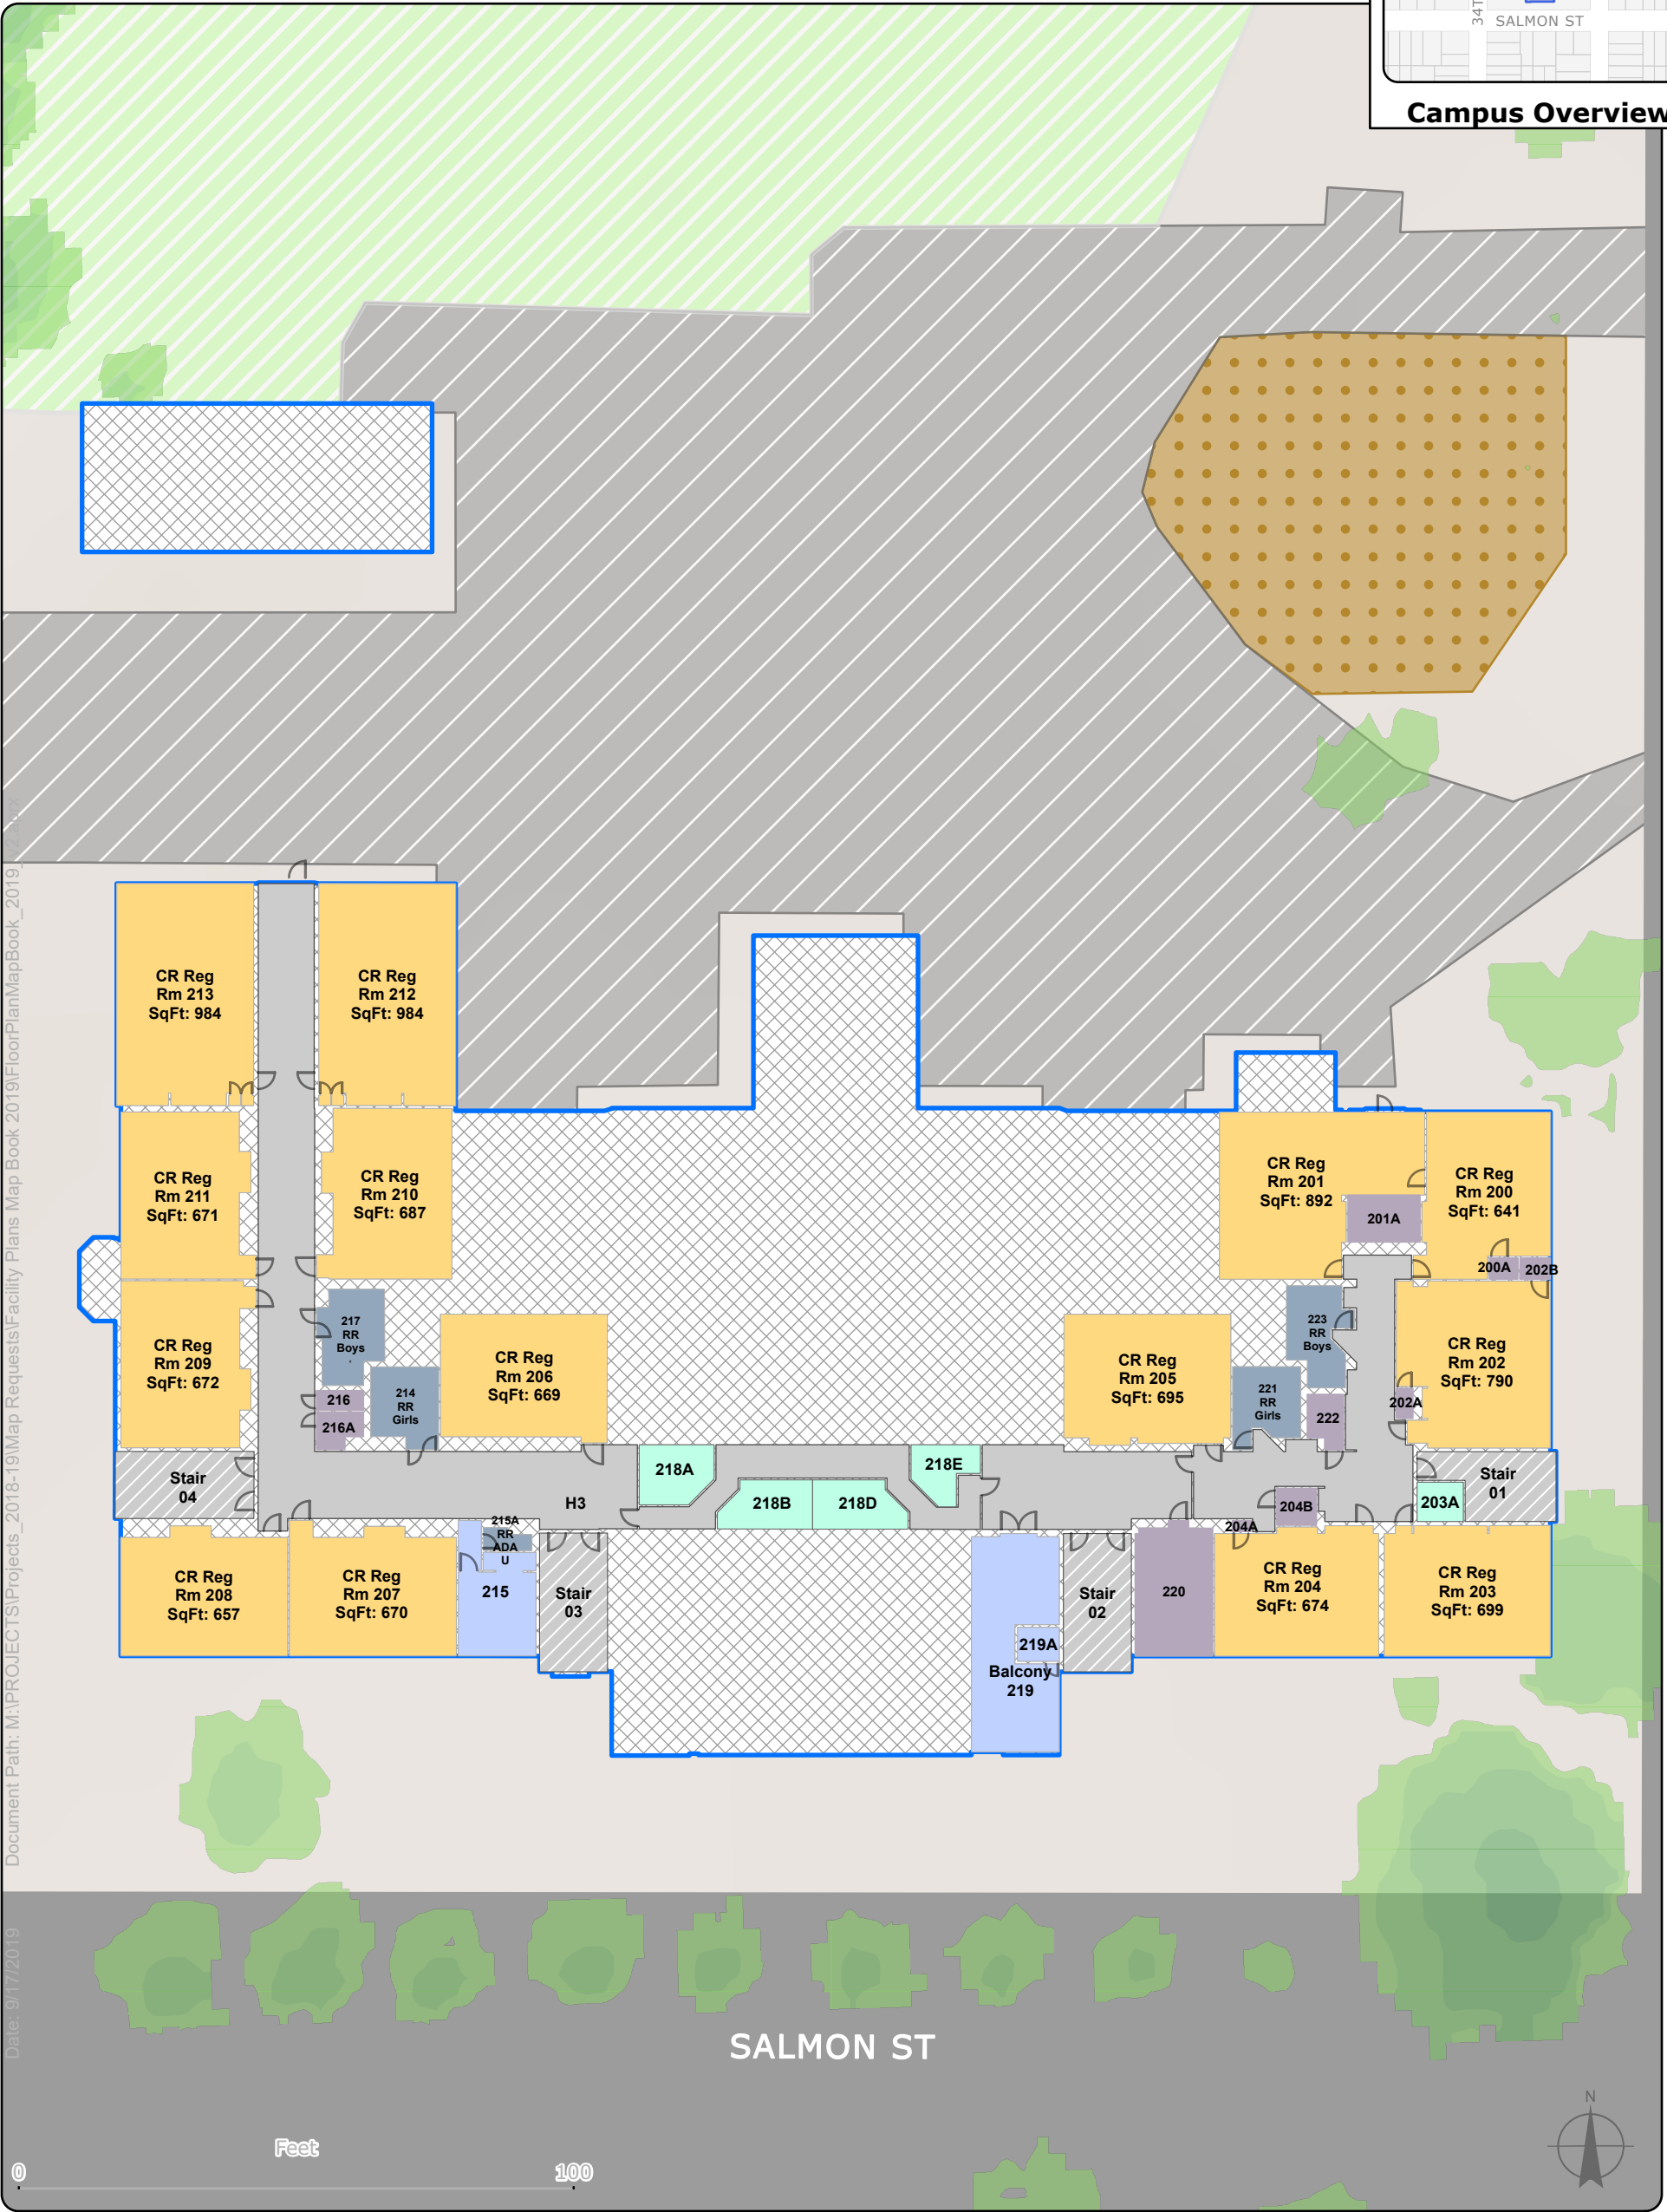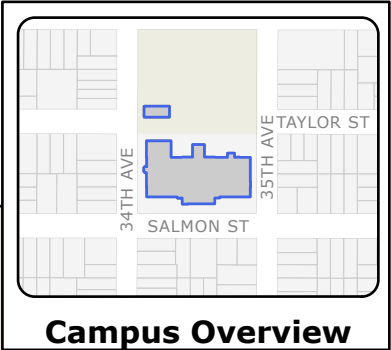

Space Use		School Grounds	
	Classroom		Campus Footprints
	Office		Athletic Field
	Rest Room		Playground: Paved
	Special Purpose		Playground: Unpaved
	Corridor		Streets
	Other		Doors
	Stairs/Elevator		

Total Number Of Rooms By Classification

Classrooms: 14	Special Purpose: 3
Office Spaces: 5	Storage: 10