

Prepared for:

Kyrene Elementary School District No. 28
8700 South Kyrene Road
Tempe, Arizona 85284

**AHERA ASBESTOS
INSPECTION REPORT**

FOR

**KYRENE DISTRICT OFFICE BUILDINGS AND BUS BARN
8700 S KYRENE RD,
TEMPE, AZ 85284**

PURCHASE ORDER NO. 251702

Prepared by:



DOMINION

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue, Building 7
Phoenix, Arizona 85027
(623) 516-1415

Dominion Project Number: AZ1418.60
Initial AHERA Inspection Date: October 2-3, 2025

TABLE OF CONTENTS

LIMITATIONS	SECTION 1
INSPECTION PROCESS	SECTION 2
EXECUTIVE SUMMARY	SECTION 3
SITE PLANS	SECTION 4
HOMOGENEOUS MATERIALS INVENTORY LISTS	SECTION 5
PLM BULK SAMPLE SHEETS	SECTION 6
PLM BULK SAMPLE LOCATION MAPS.....	SECTION 7
PHYSICAL ASSESSMENT INFORMATION SHEETS	SECTION 8
LABORATORY REPORTS	SECTION 9
ASBESTOS CONTAINING BUILDING MATERIAL LOCATION MAPS	SECTION 10
ASSUMED ACBM LOCATION MAPS.....	SECTION 11
INSPECTOR ACCREDITATION	SECTION 12
LABORATORY ACCREDITATION.....	SECTION 13

SECTION 1



LIMITATIONS

LIMITATIONS

The conclusions and results contained herein are based solely on the information presented in this report, are for the sole and exclusive use of "The Client" and are subject to the terms and conditions of "The Contract." No other person or entity may rely on this report without the prior written consent of Dominion Environmental Consultants.

Dominion performed these services using the degree of care and skill ordinarily exercised under similar conditions by reputable members of the profession practicing in the same or similar circumstances, applicable to this location and that were existing at this time. The data and findings presented in this report are valid as of the dates when the investigation(s) were performed. The sampling, testing, and observations described in the report represent conditions only at the specified times and locations, as directed by the Client. Additional information or materials that were hidden, undiscovered, inaccessible, or are not a part of the finding presented herein, would result in the modification of the conclusions and recommendations made herein. Changes over which Dominion has no control, including but not limited to, the passage of time, manifestation of latent conditions, or occurrence of future events, require reevaluation of the findings, observations, and conclusions expressed in the report. If any un-sampled suspect building materials are later discovered, those materials should be properly sampled by a certified inspector and analyzed by a qualified laboratory prior to their disturbance.

Any response action guidelines provided are based solely on the findings contained herein. Dominion did not oversee any remediation work performed by a Contractor or provide any detailed remediation protocols. Any remediation guidelines or suggested response actions are minimum general guidelines, based solely on the findings presented herein. They are presented as a courtesy and are not to be considered a complete or detailed set of specifications. Therefore, the Contractor is responsible for his own work, employees, and compliance with all regulatory and project guidelines.

The sampling, testing, and observations described in the report represent conditions only at the specified times and locations. These sampling methods, techniques, and scope of services were not exhaustive or to be considered all inclusive. Dominion is not responsible for the accuracy of information or services provided by others, including but not limited to other consultants, analytical laboratories, or public records. Dominion is not liable for conditions or consequences arising from relevant facts that were withheld, concealed, undiscovered, or not fully disclosed. Dominion performed this survey in a specific area as directed by the Client and in compliance with applicable regulations.

Dominion's scope of service for this report did not include the inspection for, or identification of fungi, lead paint, hazardous liquids, fumes or any other hazardous or controlled substances not specifically identified herein.

This report presents professional opinions and findings of a scientific or technical nature. Dominion is not a law firm and therefore makes no representations or warranty regarding any potential liability of any person or entity for site conditions. Further, Dominion is not qualified to present medical advice. If any present or future health issues are in question, it is recommended that the findings in this report be presented to a qualified medical professional for evaluation.

Please note, regarding laboratory analysis of suspect bulk asbestos-containing materials: The Environmental Protection Agency (EPA) Method 600/R-93-116, Polarized Light Microscopy (PLM) is used for the testing of bulk building materials for asbestos by performing a visual estimation. This method is the most widely used method for estimating asbestos in bulk building materials and works well for most sample types. However, it might require a more detailed method such as point counting for accurate estimation of asbestos in samples with low asbestos concentration. This method is also not applicable for samples containing large amounts of fine fibers below the resolution of the PLM (<0.3 microns). Typically, the asbestos fibers present in non-friable organically bound (NOB) materials are often less than 0.1 microns in diameter and therefore may cause the PLM method to yield low estimates or even false negative results.

Dominion suggests that Transmission Electron Microscopy (TEM) Chatfield Semi-Quantitative EPA Method 600/R-93-116 be used to confirm all negative results of NOB materials. This method is particularly useful to reduce the possibility of false negatives in NOBs and to provide additional quantitative data for samples which contain low levels of asbestos. The TEM method is available at additional cost and is done only at the Client's request.

SECTION 2



INSPECTION PROCESS

INSPECTION PROCESS

The Environmental Protection Agency (EPA) in 40 CFR 763, the Asbestos Hazard Emergency Response Act (AHERA), requires Local Education Agencies (LEAs) to identify friable and non-friable asbestos-containing building material (ACBM) in public and private elementary and secondary schools by visually inspecting school buildings for such materials and by sampling all identified suspect materials if they are not assumed to be ACBM. Those samples are then to be analyzed using appropriate analysis techniques, by a qualified laboratory, as referred to in the regulations. AHERA requires LEAs to only utilize accredited personnel when conducting inspections, re-inspections, developing management plans, or performing response actions. This regulation also includes record-keeping requirements. LEAs may contractually delegate their duties under this rule, but they remain responsible for the proper performance of those duties. LEAs are encouraged to consult with EPA Regional Asbestos Coordinators, or if applicable a State's lead agency designated by the State Governor, for assistance in complying with this rule.

This report complies with AHERA based protocols outlined in 40 CFR 763.85, specifically:

- The campus was visually inspected to identify the locations of all suspected ACBM.
- All suspect materials were touched to determine friability and condition.
- Bulk samples were collected of all homogeneous areas of friable suspected ACBM and all homogeneous areas of non-friable suspected ACBM.
- The date of the inspection, the name and signature of the person making the inspection, State of accreditation, his or her accreditation number and any changes in the condition of known or assumed ACBM are included in this report, if applicable.
- The exact locations where samples were collected during the inspection are marked, as well as a description of the manner used to determine sampling locations, the name and signature of each accredited inspector who collected the samples, State of accreditation and if applicable, his or her accreditation number.
- Also included within the report are any assessments or reassessments made of friable material, the name and signature of the accredited inspector making the assessments, State of accreditation and if applicable, his or her accreditation number.

The sampling protocol outlined in 40 CFR 763.86 is as follows:

Surfacing material is material in a school building that is sprayed-on, troweled-on, or otherwise applied to surfaces, such as acoustical plaster on ceilings and fireproofing materials on structural members, or other materials on surfaces for acoustical, fireproofing, or other purposes. Surfacing materials are collected in a statistically random manner as follows:

- At least three (3) bulk samples shall be collected from each homogeneous area that is one thousand (1,000) square feet.

- At least five (5) bulk samples shall be collected from each homogeneous area that is greater than one thousand (1,000) square feet but less than or equal to five thousand (5,000) square feet.
- At least seven (7) bulk samples shall be collected from each homogeneous area that is greater than five thousand (5,000) square feet.

Thermal system insulation (TSI) in a school building means materials applied to pipes, fittings, boilers, breeching, tanks, ducts, or other interior structural components to prevent heat loss or gain, or water condensation, or for other purposes. TSI samples are collected in a randomly distributed manner as follows:

- A minimum of three (3) bulk samples are collected from each homogeneous area of TSI that is not assumed to be ACBM.
- Collect at least one (1) bulk sample from each homogeneous area of patched TSI that is not assumed to be ACBM if the patched section is less than six (6) linear or square feet.
- In a manner sufficient to determine whether the material is ACBM or not ACBM, collect bulk samples from each insulated mechanical system that is not assumed to be ACBM where cement or plaster is used on fittings such as tees, elbows, or valves.
- Bulk samples are not required to be collected from any homogeneous area where the accredited inspector has determined that the TSI is fiberglass, foam glass, rubber, or other non-ACBM.

Miscellaneous material is sampled in a manner sufficient to determine whether the material is ACBM or not ACBM. An accredited inspector shall collect bulk samples from each homogeneous area of friable miscellaneous material that is not “assumed” to be ACBM. Therefore, Dominion will collect a minimum of three (3) samples of each miscellaneous material, as a matter of industry standards.

ASSESSMENT OF MATERIALS

In compliance with 40 CFR 763.88, Dominion inspectors have classified the ACBM and suspected ACBM in the school buildings into one of the following categories:

- (1) Damaged or significantly damaged Thermal System Insulation ACBM
- (2) Damaged friable surfacing ACBM
- (3) Significantly damaged friable surfacing ACBM
- (4) Damaged or significantly damaged friable miscellaneous ACBM
- (5) ACBM with potential for damage
- (6) ACBM with potential for significant damage
- (7) Any remaining friable ACBM or friable suspected ACBM

As part of the assessment, the following issues have been taken into consideration:

- i. Location and the amount of the material, both in total quantity and as a percentage of the functional space.
- ii. The type of damage or significant damage (e.g., flaking, blistering, water damage, or other signs of physical damage).
- iii. The severity of damage (e.g., major flaking, severely torn jackets, as opposed to occasional flaking, minor tears to jackets).
- iv. Extent or spread of damage over large areas or large percentages of the homogeneous area.
- v. Whether the material is accessible.
- vi. The material's potential for disturbance.
- vii. Known or suspected causes of damage or significant damage (e.g., air erosion, vandalism, vibration, water).
- viii. Preventive measures might eliminate the reasonable likelihood of undamaged ACBM from becoming significantly damaged.

SECTION 3



EXECUTIVE SUMMARY

EXECUTIVE SUMMARY

INTRODUCTION

Dominion Environmental Consultants, Inc. (Dominion) was authorized by Mr. Mason Meade with the Kyrene Elementary School District (KESD), to perform an AHERA Asbestos Inspection of Kyrene District Office and Bus Barn, located at 8700 S Kyrene Rd, Tempe, AZ 85284, via a written Purchase Order #251702, dated October 17, 2024.

Per the direction of Mr. Meade, as part of this inspection Dominion was instructed to utilize Dominion's AHERA 6-month surveillance sampling report dated March 3, 2024. Dominion was instructed to utilize the information from this previous survey and to only collect additional bulk samples of any previously unsampled building materials.

Due to budgetary constraints, Dominion was directed by Mr. Meade to first sample the easily accessible identified suspect building materials inside the building until a budgeted pre-determined number of samples were collected. Once the allotted number of samples per building had been collected, Dominion was then directed to "assume as asbestos-containing" the remaining identified suspect building materials. Pursuant to Mr. Meade's directions, the sampling order of importance was determined first on materials with the largest square footage, then least accessible materials, ceramic tiles, and materials least likely to be disturbed.

The Kyrene District Office and Bus Barn property consists of twelve (12) buildings. Building A is a 2-story, slab on grade block structure and Building W is a warehouse, slab on grade block structure. All other buildings located on the property are single story, slab on grade, block structures. No below grade levels were observed for any building on the property.

BACKGROUND INFORMATION

AHERA 6-MONTH ASBESTOS SURVAILANCE INSPECTION – MARCH 2024

Dominions 6-month asbestos surveillance inspection of the Kyrene District Office and Bus Barn was conducted on March 11, 2024, by Ms. Tracey Carpenter, an AHERA accredited Asbestos Building Inspector State of Arizona # ON-188748-14588-082924, expiration date September 29, 2025

INITIAL AHERA ASBESTOS INSPECTION – OCTOBER 2025

Dominion's initial AHERA asbestos inspection of the Kyrene District Office and Bus Barn was conducted on October 2 and 3, 2025, by Mr. Chase Kirby an AHERA accredited Asbestos Building Inspector State of Arizona #ON- 4380-19987-030525, expiration date March 5, 2026

COLLECTION OF BULK SAMPLES

AHERA Asbestos 6-Month Surveillance Inspection – March 2024

During the 6-month surveillance inspection, Dominion was instructed to only sample damaged building materials throughout the District Office and Bus Barn. Building A was unable to be inspected because during this time, the entire building was undergoing major renovation. A total of twenty-four (24) bulk samples were collected from fourteen (14) damaged homogeneous building materials throughout Buildings E, G, and W. No other buildings had obvious, damaged building materials at the time and locations of the inspection.

Identified in the following list, separated by building, are the fourteen (14) damaged homogeneous materials sampled during the AHERA 6-month surveillance inspection.

Building E - 6 Materials - No ACBM

- Light Blue 12" x 12" VCT
- Tan Mastic for Light Blue 12" x 12" VCT
- Dark Blue 12" x 12" VCT
- Tan Mastic for Dark Blue 12" x 12" VCT
- Blue Cove Base
- Brown/Beige Mastic for Blue Cove Case

Building G - 7 Materials - No ACBM

- ~~Brown Cove Base~~ (Previously Removed)
- ~~Tan Mastic for Brown Cove Base~~ (Previously Removed)
- ~~Green Artificial Turf Carpet~~ (Previously Removed)
- ~~Tan Mastic for Green Artificial Turf Carpet~~ (Previously Removed)
- Tan 12" x 12" VCT
- Yellow Mastic for Tan 12" x 12" VCT
- Gray Concrete

Building W - 1 Material - No ACBM

- Popcorn Ceiling Drywall System (Popcorn Texture, Tape, Joint Compound, & Drywall)

Initial Expanded AHERA Asbestos Inspection – October 2025

A total of two hundred and forty (240) bulk samples were collected from one hundred eighteen (118) suspect homogeneous building materials within the Dominions limited asbestos inspection of the Kyrene District Office and Bus Barn. The materials determined by laboratory analysis to contain greater than one percent (>1%) asbestos content are indicated by ***italicized, red type***.

Identified in the following list are the one hundred eighteen (118) suspect homogeneous building materials sampled during October 2 and 3, 2025, limited asbestos inspection.

Building A– 14 Materials – 0 ACBM

- Orange Peel Drywall (Paint, Texture, Compound, Tape, Joint Compound, & Drywall)
- White Fixture Caulking
- Black Window Glazing
- Brown Linoleum
- Yellow Mastic for Brown Linoleum
- Gray Multicolor Carpet
- Yellow Mastic for Gray Multicolor Carpet
- Dark Gray Multicolor Carpet
- Yellow Mastic for Dark Gray Multicolor Carpet
- Gray Cove Base
- Cream Mastic for Gray Cove Base
- Light Gray Interior Caulking
- Gray Interior Caulking
- 2' x 2' Ceiling Tile

Building B - 16 Materials – 1 ACBM

- 1' x 1' Tan Ceiling Tile with White Surface
- Brown Mastic for 1' x 1' Tan Ceiling Tile
- Old Orange Peel Drywall (Paint, Texture, Tape, Joint Compound, & Drywall)
- Tan Vinyl Floor (VCT)
- Black Mastic for Tan Vinyl Floor (VCT)
- Gray Vinyl Floor Tile (VCT)
- Black Mastic for Gray Vinyl Floor Tile (VCT)
- Black Cove Base
- Off-White Mastic for Black Cove Base
- Silver Flex Duct Wrap
- Pink Insulation for Flex Duct Wrap
- Silver Duct Wrap
- Tan Insulation for Duct Wrap
- Gray Duct Mastic
- **Drywall Ceiling** (Drywall & **White Compound**)
- New Orange Peel Drywall (Paint, Texture, Tape, Joint Compound, & Drywall)

Building C - 10 Materials – 0 ACBM

- Old Orange Peel Drywall System (Paint, Texture, Tape, Joint Compound, & Drywall)
- Gray Cove Base
- Cream Mastic for Gray Cove Base
- Pinhole 2x2 Ceiling Tile
- Black Window Glazing
- Silver Duct Insulation Backing
- Yellow Insulation for Duct

- Silver Flex Duct Backing
- Pink Insulation for Flex Duct
- White Batt Insulation

Building D - 8 Materials – 0 ACBM

- Orange Peel Drywall System (Paint, Texture, Tape, Joint Compound, & Drywall)
- Blue Cove Base
- Cream Mastic for Cove Base
- 2x2 Ceiling Tile
- Silver Flex Duct Insulation Wrap
- Pink Flex Duct Insulation
- 1x1 Ceiling Tile
- Brown Mastic for 1x1 Ceiling Tile

Building E - 13 Materials – 0 ACBM

- Orange Peel Drywall System (Paint, Texture, Tape, Joint Compound, & Drywall)
- Dark Blue VCT
- Yellow Mastic for Dark Blue VCT
- Green VCT
- Yellow Mastic for Green VCT
- Ceiling Tile
- Replacement Ceiling Tile
- Dark Blue Cove Base
- Brown Mastic for Dark Blue Cove Base
- Light Green VCT
- Tan Mastic for Light Green VCT
- Black Cove Base
- Cream Mastic for Black Cove Base

Building F - 6 Materials – 0 ACBM

- Concrete Foundation
- Black Window Glazing
- Interior Frame Caulking
- Orange Peel Drywall System (Paint, Texture, Tape, Joint Compound, & Drywall)
- Brown Cove Base
- Cream Mastic for Brown Cove Base

Building G - 7 Materials – 0 ACBM

- Orange Peel Drywall System (Paint, Texture, Tape, Joint Compound, & Drywall)
- Gray Cove Base

- Off-White Mastic for Cove Base
- Blue Multicolor Carpet Square
- Multicolored Mastic for Carpet
- Box Duct Insulation
- Off-White Insulation for Box Duct

Building K - 14 Materials – 0 ACBM

- Gray Wallpaper Drywall Wall & White Drywall with Brown Paper
- Blue Cove Base
- Cream Mastic for Cove Base
- 2x2 Gray Carpet
- Semi-Transparent Mastic
- White 12x12 VCT
- Yellow Mastic for 12x12 VCT
- 2x4 Ceiling Tile
- 2x2 Ceiling Tile (Drywall)
- Silver Flex Duct Wrap
- Pink Insulation for Silver Flex Duct
- Pink Batt Insulation
- Silver Box Duct Wrap
- Yellow Insulation for Silver Box Duct Wrap

Building M - 1 Materials – 0 ACBM

- Concrete Foundation

Building O - 1 Materials – 0 ACBM

- Concrete Foundation

Building T - 14 Materials – 0 ACBM

- Orange Peel Drywall System (Paint, Texture, Tape, Joint Compound, & Drywall)
- Gray Cove Base
- Cream Mastic for Cove Base
- Gray 2x2 Ceiling Tile
- Multicolor Carpet Square
- Yellow Mastic for Multicolor Carpet Square
- Floor Expansion Joint
- Skip Trowel Drywall System (Paint, Texture, Tape, Joint Compound, & Drywall)
- Concrete
- Black Cove Base
- Brown Mastic for Cove Base

- Brown Cove Base
- Yellow Mastic for Cove Base
- Interior Frame Caulking

Building W - 14 Materials – 0 ACBM

- Orange Peel Drywall System (Paint, Texture, Tape, Joint Compound, & Drywall)
- 2x2 Ceiling Tile
- 2x4 Ceiling Tile
- Brown Cove Base
- Tan Mastic for Cove Base
- Brown Mastic for Cove Base
- Heavy Orange Peel Drywall System (Paint, Texture, Tape, Joint Compound, & Drywall)
- Popcorn Ceiling Drywall System (Popcorn Texture, Tape, Joint Compound, & Drywall)
- Gray Duct Mastic
- Silver Flex Duct Wrap
- Pink Flex Duct Insulation for Silver Flex Duct Wrap
- Silver Duct Wrap
- Yellow Duct Insulation for Silver Duct Wrap
- Pink Batt Insulation

All the identified suspect bulk samples collected from Kyrene District Office and Bus Barn were submitted to EMLab P&K (EMLab) in Phoenix, Arizona for analysis using Polarized Light Microscopy (PLM) methods. EMLab used the methods prescribed in Method 40 CFR, Part 763, in the Code of Federal Register in analyzing bulk samples. EMLab is certified by the National *Institute of Standards and Technology* as a National Voluntary Laboratory Accreditation Program (NVLAP), Number 500031-0. The suspect asbestos bulk samples were collected and submitted to the laboratory using established chain-of-custody procedures.

Bulk samples were collected utilizing safety and health practices as required by the Occupational Safety and Health Administration (OSHA). At the time of sample collection, the buildings were not occupied by students. Only limited administrative and custodial staff were present on campus.

ASSUMED ACBM – October 2 & 3, 2025

Due to budgetary constraints, KESD instructed Dominion to assume any unsampled suspect building materials as asbestos containing until further asbestos bulk sampling can be budgeted and conducted. Therefore, listed below are the one hundred and seventy-nine (179) building materials that were **assumed** to contain greater than one percent (>1%) asbestos.

Building A – 57 Assumed ACBM

- **Black 2"x2" Carpet**
- **Mastic for 2"x2" Black Carpet**
- **Gray Ceramic Floor Tile**

- Grout for Floor Tile
- Thinset for Floor Tile
- White Counter Caulking
- Blue Smooth Drywall System
- Concrete Foundation
- Expansion Joint
- Pink 12"x12" VCT
- Mastic for 12"x12" VCT
- Brown 4" Cove Base
- Mastic for Brown Cove Base
- Red Fire Stop Caulking
- Gray 36"x9" Carpet
- Mastic for Carpet
- Gray w. Pattern Ceramic Wall Tile
- Grout for Wall Tile
- Mastic for Wall Tile
- Gray Fixture 12"x8" Ceramic Wall Tile
- Grout for Wall Tile
- Mastic for Wall Tile
- Fiberglass Reinforced Plastic (FRP)
- Mastic for FRP
- Mop Sink Caulking
- Gray Mortar
- Pink 2"x2" Ceramic Wall Tile
- Grout for Wall Tile
- Mastic for Wall Tile
- Pink 2"x2" Ceramic Cove Base
- Grout for Ceramic Cove Base
- Mastic for Ceramic Cove Base
- Gray 10"x2" Ceramic Wall Tile
- Grout for Wall Tile
- Mastic for Wall Tile
- Gray Wallpaper Drywall System
- Gray w. White 4"x3" Ceramic Wall Tile
- Grout for Wall Tile
- Mastic for Wall Tile
- White CMU
- Mortar for White CMU
- White 16"x5" Ceramic Wall Tile
- Grout for Wall Tile
- Mastic for Wall Tile
- Plaster Columns
- White 16"x4" Ceramic Wall Tile

- Grout for Wall Tile
- Mastic for Wall Tile
- White Pipe Wrap
- Insulation for Pipe Wrap
- Gray Duct Mastic
- Silver flex Duct Wrap
- Insulation for Flex Duct Wrap
- Gray Duct Wrap
- Insulation for Duct Wrap
- Ceiling Wrap
- Insulation for Ceiling Wrap

Building B – 12 Assumed ACBM

- 2' x 4' Ceiling Tile
- Interior Frame Caulking
- Red Fire Stop Caulking
- White 9'x2' Brick
- Mortar for Brick
- Concrete Foundation
- Untextured Drywall System
- Black Flex Duct Wrap
- Insulation for Flex Duct Wrap
- Smooth Drywall Ceiling
- Blue w. Gray 2'x2' Carpet
- Mastic for Carpet

Building C – 19 Assumed ACBM

- Gray 2x2 Carpet
- Mastic for Carpet
- Door Frame Caulking
- White Window Sealant
- Black Weather Stripping
- Gray 36'x9" Carpet
- Mastic for Carpet
- Brown Vinyl Plank Flooring
- Mastic for Vinyl Flooring
- Concrete Foundation
- Counter Caulking
- White 3"x4" Ceramic Tile
- Grout for Tile
- Mastic for Tile

- White Brick
- Mortar for Brick
- White Ceiling Wrap
- Insulation for Ceiling Wrap
- Fire Stop Caulking

Building D – 16 Assumed ACBM

- White Brick
- Mortar for White Brick
- Concrete Foundation
- White Window Frame Sealant
- Door Frame Caulking
- Light Gray 4x4 Ceramic Tile
- Grout for 4x4 Ceramic Tile
- Mastic for 4x4 Ceramic Tile
- Counter Caulking
- Gray Epoxy Flooring
- Fixture Caulking
- Fiberglass Reinforced Plastic (FRP)
- Mastic for FRP
- Mop Sink Caulking
- Gray Duct Mastic
- Drywall Ceiling

Building E – 14 Assumed ACBM

- Interior Frame Caulking
- Fiberglass Reinforced Plastic (FRP)
- Mastic for FRP
- Counter & Cabinet Caulking
- Black 4" Cove Base
- Mastic for Black 4" Cove Base
- Gray Duct Wrap
- Insulation for Duct Wrap
- Ceiling Wrap
- Insulation for Ceiling Wrap
- Pink Ceiling Wrap
- Insulation for Ceiling Wrap
- Silver Duct Wrap
- Insulation for Duct Wrap

Building G – 4 Assumed ACBM

- Window/Door Frame Caulking
- Untextured Drywall
- Black Foam Insulation
- Concrete Foundation

Building K – 4 Assumed ACBM

- Fiberglass Reinforced Plastic (FRP)
- Mastic for FRP
- White Mop Sink Caulking
- Fixture Caulking

Building T – 29 Assumed ACBM

- Blue Carpet
- Mastic for Blue Carpet
- Gray and Blue 36"x9" Carpet
- Mastic for 36"x9" Carpet
- Counter and Cabinet Caulking
- Gray 2"x2" Ceramic Floor Tile
- Grout for Gray 2"x2" Ceramic Floor Tile
- Thinset for Gray 2"x2" Ceramic Floor Tile
- Gray 12"x6" Ceramic Cove Base Tile
- Grout for Gray 12"x6" Ceramic Cove Base Tile
- Mastic for Gray 12"x6" Ceramic Cove Base Tile
- White 18"x4" Ceramic Wall Tile
- Grout for White 18"x4" Ceramic Wall Tile
- Mastic for White 18"x4" Ceramic Wall Tile
- White/Gray 2"x2" Wall Tile
- Grout for White/Gray 2"x2" Wall Tile
- Mastic for White/Gray 2"x2" Wall Tile
- White Fiberglass Reinforced Plastic (FRP)
- Mastic for FRP
- Heavy Orange Peel Drywall System
- Interior Expansion Joint
- Gray Duct Mastic
- Red Fire Caulking
- Silver Duct Wrap
- Insulation for Silver Duct Wrap
- Untextured Drywall System
- Batt Insulation
- Silver Flex Duct
- Insulation for Silver Flex Duct

Building W – 24 Assumed ACBM

- Interior Frame Caulking
- Window Glazing
- 6"x2" Brick
- Mortar for Brick
- Concrete Foundation
- Smooth Drywall System
- Brown Concrete Foundation
- Carpet
- Mastic for Carpet
- CMU Block
- Mortar for CMU Block
- 12"x12" VCT
- Mastic for VCT
- Pink 12"x12" VCT
- Mastic for Pink VCT
- White Sink Coating
- Blue/Gray Carpet
- Mastic for Blue/Gray Carpet
- Blue Cove Base
- Mastic for Cove Base
- Untextured Drywall
- White Batt Insulation
- Yellow Batt Insulation
- Red Fire Stop Caulking

INSPECTION FINDINGS

2024 ASBESTOS 6-MONTH SURVEILLANCE SAMPLING – March 11, 2024

All fourteen (14) damaged homogeneous building materials sampled throughout Buildings E, G, and W during the March 2024 inspection were reported by the laboratory using the PLM analysis method to be “none detected for asbestos content.”

2025 AHERA ASBESTOS RE-INSPECTION – October 2 and 3, 2025

One hundred seventeen (117) of the suspect homogeneous building materials sampled during the October 2025 inspection were reported by the laboratory using the PLM analysis method to be “none detected for asbestos content.”

Listed below, identified by building, is the one (1) suspect homogeneous building material reported by the laboratory to be greater than one percent (>1%) asbestos-containing.

Building B

- Drywall Ceiling (White Compound Layer)

As shown above, one hundred and seventy-nine (179) suspect homogeneous building materials were *assumed* to contain greater than one percent (>1%) asbestos.

RECOMMENDATIONS

Any building material within the Kyrene District Office and Bus Barn not identified in this inspection report that is not wood, glass, or metal, is a suspect ACBM and should not be removed, sanded, ground, abraded, or otherwise disturbed by any person without being properly trained as per 40 CFR 763.92 and, or 29 CFR 1926.1101. For detailed recommendations, please refer to the Kyrene District Office and Bus Barn AHERA Management Plan.

The ACBM or assumed ACBM located within the structures of the Kyrene District Office and Bus Barn can be managed in compliance with the Kyrene Elementary School District AHERA Management Plan until such a time as these building materials become degraded, have become friable, or will be disturbed by ongoing maintenance, renovation, or a demolition activity. Prior to a renovation or demolition activity, the previously listed assumed ACBM should be sampled by an AHERA Certified Building Inspector to determine the presence of asbestos.

At least once every six (6) months after a management plan is in effect, the KESD should conduct periodic surveillance in each building that it leases, owns, or otherwise uses as a school building that contains ACBM.

At least once every three (3) years after a management plan is in effect, the KESD should conduct an inspection of all ACBM on the school campus.

The AHERA inspection is limited to only the interior of the buildings and the underside of any covered walkways. This would mean that the additional suspect building materials found on the exterior of the buildings or structures that are not regulated by AHERA are regulated by EPA NESHAP and OSHA. Therefore, prior to any disturbance of these un-sampled or newly installed suspect building materials, Dominion recommends that these suspect materials be sampled by an AHERA Certified Building Inspector and analyzed for asbestos content by a qualified laboratory prior to any disturbance.

The property owner or his representatives should retain the services of an independent asbestos consulting firm to monitor the performance of any asbestos abatement activities. The consulting firm should oversee the completeness of any asbestos removal and verify the quality of the air during the removal work and perform final clearance air sampling in accordance with the AHERA guidelines.

All documentation is being provided to the Kyrene Elementary School District and must be retained as a permanent record. Should you have any questions regarding the procedures that were followed on this project, please contact Dominion at any time. Thank you for the opportunity to provide these environmental consulting services.

A handwritten signature in black ink, appearing to read "Chase Kirby", with a long, sweeping horizontal line extending to the right.

2025 AHERA Building Inspector

Chase Kirby

AHERA Certificate Number: 4380-19987-030525

Expires: March 5, 2026

Historical Information:

2024 AHERA Building Inspector


Tracey Carpenter

State of Arizona #ON-188748-14588-082525

SECTION 4



SITE PLANS

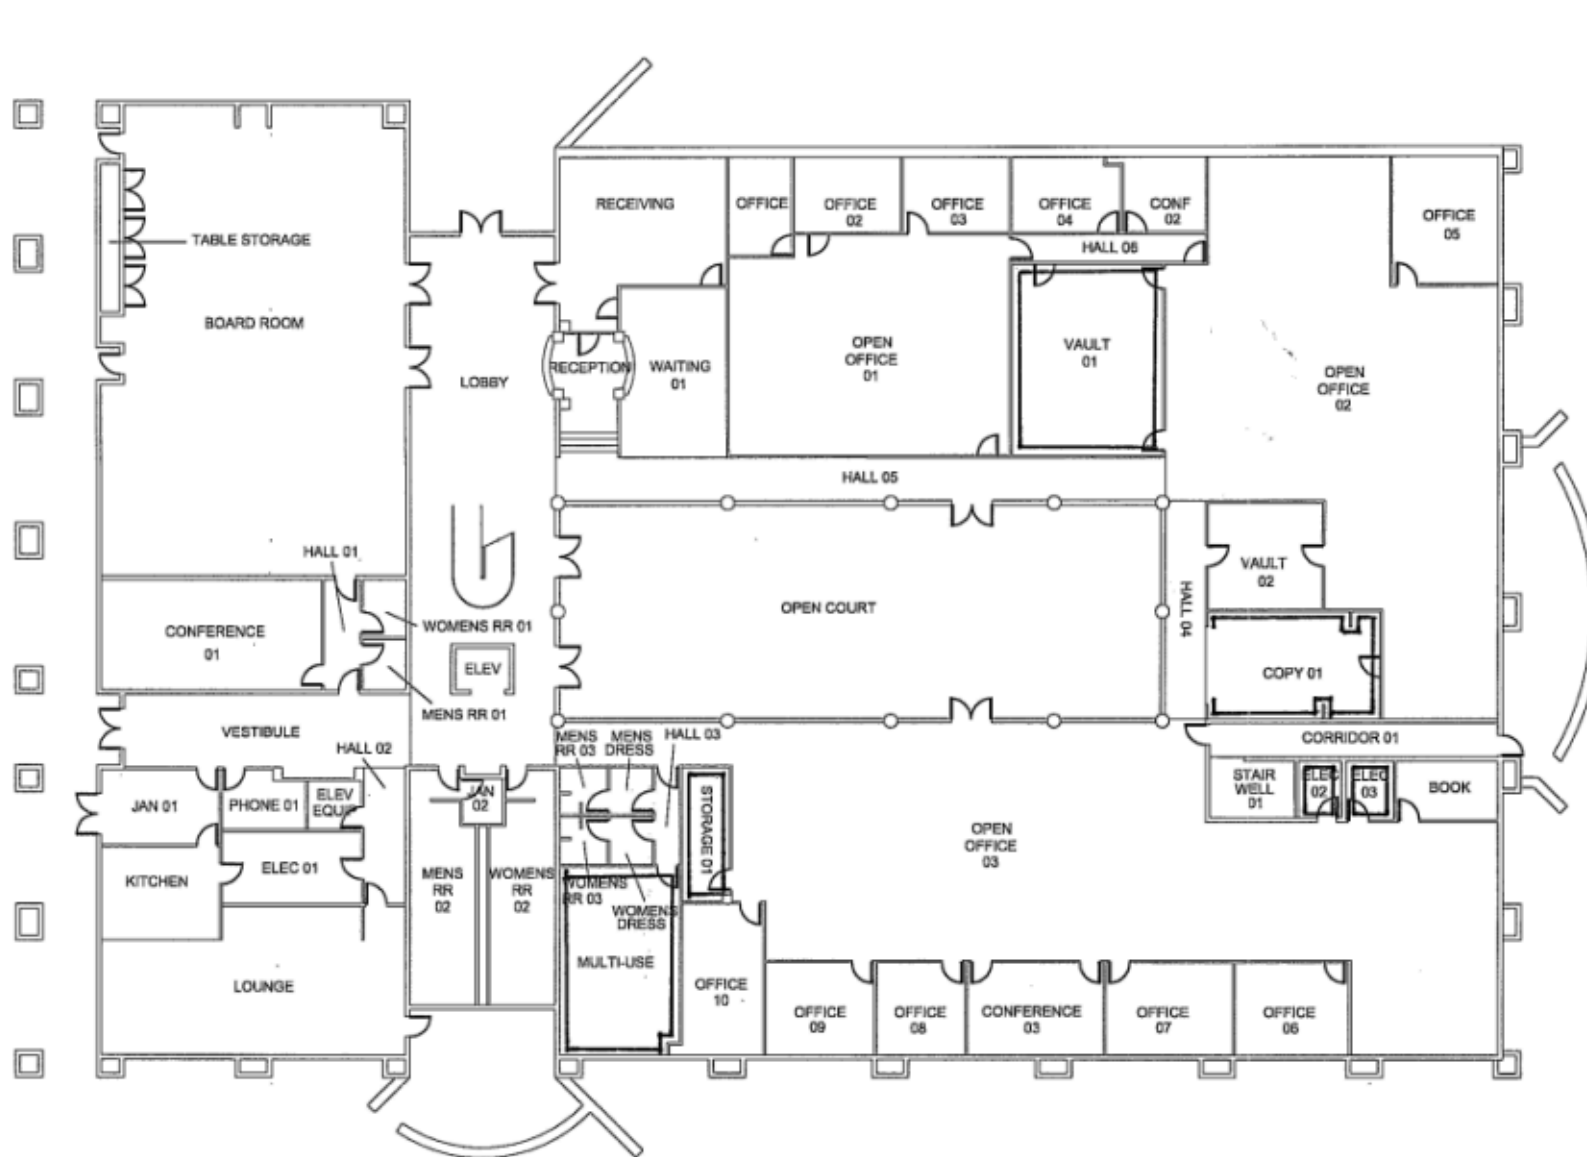


Site Plan (1)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building A - First Floor

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415



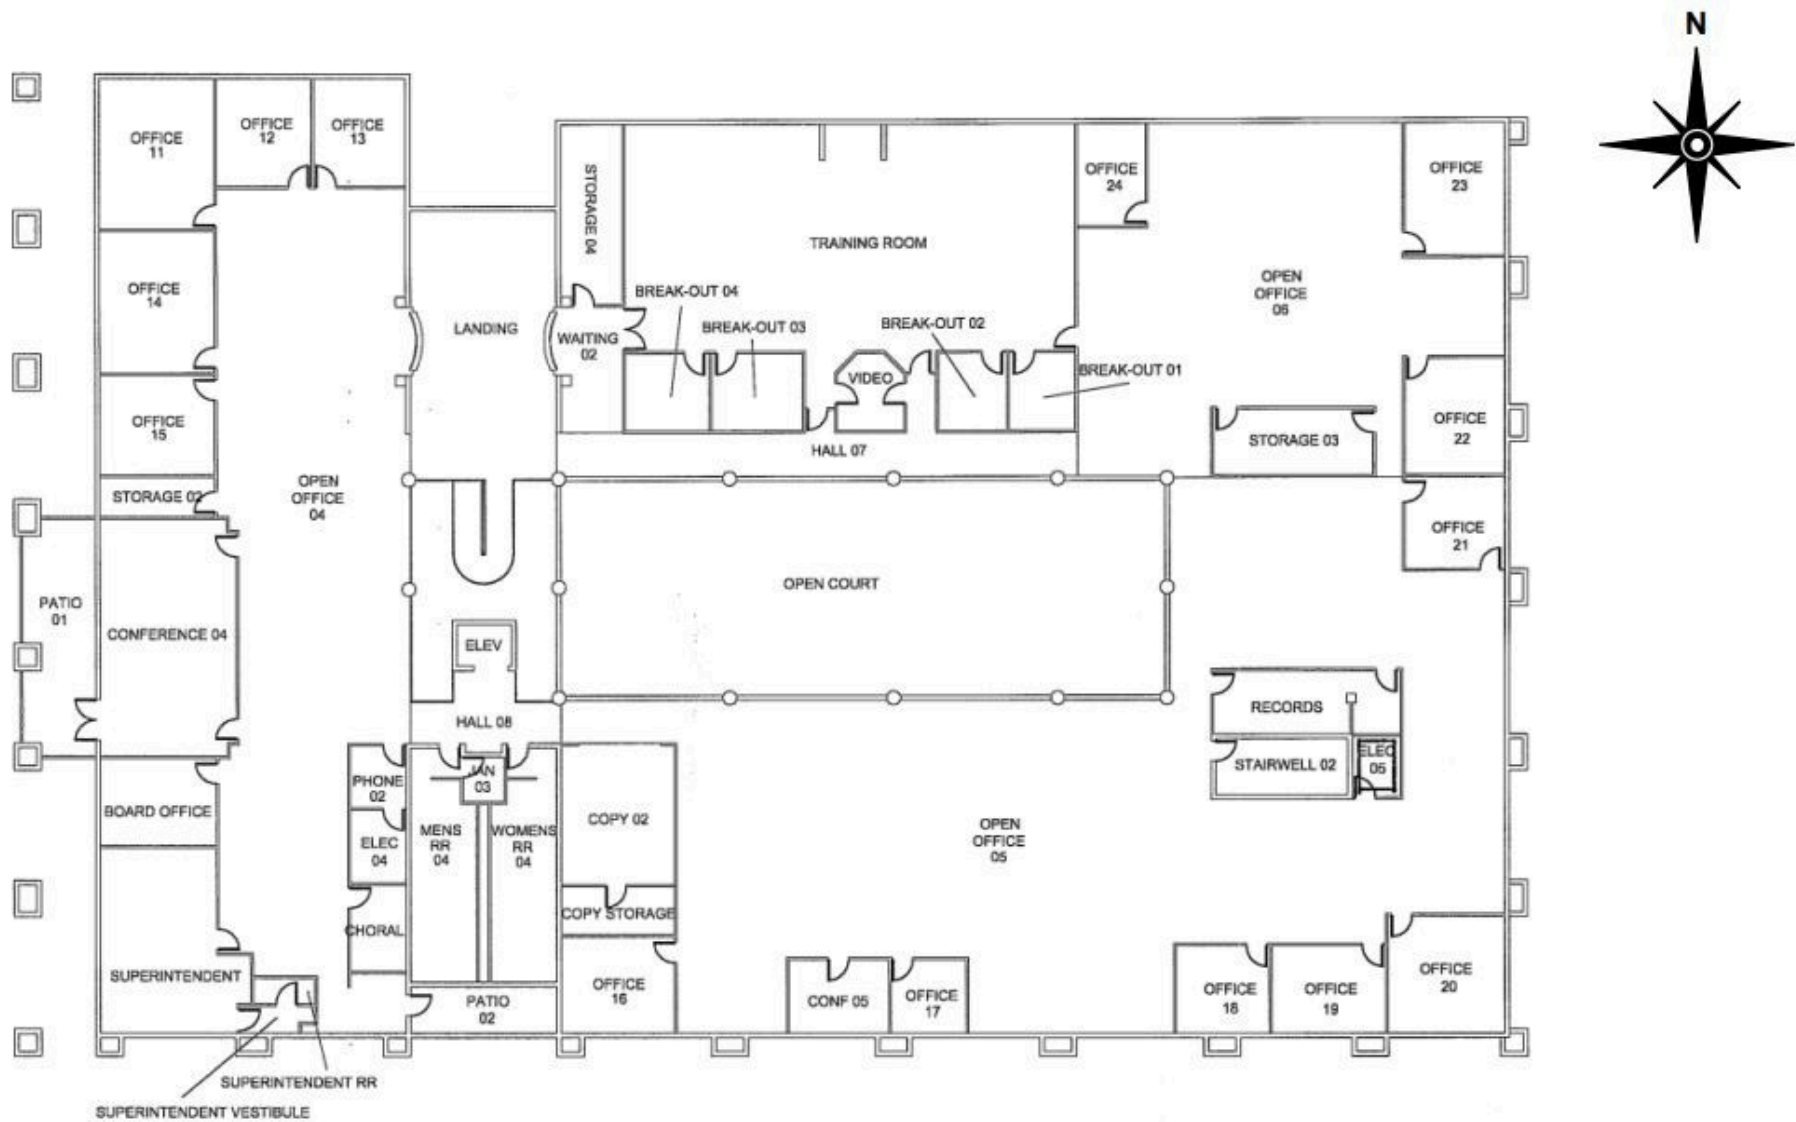


Site Plan (2)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building A - Second Floor

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

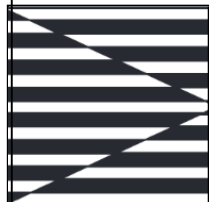
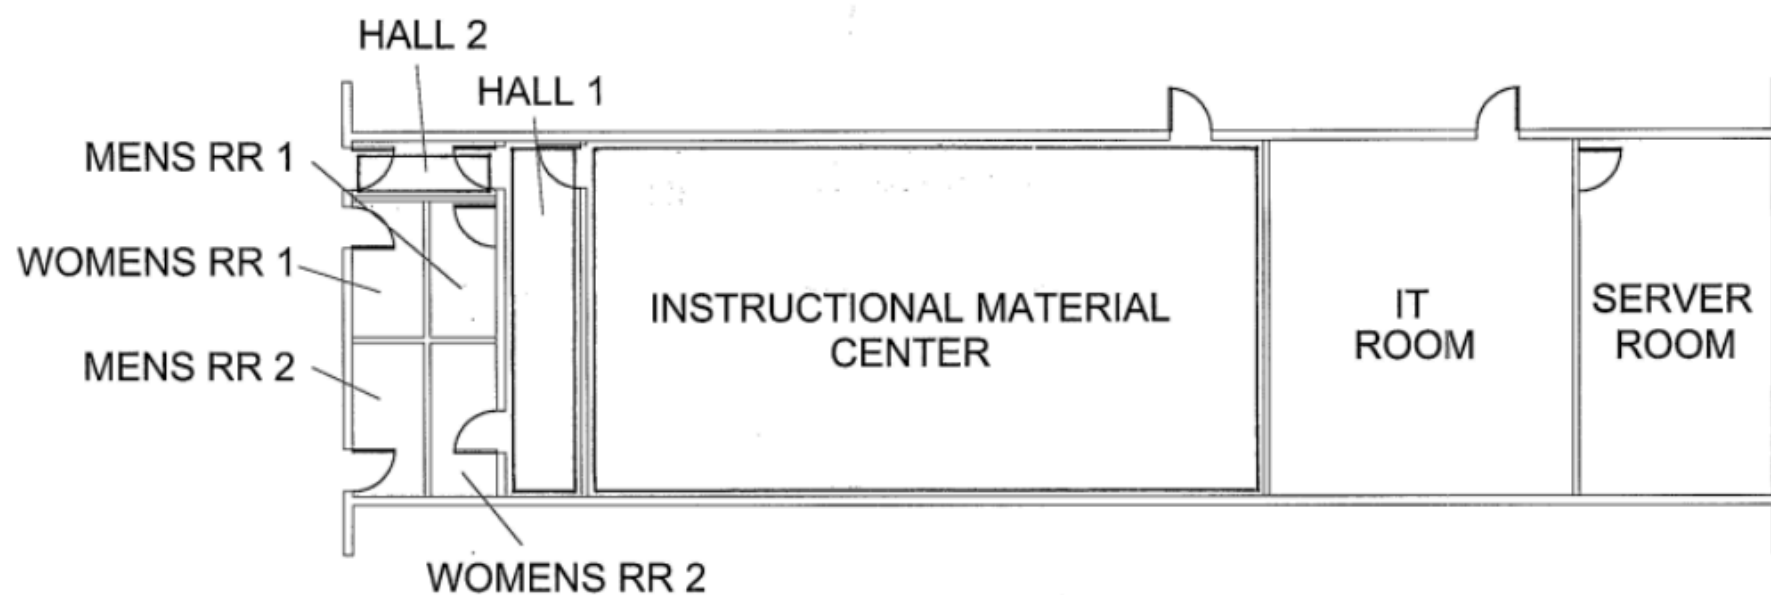
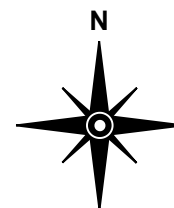


Site Plan
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building B

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

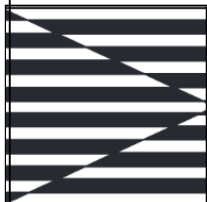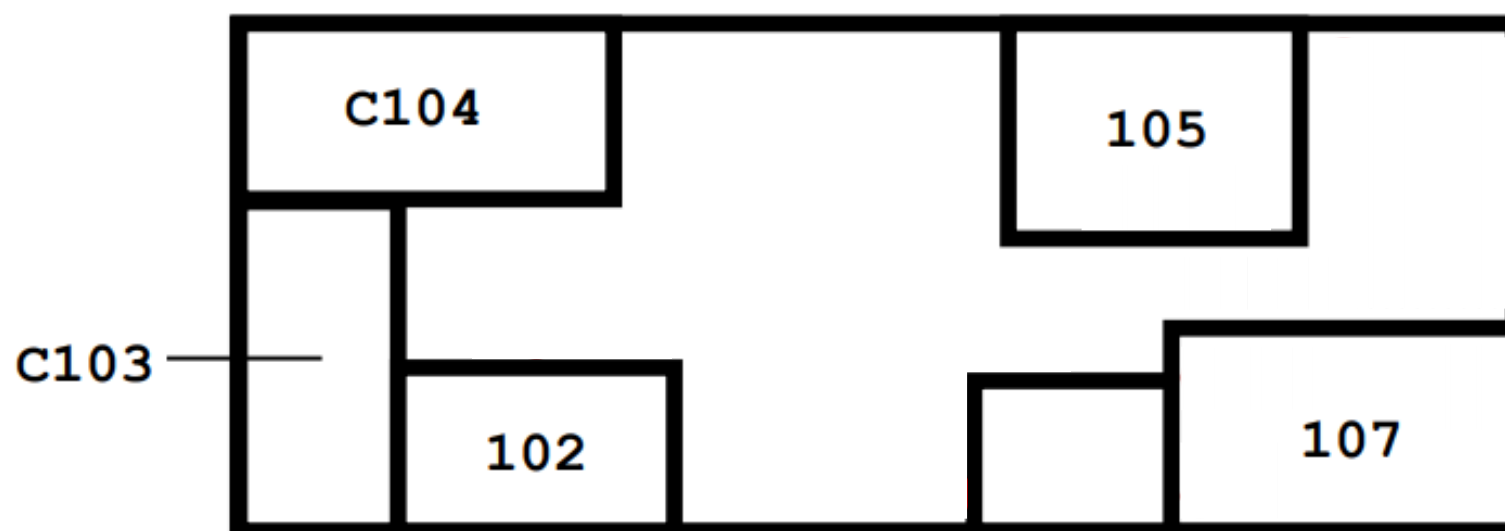
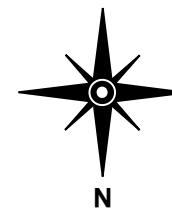


Site Plan
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building C

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

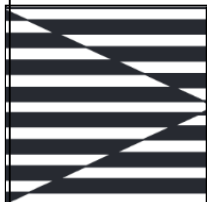
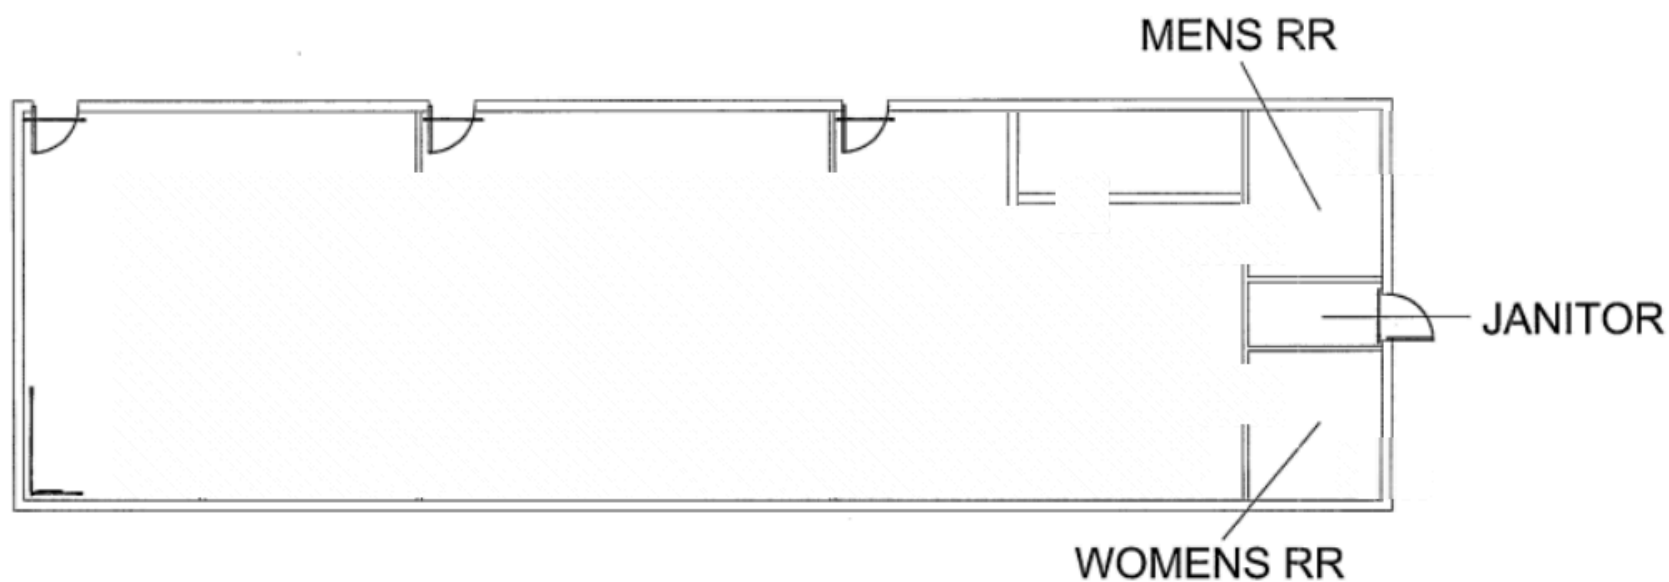


Site Plan
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building D

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

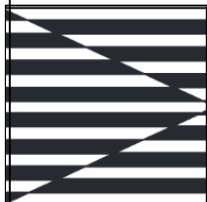
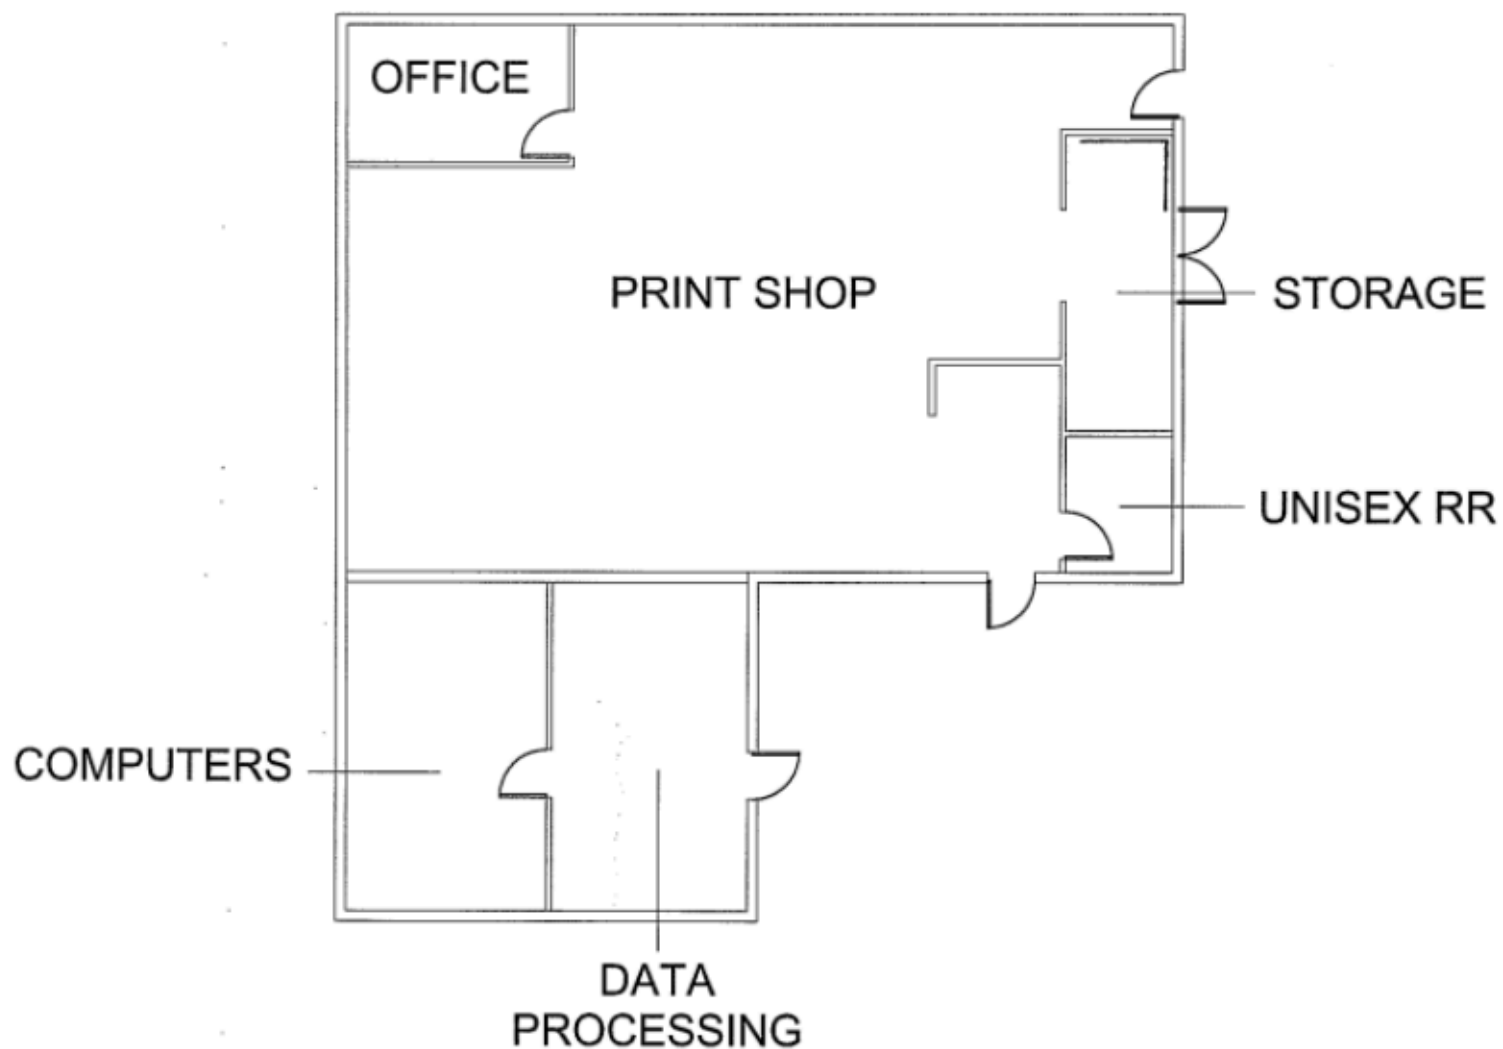


Site Plan
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building E

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

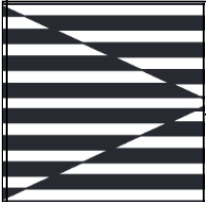
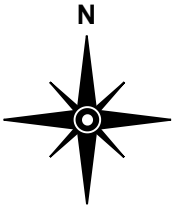


Site Plan
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building F

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

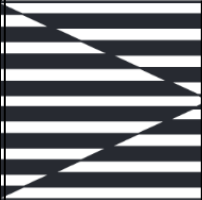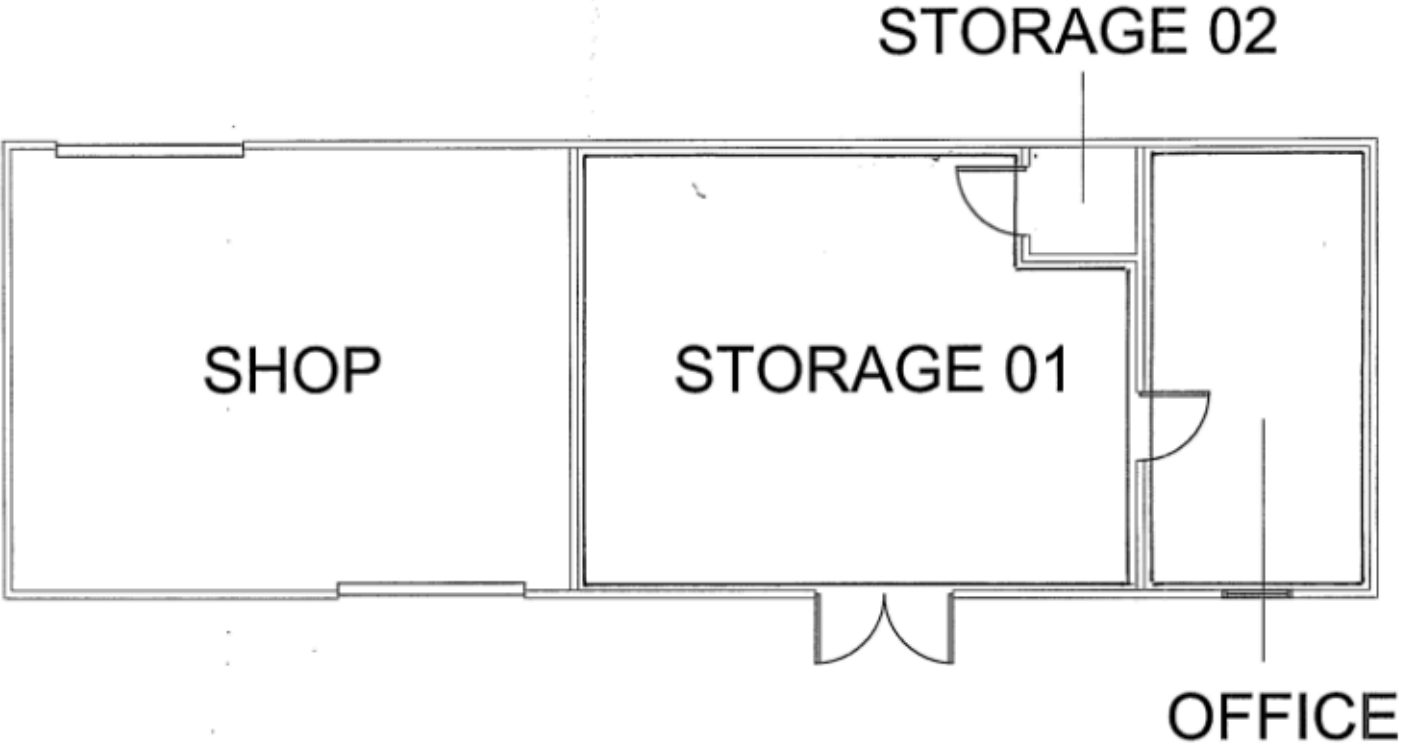


Site Plan
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60
Building G




Janitors
Corner

Closet

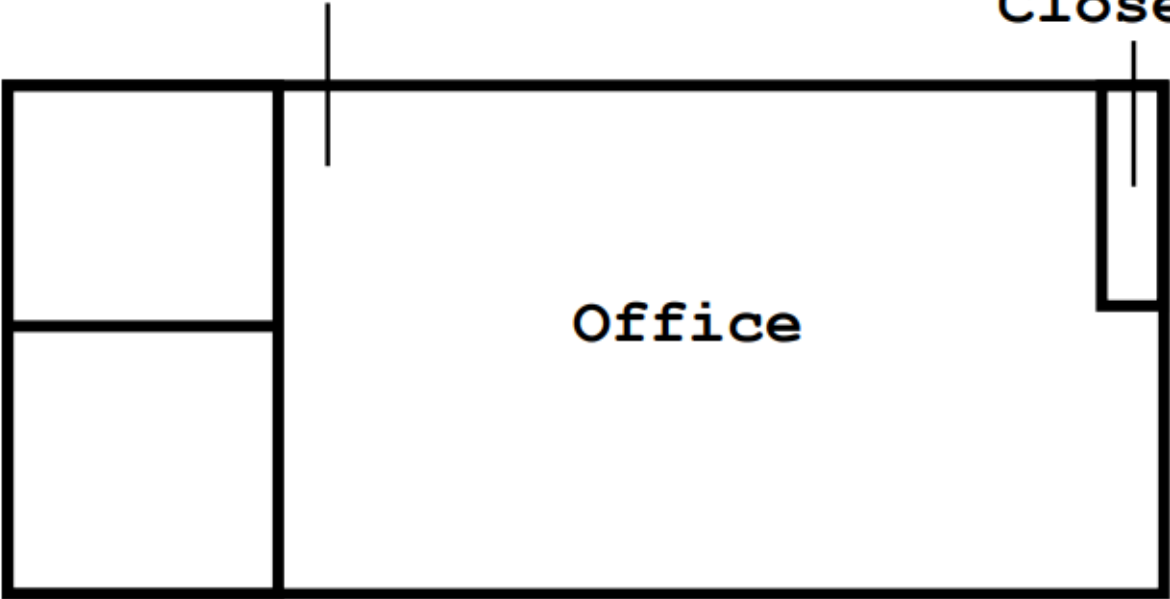

Office


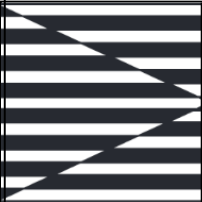


Site Plan
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building K


Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

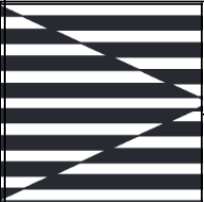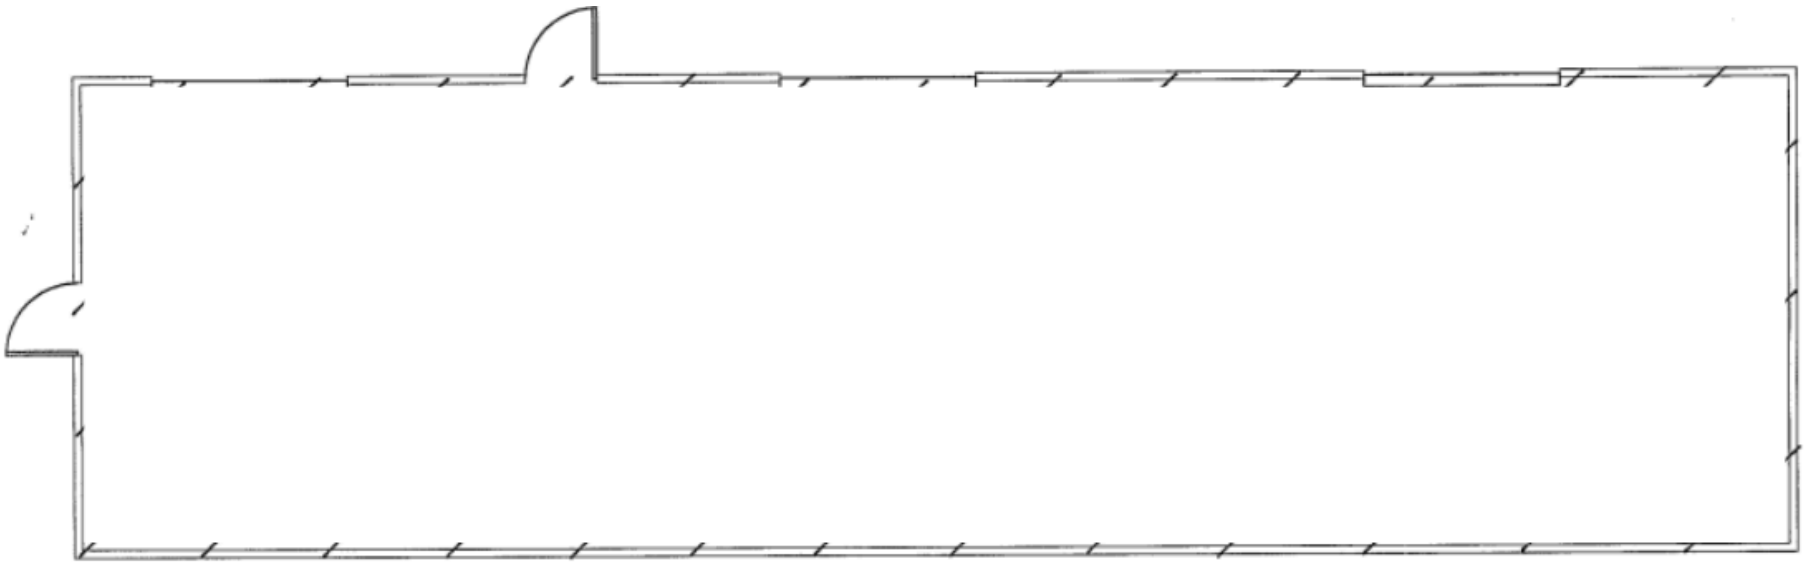

Site Plan
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60



Building M

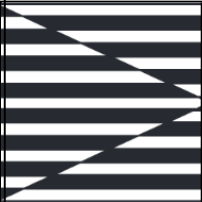

Site Plan
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60
Building O

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

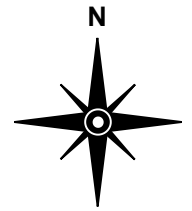
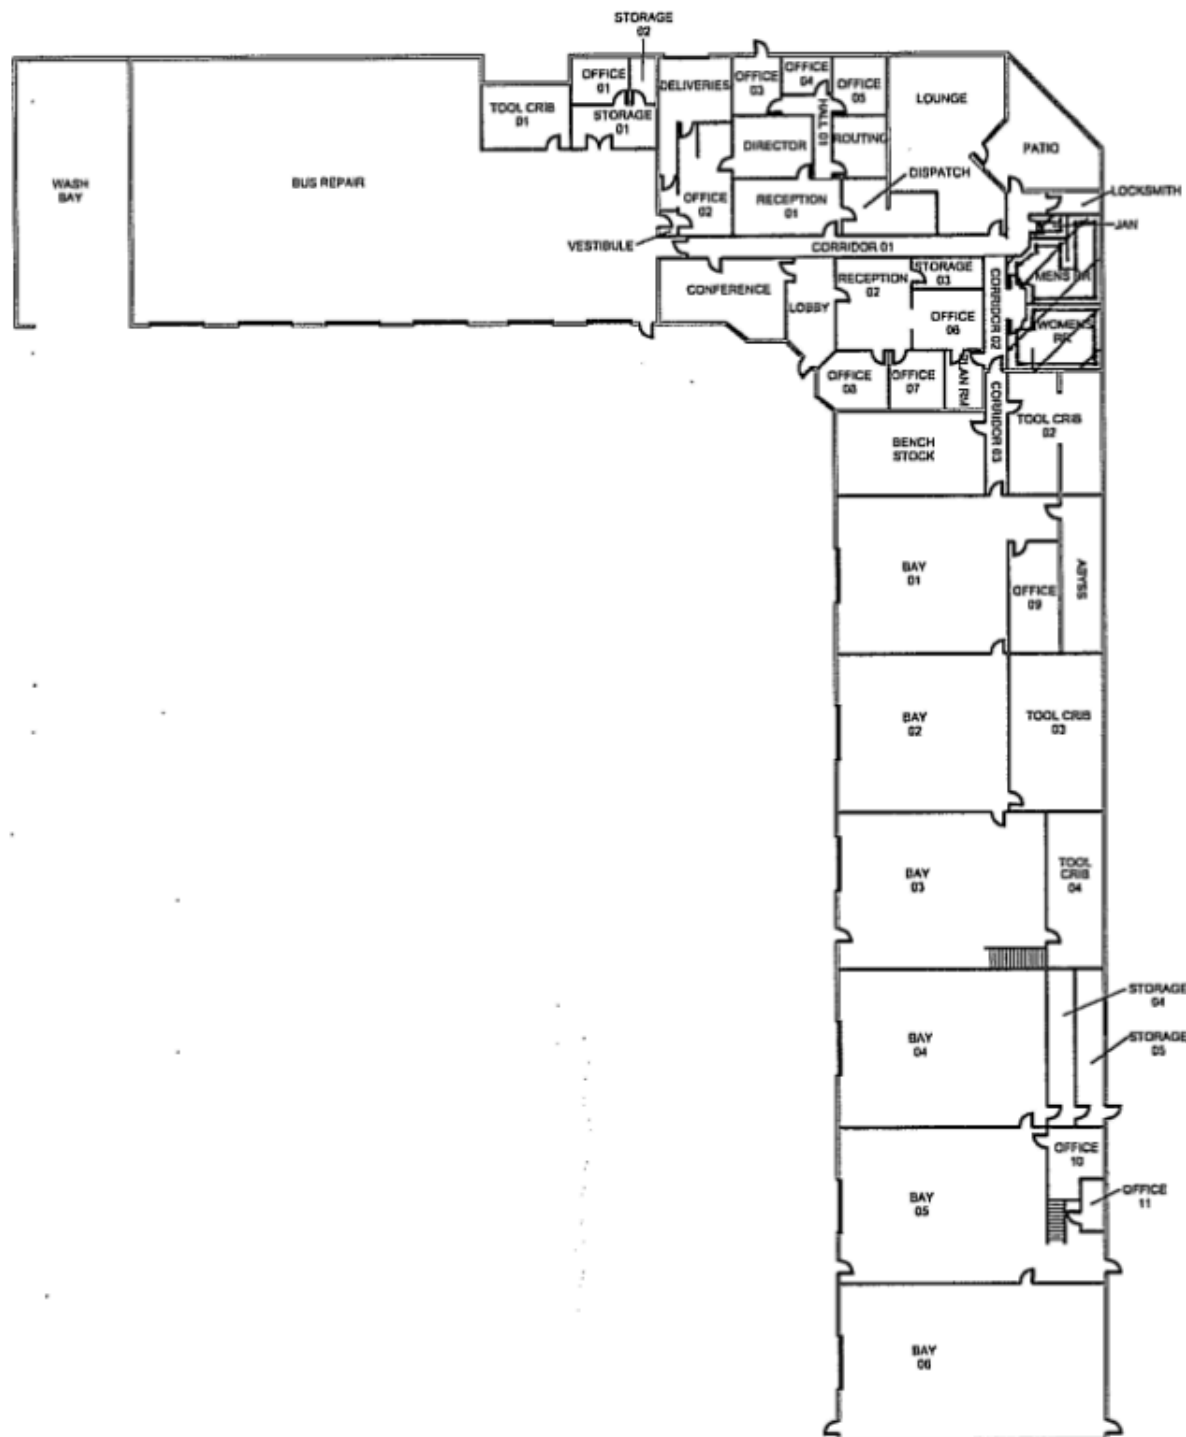


Site Plan
 Kyrene District Office & Bus Barn
 8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building T

Dominion Environmental Consultants, Inc.
 20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

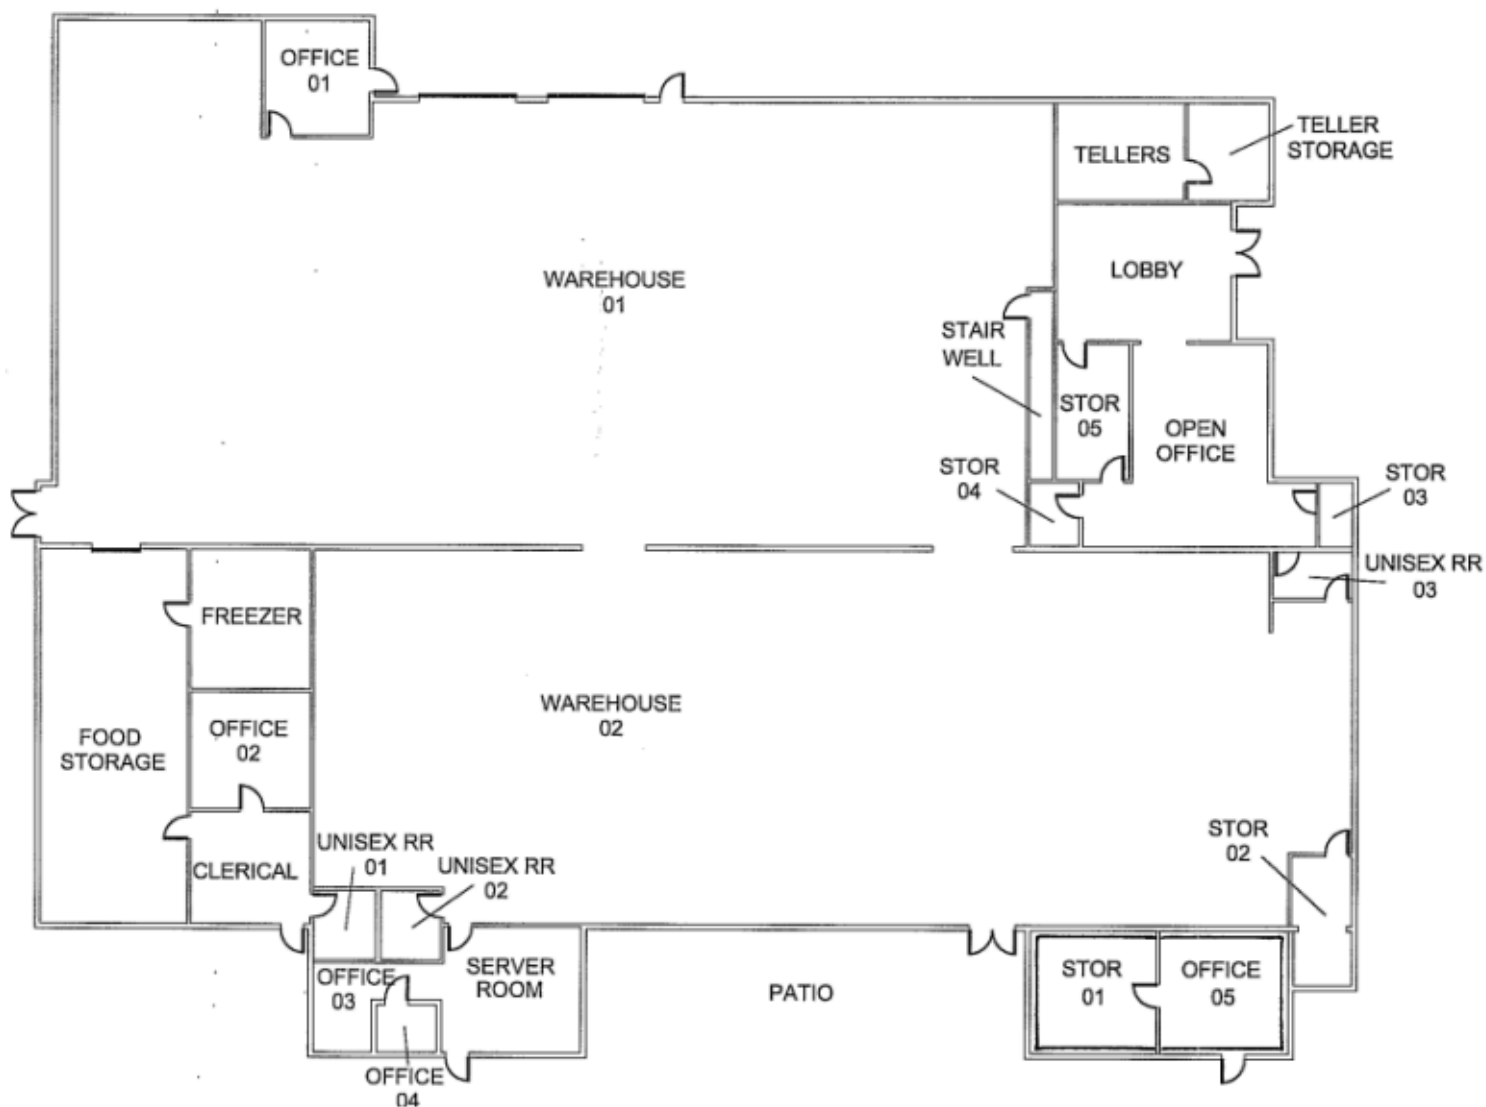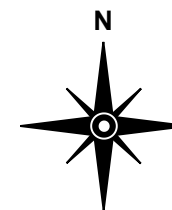

Site Plan
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building W

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

SECTION 5



HOMOGENEOUS MATERIALS INVENTORY LISTS

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/3/2025		Site: Kyrene District Office and Bus Barn (Bldg. A)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
1	Orange Peel Drywall - Off-White Paint	Throughout Building	No	No	M	56000
	White Texture					
	White Paint					
	White Compound					
	Cream Tape					
	White Joint Compound					
	White Drywall with Brown Paper					
2	White Fixture Caulking	Restrooms	No	No	M	15
3	Black Window Glazing	Throughout Building	No	No	M	20
4	Brown Linoleum	Office and Hallways	No	No	M	2,600
5	Yellow Mastic for Brown Linoleum		No	No	M	
6	Gray Multicolor Carpet	Hallways	No	No	M	3,150
7	Yellow Mastic for Gray Multicolor Carpet		No	No	M	
8	Dark Gray Multicolor Carpet	Meeting Room and Office	No	No	M	320
9	Yellow Mastic for Dark Gray Multicolor Carpet		No	No	M	
10	Gray Cove Base	Throughout Building	No	No	M	320
11	Cream Mastic for Gray Cove Base		No	No	M	
12	Light Gray Interior Caulking	Throughout Building	No	No	M	25
13	Gray Interior Caulking	Throughout Building	No	No	M	25
14	2' X 2' Ceiling Tile	Throughout Building	No	Yes	M	36,000
Assumed Materials						
15	Black 2"x2" Carpet Square	Entrances	Assumed	No	M	128
16	Mastic for 2"x2" Black Carpet Square		Assumed	No	M	
17	Gray Ceramic Floor Tile	Lobby, Restroom Hallway, Room 147	Assumed	No	M	1,300
18	Grout for Floor Tile		Assumed	No	M	
19	Thinset for Floor Tile		Assumed	No	M	
20	White Counter Caulking	Admin Area	Assumed	No	M	2

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/3/2025		Site: Kyrene District Office and Bus Barn (Bldg. A)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
21	Blue Smooth Drywall System	North Entrance, Room 106, and Room 111	Assumed	No	M	550
22	Concrete Foundation	Throughout Building	Assumed	No	M	43,000
23	Expansion Joint	Throughout Building	Assumed	No	M	50
24	Pink 12"x12" VCT	Room 103	Assumed	No	M	50
25	Mastic for Pink 12"x12" VCT		Assumed	No	M	
26	Brown 4" Cove Base	Room 103	Assumed	No	M	50
27	Mastic for Brown 4" Cove Base		Assumed	No	M	
28	Red Fire Stop Caulking	Room 101, 103, 127, and 222	Assumed	No	M	10
29	Gray 36" x 9" Carpet	Throughout Building	Assumed	No	M	2,300
30	Mastic for Gray 36" x 9" Carpet		Assumed	No	M	
31	Gray w. Pattern Ceramic Wall Tile	Restrooms	Assumed	No	M	430
32	Grout for Wall Tile		Assumed	No	M	
33	Mastic for Wall Tile		Assumed	No	M	
34	Gray Fixture 12" x 8" Ceramic Wall Tile	Restrooms	Assumed	No	M	200
35	Grout for Wall Tile		Assumed	No	M	
36	Mastic for Wall Tile		Assumed	No	M	
37	Fiberglass Reinforced Plastic (FRP)	Custodial	Assumed	No	M	20
38	Mastic for FRP		Assumed	No	M	
39	Mop Sink Caulking	Custodial	Assumed	No	M	2
40	Gray Mortar	Restrooms	Assumed	No	M	70
41	Pink 2"x2" Ceramic Wall Tile	Restrooms	Assumed	No	M	5
42	Grout for Wall Tile		Assumed	No	M	
43	Mastic for Wall Tile		Assumed	No	M	
44	Pink 2"x2" Ceramic Cove Base	Restrooms	Assumed	No	M	5
45	Grout for Ceramic Cove Base		Assumed	No	M	
46	Mastic for Ceramic Cove Base		Assumed	No	M	

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/3/2025		Site: Kyrene District Office and Bus Barn (Bldg. K)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
1	Gray Wallpaper for Drywall Wall	Throughout	No	No	M	2200
	White Drywall with Brown Paper		No	No	M	
2	Blue Cove Base	Throughout	No	No	M	80
3	Cream Mastic for Blue Cove Base		No	No	M	
4	2 x 2 Gray Carpet	Throughout	No	No	M	990
5	Semi-Transparent Mastic for 2 x 2 Gray Carpet		No	No	M	
6	White 12 x 12 VCT	Throughout	No	No	M	468
7	Yellow Mastic for 12x12 VCT		No	No	M	
8	2 x 4 Ceiling Tile	Throughout	No	Yes	M	1,000
9	2 x 2 Ceiling Tile (Drywall)	Throughout	No	No	M	364
10	Silver Flex Duct Wrap	Above Ceiling	No	No	M	100
11	Pink Insulation for Silver Flex Duct Wrap		No	No	M	
12	Pink Batt Insulation	Above Ceiling	No	No	M	1,460
13	Silver Box Duct Wrap	Above Ceiling	No	No	M	250
14	Yellow Insulation for Silver Box Duct Wrap		No	No	M	
Assumed Material						
15	White Fiberglass Reinforced Plastic (FRP)	Janitors Closet	Assumed	No	M	120
16	Mastic for White FRP		Assumed	No	M	
17	White Mop Sink Caulking	Janitors Closet	Assumed	No	M	2
18	Fixture Caulking	Restroom	Assumed	No	M	5

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Building K - Page 1

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/3/2025		Site: Kyrene District Office and Bus Barn (Bldg. A)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
47	Gray 10"x2" Ceramic Wall Tile	Water Fountain Area	Assumed	No	M	20
48	Grout for Wall Tile		Assumed	No	M	
49	Mastic for Wall Tile		Assumed	No	M	
50	Gray Wall Paper Drywall System	Room 105	Assumed	No	M	2,701
51	Gray w. White 4"x3" Ceramic Wall Tile	Break Room	Assumed	No	M	240
52	Grout for Wall Tile		Assumed	No	M	
53	Mastic for Wall Tile		Assumed	No	M	
54	White CMU Block	Room 127	Assumed	No	M	360
55	Mortar for White CMU Block		Assumed	No	M	
56	White 16"x5" Ceramic Wall Tile	Restrooms (Second Floor)	Assumed	No	M	1,400
57	Grout for Wall Tile		Assumed	No	M	
58	Mastic for Wall Tile		Assumed	No	M	
59	Plaster Columns	Lobby	Assumed	No	M	4,700
60	White 16"x4" Ceramic Wall Tile	Restrooms (Second Floor)	Assumed	No	M	250
61	Grout for Wall Tile		Assumed	No	M	
62	Mastic for Wall Tile		Assumed	No	M	
63	White Pipe Wrap	Above Ceiling	Assumed	No	M	260
64	Insulation for Pipe Wrap	Above Ceiling	Assumed	No	M	150
65	Gray Duct Mastic		Assumed	No	M	
66	Silver Flex Duct Wrap	Above Ceiling	Assumed	No	M	740
67	Insulation for Silver Flex Duct Wrap		Assumed	No	M	
68	Gray Duct Wrap	Above Ceiling	Assumed	No	M	360
69	Insulation for Gray Duct Wrap		Assumed	No	M	
70	Ceiling Insulation Wrap	Above Ceiling	Assumed	No	M	40,000
71	Insulation for Ceiling Wrap		Assumed	No	M	

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: KESD				
Inspection Date(s): 10/2/2025		Site: Kyrene District Office and Bus Barn (Bldg. B)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 10/2/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
1	1' x 1' Tan Ceiling Tile with White Surface	Throughout Building	No	No	M	2900
2	Brown Mastic for 1' x 1' Tan Ceiling Tile		No	No	M	
3	Old Orange Peel Drywall - Off-White Paint	Throughout Building	No	No	M	880
	White Texture		No	No	M	
	White Paint		No	No	M	
	White Texture 2		No	No	M	
	Cream Tape		No	No	M	
	White Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
4	Tan Vinyl Floor (VCT)	Throughout Building	No	No	M	315
5	Black Mastic for Tan Vinyl Floor (VCT)		No	No	M	
6	Gray Vinyl Floor Tile (VCT)	Sever Room	No	No	M	460
7	Black Mastic for Gray Vinyl Floor Tile (VCT)		No	No	M	
8	Black Cove Base	Sever Room	No	No	M	25
9	Off-White Mastic for Black Cove Base		No	No	M	
10	Silver Flex Duct Wrap	Above Ceiling	No	No	M	100
11	Pink Insulation for Silver Flex Duct Wrap		No	No	M	
12	Silver Duct Wrap	Above Ceiling	No	No	M	700
13	Tan Insulation for Silver Duct Wrap		No	No	M	
14	Gray Duct Mastic	Above Ceiling	No	No	M	150
15	Drywall Ceiling - White Compound for Drywall	Throughout Building	Yes	No	M	2,900
	White Drywall with Brown Paper		No	No	M	

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Building B - Page 1

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: KESD				
Inspection Date(s): 10/2/2025		Site: Kyrene District Office and Bus Barn (Bldg. B)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
16	New Orange Peel Drywall System - White Paint	I.T. Room	No	No	M	7,500
	Texture		No	No	M	
	Off-White Paint		No	No	M	
	Texture Layer #2		No	No	M	
	Tape		No	No	M	
	Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
Assumed Material						
17	2' x 4' Ceiling Tile	Throughout Building	Assumed	Yes	M	460
18	Interior Frame Caulking	Throughout Building	Assumed	No	M	5
19	Red Fire Stop Caulking	Server Room	Assumed	No	M	5
20	White 9'x2' Brick	Throughout Building	Assumed	No	M	3,752
21	Mortar for Brick	Throughout Building	Assumed	No	M	
22	Concrete Foundation	Throughout Building	Assumed	No	M	2,900
23	Unfinished Drywall System	Above Ceiling	Assumed	No	M	20
24	Black Flex Duct Wrap	Above Ceiling	Assumed	No	M	200
25	Insulation for Black Flex Duct Wrap		Assumed	No	M	
26	Smooth Drywall Ceiling	Above Ceiling	Assumed	No	M	276
27	Blue w. Gray 2'x2' Carpet	Sever Room	Assumed	No	M	358
28	Mastic for Blue w. Gray 2'x2' Carpet		Assumed	No	M	

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/2/2025		Site: Kyrene District Office and Bus Barn (Bldg. C)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 10/2/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
1	Old Orange Peel Drywall - White Paint	Throughout	No	No	M	4800
	White Texture		No	No	M	
	Cream Tape		No	No	M	
	White Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
2	Gray Cove Base	Throughout	No	No	M	140
3	Cream Mastic for Cove Base		No	No	M	
4	Pinhole 2' X 2' Ceiling Tile	Throughout	No	Yes	M	2,050
5	Black Window Glazing	Windows Throughout	No	No	M	10
6	Silver Duct Insulation Backing	Above Ceiling	No	No	M	350
7	Yellow Insulation for Silver Duct Backing		No	No	M	
8	Silver Flex Duct Backing	Above Ceiling	No	No	M	220
9	Pink Insulation for Silver Flex Duct Backing		No	No	M	
10	White Batt Insulation	Above Ceiling	No	No	M	2,050
Assumed Material						
11	Gray 2' X 2' Carpet	Office and Hallway	Assumed	No	M	1,570
12	Mastic for Gray 2' X 2' Carpet		Assumed	No	M	
13	Door Frame Caulking	Throughout	Assumed	No	M	10
14	White Window Sealant	Windows Throughout	Assumed	No	M	10
15	Black Weather Stripping	Windows Throughout	Assumed	No	M	10
16	Gray 36" X 9" Carpet	Throughout	Assumed	No	M	240
17	Mastic for Gray 36" X 9" Carpet		Assumed	No	M	
18	Brown Vinyl Plank Flooring	Break Room and Lobby	Assumed	No	M	240
19	Mastic for Brown Vinyl Flooring		Assumed	No	M	
20	Concrete Foundation	Throughout	Assumed	No	M	2,290
21	Counter Caulking	Break Room	Assumed	No	M	25

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/2/2025		Site: Kyrene District Office and Bus Barn (Bldg. C)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
22	White 3" x 4" Ceramic Tile	Restroom	Assumed	No	M	16
23	Grout for White 3" x 4" Ceramic Tile		Assumed	No	M	
24	Mastic for White 3" x 4" Ceramic Tile		Assumed	No	M	
25	White Brick	Throughout	Assumed	No	M	3,200
26	Mortar for Brick		Assumed	No	M	
27	White Ceiling Wrap	Above Ceiling	Assumed	No	M	240
28	Insulation for Ceiling Wrap		Assumed	No	M	
29	Fire Stop Caulking	Above Ceiling	Assumed	No	M	2

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/2/2025		Site: Kyrene District Office and Bus Barn (Bldg. D)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 10/2/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
1	Old Orange Peel Drywall - Off-White Paint	Throughout	No	No	M	5505
	White Texture		No	No	M	
	Cream Tape		No	No	M	
	White Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
2	Blue Cove Base	Throughout	No	No	M	60
3	Cream Mastic for Cove Base		No	No	M	
4	2 x 2 Ceiling Tile	Throughout	No	No	M	2,450
5	Silver Flex Duct Wrap	Above Ceiling	No	No	M	180
6	Pink Insulation for Silver Flex Duct Wrap	Above Ceiling	No	No	M	180
7	1 x 1 Ceiling Tile	Above Ceiling	No	No	M	350
8	Brown Mastic for 1 x 1 Ceiling Tile		No	No	M	
Assumed Material						
9	White Brick	Throughout	Assumed	No	M	3,340
10	Mortar for White Brick		Assumed	No	M	
11	Concrete Foundation	Throughout	Assumed	No	M	2,780
12	White Window Frame Sealant	Windows Throughout	Assumed	No	M	10
13	Door Frame Caulking	Doors Throughout	Assumed	No	M	10
14	Light Gray 4 x 4 Ceramic Tile	Restroom	Assumed	No	M	144
15	Grout for Light Gray 4 x 4 Ceramic Tile		Assumed	No	M	
16	Mastic for Light Gray 4 x 4 Ceramic Tile		Assumed	No	M	
17	Counter Caulking	Throughout	Assumed	No	M	2
18	Gray Epoxy Flooring	Throughout	Assumed	No	M	80
19	Fixture Caulking	Restroom	Assumed	No	M	2
20	Fiberglass Reinforced Plastic (FRP)	Janitors Closet	Assumed	No	M	32
21	Mastic for FRP		Assumed	No	M	
22	Mop Sink Caulking	Janitors Closet	Assumed	No	M	2

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.11 + AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 3/11/2024 + 10/3/2025		Site: Kyrene District Office and Bus Barn (Bldg. E)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
23	Counter & Cabinet Caulking	Restroom	Assumed	No	M	5
24	Black 4" Cove Base	Data Processing	Assumed	No	M	50
25	Mastic for Black 4" Cove Base		Assumed	No	M	
26	Gray Duct Wrap	Above Ceiling	Assumed	No	M	20
27	Insulation for Gray Duct Wrap		Assumed	No	M	
28	Ceiling Wrap	Above Ceiling	Assumed	No	M	600
29	Insulation for Ceiling Wrap		Assumed	No	M	
30	Pink Ceiling Wrap	Above Ceiling	Assumed	No	M	2,050
31	Insulation for Pink Ceiling Wrap		Assumed	No	M	
32	Silver Duct Wrap	Above Ceiling	Assumed	No	M	300
33	Insulation for Silver Duct Wrap		Assumed	No	M	

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s):AZ1418.11 + AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 3/11/2024 + 10/3/2025		Site: Kyrene District Office and Bus Barn (Bldg. E)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 3/11/2025 - AHERA Building Inspector: Tracey Carpenter (ON-188748-14588-082525)						
1	Light Blue 12" x12" VCT	Data Processing Room	No	No	M	50
2	Tan Mastic for Light Blue 12" x12" VCT		No	No	M	
3	Dark Blue 12" x12" VCT	Print Shop Storage/Entry	No	No	M	100
4	Tan Mastic for Dark Blue 12" x12" VCT		No	No	M	
5	Blue Cove Base	Print Shop Storage/Entry & Restroom	No	No	M	50
6	Brown/Beige Mastic for Blue Cove Base		No	No	M	
Inspection Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
7	Orange Peel Drywall - White Paint	Throughout	No	No	M	3,100
	White Texture		No	No	M	
	Yellow Tape (Mesh)		No	No	M	
	White Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
8	Dark Blue VCT	Restroom	No	No	M	50
9	Yellow Mastic for Dark Blue VCT		No	No	M	
10	Green VCT	Throughout	No	No	M	2,400
11	Yellow Mastic for Green VCT		No	No	M	
12	Ceiling Tile	Throughout	No	No	M	2,500
13	Replacement Ceiling Tile	Throughout	No	No	M	60
14	Dark Blue Cove Base	Throughout	No	No	M	100
15	Brown Mastic for Dark Blue Cove Base		No	No	M	
16	Light Green VCT	Throughout	No	No	M	150
17	Tan Mastic for Light Green VCT		No	No	M	
18	Black Cove Base	Throughout	No	No	M	50
19	Cream Mastic for Black Cove Base		No	No	M	
Assumed Material						
20	Interior Frame Caulking	Throughout	Assumed	No	M	15

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.11 + AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 3/11/2024 + 10/3/2025		Site: Kyrene District Office and Bus Barn (Bldg. E)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
21	Fiberglass Reinforced Plastic (FRP)	Restroom and Entrance	Assumed	No	M	48
22	Mastic for FRP		Assumed	No	M	
23	Counter & Cabinet Caulking	Restroom	Assumed	No	M	5
24	Black 4" Cove Base	Data Processing	Assumed	No	M	50
25	Mastic for Black 4" Cove Base		Assumed	No	M	
26	Gray Duct Wrap	Above Ceiling	Assumed	No	M	20
27	Insulation for Gray Duct Wrap		Assumed	No	M	
28	Ceiling Wrap	Above Ceiling	Assumed	No	M	600
29	Insulation for Ceiling Wrap		Assumed	No	M	
30	Pink Ceiling Wrap	Above Ceiling	Assumed	No	M	2,050
31	Insulation for Pink Ceiling Wrap		Assumed	No	M	
32	Silver Duct Wrap	Above Ceiling	Assumed	No	M	300
33	Insulation for Silver Duct Wrap		Assumed	No	M	

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/3/2025		Site: Kyrene District Office and Bus Barn (Bldg. F)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
1	Concrete Foundation	Throughout	No	No	M	2,050
2	Black Window Glazing	Throughout	No	No	M	15
3	Interior Frame Caulking	Throughout	No	No	M	10
4	Orange Peel Drywall - Cream Paint	Throughout	No	No	M	640
	White Texture		No	No	M	
	White Drywall with Brown Paper		No	No	M	
5	Brown Cove Base	Throughout	No	No	M	2,684
6	Cream Mastic for Brown Cove Base		No	No	M	

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.11 + AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 3/11/2024 + 10/3/2025		Site: Kyrene District Office and Bus Barn (Bldg. G)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 10/3/2025 - AHERA Building Inspector: Tracey Carpenter (ON-188748-14588-082525)						
1	Brown Cove Base	Office (Previously Removed)	No	No	M	15
2	Tan Mastic for Brown Cove Base		No	No	M	
3	Green Artificial Turf Carpet	Office (Previously Removed)	No	No	M	680
4	Tan Mastic for Green Artificial Turf Carpet		No	No	M	
5	Tan 12" x 12" VCT	Shop & Storage	No	No	M	800
6	Yellow Mastic for Tan 12" x 12" VCT		No	No	M	
7	Gray Concrete	Throughout	No	No	M	1400
Inspection Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
1	Gray Cove Base	Throughout	No	No	M	40
2	Off-White Mastic for Gray Cove Base		No	No	M	
3	Orange Peel Drywall System- White Paint	Throughout	No	No	M	2,160
	White Texture		No	No	M	
	Off-White Paint		No	No	M	
	White Texture 2		No	No	M	
	Cream Tape		No	No	M	
	White Joint Compound		No	No	M	
	White Drywall with Brown Paper		No	No	M	
4	Blue Multicolor Carpet Square	Office	No	No	M	680
5	Multicolored Mastic for Blue Multicolor Carpet Square		No	No	M	
6	Box Duct Insulation Wrap	Above Ceiling	No	No	M	25
7	Off-White Insulation for Box Duct Wrap		No	No	M	
Assumed Material						
8	Window/Door Frame Caulking	Throughout	Assumed	No	M	5
9	Untextured Drywall	Above Ceiling	Assumed	No	M	25
10	Black Foam Insulation	Above Ceiling	Assumed	No	M	5

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/3/2025		Site: Kyrene District Office and Bus Barn (Bldg. K)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
1	Gray Wallpaper for Drywall Wall	Throughout	No	No	M	2200
	White Drywall with Brown Paper		No	No	M	
2	Blue Cove Base	Throughout	No	No	M	80
3	Cream Mastic for Blue Cove Base		No	No	M	
4	2 x 2 Gray Carpet	Throughout	No	No	M	990
5	Semi-Transparent Mastic for 2 x 2 Gray Carpet		No	No	M	
6	White 12 x 12 VCT	Throughout	No	No	M	468
7	Yellow Mastic for 12x12 VCT		No	No	M	
8	2 x 4 Ceiling Tile	Throughout	No	Yes	M	1,000
9	2 x 2 Ceiling Tile (Drywall)	Throughout	No	No	M	364
10	Silver Flex Duct Wrap	Above Ceiling	No	No	M	100
11	Pink Insulation for Silver Flex Duct Wrap		No	No	M	
12	Pink Batt Insulation	Above Ceiling	No	No	M	1,460
13	Silver Box Duct Wrap	Above Ceiling	No	No	M	250
14	Yellow Insulation for Silver Box Duct Wrap		No	No	M	
Assumed Material						
15	White Fiberglass Reinforced Plastic (FRP)	Janitors Closet	Assumed	No	M	120
16	Mastic for White FRP		Assumed	No	M	
17	White Mop Sink Caulking	Janitors Closet	Assumed	No	M	2
18	Fixture Caulking	Restroom	Assumed	No	M	5

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/2/2025		Site: Kyrene District Office and Bus Barn (Bldg. M)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 10/2/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
1	Concrete Foundation	Throughout	No	No	M	1,920

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/2/2025		Site: Kyrene District Office and Bus Barn (Bldg. O)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 10/2/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
1	Concrete Foundation	Throughout	No	No	M	1,500

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/2/2025		Site: Kyrene District Office and Bus Barn (Bldg. T)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 10/2/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
1	Orange Peel Drywall - Light Gray Paint	Throughout	No	No	M	10,300
	White Texture					
	Cream Tape					
	White Joint Compound					
	White Drywall with Brown Paper					
2	Gray Cove Base	Throughout	No	No	M	300
3	Cream Mastic for Gray Cove Base					
4	Gray 2 x 2 Ceiling Tile	Throughout	No	No	M	26,000
5	Multicolor Carpet Square	Throughout	No	No	M	1,440
6	Yellow Mastic for Multicolor Carpet Square					
7	Floor Expansion Joint	Throughout	No	No	M	20
8	Skip Trowel Drywall - Tan Paint	Restrooms	No	No	M	12,100
	White Texture					
	Cream Tape					
	White Joint Compound					
	White Drywall with Brown Paper					
9	Concrete	Throughout	No	No	M	21,609
10	Black Cove Base	Mechanics Bay	No	No	M	40
11	Brown Mastic for Black Cove Base					
12	Brown Cove Base	Mechanics Bay	No	No	M	10
13	Yellow Mastic for Brown Cove Base					
14	Interior Frame Caulking	Doors Throughout	No	No	M	30
Assumed Material						
15	Blue Carpet	Throughout	Assumed	No	M	3,800
16	Mastic for Blue Carpet		Assumed	No	M	
17	Gray and Blue 36" x 9" Carpet	Room 118	Assumed	No	M	300
18	Mastic for Gray and Blue 36" x 9" Carpet		Assumed	No	M	

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 10/2/2025		Site: Kyrene District Office and Bus Barn (Bldg. T)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
19	Counter and Cabinet Caulking	Throughout	Assumed	No	M	2
20	Gray 2" x 2" Ceramic Floor Tile	Restrooms	Assumed	No	M	600
21	Grout for Gray 2" x 2" Ceramic Floor Tile		Assumed	No	M	
22	Thinset for Gray 2" x 2" Ceramic Floor Tile		Assumed	No	M	
23	Gray 12" x 6" Ceramic Cove Base Tile	Restrooms	Assumed	No	M	70
24	Grout for Gray 12" x 6" Ceramic Cove Base Tile		Assumed	No	M	
25	Mastic for Gray 12" x 6" Ceramic Cove Base Tile		Assumed	No	M	
26	White 18" x 4" Ceramic Wall Tile	Restrooms	Assumed	No	M	400
27	Grout for White 18" x 4" Ceramic Wall Tile		Assumed	No	M	
28	Mastic for White 18" x 4" Ceramic Wall Tile		Assumed	No	M	
29	White/Gray 2" x 2" Ceramic Wall Tile	Restrooms	Assumed	No	M	1,050
30	Grout for White/Gray 2" x 2" Ceramic Wall Tile		Assumed	No	M	
31	Mastic for White/Gray 2" x 2" Ceramic Wall Tile		Assumed	No	M	
32	White Fiberglass Reinforced Plastic (FRP)	Restrooms	Assumed	No	M	120
33	Mastic for White FRP		Assumed	No	M	
34	Heavy Orange Peel Drywall System	Mechanics Bay	Assumed	No	M	11,200
35	Interior Expansion Joint	Mechanics Bay	Assumed	No	M	30
36	Gray Duct Mastic	Mechanics Bay	Assumed	No	M	30
37	Red Fire Caulking	Mechanics Bay	Assumed	No	M	5
38	Silver Duct Wrap	Above Ceiling	Assumed	No	M	30
39	Insulation for Silver Duct Wrap		Assumed	No	M	
40	Untextured Drywall System	Above Ceiling	Assumed	No	M	1,300
41	Batt Insulation	Above Ceiling	Assumed	No	M	3,800
42	Silver Flex Duct	Above Ceiling	Assumed	No	M	320
43	Insulation for Silver Flex Duct		Assumed	No	M	

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.11 + AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 3/11/24 + 10/3/2025		Site: Kyrene District Office and Bus Barn (Bldg. W)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
Inspection Date: 10/3/2025 - AHERA Building Inspector: Tracey Carpenter (ON-188748-14588-082525)						
1	White Popcorn Ceiling Drywall System - Popcorn Texture	Warehouse	No	Yes	S	8100
	Cream Tape					
	White Joint Compound					
	White Drywall with Brown Paper					
Inspection Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)						
2	Orange Peel Drywall - Light Gray Paint	Lobby/Office	No	No	M	6320
	White Texture					
	Cream Tape					
	White Joint Compound					
	White Drywall with Brown Paper					
3	2' x 2' Ceiling Tile	Throughout	No	M	M	1,220
4	2' x 4' Ceiling Tile	Throughout	No	No	M	890
5	Brown Cove Base	Throughout	No	No	M	150
6	Tan Mastic for Brown Cove Base					
7	Brown Mastic for Brown Cove Base					
8	Heavy Texture Drywall - Beige Paint	Warehouse	No	No	M	450
	White Texture					
	Cream Tape					
	White Joint Compound					
	White Drywall with Brown Paper					
9	White Popcorn Ceiling	Warehouse	No	No	S	8100
	Cream Tape					
	White Joint Compound					
	White Drywall with Brown Paper					
10	Gray Duct Mastic	Above Ceiling	No	No	M	820
11	Silver Flex Duct Wrap	Above Ceiling	No	No	M	850
12	Pink Insulation for Silver Flex Duct Wrap		No	No	M	420

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA Suspect ACBM Homogeneous Building Materials Inventory List

Dominion Project Number(s): AZ1418.11 + AZ1418.60		Client: Kyrene Elementary School District No. 28				
Inspection Date(s): 3/11/24 + 10/3/2025		Site: Kyrene District Office and Bus Barn (Bldg. W)				
Homogeneous Material #	Material Description	Location(s)	ACBM Yes/No/ Assumed	Friable Yes/No	Material Category	Approximate Quantity (sq. ft.)
13	Silver Duct Wrap	Above Ceiling	No	No	M	6300
14	Yellow Insulation for Silver Duct Wrap		No	No	M	6,300
15	Pink Batt Insulation	Above Ceiling	No	No	M	2,150
Assumed Material						
16	Interior Frame Caulking	Doors Throughout	Assumed	No	M	20
17	Black Window Glazing	Windows Throughout	Assumed	No	M	25
18	6" x 2" Brick	Throughout	Assumed	No	M	5000
19	Mortar for 6" x 2" Brick					
20	Concrete Foundation	Throughout	Assumed	No	M	19,560
21	Smooth Drywall System	Warehouse	Assumed	No	M	580
22	Brown Concrete Foundation	Warehouse	Assumed	No	M	1,500
23	Stair Carpet	Stairs	Assumed	No	M	900
24	Mastic for Stair Carpet					
25	Block	Throughout	Assumed	No	M	5000
26	Mortar for Block					
27	Gray 12" x 12" VCT	Clerical and Office	Assumed	No	M	1000
28	Mastic for Gray 12" x 12" VCT					
29	Pink 12" x 12" VCT	Restroom	Assumed	No	M	120
30	Mastic for Pink 12" x 12" VCT					
31	White Sink Coating	Restroom	Assumed	No	M	5
32	Blue/Gray Carpet	Storage	Assumed	No	M	800
33	Mastic for Blue/Gray Carpet					
34	Blue Cove Base	Storage	Assumed	No	M	20
35	Mastic for Blue Cove Base					
36	Untextured Drywall	Above Ceiling	Assumed	No	M	1,100
37	White Batt Insulation	Above Ceiling	Assumed	No	M	6,300
38	Yellow Batt Insulation	Above Ceiling	Assumed	No	M	6,300
39	Red Fire Stop Caulking	Above Ceiling	Assumed	No	M	10

Inspector: Chase Kirby
Certificate # : 4380-19987-030525
State: Arizona

KEY:
S = Surfacing
M = Miscellaneous
TSI = Thermal System Insulation

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. K)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)					
AZ1418.60-PLM-1	1	Gray Wallpaper for Drywall Wall	Southeast - Main Room	Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-2		Gray Wallpaper for Drywall Wall	Southwest - Main Room	Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-3		Gray Wallpaper for Drywall Wall	Northeast - Main Room	Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-4	2	Blue Cove Base	North - Closet	Convenient	None Detected
	3	Cream Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.60-PLM-5	2	Blue Cove Base	North - Closet	Convenient	None Detected
	3	Cream Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.60-PLM-6	2	Blue Cove Base	Southwest - Main Room	Convenient	None Detected
	3	Cream Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.60-PLM-7	4	2 x 2 Gray Carpet	Southeast - Main Room	Convenient	None Detected
	5	Semi-Transparent Mastic for 2 x 2 Gray Carpet		Convenient	None Detected
AZ1418.60-PLM-8	4	2 x 2 Gray Carpet	North - Main Room	Convenient	None Detected
	5	Semi-Transparent Mastic for 2 x 2 Gray Carpet		Convenient	None Detected
AZ1418.60-PLM-9	4	2 x 2 Gray Carpet	Northwest - Main Room	Convenient	None Detected
	5	Semi-Transparent Mastic for 2 x 2 Gray Carpet		Convenient	None Detected
AZ1418.60-PLM-10	6	White 12 x 12 VCT	Southwest - Main Room	Convenient	None Detected
	7	Yellow Mastic for White 12 x 12 VCT		Convenient	None Detected
AZ1418.60-PLM-11	6	White 12 x 12 VCT	Southeast - Main Room	Convenient	None Detected
	7	Yellow Mastic for White 12 x 12 VCT		Convenient	None Detected
AZ1418.60-PLM-12	6	White 12 x 12 VCT	Northwest - Restroom	Convenient	None Detected
	7	Yellow Mastic for White 12 x 12 VCT		Convenient	None Detected
AZ1418.60-PLM-13	8	2 x 4 Ceiling Tile	Southwest - Main Room	Convenient	None Detected
AZ1418.60-PLM-14		2 x 4 Ceiling Tile	Northwest - Main Room	Convenient	None Detected
AZ1418.60-PLM-15		2 x 4 Ceiling Tile	Northeast - Main Room	Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. K)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60-PLM-16	9	2 x 2 Ceiling Tile (Drywall)	Southeast - Restroom	Convenient	None Detected
AZ1418.60-PLM-17		2 x 2 Ceiling Tile (Drywall)	Southeast - Restroom	Convenient	None Detected
AZ1418.60-PLM-18		2 x 2 Ceiling Tile (Drywall)	Northeast - Restroom	Convenient	None Detected
AZ1418.60-PLM-19	10	Silver Flex Duct Wrap	South - Above Ceiling Grid	Convenient	None Detected
	11	Pink Insulation for Silver Flex Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-20	10	Silver Flex Duct Wrap	Center - Above Ceiling Grid	Convenient	None Detected
	11	Pink Insulation for Silver Flex Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-21	10	Silver Flex Duct Wrap	Center - Above Ceiling Grid	Convenient	None Detected
	11	Pink Insulation for Silver Flex Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-22	12	Pink Batt Insulation	Southeast - Above Ceiling Grid	Convenient	None Detected
AZ1418.60-PLM-23		Pink Batt Insulation	Northeast - Above Ceiling Grid	Convenient	None Detected
AZ1418.60-PLM-24		Pink Batt Insulation	Northwest - Above Ceiling Grid	Convenient	None Detected
AZ1418.60-PLM-25	13	Silver Box Duct Wrap	South - Above Ceiling Grid	Convenient	None Detected
	14	Yellow Insulation for Silver Box Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-26	13	Silver Box Duct Wrap	Center - Above Ceiling Grid	Convenient	None Detected
	14	Yellow Insulation for Silver Box Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-27	13	Silver Box Duct Wrap	Center - Above Ceiling Grid	Convenient	None Detected
	14	Yellow Insulation for Silver Box Duct Wrap		Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/2/2025			Site: Kyrene District Office and Bus Barn (Bldg. M)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 10/2/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)					
AZ1418.60-PLM-1	1	Concrete Foundation	Northeast - Building Exterior	Convenient	None Detected
AZ1418.60-PLM-2		Concrete Foundation	West - Building Exterior	Convenient	None Detected
AZ1418.60-PLM-3		Concrete Foundation	East - Building Exterior	Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/2/2025			Site: Kyrene District Office and Bus Barn (Bldg. O)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 10/2/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)					
AZ1418.60-PLM-1	1	Concrete Foundation	Northeast - Building	Convenient	None Detected
AZ1418.60-PLM-2		Concrete Foundation	Northwest - Building	Convenient	None Detected
AZ1418.60-PLM-3		Concrete Foundation	Southwest - Building	Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/2/2025			Site: Kyrene District Office and Bus Barn (Bldg. T)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 10/2/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)					
AZ1418.60-PLM-1	1	Orange Peel Drywall - Light Gray Paint	Southeast - Conference Room	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-2		Orange Peel Drywall - Light Gray Paint	West - Storage 03	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-3		Orange Peel Drywall - Light Gray Paint	Southwest - Office 06	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-4	2	Gray Cove Base	Southeast - Conference Room	Convenient	None Detected
	3	Cream Mastic for Gray Cove Base		Convenient	None Detected
AZ1418.60-PLM-5	2	Gray Cove Base	West - Storage 03	Convenient	None Detected
	3	Cream Mastic for Gray Cove Base		Convenient	None Detected
AZ1418.60-PLM-6	2	Gray Cove Base	Southwest - Office 06	Convenient	None Detected
	3	Cream Mastic for Gray Cove Base		Convenient	None Detected
AZ1418.60-PLM-7	4	Gray 2 x 2 Ceiling Tile	Center - Reception 01	Convenient	None Detected
AZ1418.60-PLM-8		Gray 2 x 2 Ceiling Tile	Center - Lounge	Convenient	None Detected
AZ1418.60-PLM-9		Gray 2 x 2 Ceiling Tile	Northwest - Bench Stock	Convenient	None Detected
AZ1418.60-PLM-10	5	Multicolor Carpet Square	Southeast - Conference Room	Convenient	None Detected
	6	Yellow Mastic for Multicolor Carpet Square		Convenient	None Detected
AZ1418.60-PLM-11	5	Multicolor Carpet Square	West - Storage 03	Convenient	None Detected
	6	Yellow Mastic for Multicolor Carpet Square		Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/2/2025			Site: Kyrene District Office and Bus Barn (Bldg. T)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60-PLM-12	5	Multicolor Carpet Square	Southwest - Office 06	Convenient	None Detected
	6	Yellow Mastic for Multicolor Carpet Square		Convenient	None Detected
AZ1418.60-PLM-13	7	Floor Expansion Joint	Center - Corridor 03	Convenient	None Detected
AZ1418.60-PLM-14		Floor Expansion Joint	South - Corridor 03	Convenient	None Detected
AZ1418.60-PLM-15		Floor Expansion Joint	Southeast - Bay 01	Convenient	None Detected
AZ1418.60-PLM-16	8	Skip Trowel Drywall - Tan Paint	Northwest - Lounge	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-17		Skip Trowel - Tan Paint	Northwest - Lounge	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-18		Skip Trowel - Tan Paint	Northwest - Lounge	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-19	9	Concrete	Center - Corridor 03	Convenient	None Detected
AZ1418.60-PLM-20		Concrete	South - Corridor 03	Convenient	None Detected
AZ1418.60-PLM-21		Concrete	Southeast - Bay 01	Convenient	None Detected
AZ1418.60-PLM-22	10	Black Cove Base	South - Bay 01	Convenient	None Detected
	11	Brown Mastic for Black Cove Base		Convenient	None Detected
AZ1418.60-PLM-23	10	Black Cove Base	North - Bay 02	Convenient	None Detected
	11	Brown Mastic for Black Cove Base		Convenient	None Detected
AZ1418.60-PLM-24	10	Black Cove Base	Northwest - Bay 03	Convenient	None Detected
	11	Brown Mastic for Black Cove Base		Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/2/2025			Site: Kyrene District Office and Bus Barn (Bldg. T)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60-PLM-25	12	Brown Cove Base	Northeast - Bay 01	Convenient	None Detected
	13	Yellow Mastic for Brown Cove Base		Convenient	None Detected
AZ1418.60-PLM-26	12	Brown Cove Base	Northeast - Bay 01	Convenient	None Detected
	13	Yellow Mastic for Brown Cove Base		Convenient	None Detected
AZ1418.60-PLM-27	12	Brown Cove Base	Northeast - Bay 01	Convenient	None Detected
	13	Yellow Mastic for Brown Cove Base		Convenient	None Detected
AZ1418.60-PLM-28	14	Interior Frame Caulking	Northeast - Bay 03	Convenient	None Detected
AZ1418.60-PLM-29		Interior Frame Caulking	Northeast - Bay 05	Convenient	None Detected
AZ1418.60-PLM-30		Interior Frame Caulking	Northeast - Bay 06	Convenient	None Detected

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11 + AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 3/11/24 + 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. W)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 10/3/2025 - AHERA Building Inspector: Tracey Carpenter (ON-188748-14588-082525)					
AZ1418.11-PLM-1	1	Popcorn Ceiling Drywall System - Popcorn Texture	Warehouse - Northeast - Section - North	Convenient	None Detected
		Tape		Convenient	None Detected
		Joint Compound		Convenient	None Detected
		Drywall		Convenient	None Detected
AZ1418.11-PLM-1	1	Popcorn Ceiling Drywall System - Popcorn Texture	Warehouse - Northeast - Section - East	Convenient	None Detected
		Tape		Convenient	None Detected
		Joint Compound		Convenient	None Detected
		Drywall		Convenient	None Detected
AZ1418.11-PLM-1	1	Popcorn Ceiling Drywall System - Popcorn Texture	Warehouse - Northeast - Section - Center	Convenient	None Detected
		Tape		Convenient	None Detected
		Joint Compound		Convenient	None Detected
		Drywall		Convenient	None Detected
Sample Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)					
AZ1418.60-PLM-1	2	Orange Peel Drywall - Light Gray Paint	Southwest - Lobby	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-2		Orange Peel Drywall - Light Gray Paint	Northwest - Tellers	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-3	Orange Peel Drywall - Light Gray Paint	Southwest - Open Office	Convenient	None Detected	
	White Texture		Convenient	None Detected	
	Cream Tape		Convenient	None Detected	
	White Joint Compound		Convenient	None Detected	
	White Drywall with Brown Paper		Convenient	None Detected	

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11 + AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 3/11/24 + 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. W)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60-PLM-4	3	2' x 2' Ceiling Tile	North - Lobby	Convenient	None Detected
AZ1418.60-PLM-5		2' x 2' Ceiling Tile	North - Lobby	Convenient	None Detected
AZ1418.60-PLM-6		2' x 2' Ceiling Tile	North - Lobby	Convenient	None Detected
AZ1418.60-PLM-7	4	2' x 4' Ceiling Tile	North - Open Office	Convenient	None Detected
AZ1418.60-PLM-8		2' x 4' Ceiling Tile	North - Open Office	Convenient	None Detected
AZ1418.60-PLM-9		2' x 4' Ceiling Tile	North - Open Office	Convenient	None Detected
AZ1418.60-PLM-10	5	Brown Cove Base	Southwest - Office 03	Convenient	None Detected
	6	Tan Mastic for Brown Cove Base		Convenient	None Detected
	7	Brown Mastic for Brown Cove Base		Convenient	None Detected
AZ1418.60-PLM-11	5	Brown Cove Base	Southwest - Server Room	Convenient	None Detected
	6	Tan Mastic for Cove Base		Convenient	None Detected
	7	Brown Mastic for Cove Base		Convenient	None Detected
AZ1418.60-PLM-12	5	Brown Cove Base	Southeast - Storage 01	Convenient	None Detected
	6	Tan Mastic for Cove Base		Convenient	None Detected
	7	Brown Mastic for Cove Base		Convenient	None Detected
AZ1418.60-PLM-13	8	Heavy Texture Drywall - Beige Paint	Northeast - Warehouse 02	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-14		Heavy Texture Drywall - Beige Paint	Northwest - Warehouse 02	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-15		Heavy Texture Drywall - Beige Paint	Northwest - Warehouse 01	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11 + AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 3/11/24 + 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. W)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60-PLM-16	9	White Popcorn Ceiling	Northwest - Warehouse 02	Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-17	9	White Popcorn Ceiling	Northwest - Warehouse 02	Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-18	9	White Popcorn Ceiling	Northwest - Warehouse 02	Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-19	10	Gray Duct Mastic	Southeast - Open Office	Convenient	None Detected
AZ1418.60-PLM-20		Gray Duct Mastic	South - Warehouse 02	Convenient	None Detected
AZ1418.60-PLM-21		Gray Duct Mastic	Southwest - Clerical Office	Convenient	None Detected
AZ1418.60-PLM-22	11	Silver Flex Duct Wrap	Southeast - Open Office	Convenient	None Detected
	12	Pink Insulation for Silver Flex Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-23	11	Silver Flex Duct Wrap	South - Warehouse 02	Convenient	None Detected
	12	Pink Insulation for Silver Flex Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-24	11	Silver Flex Duct Wrap	Southwest - Clerical Office	Convenient	None Detected
	12	Pink Insulation for Silver Flex Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-25	13	Silver Duct Wrap	Southeast - Open Office	Convenient	None Detected
	14	Yellow Insulation for Silver Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-26	13	Silver Duct Wrap	South - Warehouse 02	Convenient	None Detected
	14	Yellow Insulation for Silver Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-27	13	Silver Duct Wrap	Southwest - Clerical Office	Convenient	None Detected
	14	Yellow Insulation for Silver Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-28	15	Pink Batt Insulation	Southeast - Open Office	Convenient	None Detected
AZ1418.60-PLM-29		Pink Batt Insulation	South - Warehouse 02	Convenient	None Detected
AZ1418.60-PLM-30		Pink Batt Insulation	Southwest - Clerical Office	Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

SECTION 6



PLM BULK
SAMPLE SHEETS

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. A)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)					
AZ1418.60- PLM-1	1	Orange Peel Drywall - Off-White Paint	Northeast - Elevator Equipment Room	Convenient	None Detected
		White Texture			
		White Paint			
		White Compound			
		Cream Tape			
		White Joint Compound			
		White Drywall with Brown Paper			
AZ1418.60- PLM-2	1	Orange Peel Drywall - Off-White Paint	East - Elec. 01	Convenient	None Detected
		White Texture			
		Cream Tape			
		White Joint Compound			
	1	White Drywall with Brown Paper	South - Storage Room 04 (Second Floor)	Convenient	None Detected
AZ1418.60- PLM-3		Orange Peel Drywall - Off-White Paint			
		White Texture			
		Cream Tape			
		White Joint Compound			
		White Drywall with Brown Paper			
AZ1418.60- PLM-4	2	White Fixture Caulking	North - Men's Restroom	Convenient	None Detected
AZ1418.60- PLM-5		White Fixture Caulking	South - Men's Restroom	Convenient	None Detected
AZ1418.60- PLM-6		White Fixture Caulking	South - Women's Restroom	Convenient	None Detected
AZ1418.60- PLM-7	3	Black Window Glazing	West - Hallway 03 (First Floor)	Convenient	None Detected
AZ1418.60- PLM-8		Black Window Glazing	West - Hallway 07 (Second Floor)	Convenient	None Detected
AZ1418.60- PLM-9		Black Window Glazing	East - Hallway 07 (Second Floor)	Convenient	None Detected
AZ1418.60- PLM-10	4	Brown Linoleum	West - Breakout 04 (Second Floor)	Convenient	None Detected
	5	Yellow Mastic for Brown Linoleum		Convenient	None Detected
AZ1418.60- PLM-11	4	Brown Linoleum	South - Reception (First Floor)	Convenient	None Detected
	5	Yellow Mastic for Brown Linoleum		Convenient	None Detected
AZ1418.60- PLM-12	4	Brown Linoleum	West - Breakout 04 (Second Floor)	Convenient	None Detected
	5	Yellow Mastic for Brown Linoleum		Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. A)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60- PLM-13	6	Gray Multicolor Carpet	Center - Hallway 05 (First Floor)	Convenient	None Detected
	7	Yellow Mastic for Gray Multicolor Carpet		Convenient	None Detected
AZ1418.60- PLM-14	6	Gray Multicolor Carpet	Center - Hallway 07 (Second Floor)	Convenient	None Detected
	7	Yellow Mastic for Gray Multicolor Carpet		Convenient	None Detected
AZ1418.60- PLM-15	6	Gray Multicolor Carpet	South - Open Office 08	Convenient	None Detected
	7	Yellow Mastic for Gray Multicolor Carpet		Convenient	None Detected
AZ1418.60- PLM-16	8	Dark Gray Multicolor Carpet	West - Training Room	Convenient	None Detected
	9	Yellow Mastic for Dark Gray Multicolor Carpet		Convenient	None Detected
AZ1418.60- PLM-17	8	Dark Gray Multicolor Carpet	Center - Training Room	Convenient	None Detected
	9	Yellow Mastic for Dark Gray Multicolor Carpet		Convenient	None Detected
AZ1418.60- PLM-18	8	Dark Gray Multicolor Carpet	East - Training Room	Convenient	None Detected
	9	Yellow Mastic for Dark Gray Multicolor Carpet		Convenient	None Detected
AZ1418.60- PLM-19	10	Gray Cove Base	Southwest - Hallway (First Floor)	Convenient	None Detected
	11	Cream Mastic for Cove Base		Convenient	None Detected
AZ1418.60- PLM-20	10	Gray Cove Base	Southwest - Lounge (First Floor)	Convenient	None Detected
	11	Cream Mastic for Cove Base		Convenient	None Detected
AZ1418.60- PLM-21	10	Gray Cove Base	Northwest - Open Office 05 (Second Floor)	Convenient	None Detected
	11	Cream Mastic for Cove Base		Convenient	None Detected
AZ1418.60- PLM-22	12	Light Gray Interior Caulking	Northeast - Training Room	Convenient	None Detected
AZ1418.60- PLM-23		Light Gray Interior Caulking	Northwest - Training Room	Convenient	None Detected
AZ1418.60- PLM-24		Light Gray Interior Caulking	Center - Hallway 05 (First Floor)	Convenient	None Detected
AZ1418.60- PLM-25	13	Gray Interior Caulking	West - Waiting (Second Floor)	Convenient	None Detected
AZ1418.60- PLM-26		Gray Interior Caulking	West - Waiting (Second Floor)	Convenient	None Detected
AZ1418.60- PLM-27		Gray Interior Caulking	West - Waiting (Second Floor)	Convenient	None Detected
AZ1418.60- PLM-28	14	2' x 2' Ceiling Tile	East - Training Room (Second Floor)	Convenient	None Detected
AZ1418.60- PLM-29		2' x 2' Ceiling Tile	North - Superintendent Office (Second Floor)	Convenient	None Detected
AZ1418.60- PLM-30		2' x 2' Ceiling Tile	Southwest - Board Room (1st Floor)	Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: KESD		
Sample Date(s): 10/2/2025			Site: Kyrene District Office and Bus Barn (Bldg. B)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 10/2/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)					
AZ1418.60-PLM-1	1	1' x 1' Tan Ceiling Tile with White Surface	I.T. Room - Northwest	Convenient	None Detected
	2	Brown Mastic for 1' x 1' Tan Ceiling Tile		Convenient	None Detected
AZ1418.60-PLM-2	1	1' x 1' Tan Ceiling Tile with White Surface	I.T. Room - Southwest	Convenient	None Detected
	2	Brown Mastic for 1' x 1' Tan Ceiling Tile		Convenient	None Detected
AZ1418.60-PLM-3	1	1' x 1' Tan Ceiling Tile with White Surface	I.T. Room - Southeast	Convenient	None Detected
	2	Brown Mastic for 1' x 1' Tan Ceiling Tile		Convenient	None Detected
AZ1418.60-PLM-4	3	Old Orange Peel Drywall System - Off-White Paint	Northwest - Server Room	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-5		Old Orange Peel Drywall System - Off-White Paint	Northeast - Sever Room	Convenient	None Detected
		White Texture		Convenient	None Detected
		White Paint		Convenient	None Detected
		White Texture 2		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
AZ1418.60-PLM-6		White Drywall with Brown Paper	Southeast - Server Room	Convenient	None Detected
		Old Orange Peel Drywall System - Off-White Paint		Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
AZ1418.60-PLM-7		4	Tan Vinyl Floor Tile (VCT)	Southwest - I.T. Room	Convenient
	5	Black Mastic for Tan Vinyl Floor Tile (VCT)	Convenient		None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: KESD		
Sample Date(s): 10/2/2025			Site: Kyrene District Office and Bus Barn (Bldg. B)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60-PLM-8	4	Tan Vinyl Floor Tile (VCT)	Southeast - I.T. Room	Convenient	None Detected
	5	Black Mastic for Tan Vinyl Floor Tile (VCT)		Convenient	None Detected
AZ1418.60-PLM-9	4	Tan Vinyl Floor Tile (VCT)	Northeast - I.T. Room	Convenient	None Detected
	5	Black Mastic for Tan Vinyl Floor Tile (VCT)		Convenient	None Detected
AZ1418.60-PLM-10	6	Gray Vinyl Floor Tile (VCT)	Southeast - Server Room	Convenient	None Detected
	7	Black Mastic for Gray Vinyl Floor Tile (VCT)		Convenient	None Detected
AZ1418.60-PLM-11	6	Gray Vinyl Floor Tile (VCT)	Southwest - Server Room	Convenient	None Detected
	7	Black Mastic for Gray Vinyl Floor Tile (VCT)		Convenient	None Detected
AZ1418.60-PLM-12	6	Gray Vinyl Floor Tile (VCT)	Northeast - Sever Room	Convenient	None Detected
	7	Black Mastic for Gray Vinyl Floor Tile (VCT)		Convenient	None Detected
AZ1418.60-PLM-13	8	Black Cove Base	Northwest - Server Room	Convenient	None Detected
	9	Off-White Mastic for Black Cove Base		Convenient	None Detected
AZ1418.60-PLM-14	8	Black Cove Base	Southwest - Server Room	Convenient	None Detected
	9	Off-White Mastic for Black Cove Base		Convenient	None Detected
AZ1418.60-PLM-15	8	Black Cove Base	Southeast - Server Room	Convenient	None Detected
	9	Off-White Mastic for Black Cove Base		Convenient	None Detected
AZ1418.60-PLM-16	10	Silver Flex Duct Wrap	Northwest - B2	Convenient	None Detected
	11	Pink Insulation for Silver Flex Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-17	10	Silver Flex Duct Wrap	Northeast - B2	Convenient	None Detected
	11	Pink Insulation for Silver Flex Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-18	10	Silver Flex Duct Wrap	Southeast - B2	Convenient	None Detected
	11	Pink Insulation for Silver Flex Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-19	12	Silver Duct Wrap	Northwest - B2	Convenient	None Detected
	13	Tan Insulation for Silver Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-20	12	Silver Duct Wrap	Northeast - B2	Convenient	None Detected
	13	Tan Insulation for Silver Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-21	12	Silver Duct Wrap	Southeast - B2	Convenient	None Detected
	13	Tan Insulation for Silver Duct Wrap		Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: KESD		
Sample Date(s): 10/2/2025			Site: Kyrene District Office and Bus Barn (Bldg. B)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60-PLM-22	14	Gray Duct Mastic	Northwest - B2	Convenient	None Detected
AZ1418.60-PLM-23		Gray Duct Mastic	Northeast - B2	Convenient	None Detected
AZ1418.60-PLM-24		Gray Duct Mastic	Southeast - B2	Convenient	None Detected
AZ1418.60-PLM-25	15	Drywall Ceiling - White Compound for Drywall	East - B2	Convenient	2% Chrysotile
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-26		Drywall Ceiling - White Compound for Drywall	Northeast - B2	Convenient	2% Chrysotile
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-27		Drywall Ceiling - White Compound for Drywall	Southwest - B2	Convenient	2% Chrysotile
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-28	16	New Orange Peel Drywall - White Paint	Northwest - I.T. Room	Convenient	None Detected
		White Texture		Convenient	None Detected
		Off-White Paint		Convenient	None Detected
		White Texture 2		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-29		New Orange Peel Drywall - White Paint	Northeast - I.T. Room	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-30		New Orange Peel Drywall - White Paint	Southeast - I.T. Room	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/2/2025			Site: Kyrene District Office and Bus Barn (Bldg. C)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 10/2/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)					
AZ1418.60-PLM-1	1	Old Orange Peel Texture Drywall - White Paint	Southeast - Room 107	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-2		Old Orange Peel Texture Drywall - White Paint	Southeast - Break Room	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-3		Old Orange Peel Texture Drywall - White Paint	Northeast - Break Room	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-4	2	Gray Cove Base	Southeast - Room 107	Convenient	None Detected
	3	Cream Mastic for Cove Base		Convenient	None Detected
AZ1418.60-PLM-5	2	Gray Cove Base	Northeast - Room 107	Convenient	None Detected
	3	Cream Mastic for Cove Base		Convenient	None Detected
AZ1418.60-PLM-6	2	Gray Cove Base	Southwest - Room 107	Convenient	None Detected
	3	Cream Mastic for Cove Base		Convenient	None Detected
AZ1418.60-PLM-7	4	Pinhole 2' X 2' Ceiling Tile	South - Break Room	Convenient	None Detected
AZ1418.60-PLM-8		Pinhole 2' X 2' Ceiling Tile	Southeast - Break Room	Convenient	None Detected
AZ1418.60-PLM-9		Pinhole 2' X 2' Ceiling Tile	North - Main Room	Convenient	None Detected
AZ1418.60-PLM-10	5	Black Window Glazing	North - Room 105	Convenient	None Detected
AZ1418.60-PLM-11		Black Window Glazing	Southeast - Main Room	Convenient	None Detected
AZ1418.60-PLM-12		Black Window Glazing	Northeast - Main Room	Convenient	None Detected
AZ1418.60-PLM-13	6	Silver Duct Insulation Backing	South - Break Room	Convenient	None Detected
	7	Yellow Insulation for Silver Duct Backing		Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/2/2025			Site: Kyrene District Office and Bus Barn (Bldg. C)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60-PLM-14	6	Silver Duct Insulation Backing	North - Break Room	Convenient	None Detected
	7	Yellow Insulation for Silver Duct Backing		Convenient	None Detected
AZ1418.60-PLM-15	6	Silver Duct Insulation Backing	Center - Main Room	Convenient	None Detected
	7	Yellow Insulation for Silver Duct Backing		Convenient	None Detected
AZ1418.60-PLM-16	8	Silver Flex Duct Backing	North - Break Room	Convenient	None Detected
	9	Pink Insulation for Silver Flex Duct Backing		Convenient	None Detected
AZ1418.60-PLM-17	8	Silver Flex Duct Backing	Center - Main Room	Convenient	None Detected
	9	Pink Insulation for Silver Flex Duct Backing		Convenient	None Detected
AZ1418.60-PLM-18	8	Silver Flex Duct Backing	North - Break Room	Convenient	None Detected
	9	Pink Insulation for Silver Flex Duct Backing		Convenient	None Detected
AZ1418.60-PLM-19	10	White Batt Insulation	North - Break Room	Convenient	None Detected
AZ1418.60-PLM-20		White Batt Insulation	West - Main Room	Convenient	None Detected
AZ1418.60-PLM-21		White Batt Insulation	North - Main Room	Convenient	None Detected

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/2/2025			Site: Kyrene District Office and Bus Barn (Bldg. D)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 10/2/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)					
AZ1418.60-PLM-1	1	Old Orange Peel Drywall - Off-White Paint	Southeast - Closet	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-2		Old Orange Peel Drywall - Off-White Paint	Southeast - Closet	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-3		Old Orange Peel Drywall - Off-White Paint	Northeast - Closet	Convenient	None Detected
		White Texture		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-4	2	Blue Cove Base	Northwest - Closet	Convenient	None Detected
	3	Cream Mastic for Cove Base		Convenient	None Detected
AZ1418.60-PLM-5	2	Blue Cove Base	Southwest - Closet	Convenient	None Detected
	3	Cream Mastic for Cove Base		Convenient	None Detected
AZ1418.60-PLM-6	2	Blue Cove Base	Southeast - Closet	Convenient	None Detected
	3	Cream Mastic for Cove Base		Convenient	None Detected
AZ1418.60-PLM-7	4	2 x 2 Ceiling Tile	North - Closet	Convenient	None Detected
AZ1418.60-PLM-8		2 x 2 Ceiling Tile	Southeast - Main Room	Convenient	None Detected
AZ1418.60-PLM-9		2 x 2 Ceiling Tile	Southwest - Main Room	Convenient	None Detected
AZ1418.60-PLM-10	5	Silver Flex Duct Wrap	North - Closet	Convenient	None Detected
	6	Pink Insulation for Silver Flex Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-11	5	Silver Flex Duct Wrap	Southeast - Main Room	Convenient	None Detected
	6	Pink Insulation for Silver Flex Duct Wrap		Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/2/2025			Site: Kyrene District Office and Bus Barn (Bldg. D)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60-PLM-12	5	Silver Flex Duct Wrap	South - Main Room	Convenient	None Detected
	6	Pink Insulation for Silver Flex Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-13	7	1 x 1 Ceiling Tile	Southeast - Main Room	Convenient	None Detected
	8	Brown Mastic for 1 x 1 Ceiling Tile		Convenient	None Detected
AZ1418.60-PLM-14	7	1 x 1 Ceiling Tile	Northeast - Main Room	Convenient	None Detected
	8	Brown Mastic for 1 x 1 Ceiling Tile		Convenient	None Detected
AZ1418.60-PLM-15	7	1 x 1 Ceiling Tile	Southwest - Main Room	Convenient	None Detected
	8	Brown Mastic for 1 x 1 Ceiling Tile		Convenient	None Detected

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11 + AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 3/11/2024 + 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. E)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 3/11/2024- AHERA Building Inspector: Tracey Carpenter (ON-188748-14588-082525)					
AZ1418.11- PLM-1	1	Light Blue 12" x 12" VCT	Data Processing Entry - North	Convenient	None Detected
	2	Tan Mastic for Light Blue 12" x 12" VCT		Convenient	None Detected
AZ1418.11- PLM-2	1	Light Blue 12" x 12" VCT	Data Processing Entry - Center	Convenient	None Detected
	2	Tan Mastic for Light Blue 12" x 12" VCT		Convenient	None Detected
AZ1418.11- PLM-3	1	Light Blue 12" x 12" VCT	Data Processing Entry - South	Convenient	None Detected
	2	Tan Mastic for Light Blue 12" x 12" VCT		Convenient	None Detected
AZ1418.11- PLM-4	3	Dark Blue 12" x 12" VCT	Print Shop Storage/Entry- North	Convenient	None Detected
	4	Tan Mastic for Dark Blue 12" x 12" VCT		Convenient	None Detected
AZ1418.11- PLM-5	3	Dark Blue 12" x 12" VCT	Print Shop Storage/Entry- Center	Convenient	None Detected
	4	Tan Mastic for Dark Blue 12" x 12" VCT		Convenient	None Detected
AZ1418.11- PLM-6	3	Dark Blue 12" x 12" VCT	Print Shop Storage/Entry- South	Convenient	None Detected
	4	Tan Mastic for Dark Blue 12" x 12" VCT		Convenient	None Detected
AZ1418.11- PLM-7	5	Blue Cove Base	Print Shop Storage - South	Convenient	None Detected
	6	Brown/Beige Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.11- PLM-8	5	Blue Cove Base	Unisex Restroom - Northeast	Convenient	None Detected
	6	Brown/Beige Mastic for Blue Cove Base		Convenient	None Detected
AZ1418.11- PLM-9	5	Blue Cove Base	Unisex Restroom - East	Convenient	None Detected
	6	Brown/Beige Mastic for Blue Cove Base		Convenient	None Detected
Sample Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)					
AZ1418.60- PLM-1	7	Orange Peel Drywall - White Paint	Southwest - Storage	Convenient	None Detected
		White Texture		Convenient	None Detected
		Yellow Tape (Mesh)		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60- PLM-2	7	Orange Peel Drywall - White Paint	Southwest - Print Shop	Convenient	None Detected
		White Texture		Convenient	None Detected
		Yellow Tape (Mesh)		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11 + AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 3/11/2024 + 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. E)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60- PLM-3	7	Orange Peel Drywall - White Paint	Northwest - Print Shop	Convenient	None Detected
		White Texture		Convenient	None Detected
		Yellow Tape (Mesh)		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60- PLM-4	8	Dark Blue VCT	East - Unisex Restroom	Convenient	None Detected
	9	Yellow Mastic for Dark Blue VCT		Convenient	None Detected
AZ1418.60- PLM-5	8	Dark Blue VCT	East - Unisex Restroom	Convenient	None Detected
	9	Yellow Mastic for Dark Blue VCT		Convenient	None Detected
AZ1418.60- PLM-6	8	Dark Blue VCT	East - Unisex Restroom	Convenient	None Detected
	9	Yellow Mastic for Dark Blue VCT		Convenient	None Detected
AZ1418.60- PLM-7	10	Green VCT	Northeast - Print Shop	Convenient	None Detected
	11	Yellow Mastic for Green VCT		Convenient	None Detected
AZ1418.60- PLM-8	10	Green VCT	South - Print Shop	Convenient	None Detected
	11	Yellow Mastic for Green VCT		Convenient	None Detected
AZ1418.60- PLM-9	10	Green VCT	North - Print Shop	Convenient	None Detected
	11	Yellow Mastic for Green VCT		Convenient	None Detected
AZ1418.60- PLM-10	12	Ceiling Tile	Northeast - Print Shop	Convenient	None Detected
AZ1418.60- PLM-11		Ceiling Tile	Center - Print Shop	Convenient	None Detected
AZ1418.60- PLM-12		Ceiling Tile	North - Print Shop	Convenient	None Detected
AZ1418.60- PLM-13	13	Replacement Ceiling Tile	Southwest - Print Shop	Convenient	None Detected
AZ1418.60- PLM-14		Replacement Ceiling Tile	Southwest - Print Shop	Convenient	None Detected
AZ1418.60- PLM-15		Replacement Ceiling Tile	Southwest - Print Shop	Convenient	None Detected
AZ1418.60- PLM-16	14	Dark Blue Cove Base	Southeast - Storage	Convenient	None Detected
	15	Brown Mastic for Dark Blue Cove Base		Convenient	None Detected
AZ1418.60- PLM-17	14	Dark Blue Cove Base	Northeast - Data Processing	Convenient	None Detected
	15	Brown Mastic for Dark Blue Cove Base		Convenient	None Detected
AZ1418.60- PLM-18	14	Dark Blue Cove Base	Southeast - Data Processing	Convenient	None Detected
	15	Brown Mastic for Dark Blue Cove Base		Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11 + AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 3/11/2024 + 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. E)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60- PLM-19	16	Light Green VCT	South - Print Shop	Convenient	None Detected
	17	Tan Mastic for Light Green VCT		Convenient	None Detected
AZ1418.60- PLM-20	16	Light Green VCT	South - Print Shop	Convenient	None Detected
	17	Tan Mastic for Light Green VCT		Convenient	None Detected
AZ1418.60- PLM-21	16	Light Green VCT	Northeast - Data Processing	Convenient	None Detected
	17	Tan Mastic for Light Green VCT		Convenient	None Detected
AZ1418.60- PLM-22	18	Black Cove Base	Southwest - Office	Convenient	None Detected
	19	Cream Mastic for Black Cove Base		Convenient	None Detected
AZ1418.60- PLM-23	18	Black Cove Base	Southwest - Office	Convenient	None Detected
	19	Cream Mastic for Black Cove Base		Convenient	None Detected
AZ1418.60- PLM-24	18	Black Cove Base	Southwest - Office	Convenient	None Detected
	19	Cream Mastic for Black Cove Base		Convenient	None Detected

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. F)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)					
AZ1418.60- PLM-1	1	Concrete Foundation	Southwest - Building	Convenient	None Detected
AZ1418.60- PLM-2		Concrete Foundation	Southeast - Building	Convenient	None Detected
AZ1418.60- PLM-3		Concrete Foundation	Northeast - Building	Convenient	None Detected
AZ1418.60- PLM-4	2	Black Window Glazing	Southwest - Building	Convenient	None Detected
AZ1418.60- PLM-5		Black Window Glazing	Southwest - Building	Convenient	None Detected
AZ1418.60- PLM-6		Black Window Glazing	West - Building	Convenient	None Detected
AZ1418.60- PLM-7	3	Interior Frame Caulking	Southeast - Building	Convenient	None Detected
AZ1418.60- PLM-8		Interior Frame Caulking	Southeast - Building	Convenient	None Detected
AZ1418.60- PLM-9		Interior Frame Caulking	Southeast - Building	Convenient	None Detected
AZ1418.60- PLM-10	4	Orange Peel Drywall - Cream Paint	South - Building	Convenient	None Detected
		White Texture		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60- PLM-11		Orange Peel Drywall - Cream Paint	South - Building	Convenient	None Detected
		White Texture		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60- PLM-12		Orange Peel Drywall - Cream Paint	South - Building	Convenient	None Detected
		White Texture		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60- PLM-13		5	Brown Cove Base	Southeast - Building	Convenient
	6	Cream Mastic for Brown Cove Base	Convenient		None Detected
AZ1418.60- PLM-14	5	Brown Cove Base	South - Building	Convenient	None Detected
	6	Cream Mastic for Brown Cove Base		Convenient	None Detected
AZ1418.60- PLM-15	5	Brown Cove Base	South - Building	Convenient	None Detected
	6	Cream Mastic for Brown Cove Base		Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11 + AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 3/11/24 + 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. G)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
Sample Date: 3/11/2024 - AHERA Building Inspector: Tracey Carpenter (ON-188748-14588-082525)					
AZ1418.11-PLM-1	1	Brown Cove Base	Office - Southwest	Convenient	None Detected
	2	Tan Mastic for Brown Cove Base		Convenient	None Detected
AZ1418.11-PLM-2	1	Brown Cove Base	Office - North	Convenient	None Detected
	2	Tan Mastic for Brown Cove Base		Convenient	None Detected
AZ1418.11-PLM-3	1	Brown Cove Base	Office - Southeast	Convenient	None Detected
	2	Tan Mastic for Brown Cove Base		Convenient	None Detected
AZ1418.11-PLM-4	3	Green Artificial Turf Carpet	Office - Southwest	Convenient	None Detected
	4	Tan Mastic for Green Artificial Turf Carpet		Convenient	None Detected
AZ1418.11-PLM-5	3	Green Artificial Turf Carpet	Office - North	Convenient	None Detected
	4	Tan Mastic for Green Artificial Turf Carpet		Convenient	None Detected
AZ1418.11-PLM-6	3	Green Artificial Turf Carpet	Office - Southeast	Convenient	None Detected
	4	Tan Mastic for Green Artificial Turf Carpet		Convenient	None Detected
AZ1418.11-PLM-7	5	Tan 12" x 12" VCT	Shop - Southwest	Convenient	None Detected
	6	Yellow Mastic for Tan 12" x 12" VCT		Convenient	None Detected
AZ1418.11-PLM-8	5	Tan 12" x 12" VCT	Shop - Northwest	Convenient	None Detected
	6	Yellow Mastic for Tan 12" x 12" VCT		Convenient	None Detected
AZ1418.11-PLM-9	5	Tan 12" x 12" VCT	Shop - South	Convenient	None Detected
	6	Yellow Mastic for Tan 12" x 12" VCT		Convenient	None Detected
AZ1418.11-PLM-10	7	Gray Concrete	Storage Entryway - South	Convenient	None Detected
AZ1418.11-PLM-11		Gray Concrete	Storage Entryway - Center	Convenient	None Detected
AZ1418.11-PLM-12		Gray Concrete	Storage Entryway - North	Convenient	None Detected
Sample Date: 10/3/2025 - AHERA Building Inspector: Chase Kirby (4380-19987-030525)					
AZ1418.60-PLM-1	1	Gray Cove Base	Southeast - Storage Room 1	Convenient	None Detected
	2	Off-White Mastic for Gray Cove Base		Convenient	None Detected
AZ1418.60-PLM-2	1	Gray Cove Base	East - Storage Room 1	Convenient	None Detected
	2	Off-White Mastic for Gray Cove Base		Convenient	None Detected
AZ1418.60-PLM-3	1	Gray Cove Base	Southeast - Office	Convenient	None Detected
	2	Off-White Mastic for Gray Cove Base		Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary

Dominion Project Number(s): AZ1418.11 + AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 3/11/24 + 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. G)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60-PLM-4	3	Orange Peel Drywall - White Paint	Southeast - Office	Convenient	None Detected
		White Texture		Convenient	None Detected
		Off-White Paint		Convenient	None Detected
		White Texture 2		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-5	4	Orange Peel Drywall - White Paint	Southwest - Office	Convenient	None Detected
		White Texture		Convenient	None Detected
		Off-White Paint		Convenient	None Detected
		White Texture 2		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-6	5	Orange Peel Drywall - White Paint	Northwest - Office	Convenient	None Detected
		White Texture		Convenient	None Detected
		Off-White Paint		Convenient	None Detected
		White Texture 2		Convenient	None Detected
		Cream Tape		Convenient	None Detected
		White Joint Compound		Convenient	None Detected
		White Drywall with Brown Paper		Convenient	None Detected
AZ1418.60-PLM-7	6	Blue Multicolor Carpet Square	Northwest - Office	Convenient	None Detected
	7	Multicolored Mastic for Blue Multicolor Carpet Square		Convenient	None Detected
AZ1418.60-PLM-8	6	Blue Multicolor Carpet Square	West - Storage Room 1	Convenient	None Detected
	7	Multicolored Mastic for Blue Multicolor Carpet Square		Convenient	None Detected
AZ1418.60-PLM-9	6	Blue Multicolor Carpet Square	Northeast - Office	Convenient	None Detected
	7	Multicolored Mastic for Blue Multicolor Carpet Square		Convenient	None Detected
AZ1418.60-PLM-10	8	Box Duct Insulation Wrap	West - Storage Room 2	Convenient	None Detected
	9	Off-White Insulation for Box Duct Wrap		Convenient	None Detected

Inspector: Chase Kirby
Certificate Number: 4380-19987-030525
State: Arizona

Dominion Environmental Consultants, Inc.
AHERA PLM Bulk Sample Summary


Dominion Project Number(s): AZ1418.11 + AZ1418.60			Client: Kyrene Elementary School District No. 28		
Sample Date(s): 3/11/24 + 10/3/2025			Site: Kyrene District Office and Bus Barn (Bldg. G)		
Sample Number	HM#	Material Description	Sample Location	Manner of Sampling	Asbestos Content
AZ1418.60-PLM-11	8	Box Duct Insulation Wrap	West - Storage Room 2	Convenient	None Detected
	9	Off-White Insulation for Box Duct Wrap		Convenient	None Detected
AZ1418.60-PLM-12	8	Box Duct Insulation Wrap	West - Storage Room 2	Convenient	None Detected
	9	Off-White Insulation for Box Duct Wrap		Convenient	None Detected

SECTION 7



PLM BULK SAMPLE LOCATION MAPS

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

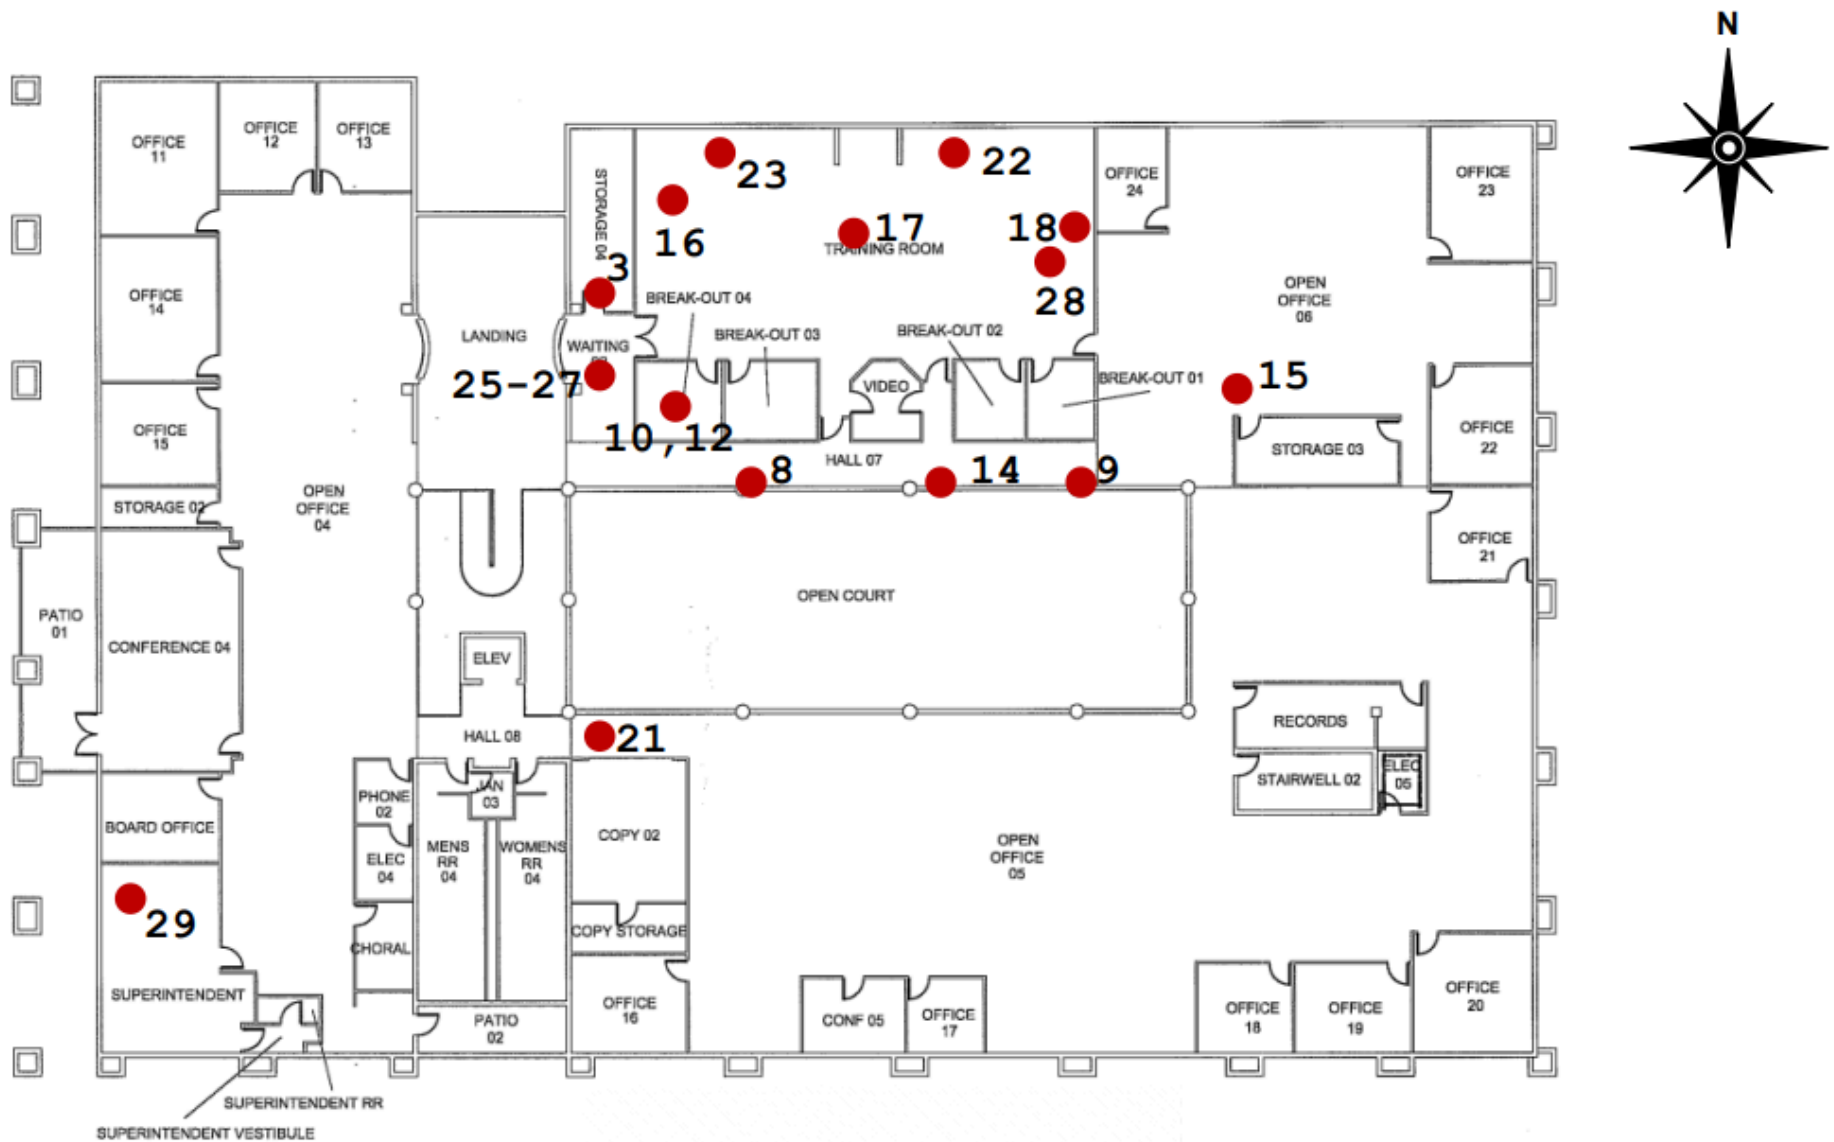

Sample Date(s) :



● October 3, 2025

PLM Bulk Sample Location Map (2)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60


Building A - Second Floor

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

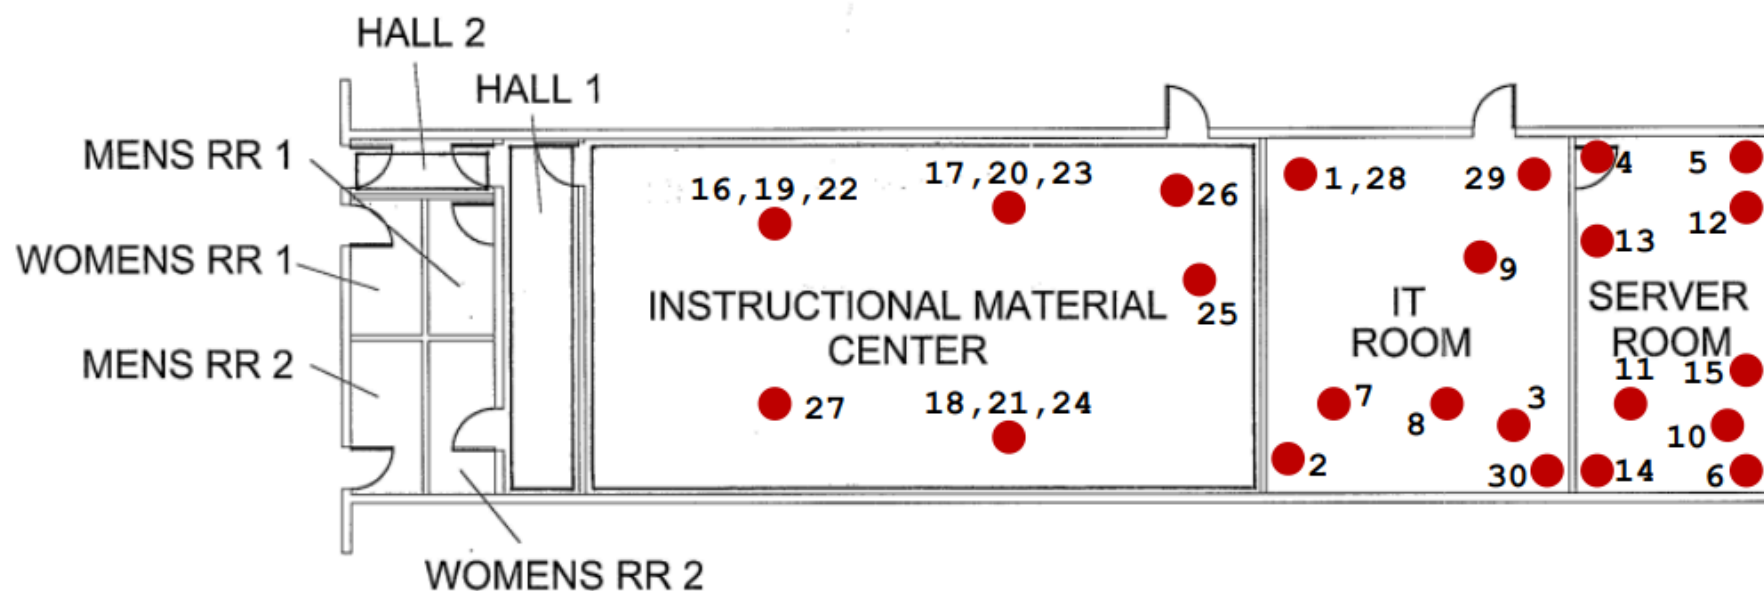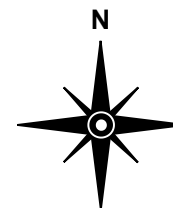

Sample Date(s) :

● October 2, 2025


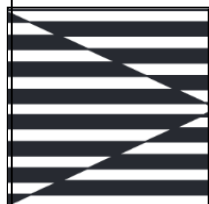


PLM Bulk Sample Location Map
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60


Building B

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

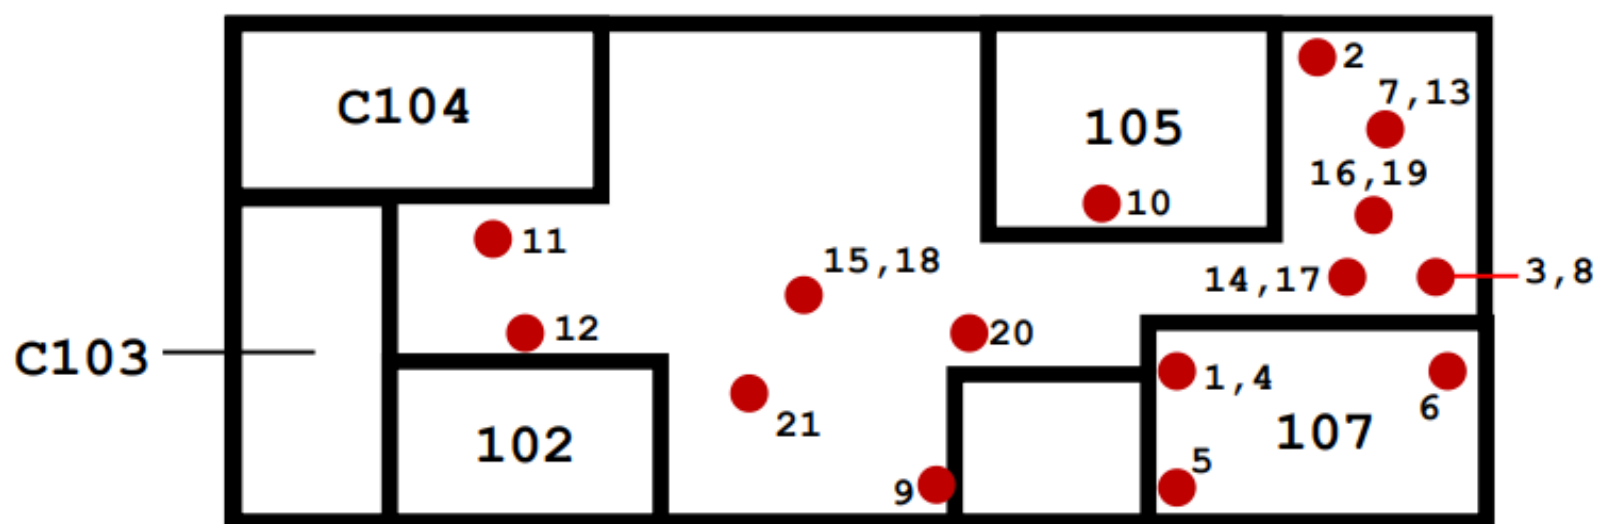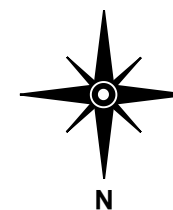

Sample Date(s) :

● October 2, 2025


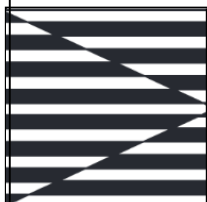


PLM Bulk Sample Location Map
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60


Building C

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

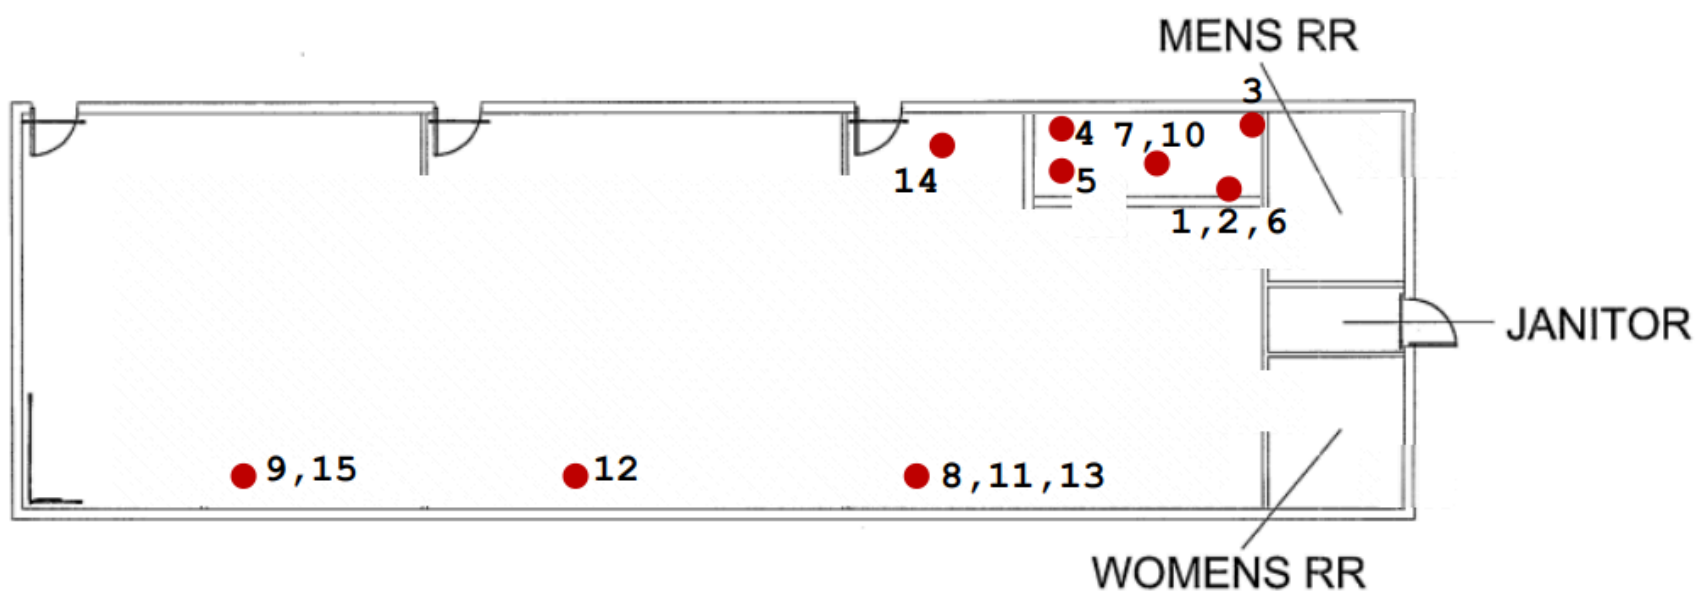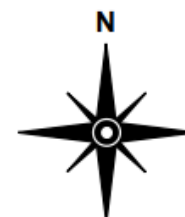

Sample Date(s) :

● October 2, 2025


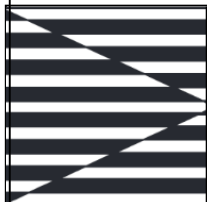


PLM Bulk Sample Location Map
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building D

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

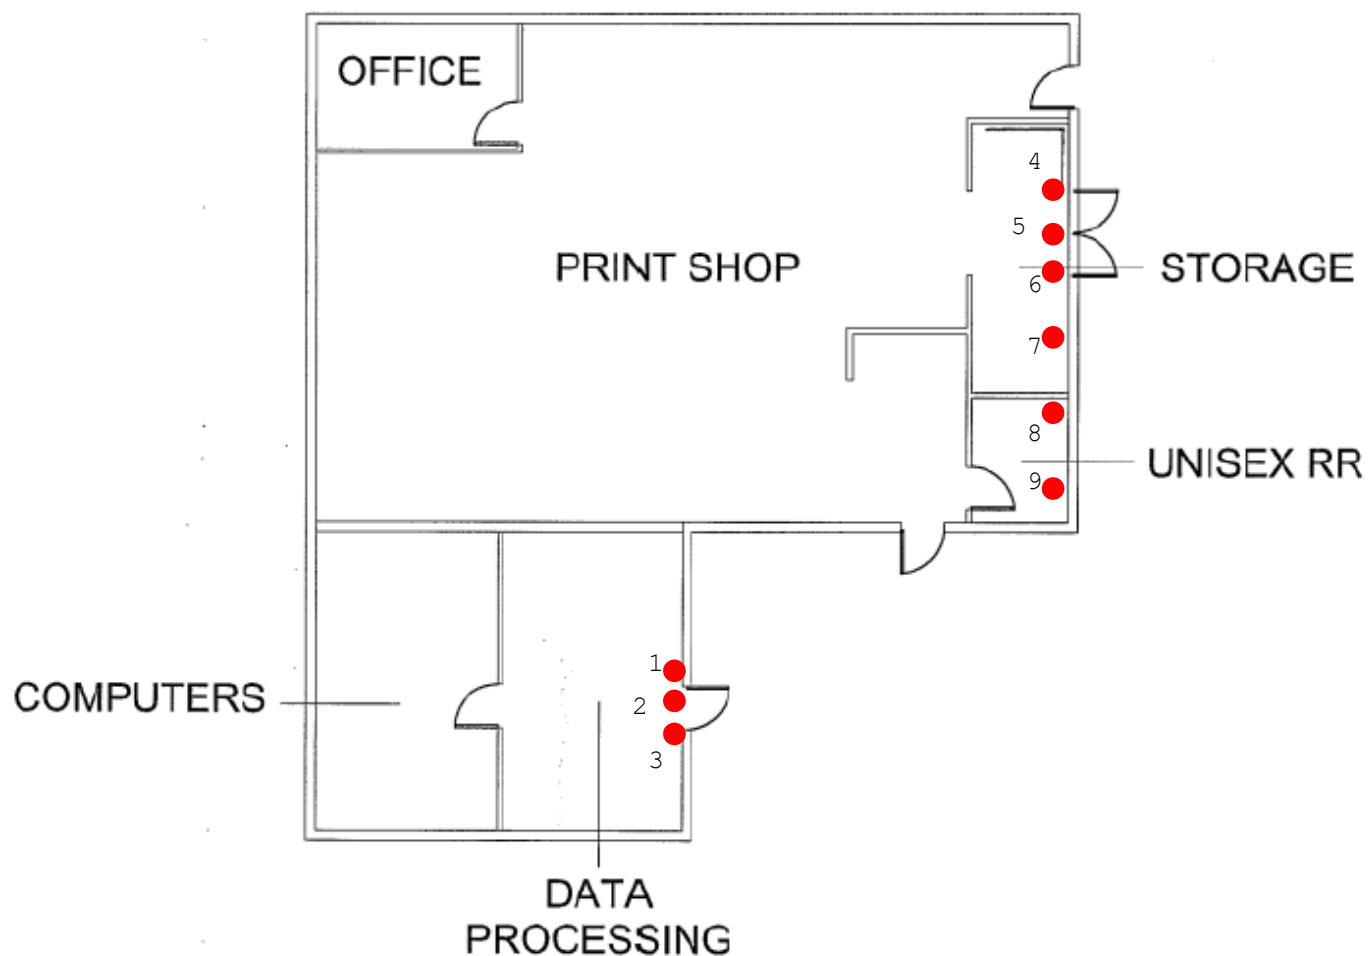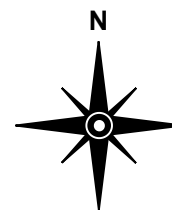


● Sample Date: March 11, 2024

PLM Bulk Sample Location Map (1 of 2)
Kyrene District Office and Bus Barn
8700 S. Kyrene Rd., Tempe, AZ 85284

Project No. AZ1418.11


Building E

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

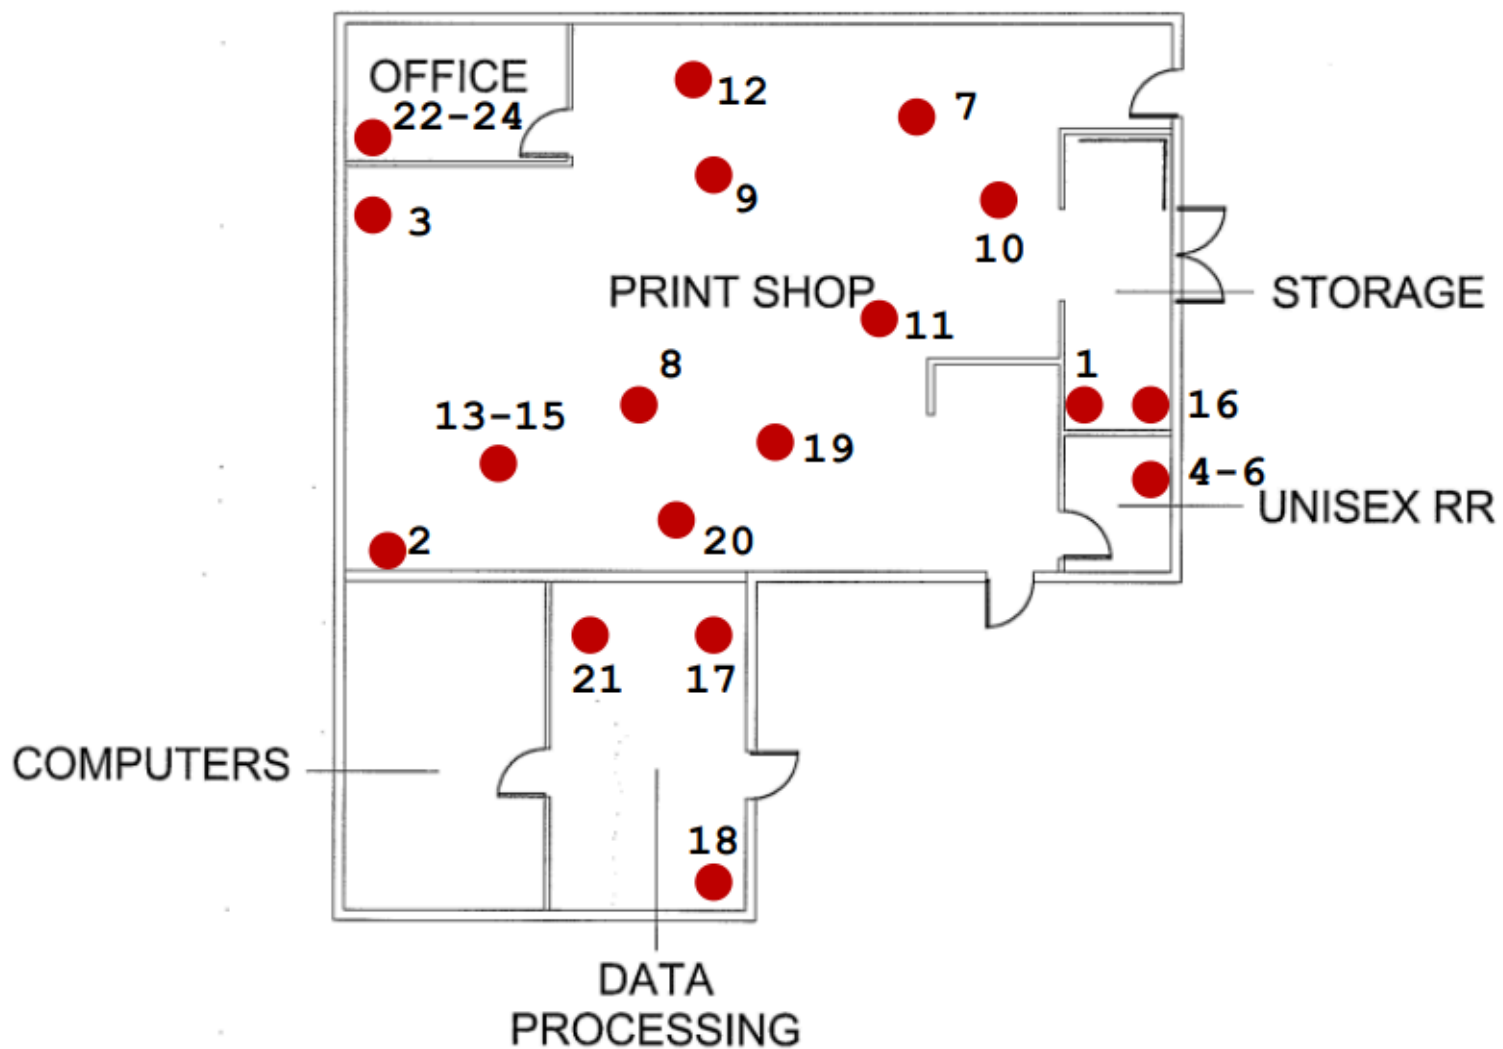

Sample Date(s) :

● October 2, 2025


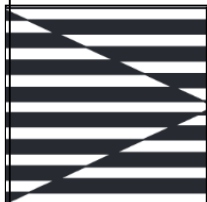


PLM Bulk Sample Location Map (2 of 2)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60


Building E

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

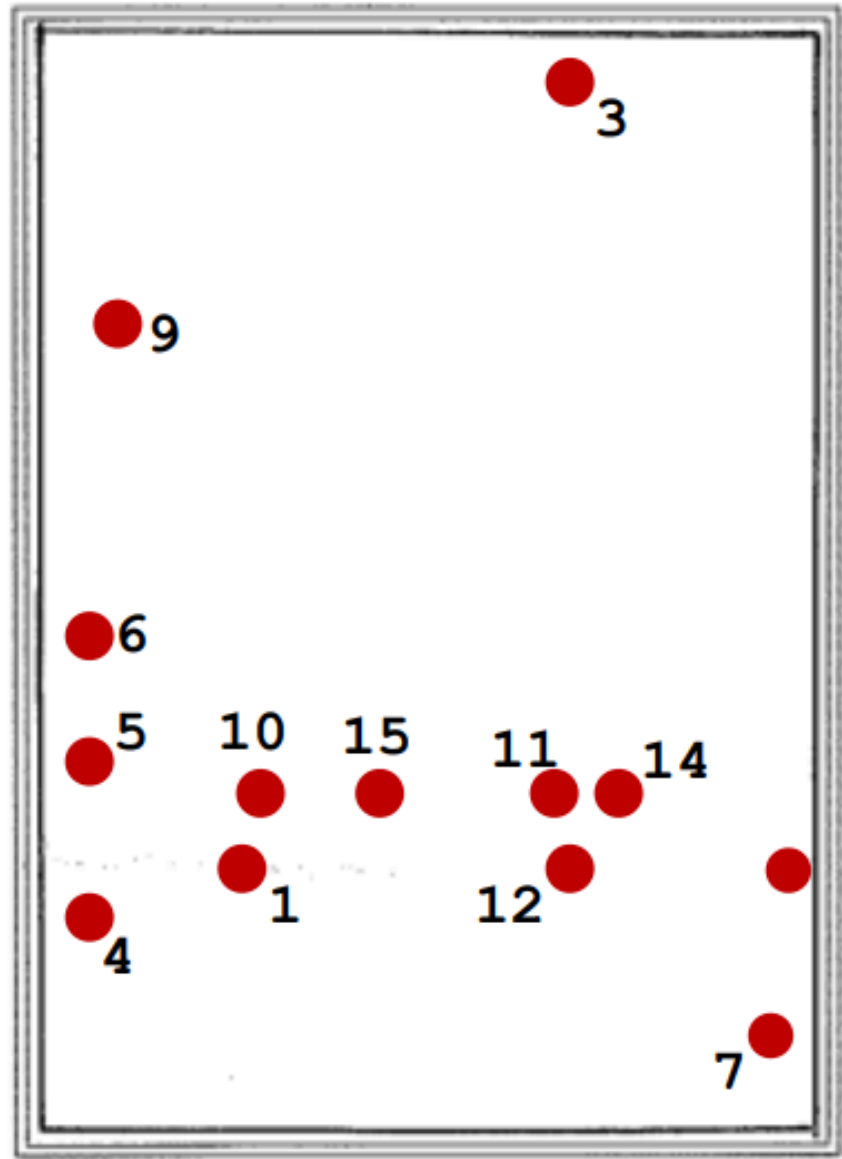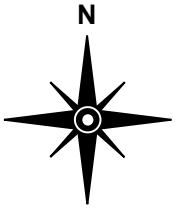

Sample Date(s) :

● October 3, 2025

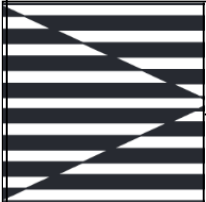


PLM Bulk Sample Location Map
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building F

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

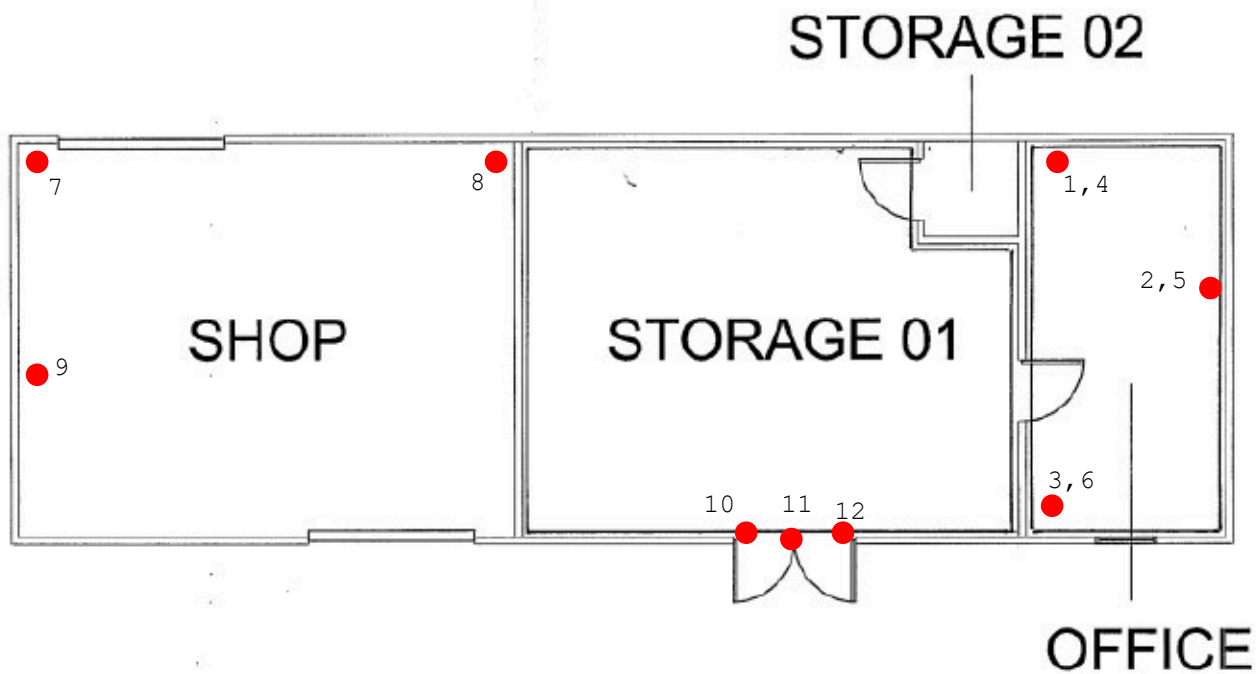



● Sample Date: March 11, 2024

PLM Bulk Sample Location Map (1 of 2)
Kyrene District Office and Bus Barn
8700 S. Kyrene Rd., Tempe, AZ 85284

Project No. AZ1418.11


Building G

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

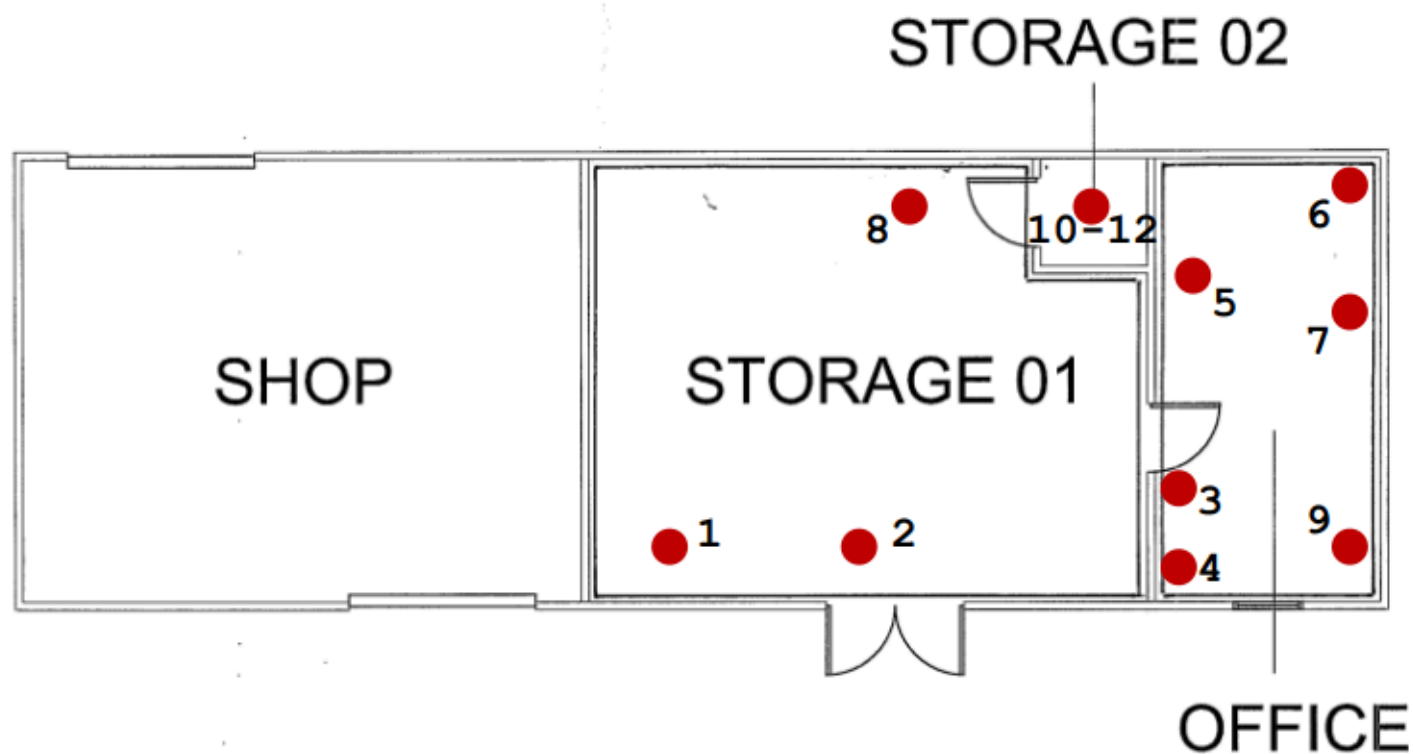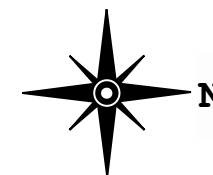

Sample Date(s) :

● October 3, 2025


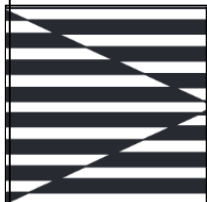


PLM Bulk Sample Location Map (2 of 2)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60


Building G

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

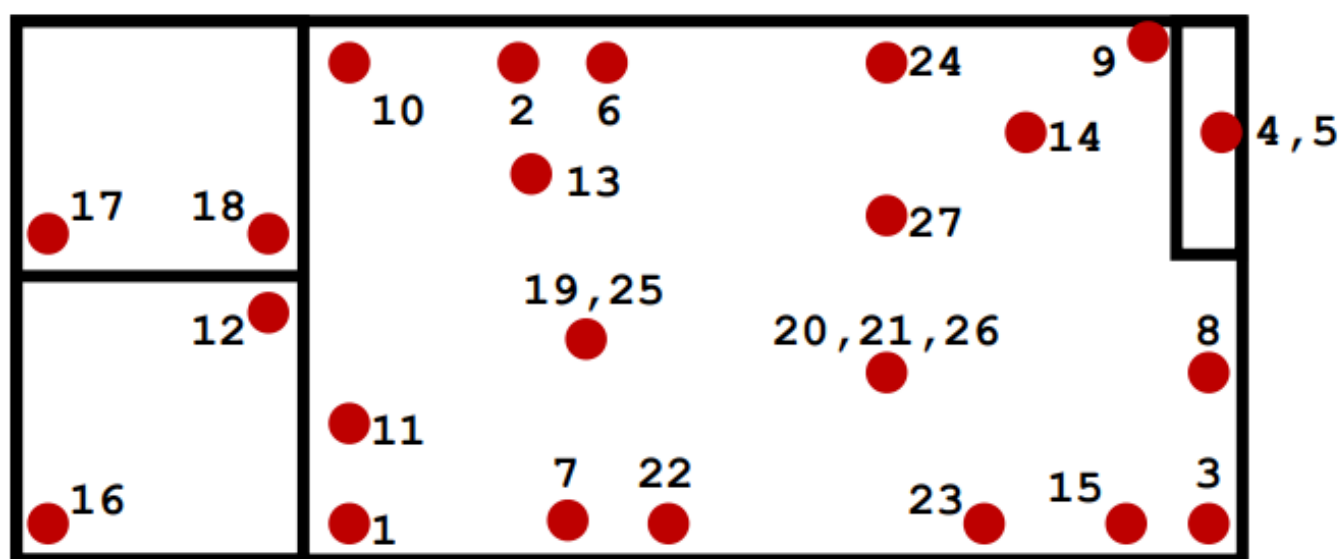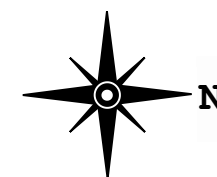

Sample Date(s) :

● October 3, 2025


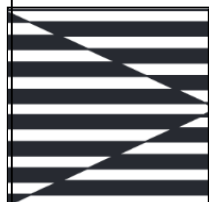


PLM Bulk Sample Location Map
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60


Building K

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

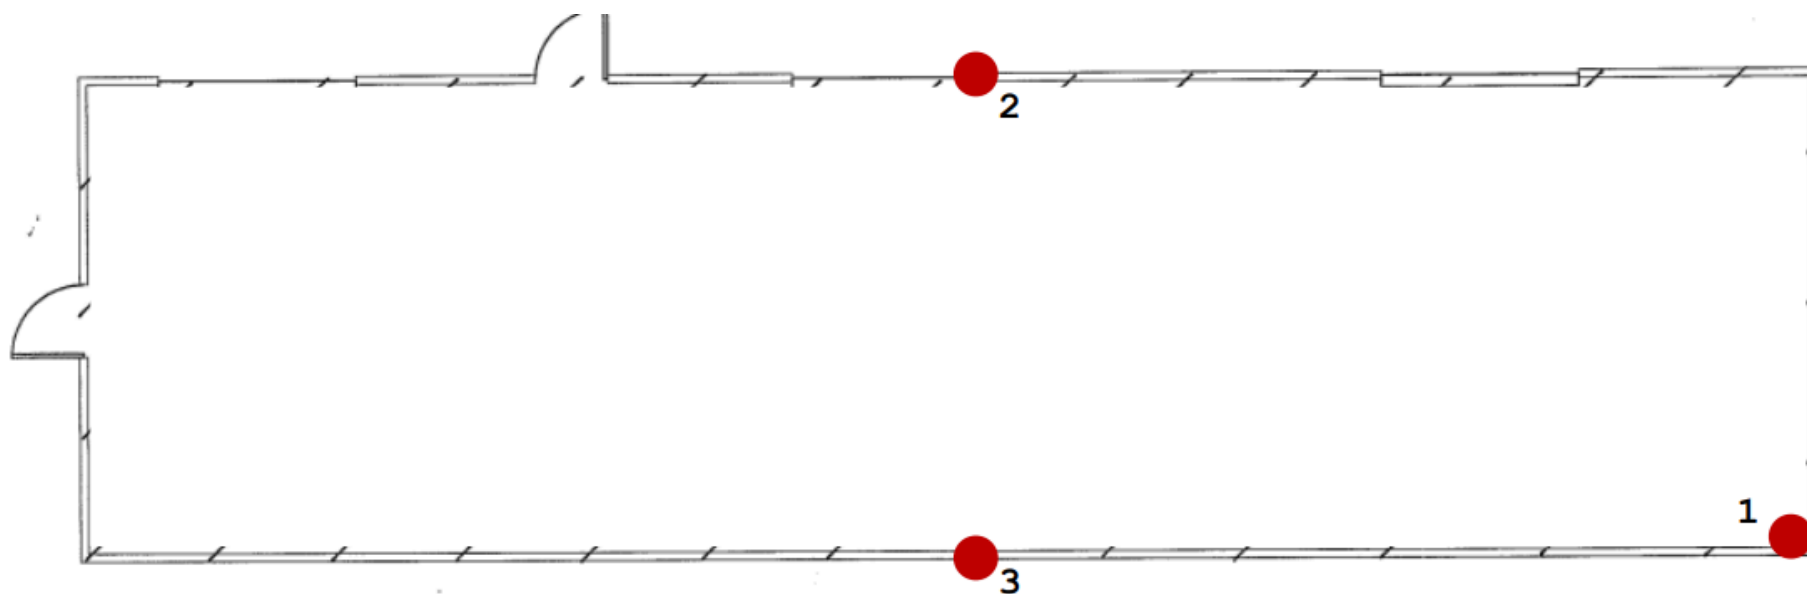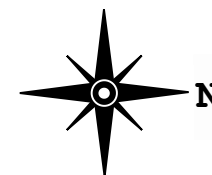

Sample Date(s) :

● **October 2, 2025**

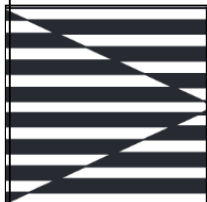


PLM Bulk Sample Location Map
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60


Building M

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

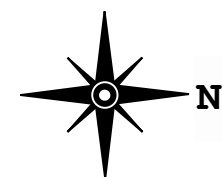

Sample Date(s) :

 **October 2, 2025**

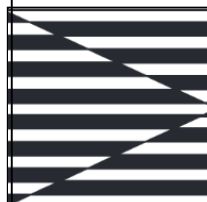


PLM Bulk Sample Location Map
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building O

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

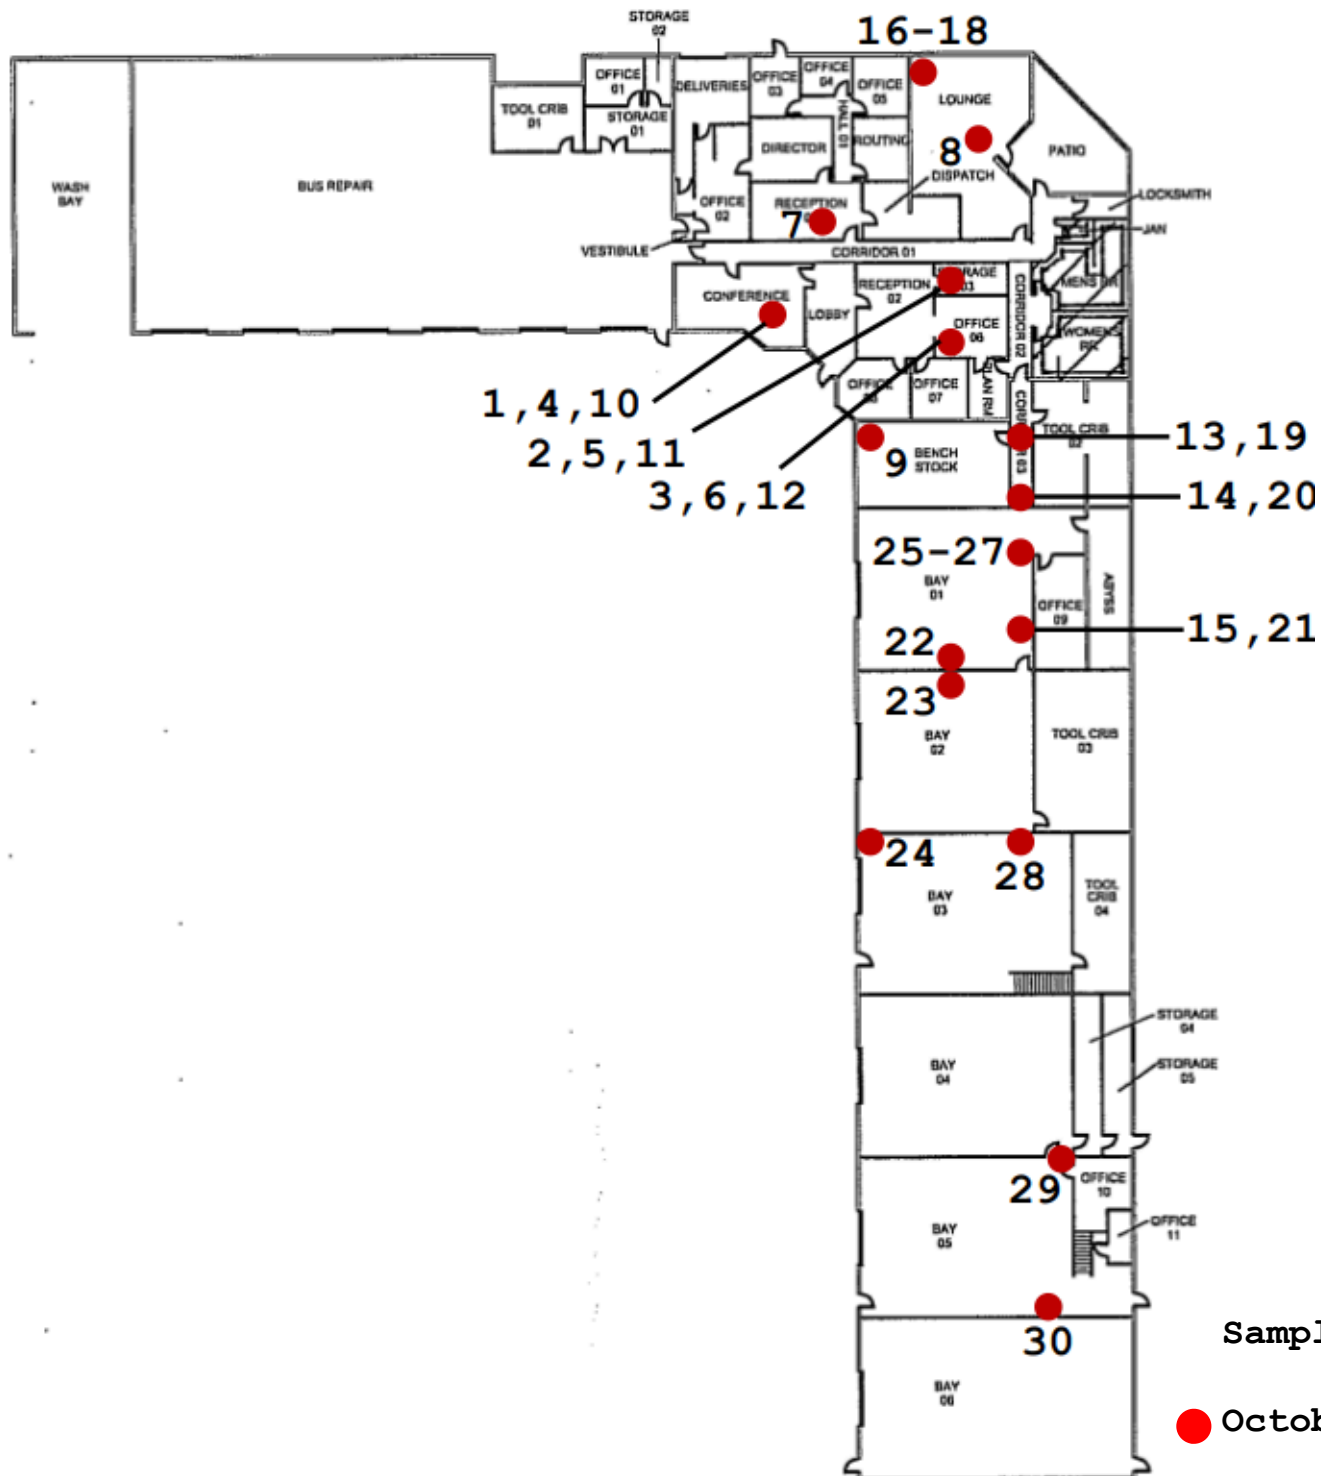


PLM Bulk Sample Location Map
 Kyrene District Office & Bus Barn
 8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building T

Dominion Environmental Consultants, Inc.
 20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

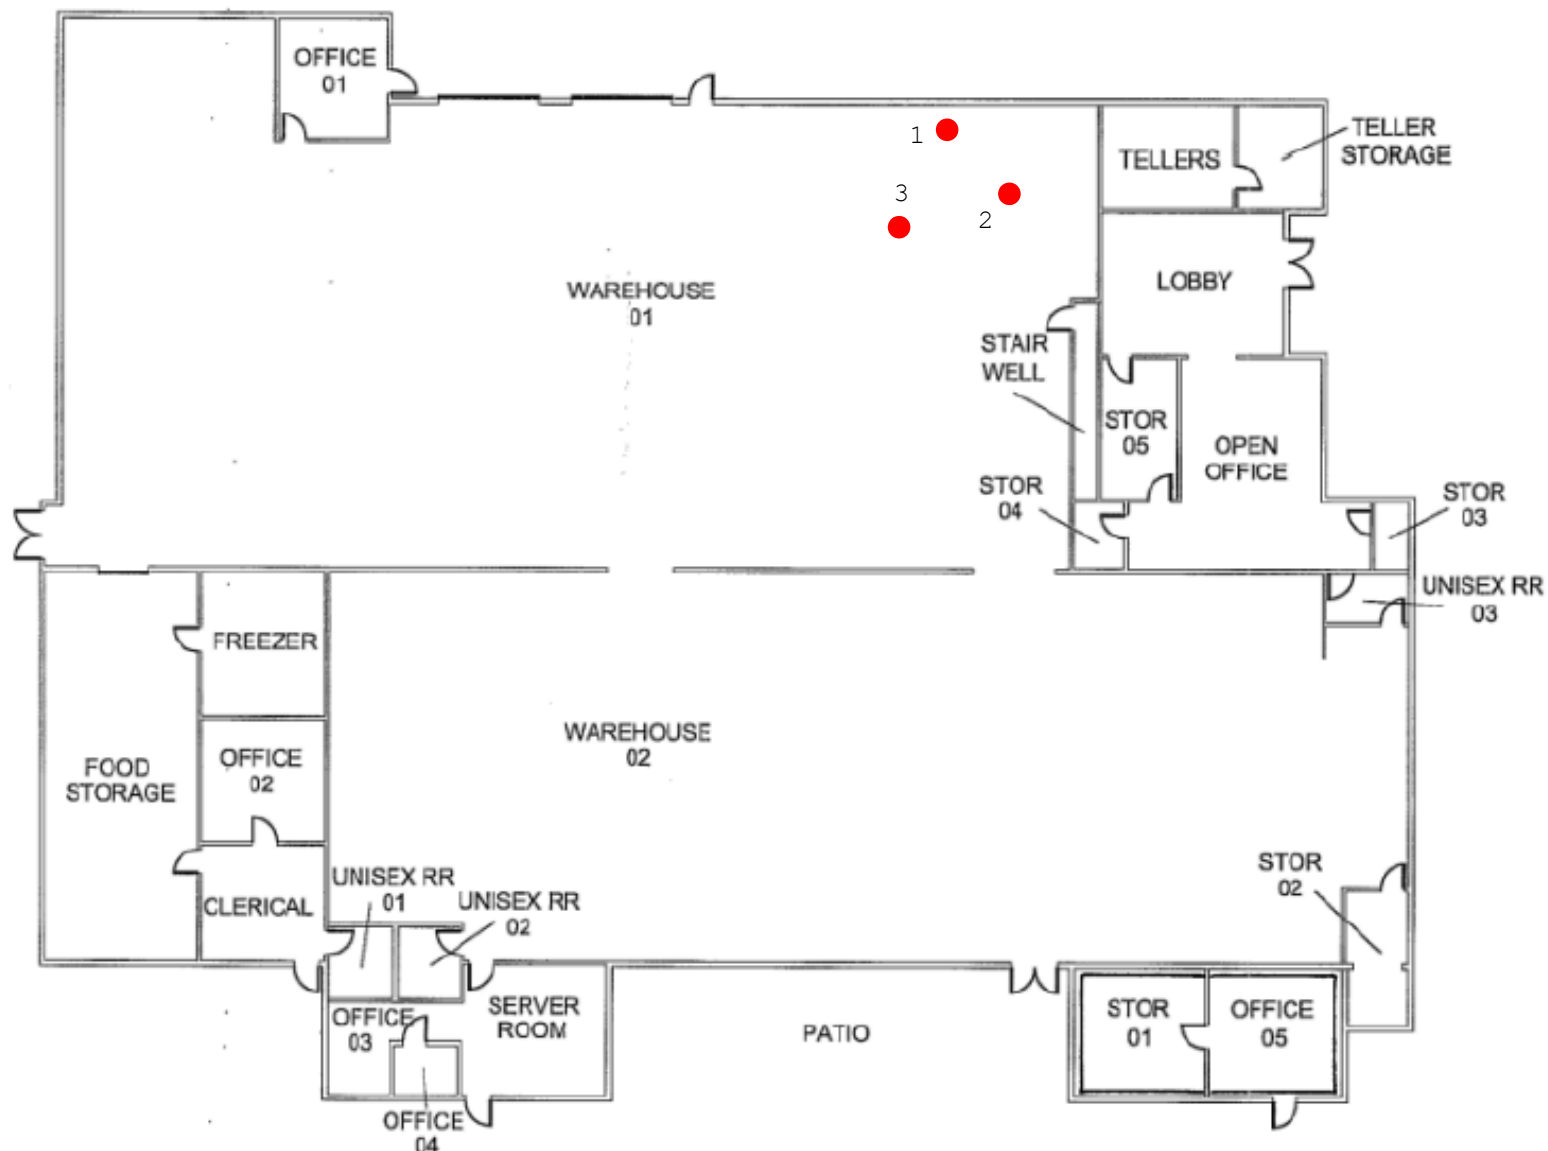



● Sample Date: March 11, 2024

PLM Bulk Sample Location Map (1 of 2)
Kyrene District Office and Bus Barn
8700 S. Kyrene Rd., Tempe, AZ 85284

Project No. AZ1418.11

Building W

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

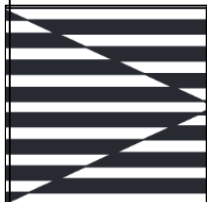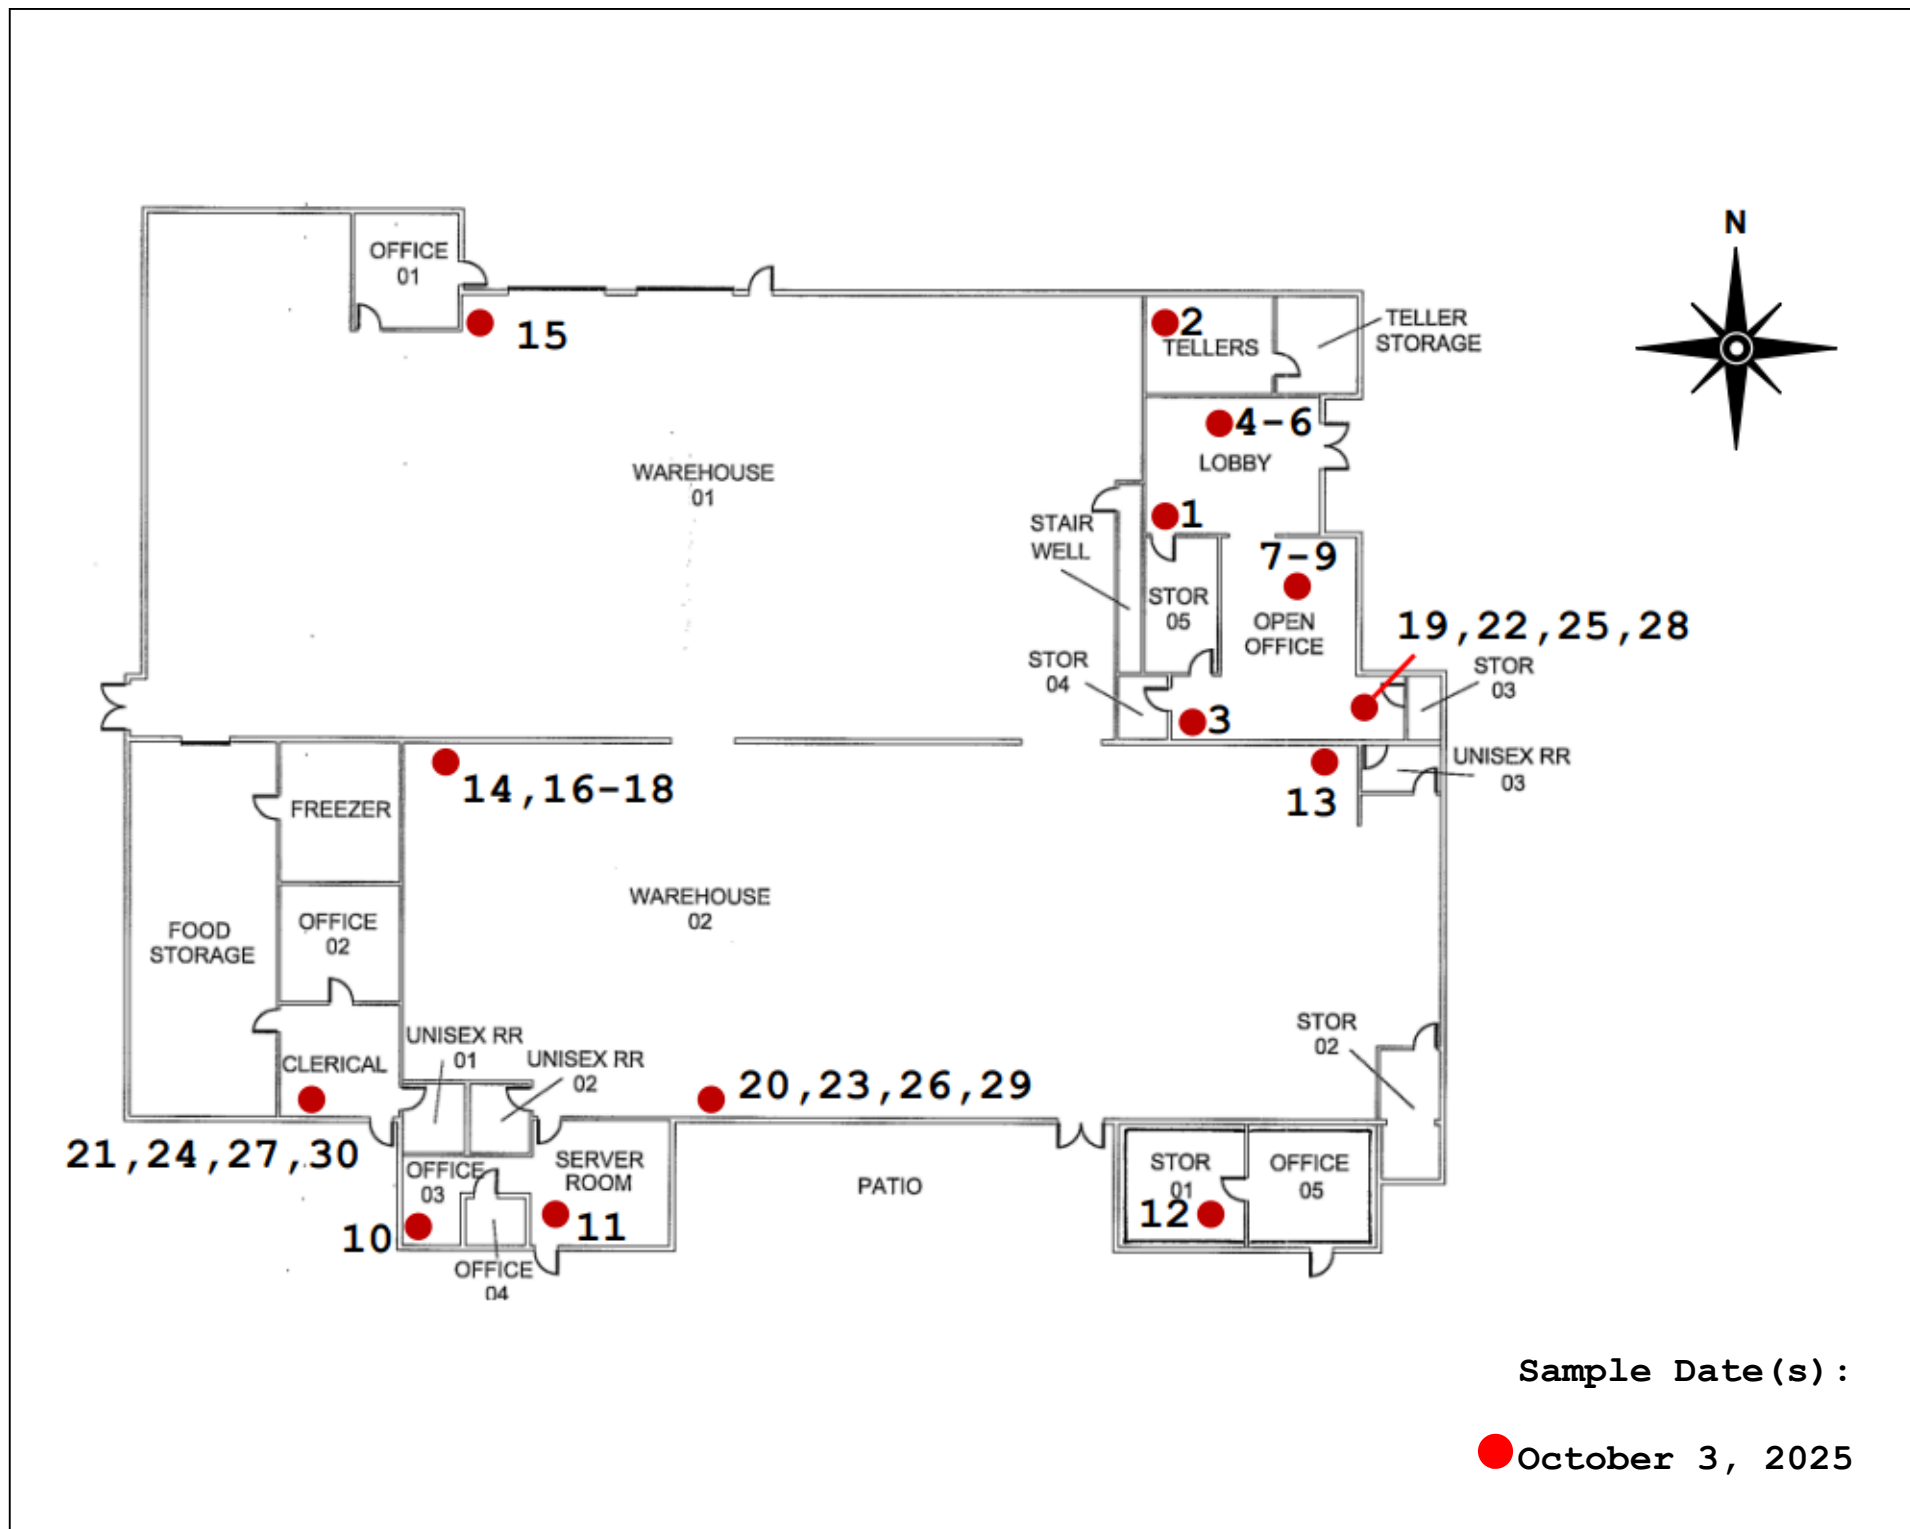

PLM Bulk Sample Location Map (2 of 2)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building W

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

SECTION 8



PHYSICAL ASSESSMENT INFORMATION SHEETS

BUILDING MATERIAL PHYSICAL ASSESSMENT INFORMATION SHEET

Project #: AZ1418.60	Client: Kyrene Elementary School District	Site: Kyrene District Office and Bus Barn	Bldg. B
(HM) Material #: 17	Quantity of Material: 950 sq. ft ..	Material in Air Plenum? Yes No	
Material Description: 2' x 4' Ceiling Tile		Material Location(s): Above Ceilings in Classrooms	
Material Type: TSI (Circle One)	Surfacing	Miscellaneous	

Physical Assessment Categories	
☐ 1) Damaged or significantly damaged TSI ACBM ☐ 2) Damaged friable surfacing ACBM ☐ 3) Significantly damaged friable surfacing ACBM ☐ 4) Damaged or significantly damaged friable misc. ACBM	☐ 5) ACBM with potential for damage ☐ 6) ACBM with potential for significant damage ☒ 7) Any remaining friable ACBM or friable suspect ACBM

Material Condition			
Damage Type:	☐ Physical ☐ Vandalism	☐ Water ☐ Vibration	☐ Air Erosion ☒ None ☐ Other
Damage Extent:	☒ Low <1% evenly; 10% locally ☐ Moderate <10% evenly; 10% - 25% locally ☐ High >10% evenly; >25% locally		
Description of Damage: None, Assumed ACBM			

Exposure Factors				
☒ Low ☐ Moderate ☐ High	☐ Low ☒ Moderate ☐ High	☒ Low ☐ Moderate ☐ High	☐ Low ☒ Moderate ☐ High	☐ Low ☒ Moderate ☐ High
Accessibility:	Occupancy:	Potential for Contact:	Potential for Vibration:	Potential for Air Erosion:
Preventative Measures: Low Potential for Disturbance				

Hazard Classification/Assessment Categories	
☒ 1) Good condition with low potential for disturbance damage ☐ 2) Good condition with potential for disturbance damage ☐ 3) Good condition with potential for significant disturbance damage ☐ 4) Damaged condition with low potential for disturbance damage	☐ 5) Damaged condition with potential for disturbance damage ☐ 6) Damaged condition with potential for significant disturbance damage ☐ 7) Significant damage with potential for any disturbance

Inspector: Chase Kirby

Certificate #: 4380-19987-030525

Signature:



State: Arizona

Exp Date: March 5, 2026

Management Planner: Xin Lou

Certificate #: ON-4651-548-100324

Signature:



State: Arizona

Exp Date: October 3, 2025

SECTION 9



LABORATORY REPORTS

Report for:

Chase Kirby
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.60; Kyrene District Office/Bus Barn A
EML ID: 4255726

Approved by:

Dates of Analysis:
Asbestos PLM: 10-06-2025



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC

1501 West Knudsen Drive, Phoenix, AZ 85027

(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.

Date of Sampling: 10-03-2025

C/O: Chase Kirby

Date of Receipt: 10-03-2025

Re: AZ1418.60; Kyrene District Office/Bus Barn A

Date of Report: 10-06-2025

ASBESTOS PLM REPORT**Total Samples Submitted:** 30**Total Samples Analyzed:** 30**Total Samples with Layer Asbestos Content > 1%:** 0**Location: PLM-1, OP Drywall(Paint,Texture,Tape,Joint Compound,Drywall w Paper)** Lab ID-Version‡: 21288916-1

Sample Layers	Asbestos Content
Off-White Paint	ND
White Texture	ND
White Paint	ND
White Compound	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-2, OP Drywall(Paint,Texture,Tape,Joint Compound,Drywall w Paper) Lab ID-Version‡: 21288917-1

Sample Layers	Asbestos Content
Off-White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn A

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-3, OP Drywall(Paint,Texture,Tape,Joint Compound,Drywall w Paper)

Lab ID-Version‡: 21288918-1

Sample Layers	Asbestos Content
Off-White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-4, Fixture Caulking

Lab ID-Version‡: 21288919-1

Sample Layers	Asbestos Content
White Caulk	ND
Sample Composite Homogeneity:	Good

Location: PLM-5, Fixture Caulking

Lab ID-Version‡: 21288920-1

Sample Layers	Asbestos Content
White Caulk	ND
Sample Composite Homogeneity:	Good

Location: PLM-6, Fixture Caulking

Lab ID-Version‡: 21288921-1

Sample Layers	Asbestos Content
White Caulk	ND
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
 C/O: Chase Kirby
 Re: AZ1418.60; Kyrene District Office/Bus Barn A

Date of Sampling: 10-03-2025
 Date of Receipt: 10-03-2025
 Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-7, Window Glazing

Lab ID-Version‡: 21288922-1

Sample Layers	Asbestos Content
Black Window Glazing	ND
Sample Composite Homogeneity:	Good

Location: PLM-8, Window Glazing

Lab ID-Version‡: 21288923-1

Sample Layers	Asbestos Content
Black Window Glazing	ND
Sample Composite Homogeneity:	Good

Location: PLM-9, Window Glazing

Lab ID-Version‡: 21288924-1

Sample Layers	Asbestos Content
Black Window Glazing	ND
Sample Composite Homogeneity:	Good

Location: PLM-10, Brown Linoleum

Lab ID-Version‡: 21288925-1

Sample Layers	Asbestos Content
Gray Linoleum	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	< 1% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-11, Brown Linoleum

Lab ID-Version‡: 21288926-1

Sample Layers	Asbestos Content
Gray Linoleum	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	< 1% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
 C/O: Chase Kirby
 Re: AZ1418.60; Kyrene District Office/Bus Barn A

Date of Sampling: 10-03-2025
 Date of Receipt: 10-03-2025
 Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-12, Brown Linoleum

Lab ID-Version‡: 21288927-1

Sample Layers	Asbestos Content
Gray Linoleum	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	< 1% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-13, Gray Multicolor Carpet & Mastic

Lab ID-Version‡: 21288928-1

Sample Layers	Asbestos Content
Gray Carpet	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	50% Synthetic Fibers < 1% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-14, Gray Multicolor Carpet & Mastic

Lab ID-Version‡: 21288929-1

Sample Layers	Asbestos Content
Gray Carpet	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	50% Synthetic Fibers < 1% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-15, Gray Multicolor Carpet & Mastic

Lab ID-Version‡: 21288930-1

Sample Layers	Asbestos Content
Gray Carpet	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	50% Synthetic Fibers < 1% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn A Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-16, Dark Gray Multicolor Carpet & Mastic

Lab ID-Version‡: 21288931-1

Sample Layers	Asbestos Content
Dark Gray Carpet	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers 3% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-17, Dark Gray Multicolor Carpet & Mastic

Lab ID-Version‡: 21288932-1

Sample Layers	Asbestos Content
Dark Gray Carpet	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers 3% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-18, Dark Gray Multicolor Carpet & Mastic

Lab ID-Version‡: 21288933-1

Sample Layers	Asbestos Content
Dark Gray Carpet	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers 3% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-19, Gray Cove Base & Mastic

Lab ID-Version‡: 21288934-1

Sample Layers	Asbestos Content
Gray Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn A

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-20, Gray Cove Base & Mastic

Lab ID-Version‡: 21288935-1

Sample Layers	Asbestos Content
Gray Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-21, Gray Cove Base & Mastic

Lab ID-Version‡: 21288936-1

Sample Layers	Asbestos Content
Gray Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-22, Light Gray Interior Caulking

Lab ID-Version‡: 21288937-1

Sample Layers	Asbestos Content
White Caulk	ND
Sample Composite Homogeneity: Good	

Location: PLM-23, Light Gray Interior Caulking

Lab ID-Version‡: 21288938-1

Sample Layers	Asbestos Content
White Caulk	ND
Sample Composite Homogeneity: Good	

Location: PLM-24, Light Gray Interior Caulking

Lab ID-Version‡: 21288939-1

Sample Layers	Asbestos Content
White Caulk	ND
Sample Composite Homogeneity: Good	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn A

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-25, Gray Interior Caulking

Lab ID-Version‡: 21288940-1

Sample Layers	Asbestos Content
Gray Caulk	ND
Sample Composite Homogeneity:	Good

Location: PLM-26, Gray Interior Caulking

Lab ID-Version‡: 21288941-1

Sample Layers	Asbestos Content
Gray Caulk	ND
Sample Composite Homogeneity:	Good

Location: PLM-27, Gray Interior Caulking

Lab ID-Version‡: 21288942-1

Sample Layers	Asbestos Content
Gray Caulk	ND
Sample Composite Homogeneity:	Good

Location: PLM-28, 2x2 Ceiling Tile

Lab ID-Version‡: 21288943-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	50% Cellulose 30% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-29, 2x2 Ceiling Tile

Lab ID-Version‡: 21288944-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	50% Cellulose 30% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn A

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-30, 2x2 Ceiling Tile

Lab ID-Version‡: 21288945-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	50% Cellulose 30% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn A

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Shelby Brown

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

www.eurofinsus.com/Built



East: (866) 871-1984

West/Central: (800) 651-4802

Built Environment Testing

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

REQUESTED SERVICES

Non-Culturable		
Spore Trap	Tape, Swab, Bulk	BioCa Swab



004255726

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave., Phx, AZ 85027 Special Instructions:
Contact:	Chase Kirby	
Phone:	623-516-1415	

PROJECT INFORMATION

TURN AROUND TIME CODES - (TAT)

Project ID:	AZ1418.60			STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene District Office/Bus Barn (A)			ND - Next Business Day	
Project Zip Code:		Sampling Date/Time:	10/3/2025	SD - Same Business Day	
PO Number:	22025	Sampled By:	CK	WH - Weekend/Holiday/ASAP	

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	O.P. Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)	B	STD		
PLM 4-6	Fixture Caulking	B	STD		
PLM 7-9	Window Glazing	B	STD		
PLM 10-12	Brown Linoleum	B	STD		
PLM 13-15	Gray Multicolor Carpet + Mastic	B	STD		
PLM 16-18	Dark Gray Multicolor Carpet + Mastic	B	STD		
PLM 19-21	Gray Cove Base + Mastic	B	STD		
PLM 22-24	Light-Gray Interior Caulking	B	STD		
PLM 25-27	Gray Interior Caulking	B	STD		
PLM 28-30	2x2 Ceiling Tile	B	STD		

SAMPLE TYPE CODES

BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	
SAS - Surface Air Sampler	B - Bulk	SO - Soil	
NP - Non-potable Water	P - Potable Water	D - Dust	

RELINQUISHED BY

[Signature]

DATE & TIME

10/3/2025

RECEIVED BY

Pailey Cuzco

DATE & TIME

10/3/25
4:09pm

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at <http://www.emlab.com/s/main/serviceterms.html>

Report for:

Chase Kirby
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.60; Kyrene District Office/Bus Barn B
EML ID: 4255735

Approved by:

Dates of Analysis:
Asbestos PLM: 10-06-2025



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC

1501 West Knudsen Drive, Phoenix, AZ 85027

(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.

C/O: Chase Kirby

Re: AZ1418.60; Kyrene District Office/Bus Barn B

Date of Sampling: 10-02-2025

Date of Receipt: 10-03-2025

Date of Report: 10-06-2025

ASBESTOS PLM REPORT**Total Samples Submitted:** 30**Total Samples Analyzed:** 30**Total Samples with Layer Asbestos Content > 1%:** 3**Location: PLM-1, 1x1 Ceiling Tile**

Lab ID-Version‡: 21288859-1

Sample Layers	Asbestos Content
Tan Ceiling Tile with White Surface	ND
Brown Mastic	ND
Composite Non-Asbestos Content:	75% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-2, 1x1 Ceiling Tile

Lab ID-Version‡: 21288860-1

Sample Layers	Asbestos Content
Tan Ceiling Tile with White Surface	ND
Brown Mastic	ND
Composite Non-Asbestos Content:	75% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-3, 1x1 Ceiling Tile

Lab ID-Version‡: 21288861-1

Sample Layers	Asbestos Content
Tan Ceiling Tile with White Surface	ND
Brown Mastic	ND
Composite Non-Asbestos Content:	75% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn B Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-4, Old OP Drywall(Paint,Texture,Tape,Joint Compound, Drywall w Paper)

Lab ID-Version‡: 21288862-1

Sample Layers	Asbestos Content
Off-White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-5, Old OP Drywall(Paint,Texture,Tape,Joint Compound, Drywall w Paper)

Lab ID-Version‡: 21288863-1

Sample Layers	Asbestos Content
Off-White Paint	ND
White Texture	ND
White Paint	ND
White Texture 2	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-6, Old OP Drywall(Paint,Texture,Tape,Joint Compound, Drywall w Paper)

Lab ID-Version‡: 21288864-1

Sample Layers	Asbestos Content
Off-White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn B

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-7, Tan VCT & Mastic

Lab ID-Version‡: 21288865-1

Sample Layers	Asbestos Content
Tan Floor Tile	ND
Black Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-8, Tan VCT & Mastic

Lab ID-Version‡: 21288866-1

Sample Layers	Asbestos Content
Tan Floor Tile	ND
Black Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-9, Tan VCT & Mastic

Lab ID-Version‡: 21288867-1

Sample Layers	Asbestos Content
Tan Floor Tile	ND
Black Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-10, Gray VCT & Mastic

Lab ID-Version‡: 21288868-1

Sample Layers	Asbestos Content
Gray Floor Tile	ND
Black Mastic	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn B

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-11, Gray VCT & Mastic

Lab ID-Version‡: 21288869-1

Sample Layers	Asbestos Content
Gray Floor Tile	ND
Black Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-12, Gray VCT & Mastic

Lab ID-Version‡: 21288870-1

Sample Layers	Asbestos Content
Gray Floor Tile	ND
Black Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-13, Black Cove Base & Mastic

Lab ID-Version‡: 21288871-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Off-White Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-14, Black Cove Base & Mastic

Lab ID-Version‡: 21288872-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Off-White Mastic	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
 C/O: Chase Kirby
 Re: AZ1418.60; Kyrene District Office/Bus Barn B

Date of Sampling: 10-02-2025
 Date of Receipt: 10-03-2025
 Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-15, Black Cove Base & Mastic

Lab ID-Version‡: 21288873-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Off-White Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-16, Silver Flex Duct Insulation

Lab ID-Version‡: 21288874-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	70% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-17, Silver Flex Duct Insulation

Lab ID-Version‡: 21288875-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	70% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-18, Silver Flex Duct Insulation

Lab ID-Version‡: 21288876-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	70% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
 C/O: Chase Kirby
 Re: AZ1418.60; Kyrene District Office/Bus Barn B

Date of Sampling: 10-02-2025
 Date of Receipt: 10-03-2025
 Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-19, Silver Duct Insulation

Lab ID-Version‡: 21288877-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Tan Insulation	ND
Composite Non-Asbestos Content:	85% Glass Fibers 3% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-20, Silver Duct Insulation

Lab ID-Version‡: 21288878-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Tan Insulation	ND
Composite Non-Asbestos Content:	85% Glass Fibers 3% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-21, Silver Duct Insulation

Lab ID-Version‡: 21288879-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Tan Insulation	ND
Composite Non-Asbestos Content:	85% Glass Fibers 3% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-22, Gray Duct Mastic

Lab ID-Version‡: 21288880-1

Sample Layers	Asbestos Content
Gray Mastic	ND
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
 C/O: Chase Kirby
 Re: AZ1418.60; Kyrene District Office/Bus Barn B

Date of Sampling: 10-02-2025
 Date of Receipt: 10-03-2025
 Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-23, Gray Duct Mastic

Lab ID-Version‡: 21288881-1

Sample Layers	Asbestos Content
Gray Mastic	ND
Sample Composite Homogeneity:	Good

Location: PLM-24, Gray Duct Mastic

Lab ID-Version‡: 21288882-1

Sample Layers	Asbestos Content
Gray Mastic	ND
Sample Composite Homogeneity:	Good

Location: PLM-25, Drywall Ceiling

Lab ID-Version‡: 21288883-1

Sample Layers	Asbestos Content
White Compound	2% Chrysotile
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-26, Drywall Ceiling

Lab ID-Version‡: 21288884-1

Sample Layers	Asbestos Content
White Compound	2% Chrysotile
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
 C/O: Chase Kirby
 Re: AZ1418.60; Kyrene District Office/Bus Barn B

Date of Sampling: 10-02-2025
 Date of Receipt: 10-03-2025
 Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-27, Drywall Ceiling

Lab ID-Version‡: 21288885-1

Sample Layers	Asbestos Content
White Compound	2% Chrysotile
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-28, New OP Drywall(Paint,Texture,Tape,Joint Compound, Drywall w Paper)

Lab ID-Version‡: 21288886-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Off-White Paint	ND
White Texture 2	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-29, New OP Drywall(Paint,Texture,Tape,Joint Compound, Drywall w Paper)

Lab ID-Version‡: 21288887-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn B Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-30, New OP Drywall(Paint,Texture,Tape,Joint Compound, Drywall w Paper)

Lab ID-Version‡: 21288888-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn B

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Jason Bosse

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

www.eurofinsus.com/Built



East:(866) 871-1984

West/Central:(800) 651-4802

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

Non-Culturable		Culturable		Other Requests
Spore Trap	Tape, Swab, Bulk	BioCa Swab	Jensen, SAS, Soil	

Company:	Dominion Environmental Consultants	Address:20045 N. 19th Ave., Phx, AZ 85027 Special Instructions:
Contact:	Chase Kirby	
Phone:	623-516-1415	

TURN AROUND TIME CODES - (TAT)

Project ID:	AZ1418.60			STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene District Office/Bus Barn (B)			ND - Next Business Day	
Project Zip Code:		Sampling Date/Time:	10/2/2025	SD - Same Business Day	
PO Number:	22017	Sampled By:	CK	WH - Weekend/Holiday/ASAP	

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	1x1 Ceiling Tile	B	STD		
PLM 4-6	Old O.P. Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)	B	STD		
PLM 7-9	Tan VCT + Mastic	B	STD		
PLM 10-12	Gray VCT + Mastic	B	STD		
PLM 13-15	Black Cove Base + Mastic	B	STD		
PLM 16-18	Silver Flex Duct Insulation	B	STD		
PLM 19-21	Silver Duct Insulation	B	STD		
PLM 22-24	Gray Duct Mastic	B	STD		
PLM 25-27	Drywall Ceiling	B	STD		
PLM 28-30	New O.P. Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)	B	STD		

RELINQUISHED BY

DATE & TIME

RECEIVED BY

DATE & TIME

BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	

Leah

10/2/2025

3

10-3-25
4:00

Report for:

Chase Kirby
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.60; Kyrene District Office/Bus Barn (C)
EML ID: 4255750

Approved by:

Dates of Analysis:
Asbestos PLM: 10-07-2025



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC

1501 West Knudsen Drive, Phoenix, AZ 85027

(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.

Date of Sampling: 10-02-2025

C/O: Chase Kirby

Date of Receipt: 10-03-2025

Re: AZ1418.60; Kyrene District Office/Bus Barn (C)

Date of Report: 10-07-2025

ASBESTOS PLM REPORT**Total Samples Submitted:** 21**Total Samples Analyzed:** 21**Total Samples with Layer Asbestos Content > 1%:** 0**Location: PLM-1, Old O.P. Drywall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)**

Lab ID-Version#: 21288697-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-2, Old O.P. Drywall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version#: 21288698-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (C) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-3, Old O.P. Drywall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version‡: 21288699-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-4, Gray Cove Base + Mastic

Lab ID-Version‡: 21288700-1

Sample Layers	Asbestos Content
Gray Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-5, Gray Cove Base + Mastic

Lab ID-Version‡: 21288701-1

Sample Layers	Asbestos Content
Gray Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-6, Gray Cove Base + Mastic

Lab ID-Version‡: 21288702-1

Sample Layers	Asbestos Content
Gray Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (C) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-7, Pinhole 2x2 Ceiling Tile

Lab ID-Version‡: 21288703-1

Sample Layers	Asbestos Content
Light Brown Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-8, Pinhole 2x2 Ceiling Tile

Lab ID-Version‡: 21288704-1

Sample Layers	Asbestos Content
Light Brown Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-9, Pinhole 2x2 Ceiling Tile

Lab ID-Version‡: 21288705-1

Sample Layers	Asbestos Content
Light Brown Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-10, Window Glazing

Lab ID-Version‡: 21288706-1

Sample Layers	Asbestos Content
Black Window Glazing	ND
Sample Composite Homogeneity:	Good

Location: PLM-11, Window Glazing

Lab ID-Version‡: 21288707-1

Sample Layers	Asbestos Content
Black Window Glazing	ND
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (C) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-12, Window Glazing

Lab ID-Version‡: 21288708-1

Sample Layers	Asbestos Content
Black Window Glazing	ND
Sample Composite Homogeneity:	Good

Location: PLM-13, Silver Duct Insulation

Lab ID-Version‡: 21288709-1

Sample Layers	Asbestos Content
Silver Insulation Backing	ND
Yellow Insulation	ND
Composite Non-Asbestos Content:	50% Glass Fibers 5% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-14, Silver Duct Insulation

Lab ID-Version‡: 21288710-1

Sample Layers	Asbestos Content
Silver Insulation Backing	ND
Yellow Insulation	ND
Composite Non-Asbestos Content:	50% Glass Fibers 5% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-15, Silver Duct Insulation

Lab ID-Version‡: 21288711-1

Sample Layers	Asbestos Content
Silver Insulation Backing	ND
Yellow Insulation	ND
Composite Non-Asbestos Content:	50% Glass Fibers 5% Cellulose
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (C) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-16, Silver Flex Duct Insulation

Lab ID-Version‡: 21288712-1

Sample Layers	Asbestos Content
Silver Insulation Backing	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	70% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-17, Silver Flex Duct Insulation

Lab ID-Version‡: 21288713-1

Sample Layers	Asbestos Content
Silver Insulation Backing	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	70% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-18, Silver Flex Duct Insulation

Lab ID-Version‡: 21288714-1

Sample Layers	Asbestos Content
Silver Insulation Backing	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	70% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-19, Batt Insulation

Lab ID-Version‡: 21288715-1

Sample Layers	Asbestos Content
White Insulation	ND
Composite Non-Asbestos Content:	99% Glass Fibers
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC

1501 West Knudsen Drive, Phoenix, AZ 85027

(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.

Date of Sampling: 10-02-2025

C/O: Chase Kirby

Date of Receipt: 10-03-2025

Re: AZ1418.60; Kyrene District Office/Bus Barn (C)

Date of Report: 10-07-2025

ASBESTOS PLM REPORT**Location: PLM-20, Batt Insulation**

Lab ID-Version‡: 21288716-1

Sample Layers	Asbestos Content
White Insulation	ND
Composite Non-Asbestos Content:	99% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-21, Batt Insulation

Lab ID-Version‡: 21288717-1

Sample Layers	Asbestos Content
White Insulation	ND
Composite Non-Asbestos Content:	99% Glass Fibers
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (C) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Renee Luna-Trepczynski

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

www.eurofinsus.com/Built



East:(866) 871-1984

West/Central:(800) 651-4802

Built Environment Testing

WEATHER		Fog	Rain	Snow	Wind
LEVEL	None				
	Light				
	Moderate				
	Heavy				



004255750

SERVICES

ersen, SAS,
Dust, Soil,
ate

Other Requests

CONTACT INFORMATION		
Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave., Phx, AZ 85027
Contact:	Chase Kirby	Special Instructions:
Phone:	623-516-1415	

PROJECT INFORMATION				TURN AROUND TIME CODES - (TAT)	
Project ID:	AZ1418.60			STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene District Office/Bus Barn (C)			ND - Next Business Day	
Project Zip Code:		Sampling Date/Time:	10/2/2025	SD - Same Business Day	
PO Number:	22016	Sampled By:	CK	WH - Weekend/Holiday/ASAP	

[illegible]

SAMPLE TYPE CODES				RELINQUISHED BY	DATE & TIME
BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:		10/2/2025
A1S - Andersen	ST - Spore Trap	SW - Swab			

[illegible]

RECEIVED BY	DATE & TIME
Peter L...	10/3/26 4:09pm

Report for:

Chase Kirby
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.60; Kyrene District Office/Bus Barn D
EML ID: 4255730

Approved by:

Dates of Analysis:
Asbestos PLM: 10-07-2025



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
 C/O: Chase Kirby Date of Receipt: 10-03-2025
 Re: AZ1418.60; Kyrene District Office/Bus Barn D Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Total Samples Submitted: 15

Total Samples Analyzed: 15

Total Samples with Layer Asbestos Content > 1%: 0

Location: PLM-1, Old OP Drywall Wall(Paint,Texture,Tape,Joint Compound,Drywall w Paper)

Lab ID-Version#: 21288996-1

Sample Layers	Asbestos Content
Off-White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-2, Old OP Drywall Wall(Paint,Texture,Tape,Joint Compound,Drywall w Paper)

Lab ID-Version#: 21288997-1

Sample Layers	Asbestos Content
Off-White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn D

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-3, Old OP Drywall Wall(Paint,Texture,Tape,Joint Compound,Drywall w Paper)

Lab ID-Version‡: 21288998-1

Sample Layers	Asbestos Content
Off-White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-4, Blue Cove Base & Mastic

Lab ID-Version‡: 21288999-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-5, Blue Cove Base & Mastic

Lab ID-Version‡: 21289000-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-6, Blue Cove Base & Mastic

Lab ID-Version‡: 21289001-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
 C/O: Chase Kirby
 Re: AZ1418.60; Kyrene District Office/Bus Barn D

Date of Sampling: 10-02-2025
 Date of Receipt: 10-03-2025
 Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-7, 2x2 Ceiling Tile

Lab ID-Version‡: 21289002-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	70% Cellulose 7% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-8, 2x2 Ceiling Tile

Lab ID-Version‡: 21289003-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	70% Cellulose 7% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-9, 2x2 Ceiling Tile

Lab ID-Version‡: 21289004-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	70% Cellulose 7% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-10, Silver Flex Duct Insulation

Lab ID-Version‡: 21289005-1

Sample Layers	Asbestos Content
Silver Insulation Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	80% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn D

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-11, Silver Flex Duct Insulation

Lab ID-Version‡: 21289006-1

Sample Layers	Asbestos Content
Silver Insulation Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	80% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-12, Silver Flex Duct Insulation

Lab ID-Version‡: 21289007-1

Sample Layers	Asbestos Content
Silver Insulation Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	80% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-13, 1x1 Ceiling Tile

Lab ID-Version‡: 21289008-1

Sample Layers	Asbestos Content
Tan Ceiling Tile with White Surface	ND
Brown Mastic	ND
Composite Non-Asbestos Content:	85% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-14, 1x1 Ceiling Tile

Lab ID-Version‡: 21289009-1

Sample Layers	Asbestos Content
Tan Ceiling Tile with White Surface	ND
Brown Mastic	ND
Composite Non-Asbestos Content:	85% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn D

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-15, 1x1 Ceiling Tile

Lab ID-Version‡: 21289010-1

Sample Layers	Asbestos Content
Tan Ceiling Tile with White Surface	ND
Brown Mastic	ND
Composite Non-Asbestos Content:	85% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn D

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Jason Bosse

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

www.eurofinsus.com/Built



East: (866) 871-1984

West/Central:(800) 651-4802

Built Environment Testing

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

REQUESTED SERVICES



004255730

Other Requests

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave., Phx, AZ 85027 Special Instructions:
Contact:	Chase Kirby	
Phone:	623-516-1415	

PROJECT INFORMATION

TURN AROUND TIME CODES - (TAT)

Project ID:	AZ1418.60		STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene District Office/Bus Barn (D)		ND - Next Business Day	
Project Zip Code:		Sampling Date/Time: 10/2/2025	SD - Same Business Day	
PO Number:	22015	By: CK	WH - Weekend/Holiday/ASAP	

[illegible]

SAMPLE TYPE CODES

BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	

RELINQUISHED BY

[Signature]

DATE & TIME

10/2/2025

RECEIVED BY

Talley Cox

DATE & TIME

10/3/25
4:09 pm

Report for:

Tracey Carpenter
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, Inc.
Project: AZ1418.11; Kyrene D.O. - Bldg E
EML ID: 3571421

Approved by:

Dates of Analysis:
Asbestos PLM: 03-13-2024



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, Inc. ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Dominion Environmental Consultants, Inc.
C/O: Tracey Carpenter
Re: AZ1418.11; Kyrene D.O. - Bldg E

Date of Sampling: 03-11-2024
Date of Receipt: 03-13-2024
Date of Report: 03-13-2024

ASBESTOS PLM REPORT

Total Samples Submitted: 9

Total Samples Analyzed: 9

Total Samples with Layer Asbestos Content > 1%: 0

Location: PLM-1, Light Blue 12"x12" VCT & Mastic

Lab ID-Version‡: 17453927-1

Sample Layers	Asbestos Content
Blue Tile (Light)	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-2, Light Blue 12"x12" VCT & Mastic

Lab ID-Version‡: 17453928-1

Sample Layers	Asbestos Content
Blue Tile (Light)	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-3, Light Blue 12"x12" VCT & Mastic

Lab ID-Version‡: 17453929-1

Sample Layers	Asbestos Content
Blue Tile (Light)	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Tracey Carpenter
Re: AZ1418.11; Kyrene D.O. - Bldg E

Date of Sampling: 03-11-2024
Date of Receipt: 03-13-2024
Date of Report: 03-13-2024

ASBESTOS PLM REPORT

Location: PLM-4, Dark Blue 12"x12" VCT & Mastic

Lab ID-Version‡: 17453930-1

Sample Layers	Asbestos Content
Blue Tile (Dark)	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-5, Dark Blue 12"x12" VCT & Mastic

Lab ID-Version‡: 17453931-1

Sample Layers	Asbestos Content
Blue Tile (Dark)	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-6, Dark Blue 12"x12" VCT & Mastic

Lab ID-Version‡: 17453932-1

Sample Layers	Asbestos Content
Blue Tile (Dark)	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Tracey Carpenter
Re: AZ1418.11; Kyrene D.O. - Bldg E

Date of Sampling: 03-11-2024
Date of Receipt: 03-13-2024
Date of Report: 03-13-2024

ASBESTOS PLM REPORT

Location: PLM-7, Blue Cove Base & Mastic

Lab ID-Version‡: 17453933-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Brown/Beige Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-8, Blue Cove Base & Mastic

Lab ID-Version‡: 17453934-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Brown/Beige Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-9, Blue Cove Base & Mastic

Lab ID-Version‡: 17453935-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Brown/Beige Mastic	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Marlton, NJ; 3000 Lincoln Dr E, Ste. A, Marlton, NJ 08053 * (866) 871-1984

Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 * (800) 651-4802

SSF, CA: 6000 Shoreline Ct, Ste. 205, S. San Francisco, CA 94080 * (866) 888-6653



003571421

ICES

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave, Bldg 7, Phoenix, AZ 85027
Contact:	Tracey Carpenter	Special Instructions: email results:
Phone:	(602) 989-9992	+carpenter@dominion-env.com

PROJECT INFORMATION

Project ID:	AZ1418.11		
Project Description:	Kyrene D.O- Bldg E		
Project Zip Code:	85044	Sampling Date/Time:	3/11/24@630 AM
PO Number:	316013	Sampled By:	T.J.

TURN AROUND TIME CODES - (TAT)

STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
ND - Next Business Day	
SD - Same Business Day	
WH - Weekend/Holiday/ASAP	

[illegible]

SAMPLE TYPE CODES

BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	
SAS - Surface Air Sampler	B - Bulk	SO - Soil	
NP - Non-potable Water	P - Potable Water	D - Dust	

RELINQUISHED BY

RELINQUISHED BY	DATE & TIME
	3/13/24
	@ 8 AM

DATE & TIME

RECEIVED BY	DATE & TIME
<i>Patricia Wgo</i>	<i>3/13/24 8:10</i>

RECEIVED BY

DATE & TIME

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at <http://www.emlab.com/s/main/serviceterms.html>

Report for:

Chase Kirby
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.60; Kyrene District Office/Bus Barn E
EML ID: 4255748

Approved by:

Dates of Analysis:
Asbestos PLM: 10-06-2025



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn E Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Total Samples Submitted: 24

Total Samples Analyzed: 24

Total Samples with Layer Asbestos Content > 1%: 0

Location: PLM-1, OP Drywall (Paint,Texture,Tape,Joint Compound, Drywall W Paper)

Lab ID-Version‡: 21288747-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Yellow Tape (Mesh)	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	10% Cellulose 5% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM-2, OP Drywall (Paint,Texture,Tape,Joint Compound, Drywall W Paper)

Lab ID-Version‡: 21288748-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn E

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-3, OP Drywall (Paint,Texture,Tape,Joint Compound, Drywall W Paper)

Lab ID-Version‡: 21288749-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
White Tape (Mesh)	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	10% Cellulose 5% Glass Fibers
Sample Composite Homogeneity:	Poor

Location: PLM-4, Dark Blue VCT & Mastic

Lab ID-Version‡: 21288750-1

Sample Layers	Asbestos Content
Blue Floor Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-5, Dark Blue VCT & Mastic

Lab ID-Version‡: 21288751-1

Sample Layers	Asbestos Content
Blue Floor Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-6, Dark Blue VCT & Mastic

Lab ID-Version‡: 21288752-1

Sample Layers	Asbestos Content
Blue Floor Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn E

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-7, Green VCT & Mastic

Lab ID-Version‡: 21288753-1

Sample Layers	Asbestos Content
Green Floor Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-8, Green VCT & Mastic

Lab ID-Version‡: 21288754-1

Sample Layers	Asbestos Content
Green Floor Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-9, Green VCT & Mastic

Lab ID-Version‡: 21288755-1

Sample Layers	Asbestos Content
Green Floor Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-10, Ceiling Tile

Lab ID-Version‡: 21288756-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn E

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-11, Ceiling Tile

Lab ID-Version‡: 21288757-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-12, Ceiling Tile

Lab ID-Version‡: 21288758-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-13, Replacement Ceiling Tile

Lab ID-Version‡: 21288759-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-14, Replacement Ceiling Tile

Lab ID-Version‡: 21288760-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
 C/O: Chase Kirby
 Re: AZ1418.60; Kyrene District Office/Bus Barn E

Date of Sampling: 10-02-2025
 Date of Receipt: 10-03-2025
 Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-15, Replacement Ceiling Tile

Lab ID-Version‡: 21288761-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-16, Dark Blue Cove Base & Mastic

Lab ID-Version‡: 21288762-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Brown Mastic	ND
Composite Non-Asbestos Content:	< 1% Wollastonite
Sample Composite Homogeneity:	Moderate

Location: PLM-17, Dark Blue Cove Base & Mastic

Lab ID-Version‡: 21288763-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Brown Mastic	ND
Composite Non-Asbestos Content:	< 1% Wollastonite
Sample Composite Homogeneity:	Moderate

Location: PLM-18, Dark Blue Cove Base & Mastic

Lab ID-Version‡: 21288764-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Brown Mastic	ND
Composite Non-Asbestos Content:	< 1% Wollastonite
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn E

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-19, Light Green VCT & Mastic

Lab ID-Version‡: 21288765-1

Sample Layers	Asbestos Content
Light Green Floor Tile	ND
Tan Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-20, Light Green VCT & Mastic

Lab ID-Version‡: 21288766-1

Sample Layers	Asbestos Content
Light Green Floor Tile	ND
Tan Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-21, Light Green VCT & Mastic

Lab ID-Version‡: 21288767-1

Sample Layers	Asbestos Content
Light Green Floor Tile	ND
Tan Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-22, Black Cove Base & Mastic

Lab ID-Version‡: 21288768-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn E

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-23, Black Cove Base & Mastic

Lab ID-Version‡: 21288769-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-24, Black Cove Base & Mastic

Lab ID-Version‡: 21288770-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn E

Date of Sampling: 10-02-2025
Date of Receipt: 10-03-2025
Date of Report: 10-06-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Jason Bosse

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

www.eurofinsus.com/Built



Built Environment Testing

East:(866) 871-1984

West/Central:(800) 651-4802

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

REQUESTED SERVICES

Non-Culturable		Culturable	
Spore Trap	Tape, Swab, Bulk	Biof Sw:	
Spore Trap Analysis			
Other biological particles - supplement			
Direct Microscopic Exam (Qualitative)			
Quantitative spore count direct exam			
Dust Characterization			
1-Media Surface Fungi (Genus ID + Asp. spp.)			
Culturable Air Fungi (Genus ID + Asp. spp.)			
Gram Stain and Counts (Culturable Air and Surface)			
Legionella culture			
Total Coliform, E. coli (Presence/Absence)			
Quantitative Tray-Sewage Screen			
OTHER (please specify test)			
Asbestos in Air - PCM Airborne Fiber Count (NIOSH)			
Asbestos Bulk - PLM (EPA method 600/R-93-116)			
Lead (Pb) / Paint Chip			
PCR (please specify test)			
Allergens (please specify test)			

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave., Phx, AZ 85027
Contact:	Chase Kirby	Special Instructions:
Phone:	623-516-1415	

PROJECT INFORMATION

TURN AROUND TIME CODES - (TAT)

PROJECT INFORMATION				STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project ID:	AZ1418.60			ND - Next Business Day	
Project Description:	Kyrene District Office/Bus Barn (E)			SD - Same Business Day	
Project Zip Code:		Sampling Date/Time:	10/2/2025	WH - Weekend/Holiday/ASAP	
PO Number:	22014	Sampled By:	CK		

[illegible]

SAMPLE TYPE CODES

BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	

RELINQUISHED BY



DATE & TIME

10/2/2025

RECEIVED BY

RECEIVED BY

DATE & TIME

10-3-25
4:09 pm

Report for:

Chase Kirby
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.60; Kyrene District Office/Bus Barn (F)
EML ID: 4255753

Approved by:

Dates of Analysis:
Asbestos PLM: 10-06-2025



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC

1501 West Knudsen Drive, Phoenix, AZ 85027

(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.

Date of Sampling: 10-03-2025

C/O: Chase Kirby

Date of Receipt: 10-03-2025

Re: AZ1418.60; Kyrene District Office/Bus Barn (F)

Date of Report: 10-06-2025

ASBESTOS PLM REPORT**Total Samples Submitted:** 15**Total Samples Analyzed:** 15**Total Samples with Layer Asbestos Content > 1%:** 0**Location: PLM-1, Concrete Foundation**

Lab ID-Version‡: 21288632-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity: Good	

Location: PLM-2, Concrete Foundation

Lab ID-Version‡: 21288633-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity: Good	

Location: PLM-3, Concrete Foundation

Lab ID-Version‡: 21288634-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity: Good	

Location: PLM-4, Window Glazing

Lab ID-Version‡: 21288635-1

Sample Layers	Asbestos Content
Black Window Glazing	ND
Sample Composite Homogeneity: Good	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (F) Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-5, Window Glazing

Lab ID-Version‡: 21288636-1

Sample Layers	Asbestos Content
Black Window Glazing	ND
Sample Composite Homogeneity:	Good

Location: PLM-6, Window Glazing

Lab ID-Version‡: 21288637-1

Sample Layers	Asbestos Content
Black Window Glazing	ND
Sample Composite Homogeneity:	Good

Location: PLM-7, Interior Frame Caulking

Lab ID-Version‡: 21288638-1

Sample Layers	Asbestos Content
Gray Caulk	ND
Sample Composite Homogeneity:	Good

Location: PLM-8, Interior Frame Caulking

Lab ID-Version‡: 21288639-1

Sample Layers	Asbestos Content
Gray Caulk	ND
Sample Composite Homogeneity:	Good

Location: PLM-9, Interior Frame Caulking

Lab ID-Version‡: 21288640-1

Sample Layers	Asbestos Content
Gray Caulk	ND
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (F) Date of Report: 10-06-2025

ASBESTOS PLM REPORT

Location: PLM-10, O.P. Drywall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version‡: 21288641-1

Sample Layers	Asbestos Content
Cream Paint	ND
White Texture	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-11, O.P. Drywall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version‡: 21288642-1

Sample Layers	Asbestos Content
Cream Paint	ND
White Texture	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-12, O.P. Drywall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version‡: 21288643-1

Sample Layers	Asbestos Content
Cream Paint	ND
White Texture	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-16, Brown Cove Base + Mastic

Lab ID-Version‡: 21288644-1

Sample Layers	Asbestos Content
Brown Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC

1501 West Knudsen Drive, Phoenix, AZ 85027

(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.

Date of Sampling: 10-03-2025

C/O: Chase Kirby

Date of Receipt: 10-03-2025

Re: AZ1418.60; Kyrene District Office/Bus Barn (F)

Date of Report: 10-06-2025

ASBESTOS PLM REPORT**Location: PLM-17, Brown Cove Base + Mastic**

Lab ID-Version‡: 21288645-1

Sample Layers	Asbestos Content
Brown Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-18, Brown Cove Base + Mastic

Lab ID-Version‡: 21288646-1

Sample Layers	Asbestos Content
Brown Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (F) Date of Report: 10-06-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Jason Bosse

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

www.eurofinsus.com/Built



East:(866) 871-1984

West/Central:(800) 651-4802

Built Environment Testing

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					



004255753

VICES

SAS	Soil
-----	------

Other Requests

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave., Phx, AZ 85027 Special Instructions:
Contact:	Chase Kirby	
Phone:	623-516-1415	

PROJECT INFORMATION

TURN AROUND TIME CODES - (TAT)

Project ID:	AZ1418.60			STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene District Office/Bus Barn (F)			ND - Next Business Day	
Project Zip Code:		Sampling Date/Time:	10/3/2025	SD - Same Business Day	
PO Number:	22023	Sampled By:	CK	WH - Weekend/Holiday/ASAP	

[illegible]

SAMPLE TYPE CODES				RELINQUISHED BY	DATE & TIME	RECEIVED BY	DATE & TIME
BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:		10/3/2025		10/3/25 4:01 pm
A1S - Andersen	ST - Spore Trap	SW - Swab					
SAS - Surface Air Sampler	B - Bulk	SO - Soil					
NP - Non-potable Water	P - Potable Water	D - Dust					

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at <http://www.emlab.com/s/main/serviceterms.html>

Report for:

Tracey Carpenter
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, Inc.
Project: AZ1418.11; Kyrene D.O. - Bldg G
EML ID: 3571418

Approved by:

Dates of Analysis:
Asbestos PLM: 03-13-2024



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, Inc. ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Dominion Environmental Consultants, Inc.
C/O: Tracey Carpenter
Re: AZ1418.11; Kyrene D.O. - Bldg G

Date of Sampling: 03-11-2024
Date of Receipt: 03-13-2024
Date of Report: 03-13-2024

ASBESTOS PLM REPORT

Total Samples Submitted: 12

Total Samples Analyzed: 12

Total Samples with Layer Asbestos Content > 1%: 0

Location: PLM-1, Brown Cove Base & Mastic

Lab ID-Version‡: 17453967-1

Sample Layers	Asbestos Content
Brown Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-2, Brown Cove Base & Mastic

Lab ID-Version‡: 17453968-1

Sample Layers	Asbestos Content
Brown Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-3, Brown Cove Base & Mastic

Lab ID-Version‡: 17453969-1

Sample Layers	Asbestos Content
Brown Cove Base	ND
Tan Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-4, Green Turf Carpet & Mastic

Lab ID-Version‡: 17453970-1

Sample Layers	Asbestos Content
Green Carpet (Artificial Turf)	ND
Tan Mastic	ND
Composite Non-Asbestos Content:	70% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Tracey Carpenter
Re: AZ1418.11; Kyrene D.O. - Bldg G

Date of Sampling: 03-11-2024
Date of Receipt: 03-13-2024
Date of Report: 03-13-2024

ASBESTOS PLM REPORT

Location: PLM-5, Green Turf Carpet & Mastic

Lab ID-Version‡: 17453971-1

Sample Layers	Asbestos Content
Green Carpet (Artificial Turf)	ND
Tan Mastic	ND
Composite Non-Asbestos Content:	70% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-6, Green Turf Carpet & Mastic

Lab ID-Version‡: 17453972-1

Sample Layers	Asbestos Content
Green Carpet (Artificial Turf)	ND
Tan Mastic	ND
Composite Non-Asbestos Content:	70% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-7, Tan 12"x12" VCT & Mastic

Lab ID-Version‡: 17453973-1

Sample Layers	Asbestos Content
Tan Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-8, Tan 12"x12" VCT & Mastic

Lab ID-Version‡: 17453974-1

Sample Layers	Asbestos Content
Tan Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Tracey Carpenter
Re: AZ1418.11; Kyrene D.O. - Bldg G

Date of Sampling: 03-11-2024
Date of Receipt: 03-13-2024
Date of Report: 03-13-2024

ASBESTOS PLM REPORT

Location: PLM-9, Tan 12"x12" VCT & Mastic

Lab ID-Version‡: 17453975-1

Sample Layers	Asbestos Content
Tan Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-10, Concrete

Lab ID-Version‡: 17453976-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity:	Good

Location: PLM-11, Concrete

Lab ID-Version‡: 17453977-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity:	Good

Location: PLM-12, Concrete

Lab ID-Version‡: 17453978-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Marlton, NJ: 3000 Lincoln Dr E, Ste. A, Marlton, NJ 08053 * (866) 871-1984

Phoenix, AZ: 1501 West Knaudsen Drive, Phoenix, AZ 85027 * (800) 651-4802

SSF, CA: 6000 Shoreline Ct, Ste. 205, S. San Francisco, CA 94080 * (866) 888-6653

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					



003571418

ICES

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave, Bldg 7, Phoenix, AZ 85027
Contact:	Tracey Carpenter	Special Instructions:
Phone:	(402) 989-9992	email results: +carpenter@dominion-env.com

PROJECT INFORMATION

Project ID:	A2 1418.11		STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene D.O. - Bldg G		ND - Next Business Day	
Project Zip Code:	85044	Sampling Date/Time: 3/11/24 @ 7AM	SD - Same Business Day	
PO Number:	316013	Sampled By: Tlc	WH - Weekend/Holiday/ASAP	

TURN AROUND TIME CODES - (TAT)

[illegible]

SAMPLE TYPE CODES

BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	
SAS - Surface Air Sampler	B - Bulk	SO - Soil	
NP - Non-potable Water	P - Potable Water	D - Dust	

RELINQUISHED BY

Gracefair	3/13/24 @ 8AM
-----------	------------------

DATE & TIME

RECEIVED BY	DATE & TIME
Rafael Wagos	3/13/24 8:10

RECEIVED BY

DESCRIPTION	DATE & TIME
Patty wages	3/13/24 8:10

DATE & TIME

13/24 8/10

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at <http://www.emlab.com/s/main/serviceterms.html>

Report for:

Chase Kirby
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.60; Kyrene District Office/Bus Barn G
EML ID: 4255751

Approved by:

Dates of Analysis:
Asbestos PLM: 10-07-2025



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn G

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Total Samples Submitted: 12

Total Samples Analyzed: 12

Total Samples with Layer Asbestos Content > 1%: 0

Location: PLM-1, Gray Cove Base & Mastic

Lab ID-Version‡: 21289038-1

Sample Layers	Asbestos Content
Gray Cove Base	ND
Off-White Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-2, Gray Cove Base & Mastic

Lab ID-Version‡: 21289039-1

Sample Layers	Asbestos Content
Gray Cove Base	ND
Off-White Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-3, Gray Cove Base & Mastic

Lab ID-Version‡: 21289040-1

Sample Layers	Asbestos Content
Gray Cove Base	ND
Off-White Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn G Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-4, OP Drywall Wall(Paint,Texture,Tape,Joint Compound,Drywall w Paper)

Lab ID-Version‡: 21289041-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Off-White Paint	ND
White Texture 2	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-5, OP Drywall Wall(Paint,Texture,Tape,Joint Compound,Drywall w Paper)

Lab ID-Version‡: 21289042-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Off-White Paint	ND
White Texture 2	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn G

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-6, OP Drywall Wall(Paint,Texture,Tape,Joint Compound,Drywall w Paper)

Lab ID-Version‡: 21289043-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Off-White Paint	ND
White Texture 2	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-7, Blue Multicolor Carpet Squares & Mastic

Lab ID-Version‡: 21289044-1

Sample Layers	Asbestos Content
Blue Carpet	ND
Multicolored Mastic	ND
Composite Non-Asbestos Content:	50% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-8, Blue Multicolor Carpet Squares & Mastic

Lab ID-Version‡: 21289045-1

Sample Layers	Asbestos Content
Blue Carpet	ND
Multicolored Mastic	ND
Composite Non-Asbestos Content:	50% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn G Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-9, Blue Multicolor Carpet Squares & Mastic

Lab ID-Version‡: 21289046-1

Sample Layers	Asbestos Content
Blue Carpet	ND
Multicolored Mastic	ND
Composite Non-Asbestos Content:	50% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-10, Box Duct Insulation

Lab ID-Version‡: 21289047-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Off-White Insulation	ND
Composite Non-Asbestos Content:	85% Glass Fibers 5% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-11, Box Duct Insulation

Lab ID-Version‡: 21289048-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Off-White Insulation	ND
Composite Non-Asbestos Content:	85% Glass Fibers 5% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-12, Box Duct Insulation

Lab ID-Version‡: 21289049-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Off-White Insulation	ND
Composite Non-Asbestos Content:	85% Glass Fibers 5% Cellulose
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn G

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Jason Bosse

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

www.eurofinsus.com/Built



Built Environment Testing

East:(866) 871-1984

West/Central:(800) 651-4802

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

REQUESTED SERVICES

Non-Culturable		Culturable		Other Requests	
Spore Trap	Tape, Swab, Bulk	Fungus: Bacteria: Parasites: Molds: Yeasts: Viruses: Prions: Other:		Other Requests: Other Requests:	
Spore Trap Analysis					
Other biological particles - supplement					
Direct Microscopic Exam (Qualitative)					
Quantitative spore count direct exam					
Dust Characterization					
1-Media Surface Fungi (Genus ID + Asp. spp.)					
Culturable Air Fungi (Genus ID + Asp. spp.)					
Gram Stain and Counts (Culturable Air an					
Legionella culture					
Total Coliform, <i>E. coli</i> (Presence/Absen					
QuantTray-Sewage Screen					
OTHER: (please specify test)					
Asbestos in Air - PCM Airborne					
Asbestos Bulk - PLM (EPA method 600/4					
Lead (Pb) / Paint Chip					
PCR (please specify test)					
Allergens (please specify test)					

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave., Phx, AZ 85027 Special Instructions:
Contact:	Chase Kirby	
Phone:	623-516-1415	

PROJECT INFORMATION

TURN AROUND TIME CODES - (TAT)

Project ID:	AZ1418.60		STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene District Office/Bus Barn (G)		ND - Next Business Day	
Project Zip Code:		Sampling Date/Time: 10/3/2025	SD - Same Business Day	
PO Number:	22021	Sampled By: CK	WH - Weekend/Holiday/ASAP	

[illegible]

SAMPLE TYPE CODES

BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	

RELINQUISHED BY

[Signature]

DATE & TIME

10/3/2025

RECEIVED BY

[illegible]

DATE & TIME

10-3-25

Report for:

Chase Kirby
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.60; Kyrene District Office/Bus Barn (K)
EML ID: 4255758

Approved by:

Dates of Analysis:
Asbestos PLM: 10-07-2025



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC

1501 West Knudsen Drive, Phoenix, AZ 85027

(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.

Date of Sampling: 10-03-2025

C/O: Chase Kirby

Date of Receipt: 10-03-2025

Re: AZ1418.60; Kyrene District Office/Bus Barn (K)

Date of Report: 10-07-2025

ASBESTOS PLM REPORT**Total Samples Submitted:** 27**Total Samples Analyzed:** 27**Total Samples with Layer Asbestos Content > 1%:** 0**Location: PLM-1, Gray Wallpaper Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)**

Lab ID-Version‡: 21288669-1

Sample Layers	Asbestos Content
Multicolored Wallpaper	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-2, Gray Wallpaper Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version‡: 21288670-1

Sample Layers	Asbestos Content
Multicolored Wallpaper	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-3, Gray Wallpaper Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version‡: 21288671-1

Sample Layers	Asbestos Content
Multicolored Wallpaper	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (K) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-4, Blue Cove Base + Mastic

Lab ID-Version‡: 21288672-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-5, Blue Cove Base + Mastic

Lab ID-Version‡: 21288673-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-6, Blue Cove Base + Mastic

Lab ID-Version‡: 21288674-1

Sample Layers	Asbestos Content
Blue Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-7, 2x2 Gray Carpet Mastic

Lab ID-Version‡: 21288675-1

Sample Layers	Asbestos Content
Gray Carpet	ND
Semi-Transparent Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
 C/O: Chase Kirby Date of Receipt: 10-03-2025
 Re: AZ1418.60; Kyrene District Office/Bus Barn (K) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-8, 2x2 Gray Carpet Mastic

Lab ID-Version‡: 21288676-1

Sample Layers	Asbestos Content
Gray Carpet	ND
Semi-Transparent Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-9, 2x2 Gray Carpet Mastic

Lab ID-Version‡: 21288677-1

Sample Layers	Asbestos Content
Gray Carpet	ND
Semi-Transparent Mastic	ND
Composite Non-Asbestos Content:	40% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-10, 12x12 VCT + Mastic

Lab ID-Version‡: 21288678-1

Sample Layers	Asbestos Content
White Floor Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-11, 12x12 VCT + Mastic

Lab ID-Version‡: 21288679-1

Sample Layers	Asbestos Content
White Floor Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (K) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-12, 12x12 VCT + Mastic

Lab ID-Version‡: 21288680-1

Sample Layers	Asbestos Content
White Floor Tile	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-13, 2x4 Ceiling Tile

Lab ID-Version‡: 21288681-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-14, 2x4 Ceiling Tile

Lab ID-Version‡: 21288682-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-15, 2x4 Ceiling Tile

Lab ID-Version‡: 21288683-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Cellulose 40% Glass Fibers
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (K) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-16, 2x2 Ceiling Tile (Drywall)

Lab ID-Version‡: 21288684-1

Sample Layers	Asbestos Content
White Drywall Ceiling Tile	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Good

Location: PLM-17, 2x2 Ceiling Tile (Drywall)

Lab ID-Version‡: 21288685-1

Sample Layers	Asbestos Content
White Drywall Ceiling Tile	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Good

Location: PLM-18, 2x2 Ceiling Tile (Drywall)

Lab ID-Version‡: 21288686-1

Sample Layers	Asbestos Content
White Drywall Ceiling Tile	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Good

Location: PLM-19, Silver Flex Duct

Lab ID-Version‡: 21288687-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	75% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-20, Silver Flex Duct

Lab ID-Version‡: 21288688-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	75% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (K) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-21, Silver Flex Duct

Lab ID-Version‡: 21288689-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	75% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-22, Batt Insulation

Lab ID-Version‡: 21288690-1

Sample Layers	Asbestos Content
Pink Insulation	ND
Composite Non-Asbestos Content:	99% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-23, Batt Insulation

Lab ID-Version‡: 21288691-1

Sample Layers	Asbestos Content
Pink Insulation	ND
Composite Non-Asbestos Content:	99% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-24, Batt Insulation

Lab ID-Version‡: 21288692-1

Sample Layers	Asbestos Content
Pink Insulation	ND
Composite Non-Asbestos Content:	99% Glass Fibers
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (K) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-25, Silver Box Insulation

Lab ID-Version‡: 21288693-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Yellow Insulation	ND
Composite Non-Asbestos Content:	60% Glass Fibers 5% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-26, Silver Box Insulation

Lab ID-Version‡: 21288694-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Yellow Insulation	ND
Composite Non-Asbestos Content:	60% Glass Fibers 5% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-27, Silver Box Insulation

Lab ID-Version‡: 21288695-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Yellow Insulation	ND
Composite Non-Asbestos Content:	60% Glass Fibers 5% Cellulose
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-03-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (K) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Renee Luna-Trepczynski

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

www.eurofinsus.com/Built



Built Environment Testing

East:(866) 871-1984

West/Central: (800) 651-4802

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

REQUESTED SERVICES

Non-Culturable		Culturable		Other Requests
_____	_____	BioCassette™ Andersen, SAS, Soil		



004255758

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave., Phx, AZ 85027
Contact:	Chase Kirby	Special Instructions:
Phone:	623-516-1415	

PROJECT INFORMATION

TURN AROUND TIME CODES - (TAT)

Project ID:	AZ1418.60			STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene District Office/Bus Barn (K)			ND - Next Business Day	
Project Zip Code:		Sampling Date/Time	10/3/2025	SD - Same Business Day	
PO Number:	22022	Sampled By	CK	WH - Weekend/Holiday/ASAP	

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	Gray Wallpaper Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)	B	STD		
PLM 4-6	Blue Cove Base + Mastic	B	STD		
PLM 7-9	2x2 Gray Carpet Mastic	B	STD		
PLM 10-12	12x12 VCT + Mastic	B	STD		
PLM 13-15	2x4 Ceiling Tile	B	STD		
PLM 16-18	2x2 Ceiling Tile (Drywall)	B	STD		
PLM 19-21	Silver Flex Duct	B	STD		
PLM 22-24	Batt Insulation	B	STD		
PLM 25-27	Silver Box Insulation	B	STD		

SAMPLE TYPE CODES			
BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	
SAS - Surface Air Sampler	B - Bulk	SO - Soil	
NP - Non-potable Water	P - Potable Water	D - Dust	

RELINQUISHED BY	DATE & TIME
	10/3/2025

RECEIVED BY	DATE & TIME
Paley Hugo	10/3/25 4:09pm

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at <http://www.emlab.com/s/main/serviceterms.html>

Report for:

Chase Kirby
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.60; Kyrene District Office/Bus Barn M
EML ID: 4255732

Approved by:

Dates of Analysis:
Asbestos PLM: 10-06-2025



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC

1501 West Knudsen Drive, Phoenix, AZ 85027

(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.

Date of Sampling: 10-02-2025

C/O: Chase Kirby

Date of Receipt: 10-03-2025

Re: AZ1418.60; Kyrene District Office/Bus Barn M

Date of Report: 10-06-2025

ASBESTOS PLM REPORT**Total Samples Submitted:** 3**Total Samples Analyzed:** 3**Total Samples with Layer Asbestos Content > 1%:** 0**Location: PLM-1, Concrete Foundation**

Lab ID-Version‡: 21288964-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-2, Concrete Foundation

Lab ID-Version‡: 21288965-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-3, Concrete Foundation

Lab ID-Version‡: 21288966-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn M Date of Report: 10-06-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Shelby Brown

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

www.eurofinsus.com/Built



Built Environment Testing

East:(866) 871-1984

West/Central:(800) 651-4802

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

REQUESTED SERVICES

Non-Culturable		Culturable	Other Requests
Spore Trap	Tape, Swab, Bulk	BioCassette™ Andersen, SAS, Swab, Water, Bulk, Dust, Soil, Contact Plate	

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave., Phx, AZ 85027 Special Instructions:
Contact:	Chase Kirby	
Phone:	623-516-1415	

PROJECT INFORMATION

TURN AROUND TIME CODES - (TAT)

Project ID:	AZ1418.60			STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene District Office/Bus Barn (M)			ND - Next Business Day	
Project Zip Code:		Sampling Date/Time:	10/2/2025	SD - Same Business Day	
		Sampled By:	CK	WH - Weekend/Holiday/ASAP	
PO Number:	22019				

[illegible]

SAMPLE TYPE CODES

BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	

RELINQUISHED BY

[Signature]

DATE & TIME

10/2/2025

RECEIVED BY

DATE & TIME

10-3-2
H. 200

Report for:

Chase Kirby
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.60; Kyrene District Office/Bus Barn (O)
EML ID: 4255749

Approved by:

Dates of Analysis:
Asbestos PLM: 10-07-2025



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC

1501 West Knudsen Drive, Phoenix, AZ 85027

(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.

Date of Sampling: 10-02-2025

C/O: Chase Kirby

Date of Receipt: 10-03-2025

Re: AZ1418.60; Kyrene District Office/Bus Barn (O)

Date of Report: 10-07-2025

ASBESTOS PLM REPORT**Total Samples Submitted:** 3**Total Samples Analyzed:** 3**Total Samples with Layer Asbestos Content > 1%:** 0**Location: PLM-1, Concrete Foundation**

Lab ID-Version‡: 21288771-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity: Good	

Location: PLM-2, Concrete Foundation

Lab ID-Version‡: 21288772-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity: Good	

Location: PLM-3, Concrete Foundation

Lab ID-Version‡: 21288773-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity: Good	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (O) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Aaron Agajanian

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

www.eurofinsus.com/Built



East:(866) 871-1984

West/Central:(800) 651-4802

Built Environment Testing

WEATHER		Fog	Rain	Snow	Wind	C
LEVEL	None					
	Light					
	Moderate					
	Heavy					



004255749

SERVICES

sen, SAS,
Dust, Soil,
e

Other Requests

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave., Phx, AZ 85027
Contact:	Chase Kirby	Special Instructions:
Phone:	623-516-1415	

PROJECT INFORMATION

TURN AROUND TIME CODES - (TAT)

Project ID:	AZ1418.60			STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene District Office/Bus Barn (O)			ND - Next Business Day	
Project Zip Code:		Sampling Date/Time:	10/2/2025	SD - Same Business Day	
PO Number:	22020	Sampled By:	CK	WH - Weekend/Holiday/ASAP	

[illegible]

SAMPLE TYPE CODES

BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	

RELINQUISHED BY



DATE & TIME

10/2/2025

RECEIVED BY

Taller had

DATE & TIME

10/31/25
4:09 pm

Report for:

Chase Kirby
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.60; Kyrene District Office/Bus Barn (T)
EML ID: 4255754

Approved by:

Dates of Analysis:
Asbestos PLM: 10-07-2025



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Aerotech Built Environment Testing, LLC

1501 West Knudsen Drive, Phoenix, AZ 85027

(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.

Date of Sampling: 10-02-2025

C/O: Chase Kirby

Date of Receipt: 10-03-2025

Re: AZ1418.60; Kyrene District Office/Bus Barn (T)

Date of Report: 10-07-2025

ASBESTOS PLM REPORT**Total Samples Submitted:** 30**Total Samples Analyzed:** 30**Total Samples with Layer Asbestos Content > 1%:** 0**Location: PLM-1, O.P Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)**

Lab ID-Version#: 21288782-1

Sample Layers	Asbestos Content
Light Gray Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-2, O.P Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version#: 21288783-1

Sample Layers	Asbestos Content
Light Gray Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (T) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-3, O.P Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version‡: 21288784-1

Sample Layers	Asbestos Content
Light Gray Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-4, Gray Cove Base + Mastic

Lab ID-Version‡: 21288785-1

Sample Layers	Asbestos Content
Gray Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-5, Gray Cove Base + Mastic

Lab ID-Version‡: 21288786-1

Sample Layers	Asbestos Content
Gray Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-6, Gray Cove Base + Mastic

Lab ID-Version‡: 21288787-1

Sample Layers	Asbestos Content
Gray Cove Base	ND
Cream Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (T) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-7, Gray 2x2 Ceiling Tile

Lab ID-Version‡: 21288788-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 15% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-8, Gray 2x2 Ceiling Tile

Lab ID-Version‡: 21288789-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 15% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-9, Gray 2x2 Ceiling Tile

Lab ID-Version‡: 21288790-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 15% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-10, Multicolor Carpet Square + Mastic

Lab ID-Version‡: 21288791-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers 3% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (T) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-11, Multicolor Carpet Square + Mastic

Lab ID-Version‡: 21288792-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers 3% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-12, Multicolor Carpet Square + Mastic

Lab ID-Version‡: 21288793-1

Sample Layers	Asbestos Content
Multicolored Carpet	ND
Yellow Mastic	ND
Composite Non-Asbestos Content:	60% Synthetic Fibers 3% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-13, Floor Expansion Joint

Lab ID-Version‡: 21288794-1

Sample Layers	Asbestos Content
Gray Expansion Joint	ND
Sample Composite Homogeneity:	Good

Location: PLM-14, Floor Expansion Joint

Lab ID-Version‡: 21288795-1

Sample Layers	Asbestos Content
Gray Expansion Joint	ND
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (T) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-15, Floor Expansion Joint

Lab ID-Version‡: 21288796-1

Sample Layers	Asbestos Content
Gray Expansion Joint	ND
Sample Composite Homogeneity:	Good

Location: PLM-16, Skip Trowel Drywall (Paint, texture, tape, j.c., drywall)

Lab ID-Version‡: 21288797-1

Sample Layers	Asbestos Content
Tan Paint	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-17, Skip Trowel Drywall (Paint, texture, tape, j.c., drywall)

Lab ID-Version‡: 21288798-1

Sample Layers	Asbestos Content
Tan Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Aerotech Built Environment Testing, LLC

1501 West Knudsen Drive, Phoenix, AZ 85027

(800) 651-4802 www.eurofinsus.com/Built

Client: Dominion Environmental Consultants, Inc.

Date of Sampling: 10-02-2025

C/O: Chase Kirby

Date of Receipt: 10-03-2025

Re: AZ1418.60; Kyrene District Office/Bus Barn (T)

Date of Report: 10-07-2025

ASBESTOS PLM REPORT**Location: PLM-18, Skip Trowel Drywall (Paint, texture, tape, j.c., drywall)**

Lab ID-Version‡: 21288799-1

Sample Layers	Asbestos Content
Tan Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-19, Concrete

Lab ID-Version‡: 21288800-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-20, Concrete

Lab ID-Version‡: 21288801-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity:	Moderate

Location: PLM-21, Concrete

Lab ID-Version‡: 21288802-1

Sample Layers	Asbestos Content
Gray Concrete	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
 C/O: Chase Kirby Date of Receipt: 10-03-2025
 Re: AZ1418.60; Kyrene District Office/Bus Barn (T) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-22, Black Cove Base + Mastic

Lab ID-Version‡: 21288803-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Brown Mastic	ND
Composite Non-Asbestos Content:	< 1% Talc
Sample Composite Homogeneity:	Moderate

Location: PLM-23, Black Cove Base + Mastic

Lab ID-Version‡: 21288804-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Brown Mastic	ND
Composite Non-Asbestos Content:	< 1% Talc
Sample Composite Homogeneity:	Moderate

Location: PLM-24, Black Cove Base + Mastic

Lab ID-Version‡: 21288805-1

Sample Layers	Asbestos Content
Black Cove Base	ND
Brown Mastic	ND
Composite Non-Asbestos Content:	< 1% Talc
Sample Composite Homogeneity:	Moderate

Location: PLM-25, Brown Cove Base + Mastic

Lab ID-Version‡: 21288806-1

Sample Layers	Asbestos Content
Brown Cove Base	ND
Yellow Mastic	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (T) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-26, Brown Cove Base + Mastic

Lab ID-Version‡: 21288807-1

Sample Layers	Asbestos Content
Brown Cove Base	ND
Yellow Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-27, Brown Cove Base + Mastic

Lab ID-Version‡: 21288808-1

Sample Layers	Asbestos Content
Brown Cove Base	ND
Yellow Mastic	ND
Sample Composite Homogeneity: Moderate	

Location: PLM-28, Interior Frame Caulking

Lab ID-Version‡: 21288809-1

Sample Layers	Asbestos Content
Gray Caulk	ND
Sample Composite Homogeneity: Good	

Location: PLM-29, Interior Frame Caulking

Lab ID-Version‡: 21288810-1

Sample Layers	Asbestos Content
Gray Caulk	ND
Sample Composite Homogeneity: Good	

Location: PLM-30, Interior Frame Caulking

Lab ID-Version‡: 21288811-1

Sample Layers	Asbestos Content
Gray Caulk	ND
Sample Composite Homogeneity: Good	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 10-02-2025
C/O: Chase Kirby Date of Receipt: 10-03-2025
Re: AZ1418.60; Kyrene District Office/Bus Barn (T) Date of Report: 10-07-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Michael Williams

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

www.eurofinsus.com/Built



East:(866) 871-1984

West/Central:(800) 651-4802

Built Environment Testing

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

REQUESTED SERVICES

Non-Culturable	Culturable	Other Requests
	BioCrest™, A. L. L. SAS, it. Soil	



004255754

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave., Phx, AZ 85027 Special Instructions:
Contact:	Chase Kirby	
Phone:	623-516-1415	

PROJECT INFORMATION

TURN AROUND TIME CODES - (TAT)

Project ID:	AZ1418.60			STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene District Office/Bus Barn (T)			ND - Next Business Day	
Project Zip Code:		Sampling Date/Time:	10/2/2025	SD - Same Business Day	
PO Number:	22018	Sampled By:	CK	WH - Weekend/Holiday/ASAP	

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	O.P. Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)	B	STD		
PLM 4-6	Gray Cove Base + Mastic	B	STD		
PLM 7-9	Gray 2x2 Ceiling Tile	B	STD		
PLM 10-12	Multicolor Carpet Square + Mastic	B	STD		
PLM 13-15	Floor Expansion Joint	B	STD		
PLM 16-18	Skip Trowel Drywall (paint, texture, tape, j.c., drywall)	B	STD		
PLM 19-21	Concrete	B	STD		
PLM 22-24	Black Cove Base + Mastic	B	STD		
PLM 25-27	Brown Cove Base + Mastic	B	STD		
PLM 28-30	Interior Frame Caulking	B	STD		

[illegible]

SAMPLE TYPE CODES

BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	

RELINQUISHED BY

RELINQUISHED BY

DATE & TIME

10/2/2025

RECEIVED BY

RECEIVED BY
Patty Wagon

DATE & TIME

10/3/28
4:09pm

Report for:

Tracey Carpenter
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, Inc.
Project: AZ1418.11; Kyrene Dist Office Bldg W
EML ID: 3571415

Approved by:

Dates of Analysis:
Asbestos PLM: 03-13-2024



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, Inc. ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Dominion Environmental Consultants, Inc.
C/O: Tracey Carpenter
Re: AZ1418.11; Kyrene Dist Office Bldg W

Date of Sampling: 03-11-2024
Date of Receipt: 03-13-2024
Date of Report: 03-13-2024

ASBESTOS PLM REPORT

Total Samples Submitted: 3

Total Samples Analyzed: 3

Total Samples with Layer Asbestos Content > 1%: 0

Location: PLM-1, Popcorn Ceiling Drywall System

Lab ID-Version‡: 17454002-1

Sample Layers	Asbestos Content
White Popcorn Ceiling	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose < 1% Polyethylene
Sample Composite Homogeneity:	Poor

Location: PLM-2, Popcorn Ceiling Drywall System

Lab ID-Version‡: 17454003-1

Sample Layers	Asbestos Content
White Popcorn Ceiling	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose < 1% Polyethylene
Sample Composite Homogeneity:	Poor

Location: PLM-3, Popcorn Ceiling Drywall System

Lab ID-Version‡: 17454004-1

Sample Layers	Asbestos Content
White Popcorn Ceiling	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Brown Semi-Fibrous Material	ND
Composite Non-Asbestos Content:	20% Cellulose < 1% Glass Fibers < 1% Polyethylene
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Marlton, NJ: 3000 Lincoln Dr E, Ste. A, Marlton, NJ 08053 * (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 * (800) 651-4802
SSF, CA: 6000 Shoreline Ct, Ste. 205, S. San Francisco, CA 94080 * (866) 888-6653



003571415

ICES

WEATHER		Fog	Rain	Snow	Wind	Clear
LEVEL	None					
	Light					
	Moderate					
	Heavy					

CONTACT INFORMATION				
Company:	Dominion Environmental Consultants		Address: 20045 N. 19th Ave, Bldg 7, Phoenix, AZ 85027	
Contact:	Tracey Carpenter		Special Instructions:	
Phone:	(602) 989-9992		email results: tcarpenter@dominion-env.com	
PROJECT INFORMATION			TURN AROUND TIME CODES - (TAT)	
Project ID:	AZ 1418.11		STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene Dist Office Bldg W		ND - Next Business Day	
Project Zip Code:	85044	Sampling Date/Time: 3/11/24 @ TAM	SD - Same Business Day	
PO Number:	316013	Sampled By: TLL	WH - Weekend/Holiday/ASAP	

[illegible]

SAMPLE TYPE CODES			
BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	
SAS - Surface Air Sampler	B - Bulk	SO - Soil	
NP - Non-potable Water	P - Potable Water	D - Dust	

RELINQUISHED BY	DATE & TIME
Gracey Corp	3/13/24 @ 8 AM

Spore Trap		Tape, Swab, Bulk	BioCassette™, Andersen, SAS, Swab, Water, Bulk, Dust, Soil, Contact Plate	Other Requests
Spore Trap Analysis				
Other biological particles - supplement				
Direct Microscopic Exam (Qualitative)				
Qualitative spore count direct exam				
Dust Characterization				
1-Media Surface Fungi (Genus ID + Asp. spp.)				
Culturable Air Fungi (Genus ID + Asp. spp.)				
Gram Stain and Counts (Culturable Air and Surface Bacteria)				
Legionella culture				
Total Coliform, E. coli (Presence/Absence)				
QuantTray-Sewage Screen				
OTHER: (please specify test)				
Asbestos in Air - PCM Airborne Fiber Count (NIOSH 7400)				
Asbestos Bulk - PLM (EPA method 600/1R-116)				
Lead (Pb)				
PCR (please specify test)				
Allergens (please specify test)				

RECEIVED BY

Patterson Wago

DATE & TIME

3/13/24 8:10am

Report for:

Chase Kirby
Dominion Environmental Consultants, Inc.
20045 N. 19th Ave, Bldg 7
Phoenix, AZ 85027

Regarding: Eurofins Aerotech Built Environment Testing, LLC
Project: AZ1418.60; Kyrene District Office/Bus Barn (W)
EML ID: 4255743

Approved by:

Dates of Analysis:
Asbestos PLM: 10-07-2025



Approved Signatory
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)
NVLAP Lab Code 500031-0

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn (W)

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Total Samples Submitted:	30
Total Samples Analyzed:	30
Total Samples with Layer Asbestos Content > 1%:	0

Location: PLM-1, O.P. Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version#: 21288821-1

Sample Layers	Asbestos Content
White Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-2, O.P. Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version#: 21288822-1

Sample Layers	Asbestos Content
White Texture	ND
Peach Paint	ND
White Texture 2	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn (W)

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-3, O.P. Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version‡: 21288823-1

Sample Layers	Asbestos Content
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-4, 2x2 Ceiling Tile

Lab ID-Version‡: 21288824-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 5% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-5, 2x2 Ceiling Tile

Lab ID-Version‡: 21288825-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 5% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-6, 2x2 Ceiling Tile

Lab ID-Version‡: 21288826-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	60% Cellulose 5% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn (W)

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-7, 2x4 Ceiling Tile

Lab ID-Version‡: 21288827-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Glass Fibers 30% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-8, 2x4 Ceiling Tile

Lab ID-Version‡: 21288828-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Glass Fibers 30% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-9, 2x4 Ceiling Tile

Lab ID-Version‡: 21288829-1

Sample Layers	Asbestos Content
Gray Ceiling Tile with White Surface	ND
Composite Non-Asbestos Content:	40% Glass Fibers 30% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-10, Brown Cove Base + Mastic

Lab ID-Version‡: 21288830-1

Sample Layers	Asbestos Content
Brown Cove Base	ND
Tan Mastic	ND
Brown Mastic	ND
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn (W)

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-11, Brown Cove Base + Mastic

Lab ID-Version‡: 21288831-1

Sample Layers	Asbestos Content
Brown Cove Base	ND
Tan Mastic	ND
Brown Mastic	ND
Sample Composite Homogeneity: Poor	

Location: PLM-12, Brown Cove Base + Mastic

Lab ID-Version‡: 21288832-1

Sample Layers	Asbestos Content
Brown Cove Base	ND
Tan Mastic	ND
Brown Mastic	ND
Sample Composite Homogeneity: Poor	

Location: PLM-13, Heavy Texture D.W. (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version‡: 21288833-1

Sample Layers	Asbestos Content
Beige Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity: Poor	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn (W)

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-14, Heavy Texture D.W. (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version‡: 21288834-1

Sample Layers	Asbestos Content
Beige Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-15, Heavy Texture D.W. (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)

Lab ID-Version‡: 21288835-1

Sample Layers	Asbestos Content
Beige Paint	ND
White Texture	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-16, Popcorn Ceiling Tile

Lab ID-Version‡: 21288836-1

Sample Layers	Asbestos Content
White Popcorn Ceiling	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn (W)

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-17, Popcorn Ceiling Tile

Lab ID-Version‡: 21288837-1

Sample Layers	Asbestos Content
White Popcorn Ceiling	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-18, Popcorn Ceiling Tile

Lab ID-Version‡: 21288838-1

Sample Layers	Asbestos Content
White Popcorn Ceiling	ND
Cream Tape	ND
White Joint Compound	ND
White Drywall with Brown Paper	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Poor

Location: PLM-19, Gray Duct Mastic

Lab ID-Version‡: 21288839-1

Sample Layers	Asbestos Content
Gray Mastic	ND
Sample Composite Homogeneity:	Good

Location: PLM-20, Gray Duct Mastic

Lab ID-Version‡: 21288840-1

Sample Layers	Asbestos Content
Gray Mastic	ND
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn (W)

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-21, Gray Duct Mastic

Lab ID-Version‡: 21288841-1

Sample Layers	Asbestos Content
Gray Mastic	ND
Sample Composite Homogeneity:	Good

Location: PLM-22, Silver Flex Duct Insulation

Lab ID-Version‡: 21288842-1

Sample Layers	Asbestos Content
Silver Foil Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	60% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-23, Silver Flex Duct Insulation

Lab ID-Version‡: 21288843-1

Sample Layers	Asbestos Content
Silver Foil Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	70% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: PLM-24, Silver Flex Duct Insulation

Lab ID-Version‡: 21288844-1

Sample Layers	Asbestos Content
Silver Foil Wrap	ND
Pink Insulation	ND
Composite Non-Asbestos Content:	60% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
 C/O: Chase Kirby
 Re: AZ1418.60; Kyrene District Office/Bus Barn (W)

Date of Sampling: 10-03-2025
 Date of Receipt: 10-03-2025
 Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-25, Silver Duct Insulation

Lab ID-Version‡: 21288845-1

Sample Layers	Asbestos Content
Silver Foil Wrap	ND
Yellow Insulation	ND
Composite Non-Asbestos Content:	60% Glass Fibers 15% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-26, Silver Duct Insulation

Lab ID-Version‡: 21288846-1

Sample Layers	Asbestos Content
Silver Foil Wrap	ND
Yellow Insulation	ND
Composite Non-Asbestos Content:	60% Glass Fibers 15% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-27, Silver Duct Insulation

Lab ID-Version‡: 21288847-1

Sample Layers	Asbestos Content
Silver Foil Wrap	ND
Yellow Insulation	ND
Composite Non-Asbestos Content:	70% Glass Fibers 10% Cellulose
Sample Composite Homogeneity:	Moderate

Location: PLM-28, Pink Batt Insulation

Lab ID-Version‡: 21288848-1

Sample Layers	Asbestos Content
Pink Insulation	ND
Composite Non-Asbestos Content:	95% Glass Fibers
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn (W)

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

Location: PLM-29, Pink Batt Insulation

Lab ID-Version‡: 21288849-1

Sample Layers	Asbestos Content
Pink Insulation	ND
Composite Non-Asbestos Content:	95% Glass Fibers
Sample Composite Homogeneity:	Good

Location: PLM-30, Pink Batt Insulation

Lab ID-Version‡: 21288850-1

Sample Layers	Asbestos Content
Pink Insulation	ND
Composite Non-Asbestos Content:	95% Glass Fibers
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.
C/O: Chase Kirby
Re: AZ1418.60; Kyrene District Office/Bus Barn (W)

Date of Sampling: 10-03-2025
Date of Receipt: 10-03-2025
Date of Report: 10-07-2025

ASBESTOS PLM REPORT

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Aaron Agajanian

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

www.eurofinsus.com/Built



East:(866) 871-1984

West/Central:(800) 651-4802

Built Environment Testing

WEATHER		Fog	Rain	Snow	W
LEVEL	None				
	Light				
	Moderate				
	Heavy				



004255743

D SERVICES

able	Other Requests
densen, SAS, lk, Dust, Soil, Plate	

CONTACT INFORMATION

Company:	Dominion Environmental Consultants	Address: 20045 N. 19th Ave., Phx, AZ 85027
Contact:	Chase Kirby	Special Instructions:
Phone:	623-516-1415	

PROJECT INFORMATION

TURN AROUND TIME CODES - (TAT)

Project ID:	AZ1418.60			STD - Standard (Default)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	Kyrene District Office/Bus Barn (W)			ND - Next Business Day	
Project Zip Code:		Sampling Date/Time:	10/3/2025	SD - Same Business Day	
PO Number:	12024	Sampled By:	CK	WH - Weekend/Holiday/ASAP	

SAMPLE ID	DESCRIPTION	Sample Type (Below)	TAT (Above)	Total Volume/Area (as applicable)	NOTES (Time of day, Temp, RH, etc.)
PLM 1-3	O.P. Drywall Wall (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)	B	STD		
PLM 4-6	2x2 Ceiling Tile	B	STD		
PLM 7-9	2x4 Ceiling Tile	B	STD		
PLM 10-12	Brown Cove Base + Mastic	B	STD		
PLM 13-15	Heavy Texture D.W. (Paint, Texture, Tape, Joint Compound, Drywall w. Paper)	B	STD		
PLM 16-18	Popcorn Ceiling Tile	B	STD		
PLM 19-21	Gray Duct Mastic	B	STD		
PLM 22-24	Silver Flex Duct Insulation	B	STD		
PLM 25-27	Silver Duct Insulation	B	STD		
PLM 28-30	Pink Batt Insulation	B	STD		

SAMPLE TYPE CODES

BC - BioCassette™	CP - Contact Plate	T - Tape	O - Other:
A1S - Andersen	ST - Spore Trap	SW - Swab	
SAS - Surface Air Sampler	B - Bulk	SO - Soil	
NP - Non-potable Water	P - Potable Water	D - Dust	

RELINQUISHED BY

[Signature]

DATE & TIME

10/3/2025

RECEIVED BY

Kelly Wey

DATE & TIME


10/3/25
9:09pm

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at <http://www.emlab.com/s/main/serviceterms.html>


SECTION 10



ASBESTOS CONTAINING BUILDING MATERIAL
LOCATION MAPS

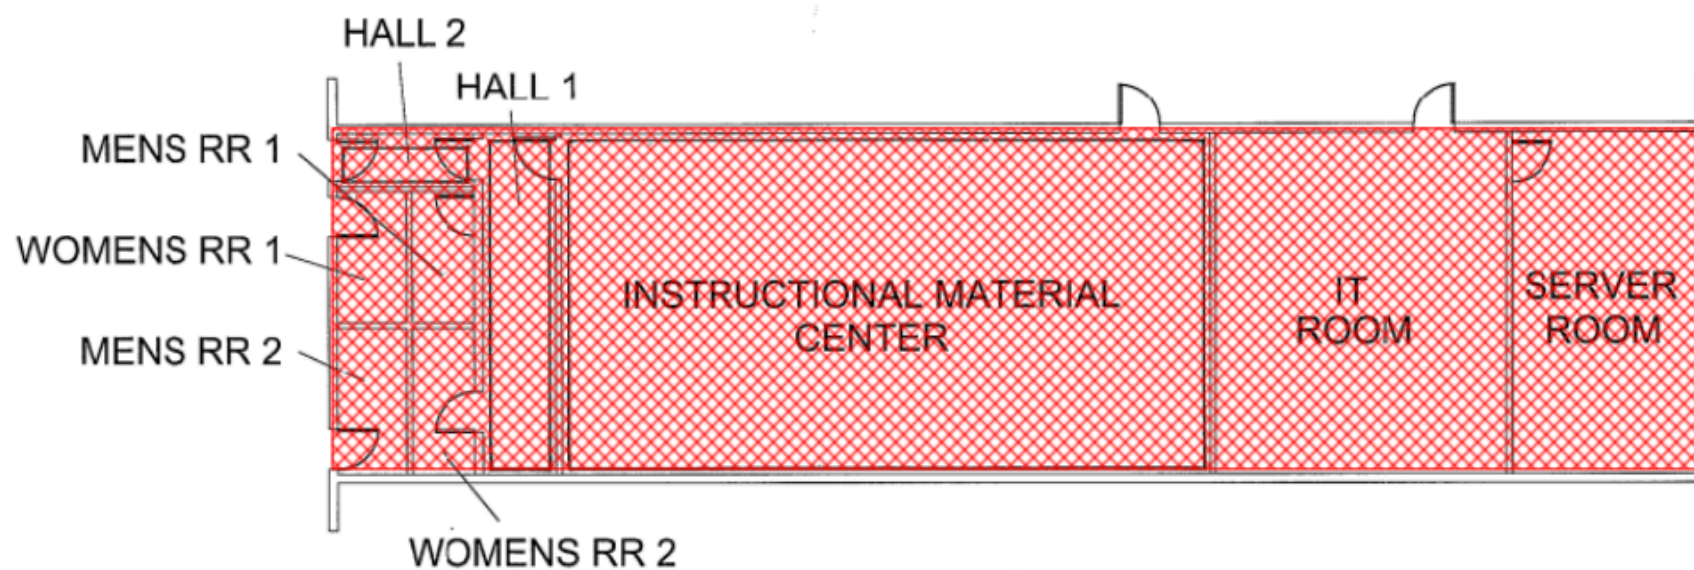

 **Asbestos-Containing
Ceiling Drywall System (White Compound Layer)**

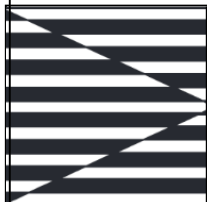

Asbestos-Containing Material Location Map
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60



Building B

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

SECTION 11



ASSUMED ACBM LOCATION MAPS

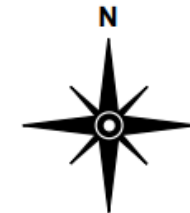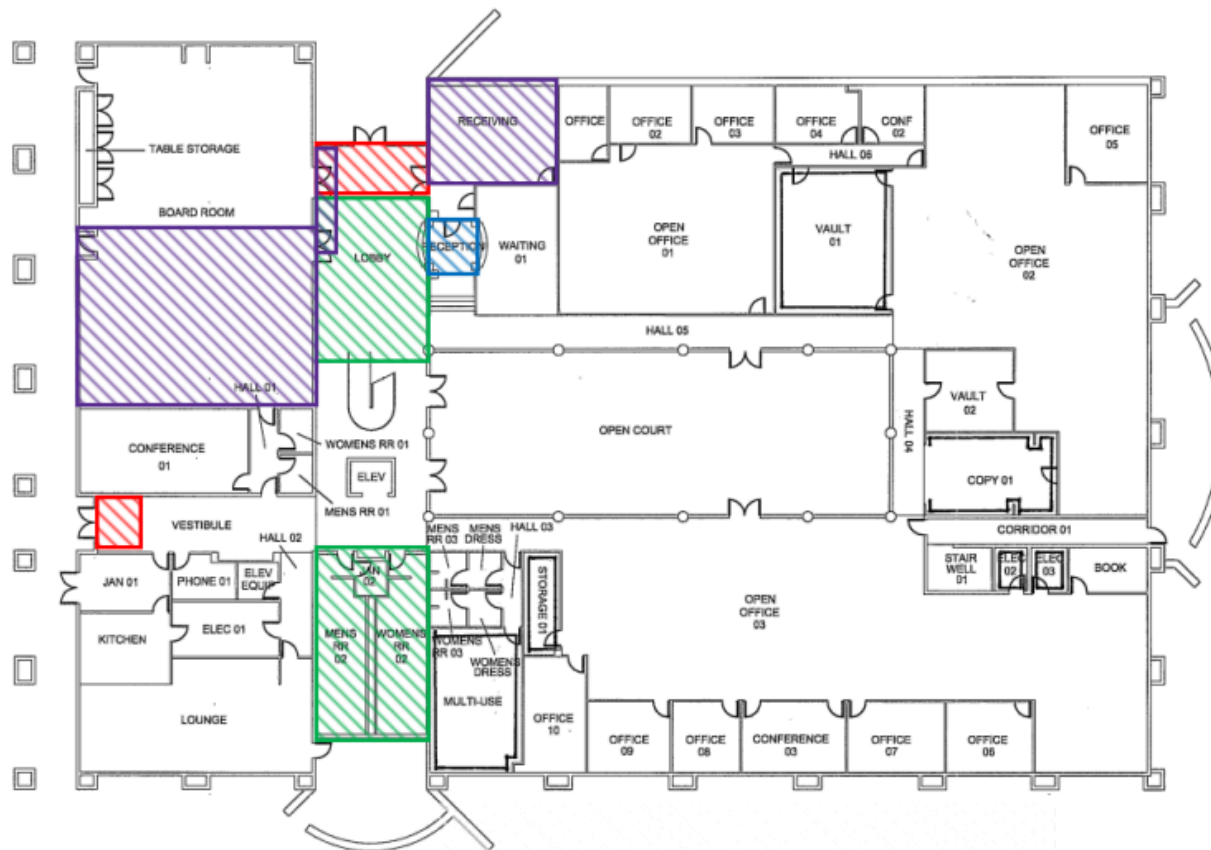

**Assumed Asbestos-Containing
Black 2"x2" Carpet & Mastic**




**Assumed Asbestos-Containing
White Counter Caulking**



**Assumed Asbestos-Containing
Gray Ceramic Floor Tile
(Grout and Thinset)**



**Assumed Asbestos-Containing
Blue Smooth Drywall System**

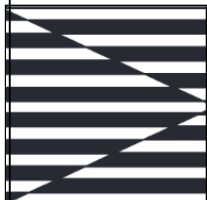

Assumed Asbestos-Containing Material Location Map (1)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284


Project No. AZ1418.60

Building A - First Floor

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415



- 

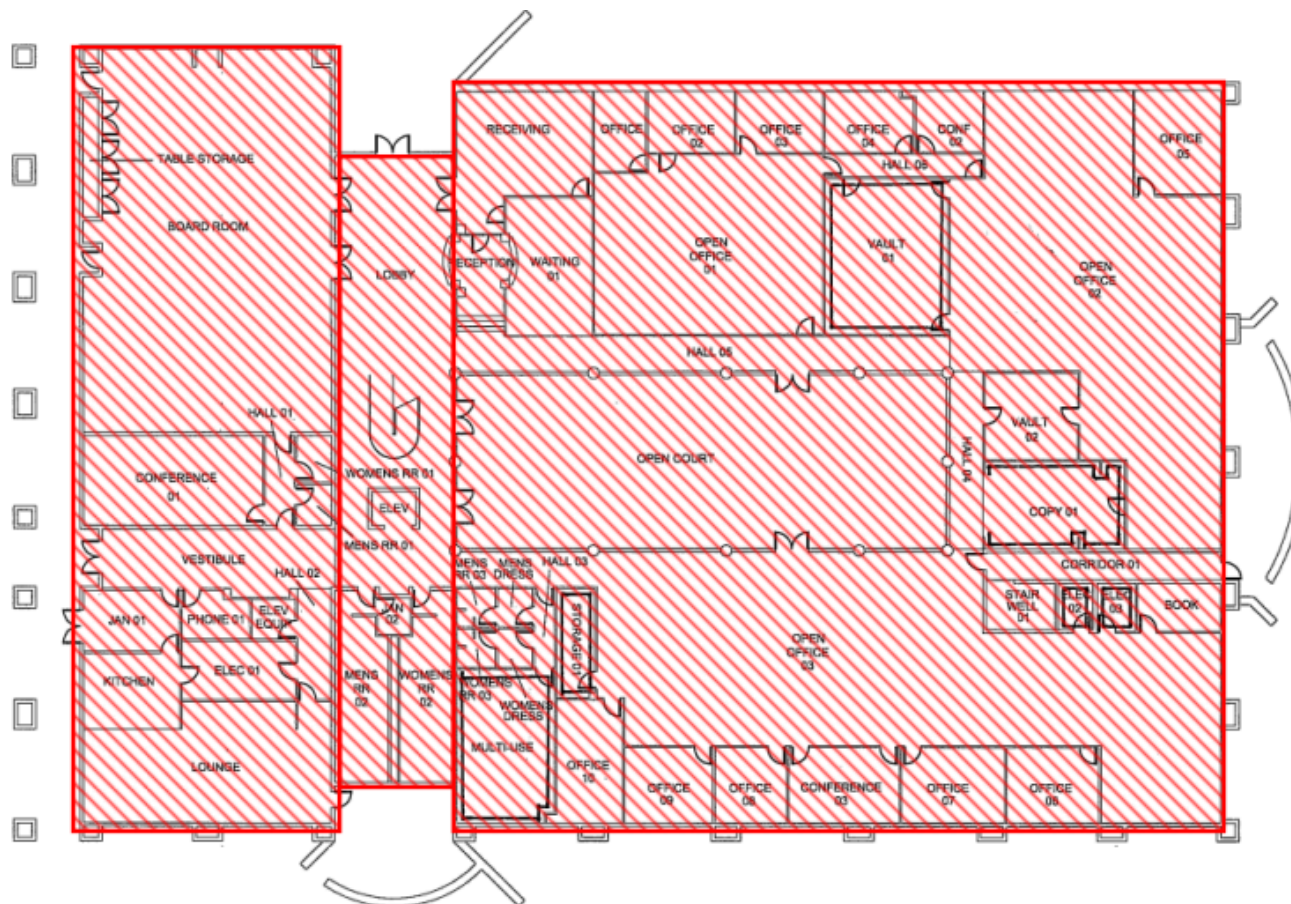

**Assumed Asbestos-Containing
Concrete Foundation
Expansion Joint**

Gray 36"x9" Carpet & Mastic


White Pipe Wrap

Gray Duct Mastic

Silver Flex Duct Wrap

Gray Duct Wrap

**Ceiling Wrap
(Insulation)**

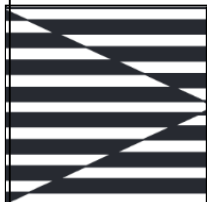


Assumed Asbestos-Containing Material Location Map (4)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building A - First Floor

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

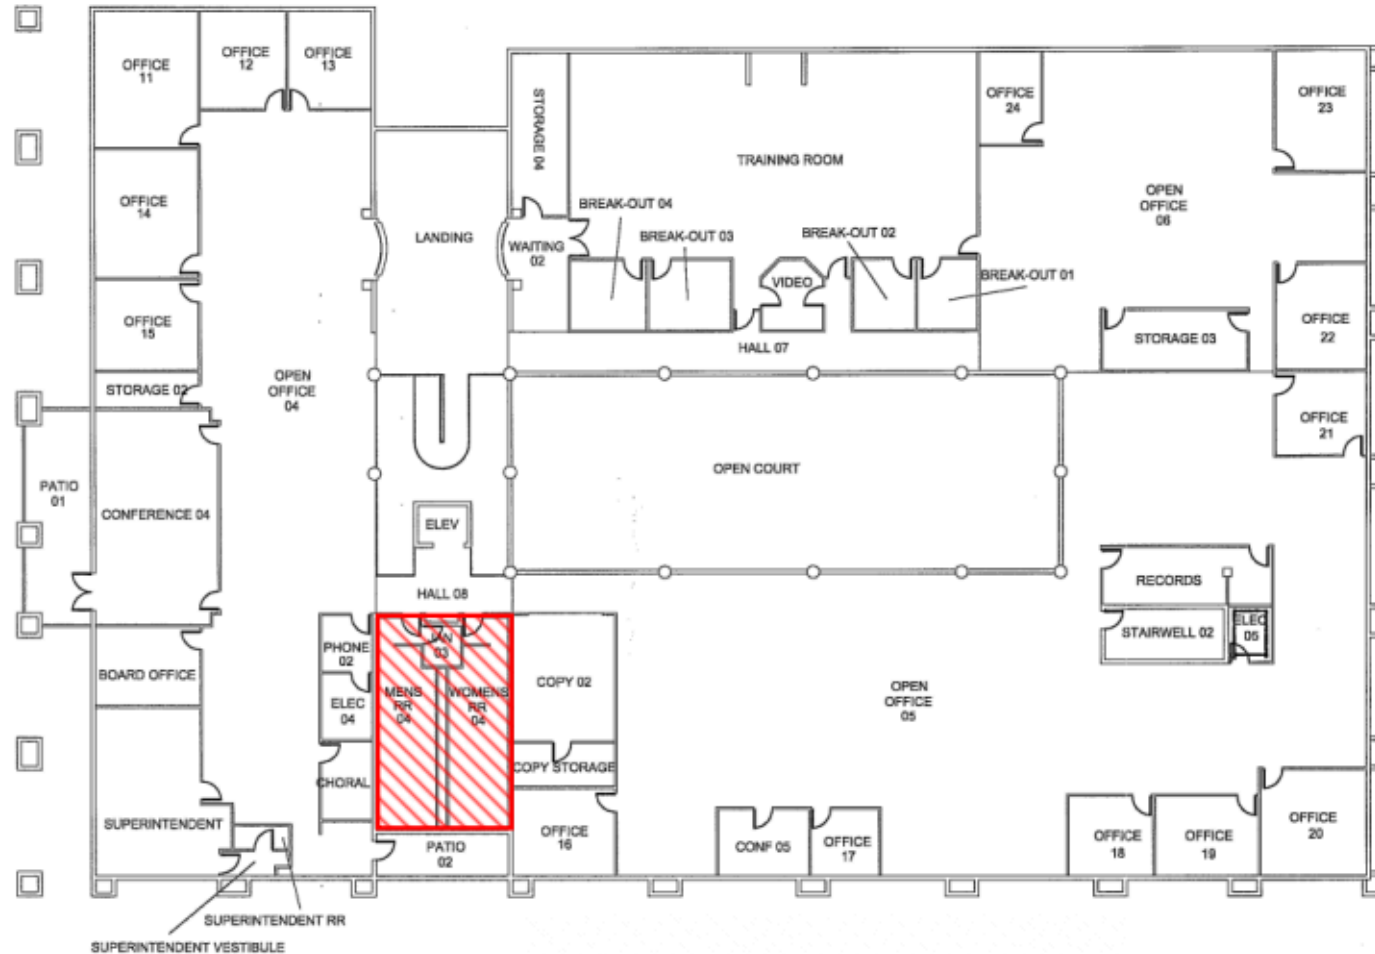



**Assumed Asbestos-Containing
Gray w. White 4"x3" Wall Tile
White 16"x5" Ceramic Wall Tile
White 16"x4" Ceramic Wall Tile
(Grout & Mastic)**

Assumed Asbestos-Containing Material Location Map (5)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building A - Second Floor

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

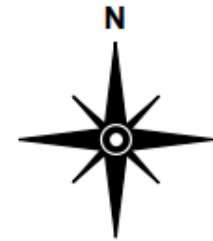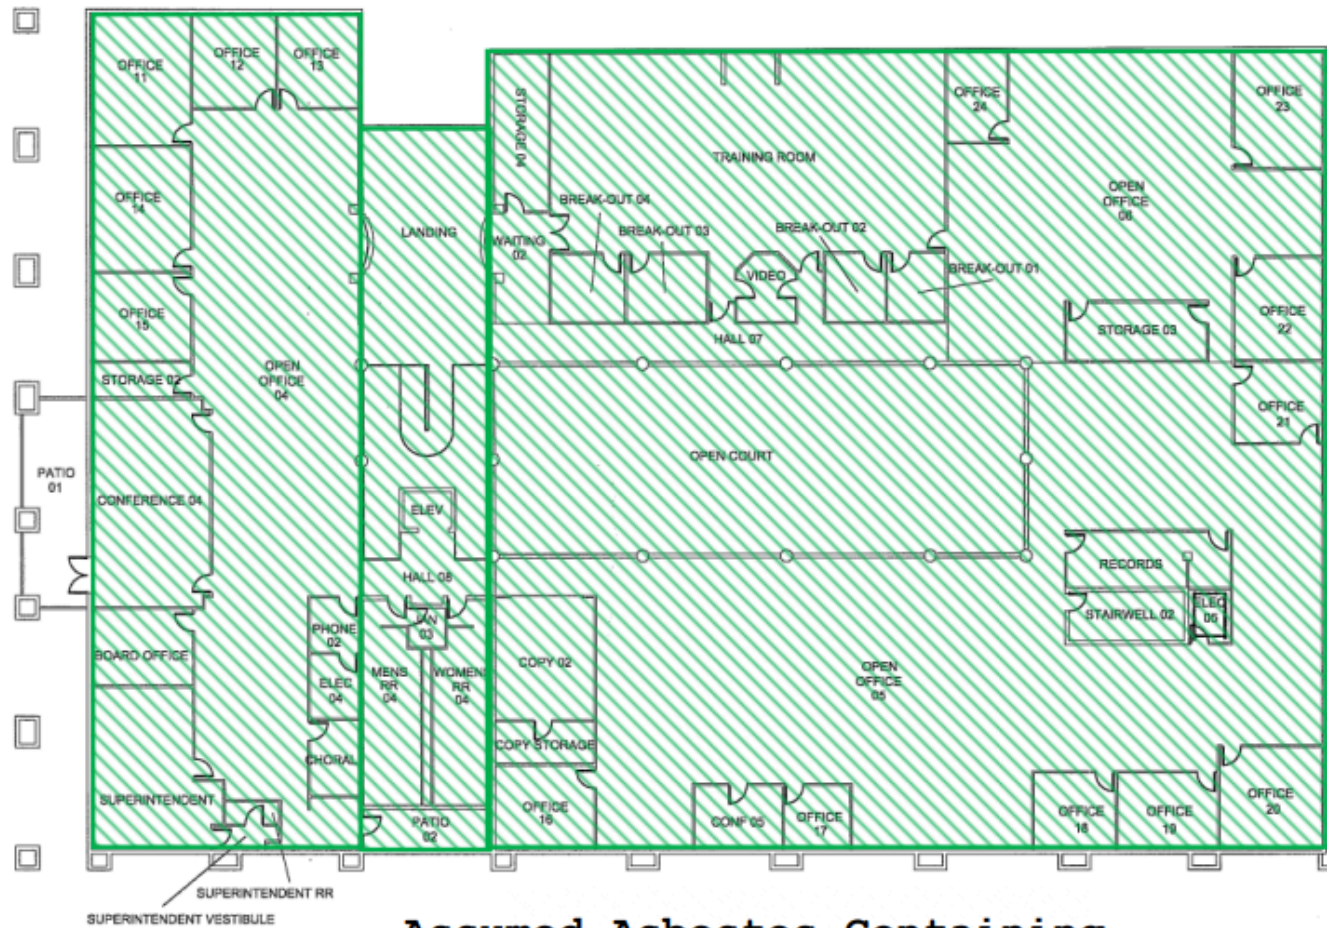


Assumed Asbestos-Containing Material Location Map (6)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284


Project No. AZ1418.60

Building A - Second Floor

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

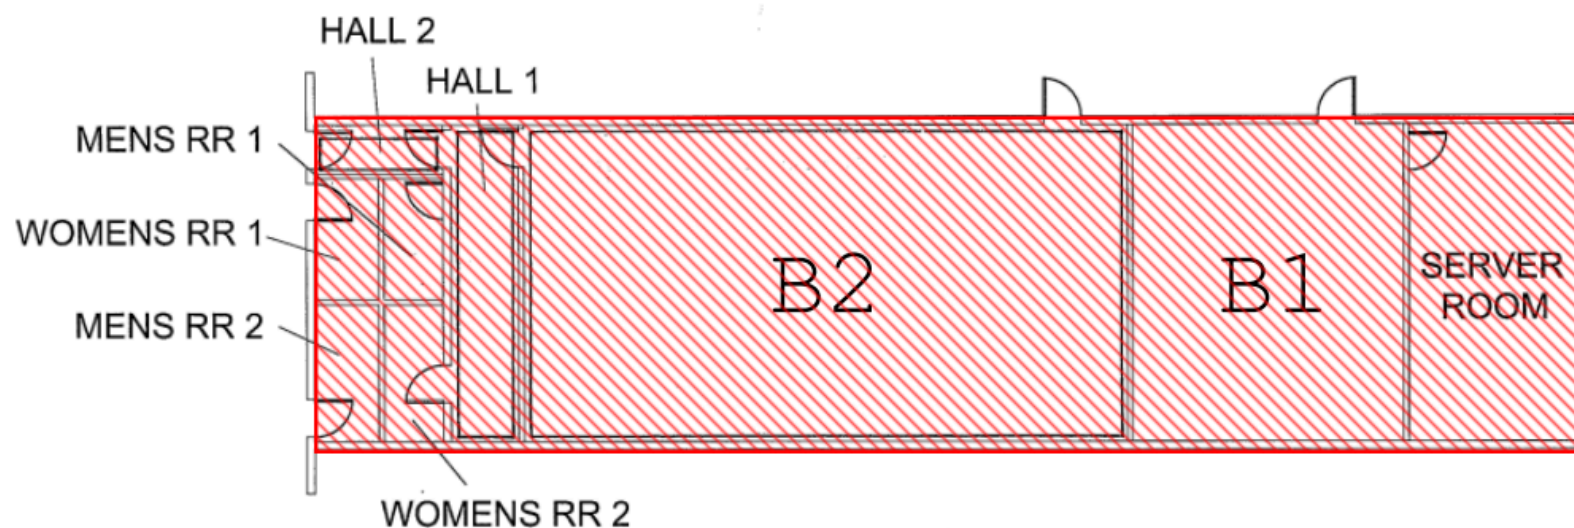

-  **Assumed Asbestos-Containing**
Interior Frame Caulking
Red Fire Stop Caulking
White 9"x2" Brick & Mortar
Concrete Foundation
Black Flex Duct Wrap & Insulation

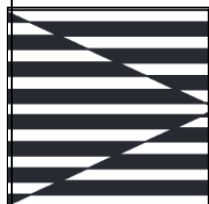


Assumed Asbestos-Containing Material Location Map (1)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building B

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

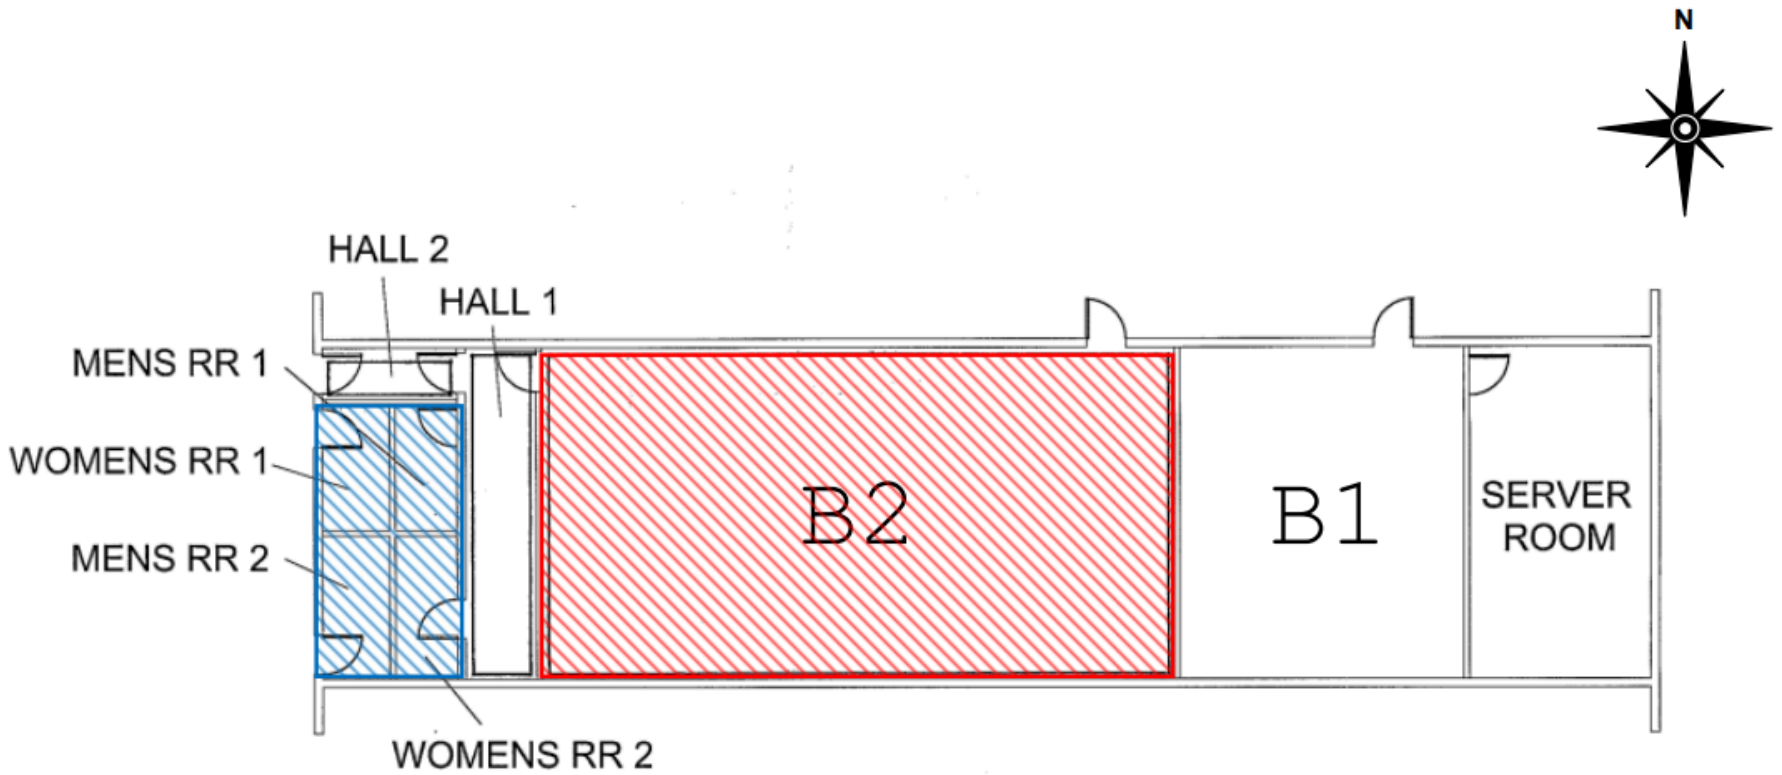


Assumed Asbestos-Containing Material Location Map (2)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building B

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

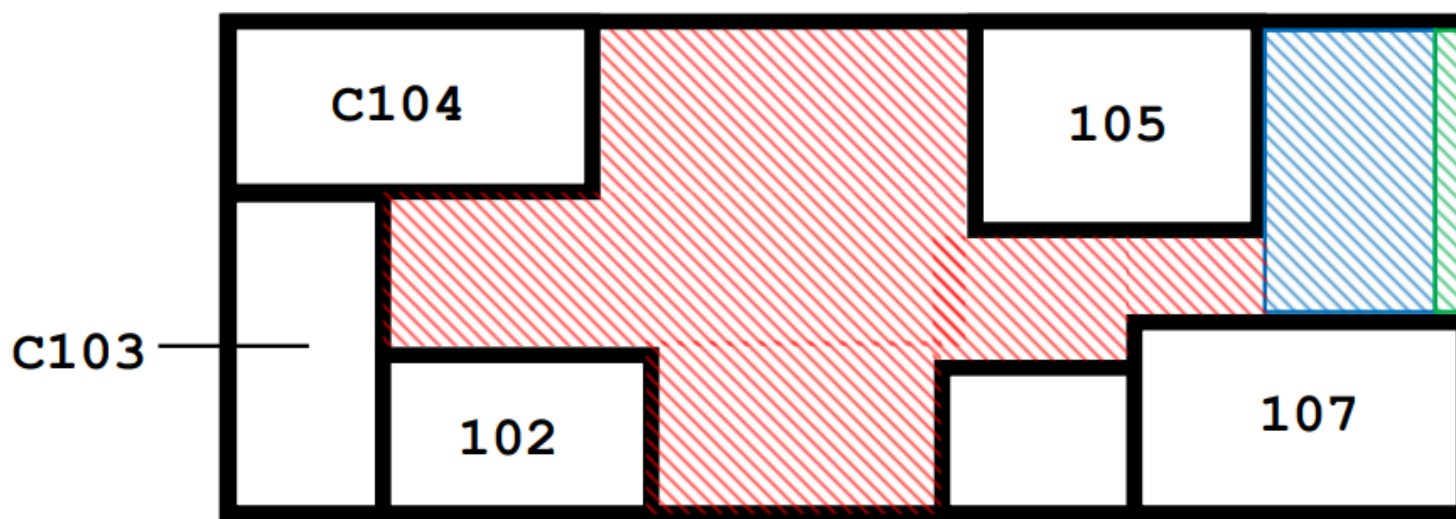


Assumed Asbestos-Containing
Gray 2'x2' Carpet
Mastic for Carpet



Assumed Asbestos-Containing
Counter Caulking



Assumed Asbestos-Containing
Brown Vinyl Plank Flooring
Mastic for Vinyl Flooring

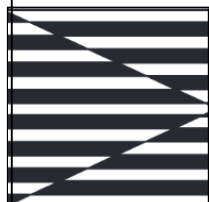


Assumed Asbestos-Containing Material Location Map (1)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284


Project No. AZ1418.60

Building C

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

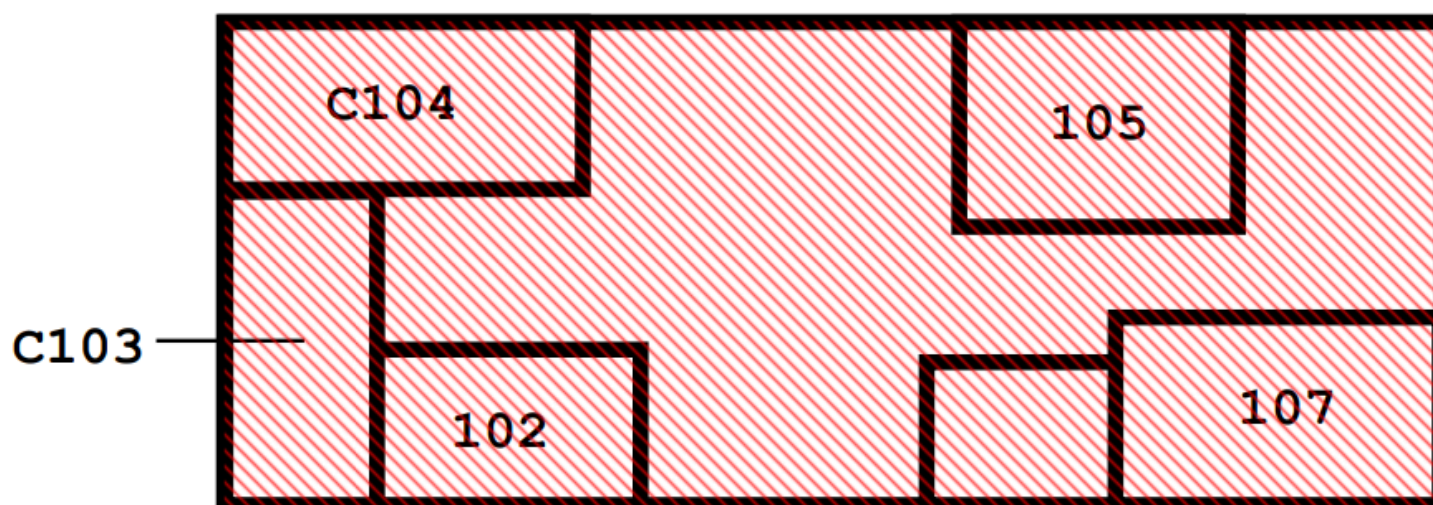

Assumed Asbestos-Containing
Door Frame Caulking
White Window Sealant
Black Weather Stripping
Gray 36"x9" Carpet & Mastic
Concrete Foundation
White Brick & Mortar
White Ceiling Wrap & Insulation
Fire Stop Caulking
Ceramic Wall Tile & Grout/Mastic

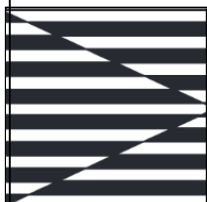


Assumed Asbestos-Containing Material Location Map (2)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building C


Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

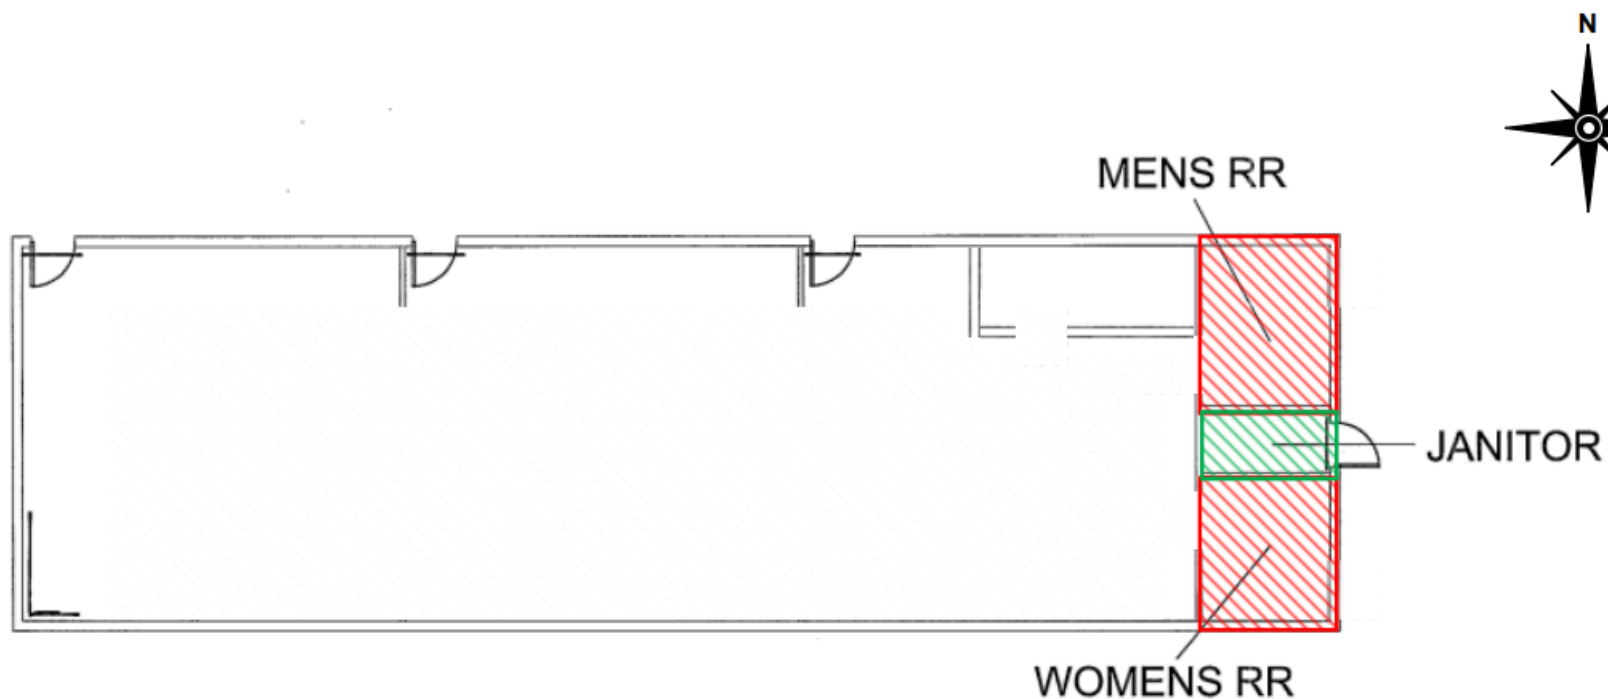

**Assumed Asbestos-Containing
Light Gray 4"x4" Ceramic Tile
(Grout & Mastic)
Fixture Caulking**



**Assumed Asbestos-Containing
Fiberglass Reinforced Plastic (FRP) & Mastic
Mop Sink Caulking**

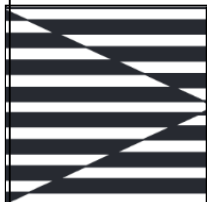


Assumed Asbestos-Containing Material Location Map (1)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284


Project No. AZ1418.60

Building D

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

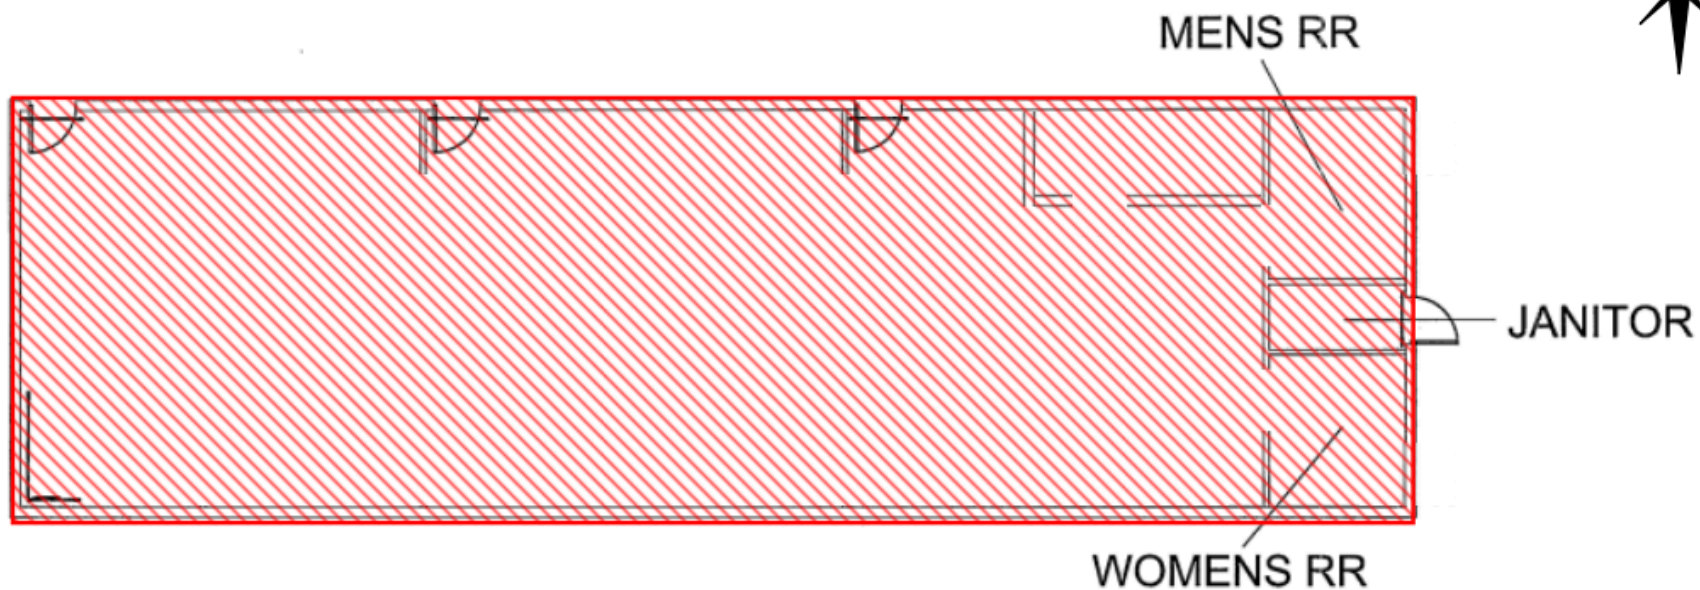

-  **Assumed Asbestos-Containing**
White Brick & Mortar
Concrete Foundation
White Window Frame sealant
Door Frame Caulking
Counter Caulking
Gray Epoxy Flooring
Gray Duct Mastic
Drywall Ceiling

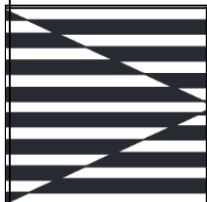


Assumed Asbestos-Containing Material Location Map (2)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building D

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

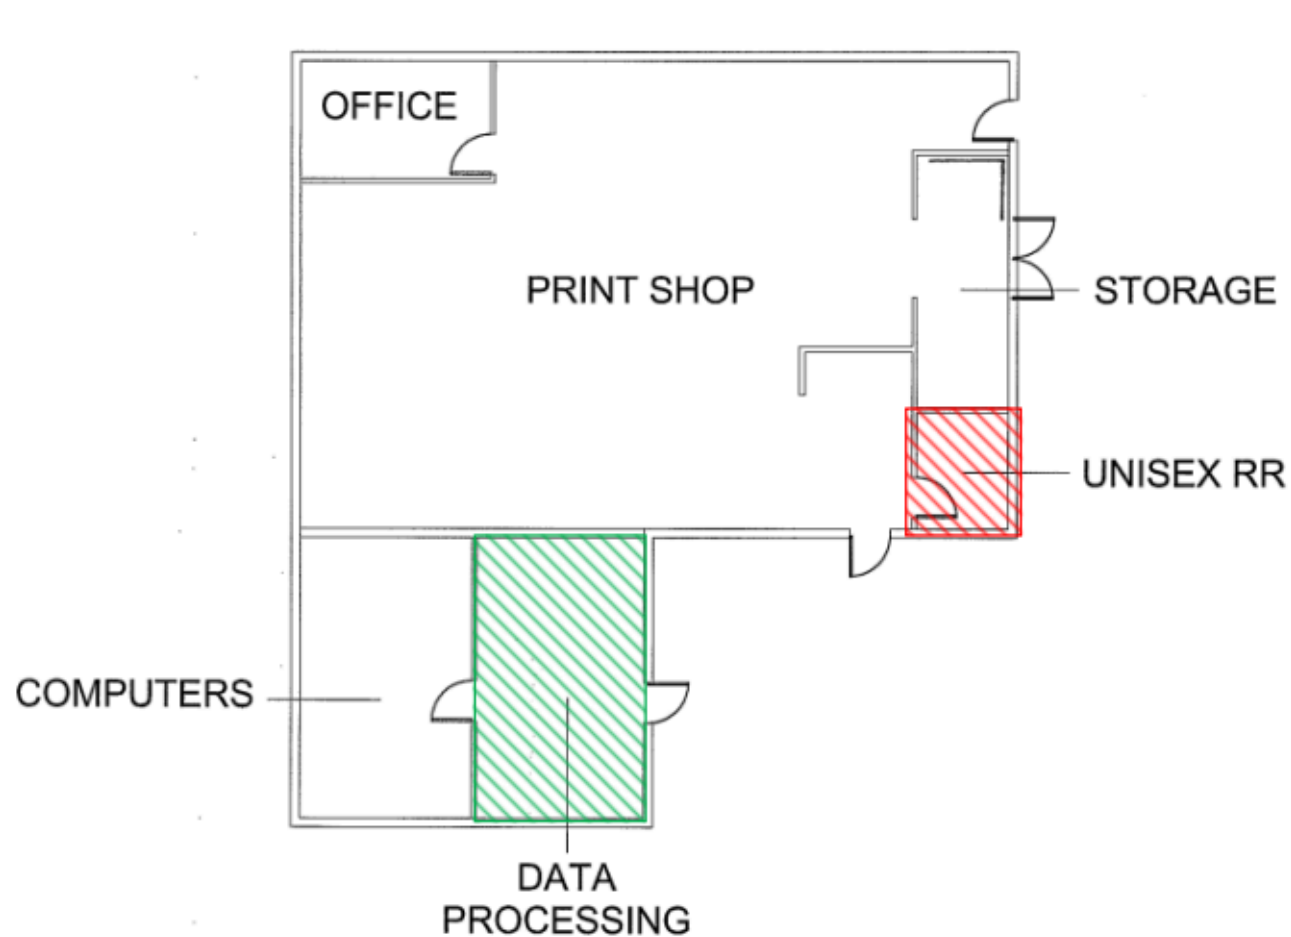



-  **Assumed Asbestos-Containing
Fiberglass Reinforced Plastic (FRP) & Mastic
Counter & Cabinet Caulking**
-  **Assumed Asbestos-Containing
Black 4" Cove Base & Mastic**

Assumed Asbestos-Containing Material Location Map (1)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284


Project No. AZ1418.60

Building E

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

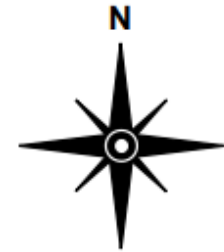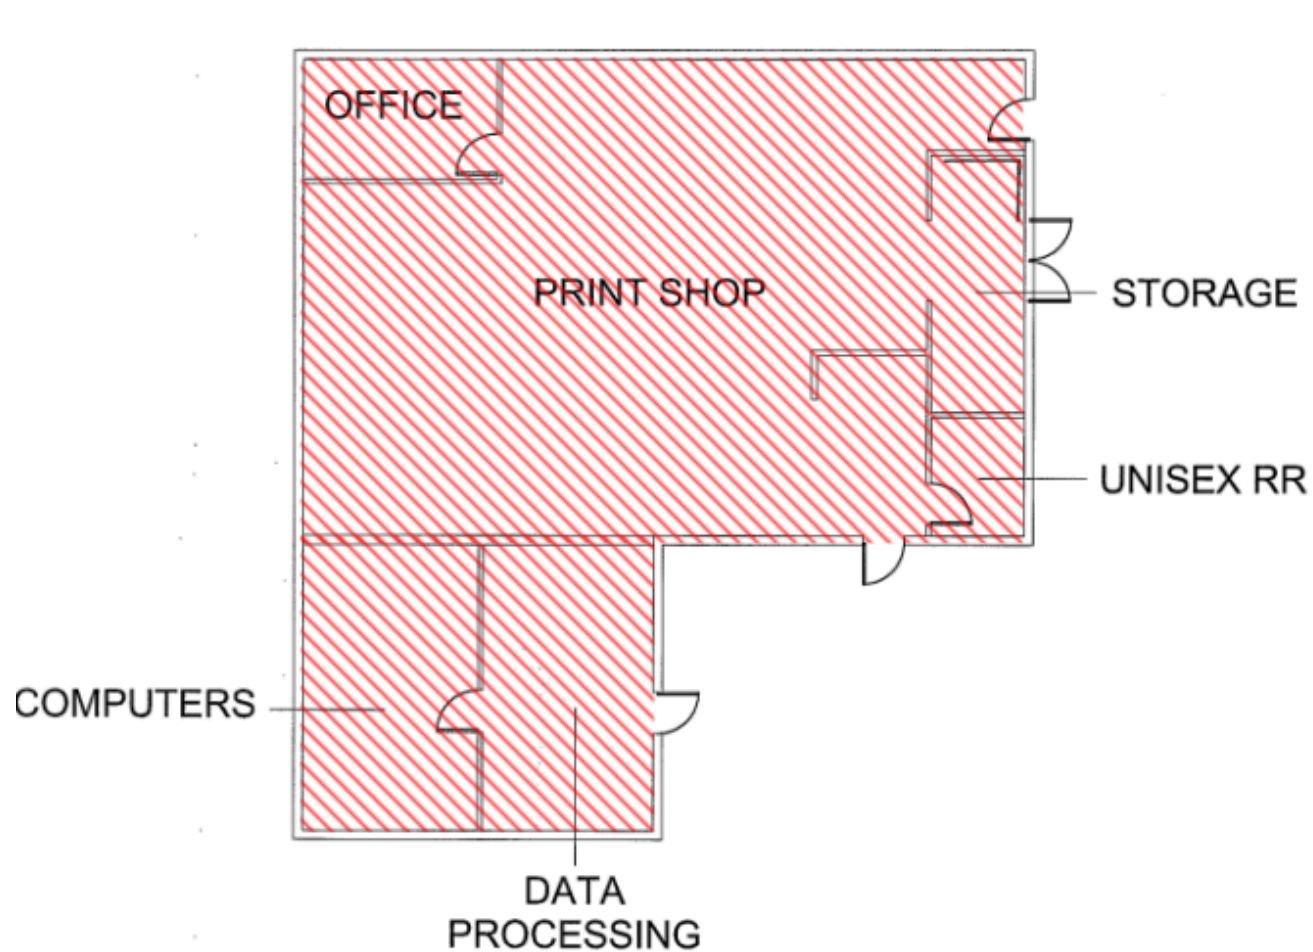

Assumed Asbestos-Containing
Interior Frame Caulking
Gray Duct Wrap & Insulation
Ceiling Wrap & Insulation
Pink Ceiling Wrap & Insulation
Silver Duct Wrap & Insulation


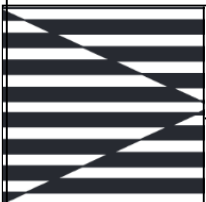


Assumed Asbestos-Containing Material Location Map (2)
 Kyrene District Office & Bus Barn
 8700 South Kyrene Road, Tempe, Arizona 85284


Project No. AZ1418.60

Building E

Dominion Environmental Consultants, Inc.
 20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

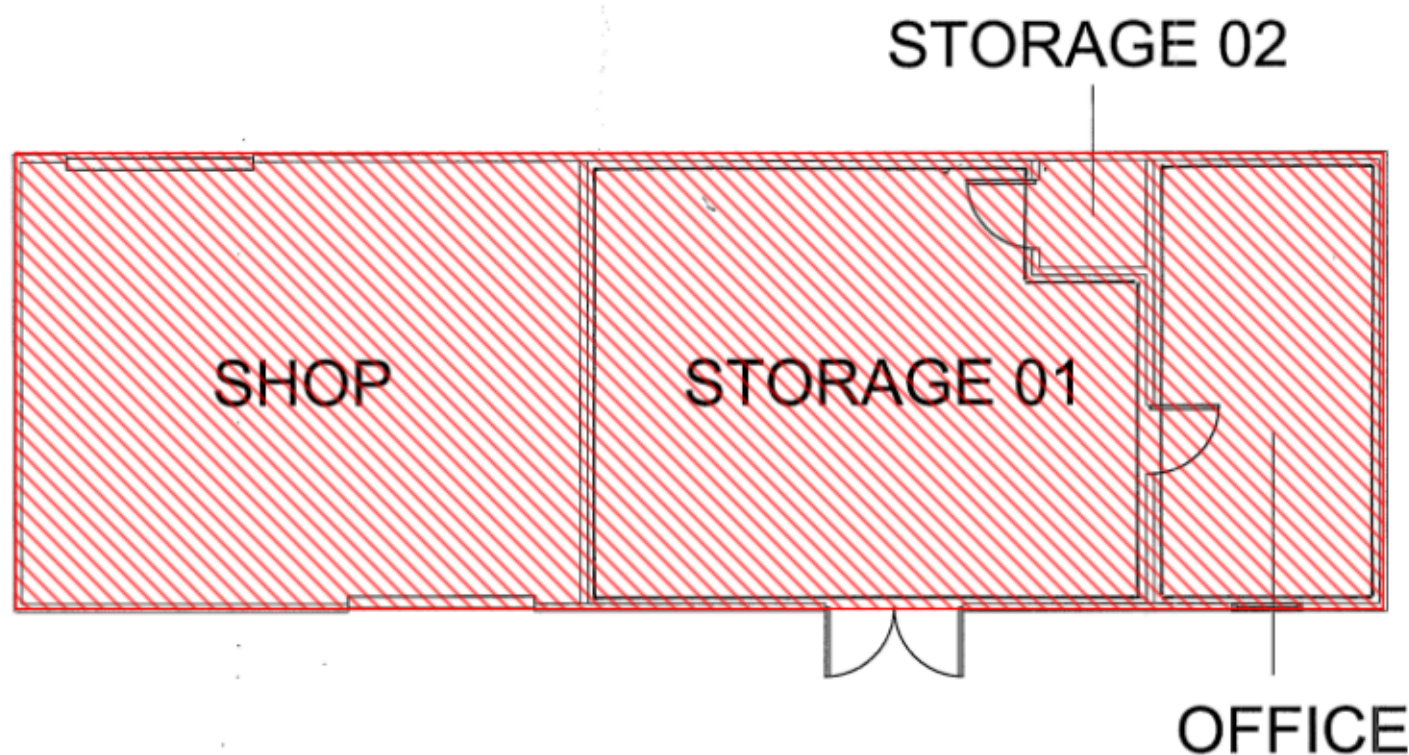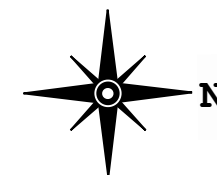

**Assumed Asbestos-Containing
Window/Door Frame Caulking
Untextured Drywall
Black Foam Insulation**

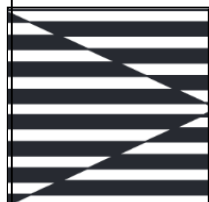


Assumed Asbestos-Containing Material Location Map (1)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60


Building G

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

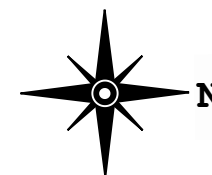

Janitors
Corner


Closet

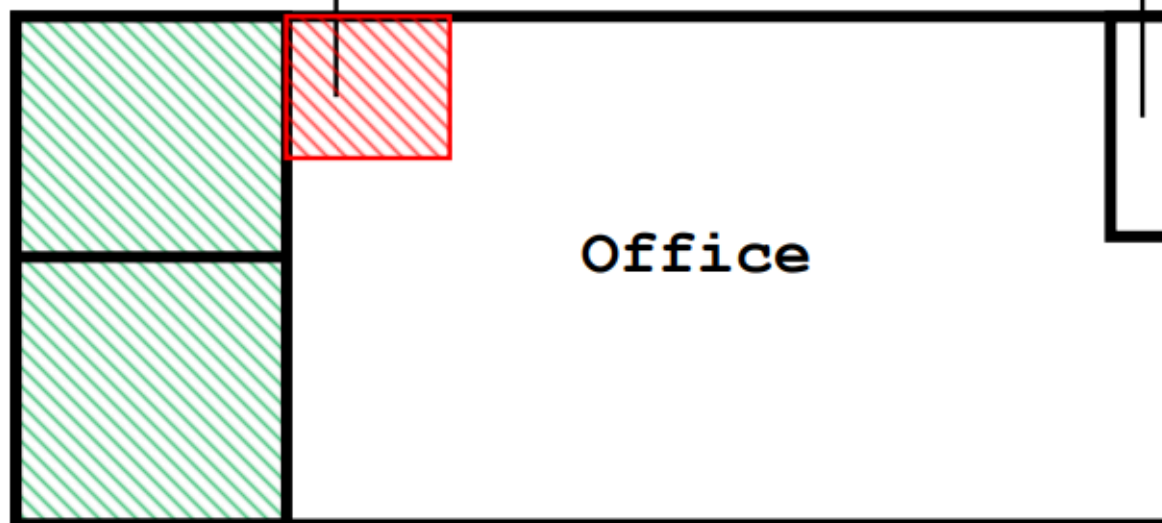

Assumed Asbestos-Containing
White Fiberglass Reinforced Plastic (FRP)
Mastic for FRP
White Mop Sink Caulking



Assumed Asbestos-Containing
Fixture Caulking

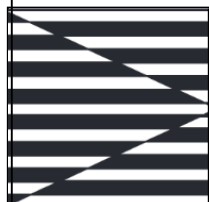


Assumed Asbestos-Containing Material Location Map (1)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building K

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

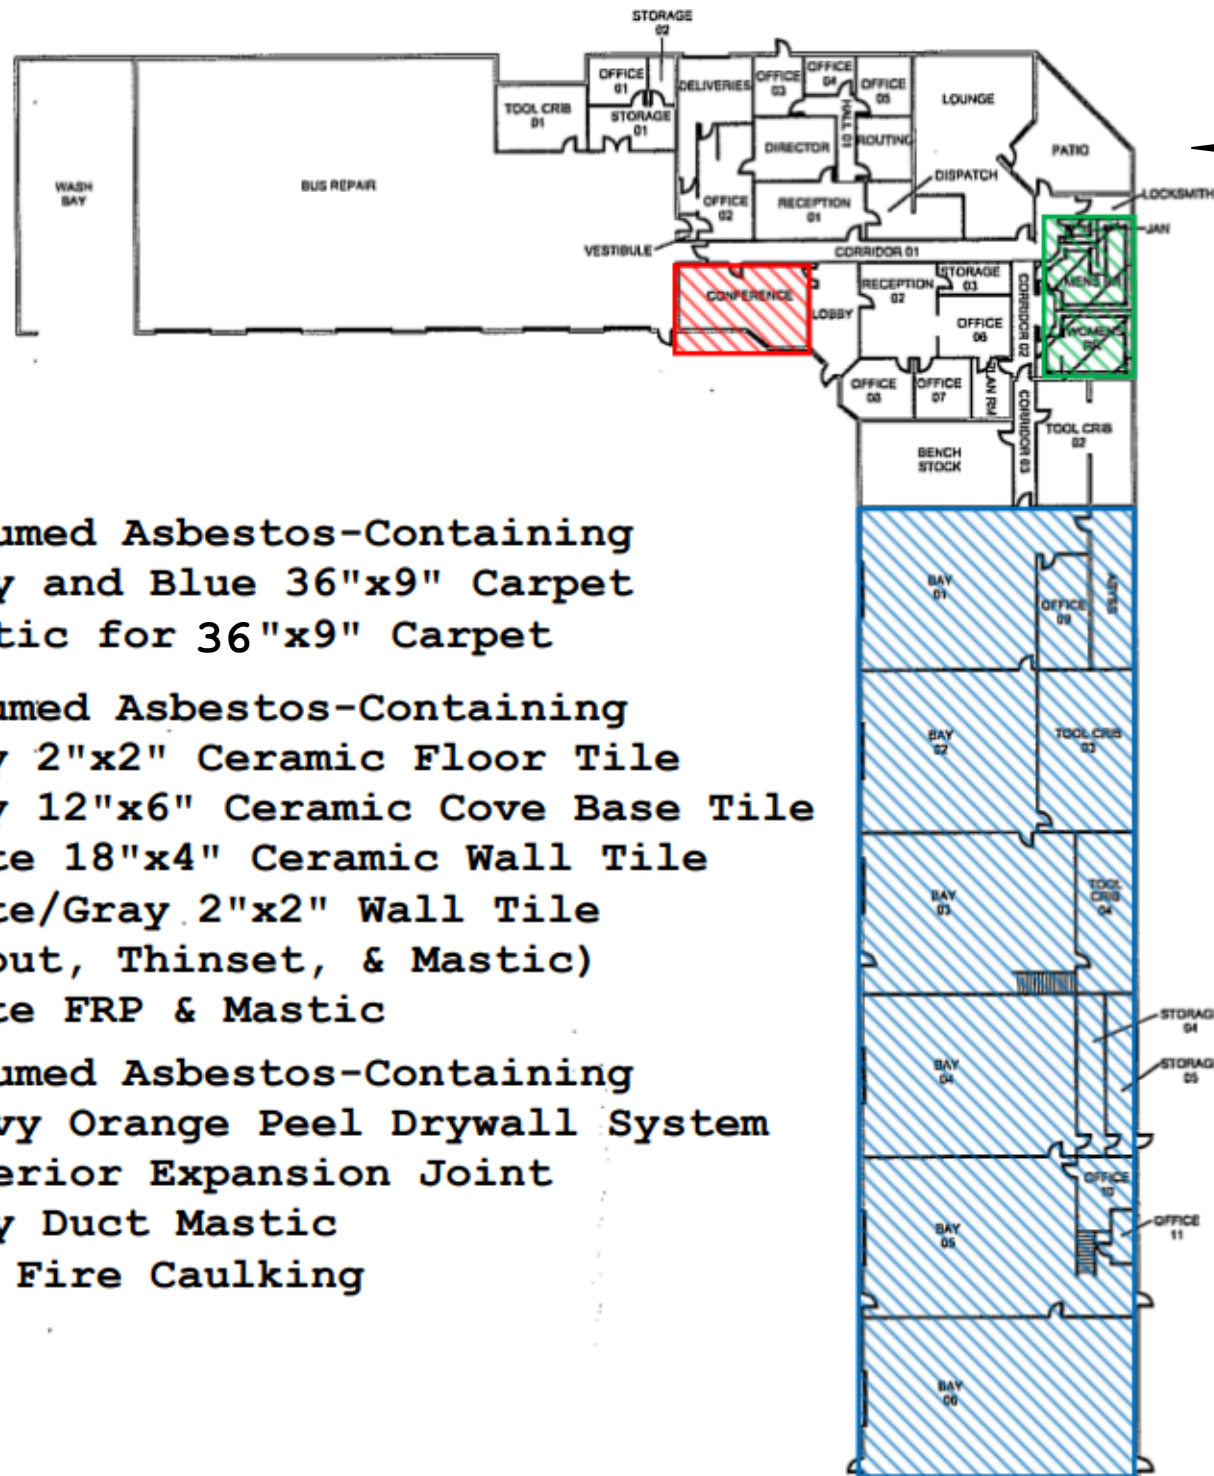

**Assumed Asbestos-Containing
Gray and Blue 36"x9" Carpet
Mastic for 36"x9" Carpet**



**Assumed Asbestos-Containing
Gray 2"x2" Ceramic Floor Tile
Gray 12"x6" Ceramic Cove Base Tile
White 18"x4" Ceramic Wall Tile
White/Gray 2"x2" Wall Tile
(Grout, Thinset, & Mastic)
White FRP & Mastic**




**Assumed Asbestos-Containing
Heavy Orange Peel Drywall System
Interior Expansion Joint
Gray Duct Mastic
Red Fire Caulking**

Assumed Asbestos-Containing Material Location Map (1)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building T

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

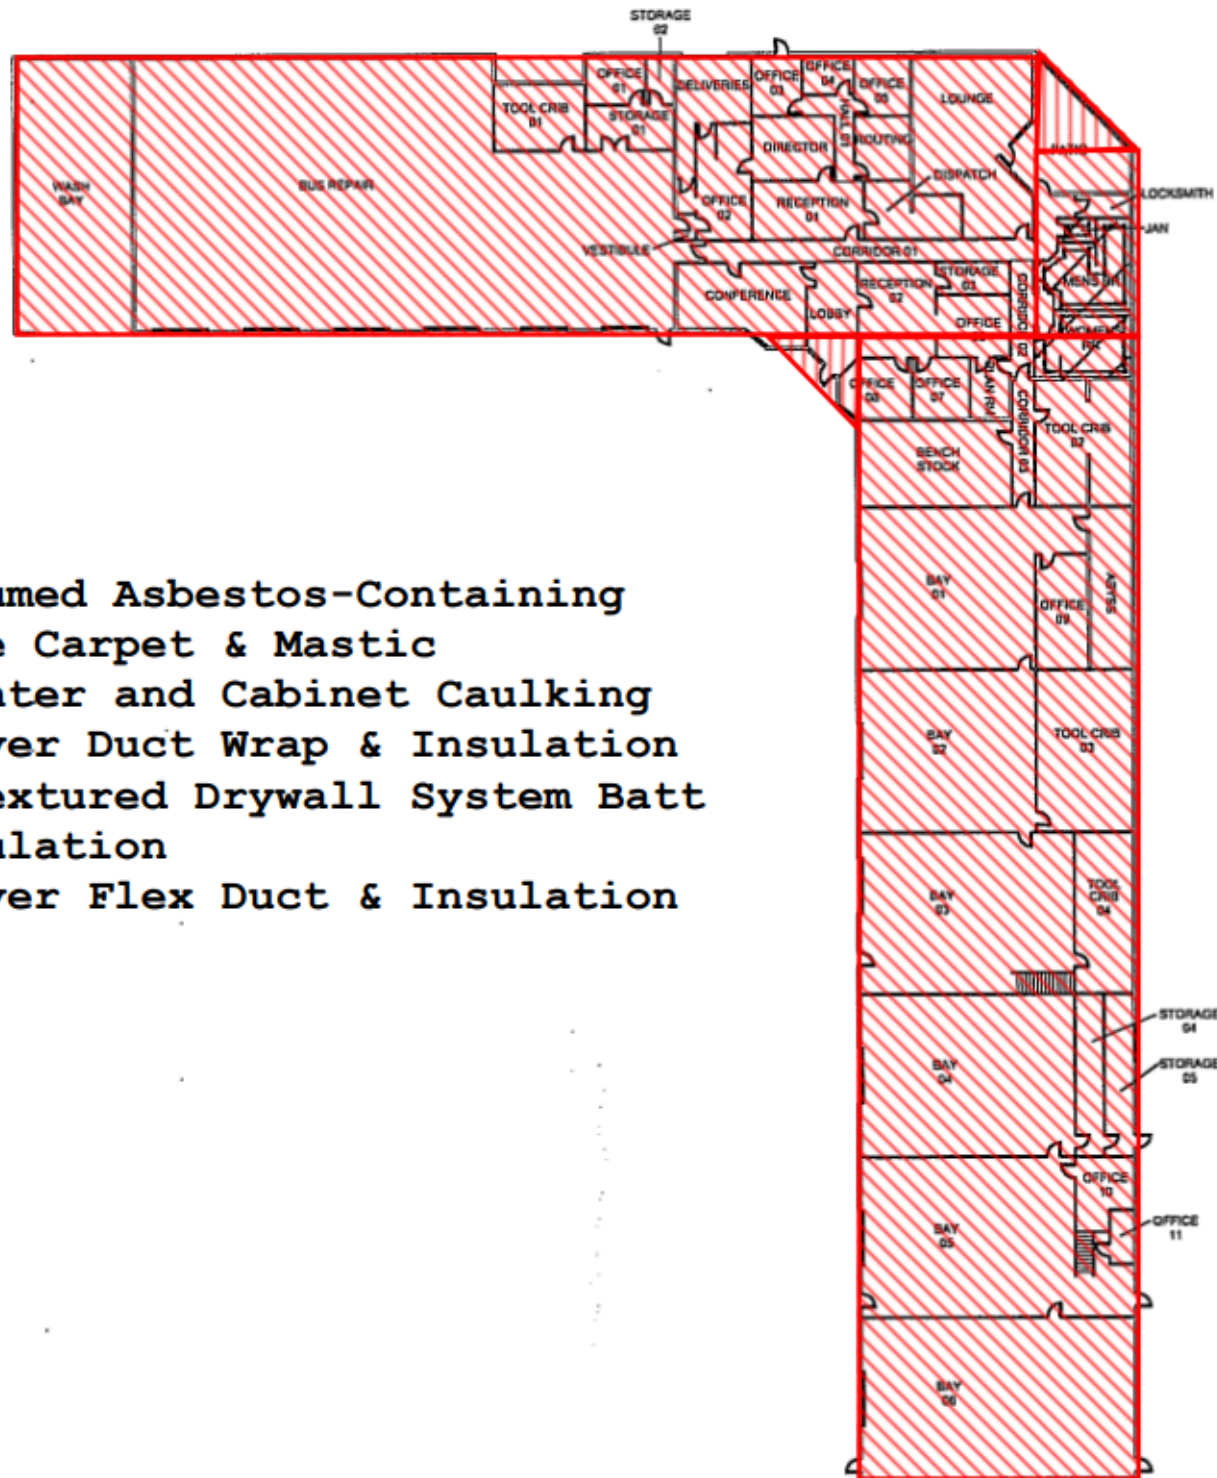



Assumed Asbestos-Containing
Blue Carpet & Mastic
Counter and Cabinet Caulking
Silver Duct Wrap & Insulation
Untextured Drywall System Batt
Insulation
Silver Flex Duct & Insulation

Assumed Asbestos-Containing Material Location Map (2)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building T

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

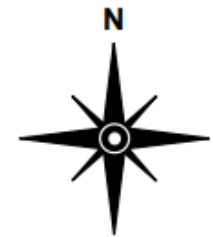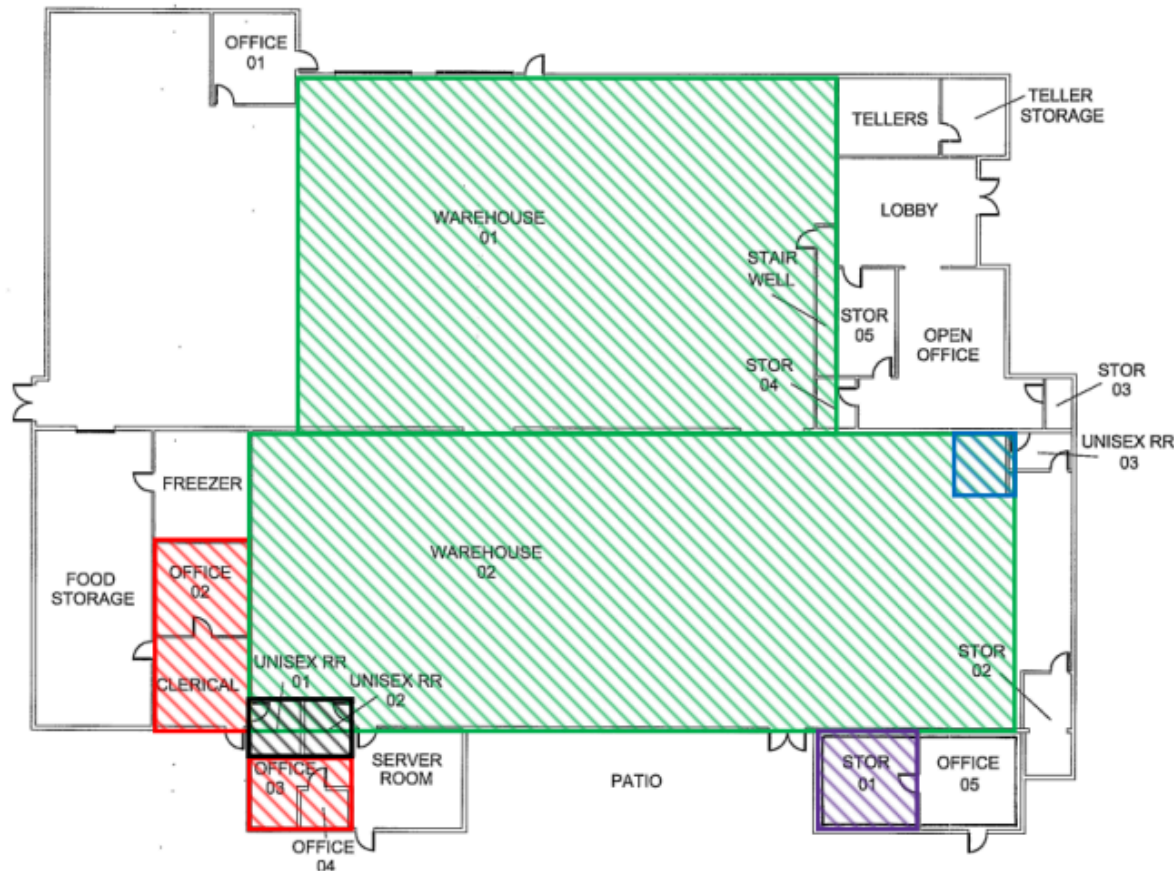


 **Assumed Asbestos-Containing
12"x12" VCT & Mastic**

 **Assumed Asbestos-Containing
Smooth Drywall System
Brown Concrete Foundation**

 **Assumed Asbestos-Containing
Carpet & Mastic**

 **Assumed Asbestos-Containing
Blue/Gray Carpet
Blue Cove Base
(Mastic)**

 **Assumed Asbestos-Containing
Pink 12"x12" VCT & Mastic
White Sink Coating**

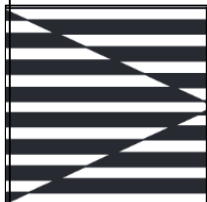


Assumed Asbestos-Containing Material Location Map (1)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building W

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

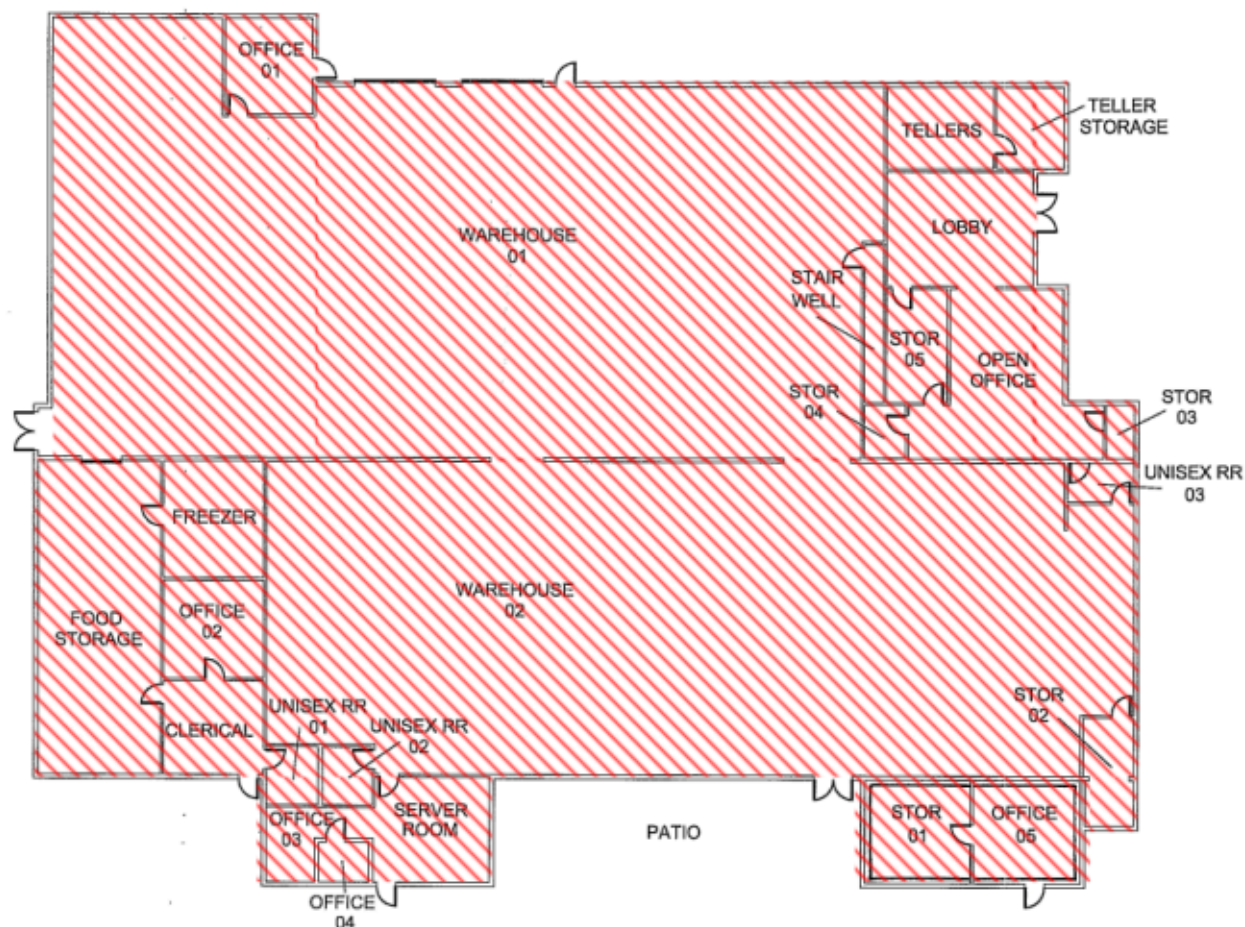

Assumed Asbestos-Containing

 **Interior Frame Caulking**

Window Glazing

6"x2" Brick & Mortar

Concrete Foundation

CMU Block & Mortar

Untextured Drywall

White Batt Insulation

Yellow Batt Insulation

Red Fire Stop Caulking

Assumed Asbestos-Containing Material Location Map (2)
Kyrene District Office & Bus Barn
8700 South Kyrene Road, Tempe, Arizona 85284

Project No. AZ1418.60

Building W

Dominion Environmental Consultants, Inc.
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

SECTION 12



INSPECTOR ACCREDITATIONS

THE ASBESTOS INSTITUTE

Certifies that

Tracey Carpenter

has attended and received instruction in the EPA approved course

AHERA Building Inspector Refresher

on

August 29, 2024

and successfully completed and passed the competency exam.

Certificate:
ON-188748-14588-082924

Date of Examination:
29-Aug-2024

Date of Expiration:
29-Aug-2025



William T. Cavness
Director



Approved Instructor

THE ASBESTOS INSTITUTE

20033 N. 19th Ave, Building 6, Phoenix, AZ 85027
602-864-6564 – www.theasbestosinstitute.com

The person receiving this certificate has completed the requisite training for asbestos accreditation under TSCA Title II.

THE ASBESTOS INSTITUTE

Certifies that

Chase Kirby

has attended and received instruction in the EPA approved course

AHERA Building Inspector Initial

on

March 3-5 2025

and successfully completed and passed the competency exam.

Certificate:
4380-19987-030525

Date of Examination:
05-Mar-2025

Date of Expiration:
05-Mar-2026



A. Zwanenburg
Director



Approved Instructor

THE ASBESTOS INSTITUTE

20033 N. 19th Ave, Building 6, Phoenix, AZ 85027
602-864-6564 – www.theasbestosinstitute.com

The person receiving this certificate has completed the requisite training for asbestos accreditation under TSCA Title II.



SECTION 13



LABORATORY ACCREDITATIONS

United States Department of Commerce
National Institute of Standards and Technology



Certificate of Accreditation to ISO/IEC 17025:2017

NVLAP LAB CODE: 500031-0

Eurofins EMLab P&K

Phoenix, AZ

*is accredited by the National Voluntary Laboratory Accreditation Program for specific services,
listed on the Scope of Accreditation, for:*

Asbestos Fiber Analysis

*This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2017.
This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality
management system (refer to joint ISO-ILAC-IAF Communique dated January 2009).*

2024-01-01 through 2024-12-31

Effective Dates

A handwritten signature in blue ink, reading 'Dana S. Laman'. Below the signature is a horizontal line.

For the National Voluntary Laboratory Accreditation Program

SCOPE OF ACCREDITATION TO ISO/IEC 17025:2017

Eurofins EMLab P&K

1501 W. Knudsen Dr.

Phoenix, AZ 85027-1307

Claudia Palermo

Phone: 856-334-1001

Email: claudia.palermo@et.eurofinsus.com

<https://www.eurofinsus.com/environment-testing/built-environment/>

ASBESTOS FIBER ANALYSIS

NVLAP LAB CODE 500031-0

Bulk Asbestos Analysis

Code


Description

18/A01

EPA -- 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples

18/A03

EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials

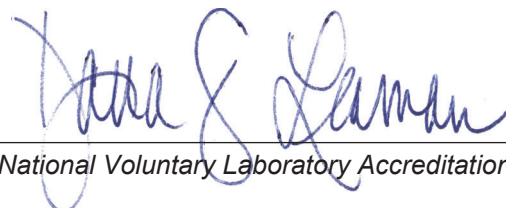

For the National Voluntary Laboratory Accreditation Program

United States Department of Commerce
National Institute of Standards and Technology



Certificate of Accreditation to ISO/IEC 17025:2017

NVLAP LAB CODE: 500031-0

Eurofins EMLab P&K

Phoenix, AZ

*is accredited by the National Voluntary Laboratory Accreditation Program for specific services,
listed on the Scope of Accreditation, for:*

Asbestos Fiber Analysis

*This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2017.
This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality
management system (refer to joint ISO-ILAC-IAF Communiqué on ISO/IEC 17025).*

2025-01-01 through 2025-12-31

Effective Dates



A handwritten signature in blue ink, reading "Dana S. Laman".

For the National Voluntary Laboratory Accreditation Program

SCOPE OF ACCREDITATION TO ISO/IEC 17025:2017

Eurofins EMLab P&K

1501 W. Knudsen Dr.

Phoenix, AZ 85027-1307

Joshua Snyder

Phone: 800-651-4802

Email: joshua.snyder@et.eurofinsus.com

<https://www.eurofinsus.com/environment-testing/built-environment/>

ASBESTOS FIBER ANALYSIS

NVLAP LAB CODE 500031-0

Bulk Asbestos Analysis

Code


Description

18/A01

EPA -- 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples

18/A03

EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials

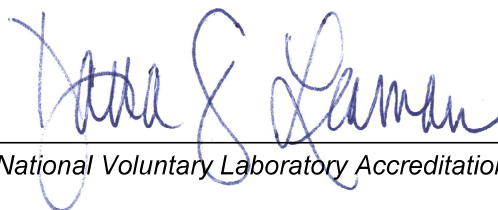

For the National Voluntary Laboratory Accreditation Program