ASBESTOS ABATEMENT PROTOCOL
Roofing Project
Portola Elementary School
6700 Eagle Street, Ventura, CA 93003
Ventura Unified School District

The following protocol is for the safe removal of the roofing system at Portola Elementary School. Following an Asbestos Survey of the roofing materials by Environmental Testing Associates, the following materials contain varying amounts of regulated asbestos:

Roofing Materials
Roofing Material Associated Mastics
Roofing Shingles
Roofing Penetration Mastics

The full survey is attached to this document and should be referenced during the bidding process. All square footage referenced within the survey are estimates and should not be relied upon for bid purpose, disposal quantities, or Ventura County Air Pollution Control District VCAPCD notifications, if required. The removal of asbestos containing roofing materials must follow all Federal, State and Local regulations.

Federal requirements which govern aspects of asbestos abatement include, but are not limited to, the following regulations.

California Code of Regulations (CCR)

1. CCR-Title 8 Section 1529- General Construction Asbestos
2. CCR-Title 8 Section 5208- Permits
3. CCR-Title 8 Section 641.6-341.14 Registration

Occupational Safety and Health Administration (OSHA)

1. Title 29 CFR 1926.1101 - Construction Standard for Asbestos
2. Title 29 CFR 1910.132 - Personal Protective Equipment
3. Title 29 CFR 1910.134 - Respiratory Protection
4. Title 29 CFR 1926 - Construction Industry Standards
5. Title 29 CFR 1910.20 - Access to Employee Exposure and Medical Records
6. Title 29 CFR 1910.1200 - Hazard Communication
7. Title 29 CFR 1910.151 - Medical and First Aid

Environmental Protection Agency **(EPA)**

1. 40 CFR 61 Subpart A and M (Revised Subpart B) - National Emission Standard for Hazardous Air Pollutants - Asbestos.
2. 40 CFR 763.80 - Asbestos Hazard Emergency Response Act (AHERA)

Department of Transportation **(DOT)**

1. Title 49 CFR 100 - 185 – Transportation
2. CCR Title 22- Transportation

The Asbestos Abatement Contractor shall assume full responsibility and liability for compliance with all applicable Federal, State and Local regulations related to any and all aspects of the asbestos abatement project. The Contractor is responsible for providing and maintaining training, accreditations, medical exams, medical records, personal protective equipment (PPE) including respiratory protection including respirator fit testing, as required by applicable Federal, State and Local regulations. The Contractor shall hold the Ventura Unified School District (VUSD) and Environmental Testing Associates (ETA) harmless for any Contractor's failure to comply with any applicable work, packaging, transporting, disposal, safety, health, or environmental requirement on the part of the abatement contractor, the abatement contractor's employees, or the abatement contractor's subcontractors. The Contractor will incur all costs, including all sampling/analytical costs to assure compliance with OSHA/EPA/State requirements related to failure to comply with the regulations applicable to the work.

The purpose of this document is to ensure that the abatement contractor follows the mandatory work practices listed below:

1. Roof level heating and ventilation air intake sources shall be isolated, or the ventilation system shall be shut down.

2. Roofing material shall be removed in an intact state to the extent feasible. Wet methods shall be used to remove roofing materials that are not intact, or that will be rendered not intact during removal, unless such wet methods are not feasible or will create safety hazards.

3. If cutting machines are used, they shall be continuously misted during use, unless a competent person determines that misting substantially decreases worker safety.(Use of mechanical means will require VCAPCD notification).

4. If a power roof cutter is utilized, all dust resulting from the cutting operation shall be collected by a HEPA dust collector or shall be HEPA vacuumed by vacuuming along the cut line by gently sweeping and then carefully and completely wiping up the still-wet dust and

debris left along the cut line. The dust and debris shall be immediately bagged or placed in covered containers.

5. Asbestos-containing material that has been removed from a roof shall not be dropped or thrown to the ground, unless the material is carried or passed to the ground by hand, it shall he lowered to the ground via covered, dust-tight chute, or hoist:

a. Any ACM that is not intact shall be lowered to the ground as soon as is practicable, but in any event no later than the end of the work shift. While the material remains on the roof it shall either be kept wet, placed in an impermeable waste bag, or wrapped in plastic sheeting.

b. Intact ACM shall be lowered to the ground as soon as is practicable, but in any event no later than the end of the work shift.

6. Upon being lowered, unwrapped material shall be transferred to a closed receptacle in such a manner as to preclude the dispersion of dust.


7. Removal or repair of sections of intact roofing less than 25 square feet in area does not require use of wet methods or HEPA vacuuming as long as manual methods, which do not render the material nonintact are used to remove the material and no visible dust is created by the removal method used. In determining whether the area involves less than 25 square feet, the employer shall include all removal and repair work performed on the same roof on the same day.

ETA is anticipating the abatement process to be completed in five business days. The abatement contractor must staff appropriately to perform the abatement. Any costs associated with the failure to complete the abatement within 5 days will be the financial responsibility of the abatement contractor for the consultant's fees and additional services as required.

A sight walk will be conducted during the bidding process. The Ventura Unified School District and Environmental Testing Associates will be onsite to help facilitate the bidding process and will assist in answering the contractors' questions.

Yours very truly,

ENVIRONMENTAL TESTING ASSOCIATES,



_____

Kevin R. Riley, Certified Asbestos Consultant (17-5871)
NIOSH 582 Certification # 120400LA-06
NV-IJPM-1674

May 13, 2024

Portola Elementary School
c/o Ventura Unified School District
ATTN: Ray Richards, Bond Construction Project Manager
255 W. Stanley Avenue
Ventura, CA 93003
Via Email: Ray.Richards@venturausd.org

LIMITED ASBESTOS SURVEY: 6700 Eagle Street, Ventura, CA 93003

Dear Ray Richards,

Environmental Testing Associates (ETA) conducted bulk sampling of suspect asbestos containing materials (ACM) at the above referenced commercial building structure. The samples were delivered under proper chain of custody to an accredited laboratory for analysis. The objective of the investigation was to determine the possible presence of asbestos within the building materials identified below which may be disturbed during remediation activities. No fire-related or structural damage was observed during this investigation.

1.0 SAMPLING FOR ASBESTOS AND PLM ANALYSIS RESULTS

ETA representative Mr. Kevin Riley, CAC 17-5871, NV-IJPM-1674 conducted the sampling activities. Mr. Riley is a State of California–DOSH-Certified Asbestos Consultant.

Sampling of suspect-ACM was conducted on May 9, 2024, following the provisions of 40 CFR Part 763-86. ETA collected 23 bulk samples and delivered them to LA Testing Laboratory, an accredited laboratory located at 520 Mission Street, South Pasadena, California 91030 (800) 303-0047. (NVLAP # 200232-0). Due to multiple layers a total of 30 samples were analyzed by the laboratory.

Analysis of suspect ACM samples for asbestos was performed per Appendix A, Subpart F, 40 CFR Part 763, Section 1, Polarized Light Microscopy, by LA Testing which is accredited by the National Voluntary Laboratory Accreditation Program for asbestos analysis of bulk samples using polarized light microscopy.

Table 1.1 – Summary of Bulk Sampling for Asbestos (Collected: 05/09/2024)

Based on the analytical results (above) 1% or greater of **asbestos was detected** in the samples collected as listed in the locations as shown below. The removal of these materials tested is regulated as ACM in the State of California.

Sample ID No.	Sample Description	Asbestos Mineral Type & Percent
A-1 Shingle	Roofing Materials See Map Gray, Fibrous, Heterogeneous	No Asbestos Detected

A-1a Tar	Roofing Materials Black, Non-Fibrous, Homogeneous	See Map	No Asbestos Detected
A-2 Shingle 1	Roofing Materials White/Black, Fibrous, Heterogeneous	See Map	No Asbestos Detected
A-2a Shingle 2/Tar Mastic	Roofing Materials White/Black, Fibrous, Heterogeneous	See Map	8% Chrysotile Asbestos Detected
A-2b Tar	Roofing Materials Black, Non-Fibrous, Homogeneous	See Map	No Asbestos Detected
A-3 Shingle	Roofing Materials White/Black, Fibrous, Heterogeneous	See Map	No Asbestos Detected
A-3a Tar	Roofing Materials Black, Non-Fibrous, Homogeneous	See Map	No Asbestos Detected
A-4	Roofing Materials Gray/Black, Fibrous, Heterogeneous	See Map	10% Chrysotile Asbestos Detected
A-5	Roofing Materials White/Black, Fibrous, Heterogeneous	See Map	10% Chrysotile Asbestos Detected
A-6	Roofing Materials White/Black, Fibrous, Heterogeneous	See Map	10% Chrysotile Asbestos Detected
A-7 Shingle	Roofing Materials Gray/Black, Fibrous, Heterogeneous	See Map	No Asbestos Detected

A-7a Tar	Roofing Materials Black, Non-Fibrous, Homogeneous	See Map	No Asbestos Detected
A-8 Shingle	Roofing Materials Gray/Black, Fibrous, Homogeneous	See Map	No Asbestos Detected
A-8a Tar	Roofing Materials Black, Non-Fibrous, Homogeneous	See Map	No Asbestos Detected
A-9 Shingle	Roofing Materials White/Black, Fibrous, Heterogeneous	See Map	No Asbestos Detected
A-9a Tar	Roofing Materials Black, Non-Fibrous, Homogeneous	See Map	No Asbestos Detected
A-10	Penetration Mastic Black, Non-Fibrous, Homogeneous	See Map	5% Chrysotile Asbestos Detected
A-11	Penetration Mastic Black, Non-Fibrous, Homogeneous	See Map	5% Chrysotile Asbestos Detected
A-12	Penetration Mastic Black, Non-Fibrous, Homogeneous	See Map	No Asbestos Detected
A-13	Penetration Mastic Black, Non-Fibrous, Homogeneous	See Map	7% Chrysotile Asbestos Detected
A-14	Penetration Mastic Black, Non-Fibrous, Homogeneous	See Map	5% Chrysotile Asbestos Detected

A-15 Shingle/Tar Mastic	Penetration Mastic Brown/Gray/Black, Non-Fibrous, Heterogeneous	See Map
A-16	Penetration Mastic Black, Non-Fibrous, Homogeneous	See Map
A-17	Penetration Mastic Gray, Non-Fibrous, Homogeneous	See Map
A-18	Penetration Mastic Gray, Non-Fibrous, Homogeneous	See Map
A-19	Penetration Mastic Gray, Non-Fibrous, Homogeneous	See Map
A-20	Penetration Mastic Gray, Non-Fibrous, Homogeneous	See Map
A-21	Penetration Mastic Gray, Non-Fibrous, Homogeneous	See Map
A-22	Penetration Mastic Gray, Non-Fibrous, Homogeneous	See Map
A-23	Penetration Mastic Gray, Non-Fibrous, Homogeneous	See Map

6% Chrysotile Asbestos Detected
5% Chrysotile Asbestos Detected
No Asbestos Detected
No Asbestos Detected
No Asbestos Detected
No Asbestos Detected
No Asbestos Detected
No Asbestos Detected
No Asbestos Detected


See Attached “Polarized Microscopy Asbestos Analysis Report” and associated chain of custody document for additional detail regarding location of samples (Appendix A).

2.0 RECOMMENDATIONS

Due to the findings, removal of these items **is** required to be performed by a California-licensed and registered asbestos abatement contractor. This report should be kept as part of the permanent archive of the subject property. If you have any questions or comments concerning this information or this report, please contact our office.

Yours very truly,

ENVIRONMENTAL TESTING ASSOCIATES,



_____

Kevin R. Riley, Certified Asbestos Consultant (17-5871)
NIOSH 582 Certification # 120400LA-06
NV-IJPM-1674
Attachments: Laboratory analytical results data sheet.

APPENDIX A

ANALYTICAL DATA

LA Testing

520 Mission Street South Pasadena, CA 91030
Tel/Fax: (323) 254-9960 / (323) 254-9982
http://www.LATesting.com / pasadenalab@latesting.com

LA Testing Order:	322412129
Customer ID:	32ETAS62
Customer PO:	
Project ID:	

Attention:	Kevin Riley	**Phone:**	
	Environmental Testing Associates	**Fax:**	(805) 497-7377
	850 Hampshire Rd	**Received Date:**	05/13/2024 9:30 AM
	Suite G	**Analysis Date:**	05/13/2024
	Westlake Village, CA 91361	**Collected Date:**	05/13/2024
Project:	Portola Elementary School Roofing Project - VENTURA UNIFIED SCHOOL DISTRICT 6700 Eagle Street, Ventura, CA 93003		

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
A1-Shingle *322412129-0001*	Roofing Materials	Gray Fibrous Heterogeneous	10% Glass	90% Non-fibrous (Other)	None Detected
A1-Tar *322412129-0001A*	Roofing Materials	Black Non-Fibrous Homogeneous	8% Glass	92% Non-fibrous (Other)	None Detected
A2-Shingle 1 *322412129-0002*	Roofing Materials	White/Black Fibrous Heterogeneous	12% Glass	88% Non-fibrous (Other)	None Detected
A2-Shingle 2/Tar Mastic *322412129-0002A* *Unable to separate*	Roofing Materials	White/Black Fibrous Heterogeneous		92% Non-fibrous (Other)	**8% Chrysotile**
A2-Tar *322412129-0002B*	Roofing Materials	Black Non-Fibrous Homogeneous	8% Glass	92% Non-fibrous (Other)	None Detected
A3-Shingle *322412129-0003*	Roofing Materials	White/Black Fibrous Heterogeneous	10% Glass	90% Non-fibrous (Other)	None Detected
A3-Tar *322412129-0003A*	Roofing Materials	Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
A4 *322412129-0004*	Roofing Materials	Gray/Black Fibrous Heterogeneous		90% Non-fibrous (Other)	**10% Chrysotile**
A5 *322412129-0005*	Roofing Materials	White/Black Fibrous Heterogeneous		90% Non-fibrous (Other)	**10% Chrysotile**
A6 *322412129-0006*	Roofing Materials	White/Black Fibrous Heterogeneous	10% Glass	90% Non-fibrous (Other)	None Detected
A7-Shingle *322412129-0007*	Roofing Materials	Gray/Black Fibrous Heterogeneous	10% Glass	90% Non-fibrous (Other)	None Detected
A7-Tar *322412129-0007A*	Roofing Materials	Black Non-Fibrous Homogeneous	3% Glass	97% Non-fibrous (Other)	None Detected
A8-Shingle *322412129-0008*	Roofing Materials	Gray/Black Fibrous Heterogeneous	10% Glass	90% Non-fibrous (Other)	None Detected
A8-Tar *322412129-0008A*	Roofing Materials	Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
A9-Shingle *322412129-0009*	Roofing Materials	White/Black Fibrous Heterogeneous	10% Glass	90% Non-fibrous (Other)	None Detected

Initial report from: 05/13/2024 14:20:58

LA Testing

520 Mission Street South Pasadena, CA 91030

Tel/Fax: (323) 254-9960 / (323) 254-9982

http://www.LATesting.com / pasadenalab@latesting.com

LA Testing Order:	322412129
Customer ID:	32ETAS62
Customer PO:	
Project ID:	

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
A9-Tar *322412129-0009A*	Roofing Materials	Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
A10 *322412129-0010*	Penetration Mastic	Black Non-Fibrous Homogeneous	2% Cellulose 5% Wollastonite	88% Non-fibrous (Other)	**5% Chrysotile**
A11 *322412129-0011*	Penetration Mastic	Black Non-Fibrous Homogeneous	2% Cellulose 5% Wollastonite	88% Non-fibrous (Other)	**5% Chrysotile**
A12 *322412129-0012*	Penetration Mastic	Black Non-Fibrous Homogeneous	2% Cellulose 5% Wollastonite	93% Non-fibrous (Other)	None Detected
A13 *322412129-0013*	Penetration Mastic	Black Non-Fibrous Homogeneous	2% Cellulose 5% Wollastonite	86% Non-fibrous (Other)	**7% Chrysotile**
A14 *322412129-0014*	Penetration Mastic	Black Non-Fibrous Homogeneous	2% Cellulose 5% Wollastonite	88% Non-fibrous (Other)	**5% Chrysotile**
A15-Shingle/Tar Mastic *322412129-0015*	Penetration Mastic	Brown/Gray/Black Non-Fibrous Heterogeneous	2% Cellulose 5% Wollastonite	87% Non-fibrous (Other)	**6% Chrysotile**
A16 *322412129-0016*	Penetration Mastic	Black Non-Fibrous Homogeneous	2% Cellulose 5% Wollastonite	88% Non-fibrous (Other)	**5% Chrysotile**
A17 *322412129-0017*	Penetration Mastic	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
A18 *322412129-0018*	Penetration Mastic	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
A19 *322412129-0019*	Penetration Mastic	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
A20 *322412129-0020*	Penetration Mastic	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
A21 *322412129-0021*	Penetration Mastic	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
A22 *322412129-0022*	Penetration Mastic	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
A23 *322412129-0023*	Penetration Mastic	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Initial report from: 05/13/2024 14:20:58

LA Testing

520 Mission Street South Pasadena, CA 91030

Tel/Fax: (323) 254-9960 / (323) 254-9982

http://www.LATesting.com / pasadenalab@latesting.com

LA Testing Order:	322412129
Customer ID:	32ETAS62
Customer PO:	
Project ID:	

Analyst(s)

Rosa Mendoza (21)

Joel Paruli (9)

Jerry Drapala Ph.D, Laboratory Manager
or Other Approved Signatory

LA Testing maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by LA Testing. LA Testing bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore LA Testing recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by LA Testing South Pasadena, CA NVLAP Lab Code 200232-0, CA ELAP 2283

Initial report from: 05/13/2024 14:20:58

#322412129

Environmental Testing Associates

CHAIN OF CUSTODY

L.A. TESTING
520 Mission Street, South Pasadena, CA
Phone: 800.303.0047 Fax: 323.254.9982

850 Hampshire Road Suite G, Westlake Village, CA 91361 Phone: 805.497.7499 Fax: 805.497.7477

Project Name: **Portola Elementary School** Roofing Project- VENTURA UNIFIED SCHOOL DISTRICT Inspector: Kevin Riley Date: 05/09/2024

Project Address: 6700 Eagle Street, Ventura, CA 93003

Client Name: VENTURA UNIFIED SCHOOL DISTRICT Contact # Ryan Hughes 805.901.9620

Email: KRiley@etatesting.com, JWeber@etatesting.com, AHamel@etatesting.com

Sample #	Sample Description	Type	Volume	Code	Comments	H/T
A1	**Roofing Materials**	G/D/SD	8 KIT	PLM	See map	NF
A2	**Roofing Materials**	G/D/SD		PLM		
A3	**Roofing Materials**	G/D/SD		PLM		
A4	**Roofing Materials**	G/D/SD		PLM		
A5	**Roofing Materials**	G/D/SD		PLM		
A6	**Roofing Materials**	G/D/SD		PLM		
A7	**Roofing Materials**	G/D/SD		PLM		
A8	**Roofing Materials**	G/D/SD		PLM		
A9	**Roofing Materials**	G/D/SD		PLM		

Relinquished by: _____ DATE: 5-11-24 TIME: 4 ☒Sent Via FedEx ☐Hand Delivered to Lab

Kevin Riley CAC-17-5871

Received by: Jhennifer Sotelo efax _____ DATE: 5/13/24 TIME: 9:30

Name (please print) Signature

Requested Analysis Circle one: 6 Hour

Page 1 of 3

Page 1 Of 3

OrderID: 322412129

#322412129

Environmental Testing Associates

CHAIN OF CUSTODY

L.A. TESTING
520 Mission Street, South Pasadena, CA
Phone: 800.303.0047 Fax: 323.254.9982

850 Hampshire Road Suite G, Westlake Village, CA 91361 Phone: 805.497.7499 Fax: 805.497.7477

Project Name: **Portola Elementary School** Roofing Project- VENTURA UNIFIED SCHOOL DISTRICT Inspector: Kevin Riley Date: 05/09/2024

Project Address: 6700 Eagle Street, Ventura, CA 93003

Client Name: VENTURA UNIFIED SCHOOL DISTRICT Contact # Ryan Hughes 805.901.9620

Email: KRiley@etatesting.com, JWeber@etatesting.com, AHamel@etatesting.com

Sample #	Sample Description	Type	Volume	Code	Comments	H/T
A10	**Penetration Mastic**	G/D/SD	3cm	PLM	See map MP	NF
A11	**Penetration Mastic**	G/D/SD		PLM		
A12	**Penetration Mastic**	G/D/SD		PLM		
A13	**Penetration Mastic**	G/D/SD		PLM		
A14	**Penetration Mastic**	G/D/SD		PLM		
A15	**Penetration Mastic**	G/D/SD		PLM		
A16	**Penetration Mastic**	G/D/SD		PLM		
	Penetration Mastic	G/D/SD		PLM		
	Penetration Mastic	G/D/SD		PLM		

Relinquished by: _____ DATE: 5-11-24 TIME: 7p ☒Sent Via FedEx ☐Hand Delivered to Lab
Kevin Riley CAC-17-5871

Received by: Jennifer Sotelo (FAX) _____ DATE: 5/13/24 TIME: 9:30
Name (please print) Signature

Requested Analysis Circle one: 6 Hour

OrderID: 322412129

#322412129

Environmental Testing Associates

CHAIN OF CUSTODY

L.A. TESTING
520 Mission Street, South Pasadena, CA
Phone: 800.303.0047 Fax: 323.254.9982

850 Hampshire Road Suite G, Westlake Village, CA 91361 Phone: 805.497.7499 Fax: 805.497.7477

Project Name: **Portola Elementary School** Roofing Project- VENTURA UNIFIED SCHOOL DISTRICT Inspector: Kevin Riley Date: 05/09/2024

Project Address: 6700 Eagle Street, Ventura, CA 93003

Client Name: VENTURA UNIFIED SCHOOL DISTRICT Contact # Ryan Hughes 805.901.9620

Email: KRiley@etatesting.com, JWeber@etatesting.com, AHamel@etatesting.com

Sample #	Sample Description	Type	Volume	Code	Comments	H/T
A17	**Penetration Mastic**	G/D/SD	3K VB	PLM	See Map	NE
A18	**Penetration Mastic**	G/D/SD		PLM		
A19	**Penetration Mastic**	G/D/SD		PLM		
A20	**Penetration Mastic**	G/D/SD		PLM		
A21	**Penetration Mastic**	G/D/SD		PLM		
A22	**Penetration Mastic**	G/D/SD		PLM		
A23	**Penetration Mastic**	G/D/SD		PLM		
	Penetration Mastic	G/D/SD		PLM		
	Penetration Mastic	G/D/SD		PLM		

Relinquished by: _____ DATE: 5-11-24 TIME: 4p ☒Sent Via FedEx ☐Hand Delivered to Lab
Kevin Riley CAC-17-5871


Received by: Jennifer Seidel (FedEx) _____ DATE: 5/13/24 TIME: 9:30
Name (please print) Signature

Requested Analysis Circle one: 6 Hour

Page 3 of 3

Page 3 Of 3

OrderID: 322412129

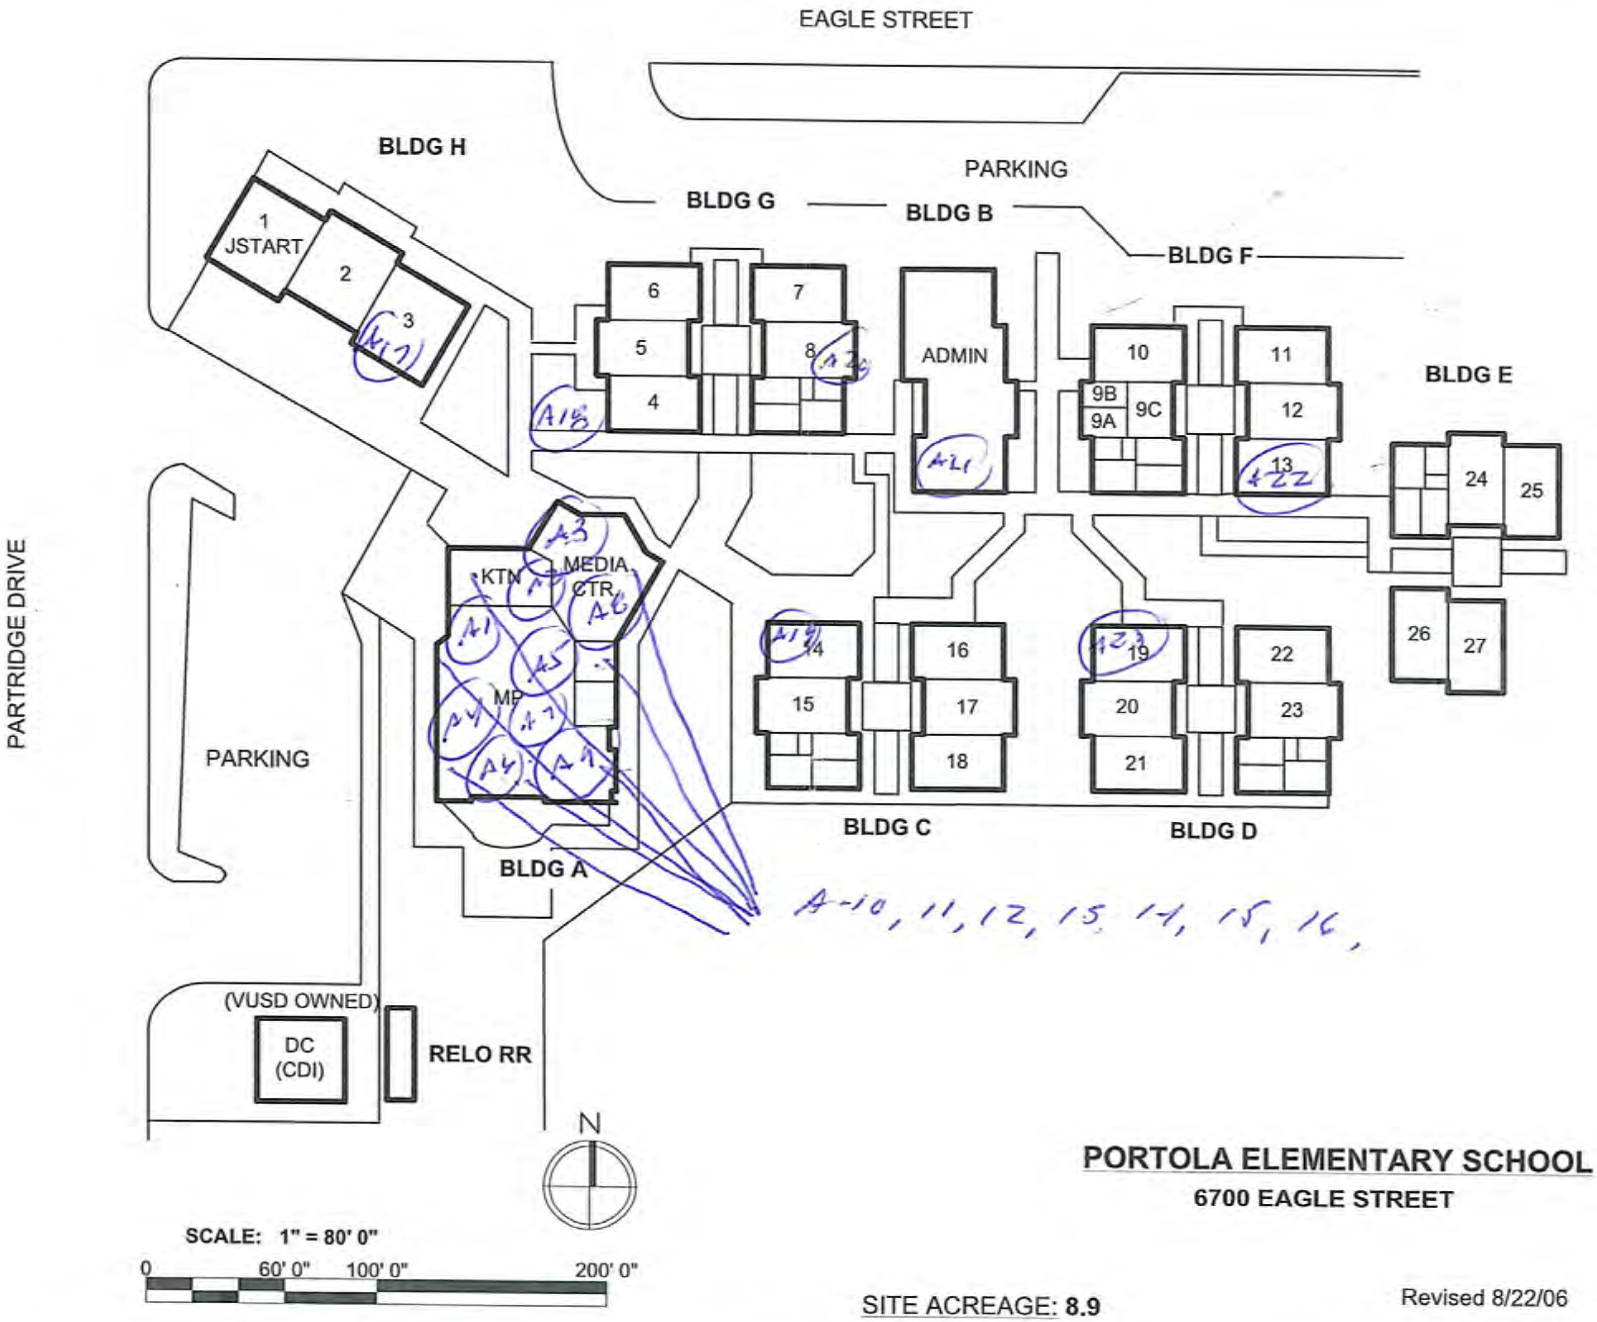

PORTOLA ELEMENTARY SCHOOL

6700 EAGLE STREET

SITE ACREAGE: **8.9**

Revised 8/22/06











State of California
Division of Occupational Safety and Health
Certified Asbestos Consultant

Kevin R Riley
Name



Certification No. **17-5871**

Expires on **02/15/25**

This certification was issued by the Division of Occupational Safety and Health as authorized by Sections 7180 et seq. of the Business and Professions Code.