ACCESSIBILITY ASSESSMENT

prepared for

Pasadena Unified School District
740 West Woodbury Road
Altadena, California 91001
Don Cristobal



ADA TITLE II ASSESSMENT

OF

Pasadena High School
2925 East Sierra Madre Boulevard
Pasadena, California 91107

PREPARED BY:
Bureau Veritas
6021 University Boulevard, Suite 200
Ellicott City, Maryland 21043
800.733.0660
www.bureauveritas.com

BV CONTACT:
Michael Cunniff
Program Manager
800.733.0660 x7296214
Michael.Cunniff@bureauveritas.com

BUREAU VERITAS PROJECT #:
164633.23R000-002.303

DATE OF REPORT:
February 1, 2024

ON-SITE DATE:
Dec. 4-8, 2023, Dec. 12-13, 2023

TABLE OF CONTENTS

1 Executive Summary 1
1.1 Summary of Findings 1
1.2 Accessibility Summary Table 1
1.3 Purpose 2
1.4 Scope of Work 2
1.5 Historic Amenities 4
1.6 Basis for Order of Magnitude Costs 4
1.7 Criteria for Priority Levels 4
2 Accessibility 6
2.1 Barrier Summary Table 6
3 Certification 43
4 Appendices 44

1 EXECUTIVE SUMMARY

1.1 SUMMARY OF FINDINGS

The Client contracted with Bureau Veritas to conduct a Title II Accessibility Assessment of Pasadena High School. The purpose of this investigation and report is to provide the Client with accessibility recommendations concerning Pasadena High School.

The site was visited on December 4-8, 2023 and December 12-13, 2023. Weather conditions at the time of the on-site visit were clear, with temperatures in the 70's (°F), mild winds with occasional gusts.

SIGNIFICANT ISSUES:

Significant barriers to accessibility are present at the amenities listed below. The issues prevent full accessibility at the amenity and are the most substantial non-compliant elements. Additional barriers may be present at the amenity. Further compliant detail is provided in Section 2 and Appendix B of the report.

Exterior

- The accessible parking spaces and access aisles have slopes greater than 2% at parking lots 1 and 3.
- The ramps leading to the auditorium and basketball courts from parking lot 1, have running slopes greater than 8.33%.
- The asphalt play area South of the swimming pools have major cracks creating abrupt changes in level greater that 1/4 inch.
- Ramps between Building G and H and between H and I on the 1st and 2nd floor do not provide handrails.
- The outdoor lockers do not provide accessible hardware.
- An accessible route is not provided to the football field bleacher seating from the accessible parking.
- The route to the wheelchair area at bleacher seating is segregated and an accessible route is not provided.
- Most of the route to the football field from the locker rooms has running slopes up to 9% and cross slopes up to 4.6% and handrails are not provided.
- An accessible route is not provided to the soccer and softball fields.
- The swimming pools do not provide the required accessible entrances.
- No accessible parking is provided at parking lots 4, 5, and 6.
- Buildings E, G, H, I, N, P, and Q have door landings that are ramped creating slopes greater than 2%.

Interior

- Most doors throughout the campus have an opening force that exceeds compliance and close too fast.
- Many doors throughout the campus have vision lights where the bottom edge is higher than 43 inches from the floor.
- All elevators require a key to operate.
- Most sinks provided in classrooms and employee areas are too high and do not provide knee and toe clearance.
- Light switches throughout the campus are above 48 inches.
- Many drinking fountains throughout the campus are a single fountain.

It is the responsibility of the owner to assess the requirement for barrier removal under Title I Employment, Title II State and Local Government Services, Title IV Telecommunications, Title V Miscellaneous of the ADA to create an accessible environment. Not all physical barriers identified in this report may need to be corrected. Some barriers may be the responsibility of others or can be corrected through programmatic change. It is incumbent upon the owner to initiate a transition planning process to outline which barrier will be corrected and when correction should take place. For further explanation, see Section 1.4, Scope of Work.

Each area of concern observed and identified by Bureau Veritas is detailed in this report, which includes Bureau Veritas's scope and methodology; ADA elements reviewed; individual observation details with recommendations and order of magnitude estimated costs; site plans with observation location data; and supporting materials.

1.2 ACCESSIBILITY SUMMARY TABLE

Based on the onsite review, Bureau Veritas found that barriers to accessibility exist at Pasadena High School. The observed elements were analyzed using the 2010 ADA Standards for Accessible Design, state and local accessibility codes. The barriers are summarized in Section 2.1.

Bureau Veritas's assessment of the subject property identified the following areas of concern:

PASADENA HIGH SCHOOL - TITLE II ACCESSIBILITY ASSESSMENT - ACCESSIBILITY SUMMARY

	Priority 1		Priority 2		Priority 3		Priority 4		Priority 5		Total	
Facility / Building	**Est. Cost**	**Items**	**Est. Cost**	**Items**	**Est. Cost**	**Items**	**Est. Cost**	**Items**	**Est. Cost**	**Items**	**Est. Cost**	**Items**
Pasadena High School	**$1,494,010**	234	**$517,340**	91	**$640,084**	377	**$240,153**	23	**$65,886**	13	**$2,957,472**	739
Grand Total	**$1,494,010**	234	**$517,340**	91	**$640,084**	377	**$240,153**	23	**$65,886**	13	**$2,957,472**	739

Order of magnitude costs to address those elements are described individually in Appendix B.

1.3 PURPOSE

The purpose of this report is to assist the Client in evaluating the compliance of certain exterior and interior elements with the requirements of Title II of the Americans with Disabilities Act (ADA) and applicable state and local codes and regulations.

1.4 SCOPE OF WORK

ADA TITLE II ASSESSMENT

A Subject Matter Expert will visit the properties to assess the compliance of existing property improvements with the Title II provisions of the Americans with Disabilities Act (ADA) and applicable state requirements. Bureau Veritas then produces a report which identifies each facility's observed compliance issues and specific barriers, along with proposed remedies. Bureau Veritas endeavors to include all barriers within the defined scope of work area, however, some barriers may not be identified in the report. **Bureau Veritas provides order of magnitude cost estimates directly associated with each barrier but does not provide engineered construction documents or construction cost estimates of barrier removal.**

The field observer will review of the facility's common areas to observe and identify representative barriers to accessibility and formulate recommendations to remedy the physical barriers. As a part of the review, the field observer will meet with a property representative with specific knowledge of the facility to gain a clear understanding of overall features, public use patterns, and relevant historical data. The ADA covers both public areas and employee-only areas for Title II entities. For the purposes of this portfolio, all public features of the property will be subject to observation, as well as employee-only areas. Public areas will include but not be limited to parking lots, sidewalks, access ramps, and exterior and interior common areas accessible to the public.

Title II entities are obligated to remove barriers under the requirements of the ADA as follows:

Facilities constructed prior to January 26, 1992– elements that do not comply with the 2010 ADA Standards are not required to be made compliant, unless alteration to those elements takes place. If elements are altered, then compliance with the 2010 Standards is required.

Facilities constructed between January 26, 1992 and March 15, 2012 – were required to comply with 1991 ADA Standards when constructed. If full compliance with the 1991 ADA Standards was not achieved by March 15, 2012, then the facilities must comply with the 2010 Standards. If elements in compliance with the 1991 Standards were altered after March 15, 2012, then compliance with the 2010 Standards is required.

Facilities constructed on March 15, 2012 to present- new construction, additions and alterations must be fully compliant with the 2010 ADA Standards for Accessible Design.

Alterations and Additions-

Additions and alterations undertaken at existing facilities are covered by the 2010 ADA Standards for Accessible Design. The extent of application is largely determined by a project's scope of work as the standards apply to those elements or spaces that are altered or added. Additional requirements apply to projects that affect or could affect the usability of, or access to, an area containing a primary function.

Alterations are defined in the standards as "a change in a building or facility that affects or could affect the usability of a building or facility or portion thereof." Many types of projects are covered as "alterations," including remodeling, renovation, rehabilitation, reconstruction, restoration, resurfacing of circulation paths or vehicular ways, and changes or rearrangement of structural parts, elements, or walls. Normal maintenance, reroofing, painting or wallpapering, or changes to mechanical and electrical systems are not considered alterations unless they affect a facility's usability. For example, a project limited to an HVAC system that includes the addition of thermostats would affect a facility's usability because it involves elements (operable parts) covered by the standards. The Department of Justice has determined that restriping of parking lots is considered an alteration of the parking facility.

The standards ensure that the opportunities for accessibility presented by an alteration are taken. How and to what extent the standards apply is determined by the scope of a project and the elements and spaces altered. Only those elements or spaces altered are required to comply, but alterations made to areas containing a primary function (a major activity for which a facility is intended) also require an accessible path of travel.

If alterations are limited only to elements in a room or space, then the standards apply only to the elements altered. Similarly, where spaces are altered, the standards apply to those spaces that are altered. If a room or space is completely altered (or built new as part of an alteration), the entire room or space is fully subject to the standards. Compliance is required to the extent that it is technically feasible.

Projects that increase, expand, or extend a facility's gross floor area or height of a facility are considered additions and must comply with the requirements of the standards applicable to new construction. Existing elements and spaces affected by an addition are treated as alterations and qualify for certain allowances or exceptions that are not permitted in new construction.

Compliance in an alteration is not required where it is "technically infeasible." The term is defined as "something that has little likelihood of being accomplished because existing structural conditions would require removing or altering a load-bearing member that is an essential part of the structural frame; or because other existing physical or site constraints prohibit modification or addition of elements, spaces, or features that are in full and strict compliance with the minimum requirements." Where technical infeasibility is encountered, compliance is still required to the maximum extent technically feasible.

FIELD OBSERVATION PROCESS

The field observer will first review documents and information provided by the owner or owner's representative that could supplement the consultant's knowledge of the subject property's physical improvements, extent and type of use, and/or assist in identifying barriers to accessibility.

During the site visit, the field observer will utilize a Survey Form that meets or exceeds the current ADAAG format, and will utilize a digital level, measuring tape, pressure gauge and digital camera. The field observer will identify and prioritize observed existing improvements which are not in accordance with the applicable ADA requirements in the order of preference as set out by the DOJ and refined by Bureau Veritas per client preferences. Typical priorities are as follows:

- Physical access to the property
- Access to areas of commerce or public accommodation

The Bureau Veritas team will assess exterior common areas and interior common areas that are defined as areas of public accommodation. Bureau Veritas will identify existing conditions that are not in accordance with the ADA Accessibility Guidelines, including the elements specified below (if applicable, where landlord is responsible for observed elements):

- Passenger loading zones
- Parking: van and standard car accessible stalls, signage, and markings
- Exterior accessible routes, including travel on vehicular ways, sidewalks and paths
- Ground and floor surfaces
- Curb ramps and other ramps: size, distance, slope, rails and surface finishes
- Interior accessible routes
- Exterior and interior stairs which are part of the means of egress
- Elevators and platform lifts (wheelchair lifts)
- Entrances and exits to common areas
- Handrails and grab bars
- Space allowance and reach ranges
- Restrooms
- Alarms (visual and audible) and warnings
- Signage- Braille, and visual characters
- Public telephones
- Switches and outlets

REPORT CONTENT

Bureau Veritas will deliver a consolidated AssetCalc™ database, which will be capable of exporting electronic (PDF) reports for each property surveyed which will include:

- Summary of Findings for all primary features (for example, parking stalls, curb ramps, paths of travel, restrooms);
- Individually recorded barriers
- Digital photos of observed barriers
- Geocode references for the location of observed exterior barriers
- Applicable ADA and state regulatory references

- Recommendations for viable corrective measures necessary to comply with regulations
- Order of magnitude cost estimates for each barrier

The estimates for the non-compliant items noted within this report are summarized in Section 2.1, and individual barrier details are provided in Appendix B.

1.5 HISTORIC AMENITIES

This property does not contain any amenities which are listed on the National Register of Historic Places or a state or local registry of historic elements.

1.6 BASIS FOR ORDER OF MAGNITUDE COSTS

Order of magnitude estimates are based on invoice or bid documents provided either by the Owner/facility and construction costs developed by construction resources such as *R.S. Means* and *Marshall & Swift,* Bureau Veritas's experience with past costs for similar properties, city cost indexes, and assumptions regarding future economic conditions. Typically, barrier removal allowances are based upon the removal of the specific element being evaluated (for example, parking stall, curb ramp, restroom). Architectural plans for renovation of areas requiring barrier removal or grading plans based on field surveys using land surveyor instrumentation could result in significantly different material quantities and subsequent higher project costs. Bureau Veritas has no control over the final scope of work, pricing methods, and costs associated with a contractor constructing the project. The opinion of estimated costs within this report cannot guarantee that the costs will accurately reflect the actual bids for construction.

1.7 CRITERIA FOR PRIORITY LEVELS

The scope of this assessment is limited to exterior site features and amenities, specifically accessible parking and exterior accessible pedestrian paths of travel to and from the amenities and features provided at each site. This includes parking, public transportation, retail, restaurant, office and industrial space, where applicable. As such, Bureau Veritas prioritized each of the captured barriers based on modified, published Department of Justice (DOJ) criteria focusing on the primary scope of work. Interior spaces such as common corridors, restrooms, kitchens and other interior elements along the common path of travel, such as water fountains, that are the responsibility of the property owner, are included.

The ADA also regulates employee work areas. Common corridors used by employees, employee restrooms, employee kitchens and employee break rooms are not considered "employee work areas." Those areas, even if used by employees only, shall comply with the ADA regulations which govern corridors, restrooms, kitchens and break rooms. The scope of this project does not include employee-only areas.

Per DOJ Guidelines, *people with disabilities should be able to arrive on the site, approach the building or facility and its amenities, and enter as freely as everyone else.*

Priority 1:

Accessible Van Parking – Access to a facility begins with accessible parking. Van accessible parking is deemed an important barrier for parking. Those with the most severe disabilities tend to require a van accessible space to accommodate their vehicle and mobility device. In addition, a minimum number of van accessible spaces is required. Barriers associated with the compliance of a van accessible space include signage, restriping, constructing or reconfiguring the pavement to accommodate the required number of spaces.

Accessible Car Parking –Car accessible parking includes all barriers associated with the compliance of a car accessible space including signage, restriping, constructing or reconfiguring the pavement to accommodate the required number of accessible spaces.

Accessible Approach and Entrances – An entity providing accommodation to the public is required to take measures to provide access to a place of public accommodation from public sidewalks, parking, or public transportation. The DOJ and state building codes dictate the minimum width, cross and running slope, signage, and handrail requirements associated with pedestrian accessible routes of travel. These measures include, for example, installing an entrance ramp, correcting tripping hazards or lessening the slope of a curb ramp. At least one route of travel to each amenity or feature should be safe and accessible for everyone, including people with disabilities.

Priority 2: ***Elements along the Accessible Route-*** Barriers which occur along the path of travel shall be removed, where such a barrier removal is easily accomplishable. Examples include moving items within reach range, widening doors, installing accessible door hardware, and removing high-pile carpeting.

Priority 3: ***Restroom Facilities-*** Barrier removal may include widening of toilet stalls, installation of grab bars, replacement of sinks, and drinking fountains.

Priority 4: ***Access to All Other Features and Amenities*** **–** Measures are required to provide access to other areas. This priority is for items not required for basic access in the other three priorities.

Priority 5: Employee-Only Areas- Where employee-only areas are included in the assessment, employee only areas are designated as the lowest priority, as a method of placing public spaces as a higher priority for barrier removals.

2 ACCESSIBILITY

Generally, Title II of the Americans with Disabilities Act (ADA) prohibits discrimination by entities to access and use of the programs, services, and activities on the basis of disability. Regardless of their age, these areas and facilities must be maintained and operated to comply with the Americans with Disabilities Act Accessibility Guidelines (ADAAG), and applicable state and local accessibility regulations to the maximum extent possible for providing programmatic access.

The scope of the Accessibility Assessment, as defined in the scope of work, is limited to exterior and interior areas covered by the ADA, and applicable state and local accessibility codes.

2.1 BARRIER SUMMARY TABLE

The following table summarizes the barriers that were identified. The costs provided are order of magnitude estimates. Costs will vary depending upon the location and volume of work performed. Individual observation details may be found in Appendix B.

Barrier Summary Report

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418281	Pasadena High School	BUILDING G	Interior Access Route	Controls And Dispensers	0	The amenity cannot be accessed and, therefore, cannot be evaluated.	Building G - G 107	ADA	$0
424384	Pasadena High School	BUILDING A	Entrance to Building	Building Entrance - Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	Building A - Main Public Entrance	California Accessibility Code	$2,188
424389	Pasadena High School	BUILDING A	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building A - A206	ADA	$910
424414	Pasadena High School	BUILDING A	Interior Access Route	Controls And Dispensers	1	Clear space is not provided at the control or operating mechanism.	Building A - A255B Restroom Women's	ADA	$250
424420	Pasadena High School	BUILDING A	Interior Access Route	Controls And Dispensers	1	Clear space is not provided at the control or operating mechanism.	Building A - A255C Restroom Women's	ADA	$116
424438	Pasadena High School	BUILDING A	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building A - 101 Nurse	ADA	$250
424439	Pasadena High School	BUILDING A	Interior Access Route	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	Building A - 101 Nurse	ADA	$1,563
424464	Pasadena High School	BUILDING A	Interior Access Route	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	Building A - A110	ADA	$1,563
424474	Pasadena High School	BUILDING A	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building A - Corridor East Side	ADA	$910
424484	Pasadena High School	BUILDING A	Interior Access Route	Controls And Dispensers	1	Clear space is not provided at the control or operating mechanism.	Building A - A112 Restroom Women's	ADA	$250
419843	Pasadena High School	BUILDING B	Interior Access Route	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	Building B - B112 Boys Dressing Room	ADA	$1,563
419854	Pasadena High School	BUILDING B	Interior Access Route	Ramp	1	The ramp running slope exceeds 1:12 (8.33%).	Building B -Ramp Adjacent To B106	ADA	$16,550
418264	Pasadena High School	BUILDING B	Interior Access Route	Door	1	The door has less than 32" clear width.	Auditorium Northeast Doors	ADA	$13,000
418266	Pasadena High School	BUILDING B	Interior Access Route	Ramp	1	Handrail heights are not compliant.	Building B - Auditorium Interior Ramp West Side	ADA	$12,225
418267	Pasadena High School	BUILDING B	Interior Access Route	Ramp	1	The ramp running slope exceeds 1:12 (8.33%).	Building B - Auditorium Interior Ramp West Side	ADA	$16,550
418268	Pasadena High School	BUILDING B	Interior Access Route	Door	1	The push side of the accessible door does not have the required maneuvering clearances.	Building B - Auditorium Exterior Southwest Doors	ADA	$1,563
418269	Pasadena High School	BUILDING B	Interior Access Route	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	Auditorium Stage Stairs	California Accessibility Code	$5,094
418232	Pasadena High School	BUILDING B	Interior Access Route	Door	1	The door has less than 32" clear width.	Auditorium East Exit Doors	ADA	$13,000
419856	Pasadena High School	BUILDING C	Interior Access Route	Interior Access Route	1	CALIFORNIA: The width of the aisle is not compliant.	Building C - C112 Workroom	California Accessibility Code	$23,250
419857	Pasadena High School	BUILDING C	Interior Access Route	Ramp	1	A ramp is required but not provided.	Building C - C106 Choir Room	ADA	$8,275
419864	Pasadena High School	BUILDING C	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building C - C107	ADA	$910
419873	Pasadena High School	BUILDING C	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings are not provided or not compliant.	Building C - Ramp Near Exit Facing South	California Accessibility Code	$204

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
419874	Pasadena High School	BUILDING C	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	Building C - Ramp Near Exit Facing South	California Accessibility Code	$14,895
418357	Pasadena High School	BUILDING D	Entrance to Building	Building Entrance-Door	1	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	Building D - D101 Student Services	California Accessibility Code	$1,563
418393	Pasadena High School	BUILDING D	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building D - D153 Corridor	ADA	$910
418376	Pasadena High School	BUILDING D	Entrance to Building	Building Entrance-Door	1	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	Building D - D102 Textbook Room	California Accessibility Code	$1,563
420145	Pasadena High School	BUILDING E	Interior Access Route	Stairs	1	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Building E - Stairs East Side	California Accessibility Code	$88
419827	Pasadena High School	BUILDING E	Interior Access Route	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	Building E - E101	ADA	$1,563
419834	Pasadena High School	BUILDING E	Interior Access Route	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	Building E - E102	ADA	$1,563
419835	Pasadena High School	BUILDING E	Interior Access Route	Door	1	The door has less than 32" clear width.	Building E - E102	ADA	$9,750
419839	Pasadena High School	BUILDING E	Interior Access Route	Stairs	1	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Building E - Stairs West Side	California Accessibility Code	$88
419842	Pasadena High School	BUILDING E	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building E - 2nd Floor 208	ADA	$910
418306	Pasadena High School	BUILDING F	Entrance to Building	Building Entrance - Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	Building F - Door Southeast Side	California Accessibility Code	$2,188
418310	Pasadena High School	BUILDING F	Interior Access Route	Stairs	1	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Building F - Drinking Fountain Adjacent to F121 Women's	California Accessibility Code	$88
418311	Pasadena High School	BUILDING F	Interior Access Route	Door	1	The push side of the accessible door does not have the required maneuvering clearances.	Building F - F102A Office	ADA	$1,563
418315	Pasadena High School	BUILDING F	Interior Access Route	Stairs	1	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Building F - Stairs Near F100 A Boys Dressing Room	California Accessibility Code	$88
419736	Pasadena High School	BUILDING H	Interior Access Route	Head Room	1	The height of the interior accessible route is less than 80" AFF.	Building H - H208	ADA	$910
419737	Pasadena High School	BUILDING H	Interior Access Route	Head Room	1	The height of the interior accessible route is less than 80" AFF.	Building H - H202	ADA	$910
419739	Pasadena High School	BUILDING H	Interior Access Route	Controls And Dispensers	1	Controls throughout the common area are not compliant.	Building H - Clasrooms With Hoods	ADA	$563

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
419756	Pasadena High School	BUILDING H	Interior Access Route	Stairs	1	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stair L Building H Breezeway	California Accessibility Code	$176
418724	Pasadena High School	BUILDING I	Interior Access Route	Door	1	The push side of the accessible door does not have the required maneuvering clearances.	Building I - Ramped Door Landings	ADA	$21,875
418728	Pasadena High School	BUILDING I	Interior Access Route	Head Room	1	The height of the interior accessible route is less than 80" AFF.	Building I - I109	ADA	$910
418730	Pasadena High School	BUILDING I	Interior Access Route	Stairs	1	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Building I - Stairs Westend	California Accessibility Code	$88
418731	Pasadena High School	BUILDING I	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building I - I210	ADA	$910
418732	Pasadena High School	BUILDING I	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building I - I208	ADA	$910
418642	Pasadena High School	BUILDING N	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building N - P105	ADA	$1,820
418639	Pasadena High School	BUILDING N	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building N - 104A Workroom	ADA	$910
418643	Pasadena High School	BUILDING Q	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building Q - Q101	ADA	$2,730
418646	Pasadena High School	BUILDING Q	Interior Access Route	Door	1	The push side of the accessible door does not have the required maneuvering clearances.	Building Q - Q107B	ADA	$1,563
418647	Pasadena High School	BUILDING Q	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building Q - Q107	ADA	$910
418648	Pasadena High School	BUILDING Q	Interior Access Route	Interior Access Route	1	Gaps in the walking surface are over 1/2" wide, or elongated gaps are not perpendicular to the path of travel.	Building Q - Q109A	ADA	$625
418649	Pasadena High School	BUILDING Q	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building Q - Q109A	ADA	$910
419785	Pasadena High School	BUILDING R	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building R - R101 Foyer	ADA	$910
419788	Pasadena High School	BUILDING R	Interior Access Route	Controls And Dispensers	1	Clear space is not provided at the control or operating mechanism.	Building R - Restroom Women's R105A	ADA	$250
419790	Pasadena High School	BUILDING R	Interior Access Route	Door	1	The push side of the accessible door does not have the required maneuvering clearances.	Building R - R104 Ticket Booth	ADA	$1,563

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
419804	Pasadena High School	BUILDING R	Interior Access Route	Ramp	1	The ramp running slope exceeds 1:12 (8.33%).	Building R - Interior Ramp Leading to West Exit	ADA	$4,138
419880	Pasadena High School	BUILDING S	Interior Access Route	Accessible Route	1	Clear widths are less than 36" minimum, including protruding objects.	Building S - S105 Training Room	ADA	$125
419887	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Controls And Dispensers	1	Clear space is not provided at the control or operating mechanism.	Building S - S109 Team Room	ADA	$252
419888	Pasadena High School	BUILDING S	Interior Access Route	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	Building S - S109 Team Room	ADA	$1,563
419889	Pasadena High School	BUILDING S	Interior Access Route	Door	1	The door has less than 32" clear width.	Building S - S109 Team Room	ADA	$250
419892	Pasadena High School	BUILDING S	Interior Access Route	Ramp	1	Handrails are not compliant - they are not secure in their fittings or they rotate	Building S - Ramp Adjacent to S129 Boys Restroom	ADA	$3,056
419898	Pasadena High School	BUILDING S	Interior Access Route	Ramp	1	The ramp running slope exceeds 1:12 (8.33%).	Building S - Ramp Adjacent to S119 Women's Restroom	ADA	$4,138
419899	Pasadena High School	BUILDING S	Employee Work Areas	Locker Rooms	1	The locker rooms are not accessible.	Building S - S130 Faculty Locker Room	ADA	$413
420134	Pasadena High School	BUILDING T	Interior Access Route	Door	1	The push side of the accessible door does not have the required maneuvering clearances.	Building T - T104	ADA	$250
424535	Pasadena High School	BUILDING U	Accessible Parking	Parking Space-Van	1	CALIFORNIA: A van space and adjacent van aisle are not provided.	Parking Lot 5 P5	California Accessibility Code	$1,050
424538	Pasadena High School	BUILDING U	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	Ramp R16 At Building U Entrance	California Accessibility Code	$10,188
418692	Pasadena High School	BUILDING V	Interior Access Route	Interior Access Route	1	CALIFORNIA: The width of the aisle is not compliant.	Building V- V104 Servery	California Accessibility Code	$31,388
418676	Pasadena High School	BUILDING W	Interior Access Route	Door	1	CALIFORNIA: The hardware at the accessible door is not compliant.	Building W - Doors With Knob Hardware	California Accessibility Code	$1,465
418677	Pasadena High School	BUILDING W	Interior Access Route	Door	1	The door has less than 32" clear width.	Building W - W106	ADA	$3,250
418678	Pasadena High School	BUILDING W	Interior Access Route	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	Building W - W106	ADA	$1,563
418679	Pasadena High School	BUILDING W	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building W - W106	ADA	$500
418680	Pasadena High School	BUILDING W	Interior Access Route	Door	1	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.	Building W - Doors With Low Closers	ADA	$700
418682	Pasadena High School	BUILDING W	Interior Access Route	Controls And Dispensers	1	Controls throughout the common area are not compliant.	Building W - W102	ADA	$1,125
418688	Pasadena High School	BUILDING W	Exterior Access Route	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	Service Windows at Building W	California Accessibility Code	$672
418689	Pasadena High School	BUILDING W	Interior Access Route	Door	1	The push side of the accessible door does not have the required maneuvering clearances.	Building W - W103 Student Store	ADA	$125
418691	Pasadena High School	BUILDING W	Interior Access Route	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	Building W - W103 Student Store	ADA	$1,563
420132	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Door	1	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	Typical Interior Doors Throughout	ADA	$0
420133	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	Typical Interior Doors Throughout	ADA	$169,275

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
419822	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Head Room	1	The height of the interior accessible route is less than 80" AFF.	Typical Classroom Monitors Too Low	ADA	$8,190
419823	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	Typical Classroom Doors With Sloped Landings	ADA	$193,750
418275	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Controls And Dispensers	1	Controls throughout the common area are not compliant.	Typical Non-Compliant Paper Towel Dispensers	ADA	$33,188
418276	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Controls And Dispensers	1	The height of controls throughout the common area are not compliant.	Typical Paper Towel Dispensers Mounted Too High	ADA	$23,000
418278	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	Typical Classroom Entry Doors With Step	ADA	$109,375
418279	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Typical Paper Towel Dispensers Protruding Objects	ADA	$0
418280	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Typical Fire Extinguishers On Hooks Protruding.	ADA	$12,500
418235	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Typical Fire Extinguishers Cabinets Protrude	ADA	$10,010
418236	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Typical Fire Alarm Pull Enclosures Protrude	ADA	$14,350
418641	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Building N, P, & Q - Typical Classroom Sinks	ADA	$2,730
418333	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Curb Ramp	1	CALIFORNIA: The curb ramp has non-compliant slopes.	Curb Ramp CR-4	California Accessibility Code	$2,188
418334	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Curb Ramp	1	CALIFORNIA: The curb ramp has non-compliant slopes.	Curb Ramp CR-5	California Accessibility Code	$2,188
418371	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stairs Adjacent to D101 Student Sevices	California Accessibility Code	$264
418372	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	Stairs Adjacent to D101 Student Sevices	California Accessibility Code	$3,260
418377	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	Ramp South Side of Building D	California Accessibility Code	$12,413
418378	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The door which overlaps the ramp landing extends further than 3" maximum into the required landing size when fully open.	Ramp South Side of Building D	California Accessibility Code	$2,483
418358	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp landings are not compliant.	Ramp R4 South Side of Building F	California Accessibility Code	$4,138
418360	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp landings are not compliant.	Ramp R4 South Side of Building F	California Accessibility Code	$4,965
418361	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings do not extend 12" horizontally above the landing beyond the top and bottom of the ramp runs and in the same direction of the ramp run.	Ramp R4 South Side of Building F	California Accessibility Code	$1,019

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418362	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp landings are not compliant.	Ramp R4 South Side of Building F	California Accessibility Code	$4,138
418363	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stairs Southeast Side of Building G	California Accessibility Code	$1,980
418365	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	An accessible route does not connect accessible building or facility entrances with all accessible spaces and elements within the building or facility. At least one accessible route shall connect accessible elements that are on the same site.	Bench Southeast Side of Building G	ADA	$2,520
418366	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stairs East Side of Building D	California Accessibility Code	$220
418367	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	Stairs East Side of Building D	California Accessibility Code	$3,260
418368	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	Steps do not have uniform and compliant riser heights and/or tread depths.	Stairs East Side of Building D	ADA	$9,563
418352	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Curb Ramp	1	CALIFORNIA: The curb ramp is non-compliant.	Curb Ramp CR-6	California Accessibility Code	$3,028
418353	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Curb Ramp	1	CALIFORNIA: The parallel curb ramp does not have a compliant detectable warning on the landing at the bottom of the curb ramp.	Curb Ramp CR-6, CR-7	California Accessibility Code	$1,680
418354	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Curb Ramp	1	CALIFORNIA: The curb ramp is non-compliant.	Curb Ramp CR-7	California Accessibility Code	$3,028
418355	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has less than 80" vertical clearance.	POT from City Sidewalk to Abel Franco Theater	UFAS	$250
418356	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	Stairs ST3	California Accessibility Code	$2,038
418217	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Accessible Route from Accessible Parking Space P1-E	ADA	$2,500
418218	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Curb Ramp	1	CALIFORNIA: The counter slopes of adjoining gutters and streets within 24" of the curb ramp are greater than 1:20 (5%).	Curb Ramp CR-3	California Accessibility Code	$2,188
418219	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Curb Ramp	1	CALIFORNIA: The curb ramp has non-compliant slopes.	Curb Ramp CR-3	California Accessibility Code	$2,188
418220	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp landings are not compliant.	Ramp R1	California Accessibility Code	$2,483
418221	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	Ramp R1	California Accessibility Code	$6,620
418222	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	Ramp R2	California Accessibility Code	$4,138
418223	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	PROWAG - The pedestrian circulation path has areas in excess of 2.08% cross slope.	Accessible Route from Accessible Parking Space P1-E	PROWAG	$97,138
418224	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	Ramp R3 in Front of Auditorium	California Accessibility Code	$16,550
418225	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings do not extend 12" horizontally above the landing beyond the top and bottom of the ramp runs and in the same direction of the ramp run.	Ramp R3 in Front of Auditorium	California Accessibility Code	$204
418226	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	Edge protection is not provided where the ramp or landing has a drop-off.	Sidewalk Adjacent South Side of The Auditorium	UFAS	$4,250

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418227	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stairs ST1	California Accessibility Code	$528
418229	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	Stairs ST2	California Accessibility Code	$8,150
418230	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	The tread nosings are not compliant.	Stairs ST2	UFAS	$16,065
418205	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Curb Ramp	1	CALIFORNIA: The counter slopes of adjoining gutters and streets within 24" of the curb ramp are greater than 1:20 (5%).	Curb Ramp CR-1	California Accessibility Code	$2,188
418206	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Curb Ramp	1	CALIFORNIA: The curb ramp has non-compliant slopes.	Curb Ramp CR-1	California Accessibility Code	$2,188
418207	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Curb Ramp	1	CALIFORNIA: The curb ramp has non-compliant slopes.	Curb Ramp CR-2	California Accessibility Code	$2,188
418208	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Curb Ramp	1	CALIFORNIA: The curb ramp has non-compliant slopes.	Curb Ramp CR-2	California Accessibility Code	$2,188
418708	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	Ramp R7 Between Building G & H South Side	California Accessibility Code	$12,633
418709	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant or not provided.	Ramp R8 Between Building G & H North Side	California Accessibility Code	$6,316
418686	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	Accessible Route West Side of Building W	ADA	$500
418720	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has running slopes greater than 1:20 (5%).	Accessible Route Between Building I & E West End	ADA	$5,800
418635	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Accessible Route to Building N	ADA	$1,750
418636	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	Ramp R5 Northwest Side of Building N	California Accessibility Code	$4,075
418637	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings extend more than 3-1/2" into the ramp clear width.	Ramp R5 Northwest Side of Building N	California Accessibility Code	$2,483
418661	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Accessible Route to Building N	ADA	$8,000
418662	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings do not extend 12" horizontally above the landing beyond the top and bottom of the ramp runs and in the same direction of the ramp run.	Ramp R6 Between Building N & P	California Accessibility Code	$815
418663	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	The ramp changes direction, but does not have a 60" minimum by 60" minimum landing at the change in direction.	Ramp R6 Between Building N & P	ADA	$12,420
418664	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Accessible Route to Building P	ADA	$7,000
418665	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	Building P - P103	ADA	$63
418190	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Accessible Route from Accessible Parking Space P1-A	ADA	$5,600
420151	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	Stairs ST11 Adjacent to C102	California Accessibility Code	$1,223

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
420152	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stairs ST11 Adjacent to C102	California Accessibility Code	$88
420153	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Sidewalk Adjacent to Building C	ADA	$14,040
420154	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	Sidewalk Adjacent to Building C	ADA	$0
420147	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stairs ST10 SE Side of Building T	California Accessibility Code	$264
419759	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	Ramp R13 Between Building H & I South Side 2nd Floor	California Accessibility Code	$12,633
419773	Pasadena High School	GENERAL EXTERIOR	Interior Access Route	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	Stair K Building I Breezeway	California Accessibility Code	$12,225
419774	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	Stairs Southeast Side of Building I	California Accessibility Code	$3,260
419775	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stairs ST4	California Accessibility Code	$176
419776	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	Stairs ST4	California Accessibility Code	$1,223
419777	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stairs ST5	California Accessibility Code	$880
419795	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stairs ST6 South of H112	California Accessibility Code	$308
419796	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stairs ST7 North of Building B	California Accessibility Code	$440
419797	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	Ramp R14 South East Corner of Building E	California Accessibility Code	$2,038
419798	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	Ramp R14 South East Corner of Building E	California Accessibility Code	$8,275
419799	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp landings are not compliant.	Ramp R14 South East Corner of Building E	California Accessibility Code	$9,103
419800	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stairs ST8 NE Corner of R107 Gym	California Accessibility Code	$308
419801	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stairs ST9 Adjacent to S101	California Accessibility Code	$176

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
419802	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp landings are not compliant.	Ramp R15 North of R107 Gym	California Accessibility Code	$4,965
419757	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	Ramp R12 Between Building H & I North Side 2nd Floor	California Accessibility Code	$12,633
419771	Pasadena High School	GENERAL EXTERIOR	Interior Access Route	Stairs	1	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	Stair K Building I Breezeway	California Accessibility Code	$176
418713	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	Ramp R9 Between Building H & I South Side	California Accessibility Code	$12,633
418714	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	Ramp R10 Between Building H & I North Side 1st Floor	California Accessibility Code	$12,633
418715	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	The ramp has cross slopes in excess of 1:48 (2.08%).	Ramp R10 Between Building H & North Side	ADA	$2,475
418716	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	The ramp has openings in the surface greater than 1/2".	Ramp R10 Between Building H & North Side	ADA	$248
418717	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Ramp	1	The ramp has cross slopes in excess of 1:48 (2.08%).	Ramp R11 East Side of T107 Gym	ADA	$4,138
424500	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	Building A - Main Public Entrance	ADA	$2,478
424501	Pasadena High School	GENERAL EXTERIOR	Entrance to Building	Building Entrance - Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	Building A - North Entrance	California Accessibility Code	$2,188
424502	Pasadena High School	GENERAL EXTERIOR	Entrance to Building	Building Entrance - Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	Building A - East Entrance	California Accessibility Code	$2,188
424504	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	Building V - West Exit	ADA	$1,388
424515	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	Upper Quad Asphalt Dining Area	ADA	$6,600
424519	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	Upper Quad Dining Area	ADA	$620
424522	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	Lower Quad Near Near West Library Entrance	ADA	$1,239
424523	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	Lower Quad Near Near West Library Entrance	ADA	$496
418706	Pasadena High School	PARKING	Accessible Parking	Parking Space-Van	1	CALIFORNIA: A van space and adjacent van aisle are not provided.	Parking Lot 4 P4	California Accessibility Code	$1,050
418191	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	Accessible Parking Space P1-A	California Accessibility Code	$7,875
418192	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	Access Aisle Serving Accessible Parking Space P1-A	California Accessibility Code	$6,250
418193	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The van aisle markings are not compliant.	Access Aisle Serving Accessible Parking Space P1-A	California Accessibility Code	$525
418194	Pasadena High School	PARKING	Accessible Parking	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	Accessible Parking Space P1-B	California Accessibility Code	$7,875
418195	Pasadena High School	PARKING	Accessible Parking	Parking Space - Car	1	Ground surfaces of the car parking stall and access aisle are not firm, stable and slip resistant.	Accessible Parking Space P1-B	ADA	$0

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418196	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	Accessible Parking Space P1-B	California Accessibility Code	$525
418197	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The van aisle markings are not compliant.	Access Aisle Serving Accessible Parking Space P1-B	California Accessibility Code	$525
418198	Pasadena High School	PARKING	Accessible Parking	Parking Space-Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	Accessible Parking Space P1-C	California Accessibility Code	$7,875
418199	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	Access Aisle Serving Accessible Parking Space P1-C	California Accessibility Code	$7,875
418200	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	Accessible Parking Space P1-D	California Accessibility Code	$7,875
418201	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: The car aisle markings are not compliant.	Access Aisle Serving Accessible Parking Space P1-D	California Accessibility Code	$525
418202	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: The car parking stall is less than 108" wide.	Accessible Parking Space P1-D	California Accessibility Code	$525
418204	Pasadena High School	PARKING	Accessible Parking	Parking Space - Car	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	Access Aisle Serving Accessible Parking Space P1-D	California Accessibility Code	$525
418209	Pasadena High School	PARKING	Accessible Parking	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	Accessible Parking Space P1-E	California Accessibility Code	$7,875
418210	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: The car aisle markings are not compliant.	Access Aisle Serving Accessible Parking Space P1-E	California Accessibility Code	$525
418211	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: The car aisle markings are not compliant.	Access Aisle Serving Accessible Parking Space P1-E	California Accessibility Code	$525
418212	Pasadena High School	PARKING	Accessible Parking	Parking Space-Van	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	Accessible Parking Space P1-F	California Accessibility Code	$525
418213	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The van aisle markings are not compliant.	Access Aisle Serving Accessible Parking Space P1-F	California Accessibility Code	$525
418214	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	Accessible Parking Space P1-F	California Accessibility Code	$7,875
418215	Pasadena High School	PARKING	Accessible Parking	Parking Space-Van	1	CALIFORNIA: The van parking aisle for perpendicular and angled parking is not on the passenger side.	Accessible Parking Space P1-F	California Accessibility Code	$525
418216	Pasadena High School	PARKING	Accessible Parking	Parking Space - Car	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	Accessible Parking Space P1-E	California Accessibility Code	$525
418336	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	Accessible Parking Space P3-A	California Accessibility Code	$350
418337	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	Accessible Parking Space P3-A	California Accessibility Code	$525
418338	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	Access Aisle Serving Accessible Parking Space P3-A	California Accessibility Code	$525
418339	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	Accessible Parking Space P3-B	California Accessibility Code	$7,875
418340	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	Access Aisle Serving Accessible Parking Space P3-A	California Accessibility Code	$6,250
418341	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The van aisle markings are not compliant.	Access Aisle Serving Accessible Parking Space P3-A	California Accessibility Code	$525
418342	Pasadena High School	PARKING	Accessible Parking	Parking Space - Car	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	Accessible Parking Space P3-B	California Accessibility Code	$525

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418343	Pasadena High School	PARKING	Accessible Parking	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	Accessible Parking Space P3-B	California Accessibility Code	$7,875
418344	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	Accessible Parking Space P3-B	California Accessibility Code	$350
418345	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The van aisle markings are not compliant.	Access Aisle Serving Accessible Parking Space P3-C	California Accessibility Code	$525
418346	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	Accessible Parking Space P3-C	California Accessibility Code	$350
418347	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	Accessible Parking Space P3-D	California Accessibility Code	$350
418348	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	Accessible Parking Space P3-C	California Accessibility Code	$7,875
418349	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	Access Aisle Serving Accessible Parking Space P3-C	California Accessibility Code	$6,250
418350	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The van parking aisle is less than 96" wide, where the van stall is less than 144" wide.	Access Aisle Serving Accessible Parking Space P3-C	California Accessibility Code	$525
418351	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	Accessible Parking Space P3-D	California Accessibility Code	$7,875
418328	Pasadena High School	PARKING	Accessible Parking	Parking Space - Van	1	CALIFORNIA: The van aisle markings are not compliant.	Van Access Aisle Serving Parking Space P2-A	California Accessibility Code	$525
418329	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	Accessible Parking Space P2-E	California Accessibility Code	$7,875
418331	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	Access Aisle Serving Parking Space P2-E	California Accessibility Code	$6,250
418332	Pasadena High School	PARKING	Accessible Parking	Parking Space-Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	Accessible Parking Space P2-F	California Accessibility Code	$7,875
420232	Pasadena High School	PARKING	Accessible Parking	Parking Spaces-General	1	The minimum number of accessible parking spaces is not provided.	Parking Lot 6 P6	ADA	$1,575
425245	Pasadena High School	PARKING	Accessible Parking	Parking Space-Van	1	CALIFORNIA: A van space and adjacent van aisle are not provided.	Parking Lot 5 P5	California Accessibility Code	$1,050
420213	Pasadena High School	SPORTS FACILITIES	Swimming Pools	Method Of Access - General	1	One accessible method of entry into the standard swimming pool with less than 300 linear feet of pool wall is not provided.	Swimming Pool South Side	ADA	$4,808
420216	Pasadena High School	SPORTS FACILITIES	Swimming Pools	Method Of Access - General	1	Two accessible methods of entry into the standard swimming pool with 300 linear feet or more of pool wall are not provided.	Swimming Pool North Side	ADA	$4,808
420220	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	Handball Court Asphalt to Concrete Transition	ADA	$2,688
420223	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	An accessible route does not connect accessible building or facility entrances with all accessible spaces and elements within the building or facility. At least one accessible route shall connect accessible elements that are on the same site.	Baseball Field Seating	ADA	$560
420224	Pasadena High School	SPORTS FACILITIES	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Baseball Field Concession Stand Area	ADA	$910
420226	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Baseball Field Concession Stand Area	ADA	$280
420227	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Accessible Route To Football Field	ADA	$7,000

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
420228	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Accessible Route To Football Field	ADA	$1,250
420229	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	Entrances To Tennis Courts	ADA	$438
420230	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Accessible Route To Football Field	ADA	$10,000
420231	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Accessible Route To Football Field	ADA	$20,000
420155	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	Exterior Basketball Courts East of Building R	ADA	$1,456
420156	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	Ramp R10 Adjacent to Portable Restrooms South of Building S	California Accessibility Code	$12,413
424524	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	An accessible route does not connect accessible building or facility entrances with all accessible spaces and elements within the building or facility. At least one accessible route shall connect accessible elements that are on the same site.	Football Field Bleachers	ADA	$546
424526	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	An accessible route does not connect accessible building or facility entrances with all accessible spaces and elements within the building or facility. At least one accessible route shall connect accessible elements that are on the same site.	Batting Cages And Practice Area	ADA	$2,946
424527	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	Route to Soccer And Softball Field	ADA	$1,120
424529	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	CALIFORNIA: The accessible route does not have 80" vertical clearance.	Route to Soccer And Softball Field	California Accessibility Code	$349
424531	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	Route to Soccer And Softball Field	ADA	$743
424534	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Drinking Fountain/Water Cooler	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	Route to Soccer And Softball Field	ADA	$1,120
424385	Pasadena High School	BUILDING A	Interior Access Route	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	Building A - Main Public Entrance	ADA	$250
424386	Pasadena High School	BUILDING A	Interior Access Route	Drinking Fountain/Water Cooler	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	Building A - A108 Principle	State of California	$2,256
424387	Pasadena High School	BUILDING A	Interior Access Route	Reach Range	2	Assembly areas do not provide wheelchair spaces.	Building A - A108 Principle	ADA	$1,889
424419	Pasadena High School	BUILDING A	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building A - A255C Restroom Women's	ADA	$250
424425	Pasadena High School	BUILDING A	Interior Access Route	Stairs	2	CALIFORNIA: The stair handrail extensions are not compliant.	Building A - Stairs West Side	California Accessibility Code	$611
424428	Pasadena High School	BUILDING A	Interior Access Route	Stairs	2	CALIFORNIA: The stair handrail extensions are not compliant.	Building A - Stairs East Side	California Accessibility Code	$611

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
424434	Pasadena High School	BUILDING A	Interior Access Route	Elevator	2	CALIFORNIA: The hall call buttons are not compliant.	Building A - Elevator	California Accessibility Code	$5,625
424437	Pasadena High School	BUILDING A	Interior Access Route	Interior Access Route	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	Building A - 101 Nurse	State of California	$2,256
424448	Pasadena High School	BUILDING A	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building A - A101B Restroom Unisex	ADA	$400
424461	Pasadena High School	BUILDING A	Interior Access Route	Interior Access Route	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	Building A - A102 Administration	State of California	$2,256
424462	Pasadena High School	BUILDING A	Interior Access Route	Interior Access Route	2	CALIFORNIA: The dining or work surface is not compliant.	Building A - A103 Reception	State of California	$2,978
424463	Pasadena High School	BUILDING A	Interior Access Route	Door	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	Building A - A111 Counseling Office	State of California	$2,256
424483	Pasadena High School	BUILDING A	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building A - A112 Restroom Women's	ADA	$250
424496	Pasadena High School	BUILDING A	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building A - Restroom Men's Near Reception Lobby	ADA	$400
424497	Pasadena High School	BUILDING A	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building A - Restroom Men's Near Reception Lobby	ADA	$250
419847	Pasadena High School	BUILDING B	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building B - B112 Boys Dressing	ADA	$400
419814	Pasadena High School	BUILDING B	Interior Access Route	Door	2	MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.	Building B - B110 Girls Dressing	State of Massachusetts	$313
419816	Pasadena High School	BUILDING B	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building B - B110 Girls Dressing	ADA	$1,300
419806	Pasadena High School	BUILDING B	Interior Access Route	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	Building B - B110 Girls Dressing	ADA	$1,250
425102	Pasadena High School	BUILDING B	Common Areas	Assembly Area	2	Assembly areas do not provide compliant aisle seats.	Auditorium Seating	ADA	$52,059

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418265	Pasadena High School	BUILDING B	Interior Access Route	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	Auditorium West Exit Doors	ADA	$69
418231	Pasadena High School	BUILDING B	Interior Access Route	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	Auditorium East Exit Doors	ADA	$69
418239	Pasadena High School	BUILDING B	Common Areas	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	Auditorium Ticket Window	State of California	$2,256
418243	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Door	2	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	Building B - Restroom Men's B 107	ADA	$250
418246	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom-Unisex	2	The slope of the floor surface is greater than 2% cross or 5% running	Building B - Restroom Men's B 107	ADA	$1,066
418253	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Door	2	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	Building B - Restroom Women's B 109	ADA	$250
418254	Pasadena High School	BUILDING B	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building B - Restroom Women's B 109	ADA	$500
419859	Pasadena High School	BUILDING C	Interior Access Route	Interior Access Route	2	MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.	Building C - C101 D	State of Massachusetts	$313
419862	Pasadena High School	BUILDING C	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building C - Testroom Women's	ADA	$250
418379	Pasadena High School	BUILDING D	Interior Access Route	Interior Access Route	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	Building D - D102 Textbook Room	State of California	$2,256
420137	Pasadena High School	BUILDING E	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building E - 2nd Floor Restroom Boys	ADA	$250
420144	Pasadena High School	BUILDING E	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building E - 2nd Floor Restroom Girl's	ADA	$250
420146	Pasadena High School	BUILDING E	Interior Access Route	Stairs	2	CALIFORNIA: The stair handrail extensions are not compliant.	Building E - Stairs East Side	California Accessibility Code	$204
420244	Pasadena High School	BUILDING E	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building E - 1st Floor Restroom Girl's	ADA	$250

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
419825	Pasadena High School	BUILDING E	Interior Access Route	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	Building E - E105B	ADA	$250
419826	Pasadena High School	BUILDING E	Interior Access Route	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	Building E - E103	ADA	$900
419828	Pasadena High School	BUILDING E	Interior Access Route	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	Building B - E101	ADA	$250
419833	Pasadena High School	BUILDING E	Interior Access Route	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	Building E - E102	ADA	$900
418287	Pasadena High School	BUILDING F	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building F - Restroom F121 Women's	ADA	$400
418297	Pasadena High School	BUILDING F	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building F - Restroom F122 Men's	ADA	$400
418314	Pasadena High School	BUILDING F	Interior Access Route	Door	2	MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.	Building F - F100 A Boys Dressing Room	State of Massachusetts	$313
418316	Pasadena High School	BUILDING F	Interior Access Route	Stairs	2	CALIFORNIA: The stair handrail extensions are not compliant.	Building F - Stairs Near F100 A Boys Dressing Room	California Accessibility Code	$611
418318	Pasadena High School	BUILDING F	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building F - Restroom F100B Unisex	ADA	$400
418274	Pasadena High School	BUILDING G	Interior Access Route	Controls And Dispensers	2	Controls or operating mechanisms are not compliant.	Building G - G 109	UFAS	$324
418282	Pasadena High School	BUILDING G	Interior Access Route	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	Building G - G 108	ADA	$0
419722	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom-Unisex	2	The slope of the floor surface is greater than 2% cross or 5% running	Building H East End - 1st Floor Restroom Boys	ADA	$1,066
419729	Pasadena High School	BUILDING H	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building H East End - 1st Floor Restroom Girls	ADA	$250
419730	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom-Unisex	2	The slope of the floor surface is greater than 2% cross or 5% running	Building H East End - 1st Floor Restroom Girls	ADA	$1,066
419732	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom-Unisex	2	The slope of the floor surface is greater than 2% cross or 5% running	Building H East End - 2nd Floor Restroom Girls	ADA	$1,066
419735	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom-Unisex	2	The slope of the floor surface is greater than 2% cross or 5% running	Building H East End - 2nd Floor Restroom Boys	ADA	$1,066
419761	Pasadena High School	BUILDING I	Restroom	Restroom/Bathroom-Unisex	2	The slope of the floor surface is greater than 2% cross or 5% running	Building I East End - 2nd Floor Restroom Boys	ADA	$2,133
419770	Pasadena High School	BUILDING I	Restroom	Restroom/Bathroom-Unisex	2	The slope of the floor surface is greater than 2% cross or 5% running	Building I East End - 2nd Floor Restroom Girls	ADA	$2,133
418638	Pasadena High School	BUILDING N	Interior Access Route	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	Building N - 104A Workroom	ADA	$900

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418667	Pasadena High School	BUILDING N	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building N - Restroom Women's Multi-User	ADA	$250
418710	Pasadena High School	BUILDING R	Locker and Dressing Rooms	Locker and Dressing Rooms	2	MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.	Building R - R111B Team Room	State of Massachusetts	$313
419782	Pasadena High School	BUILDING R	Interior Access Route	Stairs	2	A wheelchair space is not provided or is not compliant at the bleacher seating.	Building R - R107 Gymnasium	ADA	$1,344
419879	Pasadena High School	BUILDING R	Restroom	Restroom/Bathroom-Unisex	2	The slope of the floor surface is greater than 2% cross or 5% running	Building R Restroom - R106	ADA	$1,066
419881	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	2	MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.	Building S - S112 Boys Locker Room	State of Massachusetts	$1,250
419886	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	2	MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.	Building S - S110 Team Room	State of Massachusetts	$313
419890	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	2	MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.	Building S - S109 Team Room	State of Massachusetts	$313
419906	Pasadena High School	BUILDING S	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building S - S123 Restroom Girls	ADA	$250
419912	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	2	MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.	Building S - S117 Girls Locker Room	State of Massachusetts	$2,500
419914	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	2	MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.	Building S - S136 Team Room	State of Massachusetts	$313
419916	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	2	MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.	Building S - S137 Team Room	State of Massachusetts	$313
419918	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	2	MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.	Building S - S138 Team Room	State of Massachusetts	$313
418719	Pasadena High School	BUILDING T	Basketball Court	Bleacher Seating	2	A wheelchair space is not provided or is not compliant at the bleacher seating.	Building T - T101 Girls Gymnasium	ADA	$538
420135	Pasadena High School	BUILDING T	Interior Access Route	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	Typical Tactile Signs Incorrectly Located	ADA	$344
424557	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom-Unisex	2	The slope of the floor surface is greater than 2% cross or 5% running	Building U - U107 Unisex Restroom	ADA	$0
418693	Pasadena High School	BUILDING V	Interior Access Route	Interior Access Route	2	Tray slides or buffet counters in food service lines are not 28" minimum and 34" maximum height above finish floor or ground.	Building V- V104 Servery	ADA	$250
418705	Pasadena High School	BUILDING V	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Building V- V115 Restroom Staff	ADA	$250

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418687	Pasadena High School	BUILDING W	Exterior Access Route	Exterior Accessible Route	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	Service Windows at Building W	State of California	$13,534
418690	Pasadena High School	BUILDING W	Interior Access Route	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	Building W - W103 Student Store	ADA	$116
419740	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	Typical Room Identification Signs Have Missing Braille or Signs	ADA	$13,338
418273	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	Typical Non-Compliant Sinks	ADA	$26,100
418238	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Door	2	The bottom of the door vision light is higher than 43" and less than 66".	Typical Doors With High Vision Panels	ADA	$299,000
418263	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Interior Access Route	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	Typical Exit Doors Not Having Tactile Exit Signs	ADA	$2,681
418364	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	2	CALIFORNIA: The stair handrail extensions are not compliant.	Stairs Southeast Side of Building G	California Accessibility Code	$2,038
418228	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	2	CALIFORNIA: The stair handrail extensions are not compliant.	Stairs ST1	California Accessibility Code	$611
420148	Pasadena High School	GENERAL EXTERIOR	Exterior Access Route	Stairs	2	CALIFORNIA: The stair handrail extensions are not compliant.	Stairs ST10 SE Side of Building T	California Accessibility Code	$1,223
424503	Pasadena High School	GENERAL EXTERIOR	Common Areas	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	Building A - Exterior Registration Windows	State of California	$4,511
424505	Pasadena High School	GENERAL EXTERIOR	Common Areas	Vending Machine	2	The vending machines have operable parts which are not within reach range.	Vending Machines Adjacent To Building V	ADA	$12,203
424506	Pasadena High School	GENERAL EXTERIOR	Interior Access Route	Elevator	2	CALIFORNIA: The hall call buttons are not compliant.	Elevator Near Building G	California Accessibility Code	$5,625
424510	Pasadena High School	GENERAL EXTERIOR	Interior Access Route	Elevator	2	CALIFORNIA: The hall call buttons are not compliant.	Elevator 1	California Accessibility Code	$5,625
424521	Pasadena High School	GENERAL EXTERIOR	Common Areas	Vending Machine	2	The vending machines have operable parts which are not within reach range.	Vending Machines Lower Quad Dining Area	ADA	$12,203
420219	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Gate	2	The gate does not have a smooth surface within 10" of the ground.	Typical Gates to Athletic Areas	ADA	$2,000
420222	Pasadena High School	SPORTS FACILITIES	Baseball/Softball Field	Bleacher Seating	2	The required number of wheelchair spaces is not provided at the bleacher seating for the ball field.	Baseball Field Seating	ADA	$1,049
420173	Pasadena High School	SPORTS FACILITIES	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Portable Trailer Restoom Boy's	ADA	$500

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
420184	Pasadena High School	SPORTS FACILITIES	Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	Portable Trailer Restoom Girl's	ADA	$500
419831	Pasadena High School	SPORTS FACILITIES	Common Areas	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	Baseball Field Concession Stand Area	State of California	$2,256
419832	Pasadena High School	SPORTS FACILITIES	Common Areas	Dining And Work Surface	2	A minimum of 5% ADA compliant dining seating and standing spaces are not provided.	Baseball Field Concession Stand Area	ADA	$1,250
424525	Pasadena High School	SPORTS FACILITIES	Baseball/Softball Field	Bleacher Seating	2	The required number of wheelchair spaces is not provided at the bleacher seating for the ball field.	Football Field Bleachers	ADA	$546
424391	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Coat Hook	3	The coat hook is not within an allowable reach range.	Building A - A253C Restroom Men's	ADA	$144
424392	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	Building A - A253C Restroom Men's	ADA	$1,563
424393	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A253C Restroom Men's	California Accessibility Code	$250
424394	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Lavatory	3	The automatic faucet, when activated, does not remain on for minimum 10 seconds.	Building A - A253C Restroom Men's	ADA	$694
424395	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building A - A253B Restroom Men's	ADA	$625
424396	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	Building A - A253B Restroom Men's	ADA	$1,563
424397	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The wheelchair stall with in-swinging door does not have the required dimensions.	Building A - A253B Restroom Men's	California Accessibility Code	$1,375
424398	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building A - A253B Restroom Men's	California Accessibility Code	$1,710
424399	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The side grab bar at the water closet is not compliant.	Building A - A253B Restroom Men's	ADA	$444
424400	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom-Water Closet	3	The rear grab bar at the water closet is not compliant.	Building A - A253B Restroom Men's	ADA	$444
424401	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building A - A253B Restroom Men's	California Accessibility Code	$350
424402	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building A - A253B Restroom Men's	California Accessibility Code	$350
424403	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom-Urinal	3	The urinal dimensions are not compliant.	Building A - A253B Restroom Men's	ADA	$1,169
424404	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A253B Restroom Men's	California Accessibility Code	$250
424405	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Lavatory	3	The automatic faucet, when activated, does not remain on for minimum 10 seconds.	Building A - A253B Restroom Men's	ADA	$694
424406	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	Building A - A255B Restroom Women's	ADA	$1,563

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
424407	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building A - A255B Restroom Women's	ADA	$625
424408	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall with a wall mounted water closet, in a multi-stall restroom, is less than 60" wide and 56" deep.	Building A - A255B Restroom Women's	ADA	$1,710
424409	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building A - A255B Restroom Women's	California Accessibility Code	$1,710
424410	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Building A - A255B Restroom Women's	ADA	$444
424411	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The side grab bar at the water closet is not compliant.	Building A - A255B Restroom Women's	ADA	$444
424412	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building A - A255B Restroom Women's	California Accessibility Code	$350
424413	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A255B Restroom Women's	California Accessibility Code	$250
424415	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A255B Restroom Women's	California Accessibility Code	$500
424416	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Coat Hook	3	The coat hook is not within an allowable reach range.	Building A - A255C Restroom Women's	ADA	$144
424417	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	Building A - A255C Restroom Women's	California Accessibility Code	$350
424418	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A255C Restroom Women's	California Accessibility Code	$250
424421	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Lavatory	3	The automatic faucet, when activated, does not remain on for minimum 10 seconds.	Building A - A255C Restroom Women's	ADA	$694
424422	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A255C Restroom Women's	California Accessibility Code	$500
424424	Pasadena High School	BUILDING A	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Building A - 2nd Floor Drinking Fountain West Side	California Accessibility Code	$6,799
424426	Pasadena High School	BUILDING A	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Building A - 2nd Floor Drinking Fountain East Side	California Accessibility Code	$6,799
424430	Pasadena High School	BUILDING A	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Building A - 1st Floor Drinking Fountain West Side	California Accessibility Code	$6,799
424436	Pasadena High School	BUILDING A	Interior Access Route	Elevator	3	CALIFORNIA: A tactile, raised star minimum 2" high is not provided to the left of the floor designation on both jambs at the main elevator entry level OR existing stars are not compliant.	Building A - Elevator	California Accessibility Code	$350
424440	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	Building A - A101B Restroom Unisex	California Accessibility Code	$138
424441	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Building A - A101B Restroom Unisex	ADA	$69
424442	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom-Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	Building A - A101B Restroom Unisex	California Accessibility Code	$1,375
424443	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Door	3	The push side of the door does not have the required maneuvering clearances.	Building A - A101B Restroom Unisex	ADA	$1,563
424444	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building A - A101B Restroom Unisex	California Accessibility Code	$1,710
424445	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Building A - A101B Restroom Unisex	ADA	$444

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
424446	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The side grab bar at the water closet is not compliant.	Building A - A101B Restroom Unisex	ADA	$444
424447	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A101B Restroom Unisex	California Accessibility Code	$250
424449	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A101B Restroom Unisex	California Accessibility Code	$5,250
424450	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom-Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	Building A - A101B Restroom Unisex	ADA	$250
424451	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	Building A - A101A Restroom Unisex	California Accessibility Code	$138
424452	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Building A - A101A Restroom Unisex	ADA	$69
424453	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	Building A - A101A Restroom Unisex	ADA	$1,563
424454	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	Building A - A101A Restroom Unisex	California Accessibility Code	$1,375
424455	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building A - A101A Restroom Unisex	California Accessibility Code	$1,710
424456	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Building A - A101B Restroom Unisex	ADA	$444
424457	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A101B Restroom Unisex	California Accessibility Code	$250
424458	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A101B Restroom Unisex	California Accessibility Code	$250
424465	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	Building A - A110 Restroom	California Accessibility Code	$138
424466	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	Building A - A110 Restroom	ADA	$1,563
424467	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	Building A - A110 Restroom	California Accessibility Code	$1,375
424468	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The grab bars at the water closet are not provided or are not compliant.	Building A - A110 Restroom	ADA	$888
424469	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The flush control is located on the closed side and/or is not within reach range.	Building A - A110 Restroom	ADA	$391
424470	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A110 Restroom	California Accessibility Code	$250
424471	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A110 Restroom	California Accessibility Code	$1,000
424472	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	Building A - A110 Restroom	ADA	$788
424473	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Lavatory	3	The lavatory is mounted higher than 34" to the higher of the rim or counter.	Building A - A110 Restroom	ADA	$900
424475	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall with a floor mounted water closet, in a multi-stall restroom, is less than 60" wide and 59" deep.	Building A - A112 Restroom Women's	ADA	$1,710
424476	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building A - A112 Restroom Women's	ADA	$625

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
424477	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building A - A112 Restroom Women's	California Accessibility Code	$1,710
424478	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Building A - A112 Restroom Women's	ADA	$444
424479	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The side grab bar at the water closet is not compliant.	Building A - A112 Restroom Women's	ADA	$444
424480	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building A - A112 Restroom Women's	California Accessibility Code	$350
424481	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A112 Restroom Women's	California Accessibility Code	$248
424482	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	Building A - A112 Restroom Women's	California Accessibility Code	$350
424485	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - A112 Restroom Women's	California Accessibility Code	$250
424486	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	Building A - Restroom Men's Near Reception Lobby	ADA	$250
424487	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building A - Restroom Men's Near Reception Lobby	ADA	$625
424488	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building A - Restroom Men's Near Reception Lobby	California Accessibility Code	$1,710
424489	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building A - Restroom Men's Near Reception Lobby	California Accessibility Code	$350
424490	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The side grab bar at the water closet is not compliant.	Building A - Restroom Men's Near Reception Lobby	ADA	$444
424491	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".	Building A - Restroom Men's Near Reception Lobby	ADA	$125
424492	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Urinal	3	The urinal dimensions are not compliant.	Building A - Restroom Men's Near Reception Lobby	ADA	$1,169
424493	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Building A - Restroom Men's Near Reception Lobby	ADA	$444
424494	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Coat Hook	3	The coat hook is not within an allowable reach range.	Building A - Restroom Men's Near Reception Lobby	ADA	$144
424495	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - Restroom Men's Near Reception Lobby	California Accessibility Code	$250
424498	Pasadena High School	BUILDING A	Restroom	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	Building A - Restroom Men's Near Reception Lobby	ADA	$250
424499	Pasadena High School	BUILDING A	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building A - Restroom Men's Near Reception Lobby	California Accessibility Code	$500
419845	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building B - B112 Boys Dressing	California Accessibility Code	$1,710
419846	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building B - B112 Boys Dressing	California Accessibility Code	$350
419848	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	Building B - B112 Boys Dressing	California Accessibility Code	$900
419849	Pasadena High School	BUILDING B	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building B - B112 Boys Dressing	California Accessibility Code	$250

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
419850	Pasadena High School	BUILDING B	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building B - B112 Boys Dressing	California Accessibility Code	$250
419851	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Lavatory	3	The automatic faucet, when activated, does not remain on for minimum 10 seconds.	Building B - B112 Boys Dressing	ADA	$694
419852	Pasadena High School	BUILDING B	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building B - B112 Boys Dressing	California Accessibility Code	$250
419813	Pasadena High School	BUILDING B	Interior Access Route	Door	3	The locker room does not have a compliant bench.	Building B - B110 Girls Dressing	ADA	$986
419817	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building B - B110 Girls Dressing	California Accessibility Code	$1,710
419818	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building B - B110 Girls Dressing	California Accessibility Code	$350
419819	Pasadena High School	BUILDING B	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building B - B110 Girls Dressing	California Accessibility Code	$500
419820	Pasadena High School	BUILDING B	Restroom	Controls And Dispensers	3	The height of controls are not compliant.	Building B - B110 Girls Dressing	ADA	$1,250
419821	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	Building B - B110 Girls Dressing	California Accessibility Code	$900
418242	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	Building B - Restroom Men's B 107	California Accessibility Code	$138
418244	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	Building B - Restroom Men's B 107	ADA	$1,563
418245	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Lavatory	3	The lavatory is mounted higher than 34" to the higher of the rim or counter.	Building B - Restroom Men's B 107	ADA	$900
418247	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Urinal	3	The urinal dimensions are not compliant.	Building B - Restroom Men's B 107	ADA	$1,169
418248	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building B - Restroom Men's B 107	ADA	$625
418249	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Toilet Stall	3	The side grab bar is not compliant in the wheelchair stall.	Building B - Restroom Men's B 107	ADA	$444
418251	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building B - Restroom Men's B 107	California Accessibility Code	$350
418252	Pasadena High School	BUILDING B	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building B - Restroom Men's B 107	California Accessibility Code	$250
418255	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Lavatory	3	The lavatory is mounted higher than 34" to the higher of the rim or counter.	Building B - Restroom Women's B 109	ADA	$900
418256	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building B - Restroom Women's B 109	ADA	$625
418257	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building B - Restroom Women's B 109	California Accessibility Code	$1,710
418258	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Building B - Restroom Women's B 109	ADA	$444
418259	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Toilet Stall	3	The side grab bar is not compliant in the wheelchair stall.	Building B - Restroom Women's B 109	ADA	$444
418260	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building B - Restroom Women's B 109	California Accessibility Code	$350
418261	Pasadena High School	BUILDING B	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall with a wall mounted water closet, in a multi-stall restroom, is less than 60" wide and 56" deep.	Building B - Restroom Women's B 109	ADA	$1,710
419858	Pasadena High School	BUILDING C	Interior Access Route	Interior Access Route	3	The locker room does not have a compliant bench.	Building C - C101D	ADA	$986

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
419860	Pasadena High School	BUILDING C	Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".	Building C - Restroom Women's	ADA	$125
419861	Pasadena High School	BUILDING C	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	Building C - Testroom Women's	California Accessibility Code	$350
419863	Pasadena High School	BUILDING C	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building C - Testroom Women's	California Accessibility Code	$250
419865	Pasadena High School	BUILDING C	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	Building C - Drinking Fountain Adjacent to C110	California Accessibility Code	$6,799
419866	Pasadena High School	BUILDING C	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Building C - Drinking Fountain Adjacent to C110	California Accessibility Code	$6,799
419869	Pasadena High School	BUILDING C	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building C - Restroom Men's	California Accessibility Code	$250
419870	Pasadena High School	BUILDING C	Restroom	Restroom/Bathroom - Lavatory	3	The automatic faucet, when activated, does not remain on for minimum 10 seconds.	Building C - Restroom Men's	ADA	$694
419871	Pasadena High School	BUILDING C	Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	Building C - Restroom Men's	ADA	$1,563
419872	Pasadena High School	BUILDING C	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building C - Restroom Men's	California Accessibility Code	$250
419875	Pasadena High School	BUILDING C	Restroom	Restroom/Bathroom - Door	3	The push side of the door does not have the required maneuvering clearances.	Building C - Ramp Near Exit Facing South	ADA	$1,563
418370	Pasadena High School	BUILDING D	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Building D - Drinking Fountain at D153	California Accessibility Code	$6,799
418381	Pasadena High School	BUILDING D	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building D - Restroom D102A Men	California Accessibility Code	$1,710
418382	Pasadena High School	BUILDING D	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building D - Restroom D102A Men	California Accessibility Code	$350
418384	Pasadena High School	BUILDING D	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building D - Restroom D102A Men	California Accessibility Code	$250
418387	Pasadena High School	BUILDING D	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Building D - Restroom D102B Women	ADA	$444
418388	Pasadena High School	BUILDING D	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building D - Restroom D102B Women	California Accessibility Code	$350
418389	Pasadena High School	BUILDING D	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	Building D - Restroom D102B Women	California Accessibility Code	$1,375
418390	Pasadena High School	BUILDING D	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building D - Restroom D102B Women	California Accessibility Code	$250
418391	Pasadena High School	BUILDING D	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	Building D - Restroom D102B Women	California Accessibility Code	$350
420136	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building E - 2nd Floor Restroom Boys	California Accessibility Code	$1,710
420138	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building E - 2nd Floor Restroom Men's	California Accessibility Code	$350
420139	Pasadena High School	BUILDING E	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building E - 2nd Floor Restroom Men's	California Accessibility Code	$250
420140	Pasadena High School	BUILDING E	Restroom	Controls And Dispensers	3	The height of controls are not compliant.	Building E - 2nd Floor Restroom Men's	ADA	$250

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
420141	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building E - 2nd Floor Restroom Women's	California Accessibility Code	$1,710
420142	Pasadena High School	BUILDING E	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building E - 2nd Floor Restroom Women's	California Accessibility Code	$250
420143	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building E - 2nd Floor Restroom Girl's	California Accessibility Code	$1,710
420235	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Building E - 1st Floor Restroom Girl's	ADA	$69
420236	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	Building E - 1st Floor Restroom Girl's	California Accessibility Code	$138
420237	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building E - 1st Floor Restroom Girl's	ADA	$625
420238	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".	Building E - 1st Floor Restroom Girl's	ADA	$125
420239	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	Building E - 1st Floor Restroom Girl's	California Accessibility Code	$350
420240	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building E - 1st Floor Restroom Girl's	California Accessibility Code	$350
420241	Pasadena High School	BUILDING E	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building E - 1st Floor Restroom Girl's	California Accessibility Code	$250
420242	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Lavatory	3	The automatic faucet, when activated, does not remain on for minimum 10 seconds.	Building E - 1st Floor Restroom Girl's	ADA	$694
420243	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	Building E - 1st Floor Restroom Girl's	ADA	$81
420245	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Building E - 1st Floor Restroom Boy's	ADA	$69
420246	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom-Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	Building E - 1st Floor Restroom Boy's	California Accessibility Code	$138
420247	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building E - 1st Floor Restroom Boy's	ADA	$625
420248	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building E - 1st Floor Restroom Boy's	California Accessibility Code	$350
420249	Pasadena High School	BUILDING E	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building E - 1st Floor Restroom Boy's	California Accessibility Code	$250
420250	Pasadena High School	BUILDING E	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building E - 1st Floor Restroom Boy's	California Accessibility Code	$250
420195	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building E - 1st Floor Restroom Men's	ADA	$625
420196	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Door	3	The push side of the door does not have the required maneuvering clearances.	Building E - 1st Floor Restroom Men's	ADA	$1,563
420197	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building E - 1st Floor Restroom Men's	California Accessibility Code	$1,710

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
420198	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".	Building E - 1st Floor Restroom Men's	ADA	$125
420199	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Building E - 1st Floor Restroom Men's	ADA	$444
420200	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	The side grab bar at the water closet is not compliant.	Building E - 1st Floor Restroom Men's	ADA	$444
420201	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building E - 1st Floor Restroom Men's	California Accessibility Code	$350
420202	Pasadena High School	BUILDING E	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building E - 1st Floor Restroom Men's	California Accessibility Code	$250
420203	Pasadena High School	BUILDING E	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building E - 1st Floor Restroom Men's	California Accessibility Code	$250
420204	Pasadena High School	BUILDING E	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building E - 1st Floor Restroom Men's	California Accessibility Code	$250
420205	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building E - 1st Floor Restroom Women's	ADA	$625
420206	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building E - 1st Floor Restroom Women's	California Accessibility Code	$1,710
420207	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Toilet Stall	3	The rear grab bar in the wheelchair stall is not compliant.	Building E - 1st Floor Restroom Women's	ADA	$444
420208	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Toilet Stall	3	The side grab bar is not compliant in the wheelchair stall.	Building E - 1st Floor Restroom Women's	ADA	$444
420209	Pasadena High School	BUILDING E	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building E - 1st Floor Restroom Women's	California Accessibility Code	$350
420210	Pasadena High School	BUILDING E	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building E - 1st Floor Restroom Women's	California Accessibility Code	$250
420211	Pasadena High School	BUILDING E	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building E - 1st Floor Restroom Women's	California Accessibility Code	$250
420212	Pasadena High School	BUILDING E	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building E - 1st Floor Restroom Women's	California Accessibility Code	$116
419824	Pasadena High School	BUILDING E	Interior Access Route	Protruding Object	3	MASSACHUSETTS: The dressing/fitting/changing area does not have a compliant bench.	Building E - E105A	State of Massachusetts	$563
419840	Pasadena High School	BUILDING E	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Building E - 2nd Floor West Side Drinking Fountain	California Accessibility Code	$13,598
419841	Pasadena High School	BUILDING E	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Building E - 2nd Floor West Side Drinking Fountain	California Accessibility Code	$6,799
418721	Pasadena High School	BUILDING E	Exterior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	Drinking Fountain Westend of Building E	California Accessibility Code	$10,000
418723	Pasadena High School	BUILDING E	Exterior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Drinking Fountain Westend of Building E	California Accessibility Code	$10,000
418286	Pasadena High School	BUILDING F	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Building F - Drinking Fountain Adjacent to F202	California Accessibility Code	$6,799
418288	Pasadena High School	BUILDING F	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building F - Restroom F121 Women's	California Accessibility Code	$250
418289	Pasadena High School	BUILDING F	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building F - Restroom F121 Women's	California Accessibility Code	$250
418290	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building F - Restroom F121 Women's	ADA	$625

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418291	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Building F - Restroom F121 Women's	ADA	$444
418292	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and projecting objects below and at the ends of the bar is less than 1 1/2" minimum.	Building F - Restroom F121 Women's	ADA	$125
418293	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building F - Restroom F121 Women's	California Accessibility Code	$350
418294	Pasadena High School	BUILDING F	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building F - Restroom F121 Women's	California Accessibility Code	$250
418295	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	Building F - Restroom F121 Women's	California Accessibility Code	$350
418296	Pasadena High School	BUILDING F	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Building F - Drinking Fountain Adjacent to F121 Women's	California Accessibility Code	$6,799
418298	Pasadena High School	BUILDING F	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building F - Restroom F122 Men's	California Accessibility Code	$250
418299	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building F - Restroom F122 Men's	ADA	$625
418300	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building F - Restroom F122 Men's	ADA	$625
418301	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Building F - Restroom F122 Men's	ADA	$444
418302	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	The side grab bar at the water closet is not compliant.	Building F - Restroom F122 Men's	ADA	$444
418303	Pasadena High School	BUILDING F	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building F - Restroom F122 Men's	California Accessibility Code	$250
418304	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building F - Restroom F122 Men's	California Accessibility Code	$350
418305	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Urinal	3	The urinal dimensions are not compliant.	Building F - Restroom F122 Men's	ADA	$1,169
418307	Pasadena High School	BUILDING F	Common Areas	Assembly Area	3	Assistive listening signage is not compliant or is not provided.	Building F - F101 Little Theater	ADA	$69
418309	Pasadena High School	BUILDING F	Interior Access Route	Platform Lift	3	CALIFORNIA: The platform lift is not compliant.	Building F - Drinking Fountain Adjacent to F121 Women's	California Accessibility Code	$28,156
418312	Pasadena High School	BUILDING F	Interior Access Route	Door	3	Pipes are not insulated.	Building F - F102 Storage Sink	ADA	$81
418313	Pasadena High School	BUILDING F	Interior Access Route	Door	3	MASSACHUSETTS: The dressing/fitting/changing area does not have a compliant bench.	Building F - F100 A Boys Dressing Room	State of Massachusetts	$563
418317	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Door	3	The push side of the door does not have the required maneuvering clearances.	Building F - Restroom F100B Unisex	ADA	$125
418319	Pasadena High School	BUILDING F	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building F - Restroom F100B Unisex	California Accessibility Code	$250
418320	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building F - Restroom F100B Unisex	California Accessibility Code	$1,710
418321	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	Building F - Restroom F100B Unisex	ADA	$788
418322	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building F - Restroom F100B Unisex	California Accessibility Code	$350
418323	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Building F - Restroom F100B Unisex	ADA	$444
418324	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	The side grab bar at the water closet is not compliant.	Building F - Restroom F100B Unisex	ADA	$444
418325	Pasadena High School	BUILDING F	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	Building F - Restroom F100B Unisex	California Accessibility Code	$1,375

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418326	Pasadena High School	BUILDING F	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building F - Restroom F100B Unisex	California Accessibility Code	$250
419718	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Building H East End - 1st Floor Restroom Boys	ADA	$69
419719	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	Building H East End - 1st Floor Restroom Boys	ADA	$1,563
419720	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building H East End - 1st Floor Restroom Boys	ADA	$625
419721	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".	Building H East End - 1st Floor Restroom Boys	ADA	$125
419723	Pasadena High School	BUILDING H	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building H East End - 1st Floor Restroom Boys	California Accessibility Code	$250
419724	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom-Lavatory	3	The automatic faucet, when activated, does not remain on for minimum 10 seconds.	Building H East End - 1st Floor Restroom Boys	ADA	$694
419725	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Building H East End - 1st Floor Restroom Girls	ADA	$69
419726	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building H East End - 1st Floor Restroom Girls	ADA	$625
419727	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	Building H East End - 1st Floor Restroom Girls	California Accessibility Code	$350
419728	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building H East End - 1st Floor Restroom Girls	California Accessibility Code	$350
419731	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building H East End - 2nd Floor Restroom Girls	California Accessibility Code	$350
419733	Pasadena High School	BUILDING H	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building H East End - 2nd Floor Restroom Girls	California Accessibility Code	$250
419734	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building H East End - 2nd Floor Restroom Boys	California Accessibility Code	$1,710
419738	Pasadena High School	BUILDING H	Kitchen	Sink	3	CALIFORNIA: The sink does not have the required clear floor space of minimum 30" by minimum 48" for a forward approach with knee and toe clearance.	Building H - Classrooms With EyeWash / Shower	California Accessibility Code	$7,500
419741	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom-Toilet Stall	3	The wheelchair stall door is not compliant.	Building H East End - 1st Floor Restroom Men's	ADA	$625
419742	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall with a wall mounted water closet, in a multi-stall restroom, is less than 60" wide and 56" deep.	Building H East End - 1st Floor Restroom Men's	ADA	$1,710
419743	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building H East End - 1st Floor Restroom Men's	California Accessibility Code	$1,710
419744	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Building H East End - 1st Floor Restroom Men's	ADA	$444
419745	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".	Building H East End - 1st Floor Restroom Men's	ADA	$125
419746	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building H East End - 1st Floor Restroom Men's	California Accessibility Code	$350

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
419747	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	Building H East End - 1st Floor Restroom Men's	ADA	$81
419748	Pasadena High School	BUILDING H	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building H East End - 1st Floor Restroom Men's	California Accessibility Code	$250
419749	Pasadena High School	BUILDING H	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building H East End - 1st Floor Restroom Men's	California Accessibility Code	$250
419750	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building H East End - 1st Floor Restroom Women's	ADA	$625
419751	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building H East End - 1st Floor Restroom Women's	California Accessibility Code	$350
419752	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	Building H East End - 1st Floor Restroom Women's	California Accessibility Code	$350
419753	Pasadena High School	BUILDING H	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building H East End - 1st Floor Restroom Women's	California Accessibility Code	$250
419754	Pasadena High School	BUILDING H	Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	Building H East End - 1st Floor Restroom Women's	ADA	$81
419755	Pasadena High School	BUILDING H	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building H East End - 1st Floor Restroom Women's	California Accessibility Code	$250
418711	Pasadena High School	BUILDING I	Common Areas	Locker Rooms	3	The locker area does not have accessible lockers.	Lockers Between Building G & H South & South Side	ADA	$12,797
418712	Pasadena High School	BUILDING I	Exterior Access Route	Ramp	3	The locker area does not have accessible lockers.	Lockers Between Building I & H South & South Side	ADA	$49,536
419779	Pasadena High School	BUILDING I	Exterior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Building I 2nd Floor - Drinking Fountain Westend	California Accessibility Code	$10,000
419780	Pasadena High School	BUILDING I	Exterior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Building I 1st Floor - Drinking Fountain Westend	California Accessibility Code	$0
419781	Pasadena High School	BUILDING I	Exterior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is located on a wall or post-mounted cantilevered, but is not minimum 18" and maximum 19" in depth.	Building I 1st Floor - Drinking Fountain Westend	California Accessibility Code	$10,000
419762	Pasadena High School	BUILDING I	Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	Building I East End - 2nd Floor Restroom Men's	California Accessibility Code	$138
419763	Pasadena High School	BUILDING I	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building I East End - 2nd Floor Restroom Men's	California Accessibility Code	$350
419764	Pasadena High School	BUILDING I	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building I East End - 2nd Floor Restroom Men's	California Accessibility Code	$250
419765	Pasadena High School	BUILDING I	Restroom	Restroom/Bathroom-Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	Building I East End - 2nd Floor Restroom Women's	California Accessibility Code	$138
419766	Pasadena High School	BUILDING I	Restroom	Restroom/Bathroom - Door	3	The push side of the door does not have the required maneuvering clearances.	Building I East End - 2nd Floor Restroom Women's	ADA	$250
419767	Pasadena High School	BUILDING I	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building I East End - 2nd Floor Restroom Women's	California Accessibility Code	$1,710
419768	Pasadena High School	BUILDING I	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building I East End - 2nd Floor Restroom Women's	California Accessibility Code	$250
419769	Pasadena High School	BUILDING I	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building I East End - 2nd Floor Restroom Girls	California Accessibility Code	$350
418666	Pasadena High School	BUILDING N	Restroom	Restroom/Bathroom - Door	3	The push side of the door does not have the required maneuvering clearances.	Building N - Restroom Women's Multi-User	ADA	$1,563
418669	Pasadena High School	BUILDING N	Restroom	Restroom/Bathroom - Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	Building N - Restroom Women's Multi-User	ADA	$788
418670	Pasadena High School	BUILDING N	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building N - Restroom Women's Multi-User	California Accessibility Code	$350

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418671	Pasadena High School	BUILDING N	Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".	Building N - Restroom Women's Multi-User	ADA	$125
418672	Pasadena High School	BUILDING N	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	Building N - Restroom Women's Multi-User	California Accessibility Code	$350
418673	Pasadena High School	BUILDING N	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building N - Restroom Women's Multi-User	California Accessibility Code	$250
418674	Pasadena High School	BUILDING N	Restroom	Restroom/Bathroom - Lavatory	3	The automatic faucet, when activated, does not remain on for minimum 10 seconds.	Building N - Restroom Women's Multi-User	ADA	$694
418675	Pasadena High School	BUILDING N	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building N - Restroom Women's Multi-User	California Accessibility Code	$250
418653	Pasadena High School	BUILDING P	Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Building P - Restroom Men's Multi-User	ADA	$69
418654	Pasadena High School	BUILDING P	Restroom	Restroom/Bathroom-Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	Building P - Restroom Men's Multi-User	California Accessibility Code	$138
418655	Pasadena High School	BUILDING P	Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	Building P - Restroom Men's Multi-User	ADA	$1,563
418656	Pasadena High School	BUILDING P	Restroom	Restroom/Bathroom - Door	3	The push side of the door does not have the required maneuvering clearances.	Building P - Restroom Men's Multi-User	ADA	$1,563
418657	Pasadena High School	BUILDING P	Restroom	Restroom/Bathroom - Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	Building P - Restroom Men's Multi-User	ADA	$788
418658	Pasadena High School	BUILDING P	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building P - Restroom Men's Multi-User	California Accessibility Code	$116
418659	Pasadena High School	BUILDING P	Restroom	Restroom/Bathroom - Lavatory	3	The automatic faucet, when activated, does not remain on for minimum 10 seconds.	Building P - Restroom Men's Multi-User	ADA	$694
418644	Pasadena High School	BUILDING Q	Interior Access Route	Sink	3	The lavatory faucet hardware is not compliant.	Building Q - Q103B	ADA	$694
418645	Pasadena High School	BUILDING Q	Interior Access Route	Protruding Object	3	The locker room does not have accessible lockers.	Building Q - Q107B	ADA	$2,890
418650	Pasadena High School	BUILDING Q	Interior Access Route	Sink	3	Pipes are not insulated.	Building Q - Q109A	ADA	$81
418652	Pasadena High School	BUILDING Q	Exterior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Drinking Fountain Adjacent Q109	California Accessibility Code	$10,000
419784	Pasadena High School	BUILDING R	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	Building R - R107 Gymnasium	California Accessibility Code	$6,799
419786	Pasadena High School	BUILDING R	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building R - Restroom Women's R105A	California Accessibility Code	$1,710
419787	Pasadena High School	BUILDING R	Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and the wall is greater than or less than 1-1/2".	Building R - Restroom Women's R105A	ADA	$500
419789	Pasadena High School	BUILDING R	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building R - Restroom Women's R105A	California Accessibility Code	$250
419791	Pasadena High School	BUILDING R	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building R - Restroom Men's R105	California Accessibility Code	$1,710
419792	Pasadena High School	BUILDING R	Restroom	Restroom/Bathroom - Water Closet	3	The side grab bar at the water closet is not compliant.	Building R - Restroom Men's R105	ADA	$444

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
419793	Pasadena High School	BUILDING R	Restroom	Restroom/Bathroom - Ambulatory Stall	3	The ambulatory stall size is not compliant, or an ambulatory stall is not provided.	Building R - Restroom Men's R105	ADA	$900
419803	Pasadena High School	BUILDING R	Interior Access Route	Platform Lift	3	CALIFORNIA: The platform lift is not compliant.	Building R - Wheelchair Lift Adjacent to R118	California Accessibility Code	$28,156
419876	Pasadena High School	BUILDING R	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building R Restroom - Men's 104B	California Accessibility Code	$1,710
419878	Pasadena High School	BUILDING R	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building R Restroom - Men's 104B	California Accessibility Code	$250
419807	Pasadena High School	BUILDING S	Restroom	Controls And Dispensers	3	Controls on dispensers are not compliant.	Building S - Restroom Men's S105	ADA	$250
419809	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building S - Restroom Men's S105	California Accessibility Code	$1,710
419810	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	Building S - Restroom Men's S105	ADA	$788
419811	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	Building S - Restroom Men's S105	California Accessibility Code	$900
419812	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom-Locker	3	The locker area does not have accessible lockers.	Building S - Restroom Men's S105	ADA	$413
419772	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	3	The locker room does not have accessible lockers.	Building S - S112 Boys Locker Room	ADA	$13,622
419882	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building S - S112 Restroom Boys Locker Room	California Accessibility Code	$350
419884	Pasadena High School	BUILDING S	Restroom	Controls And Dispensers	3	Controls on dispensers are not compliant.	Building S - S112 Accessible Shower Boys Locker Room	ADA	$250
419885	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	3	The locker room does not have accessible lockers.	Building S - S110 Team Room	ADA	$1,238
419893	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building S - S128 A Men's Restroom	California Accessibility Code	$350
419894	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building S - Girls Restroom Pool Side	California Accessibility Code	$1,710
419895	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building S - Girls Restroom Pool Side	California Accessibility Code	$350
419901	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building S - S130 Faculty Locker Room	California Accessibility Code	$350
419902	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Roll - In Shower Stall	3	CALIFORNIA: The roll-in shower stall is not compliant.	Building S - S130 Faculty Locker Room	California Accessibility Code	$2,813
419903	Pasadena High School	BUILDING S	Restroom	Controls And Dispensers	3	Controls on dispensers are not compliant.	Building S - S130 Faculty Locker Room	ADA	$250
419904	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Lavatory	3	The lavatory is mounted higher than 34" to the higher of the rim or counter.	Building S - S130 Faculty Locker Room	ADA	$900
419905	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Building S - S123 Restroom Girls	ADA	$625
419908	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Transfer Shower Stall	3	The transfer shower is not exactly 36" by 36".	Building S - S117 Girls Locker Room Shower	ADA	$2,750
419909	Pasadena High School	BUILDING S	Restroom	Restroom/Bathroom - Transfer Shower Stall	3	A seat is not provided in the transfer shower stall.	Building S - S117 Girls Locker Room Shower	ADA	$756
419910	Pasadena High School	BUILDING S	Restroom	Controls And Dispensers	3	Controls on dispensers are not compliant.	Building S - S117 Girls Locker Room Shower	ADA	$250
419911	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	3	The locker room does not have accessible lockers.	Building S - S117 Girls Locker Room	ADA	$7,018

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
419913	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	3	The locker room does not have accessible lockers.	Building S - S136 Team Room	ADA	$826
419915	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	3	The locker room does not have accessible lockers.	Building S - S137 Team Room	ADA	$826
419917	Pasadena High School	BUILDING S	Locker and Dressing Rooms	Locker and Dressing Rooms	3	The locker room does not have accessible lockers.	Building S - S138 Team Room	ADA	$413
420126	Pasadena High School	BUILDING T	Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and the wall is greater than or less than 1-1/2".	Building T - T110 Restroom Boys	ADA	$250
420127	Pasadena High School	BUILDING T	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building T - T110 Restroom Boys	California Accessibility Code	$250
420129	Pasadena High School	BUILDING T	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building T - T111 Restroom Girls	California Accessibility Code	$1,710
420130	Pasadena High School	BUILDING T	Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and the wall is greater than or less than 1-1/2".	Building T - T111 Restroom Girls	ADA	$250
420131	Pasadena High School	BUILDING T	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	Building T - T111 Restroom Girls	California Accessibility Code	$350
424540	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom - Door	3	The door has less than 32" clear width.	Building U - U107 Unisex Restroom	ADA	$0
424541	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom-Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	Building U - U107 Unisex Restroom	California Accessibility Code	$366
424542	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	Building U - U107 Unisex Restroom	California Accessibility Code	$138
424543	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Building U - U107 Unisex Restroom	ADA	$69
424544	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Building U - U107 Unisex Restroom	California Accessibility Code	$0
424545	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom - Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	Building U - U107 Unisex Restroom	ADA	$0
424546	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom - Water Closet	3	The grab bars at the water closet are not compliant.	Building U - U107 Unisex Restroom	ADA	$888
424547	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Building U - U107 Unisex Restroom	California Accessibility Code	$350
424549	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom-Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	Building U - U107 Unisex Restroom	California Accessibility Code	$1,375
424550	Pasadena High School	BUILDING U	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building U - U107 Unisex Restroom	California Accessibility Code	$250
424551	Pasadena High School	BUILDING U	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building U - U107 Unisex Restroom	California Accessibility Code	$250
424552	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	Building U - U107 Unisex Restroom	ADA	$250
424553	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom - Lavatory	3	The lavatory is mounted higher than 34" to the higher of the rim or counter.	Building U - U107 Unisex Restroom	ADA	$0
424554	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	Building U - U107 Unisex Restroom	ADA	$81
424555	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom - Lavatory	3	CALIFORNIA: The centerline of the lavatory is less than 18" from the side wall or partition wall.	Building U - U107 Unisex Restroom	California Accessibility Code	$0

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
424556	Pasadena High School	BUILDING U	Restroom	Restroom/Bathroom	3	The entire restroom is not compliant due to limited room dimensions.	Building U - U107 Unisex Restroom	ADA	$15,000
418695	Pasadena High School	BUILDING V	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Building V- V101 Drinking Fountain at Student Dining Area	California Accessibility Code	$6,799
418704	Pasadena High School	BUILDING V	Restroom	Restroom/Bathroom-Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	Building V- V115 Restroom Staff	ADA	$250
425253	Pasadena High School	BUILDING V	Restroom	Restroom/Bathroom-Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	Building V- V115 Restroom Staff	California Accessibility Code	$138
418681	Pasadena High School	BUILDING W	Restroom	Restroom/Bathroom	3	The entire restroom is not compliant due to limited room dimensions.	Building N - Restroom Women's Multi-User	ADA	$15,000
418683	Pasadena High School	BUILDING W	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is located on a wall or post-mounted cantilevered, but is not minimum 18" and maximum 19" in depth.	Drinking Fountain West Side of Building W	California Accessibility Code	$0
418684	Pasadena High School	BUILDING W	Exterior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Drinking Fountain West Side of Building W	California Accessibility Code	$10,000
418685	Pasadena High School	BUILDING W	Exterior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	Drinking Fountain West Side of Building W	California Accessibility Code	$0
419758	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Common Areas	Locker Rooms	3	The area does not have accessible lockers.	Lockers Between Building H & I, G & H North / South Side 1st & 2nd Floor	ADA	$19,814
418284	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Common Areas	Locker Rooms	3	The locker room does not have accessible lockers.	Typical Lockers Throughout The Campus	ADA	$37,565
424507	Pasadena High School	GENERAL EXTERIOR	Interior Access Route	Elevator	3	The hoistway signage is not compliant.	Elevator Near Building G	ADA	$700
424509	Pasadena High School	GENERAL EXTERIOR	Interior Access Route	Elevator	3	CALIFORNIA: A tactile, raised star minimum 2" high is not provided to the left of the floor designation on both jambs at the main elevator entry level OR existing stars are not compliant.	Elevator Near Building G	California Accessibility Code	$700
424511	Pasadena High School	GENERAL EXTERIOR	Interior Access Route	Elevator	3	The hoistway signage is not compliant.	Elevator 1	ADA	$700
424513	Pasadena High School	GENERAL EXTERIOR	Interior Access Route	Elevator	3	CALIFORNIA: Visible and audible signal fixtures indicating which car is answering the call and the car's direction of travel are not compliant or are not provided.	Elevator 1	California Accessibility Code	$1,375
424514	Pasadena High School	GENERAL EXTERIOR	Interior Access Route	Elevator	3	CALIFORNIA: A tactile, raised star minimum 2" high is not provided to the left of the floor designation on both jambs at the main elevator entry level OR existing stars are not compliant.	Elevator 1	California Accessibility Code	$700
424516	Pasadena High School	GENERAL EXTERIOR	Dining	Dining And Work Surface	3	CALIFORNIA: A compliant dining table is not provided.	Upper Quad Asphalt Dining Area	California Accessibility Code	$6,500
424517	Pasadena High School	GENERAL EXTERIOR	Dining	Dining And Work Surface	3	CALIFORNIA: A compliant dining table is not provided.	Upper Quad Dining Area	California Accessibility Code	$4,875
420225	Pasadena High School	SPORTS FACILITIES	Common Areas	Dining And Work Surface	3	CALIFORNIA: A compliant dining table is not provided.	Baseball Field Concession Stand Area	California Accessibility Code	$1,625
420233	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	3	Less than 5% of multiple single user portable toilets clustered at a single location are accessible.	Portable Restrooms Serving Football Field	ADA	$3,750
420234	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Exterior Accessible Route	3	Less than 5% of multiple single user portable toilets clustered at a single location are accessible.	Accessible Route to Portable Restrooms	ADA	$8,438
420158	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom-Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	Portable Trailer Restoom Staff	California Accessibility Code	$138

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
420159	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	Portable Trailer Restoom Staff	California Accessibility Code	$138
420160	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	Portable Trailer Restoom Staff	California Accessibility Code	$1,710
420161	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	Portable Trailer Restoom Staff	California Accessibility Code	$1,375
420162	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	Portable Trailer Restoom Staff	ADA	$444
420163	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Water Closet	3	The side grab bar at the water closet is not compliant.	Portable Trailer Restoom Staff	ADA	$444
420164	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Lavatory	3	CALIFORNIA: The centerline of the lavatory is less than 18" from the side wall or partition wall.	Portable Trailer Restoom Staff	California Accessibility Code	$3,750
420165	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom-Lavatory	3	Pipes are not insulated.	Portable Trailer Restoom Staff	ADA	$81
420166	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Lavatory	3	The lavatory does not have the required knee clearance.	Portable Trailer Restoom Staff	ADA	$900
420167	Pasadena High School	SPORTS FACILITIES	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Portable Trailer Restoom Staff	California Accessibility Code	$500
420168	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	Portable Trailer Restoom Staff	ADA	$250
420169	Pasadena High School	SPORTS FACILITIES	Restroom	Controls And Dispensers	3	The height of controls are not compliant.	Portable Trailer Restoom Staff	ADA	$250
420170	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Lavatory	3	The automatic faucet, when activated, does not remain on for minimum 10 seconds.	Portable Trailer Restoom Staff	ADA	$694
420171	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	Portable Trailer Restoom Boy's	California Accessibility Code	$138
420172	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Portable Trailer Restoom Boy's	ADA	$69
420174	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Portable Trailer Restoom Boy's	ADA	$625
420175	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Toilet Stall	3	The side grab bars are not compliant in the ambulatory stall.	Portable Trailer Restoom Boy's	ADA	$888
420176	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall with a floor mounted water closet, in a multi-stall restroom, is less than 60" wide and 59" deep.	Portable Trailer Restoom Boy's	ADA	$1,710
420177	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Portable Trailer Restoom Boy's	California Accessibility Code	$350
420178	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Urinal	3	The urinal dimensions are not compliant.	Portable Trailer Restoom Boy's	ADA	$1,169
420179	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Lavatory	3	The lavatory is mounted higher than 34" to the higher of the rim or counter.	Portable Trailer Restoom Boy's	ADA	$900
420180	Pasadena High School	SPORTS FACILITIES	Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Portable Trailer Restoom Boy's	California Accessibility Code	$500
420181	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	Portable Trailer Restoom Boy's	ADA	$500
420182	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	Portable Trailer Restoom Girl's	California Accessibility Code	$138

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
420183	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Portable Trailer Restoom Girl's	ADA	$69
420185	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall door is not compliant.	Portable Trailer Restoom Girl's	ADA	$625
420186	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall with a floor mounted water closet, in a multi-stall restroom, is less than 60" wide and 59" deep.	Portable Trailer Restoom Girl's	ADA	$1,710
420187	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".	Portable Trailer Restoom Girl's	ADA	$125
420188	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Toilet Stall	3	The side grab bars are not compliant in the ambulatory stall.	Portable Trailer Restoom Girl's	ADA	$888
420189	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	Portable Trailer Restoom Girl's	California Accessibility Code	$350
420190	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	Portable Trailer Restoom Girl's	California Accessibility Code	$350
420191	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Toilet Stall	3	The side grab bars are not compliant in the ambulatory stall.	Portable Trailer Restoom Girl's	ADA	$888
420192	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	Portable Trailer Restoom Girl's	ADA	$250
420193	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Lavatory	3	The lavatory is mounted higher than 34" to the higher of the rim or counter.	Portable Trailer Restoom Boy's	ADA	$900
420194	Pasadena High School	SPORTS FACILITIES	Restroom	Restroom/Bathroom - Lavatory	3	The automatic faucet, when activated, does not remain on for minimum 10 seconds.	Portable Trailer Restoom Boy's	ADA	$694
424532	Pasadena High School	SPORTS FACILITIES	Interior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	Route to Soccer And Softball Field	California Accessibility Code	$3,132
424533	Pasadena High School	SPORTS FACILITIES	Exterior Access Route	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	Route to Soccer And Softball Field	California Accessibility Code	$10,000
424427	Pasadena High School	BUILDING A	Interior Access Route	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	Building A - 2nd Floor Drinking Fountain East Side	ADA	$1,225
424429	Pasadena High School	BUILDING A	Interior Access Route	Telephone	4	The highest operable part of the accessible public telephone is not compliant.	Building A - 1st Floor Telephone Booth	ADA	$500
424431	Pasadena High School	BUILDING A	Interior Access Route	Drinking Fountain/Water Cooler	4	The spout and/or water flow of the lower level drinking fountain is not compliant.	Building A - 1st Floor Drinking Fountain West Side	ADA	$3,132
424433	Pasadena High School	BUILDING A	Interior Access Route	Drinking Fountain/Water Cooler	4	The spout and/or water flow of the lower level drinking fountain is not compliant.	Building A - Hallway Near Elevator	ADA	$3,132
424460	Pasadena High School	BUILDING A	Interior Access Route	Signage	4	Signage identifying the name of a permanent indoor or outdoor space does not have raised lettering and/or visual characters.	Building A - A102 Administration	ADA	$69
419853	Pasadena High School	BUILDING B	Accessible Route	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls and outlets are not compliant.	Building B - B112 Boys Dressing	California Accessibility Code	$625
418237	Pasadena High School	BUILDING B	Interior Access Route	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	Auditorium Foyer	ADA	$1,225
419867	Pasadena High School	BUILDING C	Interior Access Route	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	Building C - Drinking Fountain Adjacent to C110	ADA	$1,225
419868	Pasadena High School	BUILDING C	Interior Access Route	Drinking Fountain/Water Cooler	4	The spout and/or water flow of the lower level drinking fountain is not compliant.	Building C - Drinking Fountain Adjacent to C110	ADA	$3,132

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418369	Pasadena High School	BUILDING D	Interior Access Route	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	Building D - Drinking Fountain at D153	ADA	$1,225
418383	Pasadena High School	BUILDING D	Accessible Route	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls and outlets are not compliant.	Building D - Restroom D102A Men	California Accessibility Code	$625
420150	Pasadena High School	BUILDING E	Interior Access Route	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	Building E - Drinking Fountain SE Side	ADA	$28,175
419829	Pasadena High School	BUILDING E	Kitchen	Kitchen- Range/Cooktop/Oven	4	The location of the controls requires reaching across burners.	Building E - E108	ADA	$949
419836	Pasadena High School	BUILDING E	Interior Access Route	Door	4	A compliant turning space is not provided.	Building E - E102	ADA	$1,120
418722	Pasadena High School	BUILDING E	Exterior Access Route	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	Drinking Fountain Westend of Building E	ADA	$3,131
419760	Pasadena High School	BUILDING I	Exterior Access Route	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	Drinking Fountain Building I 2nd Floor Breezeway	ADA	$3,131
418651	Pasadena High School	BUILDING Q	Exterior Access Route	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	Drinking Fountain Adjacent Q109	ADA	$3,131
419805	Pasadena High School	BUILDING S	Interior Access Route	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	Building S - Drinking Fountain Adjacent to S102	ADA	$1,225
418694	Pasadena High School	BUILDING V	Interior Access Route	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	Building V- V101 Drinking Fountain at Student Dining Area	ADA	$1,225
418270	Pasadena High School	CAMPUS-WIDE RECURRING BARRIERS	Accessible Route	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls and outlets are not compliant.	Typical Light Switches Too High Throughout Campus	California Accessibility Code	$146,250
418707	Pasadena High School	PARKING	Accessible Parking	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	Parking Lot 4 P4	California Accessibility Code	$350
424530	Pasadena High School	PARKING	Accessible Parking	Parking Spaces-General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	Driveway NW Entrance	California Accessibility Code	$35,000
428141	Pasadena High School	PARKING	Accessible Parking	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	Parking Lot 6 P6	California Accessibility Code	$350
418385	Pasadena High School	BUILDING D	Interior Access Route	Door	5	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	Building D - D104, D108, D109	ADA	$1,500
418392	Pasadena High School	BUILDING D	Interior Access Route	Sink	5	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	Building D - D104 Workroom	ADA	$0
418375	Pasadena High School	BUILDING D	Interior Access Route	Sink	5	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	Building D - D101 Student Services	ADA	$0
424536	Pasadena High School	BUILDING U	Exterior Access Route	Ramp	5	CALIFORNIA: The ramp landings are not compliant.	Ramp R16 At Building U Entrance	California Accessibility Code	$4,965
424537	Pasadena High School	BUILDING U	Exterior Access Route	Ramp	5	The ramp has a running slope in excess of 1:12 (8.33%) and/or cross slope in excess of 1:48 (2.08%).	Ramp R16 At Building U Entrance	ADA	$17,378
418696	Pasadena High School	BUILDING V	Interior Access Route	Door	5	The door has less than 32" clear width.	Building V- Doors Not Providing 32 inch Clear Width	ADA	$16,250
418697	Pasadena High School	BUILDING V	Interior Access Route	Door	5	CALIFORNIA: The hardware at the accessible door is not compliant.	Building V- Doors With Knob Type Hardware	California Accessibility Code	$1,831

Total Barriers: 739, Total Cost: $2,957,472

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA	Total
418698	Pasadena High School	BUILDING V	Kitchen	Sink	5	Exposed pipes lack insulation and/or sharp or abrasive surfaces are present under the sink.	Building V- V106 Kitchen	ADA	$21,938
418699	Pasadena High School	BUILDING V	Restroom	Restroom/Bathroom - Signage	5	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Building V- V115 Restroom Staff	ADA	$69
418700	Pasadena High School	BUILDING V	Restroom	Restroom/Bathroom-Water Closet	5	CALIFORNIA- The water closet does not have the required clear floor space.	Building V- V115 Restroom Staff	California Accessibility Code	$1,375
418701	Pasadena High School	BUILDING V	Restroom	Restroom/Bathroom - Lavatory	5	Pipes are not insulated.	Building V- V115 Restroom Staff	ADA	$81
418702	Pasadena High School	BUILDING V	Restroom	Controls And Dispensers	5	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building V- V115 Restroom Staff	California Accessibility Code	$250
418703	Pasadena High School	BUILDING V	Restroom	Controls And Dispensers	5	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	Building V- V115 Restroom Staff	California Accessibility Code	$250

Total Barriers: 739, Total Cost: $2,957,472

3 CERTIFICATION

Bureau Veritas has completed a Title II Accessibility Assessment of the subject property, Pasadena High School, 2925 East Sierra Madre Boulevard, Pasadena, Los Angeles County, California 91107. The site was visited on December 4-8, 2023 and December 12-13, 2023.

The assessment was performed at the Client's request using methods and procedures consistent with good commercial and customary practice for assessing compliance with the Title II provisions of the Americans with Disabilities Act (ADA) and applicable state and local requirements.

This report has been prepared for and is exclusively for the use and benefit of the Client identified on the cover page of this report. The purpose for which this report shall be used shall be limited to the use as stated in the contract between the client and Bureau Veritas.

This report, or any of the information contained therein, is not for the use or benefit of, nor may it be relied upon by any other person or entity, for any purpose without the advance written consent of Bureau Veritas. Any reuse or distribution without such consent shall be at the client's or recipient's sole risk, without liability to Bureau Veritas.

The opinions Bureau Veritas expresses in this report were formed utilizing the degree of skill and care ordinarily exercised by an architect or engineer in the same community under similar circumstances. Bureau Veritas assumes no responsibility or liability for the accuracy of information contained in this report which has been obtained from the Client or the Client's representatives, from other interested parties, or from the public domain. The conclusions presented represent Bureau Veritas's professional judgment based on information obtained during the course of this assignment. The conclusions presented are based on the data provided, observations made, and conditions that existed specifically on the date of the assessment.

Bureau Veritas certifies that Bureau Veritas has no undisclosed interest in the subject property, Bureau Veritas's relationship with the Client is at arm's-length, and that Bureau Veritas's employment and compensation are not contingent upon the findings or order of magnitude estimated costs to remove barriers.

If you have any questions regarding this report, please contact Program Manager Michael Cunniff at Michael.Cunniff@bureauveritas.com or at (800) 766-0660, x7296214.

Prepared by: Abel Machado
Field Observer

Reviewed by:



Michael Cunniff
Senior Project Manager
Michael.Cunniff@bureauveritas.com


4 APPENDICES

APPENDIX A: SITE AND FLOOR PLANS

APPENDIX B: RECORD OF INDIVIDUAL BARRIERS

APPENDIX A:
SITE AND FLOOR PLANS

Site Plan – Overall

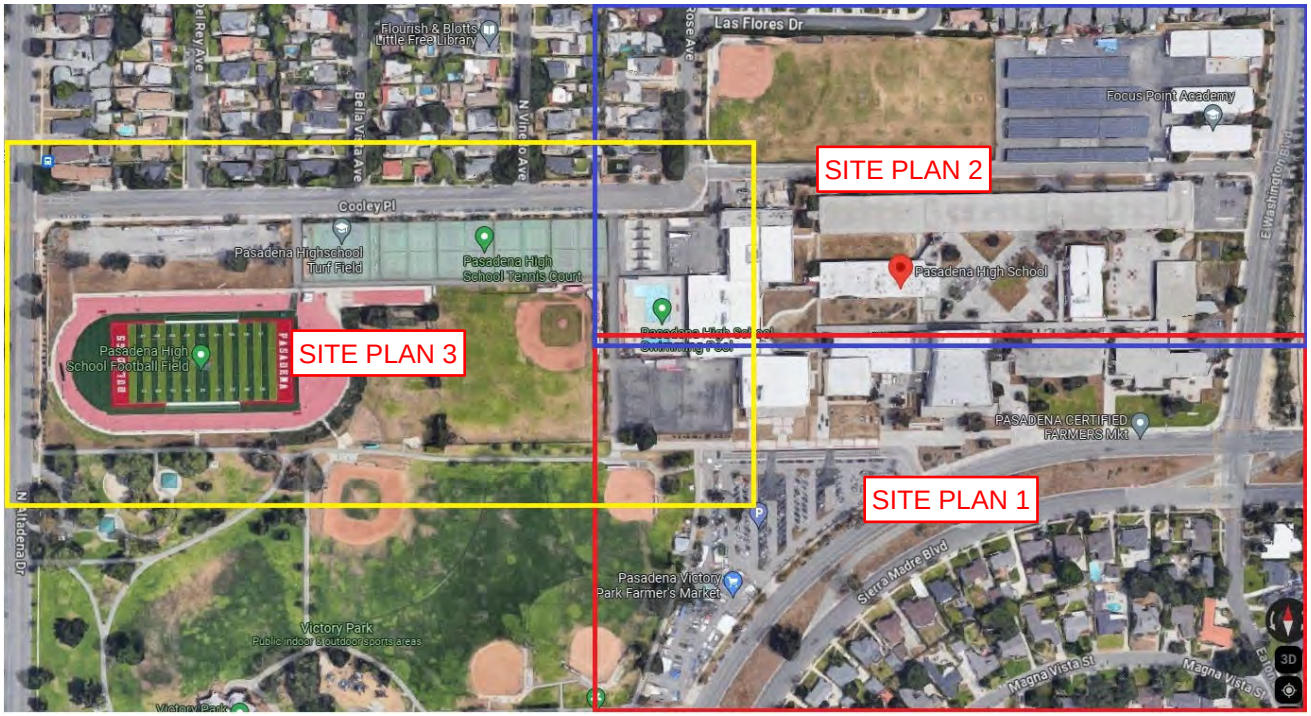

Source:

Google Maps / Google Earth

Legend:

P-# - Parking Row/Lot
P#-# - Accessible Parking Space
CR-# - Curb Ramp
R-# - Ramp
ST-# - Stair

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Site Plan 1 – Enlarged South Side

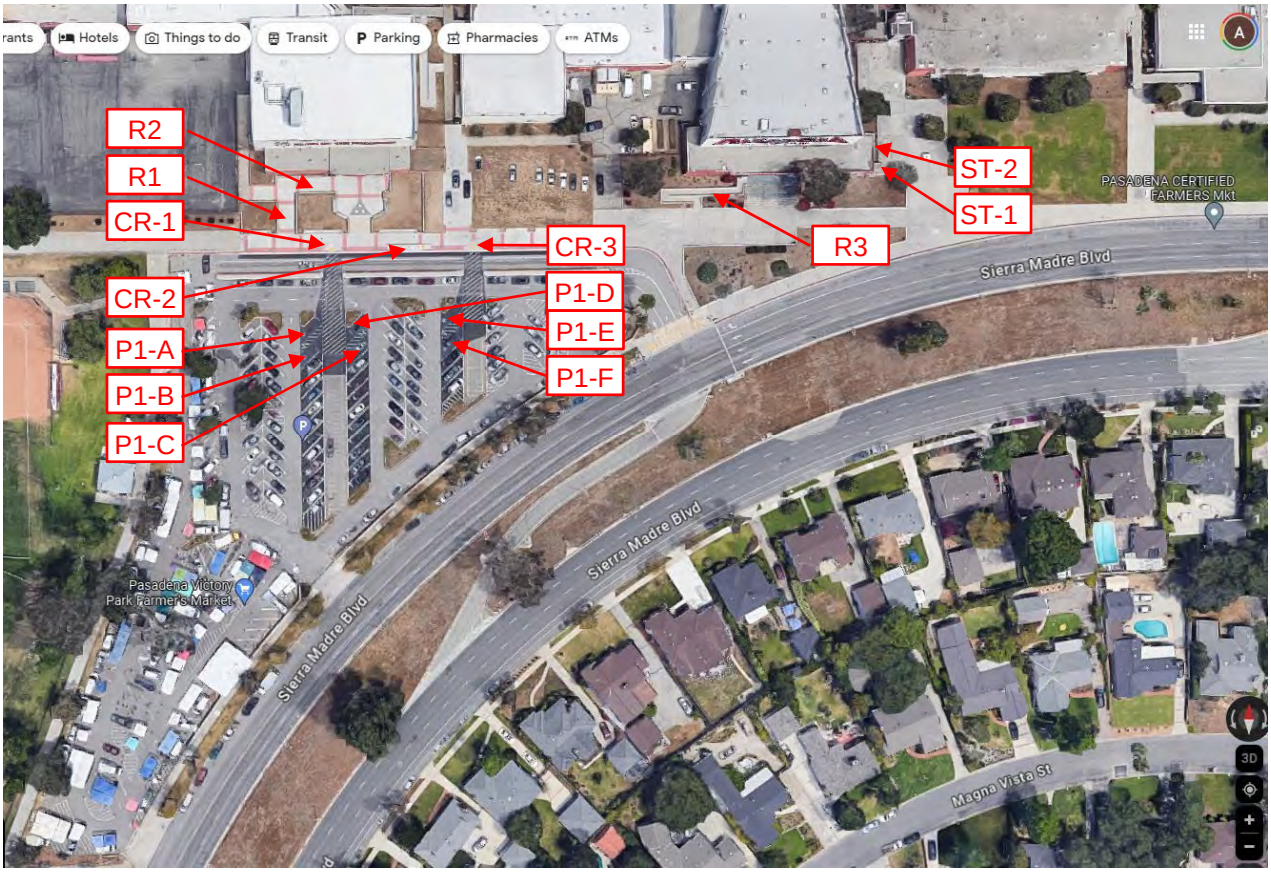

Parking Lot 1
116 Total Spaces
Required: 1 Van and 4 Standard Accessible Spaces
Provided: 2 Van and 4 Standard Accessible Spaces

Source:

Google Maps / Google Earth

Legend:

P-# - Parking Row/Lot
P#-# - Accessible Parking Space
CR-# - Curb Ramp
R-# - Ramp
ST-# - Stair

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Site Plan 2 – Enlarged North Side

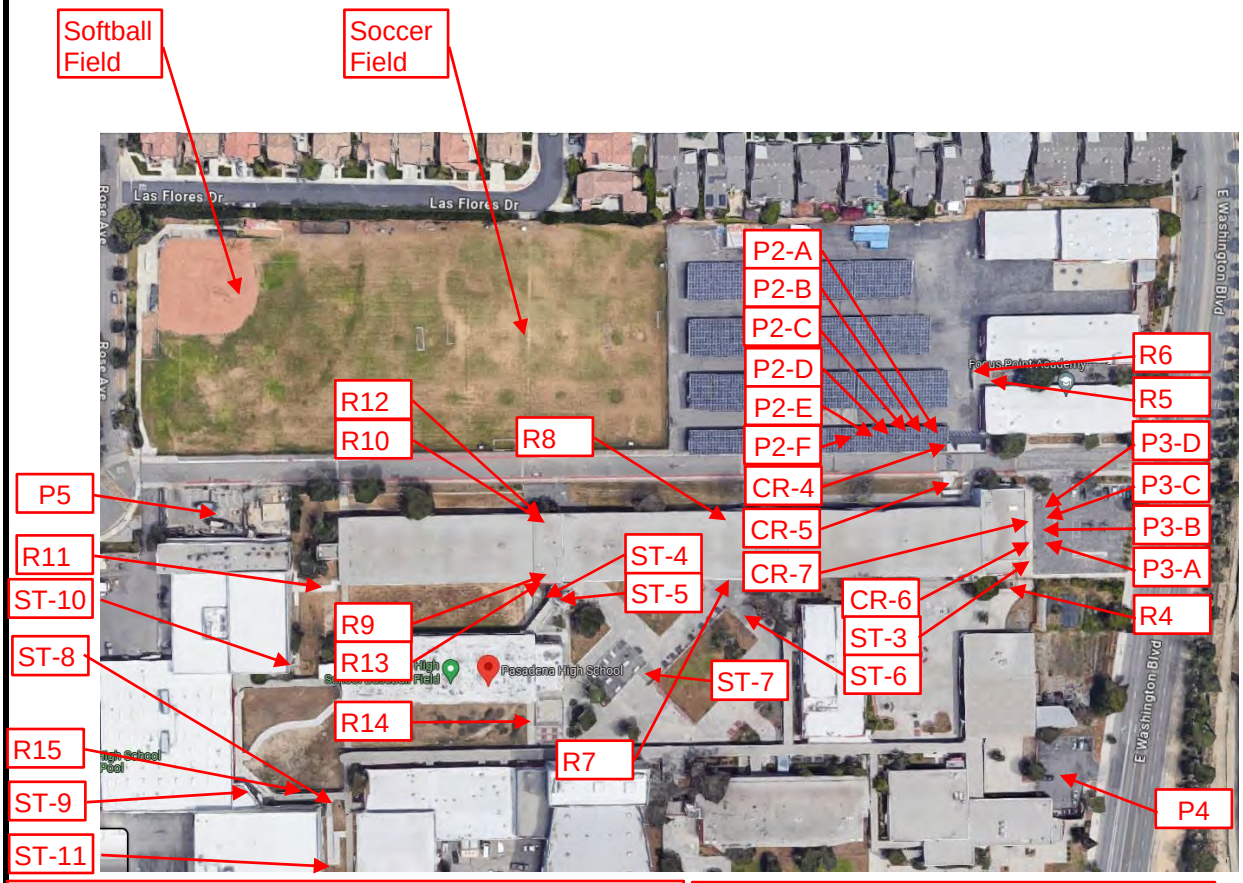

Parking Lot 2 161 Total Spaces Required: 1 Van and 5 Std Accessible Parking Spaces Provided: 1 Van and 5 Std Accessible Parking Spaces	Parking Lot 5 7 Total Spaces Required: 1 Van Accessible Parking Space Provided: 0 Accessible Parking Spaces
Parking Lot 3 19 Total Spaces Required: 1 Van Accessible Parking Space Provided: 2 Van+2 Car Accessible Parking Spaces	Parking Lot 4 9 Total Spaces Required: 1 Van Accessible Parking Space Provided: 0 Accessible Parking Spaces

Source:

Google Maps / Google Earth

Legend:

P-# - Parking Row/Lot
P#-# - Accessible Parking Space
CR-# - Curb Ramp
R-# - Ramp
ST-# - Stair

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303

Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Site Plan 3 – Enlarged West Side



AREA NOT PART OF SCHOOL

Source:

Google Maps / Google Earth

Legend:

P-# - Parking Row/Lot
P#-# - Accessible Parking Space
CR-# - Curb Ramp
R-# - Ramp
ST-# - Stair

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building A – 1st Floor

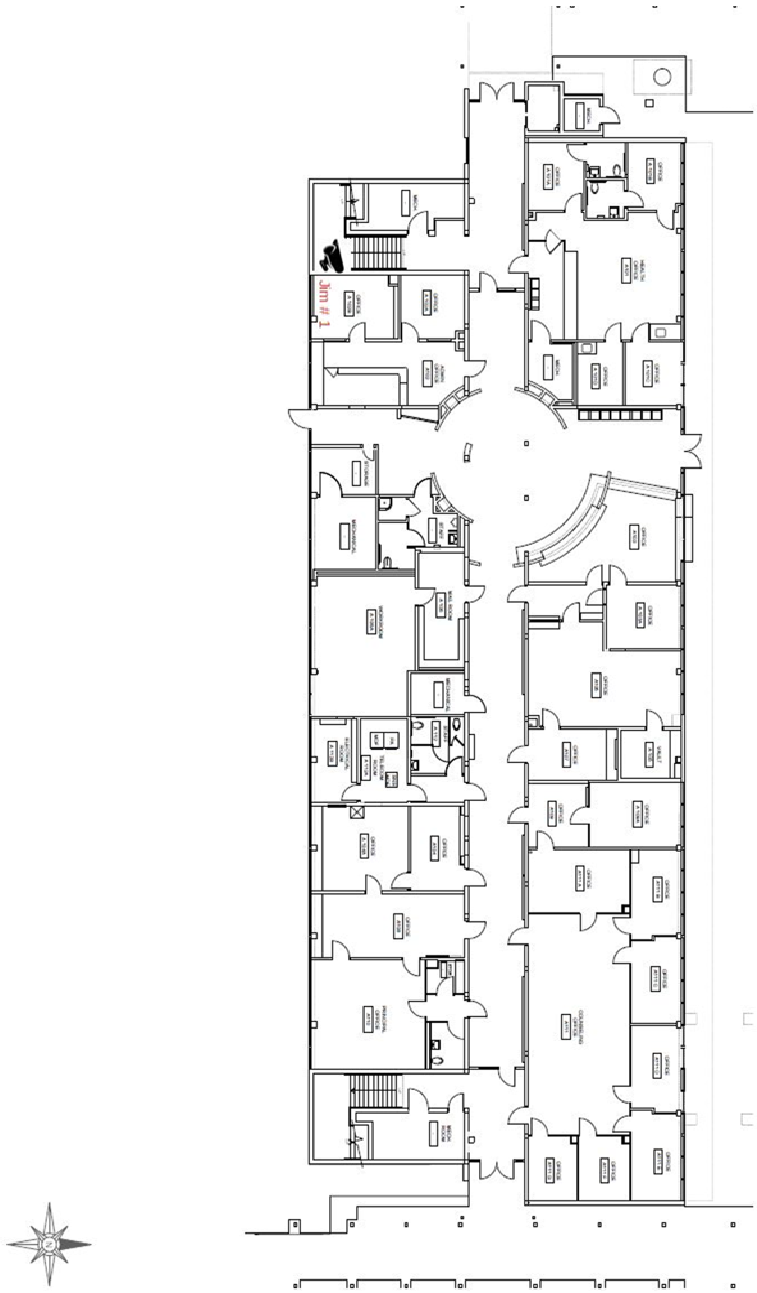

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building A – 2nd Floor

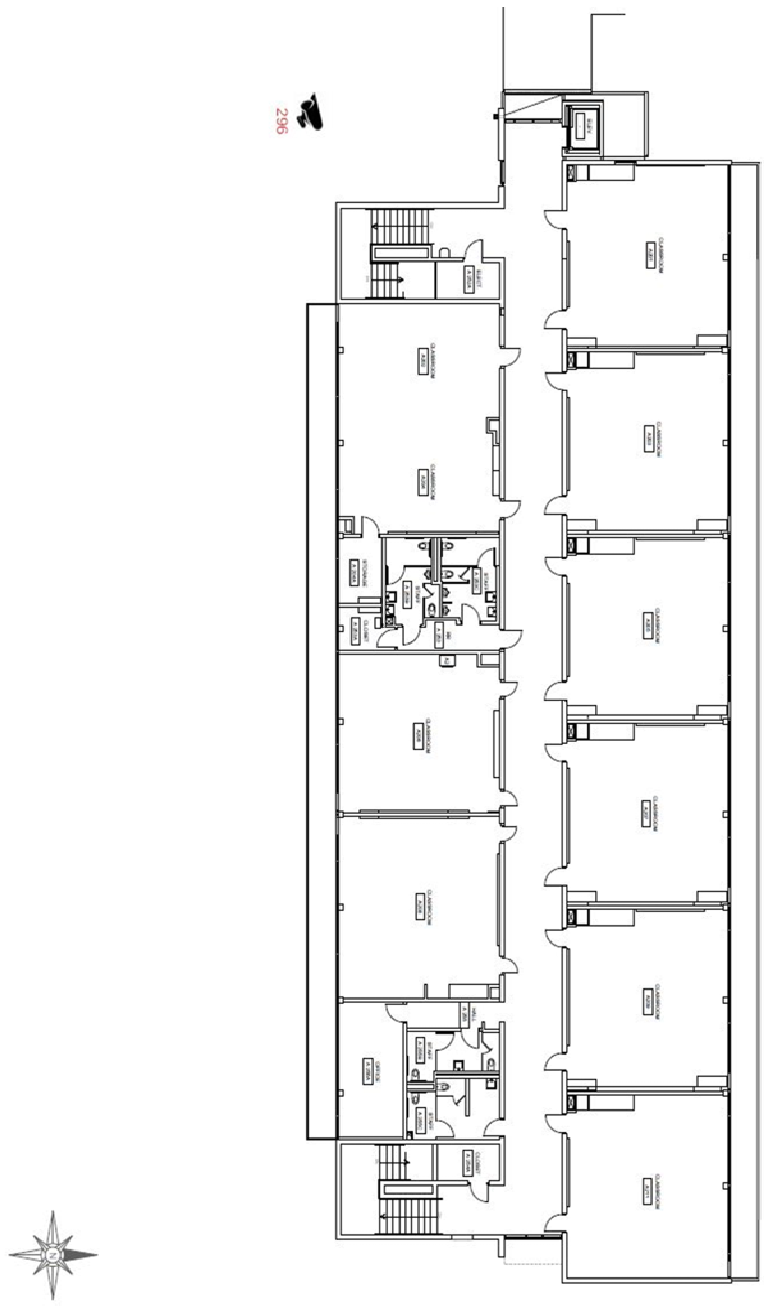

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building B

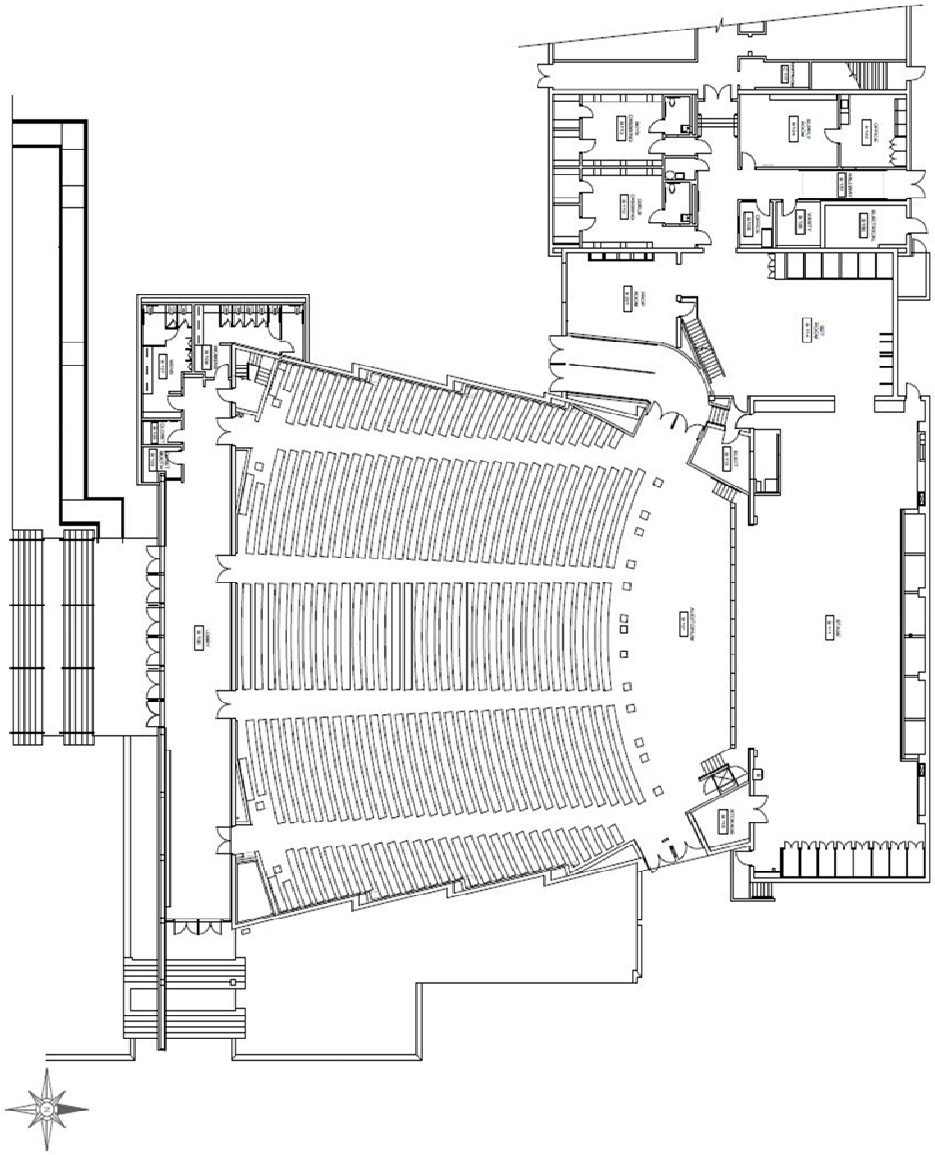

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building C

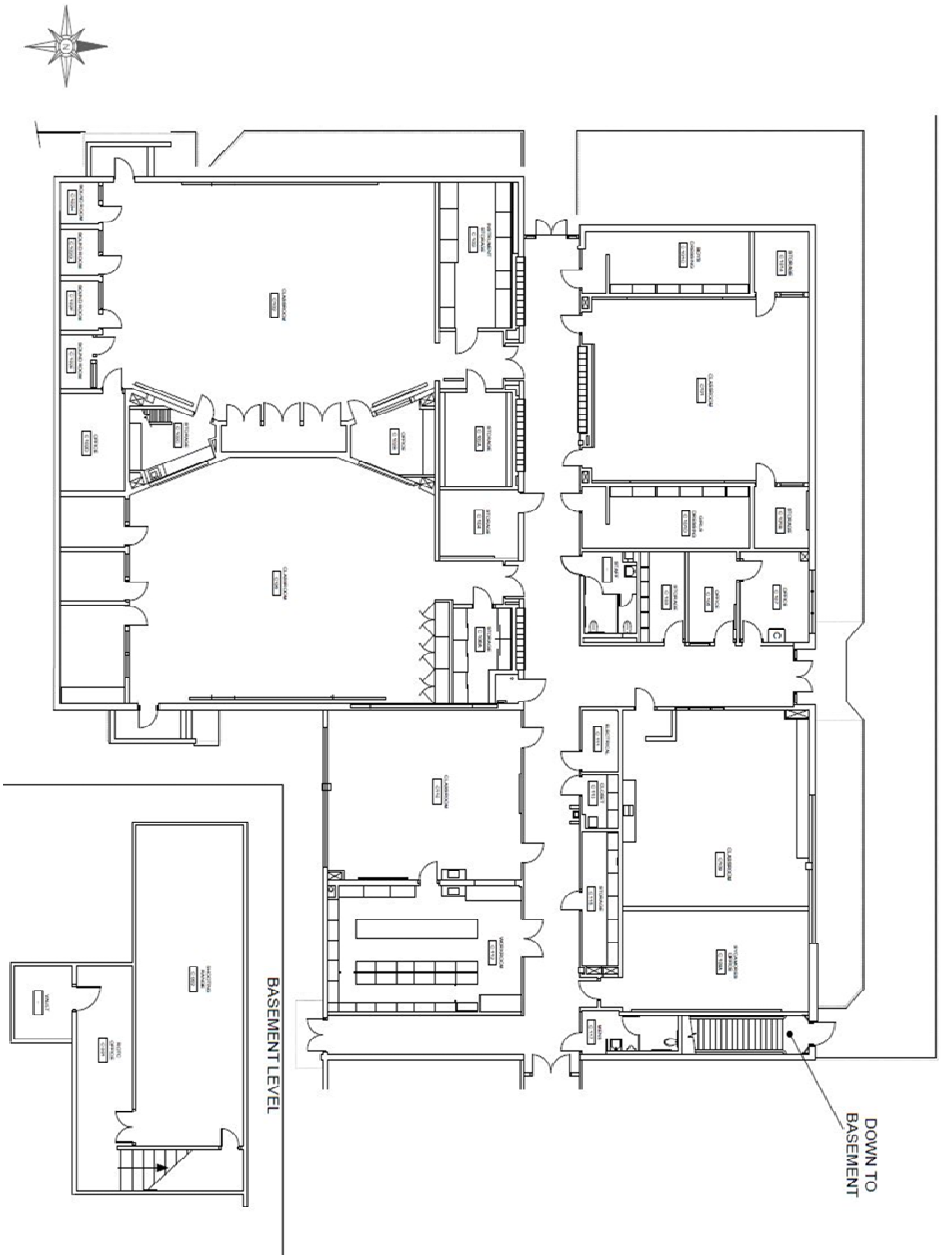

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building D

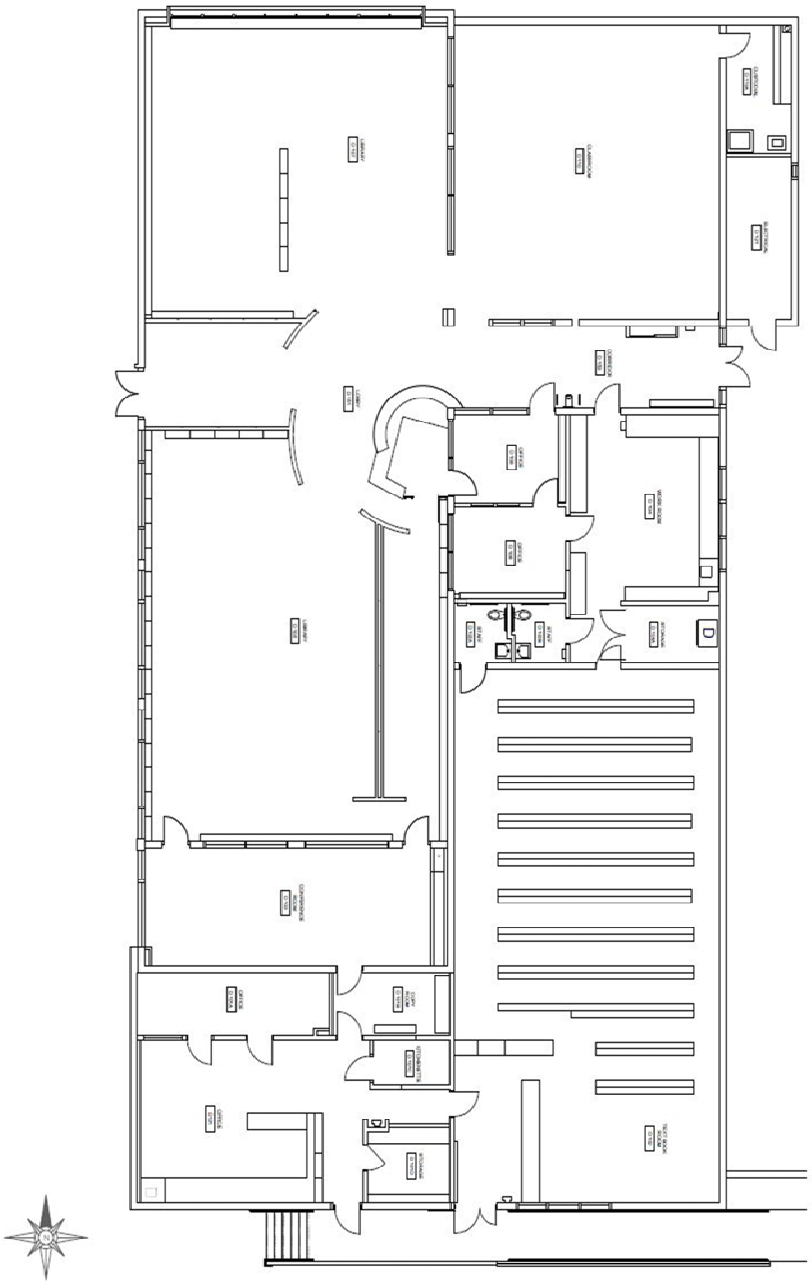

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building E – 1st Floor

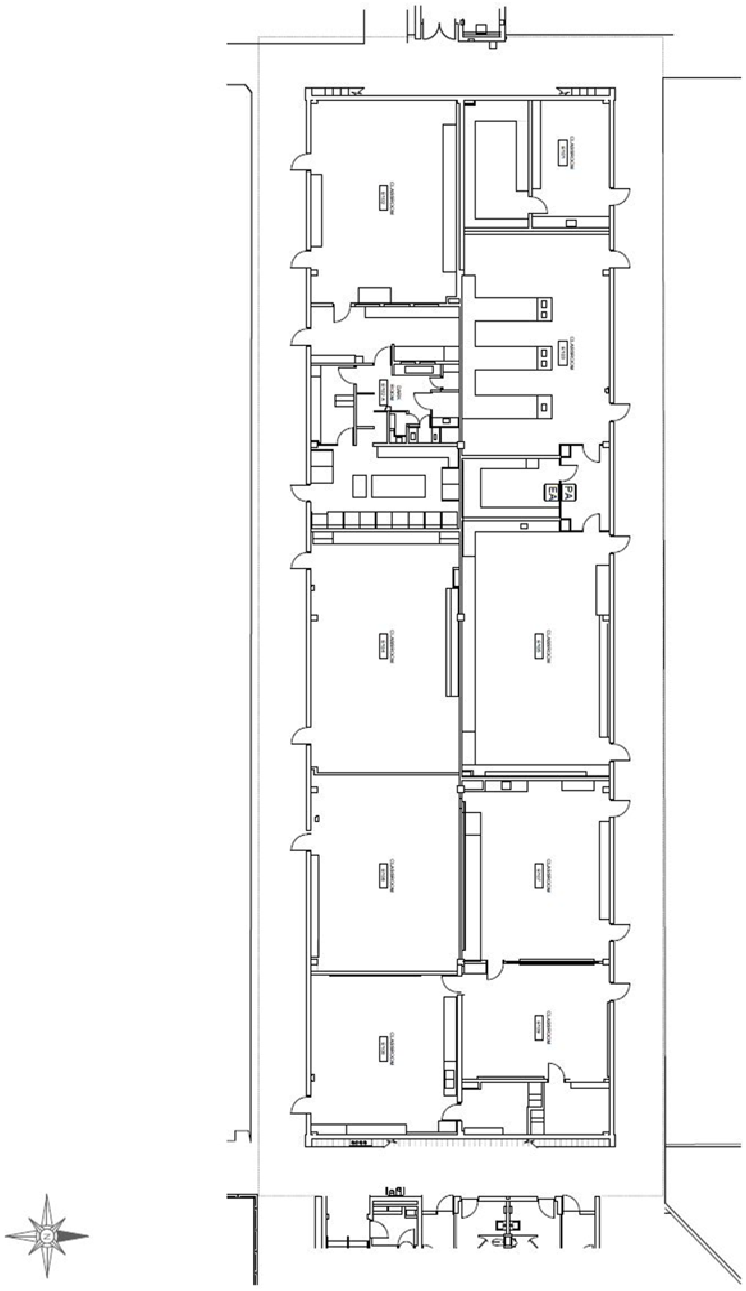

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building E – 2nd Floor

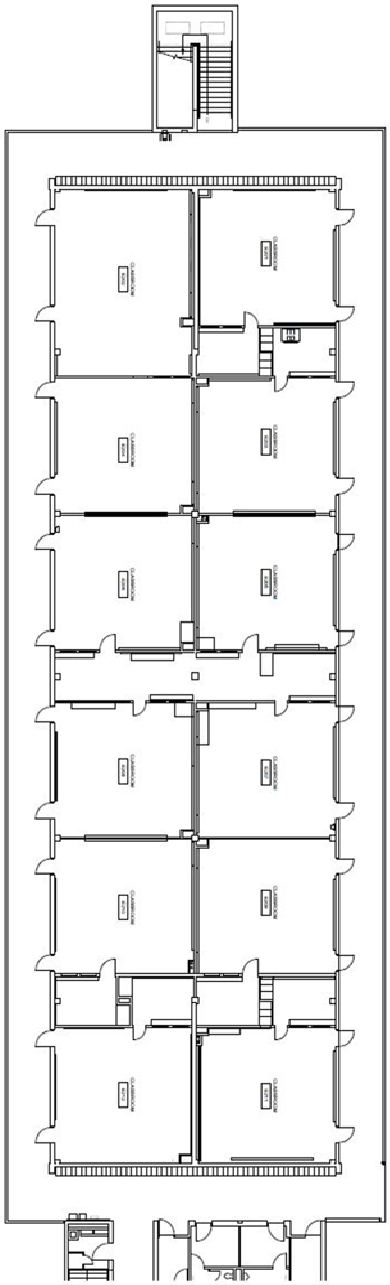

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building F – 1st Floor

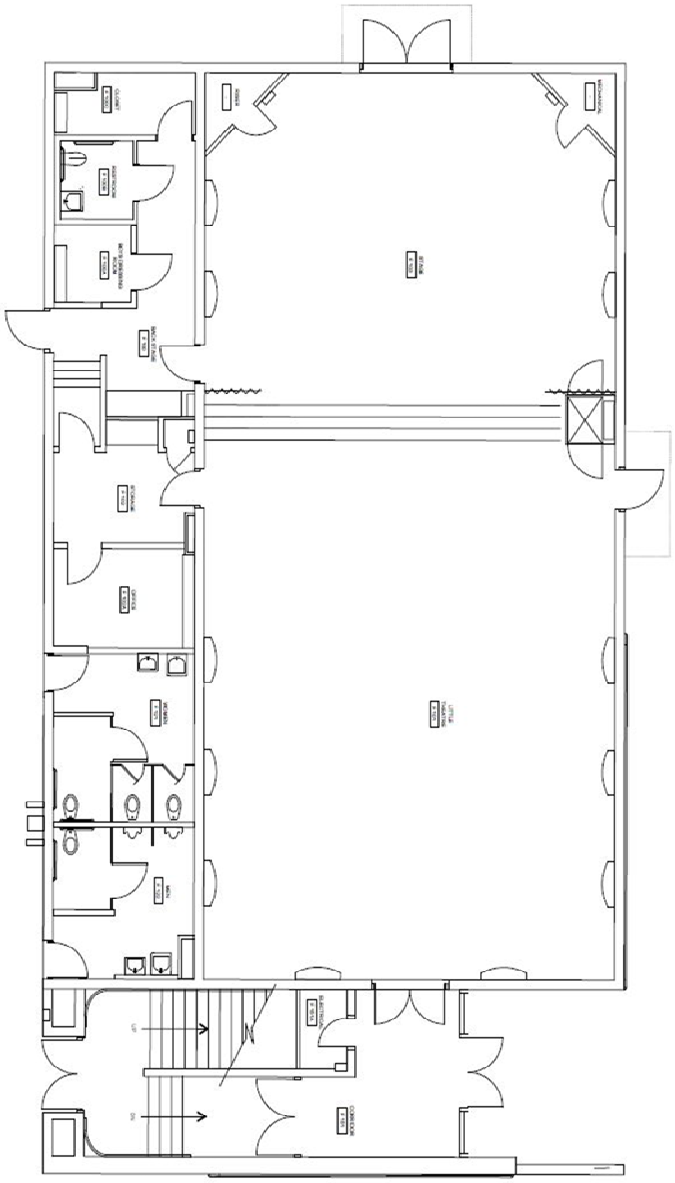

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building F – 2nd Floor

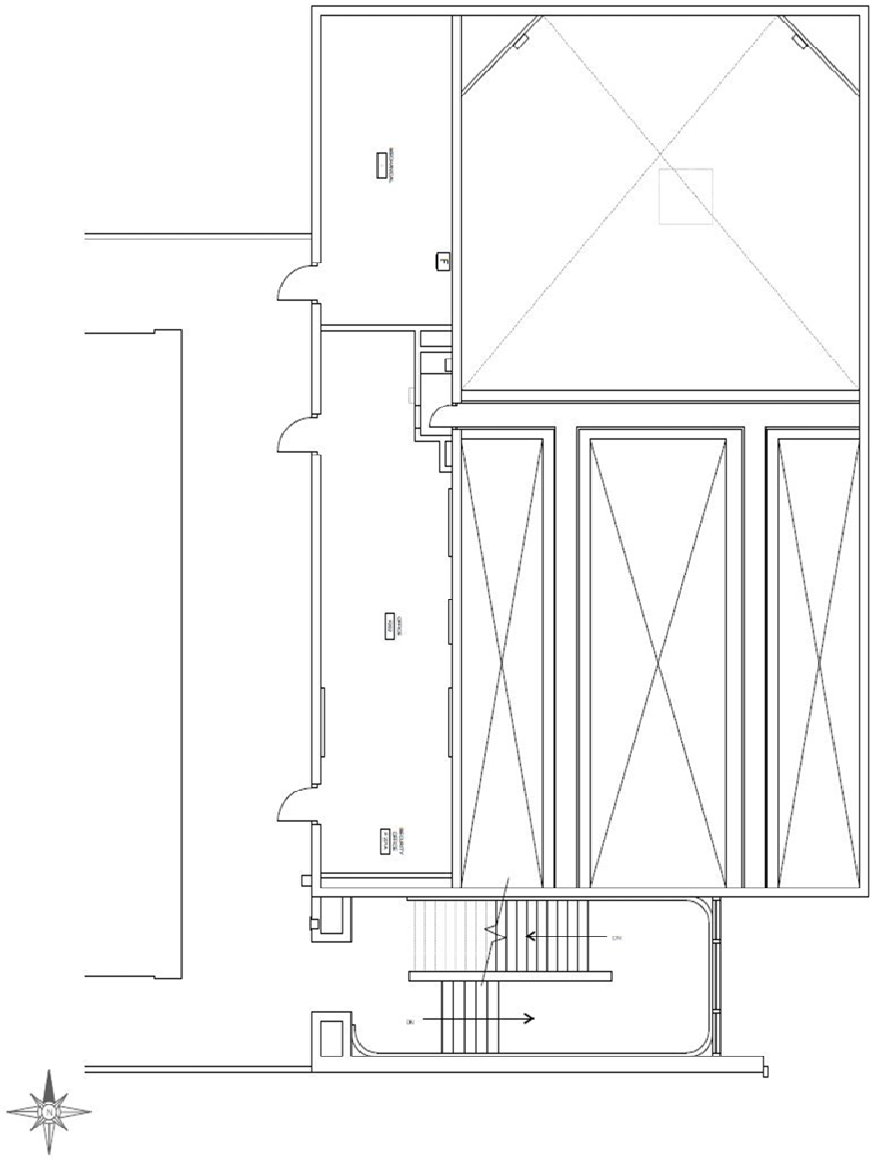

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building G – 1st Floor

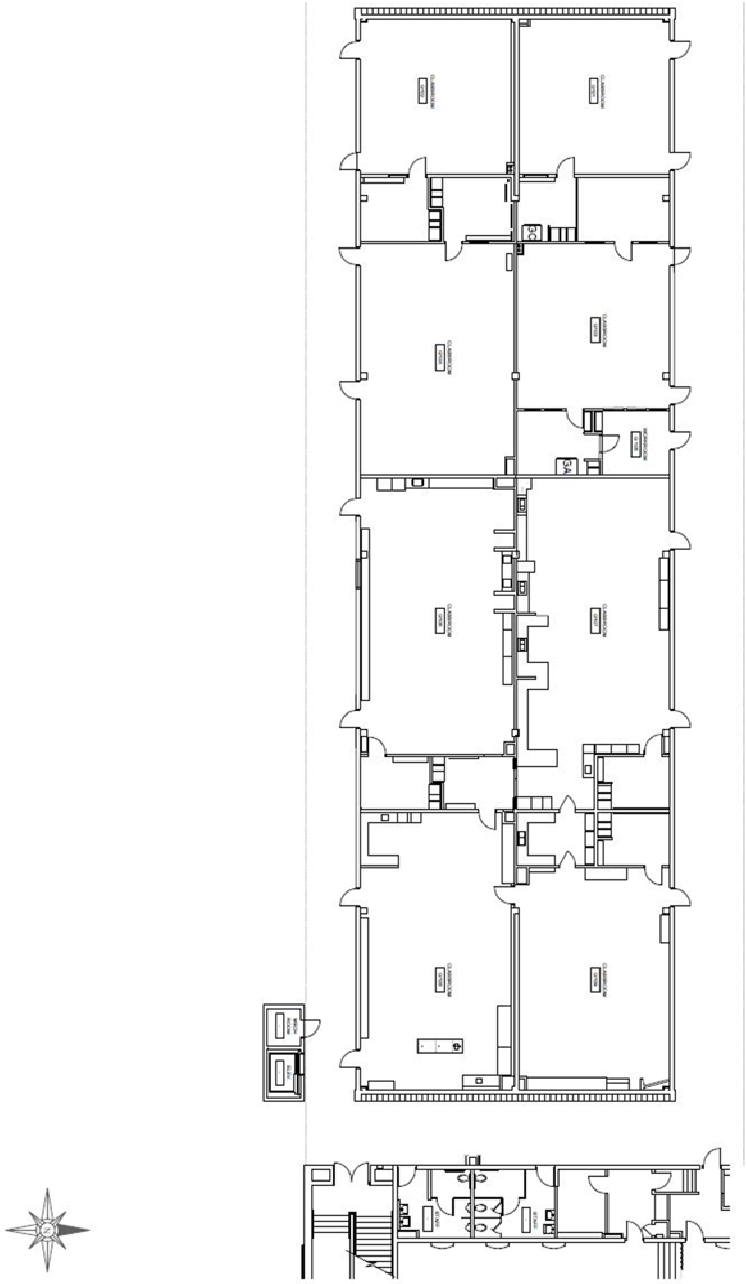

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building G – 2nd Floor

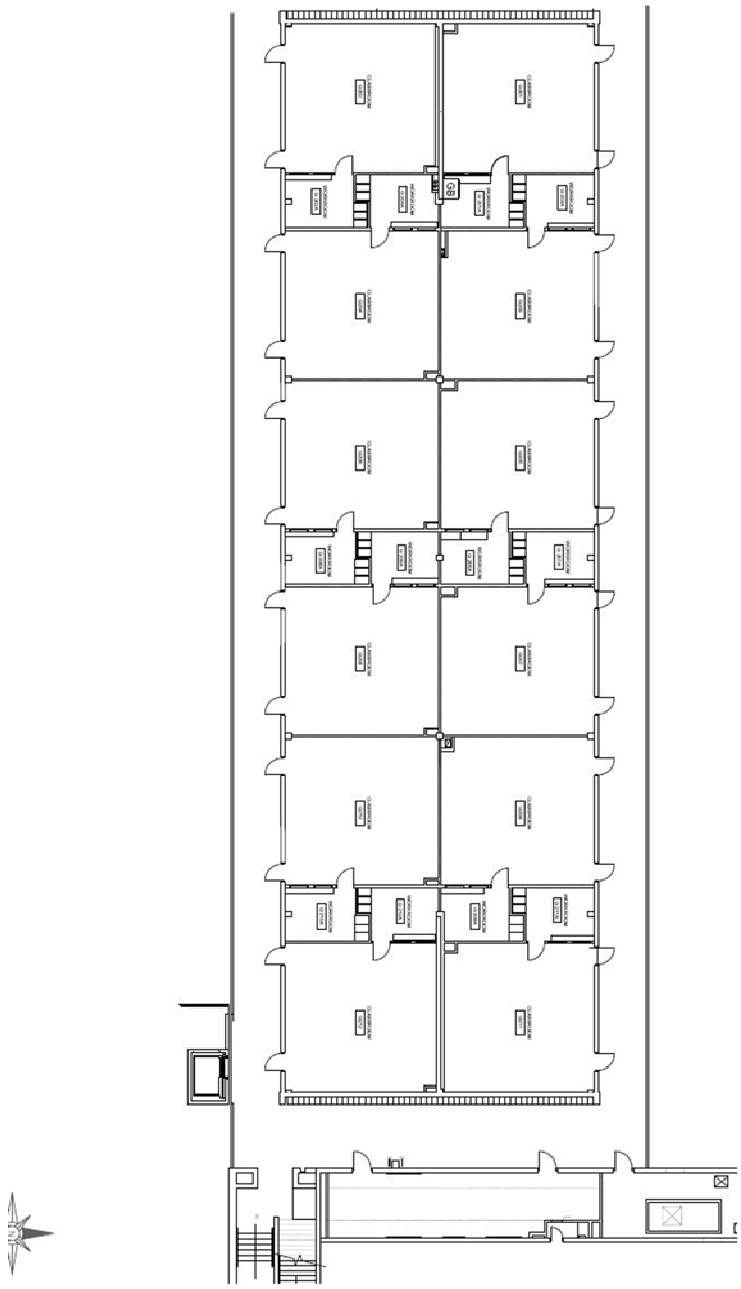

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building H – 1st Floor

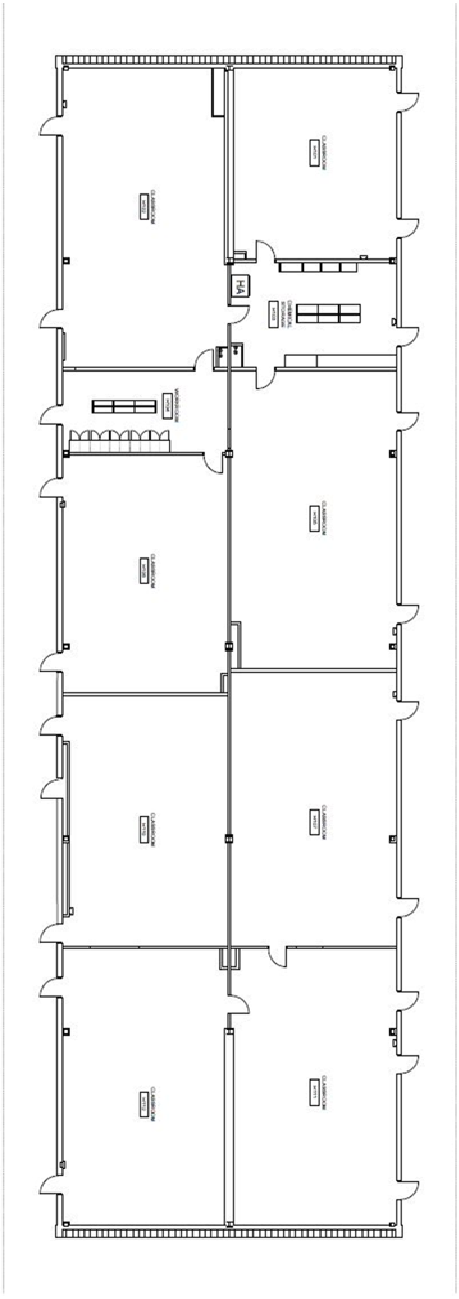

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building H – 2nd Floor

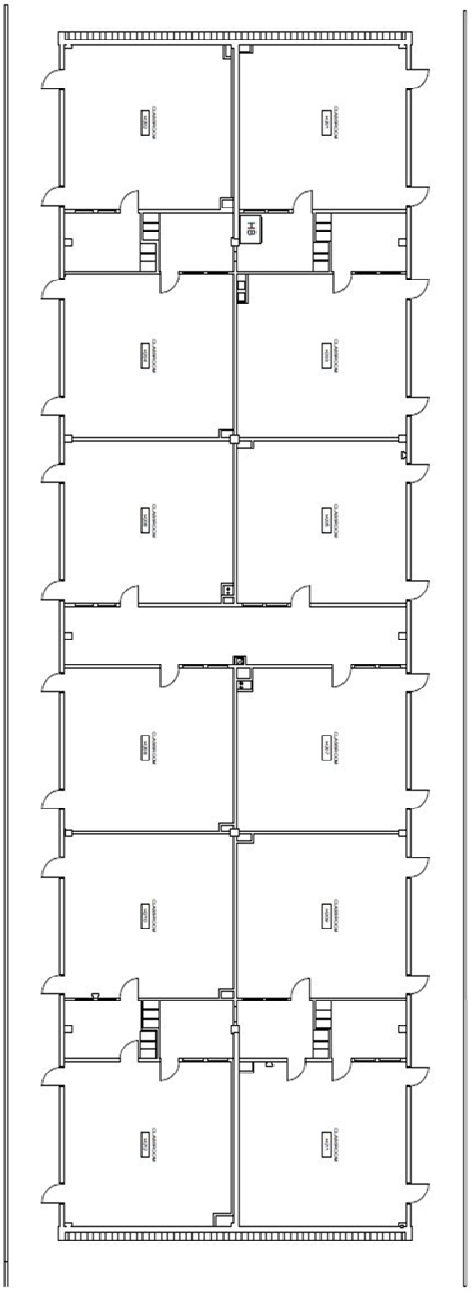

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building I – 1st Floor

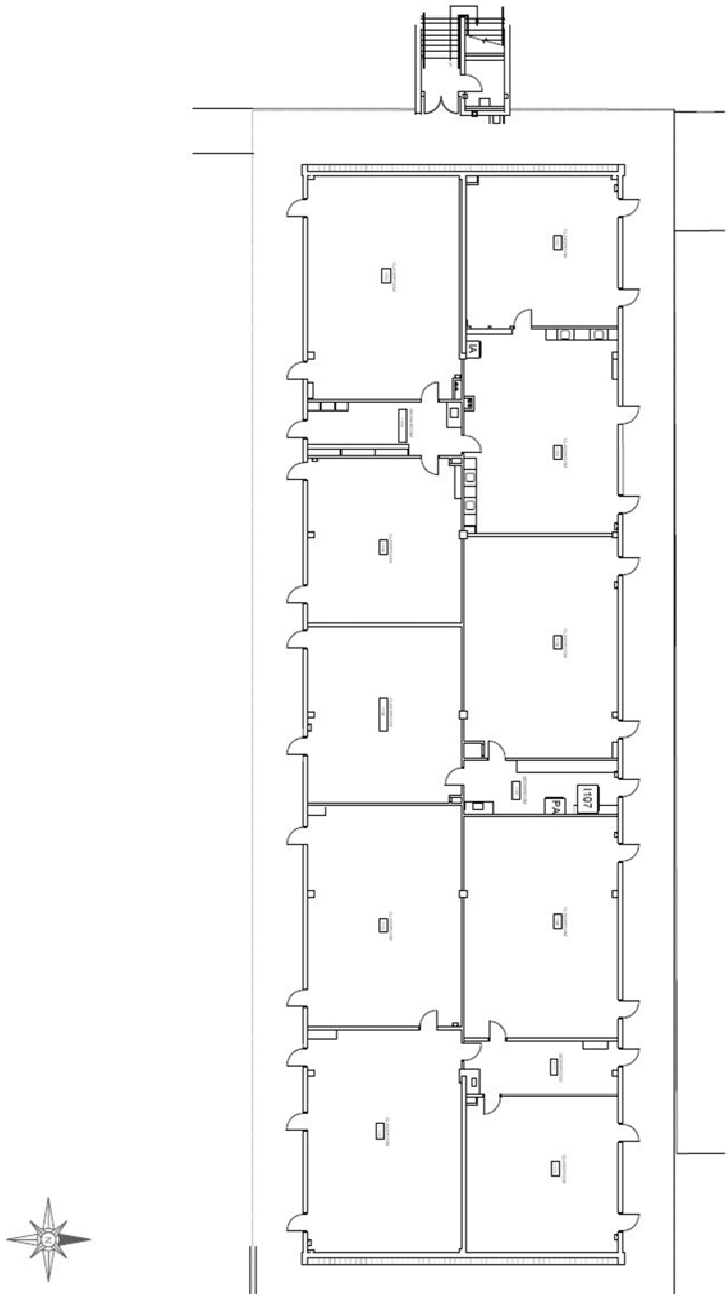

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building I – 2nd Floor

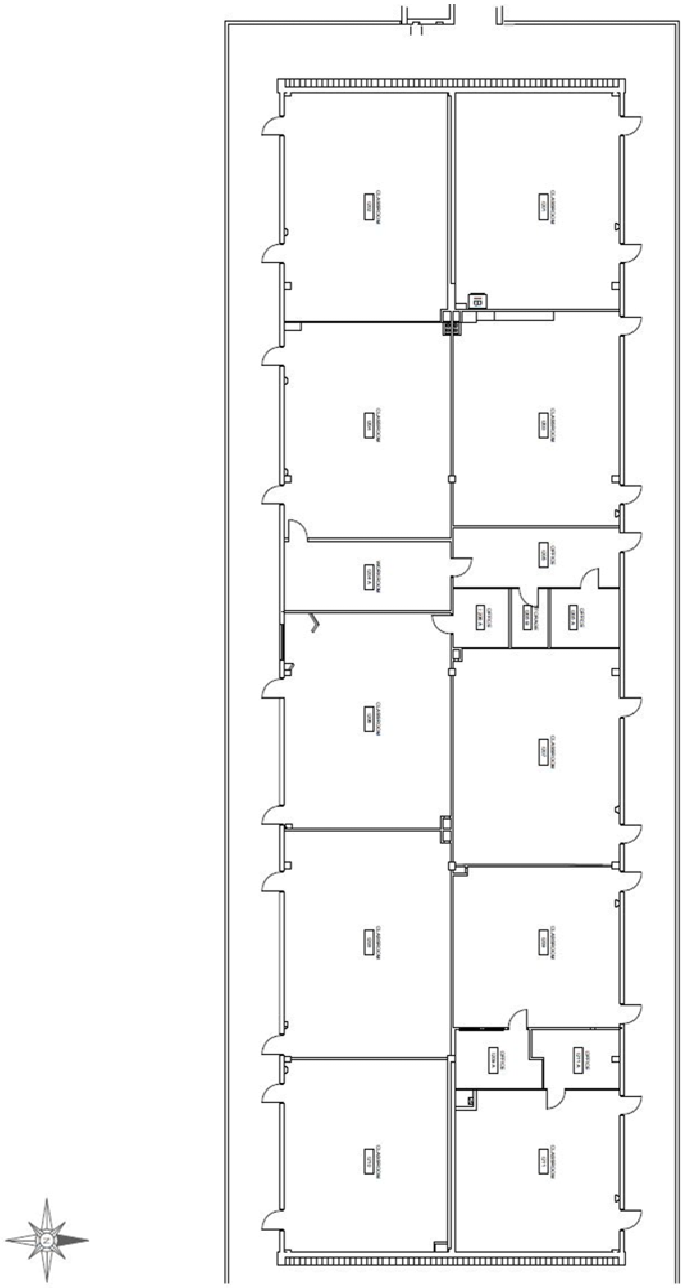

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building N

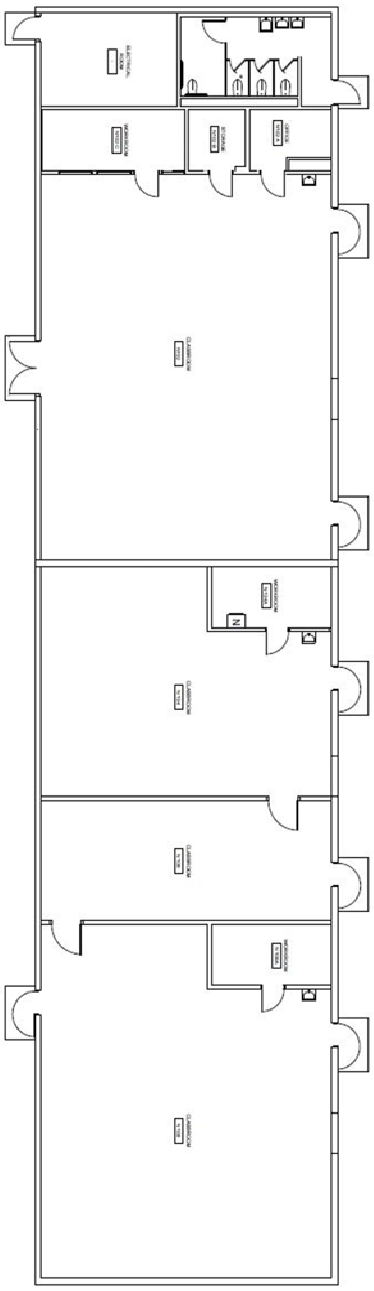

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building P

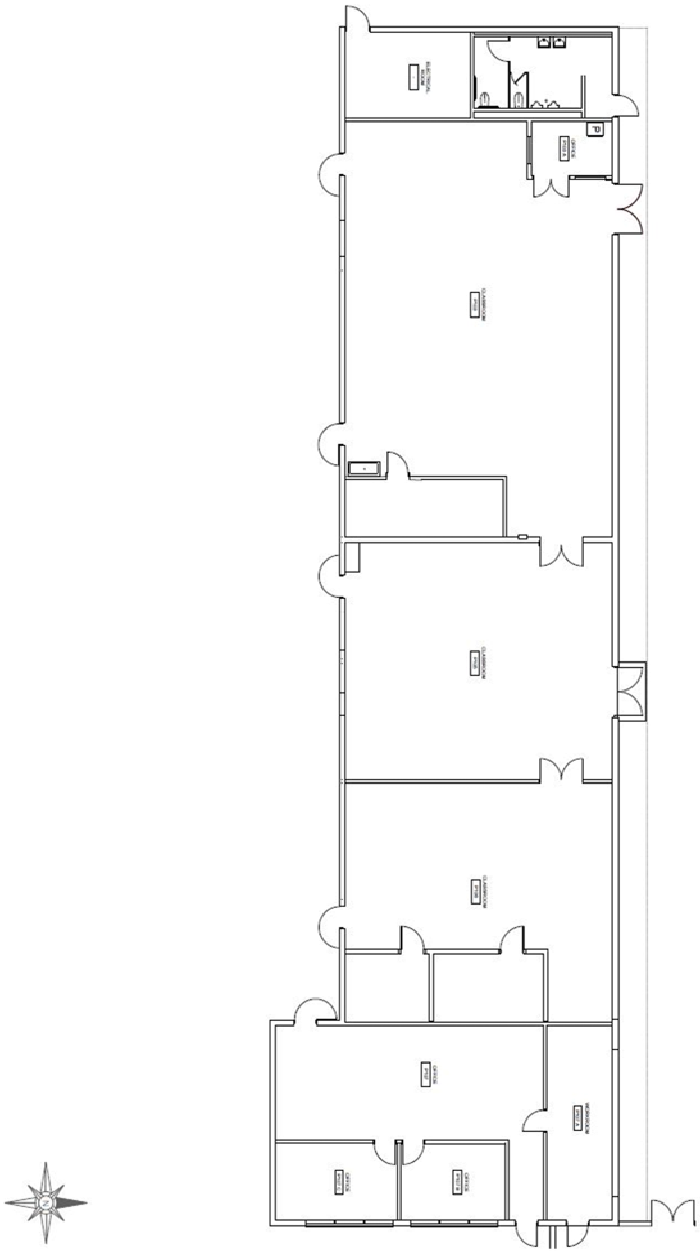

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building Q

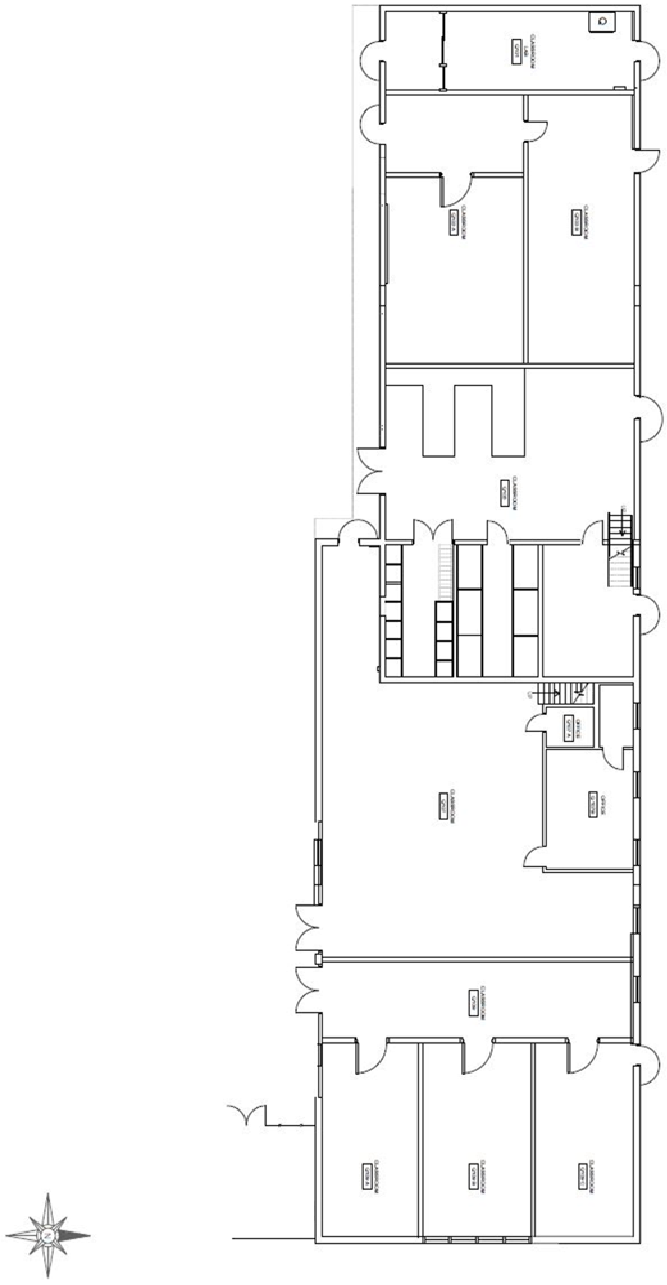

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building R

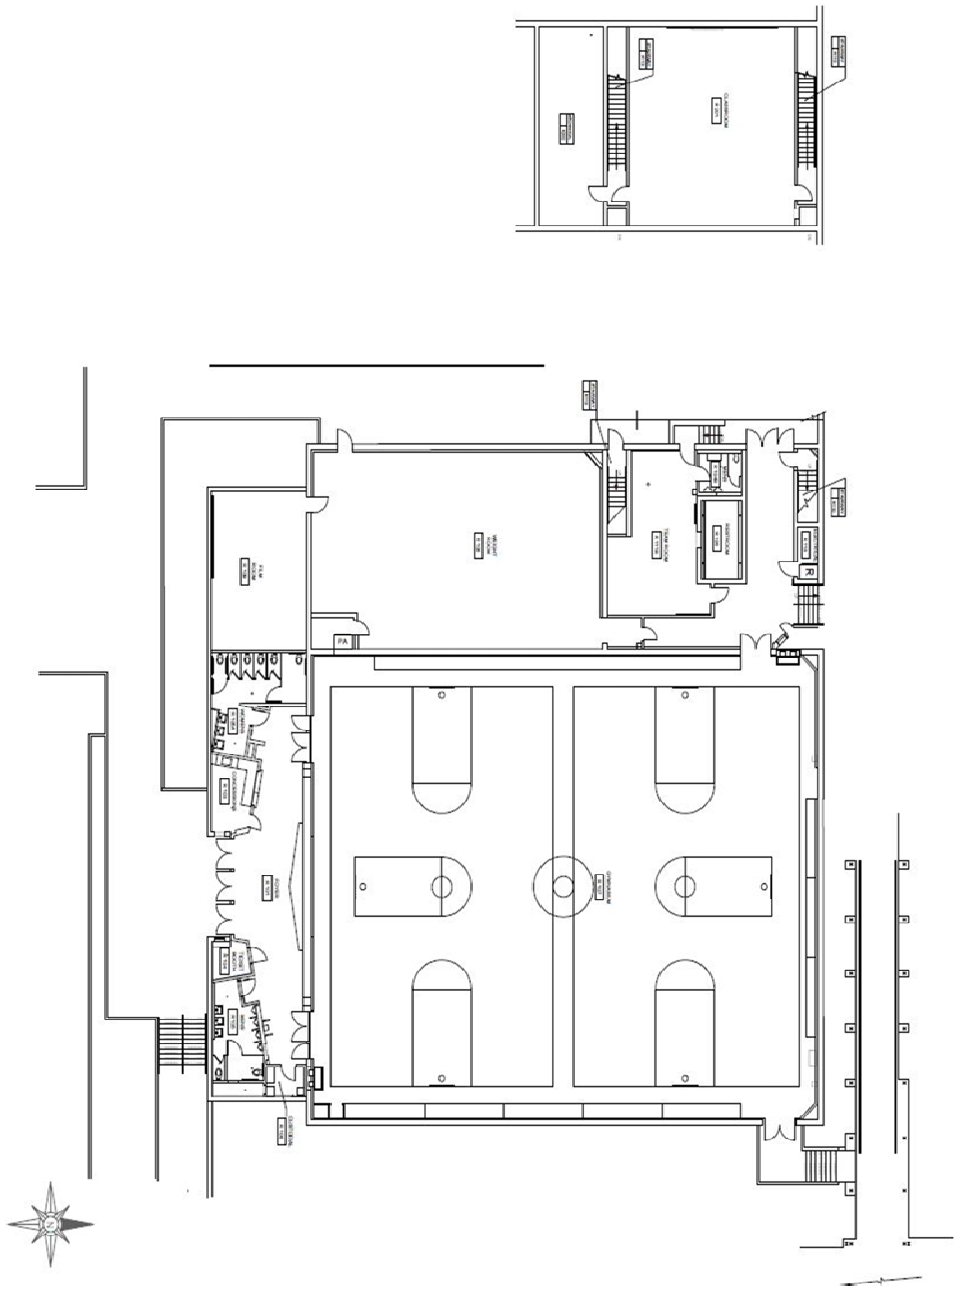

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building S

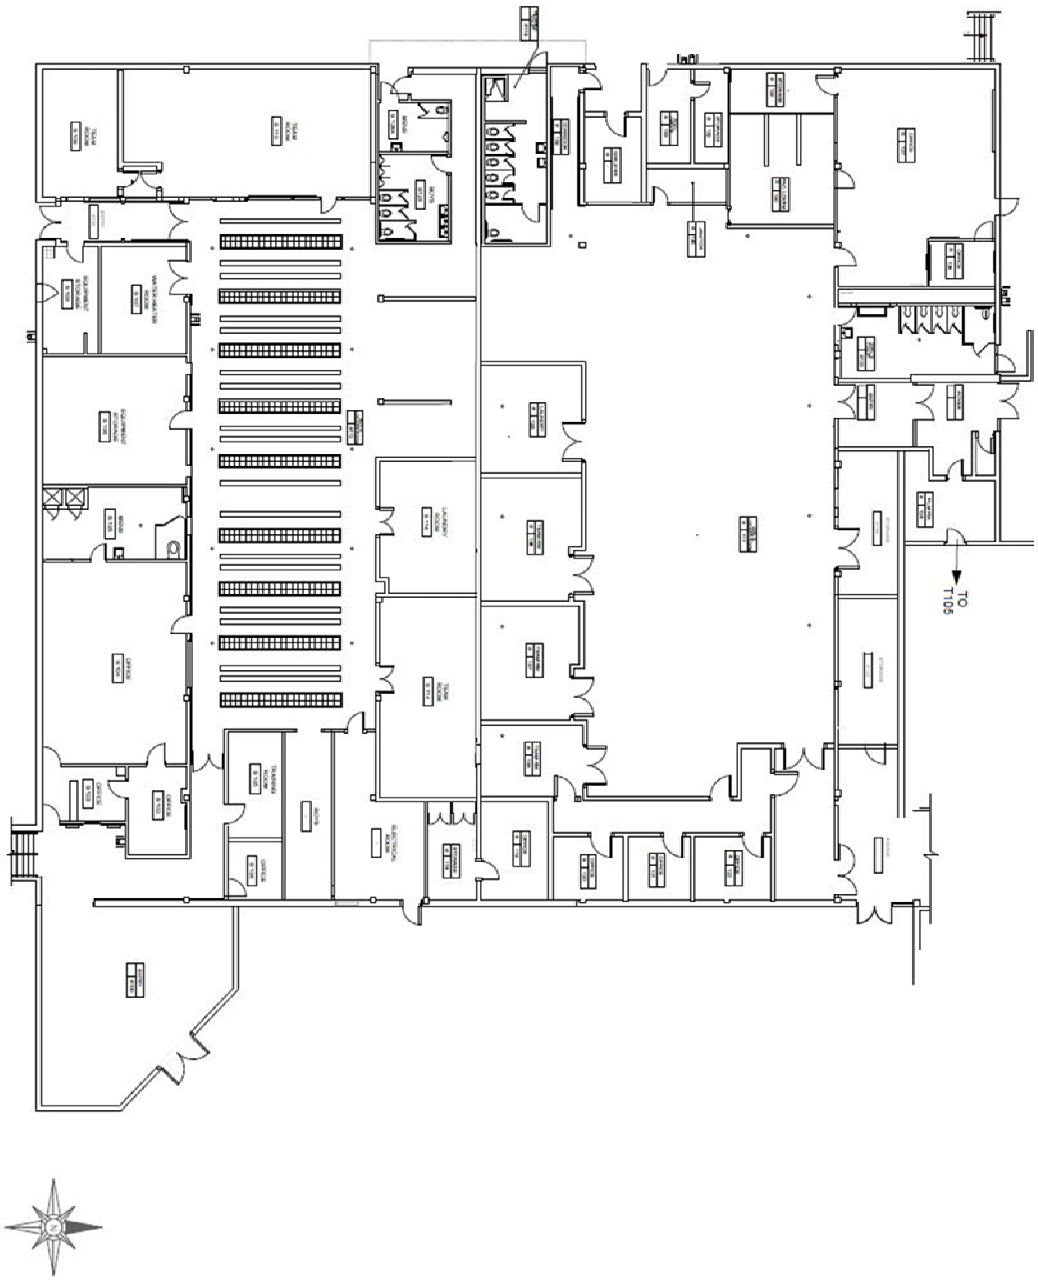

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building T

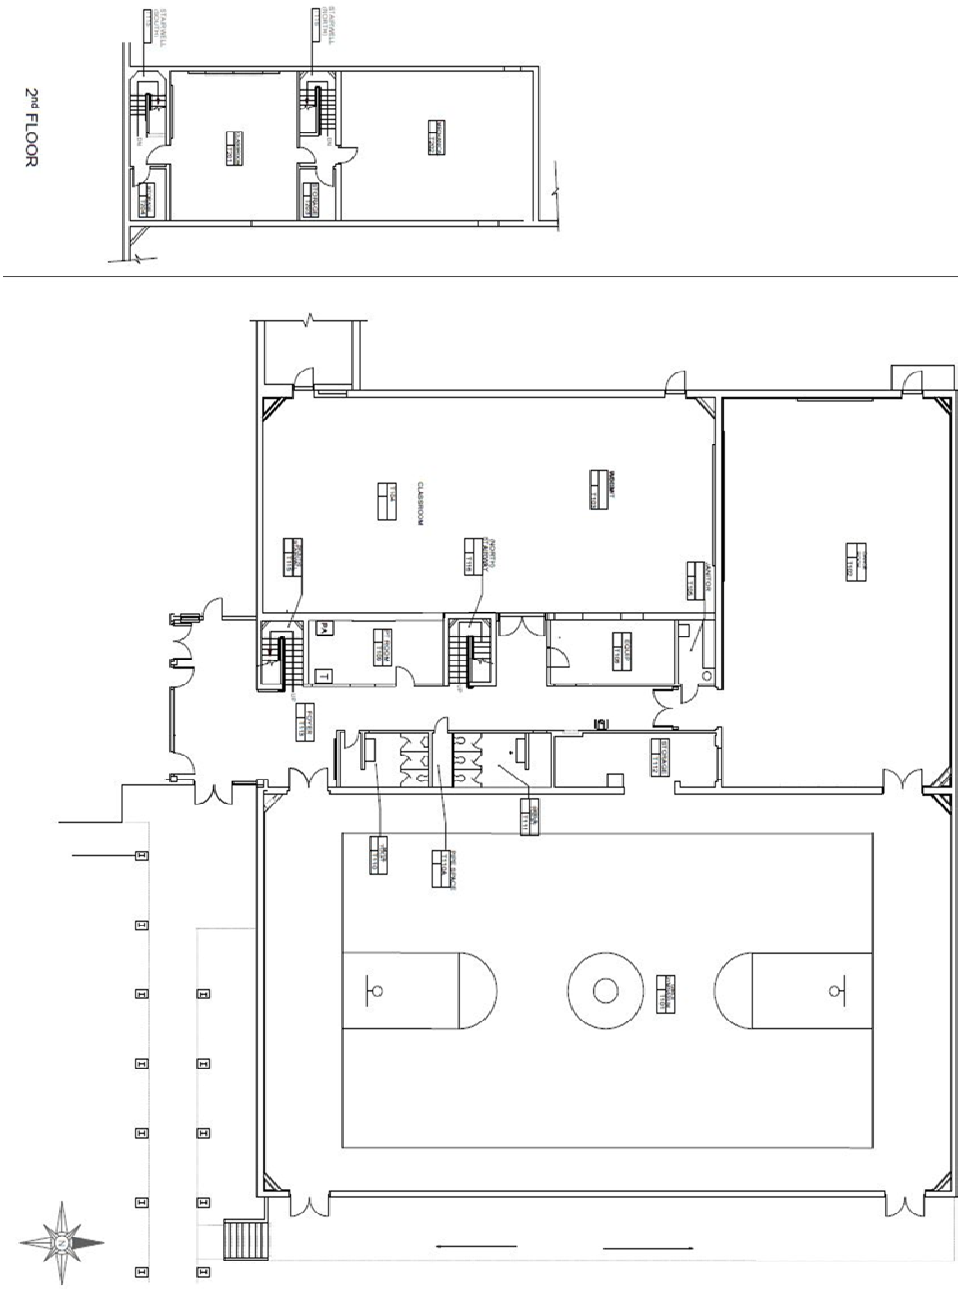

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building U

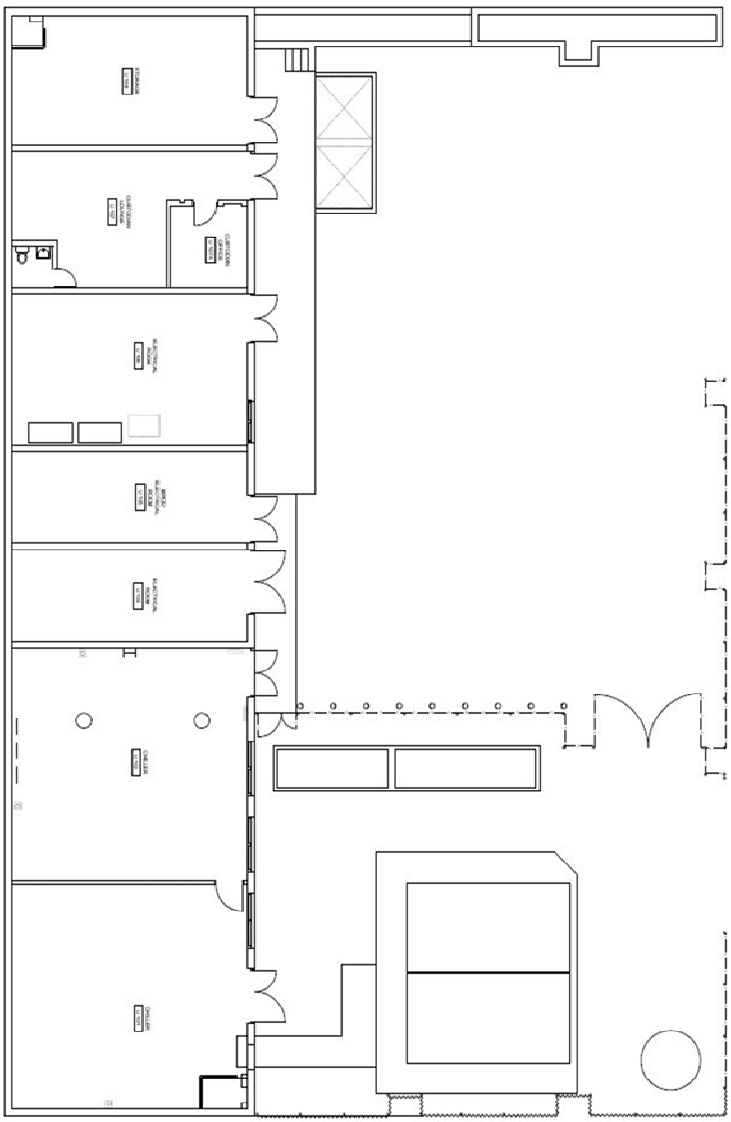

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building V

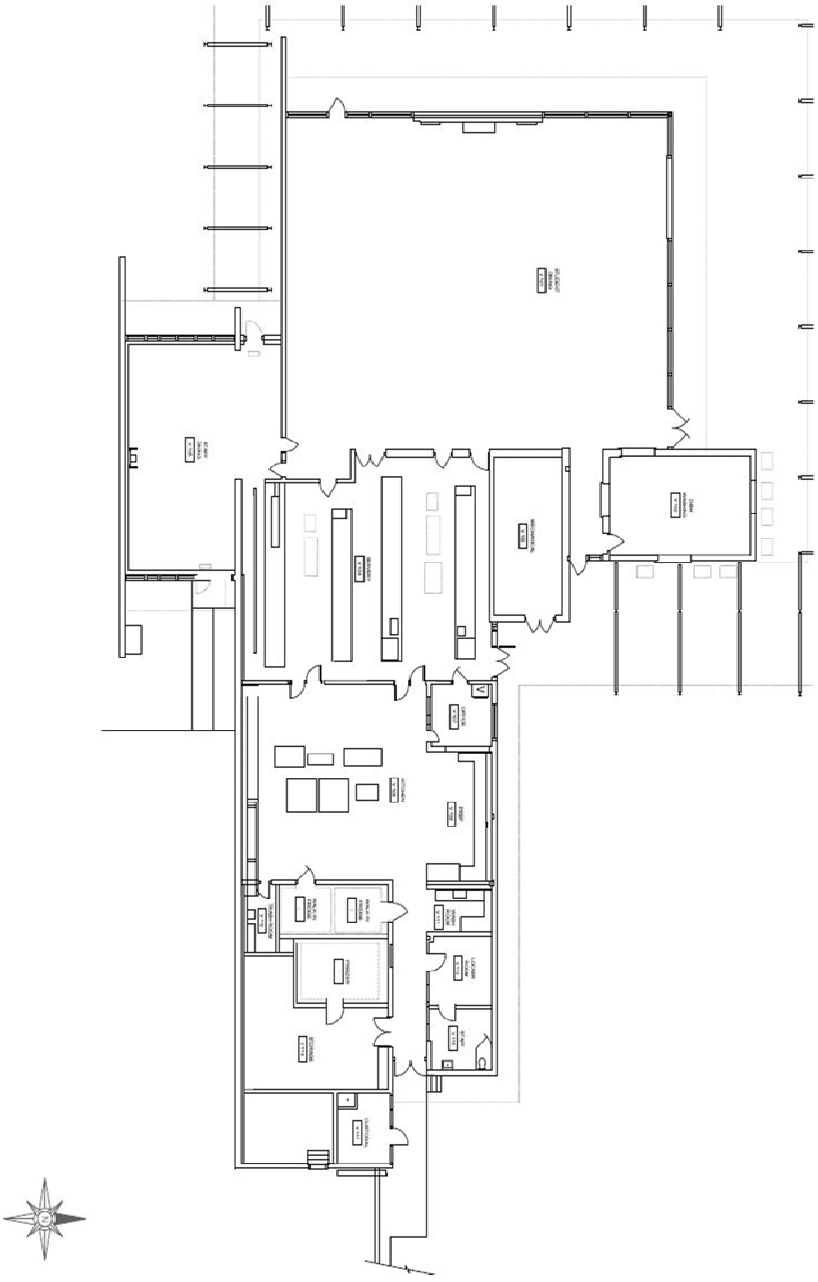

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303


Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

Floor Plan – Building W

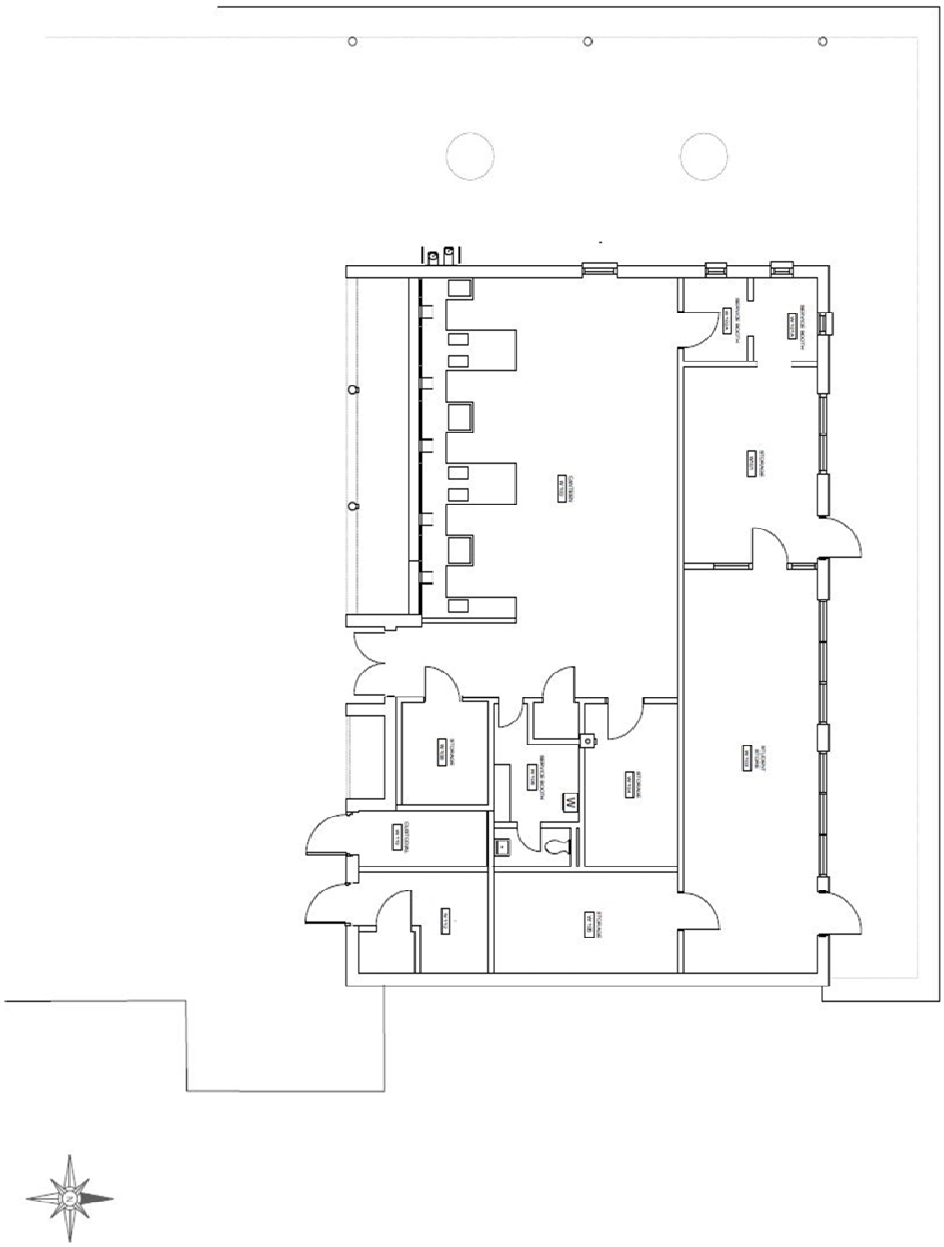

Source:

Pasadena Unified School District

Legend:

RR-# - Restroom
DF-# - Drinking Fountain
R-# - Ramp
ST-# - Stair
E-# - Elevator
D-# - Door

The north arrow indicator is an approximation of 0° North.

Project Number:

164633.23R000-002.303

Project Name:

Pasadena High School

On-Site Date:

Dec. 04-08, 2023, Dec. 12-13, 2023

APPENDIX B:
RECORD OF INDIVIDUAL BARRIERS

Barrier ID: AX418281

Pasadena High School BUILDING G

Assembly	Interior Access Route
Type	Controls And Dispensers
ADA Standard	None
Barrier Detail	The amenity cannot be accessed and, therefore, cannot be evaluated.
Location Description	Building G - G 107
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	Master key did did not work for this room. Unable to enter.

Resolution


The amenity could not be accessed, and therefore the amenity was not evaluated for compliance with accessibility codes and regulations.

Quantity

0 EA

Priority	0

Photos for Barrier ID: AX418281

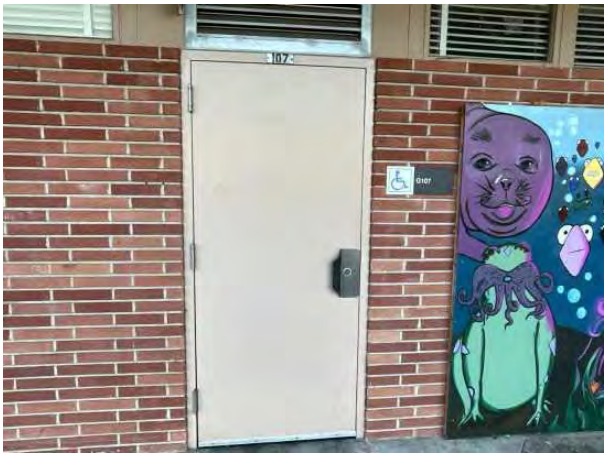

Barrier ID: AX419880

Pasadena High School BUILDING S

Assembly	Interior Access Route
Type	Accessible Route
ADA Standard	305.3 and 402.5.1
Barrier Detail	Clear widths are less than 36" minimum, including protruding objects.
Location Description	Building S - S105 Training Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	32 inch clear width is provided between the beds.

Resolution

Ensure clear widths of 36" minimum. [EXCEPTION: The clear width shall be permitted to be reduced to be 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.]


Quantity


1 EA


Priority	1

Photos for Barrier ID: AX419880



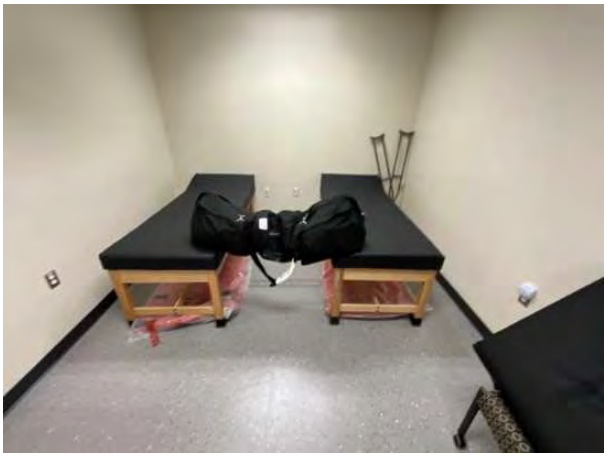

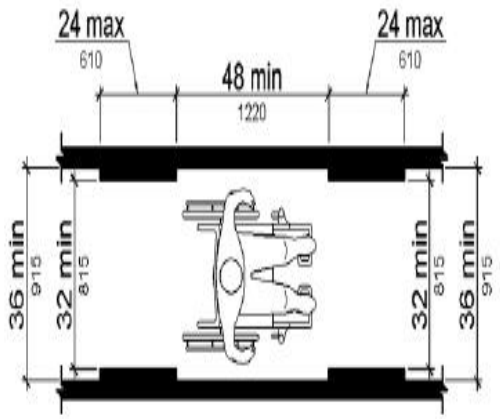

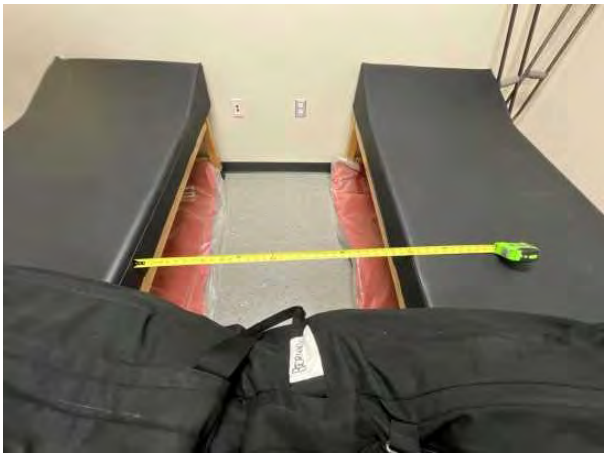

Barrier ID: AX424502

Pasadena High School GENERAL EXTERIOR

Assembly	Entrance to Building
Type	Building Entrance - Door
ADA Standard	CBC Chap 11B-404.2
Barrier Detail	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.
Location Description	Building A - East Entrance
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The door landing slopes, 3.2%.

Resolution


Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 24" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA


Priority	1


Map for Barrier ID: AX424502

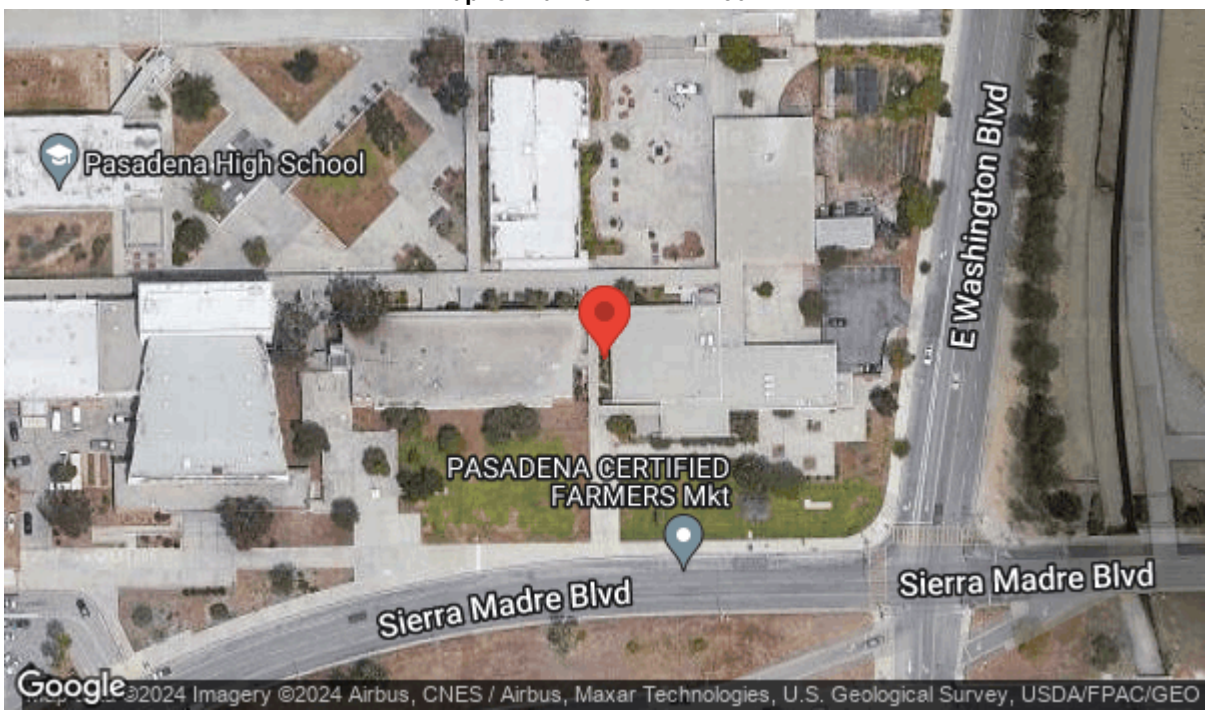

748 +34.162141, -118.091052

Photos for Barrier ID: AX424502

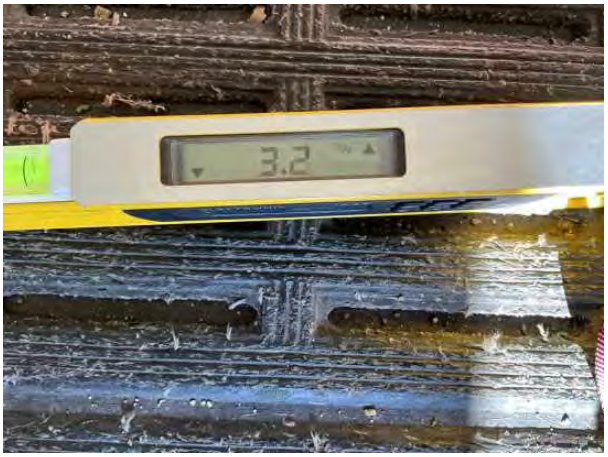

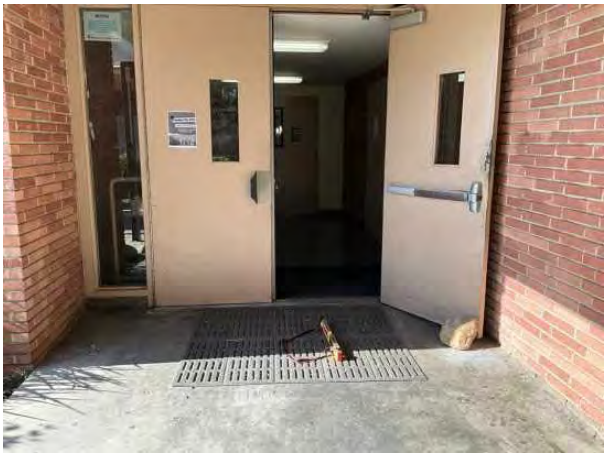

Barrier ID: AX424384

Pasadena High School BUILDING A

Assembly	Entrance to Building
Type	Building Entrance - Door
ADA Standard	CBC Chap 11B-404.2
Barrier Detail	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.
Location Description	Building A - Main Public Entrance
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door landing slopes, 2.5% and only provides 18 inch wide side maneuvering clearance for an exterior door.

Resolution

Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 24" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	1


Map for Barrier ID: AX424384



630 +34.161896, -118.091674


Photos for Barrier ID: AX424384



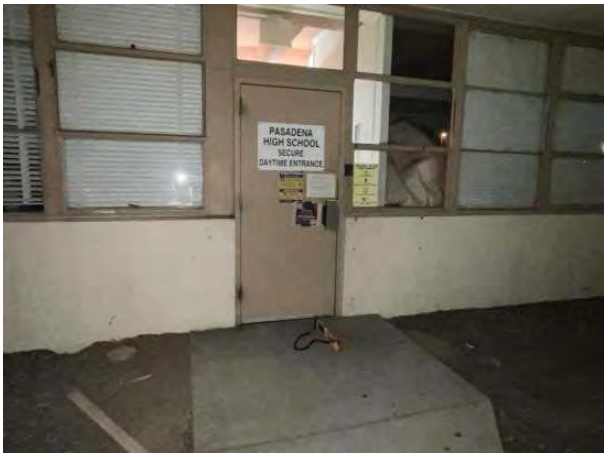





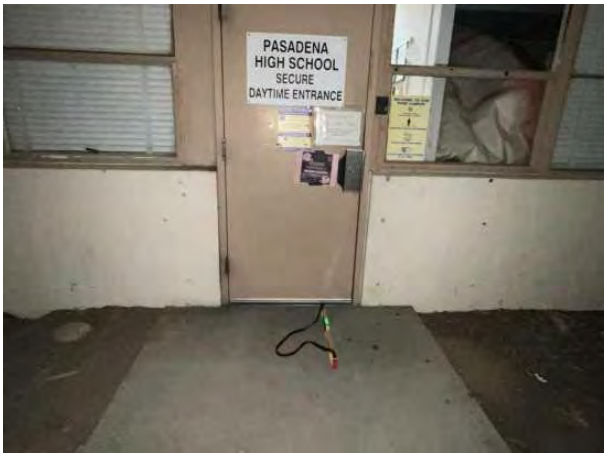

Barrier ID: AX424501

Pasadena High School GENERAL EXTERIOR

Assembly	Entrance to Building
Type	Building Entrance - Door
ADA Standard	CBC Chap 11B-404.2
Barrier Detail	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.
Location Description	Building A - North Entrance
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The door landing slopes, 4.2%

Resolution


Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 24" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA


Priority	1


Map for Barrier ID: AX424501

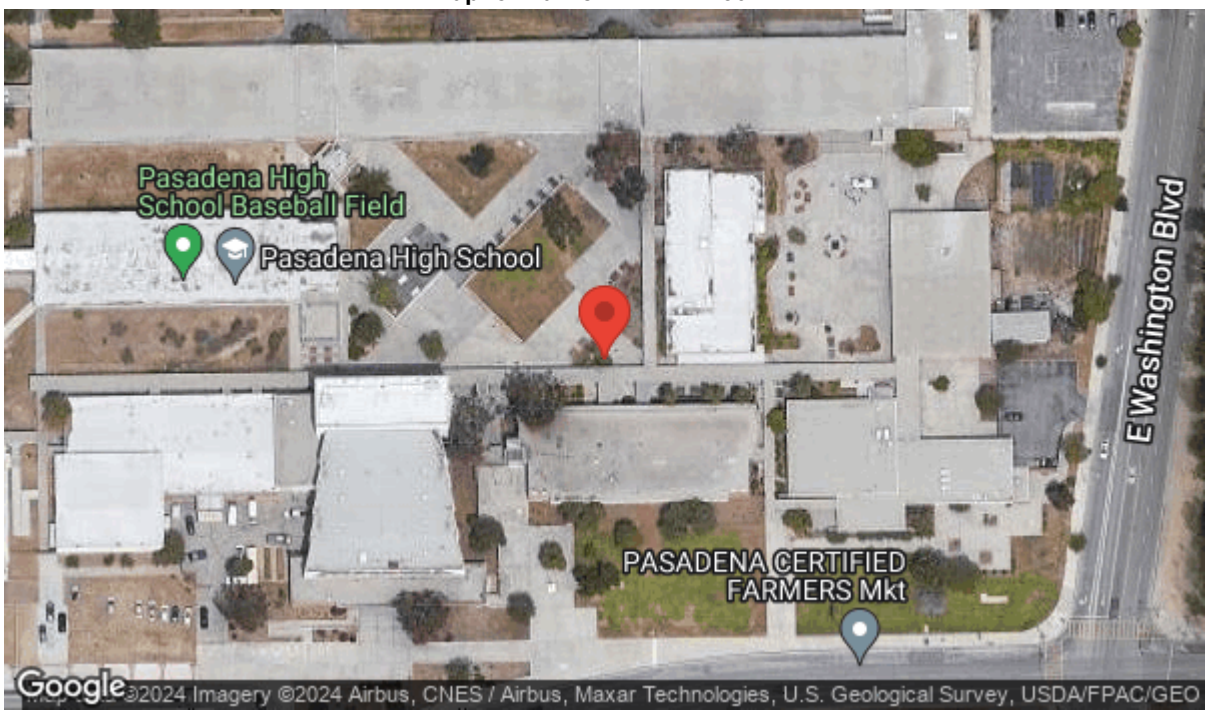

747 +34.162350, -118.091525

Photos for Barrier ID: AX424501

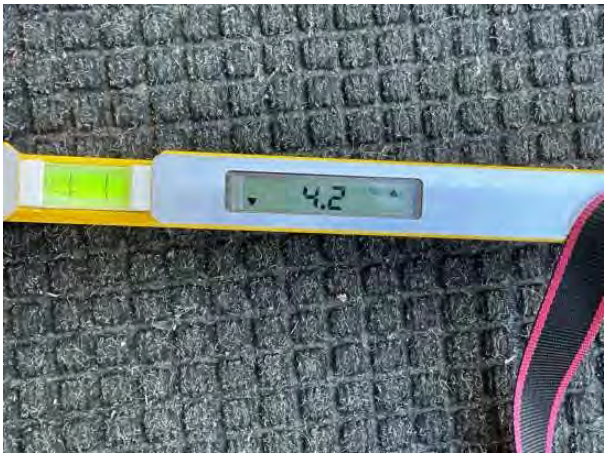

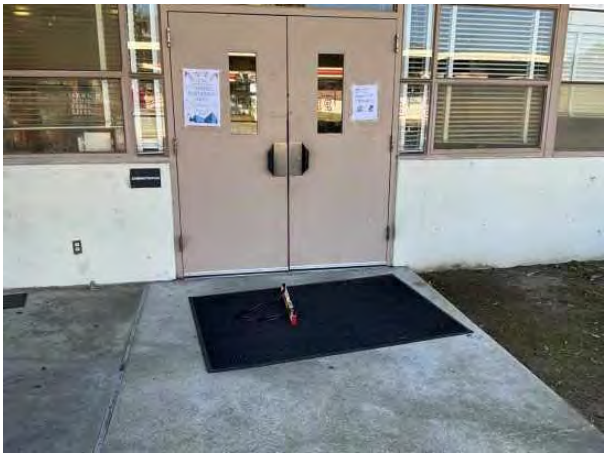

Barrier ID: AX418306

Pasadena High School BUILDING F

Assembly	Entrance to Building
Type	Building Entrance - Door
ADA Standard	CBC Chap 11B-404.2
Barrier Detail	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.
Location Description	Building F - Door Southeast Side
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door landing slopes, 3.1%.

Resolution


Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 24" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418306

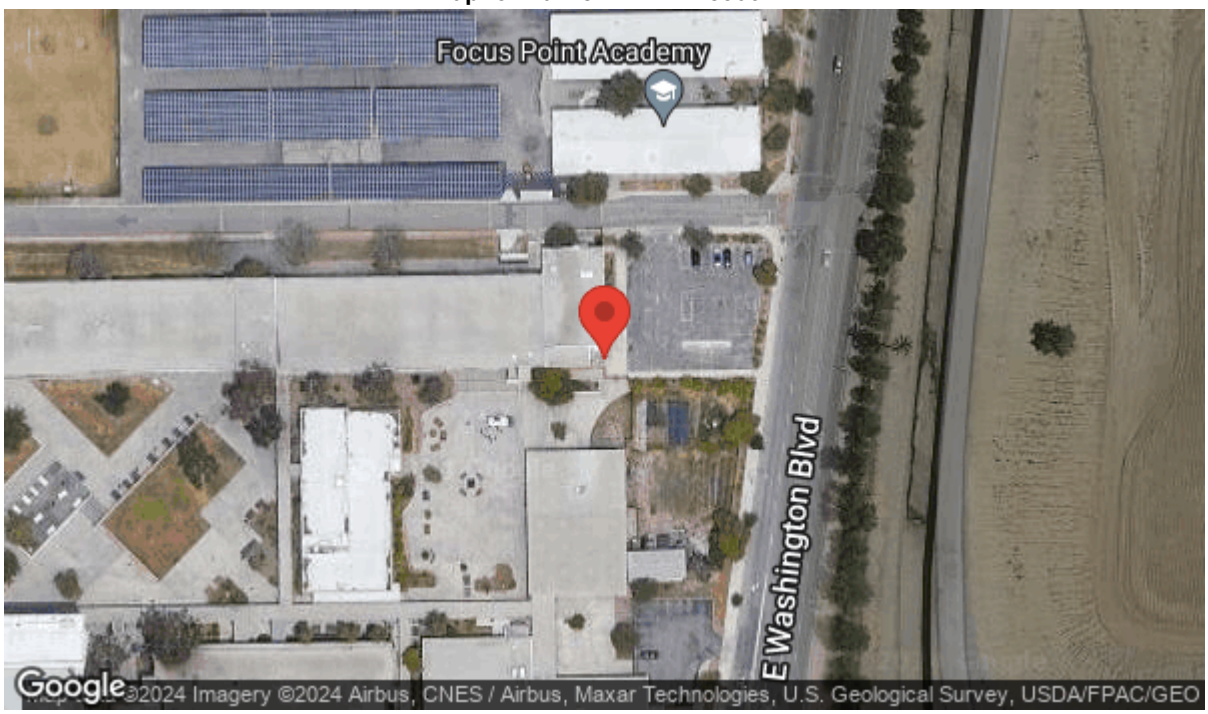

117 +34.162881, -118.090549

Photos for Barrier ID: AX418306



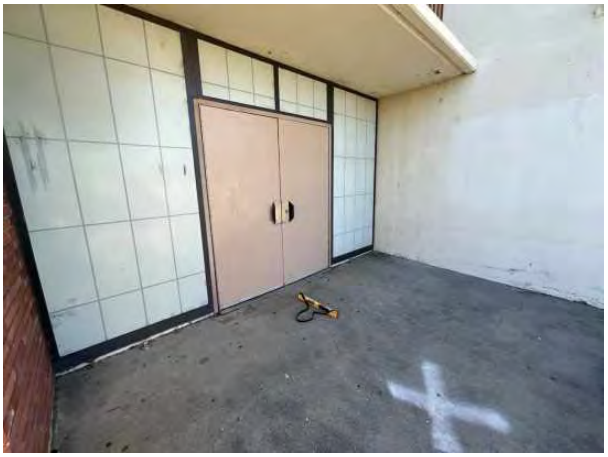

Barrier ID: AX418357

Pasadena High School BUILDING D

Assembly	Entrance to Building
Type	Building Entrance-Door
ADA Standard	CBC Chap 11B-404.2.4

Barrier Detail

CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.

Location Description	Building D - D101 Student Services
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door landing slopes, 6.7%.

Resolution

Remove and replace the surface within the required maneuvering clearance area so that the surface is level and clear with maximum slope 1:48 in any direction. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 24" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418357



168 +34.162289, -118.091250

Photos for Barrier ID: AX418357



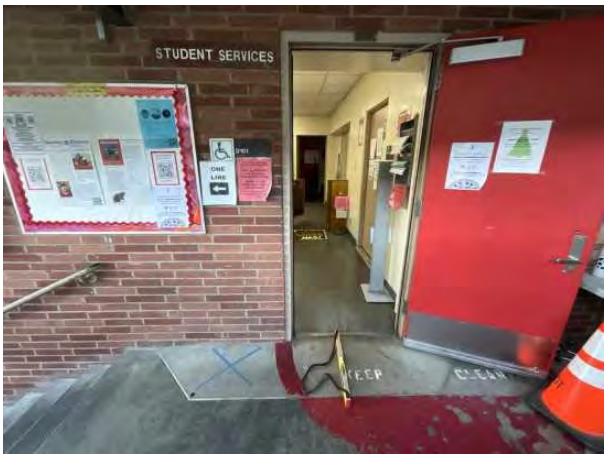

Barrier ID: AX418376

Pasadena High School BUILDING D

Assembly	Entrance to Building
Type	Building Entrance-Door
ADA Standard	CBC Chap 11B-404.2.4

Barrier Detail

CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.

Location Description	Building D - D102 Textbook Room
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door landing slopes, 4.6%.

Resolution

Remove and replace the surface within the required maneuvering clearance area so that the surface is level and clear with maximum slope 1:48 in any direction. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 24" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA


Priority	1

Map for Barrier ID: AX418376



187 +34.162289, -118.091250

Photos for Barrier ID: AX418376

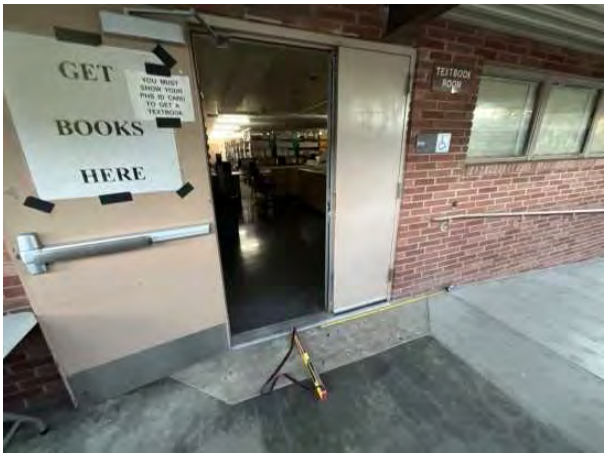



Barrier ID: AX424484

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Controls And Dispensers
ADA Standard	305
Barrier Detail	Clear space is not provided at the control or operating mechanism.
Location Description	Building A - A112 Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The furniture is obstructing the required 30 x 48 clear space in front of the hand dryer.

Resolution

Remove the furniture to provide compliant clear floor space at each control and operating mechanism that allows a forward or a parallel approach. The clear floor or ground space shall be 30" minimum by 48" minimum. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. For a forward approach, alcoves shall be 36" wide minimum where the depth exceeds 24". For a parallel approach, alcoves shall be 60" wide minimum where the depth exceeds 15". Floor or ground surfaces of a clear floor or ground space shall comply. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.]

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX424484

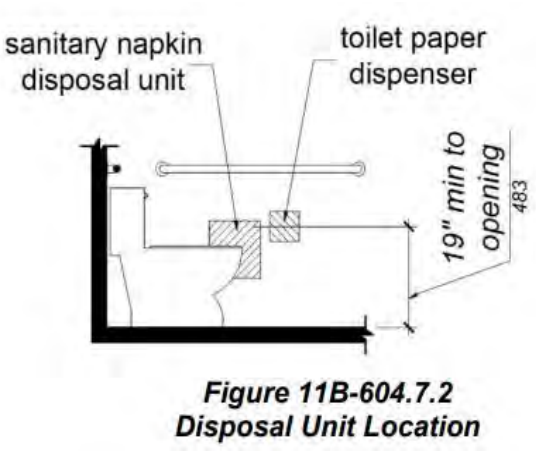


Figure 11B-604.7.2
Disposal Unit Location



Barrier ID: AX424414

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Controls And Dispensers
ADA Standard	305
Barrier Detail	Clear space is not provided at the control or operating mechanism.
Location Description	Building A - A255B Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The hand dryer, clear space is obstructed by the furniture.

Resolution


Remove the furniture to provide a compliant clear floor space at each control and operating mechanism that allows a forward or a parallel approach. The clear floor or ground space shall be 30" minimum by 48" minimum. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. For a forward approach, alcoves shall be 36" wide minimum where the depth exceeds 24". For a parallel approach, alcoves shall be 60" wide minimum where the depth exceeds 15". Floor or ground surfaces of a clear floor or ground space shall comply. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.]

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX424414

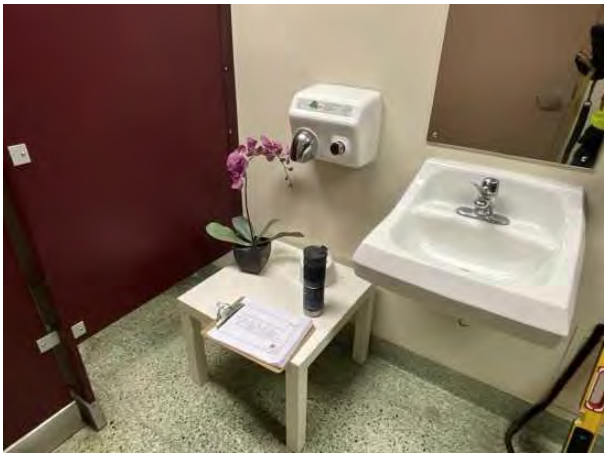

Barrier ID: AX424420

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Controls And Dispensers
ADA Standard	305
Barrier Detail	Clear space is not provided at the control or operating mechanism.
Location Description	Building A - A255C Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The furniture is obstructing the required 30 x 48 clear floor space in front of the hand dryer.

Resolution

Provide compliant clear floor space at each control and operating mechanism that allows a forward or a parallel approach. The clear floor or ground space shall be 30" minimum by 48" minimum. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. For a forward approach, alcoves shall be 36" wide minimum where the depth exceeds 24". For a parallel approach, alcoves shall be 60" wide minimum where the depth exceeds 15". Floor or ground surfaces of a clear floor or ground space shall comply. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.]

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX424420





Barrier ID: AX419739

Pasadena High School BUILDING H

Assembly	Interior Access Route
Type	Controls And Dispensers
ADA Standard	309.4
Barrier Detail	Controls throughout the common area are not compliant.
Location Description	Building H - Clasrooms With Hoods
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The hoods have controls up to 52 inches above the floor and require twisting of the wrist to operate.

Resolution

Provide controls and operating mechanisms that are operable with one hand and not require tight grasping, pinching or twisting of the wrist and do not require more than 5#s of pressure to operate. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.


Quantity

2 EA

Priority	1

Photos for Barrier ID: AX419739



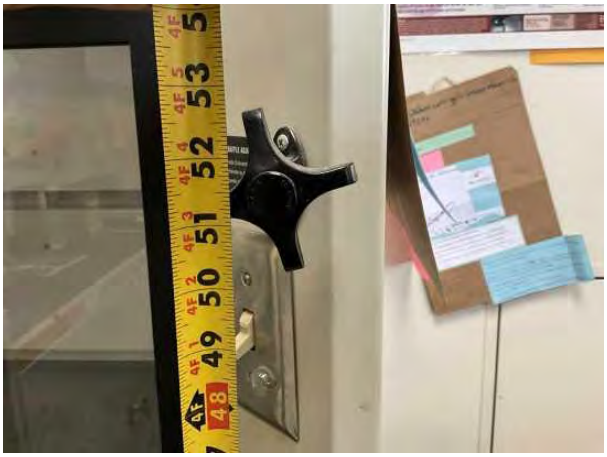



Barrier ID: AX419788

Pasadena High School BUILDING R

Assembly	Interior Access Route
Type	Controls And Dispensers
ADA Standard	305
Barrier Detail	Clear space is not provided at the control or operating mechanism.
Location Description	Building R - Restroom Women's R105A
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The seat cover dispenser does not provide a 30 x 48 clear space in front due to the water closet.

Resolution

Provide compliant clear floor space at each control and operating mechanism that allows a forward or a parallel approach. The clear floor or ground space shall be 30" minimum by 48" minimum. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. For a forward approach, alcoves shall be 36" wide minimum where the depth exceeds 24". For a parallel approach, alcoves shall be 60" wide minimum where the depth exceeds 15". Floor or ground surfaces of a clear floor or ground space shall comply. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.]

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX419788



Barrier ID: AX419887

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Controls And Dispensers
ADA Standard	305
Barrier Detail	Clear space is not provided at the control or operating mechanism.
Location Description	Building S - S109 Team Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The accessible lockers are not placed on an accessible route and do not provide the 30 x 48 clear space in front.

Resolution

Relocate the accessible lockers to provide compliant clear floor space at each control and operating mechanism that allows a forward or a parallel approach. The clear floor or ground space shall be 30" minimum by 48" minimum. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. For a forward approach, alcoves shall be 36" wide minimum where the depth exceeds 24". For a parallel approach, alcoves shall be 60" wide minimum where the depth exceeds 15". Floor or ground surfaces of a clear floor or ground space shall comply. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.]

Quantity

2 EA

Priority	1

Photos for Barrier ID: AX419887









Barrier ID: AX418682

Pasadena High School BUILDING W

Assembly	Interior Access Route
Type	Controls And Dispensers
ADA Standard	309.4
Barrier Detail	Controls throughout the common area are not compliant.
Location Description	Building W - W102
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

4 switches have knob type switch, requiring tight, grasping, pinching, and twisting of the wrist.

Resolution

Provide controls and operating mechanisms that are operable with one hand and not require tight grasping, pinching or twisting of the wrist and do not require more than 5#s of pressure to operate. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.

Quantity

4 EA

Priority	1

Photos for Barrier ID: AX418682





Barrier ID: AX418275

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Controls And Dispensers
ADA Standard	309.4
Barrier Detail	Controls throughout the common area are not compliant.
Location Description	Typical Non-Compliant Paper Towel Dispensers
Observed	Dec 3, 2023 by

Site Conditions

Typical paper towel dispensers provided throughout the campus require tight grasping, pinching, and twisting of the wrist to operate. Building A has 21. Building B has 4. Building C has 6. Building D has 4. Building E has 18. Building F has 4. Building G has 17. Building H has 22. Building I has 15. Building N has 2. Building P has 2. Building Q has 1. Building V has 2.

Resolution

Provide controls and operating mechanisms that are operable with one hand and not require tight grasping, pinching or twisting of the wrist and do not require more than 5#s of pressure to operate. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.

Quantity

118 EA

Priority	1

Photos for Barrier ID: AX418275













Barrier ID: AX418276

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Controls And Dispensers
ADA Standard	308
Barrier Detail	The height of controls throughout the common area are not compliant.
Location Description	Typical Paper Towel Dispensers Mounted Too High
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The paper towel dispensers mounted 50 to 59 inches above the floor. Building A has 8. Building C has 4. Building D has 1. Building E has 17. Building F has 2. Building G has 17. Building H has 19. Building I has 16. Building N has 3. Building P has 2. Building S has 1. Building V has 2.

Resolution

Remove and lower the element to a compliant reach range. Where a forward reach is unobstructed, the high forward reach shall be 48" maximum and the low forward reach shall be 15" minimum above the finish floor or ground. Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48" maximum where the reach depth is 20" maximum. Where the reach depth exceeds 20", the high forward reach shall be 44" maximum and the reach depth shall be 25" maximum. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48" maximum and the low side reach shall be 15" minimum above the finish floor or ground. [EXCEPTIONS: 1. An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10" maximum.] Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34" maximum and the depth of the obstruction shall be 24" maximum. The high side reach shall be 48" maximum for a reach depth of 10" maximum. Where the reach depth exceeds 10", the high side reach shall be 46" maximum for a reach depth of 24" maximum.

Quantity

92 EA

Priority	1

Photos for Barrier ID: AX418276
















breathe



Barrier ID: AX418205

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Curb Ramp
ADA Standard	California Building Code Chap 11B-406.5.8

Barrier Detail

CALIFORNIA: The counter slopes of adjoining gutters and streets within 24" of the curb ramp are greater than 1:20 (5%).

Location Description	Curb Ramp CR-1
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The curb ramp has a counter slope of 6.2%.

Resolution

Relocate the curb ramp where the counter slopes of the adjacent gutters and streets are maximum 1:20 (5%) for a distance of 24" from the bottom of the curb ramp. The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418205



16 +34.161596, -118.093367

Photos for Barrier ID: AX418205



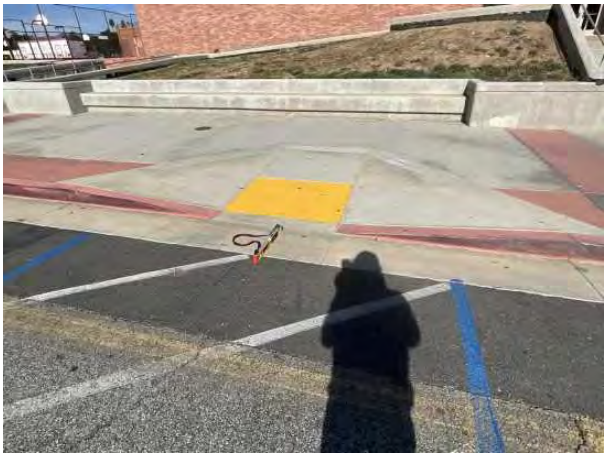

Barrier ID: AX418206

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Curb Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-406
Barrier Detail	CALIFORNIA: The curb ramp has non-compliant slopes.
Location Description	Curb Ramp CR-1
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The curb ramp has a running slope of 9.1% and the top landing slopes 2.9%.

Resolution

The curb ramp should be removed and an accessible curb ramp should be installed. Curb ramp runs shall have a running slope not steeper than 1:12 (8.3%). Cross slopes shall not be steeper than 1:48 (2.08%). Where flares are provided, flare slopes shall be no greater than 1:10 (10%).

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418206




17 +34.161619, -118.093360

Photos for Barrier ID: AX418206







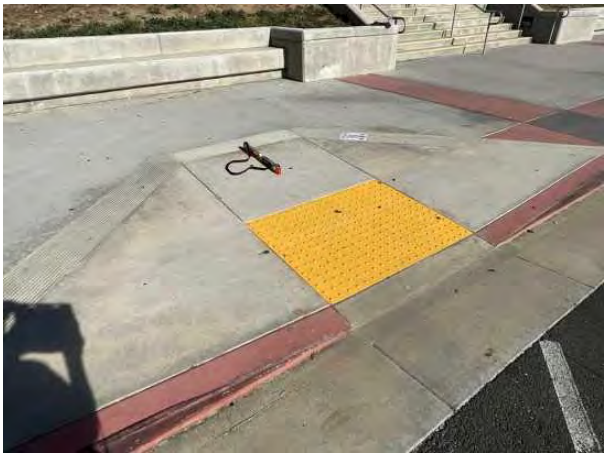

Barrier ID: AX418207

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Curb Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-406
Barrier Detail	CALIFORNIA: The curb ramp has non-compliant slopes.
Location Description	Curb Ramp CR-2
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The curb ramp has a running slope of 8.8%.

Resolution

The curb ramp should be removed and an accessible curb ramp should be installed. Curb ramp runs shall have a running slope not steeper than 1:12 (8.3%). Cross slopes shall not be steeper than 1:48 (2.08%). Where flares are provided, flare slopes shall be no greater than 1:10 (10%).

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418207



18 +34.161615, -118.093201

Photos for Barrier ID: AX418207



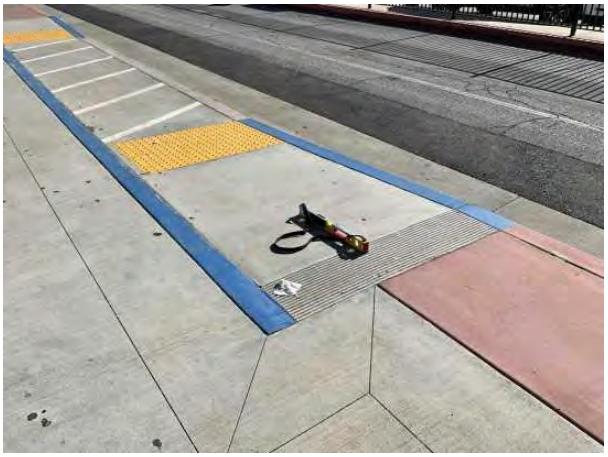

Barrier ID: AX418208

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Curb Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-406
Barrier Detail	CALIFORNIA: The curb ramp has non-compliant slopes.
Location Description	Curb Ramp CR-2
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The curb ramp has a counter slope of 5.9%.

Resolution

The curb ramp should be removed and an accessible curb ramp should be installed. Curb ramp runs shall have a running slope not steeper than 1:12 (8.3%). Cross slopes shall not be steeper than 1:48 (2.08%). Where flares are provided, flare slopes shall be no greater than 1:10 (10%).

Quantity

1 EA


Priority	1

Map for Barrier ID: AX418208



19 +34.161608, -118.093143

Photos for Barrier ID: AX418208

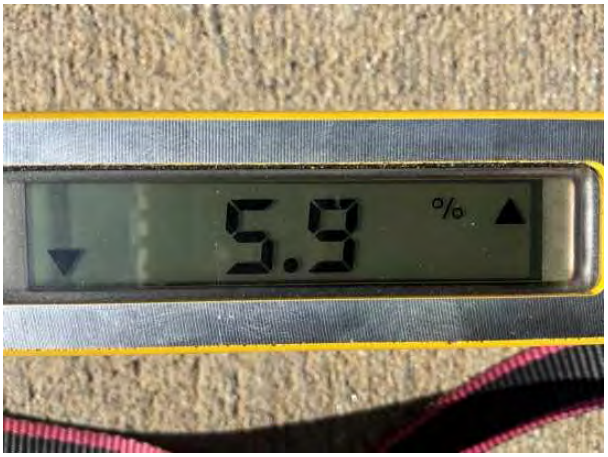



Barrier ID: AX418218

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Curb Ramp
ADA Standard	California Building Code Chap 11B-406.5.8

Barrier Detail

CALIFORNIA: The counter slopes of adjoining gutters and streets within 24" of the curb ramp are greater than 1:20 (5%).

Location Description	Curb Ramp CR-3
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The curb ramp has a counter slope of 8.4%.

Resolution

Relocate the curb ramp where the counter slopes of the adjacent gutters and streets are maximum 1:20 (5%) for a distance of 24" from the bottom of the curb ramp. The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418218



29 +34.161622, -118.092960

Photos for Barrier ID: AX418218





Barrier ID: AX418219

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Curb Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-406
Barrier Detail	CALIFORNIA: The curb ramp has non-compliant slopes.
Location Description	Curb Ramp CR-3
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The curb ramp has a running slope, 9.6%.

Resolution


The curb ramp should be removed and an accessible curb ramp should be installed. Curb ramp runs shall have a running slope not steeper than 1:12 (8.3%). Cross slopes shall not be steeper than 1:48 (2.08%). Where flares are provided, flare slopes shall be no greater than 1:10 (10%).

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418219

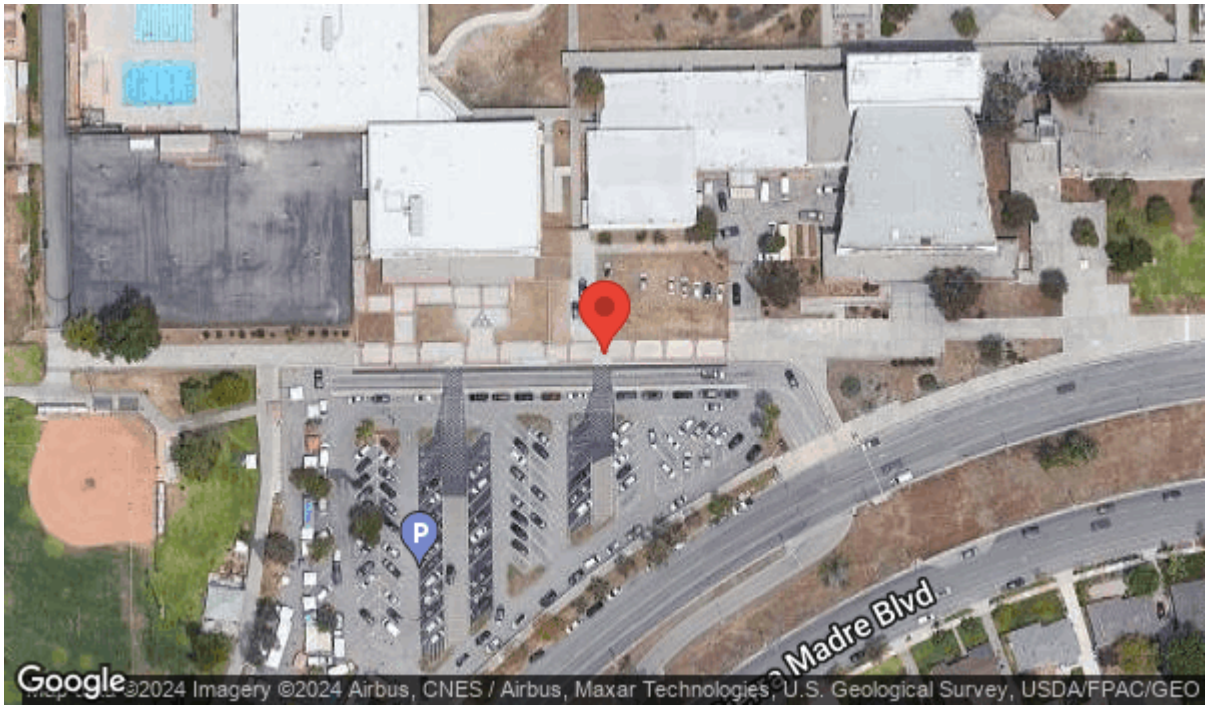

30 +34.161643, -118.092955

Photos for Barrier ID: AX418219



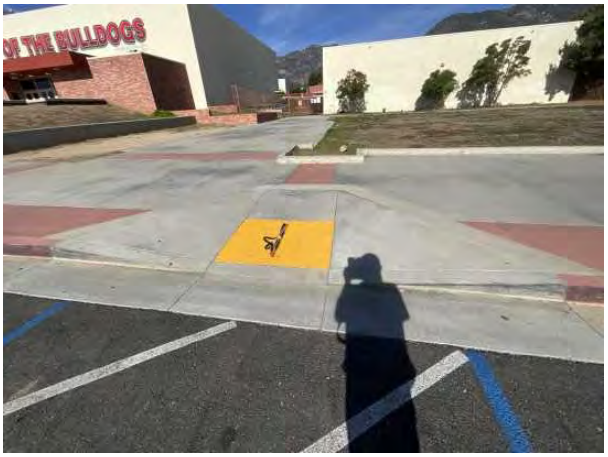

Barrier ID: AX418333

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Curb Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-406
Barrier Detail	CALIFORNIA: The curb ramp has non-compliant slopes.
Location Description	Curb Ramp CR-4
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The curb ramp has a running slope of 9.4%.

Resolution


The curb ramp should be removed and an accessible curb ramp should be installed. Curb ramp runs shall have a running slope not steeper than 1:12 (8.3%). Cross slopes shall not be steeper than 1:48 (2.08%). Where flares are provided, flare slopes shall be no greater than 1:10 (10%).

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418333

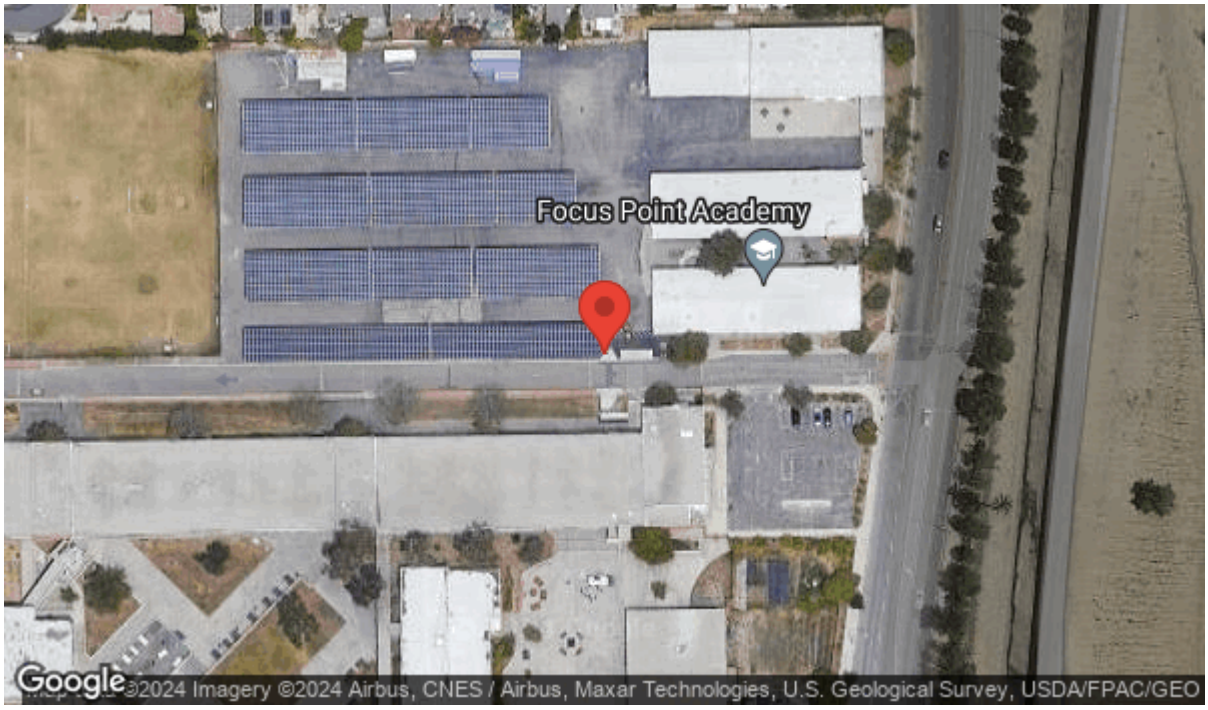

144 +34.163244, -118.090817

Photos for Barrier ID: AX418333





Barrier ID: AX418334

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Curb Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-406
Barrier Detail	CALIFORNIA: The curb ramp has non-compliant slopes.
Location Description	Curb Ramp CR-5
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The curb ramp has a running slope, 9.2% and the flares slope up to 12.8%.

Resolution

The curb ramp should be removed and an accessible curb ramp should be installed. Curb ramp runs shall have a running slope not steeper than 1:12 (8.3%). Cross slopes shall not be steeper than 1:48 (2.08%). Where flares are provided, flare slopes shall be no greater than 1:10 (10%).

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418334



145 +34.163159, -118.090812

Photos for Barrier ID: AX418334













Barrier ID: AX418352

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Curb Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-406
Barrier Detail	CALIFORNIA: The curb ramp is non-compliant.
Location Description	Curb Ramp CR-6
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The curb ramp does not provide a compliant design. The curb ramp does not provide a level top landing and has cross slopes up to 6.2%.

Resolution


Install a compliant curb ramp. Curb ramps may be perpendicular, parallel, or a combination of perpendicular and parallel. The running slope of parallel curb ramp segments shall be in-line with the direction of sidewalk travel. Curb ramp runs shall have a running slope not steeper than 1:12 (8.3%). Cross slopes shall not be steeper than 1:48 (2.08%). Where flares are provided, flare slopes shall be no greater than 1:10 (10%). A turning space 48 inches minimum by 48 inches minimum shall be provided at the bottom of a parallel curb ramp. The slope of the turning space in all directions shall be 1:48 (2.08%) maximum. Curb ramps and the flared sides of curb ramps shall be located so that they do not project into vehicular traffic lanes, parking spaces, or parking access aisles. The clear width of curb ramp runs (excluding any flared sides) and turning spaces shall be 48 inches minimum. Landings shall be provided at the tops of curb ramp runs. The landing clear length shall be 48 inches minimum. The landing clear width shall be at least as wide as the curb ramp, excluding any flared sides. The slope of the landing in all directions shall be 1:48 maximum. [Exception: Top landings are not required at parallel curb ramp runs.] [Advisory 11B-406.5.3 Landings. A level landing, 48 inches deep and at least as wide as the curb ramp, is required at the top of a curb ramp. The landing provides an area for users to exit the curb ramp and proceed along the walking surface at the top of the curb ramp. Some designs have been proposed that reduce or omit the level top landing by providing a curb ramp with flared sides of 1:12 or less. This design is not compliant with the building code and may result in a condition where a wheelchair user cannot safely turn and proceed along the intersecting walk. Exterior walks and sidewalks shall be 48 inches wide minimum with a cross-slope of 1:48 or less. Reducing or omitting the top landing of the curb ramp may result in a substandard walk width and/or a walk with a cross-slope in excess of 1:48.] Ground surfaces of curb ramps shall be firm, stable, and slip resistant. Changes in level other than the running slope and cross slope are not permitted on ramp runs. Landings subject to wet conditions shall be designed to prevent the accumulation of water. Grade breaks at the top and bottom of curb ramp runs shall be perpendicular to the direction of the ramp run. Grade breaks shall not be permitted on the surface of ramp runs and turning spaces. Surface slopes that meet at grade breaks shall be flush. Counter slopes of adjoining gutters and road surfaces immediately adjacent to and within 24 inches of the curb ramp shall not be steeper than 1:20. The adjacent surfaces at transitions at curb ramps to walks, gutters, and streets shall be at the same level. The bottom of diagonal curb ramps shall have a clear space 48 inches minimum outside active traffic lanes of the roadway. Curb ramps at marked crossings shall be wholly contained within the markings, excluding any flared sides. Diagonal curb ramps provided at marked crossings shall provide the 48 inches minimum clear space within the markings. Diagonal or corner type curb ramps with returned curbs or other well-defined edges shall have the edges parallel to the direction of pedestrian flow. Diagonal curb ramps with flared sides shall have a segment of curb 24 inches long minimum located on each side of the curb ramp and within the marked crossing. Curb ramps shall have detectable warnings. Detectable warnings at curb ramps shall extend 36 inches in the direction of travel. Detectable warnings shall extend the full width of the ramp run less 2 inches maximum on each side, excluding any flared sides. Detectable warnings shall be located so the edge nearest the curb is 6 inches minimum and 8 inches maximum from the line at the face of the curb marking the transition between the curb and the gutter, street or highway. [Exception: On parallel curb ramps, detectable warnings shall be placed on the turning space at the flush transition between the street and sidewalk. Detectable warnings shall extend the full width of the turning space at the flush transition between the street and the sidewalk less 2 inches maximum on each side.] Detectable warnings shall consist of a surface of truncated domes. Truncated domes in a detectable warning surface shall have a base diameter of 0.9 inch minimum and 0.92 inch maximum, a top diameter of 0.45 inch minimum and 0.47 inch maximum, and a height of 0.2 inch. Truncated domes in a detectable warning surface shall have a center-to-center spacing of 2.3 inches minimum and 2.4 inches maximum, and a base-to-base spacing of 0.65 inch minimum, measured between the most adjacent domes on a square grid. [Exception: Where installed in a radial pattern, truncated domes shall have a center-to-center spacing of 1.6 inches minimum to 2.4 inches maximum.] Detectable warning material used to provide visual contrast shall be an integral part of the surface. Detectable warning surfaces shall be yellow and approximate FS 33538 of Federal Standard 595C OR detectable warning surfaces shall provide a 70 percent minimum visual contrast with adjacent walking surfaces. Contrast in percent shall be determined by: Contrast percent = [(B1-B2)/B1] x 100 where B1 = light reflectance value (LRV) of the lighter area and B2 = light reflectance value (LRV) of the darker area. [Exception: Where the detectable warning surface does not provide a 70 percent minimum contrast with adjacent walking surfaces, a 1 inch wide minimum visually contrasting surface shall separate the detectable warning from adjacent walking surfaces. The visually contrasting surface shall contrast with both the detectable warning and adjacent walking surfaces either light-on-dark, or dark-on-light.]

Quantity

1 EA

Priority 1

Map for Barrier ID: AX418352

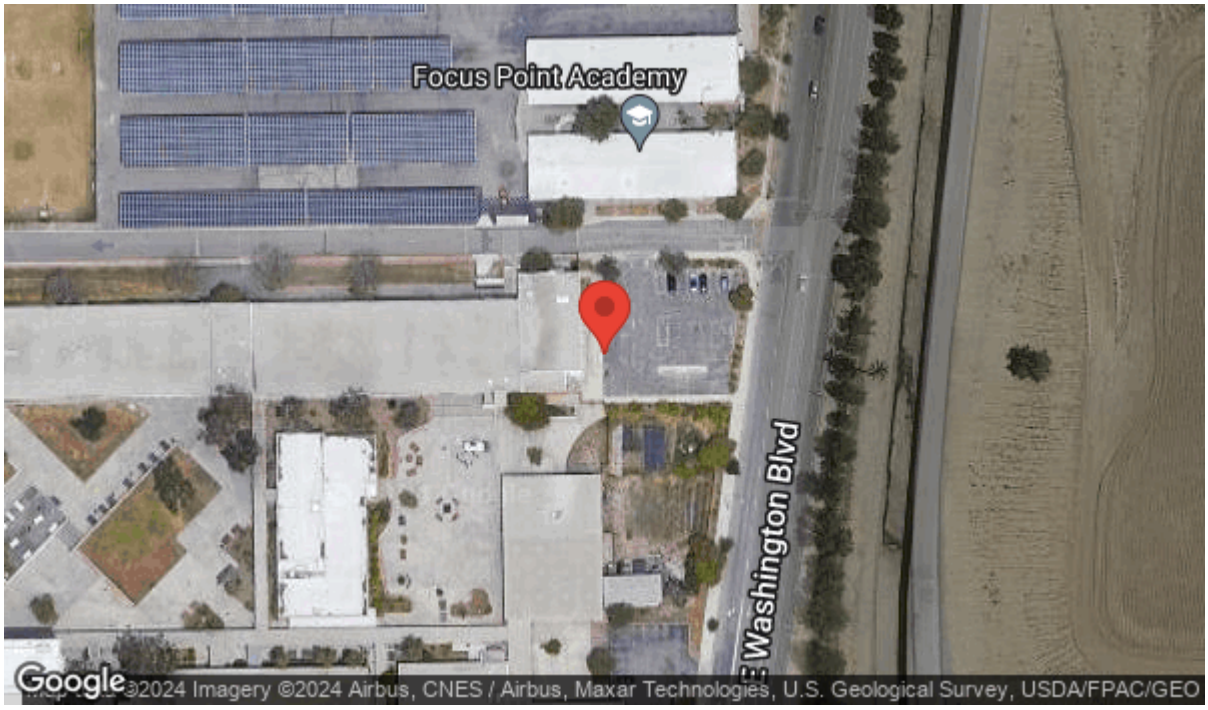

163 +34.162946, -118.090486

Photos for Barrier ID: AX418352

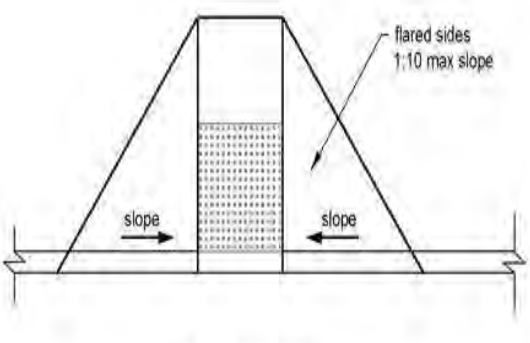


Figure 11B-406.2.2
Sides of Curb Ramps

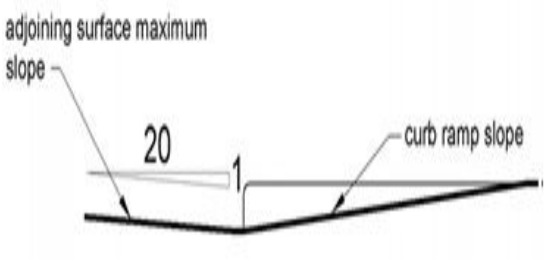


Figure 11B-406.5.8
Counter Slope of Surfaces Adjacent to Curb Ramps



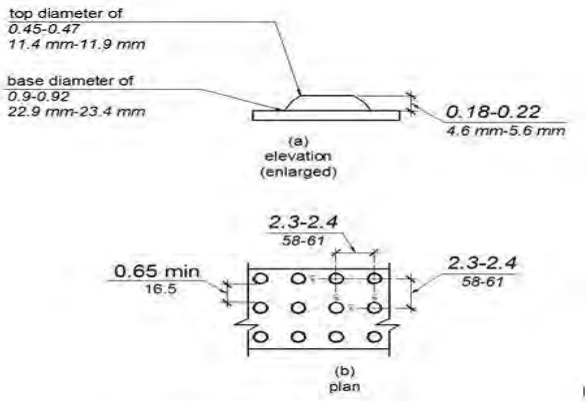


Figure 11B-705.1
Size and Spacing of Truncated Domes

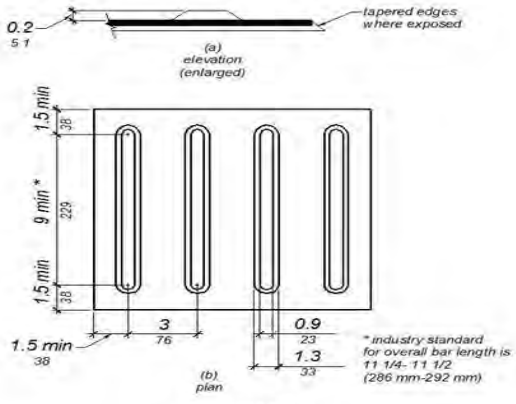


Figure 11B-705.2
Detectable Directional Texture

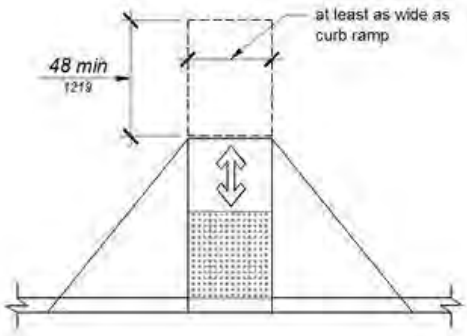
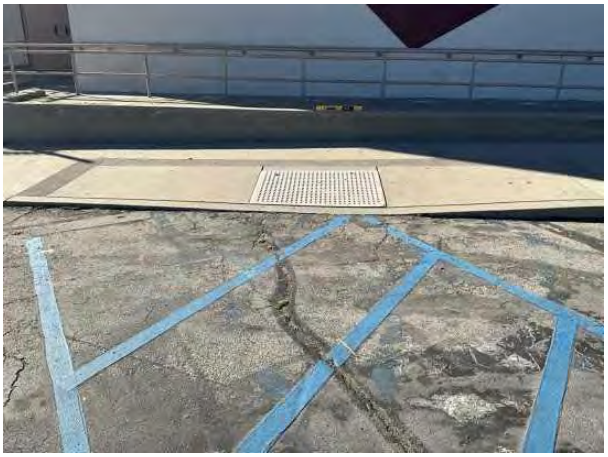
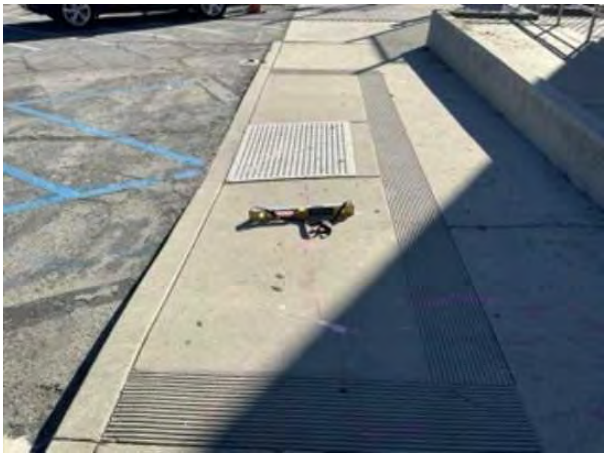


Figure 11B-406.5.3
Landings at the Top of Curb Ramps









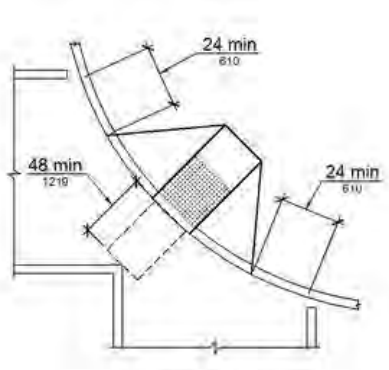


Figure *11B-406.5.10*
Diagonal or Corner Type Curb Ramps



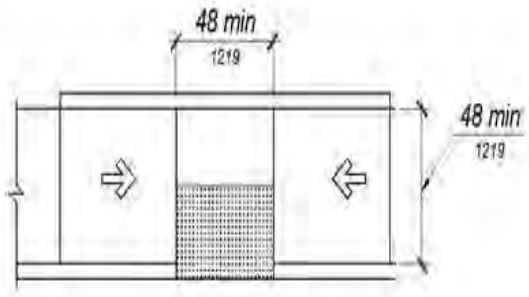


Figure 11B-406.3.2
Parallel Curb Ramps

Barrier ID: AX418353

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Curb Ramp
ADA Standard	California Building Code Chap 11B-406.5.2, 705.1.2

Barrier Detail

CALIFORNIA: The parallel curb ramp does not have a compliant detectable warning on the landing at the bottom of the curb ramp.

Location Description	Curb Ramp CR-6, CR-7
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The detectable warning domes are not compliant. The center to center dome spacing is 1 3/4 inches.

Resolution


Install a detectable warning on the bottom landing of the parallel curb ramp. A detectable warning for a parallel curb ramp shall be installed on the landing/turning space which is flush with transition between street and sidewalk. A parallel curb ramp shall have a landing at the bottom of the curb ramp run which is 48" min. wide x 48" min. deep with max. slope 1:48 (2.08%). The landing shall be flush with the transition between street and sidewalk. For parallel curb ramps, the detectable warning shall extend the full width of the turning space at the flush transition between the street and sidewalk less max. 2" on each side, and extend 36" in the direction of the path of travel. The edge of the detectable warning shall be 6" min.-8" max. from the line at the face of the curb ramp marking the transition between the curb and the gutter/street. The material used for contrast for a detectable warning shall be an integral part of the walking surface material. The compliant detectable warning shall have truncated domes. The truncated domes shall have center to center spacing of 2.3" min. and 2.4" max. between the domes, and base to base spacing 65" min. measured between the most adjacent domes on a square grid. [EXCEPTION: Where domes are in radial pattern, the center to center spacing may be 1.6" min-2.4" max.] Truncated domes shall have center to center spacing of 2.3" min. and 2.4" max. between the domes.[EXCEPTION: Where domes are in radial pattern, the center to center spacing may be 1.6" min-2.4" max.] The domes shall measure: base diameter 0.9" min. to 0.92" max., top diameter 0.45" min. to 0.47" max., and ht. 0.18" min. to 0.22" max. The detectable warning shall be yellow and approximate color FS33538 of Federal Standard 595C OR provide 70% minimum visual contrast of light-on-dark or dark-on-light. Contrast in % is determined by CONTRAST %= [(B1-B2)/B1] x100, where B1= Light Reflectance Value (LRV) of the lighter area, and B2=LRV of the darker area. [EXCEPTION: If 70% visual contrast is not provided, a min. 1" wide minimally visually contrasting strip shall separate the yellow detectable warning and the adjacent walking surface. The minimally visually contrasting surface shall contrast both with the detectable warning and the adjacent surface either dark-on-light or light-on-dark.]

Quantity

2 EA

Priority	1

Map for Barrier ID: AX418353

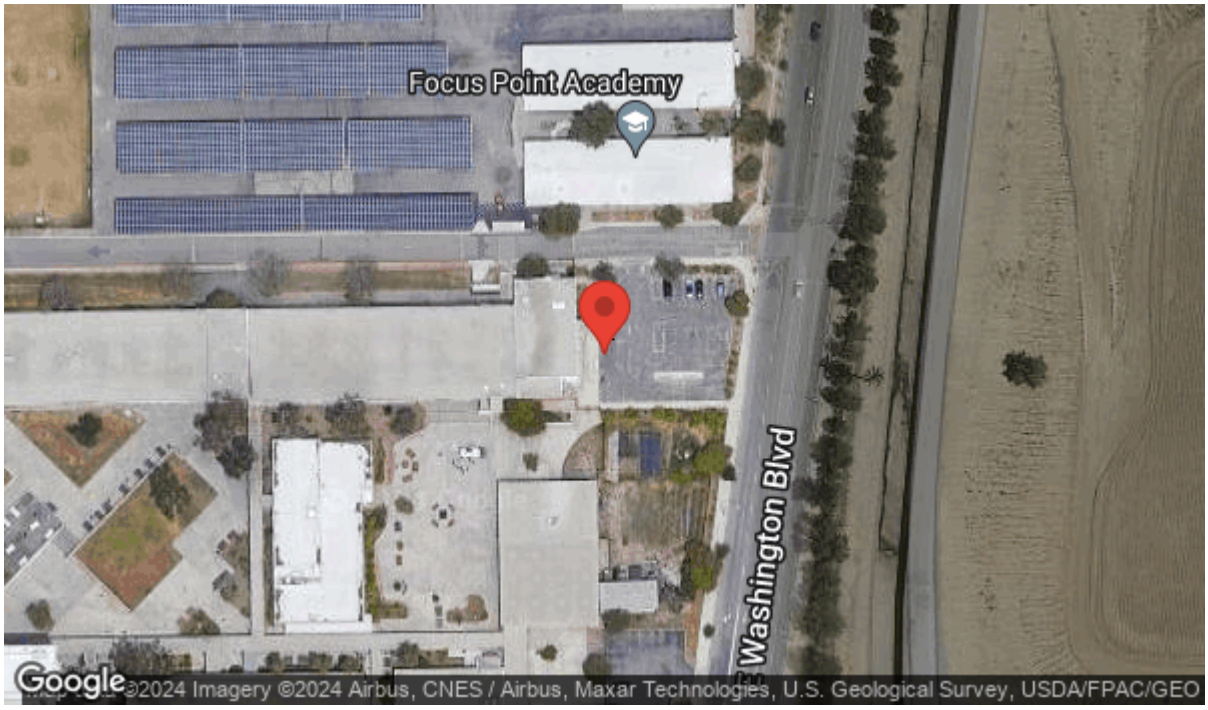

164 +34.162959, -118.090475

Photos for Barrier ID: AX418353







Barrier ID: AX418354

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Curb Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-406
Barrier Detail	CALIFORNIA: The curb ramp is non-compliant.
Location Description	Curb Ramp CR-7
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The curb ramp has a running slope of 9.2% and does not provide a compliant design. The curb ramp has cross slopes up to 6.5%.

Resolution


Install a compliant curb ramp. Curb ramps may be perpendicular, parallel, or a combination of perpendicular and parallel. The running slope of parallel curb ramp segments shall be in-line with the direction of sidewalk travel. Curb ramp runs shall have a running slope not steeper than 1:12 (8.3%). Cross slopes shall not be steeper than 1:48 (2.08%). Where flares are provided, flare slopes shall be no greater than 1:10 (10%). A turning space 48 inches minimum by 48 inches minimum shall be provided at the bottom of a parallel curb ramp. The slope of the turning space in all directions shall be 1:48 (2.08%) maximum. Curb ramps and the flared sides of curb ramps shall be located so that they do not project into vehicular traffic lanes, parking spaces, or parking access aisles. The clear width of curb ramp runs (excluding any flared sides) and turning spaces shall be 48 inches minimum. Landings shall be provided at the tops of curb ramp runs. The landing clear length shall be 48 inches minimum. The landing clear width shall be at least as wide as the curb ramp, excluding any flared sides. The slope of the landing in all directions shall be 1:48 maximum. [Exception: Top landings are not required at parallel curb ramp runs.] [Advisory 11B-406.5.3 Landings. A level landing, 48 inches deep and at least as wide as the curb ramp, is required at the top of a curb ramp. The landing provides an area for users to exit the curb ramp and proceed along the walking surface at the top of the curb ramp. Some designs have been proposed that reduce or omit the level top landing by providing a curb ramp with flared sides of 1:12 or less. This design is not compliant with the building code and may result in a condition where a wheelchair user cannot safely turn and proceed along the intersecting walk. Exterior walks and sidewalks shall be 48 inches wide minimum with a cross-slope of 1:48 or less. Reducing or omitting the top landing of the curb ramp may result in a substandard walk width and/or a walk with a cross-slope in excess of 1:48.] Ground surfaces of curb ramps shall be firm, stable, and slip resistant. Changes in level other than the running slope and cross slope are not permitted on ramp runs. Landings subject to wet conditions shall be designed to prevent the accumulation of water. Grade breaks at the top and bottom of curb ramp runs shall be perpendicular to the direction of the ramp run. Grade breaks shall not be permitted on the surface of ramp runs and turning spaces. Surface slopes that meet at grade breaks shall be flush. Counter slopes of adjoining gutters and road surfaces immediately adjacent to and within 24 inches of the curb ramp shall not be steeper than 1:20. The adjacent surfaces at transitions at curb ramps to walks, gutters, and streets shall be at the same level. The bottom of diagonal curb ramps shall have a clear space 48 inches minimum outside active traffic lanes of the roadway. Curb ramps at marked crossings shall be wholly contained within the markings, excluding any flared sides. Diagonal curb ramps provided at marked crossings shall provide the 48 inches minimum clear space within the markings. Diagonal or corner type curb ramps with returned curbs or other well-defined edges shall have the edges parallel to the direction of pedestrian flow. Diagonal curb ramps with flared sides shall have a segment of curb 24 inches long minimum located on each side of the curb ramp and within the marked crossing. Curb ramps shall have detectable warnings. Detectable warnings at curb ramps shall extend 36 inches in the direction of travel. Detectable warnings shall extend the full width of the ramp run less 2 inches maximum on each side, excluding any flared sides. Detectable warnings shall be located so the edge nearest the curb is 6 inches minimum and 8 inches maximum from the line at the face of the curb marking the transition between the curb and the gutter, street or highway. [Exception: On parallel curb ramps, detectable warnings shall be placed on the turning space at the flush transition between the street and sidewalk. Detectable warnings shall extend the full width of the turning space at the flush transition between the street and the sidewalk less 2 inches maximum on each side.] Detectable warnings shall consist of a surface of truncated domes. Truncated domes in a detectable warning surface shall have a base diameter of 0.9 inch minimum and 0.92 inch maximum, a top diameter of 0.45 inch minimum and 0.47 inch maximum, and a height of 0.2 inch. Truncated domes in a detectable warning surface shall have a center-to-center spacing of 2.3 inches minimum and 2.4 inches maximum, and a base-to-base spacing of 0.65 inch minimum, measured between the most adjacent domes on a square grid. [Exception: Where installed in a radial pattern, truncated domes shall have a center-to-center spacing of 1.6 inches minimum to 2.4 inches maximum.] Detectable warning material used to provide visual contrast shall be an integral part of the surface. Detectable warning surfaces shall be yellow and approximate FS 33538 of Federal Standard 595C OR detectable warning surfaces shall provide a 70 percent minimum visual contrast with adjacent walking surfaces. Contrast in percent shall be determined by: Contrast percent = [(B1-B2)/B1] x 100 where B1 = light reflectance value (LRV) of the lighter area and B2 = light reflectance value (LRV) of the darker area. [Exception: Where the detectable warning surface does not provide a 70 percent minimum contrast with adjacent walking surfaces, a 1 inch wide minimum visually contrasting surface shall separate the detectable warning from adjacent walking surfaces. The visually contrasting surface shall contrast with both the detectable warning and adjacent walking surfaces either light-on-dark, or dark-on-light.]

Quantity

1 EA

Priority 1

Map for Barrier ID: AX418354

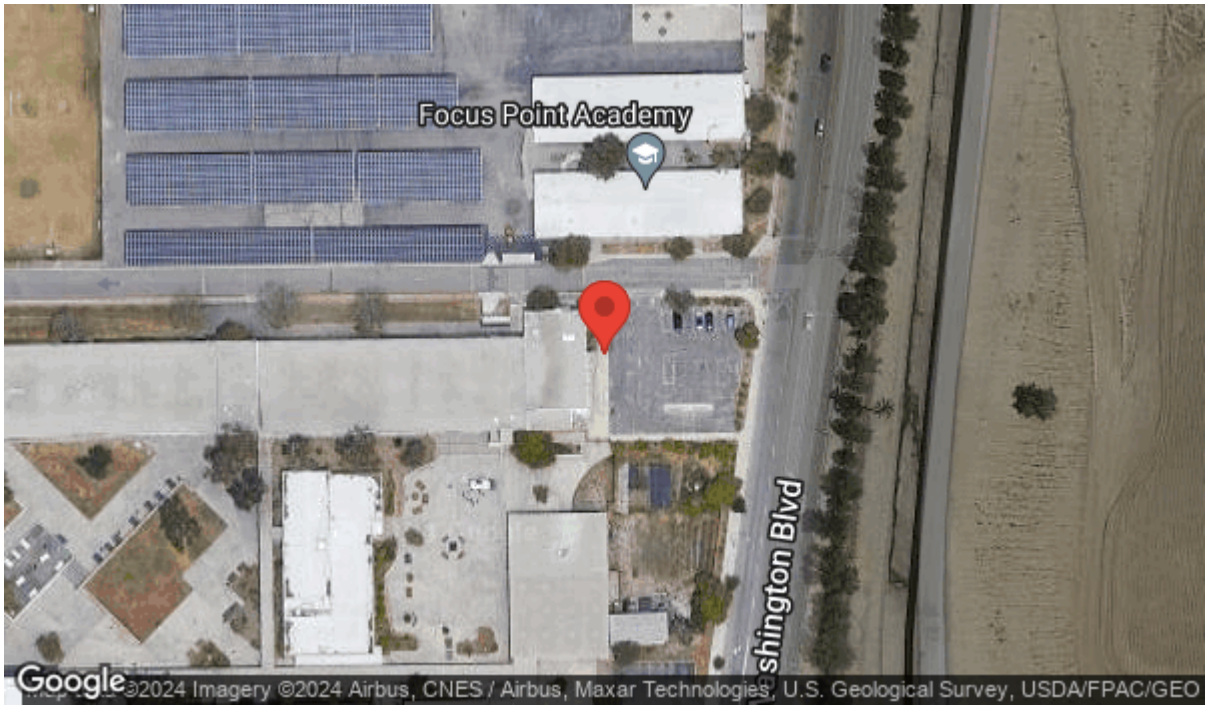

165 +34.163028, -118.090504

Photos for Barrier ID: AX418354

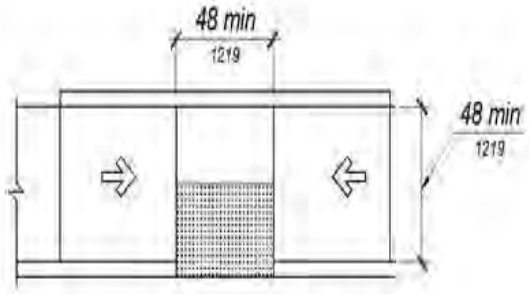


Figure 11B-406.3.2
Parallel Curb Ramps

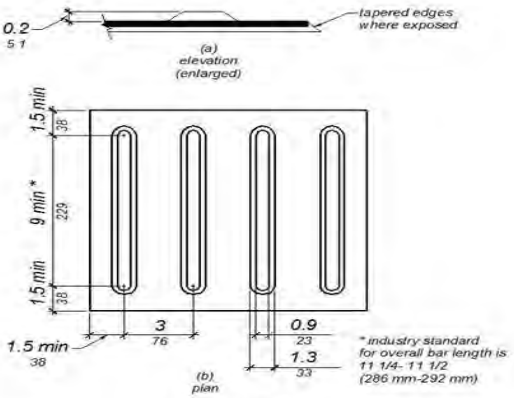


Figure 11B-705.2
Detectable Directional Texture

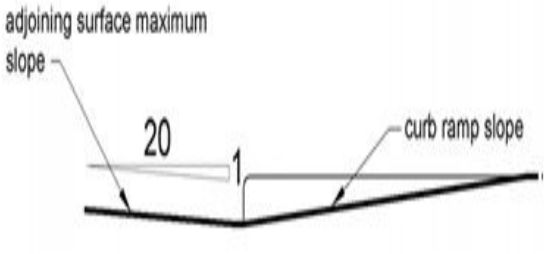


Figure 11B-406.5.8
Counter Slope of Surfaces Adjacent to Curb Ramps





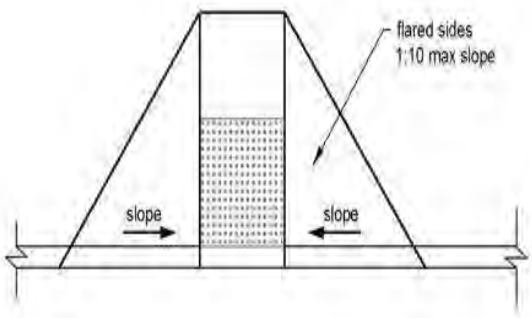
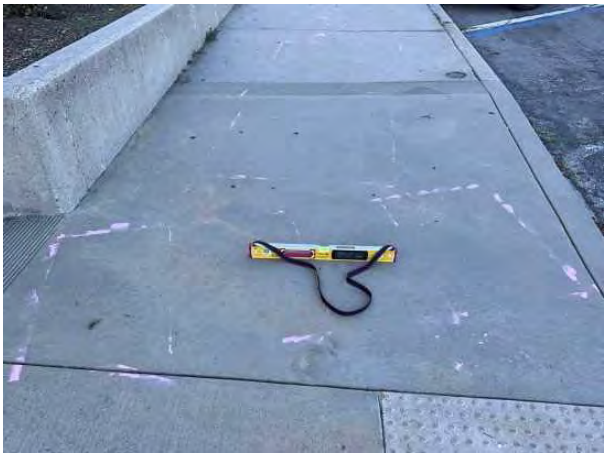


Figure 11B-406.2.2
Sides of Curb Ramps





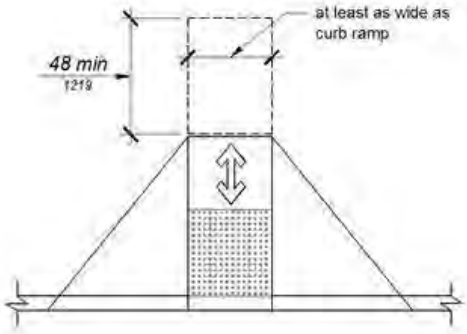


Figure *11B-406.5.3*
Landings at the Top of Curb Ramps



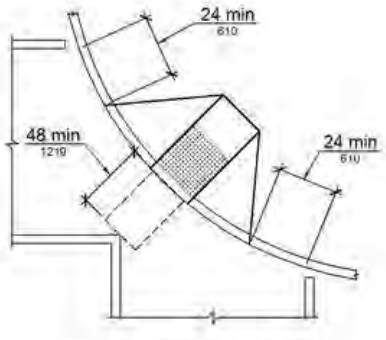


Figure *11B-406.5.10*
Diagonal or Corner Type Curb Ramps

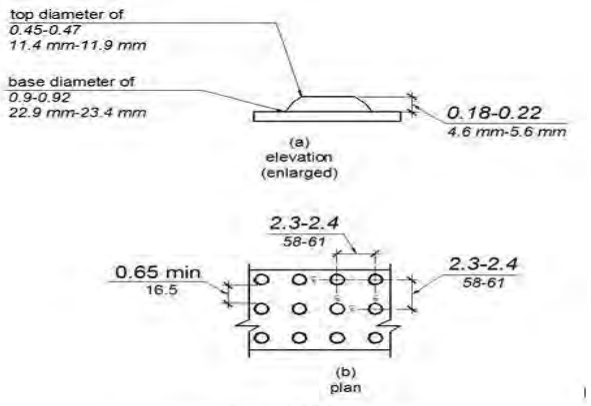


Figure *11B-705.1*
Size and Spacing of Truncated Domes



Barrier ID: AX418232

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Door
ADA Standard	307.4, 404.2.3
Barrier Detail	The door has less than 32" clear width.
Location Description	Auditorium East Exit Doors
Observed	Dec 10, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door leafs provide a 28 1/2 inch clear width.

Resolution

Remove and replace with a door that has a minimum clear opening of 32". Door openings shall provide a clear width of 32" minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24" deep shall provide a clear opening of 36" minimum. There shall be no projections into the required clear opening width lower than 34" above the finish floor or ground. Projections into the clear opening width between 34" and 80" above the finish floor or ground shall not exceed 4". [EXCEPTIONS: 1. In alterations, a projection of 5/8" maximum into the required clear width shall be permitted for the latch side stop. 2. Door closers and door stops shall be permitted to be 78" minimum above the finish floor or ground.]


Quantity

4 EA

Priority	1

Photos for Barrier ID: AX418232



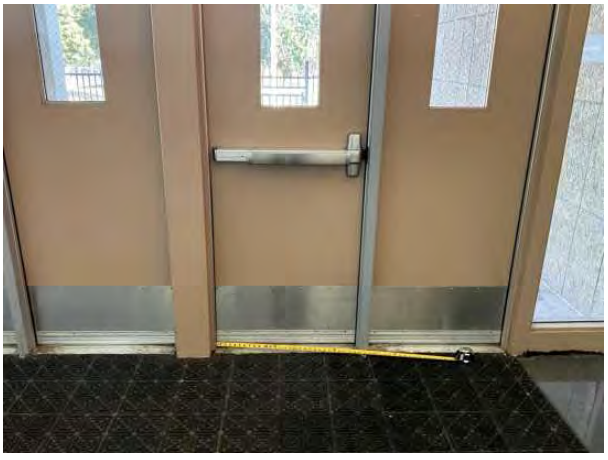

Barrier ID: AX418264

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Door
ADA Standard	307.4, 404.2.3
Barrier Detail	The door has less than 32" clear width.
Location Description	Auditorium Northeast Doors
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	Two doors do not a full 90°

Resolution


Remove and replace with a door that has a minimum clear opening of 32". Door openings shall provide a clear width of 32" minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24" deep shall provide a clear opening of 36" minimum. There shall be no projections into the required clear opening width lower than 34" above the finish floor or ground. Projections into the clear opening width between 34" and 80" above the finish floor or ground shall not exceed 4". [EXCEPTIONS: 1. In alterations, a projection of 5/8" maximum into the required clear width shall be permitted for the latch side stop. 2. Door closers and door stops shall be permitted to be 78" minimum above the finish floor or ground.]

Quantity

4 EA

Priority	1

Photos for Barrier ID: AX418264

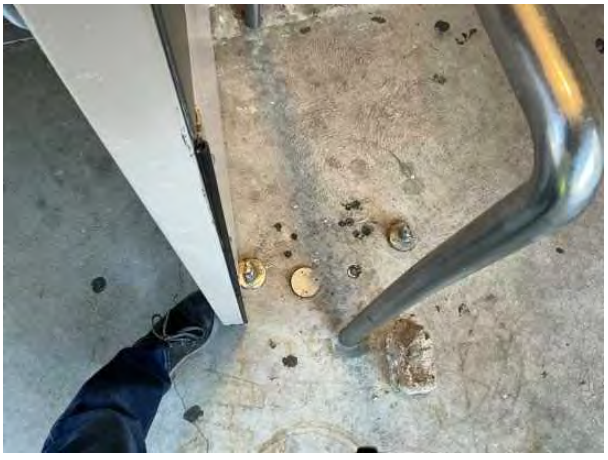



Barrier ID: AX424439

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building A - 101 Nurse
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Three nurse office door does not provide the required 18 inch wide side, maneuvering clear space.

Resolution

Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity

1 EA


Priority	1


Photos for Barrier ID: AX424439



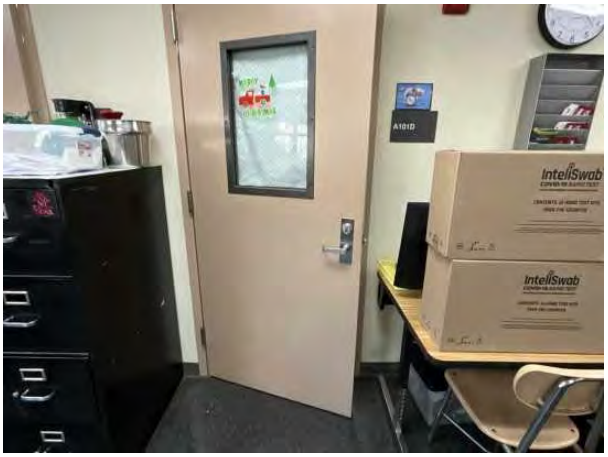



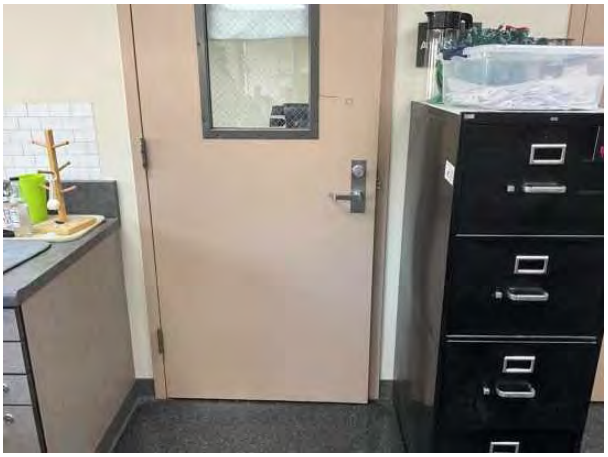

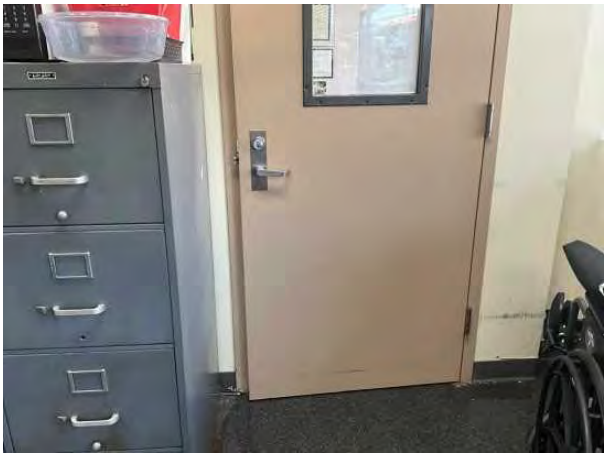



Barrier ID: AX424464

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building A - A110
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The door provides 3 inch wide side, maneuvering clearance to the shelving.

Resolution


Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX424464

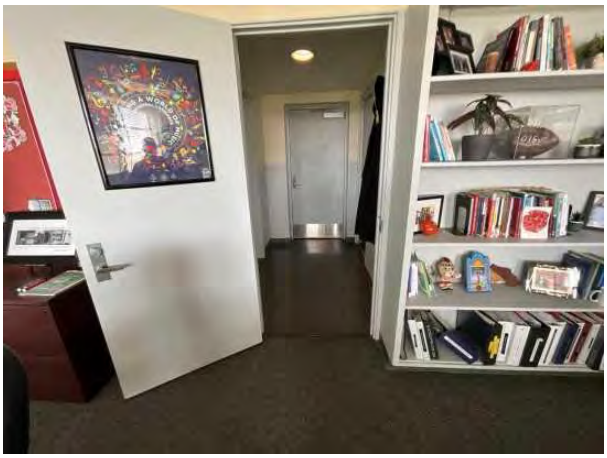



Barrier ID: AX418268

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The push side of the accessible door does not have the required maneuvering clearances.

Location Description	Building B - Auditorium Exterior Southwest Doors
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door landing extends 20 inches on the push side due to the ramp.

Resolution


Redesign to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is 478" minimum. The required side clearance is 12" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX418268

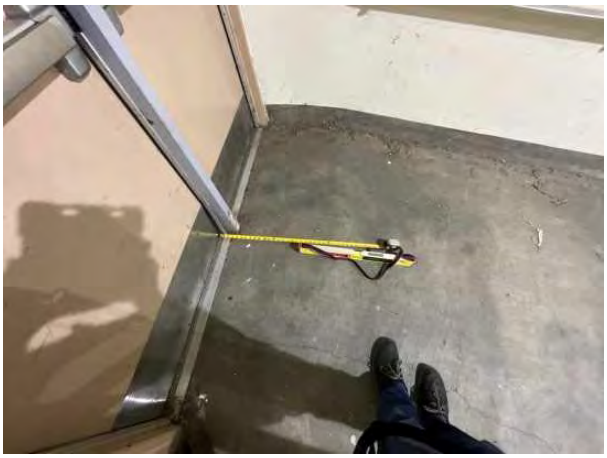



Barrier ID: AX419843

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building B - B112 Boys Dressing Room
Observed	Dec 10, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 6 1/2 inch wide maneuvering clear space on the pull side for forward approach.

Resolution


Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX419843

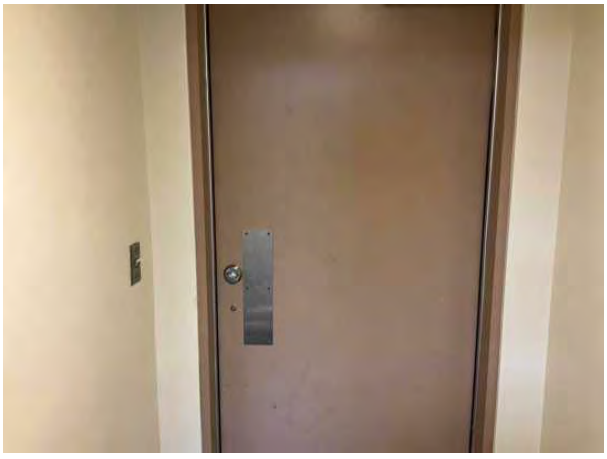



Barrier ID: AX419827

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building E - E101
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door has 6 inch wide side, maneuvering clearance on the pull side for forward approach.

Resolution

Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity


1 EA

Priority	1

Photos for Barrier ID: AX419827





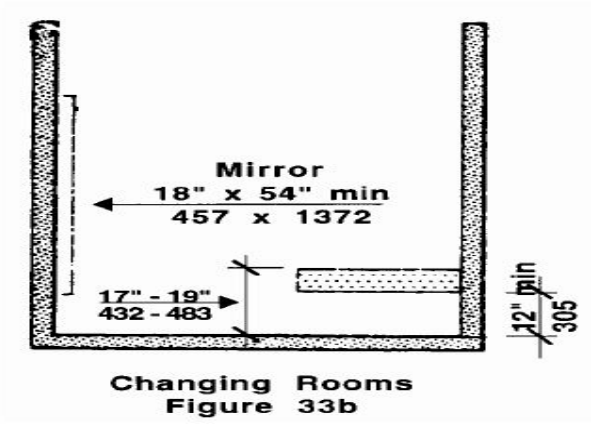

Changing Rooms
Figure 33b

Barrier ID: AX419834

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building E - E102
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door leading to E102 from the darkroom provides 5 inch wide side, maneuvering clearance on the pull side for forward approach.

Resolution

Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity

1 EA

Priority	1

Photos for Barrier ID: AX419834



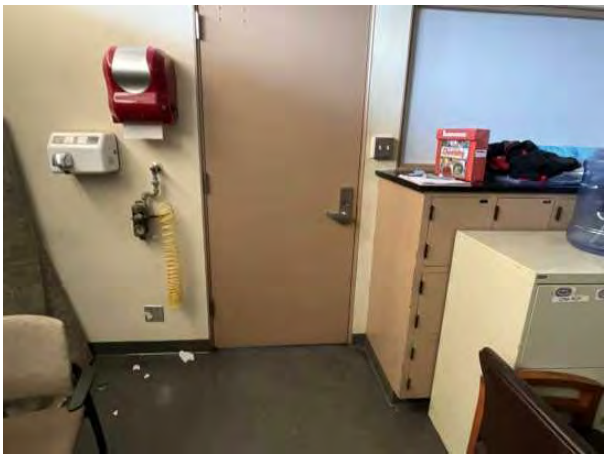

Barrier ID: AX419835

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Door
ADA Standard	307.4, 404.2.3
Barrier Detail	The door has less than 32" clear width.
Location Description	Building E - E102
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	3 doors within the dark room only provide 21 inch clear width.

Resolution


Remove and replace with a door that has a minimum clear opening of 32". Door openings shall provide a clear width of 32" minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24" deep shall provide a clear opening of 36" minimum. There shall be no projections into the required clear opening width lower than 34" above the finish floor or ground. Projections into the clear opening width between 34" and 80" above the finish floor or ground shall not exceed 4". [EXCEPTIONS: 1. In alterations, a projection of 5/8" maximum into the required clear width shall be permitted for the latch side stop. 2. Door closers and door stops shall be permitted to be 78" minimum above the finish floor or ground.]

Quantity

3 EA

Priority	1

Photos for Barrier ID: AX419835

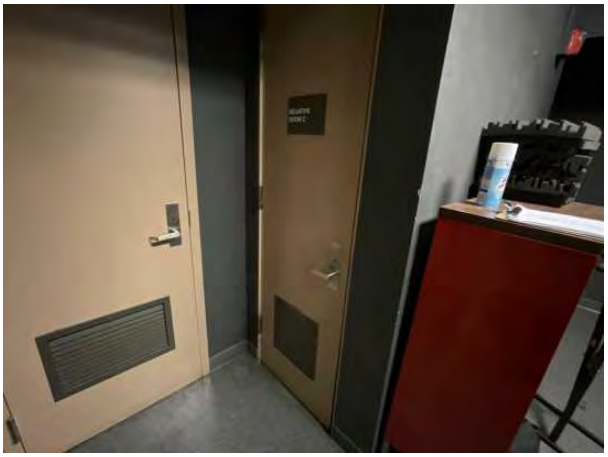







Barrier ID: AX418311

Pasadena High School BUILDING F

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The push side of the accessible door does not have the required maneuvering clearances.

Location Description	Building F - F102A Office
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door landing on the interior side of the office is 1 1/4 inches below the door sill.

Resolution


Redesign to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 12" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity


1 EA


Priority	1

Photos for Barrier ID: AX418311

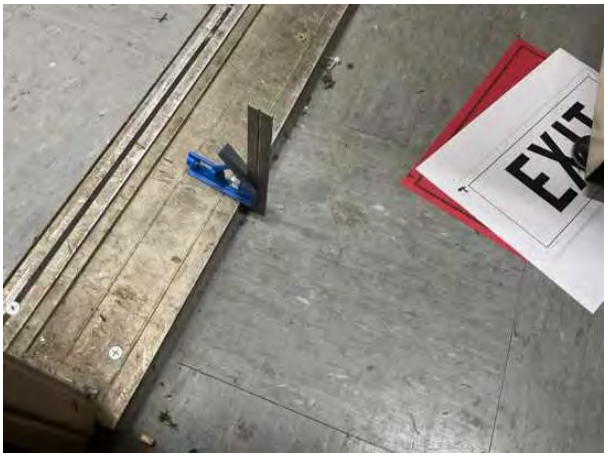



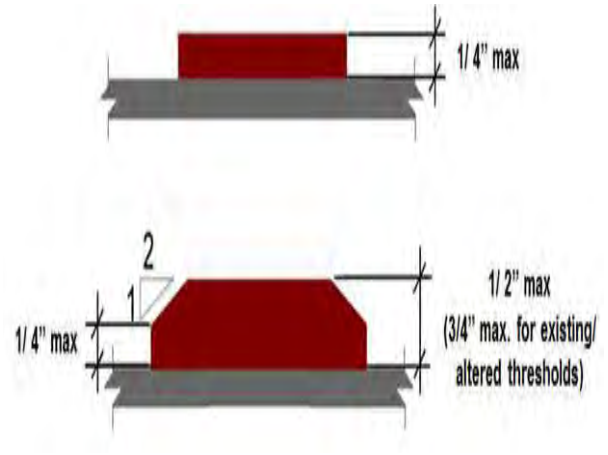

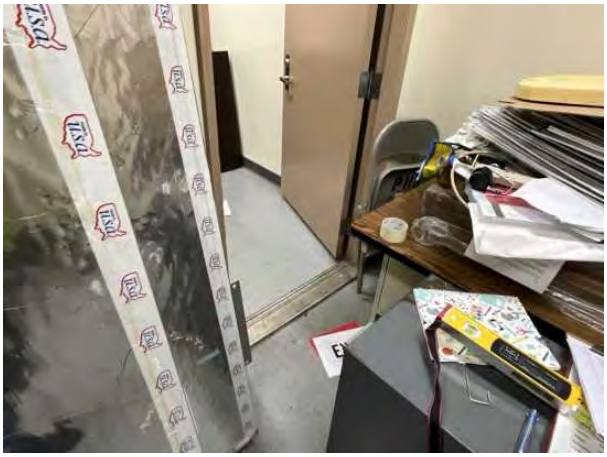





Barrier ID: AX418724

Pasadena High School BUILDING I

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The push side of the accessible door does not have the required maneuvering clearances.

Location Description	Building I - Ramped Door Landings
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Building I has 14 doors that have the interior side of the door landing ramped causing slopes up to 7.2% at required level door landing.

Resolution

Redesign to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 12" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity

14 EA

Priority	1


Photos for Barrier ID: AX418724



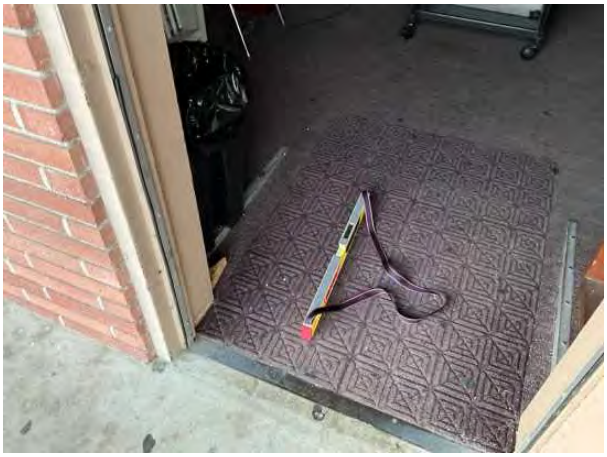





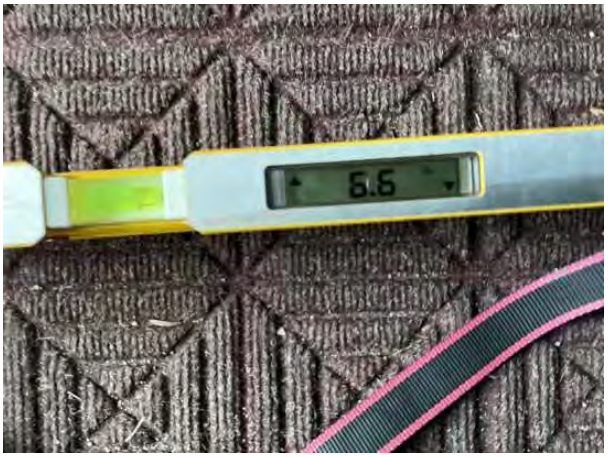



Barrier ID: AX418646

Pasadena High School BUILDING Q

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The push side of the accessible door does not have the required maneuvering clearances.

Location Description	Building Q - Q107B
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 5 inch wide side, maneuvering clearance on the push side for forward approach. The door has a closer.

Resolution

Remove the door closer to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 12" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX418646





Barrier ID: AX419790

Pasadena High School BUILDING R

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The push side of the accessible door does not have the required maneuvering clearances.

Location Description	Building R - R104 Ticket Booth
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Redesign to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 12" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Resolution

Redesign to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 12" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX419790







Barrier ID: AX419888

Pasadena High School BUILDING S

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building S - S109 Team Room
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door landing slopes, 6.3%.

Resolution


Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity

1 EA

Priority	1

Photos for Barrier ID: AX419888

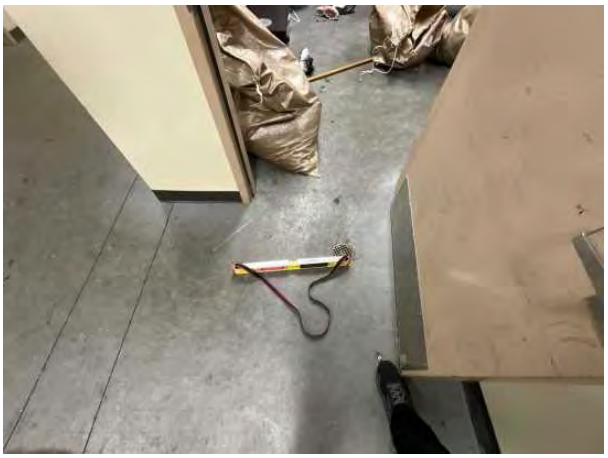

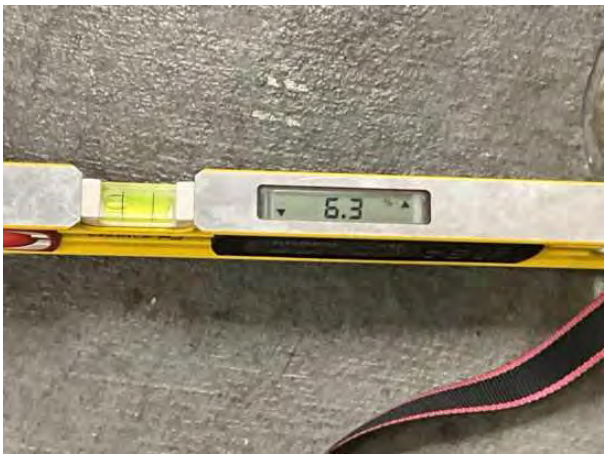

Barrier ID: AX419889

Pasadena High School BUILDING S

Assembly	Interior Access Route
Type	Door
ADA Standard	307.4, 404.2.3
Barrier Detail	The door has less than 32" clear width.
Location Description	Building S - S109 Team Room
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door does not open a full 90 degrees due to the door stopper.

Resolution

Remove the door stopper. Remove and replace with a door that has a minimum clear opening of 32". Door openings shall provide a clear width of 32" minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24" deep shall provide a clear opening of 36" minimum. There shall be no projections into the required clear opening width lower than 34" above the finish floor or ground. Projections into the clear opening width between 34" and 80" above the finish floor or ground shall not exceed 4". [EXCEPTIONS: 1. In alterations, a projection of 5/8" maximum into the required clear width shall be permitted for the latch side stop. 2. Door closers and door stops shall be permitted to be 78" minimum above the finish floor or ground.]


Quantity


1 EA

Priority	1

Photos for Barrier ID: AX419889



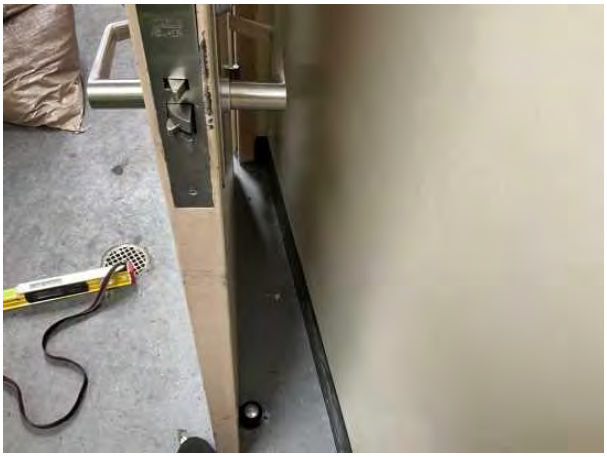

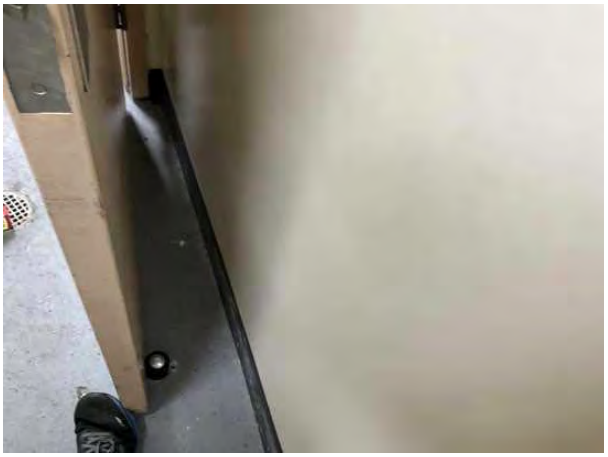

Barrier ID: AX420134

Pasadena High School BUILDING T

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The push side of the accessible door does not have the required maneuvering clearances.

Location Description	Building T - T104
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The door is in an alcove 24 inches deep and the door has a closer.

Resolution

Remove the door closer to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 12" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity

1 EA

Priority	1

Photos for Barrier ID: AX420134



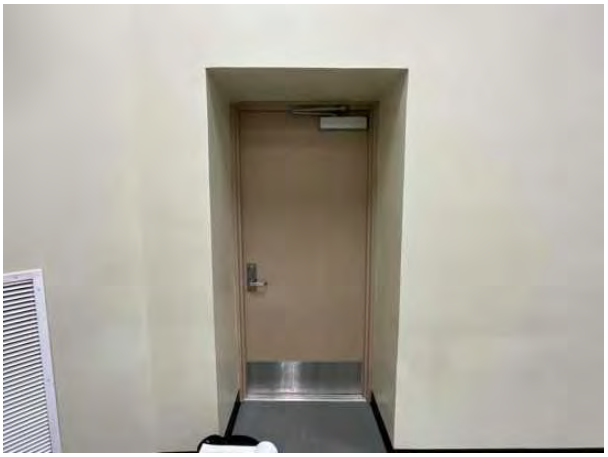



Barrier ID: AX418676

Pasadena High School BUILDING W

Assembly	Interior Access Route
Type	Door

ADA Standard

CBC Chap 11B- 309, 404.2.7, State Fire Marshall Referenced Standard Section 12-10-202(f)

Barrier Detail	CALIFORNIA: The hardware at the accessible door is not compliant.
Location Description	Building W - Doors With Knob Hardware
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	4 doors have knob type hardware.

Resolution


Remove hardware and replace with hardware that has a shape that is easy to grasp such as lever, push-type or U-shaped handles. Handles, pulls, latches, locks, and other operable parts on doors and gates shall be compliant. Operable parts of such hardware shall be 34" minimum and 44" maximum above the finish floor or ground. Where sliding doors are in the fully open position, operating hardware shall be exposed and usable from both sides. [EXCEPTIONS: 1. Existing locks shall be permitted in any location at existing glazed doors without stiles, existing overhead rolling doors or grilles, and similar existing doors or grilles that are designed with locks that are activated only at the top or bottom rail. 2. Access gates in barrier walls and fences protecting pools, spas, and hot tubs shall be permitted to have operable parts of the release of latch on self-latching devices at 54" maximum above the finish floor or ground provided the self-latching devices are not also self-locking devices and operated by means of a key, electronic opener, or integral combination lock.] [Advisory 404.2.7 Door and gate hardware. Door hardware that can be operated with a closed fist or a loose grip accommodates the greatest range of users. Hardware that requires simultaneous hand and finger movements require greater dexterity and coordination, and is not recommended.] Lever hardware of lever actuated latches or locks shall be curved with a return to within 1/2 inch of the door. [Advisory 11B-404.2.7 Door and gate hardware. In addition to the requirements of this section, designers should be aware of the Part 12, Section 12-10-202(f) requirement for lever hardware as adopted by the State Fire Marshal. The lever of lever actuated latches or locks must be curved with a return to within ½ inch of the door to prevent catching on the clothing of persons during egress.]

Quantity

4 EA

Priority	1

Photos for Barrier ID: AX418676

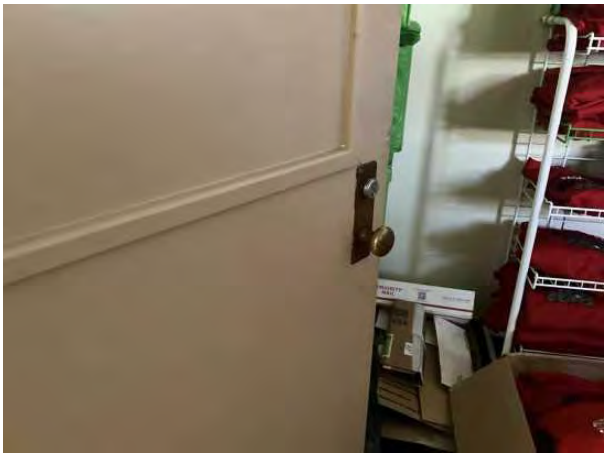







Barrier ID: AX418680

Pasadena High School BUILDING W

Assembly	Interior Access Route
Type	Door
ADA Standard	307.4, 404.2.3

Barrier Detail

The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.

Location Description	Building W - Doors With Low Closers
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Two doors have closers or the bottom edge is 76 inches above the floor and 77 inches above the floor.

Resolution

Provide an accessible door with 80" minimum head clearance above finish floor. [EXCEPTION: Door closers and door stops shall be permitted to be 78" minimum above the finish floor or ground.]


Quantity

2 EA

Priority	1

Photos for Barrier ID: AX418680



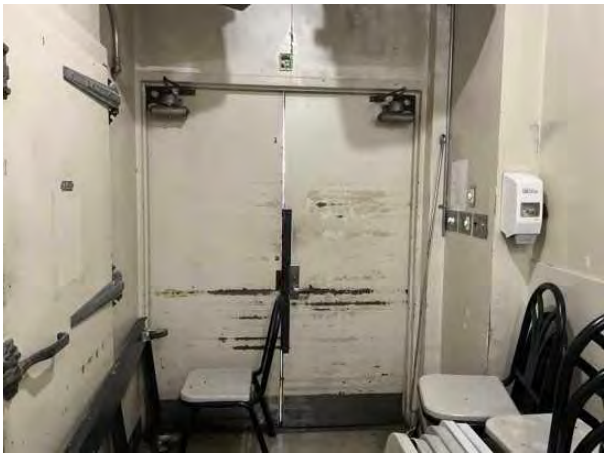





Barrier ID: AX418689

Pasadena High School BUILDING W

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The push side of the accessible door does not have the required maneuvering clearances.

Location Description	Building W - W103 Student Store
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 24 inch deep maneuvering clearance to the furniture on the push side for forward approach.

Resolution

Relocate the furniture to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 12" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity

1 EA

Priority	1

Photos for Barrier ID: AX418689



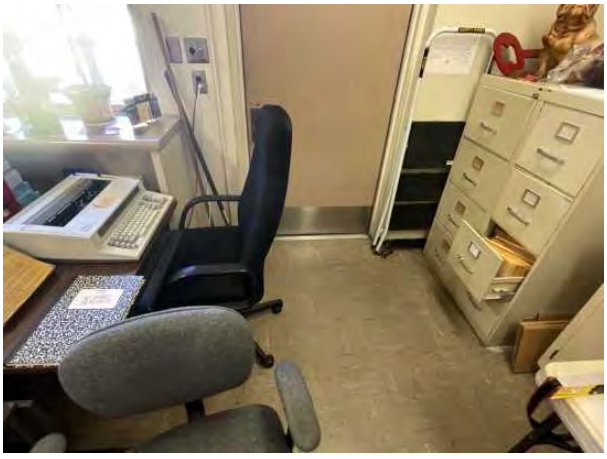

Barrier ID: AX418691

Pasadena High School BUILDING W

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building W - W103 Student Store
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 13 wide side, maneuvering clearance for forward approach on the pull side.

Resolution

Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX418691





Barrier ID: AX418677

Pasadena High School BUILDING W

Assembly	Interior Access Route
Type	Door
ADA Standard	307.4, 404.2.3
Barrier Detail	The door has less than 32" clear width.
Location Description	Building W - W106
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	2 doors provides 29 inch clear width.

Resolution


Remove and replace with a door that has a minimum clear opening of 32". Door openings shall provide a clear width of 32" minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24" deep shall provide a clear opening of 36" minimum. There shall be no projections into the required clear opening width lower than 34" above the finish floor or ground. Projections into the clear opening width between 34" and 80" above the finish floor or ground shall not exceed 4". [EXCEPTIONS: 1. In alterations, a projection of 5/8" maximum into the required clear width shall be permitted for the latch side stop. 2. Door closers and door stops shall be permitted to be 78" minimum above the finish floor or ground.]

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX418677

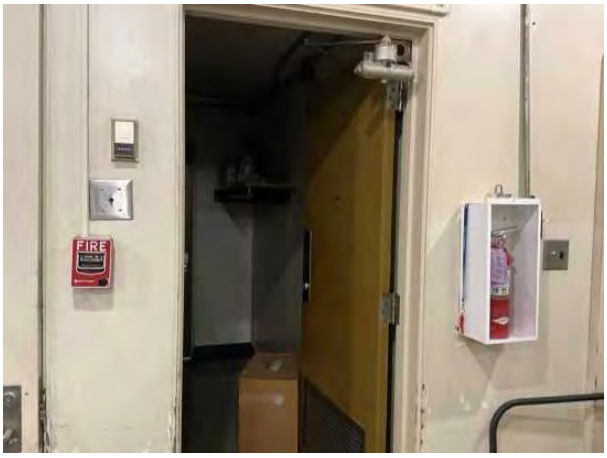



Barrier ID: AX418678

Pasadena High School BUILDING W

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building W - W106
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 2 1/2 inch wide side, maneuvering clearance for forward approach on the pull side.

Resolution

Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity

1 EA

Priority	1

Photos for Barrier ID: AX418678



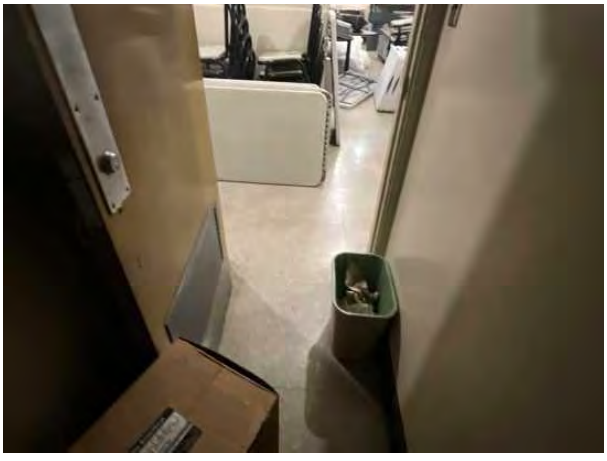

Barrier ID: AX419823

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Typical Classroom Doors With Sloped Landings
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Typical classroom doors have landings with slopes between 3.7 and 6.7%. Building E has 26 doors. Building G has 22 doors. Building H has 29 doors. Building I has 30 doors. Building N has 6 doors. Building P has 6 doors. Building Q has 5 doors.

Resolution


Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 24" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity


124 EA

Priority	1

Photos for Barrier ID: AX419823

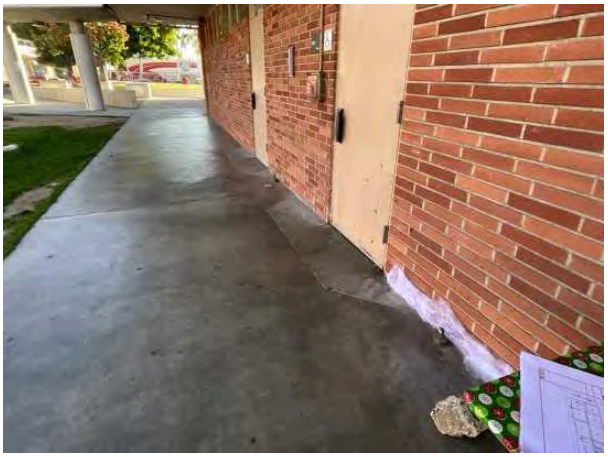


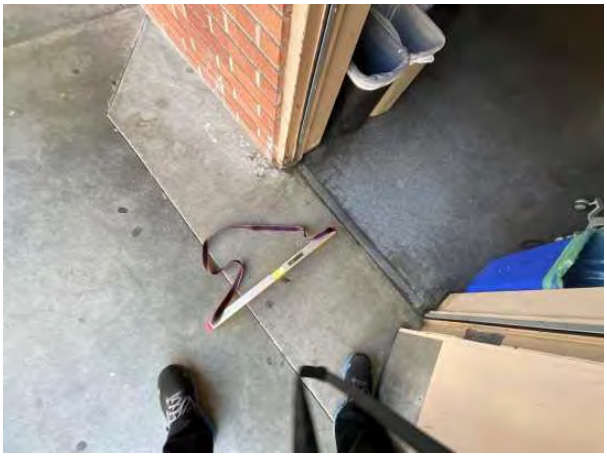

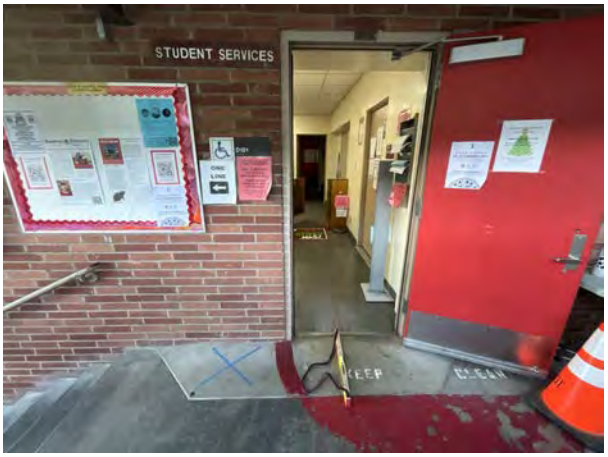






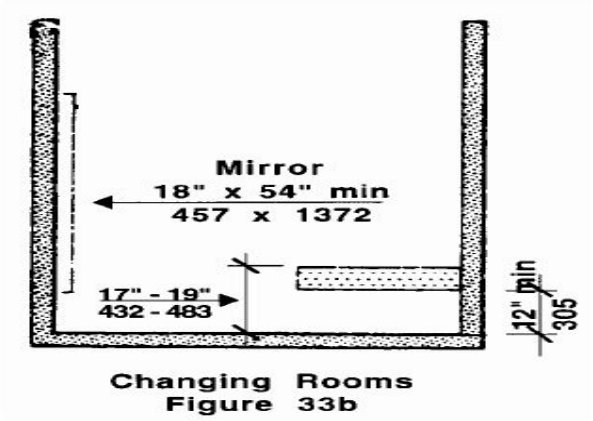

Changing Rooms
Figure 33b


3.7

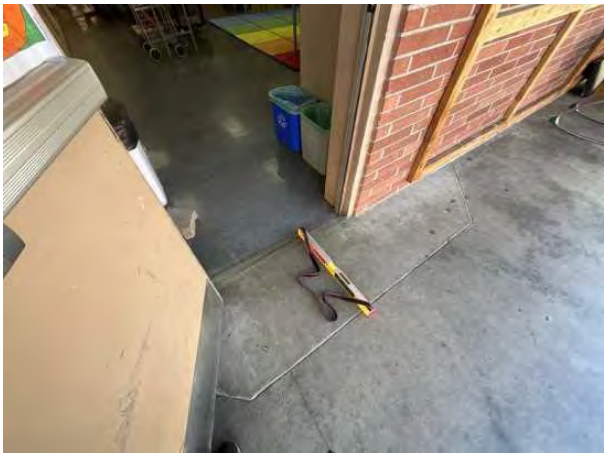

Barrier ID: AX418278

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.4; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Typical Classroom Entry Doors With Step
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Classroom doors have a 3/4 to 1 1/8 inch high step at the door sill. Building E has 14 doors. Building G has 16 doors. Building H has 14 doors. Building I has 14 doors. Building N has 2 doors. Building P has 4 doors. Building Q has 6 doors.

Resolution


Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 24" minimum on the latch/hinge side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side or hinge side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

70 EA


Priority	1

Photos for Barrier ID: AX418278

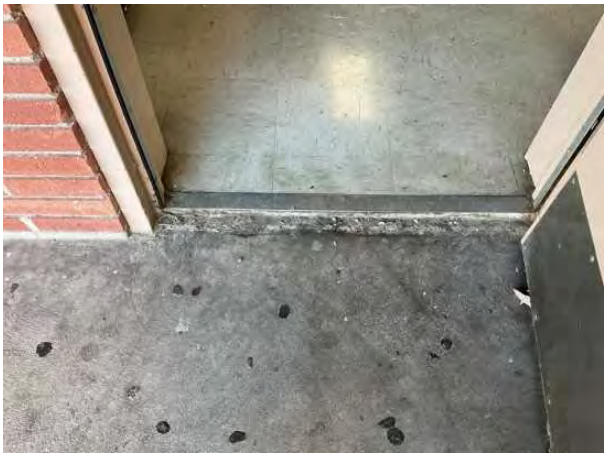





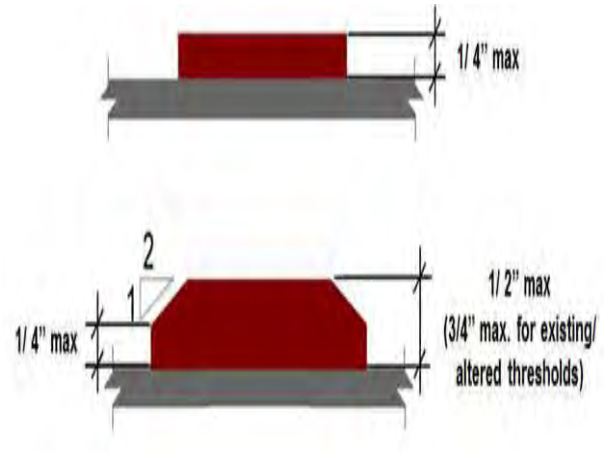







Barrier ID: AX420132

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.9

Barrier Detail

The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.

Location Description	Typical Interior Doors Throughout
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Doors throughout the campus equipped with door closers have opening forces between 6 and 15 pounds. Building A has 40 doors. Building B has 27 doors. Building C has 21 doors. Building D has 5 doors. Building E has 43 doors. Building F has 11 doors. Building G has 41 doors. Building H has 48 doors. Building I has 48 doors. Building N has 9 doors. Building P has 11 doors. Building Q has 10 doors. Building R has 12 doors. Building S has 21 doors. Building T has 10 doors. Building V has 8 doors. Building W has 5 doors.

Resolution

Adjust the closer or replace with a door that requires no more than 5 pounds of force for pushing or pulling the door open. This barrier must be removed in conjunction with barrier ID 420133. The cost of this barrier removal is covered under ID 420133 and therefore, the cost of this ID is shown as $0. The force at the latch, the force to set the door in motion, and the force to fully open the door shall be maximum 5 pounds. These forces do not apply to the force required to retract latch bolts or disengage other devices that hold the door or gate in a closed position.

Quantity


370 EA

Priority	1

Photos for Barrier ID: AX420132





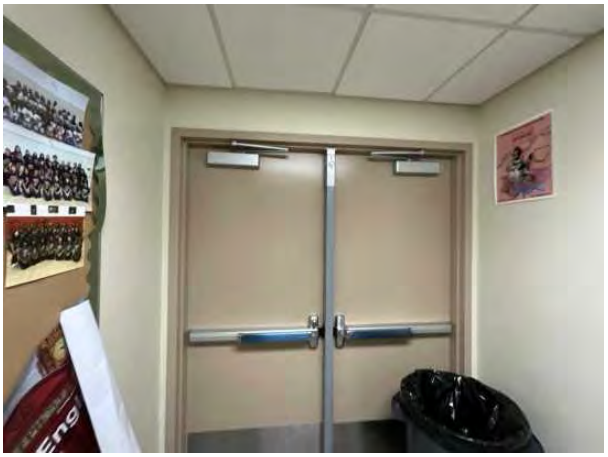







Barrier ID: AX420133

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.8

Barrier Detail

The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.

Location Description	Typical Interior Doors Throughout
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Typical doors equipped with closers provide 2.66 to 3.52 seconds of closing time from the open 90 degree position to within 12 degrees of the latch. Building A has 40 doors. Building B has 27 doors. Building C has 21 doors. Building D has 5 doors. Building E has 43 doors. Building F has 11 doors. Building G has 41 doors. Building H has 48 doors. Building I has 48 doors. Building N has 9 doors. Building P has 11 doors. Building Q has 10 doors. Building R has 12 doors. Building S has 21 doors. Building T has 10 doors. Building V has 8 doors. Building W has 5 doors.

Resolution


Adjust closer or remove and replace closer to ensure that the door has a closure time of at least 5 seconds within 12 degrees of the latch. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum.


Quantity


370 EA


Priority	1


Photos for Barrier ID: AX420133

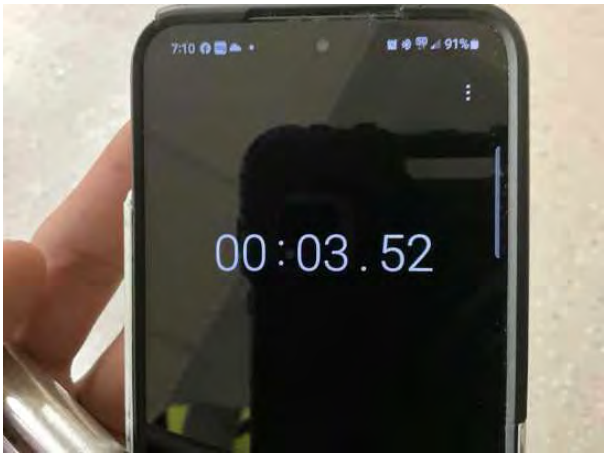

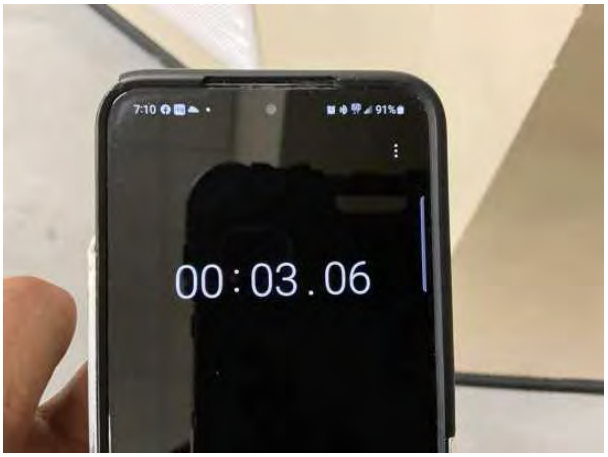

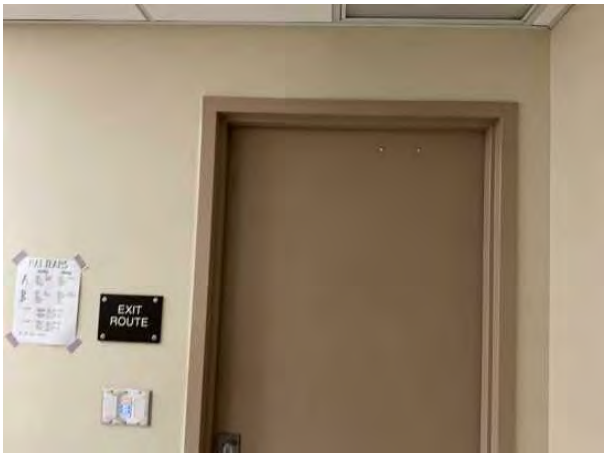

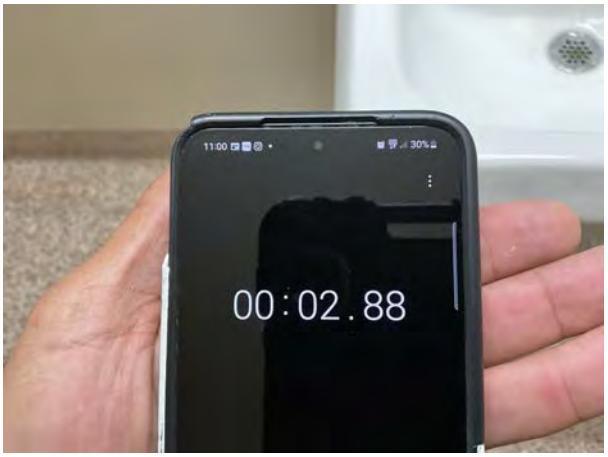

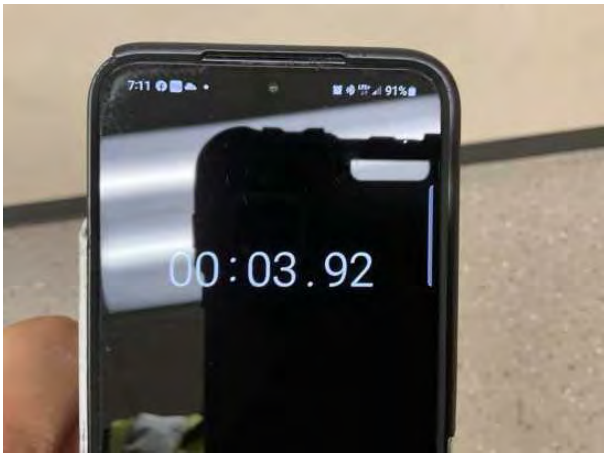



Barrier ID: AX424534

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	303

Barrier Detail

Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.

Location Description	Route to Soccer And Softball Field
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Two portable restrooms are provided and no accessible portable restrooms are provided. Portable restroom is required.

Resolution

The sidewalk should be removed (sections that are heaved, cracked etc) and repaired. Changes in level of 1/4" high maximum shall be permitted to be vertical. Changes in level between 1/4" high minimum and 1/2" high maximum shall be beveled with a slope not steeper than 1:2. Changes in level greater than 1/2" shall be ramped.

Quantity

100 SF

Priority	1

Map for Barrier ID: AX424534



780 +34.163261, -118.093778

Photos for Barrier ID: AX424534



Barrier ID: AX418720

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3
Barrier Detail	The accessible route has running slopes greater than 1:20 (5%).
Location Description	Accessible Route Between Building I & E West End
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The route has a running slope of 7.8% for a length of 58 feet by 8 feet wide.

Resolution

Grade the accessible route to maximum 1:20 (5%) running slope. An accessible route has maximum 1:20 (5%) running slope, maximum 1:50 (2%) cross slope, and minimum clear width 36". [EXCEPTION: Cross slopes not greater than 1:48 (2.08%) are permitted.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. A compliant ramp has maximum 1:12 (8.3%) running slope, maximum ramp run rise 30", landings at the top and bottom of ramp runs, handrails where the ramp run rise is greater than 6", and edge protection with exceptions. The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

464 SF


Priority	1

Map for Barrier ID: AX418720



290 +34.162789, -118.093063

Photos for Barrier ID: AX418720

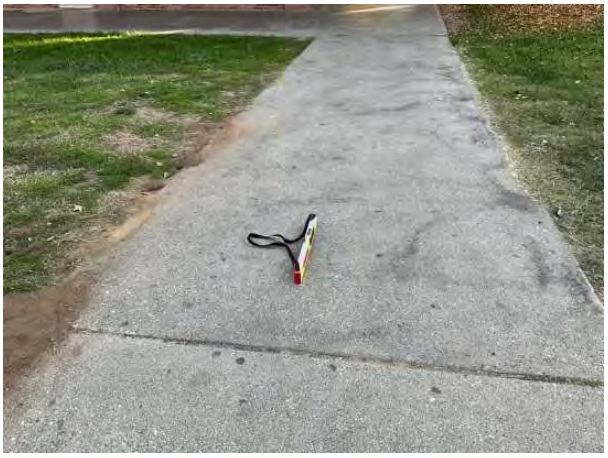







Barrier ID: AX418190

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3
Barrier Detail	The accessible route has cross slopes greater than 1:50 (2%).
Location Description	Accessible Route from Accessible Parking Space P1-A
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The accessible route striped with diagonal lines has an area 20 feet wide by 25 feet long with cross slopes up to 3.1%.

Resolution

The walkway should be graded to a maximum 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope and maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not exceeding 1:48 (2.08%) are permitted.] The clear width of walking surfaces shall be 36" minimum. [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

500 SF

Priority	1

Map for Barrier ID: AX418190




1 +34.161386, -118.093363

Photos for Barrier ID: AX418190







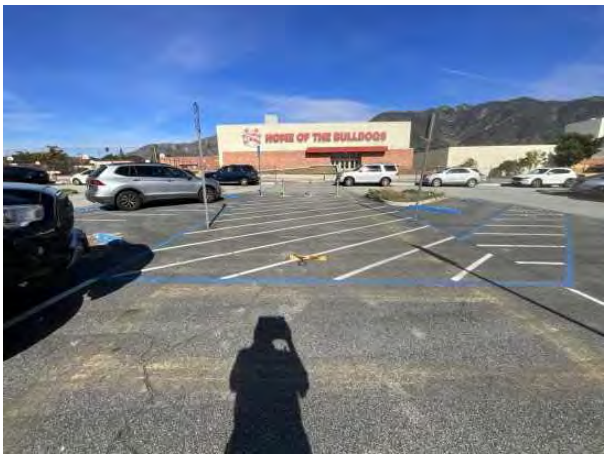

Barrier ID: AX418217

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3
Barrier Detail	The accessible route has cross slopes greater than 1:50 (2%).
Location Description	Accessible Route from Accessible Parking Space P1-E
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

An area within the stripe lines has cross slopes up to 2.8% 10 feet wide by 20 feet long

Resolution

The walkway should be graded to a maximum 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope and maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not exceeding 1:48 (2.08%) are permitted.] The clear width of walking surfaces shall be 36" minimum. [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

200 SF


Priority	1

Map for Barrier ID: AX418217




28 +34.161476, -118.092984

Photos for Barrier ID: AX418217

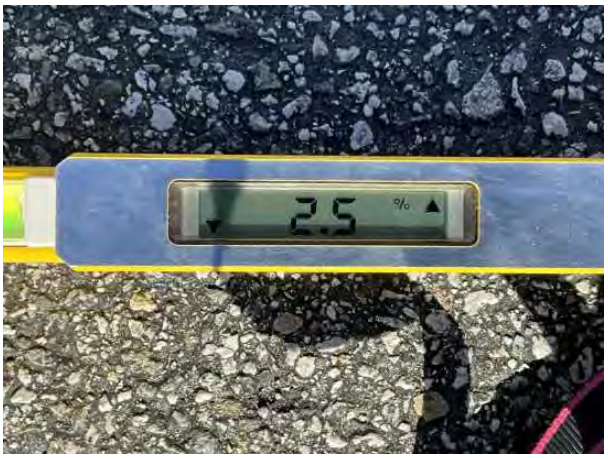



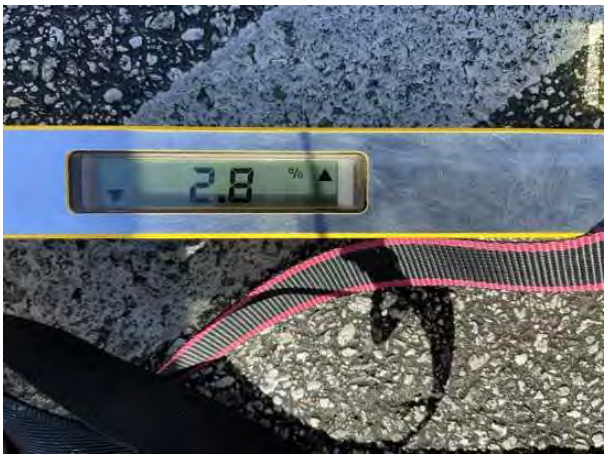



Barrier ID: AX418223

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	R204.2, R302.6, R302.6.1, R302.6.2

Barrier Detail

PROWAG - The pedestrian circulation path has areas in excess of 2.08% cross slope.

Location Description	Accessible Route from Accessible Parking Space P1-E
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The sidewalk has cross slopes up to 4.6% for a length of 112' x 35' wide.

Resolution


The accessible route should be removed, graded and replaced to a maximum 2% cross slope. An accessible PROWAG route has minimum 48" clear width. Intersection cross walks can have a 5% max cross slope where there are no stop, yield or other traffic control means. Midblock cross walks are permitted to have the cross slope be equal to the street grade.

Quantity

3920 SF


Priority	1

Map for Barrier ID: AX418223

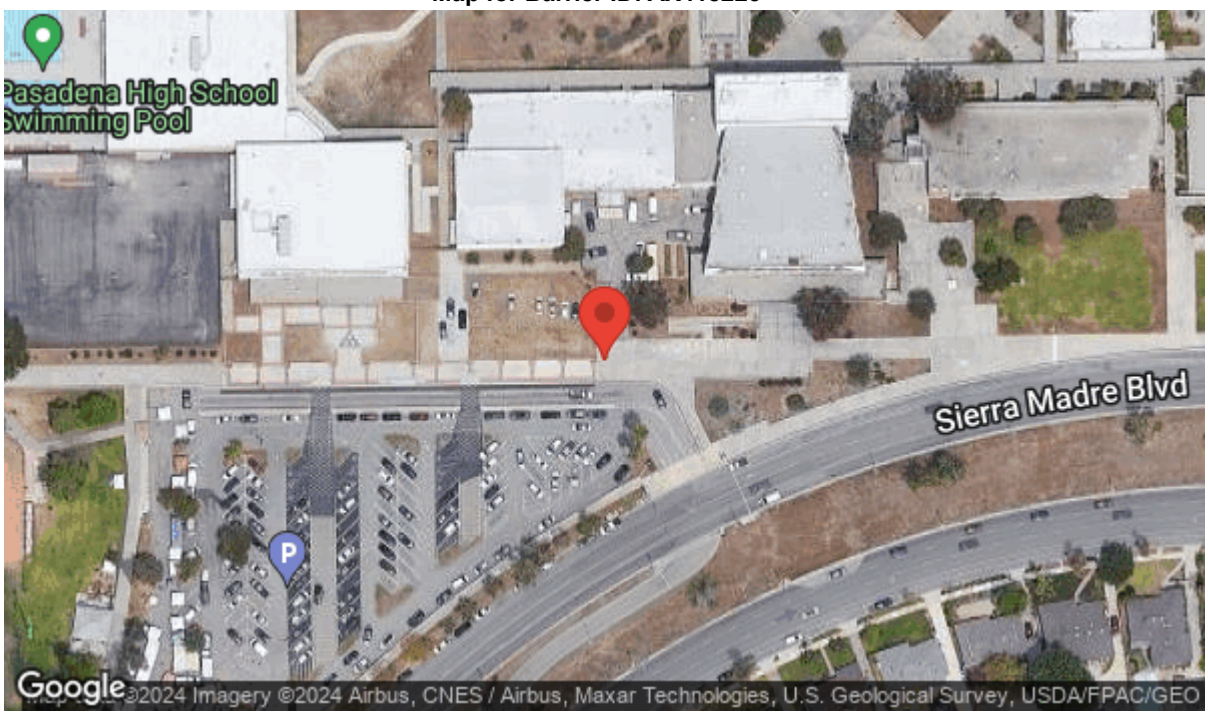

34 +34.161676, -118.092598

Photos for Barrier ID: AX418223

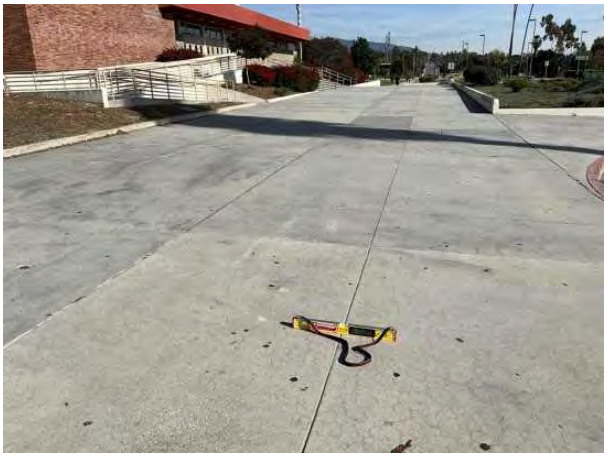










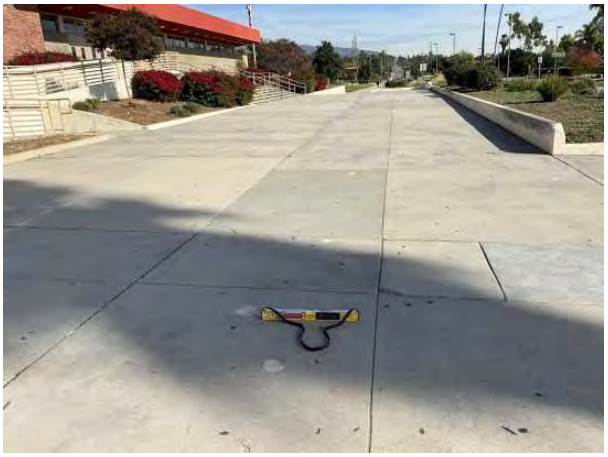

Barrier ID: AX418635

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3
Barrier Detail	The accessible route has cross slopes greater than 1:50 (2%).
Location Description	Accessible Route to Building N
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The accessible route has cross slopes up to 3.8% for a length of 35' x 4' wide.

Resolution


The walkway should be graded to a maximum 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope and maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not exceeding 1:48 (2.08%) are permitted.] The clear width of walking surfaces shall be 36" minimum. [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

140 SF


Priority	1

Map for Barrier ID: AX418635

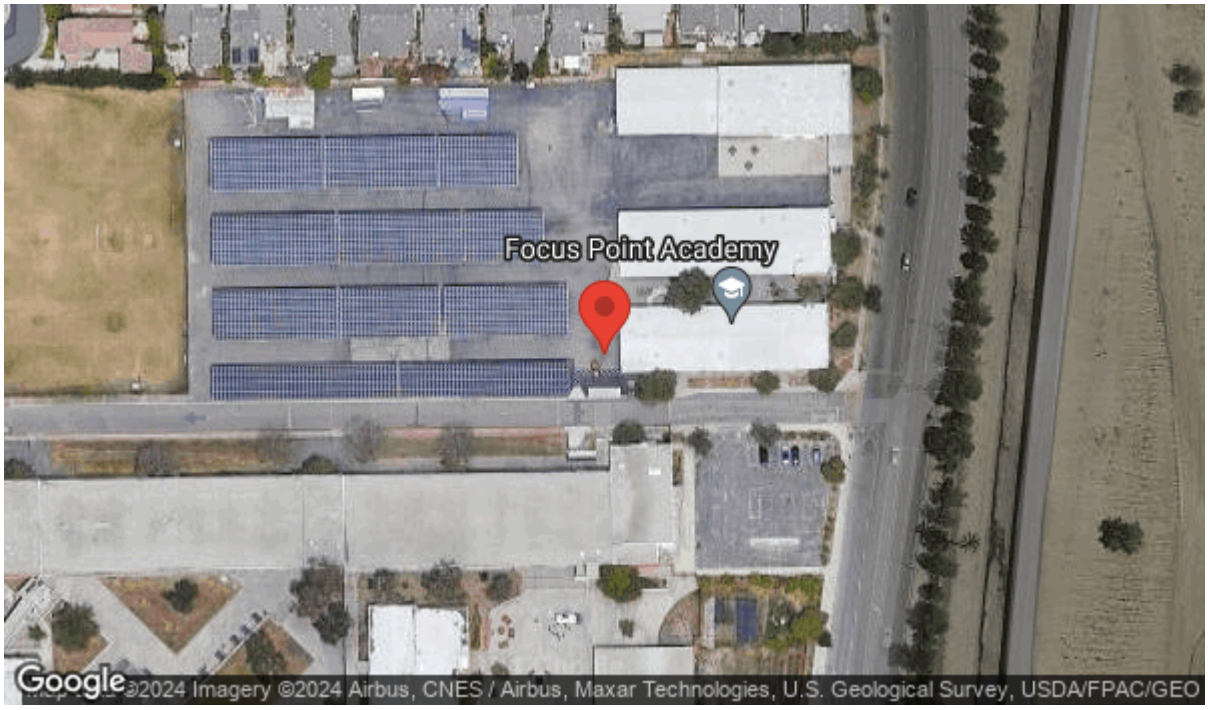


205 +34.163327, -118.090730

Photos for Barrier ID: AX418635

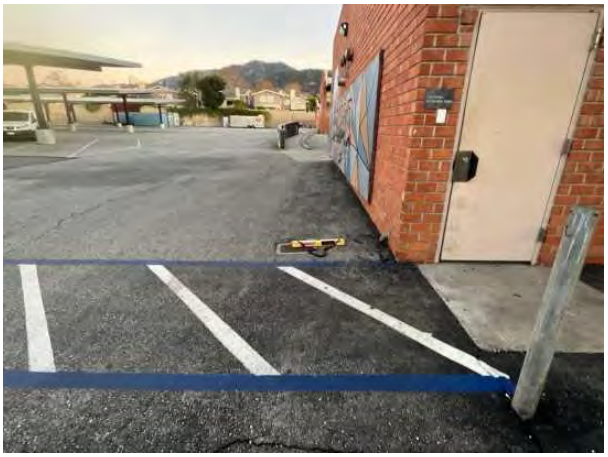



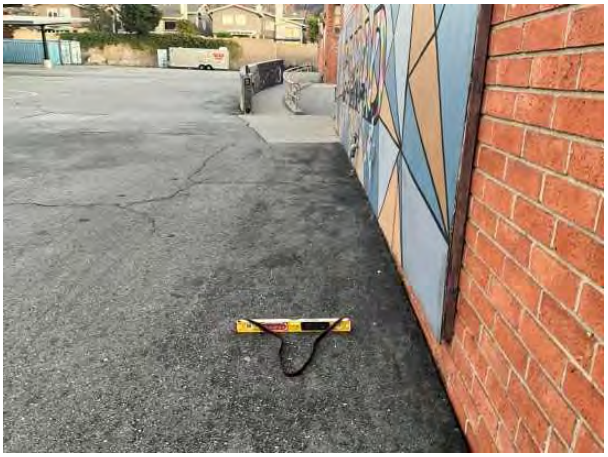







Barrier ID: AX418661

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3
Barrier Detail	The accessible route has cross slopes greater than 1:50 (2%).
Location Description	Accessible Route to Building N
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The entire route to the classroom doors on the north side of building and has cross slopes up to 8.1% for a length of 160 feet by 4 feet wide.

Resolution

The walkway should be graded to a maximum 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope and maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not exceeding 1:48 (2.08%) are permitted.] The clear width of walking surfaces shall be 36" minimum. [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

640 SF

Priority	1


Map for Barrier ID: AX418661



231 +34.163468, -118.090658

Photos for Barrier ID: AX418661



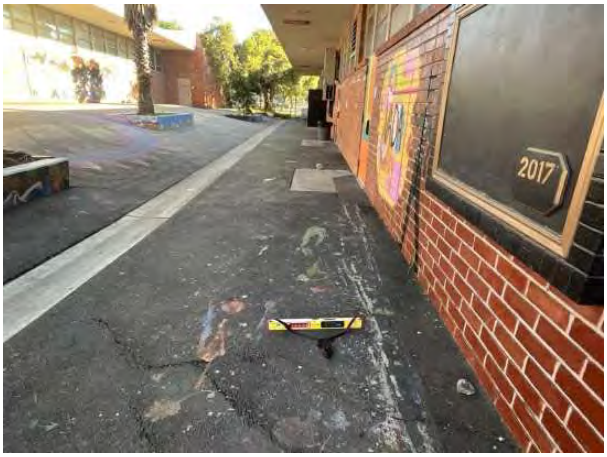







Barrier ID: AX418664

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3
Barrier Detail	The accessible route has cross slopes greater than 1:50 (2%).
Location Description	Accessible Route to Building P
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The entire route to the classroom doors on the south side of the building and has cross slopes up to 4.9% and running slopes up to 10.2% for a length of 140 feet by 4 wide.

Resolution


The walkway should be graded to a maximum 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope and maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not exceeding 1:48 (2.08%) are permitted.] The clear width of walking surfaces shall be 36" minimum. [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

560 SF

Priority	1

Map for Barrier ID: AX418664

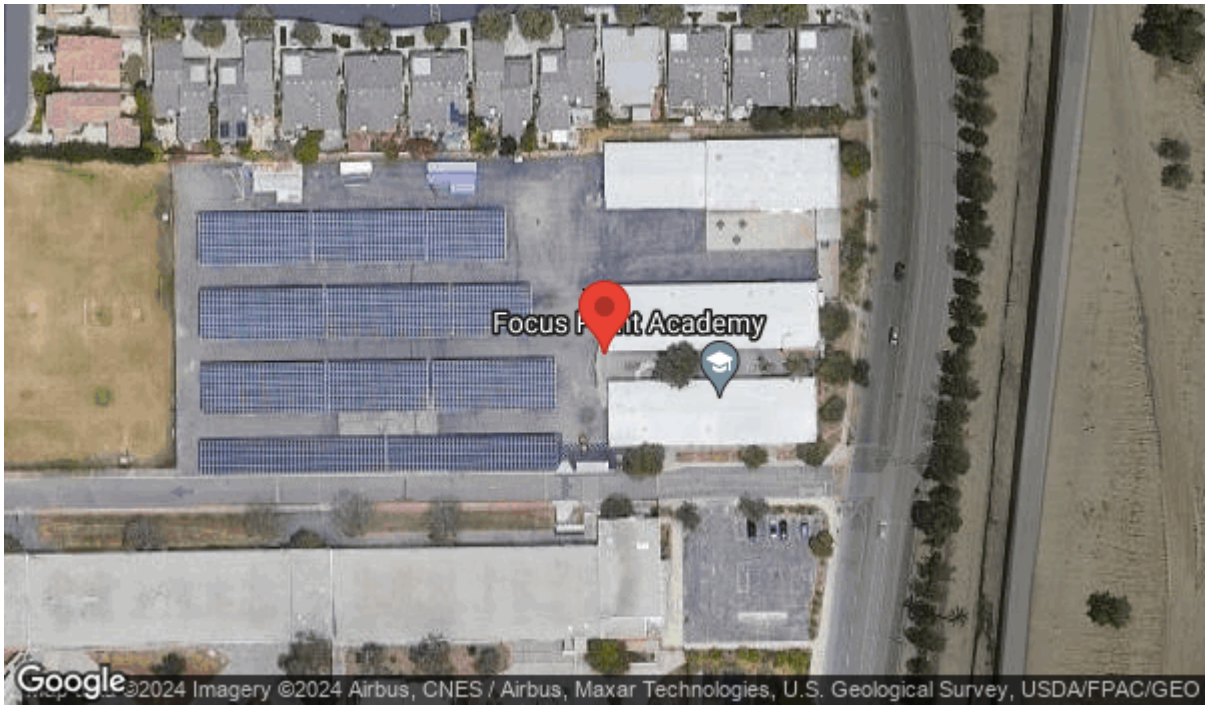


234 +34.163490, -118.090701


Photos for Barrier ID: AX418664







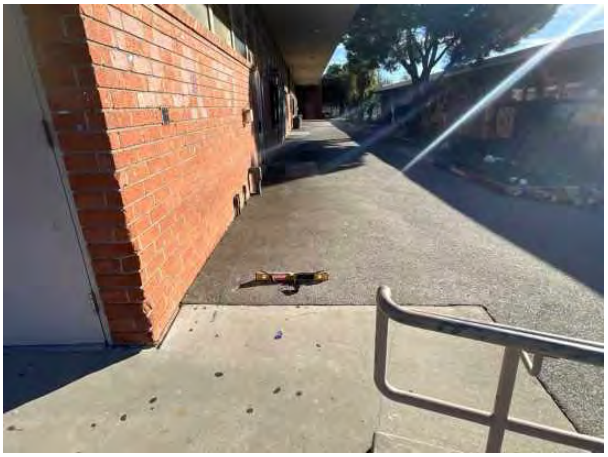

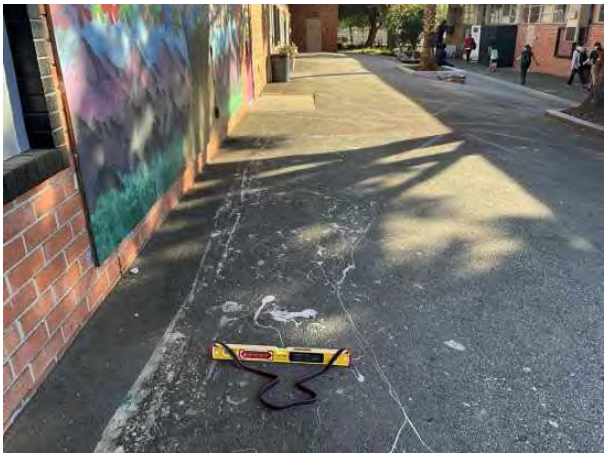



Barrier ID: AX420227

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3
Barrier Detail	The accessible route has cross slopes greater than 1:50 (2%).
Location Description	Accessible Route To Football Field
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The root slopes up to 9.0% for a length of 56 feet by 10 feet wide.

Resolution

The walkway should be graded to a maximum 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope and maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not exceeding 1:48 (2.08%) are permitted.] The clear width of walking surfaces shall be 36" minimum. [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

560 SF


Priority	1

Map for Barrier ID: AX420227



606 +34.162599, -118.094464


Photos for Barrier ID: AX420227

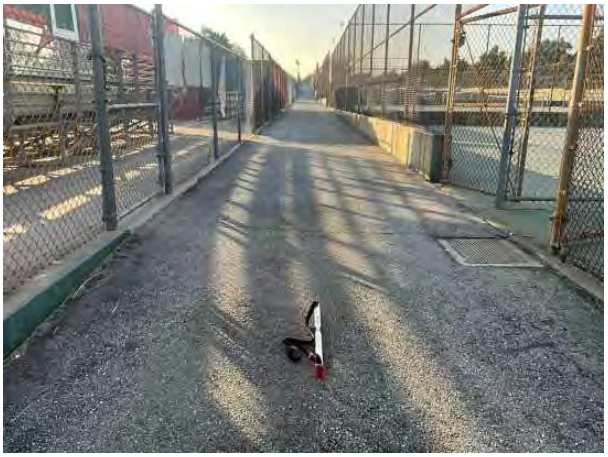







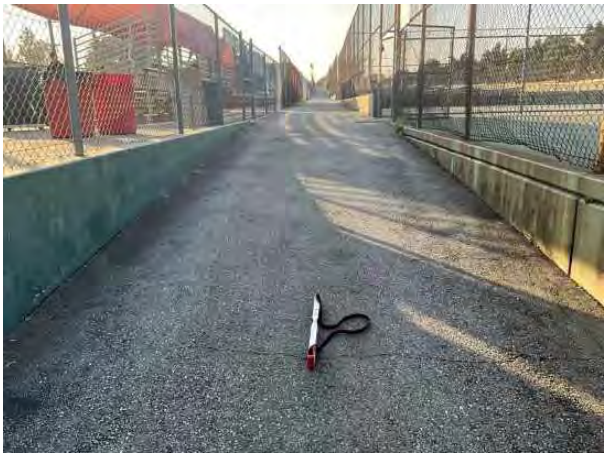



Barrier ID: AX420228

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3
Barrier Detail	The accessible route has cross slopes greater than 1:50 (2%).
Location Description	Accessible Route To Football Field
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The route has cross slopes up to 3.2% for the length of 10' x 10' wide

Resolution

The walkway should be graded to a maximum 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope and maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not exceeding 1:48 (2.08%) are permitted.] The clear width of walking surfaces shall be 36" minimum. [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

100 SF


Priority	1

Map for Barrier ID: AX420228



607 +34.162581, -118.094712

Photos for Barrier ID: AX420228

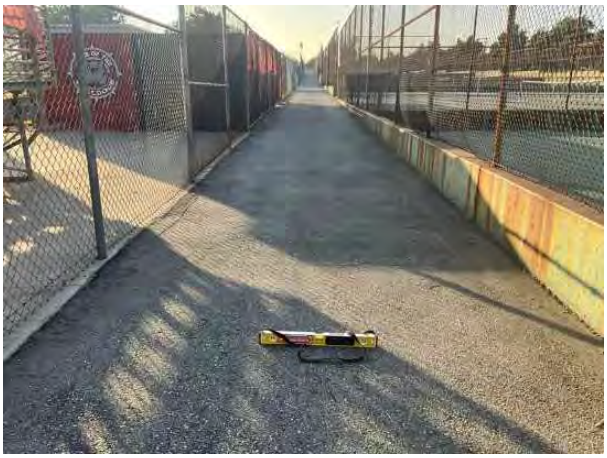



Barrier ID: AX420230

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3
Barrier Detail	The accessible route has cross slopes greater than 1:50 (2%).
Location Description	Accessible Route To Football Field
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The route has cross slopes up to 7.2% for the length of 80' x 10' wide

Resolution

The walkway should be graded to a maximum 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope and maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not exceeding 1:48 (2.08%) are permitted.] The clear width of walking surfaces shall be 36" minimum. [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

800 SF

Priority	1

Map for Barrier ID: AX420230



609 +34.162583, -118.095511


Photos for Barrier ID: AX420230









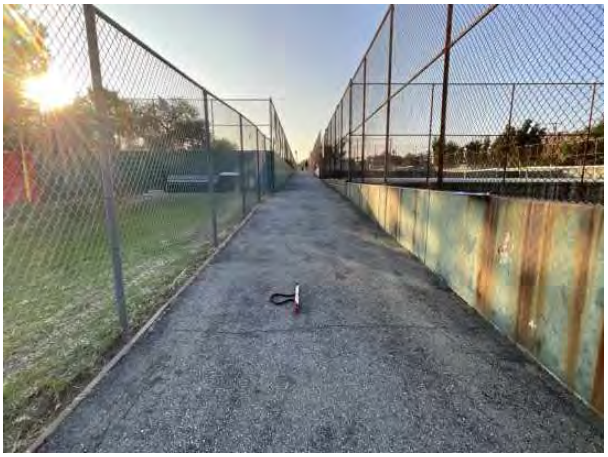



Barrier ID: AX420231

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3
Barrier Detail	The accessible route has cross slopes greater than 1:50 (2%).
Location Description	Accessible Route To Football Field
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The accessible route has cross slopes up to 4.6% for a total length of 160' x 10' wide.

Resolution

The walkway should be graded to a maximum 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope and maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not exceeding 1:48 (2.08%) are permitted.] The clear width of walking surfaces shall be 36" minimum. [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

1600 SF


Priority	1

Map for Barrier ID: AX420231




610 +34.162581, -118.095989

Photos for Barrier ID: AX420231

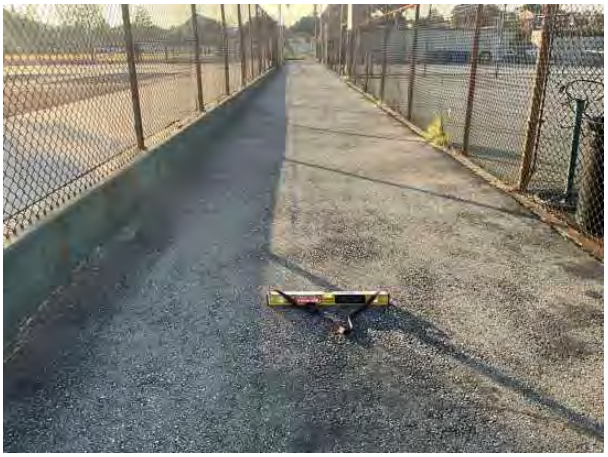





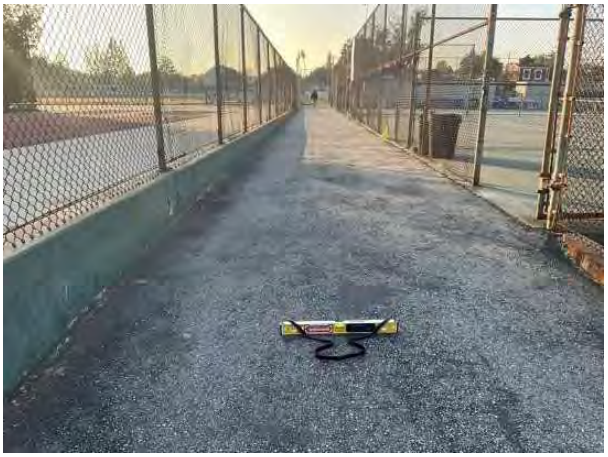





Barrier ID: AX420226

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3
Barrier Detail	The accessible route has cross slopes greater than 1:50 (2%).
Location Description	Baseball Field Concession Stand Area
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	A small area near the dining tables slopes, 2.8% for an area 5' x 5'

Resolution

The walkway should be graded to a maximum 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope and maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not exceeding 1:48 (2.08%) are permitted.] The clear width of walking surfaces shall be 36" minimum. [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

25 SF


Priority	1

Map for Barrier ID: AX420226



605 +34.162594, -118.094540

Photos for Barrier ID: AX420226

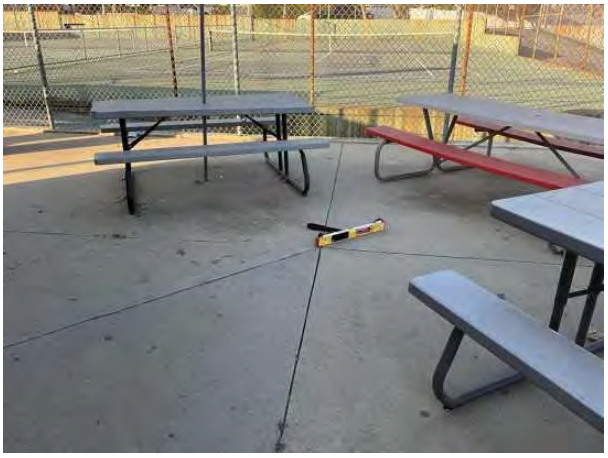



Barrier ID: AX420223

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	206.2.2; 206.2.4

Barrier Detail

An accessible route does not connect accessible building or facility entrances with all accessible spaces and elements within the building or facility. At least one accessible route shall connect accessible elements that are on the same site.

Location Description	Baseball Field Seating
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	180 total bench seats provided at the bleachers

Resolution

Provide an accessible route to connect to the space or element. At least one accessible route shall connect accessible elements that are on the same site. The accessible route shall be minimum 36" wide and shall have a running slope not steeper than 1:20 and cross slope not steeper than 1:48. EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.

Quantity

50 SF

Priority	1

Map for Barrier ID: AX420223



602 +34.162445, -118.094824

Photos for Barrier ID: AX420223











Barrier ID: AX424526

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	206.2.2; 206.2.4

Barrier Detail

An accessible route does not connect accessible building or facility entrances with all accessible spaces and elements within the building or facility. At least one accessible route shall connect accessible elements that are on the same site.

Location Description	Batting Cages And Practice Area
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The batting cages are not connected to an accessible route

Resolution

Provide an accessible route to connect to the space or element. At least one accessible route shall connect accessible elements that are on the same site. The accessible route shall be minimum 36" wide and shall have a running slope not steeper than 1:20 and cross slope not steeper than 1:48. EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.

Quantity

263 SF

Priority	1

Map for Barrier ID: AX424526



772 +34.162162, -118.095826

Photos for Barrier ID: AX424526













Barrier ID: AX418365

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	206.2.2; 206.2.4

Barrier Detail

An accessible route does not connect accessible building or facility entrances with all accessible spaces and elements within the building or facility. At least one accessible route shall connect accessible elements that are on the same site.

Location Description	Bench Southeast Side of Building G
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The bench is not on an accessible route.

Resolution


Provide an accessible route to connect to the space or element. At least one accessible route shall connect accessible elements that are on the same site. The accessible route shall be minimum 36" wide and shall have a running slope not steeper than 1:20 and cross slope not steeper than 1:48. EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.

Quantity

225 SF

Priority	1

Map for Barrier ID: AX418365

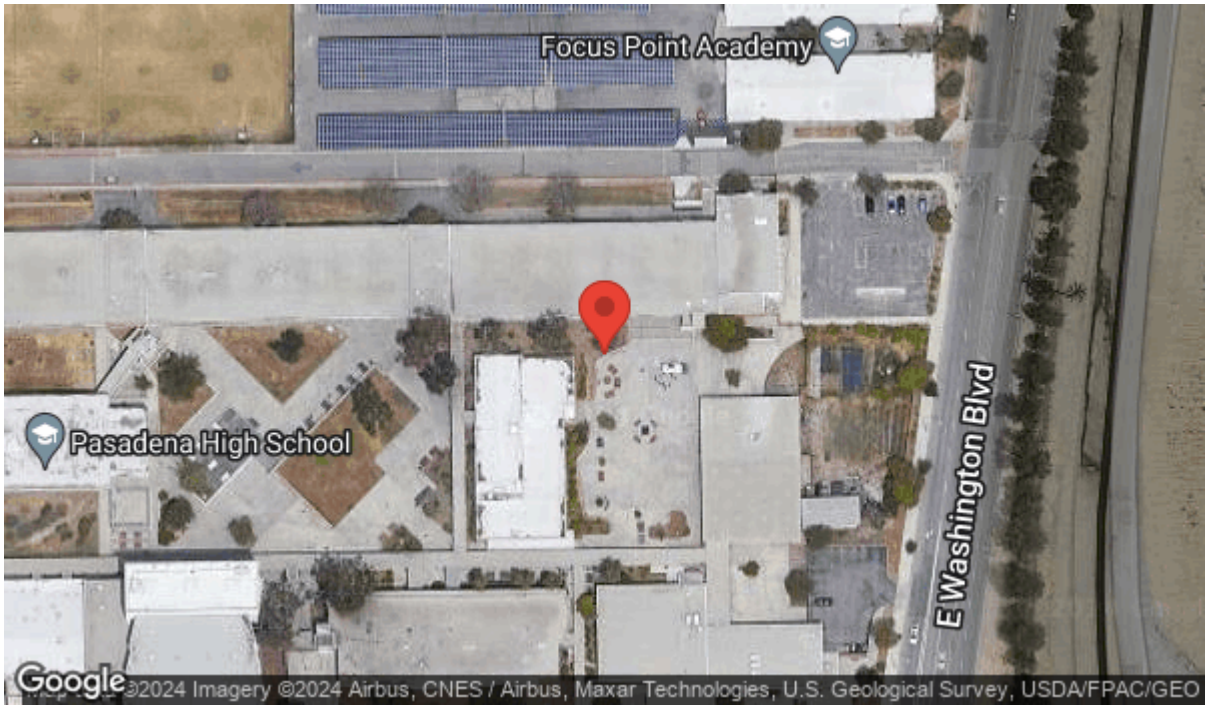

176 +34.162774, -118.091019

Photos for Barrier ID: AX418365









Barrier ID: AX424500

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3

Barrier Detail

The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.

Location Description	Building A - Main Public Entrance
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The sidewalk leading up to the main entrance has running slopes up to 6.2% and cross slopes up to 3.3% for a length of 20 feet by 5 feet wide.

Resolution

The accessible route should be graded to a maximum 1:20 (5%) running slope and 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope, maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not greater than 1:48 (2.08%) are permitted.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. An accessible route has a minimum clear width 36". [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

100 SF

Priority	1

Map for Barrier ID: AX424500



746 +34.162038, -118.091579

Photos for Barrier ID: AX424500













Barrier ID: AX418665

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	303

Barrier Detail

The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.

Location Description	Building P - P103
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door landing has an abrupt change in level 1 1/4 inches high.

Resolution


The accessible route should be repaired to eliminate vertical level changes greater than 1/4". Changes in level of 1/4" high maximum shall be permitted to be vertical. Changes in level between 1/4" high minimum and 1/2" high maximum shall be beveled with a slope not steeper than 1:2. Changes in level greater than 1/2" shall be ramped.

Quantity

5 SF

Priority	1

Map for Barrier ID: AX418665

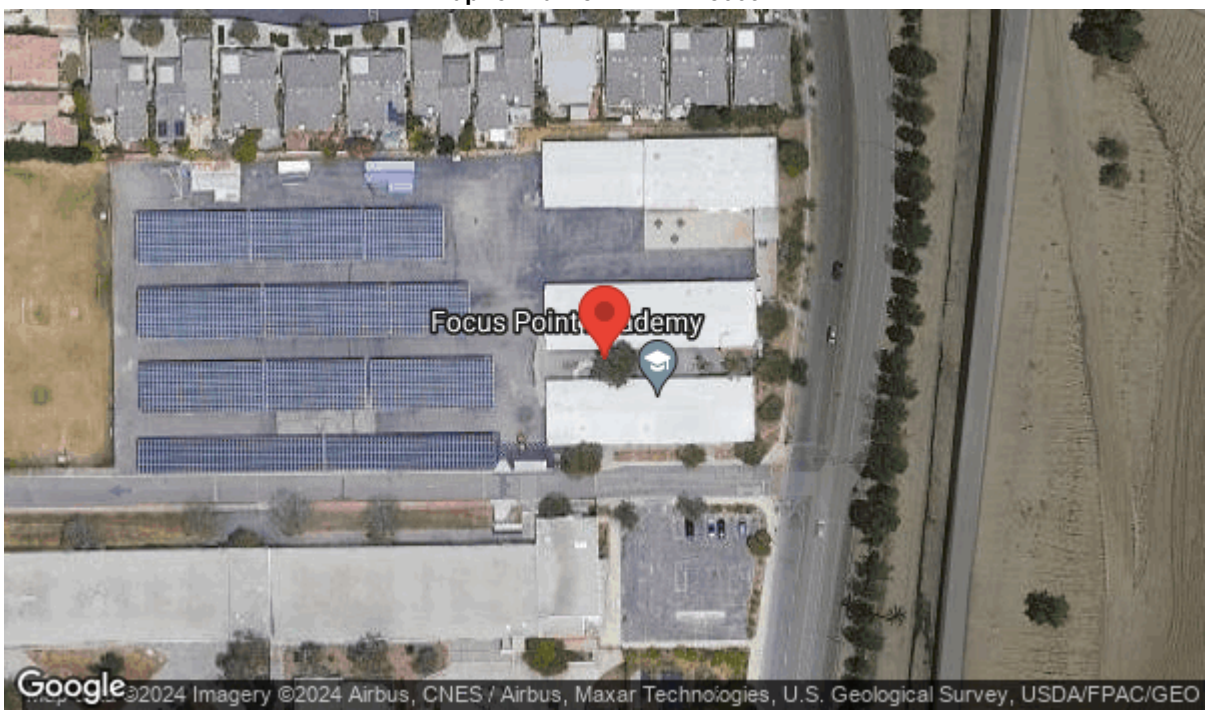

235 +34.163478, -118.090531

Photos for Barrier ID: AX418665







Barrier ID: AX424504

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3

Barrier Detail

The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.

Location Description	Building V - West Exit
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The sidewalk at the cafeteria west exit is 41 inches wide for a length of 14' x 4' wide

Resolution

The accessible route should be graded to a maximum 1:20 (5%) running slope and 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope, maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not greater than 1:48 (2.08%) are permitted.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. An accessible route has a minimum clear width 36". [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

56 SF

Priority	1

Map for Barrier ID: AX424504



750 +34.162091, -118.091042

Photos for Barrier ID: AX424504





Barrier ID: AX420229

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	303

Barrier Detail

Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.

Location Description	Entrances To Tennis Courts
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Entrances to the tennis courts have a transition at the asphalt to concrete with abrupt changes and level up to 3/4 of an inch high.

Resolution

The sidewalk should be removed (sections that are heaved, cracked etc) and repaired. Changes in level of 1/4" high maximum shall be permitted to be vertical. Changes in level between 1/4" high minimum and 1/2" high maximum shall be beveled with a slope not steeper than 1:2. Changes in level greater than 1/2" shall be ramped.

Quantity

35 SF

Priority	1

Map for Barrier ID: AX420229



608 +34.162611, -118.095042

Photos for Barrier ID: AX420229











Barrier ID: AX420155

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	303

Barrier Detail

Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.

Location Description	Exterior Basketball Courts East of Building R
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Exterior basketball courts west of building R, asphalt has cracks greater than 1 1/2 creating abrupt changes and level up to 2 1/2 inches high.

Resolution

The sidewalk should be removed (sections that are heaved, cracked etc) and repaired. Changes in level of 1/4" high maximum shall be permitted to be vertical. Changes in level between 1/4" high minimum and 1/2" high maximum shall be beveled with a slope not steeper than 1:2. Changes in level greater than 1/2" shall be ramped.

Quantity

130 SF

Priority	1

Map for Barrier ID: AX420155



534 +34.161916, -118.093689


Photos for Barrier ID: AX420155









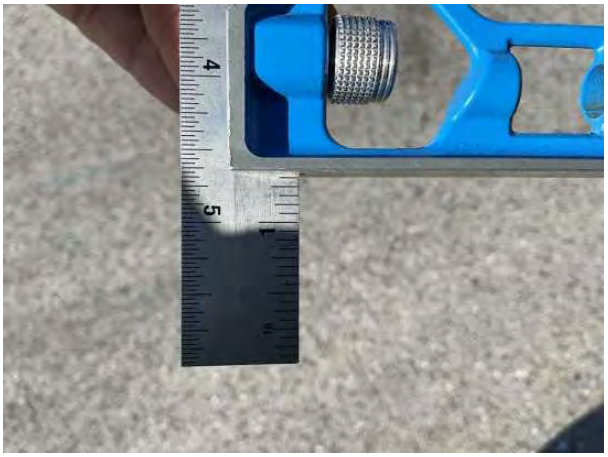



Barrier ID: AX424524

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	206.2.2; 206.2.4

Barrier Detail

An accessible route does not connect accessible building or facility entrances with all accessible spaces and elements within the building or facility. At least one accessible route shall connect accessible elements that are on the same site.

Location Description	Football Field Bleachers
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The accessible wheelchair space area does not is not connected to an accessible route.

Resolution

Provide an accessible route to connect to the space or element. At least one accessible route shall connect accessible elements that are on the same site. The accessible route shall be minimum 36" wide and shall have a running slope not steeper than 1:20 and cross slope not steeper than 1:48. EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.

Quantity

100 SF

Priority	1

Photos for Barrier ID: AX424524









Barrier ID: AX420220

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	302.3
Barrier Detail	The accessible route has gaps in the surface greater than 1/2" wide.
Location Description	Handball Court Asphalt to Concrete Transition
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The asphalt to concrete transition has a bump changes creating a change in level 1 inch high and gaps up to 4 inches wide for a total length of 240 linear feet.

Resolution

Repair the accessible route to eliminate openings in the surface greater than 1/2" wide. Openings in the ground surface of the accessible route shall not allow passage of a sphere more than 1/2" diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.

Quantity

240 SF

Priority	1

Photos for Barrier ID: AX420220













Barrier ID: AX424522

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	303

Barrier Detail

Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.

Location Description	Lower Quad Near Near West Library Entrance
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Cracks in the concrete are creating abrupt changes and level up to 3/4 of an inch high.

Resolution


The sidewalk should be removed (sections that are heaved, cracked etc) and repaired. Changes in level of 1/4" high maximum shall be permitted to be vertical. Changes in level between 1/4" high minimum and 1/2" high maximum shall be beveled with a slope not steeper than 1:2. Changes in level greater than 1/2" shall be ramped.

Quantity

50 SF

Priority	1

Map for Barrier ID: AX424522

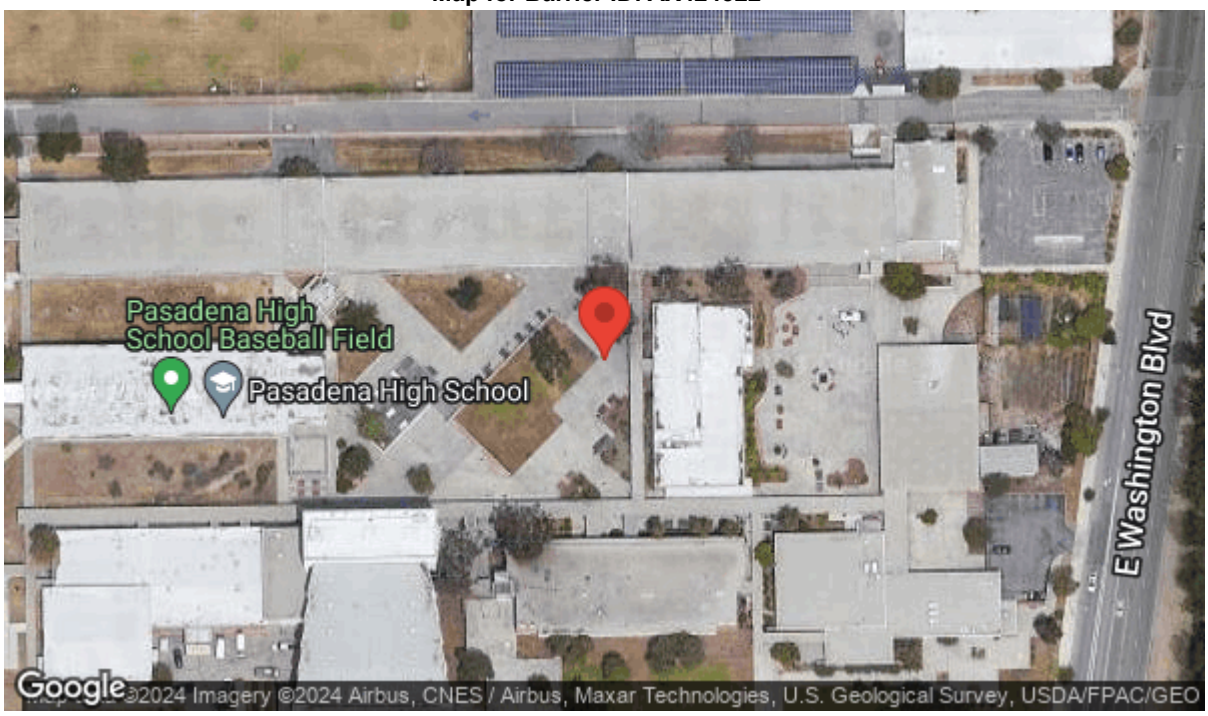

 +34.162643, -118.091494

Photos for Barrier ID: AX424522









Barrier ID: AX424523

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	303

Barrier Detail

Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.

Location Description	Lower Quad Near Near West Library Entrance
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Cracks in the concrete are creating abrupt changes and level up to 3/4 of an inch high

Resolution

The sidewalk should be removed (sections that are heaved, cracked etc) and repaired. Changes in level of 1/4" high maximum shall be permitted to be vertical. Changes in level between 1/4" high minimum and 1/2" high maximum shall be beveled with a slope not steeper than 1:2. Changes in level greater than 1/2" shall be ramped.

Quantity

20 SF

Priority	1

Map for Barrier ID: AX424523



769 +34.162364, -118.091728

Photos for Barrier ID: AX424523









Barrier ID: AX418355

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	UFAS 4.4.2
Barrier Detail	The accessible route has less than 80" vertical clearance.
Location Description	POT from City Sidewalk to Abel Franco Theater
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Tree branches encroach into the accessible route. The branches hang as low as 40 inches above the floor.

Resolution

Provide an accessible route with minimum 80" head room. Walks, halls, corridors, passageways, aisles, or other circulation spaces shall have 80" minimum clear head room (see Fig. 8(a)). If vertical clearance of an area adjoining an accessible route is reduced to less than 80" (nominal dimension), a barrier to warn blind or visually-impaired persons shall be provided (see Fig. 8(c)).

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418355



166 +34.162863, -118.090375

Photos for Barrier ID: AX418355

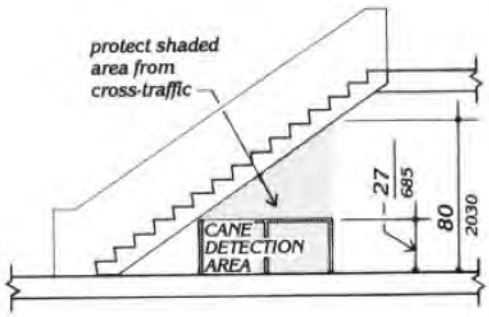


Figure 8(c)
Protruding Objects
Overhead Hazards







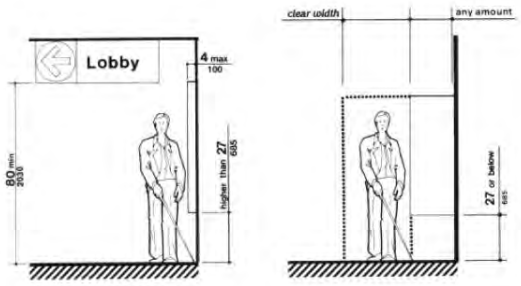


Figure 8(a)
Protruding Objects
Walking Parallel to a Wall



Barrier ID: AX424527

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	303

Barrier Detail

Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.

Location Description	Route to Soccer And Softball Field
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The route up the driveway and crossing the street has running slopes up to 10% and cross slopes up to 6.4%. For a length of 70' x 4' wide.

Resolution

The sidewalk should be removed (sections that are heaved, cracked etc) and repaired. Changes in level of 1/4" high maximum shall be permitted to be vertical. Changes in level between 1/4" high minimum and 1/2" high maximum shall be beveled with a slope not steeper than 1:2. Changes in level greater than 1/2" shall be ramped.

Quantity

100 SF

Priority	1

Map for Barrier ID: AX424527



773 +34.163209, -118.093681

Photos for Barrier ID: AX424527













Barrier ID: AX424529

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	California Building Code Chap 11-B-307.4
Barrier Detail	CALIFORNIA: The accessible route does not have 80" vertical clearance.
Location Description	Route to Soccer And Softball Field
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	Tree branches, hang 63 inches above the ground

Resolution

Provide at least 80" vertical head space along the accessible route. Where vertical clearance is less than 80" high, a barrier or guardrail 27" high maximum shall be provided. Where a guy support is used either within the circulation path or 24" maximum outside of the circulation path, the support shall be a vertical guy brace, sidewalk guy or similar device used to prevent an overhead obstruction.

Quantity

3 EA

Priority	1

Map for Barrier ID: AX424529



775 +34.163269, -118.093775

Photos for Barrier ID: AX424529







Barrier ID: AX424531

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	303

Barrier Detail

Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.

Location Description	Route to Soccer And Softball Field
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The sidewalk has an abrupt change in level up to 7/8 of an inch high at 3 locations.

Resolution

The sidewalk should be removed (sections that are heaved, cracked etc) and repaired. Changes in level of 1/4" high maximum shall be permitted to be vertical. Changes in level between 1/4" high minimum and 1/2" high maximum shall be beveled with a slope not steeper than 1:2. Changes in level greater than 1/2" shall be ramped.

Quantity

30 SF

Priority	1

Map for Barrier ID: AX424531




777 +34.163357, -118.093807

Photos for Barrier ID: AX424531







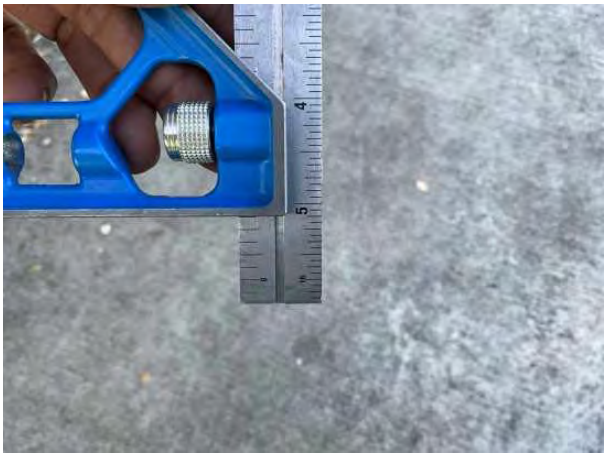

Barrier ID: AX418688

Pasadena High School BUILDING W

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	California Building Code Chap 11B-403.5.1
Barrier Detail	CALIFORNIA: The exterior accessible route is less than 48" wide.
Location Description	Service Windows at Building W
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The route to three windows are limited to 23 inches wide and 32 inches wide due to the railings.

Resolution


Install a compliant exterior accessible route. An exterior accessible route has a minimum clear width of 48", maximum 1:20 (5%) running slope and maximum 1:48 (2.08%) cross slope. [EXCEPTION: Where rights-of-way, natural barriers or other existing conditions are present, the enforcing agency may determine that compliance with the 48" minimum clear width would create an unreasonable hardship. If the enforcing agency determines that an unreasonable hardship exists, the clear width may be reduced to 36" minimum.]

Quantity

60 SF

Priority	1

Map for Barrier ID: AX418688

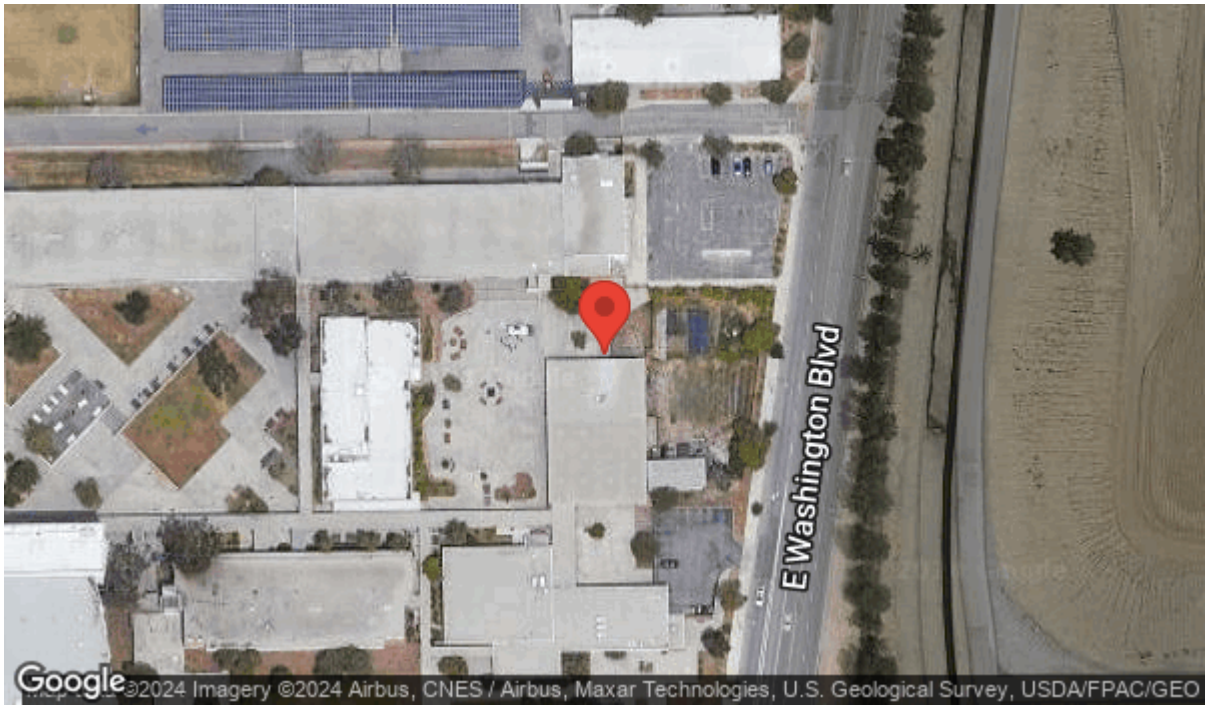


258 +34.162689, -118.090601

Photos for Barrier ID: AX418688







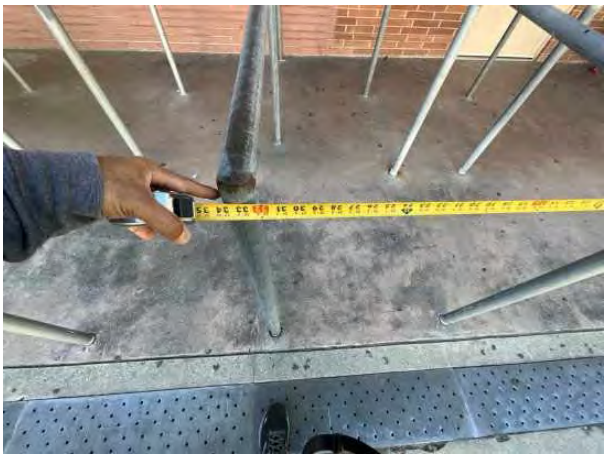

Barrier ID: AX418226

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	UFAS 4.8.7; Fig 17.
Barrier Detail	Edge protection is not provided where the ramp or landing has a drop-off.
Location Description	Sidewalk Adjacent South Side of The Auditorium
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The sidewalk has areas where the drop off is more than 4 inches in height the drop off measures 9 1/2 inches high.

Resolution

Install compliant edge protection to the ramp. Ramps and landings with drop-offs shall have curbs, walls, railings, or projecting surfaces that prevent people from slipping off the ramp. Curbs shall be a minimum of 2" high (see Figure 17).

Quantity

17 LF

Priority	1

Map for Barrier ID: AX418226



37 +34.161850, -118.091934

Photos for Barrier ID: AX418226









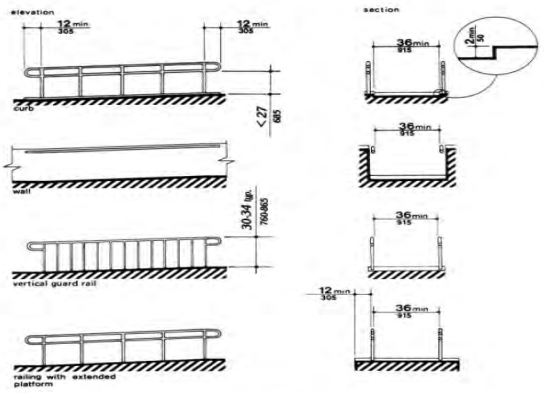


Figure 17
Examples of Edge Protection and Handrail Extensions

Barrier ID: AX420153

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3
Barrier Detail	The accessible route has cross slopes greater than 1:50 (2%).
Location Description	Sidewalk Adjacent to Building C
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

39 feet of sidewalk west of building C has cross slopes up to 5.3% For length of 39' x 15'

Resolution

The walkway should be graded to a maximum 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope and maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not exceeding 1:48 (2.08%) are permitted.] The clear width of walking surfaces shall be 36" minimum. [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

585 SF


Priority	1


Map for Barrier ID: AX420153



532 +34.162214, -118.093046

Photos for Barrier ID: AX420153

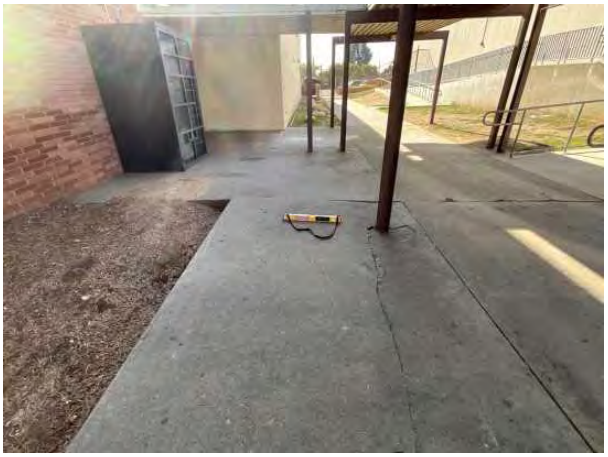

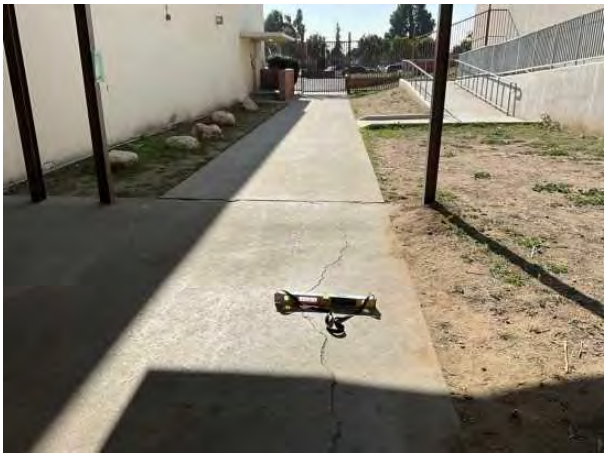









Barrier ID: AX420154

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	303

Barrier Detail

Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.

Location Description	Sidewalk Adjacent to Building C
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The sidewalk has cracks, creating gaps wider 1/2 inch and creating abrupt changes in level up to an 1 1/2 inch high for a length of 40 linear feet.

Resolution


The sidewalk should be removed (sections that are heaved, cracked etc) and repaired. This barrier must be removed in conjunction with barrier ID 420153. The cost of this barrier removal is covered under ID 420153 and therefore, the cost of this ID is shown as $0. Changes in level of 1/4" high maximum shall be permitted to be vertical. Changes in level between 1/4" high minimum and 1/2" high maximum shall be beveled with a slope not steeper than 1:2. Changes in level greater than 1/2" shall be ramped.

Quantity

40 SF

Priority	1

Map for Barrier ID: AX420154

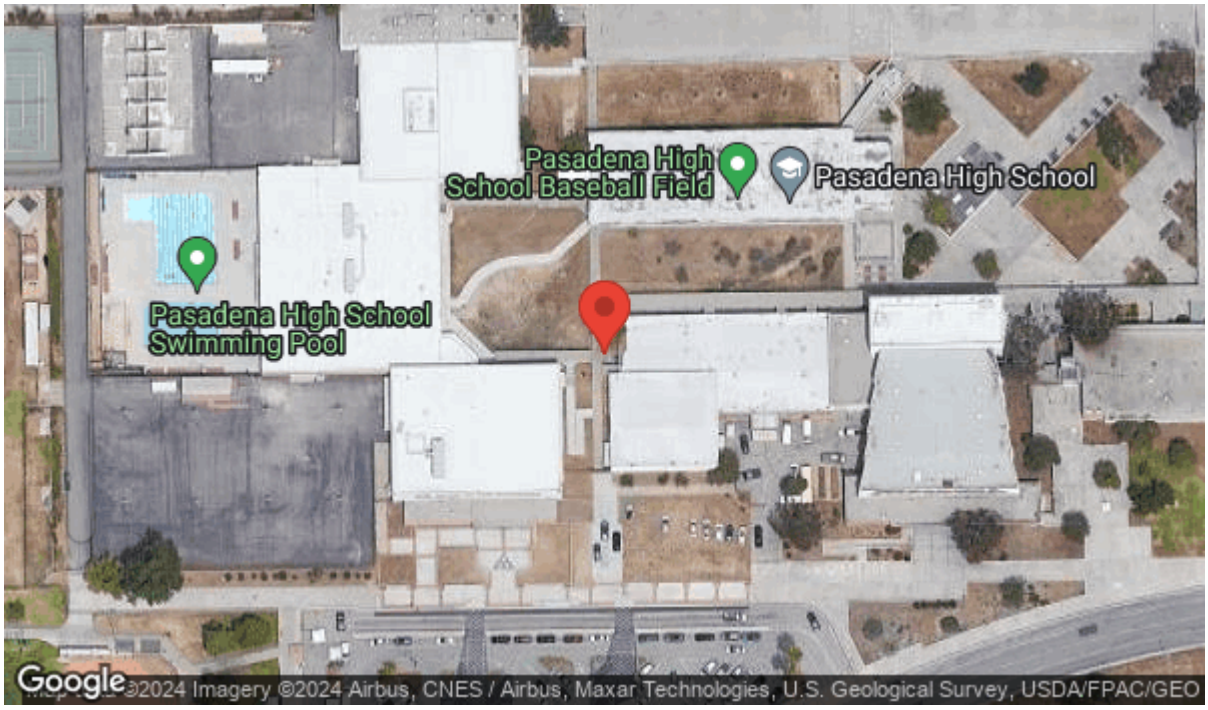


533 +34.162182, -118.093010

Photos for Barrier ID: AX420154







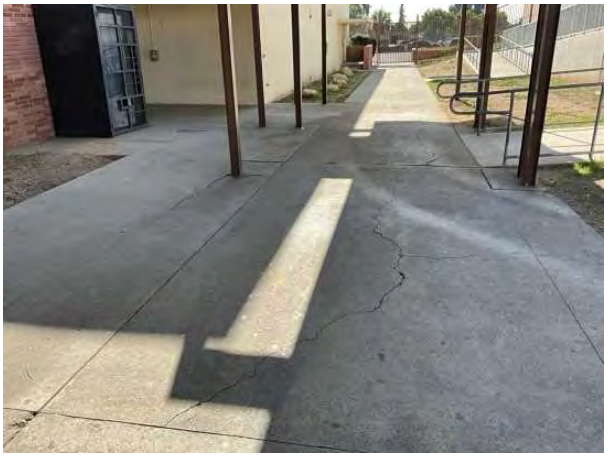





Barrier ID: AX424515

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3

Barrier Detail

The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.

Location Description	Upper Quad Asphalt Dining Area
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The entire asphalt dining area has cracks and heaving, causing cross slopes and abrupt changes in level for the entire surface.

Resolution

The accessible route should be graded to a maximum 1:20 (5%) running slope and 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope, maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not greater than 1:48 (2.08%) are permitted.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. An accessible route has a minimum clear width 36". [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

528 SF

Priority	1

Map for Barrier ID: AX424515




761 +34.162624, -118.091942

Photos for Barrier ID: AX424515







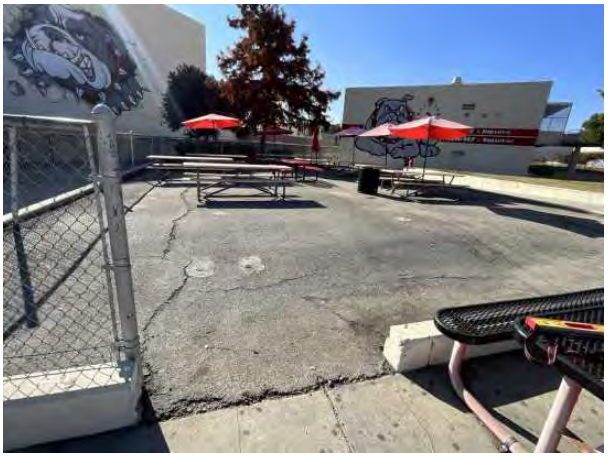





Barrier ID: AX424519

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	403.3

Barrier Detail

The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.

Location Description	Upper Quad Dining Area
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Seven tables are provided none of which are accessible. Each table seats eight persons..

Resolution


The accessible route should be graded to a maximum 1:20 (5%) running slope and 1:50 (2%) cross slope. An accessible route has maximum 1:20 (5%) running slope, maximum 1:50 (2%) cross slope. [EXCEPTION: Cross slopes not greater than 1:48 (2.08%) are permitted.] Where grading to maximum running slope of 1:20 (5% running slope) is not possible, provide a compliant ramped surface within the walkway with maximum slope 1:12 (8.33%) and maximum ramp run rise of 6" without handrails. If a ramped surface with running slopes greater than 1:20 (5%) and maximum 1:12 (8.33%) rises more than 6", handrails are required. An accessible route has a minimum clear width 36". [EXCEPTION: The clear width shall be permitted to be reduced to 32" minimum for a length of 24" maximum provided that reduced width segments are separated by segments that are 48" long minimum and 36" wide minimum.] The cost estimate for this barrier removal is based on grading the running slope to maximum 1:20 (5%). The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

25 SF

Priority	1

Map for Barrier ID: AX424519

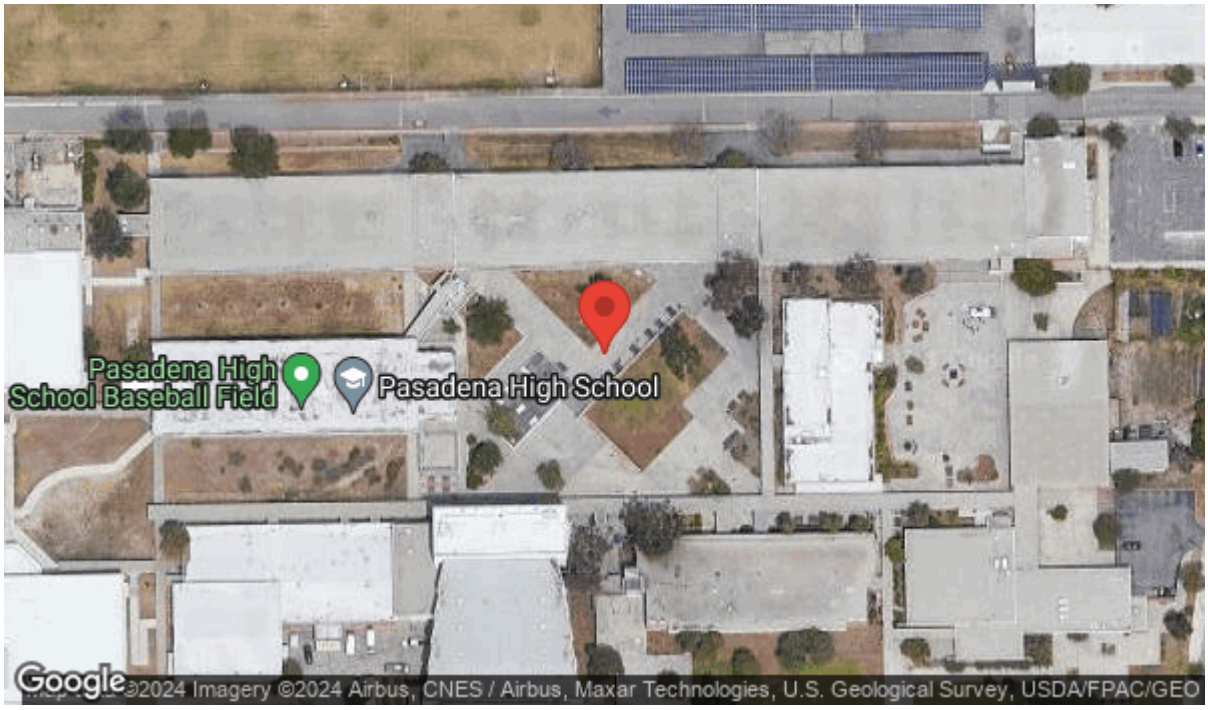

765 +34.162650, -118.091845

Photos for Barrier ID: AX424519







Barrier ID: AX419737

Pasadena High School BUILDING H

Assembly	Interior Access Route
Type	Head Room
ADA Standard	307.4
Barrier Detail	The height of the interior accessible route is less than 80" AFF.
Location Description	Building H - H202
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The T.V. bottom edge is 75 inches above floor.

Resolution

Ensure minimum vertical clearance of 80" is provided, unless a barrier or guardrail is installed to warn blind or visually impaired persons. The leading edge of such a barrier or guardrail shall be located 27" maximum above finish floor.

Quantity

1 PR

Priority	1

Photos for Barrier ID: AX419737







Barrier ID: AX419736

Pasadena High School BUILDING H

Assembly	Interior Access Route
Type	Head Room
ADA Standard	307.4
Barrier Detail	The height of the interior accessible route is less than 80" AFF.
Location Description	Building H - H208
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The T.V. bottom edge is 65 1/2 inches above the floor.

Resolution

Ensure minimum vertical clearance of 80" is provided, unless a barrier or guardrail is installed to warn blind or visually impaired persons. The leading edge of such a barrier or guardrail shall be located 27" maximum above finish floor.


Quantity

1 PR

Priority	1

Photos for Barrier ID: AX419736



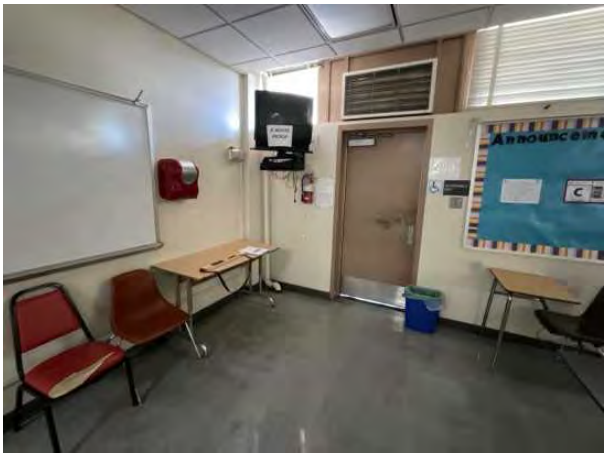



Barrier ID: AX418728

Pasadena High School BUILDING I

Assembly	Interior Access Route
Type	Head Room
ADA Standard	307.4
Barrier Detail	The height of the interior accessible route is less than 80" AFF.
Location Description	Building I - I109
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The T.V. bottom edge is 71 inches above the floor.

Resolution


Ensure minimum vertical clearance of 80" is provided, unless a barrier or guardrail is installed to warn blind or visually impaired persons. The leading edge of such a barrier or guardrail shall be located 27" maximum above finish floor.

Quantity

1 PR

Priority	1

Photos for Barrier ID: AX418728

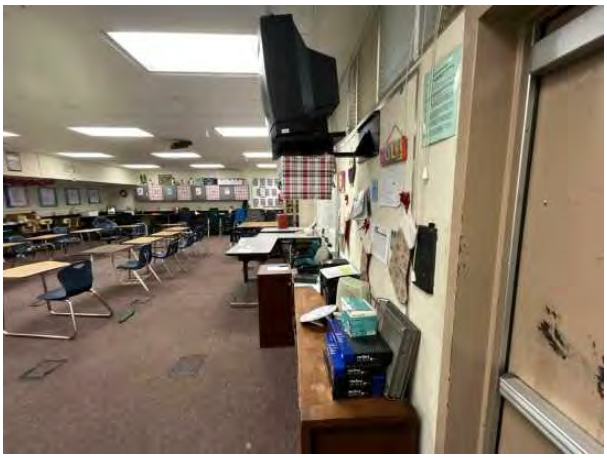



Barrier ID: AX419822

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Head Room
ADA Standard	307.4
Barrier Detail	The height of the interior accessible route is less than 80" AFF.
Location Description	Typical Classroom Monitors Too Low
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The TV monitor has the bottom edge at 73 1/2 inches and protrudes 14 inches from the wall. Building E has 4. Building H has 2. Building I has 3.

Resolution


Ensure minimum vertical clearance of 80" is provided, unless a barrier or guardrail is installed to warn blind or visually impaired persons. The leading edge of such a barrier or guardrail shall be located 27" maximum above finish floor.

Quantity


9 PR

Priority	1

Photos for Barrier ID: AX419822

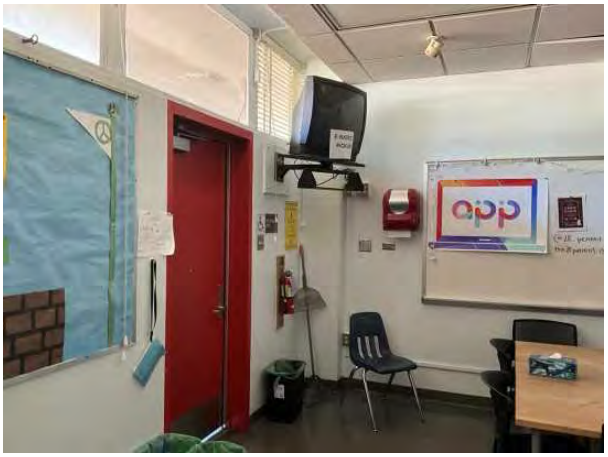



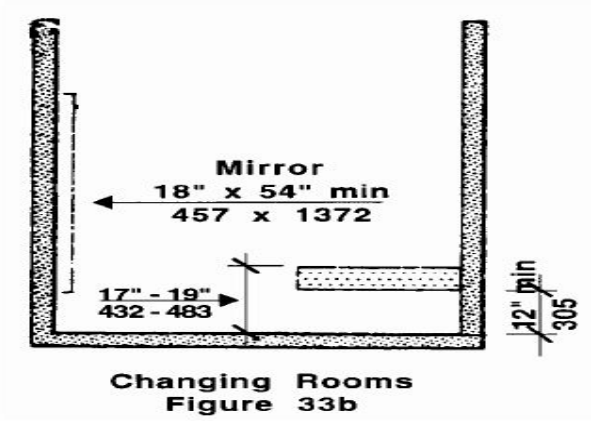

Changing Rooms
Figure 33b













Barrier ID: AX419856

Pasadena High School BUILDING C

Assembly	Interior Access Route
Type	Interior Access Route
ADA Standard	California Building Code Chap 11B-403.5.1, Exception 4
Barrier Detail	CALIFORNIA: The width of the aisle is not compliant.
Location Description	Building C - C112 Workroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	the aisle is 35 inches wide.

Resolution

Widen the walkway aisle to minimum 44" clear width. The clear width for aisles shall be 36" minimum if serving elements on only one side, and 44" minimum if serving elements on both sides.


Quantity

200 SF

Priority	1

Photos for Barrier ID: AX419856



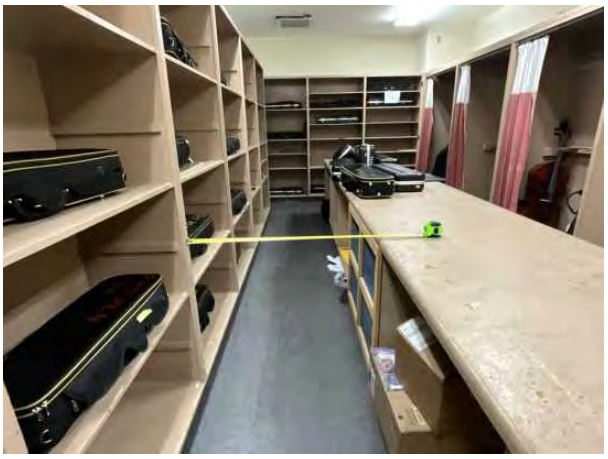

Barrier ID: AX418648

Pasadena High School BUILDING Q

Assembly	Interior Access Route
Type	Interior Access Route
ADA Standard	302.3

Barrier Detail

Gaps in the walking surface are over 1/2" wide, or elongated gaps are not perpendicular to the path of travel.

Location Description	Building Q - Q109A
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The drain grate has gaps up to 1 inch wide

Resolution


Ensure all gaps in the floor are 1/2" wide maximum. Elongated gaps must be perpendicular to path of travel.

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX418648

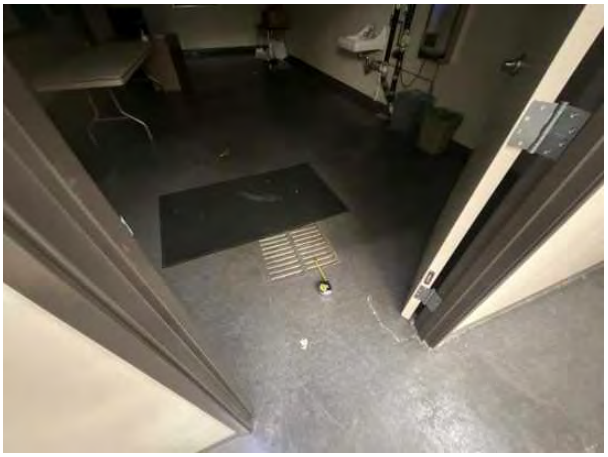



Barrier ID: AX418692

Pasadena High School BUILDING V

Assembly	Interior Access Route
Type	Interior Access Route
ADA Standard	California Building Code Chap 11B-403.5.1, Exception 4
Barrier Detail	CALIFORNIA: The width of the aisle is not compliant.
Location Description	Building V- V104 Servery
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The serving aisles are less than 36 inches wide. 1 serving aisle is 23 1/2 inches wide. Another serving aisle is 21 1/2 inches wide and the third serving aisle is 29 1/2 inches wide.

Resolution

Widen the walkway aisle to minimum 44" clear width. The clear width for aisles shall be 36" minimum if serving elements on only one side, and 44" minimum if serving elements on both sides.


Quantity

270 SF

Priority	1

Photos for Barrier ID: AX418692



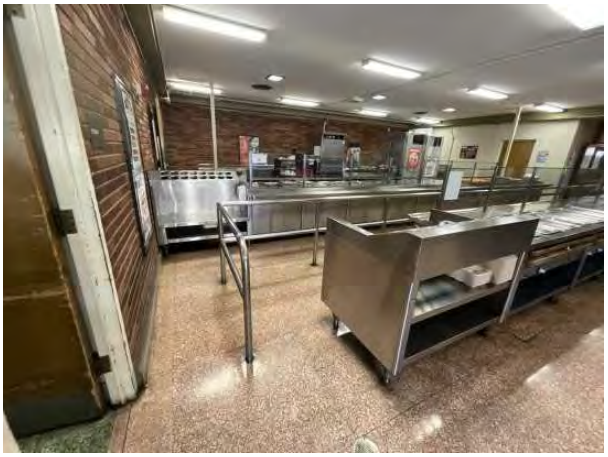









Barrier ID: AX419899

Pasadena High School BUILDING S

Assembly	Employee Work Areas
Type	Locker Rooms
ADA Standard	222.1; 222.2; 803; 304
Barrier Detail	The locker rooms are not accessible.
Location Description	Building S - S130 Faculty Locker Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The bottom shelf is 7 inches above the floor. The top shelf is 64 inches above the floor and the coat hooks are 62 inches above the floor. At least one accessible locker is required to be accessible.

Resolution

Provide a compliant locker room/dressing room. Where dressing rooms, fitting rooms, or locker rooms are provided, at least 5 percent, but no fewer than one, of each type of use in each cluster provided shall comply. Where only unisex rooms are provided, unisex rooms shall be permitted. [EXCEPTION: In alterations, where it is technically infeasible to provide rooms, one room for each sex on each level shall comply.] Compliant turning space complying shall be provided within the room; Doors shall not swing into the room unless a clear floor or compliant ground space is provided beyond the arc of the door swing. BENCH: A compliant bench shall be provided within the room. The bench shall have an adjacent clear space of 30" minimum by 48" minimum located at the end of the bench and parallel to the axis of the bench. The top of the seat shall be 17" minimum and 19" maximum from finish floor. The seat shall be 42" minimum long. The seat shall have a depth of 20" minimum and 24" maximum. The bench shall provide back support or be affixed to a wall. Back support shall be 42" minimum in length extending from a point 2" maximum above the seat surface to 18" minimum above the seat surface. Back support shall be 2-1/2" maximum from the rear edge of the seat measured horizontally. When installed in wet locations, the surface of the seat shall be slip resistant and shall not accumulate water. SHELVES AND COAT HOOKS: Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply. Where coat hooks or shelves are provided in individual compartments, at least one of each type shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply. Shelves shall be 40" minimum and 48" maximum above the finish floor or ground. Coat hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]


Quantity

1 EA

Priority	1
Employee Only Space	Yes

Photos for Barrier ID: AX419899



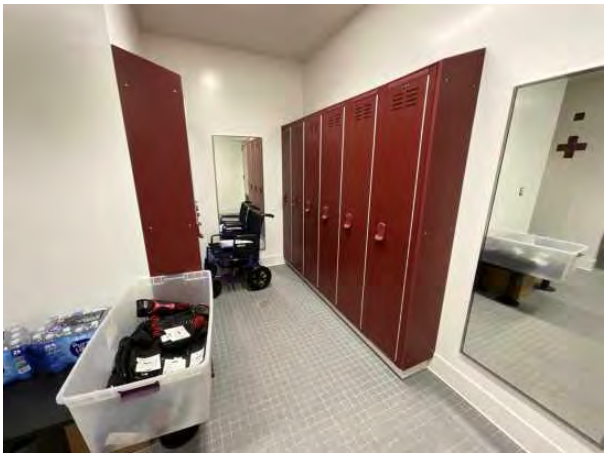







Barrier ID: AX420216

Pasadena High School SPORTS FACILITIES

Assembly	Swimming Pools
Type	Method Of Access - General
ADA Standard	242.2; 1009

Barrier Detail

Two accessible methods of entry into the standard swimming pool with 300 linear feet or more of pool wall are not provided.

Location Description	Swimming Pool North Side
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The swimming pool on the North side is approximately 300 linear feet and does not provide at least one accessible entrance to the pool. the pool has 2 stare type entrances

Resolution

Provide two methods of transfer into the pool where the total length of pool wall is 300 linear feet or greater. Accessible means of entry into a swimming pool shall be swimming pool lifts, sloped entries, transfer walls, transfer systems, and pool stairs. At least one accessible means of entry provided shall comply with pool lifts or sloped entries. [EXCEPTIONS: 1. Where a swimming pool has less than 300 linear feet of swimming pool wall, no more than one accessible means of entry shall be required, provided that the accessible means of entry is a swimming pool lift or sloped entry. 2. Wave action pools, leisure rivers, sand bottom pools, and other pools where user access is limited to one area shall not be required to provide more than one accessible means of entry provided that the accessible means of entry is a swimming pool lift, a sloped entry, or a transfer system. 3. Catch pools shall not be required to provide an accessible means of entry provided that the catch pool edge is on an accessible route.] [ADVISORY TO EXCEPTION 1: Pool walls at diving areas and areas along pool walls where there is no pool entry because of landscaping or adjacent structures are to be counted when determining the number of accessible means of entry required.] A sloped entry is required into a wading pool.

Quantity

1 EA


Priority	1


Map for Barrier ID: AX420216





595 +34.162330, -118.094203


Photos for Barrier ID: AX420216

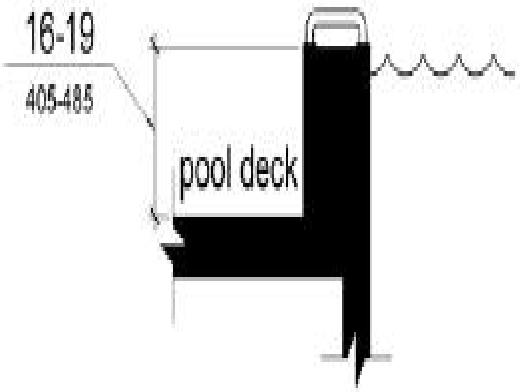

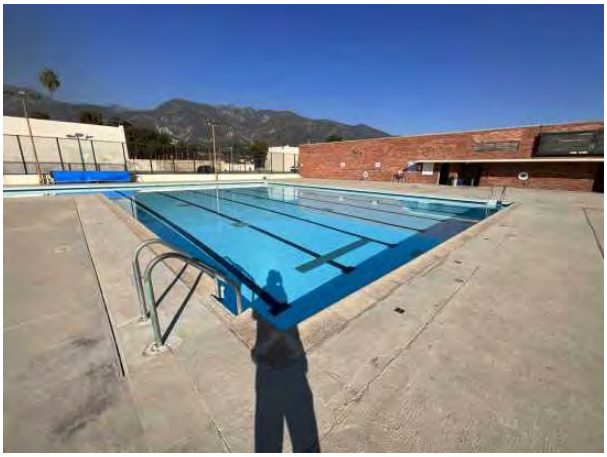

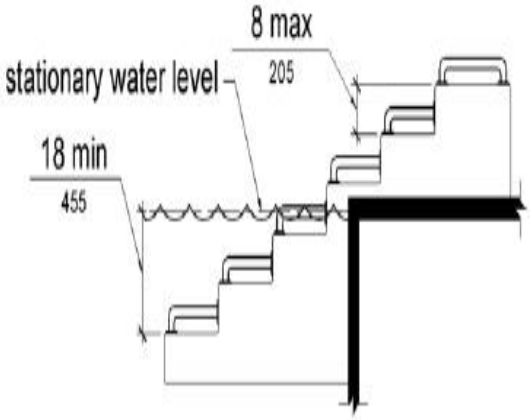

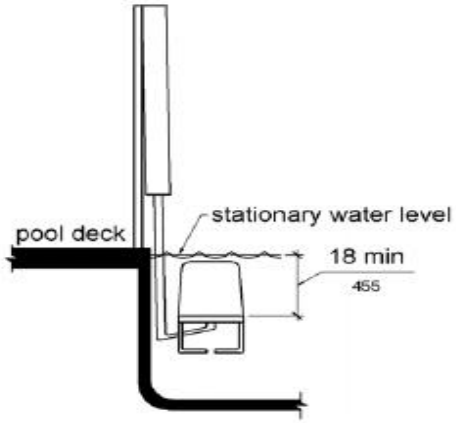

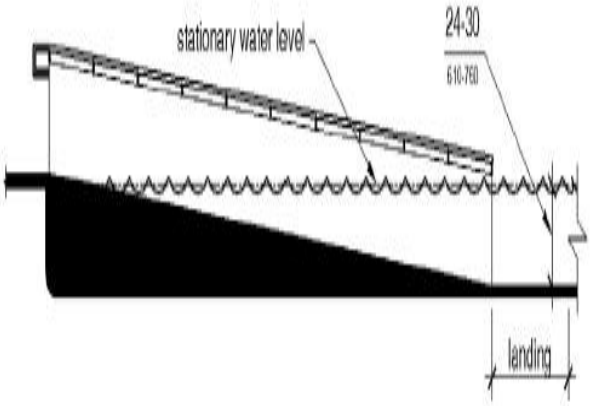





Barrier ID: AX420213

Pasadena High School SPORTS FACILITIES

Assembly	Swimming Pools
Type	Method Of Access - General
ADA Standard	242.2; 1009

Barrier Detail

One accessible method of entry into the standard swimming pool with less than 300 linear feet of pool wall is not provided.

Location Description	Swimming Pool South Side
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The swimming pool on the south side is approximately 190 linear feet and does not provide at least one accessible entrance to the pool. the pool has four stare type entrances

Resolution

Provide one method of transfer into the pool where the total length of pool wall is less than 300 linear feet. The accessible means of entry provided shall comply with pool lifts or sloped entries. [ADVISORY: Pool walls at diving areas and areas along pool walls where there is no pool entry because of landscaping or adjacent structures are to be counted when determining the number of accessible means of entry required.]

Quantity

1 EA


Priority	1

Map for Barrier ID: AX420213




592 +34.162259, -118.094050

Photos for Barrier ID: AX420213

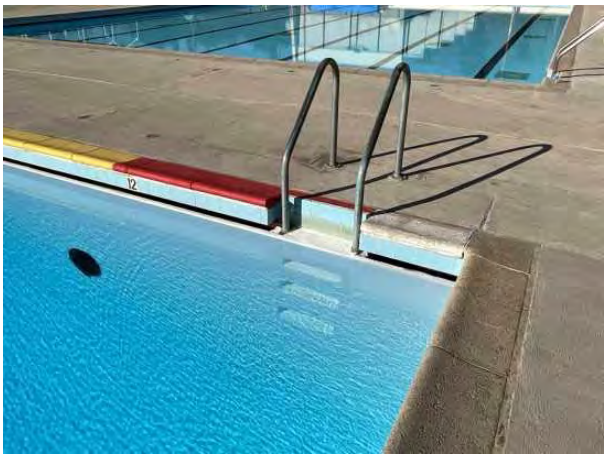



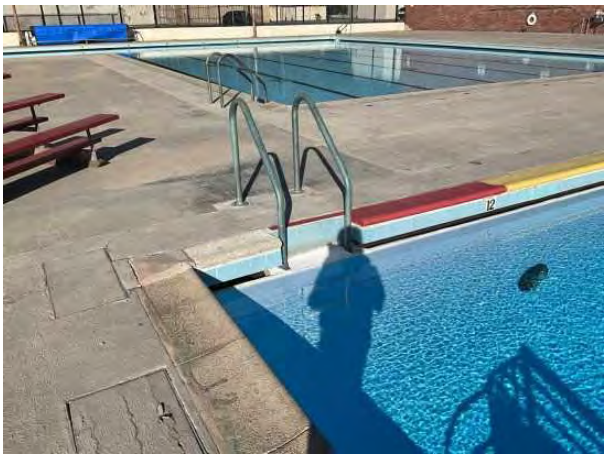

Barrier ID: AX418204

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Car
ADA Standard	California Building Code Chap 11B-502.2

Barrier Detail

CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').

Location Description	Access Aisle Serving Accessible Parking Space P1-D
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The access does not extend the full length of the parking space.

Resolution

Redesign and restripe the car stall to the required minimum length of 216" (18'). Car stalls shall be 108" (9') wide minimum, measured from the middle of stripe to middle of stripe for all measurements. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or accessible aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] Car stalls have surface markings with EITHER: 1. the International Symbol of Accessibility in white on a blue background a minimum 36"x 36" high OR 2. stall outlined or painted in blue, with the International Symbol of Accessibility in white or a suitable contrasting color and a minimum 36" by 36" high. In either case, the centerline of the International Symbol of Accessibility shall be 6" maximum from the centerline of the stall, its sides parallel to the length of the stall and its lower end at or aligned with the end of the parking space length.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418204



15 +34.161454, -118.093252

Photos for Barrier ID: AX418204







Barrier ID: AX418194

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Car
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).
Location Description	Accessible Parking Space P1-B
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes, 3.6%.

Resolution

Install a car parking stall with maximum slope 1:48 (2.08%). Accessible car stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418194




5 +34.161386, -118.093427

Photos for Barrier ID: AX418194







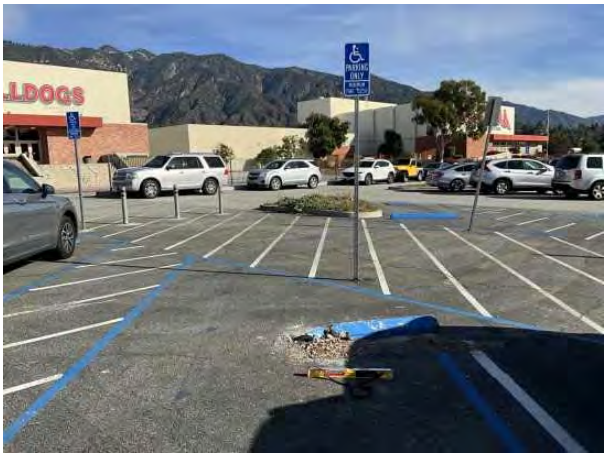

Barrier ID: AX418195

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Car
ADA Standard	302

Barrier Detail

Ground surfaces of the car parking stall and access aisle are not firm, stable and slip resistant.

Location Description	Accessible Parking Space P1-B
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The shattered wheel stop is creating loose gravel.

Resolution

Resurface the parking stall and access aisle to provide a firm, stable and slip resistant surface. This barrier must be removed in conjunction with barrier ID 418194. The cost of this barrier removal is covered under ID 418194 and therefore, the cost of this ID is shown as $0. Eliminate gaps greater than 1/2" wide which allow passage of a sphere more than 1/2 inch diameter.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418195



6 +34.161389, -118.093428

Photos for Barrier ID: AX418195



Barrier ID: AX418209

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Car
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).
Location Description	Accessible Parking Space P1-E
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes, 4.3%.

Resolution

Install a car parking stall with maximum slope 1:48 (2.08%). Accessible car stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418209



20 +34.161456, -118.093036

Photos for Barrier ID: AX418209









Barrier ID: AX418216

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Car
ADA Standard	California Building Code Chap 11B-502.2

Barrier Detail

CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').

Location Description	Accessible Parking Space P1-E
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The van parking space does not provide a van accessible parking sign.

Resolution

Redesign and restripe the car stall to the required minimum length of 216" (18'). Car stalls shall be 108" (9') wide minimum, measured from the middle of stripe to middle of stripe for all measurements. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or accessible aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] Car stalls have surface markings with EITHER: 1. the International Symbol of Accessibility in white on a blue background a minimum 36"x 36" high OR 2. stall outlined or painted in blue, with the International Symbol of Accessibility in white or a suitable contrasting color and a minimum 36" by 36" high. In either case, the centerline of the International Symbol of Accessibility shall be 6" maximum from the centerline of the stall, its sides parallel to the length of the stall and its lower end at or aligned with the end of the parking space length.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418216



27 +34.161496, -118.093006

Photos for Barrier ID: AX418216





Barrier ID: AX418342

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Car
ADA Standard	California Building Code Chap 11B-502.2

Barrier Detail

CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').

Location Description	Accessible Parking Space P3-B
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space extends 17' 8" long.

Resolution


Redesign and restripe the car stall to the required minimum length of 216" (18'). Car stalls shall be 108" (9') wide minimum, measured from the middle of stripe to middle of stripe for all measurements. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or accessible aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] Car stalls have surface markings with EITHER: 1. the International Symbol of Accessibility in white on a blue background a minimum 36"x 36" high OR 2. stall outlined or painted in blue, with the International Symbol of Accessibility in white or a suitable contrasting color and a minimum 36" by 36" high. In either case, the centerline of the International Symbol of Accessibility shall be 6" maximum from the centerline of the stall, its sides parallel to the length of the stall and its lower end at or aligned with the end of the parking space length.

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418342

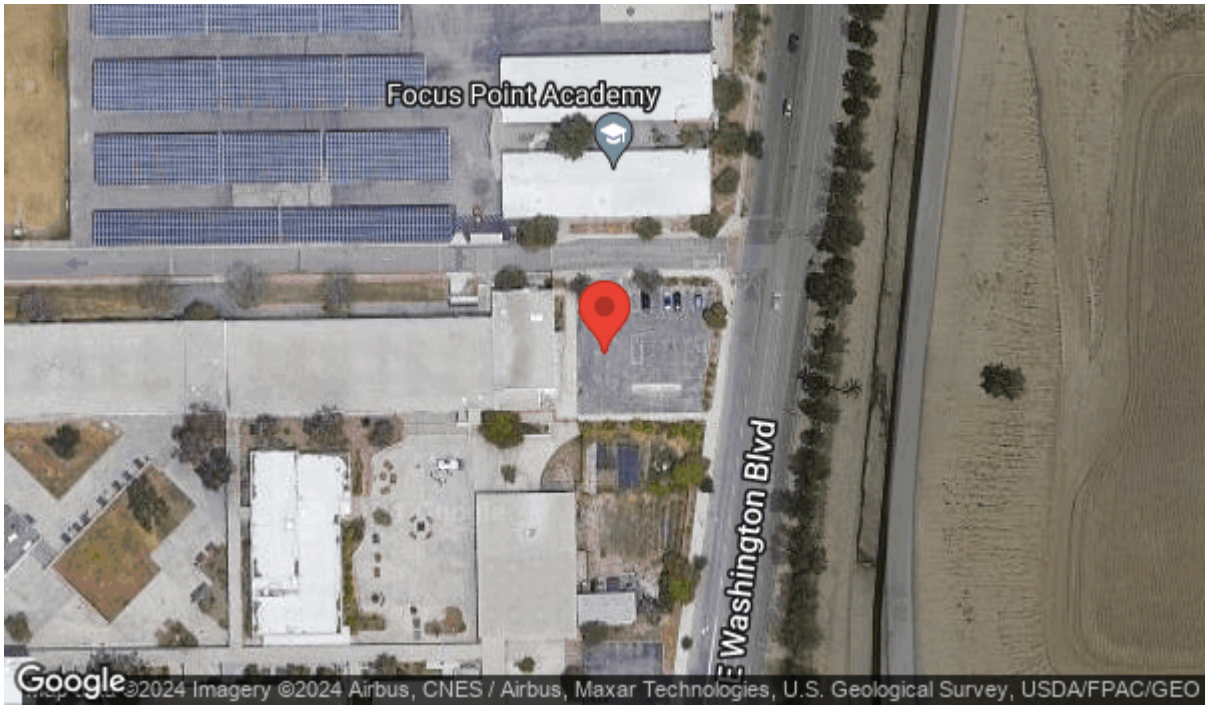

153 +34.162986, -118.090415

Photos for Barrier ID: AX418342



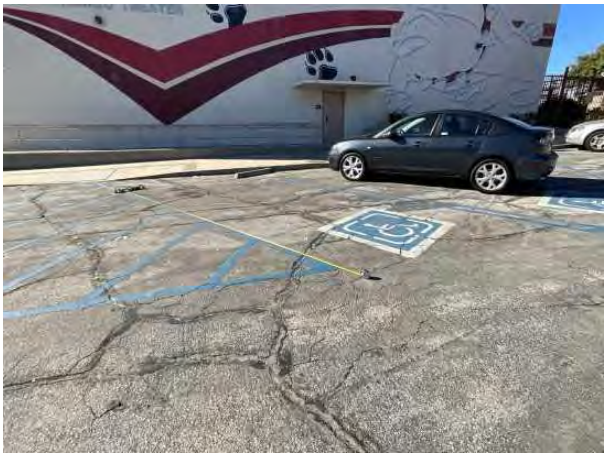

Barrier ID: AX418343

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Car
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).
Location Description	Accessible Parking Space P3-B
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes up to 3.6%.

Resolution


Install a car parking stall with maximum slope 1:48 (2.08%). Accessible car stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418343

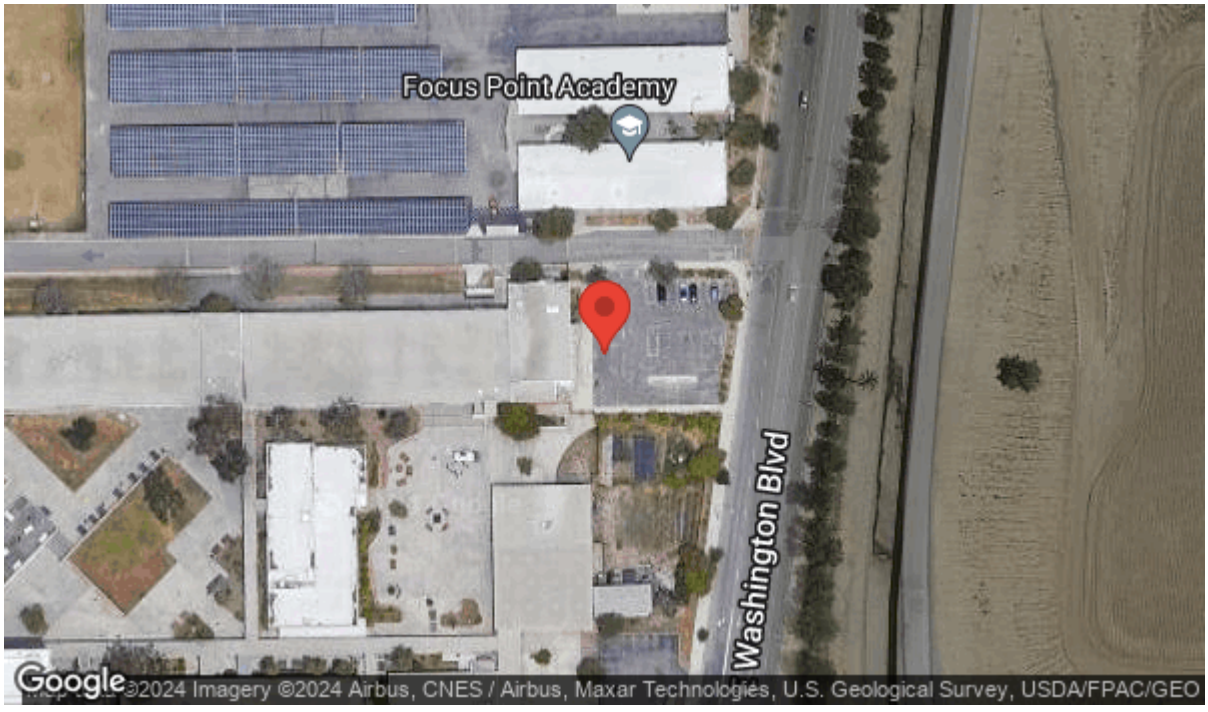

154 +34.162969, -118.090458

Photos for Barrier ID: AX418343









Barrier ID: AX418192

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).
Location Description	Access Aisle Serving Accessible Parking Space P1-A
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The access aisle slopes up to 4.0%.

Resolution


Install a van access aisle with maximum slope 1:48 (2.08%). Van access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418192

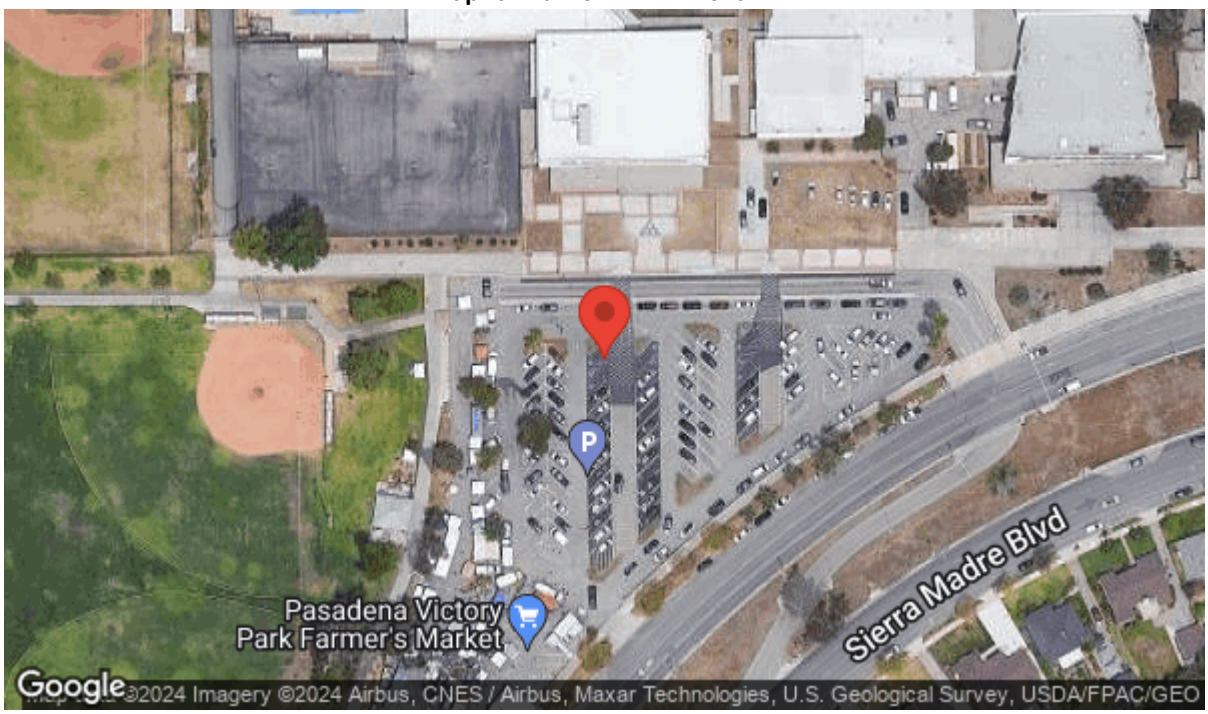

3 +34.161431, -118.093405

Photos for Barrier ID: AX418192









Barrier ID: AX418193

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.3.3
Barrier Detail	CALIFORNIA: The van aisle markings are not compliant.
Location Description	Access Aisle Serving Accessible Parking Space P1-A
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The access aisle is 5 foot 2 1/2 inches wide. The "NO PARKING" letters are 10 inches high.

Resolution

Remove and re-stripe the van aisle. Access aisles shall be the full length of the stall they serve. Stalls and access aisles shall be minimum 216" (18') in length. Markings may extend beyond the minimum required length 216" (18') of the stall the aisle serves. The aisle shall be marked with a blue painted borderline around its perimeter. The area within the blue perimeter marked with hatched lines a maximum of 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "No Parking" shall be painted on the surface within each access aisle in white letters of minimum 12" height, and located to be visible from the adjacent vehicular way. Markings may extend beyond the minimum required length 216" (18') of the stall. The van aisle shall be minimum 60" (5") wide where the van stall is minimum 144" (12') wide, OR 108" (9') wide minimum with access aisle 96" (8') wide minimum. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418193




4 +34.161407, -118.093439

Photos for Barrier ID: AX418193





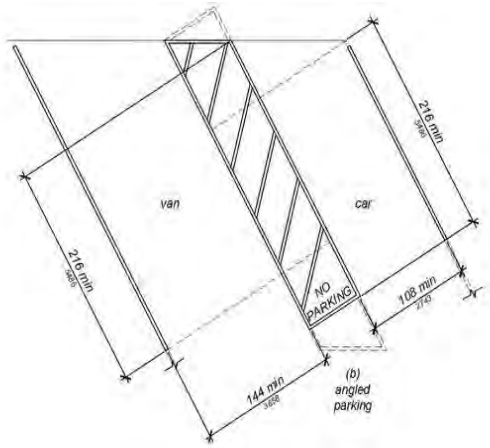










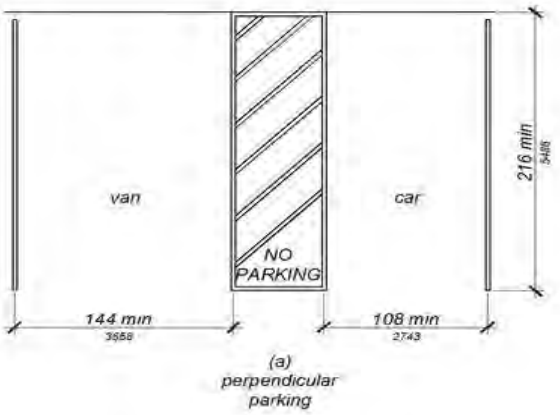

(a)
perpendicular
parking

Barrier ID: AX418197

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.3.3
Barrier Detail	CALIFORNIA: The van aisle markings are not compliant.
Location Description	Access Aisle Serving Accessible Parking Space P1-B
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The access serving P1 B does not extend the full length of the parking space.

Resolution

Remove and re-stripe the van aisle. Access aisles shall be the full length of the stall they serve. Stalls and access aisles shall be minimum 216" (18') in length. Markings may extend beyond the minimum required length 216" (18') of the stall the aisle serves. The aisle shall be marked with a blue painted borderline around its perimeter. The area within the blue perimeter marked with hatched lines a maximum of 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "No Parking" shall be painted on the surface within each access aisle in white letters of minimum 12" height, and located to be visible from the adjacent vehicular way. Markings may extend beyond the minimum required length 216" (18') of the stall. The van aisle shall be minimum 60" (5") wide where the van stall is minimum 144" (12') wide, OR 108" (9') wide minimum with access aisle 96" (8') wide minimum. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA


Priority	1


Map for Barrier ID: AX418197




8 +34.161317, -118.093451

Photos for Barrier ID: AX418197

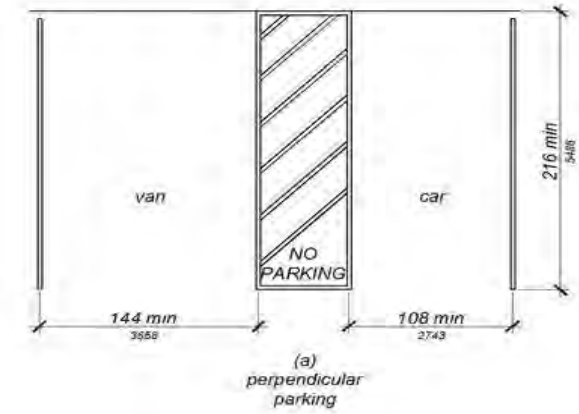

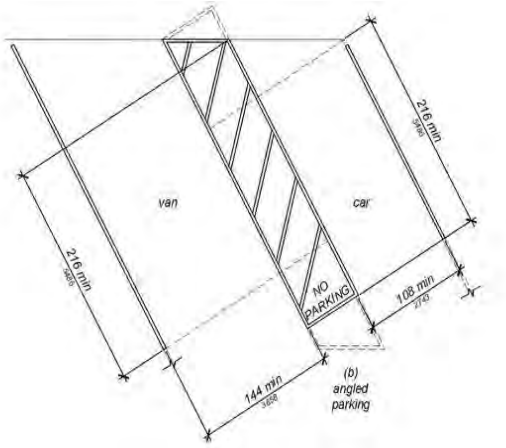

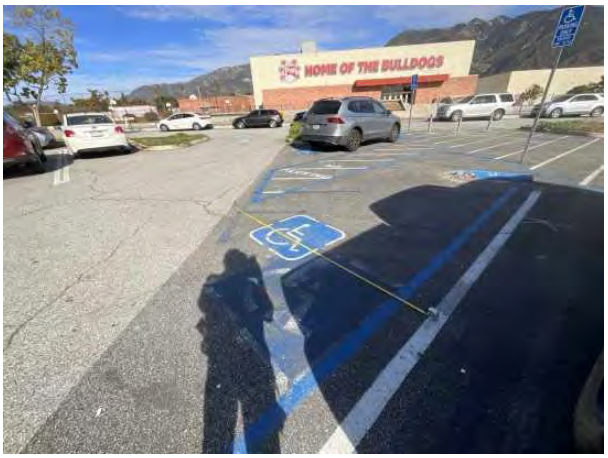

Barrier ID: AX418199

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).
Location Description	Access Aisle Serving Accessible Parking Space P1-C
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes up to 3.2%

Resolution


Install a van stall with maximum slope 1:48 (2.08%). Van stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418199

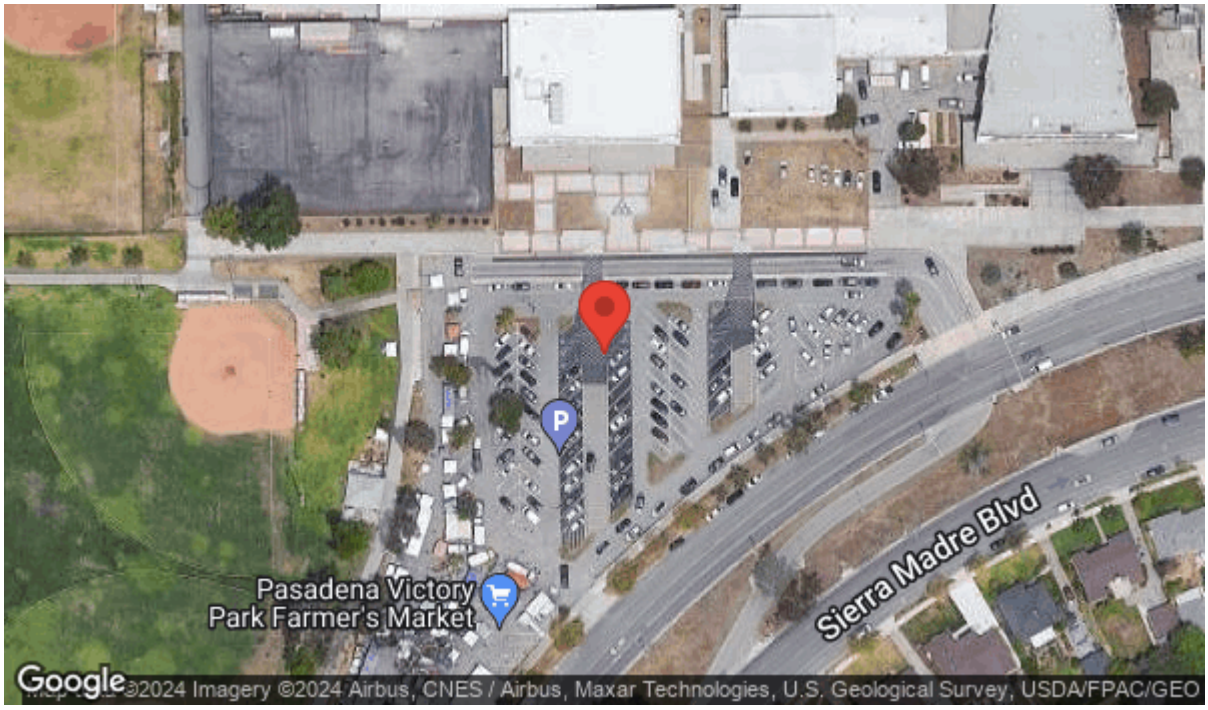

10 +34.161398, -118.093329

Photos for Barrier ID: AX418199









Barrier ID: AX418213

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.3.3
Barrier Detail	CALIFORNIA: The van aisle markings are not compliant.
Location Description	Access Aisle Serving Accessible Parking Space P1-F
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The access aisle serving P1-F does not extend the full length of the parking space.

Resolution

Remove and re-stripe the van aisle. Access aisles shall be the full length of the stall they serve. Stalls and access aisles shall be minimum 216" (18') in length. Markings may extend beyond the minimum required length 216" (18') of the stall the aisle serves. The aisle shall be marked with a blue painted borderline around its perimeter. The area within the blue perimeter marked with hatched lines a maximum of 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "No Parking" shall be painted on the surface within each access aisle in white letters of minimum 12" height, and located to be visible from the adjacent vehicular way. Markings may extend beyond the minimum required length 216" (18') of the stall. The van aisle shall be minimum 60" (5") wide where the van stall is minimum 144" (12') wide, OR 108" (9') wide minimum with access aisle 96" (8') wide minimum. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA


Priority	1

Map for Barrier ID: AX418213




24 +34.161405, -118.093057

Photos for Barrier ID: AX418213

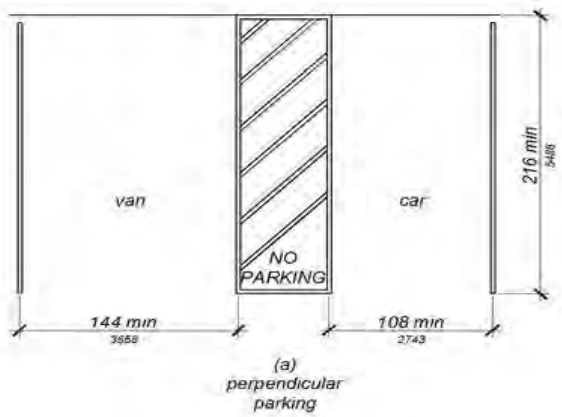



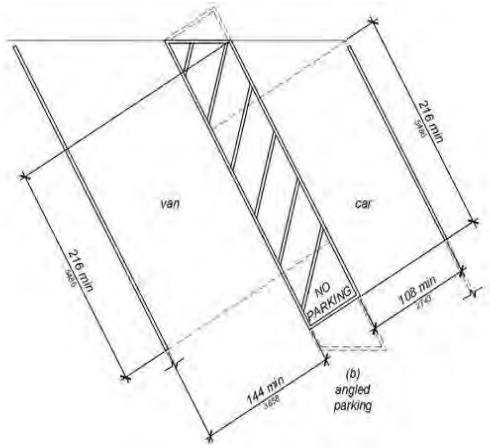





Barrier ID: AX418338

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.2

Barrier Detail

CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').

Location Description	Access Aisle Serving Accessible Parking Space P3-A
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The access aisle does not extend the full length of the parking space it serves.

Resolution


Redesign and restripe the van stall to the required minimum length of 216" (18'). Van stalls shall be either 144" (12') wide minimum with access aisle 60" (5') wide minimum, or 108" (9') wide minimum with access aisle 96" (8') wide minimum. Van stalls have surface markings with EITHER: 1. the International Symbol of Accessibility in white on a blue background a minimum 36"x 36" high OR 2. stall outlined or painted in blue, with the International Symbol of Accessibility in white or a suitable contrasting color and a minimum 36" by 36" high. In either case, the centerline of the International Symbol of Accessibility shall be 6" maximum from the centerline of the stall, its sides parallel to the length of the stall and its lower end at or aligned with the end of the parking space length.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418338

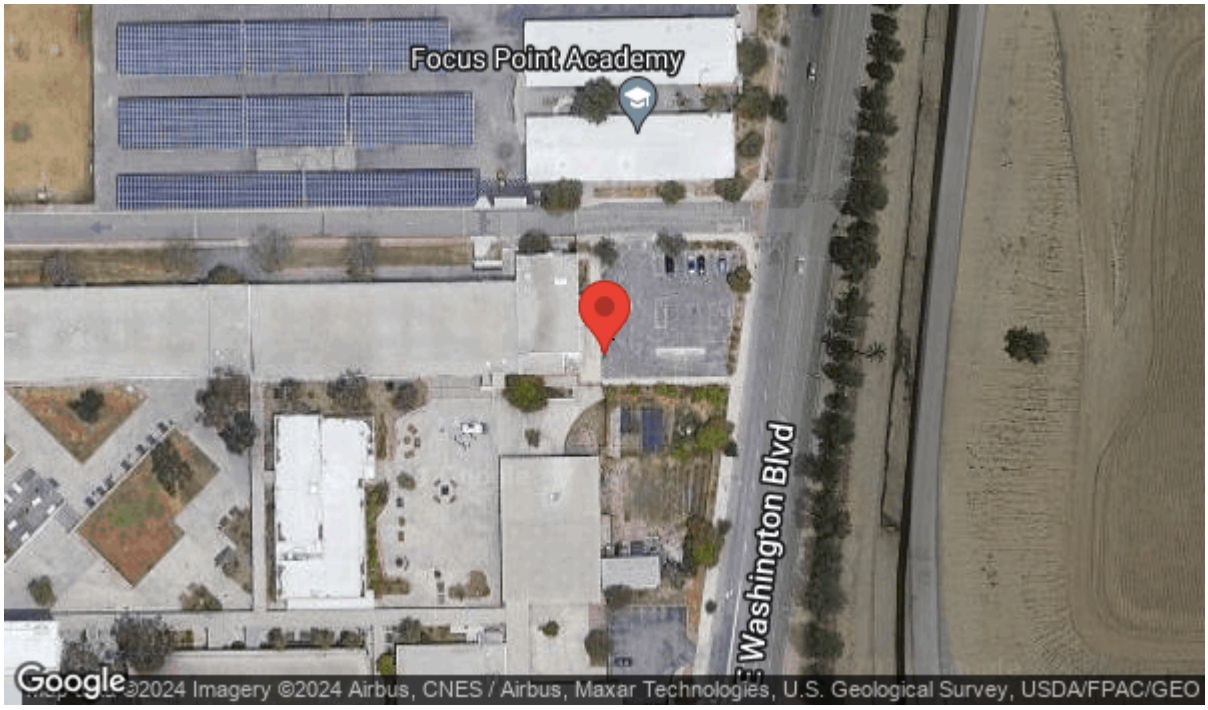

149 +34.162904, -118.090482

Photos for Barrier ID: AX418338





Barrier ID: AX418340

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).
Location Description	Access Aisle Serving Accessible Parking Space P3-A
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The access aisle slopes 3.5%

Resolution


Install a van access aisle with maximum slope 1:48 (2.08%). Van access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418340

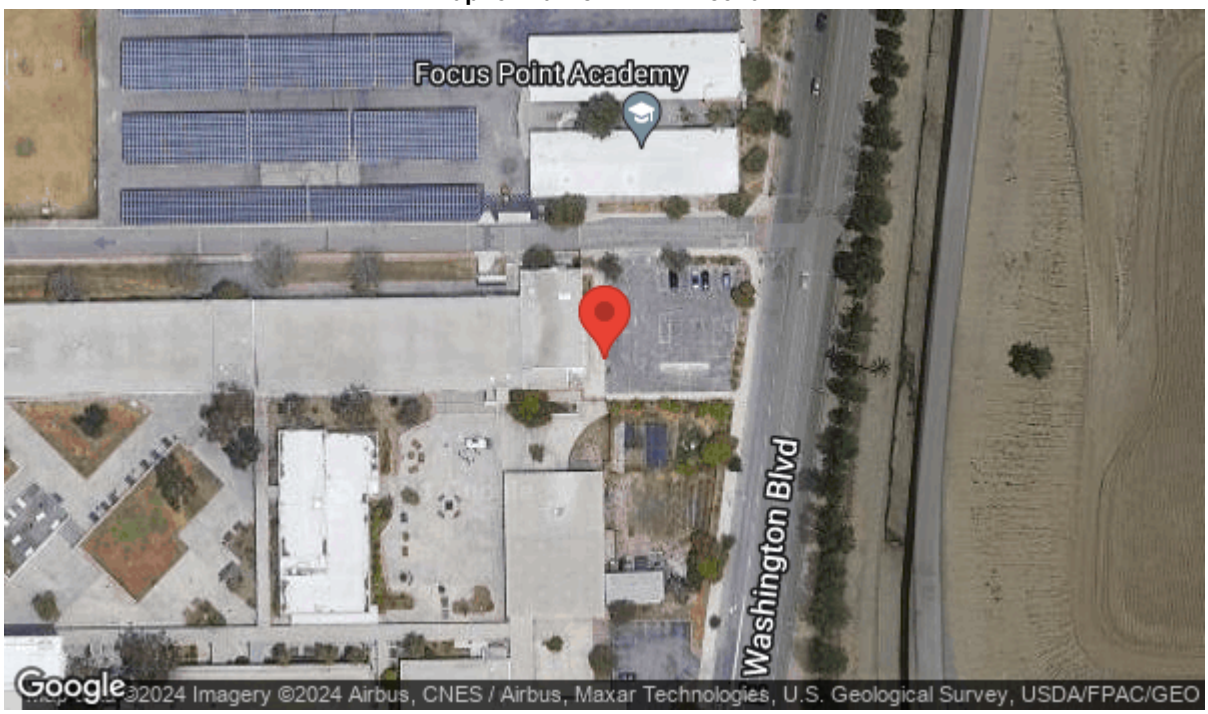


151 +34.162927, -118.090493

Photos for Barrier ID: AX418340





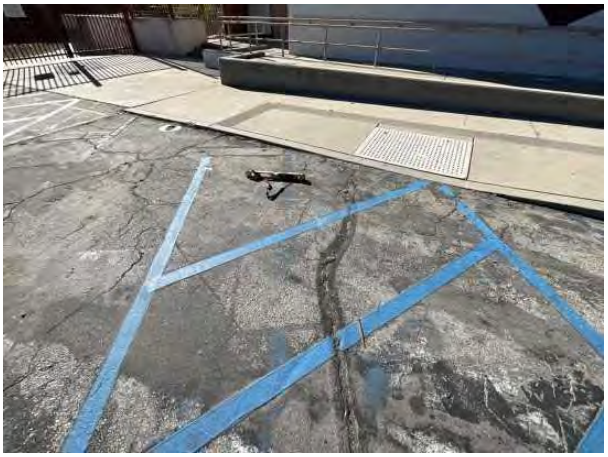





Barrier ID: AX418341

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.3.3
Barrier Detail	CALIFORNIA: The van aisle markings are not compliant.
Location Description	Access Aisle Serving Accessible Parking Space P3-A
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The access aisle does not provide the words no parking painted with 12 inch letters and does not provide the border line at the top. The access aisle does not extend the full length of parking space P3 B.

Resolution


Remove and re-stripe the van aisle. Access aisles shall be the full length of the stall they serve. Stalls and access aisles shall be minimum 216" (18') in length. Markings may extend beyond the minimum required length 216" (18') of the stall the aisle serves. The aisle shall be marked with a blue painted borderline around its perimeter. The area within the blue perimeter marked with hatched lines a maximum of 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "No Parking" shall be painted on the surface within each access aisle in white letters of minimum 12" height, and located to be visible from the adjacent vehicular way. Markings may extend beyond the minimum required length 216" (18') of the stall. The van aisle shall be minimum 60" (5") wide where the van stall is minimum 144" (12') wide, OR 108" (9') wide minimum with access aisle 96" (8') wide minimum. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA


Priority	1

Map for Barrier ID: AX418341

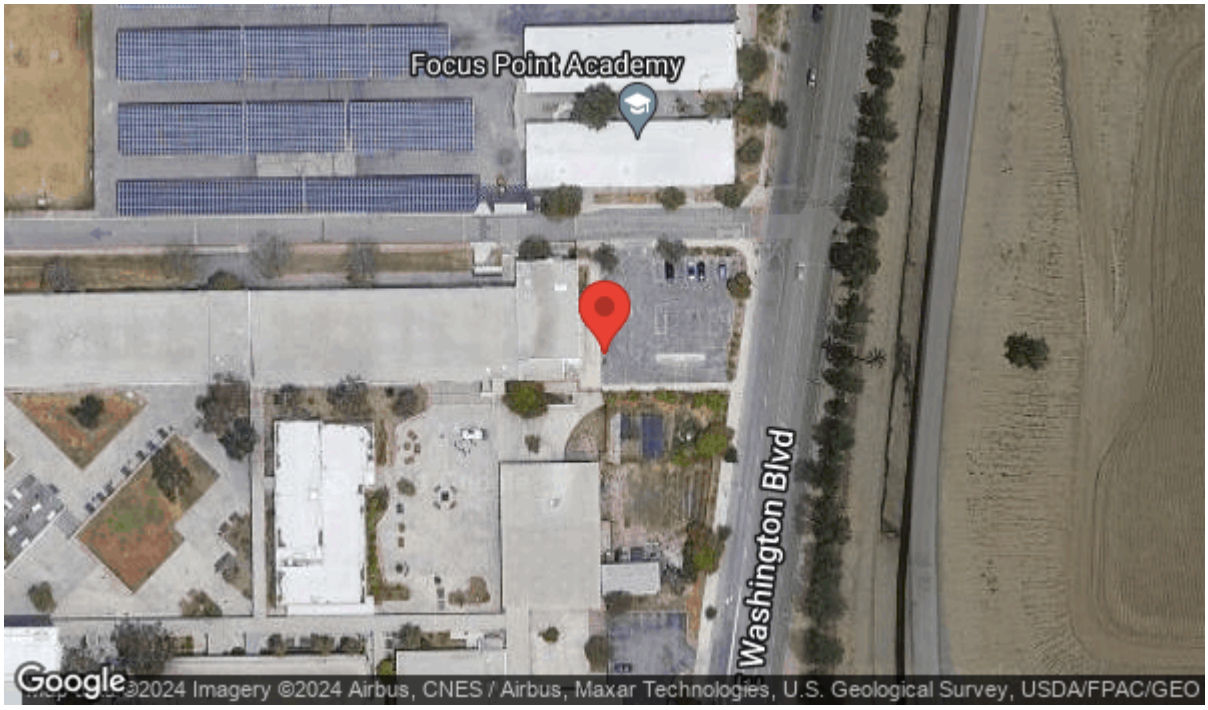

152 +34.162918, -118.090481

Photos for Barrier ID: AX418341

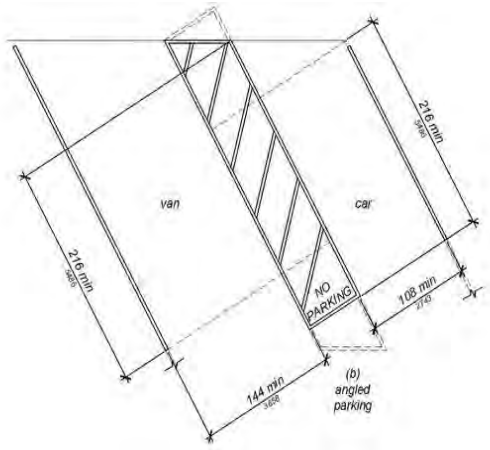












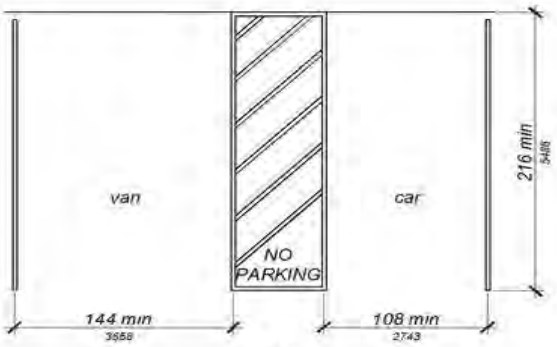

(a)
perpendicular
parking

Barrier ID: AX418345

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.3.3
Barrier Detail	CALIFORNIA: The van aisle markings are not compliant.
Location Description	Access Aisle Serving Accessible Parking Space P3-C
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The access aisle does not extend the full length of parking space P3-C.

Resolution

Remove and re-stripe the van aisle. Access aisles shall be the full length of the stall they serve. Stalls and access aisles shall be minimum 216" (18') in length. Markings may extend beyond the minimum required length 216" (18') of the stall the aisle serves. The aisle shall be marked with a blue painted borderline around its perimeter. The area within the blue perimeter marked with hatched lines a maximum of 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "No Parking" shall be painted on the surface within each access aisle in white letters of minimum 12" height, and located to be visible from the adjacent vehicular way. Markings may extend beyond the minimum required length 216" (18') of the stall. The van aisle shall be minimum 60" (5") wide where the van stall is minimum 144" (12') wide, OR 108" (9') wide minimum with access aisle 96" (8') wide minimum. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA


Priority	1

Map for Barrier ID: AX418345




156 +34.163033, -118.090474

Photos for Barrier ID: AX418345

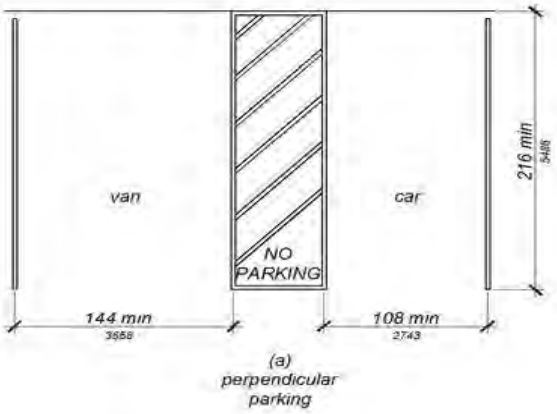



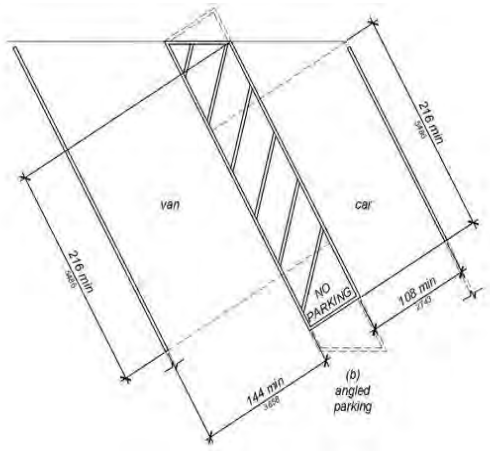



Barrier ID: AX418350

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.2 and 502.3

Barrier Detail

CALIFORNIA: The van parking aisle is less than 96" wide, where the van stall is less than 144" wide.

Location Description	Access Aisle Serving Accessible Parking Space P3-C
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The exercise does not extend the full length of parking space P3-D. The access code does not provide the words. No parking in 12 inch high letters. The exercise does not provide the top border and the access aisle is 7' - 8" wide.

Resolution

Remove and re-stripe with a parking space that is minimum 108" (9') wide, with an associated aisle minimum 96" (8') wide. Accessible van parking spaces shall be minimum 108" (9') wide and shall have an adjacent access aisle 96" (8') wide minimum OR shall be a minimum of 144" (12') wide and shall have an adjacent access aisle 60" (5') wide minimum. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] The minimum stall length shall be 216" (18'). Access aisles shall be marked with a blue painted borderline around their perimeter. The area within the blue borderlines shall be marked with hatched lines a maximum of 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "NO PARKING" shall be painted on the surface within each access aisle in white letters a minimum of 12" in height and located to be visible from the adjacent vehicular way. Access aisle markings may extend beyond the minimum required length. [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418350



161 +34.163046, -118.090459

Photos for Barrier ID: AX418350









Barrier ID: AX418191

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).
Location Description	Accessible Parking Space P1-A
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes up to 3.7%.

Resolution

Install a van stall with maximum slope 1:48 (2.08%). Van stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418191



2 +34.161448, -118.093406

Photos for Barrier ID: AX418191











Barrier ID: AX418214

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).
Location Description	Accessible Parking Space P1-F
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes 3.3%.

Resolution


Install a car parking stall with maximum slope 1:48 (2.08%). Accessible car stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418214

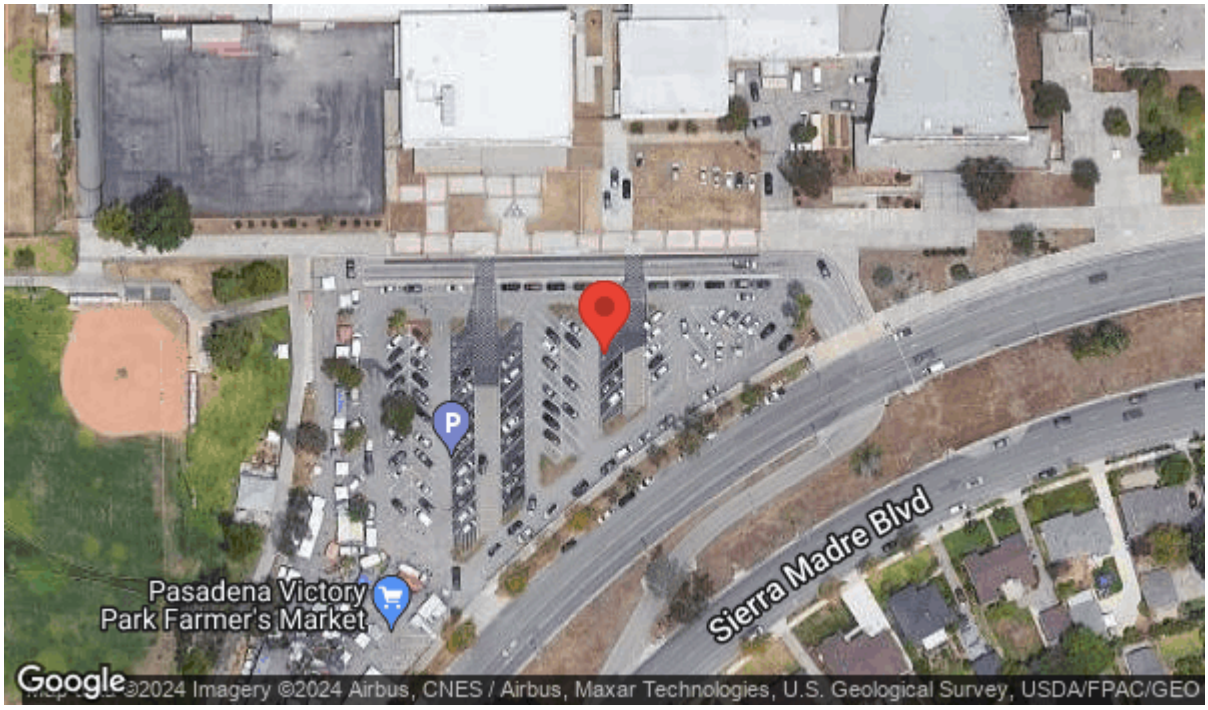

25 +34.161400, -118.093041

Photos for Barrier ID: AX418214



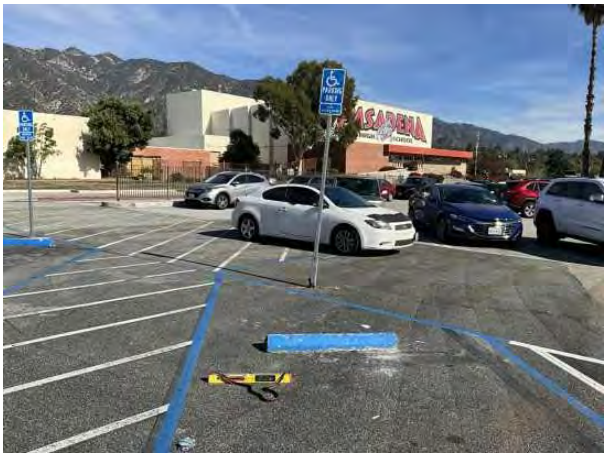





Barrier ID: AX418336

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.6

Barrier Detail

CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.

Location Description	Accessible Parking Space P3-A
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The accessible parking space does not provide the required minimum fine, 250 sign and van accessible signage.

Resolution


Provide compliant mounted signage at the van stall. Signage shall be mounted minimum 60" above the stall surface measured to the bottom of the sign. Parking space identification signs shall include the International Symbol of Accessibility and "van accessible". Parking identification signage shall be reflectorized with a minimum area of 70 square inches. The signage for the space shall be located either immediately adjacent to the space, or located within the projected parking space width at the head end of the space, or permanently posted on a wall at the interior end of the space. Van spaces shall also have "van accessible" signs as part of the same sign with the ISA or as an additional sign. Parking identification signage shall have additional language or an additional sign stating "Minimum Fine $250." Parking signage shall be visible from the parking space. Where the sign post is mounted on a raised surface which is higher than the stall pavement, the vertical measurement shall be from the stall pavement surface to the bottom of the sign.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418336

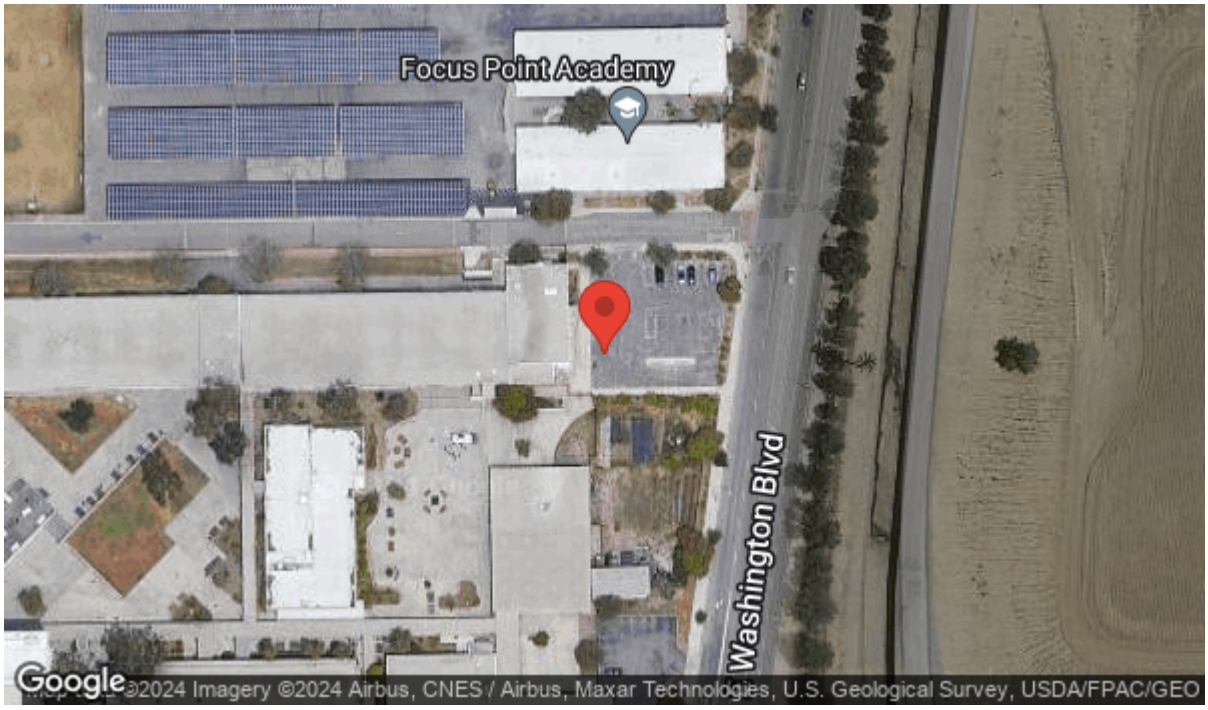

147 +34.162930, -118.090454

Photos for Barrier ID: AX418336





Barrier ID: AX418337

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.2

Barrier Detail

CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').

Location Description	Accessible Parking Space P3-A
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space is 17' 2" long.

Resolution


Redesign and restripe the van stall to the required minimum length of 216" (18'). Van stalls shall be either 144" (12') wide minimum with access aisle 60" (5') wide minimum, or 108" (9') wide minimum with access aisle 96" (8') wide minimum. Van stalls have surface markings with EITHER: 1. the International Symbol of Accessibility in white on a blue background a minimum 36"x 36" high OR 2. stall outlined or painted in blue, with the International Symbol of Accessibility in white or a suitable contrasting color and a minimum 36" by 36" high. In either case, the centerline of the International Symbol of Accessibility shall be 6" maximum from the centerline of the stall, its sides parallel to the length of the stall and its lower end at or aligned with the end of the parking space length.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418337

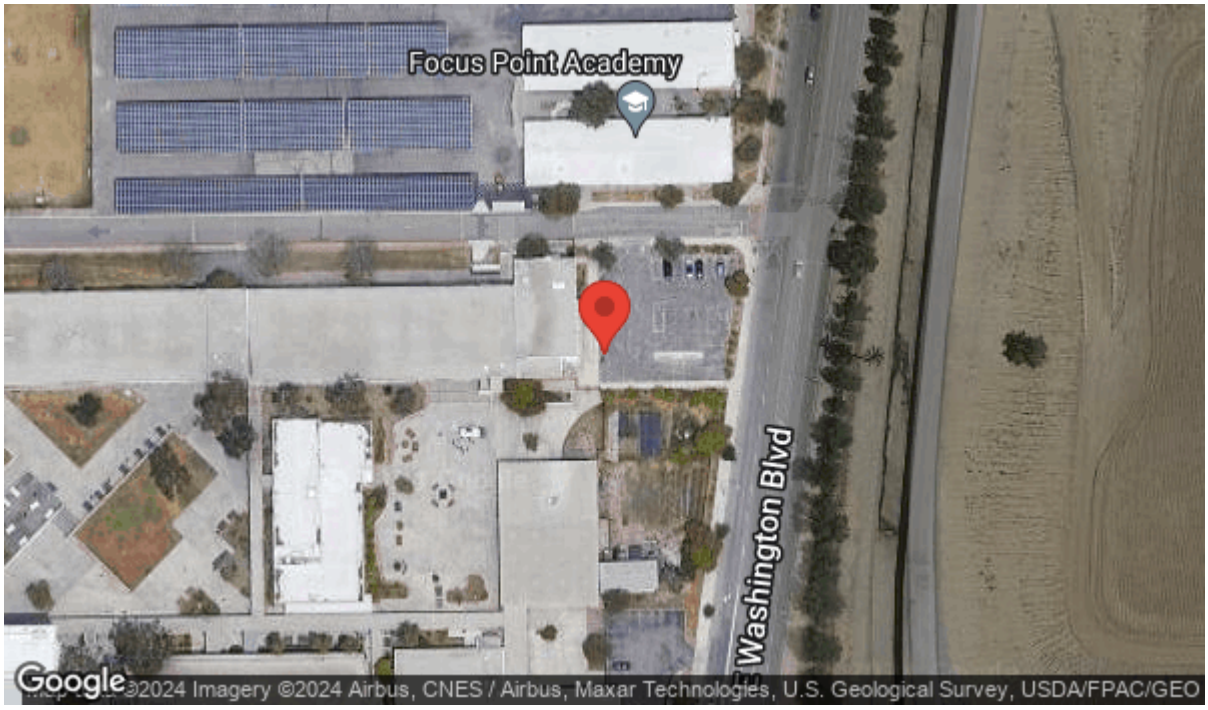

148 +34.162915, -118.090472

Photos for Barrier ID: AX418337









Barrier ID: AX418339

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).
Location Description	Accessible Parking Space P3-B
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes 3.4%

Resolution


Install a van stall with maximum slope 1:48 (2.08%). Van stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA


Priority	1

Map for Barrier ID: AX418339

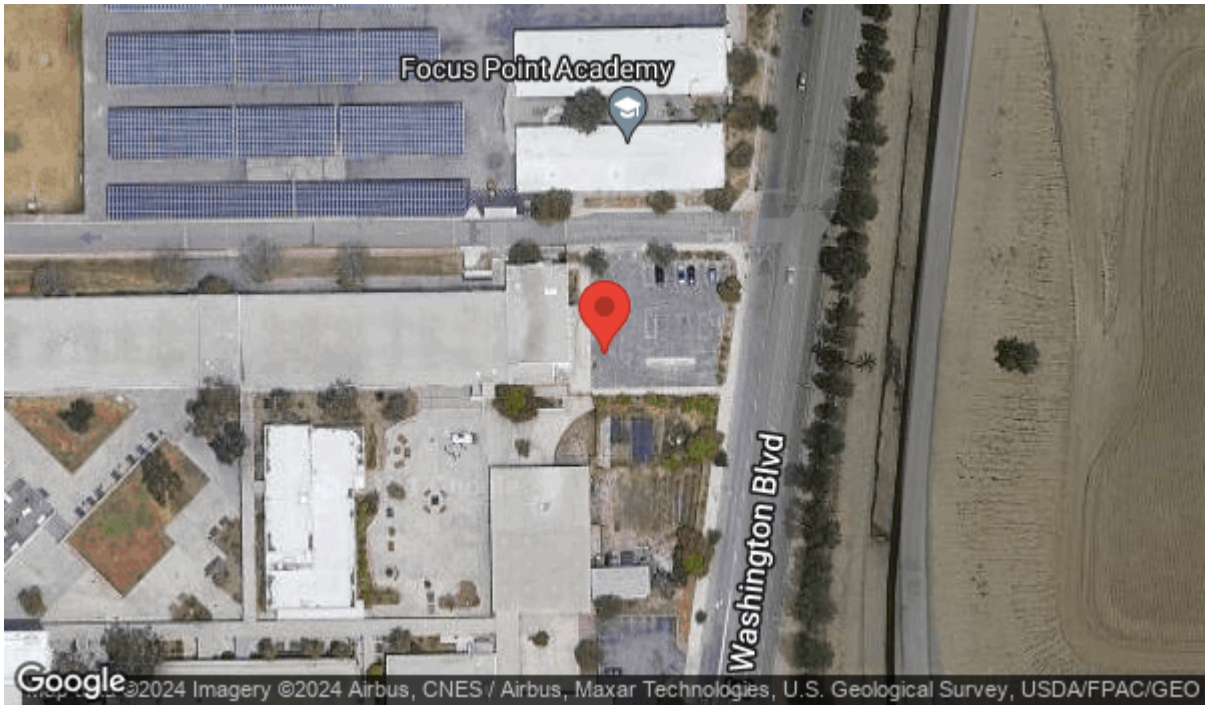

150 +34.162927, -118.090453

Photos for Barrier ID: AX418339

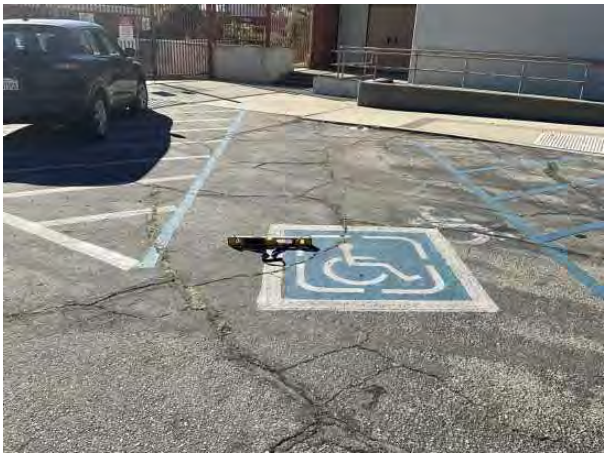







Barrier ID: AX418346

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.6

Barrier Detail

CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.

Location Description	Accessible Parking Space P3-C
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The accessible parking space does not provide the required "minimum fine, 250" sign and "van accessible" signage.

Resolution

Provide compliant mounted signage at the van stall. Signage shall be mounted minimum 60" above the stall surface measured to the bottom of the sign. Parking space identification signs shall include the International Symbol of Accessibility and "van accessible". Parking identification signage shall be reflectorized with a minimum area of 70 square inches. The signage for the space shall be located either immediately adjacent to the space, or located within the projected parking space width at the head end of the space, or permanently posted on a wall at the interior end of the space. Van spaces shall also have "van accessible" signs as part of the same sign with the ISA or as an additional sign. Parking identification signage shall have additional language or an additional sign stating "Minimum Fine $250." Parking signage shall be visible from the parking space. Where the sign post is mounted on a raised surface which is higher than the stall pavement, the vertical measurement shall be from the stall pavement surface to the bottom of the sign.

Quantity

1 EA


Priority	1

Map for Barrier ID: AX418346



157 +34.163014, -118.090481

Photos for Barrier ID: AX418346

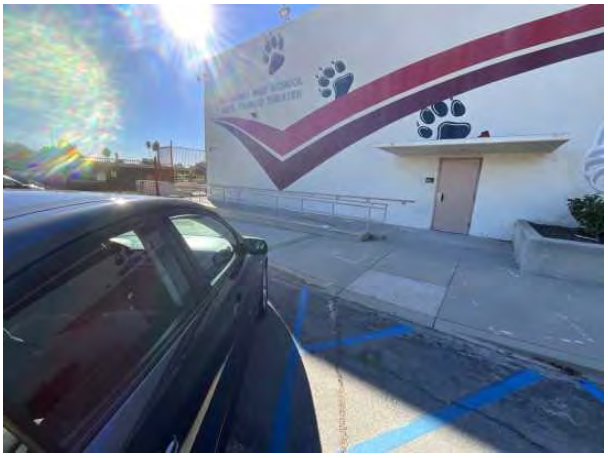



Barrier ID: AX418328

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - Van
ADA Standard	California Building Code Chap 11B-502.3.3
Barrier Detail	CALIFORNIA: The van aisle markings are not compliant.
Location Description	Van Access Aisle Serving Parking Space P2-A
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The no parking letters are fading.

Resolution


Remove and re-stripe the van aisle. Access aisles shall be the full length of the stall they serve. Stalls and access aisles shall be minimum 216" (18') in length. Markings may extend beyond the minimum required length 216" (18') of the stall the aisle serves. The aisle shall be marked with a blue painted borderline around its perimeter. The area within the blue perimeter marked with hatched lines a maximum of 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "No Parking" shall be painted on the surface within each access aisle in white letters of minimum 12" height, and located to be visible from the adjacent vehicular way. Markings may extend beyond the minimum required length 216" (18') of the stall. The van aisle shall be minimum 60" (5") wide where the van stall is minimum 144" (12') wide, OR 108" (9') wide minimum with access aisle 96" (8') wide minimum. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA


Priority	1

Map for Barrier ID: AX418328

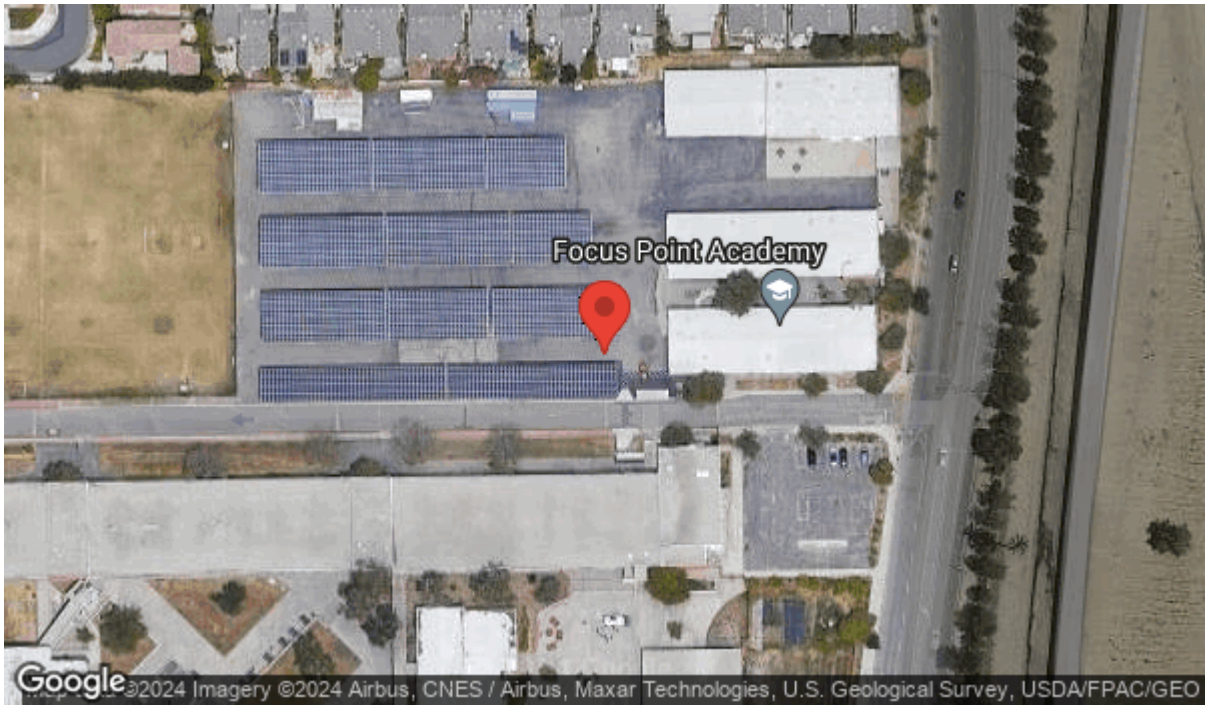


139 +34.163334, -118.090860

Photos for Barrier ID: AX418328

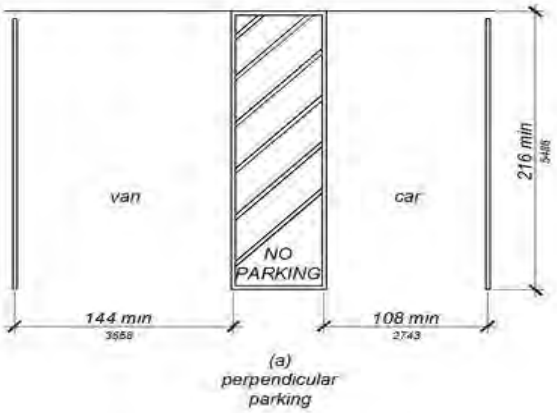



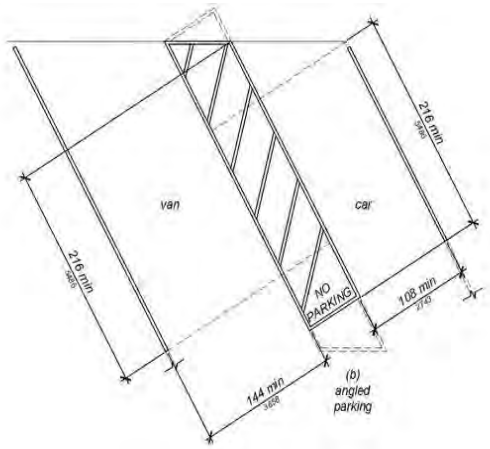

Barrier ID: AX418201

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.3.3
Barrier Detail	CALIFORNIA: The car aisle markings are not compliant.
Location Description	Access Aisle Serving Accessible Parking Space P1-D
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The access aisle is 5' 3" wide. The "NO PARKING" letters are 10 inches high.

Resolution

Remove and re-stripe the car aisle. Access aisles shall be the full length of the stall they serve. Stalls and access aisles shall be minimum 216" (18') in length. Markings may extend beyond the minimum required length 216" (18') of the stall the aisle serves. The car aisle shall be minimum 60" wide. The aisle shall be marked with a blue painted borderline around its total perimeter, including adjacent to curbs, where present. The area within the blue perimeter shall be marked with hatched lines maximum 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "No Parking" shall be painted on the surface within each access aisle in white letters of minimum 12" height, and located to be visible from the adjacent vehicular way. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418201



12 +34.161418, -118.093302


Photos for Barrier ID: AX418201



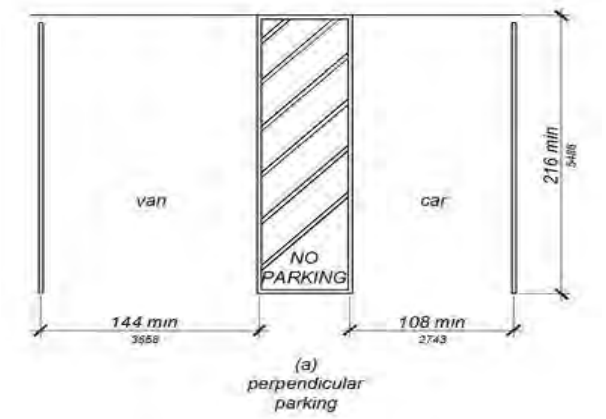





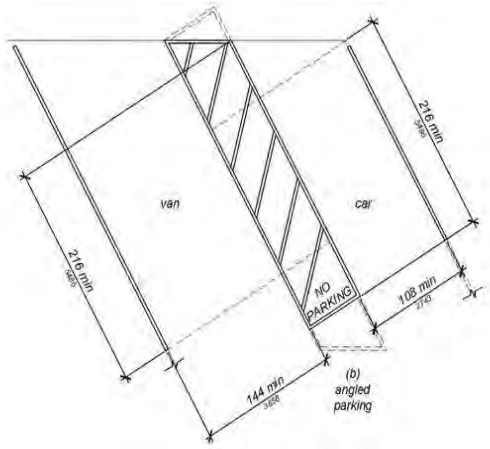



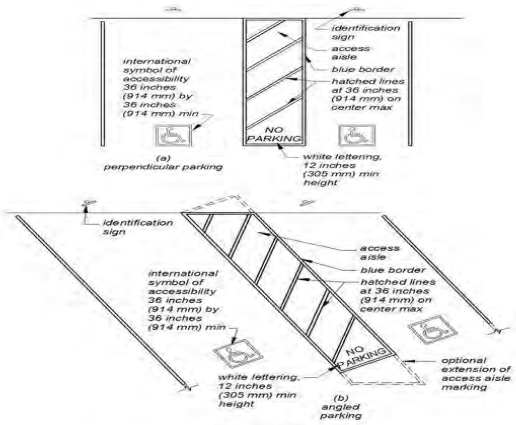


Figure 11B-502.3.3
Angled and Perpendicular Parking Identification

Barrier ID: AX418210

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.3.3
Barrier Detail	CALIFORNIA: The car aisle markings are not compliant.
Location Description	Access Aisle Serving Accessible Parking Space P1-E
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The "NO PARKING" letters are 10 inches high.

Resolution

Remove and re-stripe the car aisle. Access aisles shall be the full length of the stall they serve. Stalls and access aisles shall be minimum 216" (18') in length. Markings may extend beyond the minimum required length 216" (18') of the stall the aisle serves. The car aisle shall be minimum 60" wide. The aisle shall be marked with a blue painted borderline around its total perimeter, including adjacent to curbs, where present. The area within the blue perimeter shall be marked with hatched lines maximum 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "No Parking" shall be painted on the surface within each access aisle in white letters of minimum 12" height, and located to be visible from the adjacent vehicular way. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418210




21 +34.161418, -118.093040

Photos for Barrier ID: AX418210



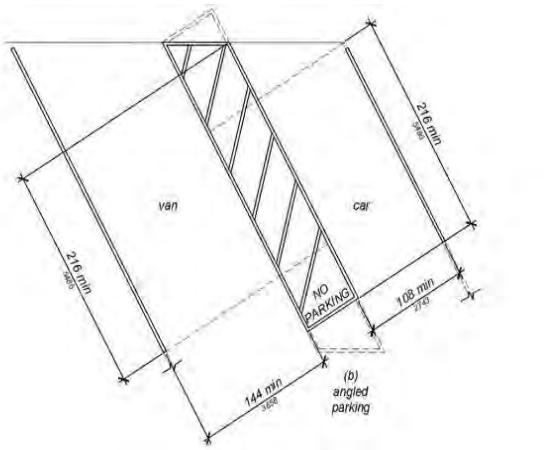



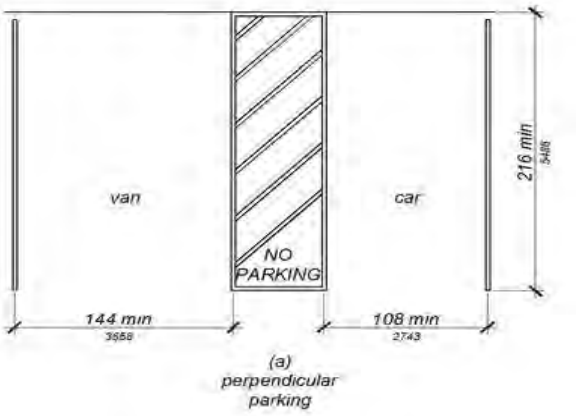



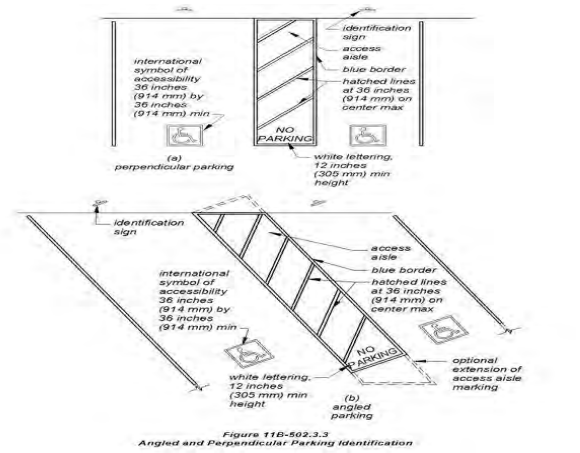


Figure 11B-502.3.3
Angled and Perpendicular Parking Identification

Barrier ID: AX418211

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.3.3
Barrier Detail	CALIFORNIA: The car aisle markings are not compliant.
Location Description	Access Aisle Serving Accessible Parking Space P1-E
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes up to 3.8%.

Resolution


Remove and re-stripe the car aisle. Access aisles shall be the full length of the stall they serve. Stalls and access aisles shall be minimum 216" (18') in length. Markings may extend beyond the minimum required length 216" (18') of the stall the aisle serves. The car aisle shall be minimum 60" wide. The aisle shall be marked with a blue painted borderline around its total perimeter, including adjacent to curbs, where present. The area within the blue perimeter shall be marked with hatched lines maximum 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "No Parking" shall be painted on the surface within each access aisle in white letters of minimum 12" height, and located to be visible from the adjacent vehicular way. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418211

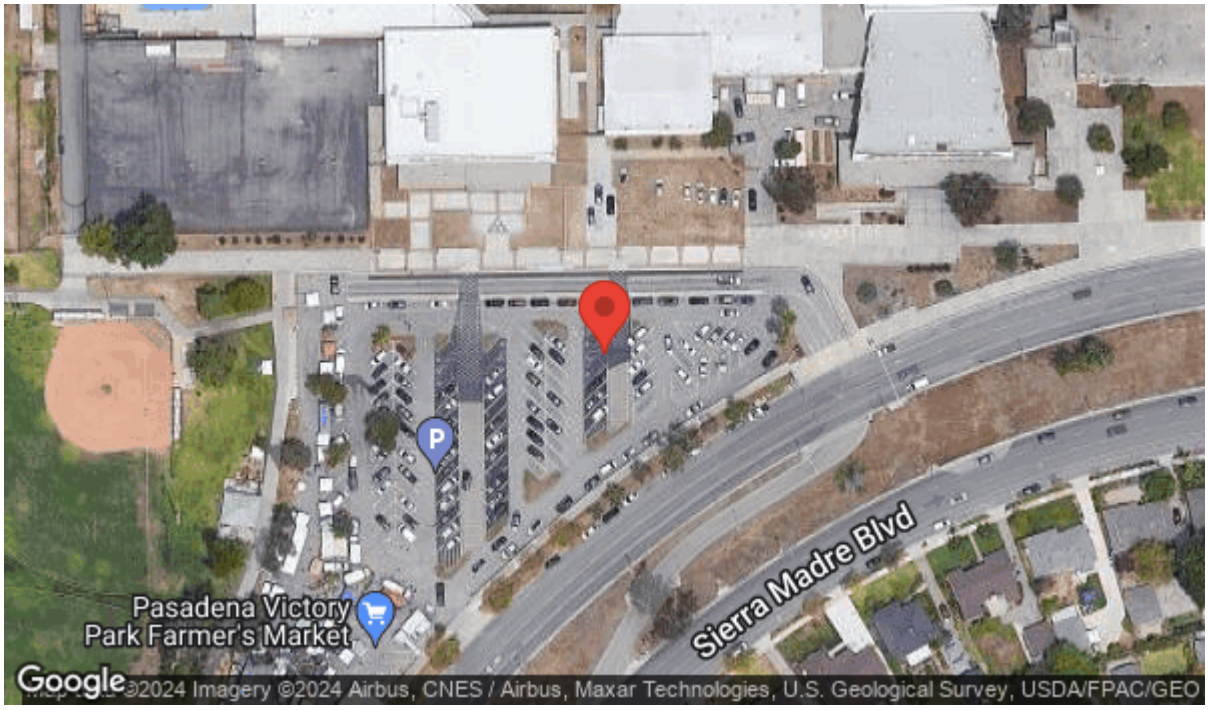


22 +34.161437, -118.092996

Photos for Barrier ID: AX418211





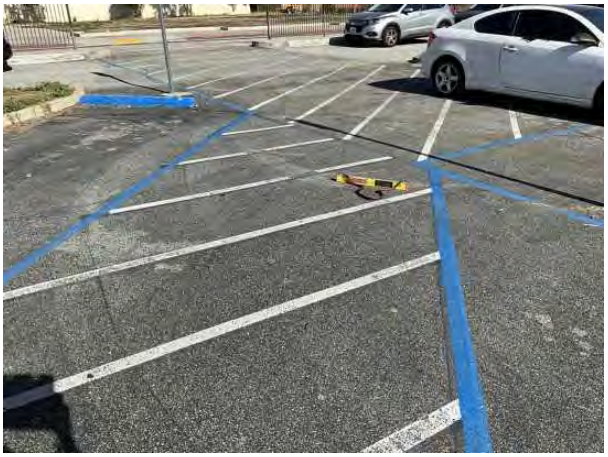



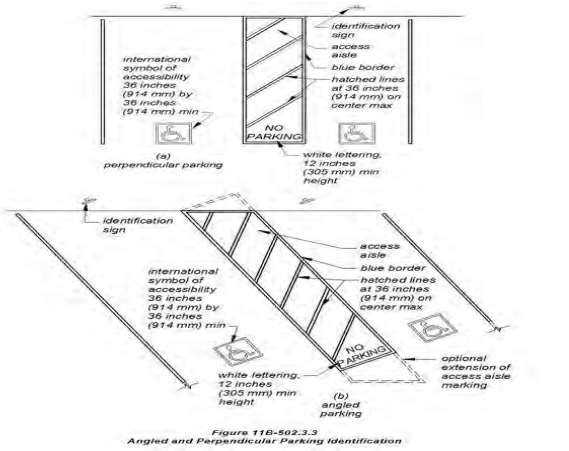


Figure 11B-502.3.3
Angled and Perpendicular Parking Identification

Barrier ID: AX418349

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).
Location Description	Access Aisle Serving Accessible Parking Space P3-C
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The access aisle slopes up to 5.7%

Resolution


Install an access aisle which has a maximum slope of 1:48 (2.08%). Car access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted.[Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418349

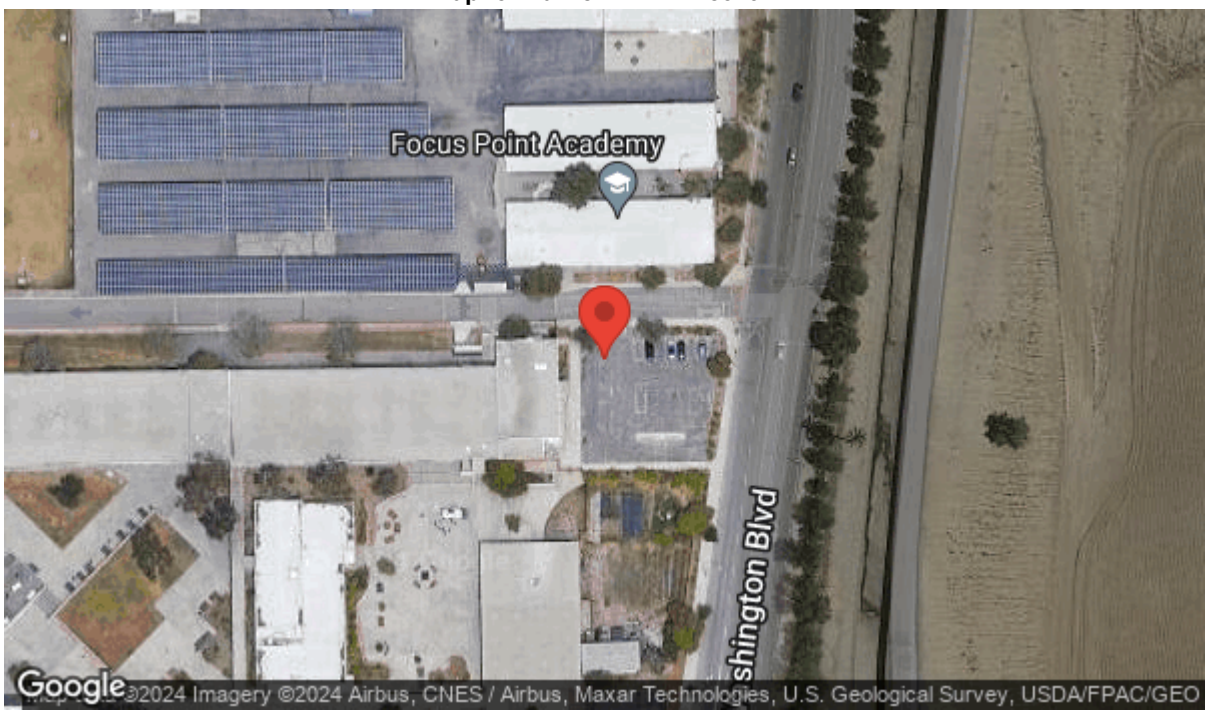

160 +34.163081, -118.090425


Photos for Barrier ID: AX418349









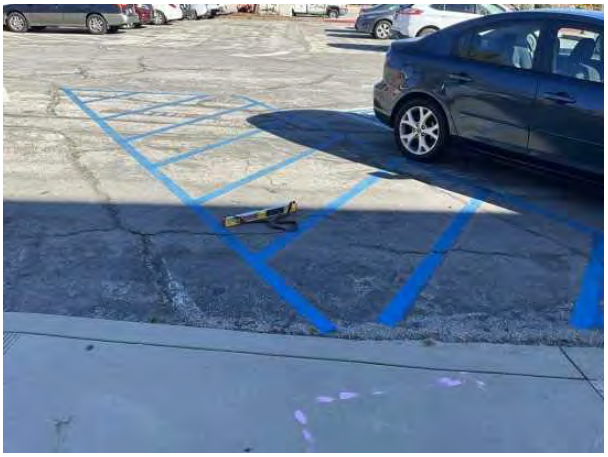



Barrier ID: AX418331

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).
Location Description	Access Aisle Serving Parking Space P2-E
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The access aisle slopes 2.7%.

Resolution


Install an access aisle which has a maximum slope of 1:48 (2.08%). Car access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted.[Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418331

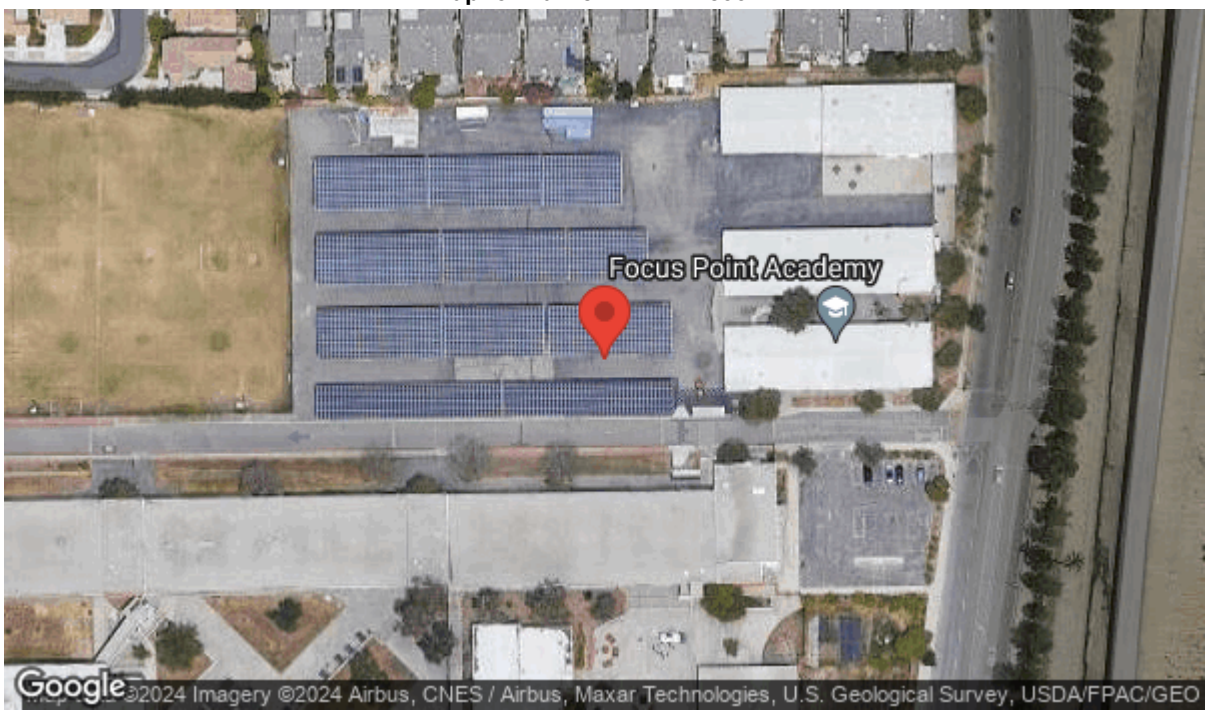


142 +34.163358, -118.091011

Photos for Barrier ID: AX418331



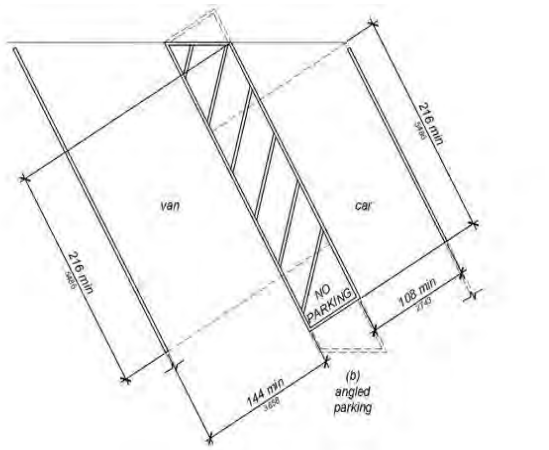

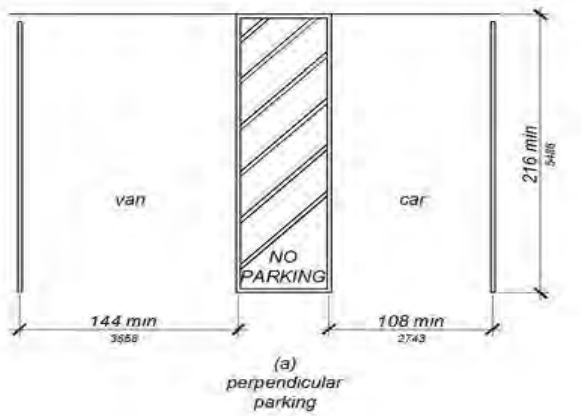



Barrier ID: AX418196

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.2

Barrier Detail

CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').

Location Description	Accessible Parking Space P1-B
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space is not striped for 18 feet long on the left side.

Resolution

Redesign and restripe the car stall to the required minimum length of 216" (18'). Car stalls shall be 108" (9') wide minimum, measured from the middle of stripe to middle of stripe for all measurements. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or accessible aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] Car stalls have surface markings with EITHER: 1. the International Symbol of Accessibility in white on a blue background a minimum 36"x 36" high OR 2. stall outlined or painted in blue, with the International Symbol of Accessibility in white or a suitable contrasting color and a minimum 36" by 36" high. In either case, the centerline of the International Symbol of Accessibility shall be 6" maximum from the centerline of the stall, its sides parallel to the length of the stall and its lower end at or aligned with the end of the parking space length.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418196



7 +34.161350, -118.093462

Photos for Barrier ID: AX418196





Barrier ID: AX418200

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).
Location Description	Accessible Parking Space P1-D
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes, 3.9%.

Resolution

Install a car parking stall with maximum slope 1:48 (2.08%). Accessible car stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418200



11 +34.161429, -118.093305

Photos for Barrier ID: AX418200









Barrier ID: AX418202

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.2
Barrier Detail	CALIFORNIA: The car parking stall is less than 108" wide.
Location Description	Accessible Parking Space P1-D
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space is 8' 11" wide.

Resolution

Remove and re-stripe with a parking space that is at least 108" wide. Accessible car parking spaces shall be at least 108" wide and shall have an adjacent access aisle 60" wide minimum. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] Car stalls shall be minimum 216" (18') in length.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418202



13 +34.161429, -118.093293

Photos for Barrier ID: AX418202







Barrier ID: AX418329

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).
Location Description	Accessible Parking Space P2-E
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes, 2.6%.

Resolution


Install a car parking stall with maximum slope 1:48 (2.08%). Accessible car stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418329

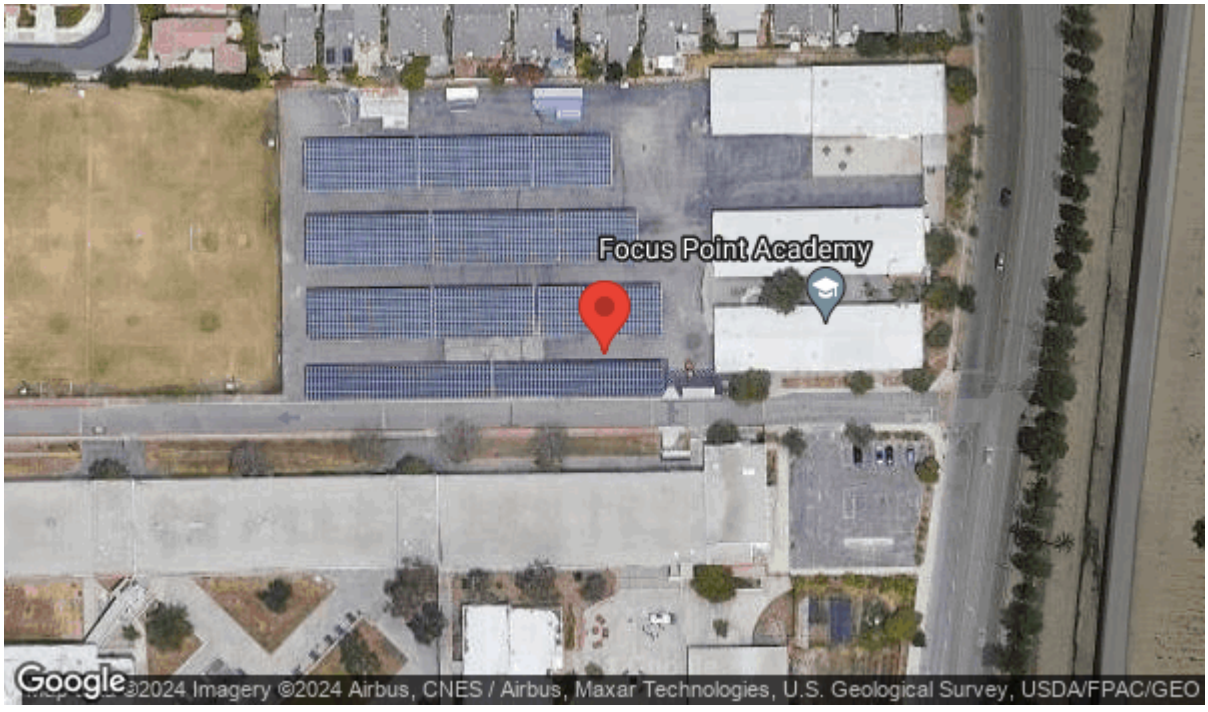



140 +34.163328, -118.090985

Photos for Barrier ID: AX418329



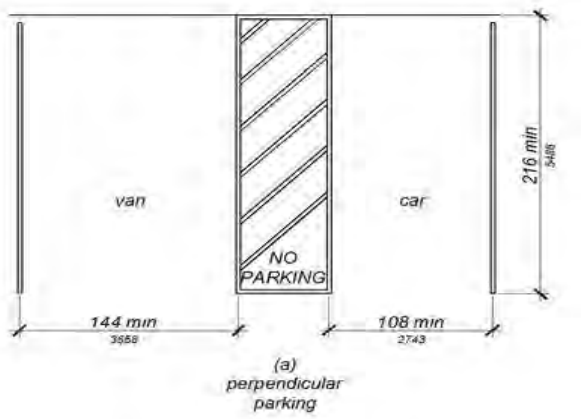

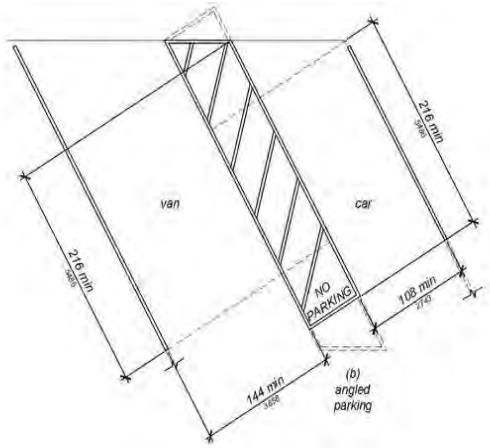

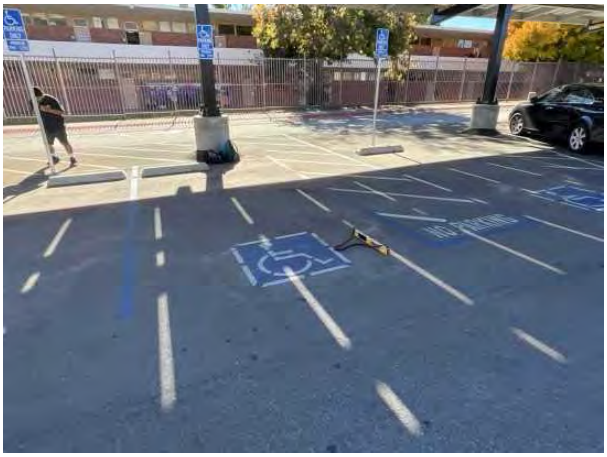

Barrier ID: AX418332

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).
Location Description	Accessible Parking Space P2-F
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes, 2.7%.

Resolution


Install a car parking stall with maximum slope 1:48 (2.08%). Accessible car stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418332

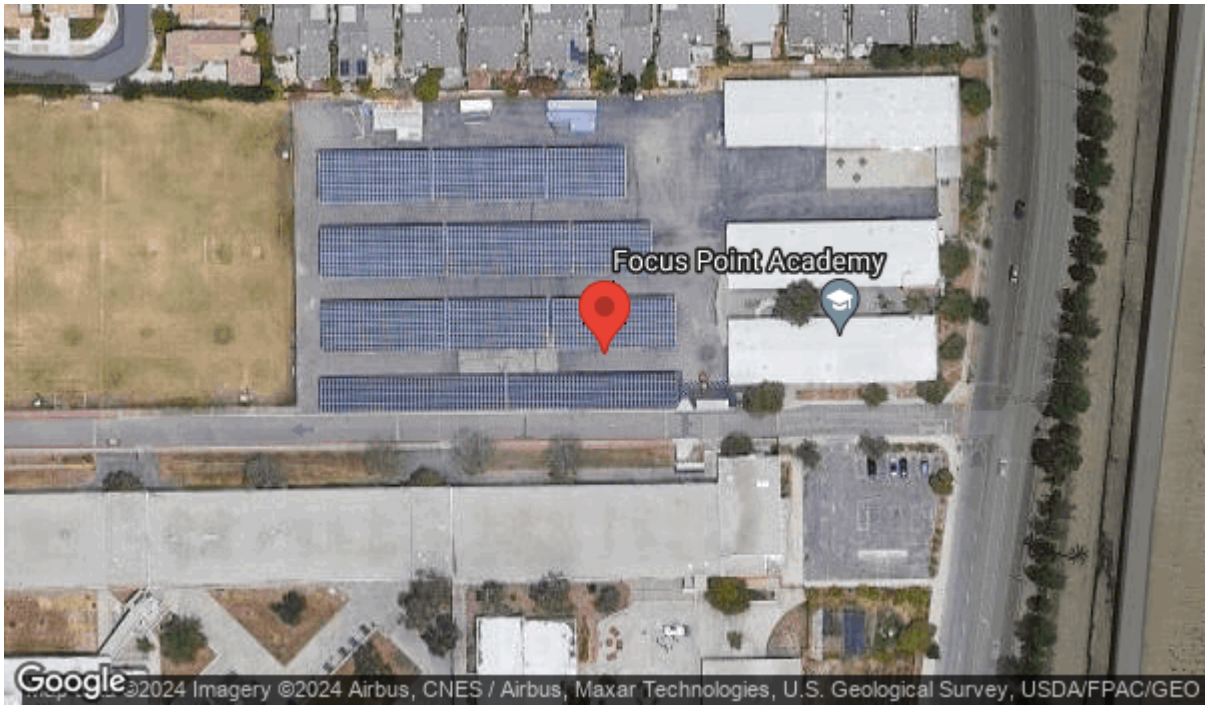


143 +34.163354, -118.091024

Photos for Barrier ID: AX418332



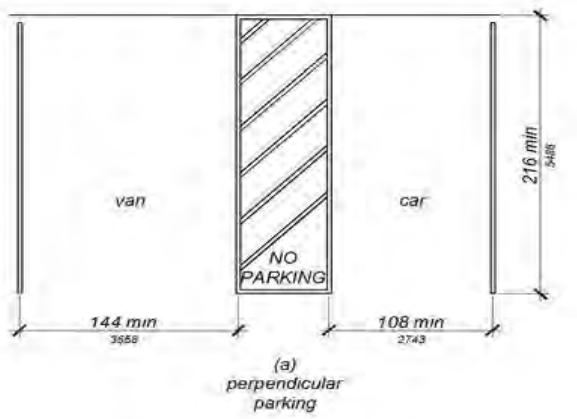



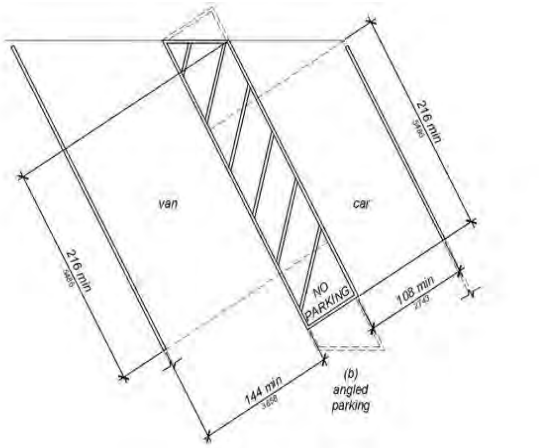

Barrier ID: AX418344

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.6

Barrier Detail

CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.

Location Description	Accessible Parking Space P3-B
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The accessible parking space does not provide the required "minimum fine, 250" sign and "van accessible" signage.

Resolution


Provide compliant mounted signage at the standard car stall. Signage shall be mounted minimum 60" above the stall surface measured to the bottom of the sign. Parking space identification signs shall include the International Symbol of Accessibility complying with 703.7.2.1. Parking identification signage shall be reflectorized with a minimum area of 70 square inches. The signage for the space shall be located either immediately adjacent to the space, or located within the projected parking space width at the head end of the space, or permanently posted on a wall at the interior end of the space. Parking identification signage shall have additional language or an additional sign stating "Minimum Fine $250." Parking signage shall be visible from the parking space. Where the sign post is mounted on a raised surface which is higher than the stall pavement, the vertical measurement shall be from the stall pavement surface to the bottom of the sign.

Quantity

1 EA


Priority	1

Map for Barrier ID: AX418344

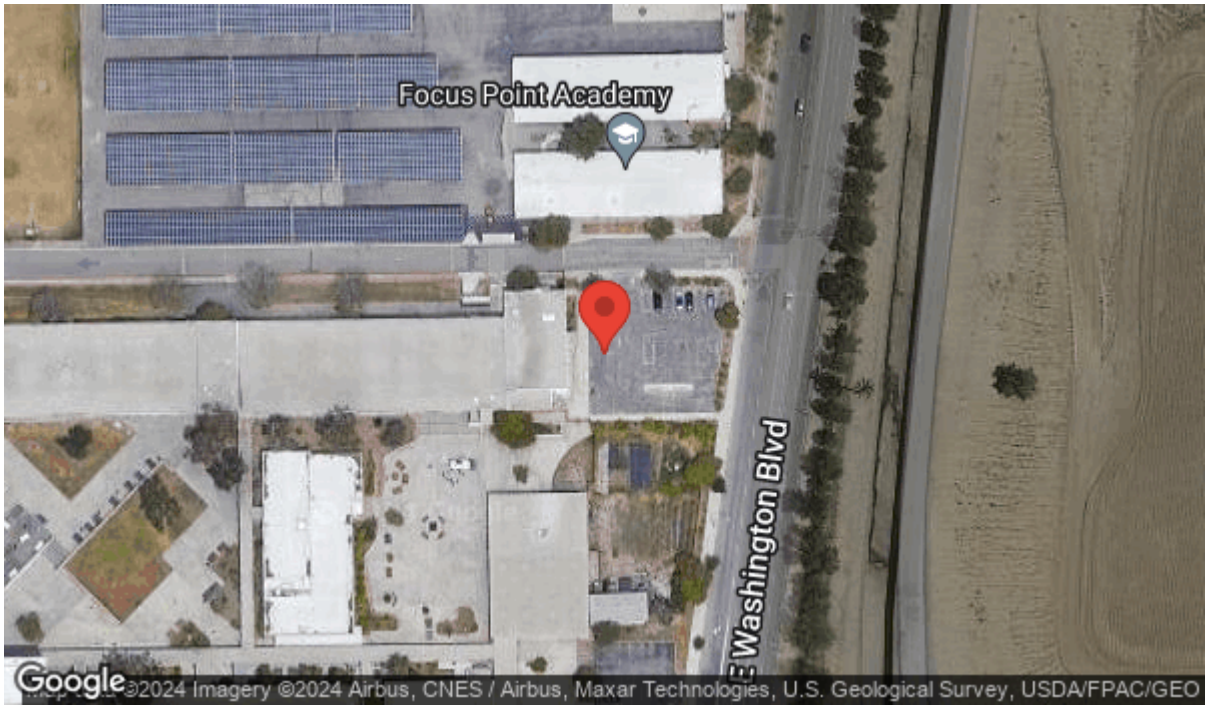

155 +34.162984, -118.090450

Photos for Barrier ID: AX418344

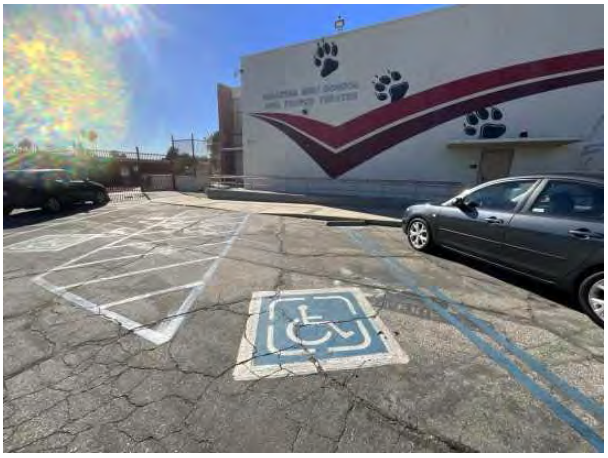



Barrier ID: AX418348

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).
Location Description	Accessible Parking Space P3-C
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes up to 3.2%

Resolution

Install a car parking stall with maximum slope 1:48 (2.08%). Accessible car stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418348



159 +34.163005, -118.090462

Photos for Barrier ID: AX418348













Barrier ID: AX418347

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.6

Barrier Detail

CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.

Location Description	Accessible Parking Space P3-D
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The accessible parking space does not provide the required "minimum fine, 250" sign and "van accessible" signage.

Resolution

Provide compliant mounted signage at the standard car stall. Signage shall be mounted minimum 60" above the stall surface measured to the bottom of the sign. Parking space identification signs shall include the International Symbol of Accessibility complying with 703.7.2.1. Parking identification signage shall be reflectorized with a minimum area of 70 square inches. The signage for the space shall be located either immediately adjacent to the space, or located within the projected parking space width at the head end of the space, or permanently posted on a wall at the interior end of the space. Parking identification signage shall have additional language or an additional sign stating "Minimum Fine $250." Parking signage shall be visible from the parking space. Where the sign post is mounted on a raised surface which is higher than the stall pavement, the vertical measurement shall be from the stall pavement surface to the bottom of the sign.

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418347



158 +34.163077, -118.090462

Photos for Barrier ID: AX418347



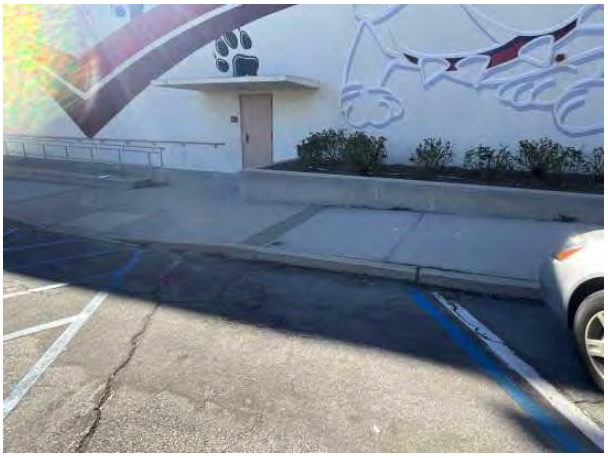

Barrier ID: AX418351

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Car
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).
Location Description	Accessible Parking Space P3-D
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes up to 4.2%

Resolution

Install a car parking stall with maximum slope 1:48 (2.08%). Accessible car stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1


Map for Barrier ID: AX418351



162 +34.163054, -118.090459

Photos for Barrier ID: AX418351



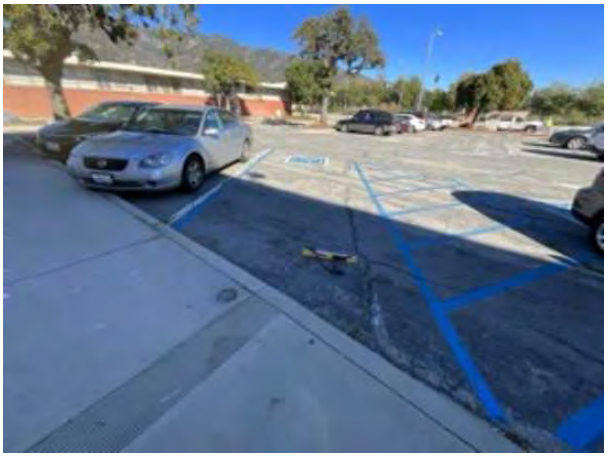









Barrier ID: AX420232

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Spaces-General
ADA Standard	208.2
Barrier Detail	The minimum number of accessible parking spaces is not provided.
Location Description	Parking Lot 6 P6
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Approximately 61 parking spaces are provided to serve the football field. No accessible parking is provided. At least one van accessible and two standard accessible parking spaces is required.

Resolution


Provide required accessible parking spaces that are compliant with applicable standards. Parking spaces shall be provided in accordance the below Table 208.2 (Except for allowed EXCEPTIONS). Where more than one parking facility is provided on a site, the number of accessible spaces provided on the site shall be calculated according to the number of spaces required for each parking facility. Total Number of Parking Spaces-Provided in Parking Facility/Minimum Number of Required Accessible Parking Spaces 1 to 25 requires 1 (van); 26 to 50 requires 2 (1 van and 1 car); 51 to 75 requires 3 (1 van and 2 cars); 76 to 100 requires 4 (1 van and 3 cars); 101 to 150 requires 5 (1 van and 4 cars); 151 to 200 requires 6 (1 van and 5 cars); 201 to 300 requires 7 (2 vans and 5 cars); 301 to 400 requires 8 (2 vans and 6 cars); 401 to 500 requires 9 (2 vans and 7 cars); 501 to 1000 requires 2 % of total (1/6 vans and 5/6 cars) 1001 and over requires 20, plus 1 for each 100, or fraction thereof, over 1000 (1/6 vans and 5/6 cars)

Quantity

3 EA

Priority	1

Map for Barrier ID: AX420232

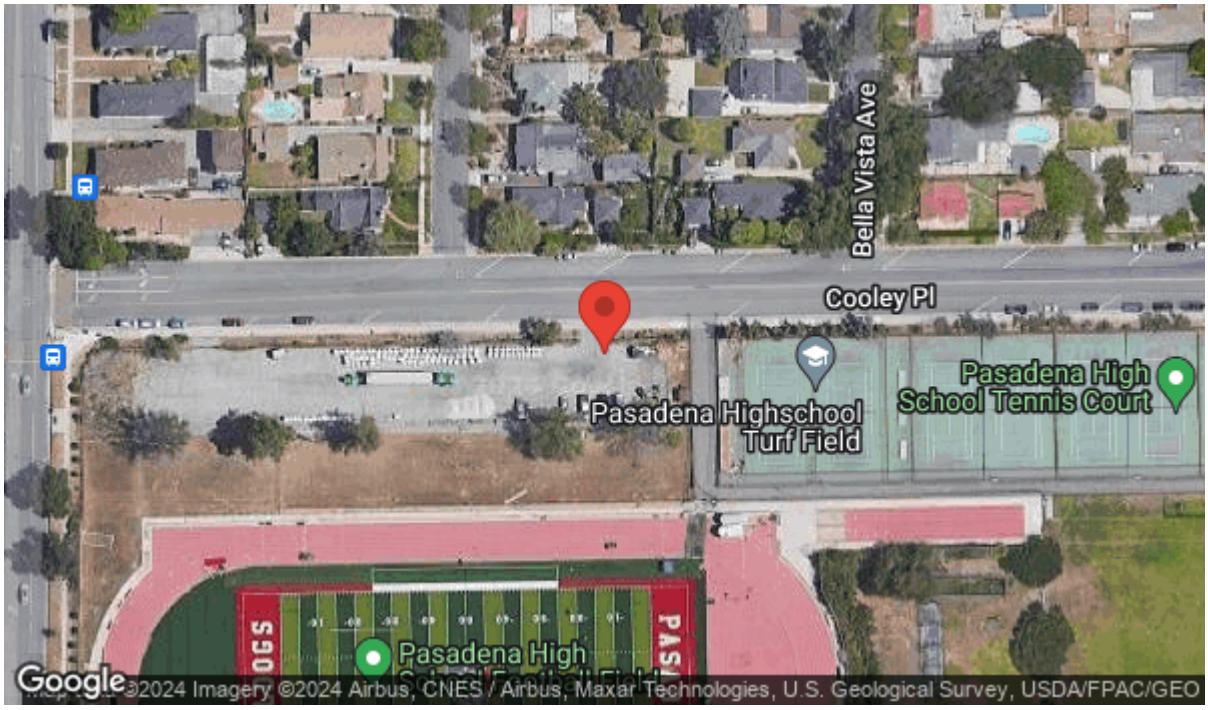

611 +34.162846, -118.096835

Photos for Barrier ID: AX420232









Barrier ID: AX418198

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Van
ADA Standard	California Building Code Chap 11B-502.4
Barrier Detail	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).
Location Description	Accessible Parking Space P1-C
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space slopes, 3.8%.

Resolution

Install a van stall with maximum slope 1:48 (2.08%). Van stalls shall be level. Changes in level are not permitted. [Exception: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removing and repairing the barrier are not included.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418198



9 +34.161381, -118.093301

Photos for Barrier ID: AX418198









Barrier ID: AX418212

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Van
ADA Standard	California Building Code Chap 11B-502.2

Barrier Detail

CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').

Location Description	Accessible Parking Space P1-F
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The parking space is 16' 9" long.

Resolution


Redesign and restripe the van stall to the required minimum length of 216" (18'). Van stalls shall be either 144" (12') wide minimum with access aisle 60" (5') wide minimum, or 108" (9') wide minimum with access aisle 96" (8') wide minimum. Van stalls have surface markings with EITHER: 1. the International Symbol of Accessibility in white on a blue background a minimum 36"x 36" high OR 2. stall outlined or painted in blue, with the International Symbol of Accessibility in white or a suitable contrasting color and a minimum 36" by 36" high. In either case, the centerline of the International Symbol of Accessibility shall be 6" maximum from the centerline of the stall, its sides parallel to the length of the stall and its lower end at or aligned with the end of the parking space length.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418212

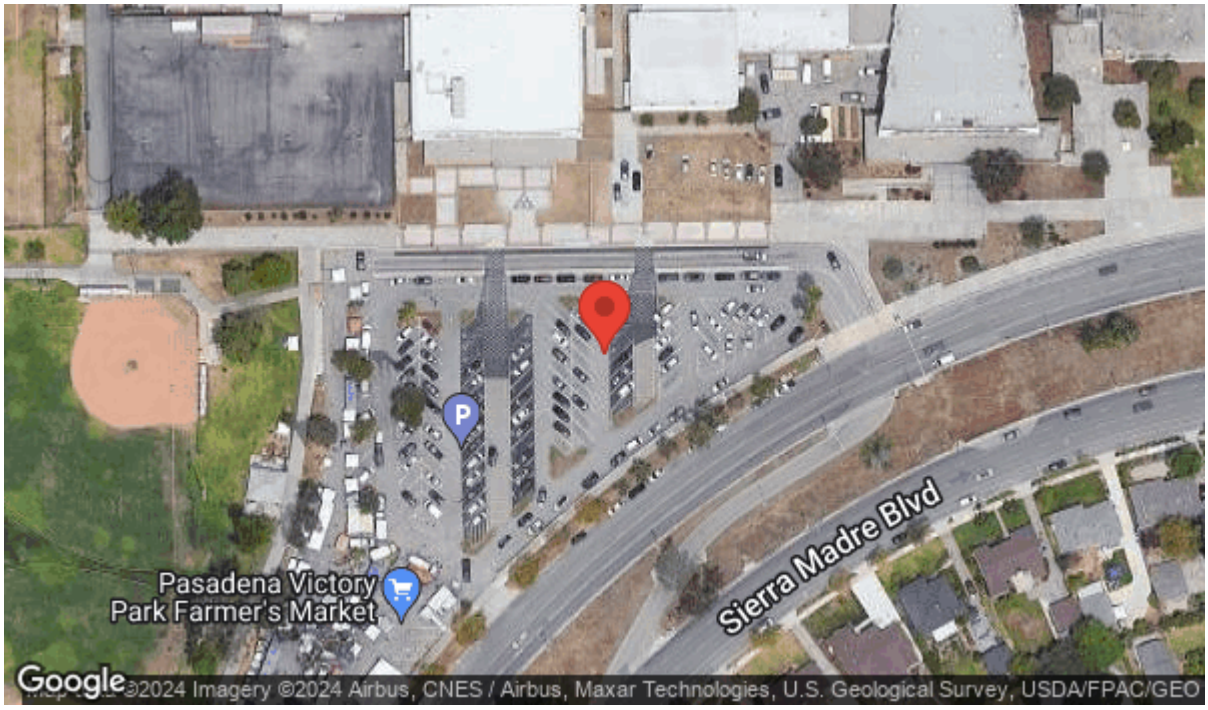

23 +34.161385, -118.093063

Photos for Barrier ID: AX418212







Barrier ID: AX418215

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Van
ADA Standard	California Building Code Chap 11B-502.3.4

Barrier Detail

CALIFORNIA: The van parking aisle for perpendicular and angled parking is not on the passenger side.

Location Description	Accessible Parking Space P1-F
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The van access aisle is not on the the passenger side.

Resolution

Remove and re-stripe with a van parking aisle which is on the passenger side of the van parking space. Accessible van parking spaces shall be at least 108" (9') wide and shall have an adjacent access aisle 96" (8') wide minimum OR shall be a minimum of 144" (12') wide and shall have an adjacent access aisle 60" (5') wide minimum. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] Each accessible car and van space shall have surface identification complying with either Section 11B-502.6.4.1 or 11B-502.6.4.2. Section 11B-502.6.4.1: The parking space shall be marked with an International Symbol of Accessibility in white on a blue background a minimum 36" wide by 36" high. The centerline of the International Symbol of Accessibility shall be a maximum of 6" from the centerline of the parking space, its sides parallel to the length of the parking space and its lower corner at, or lower side aligned with, the end of the parking space length. 11B-502.6.4.2: The parking space shall be outlined in blue or painted blue and shall be marked with an International Symbol of Accessibility minimum 36" wide by 36" high in white or a suitable contrasting color. The centerline of the International Symbol of Accessibility shall be a maximum of 6" from the centerline of the parking space, its sides parallel to the length of the parking space and its lower corner at, or lower side aligned with, the end of the parking space. Access aisles shall be marked with a blue painted borderline around their perimeter. The area within the blue borderlines shall be marked with hatched lines a maximum of 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "NO PARKING" shall be painted on the surface within each access aisle in white letters a minimum of 12" in height and located to be visible from the adjacent vehicular way. Access aisle markings may extend beyond the minimum required length.

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418215




26 +34.161419, -118.093012

Photos for Barrier ID: AX418215





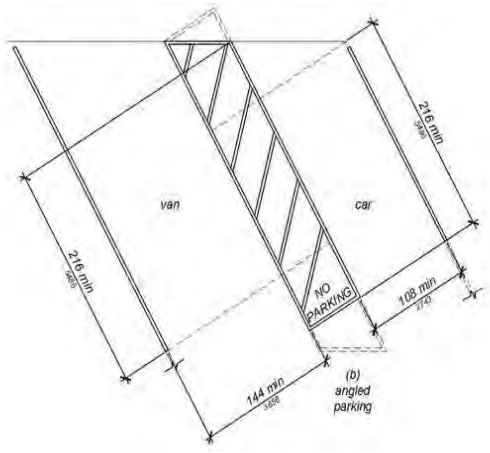

Barrier ID: AX418706

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Van
ADA Standard	California Building Code Chap 11B-502.2, 502.3, 502.6
Barrier Detail	CALIFORNIA: A van space and adjacent van aisle are not provided.
Location Description	Parking Lot 4 P4
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	Nine parking spaces provided and no accessible parking is provided.

Resolution

Provide a van parking stall and adjacent van aisle. The minimum required length of the stall is 216" (18'). The van stall shall be either 144" (12') wide minimum with access aisle 60" (5') wide minimum, or 108" (9') wide minimum with access aisle 96" (8') wide minimum. The van stall shall have surface markings with EITHER: 1. the International Symbol of Accessibility in white on a blue background a minimum 36"x 36" high OR 2. stall outlined or painted in blue, with the International Symbol of Accessibility in white or a suitable contrasting color and a minimum 36" x minimum 36" high. The centerline of the International Symbol of Accessibility shall be 6" maximum from the centerline of the stall, its sides parallel to the length of the stall and its lower side at, or lower side aligned with, the end of the parking space length. The van aisle shall be on the passenger side for both angled and straight/perpendicular 90 degree parking, when pulling into the stall. The aisle shall be marked with a blue painted borderline around its total perimeter, including adjacent to curbs, where present. The area within the blue perimeter marked with hatched lines a maximum of 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "No Parking" shall be painted on the surface within each access aisle in white letters of minimum 12" height, and located to be visible from the adjacent vehicular way. Markings may extend beyond the minimum required length 216" (18') of the stall. The van aisle shall be minimum 60" (5") wide where the van stall is minimum 144" (12') wide, OR 108" (9') wide minimum with access aisle 96" (8') wide minimum. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA

Priority	1

Map for Barrier ID: AX418706



276 +34.162271, -118.090303

Photos for Barrier ID: AX418706







Barrier ID: AX424535

Pasadena High School BUILDING U

Assembly	Accessible Parking
Type	Parking Space-Van
ADA Standard	California Building Code Chap 11B-502.2, 502.3, 502.6
Barrier Detail	CALIFORNIA: A van space and adjacent van aisle are not provided.
Location Description	Parking Lot 5 P5
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Seven parking spaces are provided. No accessible parking space provided. 1 van accessible parking space is required.

Resolution

Provide a van parking stall and adjacent van aisle. The minimum required length of the stall is 216" (18'). The van stall shall be either 144" (12') wide minimum with access aisle 60" (5') wide minimum, or 108" (9') wide minimum with access aisle 96" (8') wide minimum. The van stall shall have surface markings with EITHER: 1. the International Symbol of Accessibility in white on a blue background a minimum 36"x 36" high OR 2. stall outlined or painted in blue, with the International Symbol of Accessibility in white or a suitable contrasting color and a minimum 36" x minimum 36" high. The centerline of the International Symbol of Accessibility shall be 6" maximum from the centerline of the stall, its sides parallel to the length of the stall and its lower side at, or lower side aligned with, the end of the parking space length. The van aisle shall be on the passenger side for both angled and straight/perpendicular 90 degree parking, when pulling into the stall. The aisle shall be marked with a blue painted borderline around its total perimeter, including adjacent to curbs, where present. The area within the blue perimeter marked with hatched lines a maximum of 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "No Parking" shall be painted on the surface within each access aisle in white letters of minimum 12" height, and located to be visible from the adjacent vehicular way. Markings may extend beyond the minimum required length 216" (18') of the stall. The van aisle shall be minimum 60" (5") wide where the van stall is minimum 144" (12') wide, OR 108" (9') wide minimum with access aisle 96" (8') wide minimum. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA

Priority	1

Map for Barrier ID: AX424535



781 +34.163025, -118.093515

Photos for Barrier ID: AX424535





Barrier ID: AX425245

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space-Van
ADA Standard	California Building Code Chap 11B-502.2, 502.3, 502.6
Barrier Detail	CALIFORNIA: A van space and adjacent van aisle are not provided.
Location Description	Parking Lot 5 P5
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	A van accessible parking space is not provided.

Resolution

Provide a van parking stall and adjacent van aisle. The minimum required length of the stall is 216" (18'). The van stall shall be either 144" (12') wide minimum with access aisle 60" (5') wide minimum, or 108" (9') wide minimum with access aisle 96" (8') wide minimum. The van stall shall have surface markings with EITHER: 1. the International Symbol of Accessibility in white on a blue background a minimum 36"x 36" high OR 2. stall outlined or painted in blue, with the International Symbol of Accessibility in white or a suitable contrasting color and a minimum 36" x minimum 36" high. The centerline of the International Symbol of Accessibility shall be 6" maximum from the centerline of the stall, its sides parallel to the length of the stall and its lower side at, or lower side aligned with, the end of the parking space length. The van aisle shall be on the passenger side for both angled and straight/perpendicular 90 degree parking, when pulling into the stall. The aisle shall be marked with a blue painted borderline around its total perimeter, including adjacent to curbs, where present. The area within the blue perimeter marked with hatched lines a maximum of 36" on center in a color contrasting with that of the aisle surface, preferably blue or white. The words "No Parking" shall be painted on the surface within each access aisle in white letters of minimum 12" height, and located to be visible from the adjacent vehicular way. Markings may extend beyond the minimum required length 216" (18') of the stall. The van aisle shall be minimum 60" (5") wide where the van stall is minimum 144" (12') wide, OR 108" (9') wide minimum with access aisle 96" (8') wide minimum. Width measurements of parking spaces and access aisles shall be made from the centerline of the markings. [EXCEPTION: Where parking spaces or access aisles are not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the parking space or access aisle.] [ADVISORY 11B-502.3.3 Marking. The requirement that the hatching at the loading and unloading access aisle be a suitable contrasting color to the parking space is intended to ensure that the hatching is visually distinct from the background to which it is applied, and thus can be more easily seen. As hatching is generally recognized as a no-parking area, this difference in contrast assists drivers by providing a conspicuous visual deterrent to parking in the loading and unloading access aisle. Asphalt is often the parking surface material used at accessible parking spaces. Asphalt is generally considered to be fairly dark in appearance. In order to provide a suitable contrasting color at the hatched area of the loading and unloading access aisle, a light color hatching should be used at locations where asphalt is the parking surface material. Although white paint is preferred (and traditionally the color most often used), its use is not mandatory under the California Building Code (CBC). In order to provide a suitable contrast at the hatched area of the loading and unloading access aisle in locations where light concrete is used as the parking surface material (such as at concrete parking garages), a dark color hatching should be used. Although blue paint is preferred, its use is not mandatory under the California Building Code (CBC).]

Quantity

1 EA

Priority	1
Employee Only Space	Yes

Map for Barrier ID: AX425245



807 +34.163025, -118.093515

Photos for Barrier ID: AX425245





Barrier ID: AX418686

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.

Location Description	Accessible Route West Side of Building W
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The shelf protrudes 15 inches from the wall where the bottom edge is 41 inches above the floor. The cabinet protrudes 6 inches from the wall where the bottom edge is 38 inches above the floor.

Resolution


Install cane detectors or lower the object so that the base of the object is maximum 27" above finish floor. Objects with leading edges more than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4 -1/2" maximum.]

Quantity

2 EA

Priority	1

Map for Barrier ID: AX418686

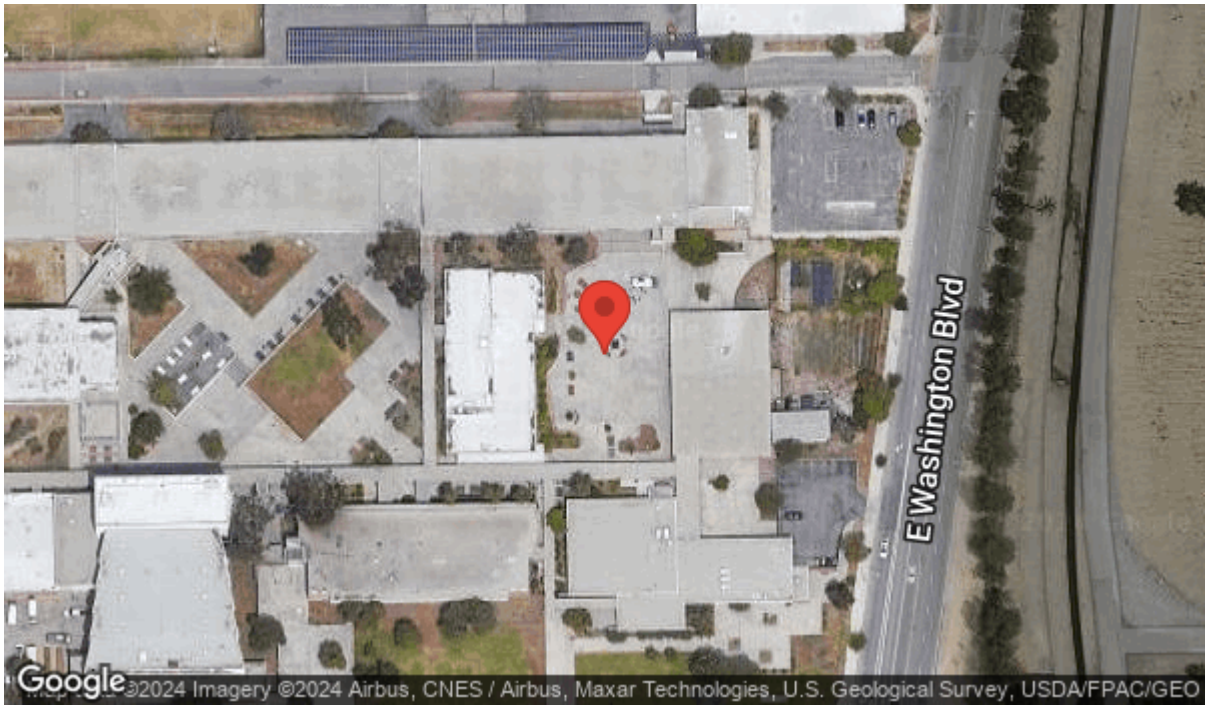

256 +34.162581, -118.090937


Photos for Barrier ID: AX418686









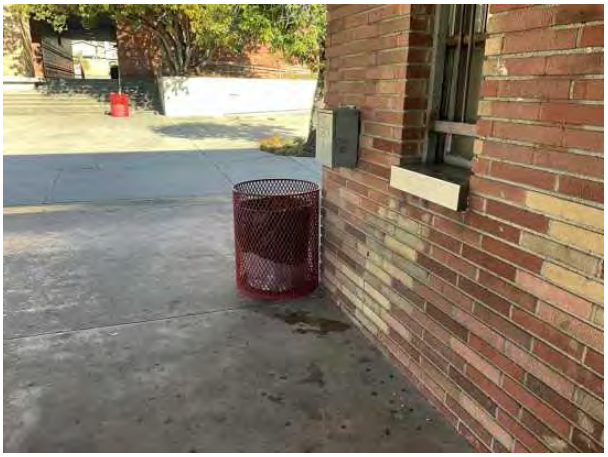



Barrier ID: AX420224

Pasadena High School SPORTS FACILITIES

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Baseball Field Concession Stand Area
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The counters protrude 14 1/4 inches from the wall where the bottom edge is 35 1/2 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity

1 EA


Priority	1

Photos for Barrier ID: AX420224







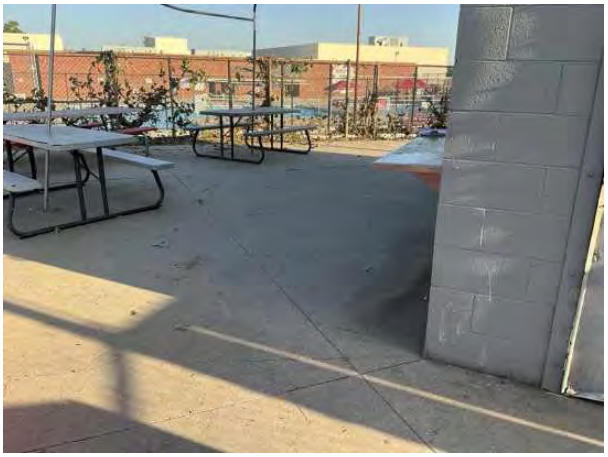

Barrier ID: AX424438

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building A - 101 Nurse
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The paper towel dispenser protrudes, 9 inches from the wall, where the bottom edge is 59 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity


1 EA

Priority	1

Photos for Barrier ID: AX424438





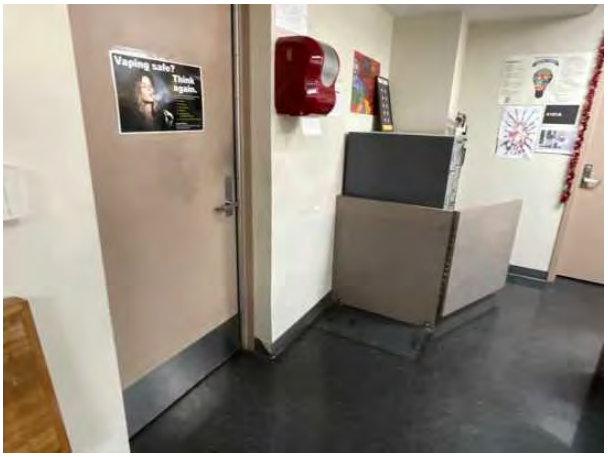

Barrier ID: AX424389

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building A - A206
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The IT cabinet protrudes 27 inches from the wall where the bottom edge is 36 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX424389







Barrier ID: AX424474

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building A - Corridor East Side
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The display case protrudes 14 inches from the wall where the bottom edge is 50 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX424474







Barrier ID: AX419864

Pasadena High School BUILDING C

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building C - C107
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The IT cabinet protrudes 28 inches from the wall where the bottom edge is 48 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity


1 EA

Priority	1

Photos for Barrier ID: AX419864





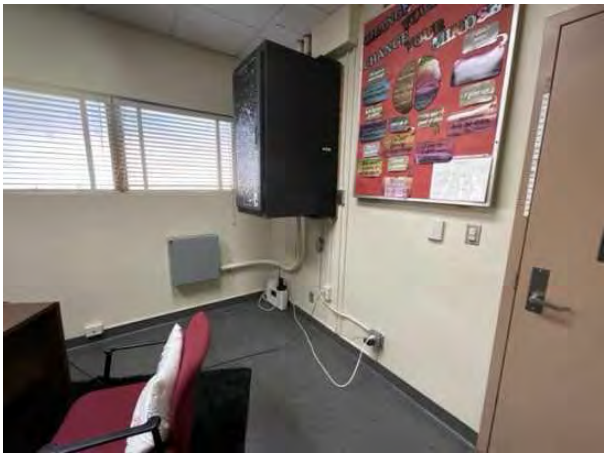

Barrier ID: AX418393

Pasadena High School BUILDING D

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building D - D153 Corridor
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The display case protrudes 14 1/4 inches where the bottom edges 39 and three-quarter inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity


1 EA

Priority	1

Photos for Barrier ID: AX418393





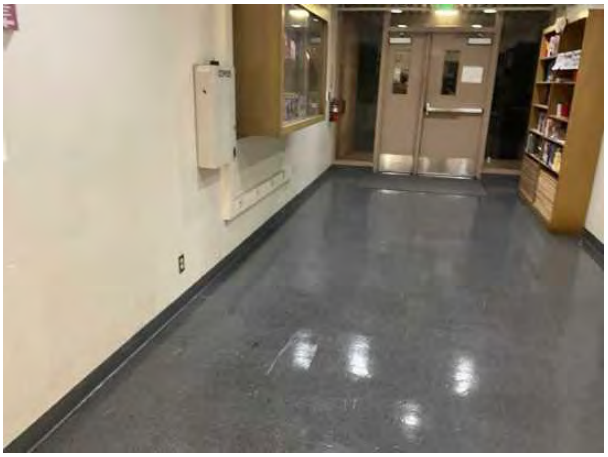

Barrier ID: AX419842

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building E - 2nd Floor 208
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The T.V. monitor protrudes 5 1/2 inches from the wall where the bottom edge is higher than 27 inches from the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]


Quantity

1 EA

Priority	1

Photos for Barrier ID: AX419842



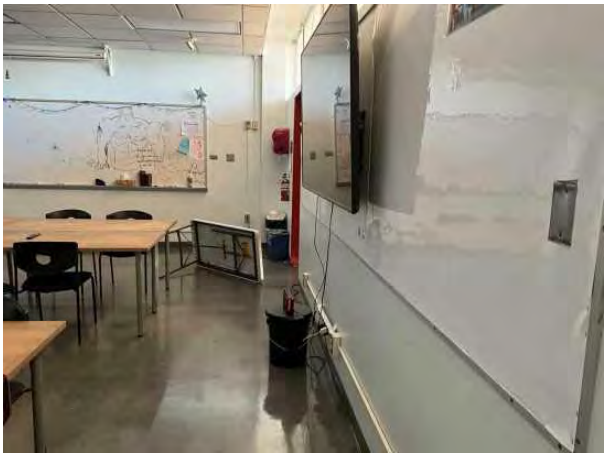

Barrier ID: AX418732

Pasadena High School BUILDING I

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building I - I208
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The IT cabinet protrudes 24 inches from the wall where the bottom edge is 48 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX418732







Barrier ID: AX418731

Pasadena High School BUILDING I

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building I - I210
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The shelf protrudes 10 inches from the wall where the bottom edge is 59 inches above the floor. The TV monitor protrudes up to 20 inches from the wall where the bottom edge is 68 inches above the floor.

Resolution


Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]


Quantity

1 EA

Priority	1

Photos for Barrier ID: AX418731

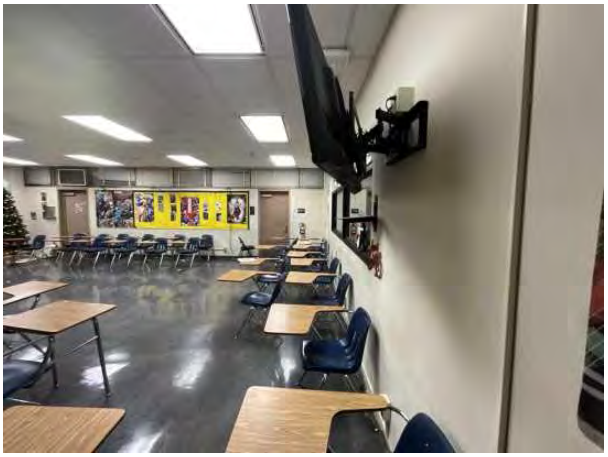

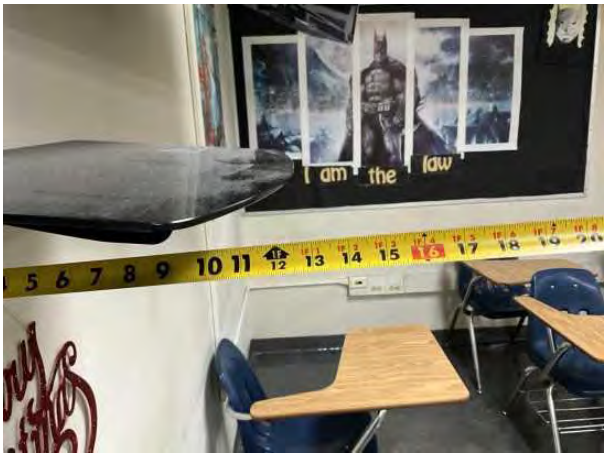









Barrier ID: AX418639

Pasadena High School BUILDING N

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building N - 104A Workroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The IT cabinet protrudes 27 inches from the wall, and the bottom edge is 52 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX418639







Barrier ID: AX418642

Pasadena High School BUILDING N

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building N - P105
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The the fire extinguisher cabinet protrudes 6 1/2 inches from the wall where the bottom edge is 27 1/4 inches above the floor

Resolution


Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity

2 EA

Priority	1

Photos for Barrier ID: AX418642

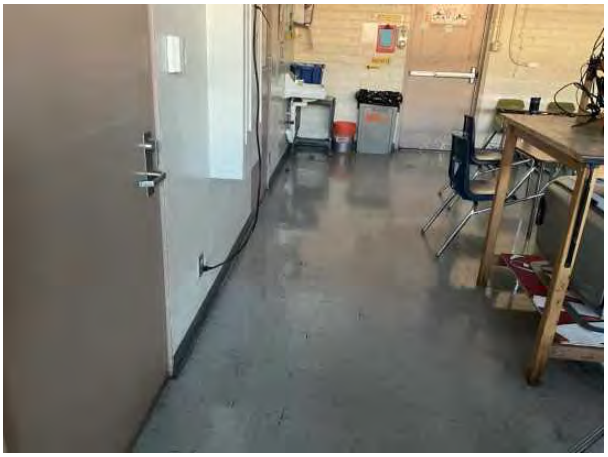





Barrier ID: AX418641

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building N, P, & Q - Typical Classroom Sinks
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Classrooms N104, P105, and Q107 have sinks protruding 18 inches from the wall where the bottom 29 1/2 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity

3 EA

Priority	1

Photos for Barrier ID: AX418641













Barrier ID: AX418643

Pasadena High School BUILDING Q

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building Q - Q101
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The IT cabinet protrudes 27 inches or the bottom edge 49 1/2 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]


Quantity

3 EA

Priority	1

Photos for Barrier ID: AX418643



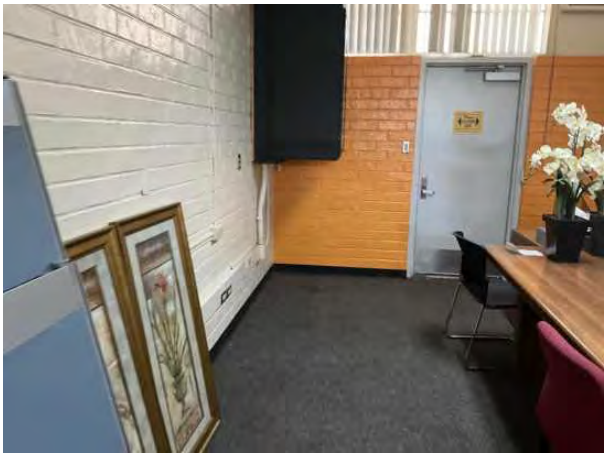



Barrier ID: AX418647

Pasadena High School BUILDING Q

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building Q - Q107
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Electrical panel protrudes 5 1/4 inches from the wall where the bottom edge is 38 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity


1 EA

Priority	1

Photos for Barrier ID: AX418647





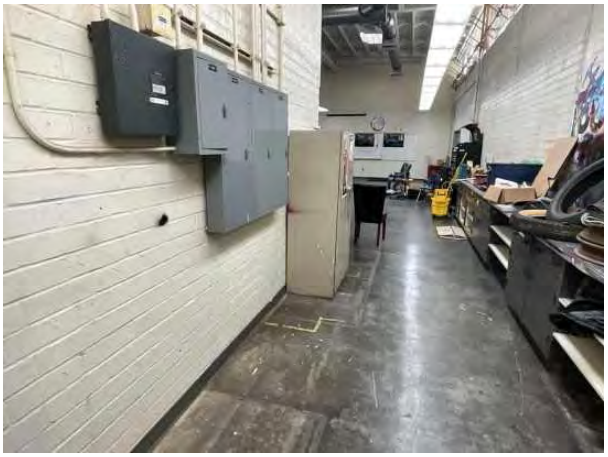

Barrier ID: AX418649

Pasadena High School BUILDING Q

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building Q - Q109A
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The sink is a protruding object which protrudes from the wall 18 inches where the bottom edge is 29 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity

1 EA

Priority	1

Photos for Barrier ID: AX418649







Barrier ID: AX419785

Pasadena High School BUILDING R

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building R - R101 Foyer
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The concession counter protrudes 4 3/4 inches from the wall where the bottom edge is 32 3/4 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]


Quantity

1 EA

Priority	1

Photos for Barrier ID: AX419785



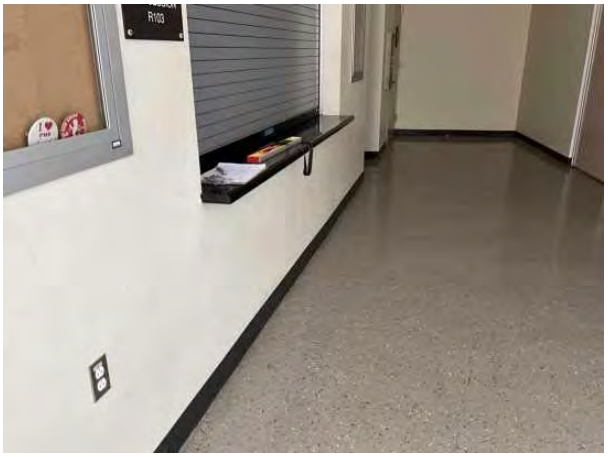



Barrier ID: AX418679

Pasadena High School BUILDING W

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Building W - W106
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The shelf protrudes 14 inches from the wall where the bottom edge is 62 inches above the floor and the IT cabinet protrudes 27 inches from the wall where the bottom edge is 40 inches above the floor.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity

2 EA

Priority	1
Employee Only Space	Yes

Photos for Barrier ID: AX418679












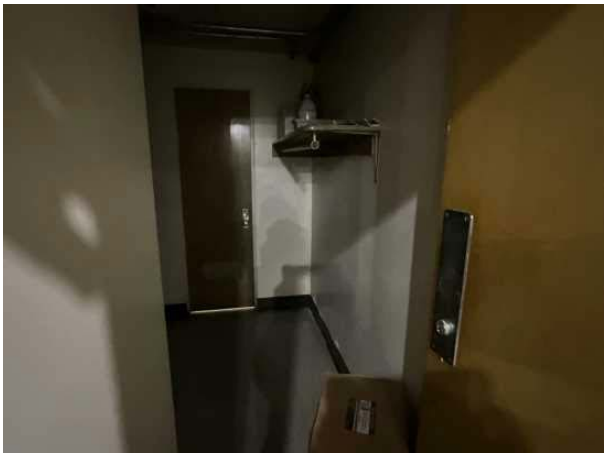

Barrier ID: AX418236

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Typical Fire Alarm Pull Enclosures Protrude
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Typical throughout the campus, the fire alarm pull enclosures protrude 5 1/2 inches from the wall where the bottom edge is 45 inches above the floor. Building A has 2 enclosures. Building B has 6 enclosures. Building C has 2 enclosures. Building E has 6 enclosures. Building F has 3 enclosures. Building G has 6 enclosures. Building H has 6 enclosures. Building I has 6 enclosures. Building P has 2 enclosures. Building V has 2 enclosures.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity


41 EA

Priority	1

Photos for Barrier ID: AX418236





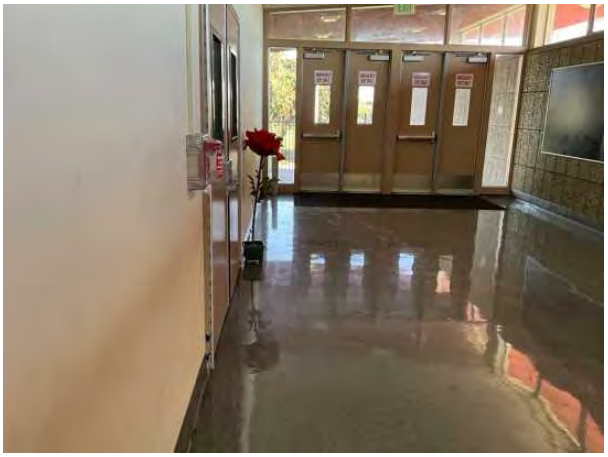







Barrier ID: AX418235

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Typical Fire Extinguishers Cabinets Protrude
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The fire extinguisher cabinets protrude 6 inches from the wall where the bottom edge is 30 inches above the floor. Building B has 7 cabinets protruding. Building T has 4 cabinets protruding.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]


Quantity

11 EA

Priority	1


Photos for Barrier ID: AX418235




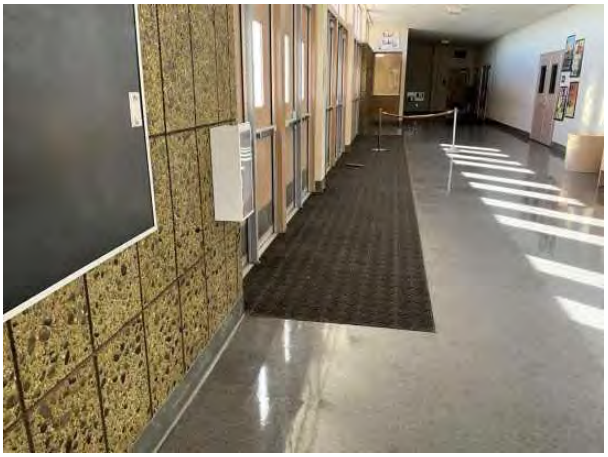





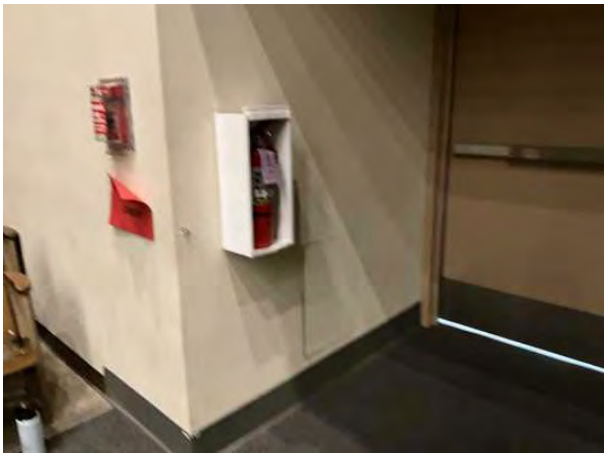

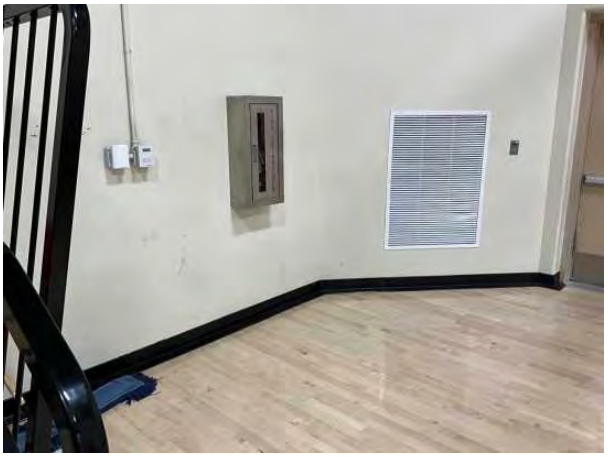




27
28
29
30
31
32
33

Barrier ID: AX418280

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Typical Fire Extinguishers On Hooks Protruding.
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Typical fire extinguisher cabinets or fire fire extinguishers on hooks, protrude more than 4 inches from the wall where the bottom edge is above 27 inches. Building A has 8. Building D has 1. Building E has 12. Building F has 2. Building E has 6. Building H has 10. Building I has 6. Building N has 3. Building P has 1. Building W has 1.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity

50 EA

Priority	1

Photos for Barrier ID: AX418280









Barrier ID: AX418279

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.

Location Description	Typical Paper Towel Dispensers Protruding Objects
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Most paper towel dispensers provided throughout the campus are mounted within an accessible route protruding from the wall 9 inches where the bottom edges are higher than 27 from the floor. Building A has 6, 2nd floor. Building C has 2. Building E has 9. Building F has 1. Building G has 10. Building H has 2. Building I has 3.

Resolution

Install cane detectors. Objects with leading edges higher than 27" and not more than 80" above the finish floor or ground shall protrude 4" maximum horizontally into the circulation path. [EXCEPTION: Handrails shall be permitted to protrude 4-1/2" maximum.]

Quantity

27 EA

Priority	1

Photos for Barrier ID: AX418279









Barrier ID: AX418266

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Ramp
ADA Standard	505
Barrier Detail	Handrail heights are not compliant.
Location Description	Building B - Auditorium Interior Ramp West Side
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions


The ramp handrails are not compliant. The top gripping surface is 32 inches above the floor and the ramp does not provide the top and bottom 12 inch horizontal extensions. The handrail cross section dimension is 3 1/2.

Resolution


Install compliant handrails on each side of ramp. Handrails are required on ramp runs with a rise greater than 6". Handrails are not required on walking surfaces with running slopes less than 1:20. Handrails shall be provided on both sides of ramps. [EXCEPTION: In assembly areas, handrails shall not be required on both sides of aisle ramps where a handrail is provided at either side or within the aisle width.] Handrails shall be continuous within the full length of each ramp run. Inside handrails on ramps shall be continuous between runs. [EXCEPTION: In assembly areas, handrails on ramps shall not be required to be continuous in aisles serving seating.] Handrails shall be at a consistent height above the ramp on both sides of the ramp. Tops of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above ramp surfaces. [ADVISORY: The requirements for ramp handrails are for adults. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28", measured to the top of the gripping surface from the ramp surface or stair nosing, is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.] Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1. Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4".] Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of ramp runs. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg ramps AND 3. In alterations, full extensions of handrails shall not be required where such extensions would be hazardous due to plan configuration.] Ramp handrails shall extend horizontally above the landing for 12" minimum beyond the top and bottom of ramp runs. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent ramp run. Edge Protection: A curb or barrier shall be provided that prevents the passage of a 4" diameter sphere, where any portion of the sphere is within 4" of the finish floor or ground surface, or the surface of the ramp shall extend 12" minimum beyond the handrail. [EXCEPTIONS: 1. Edge protection is not required on ramps that are not required to have handrails and curb ramps with flares. 2. Edge protection is not required on the sides of ramp landings servings an adjoining ramp run. 3. Edge protection shall not be required on the sides of ramp landings having a vertical drop-off of ½" maximum within 10" horizontally of the minimum landing area.]


Quantity	
60 LF	
Priority	1

Photos for Barrier ID: AX418266

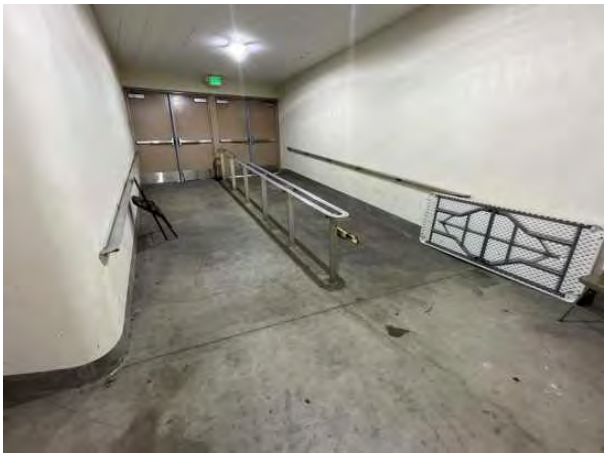





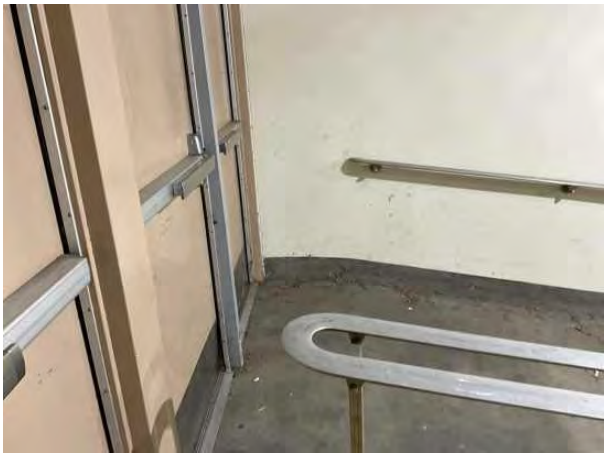

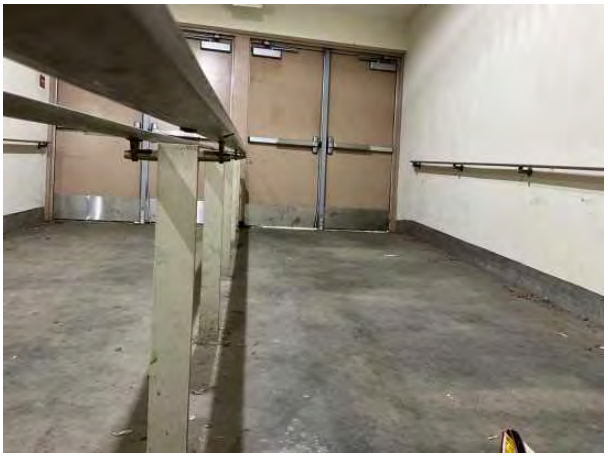



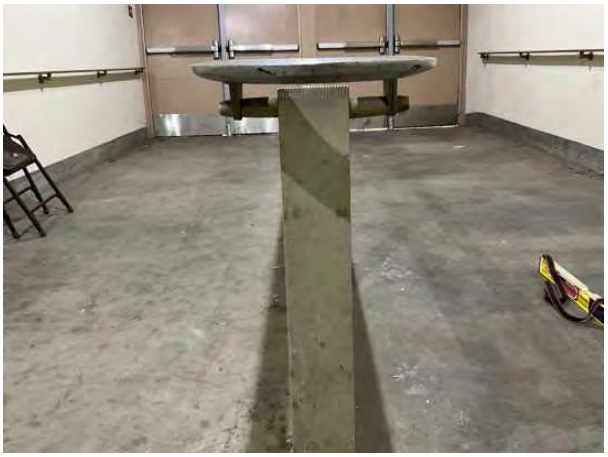

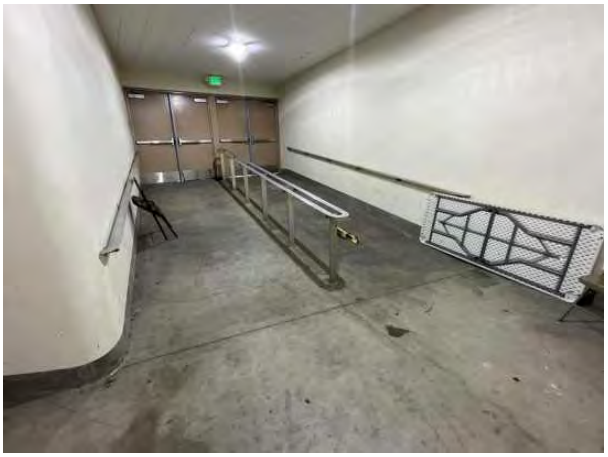

Barrier ID: AX418267

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Ramp
ADA Standard	405.2
Barrier Detail	The ramp running slope exceeds 1:12 (8.33%).
Location Description	Building B - Auditorium Interior Ramp West Side
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp slopes up to 12.3%

Resolution


Remove and replace areas of the ramp run to provide a ramp run with maximum slopes 1:12 (8.33%). The cross slope of ramp surfaces shall be no greater than 1:50 (2.0%). [EXCEPTION: Cross slopes not greater than 1:48 are permitted.] Ramp runs shall have a running slope not steeper than 1:12. [EXCEPTION: In existing sites, buildings, and facilities, ramps shall be permitted to have running slopes steeper than 1:12 where such slopes are necessary due to space limitations. Maximum Ramp Slope and Rise for Existing Sites, Buildings, and Facilities: Slope-Steeper than 1:10 but not steeper than 1:8; Maximum Rise is 3"; Steeper than 1:12 but not steeper than 1:10; Maximum Rise is 6". A slope steeper than 1:8 is prohibited.]


Quantity

20 LF


Priority	1

Photos for Barrier ID: AX418267

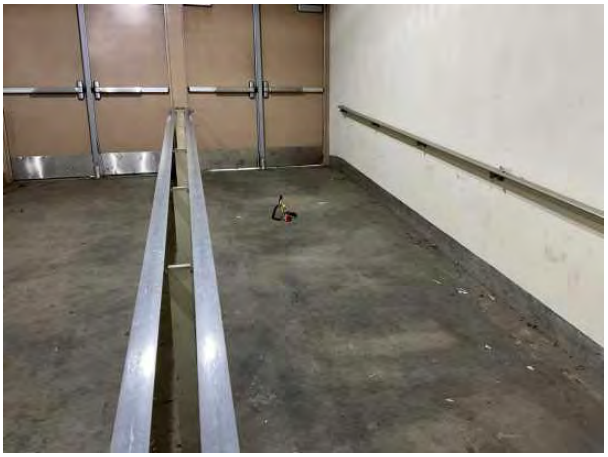

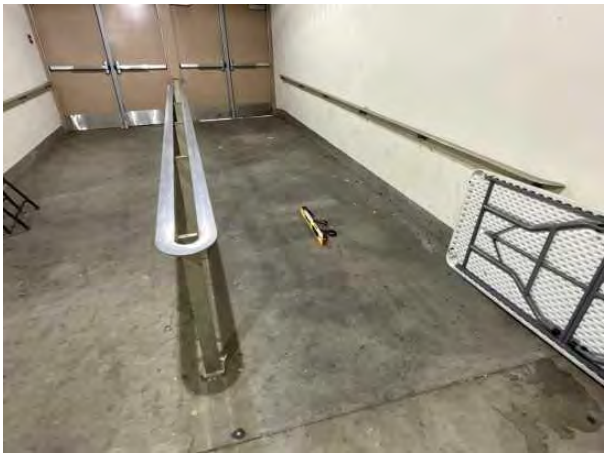



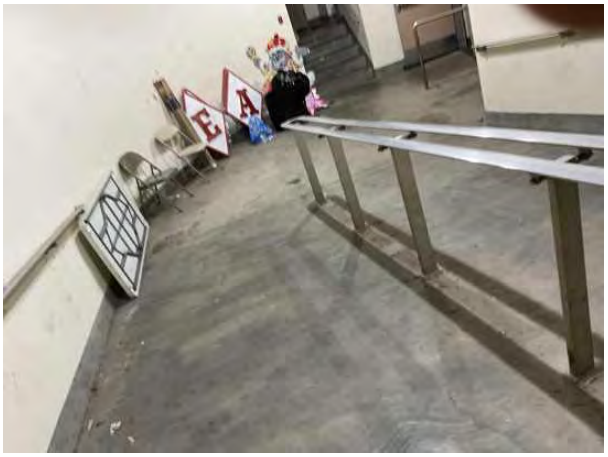



Barrier ID: AX419854

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Ramp
ADA Standard	405.2
Barrier Detail	The ramp running slope exceeds 1:12 (8.33%).
Location Description	Building B -Ramp Adjacent To B106
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp has running slopes up to 9.8%.

Resolution


Remove and replace areas of the ramp run to provide a ramp run with maximum slopes 1:12 (8.33%). The cross slope of ramp surfaces shall be no greater than 1:50 (2.0%). [EXCEPTION: Cross slopes not greater than 1:48 are permitted.] Ramp runs shall have a running slope not steeper than 1:12. [EXCEPTION: In existing sites, buildings, and facilities, ramps shall be permitted to have running slopes steeper than 1:12 where such slopes are necessary due to space limitations. Maximum Ramp Slope and Rise for Existing Sites, Buildings, and Facilities: Slope-Steeper than 1:10 but not steeper than 1:8; Maximum Rise is 3"; Steeper than 1:12 but not steeper than 1:10; Maximum Rise is 6". A slope steeper than 1:8 is prohibited.]

Quantity

20 LF

Priority	1

Photos for Barrier ID: AX419854

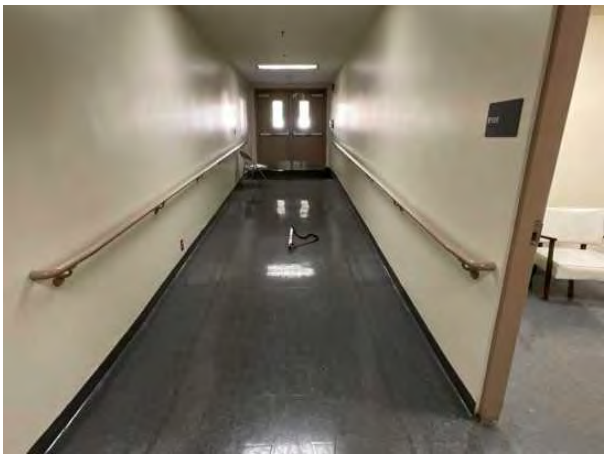



Barrier ID: AX419857

Pasadena High School BUILDING C

Assembly	Interior Access Route
Type	Ramp
ADA Standard	405, 505
Barrier Detail	A ramp is required but not provided.
Location Description	Building C - C106 Choir Room
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	A ramp is not provided to the upper seating area.

Resolution

Provide a compliant ramp or reduce the walking surface to maximum 1:20 (5%) running slope. The cost estimate for this barrier removal is based on providing a ramp, rather than grading the running slope to maximum 1:20 (5%). Ramp runs shall have a running slope not steeper than 1:12, and a cross slope not steeper than 1:48. [EXCEPTION: In existing sites built pre-1/26/92, buildings, and facilities, ramps shall be permitted to have running slopes steeper than 1:12 where such slopes are necessary due to space limitations.Where slopes are steeper than 1:10 but not steeper than 1:8, the rise shall be 3" maximum. Where slopes are steeper than 1:12 but not steeper than 1:10, the rise shall be 6" maximum.] The clear width of a ramp run and, where handrails are provided, the clear width between handrails shall be 36" minimum. The clear width of a ramp run and, where handrails are provided, the clear width between handrails shall be 36" minimum. [EXCEPTION: Within employee work areas, the required clear width of ramps that are a part of common use circulation paths shall be permitted to be decreased by work area equipment provided that the decrease is essential to the function of the work being performed.] Ramp runs shall have maximum 30" rise. Ramp landings shall be located at the top and bottom of ramp runs, and at turns of ramp direction. Landings shall be 1:48 maximum slope in any direction. Landings shall be minimum 60" length, and as wide as the ramp run, except ramp landings at turns which shall be minimum 60" x 60" minimum. All ramp runs with a rise of 6" or greater shall have handrails on each side of the ramp. Handrails shall be compliant. The top of the handrail gripping surface shall be 34" minimum to 38" maximum vertically above the ramp surface. Provide edge protection on the sides of each ramp run which rises more than 6" and on ramp landings. Compliant edge protection shall be provided on each side of ramp runs and at each side of ramp landings. Compliant edge protection is EITHER a curb or barrier that prevents the passage of a 4" diameter sphere where the sphere is within 4" of the ramp surface OR an extension of the ramp surface 12" minimum beyond the inner face of the rail. [EXCEPTIONS: 1. Edge protection shall not be required on ramps that are not required to have handrails and have sides. 2. Edge protection shall not be required on the sides of ramp landings serving an adjoining ramp run or stairway. 3. Edge protection shall not be required on the sides of ramp landings having a vertical drop-off of 1/2" maximum within 10" horizontally of the minimum required landing area.] Ramps and their approaches shall be designed so that water will not accumulate on walking surfaces.


Quantity

10 LF

Priority	1

Photos for Barrier ID: AX419857



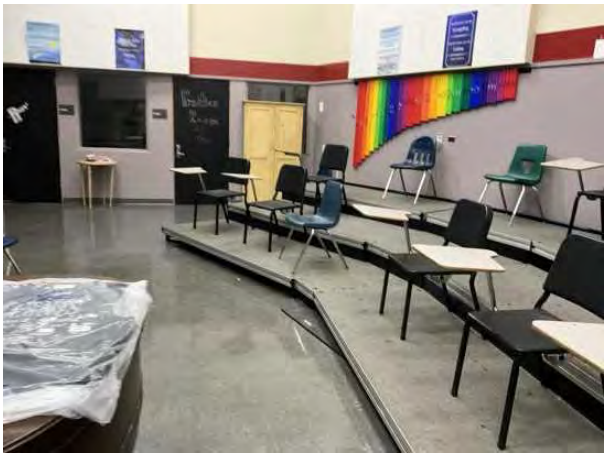

Barrier ID: AX419873

Pasadena High School BUILDING C

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-403.5.1,505
Barrier Detail	CALIFORNIA: The exterior ramp railings are not provided or not compliant.
Location Description	Building C - Ramp Near Exit Facing South
Observed	Dec 10, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp does not provide handrails.

Resolution


Provide compliant handrails on both sides of the ramp. [EXCEPTION: At door landings, handrails are not required on ramp runs less than 6" rise or 72" in length.] The handrails on each side shall be a minimum 48" apart horizontally. The top of the gripping surface of the handrail shall be 34" minimum and 38" maximum vertical above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. The gripping surface of handrails shall be 1.25" to 2" diameter, or a non-circular grip that has a perimeter dimension of 4" to 6.25" maximum. Provide a bottom rail that is maximum 4" from the ramp surface and prevents the passage of a 4" diameter sphere between the ramp surface and the rail. Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1.Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of ramp runs. Ramp handrails shall extend horizontally above the landing for 12" minimum beyond the top and bottom of ramp runs. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent ramp run. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, where the extension of the handrail in the direction of the ramp run would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of the ramp run.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

1 LF

Priority 1

Photos for Barrier ID: AX419873

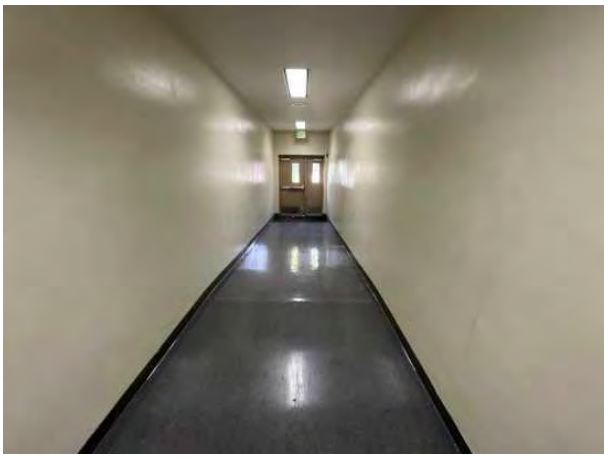

Barrier ID: AX419874

Pasadena High School BUILDING C

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-405
Barrier Detail	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.
Location Description	Building C - Ramp Near Exit Facing South
Observed	Dec 10, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp slopes, 8.8% and no handrails are provided.

Resolution

The ramp should be removed and an accessible ramp should be installed. Ramp runs shall have a running slope not steeper than 1:12. Cross slopes shall not be steeper than 1:48. The maximum rise of a ramp run shall be 30". The ramp shall have 48" minimum clear width. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, and min. 60" wide and at least as wide as the ramp run. Ramp landings at the top of ramps shall be 60" minimum by 60" minimum. Ramp landings located between ramp runs, where landings are not at a turn in direction shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" min. wide by 72" min. length in the direction of downward travel from the upper ramp run. Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. Ramps and their approaches shall be designed so that water will not accumulate on walking surfaces. All ramp runs shall have handrails on each side of the ramp. [Exception: A door landings, handrails are not required on ramp runs less than 6" in rise or minimum 72" in length.]


Quantity

18 LF

Priority	1

Photos for Barrier ID: AX419874



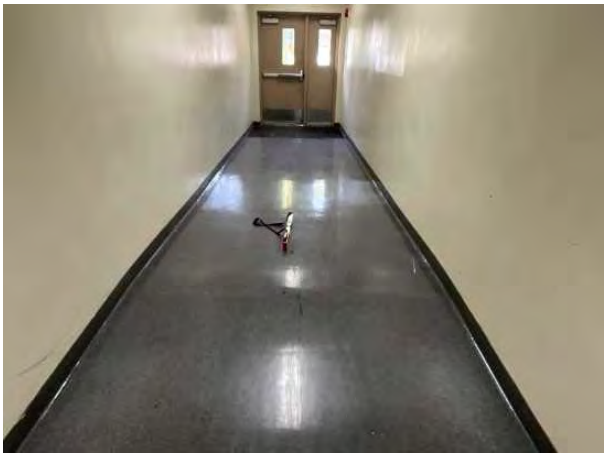

Barrier ID: AX419804

Pasadena High School BUILDING R

Assembly	Interior Access Route
Type	Ramp
ADA Standard	405.2
Barrier Detail	The ramp running slope exceeds 1:12 (8.33%).
Location Description	Building R - Interior Ramp Leading to West Exit
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp has a running slope of 9% for a length of 5 feet.

Resolution


Remove and replace areas of the ramp run to provide a ramp run with maximum slopes 1:12 (8.33%). The cross slope of ramp surfaces shall be no greater than 1:50 (2.0%). [EXCEPTION: Cross slopes not greater than 1:48 are permitted.] Ramp runs shall have a running slope not steeper than 1:12. [EXCEPTION: In existing sites, buildings, and facilities, ramps shall be permitted to have running slopes steeper than 1:12 where such slopes are necessary due to space limitations. Maximum Ramp Slope and Rise for Existing Sites, Buildings, and Facilities: Slope-Steeper than 1:10 but not steeper than 1:8; Maximum Rise is 3"; Steeper than 1:12 but not steeper than 1:10; Maximum Rise is 6". A slope steeper than 1:8 is prohibited.]

Quantity

5 LF

Priority	1

Photos for Barrier ID: AX419804

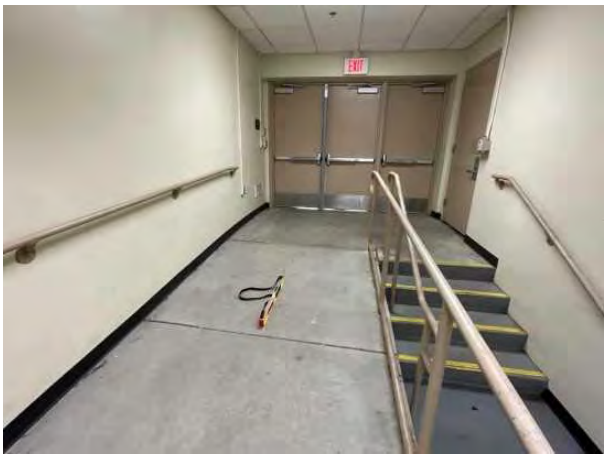



Barrier ID: AX419898

Pasadena High School BUILDING S

Assembly	Interior Access Route
Type	Ramp
ADA Standard	405.2
Barrier Detail	The ramp running slope exceeds 1:12 (8.33%).
Location Description	Building S - Ramp Adjacent to S119 Women's Restroom
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp slopes, 9.5% for a length of 5 feet.

Resolution


Remove and replace areas of the ramp run to provide a ramp run with maximum slopes 1:12 (8.33%). The cross slope of ramp surfaces shall be no greater than 1:50 (2.0%). [EXCEPTION: Cross slopes not greater than 1:48 are permitted.] Ramp runs shall have a running slope not steeper than 1:12. [EXCEPTION: In existing sites, buildings, and facilities, ramps shall be permitted to have running slopes steeper than 1:12 where such slopes are necessary due to space limitations. Maximum Ramp Slope and Rise for Existing Sites, Buildings, and Facilities: Slope-Steeper than 1:10 but not steeper than 1:8; Maximum Rise is 3"; Steeper than 1:12 but not steeper than 1:10; Maximum Rise is 6". A slope steeper than 1:8 is prohibited.]

Quantity

5 LF

Priority	1

Photos for Barrier ID: AX419898

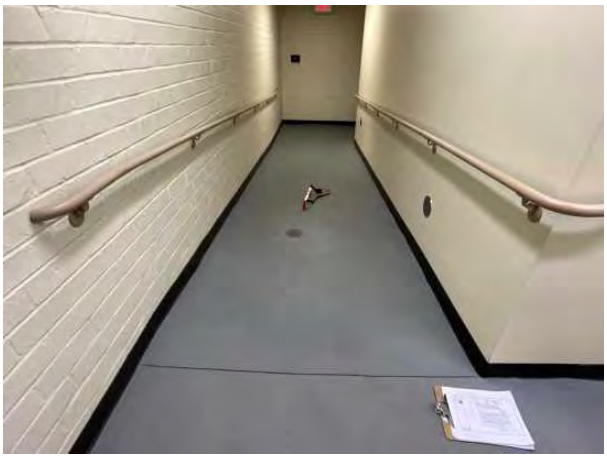



Barrier ID: AX419892

Pasadena High School BUILDING S

Assembly	Interior Access Route
Type	Ramp
ADA Standard	505.9
Barrier Detail	Handrails are not compliant - they are not secure in their fittings or they rotate
Location Description	Building S - Ramp Adjacent to S129 Boys Restroom
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The ramp handrail is loose and does not provide a 12 inch extension at the top

Resolution	Modify or replace handrails to be secure in their fittings and do not rotate.


Quantity

15 LF

Priority	1

Photos for Barrier ID: AX419892



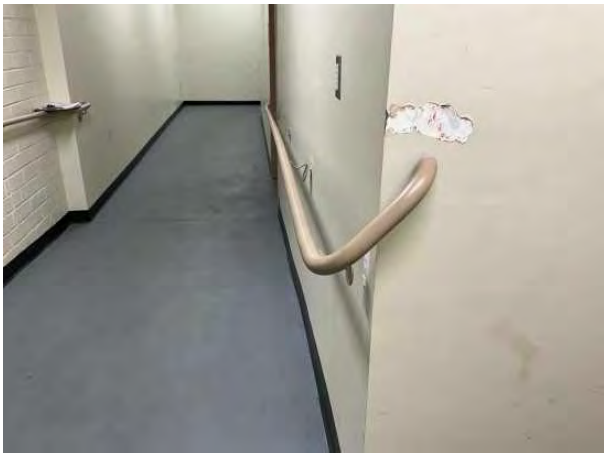



Barrier ID: AX418220

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-405.7
Barrier Detail	CALIFORNIA: The ramp landings are not compliant.
Location Description	Ramp R1
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The bottom landing slopes, 3.8%.

Resolution

Install compliant ramp landings. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, minimum 60" wide, and at least as wide as the ramp run. Ramp landings at the top of the ramp shall be 60" minimum length and 60" minimum wide. Ramp landings in the middle of the ramp, where landings are not at a turn shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" minimum wide by 72" minimum length in the direction of downward travel from the upper ramp run. The maximum rise of a ramp run shall be 30". Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. [Exception: Slopes not steeper than 1:48 shall be permitted.]

Quantity

3 LF

Priority	1


Map for Barrier ID: AX418220



31 +34.161687, -118.093487

Photos for Barrier ID: AX418220



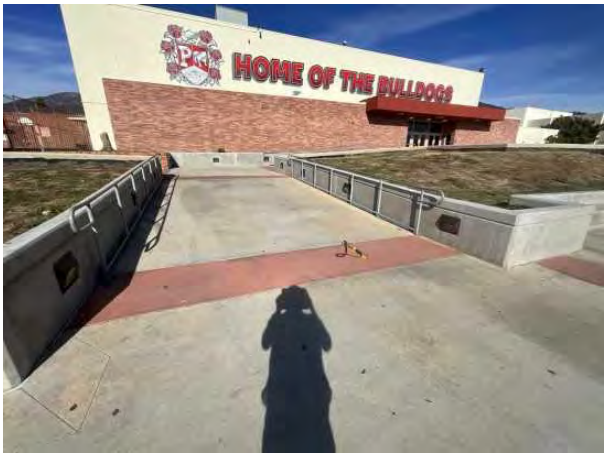

Barrier ID: AX418221

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-405
Barrier Detail	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.
Location Description	Ramp R1
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The ramp has a running slope of 8.7% toward the top of the ramp for a length of 8 feet.

Resolution

The ramp should be removed and an accessible ramp should be installed. Ramp runs shall have a running slope not steeper than 1:12. Cross slopes shall not be steeper than 1:48. The maximum rise of a ramp run shall be 30". The ramp shall have 48" minimum clear width. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, and min. 60" wide and at least as wide as the ramp run. Ramp landings at the top of ramps shall be 60" minimum by 60" minimum. Ramp landings located between ramp runs, where landings are not at a turn in direction shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" min. wide by 72" min. length in the direction of downward travel from the upper ramp run. Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. Ramps and their approaches shall be designed so that water will not accumulate on walking surfaces. All ramp runs shall have handrails on each side of the ramp. [Exception: A door landings, handrails are not required on ramp runs less than 6" in rise or minimum 72" in length.]

Quantity

8 LF


Priority	1

Map for Barrier ID: AX418221



32 +34.161763, -118.093493

Photos for Barrier ID: AX418221

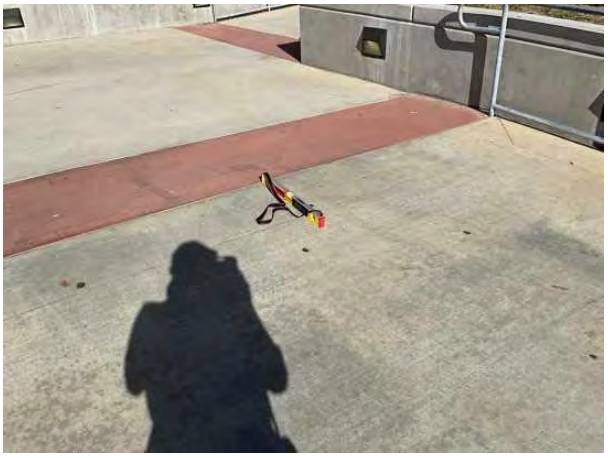



Barrier ID: AX420156

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-405
Barrier Detail	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.
Location Description	Ramp R10 Adjacent to Portable Restrooms South of Building S
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp has running slopes up to 9.2%.

Resolution

The ramp should be removed and an accessible ramp should be installed. Ramp runs shall have a running slope not steeper than 1:12. Cross slopes shall not be steeper than 1:48. The maximum rise of a ramp run shall be 30". The ramp shall have 48" minimum clear width. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, and min. 60" wide and at least as wide as the ramp run. Ramp landings at the top of ramps shall be 60" minimum by 60" minimum. Ramp landings located between ramp runs, where landings are not at a turn in direction shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" min. wide by 72" min. length in the direction of downward travel from the upper ramp run. Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. Ramps and their approaches shall be designed so that water will not accumulate on walking surfaces. All ramp runs shall have handrails on each side of the ramp. [Exception: A door landings, handrails are not required on ramp runs less than 6" in rise or minimum 72" in length.]

Quantity

15 LF

Priority	1

Map for Barrier ID: AX420156




535 +34.162025, -118.093976


Photos for Barrier ID: AX420156







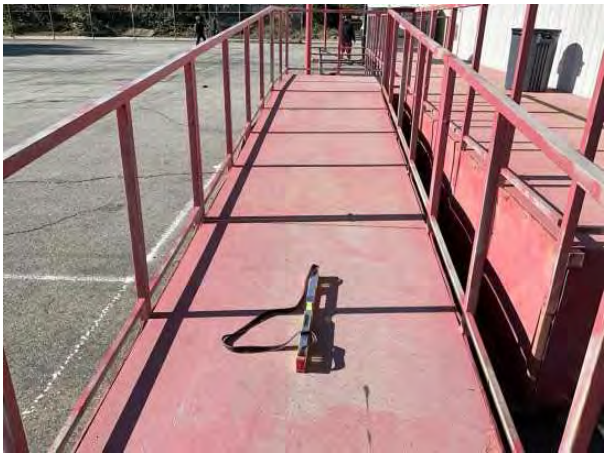

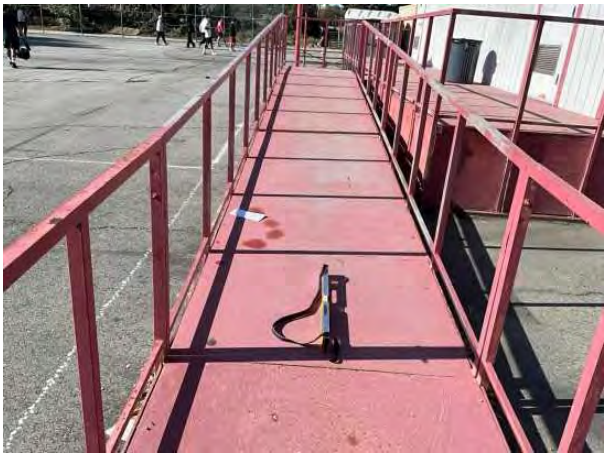

Barrier ID: AX418714

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-403.5.1,505
Barrier Detail	CALIFORNIA: The exterior ramp railings are not compliant.
Location Description	Ramp R10 Between Building H & I North Side 1st Floor
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp slope, 5.0% percent to 5.8% and only one handrail is provided.

Resolution

Provide compliant handrails on both sides of the ramp. [EXCEPTION: At door landings, handrails are not required on ramp runs less than 6" rise or 72" in length.] The handrails on each side shall be a minimum 48" apart horizontally. The top of the gripping surface of the handrail shall be 34" minimum and 38" maximum vertical above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. The gripping surface of handrails shall be 1.25" to 2" diameter, or a non-circular grip that has a perimeter dimension of 4" to 6.25" maximum. Provide a bottom rail that is maximum 4" from the ramp surface and prevents the passage of a 4" diameter sphere between the ramp surface and the rail. Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1.Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of ramp runs. Ramp handrails shall extend horizontally above the landing for 12" minimum beyond the top and bottom of ramp runs. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent ramp run. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, where the extension of the handrail in the direction of the ramp run would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of the ramp run.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

62 LF


Priority 1


Map for Barrier ID: AX418714




284 +34.162837, -118.092213

Photos for Barrier ID: AX418714

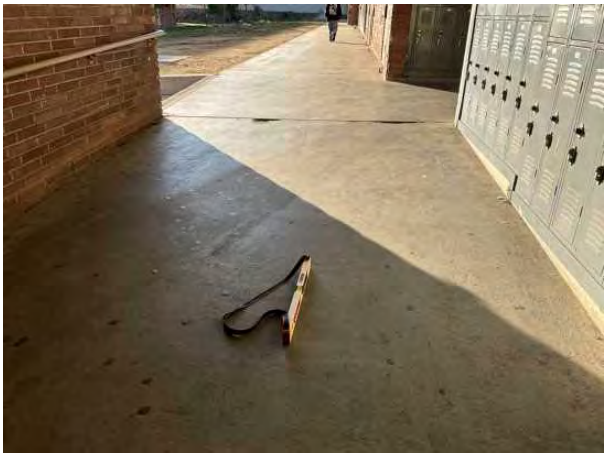

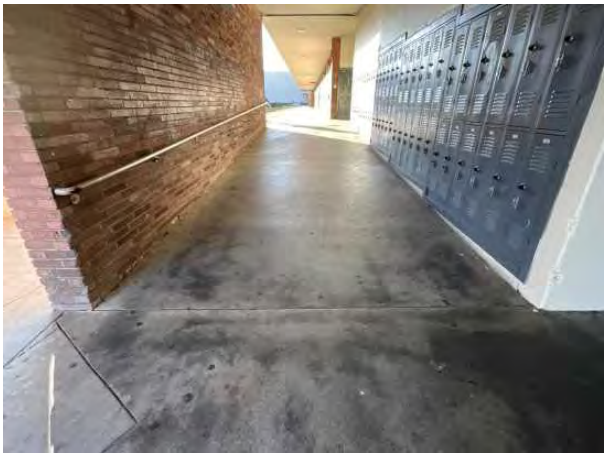



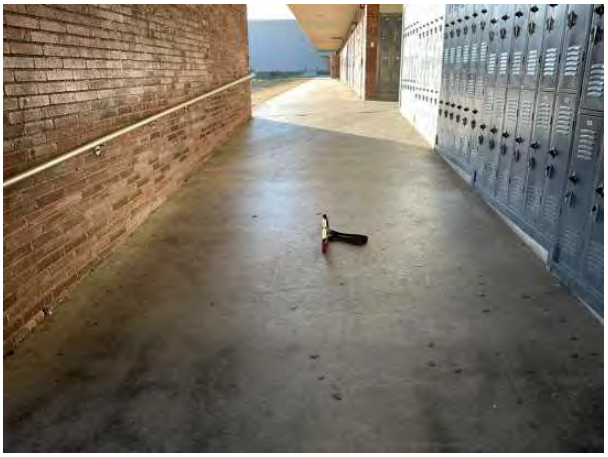



Barrier ID: AX418715

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	405.3
Barrier Detail	The ramp has cross slopes in excess of 1:48 (2.08%).
Location Description	Ramp R10 Between Building H & North Side
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp has cross slopes up to 2.8% for a total length of 10' x 10' wide

Resolution

The ramp should be removed and an accessible ramp should be installed. Ramp runs shall have a cross slope not steeper than 1:48. Ramp runs shall have a running slope not steeper than 1:12. [EXCEPTION: In existing sites, buildings, and facilities built pre 1/26/92, ramps shall be permitted to have running slopes steeper than 1:12 where such slopes are necessary due to space limitations. Where slopes are steeper than 1:10 but not steeper than 1:8, the rise shall be 3" maximum. Where slopes are steeper than 1:12 but not steeper than 1:10, the rise shall be 6" maximum.]

Quantity

100 LF

Priority	1


Map for Barrier ID: AX418715




285 +34.162816, -118.092271

Photos for Barrier ID: AX418715



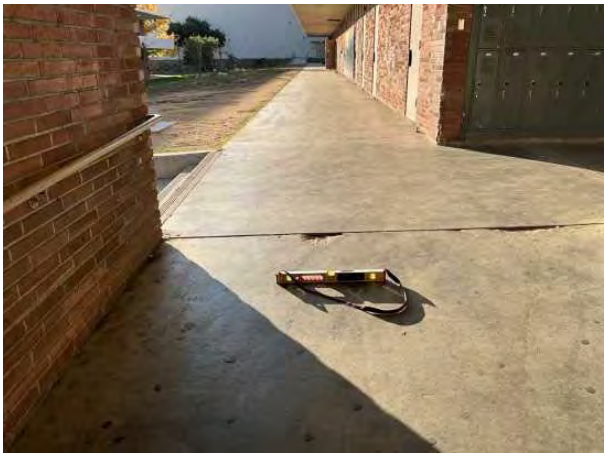



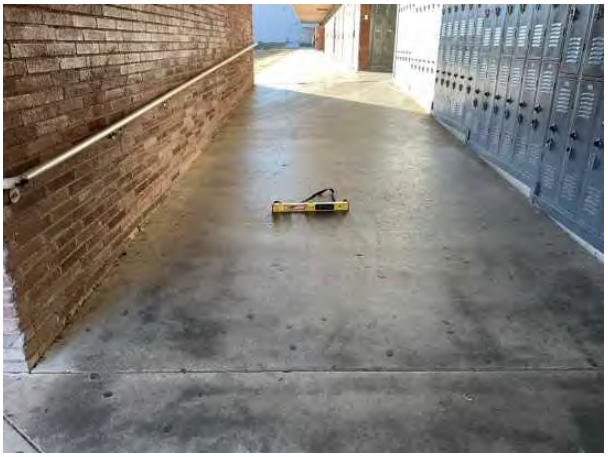

Barrier ID: AX418716

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	302.3
Barrier Detail	The ramp has openings in the surface greater than 1/2".
Location Description	Ramp R10 Between Building H & North Side
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The ramp has two cracks in the concrete, creating an abrupt change in level up to 1 inch high.

Resolution


Repair ramp so that all openings in the surface are less than or equal to 1/2" in width. Openings in ground surface shall not permit the passage of a sphere more than 1/2" in diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.

Quantity

10 SF

Priority	1

Map for Barrier ID: AX418716

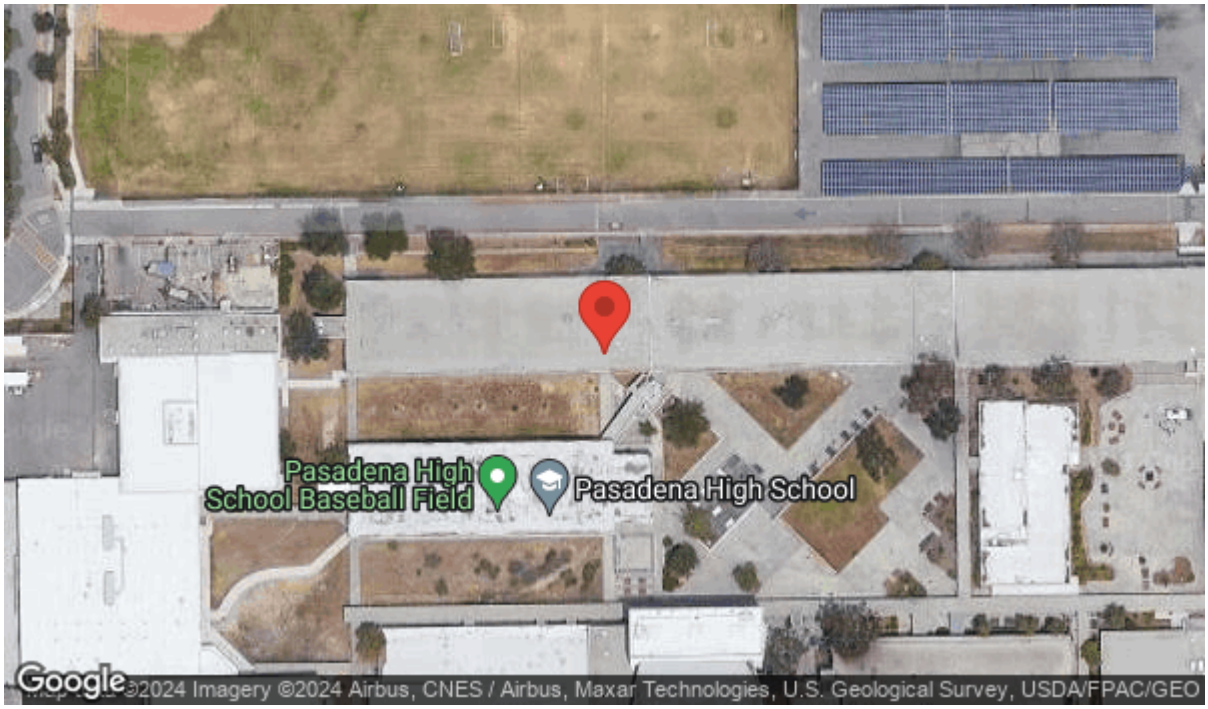

286 +34.162876, -118.092366

Photos for Barrier ID: AX418716







Barrier ID: AX418717

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	405.3
Barrier Detail	The ramp has cross slopes in excess of 1:48 (2.08%).
Location Description	Ramp R11 East Side of T107 Gym
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp has a running slope of 9% for a length of 5' x 6' wide.

Resolution

The ramp should be removed and an accessible ramp should be installed. Ramp runs shall have a cross slope not steeper than 1:48. Ramp runs shall have a running slope not steeper than 1:12. [EXCEPTION: In existing sites, buildings, and facilities built pre 1/26/92, ramps shall be permitted to have running slopes steeper than 1:12 where such slopes are necessary due to space limitations. Where slopes are steeper than 1:10 but not steeper than 1:8, the rise shall be 3" maximum. Where slopes are steeper than 1:12 but not steeper than 1:10, the rise shall be 6" maximum.]

Quantity

5 LF

Priority	1


Map for Barrier ID: AX418717



287 +34.162813, -118.093192

Photos for Barrier ID: AX418717



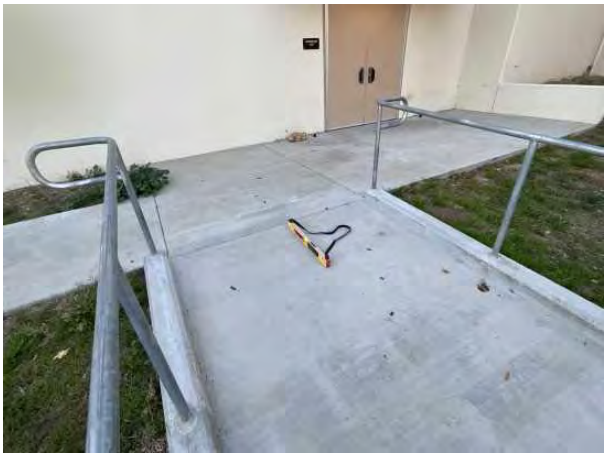

Barrier ID: AX419757

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-403.5.1,505
Barrier Detail	CALIFORNIA: The exterior ramp railings are not compliant.
Location Description	Ramp R12 Between Building H & I North Side 2nd Floor
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp does not provide handrails.

Resolution

Provide compliant handrails on both sides of the ramp. [EXCEPTION: At door landings, handrails are not required on ramp runs less than 6" rise or 72" in length.] The handrails on each side shall be a minimum 48" apart horizontally. The top of the gripping surface of the handrail shall be 34" minimum and 38" maximum vertical above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. The gripping surface of handrails shall be 1.25" to 2" diameter, or a non-circular grip that has a perimeter dimension of 4" to 6.25" maximum. Provide a bottom rail that is maximum 4" from the ramp surface and prevents the passage of a 4" diameter sphere between the ramp surface and the rail. Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1.Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of ramp runs. Ramp handrails shall extend horizontally above the landing for 12" minimum beyond the top and bottom of ramp runs. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent ramp run. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, where the extension of the handrail in the direction of the ramp run would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of the ramp run.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

62 LF


Priority 1

Map for Barrier ID: AX419757



343 +34.163081, -118.092239

Photos for Barrier ID: AX419757

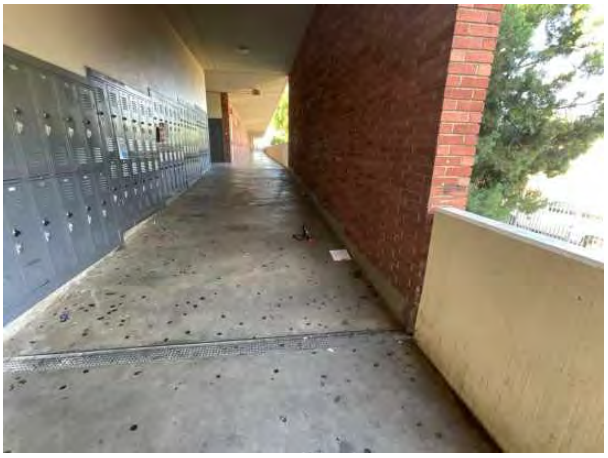

Barrier ID: AX419759

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-403.5.1,505
Barrier Detail	CALIFORNIA: The exterior ramp railings are not compliant.
Location Description	Ramp R13 Between Building H & I South Side 2nd Floor
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The ramp has a running slopes up to 6.7% for a length of 31 feet by 10 feet wide.

Resolution


Provide compliant handrails on both sides of the ramp. [EXCEPTION: At door landings, handrails are not required on ramp runs less than 6" rise or 72" in length.] The handrails on each side shall be a minimum 48" apart horizontally. The top of the gripping surface of the handrail shall be 34" minimum and 38" maximum vertical above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. The gripping surface of handrails shall be 1.25" to 2" diameter, or a non-circular grip that has a perimeter dimension of 4" to 6.25" maximum. Provide a bottom rail that is maximum 4" from the ramp surface and prevents the passage of a 4" diameter sphere between the ramp surface and the rail. Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1.Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of ramp runs. Ramp handrails shall extend horizontally above the landing for 12" minimum beyond the top and bottom of ramp runs. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent ramp run. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, where the extension of the handrail in the direction of the ramp run would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of the ramp run.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

62 LF

Priority 1

Map for Barrier ID: AX419759

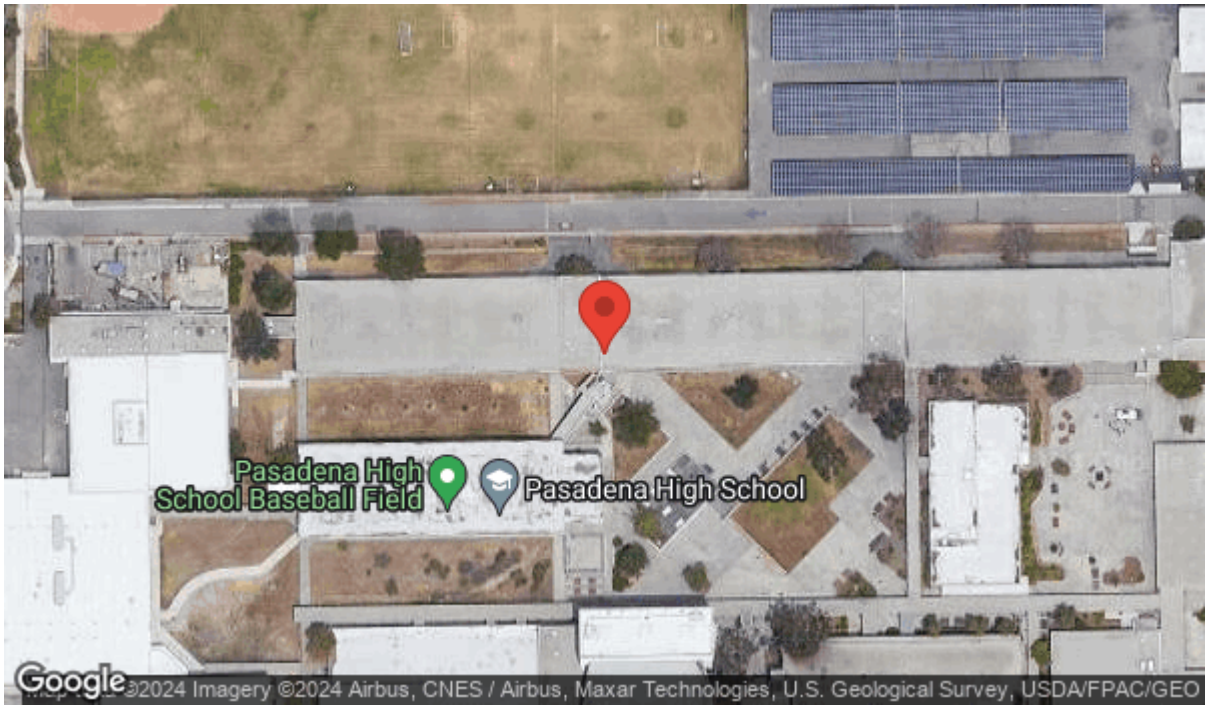


345 +34.162874, -118.092236

Photos for Barrier ID: AX419759





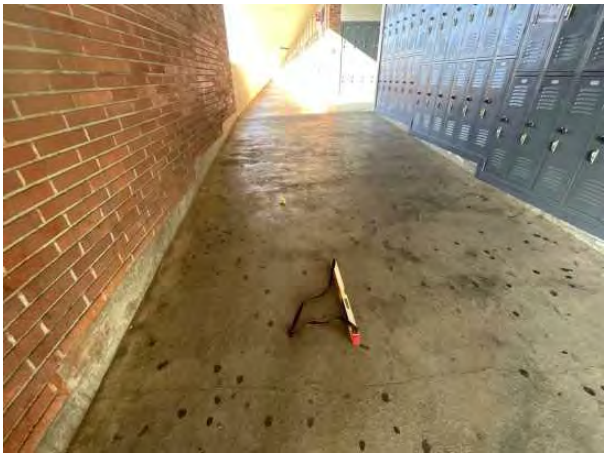



Barrier ID: AX419798

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-405
Barrier Detail	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.
Location Description	Ramp R14 South East Corner of Building E
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp slopes up to 9.4% for a length of 10 feet by 6 feet wide.

Resolution


The ramp should be removed and an accessible ramp should be installed. Ramp runs shall have a running slope not steeper than 1:12. Cross slopes shall not be steeper than 1:48. The maximum rise of a ramp run shall be 30". The ramp shall have 48" minimum clear width. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, and min. 60" wide and at least as wide as the ramp run. Ramp landings at the top of ramps shall be 60" minimum by 60" minimum. Ramp landings located between ramp runs, where landings are not at a turn in direction shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" min. wide by 72" min. length in the direction of downward travel from the upper ramp run. Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. Ramps and their approaches shall be designed so that water will not accumulate on walking surfaces. All ramp runs shall have handrails on each side of the ramp. [Exception: A door landings, handrails are not required on ramp runs less than 6" in rise or minimum 72" in length.]

Quantity

10 LF


Priority	1

Map for Barrier ID: AX419798

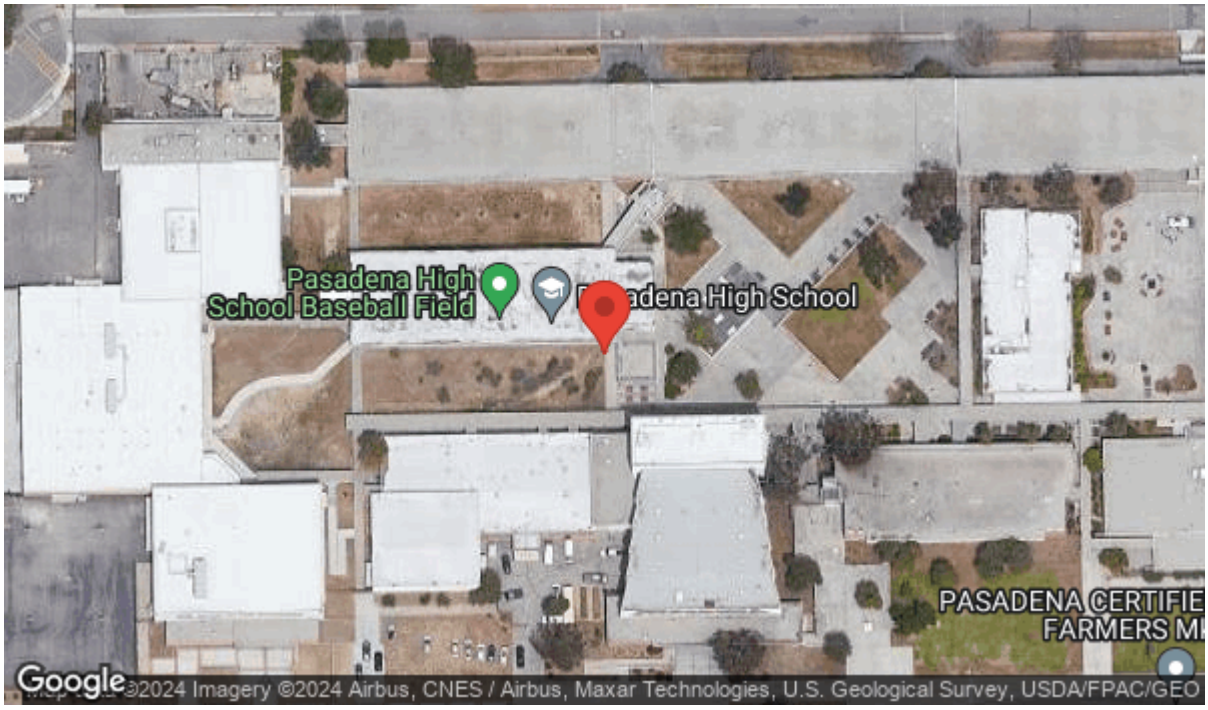

384 +34.162450, -118.092372

Photos for Barrier ID: AX419798

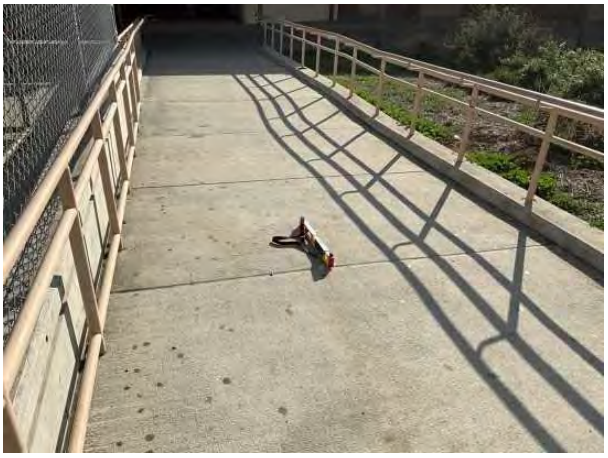



Barrier ID: AX419799

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-405.7
Barrier Detail	CALIFORNIA: The ramp landings are not compliant.
Location Description	Ramp R14 South East Corner of Building E
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The intermediate landing slopes up to 4.3% and the bottom landing slopes 3.3%.

Resolution


Install compliant ramp landings. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, minimum 60" wide, and at least as wide as the ramp run. Ramp landings at the top of the ramp shall be 60" minimum length and 60" minimum wide. Ramp landings in the middle of the ramp, where landings are not at a turn shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" minimum wide by 72" minimum length in the direction of downward travel from the upper ramp run. The maximum rise of a ramp run shall be 30". Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. [Exception: Slopes not steeper than 1:48 shall be permitted.]

Quantity

11 LF

Priority	1

Map for Barrier ID: AX419799

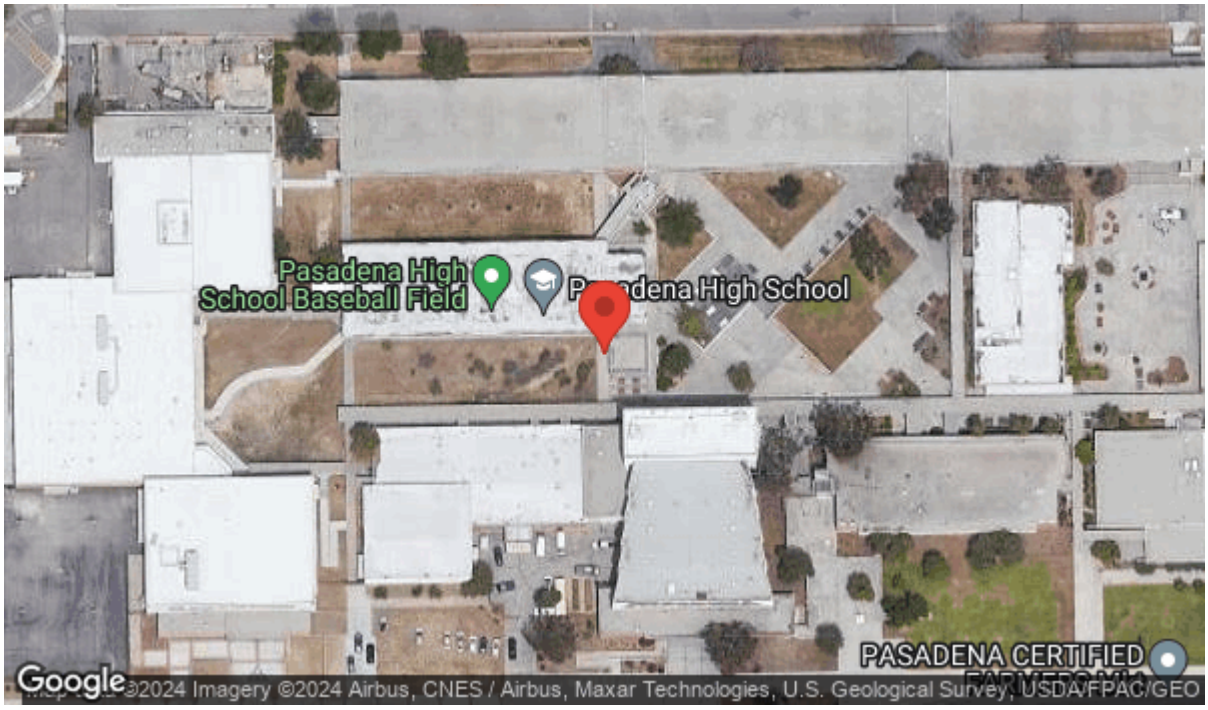


385 +34.162429, -118.092350

Photos for Barrier ID: AX419799







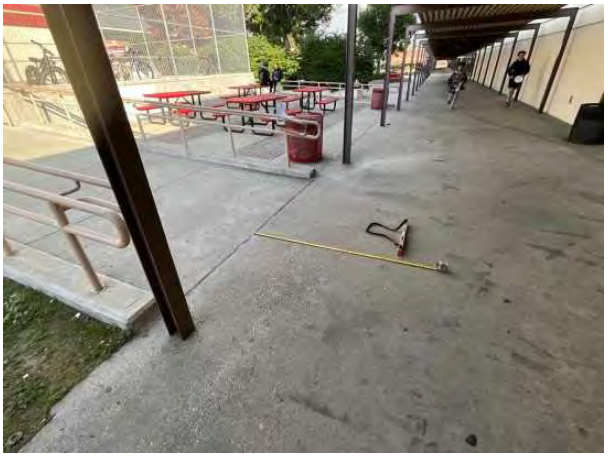





Barrier ID: AX419802

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-405.7
Barrier Detail	CALIFORNIA: The ramp landings are not compliant.
Location Description	Ramp R15 North of R107 Gym
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The bottom landing slopes up to 4.3%.

Resolution

Install compliant ramp landings. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, minimum 60" wide, and at least as wide as the ramp run. Ramp landings at the top of the ramp shall be 60" minimum length and 60" minimum wide. Ramp landings in the middle of the ramp, where landings are not at a turn shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" minimum wide by 72" minimum length in the direction of downward travel from the upper ramp run. The maximum rise of a ramp run shall be 30". Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. [Exception: Slopes not steeper than 1:48 shall be permitted.]

Quantity

6 LF


Priority	1


Map for Barrier ID: AX419802



388 +34.162216, -118.093145

Photos for Barrier ID: AX419802

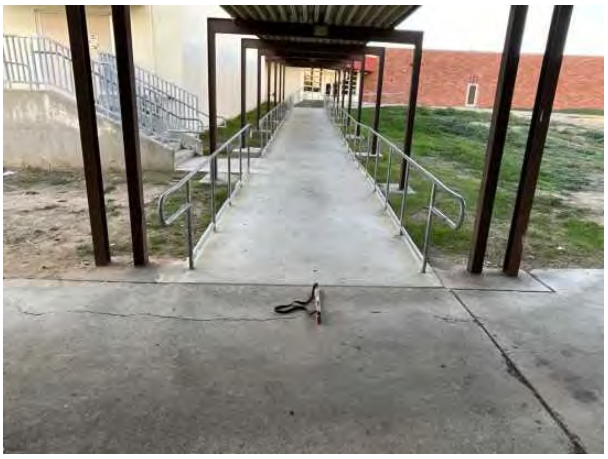

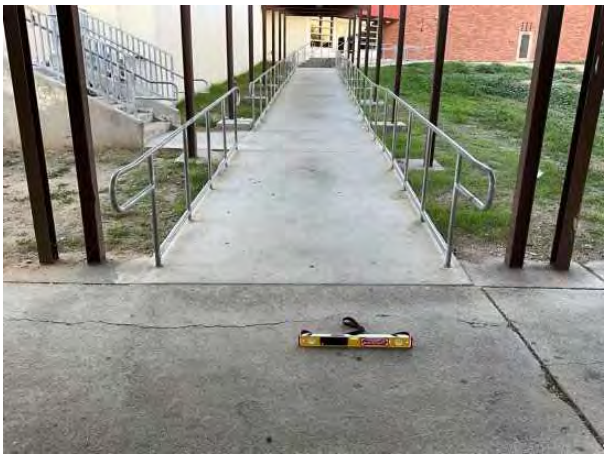





Barrier ID: AX424538

Pasadena High School BUILDING U

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-403.5.1,505
Barrier Detail	CALIFORNIA: The exterior ramp railings are not compliant.
Location Description	Ramp R16 At Building U Entrance
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp does not provide compliant handrails with edge protection.

Resolution

Provide compliant handrails on both sides of the ramp. [EXCEPTION: At door landings, handrails are not required on ramp runs less than 6" rise or 72" in length.] The handrails on each side shall be a minimum 48" apart horizontally. The top of the gripping surface of the handrail shall be 34" minimum and 38" maximum vertical above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. The gripping surface of handrails shall be 1.25" to 2" diameter, or a non-circular grip that has a perimeter dimension of 4" to 6.25" maximum. Provide a bottom rail that is maximum 4" from the ramp surface and prevents the passage of a 4" diameter sphere between the ramp surface and the rail. Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1.Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of ramp runs. Ramp handrails shall extend horizontally above the landing for 12" minimum beyond the top and bottom of ramp runs. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent ramp run. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, where the extension of the handrail in the direction of the ramp run would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of the ramp run.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

50 LF

Priority 1

Map for Barrier ID: AX424538



784 +34.162958, -118.093499

Photos for Barrier ID: AX424538





Barrier ID: AX418222

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-405
Barrier Detail	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.
Location Description	Ramp R2
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp has a running slope of 9.0% toward the top for the length of 5 feet.

Resolution

The ramp should be removed and an accessible ramp should be installed. Ramp runs shall have a running slope not steeper than 1:12. Cross slopes shall not be steeper than 1:48. The maximum rise of a ramp run shall be 30". The ramp shall have 48" minimum clear width. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, and min. 60" wide and at least as wide as the ramp run. Ramp landings at the top of ramps shall be 60" minimum by 60" minimum. Ramp landings located between ramp runs, where landings are not at a turn in direction shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" min. wide by 72" min. length in the direction of downward travel from the upper ramp run. Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. Ramps and their approaches shall be designed so that water will not accumulate on walking surfaces. All ramp runs shall have handrails on each side of the ramp. [Exception: A door landings, handrails are not required on ramp runs less than 6" in rise or minimum 72" in length.]

Quantity

5 LF

Priority	1

Map for Barrier ID: AX418222



33 +34.161801, -118.093383

Photos for Barrier ID: AX418222





Barrier ID: AX418224

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-405
Barrier Detail	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.
Location Description	Ramp R3 in Front of Auditorium
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The upper portion of the ramp has running slopes up to 9.2%.

Resolution


The ramp should be removed and an accessible ramp should be installed. Ramp runs shall have a running slope not steeper than 1:12. Cross slopes shall not be steeper than 1:48. The maximum rise of a ramp run shall be 30". The ramp shall have 48" minimum clear width. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, and min. 60" wide and at least as wide as the ramp run. Ramp landings at the top of ramps shall be 60" minimum by 60" minimum. Ramp landings located between ramp runs, where landings are not at a turn in direction shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" min. wide by 72" min. length in the direction of downward travel from the upper ramp run. Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. Ramps and their approaches shall be designed so that water will not accumulate on walking surfaces. All ramp runs shall have handrails on each side of the ramp. [Exception: A door landings, handrails are not required on ramp runs less than 6" in rise or minimum 72" in length.]

Quantity

20 LF

Priority	1

Map for Barrier ID: AX418224

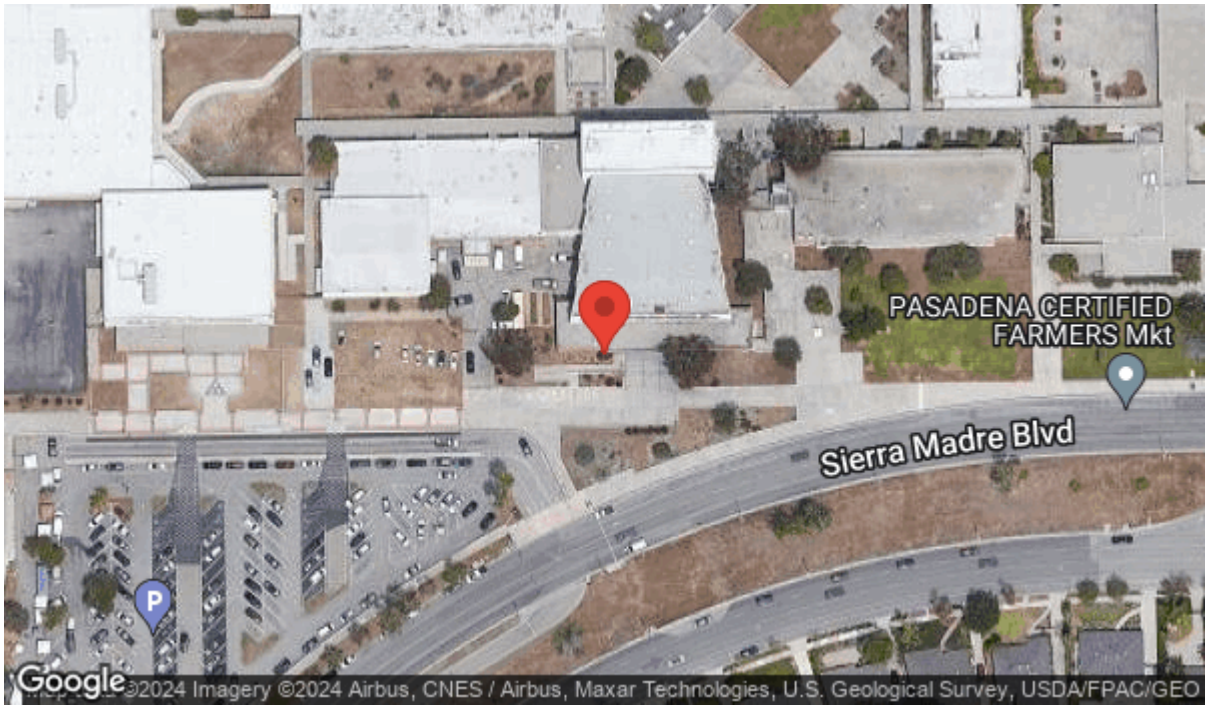


35 +34.161795, -118.092241

Photos for Barrier ID: AX418224





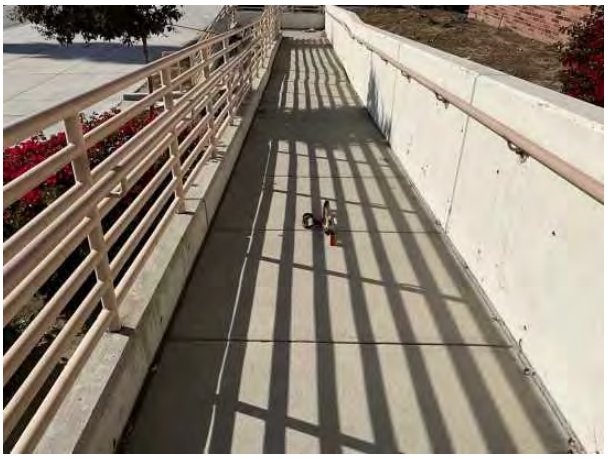



Barrier ID: AX418225

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-505.10.1

Barrier Detail

CALIFORNIA: The exterior ramp railings do not extend 12" horizontally above the landing beyond the top and bottom of the ramp runs and in the same direction of the ramp run.

Location Description	Ramp R3 in Front of Auditorium
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	One of the handrail extensions extends 4 inches.

Resolution


Install compliant ramp railings. The handrails shall extend 12" horizontally above the landing beyond the top and bottom of ramp runs and in the same direction of the ramp run. The rail extensions shall return to a wall, guard, or to the landing surface, or continuous to the handrail of an adjacent ramp run. EXCEPTION: In alterations, where the extension of the handrail in the direction of the ramp run would create a hazard, the extension may be turned 90 degrees from the direction of the ramp run.

Quantity

1 LF

Priority	1

Map for Barrier ID: AX418225

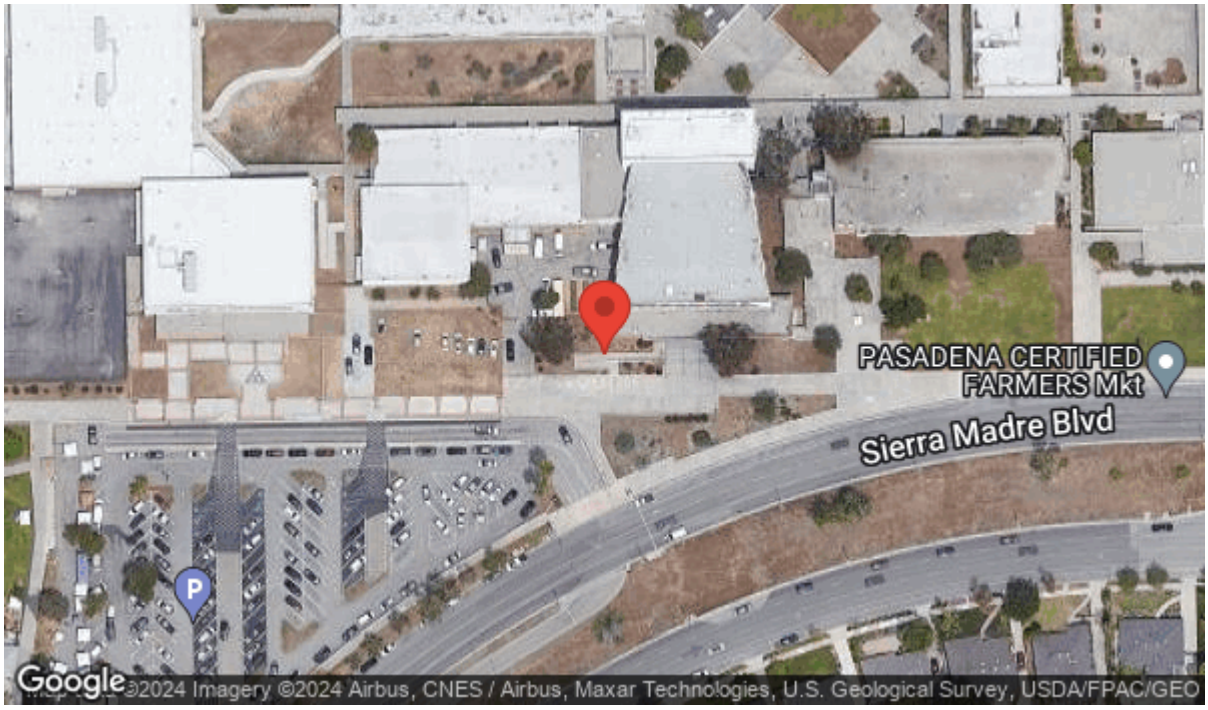

36 +34.161768, -118.092348

Photos for Barrier ID: AX418225





Barrier ID: AX418358

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-405.7
Barrier Detail	CALIFORNIA: The ramp landings are not compliant.
Location Description	Ramp R4 South Side of Building F
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The bottom landing slopes, 3.7%.

Resolution


Install compliant ramp landings. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, minimum 60" wide, and at least as wide as the ramp run. Ramp landings at the top of the ramp shall be 60" minimum length and 60" minimum wide. Ramp landings in the middle of the ramp, where landings are not at a turn shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" minimum wide by 72" minimum length in the direction of downward travel from the upper ramp run. The maximum rise of a ramp run shall be 30". Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. [Exception: Slopes not steeper than 1:48 shall be permitted.]

Quantity

5 LF

Priority	1

Map for Barrier ID: AX418358

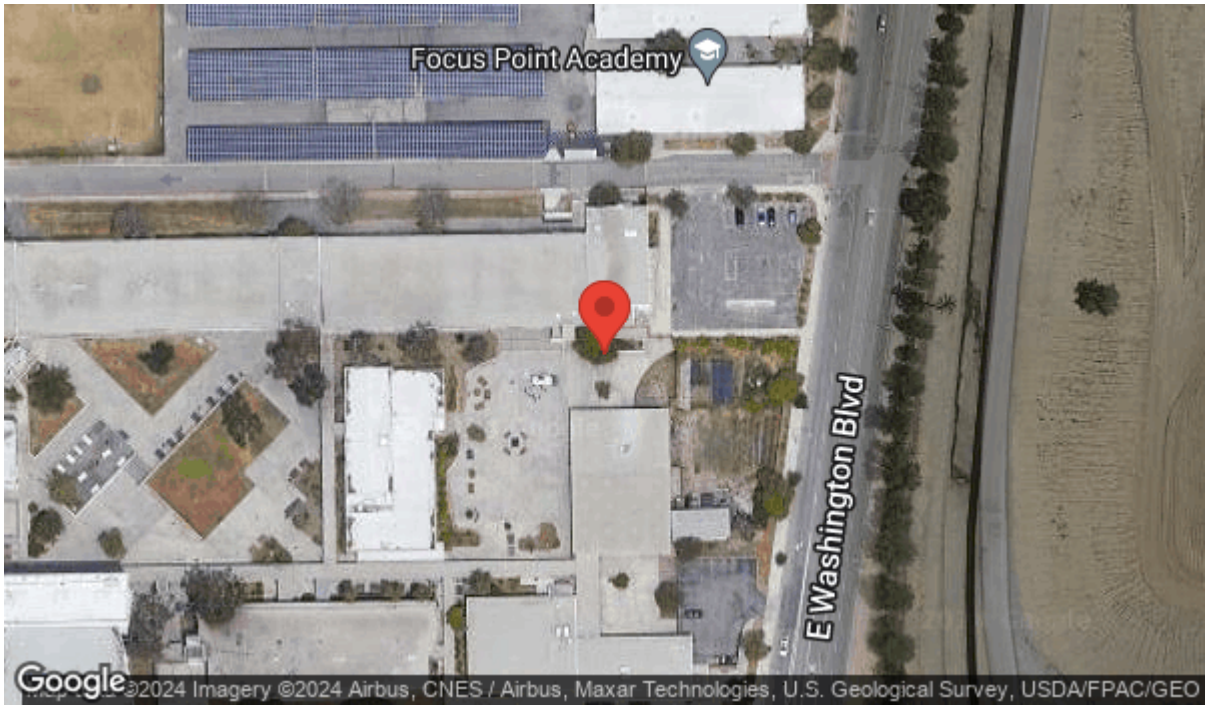


169 +34.162801, -118.090670

Photos for Barrier ID: AX418358







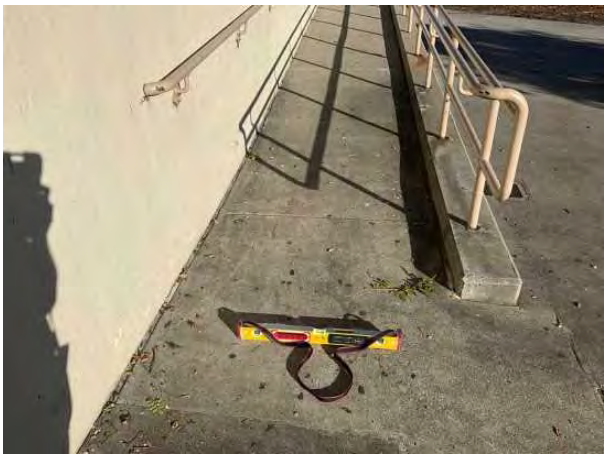

Barrier ID: AX418360

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-405.7
Barrier Detail	CALIFORNIA: The ramp landings are not compliant.
Location Description	Ramp R4 South Side of Building F
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The bottom landing extends 5 feet.

Resolution


Install compliant ramp landings. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, minimum 60" wide, and at least as wide as the ramp run. Ramp landings at the top of the ramp shall be 60" minimum length and 60" minimum wide. Ramp landings in the middle of the ramp, where landings are not at a turn shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" minimum wide by 72" minimum length in the direction of downward travel from the upper ramp run. The maximum rise of a ramp run shall be 30". Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. [Exception: Slopes not steeper than 1:48 shall be permitted.]

Quantity

6 LF


Priority	1

Map for Barrier ID: AX418360

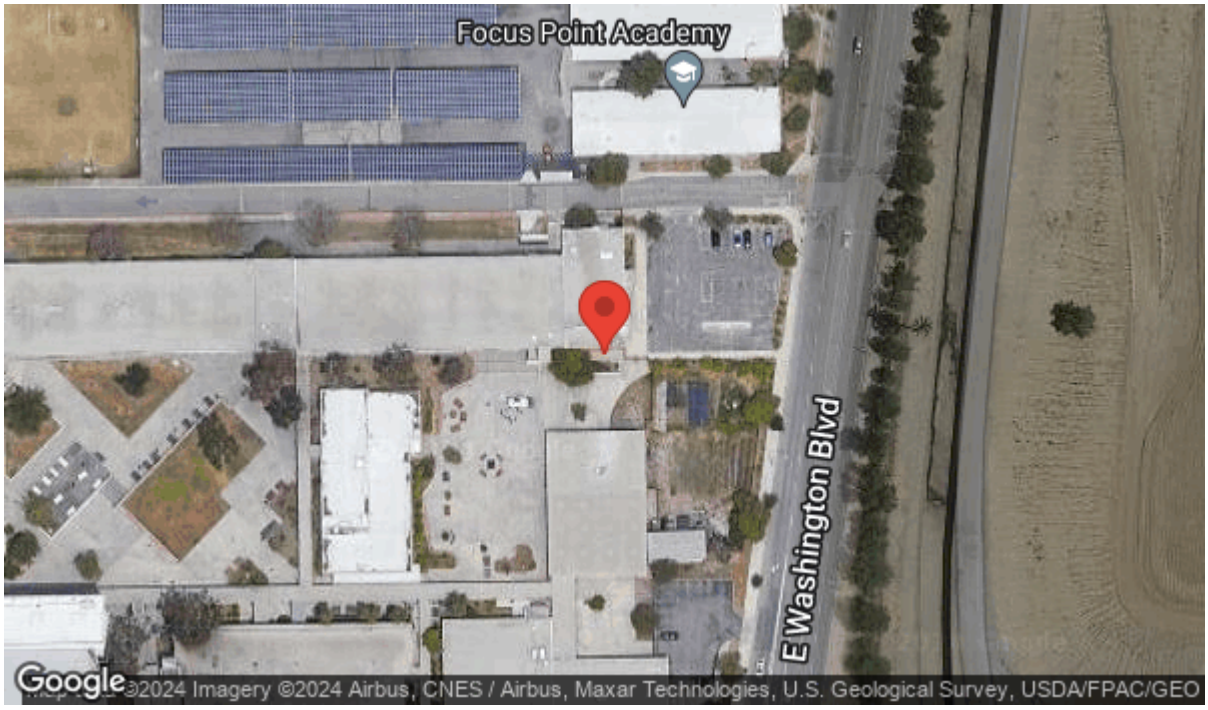


171 +34.162847, -118.090604

Photos for Barrier ID: AX418360

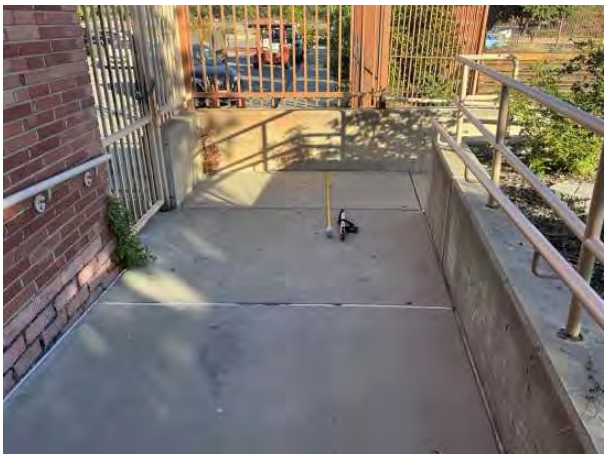



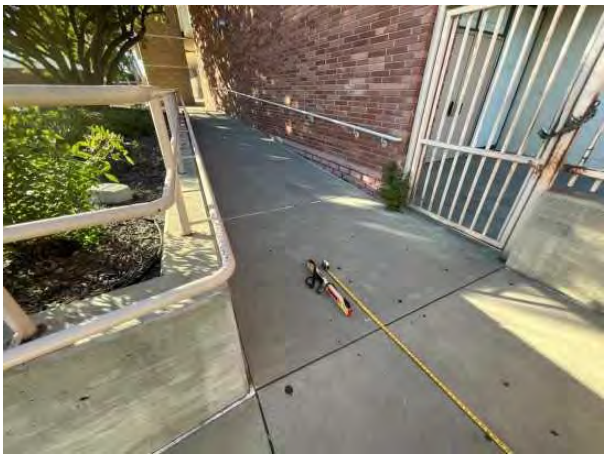

Barrier ID: AX418361

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-505.10.1

Barrier Detail

CALIFORNIA: The exterior ramp railings do not extend 12" horizontally above the landing beyond the top and bottom of the ramp runs and in the same direction of the ramp run.

Location Description	Ramp R4 South Side of Building F
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp handrails do not continue the full length of the ramp run.

Resolution

Install compliant ramp railings. The handrails shall extend 12" horizontally above the landing beyond the top and bottom of ramp runs and in the same direction of the ramp run. The rail extensions shall return to a wall, guard, or to the landing surface, or continuous to the handrail of an adjacent ramp run. EXCEPTION: In alterations, where the extension of the handrail in the direction of the ramp run would create a hazard, the extension may be turned 90 degrees from the direction of the ramp run.

Quantity

5 LF


Priority	1

Map for Barrier ID: AX418361



172 +34.162867, -118.090579

Photos for Barrier ID: AX418361

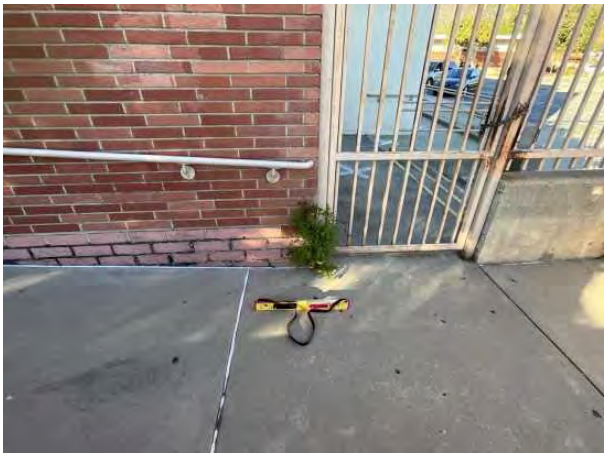



Barrier ID: AX418362

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-405.7
Barrier Detail	CALIFORNIA: The ramp landings are not compliant.
Location Description	Ramp R4 South Side of Building F
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp does not provide a 60 x 60" top landing.

Resolution


Install compliant ramp landings. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, minimum 60" wide, and at least as wide as the ramp run. Ramp landings at the top of the ramp shall be 60" minimum length and 60" minimum wide. Ramp landings in the middle of the ramp, where landings are not at a turn shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" minimum wide by 72" minimum length in the direction of downward travel from the upper ramp run. The maximum rise of a ramp run shall be 30". Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. [Exception: Slopes not steeper than 1:48 shall be permitted.]

Quantity

5 LF

Priority	1

Map for Barrier ID: AX418362

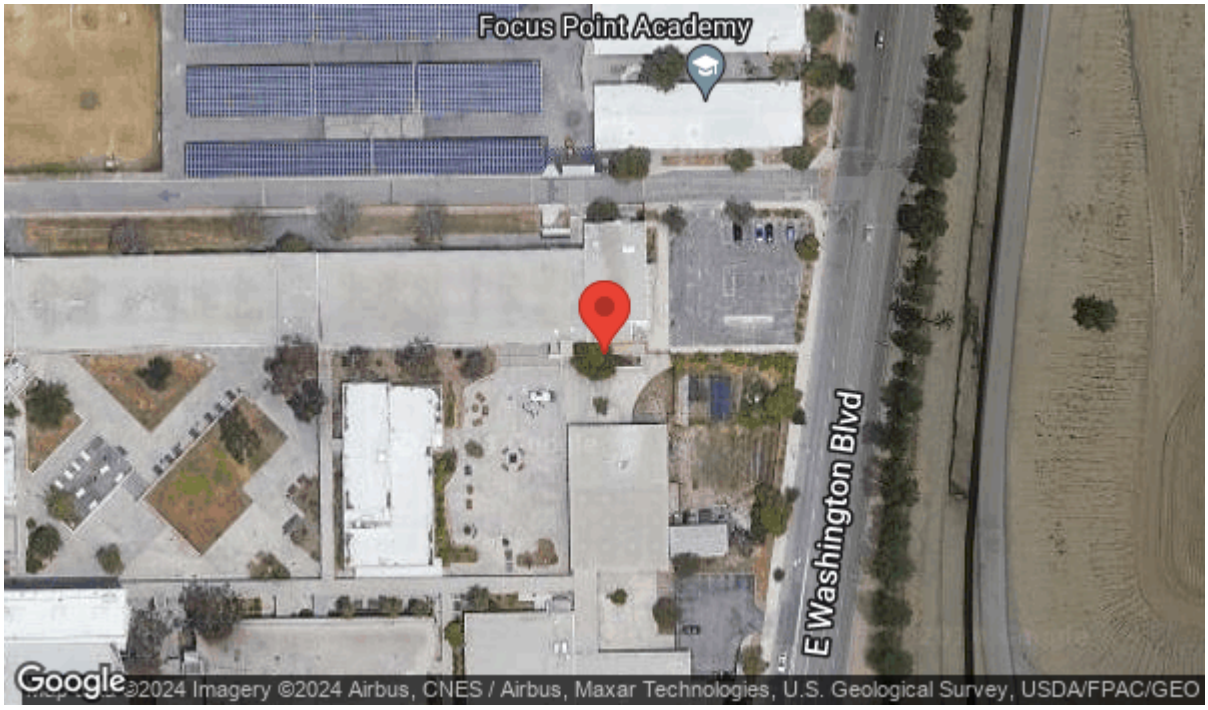

173 +34.162836, -118.090663

Photos for Barrier ID: AX418362







Barrier ID: AX418636

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-403.5.1,505
Barrier Detail	CALIFORNIA: The exterior ramp railings are not compliant.
Location Description	Ramp R5 Northwest Side of Building N
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The ramp does not provide handrails on both sides, and does not provide the required extensions.

Resolution


Provide compliant handrails on both sides of the ramp. [EXCEPTION: At door landings, handrails are not required on ramp runs less than 6" rise or 72" in length.] The handrails on each side shall be a minimum 48" apart horizontally. The top of the gripping surface of the handrail shall be 34" minimum and 38" maximum vertical above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. The gripping surface of handrails shall be 1.25" to 2" diameter, or a non-circular grip that has a perimeter dimension of 4" to 6.25" maximum. Provide a bottom rail that is maximum 4" from the ramp surface and prevents the passage of a 4" diameter sphere between the ramp surface and the rail. Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1.Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of ramp runs. Ramp handrails shall extend horizontally above the landing for 12" minimum beyond the top and bottom of ramp runs. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent ramp run. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, where the extension of the handrail in the direction of the ramp run would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of the ramp run.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

20 LF

Priority 1

Map for Barrier ID: AX418636

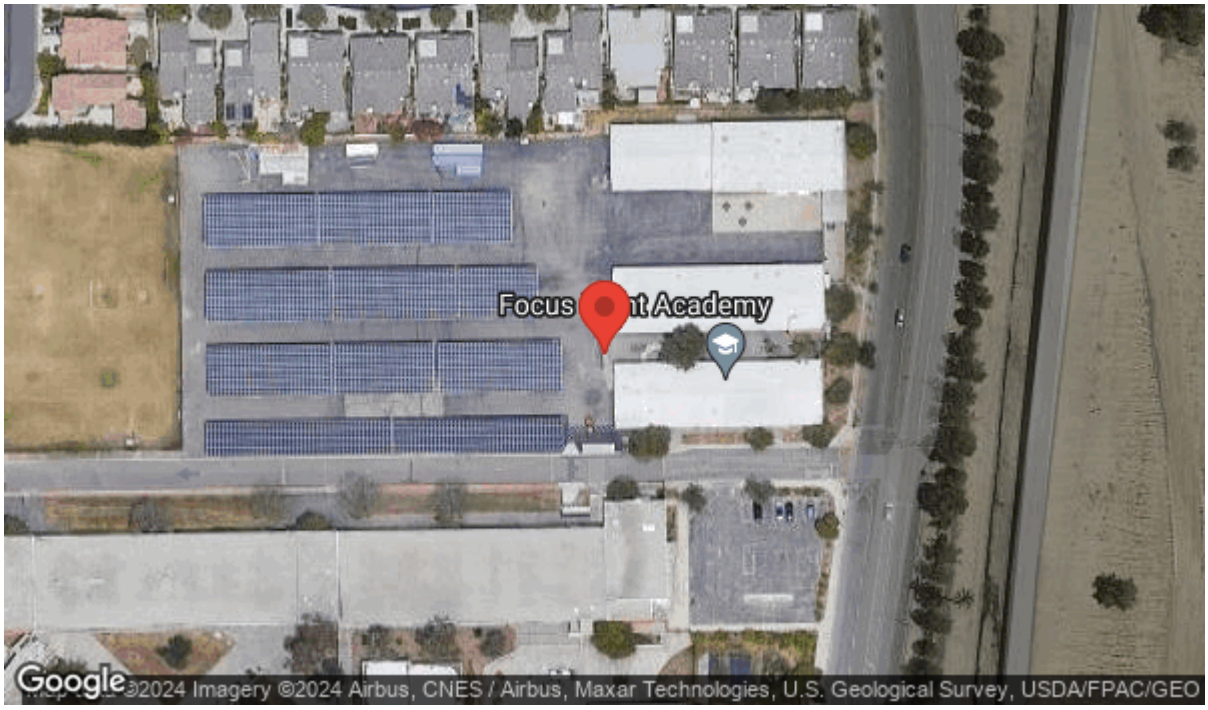


206 +34.163450, -118.090715

Photos for Barrier ID: AX418636





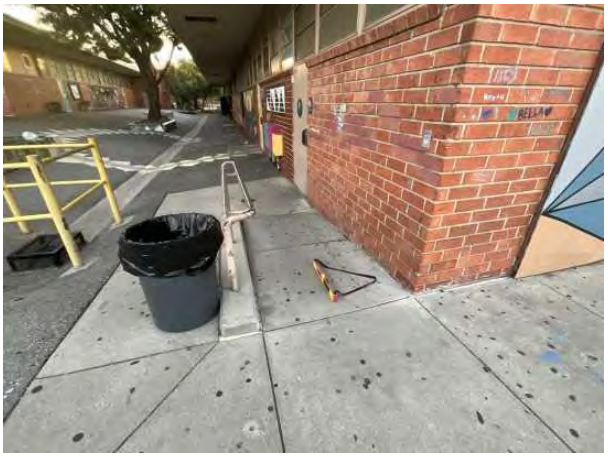

Barrier ID: AX418637

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-405.5 Exception 2; 405.8 Exception 4

Barrier Detail

CALIFORNIA: The exterior ramp railings extend more than 3-1/2" into the ramp clear width.

Location Description	Ramp R5 Northwest Side of Building N
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door swings into the ramp landing 100%.

Resolution

Install compliant ramp railings. Handrails shall extend 3-1/2" max. on each side into the required 48" minimum clear width. EXCEPTION: At door landings, railings not required on ramp runs less than 6" rise, or 72" in length.

Quantity

3 LF

Priority	1


Map for Barrier ID: AX418637



207 +34.163502, -118.090687

Photos for Barrier ID: AX418637



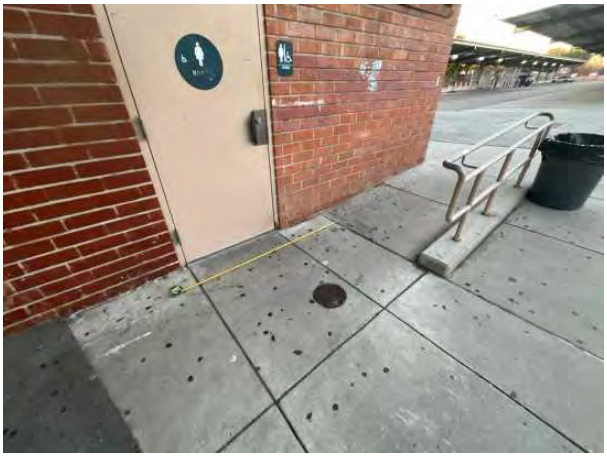



Barrier ID: AX418662

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-505.10.1

Barrier Detail

CALIFORNIA: The exterior ramp railings do not extend 12" horizontally above the landing beyond the top and bottom of the ramp runs and in the same direction of the ramp run.

Location Description	Ramp R6 Between Building N & P
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The ramp does not provide the required top and bottom 12 inch horizontal extensions.

Resolution


Install compliant ramp railings. The handrails shall extend 12" horizontally above the landing beyond the top and bottom of ramp runs and in the same direction of the ramp run. The rail extensions shall return to a wall, guard, or to the landing surface, or continuous to the handrail of an adjacent ramp run. EXCEPTION: In alterations, where the extension of the handrail in the direction of the ramp run would create a hazard, the extension may be turned 90 degrees from the direction of the ramp run.

Quantity

4 LF


Priority	1


Map for Barrier ID: AX418662

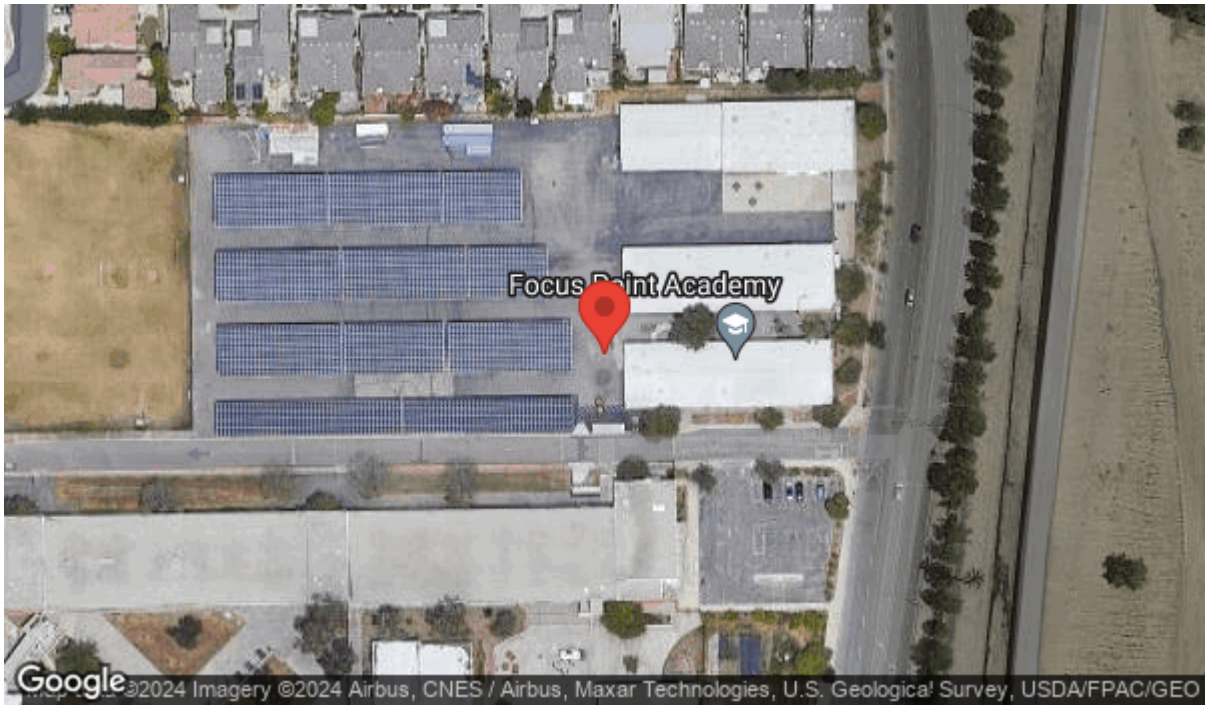

232 +34.163408, -118.090742

Photos for Barrier ID: AX418662

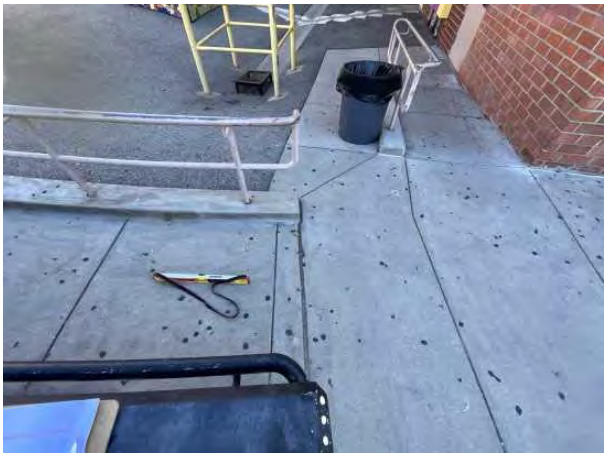

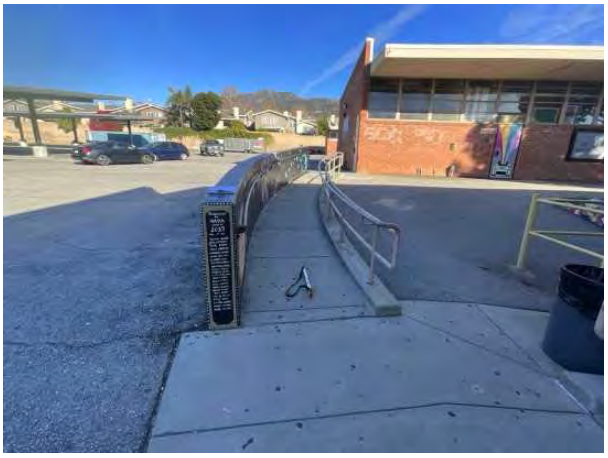



Barrier ID: AX418663

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	405.7

Barrier Detail

The ramp changes direction, but does not have a 60" minimum by 60" minimum landing at the change in direction.

Location Description	Ramp R6 Between Building N & P
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp is curved and changes directions without intermediate landings.

Resolution


The ramp should be removed and an accessible ramp should be installed. Landings at change in direction shall be 60" minimum by 60" minimum. Landings shall have slopes not steeper than 1:48 in any direction. Ramp runs shall have a running slope not steeper than 1:12, and a cross slope not steeper than 1:48. [EXCEPTION: In existing sites, buildings, and facilities built pre 1/26/92, ramps shall be permitted to have running slopes steeper than 1:12 where such slopes are necessary due to space limitations. Where slopes are steeper than 1:10 but not steeper than 1:8, the rise shall be 3" maximum. Where slopes are steeper than 1:12 but not steeper than 1:10, the rise shall be 6" maximum.]

Quantity

15 EA

Priority	1

Map for Barrier ID: AX418663

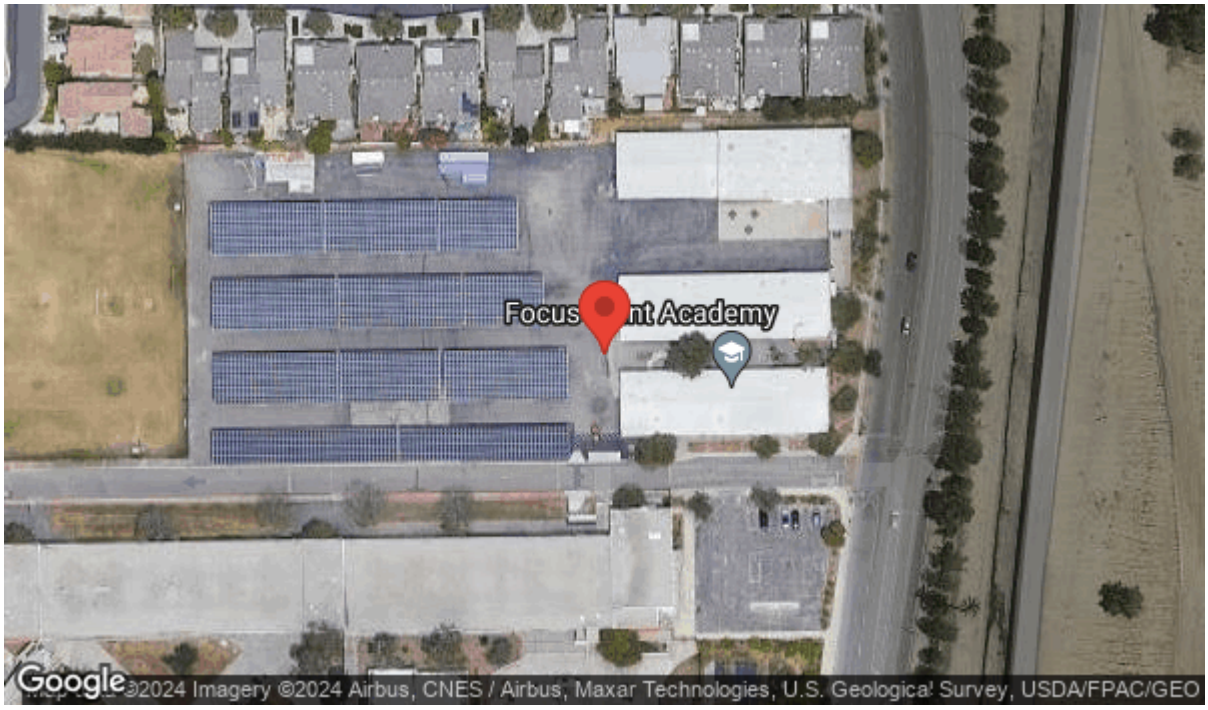

233 +34.163468, -118.090731

Photos for Barrier ID: AX418663



Barrier ID: AX418708

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-403.5.1,505
Barrier Detail	CALIFORNIA: The exterior ramp railings are not compliant.
Location Description	Ramp R7 Between Building G & H South Side
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The sloped walk between buildings G and H on the north side has running slopes between 7.3 and 7.6% and does not provide handrails. The ramp length is 31 feet by 10 feet wide.

Resolution


Provide compliant handrails on both sides of the ramp. [EXCEPTION: At door landings, handrails are not required on ramp runs less than 6" rise or 72" in length.] The handrails on each side shall be a minimum 48" apart horizontally. The top of the gripping surface of the handrail shall be 34" minimum and 38" maximum vertical above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. The gripping surface of handrails shall be 1.25" to 2" diameter, or a non-circular grip that has a perimeter dimension of 4" to 6.25" maximum. Provide a bottom rail that is maximum 4" from the ramp surface and prevents the passage of a 4" diameter sphere between the ramp surface and the rail. Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1.Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of ramp runs. Ramp handrails shall extend horizontally above the landing for 12" minimum beyond the top and bottom of ramp runs. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent ramp run. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, where the extension of the handrail in the direction of the ramp run would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of the ramp run.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

62 LF


Priority 1

Map for Barrier ID: AX418708

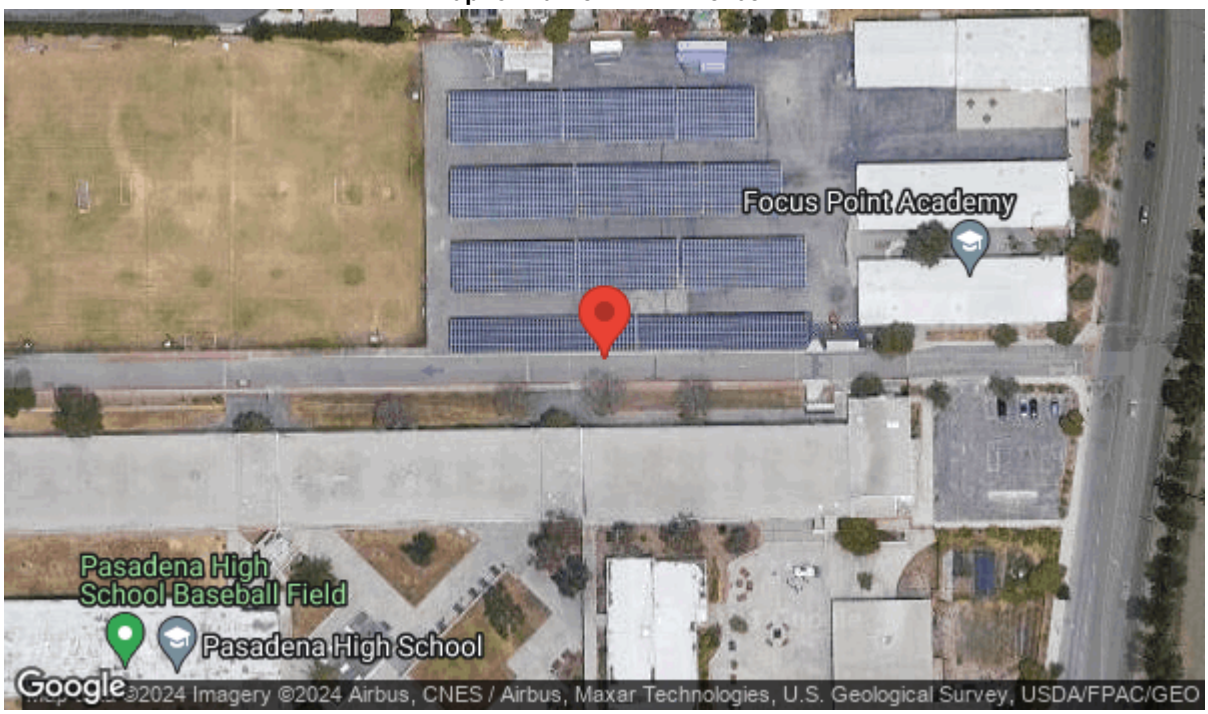

278 +34.163214, -118.091372

Photos for Barrier ID: AX418708

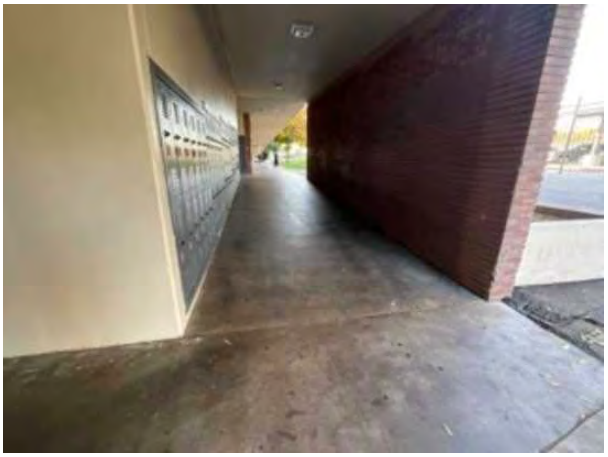

Barrier ID: AX418709

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-403.5.1,505
Barrier Detail	CALIFORNIA: The exterior ramp railings are not compliant or not provided.
Location Description	Ramp R8 Between Building G & H North Side
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp slopes 6.5% to 7.3% and does not provide handrails on both sides.

Resolution


Provide compliant handrails on both sides of the ramp. [EXCEPTION: At door landings, handrails are not required on ramp runs less than 6" rise or 72" in length.] The handrails on each side shall be a minimum 48" apart horizontally. The top of the gripping surface of the handrail shall be 34" minimum and 38" maximum vertical above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. The gripping surface of handrails shall be 1.25" to 2" diameter, or a non-circular grip that has a perimeter dimension of 4" to 6.25" maximum. Provide a bottom rail that is maximum 4" from the ramp surface and prevents the passage of a 4" diameter sphere between the ramp surface and the rail. Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1.Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of ramp runs. Ramp handrails shall extend horizontally above the landing for 12" minimum beyond the top and bottom of ramp runs. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent ramp run. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, where the extension of the handrail in the direction of the ramp run would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of the ramp run.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

31 LF


Priority 1


Map for Barrier ID: AX418709

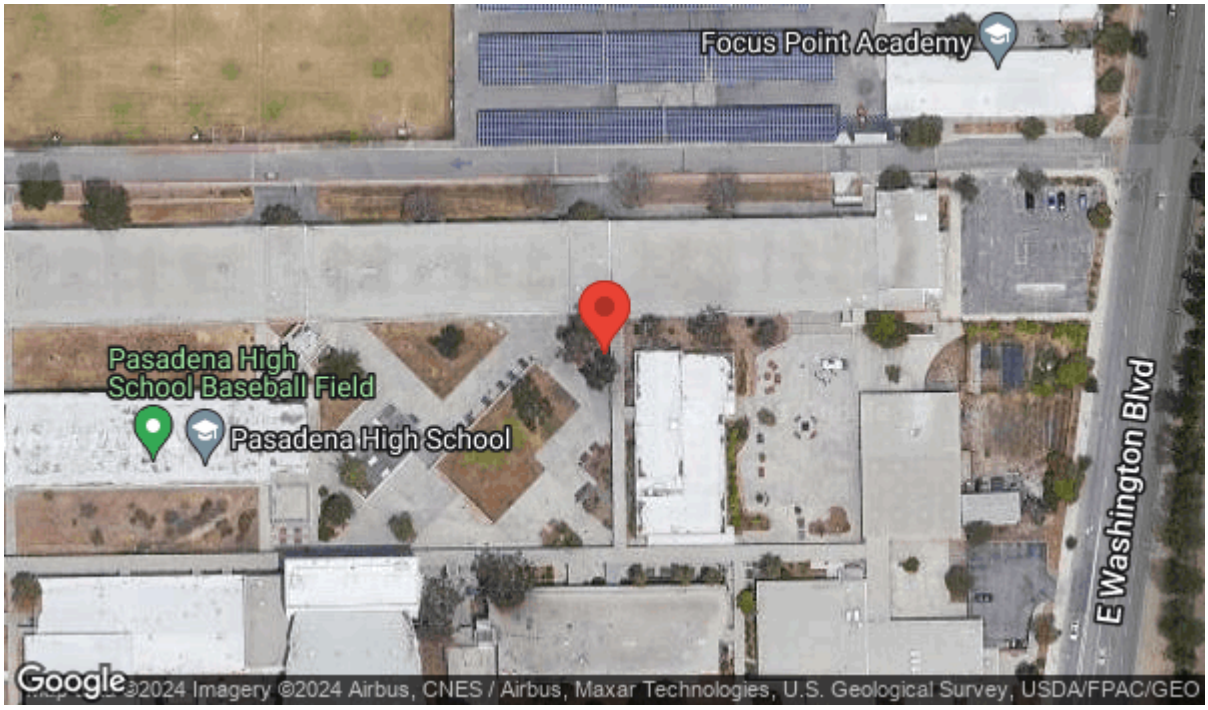

279 +34.162763, -118.091448

Photos for Barrier ID: AX418709

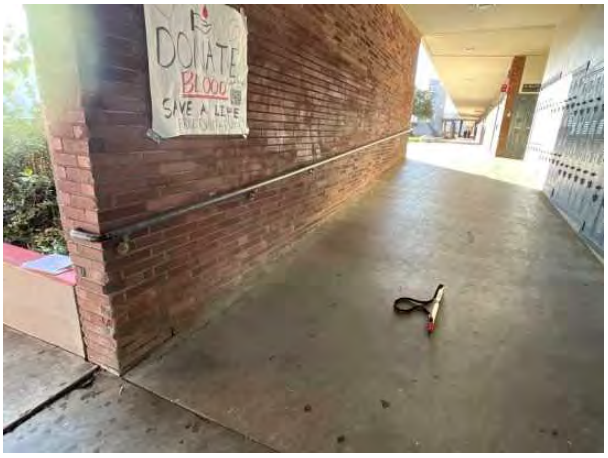

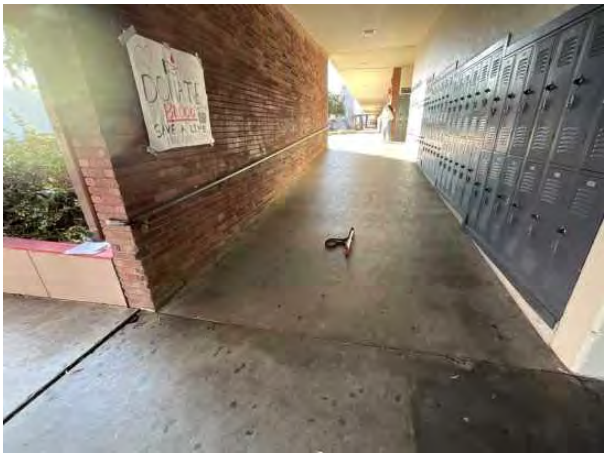

Barrier ID: AX418713

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-403.5.1,505
Barrier Detail	CALIFORNIA: The exterior ramp railings are not compliant.
Location Description	Ramp R9 Between Building H & I South Side
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp slopes, 6.8 percent to 7.6% and no handrails are provided.

Resolution

Provide compliant handrails on both sides of the ramp. [EXCEPTION: At door landings, handrails are not required on ramp runs less than 6" rise or 72" in length.] The handrails on each side shall be a minimum 48" apart horizontally. The top of the gripping surface of the handrail shall be 34" minimum and 38" maximum vertical above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. The gripping surface of handrails shall be 1.25" to 2" diameter, or a non-circular grip that has a perimeter dimension of 4" to 6.25" maximum. Provide a bottom rail that is maximum 4" from the ramp surface and prevents the passage of a 4" diameter sphere between the ramp surface and the rail. Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above ramp surfaces. Handrails shall be at a consistent height above ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1.Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of ramp runs. Ramp handrails shall extend horizontally above the landing for 12" minimum beyond the top and bottom of ramp runs. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent ramp run. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, where the extension of the handrail in the direction of the ramp run would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of the ramp run.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

62 LF

Priority 1


Map for Barrier ID: AX418713




283 +34.163201, -118.092260

Photos for Barrier ID: AX418713



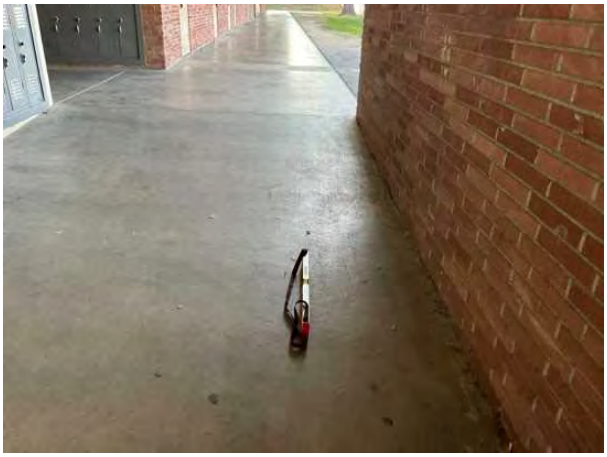

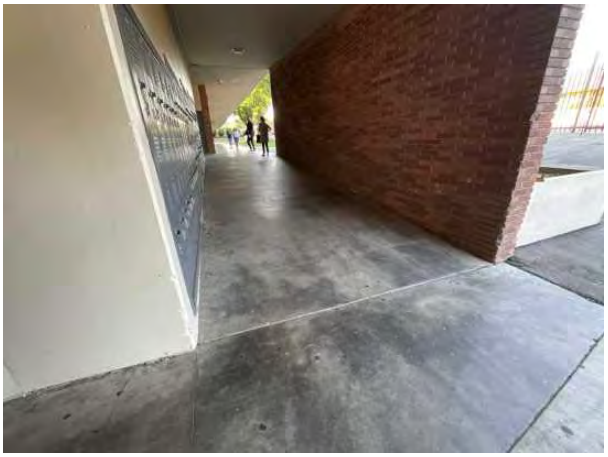



Barrier ID: AX418377

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-405
Barrier Detail	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.
Location Description	Ramp South Side of Building D
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp has a running slope up to 10.6% for a length of 15 feet.

Resolution


The ramp should be removed and an accessible ramp should be installed. Ramp runs shall have a running slope not steeper than 1:12. Cross slopes shall not be steeper than 1:48. The maximum rise of a ramp run shall be 30". The ramp shall have 48" minimum clear width. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, and min. 60" wide and at least as wide as the ramp run. Ramp landings at the top of ramps shall be 60" minimum by 60" minimum. Ramp landings located between ramp runs, where landings are not at a turn in direction shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" min. wide by 72" min. length in the direction of downward travel from the upper ramp run. Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. Ramps and their approaches shall be designed so that water will not accumulate on walking surfaces. All ramp runs shall have handrails on each side of the ramp. [Exception: A door landings, handrails are not required on ramp runs less than 6" in rise or minimum 72" in length.]

Quantity

15 LF


Priority	1


Map for Barrier ID: AX418377

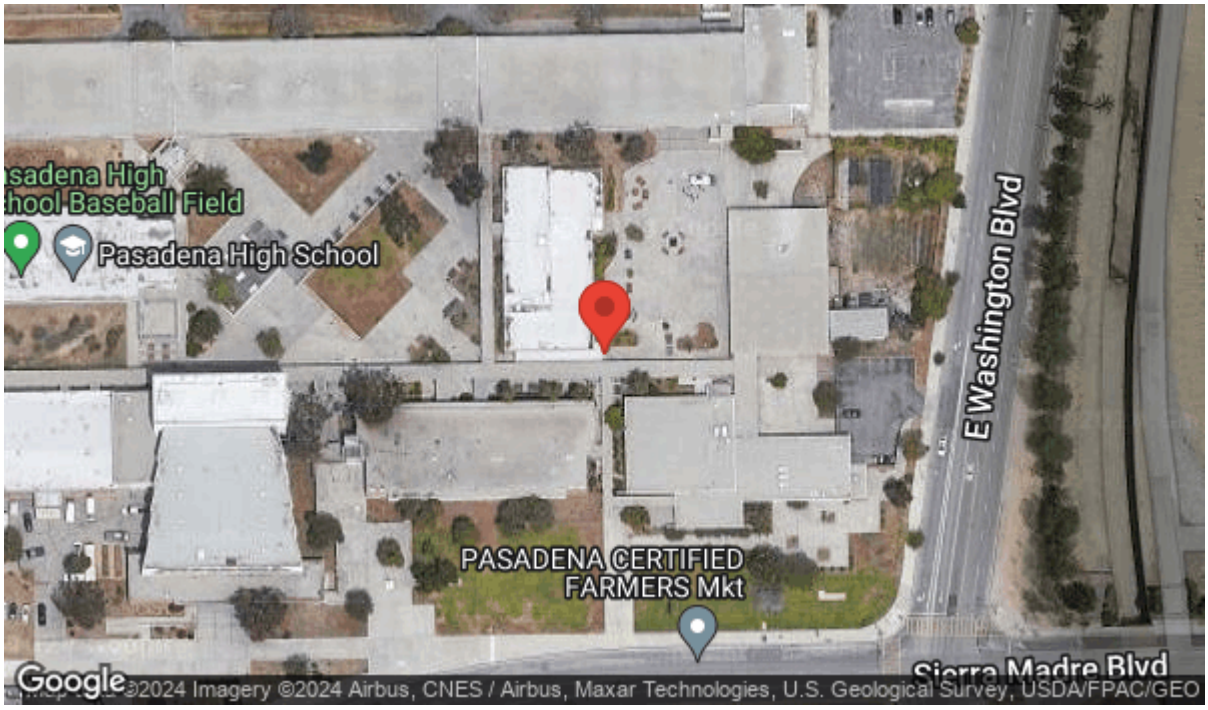


188 +34.162355, -118.091092


Photos for Barrier ID: AX418377

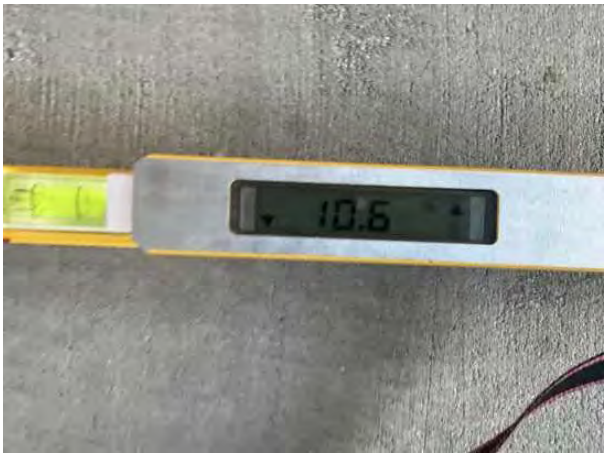

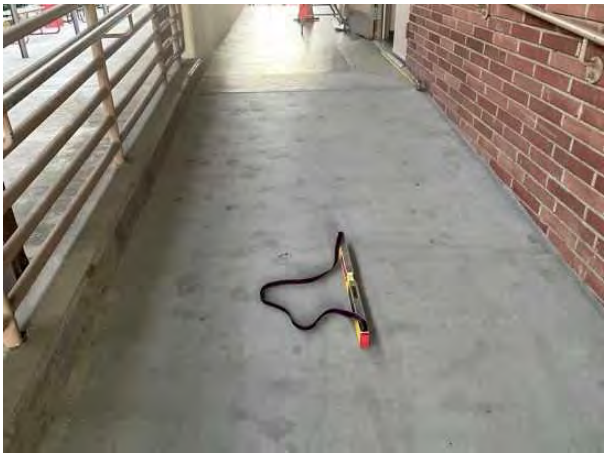



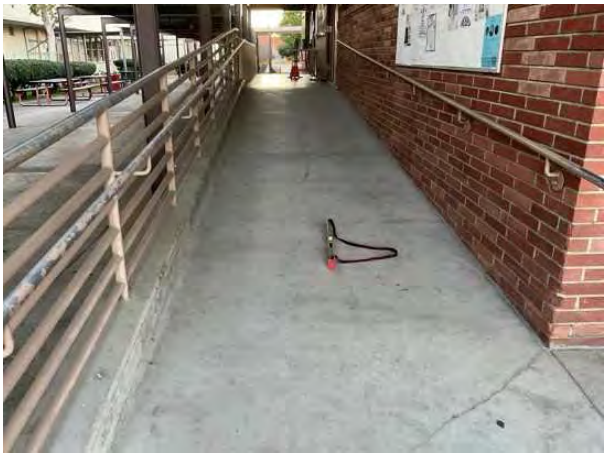

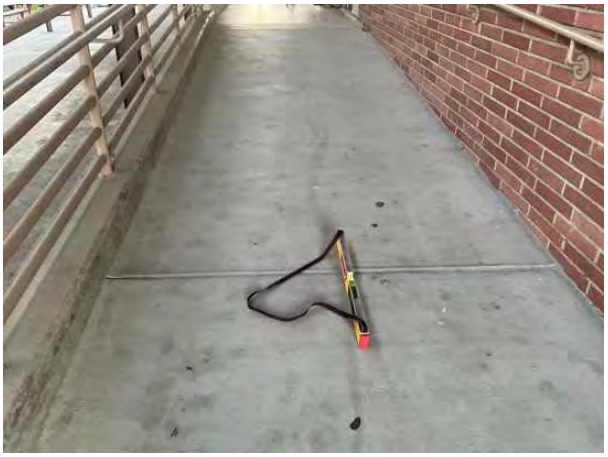



Barrier ID: AX418378

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-405.7

Barrier Detail

CALIFORNIA: The door which overlaps the ramp landing extends further than 3" maximum into the required landing size when fully open.

Location Description	Ramp South Side of Building D
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door overlaps the ramp landing by 5 1/2 inches

Resolution


Redesign the ramp landing and/or door so that the door extends maximum 3" over the required landing size when fully open. The door in any position shall allow min. 42" width and min. 42" depth of the landing.

Quantity

3 LF

Priority	1

Map for Barrier ID: AX418378

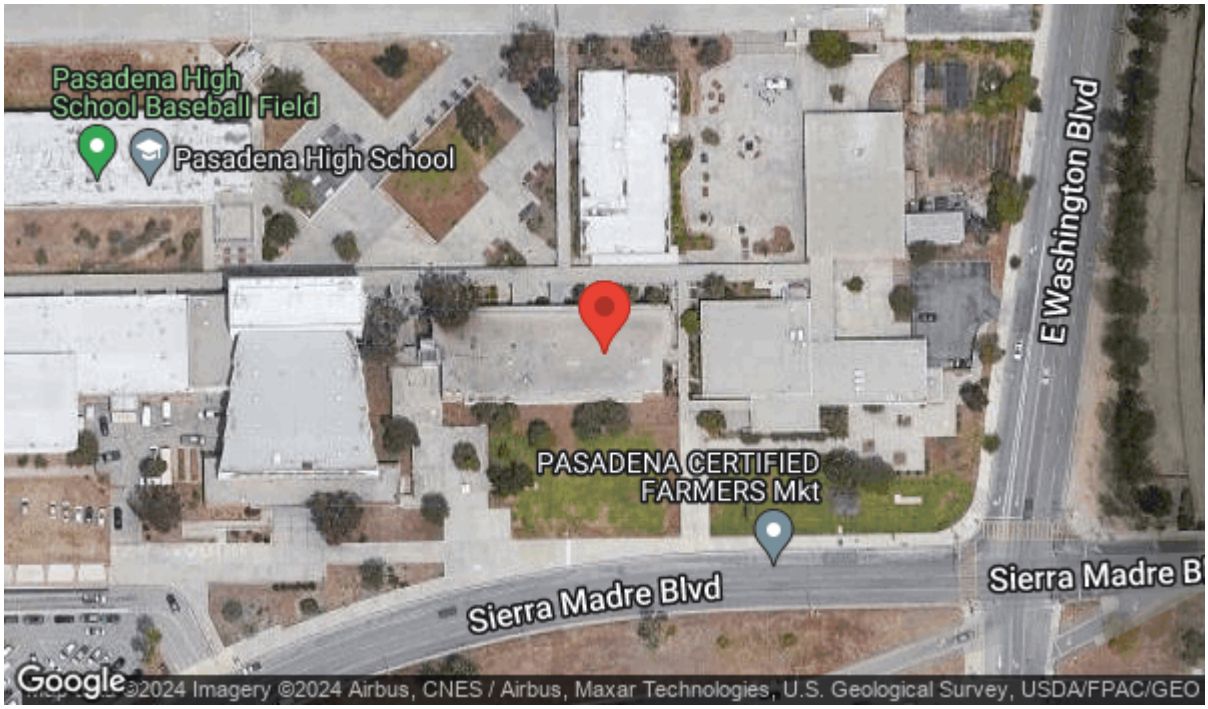

189 +34.162143, -118.091295

Photos for Barrier ID: AX418378





Barrier ID: AX418269

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Stairs
ADA Standard	CBC Chap 11B-505
Barrier Detail	CALIFORNIA: Handrails are not compliant or are not provided.
Location Description	Auditorium Stage Stairs
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	Both stairs do not provide handrails on both sides.

Resolution

Install handrails on both sides of all stairs that comply with guidelines. Handrails shall be provided on both sides of stairs. [Exception: In assembly areas, handrails shall not be required on both sides of aisle ramps where a handrail is provided at either side or within the aisle width.] Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above walking surfaces, stair nosings, and ramp surfaces. Handrails shall be at a consistent height above walking surfaces, stair nosings, and ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrails may be located in a recess if the recess is 3" maximum deep and 18" minimum clear above the top of the handrail. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1. Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of stair flights. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, full extensions of handrails shall not be required where such extensions would be hazardous due to plan configuration.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

25 LF

Priority 1

Photos for Barrier ID: AX418269









Barrier ID: AX420145

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Building E - Stairs East Side
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The top and bottom treads do not provide the contrasting stripe.

Resolution

Install visual contrast at the interior stair flight. The upper approach and lower tread shall be marked by a stripe providing clear visual contrast. The visual contrast shall be located at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from the nose of the step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.


Quantity

2 Riser

Priority	1

Photos for Barrier ID: AX420145



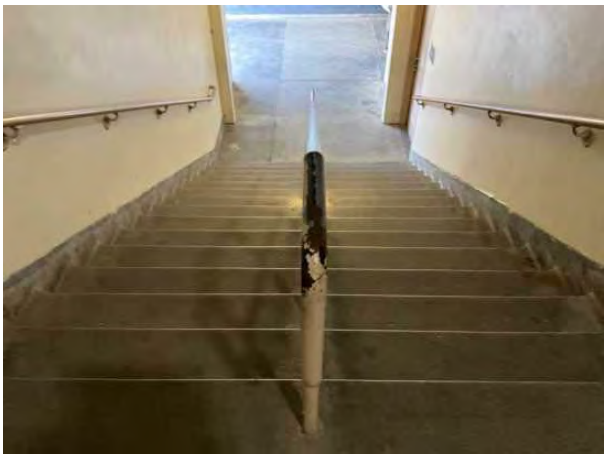

Barrier ID: AX419839

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Building E - Stairs West Side
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The top and bottom treads do not provide the contrasting stripe.

Resolution

Install visual contrast at the interior stair flight. The upper approach and lower tread shall be marked by a stripe providing clear visual contrast. The visual contrast shall be located at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from the nose of the step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

2 Riser

Priority	1

Photos for Barrier ID: AX419839





Barrier ID: AX418310

Pasadena High School BUILDING F

Assembly	Interior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Building F - Drinking Fountain Adjacent to F121 Women's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The top and bottom treads do not provide a contrasting stripe.

Resolution


Install visual contrast at the interior stair flight. The upper approach and lower tread shall be marked by a stripe providing clear visual contrast. The visual contrast shall be located at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from the nose of the step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

2 Riser

Priority	1

Photos for Barrier ID: AX418310

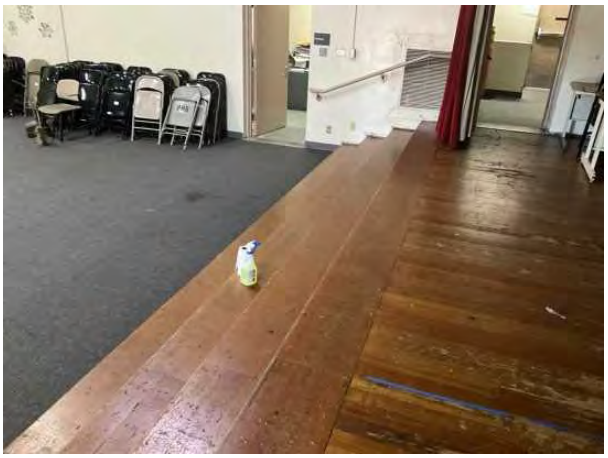



Barrier ID: AX418315

Pasadena High School BUILDING F

Assembly	Interior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Building F - Stairs Near F100 A Boys Dressing Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The top and bottom treads do not provide a contrasting stripe.

Resolution


Install visual contrast at the interior stair flight. The upper approach and lower tread shall be marked by a stripe providing clear visual contrast. The visual contrast shall be located at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from the nose of the step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

2 Riser

Priority	1

Photos for Barrier ID: AX418315

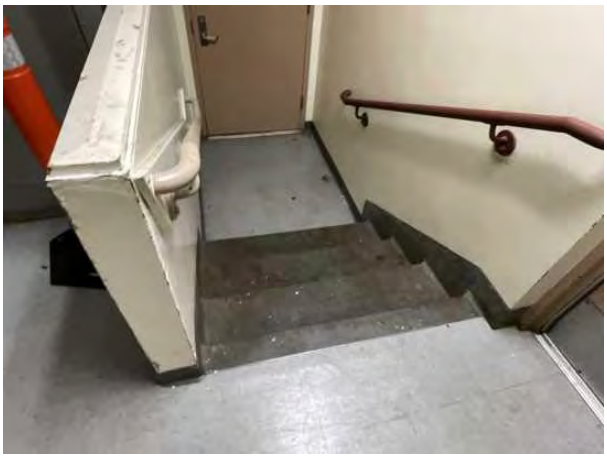

Barrier ID: AX418730

Pasadena High School BUILDING I

Assembly	Interior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Building I - Stairs Westend
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The stairs top and bottom treads paint is eroding.

Resolution


Install visual contrast at the interior stair flight. The upper approach and lower tread shall be marked by a stripe providing clear visual contrast. The visual contrast shall be located at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from the nose of the step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.


Quantity

2 Riser

Priority	1

Photos for Barrier ID: AX418730

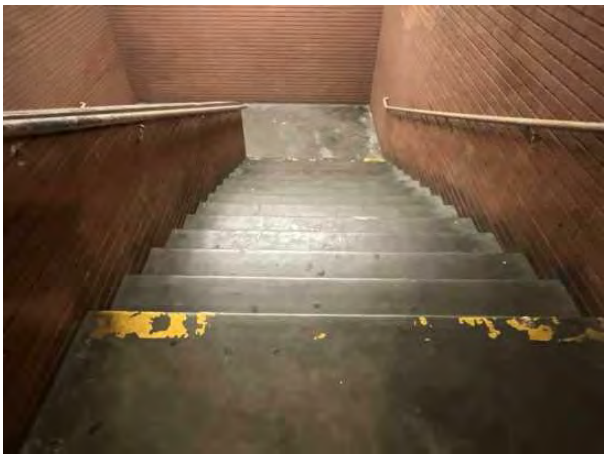

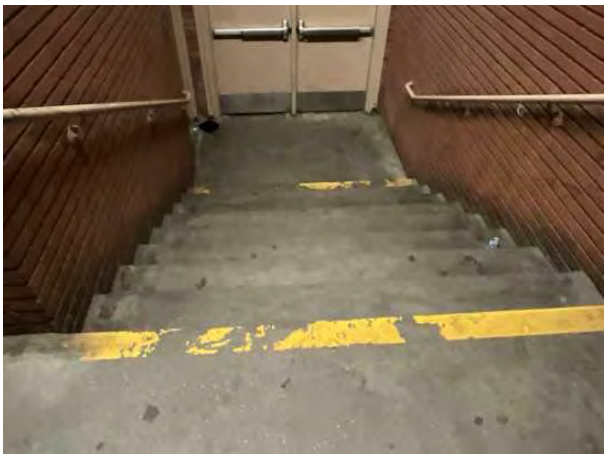

Barrier ID: AX419797

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	CBC Chap 11B-505
Barrier Detail	CALIFORNIA: Handrails are not compliant or are not provided.
Location Description	Ramp R14 South East Corner of Building E
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The ramp handrail does not extend the full length of the ramp plus the 12 inch extension. The handrail at the bottom do not extend 12 inches horizontally.

Resolution


Install handrails on both sides of all stairs that comply with guidelines. Handrails shall be provided on both sides of stairs. [Exception: In assembly areas, handrails shall not be required on both sides of aisle ramps where a handrail is provided at either side or within the aisle width.] Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above walking surfaces, stair nosings, and ramp surfaces. Handrails shall be at a consistent height above walking surfaces, stair nosings, and ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrails may be located in a recess if the recess is 3" maximum deep and 18" minimum clear above the top of the handrail. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1. Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of stair flights. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, full extensions of handrails shall not be required where such extensions would be hazardous due to plan configuration.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

10 LF

Priority 1


Map for Barrier ID: AX419797

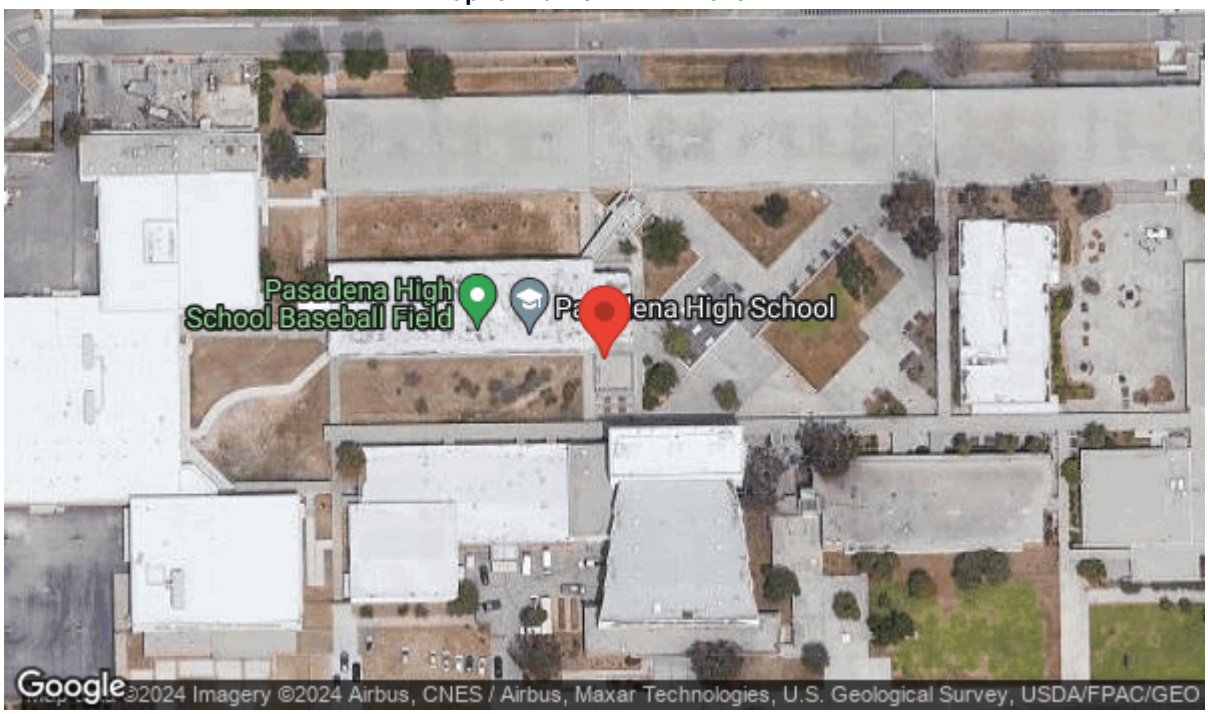


383 +34.162462, -118.092314

Photos for Barrier ID: AX419797



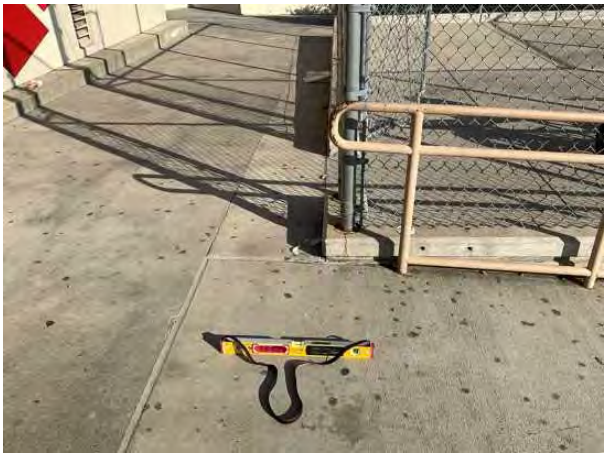

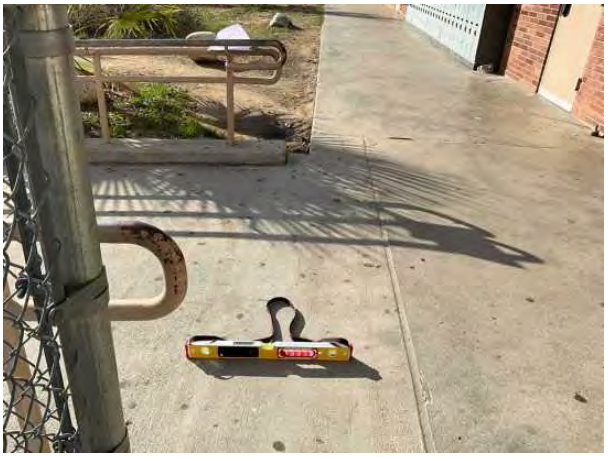



Barrier ID: AX419771

Pasadena High School GENERAL EXTERIOR

Assembly	Interior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stair K Building I Breezeway
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The contrasting stripe paint is eroding.

Resolution


Install visual contrast at the interior stair flight. The upper approach and lower tread shall be marked by a stripe providing clear visual contrast. The visual contrast shall be located at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from the nose of the step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.


Quantity

4 Riser

Priority	1

Photos for Barrier ID: AX419771

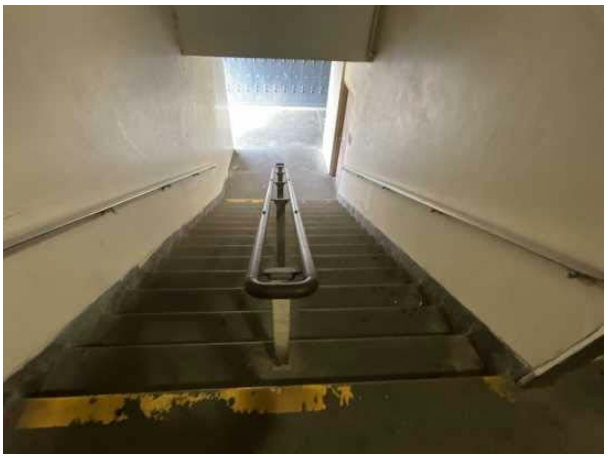

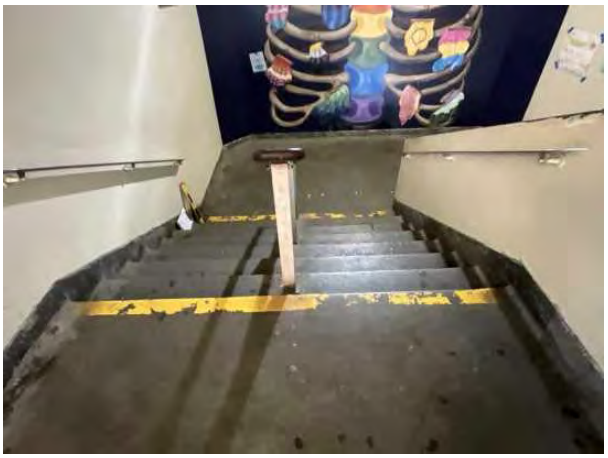

Barrier ID: AX419773

Pasadena High School GENERAL EXTERIOR

Assembly	Interior Access Route
Type	Stairs
ADA Standard	CBC Chap 11B-505
Barrier Detail	CALIFORNIA: Handrails are not compliant or are not provided.
Location Description	Stair K Building I Breezeway
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The handrails attached to the wall are not compliant due to not providing a cross section dimension of 2 3/4 inches. The rails do not provide extensions at the top or the bottom.

Resolution

Install handrails on both sides of all stairs that comply with guidelines. Handrails shall be provided on both sides of stairs. [Exception: In assembly areas, handrails shall not be required on both sides of aisle ramps where a handrail is provided at either side or within the aisle width.] Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above walking surfaces, stair nosings, and ramp surfaces. Handrails shall be at a consistent height above walking surfaces, stair nosings, and ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrails may be located in a recess if the recess is 3" maximum deep and 18" minimum clear above the top of the handrail. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1. Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of stair flights. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, full extensions of handrails shall not be required where such extensions would be hazardous due to plan configuration.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

60 LF

Priority 1

Photos for Barrier ID: AX419773









Barrier ID: AX419756

Pasadena High School BUILDING H

Assembly	Interior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stair L Building H Breezeway
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The contrasting stripe paint is eroding.

Resolution


Install visual contrast at the interior stair flight. The upper approach and lower tread shall be marked by a stripe providing clear visual contrast. The visual contrast shall be located at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from the nose of the step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.


Quantity

4 Riser

Priority	1

Photos for Barrier ID: AX419756

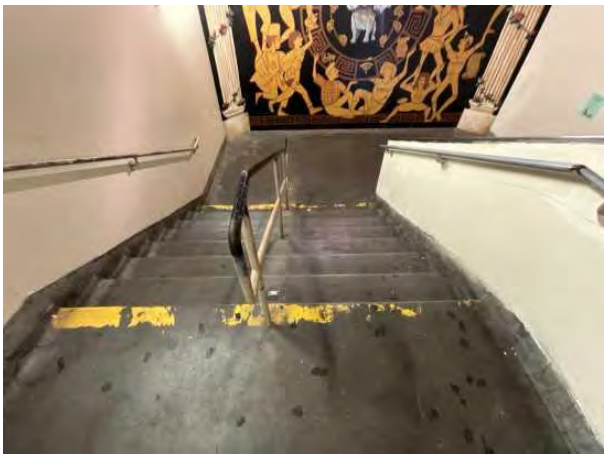

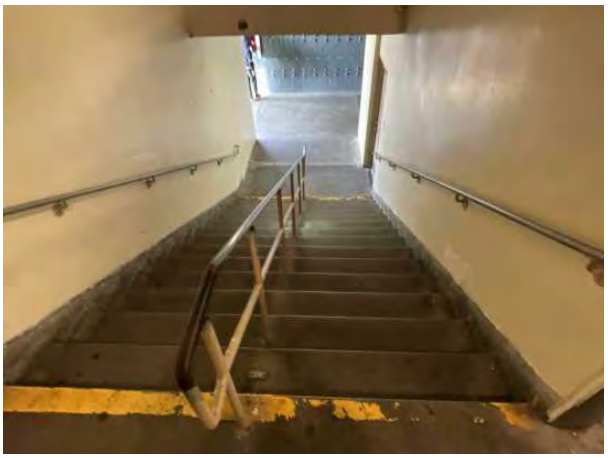

Barrier ID: AX418371

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Building Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stairs Adjacent to D101 Student Sevices
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stair treads do not provide a contrasting stripe.

Resolution


Install a visual contrast at the top of the stair flight and on each stair tread at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from nose of step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

6 Riser


Priority	1

Map for Barrier ID: AX418371

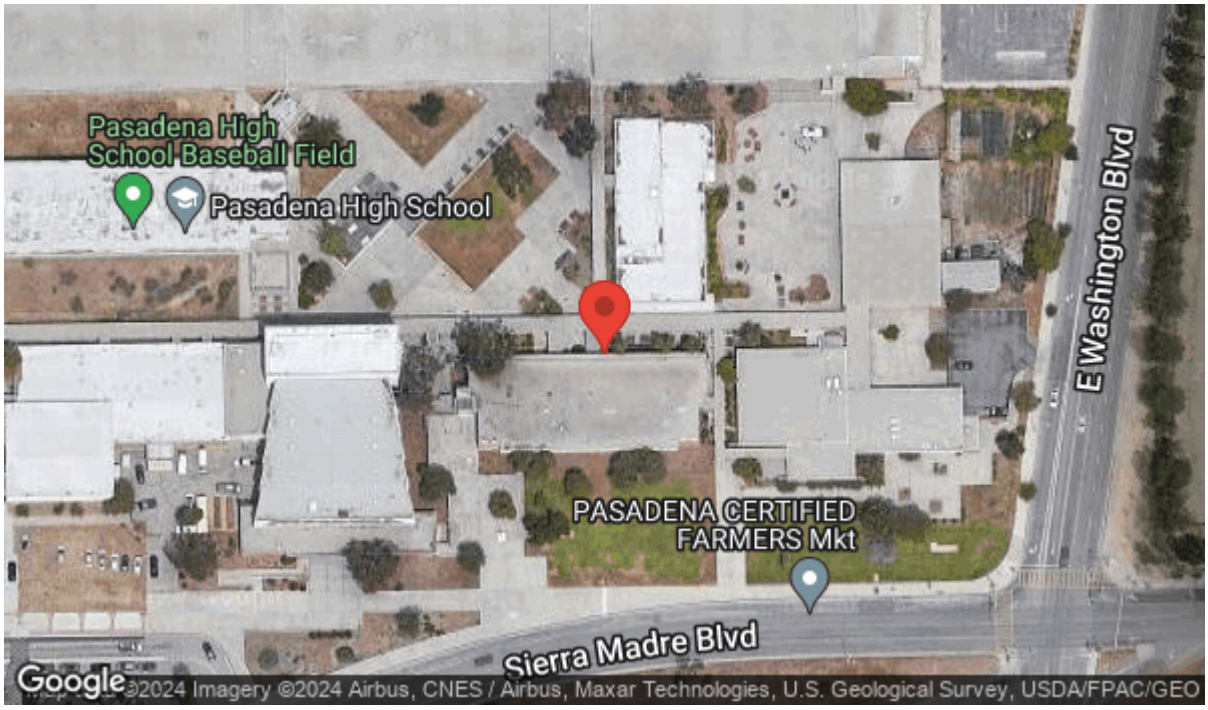

182 +34.162248, -118.091392

Photos for Barrier ID: AX418371

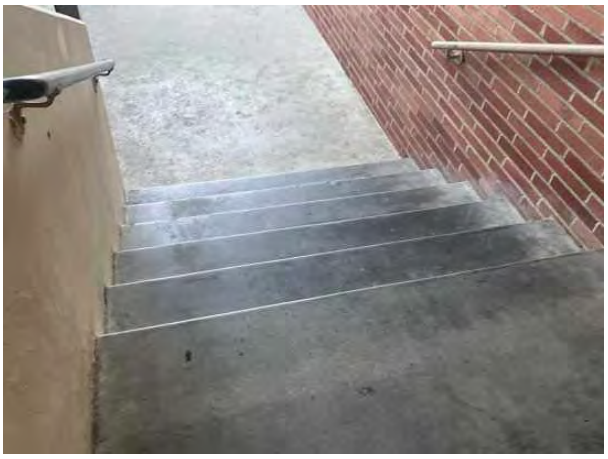

Barrier ID: AX418372

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	CBC Chap 11B-505
Barrier Detail	CALIFORNIA: Handrails are not compliant or are not provided.
Location Description	Stairs Adjacent to D101 Student Sevices
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The stairs top gripping surface is 32 1/4 inches above the risers. The stairs does not provide the required top and bottom extensions.

Resolution


Install handrails on both sides of all stairs that comply with guidelines. Handrails shall be provided on both sides of stairs. [Exception: In assembly areas, handrails shall not be required on both sides of aisle ramps where a handrail is provided at either side or within the aisle width.] Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above walking surfaces, stair nosings, and ramp surfaces. Handrails shall be at a consistent height above walking surfaces, stair nosings, and ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrails may be located in a recess if the recess is 3" maximum deep and 18" minimum clear above the top of the handrail. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1. Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of stair flights. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, full extensions of handrails shall not be required where such extensions would be hazardous due to plan configuration.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

16 LF

Priority 1


Map for Barrier ID: AX418372

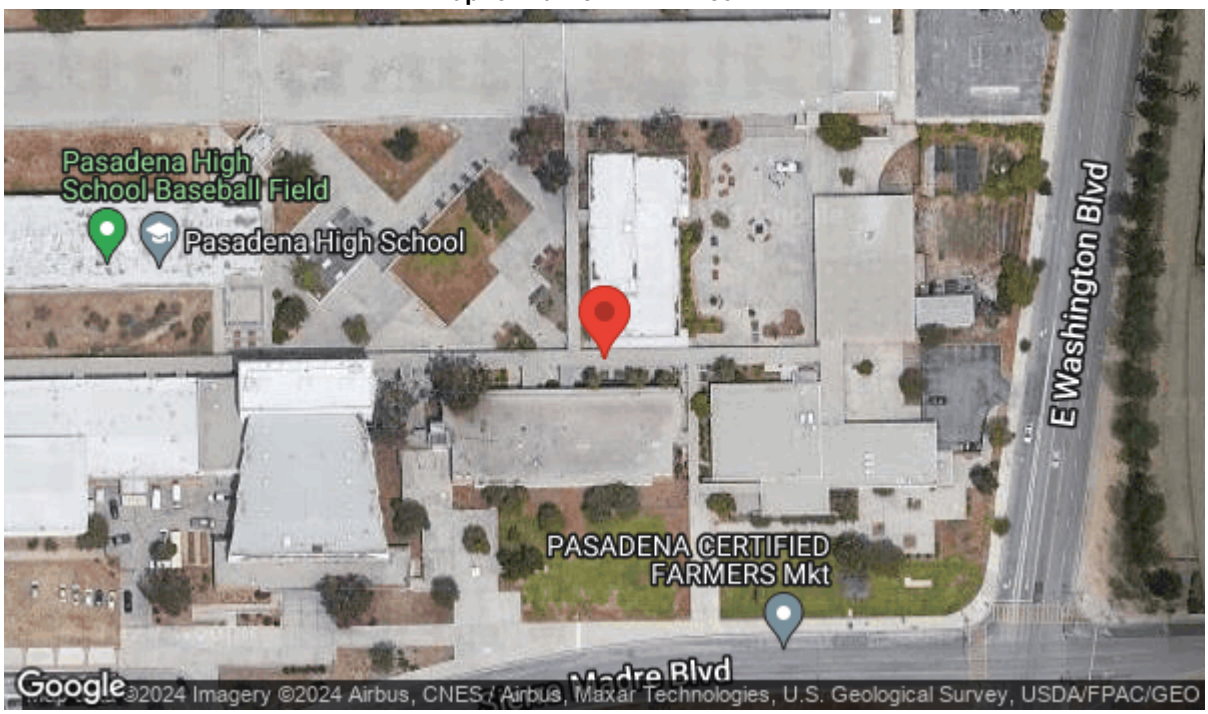


183 +34.162315, -118.091324

Photos for Barrier ID: AX418372



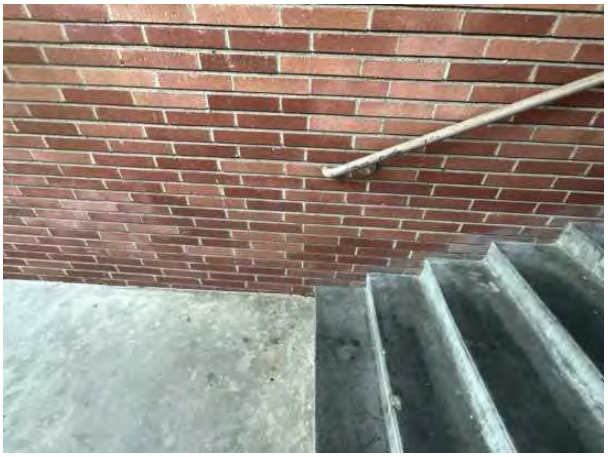



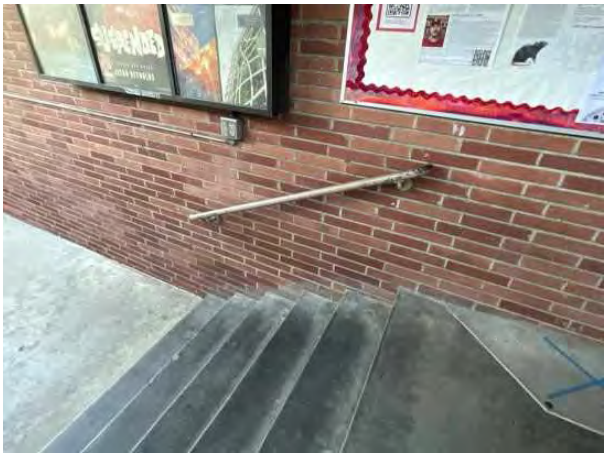



Barrier ID: AX418366

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Building Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stairs East Side of Building D
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stairs striping is eroding.

Resolution


Install a visual contrast at the top of the stair flight and on each stair tread at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from nose of step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

5 Riser


Priority	1

Map for Barrier ID: AX418366

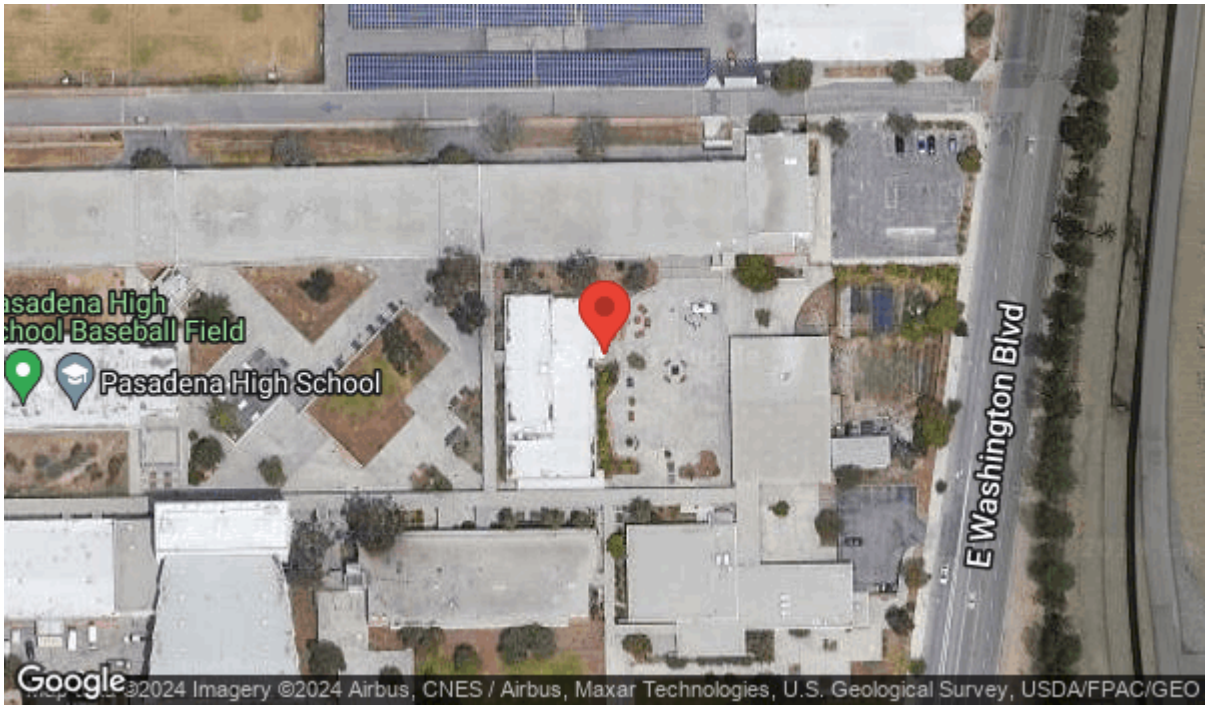

177 +34.162638, -118.091099

Photos for Barrier ID: AX418366

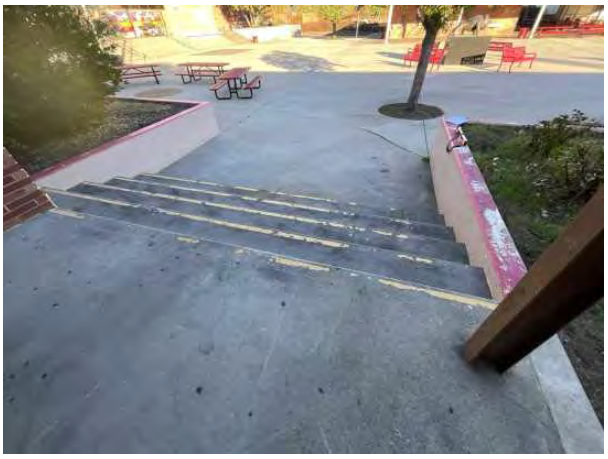

Barrier ID: AX418367

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	CBC Chap 11B-505
Barrier Detail	CALIFORNIA: Handrails are not compliant or are not provided.
Location Description	Stairs East Side of Building D
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stairs does not have handrails on either side.

Resolution


Install handrails on both sides of all stairs that comply with guidelines. Handrails shall be provided on both sides of stairs. [Exception: In assembly areas, handrails shall not be required on both sides of aisle ramps where a handrail is provided at either side or within the aisle width.] Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above walking surfaces, stair nosings, and ramp surfaces. Handrails shall be at a consistent height above walking surfaces, stair nosings, and ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrails may be located in a recess if the recess is 3" maximum deep and 18" minimum clear above the top of the handrail. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1. Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of stair flights. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, full extensions of handrails shall not be required where such extensions would be hazardous due to plan configuration.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

16 LF


Priority 1

Map for Barrier ID: AX418367

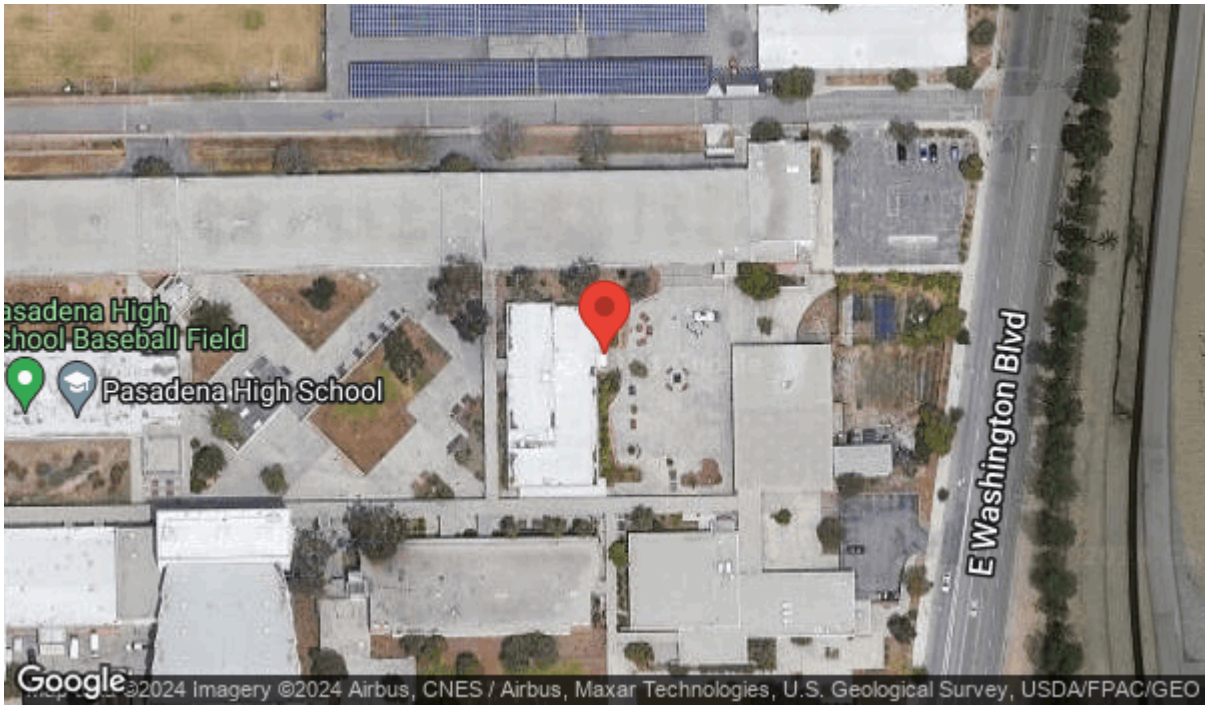


178 +34.162659, -118.091102

Photos for Barrier ID: AX418367

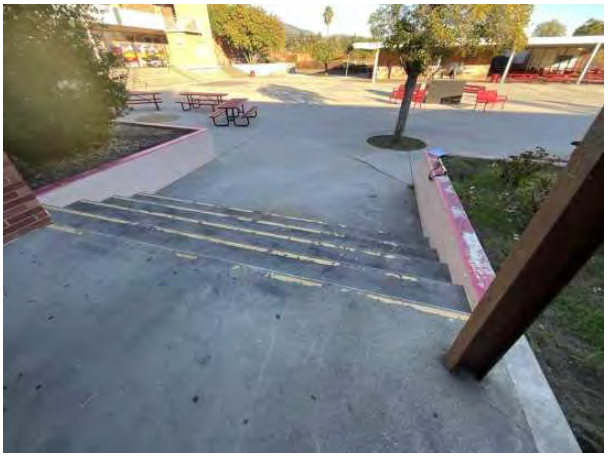



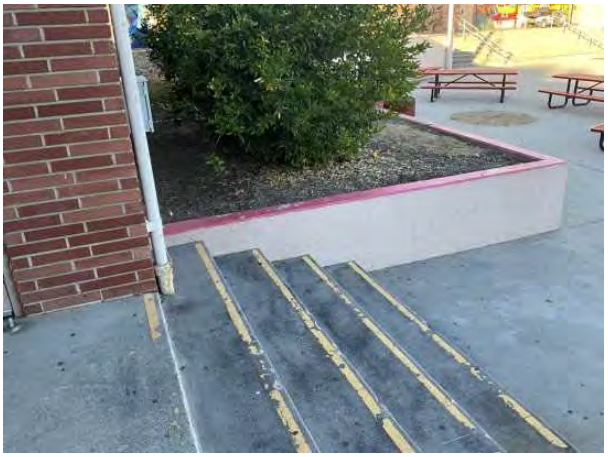

Barrier ID: AX418368

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	504.2
Barrier Detail	Steps do not have uniform and compliant riser heights and/or tread depths.
Location Description	Stairs East Side of Building D
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Does stair treads have cracks, creating non-uniform, tread depth, and riser Heights.

Resolution


Replace the stairway. All steps on a flight of stairs shall have uniform riser heights and uniform tread depths. Risers shall be 4" high minimum and 7" high maximum. Treads shall be 11" deep minimum.. [Exterior stairs are required to be compliant where the stairs are part of a path of travel leading to designated exterior areas of refuge from the designated accessible emergency exit from the building. Existing buildings are generally required to have one accessible interior path of travel from every accessible space within the building for emergency purposes. Refer to the emergency/fire plan approved by the appropriate local authority.]

Quantity

100 SF

Priority	1

Map for Barrier ID: AX418368

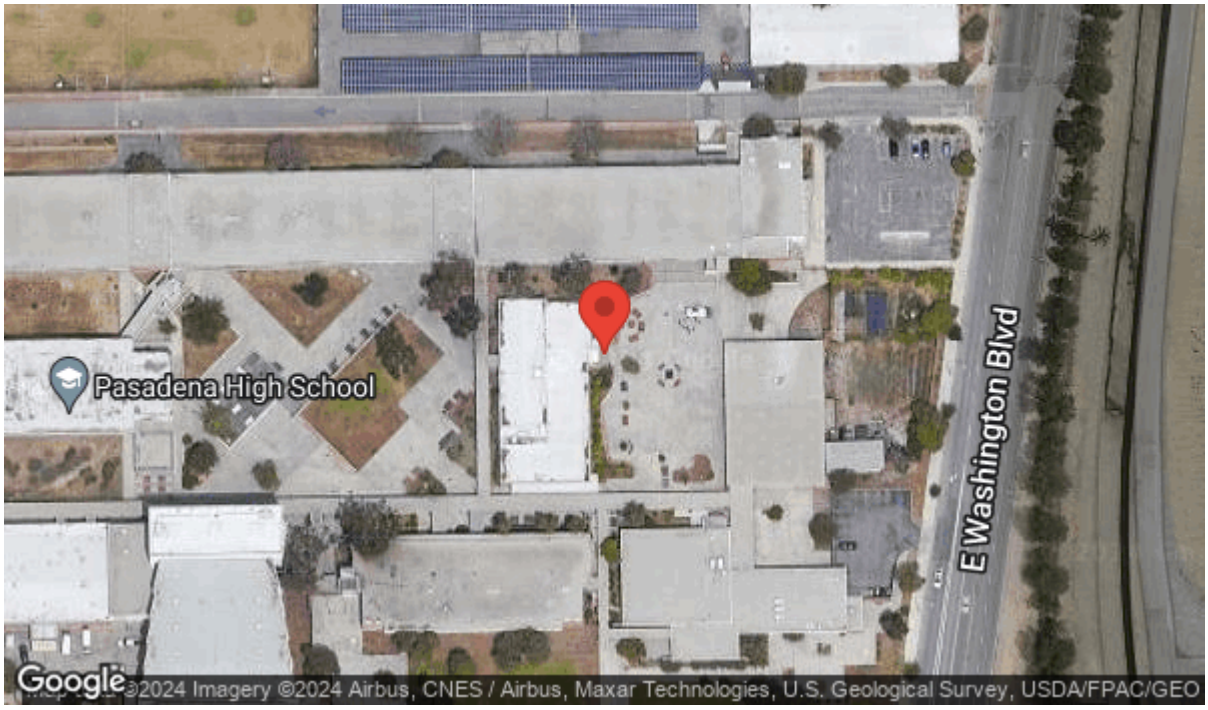

179 +34.162650, -118.091079

Photos for Barrier ID: AX418368









Barrier ID: AX418363

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Building Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stairs Southeast Side of Building G
Observed	Dec 10, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The contrasting stripe at the stair treads is fading or eroding.

Resolution


Install a visual contrast at the top of the stair flight and on each stair tread at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from nose of step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

45 Riser

Priority	1

Map for Barrier ID: AX418363

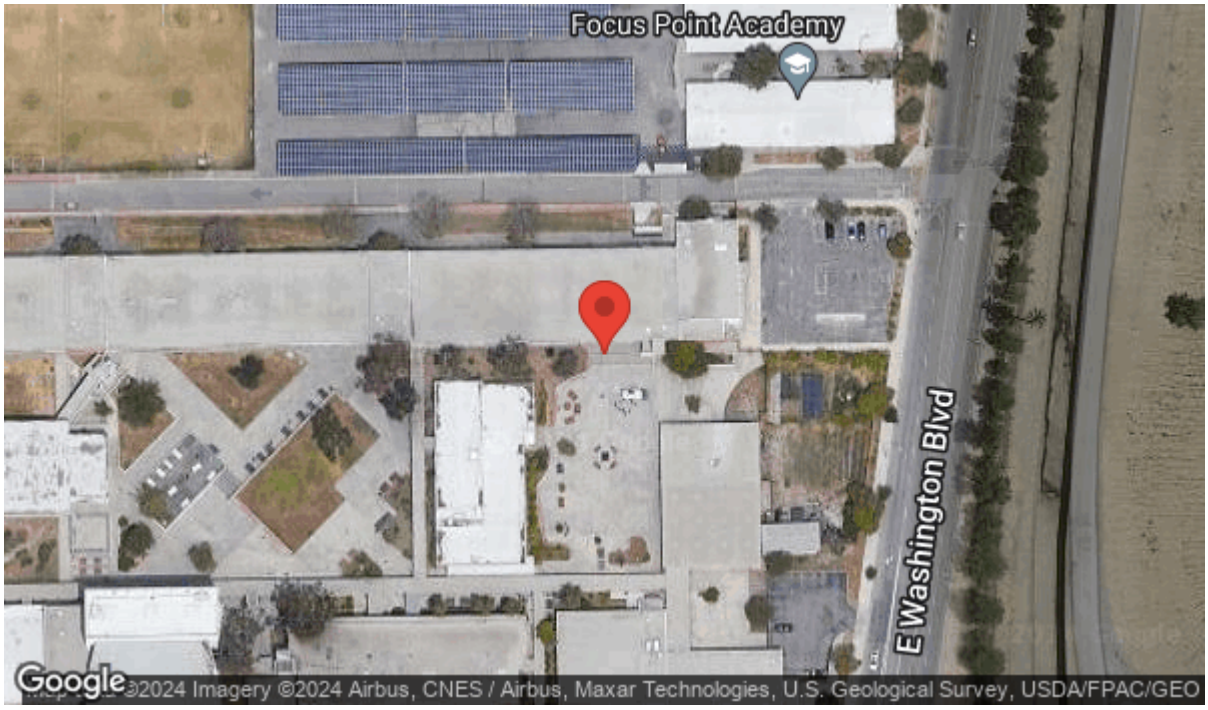

174 +34.162832, -118.090908

Photos for Barrier ID: AX418363







Barrier ID: AX419774

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	CBC Chap 11B-505
Barrier Detail	CALIFORNIA: Handrails are not compliant or are not provided.
Location Description	Stairs Southeast Side of Building I
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stairs do not provide handrails.

Resolution


Install handrails on both sides of all stairs that comply with guidelines. Handrails shall be provided on both sides of stairs. [Exception: In assembly areas, handrails shall not be required on both sides of aisle ramps where a handrail is provided at either side or within the aisle width.] Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above walking surfaces, stair nosings, and ramp surfaces. Handrails shall be at a consistent height above walking surfaces, stair nosings, and ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrails may be located in a recess if the recess is 3" maximum deep and 18" minimum clear above the top of the handrail. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1. Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of stair flights. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, full extensions of handrails shall not be required where such extensions would be hazardous due to plan configuration.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

16 LF

Priority 1

Map for Barrier ID: AX419774

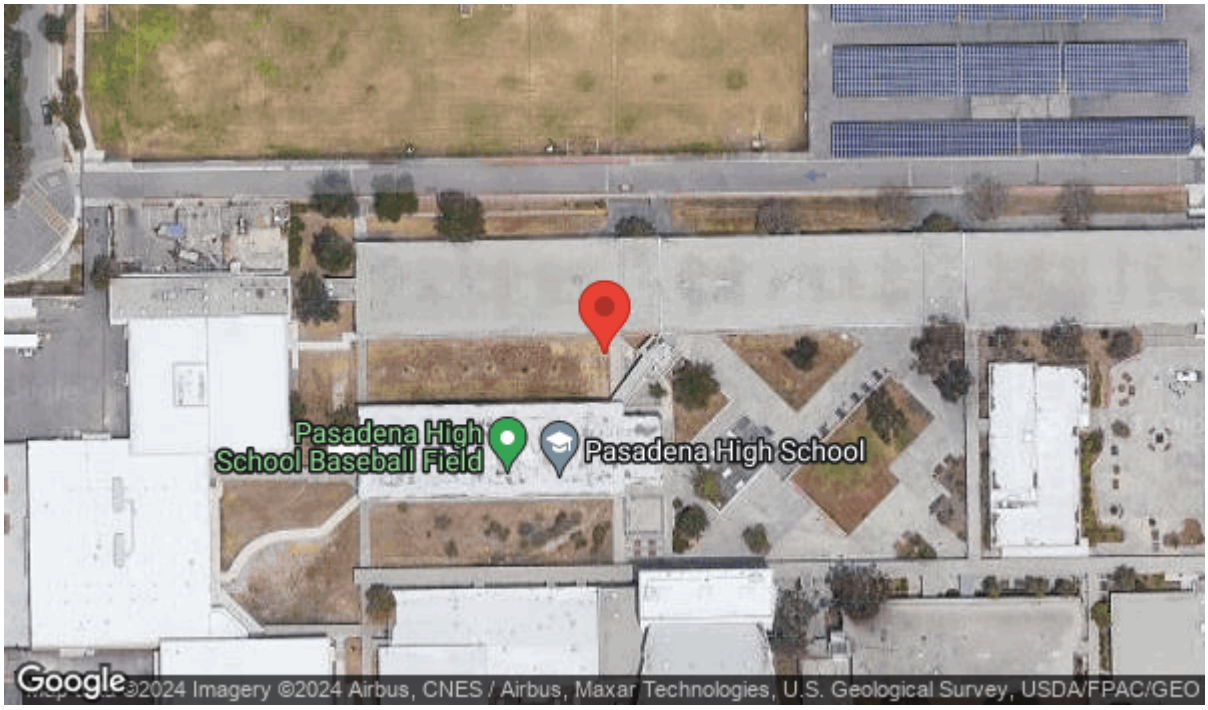

360 +34.162792, -118.092396

Photos for Barrier ID: AX419774





Barrier ID: AX418227

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Building Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stairs ST1
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stair treads do not provide a contrasting stripe at each tread.

Resolution

Install a visual contrast at the top of the stair flight and on each stair tread at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from nose of step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

12 Riser

Priority	1

Map for Barrier ID: AX418227



38 +34.161848, -118.091829

Photos for Barrier ID: AX418227



Barrier ID: AX420147

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Building Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stairs ST10 SE Side of Building T
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The contrasting stripe paint is fading.

Resolution

Install a visual contrast at the top of the stair flight and on each stair tread at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from nose of step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

6 Riser

Priority	1

Map for Barrier ID: AX420147



526 +34.162568, -118.093235

Photos for Barrier ID: AX420147



Barrier ID: AX420151

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	CBC Chap 11B-505
Barrier Detail	CALIFORNIA: Handrails are not compliant or are not provided.
Location Description	Stairs ST11 Adjacent to C102
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stairs do not provide handrails.

Resolution

Install handrails on both sides of all stairs that comply with guidelines. Handrails shall be provided on both sides of stairs. [Exception: In assembly areas, handrails shall not be required on both sides of aisle ramps where a handrail is provided at either side or within the aisle width.] Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above walking surfaces, stair nosings, and ramp surfaces. Handrails shall be at a consistent height above walking surfaces, stair nosings, and ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrails may be located in a recess if the recess is 3" maximum deep and 18" minimum clear above the top of the handrail. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1. Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of stair flights. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, full extensions of handrails shall not be required where such extensions would be hazardous due to plan configuration.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

6 LF


Priority 1

Map for Barrier ID: AX420151



530 +34.161952, -118.093177

Photos for Barrier ID: AX420151

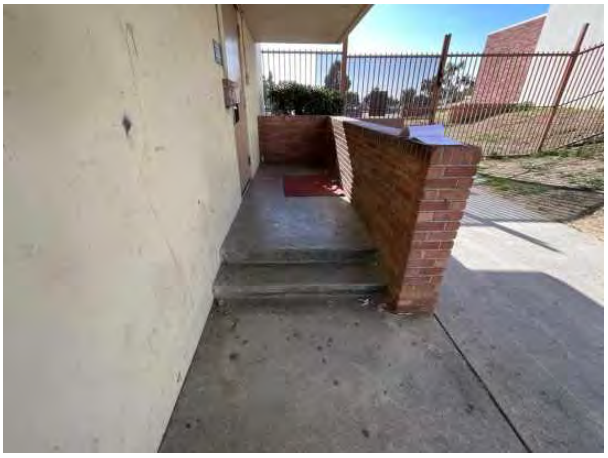

Barrier ID: AX420152

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Building Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stairs ST11 Adjacent to C102
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stairs do not provide the contrasting stripes on each tread.

Resolution

Install a visual contrast at the top of the stair flight and on each stair tread at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from nose of step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

2 Riser


Priority	1

Map for Barrier ID: AX420152



531 +34.161938, -118.093158

Photos for Barrier ID: AX420152

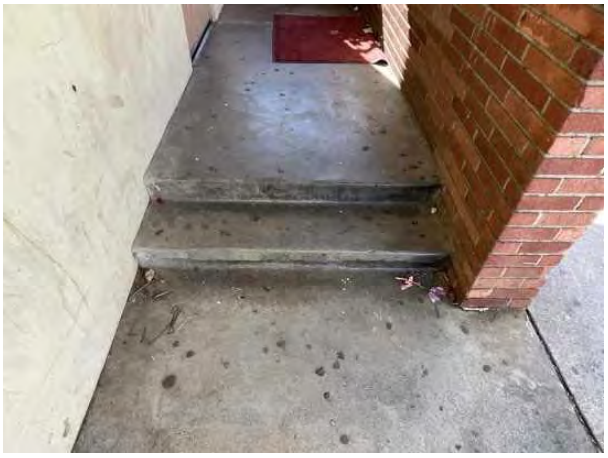

Barrier ID: AX418229

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	CBC Chap 11B-505
Barrier Detail	CALIFORNIA: Handrails are not compliant or are not provided.
Location Description	Stairs ST2
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The handrail top gripping surface is 33 1/2 inches to 33 3/4 above the risers.

Resolution

Install handrails on both sides of all stairs that comply with guidelines. Handrails shall be provided on both sides of stairs. [Exception: In assembly areas, handrails shall not be required on both sides of aisle ramps where a handrail is provided at either side or within the aisle width.] Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above walking surfaces, stair nosings, and ramp surfaces. Handrails shall be at a consistent height above walking surfaces, stair nosings, and ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrails may be located in a recess if the recess is 3" maximum deep and 18" minimum clear above the top of the handrail. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1. Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of stair flights. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, full extensions of handrails shall not be required where such extensions would be hazardous due to plan configuration.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

40 LF

Priority 1


Map for Barrier ID: AX418229




40 +34.161918, -118.091890

Photos for Barrier ID: AX418229



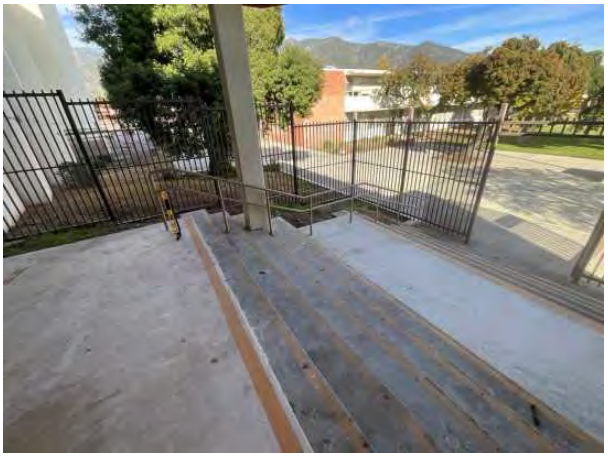

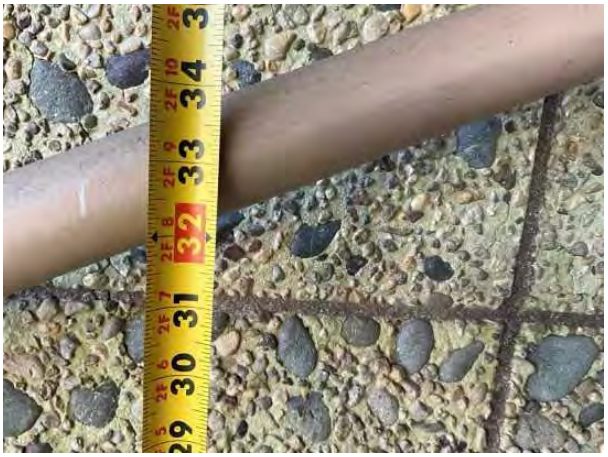

Barrier ID: AX418230

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	UFAS 4.9.3
Barrier Detail	The tread nosings are not compliant.
Location Description	Stairs ST2
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The nosing protrudes 2 3/4 inches.

Resolution

Replace with compliant leading edges of the treads that are compliant. The undersides of nosings shall not be abrupt. The radius of curvature at the leading edge of the tread shall be no greater than 1/2". Risers shall be sloped or the underside of the nosing shall have an angle not less than 60 degrees from the horizontal. Nosings shall project no more than 1-1/2" (see Fig. 18).

Quantity

168 SF

Priority	1

Map for Barrier ID: AX418230



41 +34.161895, -118.091852

Photos for Barrier ID: AX418230







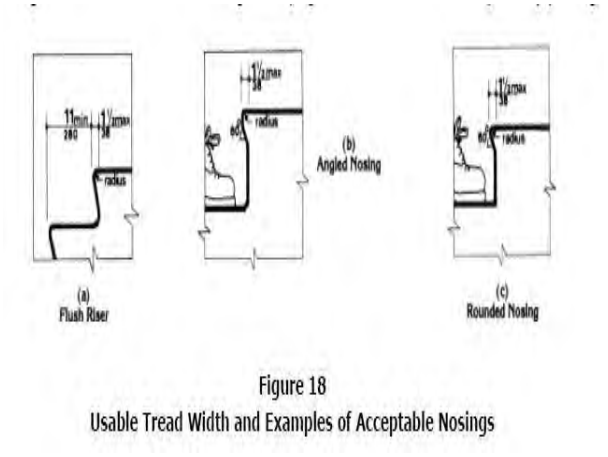


Figure 18
Usable Tread Width and Examples of Acceptable Nosings

Barrier ID: AX418356

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	CBC Chap 11B-505
Barrier Detail	CALIFORNIA: Handrails are not compliant or are not provided.
Location Description	Stairs ST3
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stairs does not provide handrails on both sides.

Resolution


Install handrails on both sides of all stairs that comply with guidelines. Handrails shall be provided on both sides of stairs. [Exception: In assembly areas, handrails shall not be required on both sides of aisle ramps where a handrail is provided at either side or within the aisle width.] Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above walking surfaces, stair nosings, and ramp surfaces. Handrails shall be at a consistent height above walking surfaces, stair nosings, and ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrails may be located in a recess if the recess is 3" maximum deep and 18" minimum clear above the top of the handrail. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1. Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of stair flights. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, full extensions of handrails shall not be required where such extensions would be hazardous due to plan configuration.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

10 LF


Priority 1


Map for Barrier ID: AX418356

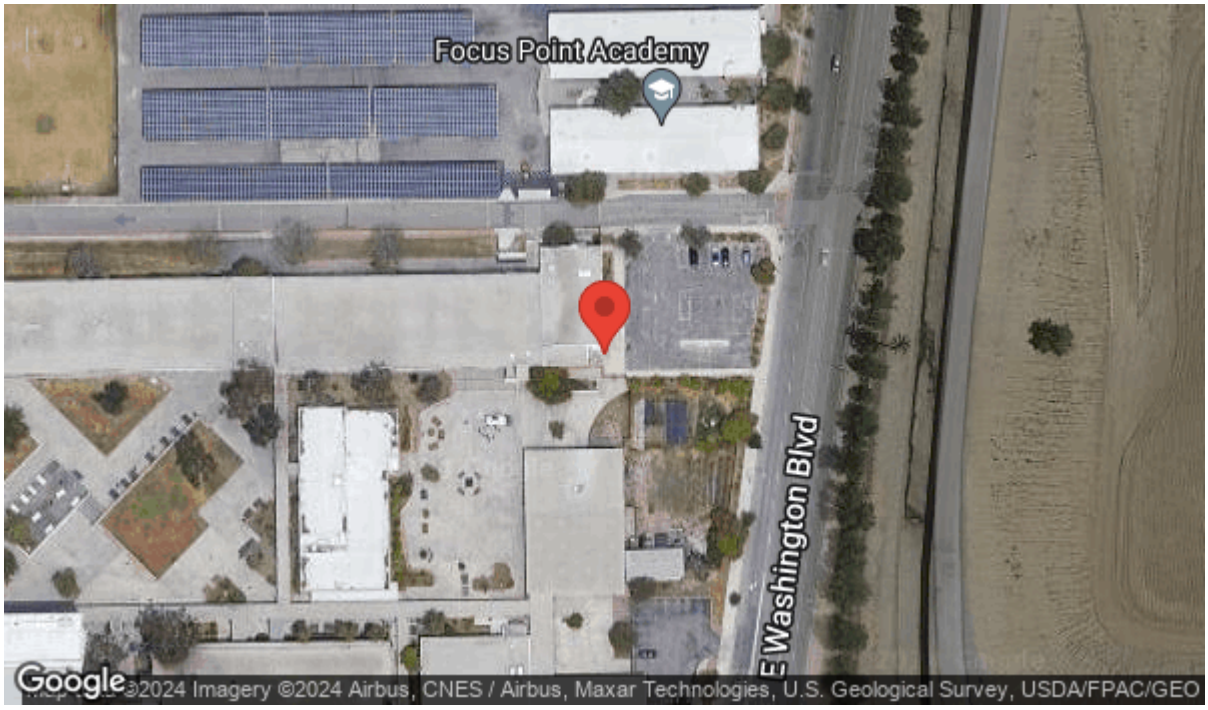

167 +34.162887, -118.090543

Photos for Barrier ID: AX418356

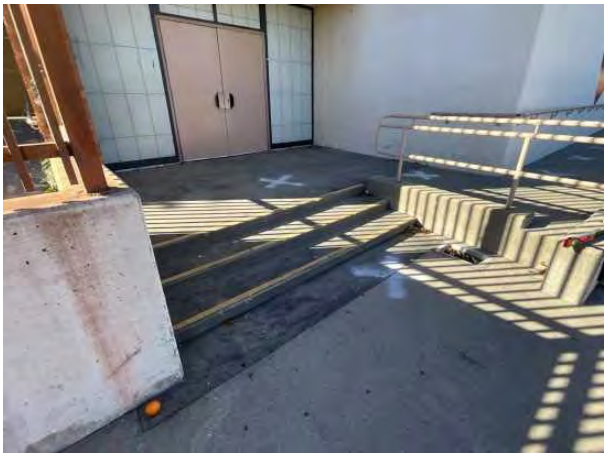

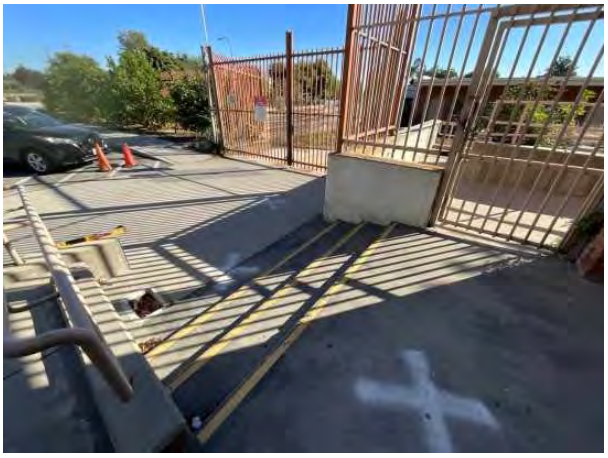

Barrier ID: AX419775

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Building Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stairs ST4
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stair treads do not provide contrasting stripes on all treads.

Resolution

Install a visual contrast at the top of the stair flight and on each stair tread at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from nose of step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

4 Riser

Priority	1

Map for Barrier ID: AX419775



361 +34.162767, -118.092303

Photos for Barrier ID: AX419775







Barrier ID: AX419776

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	CBC Chap 11B-505
Barrier Detail	CALIFORNIA: Handrails are not compliant or are not provided.
Location Description	Stairs ST4
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The middle handrail does not provide the required extensions at the bottom and one handrail is missing.

Resolution

Install handrails on both sides of all stairs that comply with guidelines. Handrails shall be provided on both sides of stairs. [Exception: In assembly areas, handrails shall not be required on both sides of aisle ramps where a handrail is provided at either side or within the aisle width.] Handrails shall be continuous within the full length of each stair flight or ramp run. Inside handrails on switchback or dogleg stairs and ramps shall be continuous between flights or runs. Top of gripping surfaces of handrails shall be 34" minimum and 38" maximum vertically above walking surfaces, stair nosings, and ramp surfaces. Handrails shall be at a consistent height above walking surfaces, stair nosings, and ramp surfaces. Clearance between handrail gripping surfaces and adjacent surfaces shall be 1-1/2" minimum. Handrails may be located in a recess if the recess is 3" maximum deep and 18" minimum clear above the top of the handrail. Handrail gripping surfaces shall be continuous along their length and shall not be obstructed along their tops or sides. The bottoms of handrail gripping surfaces shall not be obstructed for more than 20% of their length. Where provided, horizontal projections shall occur 1-1/2" minimum below the bottom of the handrail gripping surface. [EXCEPTIONS: 1. Where handrails are provided along walking surfaces with slopes not steeper than 1:20, the bottoms of handrail gripping surfaces shall be permitted to be obstructed along their entire length where they are integral to crash rails or bumper guards. 2. The distance between horizontal projections and the bottom of the gripping surface shall be permitted to be reduced by 1/8" for each 1/2" of additional handrail perimeter dimension that exceeds 4". Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4" minimum and 2" maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4" minimum and 6-1/4" maximum, and a cross-section dimension of 2-1/4" maximum. Handrail gripping surfaces and any surfaces adjacent to them shall be free of sharp or abrasive elements and shall have rounded edges. Handrails shall not rotate within their fittings. Handrail gripping surfaces shall extend beyond and in the same direction of stair flights. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTIONS: 1. Extensions shall not be required for continuous handrails at the inside turn of switchback or dogleg stairs and ramps AND 3. In alterations, full extensions of handrails shall not be required where such extensions would be hazardous due to plan configuration.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28" measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9" minimum, should be provided to help prevent entrapment.]

Quantity

6 LF


Priority 1

Map for Barrier ID: AX419776



362 +34.162815, -118.092262

Photos for Barrier ID: AX419776

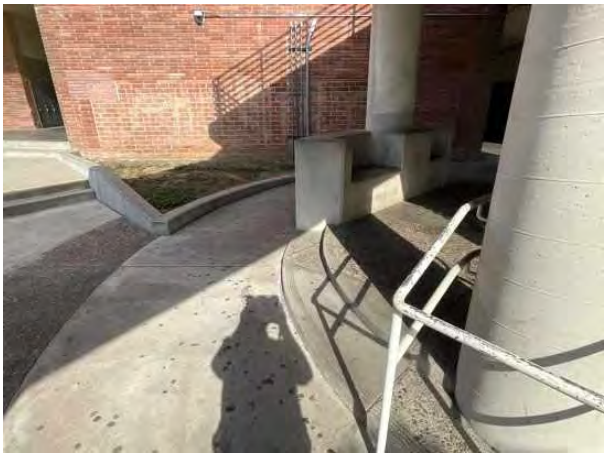



Barrier ID: AX419777

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Building Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stairs ST5
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The treads do not provide contrasting stripes on all treads.

Resolution


Install a visual contrast at the top of the stair flight and on each stair tread at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from nose of step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

20 Riser


Priority	1


Map for Barrier ID: AX419777

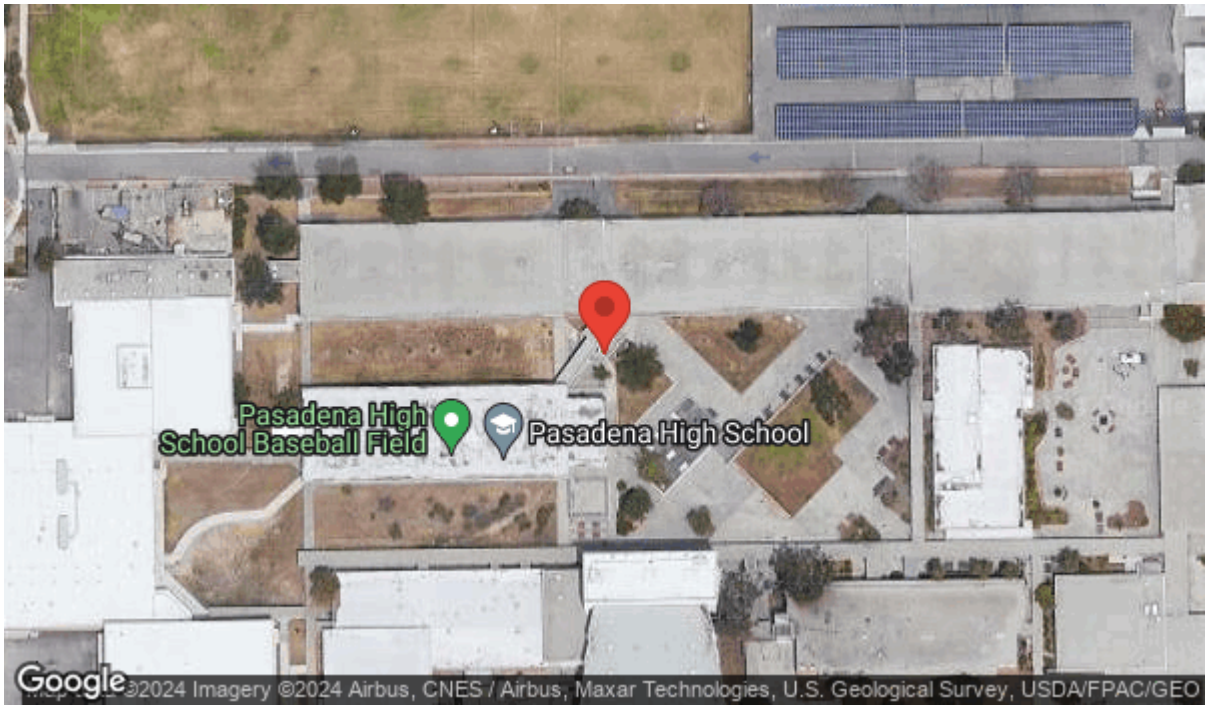

363 +34.162751, -118.092244

Photos for Barrier ID: AX419777

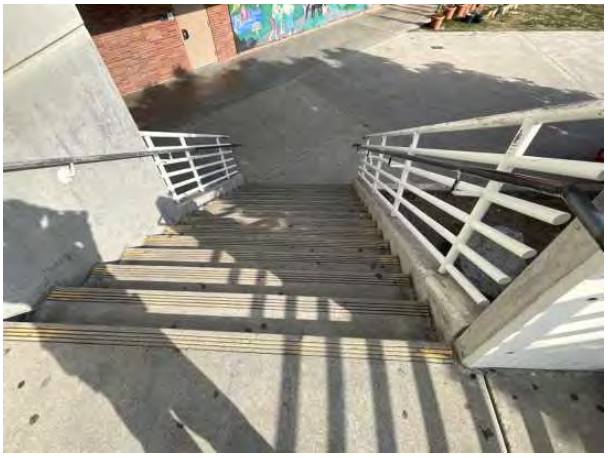

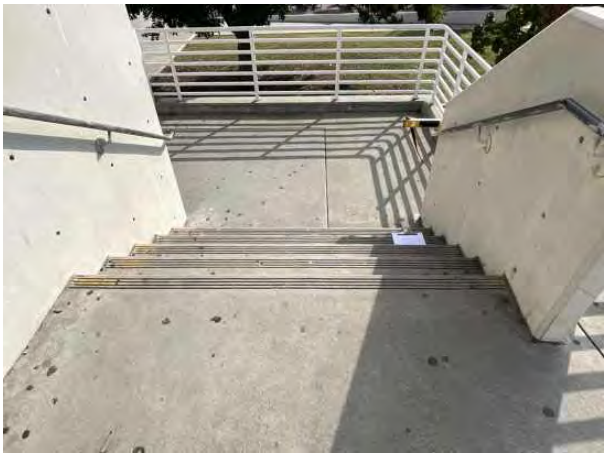

Barrier ID: AX419795

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Building Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stairs ST6 South of H112
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stairs do not provide contrasting stripes on each tread.

Resolution


Install a visual contrast at the top of the stair flight and on each stair tread at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from nose of step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

7 Riser

Priority	1

Map for Barrier ID: AX419795

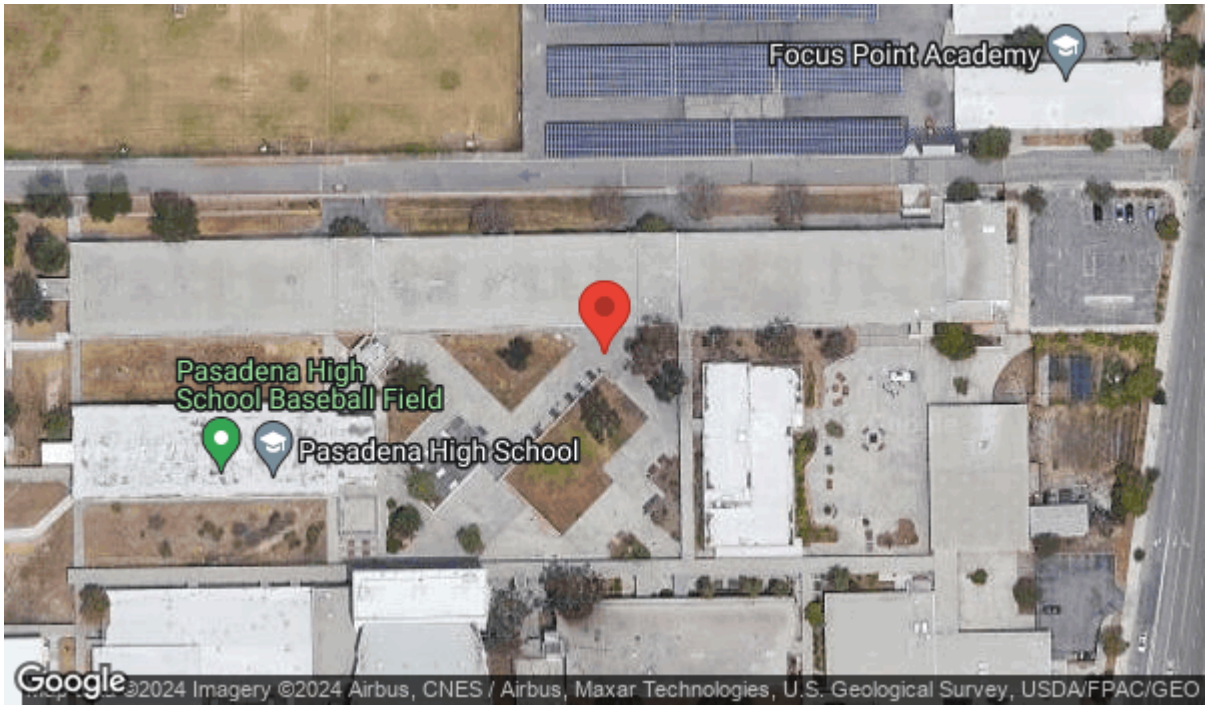

381 +34.162790, -118.091629

Photos for Barrier ID: AX419795



Barrier ID: AX419796

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Building Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stairs ST7 North of Building B
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The treads do not provide a contrasting stripes on all treads.

Resolution


Install a visual contrast at the top of the stair flight and on each stair tread at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from nose of step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

10 Riser


Priority	1

Map for Barrier ID: AX419796

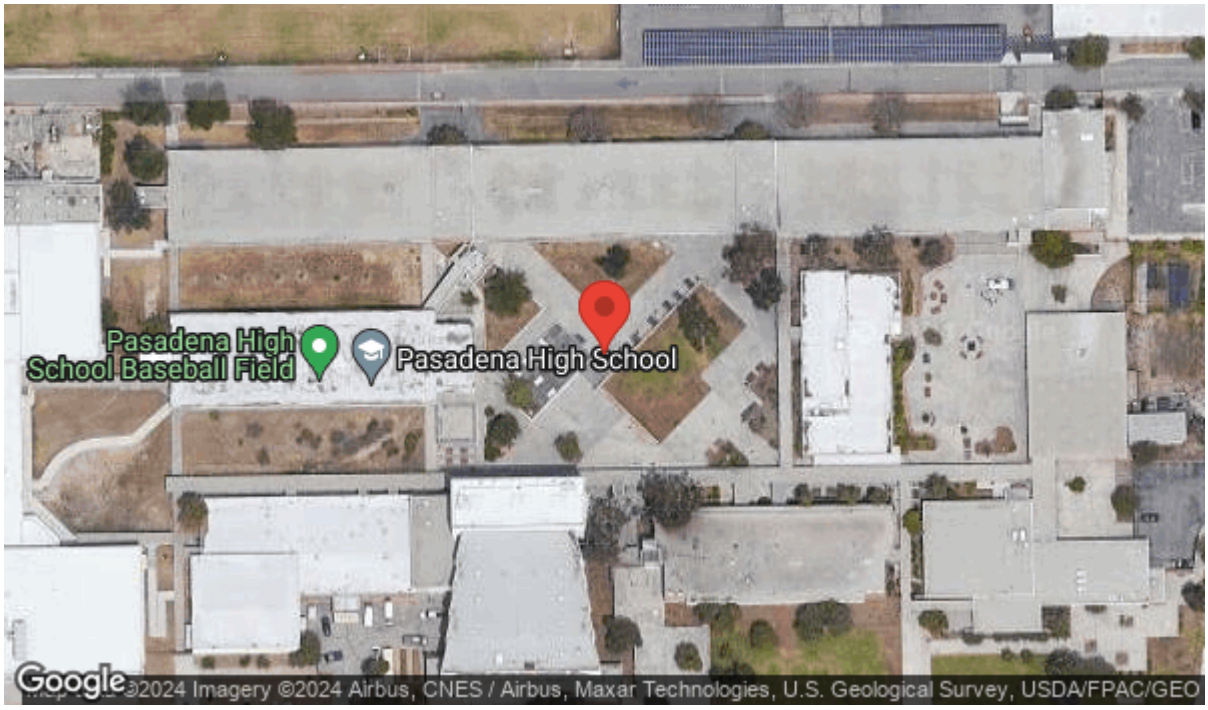

382 +34.162585, -118.091891

Photos for Barrier ID: AX419796

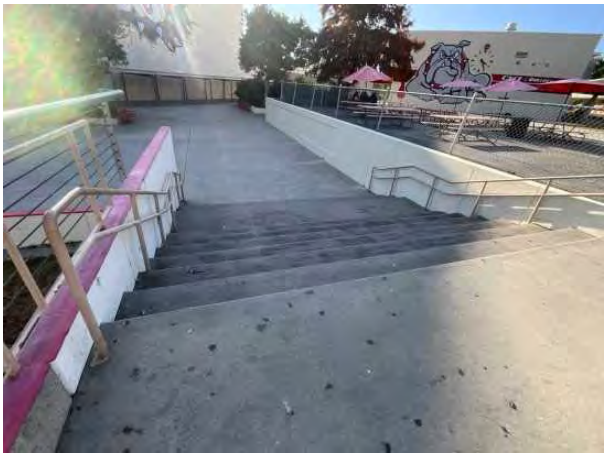

Barrier ID: AX419800

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Building Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stairs ST8 NE Corner of R107 Gym
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stair treads do not provide contrasting stripes on each tread.

Resolution

Install a visual contrast at the top of the stair flight and on each stair tread at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from nose of step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

7 Riser


Priority	1

Map for Barrier ID: AX419800



386 +34.162160, -118.093086

Photos for Barrier ID: AX419800

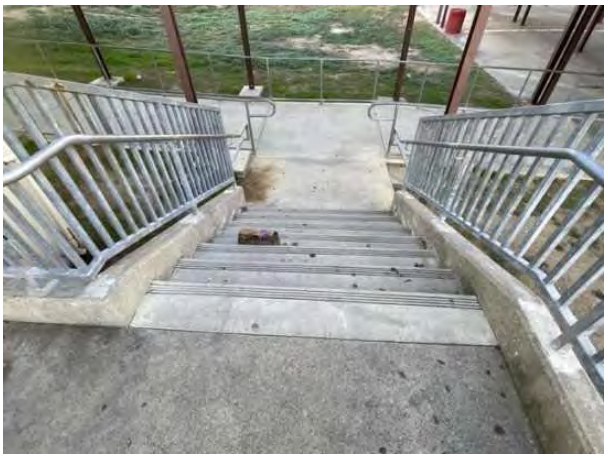

Barrier ID: AX419801

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Building Code Chap 11B-504.4.1

Barrier Detail

CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.

Location Description	Stairs ST9 Adjacent to S101
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The contrasting stripes are eroding.

Resolution

Install a visual contrast at the top of the stair flight and on each stair tread at the nosing. The stripe shall be minimum 2" to maximum 4" wide, parallel to and maximum 1" from nose of step or upper approach, run full width of stairway, and as slip resistant as the stairway material. A painted stripe is compliant. Grooves without paint are not compliant.

Quantity

4 Riser


Priority	1

Map for Barrier ID: AX419801



387 +34.162293, -118.093295

Photos for Barrier ID: AX419801

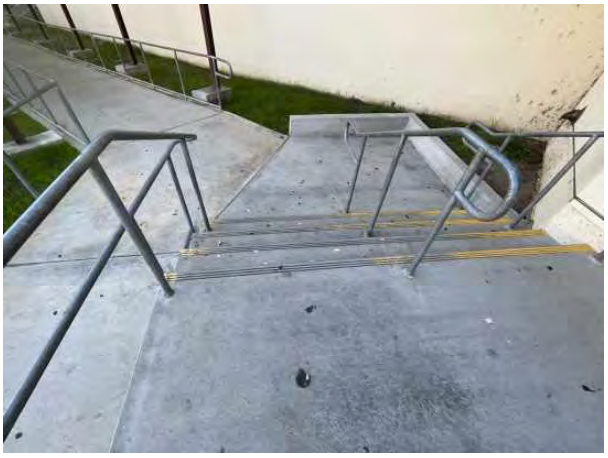

Barrier ID: AX425102

Pasadena High School BUILDING B

Assembly	Common Areas
Type	Assembly Area
ADA Standard	221.4; 802.4
Barrier Detail	Assembly areas do not provide compliant aisle seats.
Location Description	Auditorium Seating
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

A total of 536 aisle seats are provided. 5% of aisle seats are required to be near exits providing retractable arm rests where are armrests are provided. 5% of 536 is 27. Provide 27 aisle seats with retractable armrests and identified with an ISA.

Resolution


Provide a minimum of 5% of the total number of aisle seats as aisle seats designated as accessible. Accessible aisle seats shall be the aisle seats located closest to accessible routes, and shall be dispersed among types of seating available to the public. Where armrests are provided on the seating in the immediate area, folding or retractable armrests shall be provided on the aisle side of the designated accessible aisle seat. Each designated aisle seat shall be identified by a sign or marker.

Quantity


27 EA

Priority	2

Photos for Barrier ID: AX425102

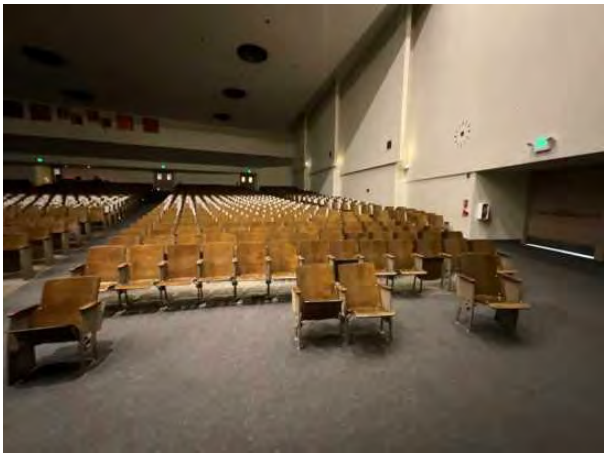



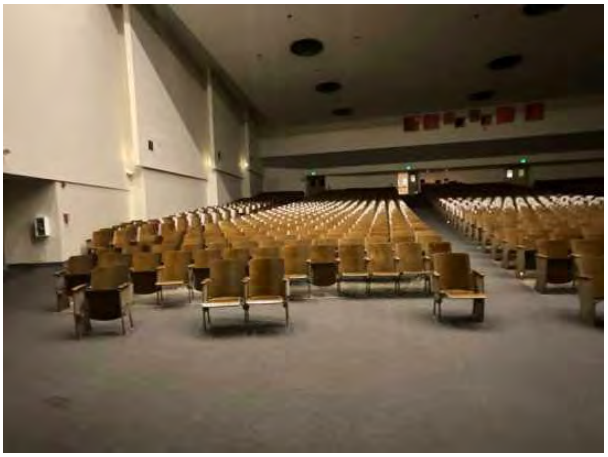

Barrier ID: AX420222

Pasadena High School SPORTS FACILITIES

Assembly	Baseball/Softball Field
Type	Bleacher Seating
ADA Standard	221; 802.2; 802.3

Barrier Detail

The required number of wheelchair spaces is not provided at the bleacher seating for the ball field.

Location Description	Baseball Field Seating
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

90 total bench seats are provided at each bleacher. 90 bleacher seats requires 4 wheelchair spaces per bleacher.

Resolution

Provide wheelchair spaces at the bleacher seating to comply with the following table: Number of Seats/Minimum No. of Required Wheelchair Spaces; under 25 seats- 1 wheelchair space; 25 to 50 seats- 2 wheelchair spaces; 51 to 150 seats- 4 wheelchair spaces; 151 to 300 seats- 5 wheelchair spaces; 301 to 500 seats-6 wheelchair spaces; 501 to 5000 seats- 6 wheelchair spaces, plus 1 for each 150, or fraction thereof, between 501 through 5000; 5001 and over seats-36 wheelchair spaces, plus 1 for each 200, or fraction thereof, over 5000. Wheelchair spaces shall not have slopes steeper than 1:48. A single wheelchair space shall be 36" wide minimum. Where two or more wheelchair spaces are provided, each wheelchair space shall be 33" wide minimum. Where a wheelchair space can be entered from the front or rear, the wheelchair space shall be 48" deep minimum. Where a wheelchair space can be entered only from the side, the wheelchair space shall be 60" deep minimum. Each wheelchair space shall adjoin an accessible route. Accessible routes shall not overlap wheelchair spaces, and access to any wheelchair space cannot be through another wheelchair space. Wheelchair spaces shall not overlap circulation paths, which are aisle width required by building or safety codes. Where a circulation path provided is wider than the required aisle width, the wheelchair space may intrude into that portion of the circulation path that is provided in excess of the required aisle width. The wheelchair space shall provide lines of sight to the field play area. In bleacher seating, wheelchair spaces shall not be required to be provided in rows other than rows at points of entry to bleacher seating. At least one companion seat shall be located at each required wheelchair seat. Companion seats must be located to provide shoulder alignment with adjacent wheelchair spaces. The shoulder alignment point of the wheelchair space shall be measured 36" from the front of the wheelchair space. The floor surface of the companion seat shall be at the same elevations as the floor surface of the wheelchair space.

Quantity

192 SF

Priority	2

Map for Barrier ID: AX420222



601 +34.162533, -118.094793

Photos for Barrier ID: AX420222





Barrier ID: AX418719

Pasadena High School BUILDING T

Assembly	Basketball Court
Type	Bleacher Seating
ADA Standard	221.2.1.4; 802.1
Barrier Detail	A wheelchair space is not provided or is not compliant at the bleacher seating.
Location Description	Building T - T101 Girls Gymnasium
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

84 seats and 2 wheelchair spaces are provided per side. 84 seats requires 4 wheel chair spaces. 2 additional wheelchair spaces are required per side, (4 total).

Resolution

Provide at least one wheelchair space at each bleachers for the basketball court. Provide wheelchair spaces at the bleacher seating to comply with the following table: Number of Seats/Minimum No. of Required Wheelchair Spaces; under 25 seats- 1 wheelchair space; 25 to 50 seats- 2 wheelchair spaces; 51 to 150 seats- 4 wheelchair spaces; 151 to 300 seats- 5 wheelchair spaces; 301 to 500 seats-6 wheelchair spaces; 501 to 5000 seats- 6 wheelchair spaces, plus 1 for each 150, or fraction thereof, between 501 through 5000; 5001 and over seats-36 wheelchair spaces, plus 1 for each 200, or fraction thereof, over 5000. Wheelchair spaces shall not have slopes steeper than 1:48. A single wheelchair space shall be 36" wide minimum. Where two or more wheelchair spaces are provided, each wheelchair space shall be 33" wide minimum. Where a wheelchair space can be entered from the front or rear, the wheelchair space shall be 48" deep minimum. Where a wheelchair space can be entered only from the side, the wheelchair space shall be 60" deep minimum. Each wheelchair space shall adjoin an accessible route. Accessible routes shall not overlap wheelchair spaces, and access to any wheelchair space cannot be through another wheelchair space. Wheelchair spaces shall not overlap circulation paths, which are aisle width required by building or safety codes. Where a circulation path provided is wider than the required aisle width, the wheelchair space may intrude into that portion of the circulation path that is provided in excess of the required aisle width. The wheelchair space shall provide lines of sight to the ball play area.


Quantity


48 SF


Priority	2

Photos for Barrier ID: AX418719



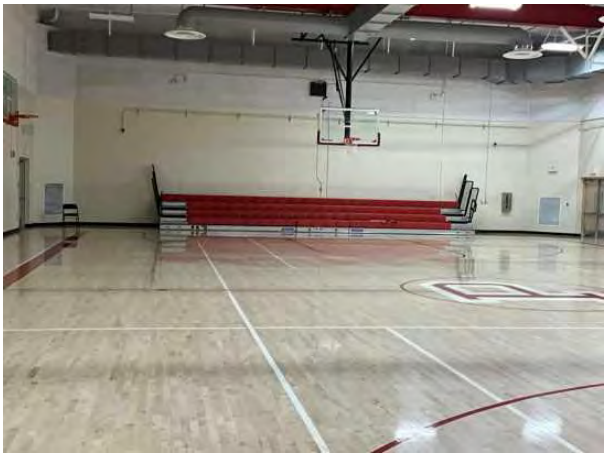

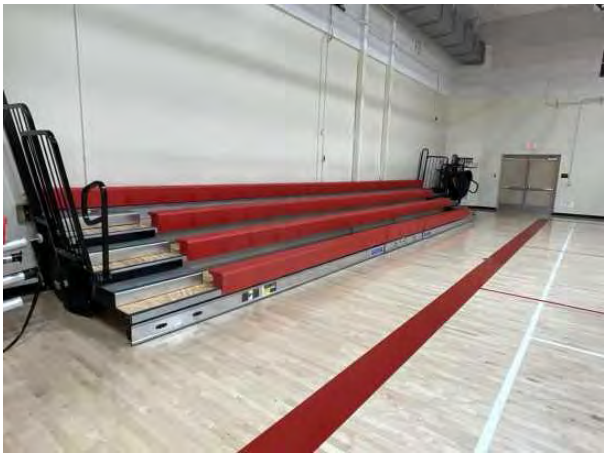

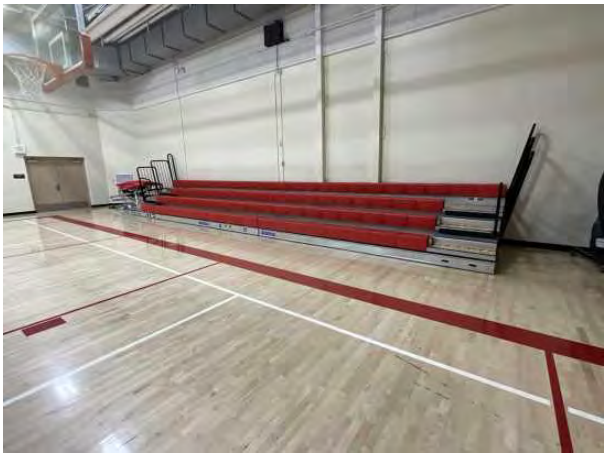

Barrier ID: AX424525

Pasadena High School SPORTS FACILITIES

Assembly	Baseball/Softball Field
Type	Bleacher Seating
ADA Standard	221; 802.2; 802.3

Barrier Detail

The required number of wheelchair spaces is not provided at the bleacher seating for the ball field.

Location Description	Football Field Bleachers
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The bleachers does not provide accessible wheelchair spaces. 5 wheelchair spaces are required.

Resolution


Provide wheelchair spaces at the bleacher seating to comply with the following table: Number of Seats/Minimum No. of Required Wheelchair Spaces; under 25 seats- 1 wheelchair space; 25 to 50 seats- 2 wheelchair spaces; 51 to 150 seats- 4 wheelchair spaces; 151 to 300 seats- 5 wheelchair spaces; 301 to 500 seats-6 wheelchair spaces; 501 to 5000 seats- 6 wheelchair spaces, plus 1 for each 150, or fraction thereof, between 501 through 5000; 5001 and over seats-36 wheelchair spaces, plus 1 for each 200, or fraction thereof, over 5000. Wheelchair spaces shall not have slopes steeper than 1:48. A single wheelchair space shall be 36" wide minimum. Where two or more wheelchair spaces are provided, each wheelchair space shall be 33" wide minimum. Where a wheelchair space can be entered from the front or rear, the wheelchair space shall be 48" deep minimum. Where a wheelchair space can be entered only from the side, the wheelchair space shall be 60" deep minimum. Each wheelchair space shall adjoin an accessible route. Accessible routes shall not overlap wheelchair spaces, and access to any wheelchair space cannot be through another wheelchair space. Wheelchair spaces shall not overlap circulation paths, which are aisle width required by building or safety codes. Where a circulation path provided is wider than the required aisle width, the wheelchair space may intrude into that portion of the circulation path that is provided in excess of the required aisle width. The wheelchair space shall provide lines of sight to the field play area. In bleacher seating, wheelchair spaces shall not be required to be provided in rows other than rows at points of entry to bleacher seating. At least one companion seat shall be located at each required wheelchair seat. Companion seats must be located to provide shoulder alignment with adjacent wheelchair spaces. The shoulder alignment point of the wheelchair space shall be measured 36" from the front of the wheelchair space. The floor surface of the companion seat shall be at the same elevations as the floor surface of the wheelchair space.

Quantity

100 SF

Priority	2

Map for Barrier ID: AX424525

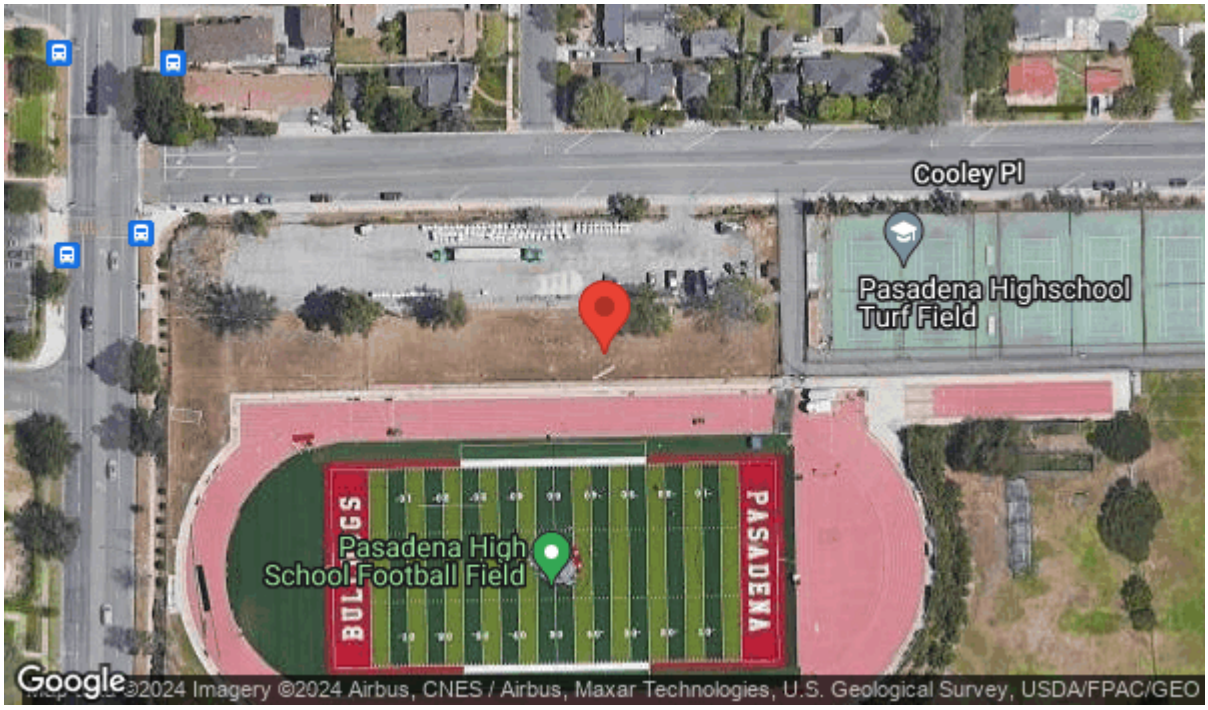

771 +34.162572, -118.097075

Photos for Barrier ID: AX424525





Barrier ID: AX418274

Pasadena High School BUILDING G

Assembly	Interior Access Route
Type	Controls And Dispensers
ADA Standard	UFAS 4.27.4
Barrier Detail	Controls or operating mechanisms are not compliant.
Location Description	Building G - G 109
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The timer switch requires twisting of the wrist to operate.

Resolution

Provide controls and operating mechanisms that are operable with one hand and not require tight grasping, pinching or twisting of the wrist. Controls and operating mechanisms shall not require more than 5#s of pressure to operate.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418274





Barrier ID: AX419832

Pasadena High School SPORTS FACILITIES

Assembly	Common Areas
Type	Dining And Work Surface
ADA Standard	226.1

Barrier Detail

A minimum of 5% ADA compliant dining seating and standing spaces are not provided.

Location Description	Baseball Field Concession Stand Area
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The bar style counters are 36 1/4 inches above the floor. No accessible dining tables are provided in the area.

Resolution


Provide a minimum of 5% ADA compliant seating and standing spaces. At least one dining table must be compliant. The height of a dining table shall be minimum 28" and maximum 34". Provide a wheelchair space at the table with knee and toe clearance. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25 inches maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX419832

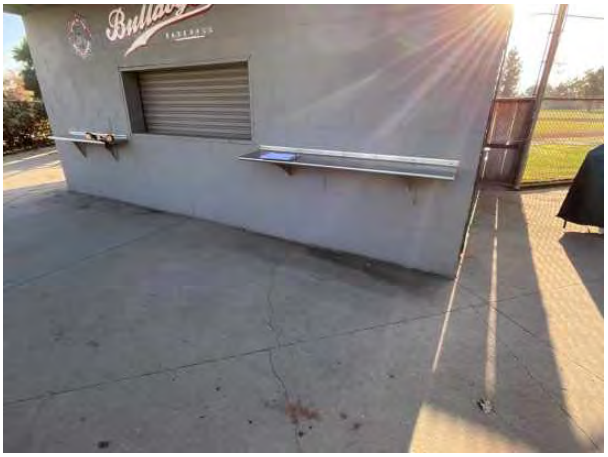



Barrier ID: AX424463

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Door
ADA Standard	CBC Chap 11B-306, 904.4

Barrier Detail

CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.

Location Description	Building A - A111 Counseling Office
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The counseling sign-in sheet and counter is 41 inches above the floor.

Resolution

Provide either a compliant parallel or a compliant forward approach to the counter. For a parallel approach, a portion of service counter must be 36" minimum long and 34" maximum above finished floor. Clear space of minimum 30" wide and minimum 48" long shall be located adjacent to the compliant portion of the counter, and oriented for a parallel approach, with the 48" dimension adjacent to the compliant portion. [EXCEPTION: Where the provided counter surface is less then 36" long, the entire counter surface shall be 34" high maximum above the finish floor.] For a forward approach, a portion of the service counter must be 36" long and 34" high maximum, with knee and toe clearance. Knee and toe clearance shall be provided for a forward approach. Clear floor space minimum 30" wide and minimum 48" long shall be provided on the compliant portion of the counter, and oriented for a forward approach. Clear space at the counter shall be maximum 2.08% in all directions and a firm and stable surface. Knee clearance shall be the space under an element between 9" and 27" above the finish floor or ground. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element .Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

3 LF

Priority	2

Photos for Barrier ID: AX424463









Barrier ID: AX419806

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.10

Barrier Detail

The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.

Location Description	Building B - B110 Girls Dressing
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

5 doors within the girls dressing area have door with smooth surface extending 9 1/4 inch high.

Resolution

Modify or replace the door to provide a smooth surface on the door within 10 inches of the finish floor or ground for the full width of the door on the push side. Parts creating horizontal or vertical joints in these surfaces shall be within 1/16 inch of the same plane as the other and be free of sharp or abrasive edges. Cavities created by added kick plates shall be capped.Swinging door and gate surfaces within 10 inches of the finish floor or ground measured vertically shall have a smooth surface on the push side extending the full width of the door or gate. Parts creating horizontal or vertical joints in these surfaces shall be within 1/16 inch of the same plane as the other. Cavities created by added kick plates shall be capped. [EXCEPTIONS: 1. Sliding doors shall not be required to comply. 2. Tempered glass doors without stiles and having a bottom rail or shoe with the top leading edge tapered at 60 degrees minimum from the horizontal shall not be required to meet the 10 inch bottom smooth surface height requirement. 3. Doors and gates that do not extend to within 10 inches of the finish floor or ground shall not be required to comply. 4. Existing doors and gates without smooth surfaces within 10 inches of the finish floor or ground shall not be required to provide smooth surfaces provided that if added kick plates are installed, cavities created by such kick plates are capped.]


Quantity


5 EA

Priority	2

Photos for Barrier ID: AX419806



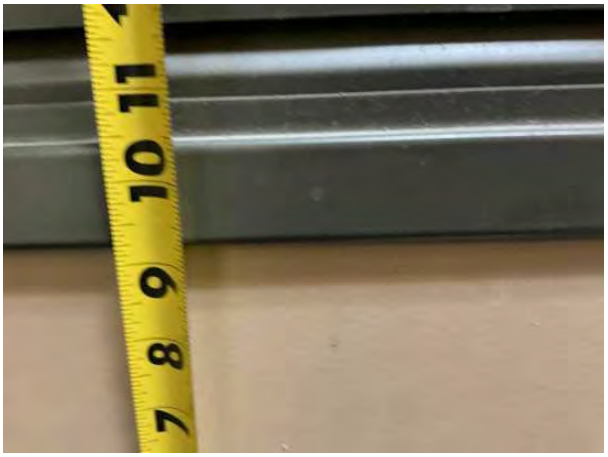

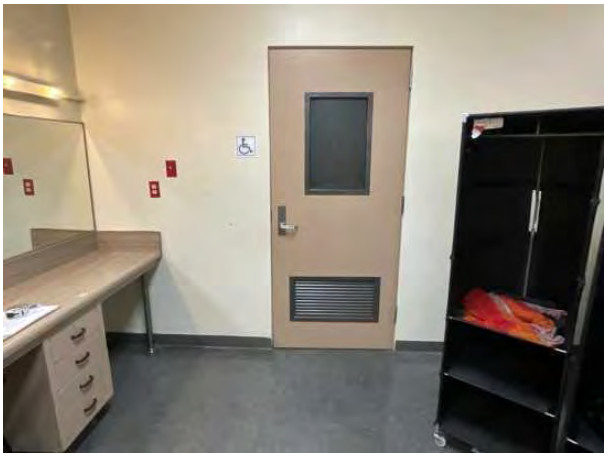



Barrier ID: AX419814

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Door
ADA Standard	521 CMR 33.7

Barrier Detail

MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.

Location Description	Building B - B110 Girls Dressing
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The dressing room does not provide the correct mirror dimensions

Resolution

Provide a compliant mirror in the dressing room/ fitting room/ changing room/ locker room.. Where mirrors are provided in dressing rooms, fitting rooms, changing rooms or locker rooms the mirror, a full-length mirror measuring at least 18" wide by 54" high shall be mounted 18" above the finish floor, in a position affording a view to a person on the bench as well as to a person in a standing position.

Quantity


1 EA

Priority	2


Photos for Barrier ID: AX419814





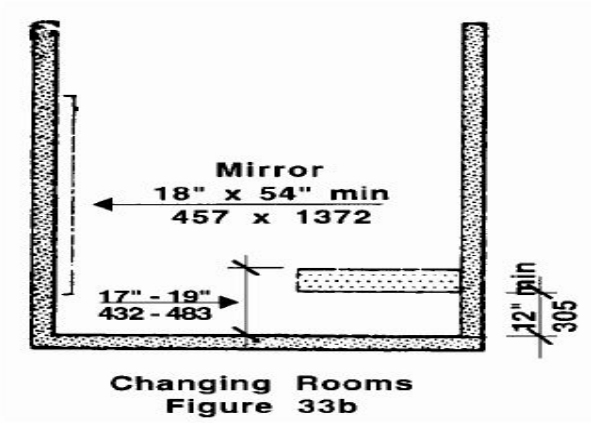

Changing Rooms
Figure 33b

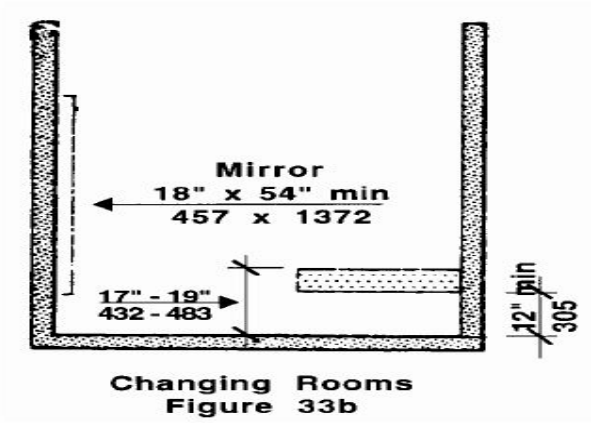

Changing Rooms
Figure 33b

Barrier ID: AX419828

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.10

Barrier Detail

The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.

Location Description	Building B - E101
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The door bottom smooth surface extends 9 5/8 inches above the floor.

Resolution

Modify or replace the door to provide a smooth surface on the door within 10 inches of the finish floor or ground for the full width of the door on the push side. Parts creating horizontal or vertical joints in these surfaces shall be within 1/16 inch of the same plane as the other and be free of sharp or abrasive edges. Cavities created by added kick plates shall be capped.Swinging door and gate surfaces within 10 inches of the finish floor or ground measured vertically shall have a smooth surface on the push side extending the full width of the door or gate. Parts creating horizontal or vertical joints in these surfaces shall be within 1/16 inch of the same plane as the other. Cavities created by added kick plates shall be capped. [EXCEPTIONS: 1. Sliding doors shall not be required to comply. 2. Tempered glass doors without stiles and having a bottom rail or shoe with the top leading edge tapered at 60 degrees minimum from the horizontal shall not be required to meet the 10 inch bottom smooth surface height requirement. 3. Doors and gates that do not extend to within 10 inches of the finish floor or ground shall not be required to comply. 4. Existing doors and gates without smooth surfaces within 10 inches of the finish floor or ground shall not be required to provide smooth surfaces provided that if added kick plates are installed, cavities created by such kick plates are capped.]


Quantity

1 EA

Priority	2

Photos for Barrier ID: AX419828



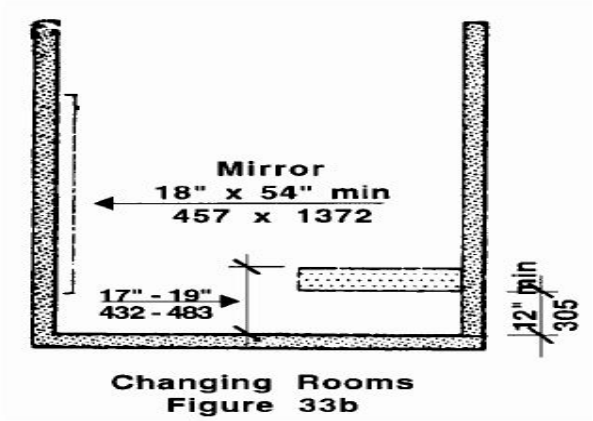

Changing Rooms
Figure 33b



Barrier ID: AX419825

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.10

Barrier Detail

The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.

Location Description	Building E - E105B
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The door bottom smooth surface extends 9 1/2 inches above the floor.

Resolution


Modify or replace the door to provide a smooth surface on the door within 10 inches of the finish floor or ground for the full width of the door on the push side. Parts creating horizontal or vertical joints in these surfaces shall be within 1/16 inch of the same plane as the other and be free of sharp or abrasive edges. Cavities created by added kick plates shall be capped.Swinging door and gate surfaces within 10 inches of the finish floor or ground measured vertically shall have a smooth surface on the push side extending the full width of the door or gate. Parts creating horizontal or vertical joints in these surfaces shall be within 1/16 inch of the same plane as the other. Cavities created by added kick plates shall be capped. [EXCEPTIONS: 1. Sliding doors shall not be required to comply. 2. Tempered glass doors without stiles and having a bottom rail or shoe with the top leading edge tapered at 60 degrees minimum from the horizontal shall not be required to meet the 10 inch bottom smooth surface height requirement. 3. Doors and gates that do not extend to within 10 inches of the finish floor or ground shall not be required to comply. 4. Existing doors and gates without smooth surfaces within 10 inches of the finish floor or ground shall not be required to provide smooth surfaces provided that if added kick plates are installed, cavities created by such kick plates are capped.]

Quantity

1 EA


Priority	2

Photos for Barrier ID: AX419825

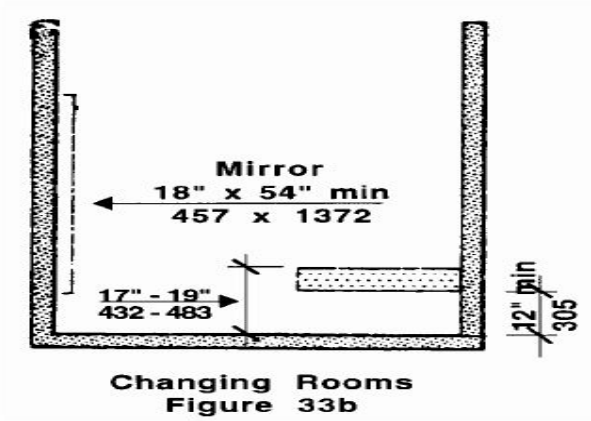

Changing Rooms
Figure 33b



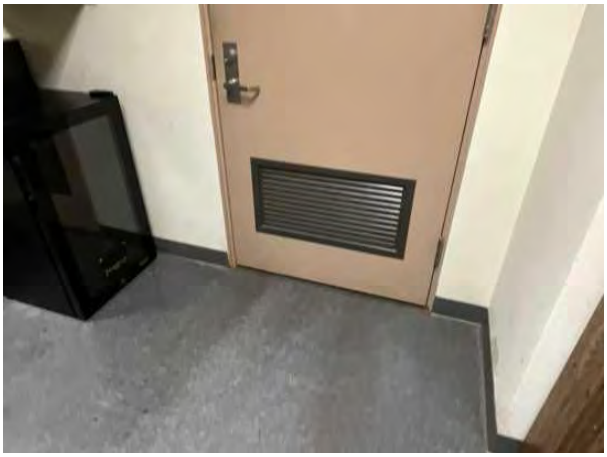

Barrier ID: AX418314

Pasadena High School BUILDING F

Assembly	Interior Access Route
Type	Door
ADA Standard	521 CMR 33.7

Barrier Detail

MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.

Location Description	Building F - F100 A Boys Dressing Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The boys dressing room does not provide a bench and a full size mirror.

Resolution


Provide a compliant mirror in the dressing room/ fitting room/ changing room/ locker room.. Where mirrors are provided in dressing rooms, fitting rooms, changing rooms or locker rooms the mirror, a full-length mirror measuring at least 18" wide by 54" high shall be mounted 18" above the finish floor, in a position affording a view to a person on the bench as well as to a person in a standing position.

Quantity

1 EA


Priority	2

Photos for Barrier ID: AX418314

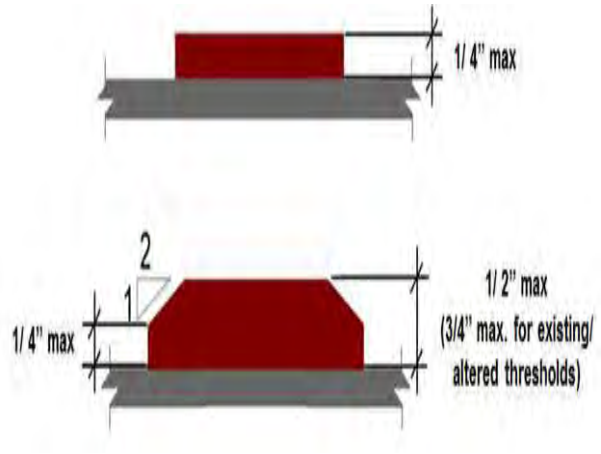





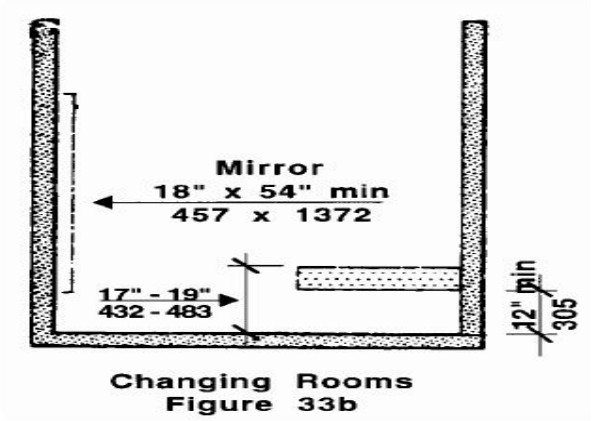



Barrier ID: AX418690

Pasadena High School BUILDING W

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.10

Barrier Detail

The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.

Location Description	Building W - W103 Student Store
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The door has a doorstop within the required 10 inch high clear, smooth space.

Resolution

Modify or replace the door to provide a smooth surface on the door within 10 inches of the finish floor or ground for the full width of the door on the push side. Parts creating horizontal or vertical joints in these surfaces shall be within 1/16 inch of the same plane as the other and be free of sharp or abrasive edges. Cavities created by added kick plates shall be capped.Swinging door and gate surfaces within 10 inches of the finish floor or ground measured vertically shall have a smooth surface on the push side extending the full width of the door or gate. Parts creating horizontal or vertical joints in these surfaces shall be within 1/16 inch of the same plane as the other. Cavities created by added kick plates shall be capped. [EXCEPTIONS: 1. Sliding doors shall not be required to comply. 2. Tempered glass doors without stiles and having a bottom rail or shoe with the top leading edge tapered at 60 degrees minimum from the horizontal shall not be required to meet the 10 inch bottom smooth surface height requirement. 3. Doors and gates that do not extend to within 10 inches of the finish floor or ground shall not be required to comply. 4. Existing doors and gates without smooth surfaces within 10 inches of the finish floor or ground shall not be required to provide smooth surfaces provided that if added kick plates are installed, cavities created by such kick plates are capped.]


Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418690



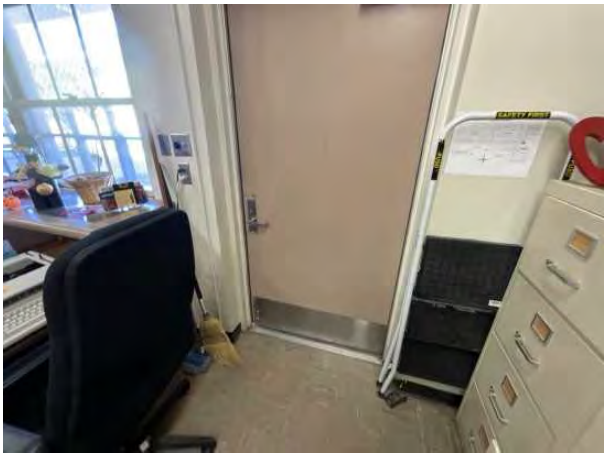

Barrier ID: AX418238

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.11
Barrier Detail	The bottom of the door vision light is higher than 43" and less than 66".
Location Description	Typical Doors With High Vision Panels
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Typical throughout the campus, many doors have vision panels where the bottom edge is 48 3/4 inches above the floor and higher. Building A has 26 doors. Building B has 29 doors. Building C has 13 doors. Building D has 3 doors. Building E has 5 doors. Building H has 8 doors. Building I has 4 doors. Building Q has 2 doors. Building V has 2 doors.

Resolution

Provide a door with the bottom of at least one of the glazing panels located 43" maximum above the finish floor or grade. At least one of the glazing panels shall be located for viewing through the panels, if the panel is designed for viewing. [EXCEPTION: Vision lights with the lowest part more than 66" from the finish floor or ground are not required to comply.]

Quantity


92 EA


Priority	2

Photos for Barrier ID: AX418238





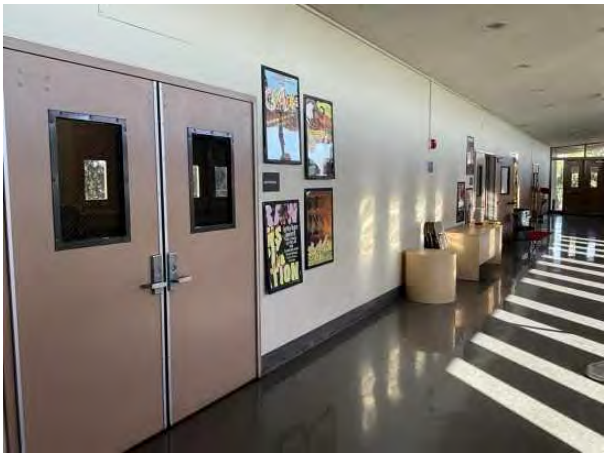

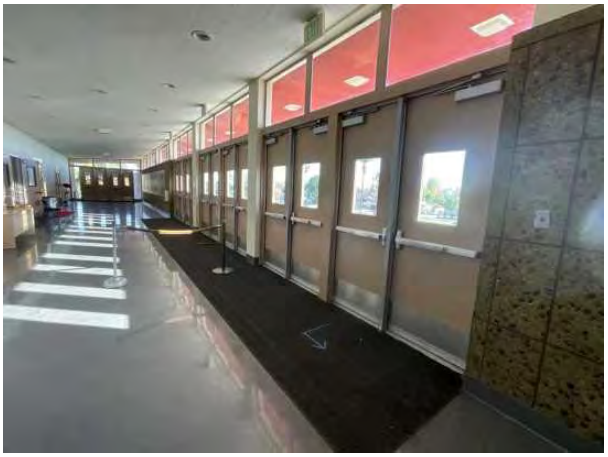

Barrier ID: AX424386

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	CBC Chap 11B-306, 904.4

Barrier Detail

CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.

Location Description	Building A - A108 Principle
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The receptionist desk counter is 41 inches above the floor.

Resolution

Provide either a compliant parallel or a compliant forward approach to the counter. For a parallel approach, a portion of service counter must be 36" minimum long and 34" maximum above finished floor. Clear space of minimum 30" wide and minimum 48" long shall be located adjacent to the compliant portion of the counter, and oriented for a parallel approach, with the 48" dimension adjacent to the compliant portion. [EXCEPTION: Where the provided counter surface is less then 36" long, the entire counter surface shall be 34" high maximum above the finish floor.] For a forward approach, a portion of the service counter must be 36" long and 34" high maximum, with knee and toe clearance. Knee and toe clearance shall be provided for a forward approach. Clear floor space minimum 30" wide and minimum 48" long shall be provided on the compliant portion of the counter, and oriented for a forward approach. Clear space at the counter shall be maximum 2.08% in all directions and a firm and stable surface. Knee clearance shall be the space under an element between 9" and 27" above the finish floor or ground. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element .Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.


Quantity

3 LF

Priority	2

Photos for Barrier ID: AX424386



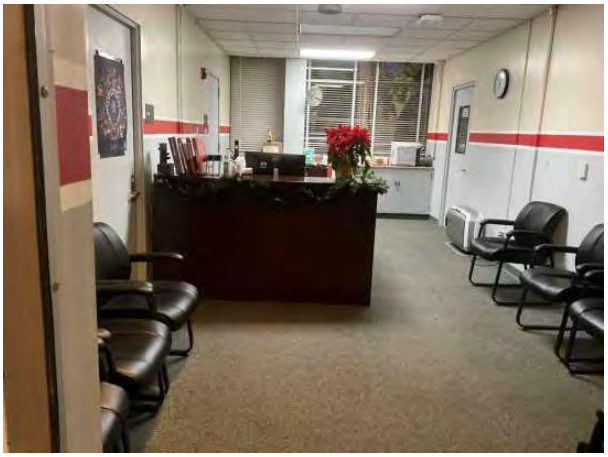

Barrier ID: AX424434

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Elevator
ADA Standard	CBC Chap 11B-407.2.1.2
Barrier Detail	CALIFORNIA: The hall call buttons are not compliant.
Location Description	Building A - Elevator
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The elevator hall, call button is not internally illuminated for the entire surface.

Resolution

Remove and replace with call buttons that have square shoulders, and are a minimum of 3/4" in the smallest dimension. Call buttons shall be raised a minimum of 1/8" plus or minus 1/16" above the surrounding surface. The buttons shall be activated by a mechanical motion that is detectable. Call buttons shall have visible signals that will activate when each call is registered and will extinguish when each call is answered. Call buttons shall be internally illuminated with a white light over the entire surface of the button.[Exception: Destination-oriented elevators are not required to comply with the visible illumination requirement if the elevator has compliant visible and audible signals indicating which elevator car to enter.] The call button that designates the up direction shall be located above the call button that designates the down direction. [Exception: Destination-oriented elevators not required to comply with the up-down button location.] Call buttons shall be located within a compliant reach range. Clear space minimum 36" by minimum 48" shall be provided at the call controls.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX424434





Barrier ID: AX424510

Pasadena High School GENERAL EXTERIOR

Assembly	Interior Access Route
Type	Elevator
ADA Standard	CBC Chap 11B-407.2.1.2
Barrier Detail	CALIFORNIA: The hall call buttons are not compliant.
Location Description	Elevator 1
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The hall call button does not illuminate for the entire surface.

Resolution


Remove and replace with call buttons that have square shoulders, and are a minimum of 3/4" in the smallest dimension. Call buttons shall be raised a minimum of 1/8" plus or minus 1/16" above the surrounding surface. The buttons shall be activated by a mechanical motion that is detectable. Call buttons shall have visible signals that will activate when each call is registered and will extinguish when each call is answered. Call buttons shall be internally illuminated with a white light over the entire surface of the button.[Exception: Destination-oriented elevators are not required to comply with the visible illumination requirement if the elevator has compliant visible and audible signals indicating which elevator car to enter.] The call button that designates the up direction shall be located above the call button that designates the down direction. [Exception: Destination-oriented elevators not required to comply with the up-down button location.] Call buttons shall be located within a compliant reach range. Clear space minimum 36" by minimum 48" shall be provided at the call controls.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX424510

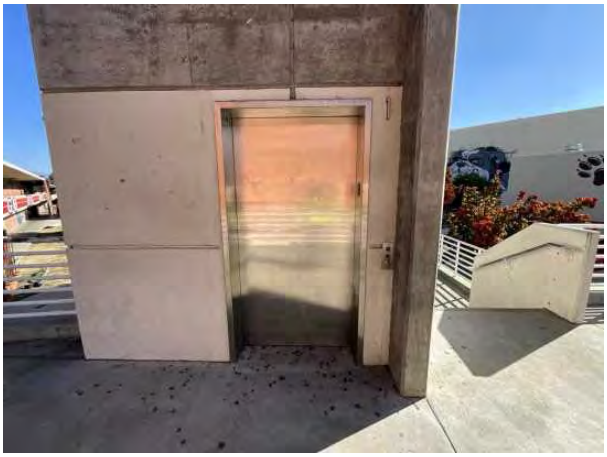



Barrier ID: AX424506

Pasadena High School GENERAL EXTERIOR

Assembly	Interior Access Route
Type	Elevator
ADA Standard	CBC Chap 11B-407.2.1.2
Barrier Detail	CALIFORNIA: The hall call buttons are not compliant.
Location Description	Elevator Near Building G
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The hall call button does not illuminate for the entire surface.

Resolution

Remove and replace with call buttons that have square shoulders, and are a minimum of 3/4" in the smallest dimension. Call buttons shall be raised a minimum of 1/8" plus or minus 1/16" above the surrounding surface. The buttons shall be activated by a mechanical motion that is detectable. Call buttons shall have visible signals that will activate when each call is registered and will extinguish when each call is answered. Call buttons shall be internally illuminated with a white light over the entire surface of the button.[Exception: Destination-oriented elevators are not required to comply with the visible illumination requirement if the elevator has compliant visible and audible signals indicating which elevator car to enter.] The call button that designates the up direction shall be located above the call button that designates the down direction. [Exception: Destination-oriented elevators not required to comply with the up-down button location.] Call buttons shall be located within a compliant reach range. Clear space minimum 36" by minimum 48" shall be provided at the call controls.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX424506







Barrier ID: AX418687

Pasadena High School BUILDING W

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	CBC Chap 11B-306, 904.4

Barrier Detail

CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.

Location Description	Service Windows at Building W
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The service window counters are 41 1/2 inches above the ground.

Resolution


Provide either a compliant parallel or a compliant forward approach to the counter. For a parallel approach, a portion of service counter must be 36" minimum long and 34" maximum above finished floor. Clear space of minimum 30" wide and minimum 48" long shall be located adjacent to the compliant portion of the counter, and oriented for a parallel approach, with the 48" dimension adjacent to the compliant portion. [EXCEPTION: Where the provided counter surface is less then 36" long, the entire counter surface shall be 34" high maximum above the finish floor.] For a forward approach, a portion of the service counter must be 36" long and 34" high maximum, with knee and toe clearance. Knee and toe clearance shall be provided for a forward approach. Clear floor space minimum 30" wide and minimum 48" long shall be provided on the compliant portion of the counter, and oriented for a forward approach. Clear space at the counter shall be maximum 2.08% in all directions and a firm and stable surface. Knee clearance shall be the space under an element between 9" and 27" above the finish floor or ground. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element .Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

18 LF

Priority	2

Map for Barrier ID: AX418687

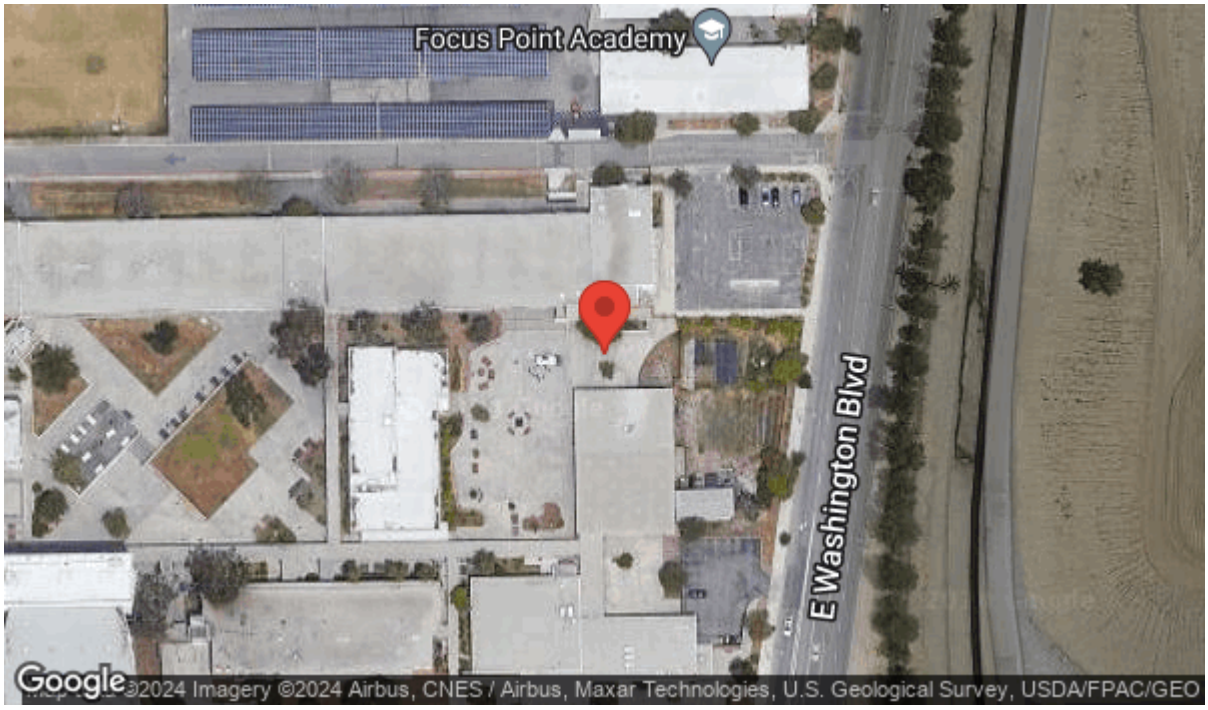

257 +34.162754, -118.090676

Photos for Barrier ID: AX418687









Barrier ID: AX420219

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Gate
ADA Standard	404.2.10
Barrier Detail	The gate does not have a smooth surface within 10" of the ground.
Location Description	Typical Gates to Athletic Areas
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	Both entry gates do not provide a bottom 10 inch smooth surface.

Resolution

Provide a swinging gate with a smooth surface within 10" of the ground, measured vertically on the push side of the gate and extending the full width of the gate. Parts creating horizontal or vertical joints in the surfaces shall be within 1/16" of the same plane as the other. Cavities created by adding kick plates shall be capped.

Quantity

10 EA

Priority	2

Map for Barrier ID: AX420219




598 +34.162141, -118.093950


Photos for Barrier ID: AX420219







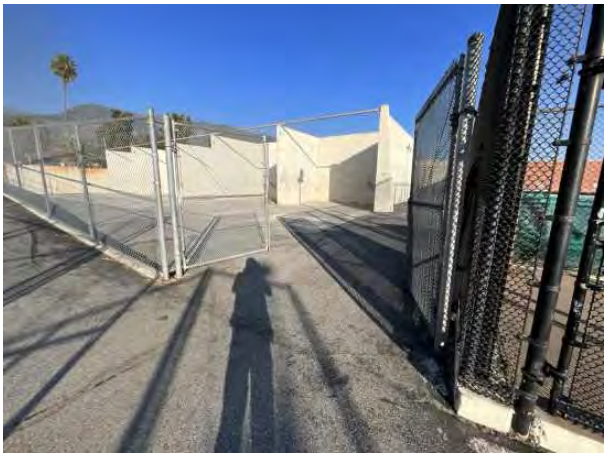

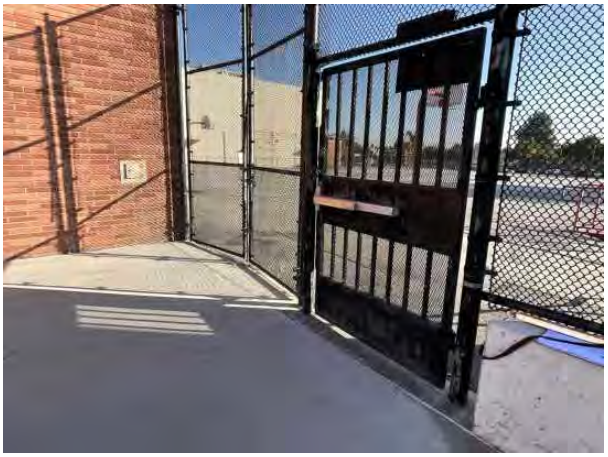



Barrier ID: AX424437

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Interior Access Route
ADA Standard	CBC Chap 11B-306, 904.4

Barrier Detail

CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.

Location Description	Building A - 101 Nurse
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The low counter does not appear to be in use, and the high counter is 44 inches above the floor.

Resolution


Provide either a compliant parallel or a compliant forward approach to the counter. For a parallel approach, a portion of service counter must be 36" minimum long and 34" maximum above finished floor. Clear space of minimum 30" wide and minimum 48" long shall be located adjacent to the compliant portion of the counter, and oriented for a parallel approach, with the 48" dimension adjacent to the compliant portion. [EXCEPTION: Where the provided counter surface is less then 36" long, the entire counter surface shall be 34" high maximum above the finish floor.] For a forward approach, a portion of the service counter must be 36" long and 34" high maximum, with knee and toe clearance. Knee and toe clearance shall be provided for a forward approach. Clear floor space minimum 30" wide and minimum 48" long shall be provided on the compliant portion of the counter, and oriented for a forward approach. Clear space at the counter shall be maximum 2.08% in all directions and a firm and stable surface. Knee clearance shall be the space under an element between 9" and 27" above the finish floor or ground. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element .Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity


3 LF

Priority	2

Photos for Barrier ID: AX424437

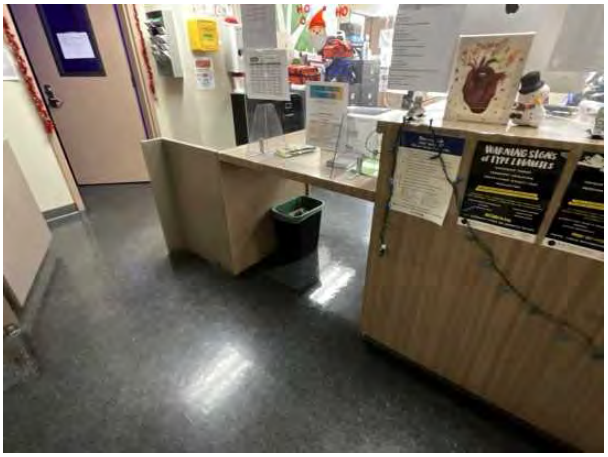



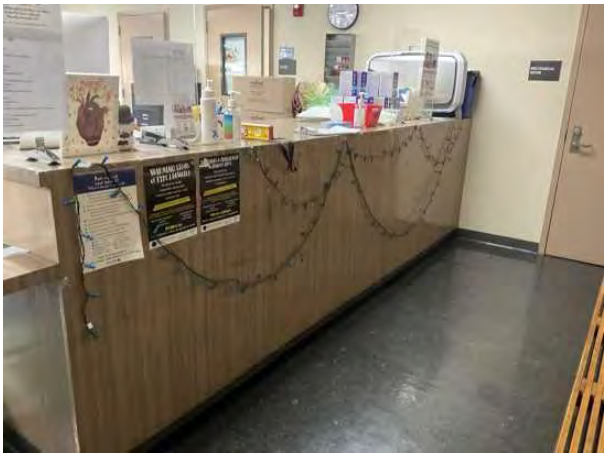

Barrier ID: AX424461

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Interior Access Route
ADA Standard	CBC Chap 11B-306, 904.4

Barrier Detail

CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.

Location Description	Building A - A102 Administration
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The service counter is 36 1/2 inches above the floor.

Resolution


Provide either a compliant parallel or a compliant forward approach to the counter. For a parallel approach, a portion of service counter must be 36" minimum long and 34" maximum above finished floor. Clear space of minimum 30" wide and minimum 48" long shall be located adjacent to the compliant portion of the counter, and oriented for a parallel approach, with the 48" dimension adjacent to the compliant portion. [EXCEPTION: Where the provided counter surface is less then 36" long, the entire counter surface shall be 34" high maximum above the finish floor.] For a forward approach, a portion of the service counter must be 36" long and 34" high maximum, with knee and toe clearance. Knee and toe clearance shall be provided for a forward approach. Clear floor space minimum 30" wide and minimum 48" long shall be provided on the compliant portion of the counter, and oriented for a forward approach. Clear space at the counter shall be maximum 2.08% in all directions and a firm and stable surface. Knee clearance shall be the space under an element between 9" and 27" above the finish floor or ground. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element .Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

3 LF

Priority	2

Photos for Barrier ID: AX424461

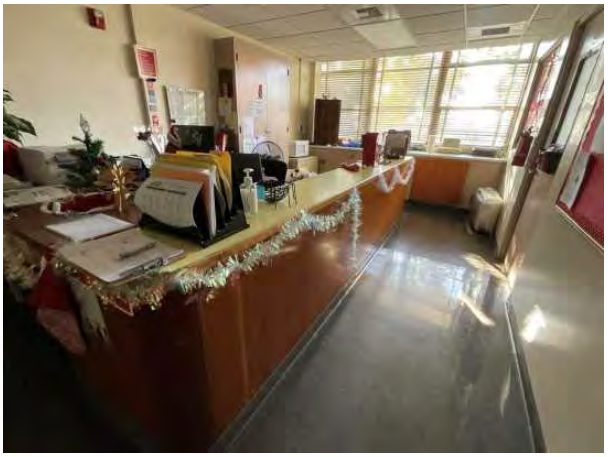



Barrier ID: AX424462

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Interior Access Route
ADA Standard	CBC Chap 11B-306, 902
Barrier Detail	CALIFORNIA: The dining or work surface is not compliant.
Location Description	Building A - A103 Reception
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The visitor check-in computer is on a 42 inch high counter.

Resolution


Install a dining or work surface minimum 28" to maximum 34" height with clear space and compliant knee and toe clearance for a forward approach. Where food or drink is served for consumption at a counter exceeding 34 inches in height, a portion of the main counter 60 inches minimum in length shall be provided in compliance. Dining surfaces required to comply shall be dispersed throughout the space or facility containing dining surfaces for each type of seating in a functional area. Work surfaces required to comply shall be dispersed throughout the space or facility containing work surfaces. Where dining surfaces are provided for the consumption of food or drink, at least 5 percent of the seating spaces and standing spaces at the dining surfaces shall comply. Where work surfaces are provided for use by other than employees, at least 5 percent shall comply. [EXCEPTIONS: 1. Sales counters and service counters shall not be required to comply. 2. Check writing surfaces provided at check-out aisles not required to be accessible shall not be required to comply.] Clear space shall be maximum 1:48 (2.08%) in all directions and a firm and stable surface. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25 inches maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground. At dining and work surfaces required to be accessible, knee clearance shall extend 19 inches deep minimum at 27 inches above the finish floor or ground. The knee clearance shall not be reduced at built-in dining and work surfaces required to be accessible. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum. The toe clearance shall extend 19 inches minimum under built-in dining and work surfaces required to be accessible.

Quantity

3 LF

Priority	2

Photos for Barrier ID: AX424462

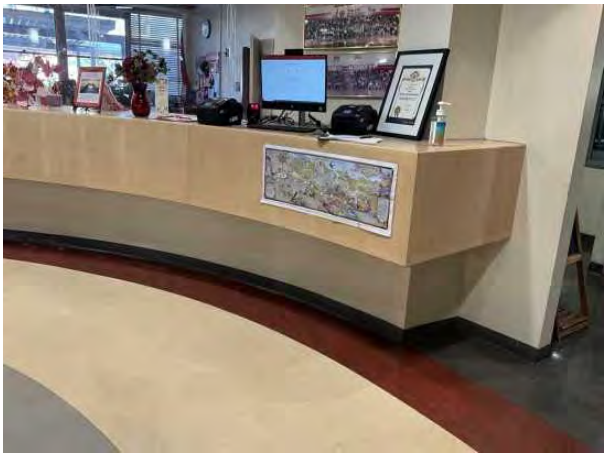

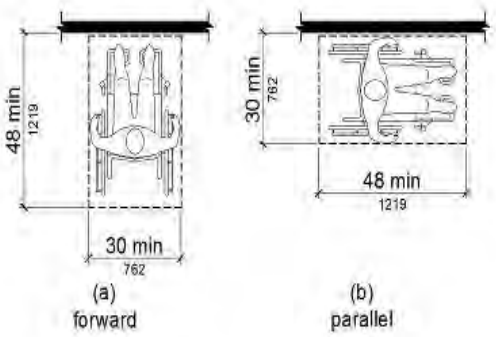


Figure *11B*-305.5
Position of Clear Floor or Ground Space



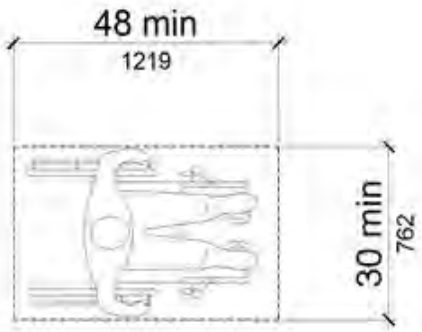


Figure *11B*-305.3
Clear Floor or Ground Space

Barrier ID: AX419859

Pasadena High School BUILDING C

Assembly	Interior Access Route
Type	Interior Access Route
ADA Standard	521 CMR 33.7

Barrier Detail

MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.

Location Description	Building C - C101 D
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

A mirror is not provided in front of the bench which will afford a view while sitting on the bench.

Resolution


Provide a compliant mirror in the dressing room/ fitting room/ changing room/ locker room.. Where mirrors are provided in dressing rooms, fitting rooms, changing rooms or locker rooms the mirror, a full-length mirror measuring at least 18" wide by 54" high shall be mounted 18" above the finish floor, in a position affording a view to a person on the bench as well as to a person in a standing position.


Quantity

1 EA


Priority	2

Photos for Barrier ID: AX419859

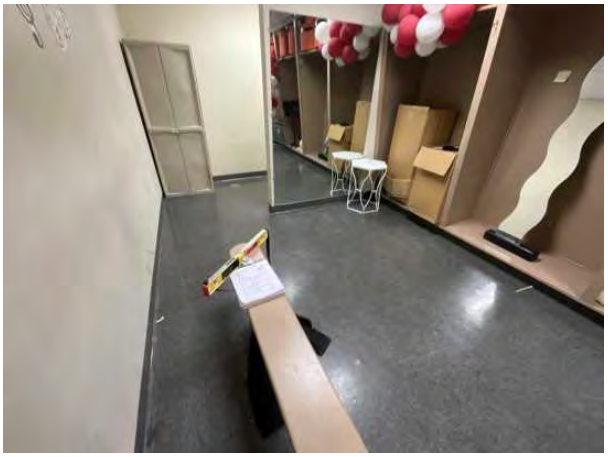

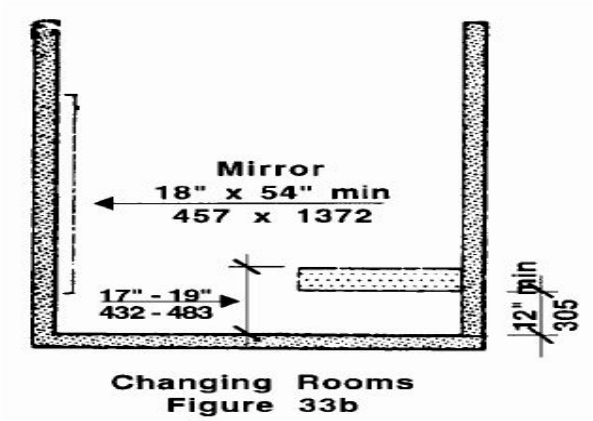

Changing Rooms
Figure 33b

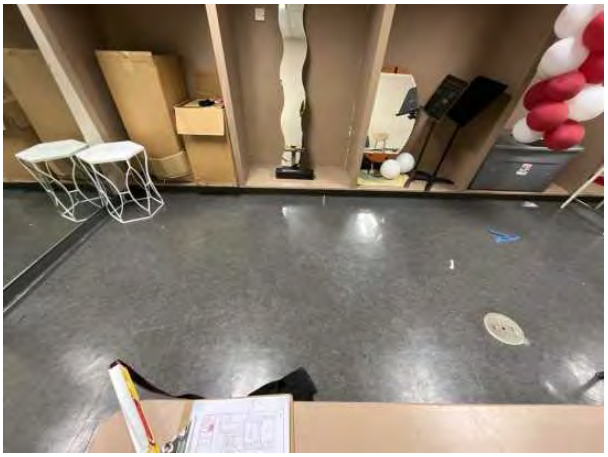

Barrier ID: AX418379

Pasadena High School BUILDING D

Assembly	Interior Access Route
Type	Interior Access Route
ADA Standard	CBC Chap 11B-306, 904.4

Barrier Detail

CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.

Location Description	Building D - D102 Textbook Room
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The service counter is 39 1/4 inches above the floor. The lowered counter does not appear to be used as a service counter.

Resolution


Provide either a compliant parallel or a compliant forward approach to the counter. For a parallel approach, a portion of service counter must be 36" minimum long and 34" maximum above finished floor. Clear space of minimum 30" wide and minimum 48" long shall be located adjacent to the compliant portion of the counter, and oriented for a parallel approach, with the 48" dimension adjacent to the compliant portion. [EXCEPTION: Where the provided counter surface is less then 36" long, the entire counter surface shall be 34" high maximum above the finish floor.] For a forward approach, a portion of the service counter must be 36" long and 34" high maximum, with knee and toe clearance. Knee and toe clearance shall be provided for a forward approach. Clear floor space minimum 30" wide and minimum 48" long shall be provided on the compliant portion of the counter, and oriented for a forward approach. Clear space at the counter shall be maximum 2.08% in all directions and a firm and stable surface. Knee clearance shall be the space under an element between 9" and 27" above the finish floor or ground. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element .Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

3 LF

Priority	2

Photos for Barrier ID: AX418379

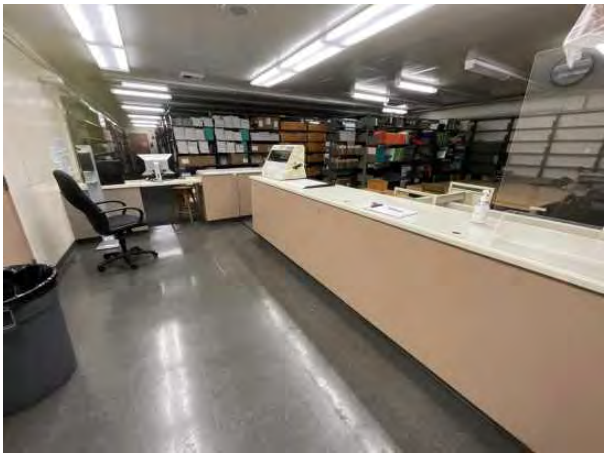



Barrier ID: AX418693

Pasadena High School BUILDING V

Assembly	Interior Access Route
Type	Interior Access Route
ADA Standard	904.5.2

Barrier Detail

Tray slides or buffet counters in food service lines are not 28" minimum and 34" maximum height above finish floor or ground.

Location Description	Building V- V104 Servery
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The tray slide furthest south is 34 1/4 inches above the floor.

Resolution

Modify buffet counters in food service lines to between 28" minimum and 34" maximum height above finish floor or ground.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418693





Barrier ID: AX418710

Pasadena High School BUILDING R

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	521 CMR 33.7

Barrier Detail

MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.

Location Description	Building R - R111B Team Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

A mirror affording a view while sitting on the bench is not provided at the accessible bench.

Resolution


Provide a compliant mirror in the dressing room/ fitting room/ changing room/ locker room.. Where mirrors are provided in dressing rooms, fitting rooms, changing rooms or locker rooms the mirror, a full-length mirror measuring at least 18" wide by 54" high shall be mounted 18" above the finish floor, in a position affording a view to a person on the bench as well as to a person in a standing position.


Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418710

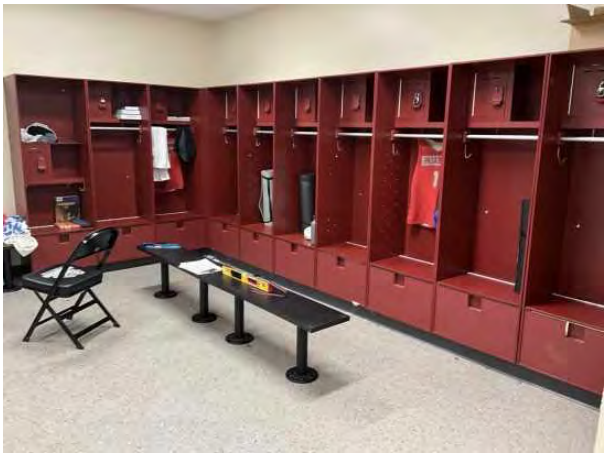

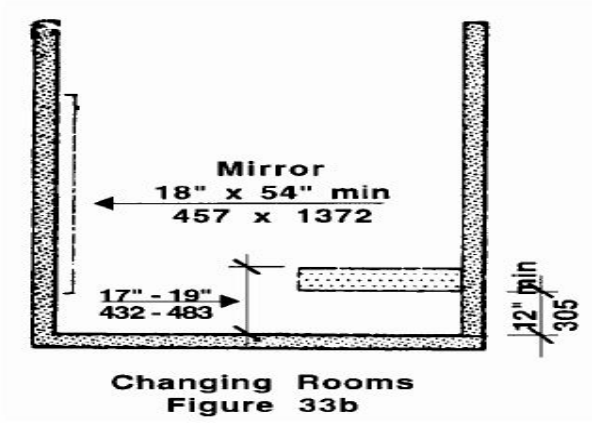

Changing Rooms
Figure 33b



Barrier ID: AX419890

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	521 CMR 33.7

Barrier Detail

MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.

Location Description	Building S - S109 Team Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The bench does not have a mirror affording a view while sitting at the bench.

Resolution


Provide a compliant mirror in the dressing room/ fitting room/ changing room/ locker room.. Where mirrors are provided in dressing rooms, fitting rooms, changing rooms or locker rooms the mirror, a full-length mirror measuring at least 18" wide by 54" high shall be mounted 18" above the finish floor, in a position affording a view to a person on the bench as well as to a person in a standing position.


Quantity

1 EA

Priority	2

Photos for Barrier ID: AX419890

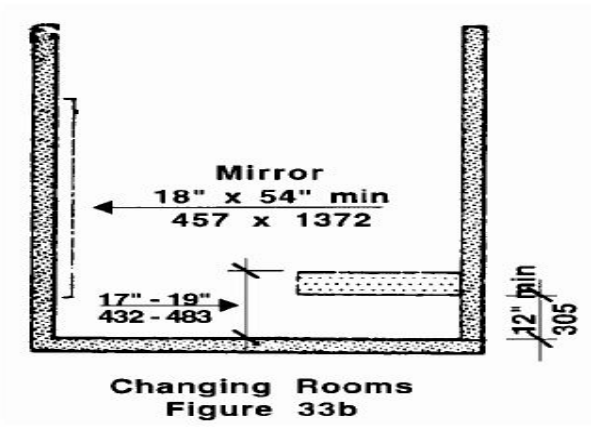

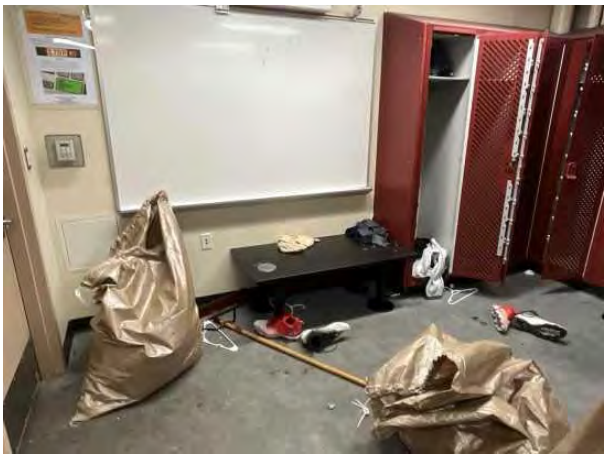

Barrier ID: AX419886

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	521 CMR 33.7

Barrier Detail

MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.

Location Description	Building S - S110 Team Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

A mirror is not provided at the accessible bench affording a view while sitting on the bench.

Resolution


Provide a compliant mirror in the dressing room/ fitting room/ changing room/ locker room.. Where mirrors are provided in dressing rooms, fitting rooms, changing rooms or locker rooms the mirror, a full-length mirror measuring at least 18" wide by 54" high shall be mounted 18" above the finish floor, in a position affording a view to a person on the bench as well as to a person in a standing position.


Quantity

1 EA


Priority	2

Photos for Barrier ID: AX419886

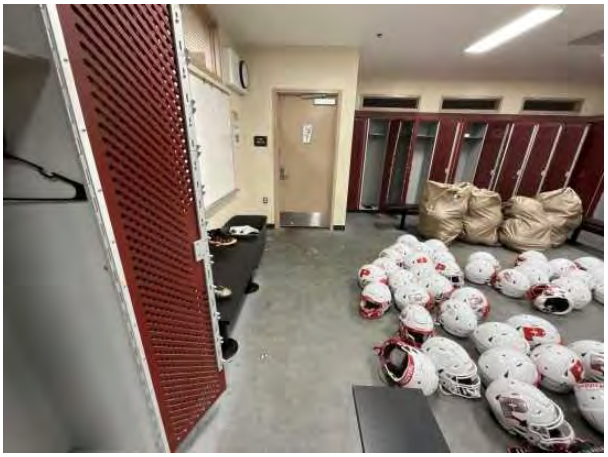

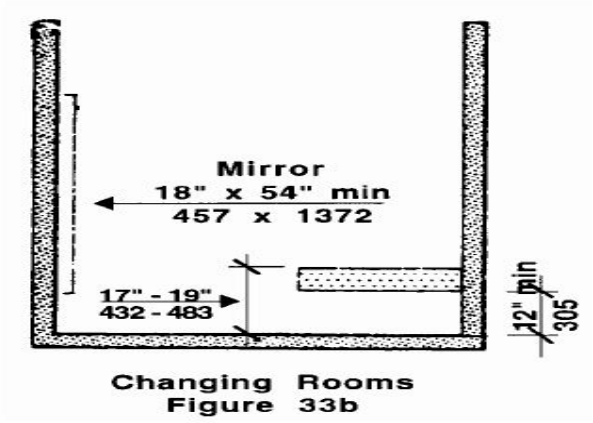

Changing Rooms
Figure 33b

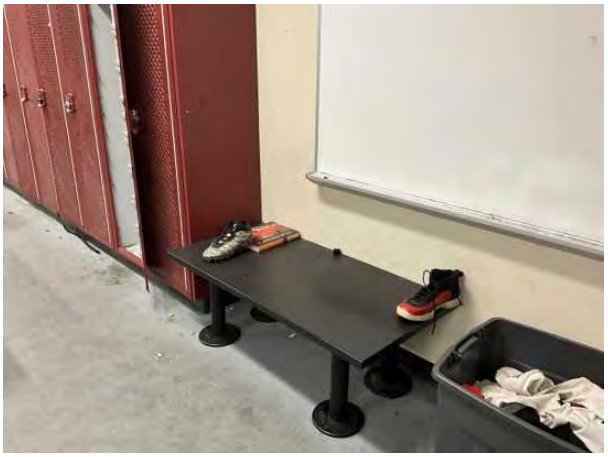

Barrier ID: AX419881

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	521 CMR 33.7

Barrier Detail

MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.

Location Description	Building S - S112 Boys Locker Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

4 accessible benches are provided and no mirrors are provided at the benches. No mirrors are provided affording a view while sitting on the bench.

Resolution

Provide a compliant mirror in the dressing room/ fitting room/ changing room/ locker room.. Where mirrors are provided in dressing rooms, fitting rooms, changing rooms or locker rooms the mirror, a full-length mirror measuring at least 18" wide by 54" high shall be mounted 18" above the finish floor, in a position affording a view to a person on the bench as well as to a person in a standing position.


Quantity

4 EA


Priority	2

Photos for Barrier ID: AX419881



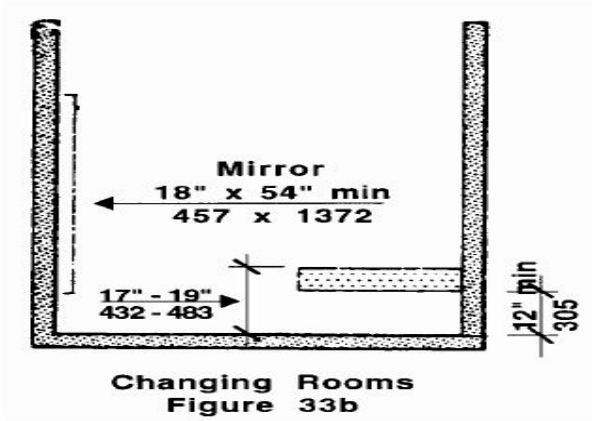

Changing Rooms
Figure 33b

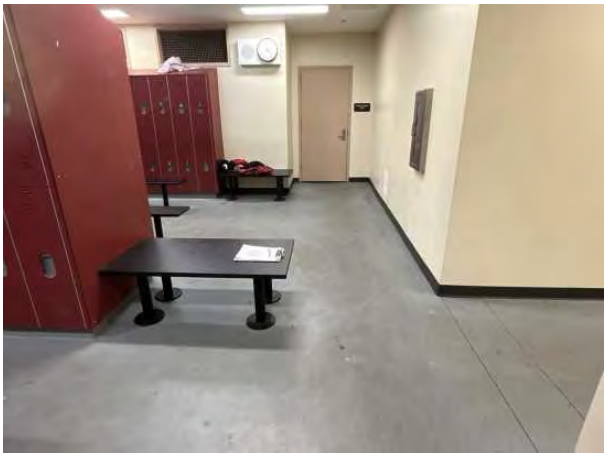

Barrier ID: AX419912

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	521 CMR 33.7

Barrier Detail

MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.

Location Description	Building S - S117 Girls Locker Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The benches do not provide a mirror affording a view while sitting on the bench. 8 accessible benches are provided.

Resolution


Provide a compliant mirror in the dressing room/ fitting room/ changing room/ locker room.. Where mirrors are provided in dressing rooms, fitting rooms, changing rooms or locker rooms the mirror, a full-length mirror measuring at least 18" wide by 54" high shall be mounted 18" above the finish floor, in a position affording a view to a person on the bench as well as to a person in a standing position.

Quantity

8 EA

Priority	2

Photos for Barrier ID: AX419912

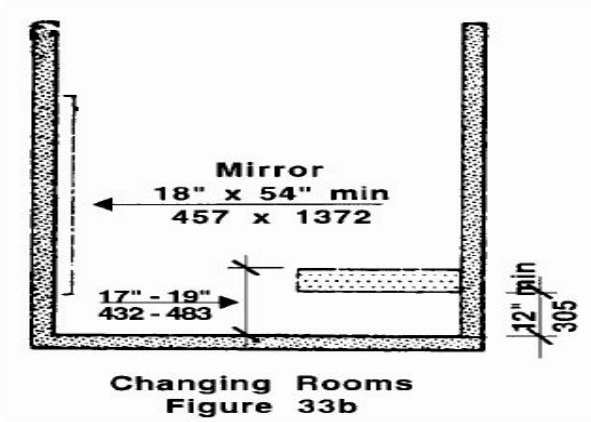



Barrier ID: AX419914

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	521 CMR 33.7

Barrier Detail

MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.

Location Description	Building S - S136 Team Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

A mirror is not provided at the accessible bench affording a view while sitting on the bench.

Resolution


Provide a compliant mirror in the dressing room/ fitting room/ changing room/ locker room.. Where mirrors are provided in dressing rooms, fitting rooms, changing rooms or locker rooms the mirror, a full-length mirror measuring at least 18" wide by 54" high shall be mounted 18" above the finish floor, in a position affording a view to a person on the bench as well as to a person in a standing position.


Quantity

1 EA

Priority	2

Photos for Barrier ID: AX419914

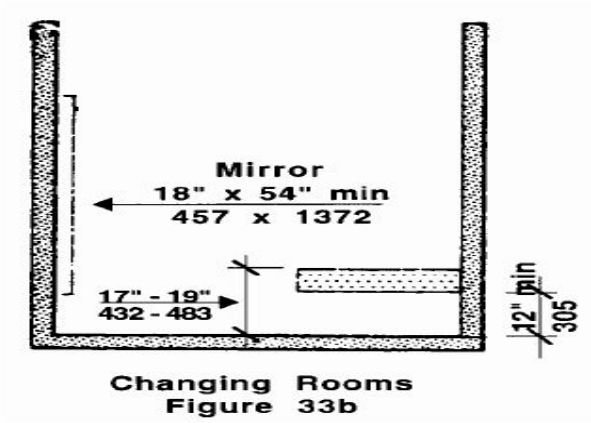

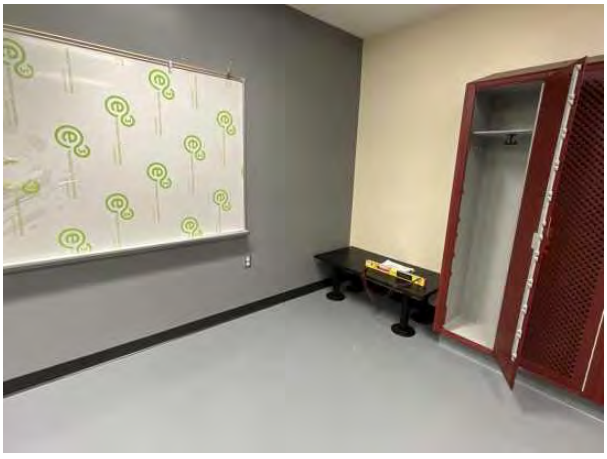

Barrier ID: AX419916

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	521 CMR 33.7

Barrier Detail

MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.

Location Description	Building S - S137 Team Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

A mirror is not provided at the accessible bench to affording a view while sitting on the bench.

Resolution


Provide a compliant mirror in the dressing room/ fitting room/ changing room/ locker room.. Where mirrors are provided in dressing rooms, fitting rooms, changing rooms or locker rooms the mirror, a full-length mirror measuring at least 18" wide by 54" high shall be mounted 18" above the finish floor, in a position affording a view to a person on the bench as well as to a person in a standing position.


Quantity

1 EA

Priority	2

Photos for Barrier ID: AX419916

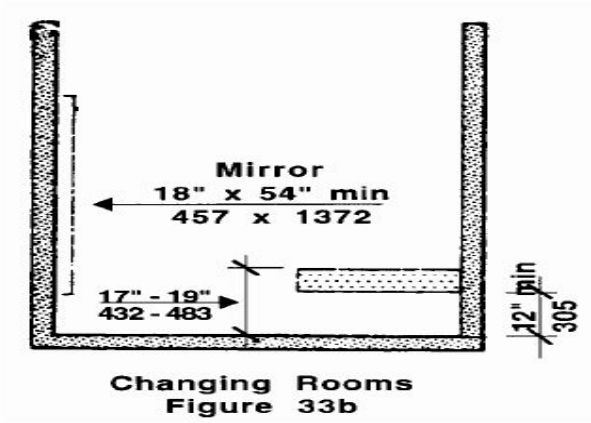

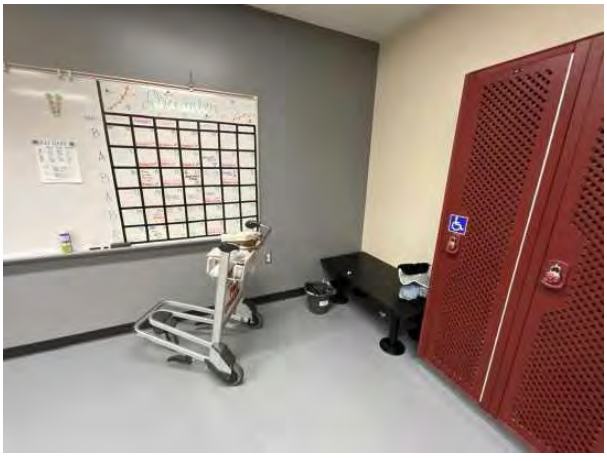

Barrier ID: AX419918

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	521 CMR 33.7

Barrier Detail

MASSACHUSETTS: The mirror in the dressing/ fitting / changing room is not compliant.

Location Description	Building S - S138 Team Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

A mirror is not provided at the accessible bench to provide a view while sitting on the bench.

Resolution

Provide a compliant mirror in the dressing room/ fitting room/ changing room/ locker room.. Where mirrors are provided in dressing rooms, fitting rooms, changing rooms or locker rooms the mirror, a full-length mirror measuring at least 18" wide by 54" high shall be mounted 18" above the finish floor, in a position affording a view to a person on the bench as well as to a person in a standing position.


Quantity

1 EA

Priority	2

Photos for Barrier ID: AX419918



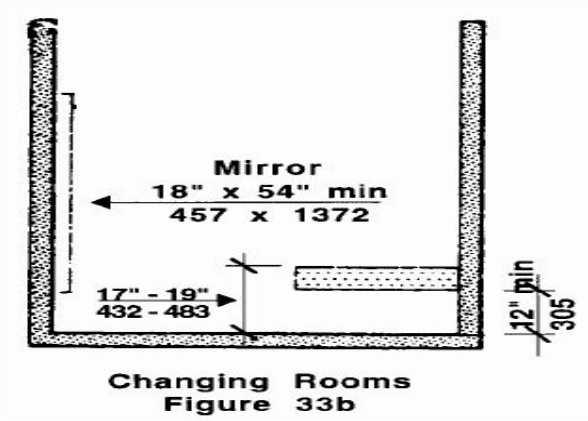

Barrier ID: AX424448

Pasadena High School BUILDING A

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building A - A101B Restroom Unisex
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The hand dryer protrudes 8 1/2 inches from the wall where the bottom edge is 36 1/4 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX424448







Barrier ID: AX424483

Pasadena High School BUILDING A

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building A - A112 Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The paper towel dispenser protrudes 9 inches from the wall where the bottom edge is 47 1/2 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity


1 EA

Priority	2

Photos for Barrier ID: AX424483





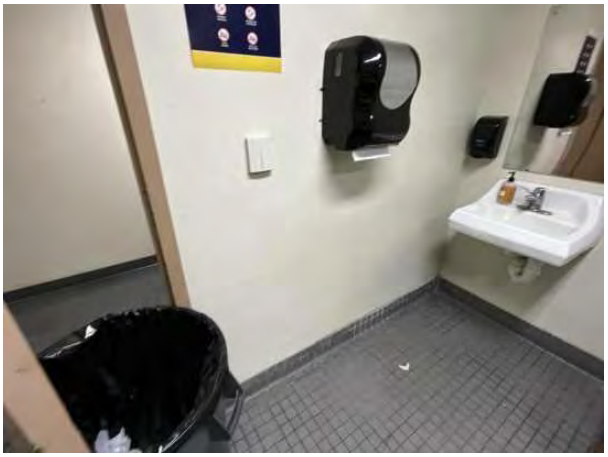

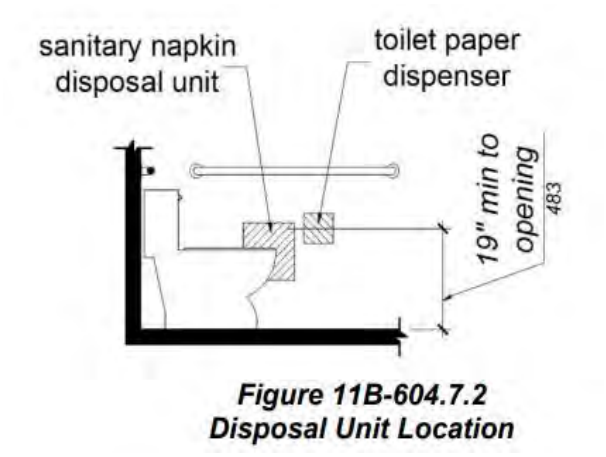


Figure 11B-604.7.2
Disposal Unit Location

Barrier ID: AX424419

Pasadena High School BUILDING A

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building A - A255C Restroom Women's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The product dispenser protrudes 6 inches from the wall where the bottom edge is 36 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.


Quantity

1 EA

Priority	2

Photos for Barrier ID: AX424419



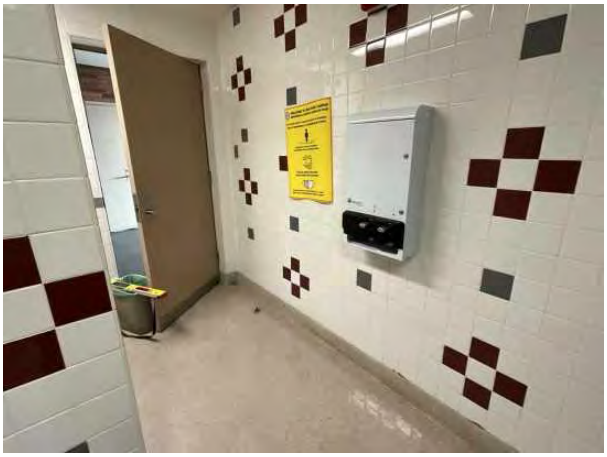



Barrier ID: AX424496

Pasadena High School BUILDING A

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The handryer protrudes 8 inches from the wall where the bottom edge is 36 1/2 inches above the floor.

Resolution


Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX424496

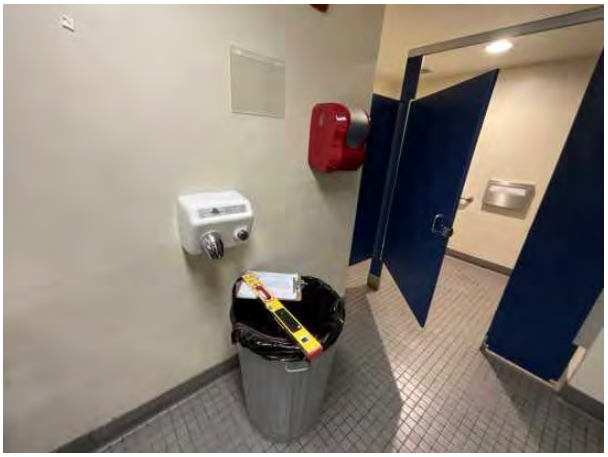





Barrier ID: AX424497

Pasadena High School BUILDING A

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The paper towel dispenser protrudes 9 inches from the wall where the bottom edge is 49 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity


1 EA

Priority	2

Photos for Barrier ID: AX424497





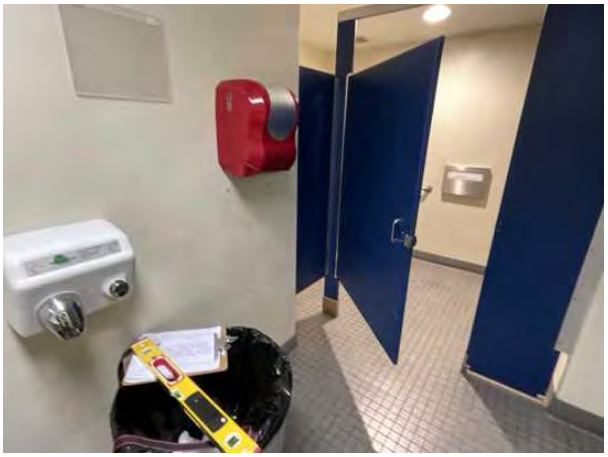

Barrier ID: AX419816

Pasadena High School BUILDING B

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building B - B110 Girls Dressing
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The hairdryer protrudes 8 inches from the wall where the bottom edge is 37 1/2 inches above the floor. The paper towel dispenser protrudes 9 inches from the wall where the bottom edge is 48 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity

2 EA

Priority	2


Photos for Barrier ID: AX419816









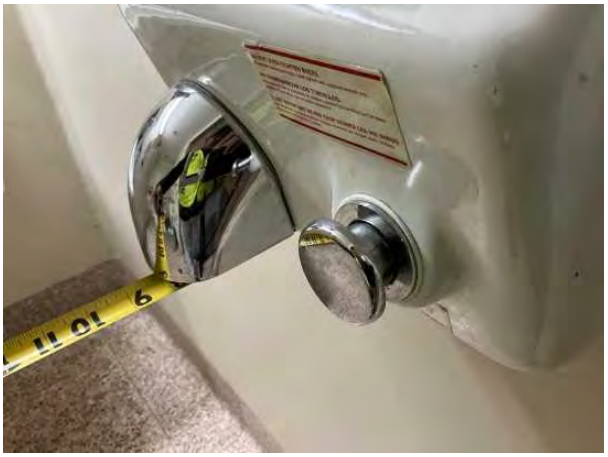

Barrier ID: AX419847

Pasadena High School BUILDING B

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building B - B112 Boys Dressing
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The hairdryer protrudes 8 1/2 inches from the wall where the bottom edge is 37 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX419847

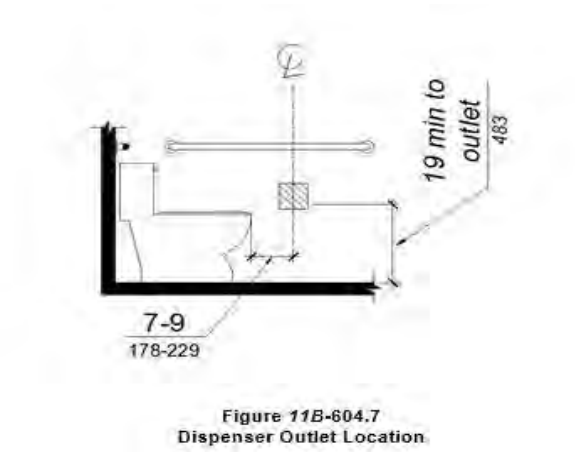


Figure *11B*-604.7
Dispenser Outlet Location







Barrier ID: AX418254

Pasadena High School BUILDING B

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building B - Restroom Women's B 109
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The lavatory casework protrudes 24 1/2 inches from the wall where the bottom edge is 27 1/8 inch above the floor.

Resolution


Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418254

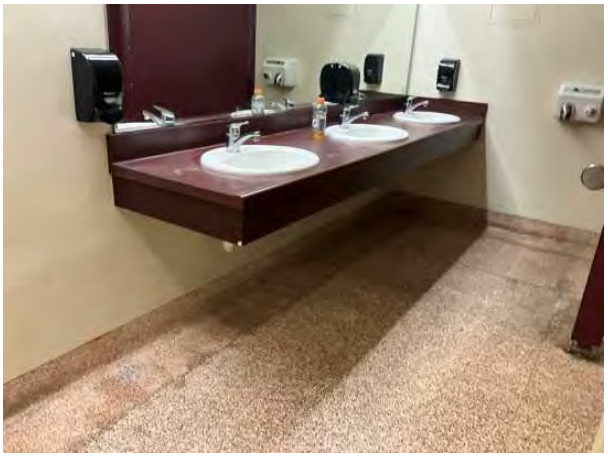





Barrier ID: AX419862

Pasadena High School BUILDING C

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building C - Testroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The product dispenser protrudes 5 1/2 inches from the wall where the bottom edges 36 1/4 inch.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX419862







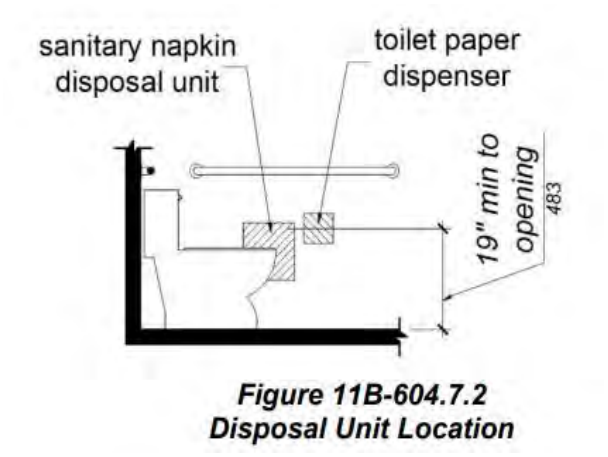


Figure 11B-604.7.2
Disposal Unit Location

Barrier ID: AX420244

Pasadena High School BUILDING E

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building E - 1st Floor Restroom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The product dispenser protrudes 7 inches from the wall where the bottom edge is 34 1/2 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity


1 EA

Priority	2

Photos for Barrier ID: AX420244





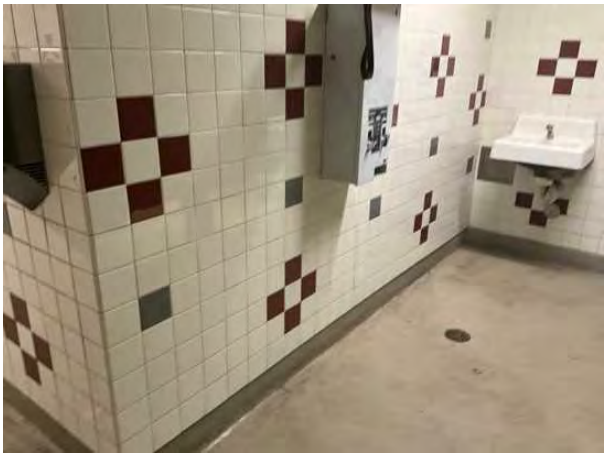

Barrier ID: AX420137

Pasadena High School BUILDING E

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building E - 2nd Floor Restroom Boys
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The lavatory is a protruding object that is not protected. The lavatory protrudes 18 inches from the wall where the bottom edge is 29 1/2 inches above the floor..

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX420137







Barrier ID: AX420144

Pasadena High School BUILDING E

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building E - 2nd Floor Restroom Girl's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The lavatory protrudes 18 inches from the wall where the bottom edge is 29 1/2 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity


1 EA

Priority	2

Photos for Barrier ID: AX420144





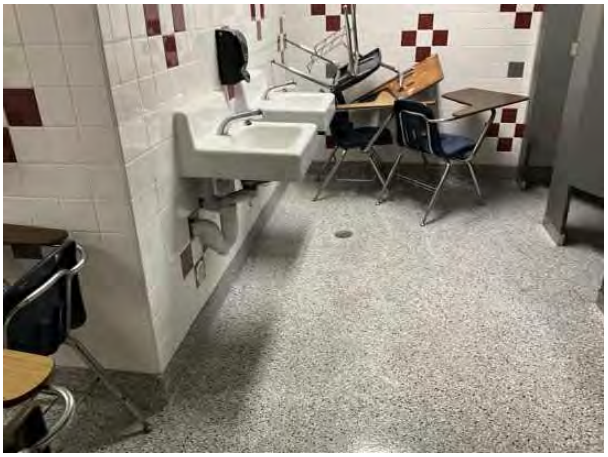

Barrier ID: AX418318

Pasadena High School BUILDING F

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building F - Restroom F100B Unisex
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The hand dryer protrudes 8 1/2 inches from the wall where the bottom edge is 37 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.


Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418318



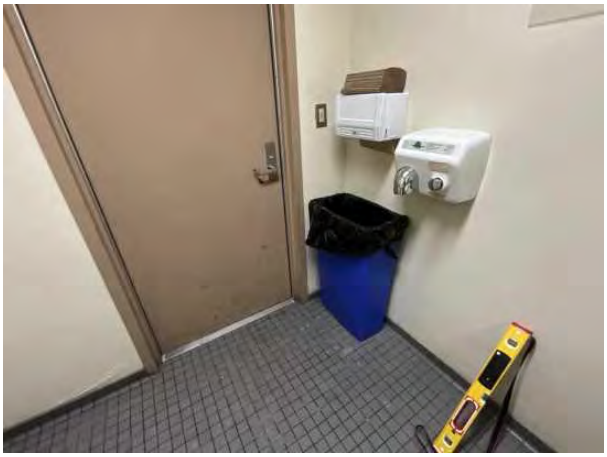



Barrier ID: AX418287

Pasadena High School BUILDING F

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building F - Restroom F121 Women's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The hand dryer protrudes 8 1/2 inches from the wall where the bottom edge is 36 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418287







Barrier ID: AX418297

Pasadena High School BUILDING F

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building F - Restroom F122 Men's
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The hand dryer protrudes 8 1/2 inches from the wall where the bottom edge is 34 1/4 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418297









Barrier ID: AX419729

Pasadena High School BUILDING H

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building H East End - 1st Floor Restroom Girls
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The product dispenser protrudes 6 inches from the wall where the bottom edge is 36 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity


1 EA

Priority	2

Photos for Barrier ID: AX419729





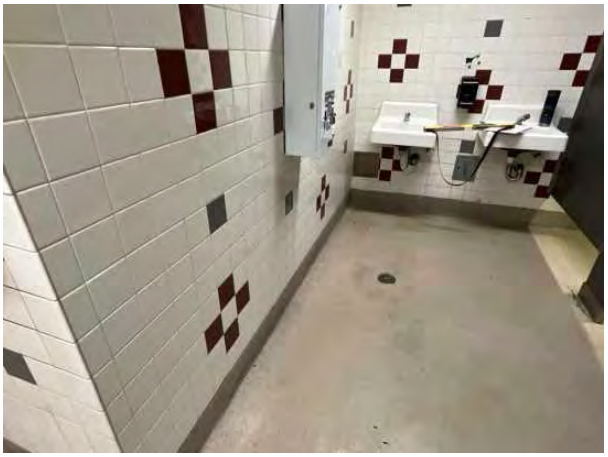

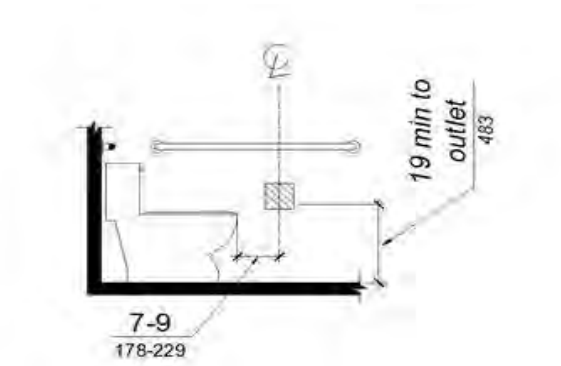


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX418667

Pasadena High School BUILDING N

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building N - Restroom Women's Multi-User
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The product dispenser protrudes 6 inches from the wall where the bottom edge is 33 inches above the floor.

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.


Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418667



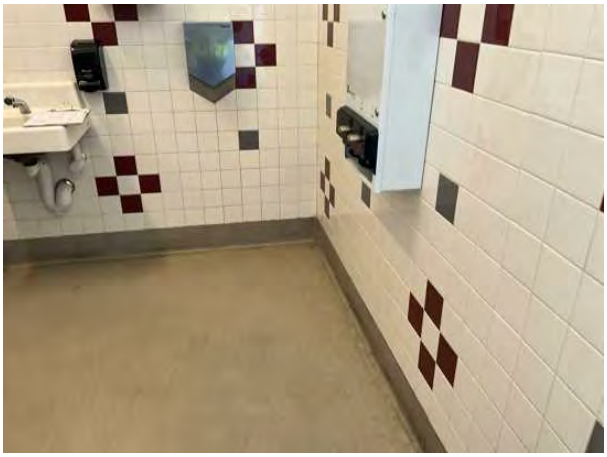



Barrier ID: AX419906

Pasadena High School BUILDING S

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building S - S123 Restroom Girls
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The product dispenser protrudes 6 3/4 inches from the wall where the bottom edge is 42 1/2 inches above the floor.

Resolution


Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity


1 EA

Priority	2

Photos for Barrier ID: AX419906

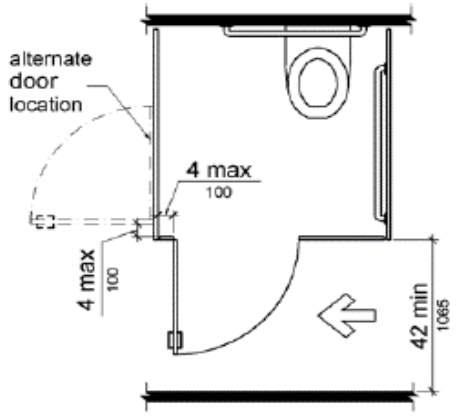



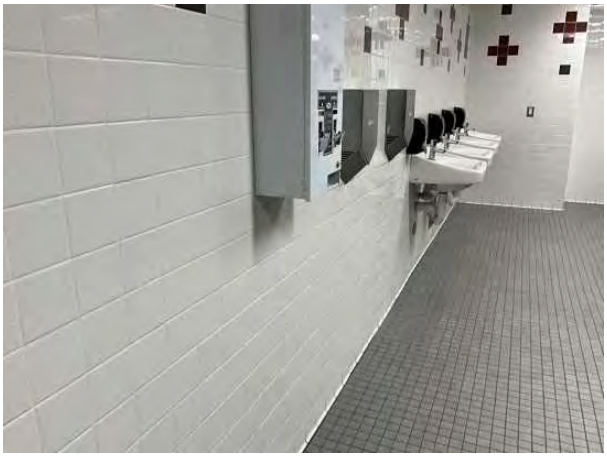



Barrier ID: AX418705

Pasadena High School BUILDING V

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Building V- V115 Restroom Staff
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The shelf protrudes 10 inches where the bottom edge is 41 inches above the floor

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418705







Barrier ID: AX420173

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Portable Trailer Restoom Boy's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The lavatory protrudes 18 inches from the wall where the bottom edge is 31 inches above the floor

Resolution


Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX420173

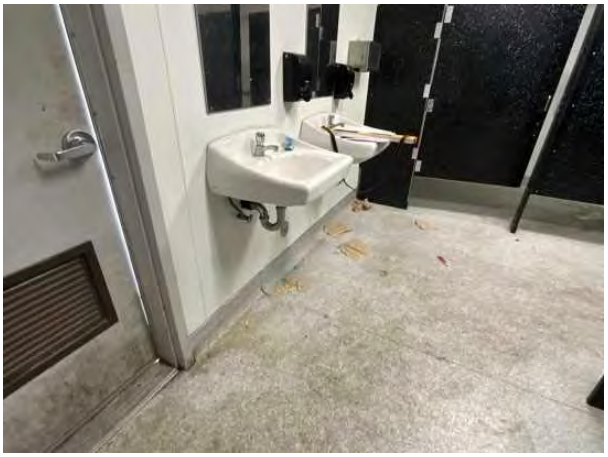





Barrier ID: AX420184

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Protruding Object
ADA Standard	307.2

Barrier Detail

The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Location Description	Portable Trailer Restoom Girl's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The lavatory protrudes 18 inches from the wall where the bottom edge is 31 inches above the floor

Resolution

Provide a restroom circulation path which does not have objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX420184







Barrier ID: AX424387

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Reach Range
ADA Standard	221; 221.1; 221.2.1 thru 3; 221.2.3.1 & 2; 221.3; 802.3
Barrier Detail	Assembly areas do not provide wheelchair spaces.
Location Description	Building A - A108 Principle
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The waiting area does not have a 30 by 48 inch wheelchair space.

Resolution


Wheelchair spaces shall be provided. A single wheelchair space is minimum 36" wide. Where two wheelchair spaces adjoin, the wheelchair spaces shall be minimum 33" wide. When approached from the front or rear, wheelchair spaces shall be minimum 48" deep. Wheelchair spaces approached from the side shall be minimum 60" deep. One side of the wheelchair space shall connect to, but be separate from, an accessible route and shall not overlap the circulation path. In row seating, at least one companion seat shall be provided adjacent to each required wheelchair space. Number of Wheelchair Spaces in Assembly Areas Number of Seats- Minimum Number of Required Wheelchair Spaces: 4 to 25 requires 1; 26 to 50 requires 2; 51 to 150 requires 4; 151 to 300 requires 5; 301 to 500 requires 6; 501 to 5000 requires 6, plus 1 for each 150, or fraction thereof, between 501 through 5000; 5001 and over requires 36, plus 1 for each 200, or fraction thereof, over 5000. Wheelchair spaces shall provide compliant lines of sight. In providing lines of sight, wheelchair spaces shall be dispersed. Wheelchair spaces shall provide spectators with choices of seating locations and viewing angles that are substantially equivalent to, or better than, the choices of seating locations and viewing angles available to all other spectators. When the number of wheelchair spaces required has been met, further dispersion shall not be required. Wheelchair spaces shall be dispersed horizontally. [EXCEPTIONS: 1. Horizontal dispersion shall not be required in assembly areas with 300 or fewer seats if the companion seats required and wheelchair spaces are located within the 2nd or 3rd quartile of the total row length. Intermediate aisles shall be included in determining the total row length. If the row length in the 2nd and 3rd quartile of a row is insufficient to accommodate the required number of companion seats and wheelchair spaces, the additional companion seats and wheelchair spaces shall be permitted to be located in the 1st and 4th quartile of the row. 2. In row seating, two wheelchair spaces shall be permitted to be located side-by-side.] Wheelchair spaces shall be dispersed vertically at varying distances from the screen, performance area, or playing field. In addition, wheelchair spaces shall be located in each balcony or mezzanine that is located on an accessible route. [EXCEPTIONS: 1. Vertical dispersion shall not be required in assembly areas with 300 or fewer seats if the wheelchair spaces provide viewing angles that are equivalent to, or better than, the average viewing angle provided in the facility.]

Quantity

24 SF

Priority	2

Photos for Barrier ID: AX424387

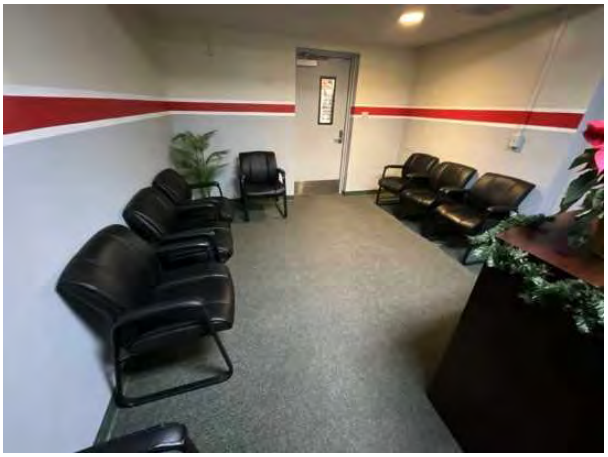

Barrier ID: AX424385

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Reach Range
ADA Standard	308, 309

Barrier Detail

Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.

Location Description	Building A - Main Public Entrance
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The asphalt sidewalk has cross slopes up to 5.7% due to cracks and heaving for the entire length of the sidewalk. The sidewalk measures 9 feet wide.

Resolution

Remove and lower to a compliant reach range. Unobstructed Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48" maximum and the low side reach shall be 15" minimum above the finish floor or ground. [EXCEPTION: An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10" maximum.] [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

1 EA

Priority	2

Map for Barrier ID: AX424385



631 +34.161991, -118.091624

Photos for Barrier ID: AX424385





Barrier ID: AX418243

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2.10

Barrier Detail

The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.

Location Description	Building B - Restroom Men's B 107
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door, smooth surface extends 9 1/2 inches above the floor.

Resolution

Provide a swinging door with a smooth surface within 10" of the finish floor or ground measured vertically on the push side extending the full width of the door. Parts creating horizontal or vertical joints in the surfaces shall be within 1/16" of the same plane as the other. Cavities created by adding kick plates shall be capped.


Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418243



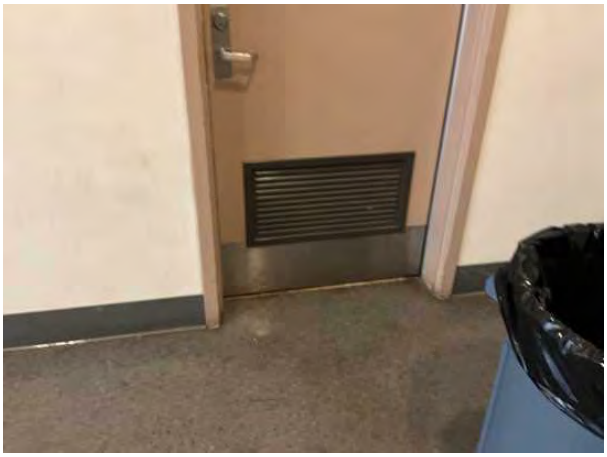



Barrier ID: AX418253

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2.10

Barrier Detail

The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.

Location Description	Building B - Restroom Women's B 109
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door, bottom, smooth surface, extends 9 3/8 inches above the floor.

Resolution


Provide a swinging door with a smooth surface within 10" of the finish floor or ground measured vertically on the push side extending the full width of the door. Parts creating horizontal or vertical joints in the surfaces shall be within 1/16" of the same plane as the other. Cavities created by adding kick plates shall be capped.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418253

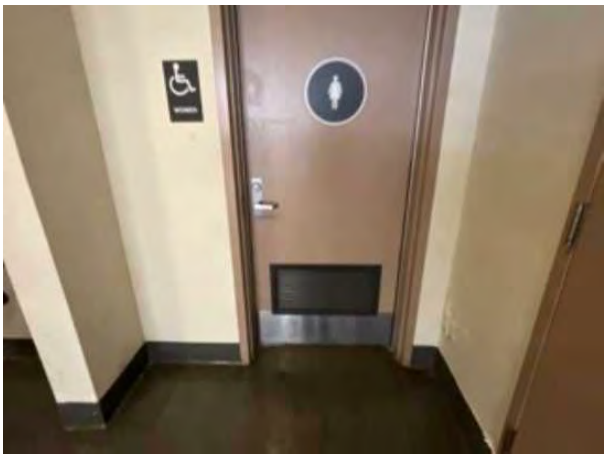



Barrier ID: AX418246

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom-Unisex
ADA Standard	403.3
Barrier Detail	The slope of the floor surface is greater than 2% cross or 5% running
Location Description	Building B - Restroom Men's B 107
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The floor slopes, 3.3% in front of the accessible urinal.

Resolution


Provide a floor surface with slopes no greater than 2% cross or 5% running. Ensure compliant thresholds.

Quantity

25 SF

Priority	2

Photos for Barrier ID: AX418246

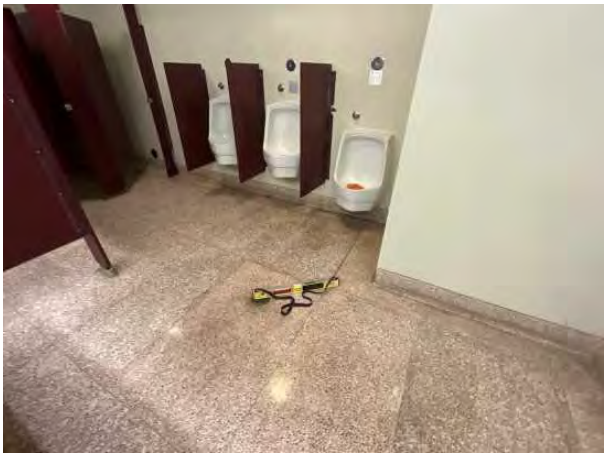



Barrier ID: AX419722

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom-Unisex
ADA Standard	403.3
Barrier Detail	The slope of the floor surface is greater than 2% cross or 5% running
Location Description	Building H East End - 1st Floor Restroom Boys
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The floor slopes, 3.2% near the urinal.

Resolution


Provide a floor surface with slopes no greater than 2% cross or 5% running. Ensure compliant thresholds.


Quantity

25 SF

Priority	2

Photos for Barrier ID: AX419722

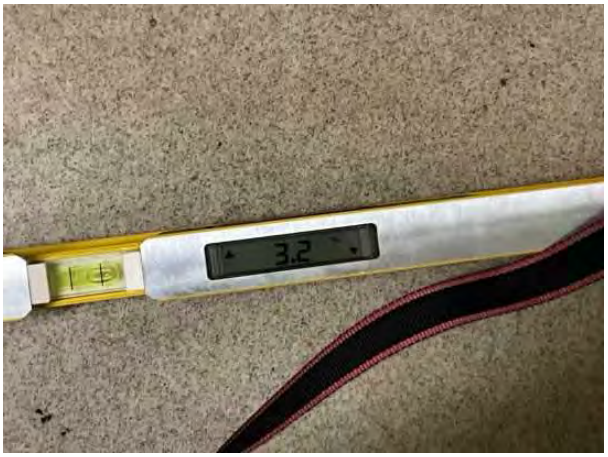

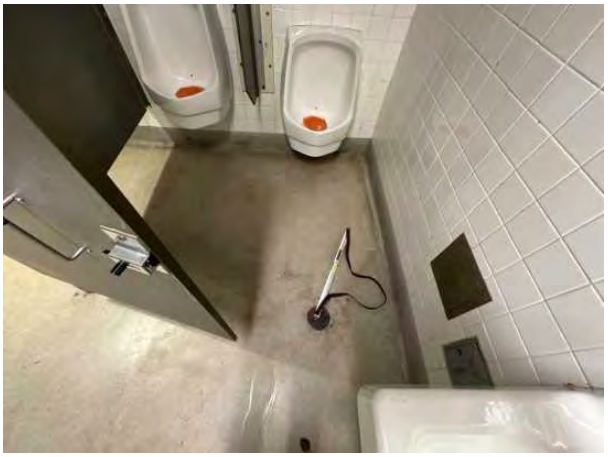

Barrier ID: AX419730

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom-Unisex
ADA Standard	403.3
Barrier Detail	The slope of the floor surface is greater than 2% cross or 5% running
Location Description	Building H East End - 1st Floor Restroom Girls
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The floor slopes, 2.9%.

Resolution


Provide a floor surface with slopes no greater than 2% cross or 5% running. Ensure compliant thresholds.

Quantity

25 SF

Priority	2

Photos for Barrier ID: AX419730

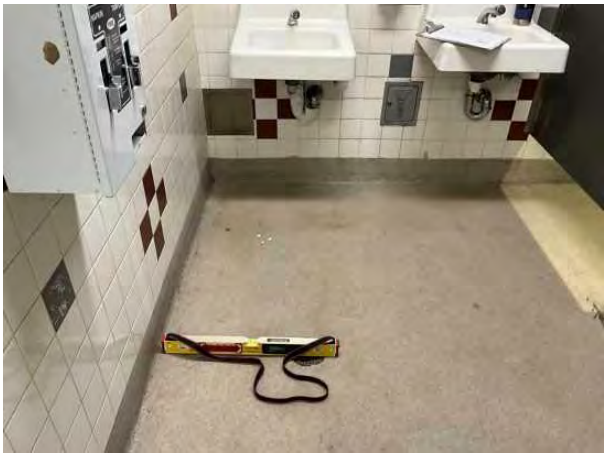



Barrier ID: AX419735

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom-Unisex
ADA Standard	403.3
Barrier Detail	The slope of the floor surface is greater than 2% cross or 5% running
Location Description	Building H East End - 2nd Floor Restroom Boys
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The floor slopes, 3.0%.

Resolution

Provide a floor surface with slopes no greater than 2% cross or 5% running. Ensure compliant thresholds.


Quantity

25 SF

Priority	2

Photos for Barrier ID: AX419735



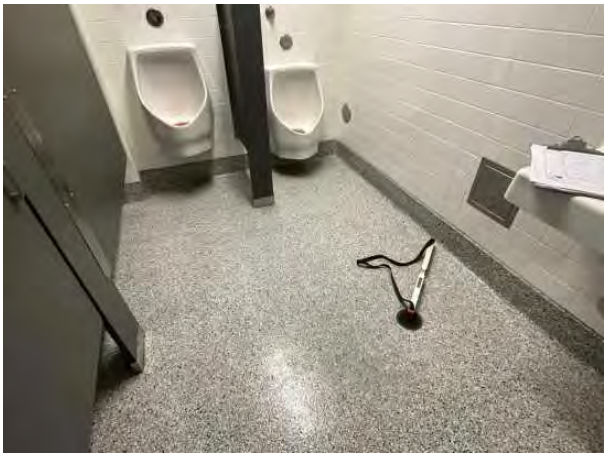

Barrier ID: AX419732

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom-Unisex
ADA Standard	403.3
Barrier Detail	The slope of the floor surface is greater than 2% cross or 5% running
Location Description	Building H East End - 2nd Floor Restroom Girls
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The floor slopes, 2.9%.

Resolution


Provide a floor surface with slopes no greater than 2% cross or 5% running. Ensure compliant thresholds.

Quantity

25 SF

Priority	2

Photos for Barrier ID: AX419732

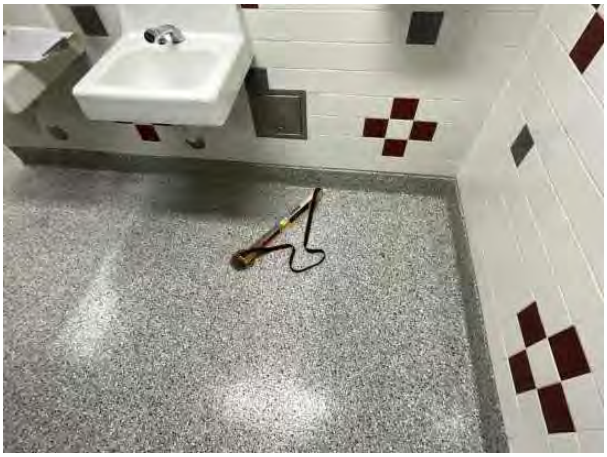



Barrier ID: AX419761

Pasadena High School BUILDING I

Assembly	Restroom
Type	Restroom/Bathroom-Unisex
ADA Standard	403.3
Barrier Detail	The slope of the floor surface is greater than 2% cross or 5% running
Location Description	Building I East End - 2nd Floor Restroom Boys
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The floor slopes, 2.9%.

Resolution


Provide a floor surface with slopes no greater than 2% cross or 5% running. Ensure compliant thresholds.

Quantity

50 SF

Priority	2

Photos for Barrier ID: AX419761

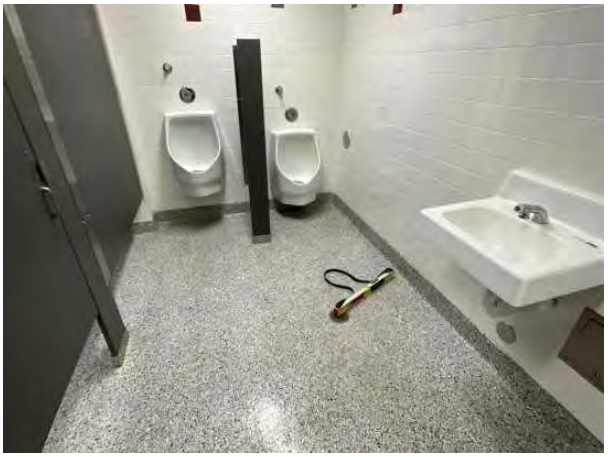



Barrier ID: AX419770

Pasadena High School BUILDING I

Assembly	Restroom
Type	Restroom/Bathroom-Unisex
ADA Standard	403.3
Barrier Detail	The slope of the floor surface is greater than 2% cross or 5% running
Location Description	Building I East End - 2nd Floor Restroom Girls
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The floor slopes, 3.9%.

Resolution


Provide a floor surface with slopes no greater than 2% cross or 5% running. Ensure compliant thresholds.

Quantity

50 SF

Priority	2

Photos for Barrier ID: AX419770

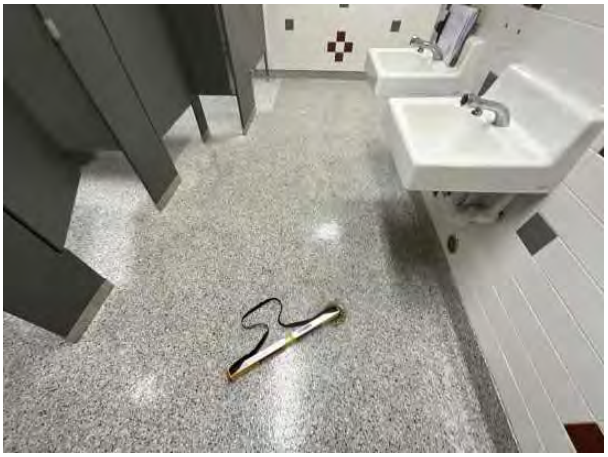



Barrier ID: AX419879

Pasadena High School BUILDING R

Assembly	Restroom
Type	Restroom/Bathroom-Unisex
ADA Standard	403.3
Barrier Detail	The slope of the floor surface is greater than 2% cross or 5% running
Location Description	Building R Restroom - R106
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The floor slopes, 2.6%

Resolution

Provide a floor surface with slopes no greater than 2% cross or 5% running. Ensure compliant thresholds.


Quantity

25 SF

Priority	2

Photos for Barrier ID: AX419879



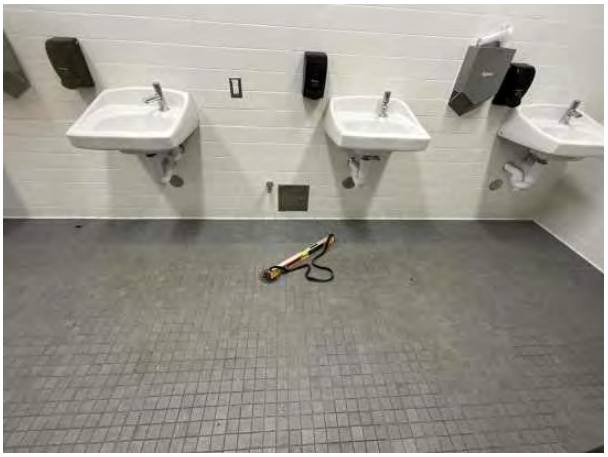

Barrier ID: AX424557

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom-Unisex
ADA Standard	403.3
Barrier Detail	The slope of the floor surface is greater than 2% cross or 5% running
Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The doorstop is within the water closet clear space which creates an abrupt change level greater than 1/4 inch. This barrier must be removed in conjunction with barrier ID 424556. The cost of this barrier removal is covered under ID 424556 and therefore, the cost of this ID is shown as $0. The concrete around the drain plate has cracks and creates changes in level greater than a 1/4 inch.

Resolution

Provide a smooth floor without abrupt changes in level greater than 1/4 inch. Provide a floor surface with slopes no greater than 2% cross or 5% running. Ensure compliant thresholds.

Quantity

25 SF

Priority	2

Photos for Barrier ID: AX424557







Barrier ID: AX418239

Pasadena High School BUILDING B

Assembly	Common Areas
Type	Service Counter
ADA Standard	CBC Chap 11B-306, 904.4

Barrier Detail

CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.

Location Description	Auditorium Ticket Window
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The ticket window counter is 42 1/4 inches above the floor.

Resolution

Provide either a compliant parallel or a compliant forward approach to the counter. For a parallel approach, a portion of service counter must be 36" minimum long and 34" maximum above finished floor. Clear space of minimum 30" wide and minimum 48" long shall be located adjacent to the compliant portion of the counter, and oriented for a parallel approach, with the 48" dimension adjacent to the compliant portion. [EXCEPTION: Where the provided counter surface is less then 36" long, the entire counter surface shall be 34" high maximum above the finish floor.] For a forward approach, a portion of the service counter must be 36" long and 34" high maximum, with knee and toe clearance. Knee and toe clearance shall be provided for a forward approach. Clear floor space minimum 30" wide and minimum 48" long shall be provided on the compliant portion of the counter, and oriented for a forward approach. Clear space at the counter shall be maximum 2.08% in all directions and a firm and stable surface. Knee clearance shall be the space under an element between 9" and 27" above the finish floor or ground. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element .Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

3 LF

Priority	2

Photos for Barrier ID: AX418239





Barrier ID: AX419831

Pasadena High School SPORTS FACILITIES

Assembly	Common Areas
Type	Service Counter
ADA Standard	CBC Chap 11B-306, 904.4

Barrier Detail

CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.

Location Description	Baseball Field Concession Stand Area
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The concession stand ordering window is 40 inches above the floor.

Resolution

Provide either a compliant parallel or a compliant forward approach to the counter. For a parallel approach, a portion of service counter must be 36" minimum long and 34" maximum above finished floor. Clear space of minimum 30" wide and minimum 48" long shall be located adjacent to the compliant portion of the counter, and oriented for a parallel approach, with the 48" dimension adjacent to the compliant portion. [EXCEPTION: Where the provided counter surface is less then 36" long, the entire counter surface shall be 34" high maximum above the finish floor.] For a forward approach, a portion of the service counter must be 36" long and 34" high maximum, with knee and toe clearance. Knee and toe clearance shall be provided for a forward approach. Clear floor space minimum 30" wide and minimum 48" long shall be provided on the compliant portion of the counter, and oriented for a forward approach. Clear space at the counter shall be maximum 2.08% in all directions and a firm and stable surface. Knee clearance shall be the space under an element between 9" and 27" above the finish floor or ground. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element .Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

3 LF

Priority	2

Photos for Barrier ID: AX419831





Barrier ID: AX424503

Pasadena High School GENERAL EXTERIOR

Assembly	Common Areas
Type	Service Counter
ADA Standard	CBC Chap 11B-306, 904.4

Barrier Detail

CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.

Location Description	Building A - Exterior Registration Windows
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The registration window counter is 42 inches above the floor.

Resolution


Provide either a compliant parallel or a compliant forward approach to the counter. For a parallel approach, a portion of service counter must be 36" minimum long and 34" maximum above finished floor. Clear space of minimum 30" wide and minimum 48" long shall be located adjacent to the compliant portion of the counter, and oriented for a parallel approach, with the 48" dimension adjacent to the compliant portion. [EXCEPTION: Where the provided counter surface is less then 36" long, the entire counter surface shall be 34" high maximum above the finish floor.] For a forward approach, a portion of the service counter must be 36" long and 34" high maximum, with knee and toe clearance. Knee and toe clearance shall be provided for a forward approach. Clear floor space minimum 30" wide and minimum 48" long shall be provided on the compliant portion of the counter, and oriented for a forward approach. Clear space at the counter shall be maximum 2.08% in all directions and a firm and stable surface. Knee clearance shall be the space under an element between 9" and 27" above the finish floor or ground. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element .Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

6 LF

Priority	2

Map for Barrier ID: AX424503

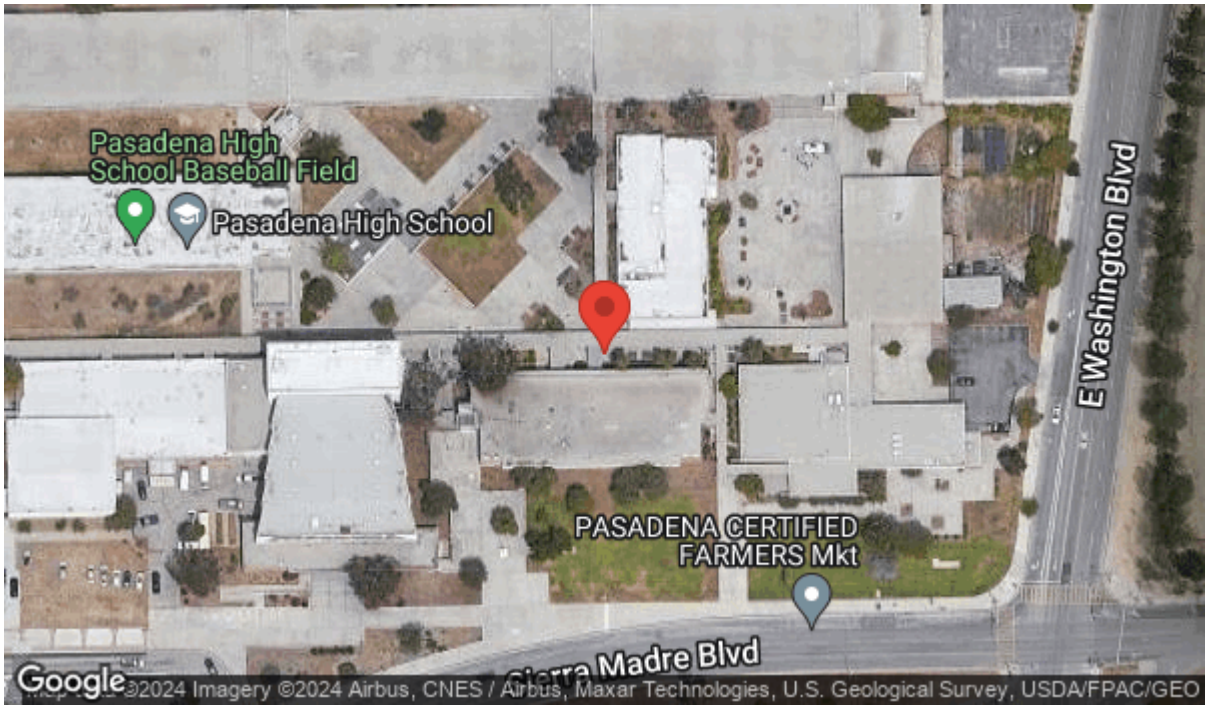

749 +34.162286, -118.091395

Photos for Barrier ID: AX424503





Barrier ID: AX418231

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Signage
ADA Standard	216.4, 703

Barrier Detail

Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)

Location Description	Auditorium East Exit Doors
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The doors do not provide an exit stairs down sign.

Resolution

Provide compliant means of egress signage at each exit passageway, exit discharge, and exit stairway. Signs at designated egress passageways, stairways, exit doors and areas of refuge shall include tactile signage. Signs shall be installed alongside the door at the latch side. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, sign shall be located on the nearest adjacent wall. Where both visual and tactile characters are required, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Signs containing tactile characters shall be located so that clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degrees open. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows- Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style" Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height. Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.]

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418231



Barrier ID: AX418265

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Signage
ADA Standard	216.4, 703

Barrier Detail

Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)

Location Description	Auditorium West Exit Doors
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The doors do not provide tactile exit ramp up sign.

Resolution


Provide compliant means of egress signage at each exit passageway, exit discharge, and exit stairway. Signs at designated egress passageways, stairways, exit doors and areas of refuge shall include tactile signage. Signs shall be installed alongside the door at the latch side. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, sign shall be located on the nearest adjacent wall. Where both visual and tactile characters are required, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Signs containing tactile characters shall be located so that clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degrees open. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows- Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style" Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height. Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.]


Quantity


1 EA

Priority	2

Photos for Barrier ID: AX418265

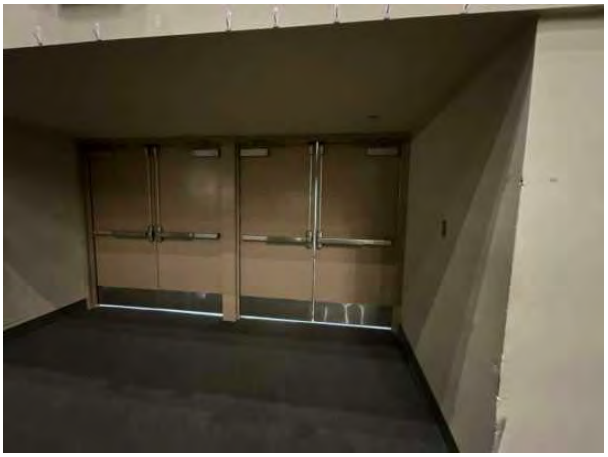

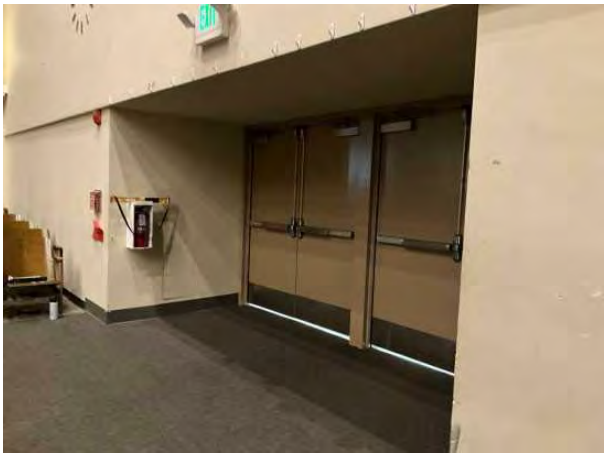

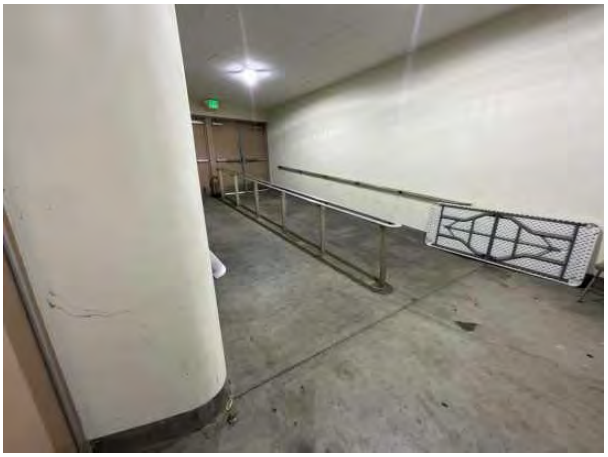

Barrier ID: AX418263

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Signage
ADA Standard	216.4, 703

Barrier Detail

Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)

Location Description	Typical Exit Doors Not Having Tactile Exit Signs
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Typical at most buildings, a tactile exit sign is not provided at exterior doors or doors leading exterior exits. Building A has 5. Building B has 13. Building C has 5. Building D has 4. Building R has 1 on the wrong side. Building S has 1 on the wrong side. Building T has 3 on the wrong side. Building V has 7. .

Resolution

Provide compliant means of egress signage at each exit passageway, exit discharge, and exit stairway. Signs at designated egress passageways, stairways, exit doors and areas of refuge shall include tactile signage. Signs shall be installed alongside the door at the latch side. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, sign shall be located on the nearest adjacent wall. Where both visual and tactile characters are required, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Signs containing tactile characters shall be located so that clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degrees open. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows- Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style" Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height. Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.]

Quantity


39 EA


Priority	2

Photos for Barrier ID: AX418263






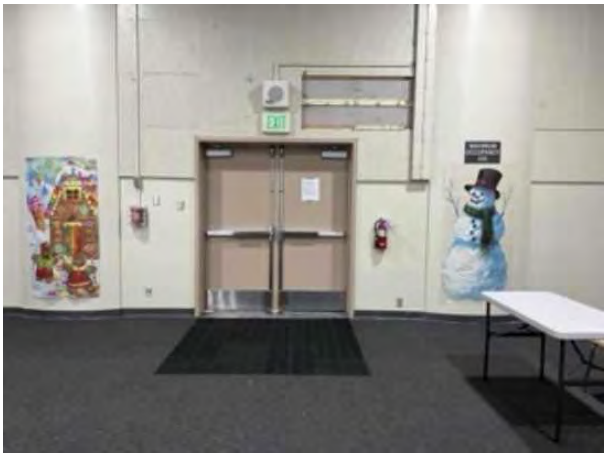

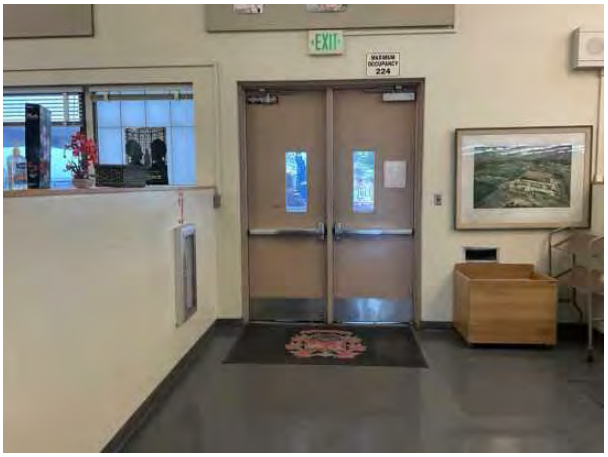





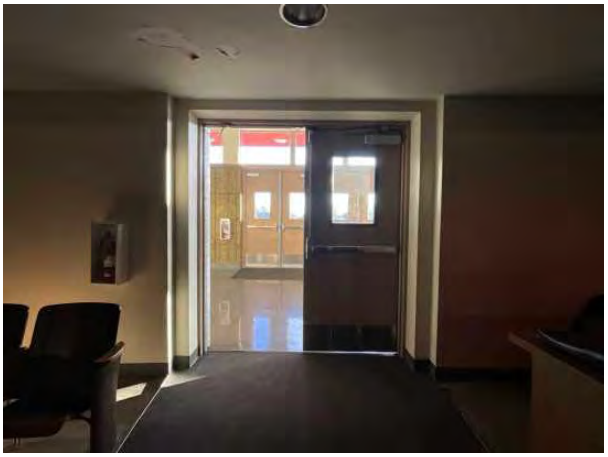

Barrier ID: AX419740

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Signage
ADA Standard	216.2, 703.2; 703.3; 703.5

Barrier Detail

The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.

Location Description	Typical Room Identification Signs Have Missing Braille or Signs
Observed	Jan 8, 2024 by

Site Conditions

Typical room, tactile room identification signs have missing braille or partially missing braille or no sign at all. Building A has 18. Building C has 9. Building D has 3. Building E has 30. Building G, H, I, 1st Floor has 49. Building G, H, I, 2nd Floor has 60. Building N has 6 signs. Building P has 9 signs. Building Q has 10 signs.

Resolution

Remove and replace signage with compliant signage. Raised characters shall be compliant and shall be duplicated in Braille. Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.]

Quantity

194 EA

Priority	2

Photos for Barrier ID: AX419740











Barrier ID: AX420135

Pasadena High School BUILDING T

Assembly	Interior Access Route
Type	Signage
ADA Standard	216.2, 703.2; 703.3; 703.5

Barrier Detail

The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.

Location Description	Typical Tactile Signs Incorrectly Located
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	5 tactile exit signs are not placed on the right side wall of double doors.

Resolution


Remove and replace signage with compliant signage. Raised characters shall be compliant and shall be duplicated in Braille. Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.]


Quantity

5 EA


Priority	2

Photos for Barrier ID: AX420135

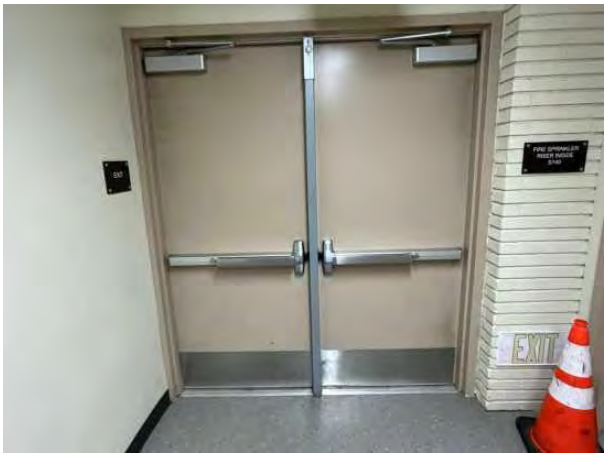

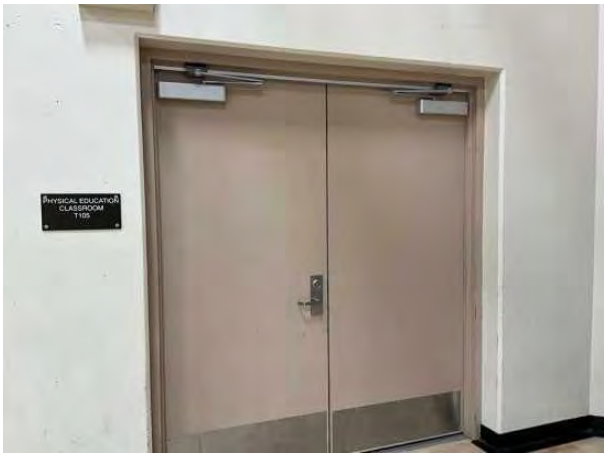



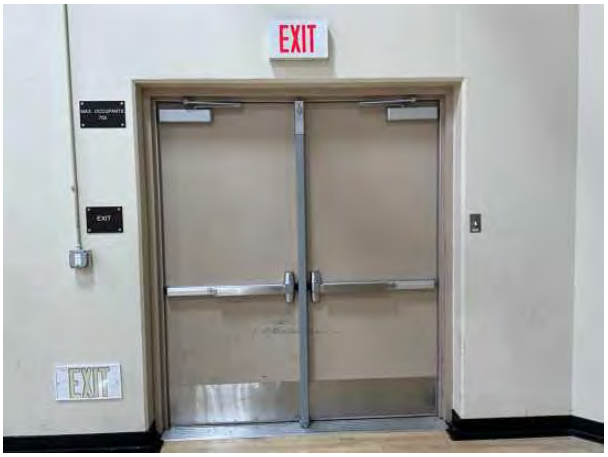

Barrier ID: AX419833

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Sink
ADA Standard	306.2 and 606.3

Barrier Detail

The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).

Location Description	Building E - E102
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The dark room sink is 42 inches above the floor.

Resolution

Relocate sink to compliant height with knee and toe clearances. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX419833







Barrier ID: AX419826

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Sink
ADA Standard	306.2 and 606.3

Barrier Detail

The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).

Location Description	Building E - E103
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The eyewash station is too high and does not provide knee and toe clearance. The shower station does not have a control within reach range.

Resolution

Relocate sink to compliant height with knee and toe clearances. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

1 EA

Priority	2


Photos for Barrier ID: AX419826









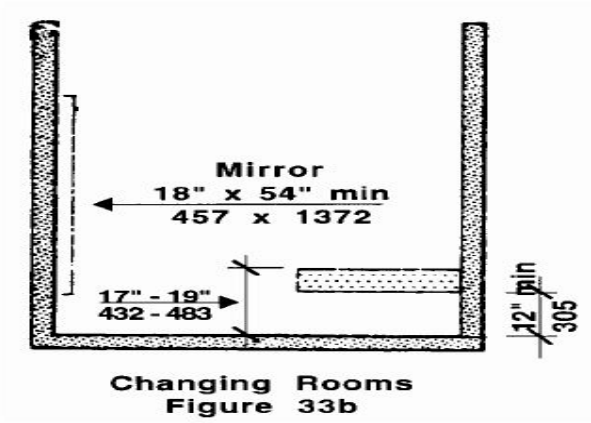

Changing Rooms
Figure 33b

Barrier ID: AX418282

Pasadena High School BUILDING G

Assembly	Interior Access Route
Type	Sink
ADA Standard	306.2 and 606.3

Barrier Detail

The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).

Location Description	Building G - G 108
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The classroom sink rim is 36 1/4 inches high and does not provided knee and toe clearance.

Resolution

Relocate sink to compliant height with knee and toe clearances. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418282







Barrier ID: AX418638

Pasadena High School BUILDING N

Assembly	Interior Access Route
Type	Sink
ADA Standard	306.2 and 606.3

Barrier Detail

The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).

Location Description	Building N - 104A Workroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The sink is 35 1/2 inches above the floor and does not provide knee clearance.

Resolution

Relocate sink to compliant height with knee and toe clearances. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.


Quantity

1 EA

Priority	2

Photos for Barrier ID: AX418638



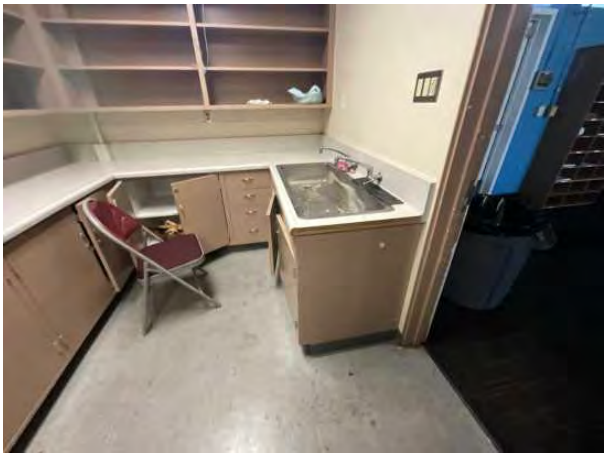

Barrier ID: AX418273

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Interior Access Route
Type	Sink
ADA Standard	306.2 and 606.3

Barrier Detail

The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).

Location Description	Typical Non-Compliant Sinks
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Most sinks provided throughout the campus either counter / rim is above 34 inches or does not provide the required knee and toe clearance to due base cabinets or non-compliant casework. Building A has 3 sinks. Building C has 2 sinks. Building D has 2 sinks. Building E has 4 sinks. Building G has 4 sinks. Building H has 6 sinks. Building I has 5 sinks. Building N has 1 sink.

Resolution

Relocate sink to compliant height with knee and toe clearances. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

29 EA

Priority	2

Photos for Barrier ID: AX418273


















CREATIVE


33
34
35
36





Barrier ID: AX424428

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-505.4, 505.10
Barrier Detail	CALIFORNIA: The stair handrail extensions are not compliant.
Location Description	Building A - Stairs East Side
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

One handrail at the bottom, and one hand at the top, do not provide the required extensions.

Resolution

Install compliant handrail extensions at the top and bottom of the stair flight. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. The handrails at the bottom of the stairs shall extend at the s lope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTION: In alterations, where the extension of the handrail in the direction of stair flight would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of stair flight.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28 inches measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9 inches minimum, should be provided to help prevent entrapment.]

Quantity

3 LF

Priority	2

Photos for Barrier ID: AX424428







Barrier ID: AX424425

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-505.4, 505.10
Barrier Detail	CALIFORNIA: The stair handrail extensions are not compliant.
Location Description	Building A - Stairs West Side
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

One handrail at the bottom, and one handrail at the top, do not provide the required extensions.

Resolution

Install compliant handrail extensions at the top and bottom of the stair flight. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. The handrails at the bottom of the stairs shall extend at the s lope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTION: In alterations, where the extension of the handrail in the direction of stair flight would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of stair flight.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28 inches measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9 inches minimum, should be provided to help prevent entrapment.]

Quantity

3 LF

Priority	2

Photos for Barrier ID: AX424425







Barrier ID: AX420146

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-505.4, 505.10
Barrier Detail	CALIFORNIA: The stair handrail extensions are not compliant.
Location Description	Building E - Stairs East Side
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	1 handrail at the bottom does not provide the required extensions.

Resolution


Install compliant handrail extensions at the top and bottom of the stair flight. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. The handrails at the bottom of the stairs shall extend at the s lope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTION: In alterations, where the extension of the handrail in the direction of stair flight would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of stair flight.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28 inches measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9 inches minimum, should be provided to help prevent entrapment.]


Quantity

1 LF

Priority	2

Photos for Barrier ID: AX420146

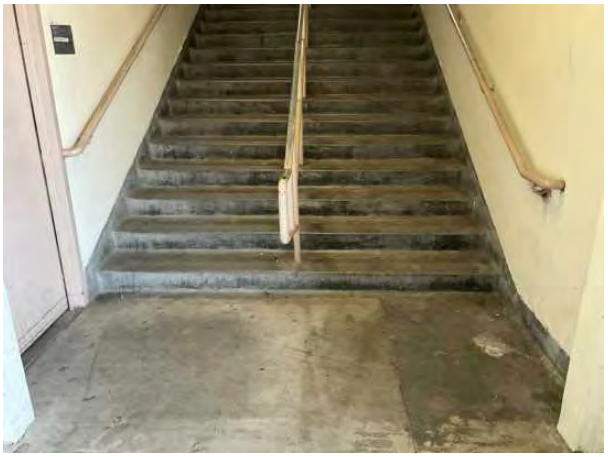

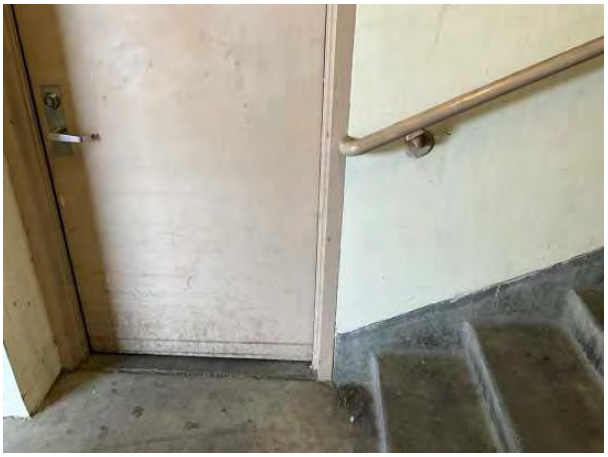

Barrier ID: AX418316

Pasadena High School BUILDING F

Assembly	Interior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-505.4, 505.10
Barrier Detail	CALIFORNIA: The stair handrail extensions are not compliant.
Location Description	Building F - Stairs Near F100 A Boys Dressing Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	Three of the handrails do not provide the required 12 inch extensions.

Resolution

Install compliant handrail extensions at the top and bottom of the stair flight. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. The handrails at the bottom of the stairs shall extend at the s lope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTION: In alterations, where the extension of the handrail in the direction of stair flight would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of stair flight.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28 inches measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9 inches minimum, should be provided to help prevent entrapment.]


Quantity

3 LF


Priority	2

Photos for Barrier ID: AX418316



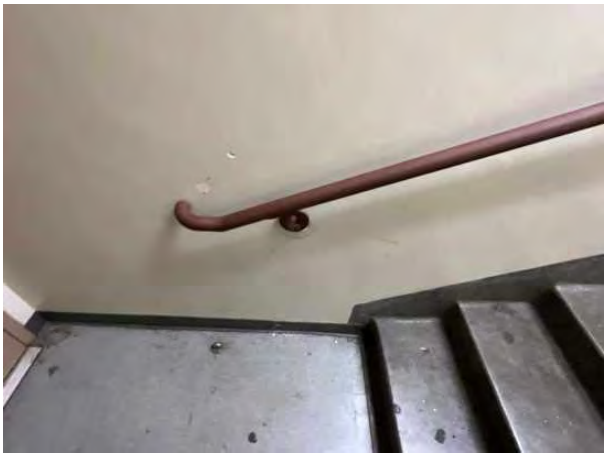



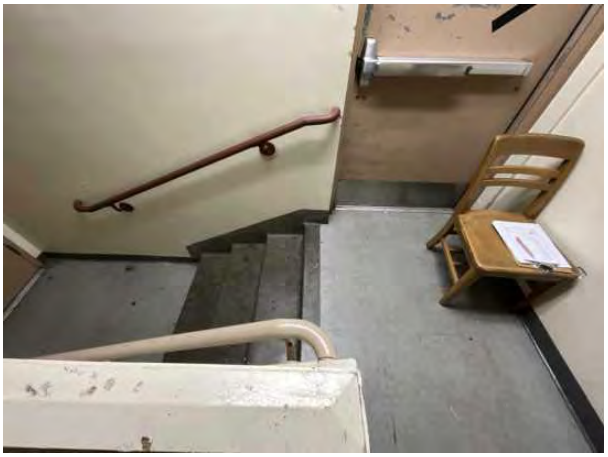

Barrier ID: AX419782

Pasadena High School BUILDING R

Assembly	Interior Access Route
Type	Stairs
ADA Standard	221.2.1.4; 802.1
Barrier Detail	A wheelchair space is not provided or is not compliant at the bleacher seating.
Location Description	Building R - R107 Gymnasium
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

971 total seats are provided. 16 wheelchair spaces are provided. 971 seats requires 10 accessible wheel chair spaces. Unable to verify the wheelchair spaces are the correct size.

Resolution

Provide at least one wheelchair space at each bleachers for the basketball court. Provide wheelchair spaces at the bleacher seating to comply with the following table: Number of Seats/Minimum No. of Required Wheelchair Spaces; under 25 seats- 1 wheelchair space; 25 to 50 seats- 2 wheelchair spaces; 51 to 150 seats- 4 wheelchair spaces; 151 to 300 seats- 5 wheelchair spaces; 301 to 500 seats-6 wheelchair spaces; 501 to 5000 seats- 6 wheelchair spaces, plus 1 for each 150, or fraction thereof, between 501 through 5000; 5001 and over seats-36 wheelchair spaces, plus 1 for each 200, or fraction thereof, over 5000. Wheelchair spaces shall not have slopes steeper than 1:48. A single wheelchair space shall be 36" wide minimum. Where two or more wheelchair spaces are provided, each wheelchair space shall be 33" wide minimum. Where a wheelchair space can be entered from the front or rear, the wheelchair space shall be 48" deep minimum. Where a wheelchair space can be entered only from the side, the wheelchair space shall be 60" deep minimum. Each wheelchair space shall adjoin an accessible route. Accessible routes shall not overlap wheelchair spaces, and access to any wheelchair space cannot be through another wheelchair space. Wheelchair spaces shall not overlap circulation paths, which are aisle width required by building or safety codes. Where a circulation path provided is wider than the required aisle width, the wheelchair space may intrude into that portion of the circulation path that is provided in excess of the required aisle width. The wheelchair space shall provide lines of sight to the ball play area.


Quantity


120 SF


Priority	2

Photos for Barrier ID: AX419782



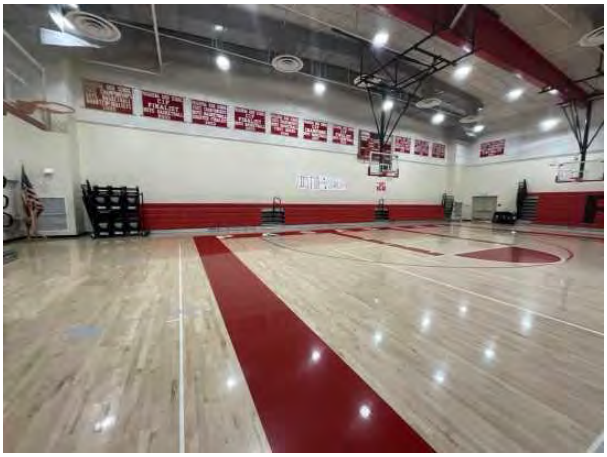

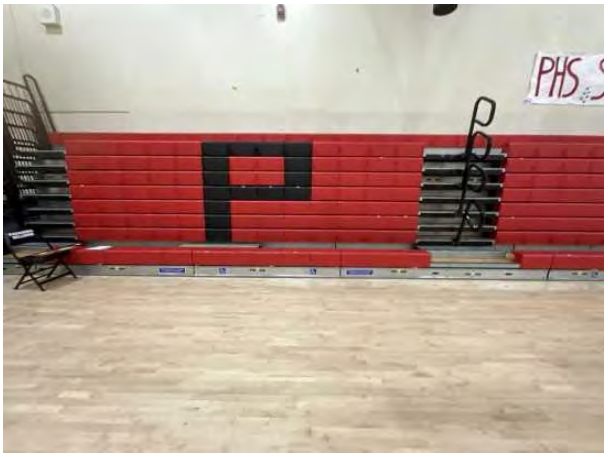

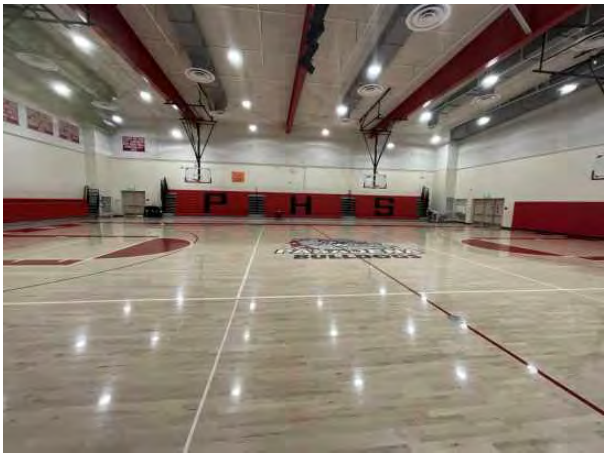

Barrier ID: AX418364

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-505.10
Barrier Detail	CALIFORNIA: The stair handrail extensions are not compliant.
Location Description	Stairs Southeast Side of Building G
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The stairs does not provide handrail extensions at the top or bottom of the stairs.

Resolution


Install compliant handrail extensions at the top and bottom of the stair flight. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTION: In alterations, where the extension of the handrail in the direction of stair flight would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of stair flight.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28 inches measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9 inches minimum, should be provided to help prevent entrapment.]

Quantity

10 LF


Priority	2

Map for Barrier ID: AX418364

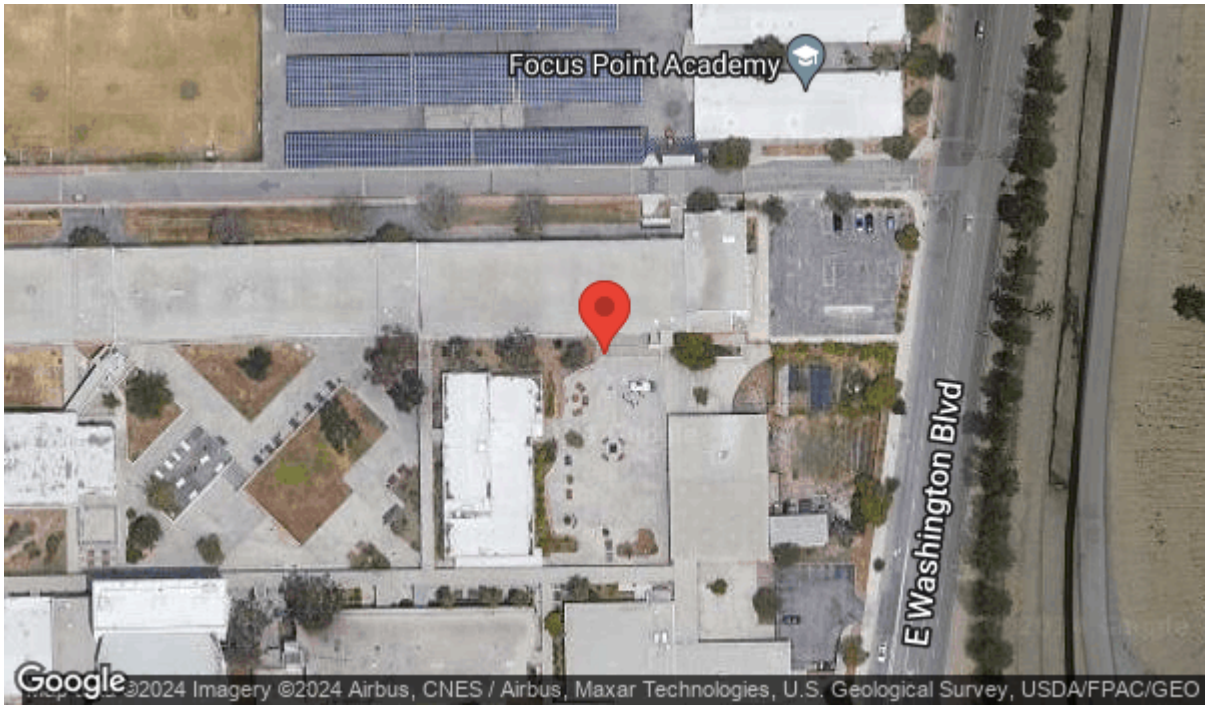

175 +34.162813, -118.090930

Photos for Barrier ID: AX418364

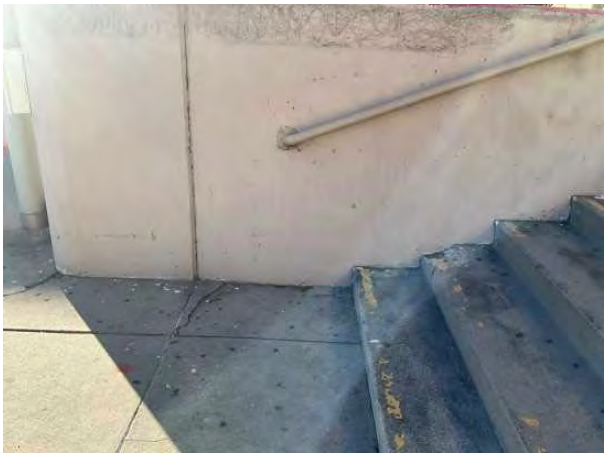



Barrier ID: AX418228

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-505.10
Barrier Detail	CALIFORNIA: The stair handrail extensions are not compliant.
Location Description	Stairs ST1
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

One handrail bottom extension does not provide the 12 inch horizontal extension.

Resolution


Install compliant handrail extensions at the top and bottom of the stair flight. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTION: In alterations, where the extension of the handrail in the direction of stair flight would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of stair flight.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28 inches measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9 inches minimum, should be provided to help prevent entrapment.]

Quantity

3 LF

Priority	2


Map for Barrier ID: AX418228

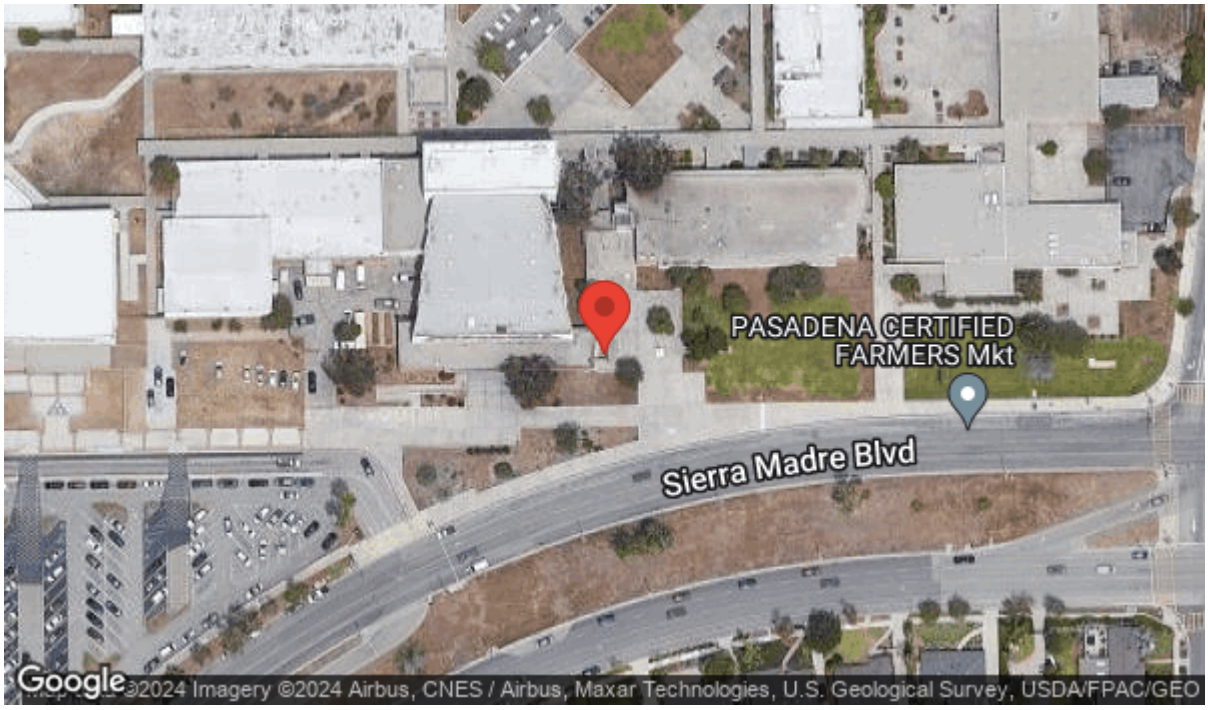

39 +34.161842, -118.091815

Photos for Barrier ID: AX418228



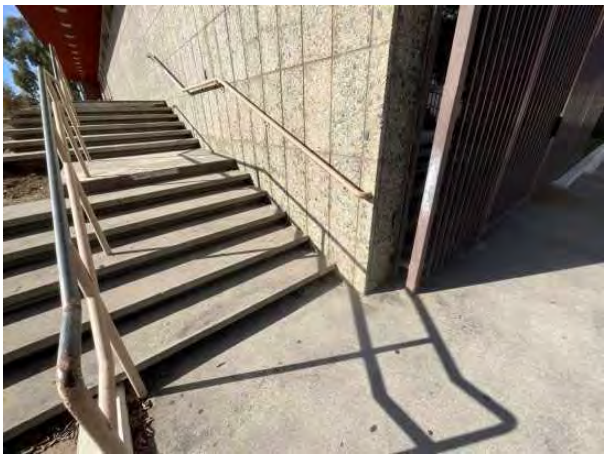

Barrier ID: AX420148

Pasadena High School GENERAL EXTERIOR

Assembly	Exterior Access Route
Type	Stairs
ADA Standard	California Builiding Code Chap 11B-505.10
Barrier Detail	CALIFORNIA: The stair handrail extensions are not compliant.
Location Description	Stairs ST10 SE Side of Building T
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The top and bottom of the stairs do not provide the required extensions.

Resolution

Install compliant handrail extensions at the top and bottom of the stair flight. At the top of a stair flight, handrails shall extend horizontally above the landing for 12 inches minimum beginning directly above the first riser nosing. The handrails at the bottom of the stairs shall extend at the slope of the stair flight for a horizontal distance equal to minimum one tread depth beyond the last riser nosing and then continue 12 inches minimum horizontally at a height equal to that of the sloping portion of the rail. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. [EXCEPTION: In alterations, where the extension of the handrail in the direction of stair flight would create a hazard, the extension of the handrail may be turned 90 degrees from the direction of stair flight.] [ADVISORY: It is advisable, but not required, to provide a handrail at a height designed for children. When children are the principal users in a building or facility (e.g., elementary schools), a second set of handrails at an appropriate height can assist them and aid in preventing accidents. A maximum height of 28 inches measured to the top of the gripping surface from the ramp surface or stair nosing is recommended for handrails designed for children. Sufficient vertical clearance between upper and lower handrails, 9 inches minimum, should be provided to help prevent entrapment.]

Quantity

6 LF

Priority	2

Map for Barrier ID: AX420148



527 +34.162561, -118.093230

Photos for Barrier ID: AX420148





Barrier ID: AX424505

Pasadena High School GENERAL EXTERIOR

Assembly	Common Areas
Type	Vending Machine
ADA Standard	228.1; 305; 308; 309
Barrier Detail	The vending machines have operable parts which are not within reach range.
Location Description	Vending Machines Adjacent To Building V
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	3 machines have controls over 48 inches above the floor.

Resolution

Where provided, at least one of each type of depository, vending machine, change machine, and fuel dispenser shall comply. A clear floor or ground space shall be provided. Operable parts shall be placed within one or more of the allowable reach ranges. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48" maximum and the low side reach shall be 15" minimum above the finish floor or ground. [EXCEPTION: An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10" maximum.] Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34" maximum and the depth of the obstruction shall be 24" maximum. The high side reach shall be 48" maximum for a reach depth of 10" maximum. Where the reach depth exceeds 10", the high side reach shall be 46" maximum for a reach depth of 24" maximum. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

3 EA

Priority	2

Map for Barrier ID: AX424505



751 +34.162307, -118.090765

Photos for Barrier ID: AX424505









Barrier ID: AX424521

Pasadena High School GENERAL EXTERIOR

Assembly	Common Areas
Type	Vending Machine
ADA Standard	228.1; 305; 308; 309
Barrier Detail	The vending machines have operable parts which are not within reach range.
Location Description	Vending Machines Lower Quad Dining Area
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	3 vending machines have controls over 48 inches above the floor.

Resolution


Where provided, at least one of each type of depository, vending machine, change machine, and fuel dispenser shall comply. A clear floor or ground space shall be provided. Operable parts shall be placed within one or more of the allowable reach ranges. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48" maximum and the low side reach shall be 15" minimum above the finish floor or ground. [EXCEPTION: An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10" maximum.] Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34" maximum and the depth of the obstruction shall be 24" maximum. The high side reach shall be 48" maximum for a reach depth of 10" maximum. Where the reach depth exceeds 10", the high side reach shall be 46" maximum for a reach depth of 24" maximum. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

3 EA

Priority	2

Map for Barrier ID: AX424521

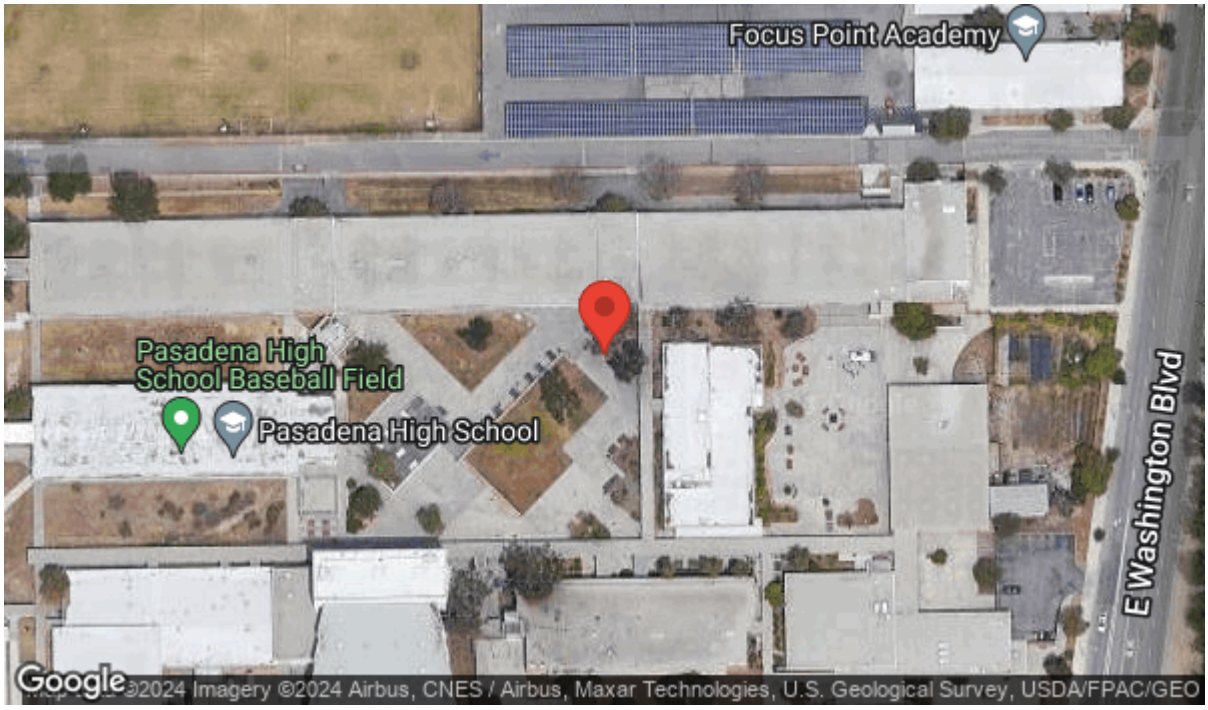

767 +34.162745, -118.091521

Photos for Barrier ID: AX424521









Barrier ID: AX418307

Pasadena High School BUILDING F

Assembly	Common Areas
Type	Assembly Area
ADA Standard	216.10; 219; 706
Barrier Detail	Assistive listening signage is not compliant or is not provided.
Location Description	Building F - F101 Little Theater
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	Assistive listening device signage is not provided.

Resolution


Provide assistive listening signage. Each assembly area required to provide assistive listening systems shall provide signs informing patrons of the availability of the assistive listening system. Assistive listening signs shall comply and shall include the International Symbol of Access for Hearing Loss. [EXCEPTION: Where ticket offices or windows are provided, signs shall not be required at each assembly area provided that signs are displayed at each ticket office or window informing patrons of the availability of assistive listening systems].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418307

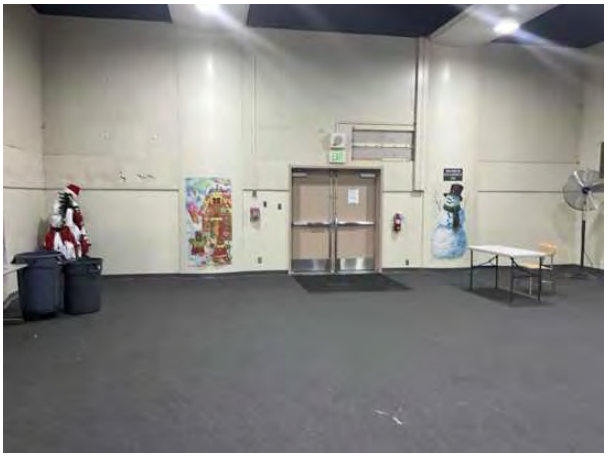







Barrier ID: AX424447

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A101B Restroom Unisex
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 41 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424447





Barrier ID: AX424449

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A101B Restroom Unisex
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The soap dispenser is 44 inches above the floor and the paper towel dispenser is 52 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

21 EA

Priority	3

Photos for Barrier ID: AX424449







Barrier ID: AX424457

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A101B Restroom Unisex
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The soap dispenser is 41 1/2 inches above the floor and the paper towel dispenser is 55 inches above the floor.

Resolution


Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424457

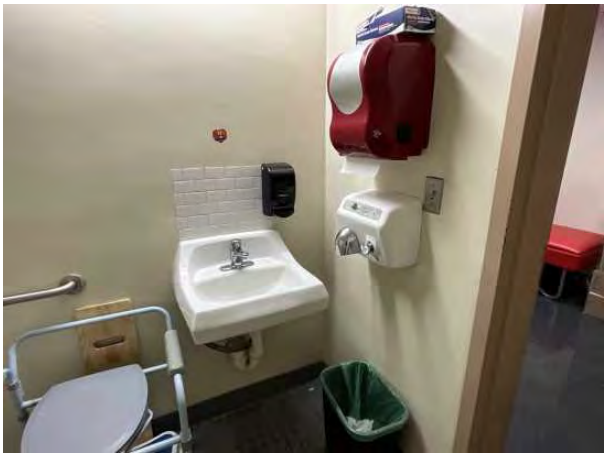





Barrier ID: AX424458

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A101B Restroom Unisex
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The product dispenser is 49 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424458





Barrier ID: AX424470

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A110 Restroom
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The seat cover dispenser is 47 inches above the floor and does not provide a 30 x 48 clear space in front due to the water closet.

Resolution


Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX424470

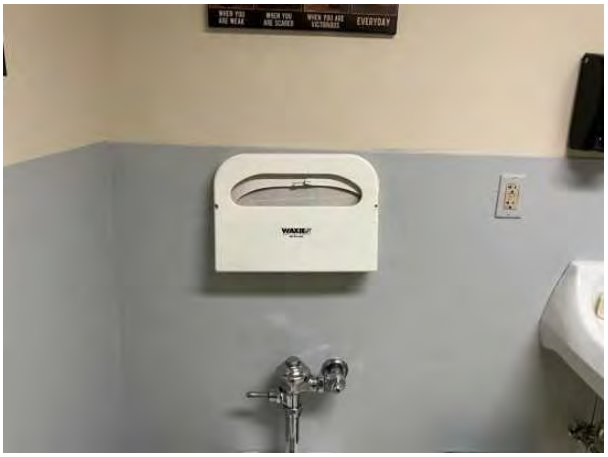



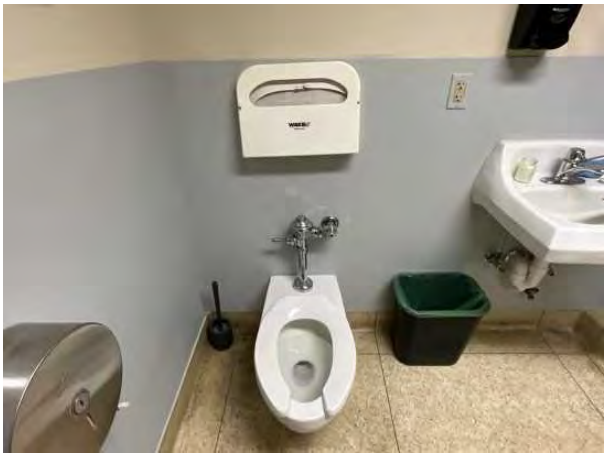

Barrier ID: AX424471

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A110 Restroom
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The soap dispenser is 52 1/2 inches above the floor and the paper paper towel dispenser is 52 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

4 EA

Priority	3

Photos for Barrier ID: AX424471



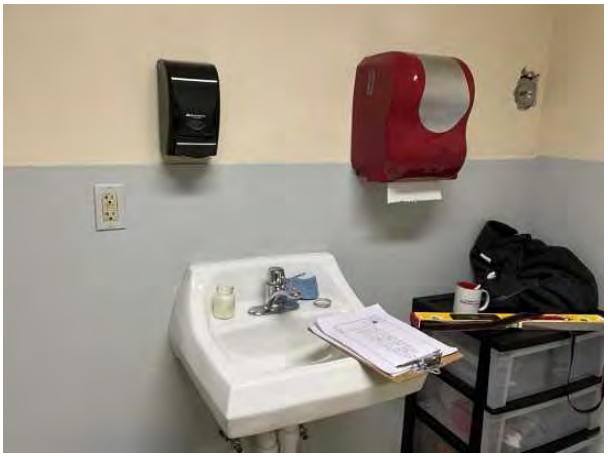



Barrier ID: AX424481

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A112 Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 41 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424481





Barrier ID: AX424485

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A112 Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The paper towel dispenser is 53 inches above the floor and the soap dispenser is 42 1/2 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424485







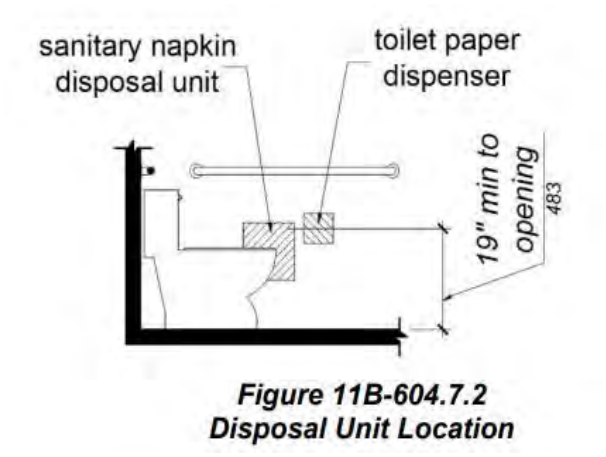


Figure 11B-604.7.2
Disposal Unit Location

Barrier ID: AX424404

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A253B Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 59 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424404





Barrier ID: AX424393

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A253C Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 60 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424393





Barrier ID: AX424413

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A255B Restroom Women's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 41 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424413



Barrier ID: AX424415

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A255B Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The soap dispenser is 41 inches above the floor and the paper towel dispenser is 59 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

2 EA

Priority	3

Photos for Barrier ID: AX424415







Barrier ID: AX424418

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A255C Restroom Women's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 42 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424418





Barrier ID: AX424422

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - A255C Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The soap dispenser is 41 inches above the floor and the paper towel dispenser is 60 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

2 EA

Priority	3

Photos for Barrier ID: AX424422



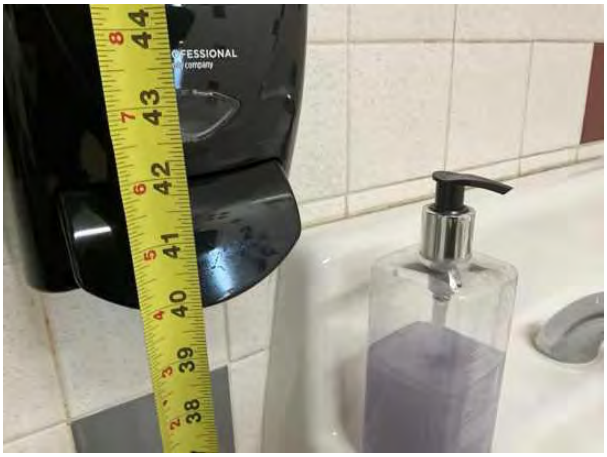



Barrier ID: AX424495

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 41 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424495



Barrier ID: AX424499

Pasadena High School BUILDING A

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The soap dispenser is 40 1/2 inches above the floor and the paper towel dispenser is 53 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

2 EA

Priority	3

Photos for Barrier ID: AX424499



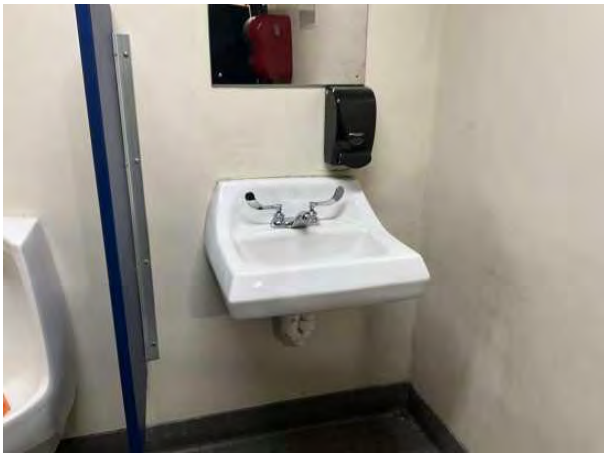



Barrier ID: AX419819

Pasadena High School BUILDING B

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building B - B110 Girls Dressing
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The soap dispenser is 44 inches above the floor and the paper towel dispenser is 51 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

2 EA

Priority	3

Photos for Barrier ID: AX419819





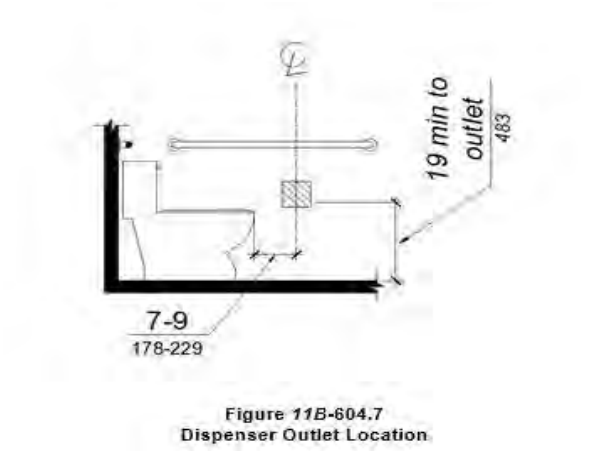


Figure *11B*-604.7
Dispenser Outlet Location





Barrier ID: AX419820

Pasadena High School BUILDING B

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	606.1; 309.3
Barrier Detail	The height of controls are not compliant.
Location Description	Building B - B110 Girls Dressing
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

One light switch is 49 inches above the floor and the other is 54 inches above the floor.

Resolution

Provide operable parts of all controls, dispenser, receptacle and other operable equipment within at least one of the reach ranges. Operable parts shall be placed within one or more of the reach ranges. Unobstructed Forward Reach: Where a forward reach is unobstructed, the high forward reach shall be 48" maximum and the low forward reach shall be 15" minimum above the finish floor or ground. Obstructed High Forward Reach: Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48" maximum where the reach depth is 20" maximum. Where the reach depth exceeds 20", the high forward reach shall be 44" maximum and the reach depth shall be 25" maximum. Unobstructed Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48" maximum and the low side reach shall be 15" minimum above the finish floor or ground. [EXCEPTION: An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10" maximum.] Obstructed High Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34" maximum and the depth of the obstruction shall be 24" maximum. The high side reach shall be 48" maximum for a reach depth of 10" maximum. Where the reach depth exceeds 10", the high side reach shall be 46" maximum for a reach depth of 24" maximum. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

2 EA

Priority	3

Photos for Barrier ID: AX419820







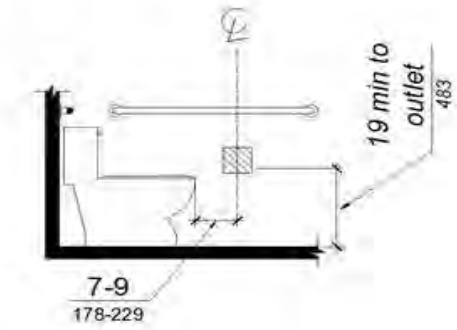


Figure *11B*-604.7
Dispenser Outlet Location



Barrier ID: AX419849

Pasadena High School BUILDING B

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building B - B112 Boys Dressing
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispenser is 44 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419849

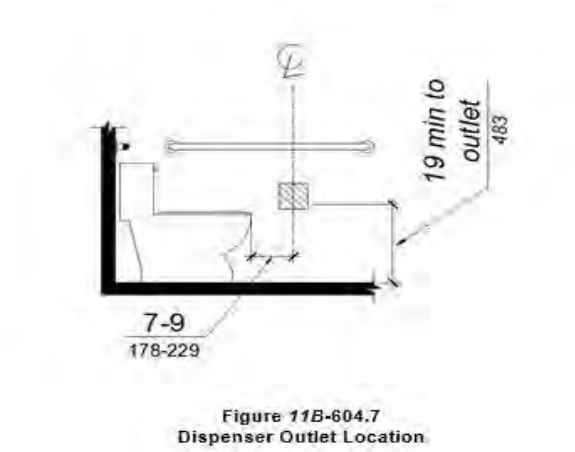


Figure *11B*-604.7
Dispenser Outlet Location





Barrier ID: AX419850

Pasadena High School BUILDING B

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building B - B112 Boys Dressing
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 51 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419850

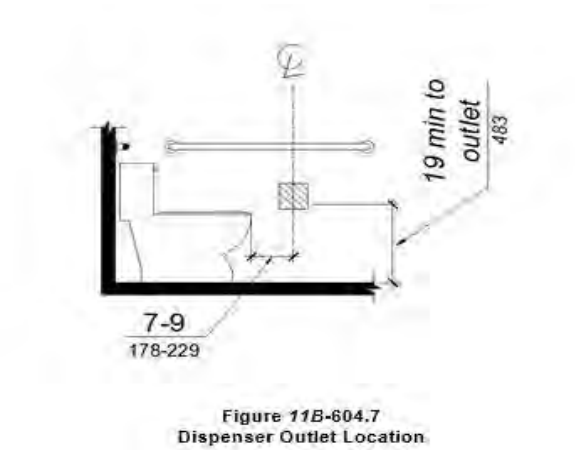


Figure *11B*-604.7
Dispenser Outlet Location





Barrier ID: AX419852

Pasadena High School BUILDING B

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building B - B112 Boys Dressing
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 41 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419852



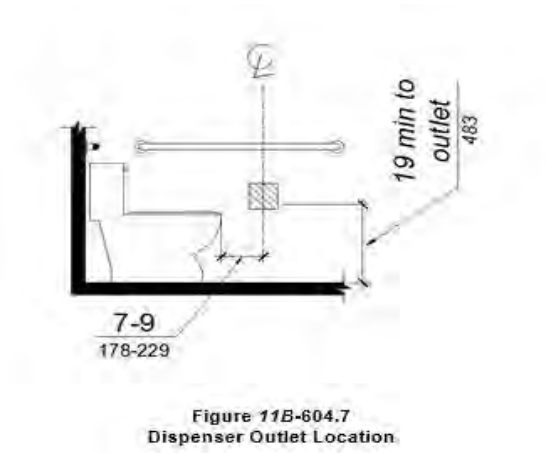


Figure *11B*-604.7
Dispenser Outlet Location



Barrier ID: AX418252

Pasadena High School BUILDING B

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building B - Restroom Men's B 107
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispenser is 42 1/2 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418252





Barrier ID: AX419869

Pasadena High School BUILDING C

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building C - Restroom Men's
Observed	Dec 10, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 43 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419869





Barrier ID: AX419872

Pasadena High School BUILDING C

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building C - Restroom Men's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 57 inches above the floor.

Resolution


Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419872

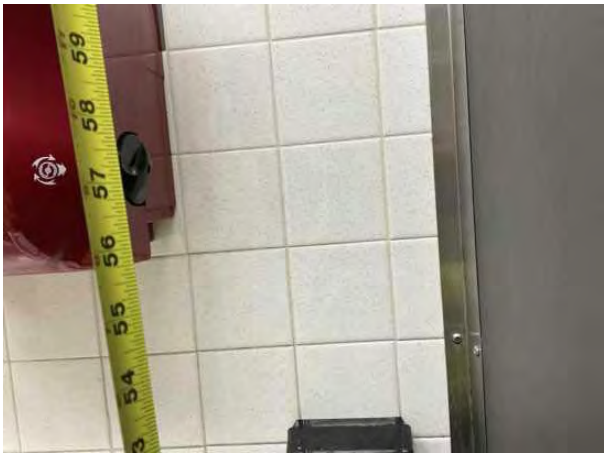

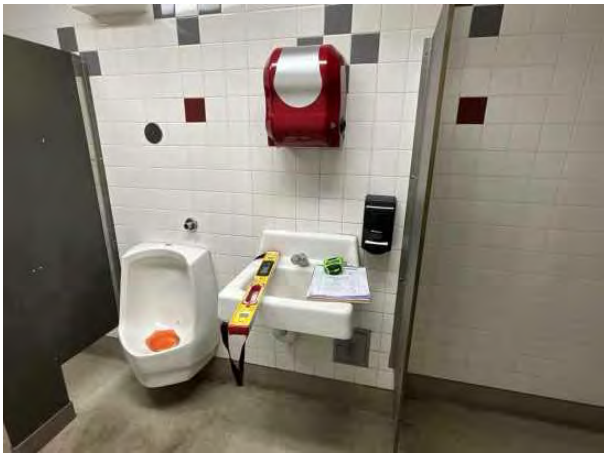

Barrier ID: AX419863

Pasadena High School BUILDING C

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building C - Testroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 51 inches above the floor.

Resolution


Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419863

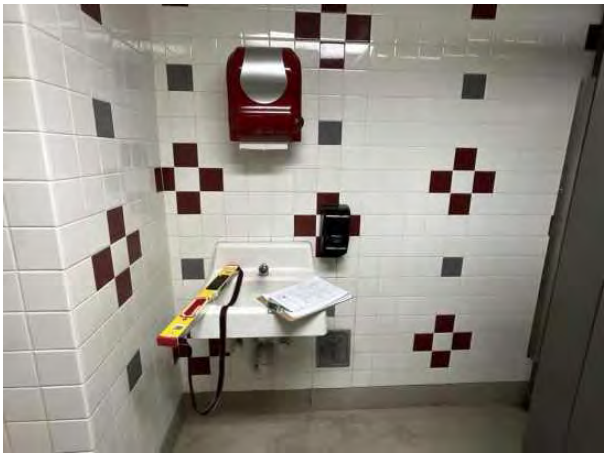



Barrier ID: AX418384

Pasadena High School BUILDING D

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building D - Restroom D102A Men
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 48 inches above the floor.

Resolution


Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418384

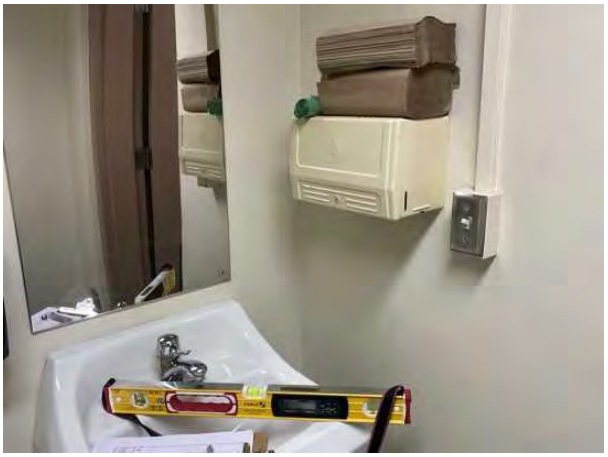



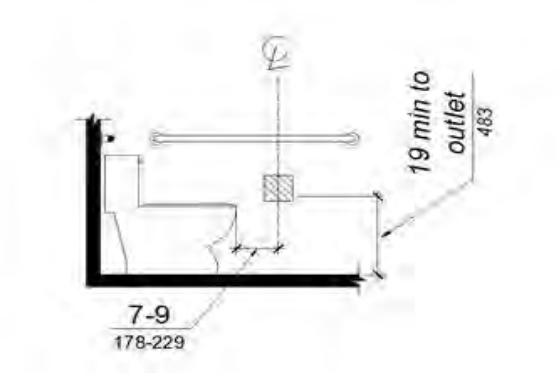


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX418390

Pasadena High School BUILDING D

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building D - Restroom D102B Women
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 58 inches above the floor.

Resolution


Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418390

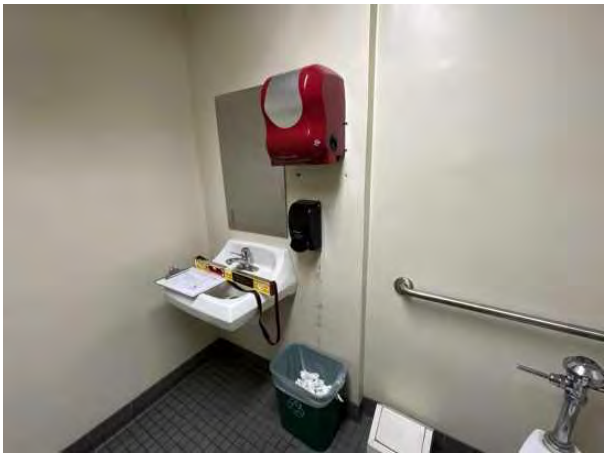



Barrier ID: AX420249

Pasadena High School BUILDING E

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building E - 1st Floor Restroom Boy's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The seat covered dispenser is 42 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420249





Barrier ID: AX420250

Pasadena High School BUILDING E

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building E - 1st Floor Restroom Boy's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispenser is 42 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420250





Barrier ID: AX420241

Pasadena High School BUILDING E

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building E - 1st Floor Restroom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The seat covered dispenser is 42 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420241





Barrier ID: AX420202

Pasadena High School BUILDING E

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building E - 1st Floor Restroom Men's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 41 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420202



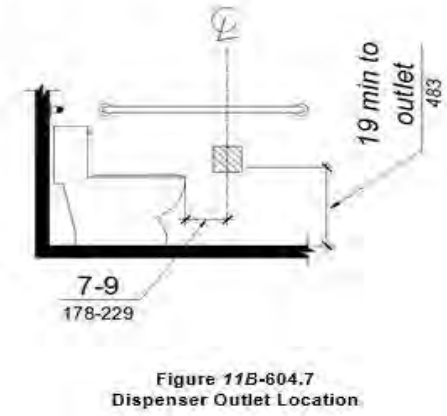


Figure 11B-604.7
Dispenser Outlet Location

Barrier ID: AX420203

Pasadena High School BUILDING E

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building E - 1st Floor Restroom Men's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispenser is 42 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420203



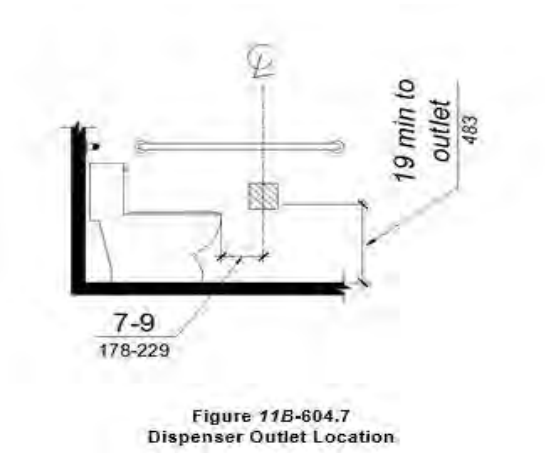


Figure *11B*-604.7
Dispenser Outlet Location



Barrier ID: AX420204

Pasadena High School BUILDING E

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building E - 1st Floor Restroom Men's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 5/8 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420204

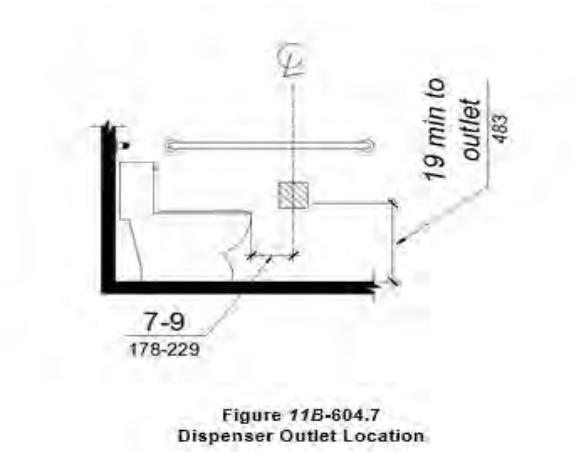


Figure 11B-604.7
Dispenser Outlet Location



Barrier ID: AX420210

Pasadena High School BUILDING E

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building E - 1st Floor Restroom Women's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 41 1/2 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420210




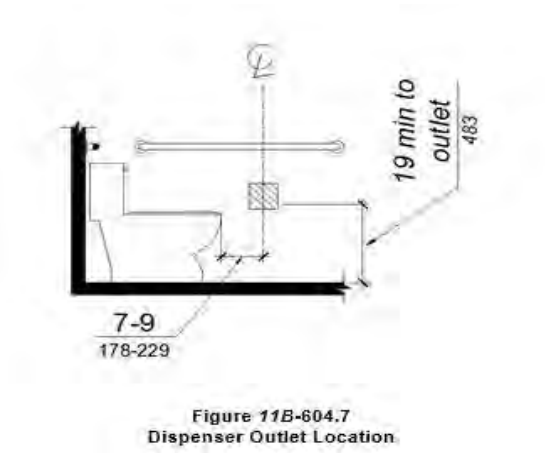


Figure *11B*-604.7
Dispenser Outlet Location

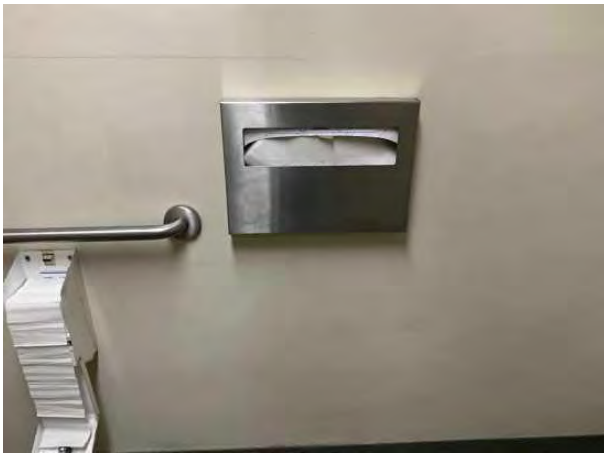

Barrier ID: AX420211

Pasadena High School BUILDING E

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building E - 1st Floor Restroom Women's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispenser is 44 1/2 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420211



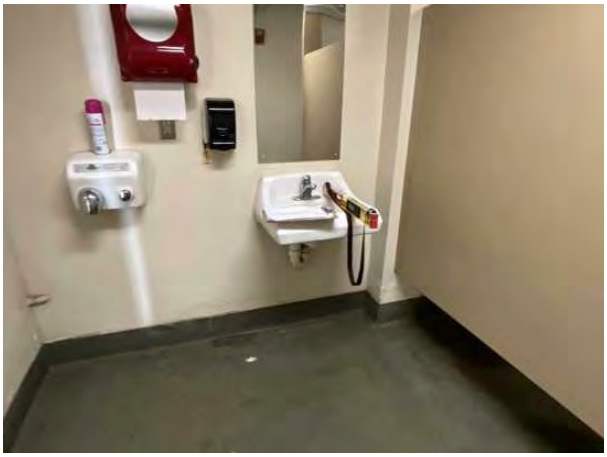

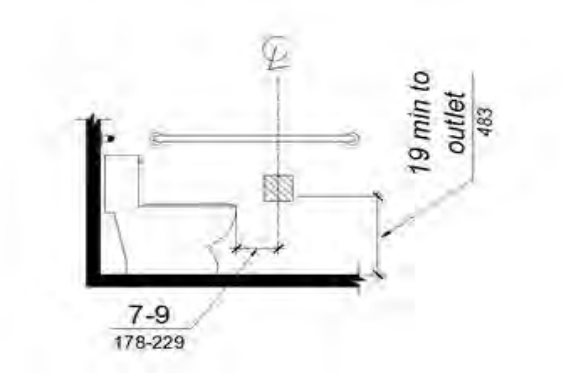


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX420212

Pasadena High School BUILDING E

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building E - 1st Floor Restroom Women's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 58 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420212



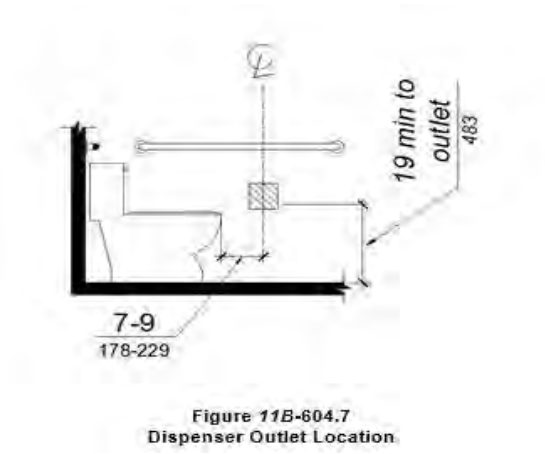


Figure *11B*-604.7
Dispenser Outlet Location



Barrier ID: AX420139

Pasadena High School BUILDING E

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building E - 2nd Floor Restroom Men's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 56 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420139



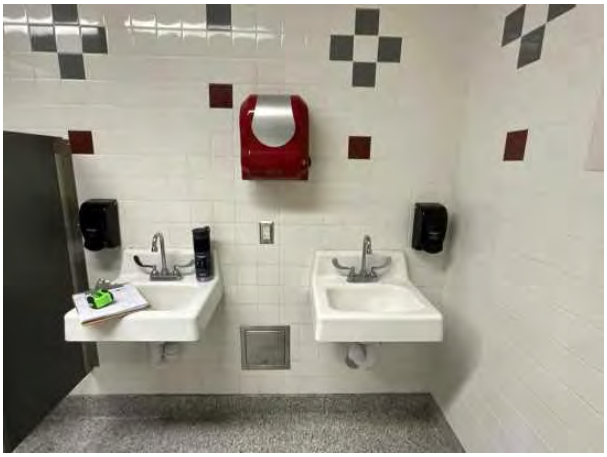

Barrier ID: AX420140

Pasadena High School BUILDING E

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	606.1; 309.3
Barrier Detail	The height of controls are not compliant.
Location Description	Building E - 2nd Floor Restroom Men's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The light switch is 55 inches above the floor.

Resolution

Provide operable parts of all controls, dispenser, receptacle and other operable equipment within at least one of the reach ranges. Operable parts shall be placed within one or more of the reach ranges. Unobstructed Forward Reach: Where a forward reach is unobstructed, the high forward reach shall be 48" maximum and the low forward reach shall be 15" minimum above the finish floor or ground. Obstructed High Forward Reach: Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48" maximum where the reach depth is 20" maximum. Where the reach depth exceeds 20", the high forward reach shall be 44" maximum and the reach depth shall be 25" maximum. Unobstructed Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48" maximum and the low side reach shall be 15" minimum above the finish floor or ground. [EXCEPTION: An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10" maximum.] Obstructed High Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34" maximum and the depth of the obstruction shall be 24" maximum. The high side reach shall be 48" maximum for a reach depth of 10" maximum. Where the reach depth exceeds 10", the high side reach shall be 46" maximum for a reach depth of 24" maximum. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420140



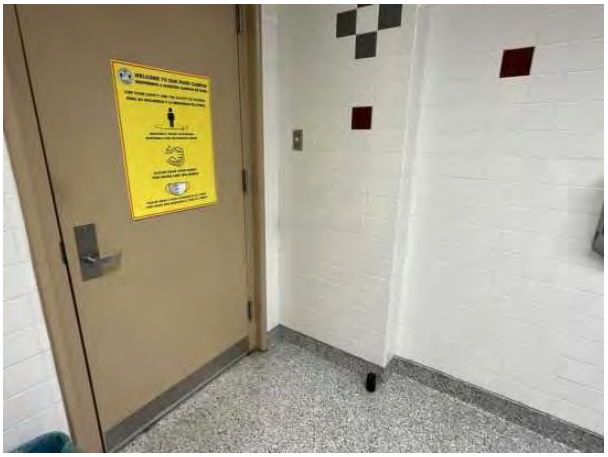

Barrier ID: AX420142

Pasadena High School BUILDING E

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building E - 2nd Floor Restroom Women's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser control is 57 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420142



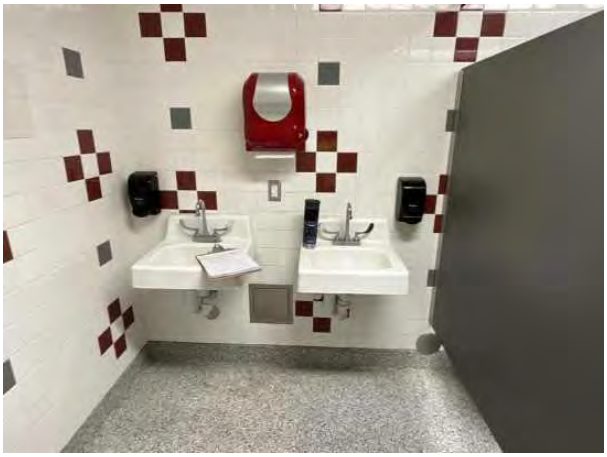

Barrier ID: AX418319

Pasadena High School BUILDING F

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building F - Restroom F100B Unisex
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 43 inches above the floor.

Resolution


Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418319

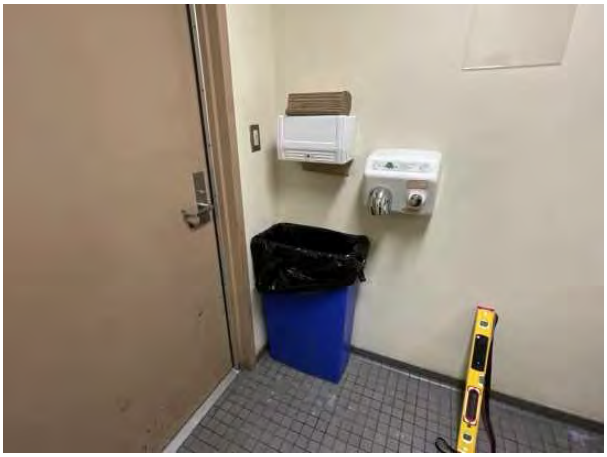



Barrier ID: AX418326

Pasadena High School BUILDING F

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building F - Restroom F100B Unisex
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 41 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418326



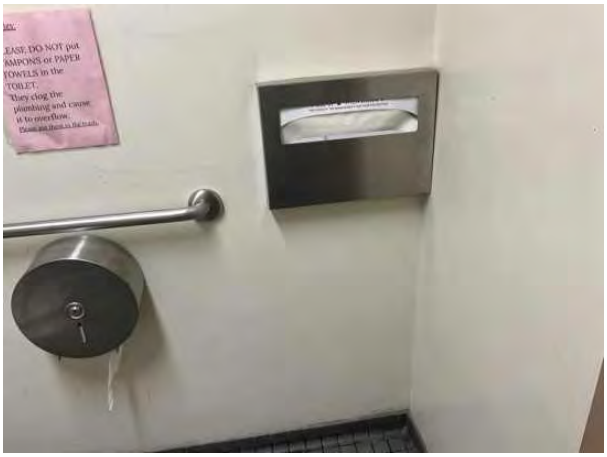

Barrier ID: AX418288

Pasadena High School BUILDING F

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building F - Restroom F121 Women's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	Paper towel dispenser is 56 inches above the floor.

Resolution


Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418288

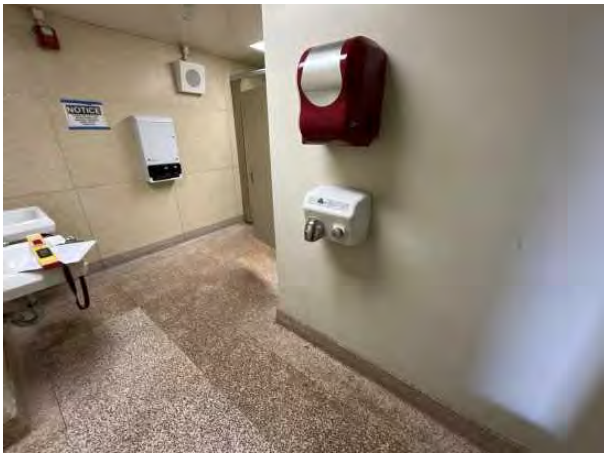



Barrier ID: AX418289

Pasadena High School BUILDING F

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building F - Restroom F121 Women's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The product dispenser protrudes 5 1/2 inches from the wall where the bottom edge is 35 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418289







Barrier ID: AX418294

Pasadena High School BUILDING F

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building F - Restroom F121 Women's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 41 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418294





Barrier ID: AX418298

Pasadena High School BUILDING F

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building F - Restroom F122 Men's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 57 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418298



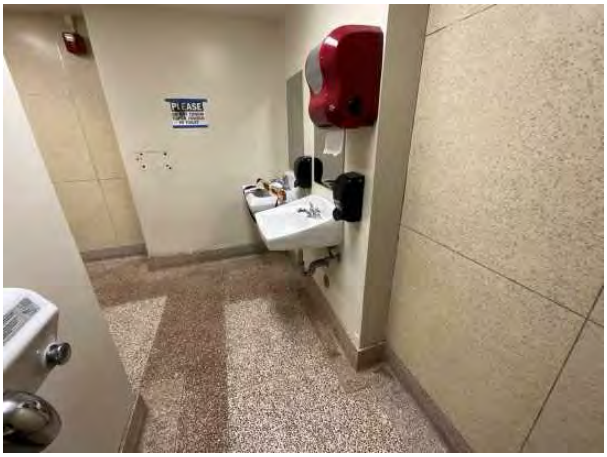

Barrier ID: AX418303

Pasadena High School BUILDING F

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building F - Restroom F122 Men's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The seat cover dispenser is 62 inches above the floor and does not provide a 30 x 48" clear space in front.

Resolution


Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418303

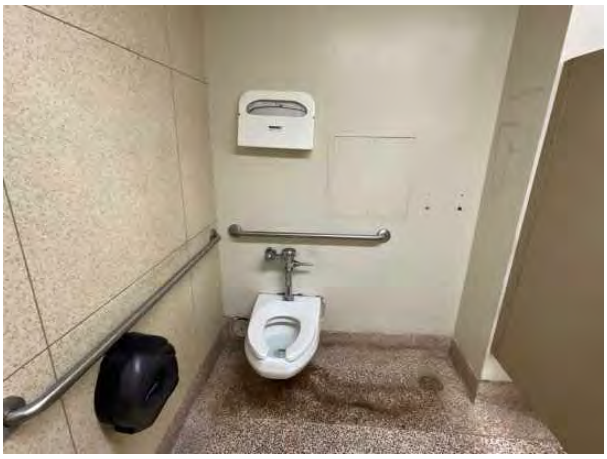



Barrier ID: AX419723

Pasadena High School BUILDING H

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building H East End - 1st Floor Restroom Boys
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispenser control is 43 1/2 inches above the floor

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419723



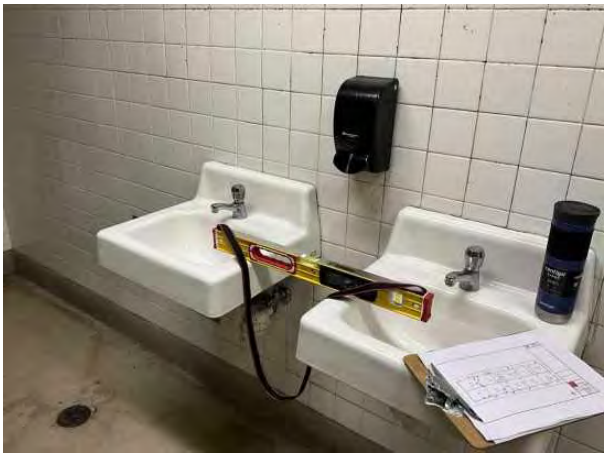

Barrier ID: AX419748

Pasadena High School BUILDING H

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building H East End - 1st Floor Restroom Men's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispenser is 41 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419748





Barrier ID: AX419749

Pasadena High School BUILDING H

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building H East End - 1st Floor Restroom Men's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 54 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419749



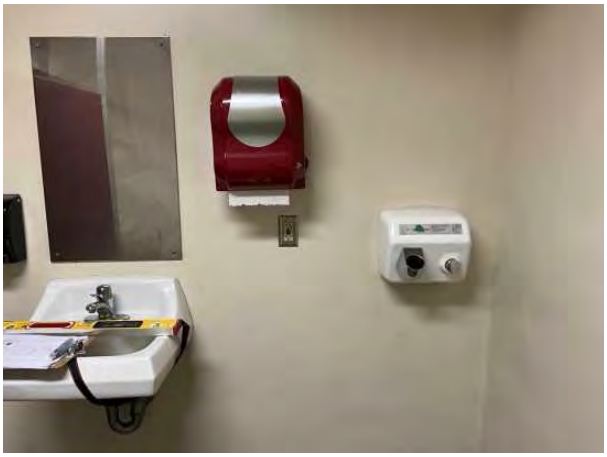

Barrier ID: AX419753

Pasadena High School BUILDING H

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building H East End - 1st Floor Restroom Women's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 59 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419753

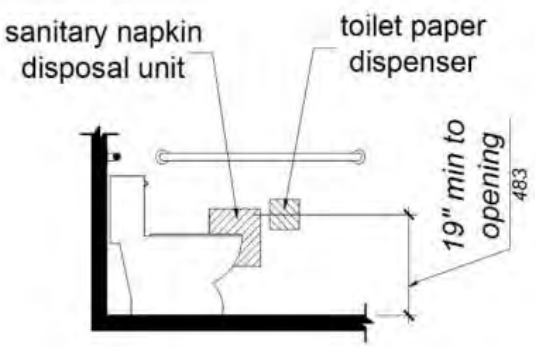


Figure 11B-604.7.2
Disposal Unit Location





Barrier ID: AX419755

Pasadena High School BUILDING H

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building H East End - 1st Floor Restroom Women's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel control is 57 inches above the floor.

Resolution


Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419755

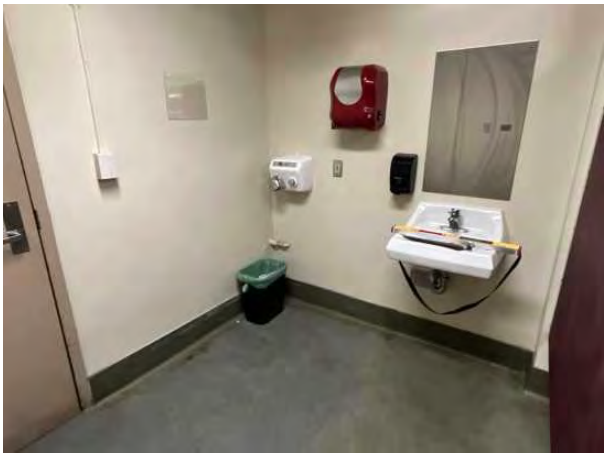



Barrier ID: AX419733

Pasadena High School BUILDING H

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building H East End - 2nd Floor Restroom Girls
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispenser control is 40 1/2 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419733



Barrier ID: AX419764

Pasadena High School BUILDING I

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building I East End - 2nd Floor Restroom Men's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser control is 60 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419764


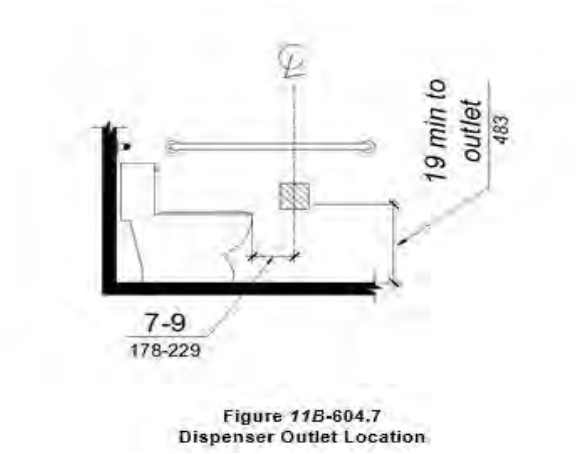


Figure *11B*-604.7
Dispenser Outlet Location



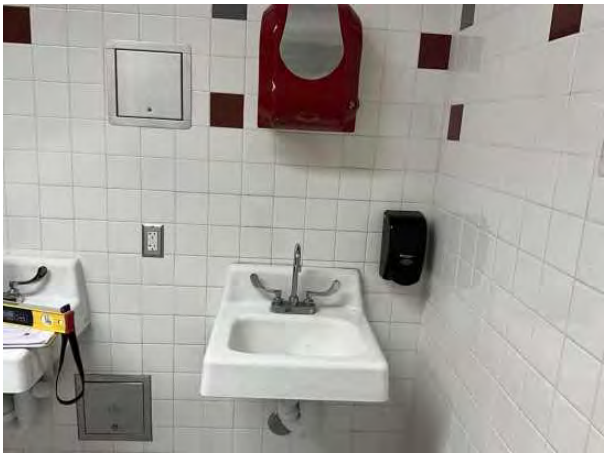

Barrier ID: AX419768

Pasadena High School BUILDING I

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building I East End - 2nd Floor Restroom Women's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 60 inches above the floor.

Resolution


Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419768

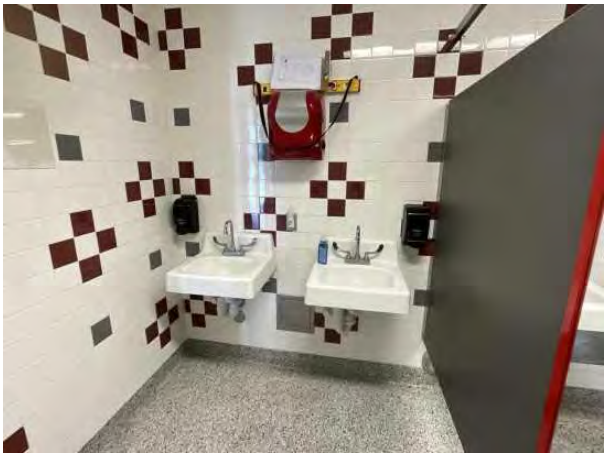



Barrier ID: AX418673

Pasadena High School BUILDING N

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building N - Restroom Women's Multi-User
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 42 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418673



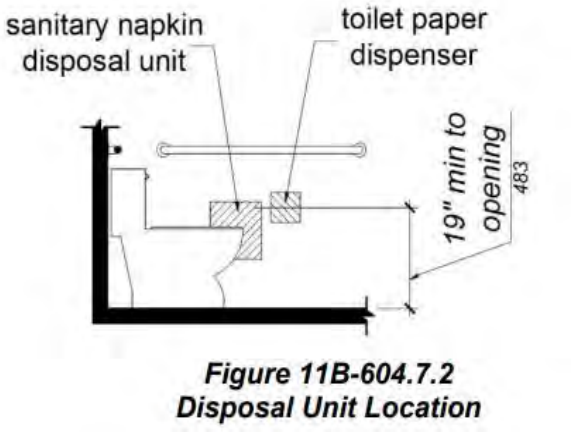


Figure 11B-604.7.2
Disposal Unit Location



Barrier ID: AX418675

Pasadena High School BUILDING N

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building N - Restroom Women's Multi-User
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 59 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418675



Barrier ID: AX418658

Pasadena High School BUILDING P

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building P - Restroom Men's Multi-User
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 42 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418658



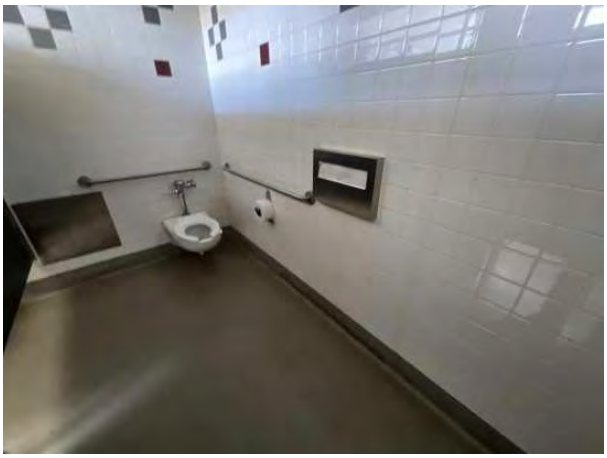

Barrier ID: AX419878

Pasadena High School BUILDING R

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building R Restroom - Men's 104B
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispenser is 44 1/2 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419878





Barrier ID: AX419789

Pasadena High School BUILDING R

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building R - Restroom Women's R105A
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispensers are 43 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419789



Barrier ID: AX419807

Pasadena High School BUILDING S

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	606.1; 309.4
Barrier Detail	Controls on dispensers are not compliant.
Location Description	Building S - Restroom Men's S105
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The shower, vertical adjustment control is a knob and requires tight, grasping and twisting of the wrist to operate.

Resolution


Provide compliant controls and operating mechanisms. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419807

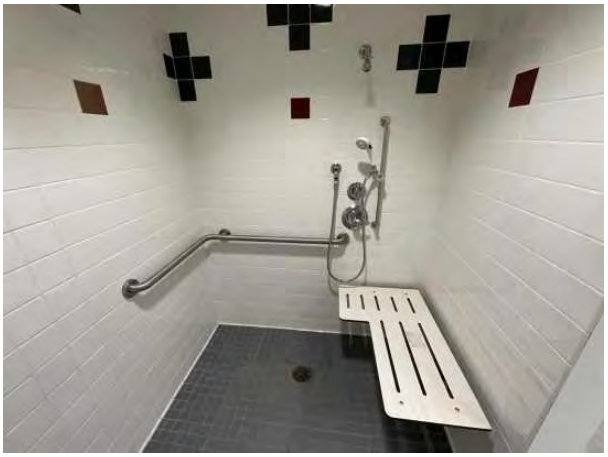



Barrier ID: AX419884

Pasadena High School BUILDING S

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	606.1; 309.4
Barrier Detail	Controls on dispensers are not compliant.
Location Description	Building S - S112 Accessible Shower Boys Locker Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The height adjustment bar has a knob type control, requiring twisting of the wrist and tight grasping.

Resolution


Provide compliant controls and operating mechanisms. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419884

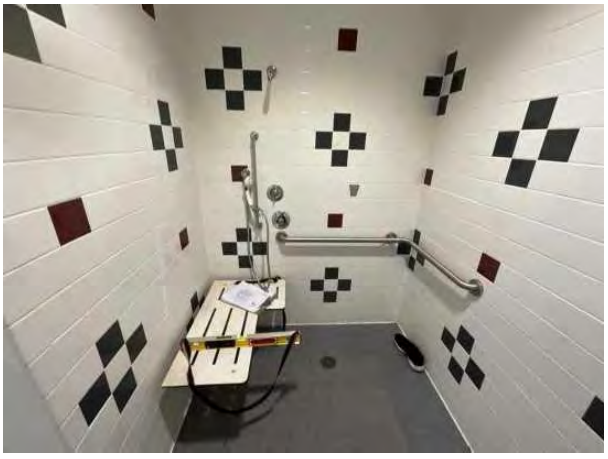



Barrier ID: AX419910

Pasadena High School BUILDING S

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	606.1; 309.4
Barrier Detail	Controls on dispensers are not compliant.
Location Description	Building S - S117 Girls Locker Room Shower
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The shower spray vertical adjustment bar has a knob type control, requiring tight, grasping, and twisting of the wrist.

Resolution


Provide compliant controls and operating mechanisms. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.


Quantity

1 EA


Priority	3

Photos for Barrier ID: AX419910

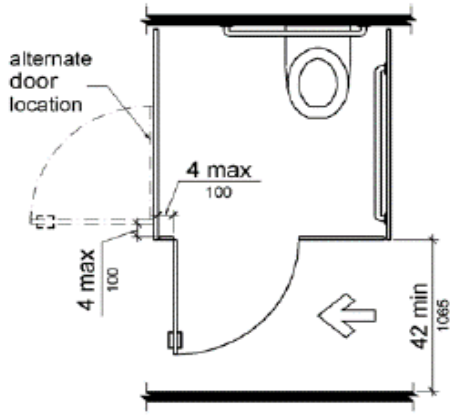

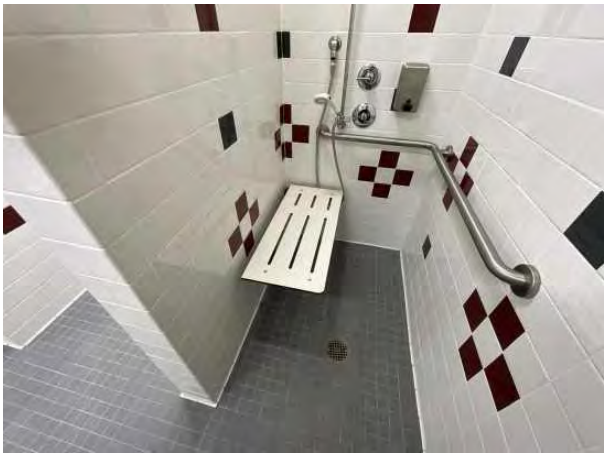



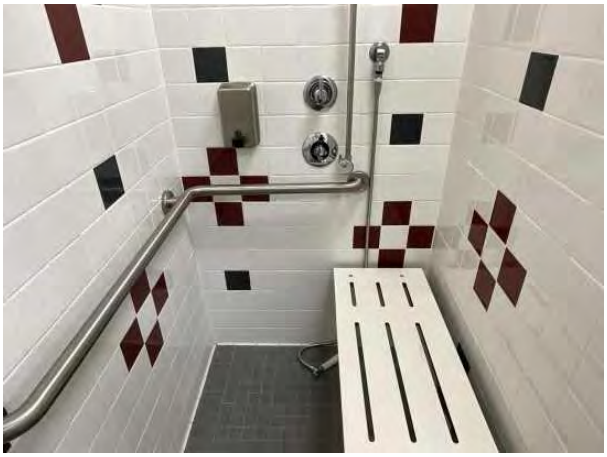

Barrier ID: AX419903

Pasadena High School BUILDING S

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	606.1; 309.4
Barrier Detail	Controls on dispensers are not compliant.
Location Description	Building S - S130 Faculty Locker Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The height adjustment bar has a knob type hardware, requiring tight, grasping, and twisting of the wrist to open.

Resolution


Provide compliant controls and operating mechanisms. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX419903

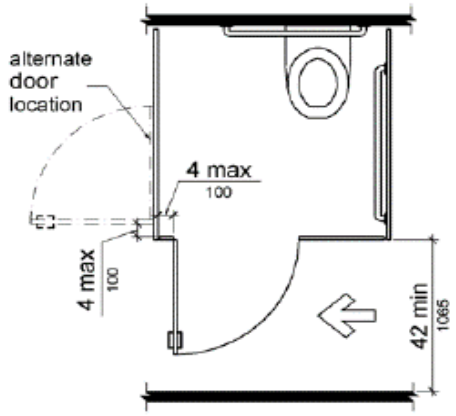



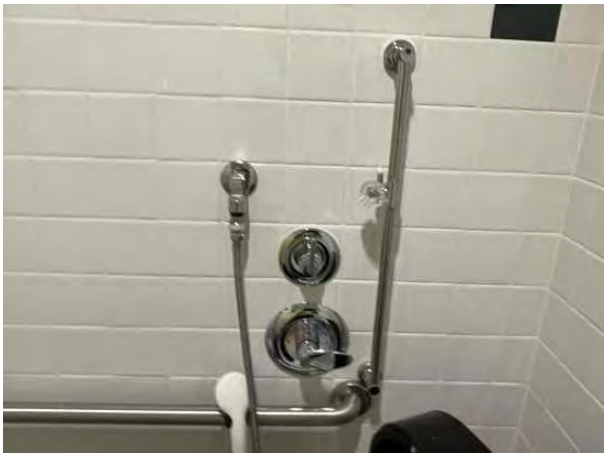

Barrier ID: AX420127

Pasadena High School BUILDING T

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building T - T110 Restroom Boys
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispenser control is 41 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420127



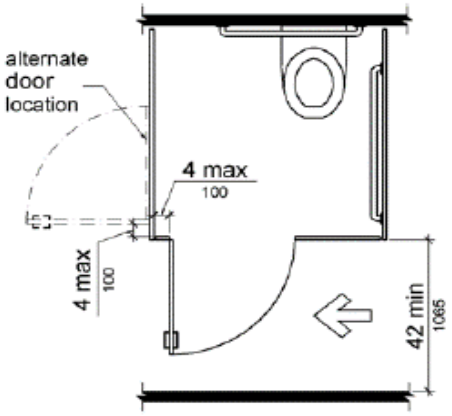



Barrier ID: AX424550

Pasadena High School BUILDING U

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 61 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424550





Barrier ID: AX424551

Pasadena High School BUILDING U

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	Paper towel dispenser is 52 1/4 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424551





Barrier ID: AX420180

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Portable Trailer Restoom Boy's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The paper towel dispenser is 49 inches above the floor and the soap dispenser is 42 1/2 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity


2 EA

Priority	3

Photos for Barrier ID: AX420180





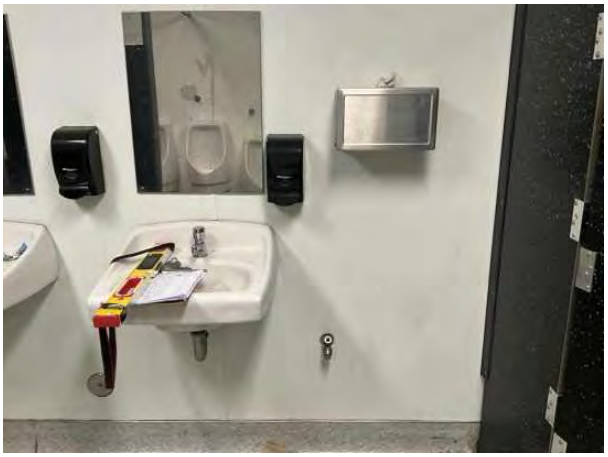

Barrier ID: AX420167

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Portable Trailer Restoom Staff
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The soap dispenser is 41 inches above the floor and the paper towel dispenser is 51 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

2 EA


Priority	3

Photos for Barrier ID: AX420167







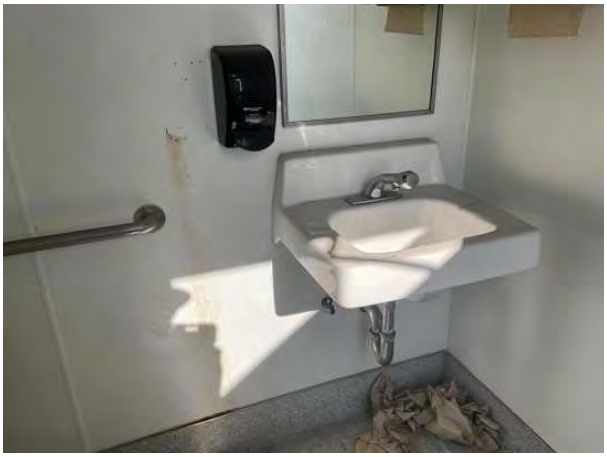

Barrier ID: AX420169

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	606.1; 309.3
Barrier Detail	The height of controls are not compliant.
Location Description	Portable Trailer Restoom Staff
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The light switch is 49 inches above the floor measured to the top of the box.

Resolution

Provide operable parts of all controls, dispenser, receptacle and other operable equipment within at least one of the reach ranges. Operable parts shall be placed within one or more of the reach ranges. Unobstructed Forward Reach: Where a forward reach is unobstructed, the high forward reach shall be 48" maximum and the low forward reach shall be 15" minimum above the finish floor or ground. Obstructed High Forward Reach: Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48" maximum where the reach depth is 20" maximum. Where the reach depth exceeds 20", the high forward reach shall be 44" maximum and the reach depth shall be 25" maximum. Unobstructed Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48" maximum and the low side reach shall be 15" minimum above the finish floor or ground. [EXCEPTION: An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10" maximum.] Obstructed High Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34" maximum and the depth of the obstruction shall be 24" maximum. The high side reach shall be 48" maximum for a reach depth of 10" maximum. Where the reach depth exceeds 10", the high side reach shall be 46" maximum for a reach depth of 24" maximum. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420169



Barrier ID: AX420225

Pasadena High School SPORTS FACILITIES

Assembly	Common Areas
Type	Dining And Work Surface
ADA Standard	ADA 902.2; 902.4; California Building Code Chap 11B-226, 306.2, 306.3
Barrier Detail	CALIFORNIA: A compliant dining table is not provided.
Location Description	Baseball Field Concession Stand Area
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	14 bench seats are provided. At least one table is required to be accessible.

Resolution

Provide a compliant table that allows a clear space of 30" x 48" positioned for forward approach. Where dining surfaces are provided for the consumption of food or drink, at least 5% of the standing spaces and the seating spaces at dining surfaces shall comply. Dining surfaces shall be dispersed throughout the space or facility containing dining surfaces for each type of seating in a functional area. The top of the table shall be minimum 28" and maximum 34" high above the finish floor or ground. Where food or drink is served for consumption at a counter exceeding 34" in height, a portion of the main counter 60" minimum in length shall be provided at minimum 28" and maximum 34" high above the finish floor or ground. The table shall provide knee clearance, which shall be considered space under an element between 9" and 27" above the finish floor or ground. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. The knee clearance shall be 19" deep minimum from floor or ground to minimum 27" above the finish floor or ground. Provide toe clearance between the finish floor or ground surface and a height of 9", width of 30" minimum, and depth of 19" minimum to 25" maximum. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Wheelchair spaces shall adjoin accessible routes. Accessible routes and circulation paths shall not overlap wheelchair spaces. Provide a picnic table with a surface at minimum 26" and maximum 34" height. Clear space shall be maximum 2.08% in all directions and a firm and stable surface.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420225











Barrier ID: AX424516

Pasadena High School GENERAL EXTERIOR

Assembly	Dining
Type	Dining And Work Surface
ADA Standard	ADA 902.2; 902.4; California Building Code Chap 11B-226, 306.2, 306.3
Barrier Detail	CALIFORNIA: A compliant dining table is not provided.
Location Description	Upper Quad Asphalt Dining Area
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Eight bench tables are provided. One accessible table is provided. Eight tables seats, 64, persons seats requires 4 accessible tables.

Resolution

Provide a compliant table that allows a clear space of 30" x 48" positioned for forward approach. Where dining surfaces are provided for the consumption of food or drink, at least 5% of the standing spaces and the seating spaces at dining surfaces shall comply. Dining surfaces shall be dispersed throughout the space or facility containing dining surfaces for each type of seating in a functional area. The top of the table shall be minimum 28" and maximum 34" high above the finish floor or ground. Where food or drink is served for consumption at a counter exceeding 34" in height, a portion of the main counter 60" minimum in length shall be provided at minimum 28" and maximum 34" high above the finish floor or ground. The table shall provide knee clearance, which shall be considered space under an element between 9" and 27" above the finish floor or ground. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. The knee clearance shall be 19" deep minimum from floor or ground to minimum 27" above the finish floor or ground. Provide toe clearance between the finish floor or ground surface and a height of 9", width of 30" minimum, and depth of 19" minimum to 25" maximum. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Wheelchair spaces shall adjoin accessible routes. Accessible routes and circulation paths shall not overlap wheelchair spaces. Provide a picnic table with a surface at minimum 26" and maximum 34" height. Clear space shall be maximum 2.08% in all directions and a firm and stable surface.

Quantity

4 EA


Priority	3

Map for Barrier ID: AX424516



762 +34.162580, -118.092034

Photos for Barrier ID: AX424516

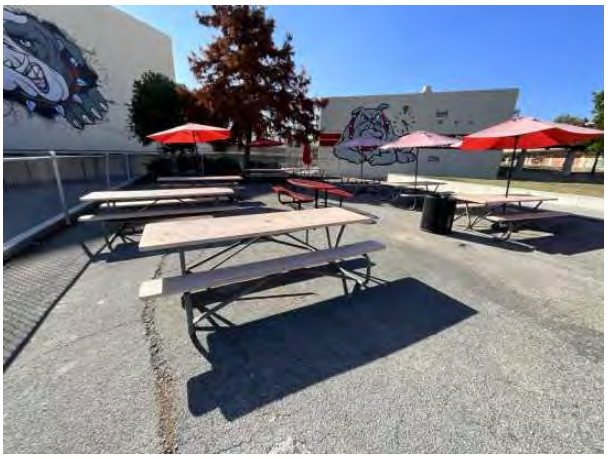

Barrier ID: AX424517

Pasadena High School GENERAL EXTERIOR

Assembly	Dining
Type	Dining And Work Surface
ADA Standard	ADA 902.2; 902.4; California Building Code Chap 11B-226, 306.2, 306.3
Barrier Detail	CALIFORNIA: A compliant dining table is not provided.
Location Description	Upper Quad Dining Area
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

7 tables are provided none of which are accessible. Each table seats eight persons. 56 seats requires 3 accessible tables.

Resolution


Provide a compliant table that allows a clear space of 30" x 48" positioned for forward approach. Where dining surfaces are provided for the consumption of food or drink, at least 5% of the standing spaces and the seating spaces at dining surfaces shall comply. Dining surfaces shall be dispersed throughout the space or facility containing dining surfaces for each type of seating in a functional area. The top of the table shall be minimum 28" and maximum 34" high above the finish floor or ground. Where food or drink is served for consumption at a counter exceeding 34" in height, a portion of the main counter 60" minimum in length shall be provided at minimum 28" and maximum 34" high above the finish floor or ground. The table shall provide knee clearance, which shall be considered space under an element between 9" and 27" above the finish floor or ground. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. The knee clearance shall be 19" deep minimum from floor or ground to minimum 27" above the finish floor or ground. Provide toe clearance between the finish floor or ground surface and a height of 9", width of 30" minimum, and depth of 19" minimum to 25" maximum. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Wheelchair spaces shall adjoin accessible routes. Accessible routes and circulation paths shall not overlap wheelchair spaces. Provide a picnic table with a surface at minimum 26" and maximum 34" height. Clear space shall be maximum 2.08% in all directions and a firm and stable surface.

Quantity

3 EA

Priority	3

Map for Barrier ID: AX424517

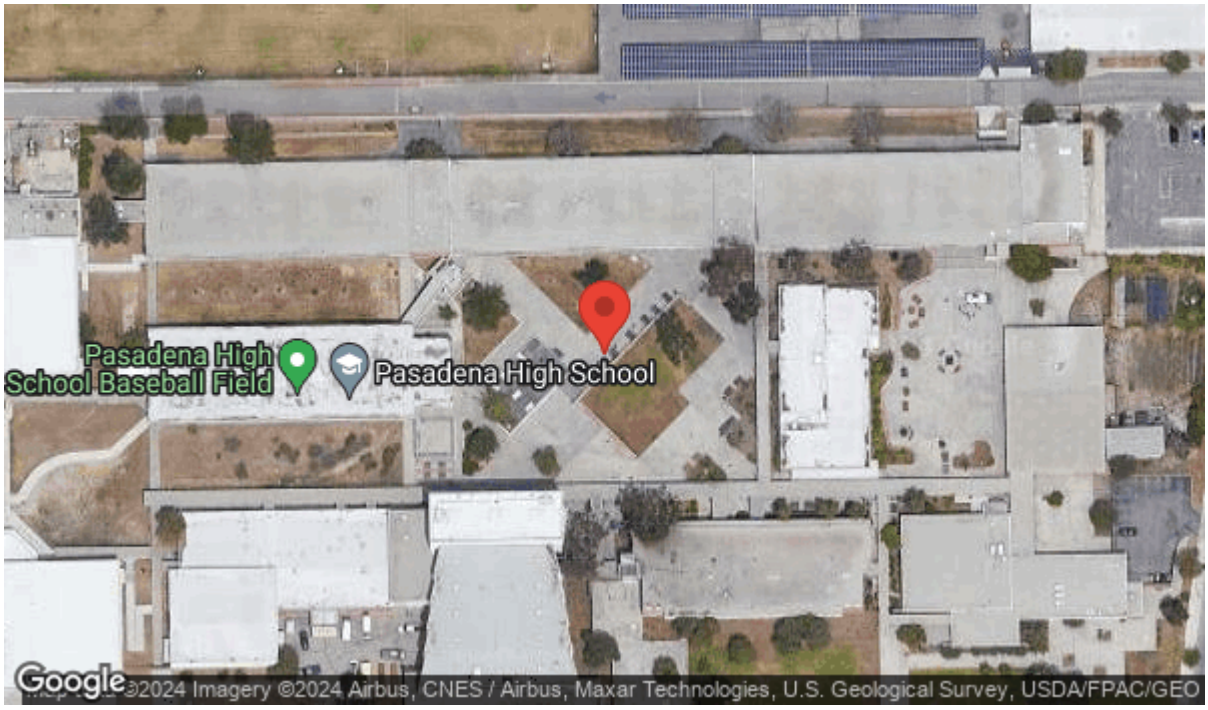

763 +34.162619, -118.091834

Photos for Barrier ID: AX424517



Barrier ID: AX419813

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Door
ADA Standard	222, 803, 903
Barrier Detail	The locker room does not have a compliant bench.
Location Description	Building B - B110 Girls Dressing
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The dressing room does not provide the correct bench dimensions.

Resolution


Provide a bench on an accessible route and adjacent to an accessible locker. The bench shall have an adjacent clear space of 30" minimum by 48" minimum located at the end of the bench and parallel to the axis of the bench. The top of the seat shall be 17" minimum and 19" maximum from finish floor. The seat shall be 42" minimum long. The seat shall have a depth of 20" minimum and 24" maximum. The bench shall provide back support or be affixed to a wall. Back support shall be 42" minimum in length extending from a point 2" maximum above the seat surface to 18" minimum above the seat surface. Back support shall be 2-1/2" maximum from the rear edge of the seat measured horizontally. When installed in wet locations, the surface of the seat shall be slip resistant and shall not accumulate water.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419813

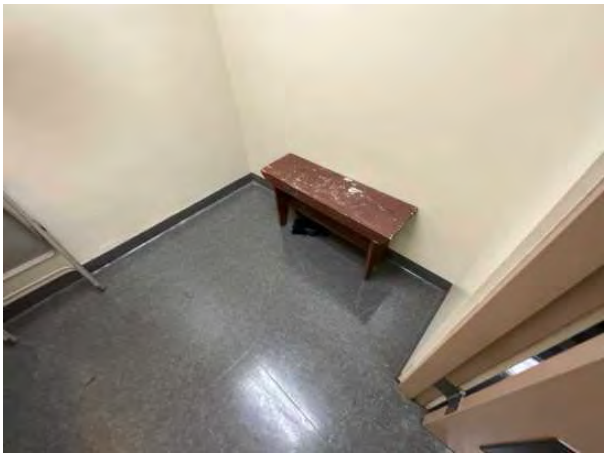

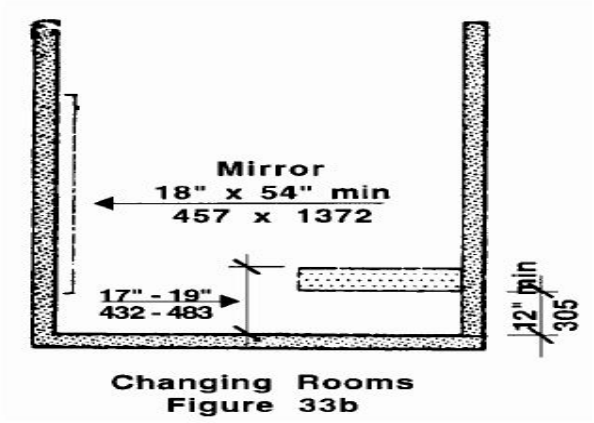





Barrier ID: AX418313

Pasadena High School BUILDING F

Assembly	Interior Access Route
Type	Door
ADA Standard	521 CMR 33.6; ADA 903

Barrier Detail

MASSACHUSETTS: The dressing/fitting/changing area does not have a compliant bench.

Location Description	Building F - F100 A Boys Dressing Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	A boys dressing room is provided but no girls dressing room is provided.

Resolution

Convert the existing boys dressing room in to a unisex dressing room. Provide a bench in each dressing / fitting/ changing room. The bench shall be on an accessible route and adjacent to an accessible locker, if lockers are present. The bench shall have an adjacent clear space of 30" minimum x 40" minimum located at the end of the bench and parallel to the axis of the bench for a parallel approach to the bench. The seat/bench shall be 24" x 48" and fixed to the wall along the shorter dimension. The seat shall be mounted 17" to 19" above the finish floor and open below with a minimum of 12" in height measured from the floor. Back support shall be 42" minimum in length extending from a point 2" maximum above the seat surface to 18" minimum above the seat surface. Back support shall be 2-1/2" maximum from the rear edge of the seat measured horizontally. Back support can be provided by a wall. When installed in wet locations, the surface of the seat shall be slip resistant and shall not accumulate water.


Quantity

1 EA


Priority	3

Photos for Barrier ID: AX418313



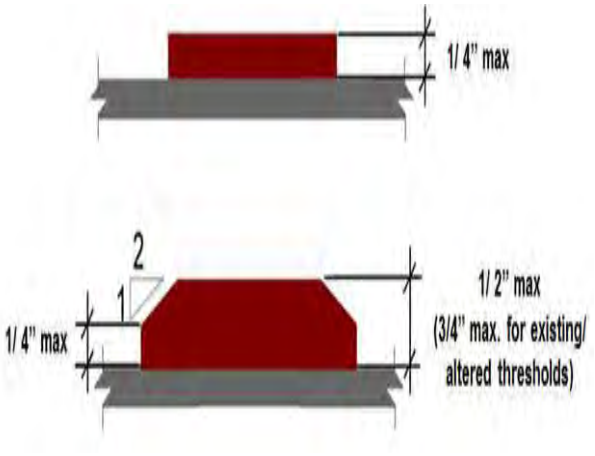



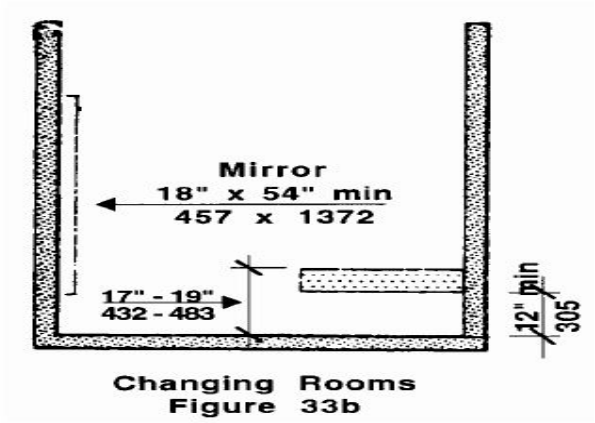

Barrier ID: AX418312

Pasadena High School BUILDING F

Assembly	Interior Access Route
Type	Door
ADA Standard	213.3.4, 606.5
Barrier Detail	Pipes are not insulated.
Location Description	Building F - F102 Storage Sink
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The sink does not have insulated or sleeved pipes.

Resolution

Insulate water supply and drain pipes under the accessible lavatory. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. Pipes under lavatories and sinks shall be free from sharp or abrasive surfaces. A minimum of one lavatory in a multi-lavatory restroom shall be a compliant lavatory.


Quantity


1 EA

Priority	3

Photos for Barrier ID: AX418312



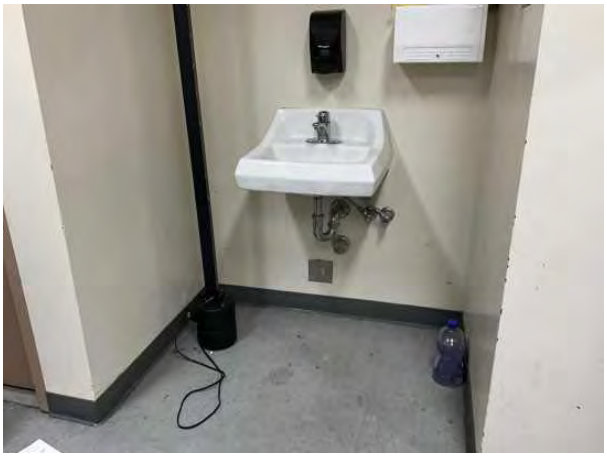

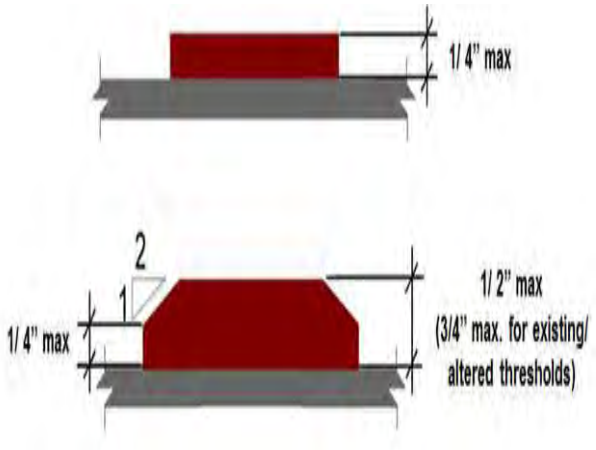

Barrier ID: AX424430

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Building A - 1st Floor Drinking Fountain West Side
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The drinking fountain does not provide one for standing persons

Resolution

Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA

Priority 3

Photos for Barrier ID: AX424430



Barrier ID: AX424426

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Building A - 2nd Floor Drinking Fountain East Side
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	A drinking fountain for standing persons is not provided.

Resolution


Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA

Priority 3

Photos for Barrier ID: AX424426

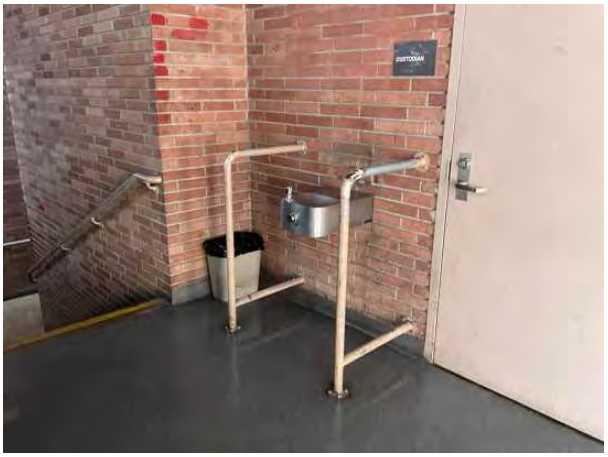

Barrier ID: AX424424

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Building A - 2nd Floor Drinking Fountain West Side
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	A drinking fountain for standing persons is not provided.

Resolution

Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA

Priority 3

Photos for Barrier ID: AX424424



Barrier ID: AX419865

Pasadena High School BUILDING C

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	ADA 305.7; CBC Chap 11B-602.9

Barrier Detail

CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.

Location Description	Building C - Drinking Fountain Adjacent to C110
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The clearance between the rails is 31 1/2 inches.

Resolution


Install the accessible drinking fountain(s) at a location within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area for the fountain shall be 32" minimum wide and 18" minimum deep. For a forward approach to an alcove where the alcove depth is greater than 24", the alcove shall be 36" minimum wide. For a parallel approach to an alcove, the alcove shall be 60" wide minimum. When wing walls or barriers are used, they shall project horizontally at least as far as the fountain, and to within 6" vertically from the floor/ground surface. Drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30" by minimum 48", and maximum 2.08% in all directions and a firm and stable surface. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3 -1/2" maximum from the front edge of the unit, including bumpers.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419865

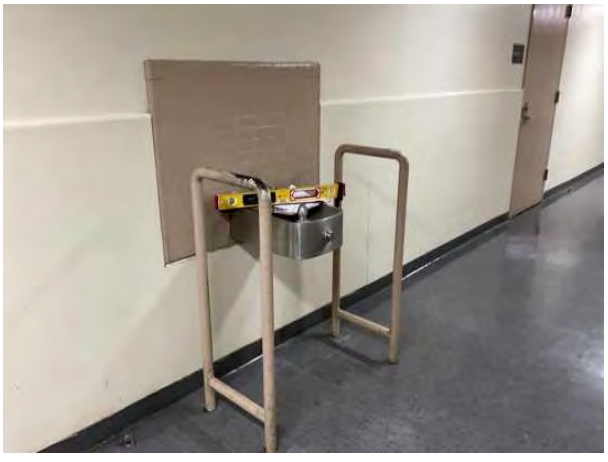



Barrier ID: AX419866

Pasadena High School BUILDING C

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Building C - Drinking Fountain Adjacent to C110
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	A drinking fountain for standing persons is not provided.

Resolution

Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA

Priority 3

Photos for Barrier ID: AX419866



Barrier ID: AX418370

Pasadena High School BUILDING D

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Building D - Drinking Fountain at D153
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	A drinking fountain for standing persons is not provided.

Resolution


Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA

Priority 3

Photos for Barrier ID: AX418370

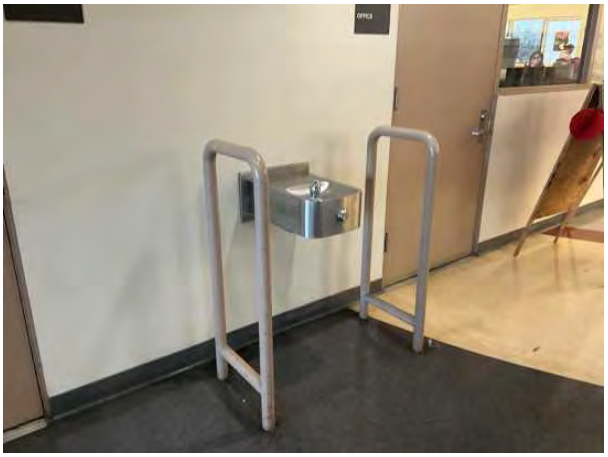

Barrier ID: AX419840

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Building E - 2nd Floor West Side Drinking Fountain
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The drinking fountain does not provide a fountain for standing persons.

Resolution

Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

2 EA

Priority 3

Photos for Barrier ID: AX419840



Barrier ID: AX419841

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Building E - 2nd Floor West Side Drinking Fountain
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The drinking fountain knee clearance extends 26 7/8 above the floor.

Resolution

Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA

Priority 3

Photos for Barrier ID: AX419841





Barrier ID: AX418296

Pasadena High School BUILDING F

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Building F - Drinking Fountain Adjacent to F121 Women's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	A drinking fountain is not provided for standing people.

Resolution

Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA

Priority 3

Photos for Barrier ID: AX418296



Barrier ID: AX418286

Pasadena High School BUILDING F

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Building F - Drinking Fountain Adjacent to F202
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	A drinking fountain is not provided for standing people.

Resolution

Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418286



Barrier ID: AX419780

Pasadena High School BUILDING I

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Building I 1st Floor - Drinking Fountain Westend
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	A drinking fountain for standing persons is not provided.

Resolution

Install an accessible drinking fountain(s). This barrier must be removed in conjunction with barrier ID 419781. The cost of this barrier removal is covered under ID 419781 and therefore, the cost of this ID is shown as $0. Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA


Priority 3

Map for Barrier ID: AX419780



366 +34.163006, -118.093158

Photos for Barrier ID: AX419780

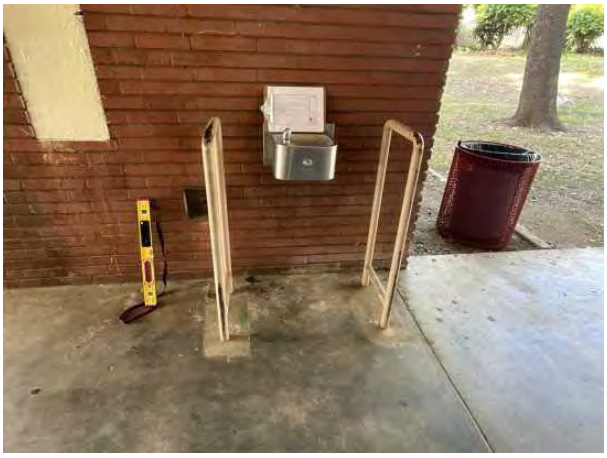

Barrier ID: AX419781

Pasadena High School BUILDING I

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-602.8

Barrier Detail

CALIFORNIA: The drinking fountain is located on a wall or post-mounted cantilevered, but is not minimum 18" and maximum 19" in depth.

Location Description	Building I 1st Floor - Drinking Fountain Westend
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The drinking fountain is not compliant and is only 13 inches deep.

Resolution

Install an accessible drinking fountain, if at a location on a wall or post-mounted cantilevered, which is minimum 18" and maximum 19" in depth. Drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30" by minimum 48", and maximum 2.08% in all directions and a firm and stable surface. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.]

Quantity

1 EA

Priority	3

Map for Barrier ID: AX419781



367 +34.162979, -118.093155

Photos for Barrier ID: AX419781





Barrier ID: AX419779

Pasadena High School BUILDING I

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Building I 2nd Floor - Drinking Fountain Westend
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	the drinking fountain does not provide a unit for standing persons.

Resolution

Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA

Priority 3

Map for Barrier ID: AX419779



365 +34.162825, -118.093216

Photos for Barrier ID: AX419779



Barrier ID: AX419784

Pasadena High School BUILDING R

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	ADA 305.7; CBC Chap 11B-602.9

Barrier Detail

CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.

Location Description	Building R - R107 Gymnasium
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The drinking fountain is not located in an alcove or is not protected with railings.

Resolution

Install the accessible drinking fountain(s) at a location within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area for the fountain shall be 32" minimum wide and 18" minimum deep. For a forward approach to an alcove where the alcove depth is greater than 24", the alcove shall be 36" minimum wide. For a parallel approach to an alcove, the alcove shall be 60" wide minimum. When wing walls or barriers are used, they shall project horizontally at least as far as the fountain, and to within 6" vertically from the floor/ground surface. Drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30" by minimum 48", and maximum 2.08% in all directions and a firm and stable surface. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3 -1/2" maximum from the front edge of the unit, including bumpers.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419784







Barrier ID: AX418695

Pasadena High School BUILDING V

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Building V- V101 Drinking Fountain at Student Dining Area
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	A drinking fountain for standing persons is not provided.

Resolution


Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA

Priority 3

Photos for Barrier ID: AX418695

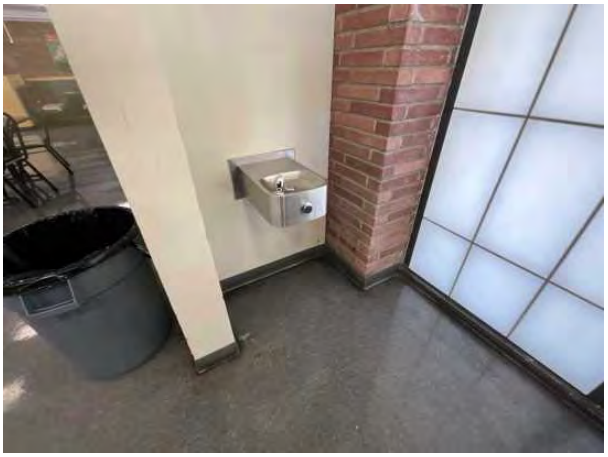

Barrier ID: AX418652

Pasadena High School BUILDING Q

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Drinking Fountain Adjacent Q109
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	A drinking fountain for standing persons is not provided.

Resolution


Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA


Priority 3

Map for Barrier ID: AX418652

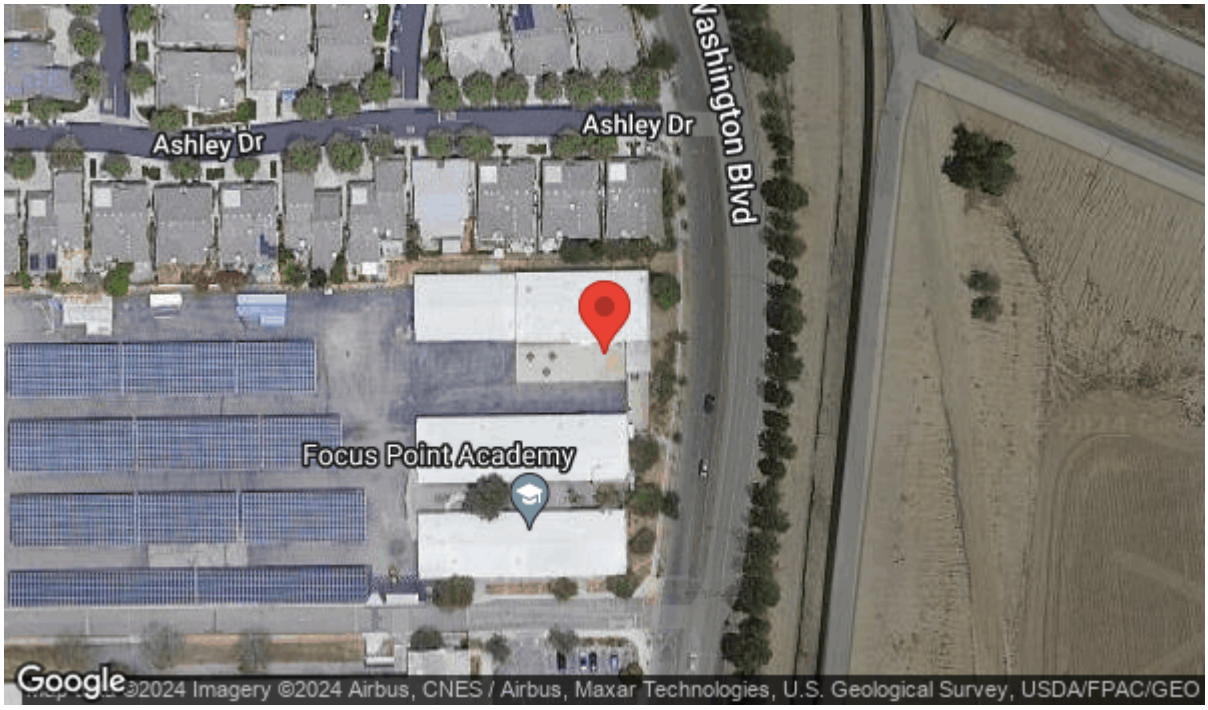

222 +34.163786, -118.090191

Photos for Barrier ID: AX418652

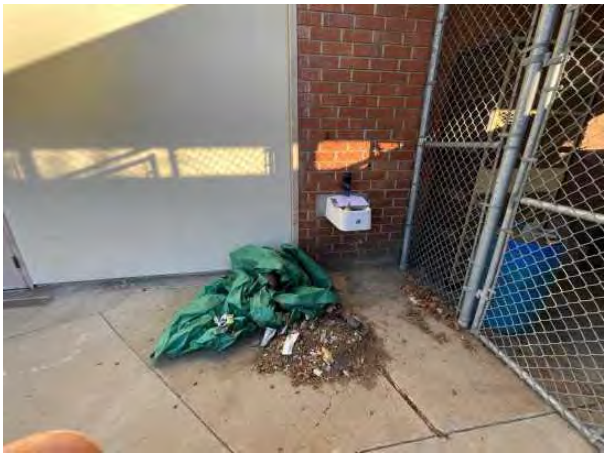

Barrier ID: AX418683

Pasadena High School BUILDING W

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-602.8

Barrier Detail

CALIFORNIA: The drinking fountain is located on a wall or post-mounted cantilevered, but is not minimum 18" and maximum 19" in depth.

Location Description	Drinking Fountain West Side of Building W
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The drinking fountain knee clearance does not extend 17 inches deep. The drinking fountain is not a compliant type.

Resolution

Install an accessible drinking fountain, if at a location on a wall or post-mounted cantilevered, which is minimum 18" and maximum 19" in depth. This barrier must be removed in conjunction with barrier ID 418684. The cost of this barrier removal is covered under ID 418684 and therefore, the cost of this ID is shown as $0. Drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30" by minimum 48", and maximum 2.08% in all directions and a firm and stable surface. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.]

Quantity

1 EA

Priority	3

Map for Barrier ID: AX418683



253 +34.162584, -118.090800

Photos for Barrier ID: AX418683





Barrier ID: AX418684

Pasadena High School BUILDING W

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Drinking Fountain West Side of Building W
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	A compliant high-low unit is not provided.

Resolution


Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA

Priority 3

Map for Barrier ID: AX418684

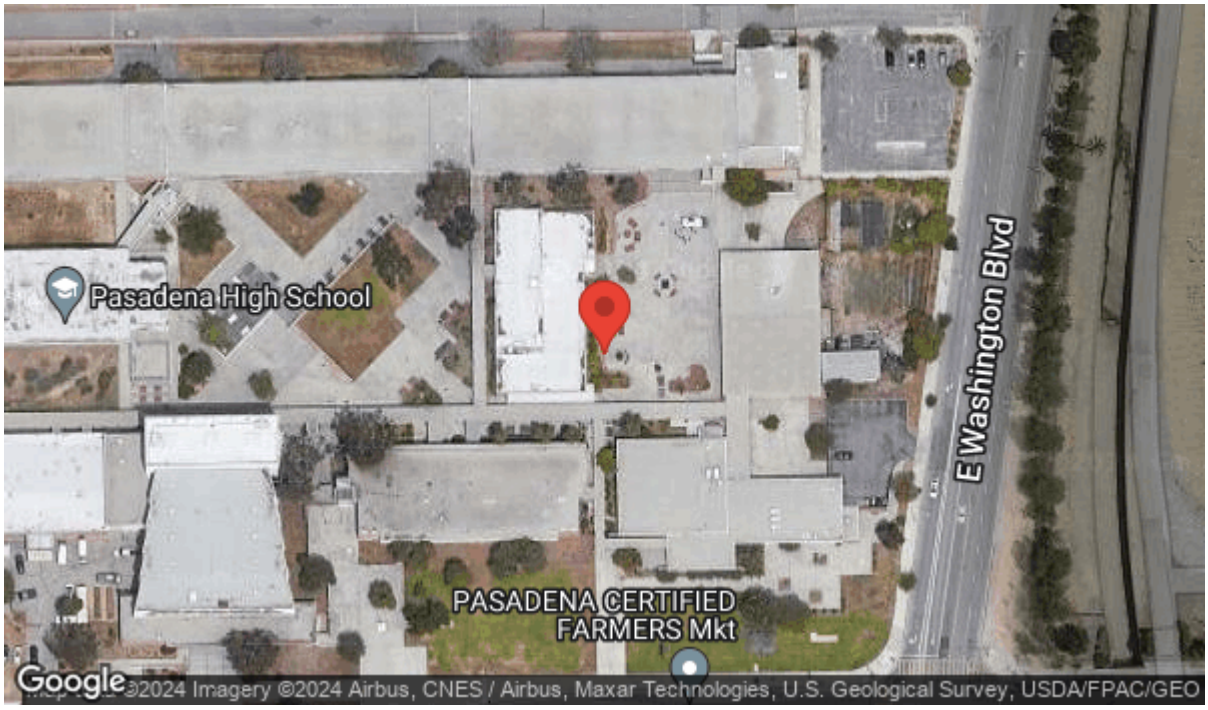

254 +34.162449, -118.091068

Photos for Barrier ID: AX418684



Barrier ID: AX418685

Pasadena High School BUILDING W

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	ADA 305.7; CBC Chap 11B-602.9

Barrier Detail

CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.

Location Description	Drinking Fountain West Side of Building W
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The drinking fountain does not provide detectable barriers or is not located in an alcove.

Resolution


Install the accessible drinking fountain(s) at a location within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. This barrier must be removed in conjunction with barrier ID 418684. The cost of this barrier removal is covered under ID 418684 and therefore, the cost of this ID is shown as $0. The protected area for the fountain shall be 32" minimum wide and 18" minimum deep. For a forward approach to an alcove where the alcove depth is greater than 24", the alcove shall be 36" min. wide. For a parallel approach to an alcove, the alcove shall be 60" wide minimum. When wing walls or barriers are used, they shall project horizontally at least as far as the fountain, and to within 6" vertically from the floor/ground surface. Drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30" by minimum 48", and maximum 2.08% in all directions and a firm and stable surface. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.]

Quantity

1 EA

Priority	3

Map for Barrier ID: AX418685

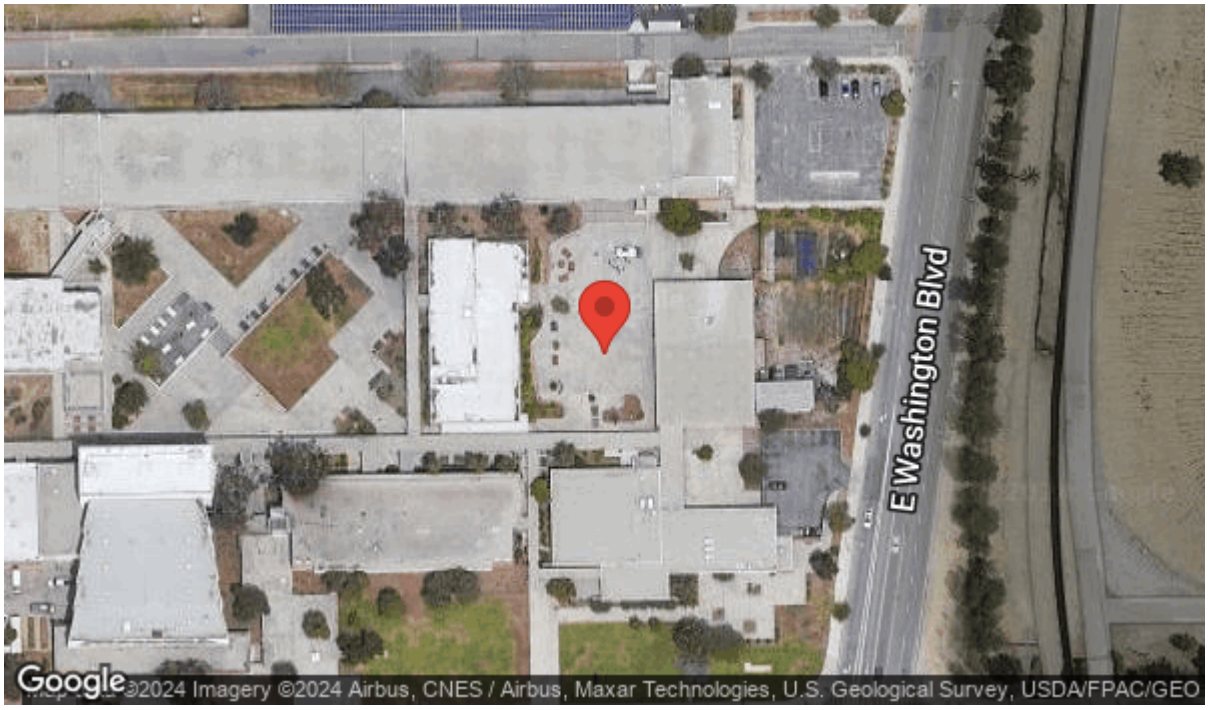

255 +34.162515, -118.090891

Photos for Barrier ID: AX418685





Barrier ID: AX418721

Pasadena High School BUILDING E

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	ADA 305.7; CBC Chap 11B-602.9

Barrier Detail

CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.

Location Description	Drinking Fountain Westend of Building E
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The drinking fountain provides 31 3/4 inches clearance between the rails.

Resolution

Install the accessible drinking fountain(s) at a location within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area for the fountain shall be 32" minimum wide and 18" minimum deep. For a forward approach to an alcove where the alcove depth is greater than 24", the alcove shall be 36" min. wide. For a parallel approach to an alcove, the alcove shall be 60" wide minimum. When wing walls or barriers are used, they shall project horizontally at least as far as the fountain, and to within 6" vertically from the floor/ground surface. Drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30" by minimum 48", and maximum 2.08% in all directions and a firm and stable surface. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.]

Quantity

1 EA

Priority	3

Map for Barrier ID: AX418721




291 +34.162566, -118.093158

Photos for Barrier ID: AX418721





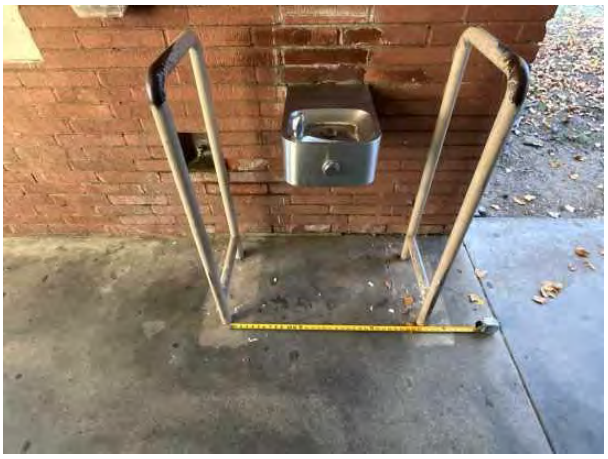

Barrier ID: AX418723

Pasadena High School BUILDING E

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Drinking Fountain Westend of Building E
Observed	Dec 10, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The drinking fountain does not provide a unit for standing persons.

Resolution

Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA


Priority 3

Map for Barrier ID: AX418723



293 +34.162590, -118.093188

Photos for Barrier ID: AX418723

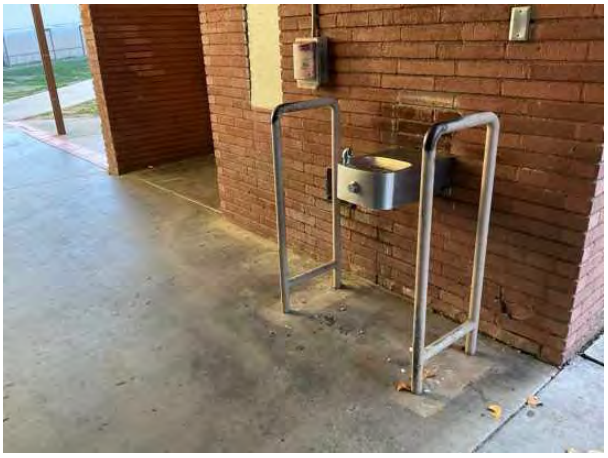

Barrier ID: AX424532

Pasadena High School SPORTS FACILITIES

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	California Building Code Chap 11B-211, 602
Barrier Detail	CALIFORNIA: The minimum number of drinking fountains is not provided.
Location Description	Route to Soccer And Softball Field
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

A drinking fountain for fountain for standing persons, and the low fountain does not work.

Resolution


Install an accessible drinking fountain(s). Where drinking fountains are provided on an exterior site, on a floor, or within a secured area, they shall be compliant. [EXCEPTION: In detention or correctional facilities, drinking fountains only serving non-accessible holding or housing cells are not required to comply.] No fewer than two levels of drinking fountains shall be provided: wheelchair height and standing height. When two drinking fountains are provided, one drinking fountain shall comply with wheelchair unit requirements, and one drinking fountain shall comply with standing unit requirements. [EXCEPTION: Where a single hi-lo drinking fountain is provided, it shall be permitted to be substituted for two separate drinking fountains.] [ADVISORY: The 2019 California Plumbing Code (CPC), Table 4-1 provides minimum plumbing fixture requirements for new buildings, and changes of occupancy or use in an existing building resulting in increased occupant load. CPC Table 4-1 should be consulted in conjunction with the accessibility requirements.] Where more than the minimum number of drinking fountains are provided, 50 percent of the total number of drinking fountains provided shall comply with wheelchair level fountains, and 50 percent of the total number of drinking fountains provided shall comply with standing level drinking fountains. [EXCEPTION: Where 50 percent of the drinking fountains yields a fraction, 50 percent shall be permitted to be rounded up or down provided that the total number of drinking fountains equals 100 percent of drinking fountains.] WHEELCHAIR DRINKING FOUNTAINS: Spout outlets shall be 36 inches maximum above the finish floor or ground. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4 inches high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [ADVISORY: The purpose of requiring the drinking fountain spout to produce a flow of water 4 inches high minimum is so that a cup can be inserted under the flow of water to provide a drink of water for an individual who, because of a disability, would otherwise be incapable of using the drinking fountain.] Wall- and post-mounted cantilevered drinking fountains shall be 18 inches minimum and 19 inches maximum in depth. Operable parts shall be placed within one or more of the allowable reach ranges Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. The flow of water shall be activated by a manually operated system that is front mounted or side mounted and located within 6 inches of the front edge of the fountain or an automatic electronically controlled device. Wheelchair level drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30 inches by minimum 48 inches, and maximum 2.08% in all directions and a firm and stable surface. Knee and toe clearance minimum 30 inches wide shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30 inches maximum above the finish floor or ground and is 3-1/2 inches maximum from the front edge of the unit, including bumpers.] Knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. Between 9 inches and 27 inches above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1 inch in depth for each 6 inches in height. Toe clearance shall be the space between the finish floor or ground and 9 inches above the finish floor or ground. Toe clearance depth shall be 17 inches minimum under the drinking fountain. STANDING LEVEL DRINKING FOUNTAIN: Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground. ALL DRINKING FOUNTAINS: All drinking fountains shall either be located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area within which a drinking fountain is located shall be 32 inches wide minimum and 18 inches deep minimum, and shall comply. When used, wing walls or barriers shall project horizontally at least as far as the drinking fountain and to within 6 inches vertically from the floor or ground surface.

Quantity

1 EA

Priority 3

Map for Barrier ID: AX424532

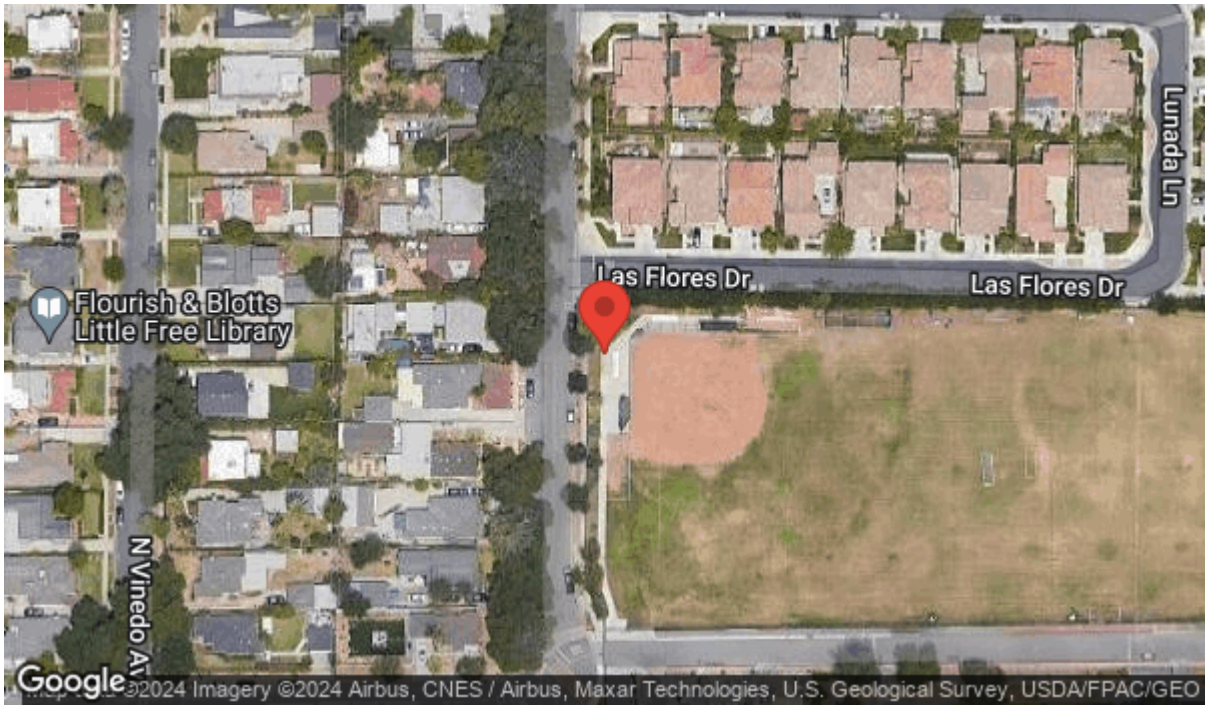

778 +34.163828, -118.093797

Photos for Barrier ID: AX424532



Barrier ID: AX424533

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	ADA 305.7; CBC Chap 11B-602.9

Barrier Detail

CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.

Location Description	Route to Soccer And Softball Field
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The drinking fountain protrudes 18 inches from the post where the bottom edge is 28 inches above the floor

Resolution


Install the accessible drinking fountain(s) at a location within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways. The protected area for the fountain shall be 32" minimum wide and 18" minimum deep. For a forward approach to an alcove where the alcove depth is greater than 24", the alcove shall be 36" min. wide. For a parallel approach to an alcove, the alcove shall be 60" wide minimum. When wing walls or barriers are used, they shall project horizontally at least as far as the fountain, and to within 6" vertically from the floor/ground surface. Drinking fountains shall be located so that a clear space is positioned at the drinking fountain for a forward approach and centered on the unit. Clear space shall be minimum 30" by minimum 48", and maximum 2.08% in all directions and a firm and stable surface. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.]

Quantity

1 EA

Priority	3

Map for Barrier ID: AX424533

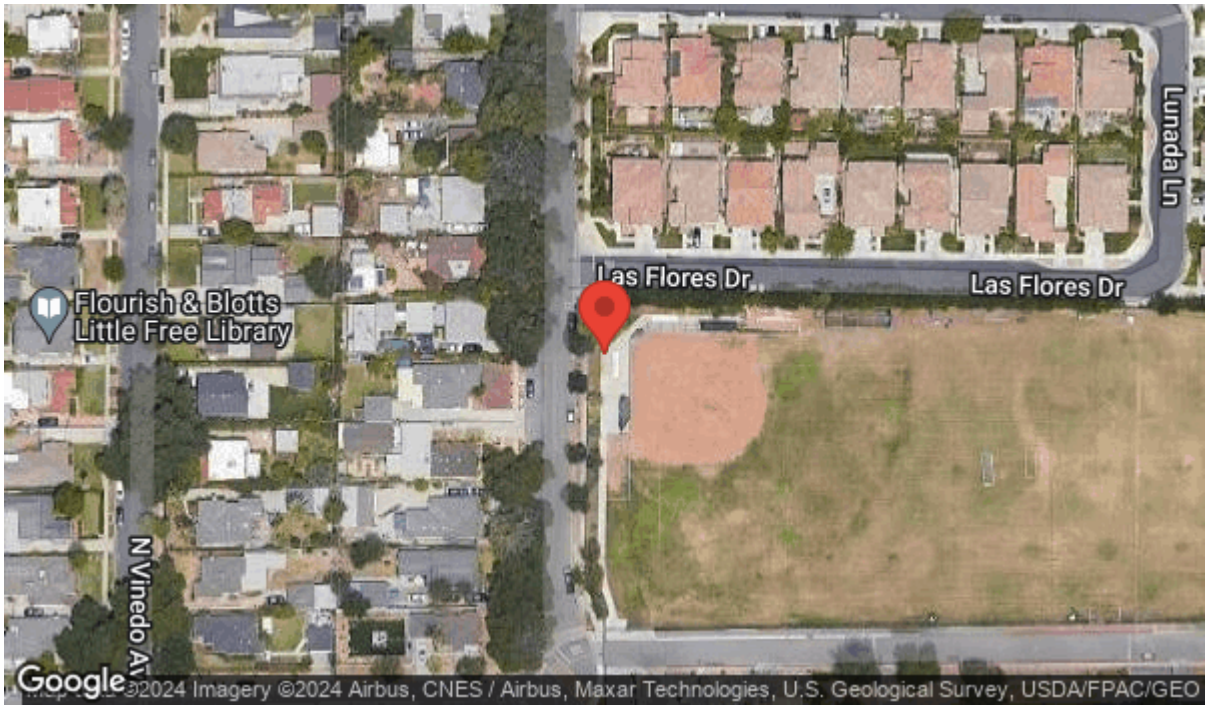

779 +34.163827, -118.093794

Photos for Barrier ID: AX424533









Barrier ID: AX424436

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Elevator
ADA Standard	California Building Code Chap 11B-407.2.3.1

Barrier Detail

CALIFORNIA: A tactile, raised star minimum 2" high is not provided to the left of the floor designation on both jambs at the main elevator entry level OR existing stars are not compliant.

Location Description	Building A - Elevator
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The raised star character does not have equal sides.

Resolution

Provide a tactile raised star, minimum 2" high, placed to the left of the floor designation, on both door jambs at the main elevator entry level. The outside of the star shall be 2" and all points shall be of equal length. Raised characters, including the star, shall be white on a black background. Compliant Braille shall be placed below the corresponding characters and the star. The Braille translation for the star shall be "MAIN". Applied plates are acceptable if they are permanently fixed to the jamb.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424436



Barrier ID: AX424511

Pasadena High School GENERAL EXTERIOR

Assembly	Interior Access Route
Type	Elevator
ADA Standard	407.2.3
Barrier Detail	The hoistway signage is not compliant.
Location Description	Elevator 1
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The tactile, hoistway signs are placed on one side only.

Resolution

Install floor designation signs in both tactile and Braille located at both jambs of each elevator hoistway entrance. Floor designations shall be provided on both jambs of elevator hoistway entrances. Floor designations shall be provided in both tactile characters and Braille. Tactile characters shall be 2" high minimum. A tactile star shall be provided on both jambs at the main entry level. The outside of the star shall be 2" minimum height, and all points shall be of equal length. Raised characters, including the star, shall be white on a black background. Compliant Braille shall be placed below the corresponding characters and the star. The Braille translation for the star shall be "MAIN". Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Hoistway jamb signage shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Applied plates are acceptable if they are permanently fixed to the jamb.

Quantity

2 EA

Priority	3

Photos for Barrier ID: AX424511







Barrier ID: AX424513

Pasadena High School GENERAL EXTERIOR

Assembly	Interior Access Route
Type	Elevator
ADA Standard	CBC Chap 11B-407.2.2

Barrier Detail

CALIFORNIA: Visible and audible signal fixtures indicating which car is answering the call and the car's direction of travel are not compliant or are not provided.

Location Description	Elevator 1
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The floor indicator is not illuminating..

Resolution

Provide visual and audible signal fixtures at each hoistway entrance to indicate which car is answering a call and the car's direction of travel. Where in-car signals are provided, they must be visible from the floor area adjacent to the hall call buttons. [Exception: Visual and audible signals shall not be required at each destination-oriented elevator where a visible and audible signal is provided indicating the elevator car designation information.] Visual signal fixtures shall be centered at 72" minimum above the finish floor. The visible signal elements shall be minimum 2-1/2" high by minimum 2-1/2" wide, measured along the vertical centerline of the element. Signals shall be visible from the floor area adjacent to the hall call button. [Exception: Destination-oriented elevators are permitted to have signals visible from the floor area adjacent to the hoistway entrance. Audible signals shall sound once for the up direction and twice for the down direction, or shall have verbal annunciators that indicate the direction of elevator car travel. Audible signals shall have a frequency of 1500 Hz maximum. Verbal annunciators shall have a frequency of 300 Hz minimum and 3000 Hz maximum. The audible signal and verbal annunciator shall be 10 dB minimum above ambient, but shall not exceed 80 dB, measured at the hall call button. [Exception: Destination-oriented elevators shall not be required to comply provided that the audible tone and verbal announcement is the same as those given at the call button or call button keypad.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424513



Barrier ID: AX424514

Pasadena High School GENERAL EXTERIOR

Assembly	Interior Access Route
Type	Elevator
ADA Standard	California Building Code Chap 11B-407.2.3.1

Barrier Detail

CALIFORNIA: A tactile, raised star minimum 2" high is not provided to the left of the floor designation on both jambs at the main elevator entry level OR existing stars are not compliant.

Location Description	Elevator 1
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The raised star does not have equal sides, and is not provided on the opposite side of the jamb.

Resolution

Provide a tactile raised star, minimum 2" high, placed to the left of the floor designation, on both door jambs at the main elevator entry level. The outside of the star shall be 2" and all points shall be of equal length. Raised characters, including the star, shall be white on a black background. Compliant Braille shall be placed below the corresponding characters and the star. The Braille translation for the star shall be "MAIN". Applied plates are acceptable if they are permanently fixed to the jamb.

Quantity

2 EA

Priority	3

Photos for Barrier ID: AX424514





Barrier ID: AX424507

Pasadena High School GENERAL EXTERIOR

Assembly	Interior Access Route
Type	Elevator
ADA Standard	407.2.3
Barrier Detail	The hoistway signage is not compliant.
Location Description	Elevator Near Building G
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The elevator tactile hoistway signage is not provided on both sides of the elevator jamb.

Resolution

Install floor designation signs in both tactile and Braille located at both jambs of each elevator hoistway entrance. Floor designations shall be provided on both jambs of elevator hoistway entrances. Floor designations shall be provided in both tactile characters and Braille. Tactile characters shall be 2" high minimum. A tactile star shall be provided on both jambs at the main entry level. The outside of the star shall be 2" minimum height, and all points shall be of equal length. Raised characters, including the star, shall be white on a black background. Compliant Braille shall be placed below the corresponding characters and the star. The Braille translation for the star shall be "MAIN". Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Hoistway jamb signage shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Applied plates are acceptable if they are permanently fixed to the jamb.

Quantity

2 EA

Priority	3

Photos for Barrier ID: AX424507







Barrier ID: AX424509

Pasadena High School GENERAL EXTERIOR

Assembly	Interior Access Route
Type	Elevator
ADA Standard	California Building Code Chap 11B-407.2.3.1

Barrier Detail

CALIFORNIA: A tactile, raised star minimum 2" high is not provided to the left of the floor designation on both jambs at the main elevator entry level OR existing stars are not compliant.

Location Description	Elevator Near Building G
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The 1st floor (main floor) hoistway signage does not provide the raised star character on each side of the door jamb.

Resolution


Provide a tactile raised star, minimum 2" high, placed to the left of the floor designation, on both door jambs at the main elevator entry level. The outside of the star shall be 2" and all points shall be of equal length. Raised characters, including the star, shall be white on a black background. Compliant Braille shall be placed below the corresponding characters and the star. The Braille translation for the star shall be "MAIN". Applied plates are acceptable if they are permanently fixed to the jamb.

Quantity

2 EA

Priority	3

Photos for Barrier ID: AX424509

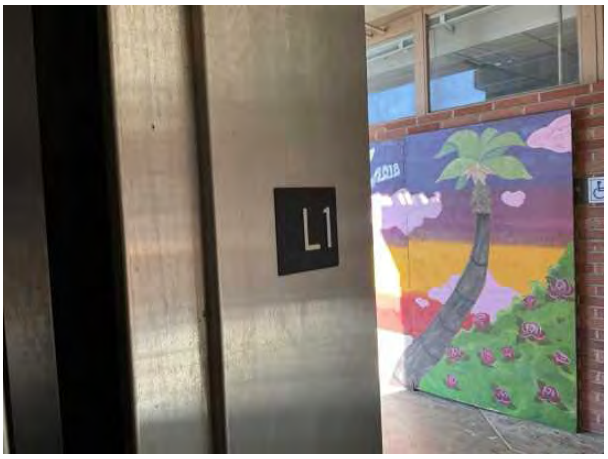



Barrier ID: AX420234

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	213.2 Exception 3

Barrier Detail

Less than 5% of multiple single user portable toilets clustered at a single location are accessible.

Location Description	Accessible Route to Portable Restrooms
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The asphalt sidewalk has cross slopes up to 5.7% due to cracks and heaving for the entire length of the sidewalk. The sidewalk measures 9 feet wide.

Resolution

Provide minimum 5% accessible single user portable toilets in each cluster of single user portable toilets.

Quantity

675 EA

Priority	3


Map for Barrier ID: AX420234



613 +34.162730, -118.097624

Photos for Barrier ID: AX420234



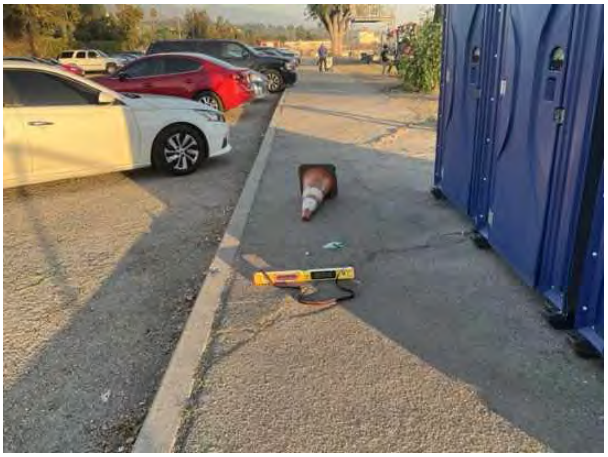









Barrier ID: AX420233

Pasadena High School SPORTS FACILITIES

Assembly	Exterior Access Route
Type	Exterior Accessible Route
ADA Standard	213.2 Exception 3

Barrier Detail

Less than 5% of multiple single user portable toilets clustered at a single location are accessible.

Location Description	Portable Restrooms Serving Football Field
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

An accessible portable restroom is not provided where 3 non-accessible portable restrooms are provided. 5% of three is at least one accessible, portable restroom is required.

Resolution

Provide minimum 5% accessible single user portable toilets in each cluster of single user portable toilets.

Quantity

1 EA

Priority	3

Map for Barrier ID: AX420233



612 +34.162730, -118.097649

Photos for Barrier ID: AX420233



Barrier ID: AX419858

Pasadena High School BUILDING C

Assembly	Interior Access Route
Type	Interior Access Route
ADA Standard	222, 803, 903
Barrier Detail	The locker room does not have a compliant bench.
Location Description	Building C - C101D
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The dressing room bench is 7 1/2 half inches wide.

Resolution


Provide a bench on an accessible route and adjacent to an accessible locker. The bench shall have an adjacent clear space of 30" minimum by 48" minimum located at the end of the bench and parallel to the axis of the bench. The top of the seat shall be 17" minimum and 19" maximum from finish floor. The seat shall be 42" minimum long. The seat shall have a depth of 20" minimum and 24" maximum. The bench shall provide back support or be affixed to a wall. Back support shall be 42" minimum in length extending from a point 2" maximum above the seat surface to 18" minimum above the seat surface. Back support shall be 2-1/2" maximum from the rear edge of the seat measured horizontally. When installed in wet locations, the surface of the seat shall be slip resistant and shall not accumulate water.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419858

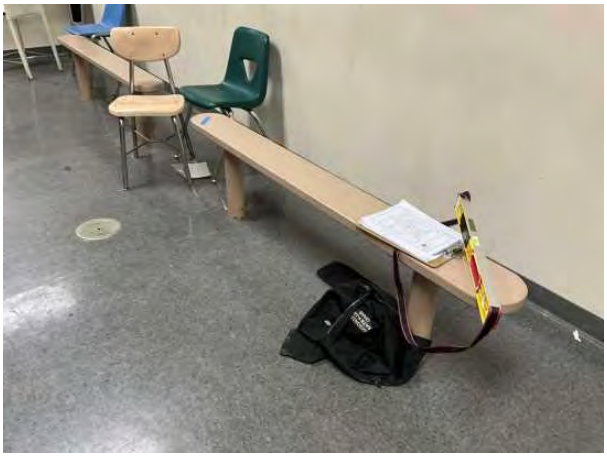



Barrier ID: AX419885

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	225.21
Barrier Detail	The locker room does not have accessible lockers.
Location Description	Building S - S110 Team Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

48 lockers are provided. None of the lockers provide a shelf and coat hooks within reach range. 48 lockers requires 3 accessible lockers.

Resolution

Provide a minimum of 5%, or at least one, of the total number of lockers as designated accessible lockers which are accessible. Accessible lockers shall be dispersed among the total number of lockers provided. Accessible lockers have clear space of 30" minimum by 48" minimum centered on the locker. Accessible lockers have operable parts that can be operated with one hand, and do not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds maximum. SHELVES AND COAT HOOKS: Accessible lockers have shelves and clothing hooks within at least one of the allowable reach ranges for a forward or side approach. A minimum of one shelf shall be 40" minimum and 48" maximum above the finish floor or ground. Hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

3 EA

Priority	3

Photos for Barrier ID: AX419885













Barrier ID: AX419772

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	225.21
Barrier Detail	The locker room does not have accessible lockers.
Location Description	Building S - S112 Boys Locker Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

660 lockers are provided. None of the lockers provide shelves within reach range. 660 lockers requires 33 lockers to be accessible.

Resolution


Provide a minimum of 5%, or at least one, of the total number of lockers as designated accessible lockers which are accessible. Accessible lockers shall be dispersed among the total number of lockers provided. Accessible lockers have clear space of 30" minimum by 48" minimum centered on the locker. Accessible lockers have operable parts that can be operated with one hand, and do not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds maximum. SHELVES AND COAT HOOKS: Accessible lockers have shelves and clothing hooks within at least one of the allowable reach ranges for a forward or side approach. A minimum of one shelf shall be 40" minimum and 48" maximum above the finish floor or ground. Hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]


Quantity

33 EA

Priority	3

Photos for Barrier ID: AX419772

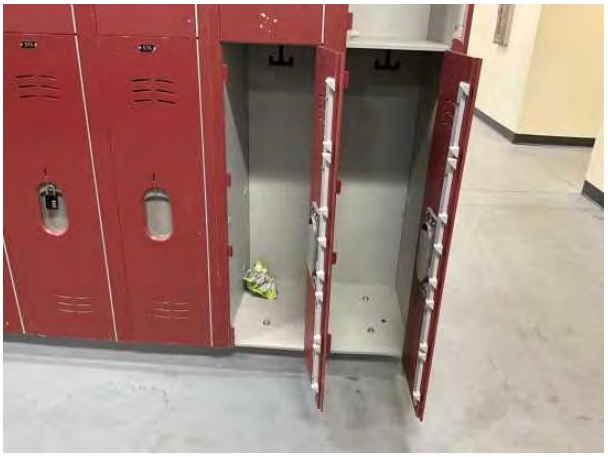

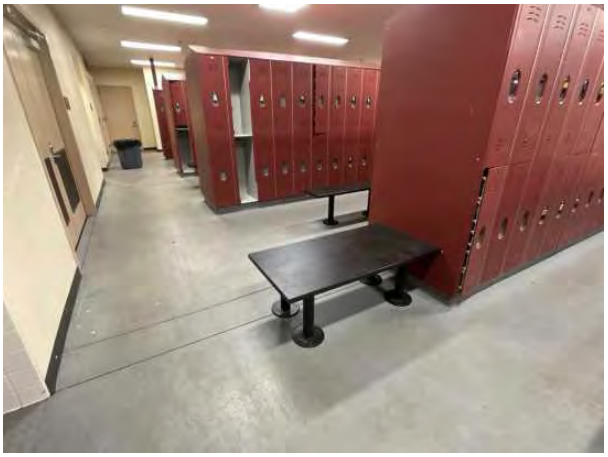









Barrier ID: AX419911

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	225.21
Barrier Detail	The locker room does not have accessible lockers.
Location Description	Building S - S117 Girls Locker Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

660 total lockers provided. 16 accessible lockers are provided. 660 lockers requires 33 to be accessible.

Resolution

Provide a minimum of 5% of the total number of lockers as designated accessible lockers which are accessible. Accessible lockers shall be dispersed among the total number of lockers provided. Accessible lockers have clear space of 30" minimum by 48" minimum centered on the locker. Accessible lockers have operable parts that can be operated with one hand, and do not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds maximum. SHELVES AND COAT HOOKS: Accessible lockers have shelves and clothing hooks within at least one of the allowable reach ranges for a forward or side approach. A minimum of one shelf shall be 40" minimum and 48" maximum above the finish floor or ground. Hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]


Quantity


17 EA

Priority	3

Photos for Barrier ID: AX419911



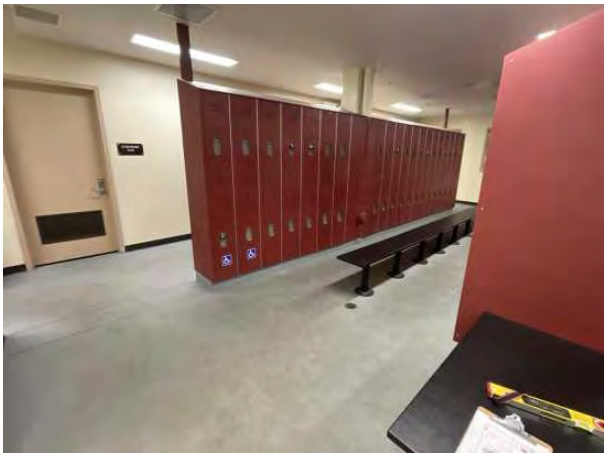

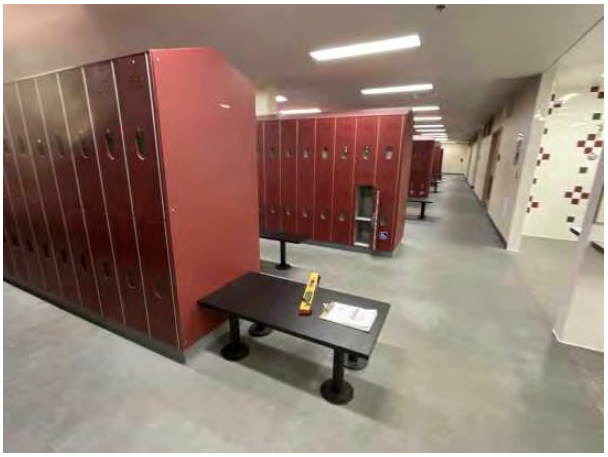

Barrier ID: AX419913

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	225.21
Barrier Detail	The locker room does not have accessible lockers.
Location Description	Building S - S136 Team Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The bottom shelf is 7 inches above the floor. The top shelf is 65 inches above the floor and the coat hooks are 62 inches above the floor. A total of 30 lockers are provided. No accessible locker is provided. 2 accessible lockers is required.

Resolution


Provide a minimum of 5%, or at least one, of the total number of lockers as designated accessible lockers which are accessible. Accessible lockers shall be dispersed among the total number of lockers provided. Accessible lockers have clear space of 30" minimum by 48" minimum centered on the locker. Accessible lockers have operable parts that can be operated with one hand, and do not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds maximum. SHELVES AND COAT HOOKS: Accessible lockers have shelves and clothing hooks within at least one of the allowable reach ranges for a forward or side approach. A minimum of one shelf shall be 40" minimum and 48" maximum above the finish floor or ground. Hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

2 EA


Priority	3

Photos for Barrier ID: AX419913

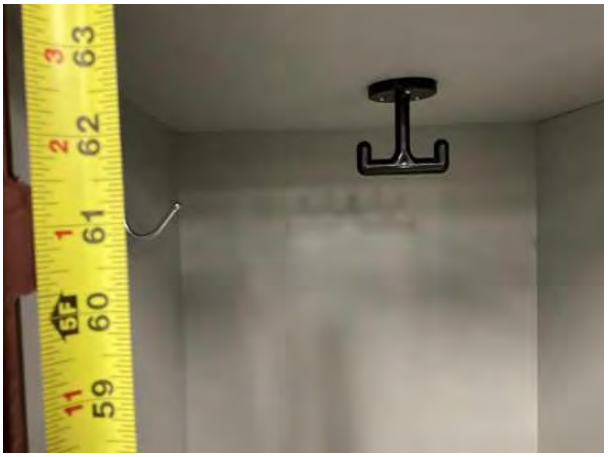





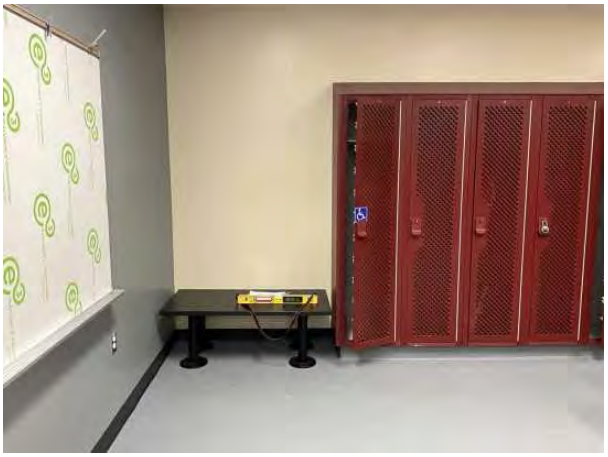

Barrier ID: AX419915

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	225.21
Barrier Detail	The locker room does not have accessible lockers.
Location Description	Building S - S137 Team Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The bottom shelf is 7 inches above the floor. The top shelf is 65 inches above the floor and the coat hooks are 62 inches above the floor. A total of 30 lockers are provided. not accessible locker is provided. No accessible locker is provided. 2 accessible lockers are required.

Resolution


Provide a minimum of 5%, or at least one, of the total number of lockers as designated accessible lockers which are accessible. Accessible lockers shall be dispersed among the total number of lockers provided. Accessible lockers have clear space of 30" minimum by 48" minimum centered on the locker. Accessible lockers have operable parts that can be operated with one hand, and do not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds maximum. SHELVES AND COAT HOOKS: Accessible lockers have shelves and clothing hooks within at least one of the allowable reach ranges for a forward or side approach. A minimum of one shelf shall be 40" minimum and 48" maximum above the finish floor or ground. Hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]


Quantity

2 EA

Priority	3

Photos for Barrier ID: AX419915

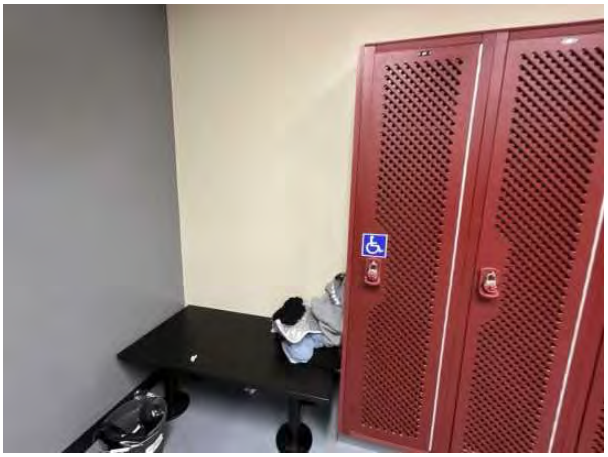

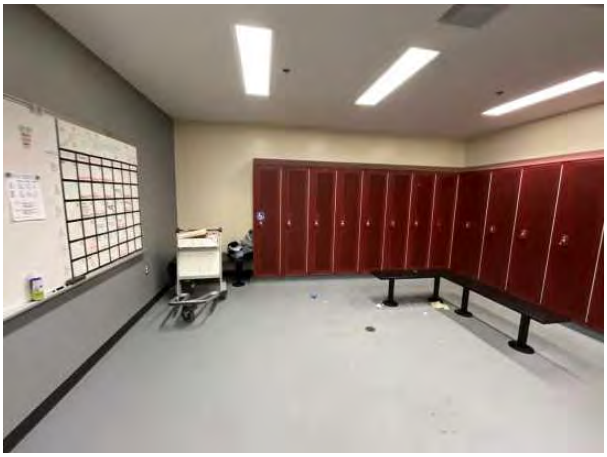

Barrier ID: AX419917

Pasadena High School BUILDING S

Assembly	Locker and Dressing Rooms
Type	Locker and Dressing Rooms
ADA Standard	225.21
Barrier Detail	The locker room does not have accessible lockers.
Location Description	Building S - S138 Team Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The bottom shelf is 7 inches above the floor. The top shelf is 65 inches above the floor and the coat hooks are 62 inches above the floor. A total of 30 lockers are provided. not accessible locker is provided. No accessible locker is provided.

Resolution


Provide a minimum of 5%, or at least one, of the total number of lockers as designated accessible lockers which are accessible. Accessible lockers shall be dispersed among the total number of lockers provided. Accessible lockers have clear space of 30" minimum by 48" minimum centered on the locker. Accessible lockers have operable parts that can be operated with one hand, and do not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds maximum. SHELVES AND COAT HOOKS: Accessible lockers have shelves and clothing hooks within at least one of the allowable reach ranges for a forward or side approach. A minimum of one shelf shall be 40" minimum and 48" maximum above the finish floor or ground. Hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419917

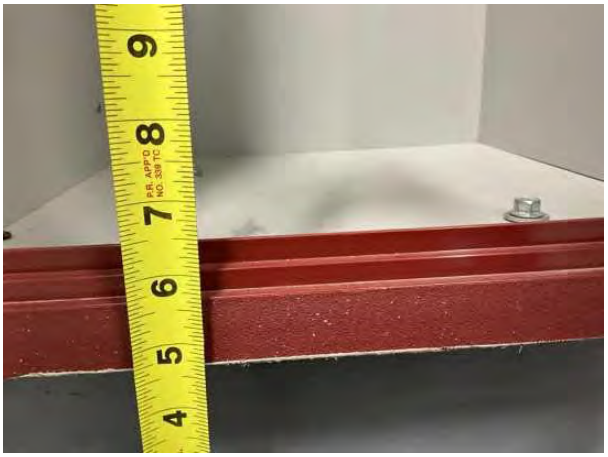







Barrier ID: AX418711

Pasadena High School BUILDING I

Assembly	Common Areas
Type	Locker Rooms
ADA Standard	225.21
Barrier Detail	The locker area does not have accessible lockers.
Location Description	Lockers Between Building G & H South & South Side
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The lockers between buildings, H and G are placed on a on a ramp and will not provide accessible lockers due to the slopes. A total of 120 lockers are provided. 6 additional accessible lockers are required at the nearest group of lockers.

Resolution


Provide a minimum of 5% of the total number of lockers as designated accessible lockers, or at least one locker, which are accessible. Accessible lockers have clear space of 30" minimum by 48" minimum centered on the locker. Accessible lockers have operable parts that can be operated with one hand, and do not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds maximum. SHELVES AND COAT HOOKS: Accessible lockers have shelves and clothing hooks within at least one of the allowable reach ranges for a forward or side approach. A minimum of one shelf shall be 40" minimum and 48" maximum above the finish floor or ground. Hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

31 EA

Priority	3

Map for Barrier ID: AX418711

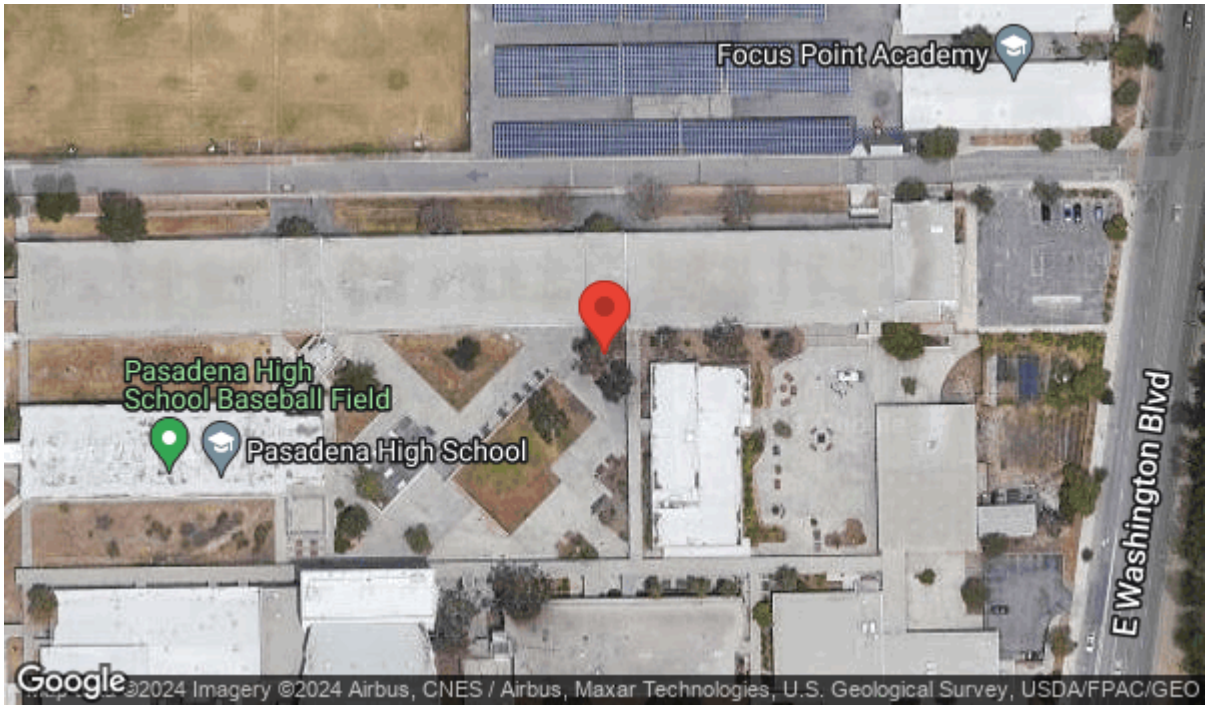


281 +34.162791, -118.091490


Photos for Barrier ID: AX418711







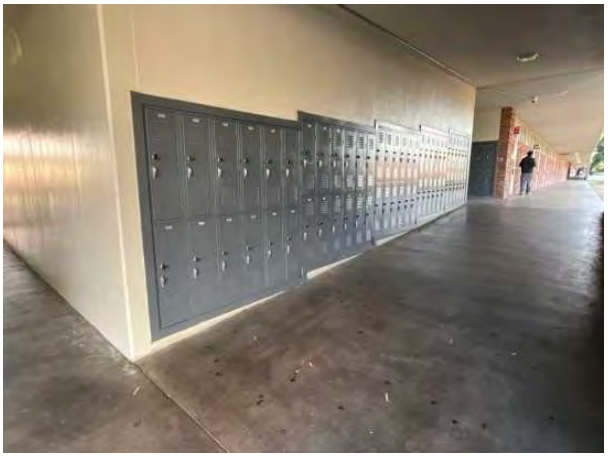

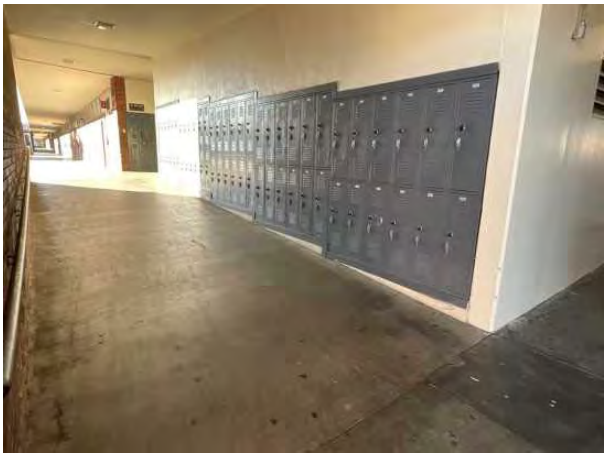

Barrier ID: AX419758

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Common Areas
Type	Locker Rooms
ADA Standard	225.21
Barrier Detail	The area does not have accessible lockers.
Location Description	Lockers Between Building H & I, G & H North / South Side 1st & 2nd Floor
Observed	Dec 10, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

A total of 120 lockers are provided per group. This happens at 8 ramps. None of the lockers can be accessible due to the ramp slope. 120 per group of lockers requires 6 to be accessible per group. Provide additional accessible lockers at the nearest group of lockers.

Resolution


Provide a minimum of 5% of the total number of lockers as designated accessible lockers, or at least one locker, which are accessible. Accessible lockers have clear space of 30" minimum by 48" minimum centered on the locker. Accessible lockers have operable parts that can be operated with one hand, and do not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds maximum. SHELVES AND COAT HOOKS: Accessible lockers have shelves and clothing hooks within at least one of the allowable reach ranges for a forward or side approach. A minimum of one shelf shall be 40" minimum and 48" maximum above the finish floor or ground. Hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

48 EA

Priority	3


Map for Barrier ID: AX419758

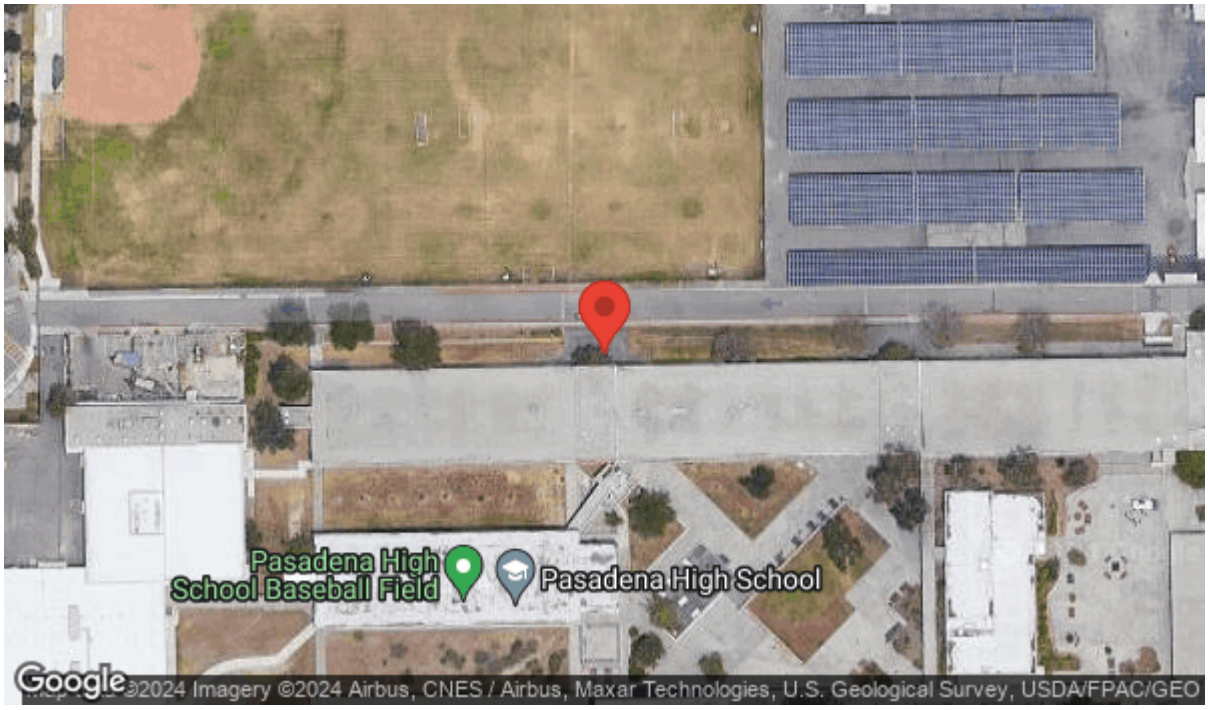

344 +34.163073, -118.092279

Photos for Barrier ID: AX419758



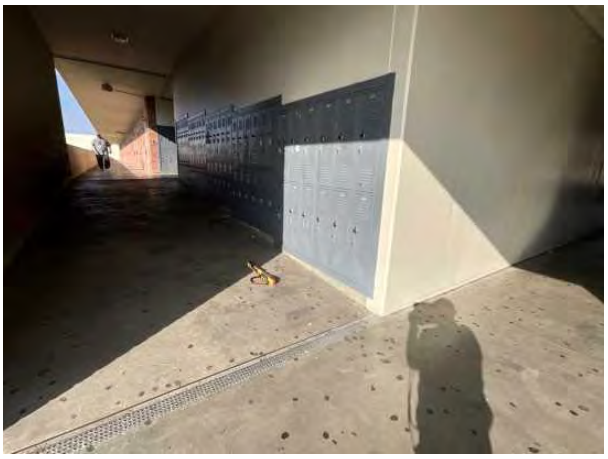





Barrier ID: AX418284

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Common Areas
Type	Locker Rooms
ADA Standard	225.21
Barrier Detail	The locker room does not have accessible lockers.
Location Description	Typical Lockers Throughout The Campus
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The campus student lockers have hardware requiring tight, grasping, pinching, and twisting of the wrist to operate. Approximately..... Building E has a total of 490 lockers. Building G has a total of 440 lockers. Building H has a total of 440 lockers. Building I has a total of 440 lockers.

Resolution


Provide a minimum of 5% of the total number of lockers as designated accessible lockers, which are accessible. Distribute accessible lockers based on amount of lockers per group. Accessible lockers have clear space of 30" minimum by 48" minimum centered on the locker. Accessible lockers have operable parts that can be operated with one hand, and do not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds maximum. SHELVES AND COAT HOOKS: Accessible lockers have shelves and clothing hooks within at least one of the allowable reach ranges for a forward or side approach. A minimum of one shelf shall be 40" minimum and 48" maximum above the finish floor or ground. Hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

91 EA

Priority	3

Photos for Barrier ID: AX418284

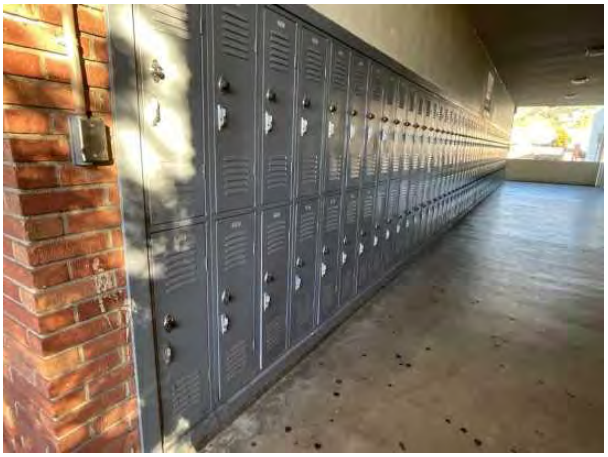



Barrier ID: AX418309

Pasadena High School BUILDING F

Assembly	Interior Access Route
Type	Platform Lift
ADA Standard	CBD Chap 11B-410
Barrier Detail	CALIFORNIA: The platform lift is not compliant.
Location Description	Building F - Drinking Fountain Adjacent to F121 Women's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Unable to verify if the lift works. The lift has power, however, does not respond to up-and-down controls otherwise appears to be compliant.

Resolution

Install a compliant platform lift. A platform lift shall operate without an attendant and allow unassisted entry and exit from the lift. The platform lift shall be provided with a stand-by power source or self-charging standby battery capable of powering all functions for min. 5 upward and downward trips, in case of primary power loss. The doors/gates shall be low-energy power operated unless the following exception applies. [EXCEPTION: Platform lifts serving two landings maximum and having doors or gates on opposite sides are permitted to have self-closing manual doors or gates.] Where power-operated doors are provided, the door/gate shall open automatically and remain open for 20 seconds minimum. End doors shall provide 32" minimum clearance and side doors provide 42" minimum clearance. The floor surface in the platform lift shall be stable, firm and slip resistant, and maximum 2.08% slope. Clear floor space 30" minimum by 48" minimum shall be provided in the lift. Clear space of 30" minimum x 48" minimum for forward or parallel approach shall be provided at the controls, both within the platform lift and exterior controls. The clearance between the platform sill and the edge of any runway landing shall be 1-1/4" maximum. The controls shall be within reach range and operable with one hand without tight grasping, pinching, or twisting of the wrist motions. Install a sign stating "NO FREIGHT" and the International Symbol of Accessibility posted at a conspicuous place at each landing and within the platform enclosure.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418309





Barrier ID: AX419803

Pasadena High School BUILDING R

Assembly	Interior Access Route
Type	Platform Lift
ADA Standard	CBD Chap 11B-410
Barrier Detail	CALIFORNIA: The platform lift is not compliant.
Location Description	Building R - Wheelchair Lift Adjacent to R118
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Unable to verify, if the wheelchair lift works. The wheelchair lift appears to comply with spatial requirements and reach range requirements.

Resolution

Install a compliant platform lift. A platform lift shall operate without an attendant and allow unassisted entry and exit from the lift. The platform lift shall be provided with a stand-by power source or self-charging standby battery capable of powering all functions for min. 5 upward and downward trips, in case of primary power loss. The doors/gates shall be low-energy power operated unless the following exception applies. [EXCEPTION: Platform lifts serving two landings maximum and having doors or gates on opposite sides are permitted to have self-closing manual doors or gates.] Where power-operated doors are provided, the door/gate shall open automatically and remain open for 20 seconds minimum. End doors shall provide 32" minimum clearance and side doors provide 42" minimum clearance. The floor surface in the platform lift shall be stable, firm and slip resistant, and maximum 2.08% slope. Clear floor space 30" minimum by 48" minimum shall be provided in the lift. Clear space of 30" minimum x 48" minimum for forward or parallel approach shall be provided at the controls, both within the platform lift and exterior controls. The clearance between the platform sill and the edge of any runway landing shall be 1-1/4" maximum. The controls shall be within reach range and operable with one hand without tight grasping, pinching, or twisting of the wrist motions. Install a sign stating "NO FREIGHT" and the International Symbol of Accessibility posted at a conspicuous place at each landing and within the platform enclosure.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419803









Barrier ID: AX419824

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	521 CMR 33.6; ADA 903

Barrier Detail

MASSACHUSETTS: The dressing/fitting/changing area does not have a compliant bench.

Location Description	Building E - E105A
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The IT cabinet has the bottom edge at 47 inches above the floor and protrudes 10 inches.

Resolution

Provide a bench in each dressing / fitting/ changing room. The bench shall be on an accessible route and adjacent to an accessible locker, if lockers are present. The bench shall have an adjacent clear space of 30" minimum x 40" minimum located at the end of the bench and parallel to the axis of the bench for a parallel approach to the bench. The seat/bench shall be 24" x 48" and fixed to the wall along the shorter dimension. The seat shall be mounted 17" to 19" above the finish floor and open below with a minimum of 12" in height measured from the floor. Back support shall be 42" minimum in length extending from a point 2" maximum above the seat surface to 18" minimum above the seat surface. Back support shall be 2-1/2" maximum from the rear edge of the seat measured horizontally. Back support can be provided by a wall. When installed in wet locations, the surface of the seat shall be slip resistant and shall not accumulate water.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419824



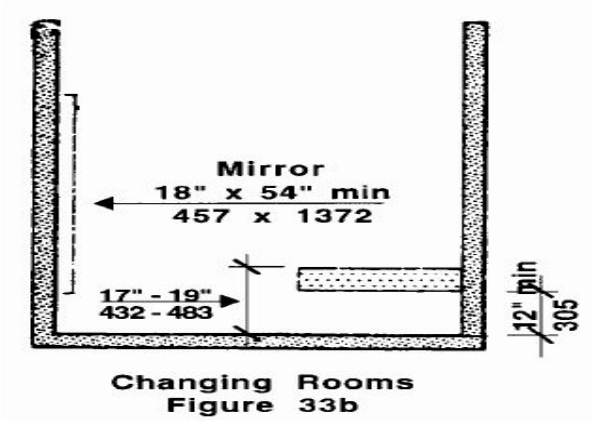





Barrier ID: AX418645

Pasadena High School BUILDING Q

Assembly	Interior Access Route
Type	Protruding Object
ADA Standard	225.21
Barrier Detail	The locker room does not have accessible lockers.
Location Description	Building Q - Q107B
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

132 lockers provided. None are accessible due to the hardware. The hardware requires tight, grasping, pinching, and twisting of the wrist to open. 132 lockers requires 7 lockers to be accessible.

Resolution

Provide a minimum of 5% of the total number of lockers as designated accessible lockers, or at least one locker, which are accessible. Accessible lockers have clear space of 30" minimum by 48" minimum centered on the locker. Accessible lockers have operable parts that can be operated with one hand, and do not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds maximum. SHELVES AND COAT HOOKS: Accessible lockers have shelves and clothing hooks within at least one of the allowable reach ranges for a forward or side approach. A minimum of one shelf shall be 40" minimum and 48" maximum above the finish floor or ground. Hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]


Quantity

7 EA

Priority	3

Photos for Barrier ID: AX418645



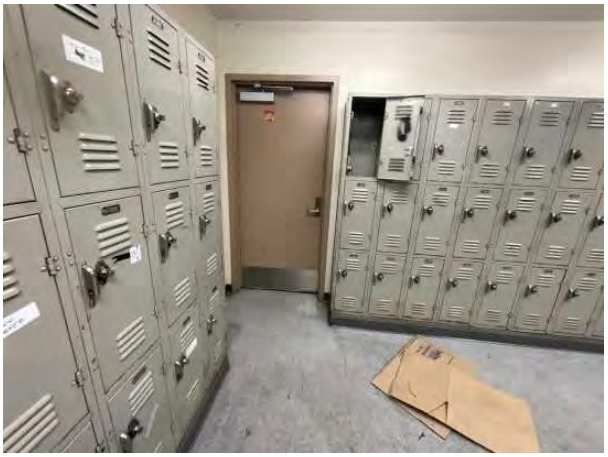



Barrier ID: AX418712

Pasadena High School BUILDING I

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	225.21
Barrier Detail	The locker area does not have accessible lockers.
Location Description	Lockers Between Building I & H South & South Side
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The lockers between buildings, H and G are placed on a on a ramp and will not provide accessible lockers due to the slopes. A total of 120 lockers are provided. 6 additional accessible lockers are required at the nearest group of lockers.

Resolution


Provide a minimum of 5% of the total number of lockers as designated accessible lockers, or at least one locker, which are accessible. Accessible lockers have clear space of 30" minimum by 48" minimum centered on the locker. Accessible lockers have operable parts that can be operated with one hand, and do not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds maximum. SHELVES AND COAT HOOKS: Accessible lockers have shelves and clothing hooks within at least one of the allowable reach ranges for a forward or side approach. A minimum of one shelf shall be 40" minimum and 48" maximum above the finish floor or ground. Hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

120 EA


Priority	3


Map for Barrier ID: AX418712

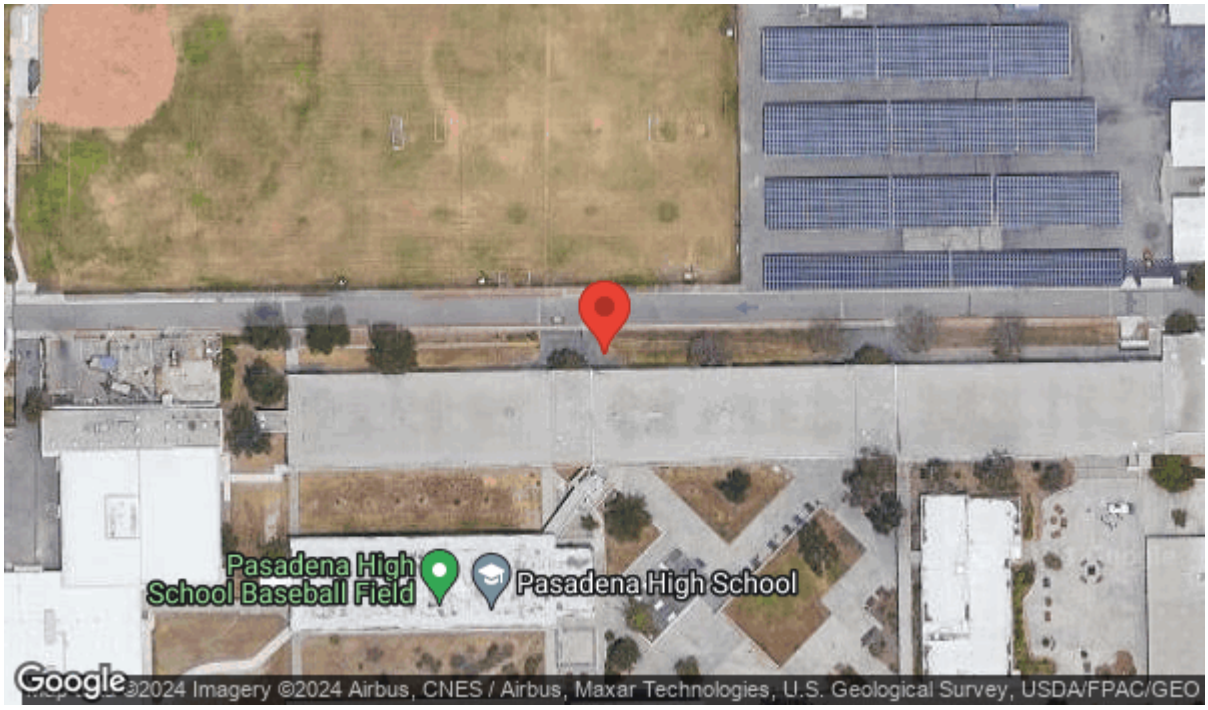


282 +34.163081, -118.092213

Photos for Barrier ID: AX418712

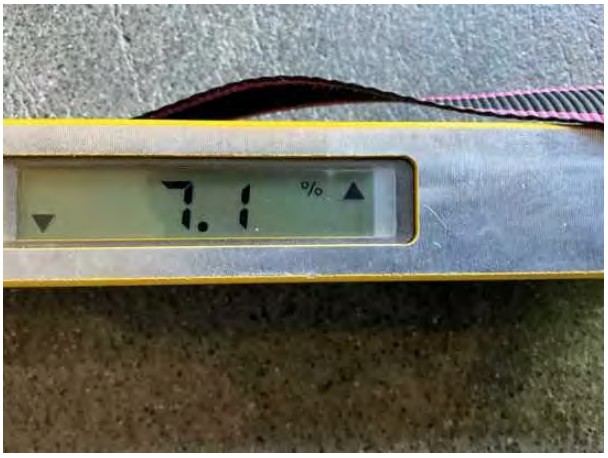

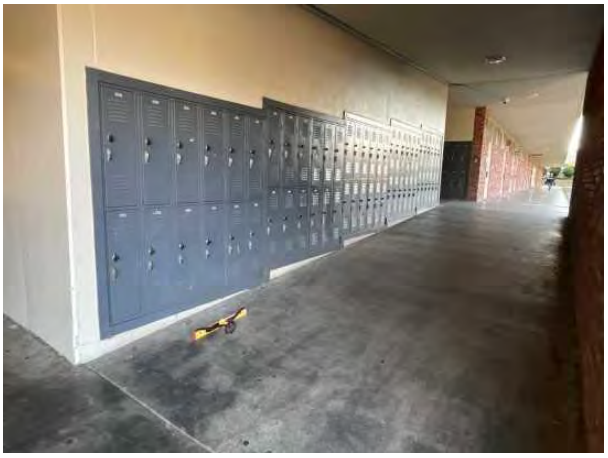

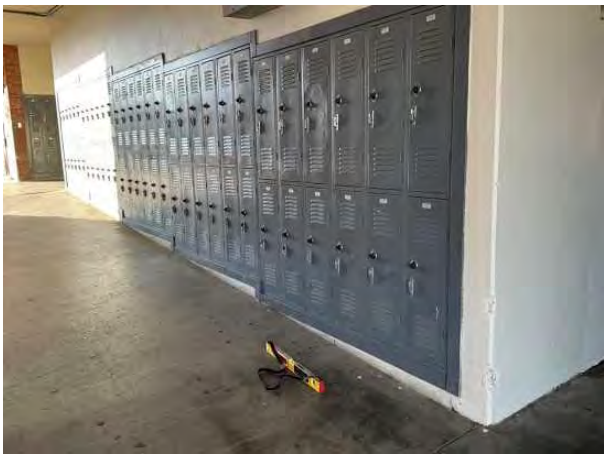



Barrier ID: AX418681

Pasadena High School BUILDING W

Assembly	Restroom
Type	Restroom/Bathroom
ADA Standard	603, 604, 606
Barrier Detail	The entire restroom is not compliant due to limited room dimensions.
Location Description	Building N - Restroom Women's Multi-User
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The restroom is too small to be compliant. The restroom width is 40 inches the door is 23 1/2 inches wide.

Resolution


Redesign the single user restroom to allow for a larger restroom with compliant dimensions for all restroom fixtures, including an accessible route into the restroom and clear space at fixtures. Provide compliant restroom fixtures. Clearance at the water closet shall be minimum 60" wide and minimum 56" deep. Water closet clearance can overlap with the toilet, grab bars, dispensers, clear floor space of other fixtures, and turning spaces, but cannot overlap other fixtures. Horizontal grab bars shall be provided on the side wall and rear wall at the water closet. Horizontal grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface. The horizontal side wall grab bar shall be located on the side wall closest to the toilet. The side grab bar shall measure 42" long, be mounted 12" maximum from rear wall, and extend 54" minimum from the rear wall. The rear wall grab bar shall be 36" long, and extend from the centerline of the toilet 12" minimum on closed side of the toilet and 24" minimum on the open side of the toilet. [Exceptions: 1. Where wall space does not allow for a 36" long bar due to a recessed fixture adjacent to the water closet, a 24" long bar centered on the toilet is permitted. 2. Where the administrative authority requires flush controls for flush valves located in a position which conflicts with the rear grab bar, then the rear grab bar may be split or shifted to the open side of the water closet.] Projecting fixtures/dispensers above grab bars shall be located minimum 12" above horizontal grab bars and minimum of 1-1/2" below horizontal grab bars. Flush controls shall be mounted on the open side of the toilet, operable with one hand and mounted no higher than 48" above the finished floor. The centerline of the water closet shall be 16" minimum to 18" maximum from the side wall. The water closet seat height shall be 17" minimum to 19" maximum above finished floor. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the leading edge of the toilet, measured to the center line of the dispenser. Toilet paper dispensers shall allow continuous flow without delivery control. Relocate the lavatory to provide minimum 30" wide by minimum 48" deep clear floor space, positioned for a forward approach to the lavatory with the 30" dimension centered on the lavatory. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. Alcoves shall be 36" wide minimum where the depth exceeds 24". Alcoves shall be 60" wide minimum where the depth exceeds 15". The rim of the lavatory shall be 34" maximum above finish floor. Compliant knee and toe clearance shall be provided. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25 inches maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance and shall comply with 306.2. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum. [EXCEPTIONS: The dip of the overflow shall not be considered in determining knee and toe clearances. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.] Floor or ground surfaces of a clear floor or ground space shall comply with 302. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] Provide a turning space within the restroom. Provide a turning space within the restroom. Turning space shall be either a circular space or a T- shaped space. The circular turning space shall be a space of 60" diameter minimum. The space shall be permitted to include knee and toe clearance. The T-shaped turning space shall be a T-shaped space within a 60" square minimum with arms and base 36" wide minimum. Each arm of the T shall be clear of obstructions 12" minimum in each direction and the base shall be clear of obstructions 24" minimum. The space shall be permitted to include knee and toe clearance only at the end of either the base or one arm. Floor or ground surfaces of a turning space shall be level. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] [Advisory 304.2: Floor or Ground Surface Exception: Turning space "changes in level" refers to surfaces with slopes and to surfaces with abrupt rise exceeding 1/4". Such changes in level are prohibited in required clear floor and ground spaces, turning spaces, and in similar spaces where people using wheelchairs and other mobility devices must park their mobility aides, such as in wheelchair spaces, or maneuver to use elements such as at doors, fixtures, and telephones.] At least one of each type of fixture, element, control or dispenser in each toilet room shall be accessible, within allowable reach ranges. The bottom of the reflective surface of mirrors, not including the frame, shall be 40" maximum above finish floor when above lavatories and counters, and 35" maximum when not above sinks and counters. [ADVISORY: the top edge of the reflective surface of mirrors should be 74" minimum from finished floor.]


Quantity

1 EA

Priority 3

Photos for Barrier ID: AX418681

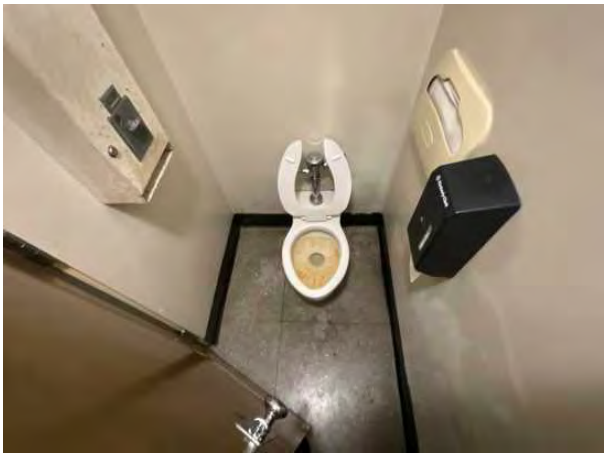

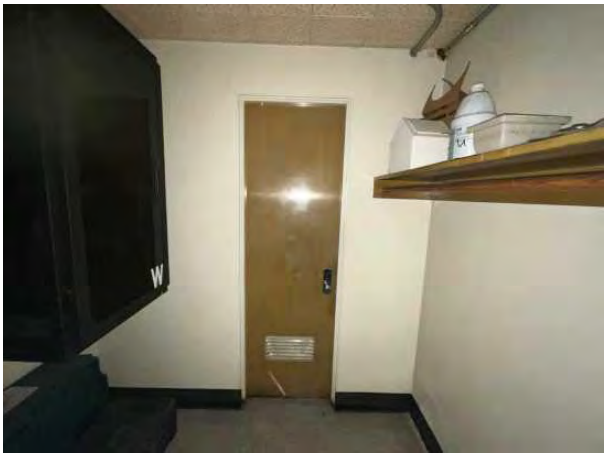







Barrier ID: AX424556

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom
ADA Standard	603, 604, 606
Barrier Detail	The entire restroom is not compliant due to limited room dimensions.
Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The restroom is too small to comply with water closet required clearances, the lavatory required clearances, and the door maneuvering clearances.

Resolution

Redesign the single user restroom to allow for a larger restroom with compliant dimensions for all restroom fixtures, including an accessible route into the restroom and clear space at fixtures. Provide compliant restroom fixtures. Clearance at the water closet shall be minimum 60" wide and minimum 56" deep. Water closet clearance can overlap with the toilet, grab bars, dispensers, clear floor space of other fixtures, and turning spaces, but cannot overlap other fixtures. Horizontal grab bars shall be provided on the side wall and rear wall at the water closet. Horizontal grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface. The horizontal side wall grab bar shall be located on the side wall closest to the toilet. The side grab bar shall measure 42" long, be mounted 12" maximum from rear wall, and extend 54" minimum from the rear wall. The rear wall grab bar shall be 36" long, and extend from the centerline of the toilet 12" minimum on closed side of the toilet and 24" minimum on the open side of the toilet. [Exceptions: 1. Where wall space does not allow for a 36" long bar due to a recessed fixture adjacent to the water closet, a 24" long bar centered on the toilet is permitted. 2. Where the administrative authority requires flush controls for flush valves located in a position which conflicts with the rear grab bar, then the rear grab bar may be split or shifted to the open side of the water closet.] Projecting fixtures/dispensers above grab bars shall be located minimum 12" above horizontal grab bars and minimum of 1-1/2" below horizontal grab bars. Flush controls shall be mounted on the open side of the toilet, operable with one hand and mounted no higher than 48" above the finished floor. The centerline of the water closet shall be 16" minimum to 18" maximum from the side wall. The water closet seat height shall be 17" minimum to 19" maximum above finished floor. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the leading edge of the toilet, measured to the center line of the dispenser. Toilet paper dispensers shall allow continuous flow without delivery control. Relocate the lavatory to provide minimum 30" wide by minimum 48" deep clear floor space, positioned for a forward approach to the lavatory with the 30" dimension centered on the lavatory. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. Alcoves shall be 36" wide minimum where the depth exceeds 24". Alcoves shall be 60" wide minimum where the depth exceeds 15". The rim of the lavatory shall be 34" maximum above finish floor. Compliant knee and toe clearance shall be provided. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25 inches maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance and shall comply with 306.2. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum. [EXCEPTIONS: The dip of the overflow shall not be considered in determining knee and toe clearances. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.] Floor or ground surfaces of a clear floor or ground space shall comply with 302. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] Provide a turning space within the restroom. Provide a turning space within the restroom. Turning space shall be either a circular space or a T- shaped space. The circular turning space shall be a space of 60" diameter minimum. The space shall be permitted to include knee and toe clearance. The T-shaped turning space shall be a T-shaped space within a 60" square minimum with arms and base 36" wide minimum. Each arm of the T shall be clear of obstructions 12" minimum in each direction and the base shall be clear of obstructions 24" minimum. The space shall be permitted to include knee and toe clearance only at the end of either the base or one arm. Floor or ground surfaces of a turning space shall be level. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] [Advisory 304.2: Floor or Ground Surface Exception: Turning space "changes in level" refers to surfaces with slopes and to surfaces with abrupt rise exceeding 1/4". Such changes in level are prohibited in required clear floor and ground spaces, turning spaces, and in similar spaces where people using wheelchairs and other mobility devices must park their mobility aides, such as in wheelchair spaces, or maneuver to use elements such as at doors, fixtures, and telephones.] At least one of each type of fixture, element, control or dispenser in each toilet room shall be accessible, within allowable reach ranges. The bottom of the reflective surface of mirrors, not including the frame, shall be 40" maximum above finish floor when above lavatories and counters, and 35" maximum when not above sinks and counters. [ADVISORY: the top edge of the reflective surface of mirrors should be 74" minimum from finished floor.]


Quantity

1 EA


Priority 3

Photos for Barrier ID: AX424556



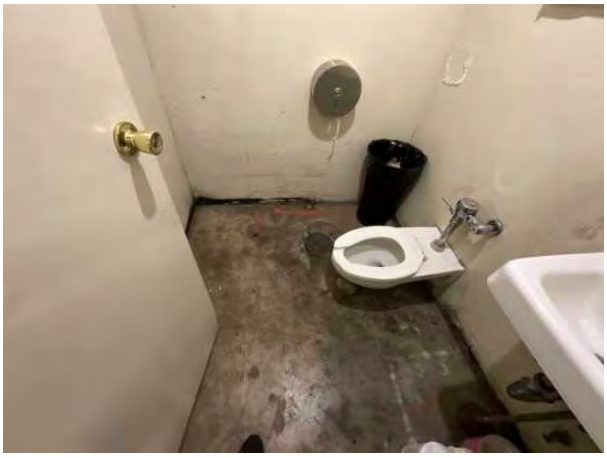



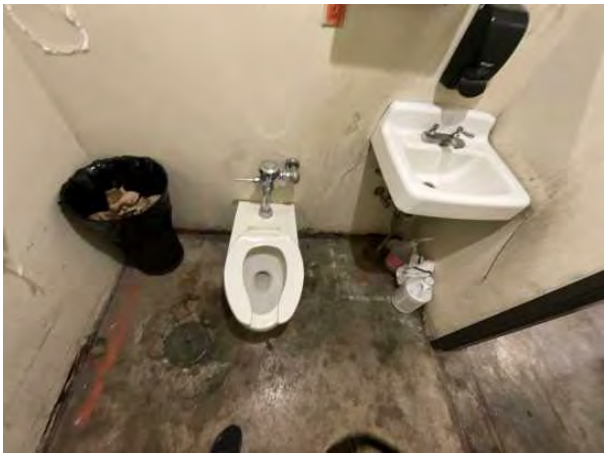



Barrier ID: AX419793

Pasadena High School BUILDING R

Assembly	Restroom
Type	Restroom/Bathroom - Ambulatory Stall
ADA Standard	213.3.1, 309, 404.2.7, 604.8.2

Barrier Detail

The ambulatory stall size is not compliant, or an ambulatory stall is not provided.

Location Description	Building R - Restroom Men's R105
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

A combination of six urinals and water closets are provided, and no ambulatory stall is provided.

Resolution

Provide a compliant ambulatory stall, where six or more toilet compartments are provided or where the combination of urinals and water closets totals six or more fixtures. An ambulatory stall is minimum 60" deep and the width is minimum 35" and maximum 37". Grab bars shall be provided on both sides of the compartment. The side grab bars shall be 33" minimum to 36" maximum above finish floor to the top of the gripping surface, except in children's (ages 3-12) water closets where horizontal grab bars shall be 18" minimum and 27" maximum above the finish floor to the top of the gripping surface. Horizontal grab bars should be installed at a consistent height. The side wall grab bars shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. The centerline of the toilet shall be minimum 17" to maximum 19" from the side wall. Toilet compartment doors for ambulatory stalls shall be minimum 32" wide when open 90 degrees and have minimum 80" high clearance. If the approach is to the latch side of the compartment door, clearance between the exterior side of the door of the compartment and any obstruction shall be 42" minimum. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19".]

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX419793





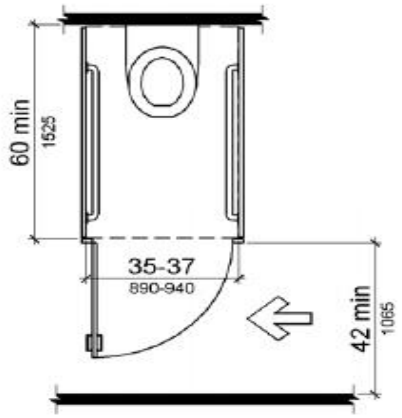



Barrier ID: AX424391

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Coat Hook
ADA Standard	213.3.7, 604.8.3, 308
Barrier Detail	The coat hook is not within an allowable reach range.
Location Description	Building A - A253C Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The coat hook is 49 inches above the floor.

Resolution

Install the coat hook within an allowable reach range. Unobstructed Forward Reach: Where a forward reach is unobstructed, the high forward reach shall be 48" maximum and the low forward reach shall be 15" minimum above the finish floor or ground. Obstructed High Forward Reach: Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48" maximum where the reach depth is 20" maximum. Where the reach depth exceeds 20", the high forward reach shall be 44" maximum and the reach depth shall be 25" maximum. Unobstructed Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48" maximum and the low side reach shall be 15" minimum above the finish floor or ground. [EXCEPTION: An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10" maximum.] Obstructed High Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34" maximum and the depth of the obstruction shall be 24" maximum. The high side reach shall be 48" maximum for a reach depth of 10" maximum. Where the reach depth exceeds 10", the high side reach shall be 46" maximum for a reach depth of 24" maximum. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424391





Barrier ID: AX424416

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Coat Hook
ADA Standard	213.3.7, 604.8.3, 308
Barrier Detail	The coat hook is not within an allowable reach range.
Location Description	Building A - A255C Restroom Women's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The coat hook is 49 inches above the floor.

Resolution

Install the coat hook within an allowable reach range. Unobstructed Forward Reach: Where a forward reach is unobstructed, the high forward reach shall be 48" maximum and the low forward reach shall be 15" minimum above the finish floor or ground. Obstructed High Forward Reach: Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48" maximum where the reach depth is 20" maximum. Where the reach depth exceeds 20", the high forward reach shall be 44" maximum and the reach depth shall be 25" maximum. Unobstructed Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48" maximum and the low side reach shall be 15" minimum above the finish floor or ground. [EXCEPTION: An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10" maximum.] Obstructed High Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34" maximum and the depth of the obstruction shall be 24" maximum. The high side reach shall be 48" maximum for a reach depth of 10" maximum. Where the reach depth exceeds 10", the high side reach shall be 46" maximum for a reach depth of 24" maximum. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424416





Barrier ID: AX424494

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Coat Hook
ADA Standard	213.3.7, 604.8.3, 308
Barrier Detail	The coat hook is not within an allowable reach range.
Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The coat hook is 52 inches above the floor.

Resolution


Install the coat hook within an allowable reach range. Unobstructed Forward Reach: Where a forward reach is unobstructed, the high forward reach shall be 48" maximum and the low forward reach shall be 15" minimum above the finish floor or ground. Obstructed High Forward Reach: Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48" maximum where the reach depth is 20" maximum. Where the reach depth exceeds 20", the high forward reach shall be 44" maximum and the reach depth shall be 25" maximum. Unobstructed Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48" maximum and the low side reach shall be 15" minimum above the finish floor or ground. [EXCEPTION: An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10" maximum.] Obstructed High Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34" maximum and the depth of the obstruction shall be 24" maximum. The high side reach shall be 48" maximum for a reach depth of 10" maximum. Where the reach depth exceeds 10", the high side reach shall be 46" maximum for a reach depth of 24" maximum. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424494

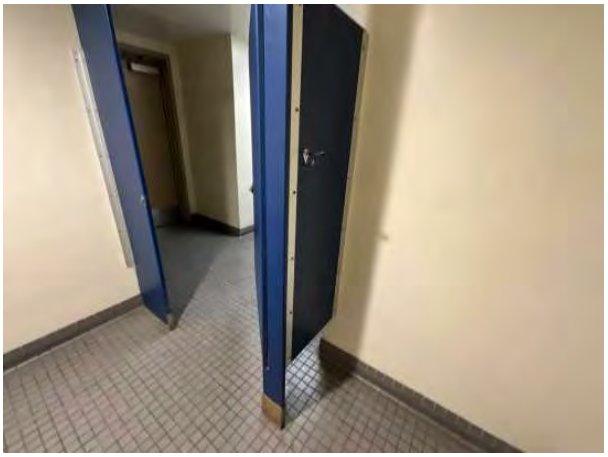

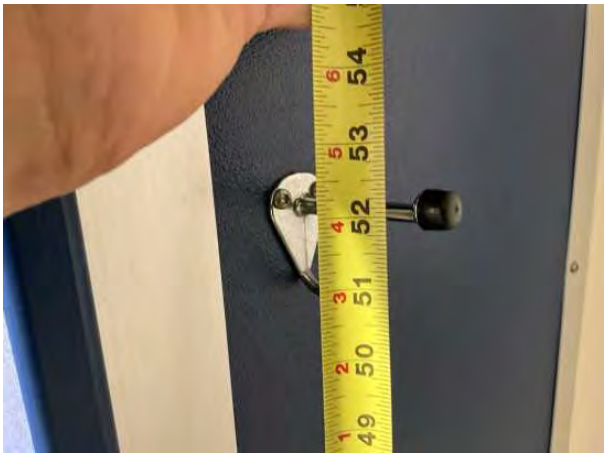

Barrier ID: AX424453

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building A - A101A Restroom Unisex
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door has 32 inch deep, maneuvering clear space for latch approach on the pull side due to a bed.

Resolution


Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX424453

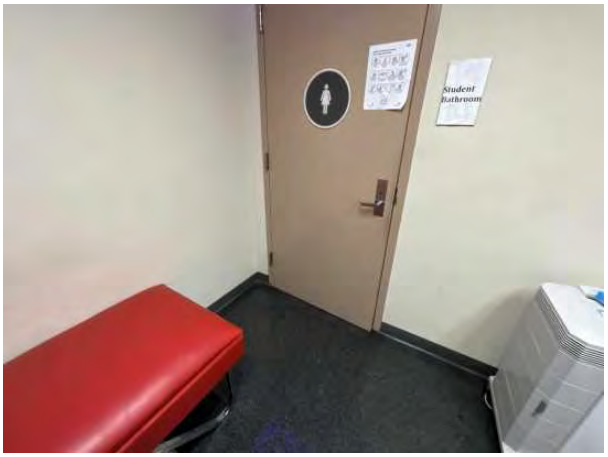



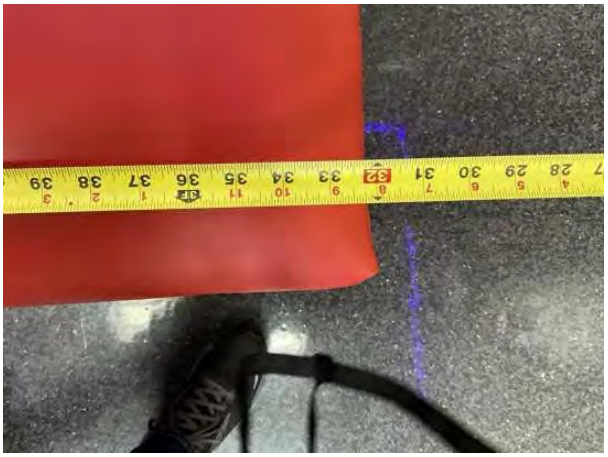

Barrier ID: AX424443

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2.4

Barrier Detail

The push side of the door does not have the required maneuvering clearances.

Location Description	Building A - A101B Restroom Unisex
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The furniture is within the required door, push side, maneuvering clearance

Resolution


Remove the furniture to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 12" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424443

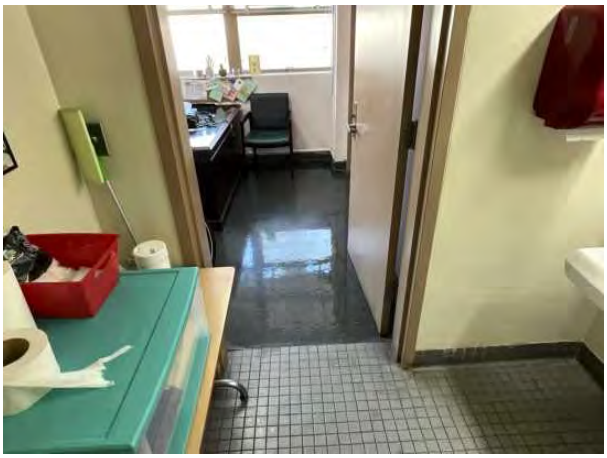



Barrier ID: AX424466

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building A - A110 Restroom
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 9 inch wide side, maneuvering clearance for forward, approach on the pull side due to a step in the concrete.

Resolution


Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424466

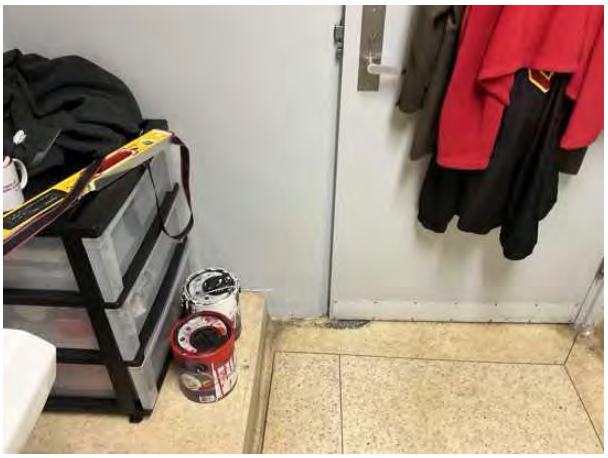



Barrier ID: AX424396

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building A - A253B Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 48 inch deep, maneuvering clear space for forward, approach on the pull side to the lavatory.

Resolution

Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424396





Barrier ID: AX424392

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building A - A253C Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 15 5/8 inches wide side, maneuvering, clear space on the pull side for forward approach to the lavatory.

Resolution

Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is X" minimum. The required side clearance is Y" minimum on the latch/hinge side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side or hinge side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA


Priority	3

Photos for Barrier ID: AX424392







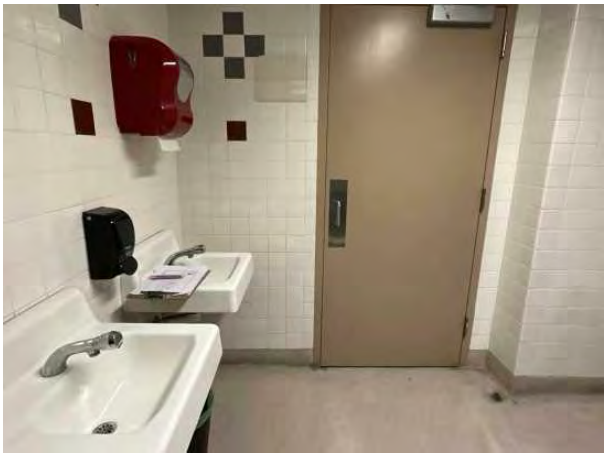

Barrier ID: AX424406

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building A - A255B Restroom Women's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 55 3/4 inch deep maneuvering clearance on the pull side for forward approach to the furniture.

Resolution

Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424406





Barrier ID: AX424486

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 16 inch wide side, maneuvering clearance for forward approach on the pull side.

Resolution

Relocate the shelving to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424486





Barrier ID: AX418244

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building B - Restroom Men's B 107
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The door maneuvering clearance extends 40 inches to the wall pop out. The side maneuvering, clear space extends 12 inches to the wall pop out.

Resolution

Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA


Priority	3

Photos for Barrier ID: AX418244







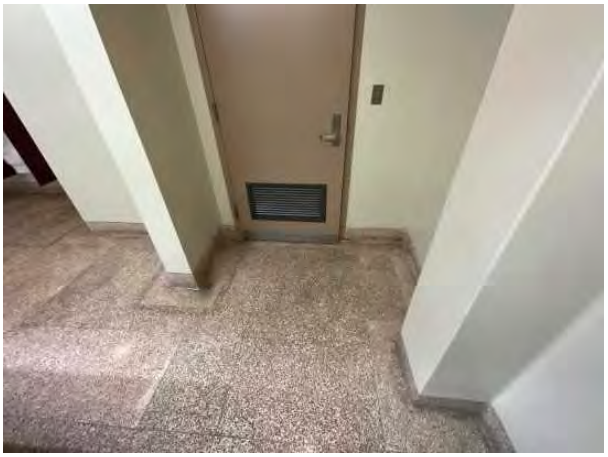

Barrier ID: AX419875

Pasadena High School BUILDING C

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2.4

Barrier Detail

The push side of the door does not have the required maneuvering clearances.

Location Description	Building C - Ramp Near Exit Facing South
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door does not have a level landing due to the ramp. The door landing slopes 7.2%.

Resolution


Redesign to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity


1 EA

Priority	3

Photos for Barrier ID: AX419875

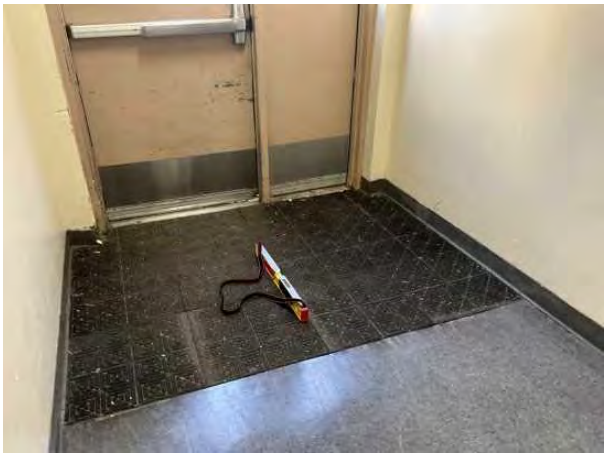

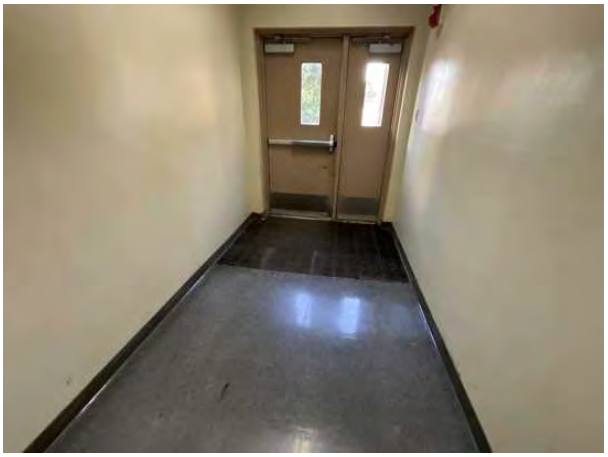

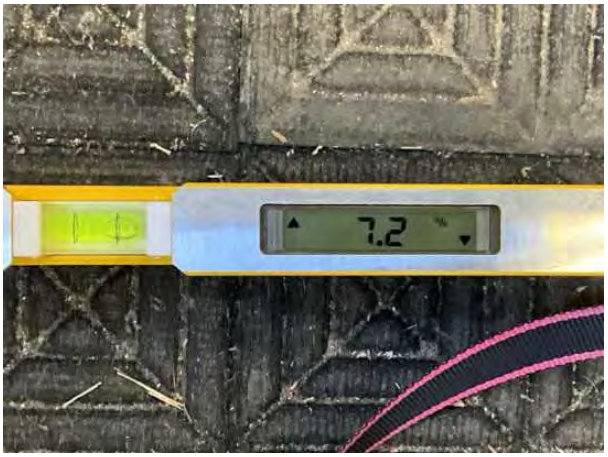

Barrier ID: AX419871

Pasadena High School BUILDING C

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building C - Restroom Men's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 12 inch wide side, maneuvering clearance on the pull side for forward approach.

Resolution

Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419871



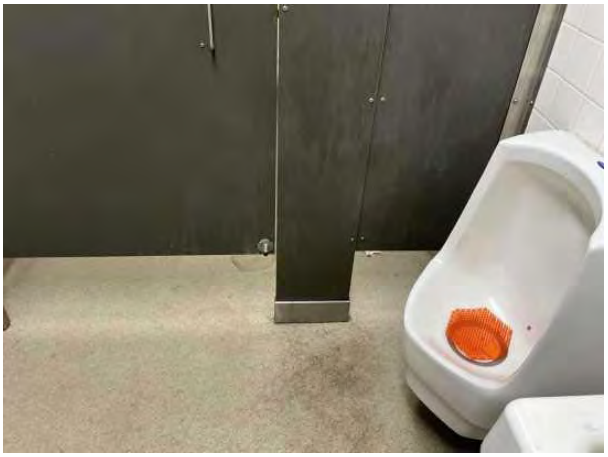



Barrier ID: AX420196

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2.4

Barrier Detail

The push side of the door does not have the required maneuvering clearances.

Location Description	Building E - 1st Floor Restroom Men's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The urinal partition is placed within the wheelchair stall door, maneuvering, clear space on the push side. The push side maneuvering clearance depth is 33 inches.

Resolution

Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 0" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity


1 EA

Priority	3

Photos for Barrier ID: AX420196



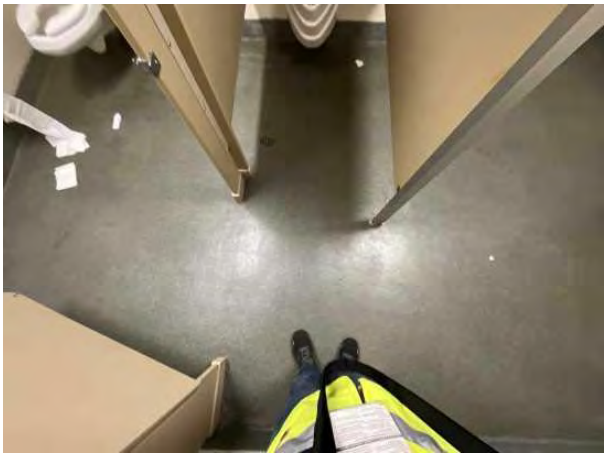

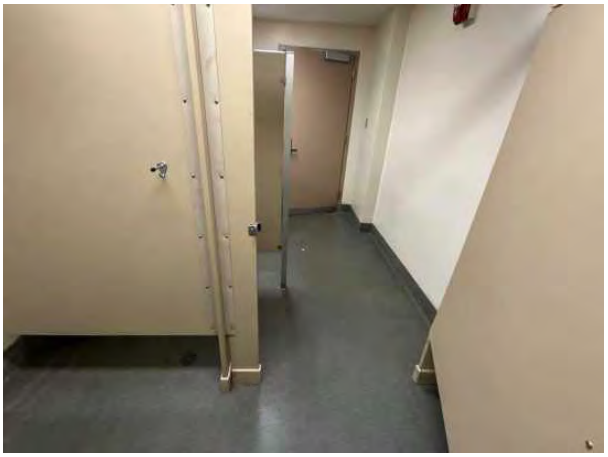

Barrier ID: AX418317

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2.4

Barrier Detail

The push side of the door does not have the required maneuvering clearances.

Location Description	Building F - Restroom F100B Unisex
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 4 inch wide side, maneuvering clearance for forward approach on the push side due to the trash can.

Resolution

Relocate the trash can to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 12" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418317



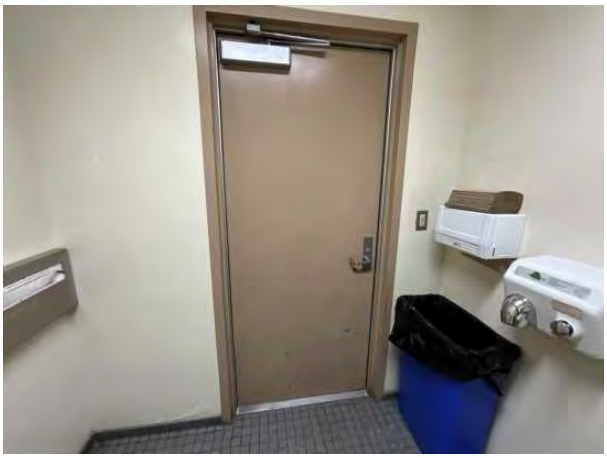

Barrier ID: AX419719

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building H East End - 1st Floor Restroom Boys
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The door provides 48 inch deep, maneuvering clear space for latch approach on the pull side.

Resolution


Redesign to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 18" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419719

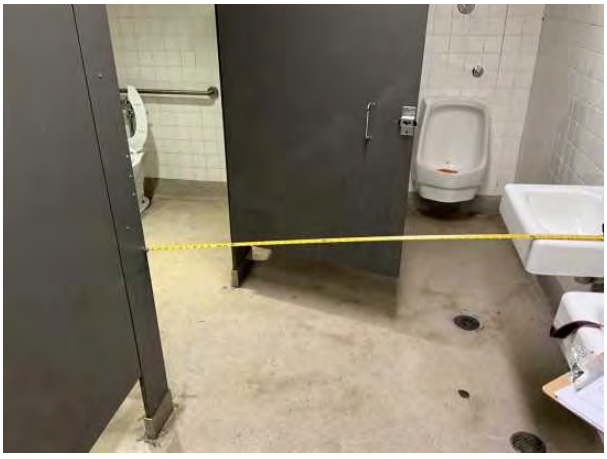



Barrier ID: AX419766

Pasadena High School BUILDING I

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2.4

Barrier Detail

The push side of the door does not have the required maneuvering clearances.

Location Description	Building I East End - 2nd Floor Restroom Women's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The bench obstructs the wheelchair compartment door maneuvering clearance by 21 1/2 inches.

Resolution

Relocate the bench to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 0" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419766



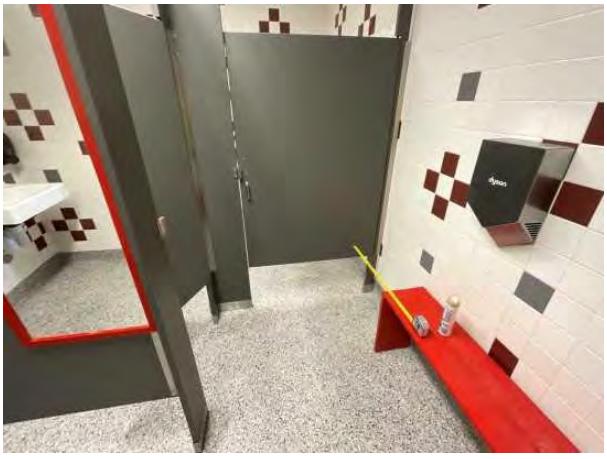

Barrier ID: AX418666

Pasadena High School BUILDING N

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2.4

Barrier Detail

The push side of the door does not have the required maneuvering clearances.

Location Description	Building N - Restroom Women's Multi-User
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door is in an alcove 9 1/4 inches deep and the door has a closer.

Resolution

Redesign to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is 48" minimum. The required side clearance is 12" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418666



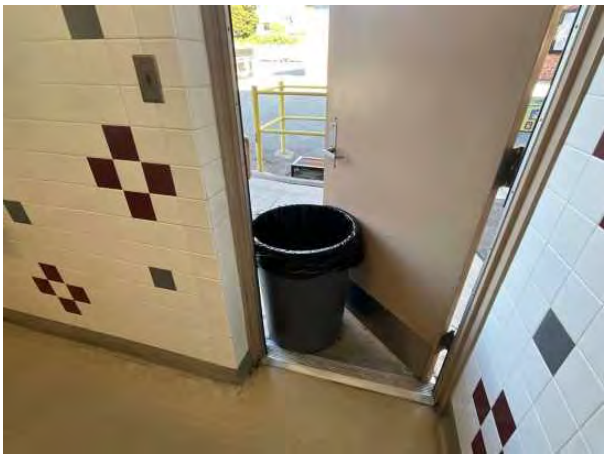

Barrier ID: AX418655

Pasadena High School BUILDING P

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2; Table 404.2.4.1

Barrier Detail

The pull side of the accessible door does not have the required maneuvering clearances.

Location Description	Building P - Restroom Men's Multi-User
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The door landing slopes, 4.5% and the sandbags are within the doors 24 inch side wide maneuvering clearance.

Resolution


Relocate the sandbags to provide the required maneuvering clearance at the pull side of the door. The required depth of the maneuvering clearance is 60" minimum. The required side clearance is 24" minimum on the latch side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418655

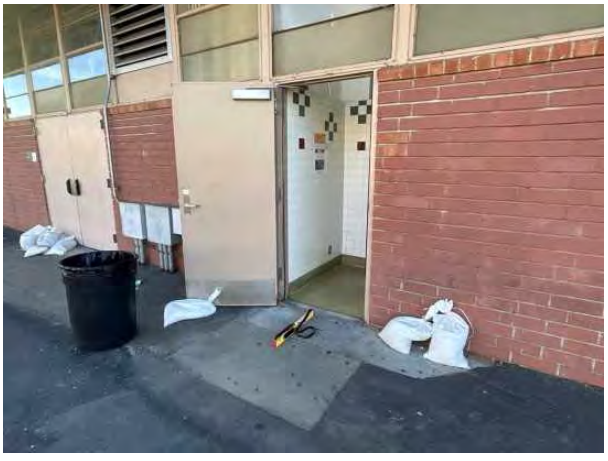



Barrier ID: AX418656

Pasadena High School BUILDING P

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2.4

Barrier Detail

The push side of the door does not have the required maneuvering clearances.

Location Description	Building P - Restroom Men's Multi-User
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door is in a 9 inch deep alcove, and the door has a closer.

Resolution


Redesign to provide the required maneuvering clearance at the push side of the door. The required depth of the maneuvering clearance is X" minimum. The required side clearance is Y" minimum on the latch/hinge side of the door. Maneuvering clearance shall extend the full width of the doorway and the required latch side or hinge side clearance. Floor or ground space within the required maneuvering clearance shall be maximum 1:48 (2.08%) slope. Changes in level are not permitted.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418656

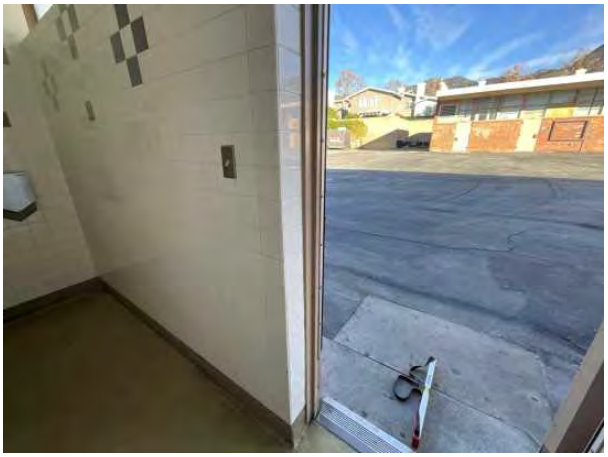





Barrier ID: AX424540

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom - Door
ADA Standard	404.2.3
Barrier Detail	The door has less than 32" clear width.
Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The door width is only 27 inches clear.

Resolution

Remove and replace with a door that has a minimum clear opening of 32"; measured with the door open at 90°, measured from the face of the door to the stop. This barrier must be removed in conjunction with barrier ID 424556. The cost of this barrier removal is covered under ID 424556 and therefore, the cost of this ID is shown as $0. Door openings shall provide a clear width of 32" minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90°. Openings more than 24" deep shall provide a clear opening of 36" minimum. There shall be no projections into the required clear opening width lower than 34" above the finish floor or ground. Projections into the clear opening width between 34" and 80" above the finish floor or ground shall not exceed 4". [EXCEPTIONS: 1. In alterations, a projection of 5/8" maximum into the required clear width shall be permitted for the latch side stop. 2. Door closers and door stops shall be permitted to be 78" minimum above the finish floor or ground.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424540





Barrier ID: AX424473

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.2 and 606.3
Barrier Detail	The lavatory is mounted higher than 34" to the higher of the rim or counter.
Location Description	Building A - A110 Restroom
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The lavatory rim is 34 1/4 inches above the floor.

Resolution

Install the lavatory at a compliant height, and provide knee and toe clearance. Minimum one lavatory in a restroom shall comply. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. [EXCEPTIONS: 1. A lavatory in a toilet or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling unit kitchens, sinks that are adjustable to variable heights, 29" minimum and 36" maximum, shall be permitted where rough-in plumbing permits connections of supply and drain pipes for sinks mounted at the height of 29".] Compliant knee and toe clearance shall be provided. [EXCEPTIONS: 2. A lavatory in a toilet room or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to provide knee and toe clearance. 3. In residential dwelling units, cabinetry shall be permitted under lavatories and kitchen sinks provided that all of the following conditions are met: (a) the cabinetry can be removed without removal or replacement of the fixture; (b) the finish floor extends under the cabinetry; and (c) the walls behind and surrounding the cabinetry are finished. 4. A knee clearance of 24" minimum above the finish floor or ground shall be permitted at lavatories and sinks used primarily by children 6 through 12 years where the rim or counter surface is 31" maximum above the finish floor or ground. 5. A parallel approach complying with 305 shall be permitted to lavatories and sinks used primarily by children 5 years and younger. 6. The dip of the overflow shall not be considered in determining knee and toe clearances. 7. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.] Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance and shall comply. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Floor or ground surfaces of a clear floor or ground space shall comply. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] The clear floor or ground space shall be 30" minimum by 48" minimum. Unless otherwise specified, clear floor or ground space shall be permitted to include compliant clear space. Unless otherwise specified, clear floor or ground space shall be positioned for either forward or parallel approach to an element. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. Alcoves shall be 36" wide minimum where the depth exceeds 24". Alcoves shall be 60" wide minimum where the depth exceeds 15".

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424473



Barrier ID: AX424405

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.4

Barrier Detail

The automatic faucet, when activated, does not remain on for minimum 10 seconds.

Location Description	Building A - A253B Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The metered faucet stays on for 6.36 seconds.

Resolution

Replace faucets with compliant handles. Hand-operated metering faucets shall remain open for 10 seconds minimum. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424405



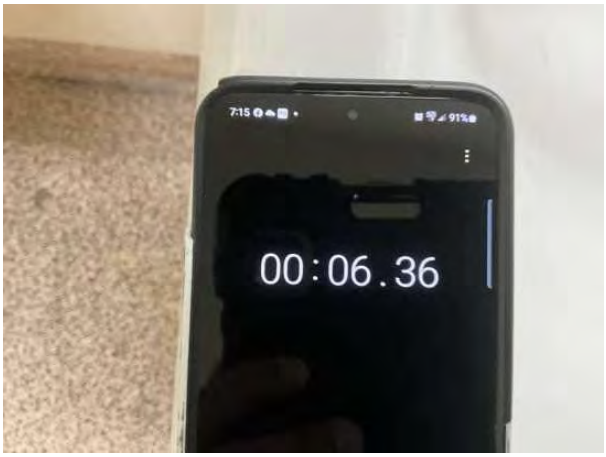

Barrier ID: AX424394

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.4

Barrier Detail

The automatic faucet, when activated, does not remain on for minimum 10 seconds.

Location Description	Building A - A253C Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The metered faucet stays on for 7.86 seconds.

Resolution


Replace faucets with compliant handles. Hand-operated metering faucets shall remain open for 10 seconds minimum. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424394

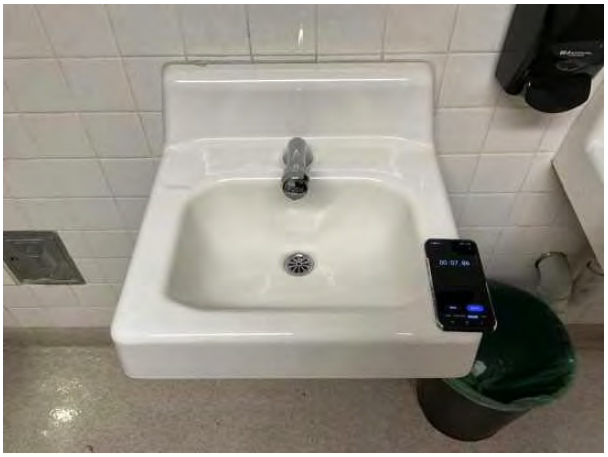

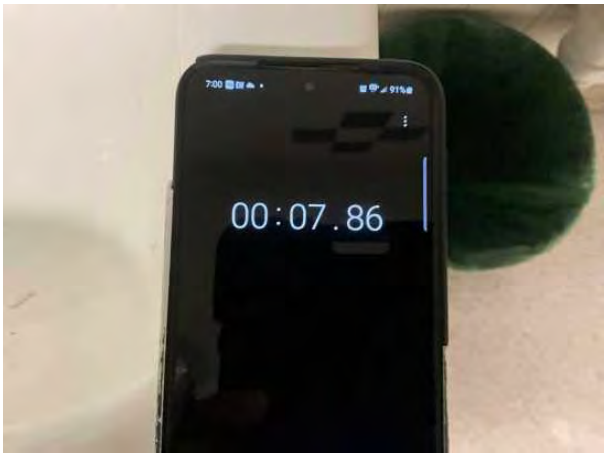

Barrier ID: AX424421

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.4

Barrier Detail

The automatic faucet, when activated, does not remain on for minimum 10 seconds.

Location Description	Building A - A255C Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The metered faucet provides 8.56 seconds of water flow.

Resolution

Replace faucets with compliant handles. Hand-operated metering faucets shall remain open for 10 seconds minimum. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424421



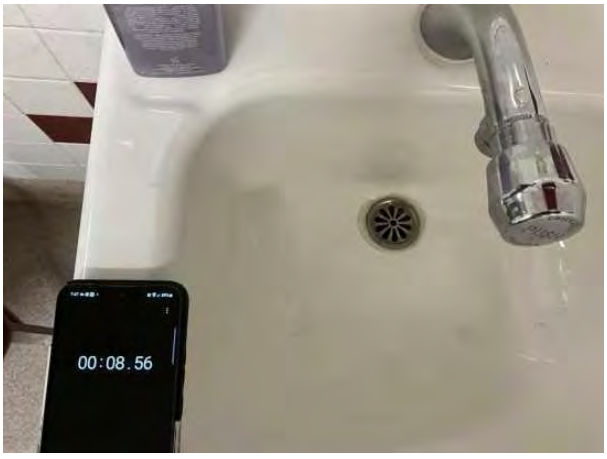

Barrier ID: AX419821

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	CBC Chap 11B-213, 306, 606

Barrier Detail

CALIFORNIA: The lavatory does not have the required knee and toe clearance.

Location Description	Building B - B110 Girls Dressing
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The 27 inch high knee clearance, extends 5 inches past the apron.

Resolution

Provide at least 10% but no fewer than one lavatory with compliant knee and toe clearance. The lavatory shall maintain the maximum allowable height of 34" to the rim of the sink. The maximum allowable exterior bowl depth is 6-1/2". A compliant clear floor space of minimum 30" wide centered on the lavatory and minimum 48" deep, positioned for a forward approach, shall be provided. Space under an element between 9" and 29" above the finish floor or ground shall be considered knee clearance and shall comply. Knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor. The bottom of the front of the lavatory shall be minimum 29" above the finish floor. Knee clearance reduction is not allowed. Toe clearance shall be minimum 25" horizontal depth between the finish floor and 9" AFF. Knee and toe clearance shall be 30" wide minimum and centered on the lavatory. A compliant clear floor space, positioned for a forward approach, and compliant knee and toe clearance shall be provided. [EXCEPTIONS: 1. Toe clearance shall extend 19" maximum under lavatories 2. A lavatory in a toilet room or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to provide knee and toe clearance. 3. In residential dwelling units, cabinetry shall be permitted under lavatories and kitchen sinks provided that all of the following conditions are met: (a) the cabinetry can be removed without removal or replacement of the fixture; (b) the finish floor extends under the cabinetry; and (c) the walls behind and surrounding the cabinetry are finished. 4. A knee clearance of 24" minimum above the finish floor or ground shall be permitted at lavatories and sinks used primarily by children 6 through 12 years where the rim or counter surface is 31" maximum above the finish floor or ground. 5. A parallel approach complying with 305 shall be permitted to lavatories and sinks used primarily by children 5 years and younger.6. The dip of the overflow shall not be considered in determining knee and toe clearances. 7. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419821

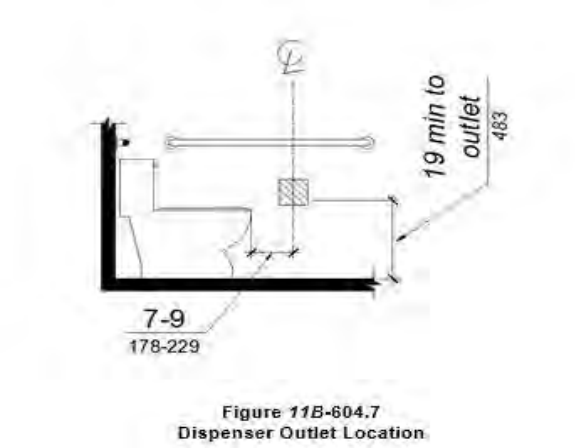


Figure *11B*-604.7
Dispenser Outlet Location





Barrier ID: AX419848

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	CBC Chap 11B-213, 306, 606

Barrier Detail

CALIFORNIA: The lavatory does not have the required knee and toe clearance.

Location Description	Building B - B112 Boys Dressing
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The 27 inch high knee clearance extends 5 1/2 inches past the apron.

Resolution

Provide at least 10% but no fewer than one lavatory with compliant knee and toe clearance. The lavatory shall maintain the maximum allowable height of 34" to the rim of the sink. The maximum allowable exterior bowl depth is 6-1/2". A compliant clear floor space of minimum 30" wide centered on the lavatory and minimum 48" deep, positioned for a forward approach, shall be provided. Space under an element between 9" and 29" above the finish floor or ground shall be considered knee clearance and shall comply. Knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor. The bottom of the front of the lavatory shall be minimum 29" above the finish floor. Knee clearance reduction is not allowed. Toe clearance shall be minimum 25" horizontal depth between the finish floor and 9" AFF. Knee and toe clearance shall be 30" wide minimum and centered on the lavatory. A compliant clear floor space, positioned for a forward approach, and compliant knee and toe clearance shall be provided. [EXCEPTIONS: 1. Toe clearance shall extend 19" maximum under lavatories 2. A lavatory in a toilet room or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to provide knee and toe clearance. 3. In residential dwelling units, cabinetry shall be permitted under lavatories and kitchen sinks provided that all of the following conditions are met: (a) the cabinetry can be removed without removal or replacement of the fixture; (b) the finish floor extends under the cabinetry; and (c) the walls behind and surrounding the cabinetry are finished. 4. A knee clearance of 24" minimum above the finish floor or ground shall be permitted at lavatories and sinks used primarily by children 6 through 12 years where the rim or counter surface is 31" maximum above the finish floor or ground. 5. A parallel approach complying with 305 shall be permitted to lavatories and sinks used primarily by children 5 years and younger.6. The dip of the overflow shall not be considered in determining knee and toe clearances. 7. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419848



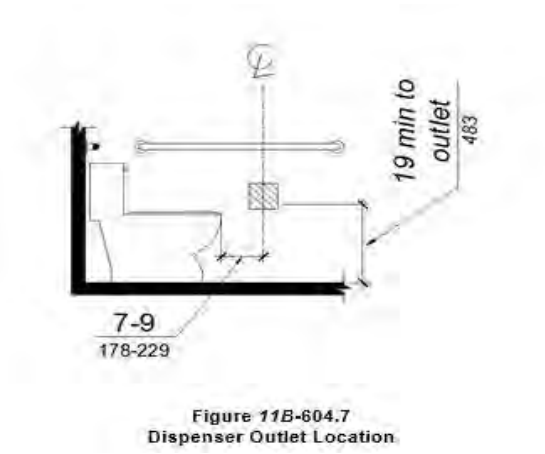


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX419851

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.4

Barrier Detail

The automatic faucet, when activated, does not remain on for minimum 10 seconds.

Location Description	Building B - B112 Boys Dressing
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The metered faucet stays on for 2.88 seconds.

Resolution

Replace faucets with compliant handles. Hand-operated metering faucets shall remain open for 10 seconds minimum. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419851


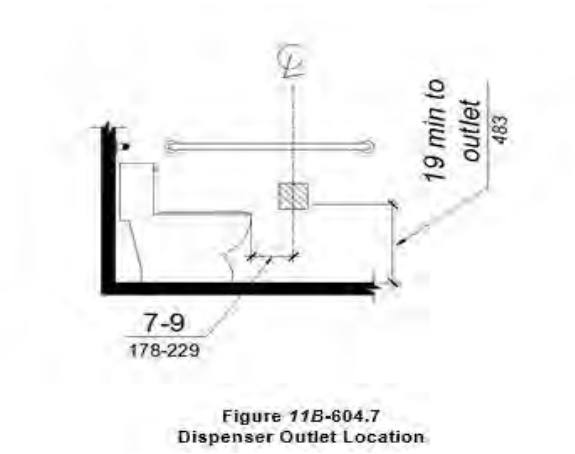


Figure *11B*-604.7
Dispenser Outlet Location



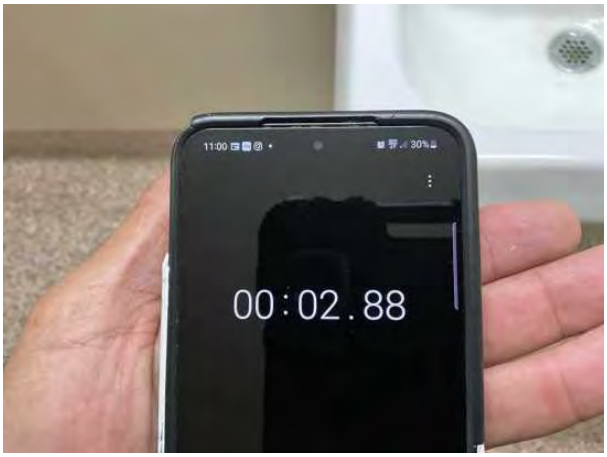

Barrier ID: AX418245

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.2 and 606.3
Barrier Detail	The lavatory is mounted higher than 34" to the higher of the rim or counter.
Location Description	Building B - Restroom Men's B 107
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The lavatory rim is 34 3/4 inches above the floor.

Resolution

Install the lavatory at a compliant height, and provide knee and toe clearance. Minimum one lavatory in a restroom shall comply. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. [EXCEPTIONS: 1. A lavatory in a toilet or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling unit kitchens, sinks that are adjustable to variable heights, 29" minimum and 36" maximum, shall be permitted where rough-in plumbing permits connections of supply and drain pipes for sinks mounted at the height of 29".] Compliant knee and toe clearance shall be provided. [EXCEPTIONS: 2. A lavatory in a toilet room or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to provide knee and toe clearance. 3. In residential dwelling units, cabinetry shall be permitted under lavatories and kitchen sinks provided that all of the following conditions are met: (a) the cabinetry can be removed without removal or replacement of the fixture; (b) the finish floor extends under the cabinetry; and (c) the walls behind and surrounding the cabinetry are finished. 4. A knee clearance of 24" minimum above the finish floor or ground shall be permitted at lavatories and sinks used primarily by children 6 through 12 years where the rim or counter surface is 31" maximum above the finish floor or ground. 5. A parallel approach complying with 305 shall be permitted to lavatories and sinks used primarily by children 5 years and younger. 6. The dip of the overflow shall not be considered in determining knee and toe clearances. 7. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.] Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance and shall comply. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Floor or ground surfaces of a clear floor or ground space shall comply. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] The clear floor or ground space shall be 30" minimum by 48" minimum. Unless otherwise specified, clear floor or ground space shall be permitted to include compliant clear space. Unless otherwise specified, clear floor or ground space shall be positioned for either forward or parallel approach to an element. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. Alcoves shall be 36" wide minimum where the depth exceeds 24". Alcoves shall be 60" wide minimum where the depth exceeds 15".

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418245





Barrier ID: AX418255

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.2 and 606.3
Barrier Detail	The lavatory is mounted higher than 34" to the higher of the rim or counter.
Location Description	Building B - Restroom Women's B 109
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The lavatory rim is 34 1/4 inch above the floor.

Resolution

Install the lavatory at a compliant height, and provide knee and toe clearance. Minimum one lavatory in a restroom shall comply. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. [EXCEPTIONS: 1. A lavatory in a toilet or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling unit kitchens, sinks that are adjustable to variable heights, 29" minimum and 36" maximum, shall be permitted where rough-in plumbing permits connections of supply and drain pipes for sinks mounted at the height of 29".] Compliant knee and toe clearance shall be provided. [EXCEPTIONS: 2. A lavatory in a toilet room or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to provide knee and toe clearance. 3. In residential dwelling units, cabinetry shall be permitted under lavatories and kitchen sinks provided that all of the following conditions are met: (a) the cabinetry can be removed without removal or replacement of the fixture; (b) the finish floor extends under the cabinetry; and (c) the walls behind and surrounding the cabinetry are finished. 4. A knee clearance of 24" minimum above the finish floor or ground shall be permitted at lavatories and sinks used primarily by children 6 through 12 years where the rim or counter surface is 31" maximum above the finish floor or ground. 5. A parallel approach complying with 305 shall be permitted to lavatories and sinks used primarily by children 5 years and younger. 6. The dip of the overflow shall not be considered in determining knee and toe clearances. 7. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.] Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance and shall comply. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Floor or ground surfaces of a clear floor or ground space shall comply. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] The clear floor or ground space shall be 30" minimum by 48" minimum. Unless otherwise specified, clear floor or ground space shall be permitted to include compliant clear space. Unless otherwise specified, clear floor or ground space shall be positioned for either forward or parallel approach to an element. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. Alcoves shall be 36" wide minimum where the depth exceeds 24". Alcoves shall be 60" wide minimum where the depth exceeds 15".


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418255



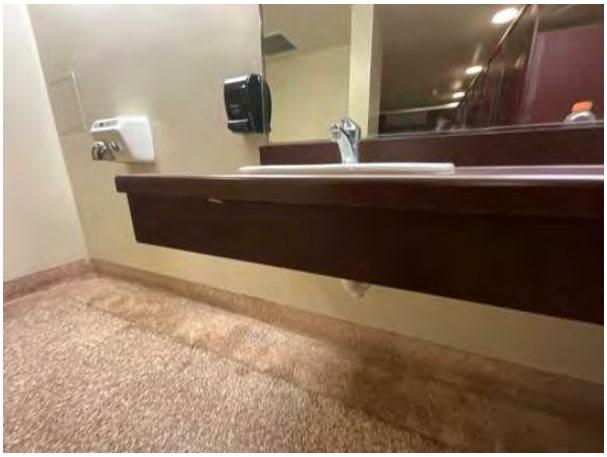

Barrier ID: AX419870

Pasadena High School BUILDING C

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.4

Barrier Detail

The automatic faucet, when activated, does not remain on for minimum 10 seconds.

Location Description	Building C - Restroom Men's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The metered faucet stays on for 8.78 seconds.

Resolution


Replace faucets with compliant handles. Hand-operated metering faucets shall remain open for 10 seconds minimum. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419870

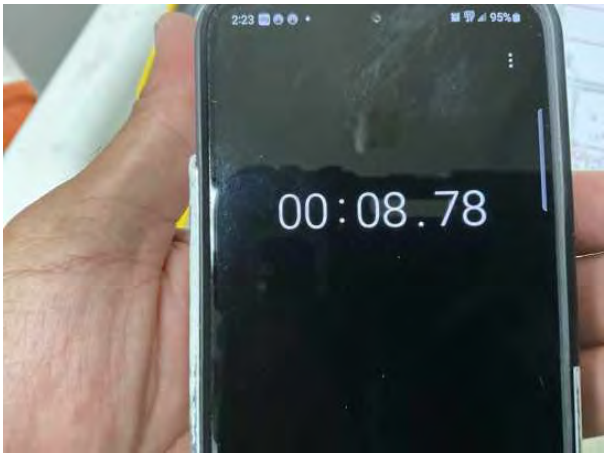





Barrier ID: AX420242

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.4

Barrier Detail

The automatic faucet, when activated, does not remain on for minimum 10 seconds.

Location Description	Building E - 1st Floor Restroom Girl's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The metered faucet stays on for 7.25 seconds.

Resolution

Replace faucets with compliant handles. Hand-operated metering faucets shall remain open for 10 seconds minimum. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX420242





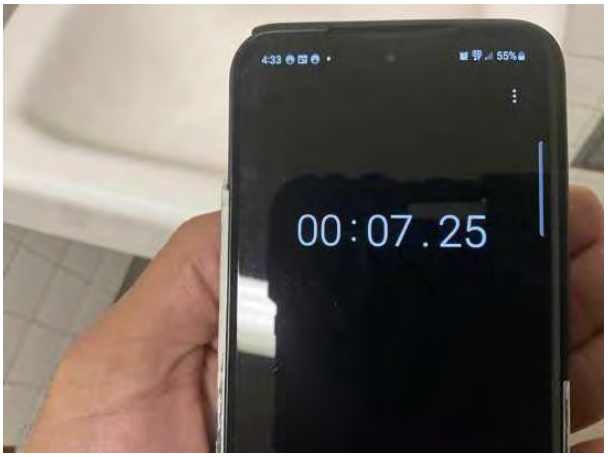

Barrier ID: AX420243

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	213.3.4, 606.5
Barrier Detail	Pipes are not insulated.
Location Description	Building E - 1st Floor Restroom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The pipe is not properly insulated or sleeved.

Resolution

Insulate water supply and drain pipes under the accessible lavatory. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. Pipes under lavatories and sinks shall be free from sharp or abrasive surfaces. A minimum of one lavatory in a multi-lavatory restroom shall be a compliant lavatory.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420243



Barrier ID: AX419747

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	213.3.4, 606.5
Barrier Detail	Pipes are not insulated.
Location Description	Building H East End - 1st Floor Restroom Men's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The pipes are not insulated or sleeved.

Resolution


Insulate water supply and drain pipes under the accessible lavatory. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. Pipes under lavatories and sinks shall be free from sharp or abrasive surfaces. A minimum of one lavatory in a multi-lavatory restroom shall be a compliant lavatory.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419747

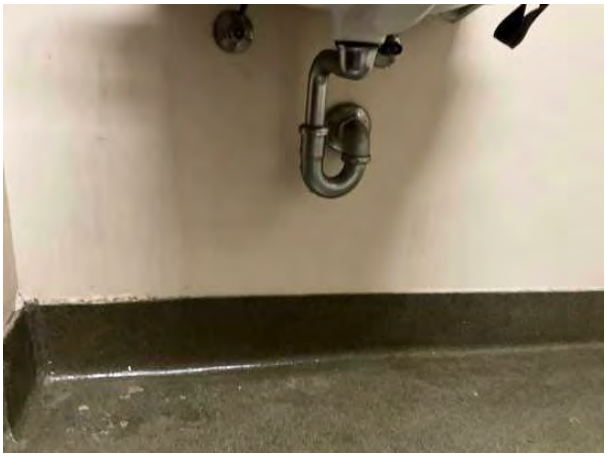

Barrier ID: AX419754

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	213.3.4, 606.5
Barrier Detail	Pipes are not insulated.
Location Description	Building H East End - 1st Floor Restroom Women's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The lavatory pipes are not sleeved or insulated.

Resolution

Insulate water supply and drain pipes under the accessible lavatory. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. Pipes under lavatories and sinks shall be free from sharp or abrasive surfaces. A minimum of one lavatory in a multi-lavatory restroom shall be a compliant lavatory.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419754



Barrier ID: AX418674

Pasadena High School BUILDING N

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.4

Barrier Detail

The automatic faucet, when activated, does not remain on for minimum 10 seconds.

Location Description	Building N - Restroom Women's Multi-User
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The metered water faucet stays on for 4.39 seconds.

Resolution


Replace faucets with compliant handles. Hand-operated metering faucets shall remain open for 10 seconds minimum. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX418674

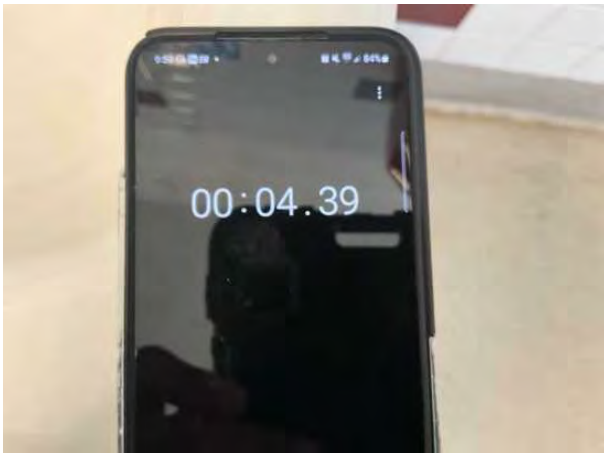



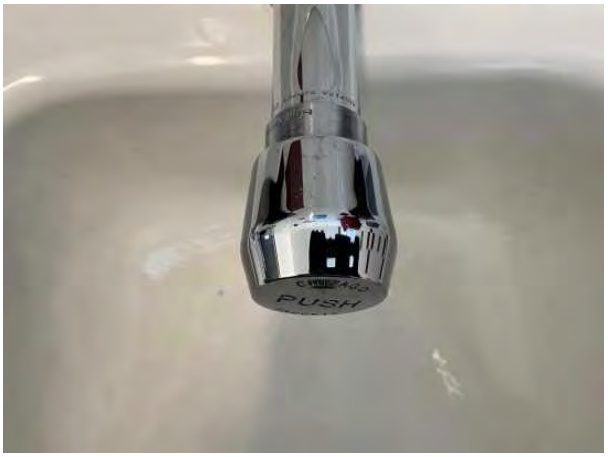

Barrier ID: AX418659

Pasadena High School BUILDING P

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.4

Barrier Detail

The automatic faucet, when activated, does not remain on for minimum 10 seconds.

Location Description	Building P - Restroom Men's Multi-User
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet seat height is 16 and 58 inches above above the floor.

Resolution

Replace faucets with compliant handles. Hand-operated metering faucets shall remain open for 10 seconds minimum. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX418659





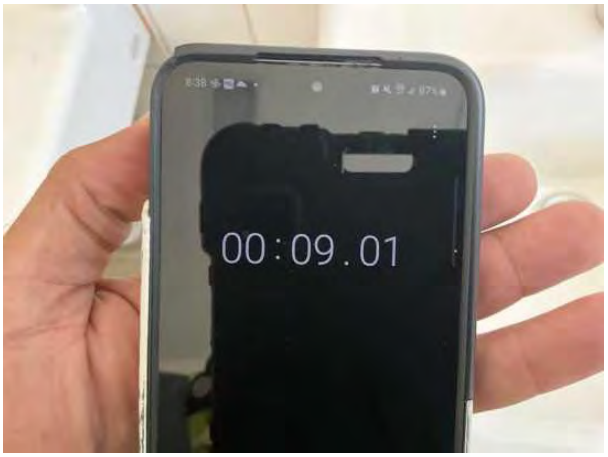

Barrier ID: AX419811

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	CBC Chap 11B-213, 306, 606

Barrier Detail

CALIFORNIA: The lavatory does not have the required knee and toe clearance.

Location Description	Building S - Restroom Men's S105
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The lavatory rim is 34 1/4 inches above the floor.

Resolution


Provide at least 10% but no fewer than one lavatory with compliant knee and toe clearance. The lavatory shall maintain the maximum allowable height of 34" to the rim of the sink. The maximum allowable exterior bowl depth is 6-1/2". A compliant clear floor space of minimum 30" wide centered on the lavatory and minimum 48" deep, positioned for a forward approach, shall be provided. Space under an element between 9" and 29" above the finish floor or ground shall be considered knee clearance and shall comply. Knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor. The bottom of the front of the lavatory shall be minimum 29" above the finish floor. Knee clearance reduction is not allowed. Toe clearance shall be minimum 25" horizontal depth between the finish floor and 9" AFF. Knee and toe clearance shall be 30" wide minimum and centered on the lavatory. A compliant clear floor space, positioned for a forward approach, and compliant knee and toe clearance shall be provided. [EXCEPTIONS: 1. Toe clearance shall extend 19" maximum under lavatories 2. A lavatory in a toilet room or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to provide knee and toe clearance. 3. In residential dwelling units, cabinetry shall be permitted under lavatories and kitchen sinks provided that all of the following conditions are met: (a) the cabinetry can be removed without removal or replacement of the fixture; (b) the finish floor extends under the cabinetry; and (c) the walls behind and surrounding the cabinetry are finished. 4. A knee clearance of 24" minimum above the finish floor or ground shall be permitted at lavatories and sinks used primarily by children 6 through 12 years where the rim or counter surface is 31" maximum above the finish floor or ground. 5. A parallel approach complying with 305 shall be permitted to lavatories and sinks used primarily by children 5 years and younger.6. The dip of the overflow shall not be considered in determining knee and toe clearances. 7. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419811

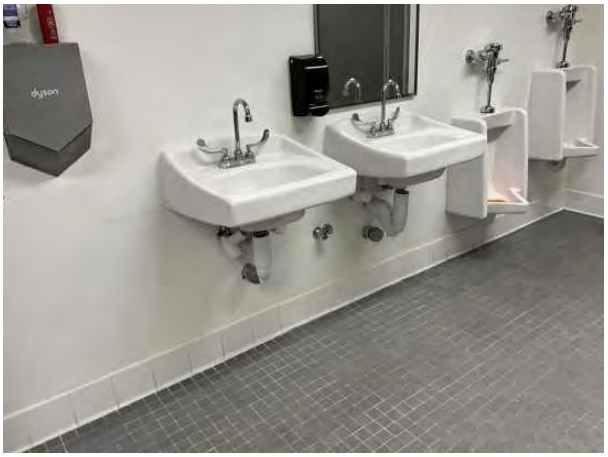



Barrier ID: AX419904

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.2 and 606.3
Barrier Detail	The lavatory is mounted higher than 34" to the higher of the rim or counter.
Location Description	Building S - S130 Faculty Locker Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The lavatory rim is 34 1/4 inches above the floor.

Resolution


Install the lavatory at a compliant height, and provide knee and toe clearance. Minimum one lavatory in a restroom shall comply. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. [EXCEPTIONS: 1. A lavatory in a toilet or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling unit kitchens, sinks that are adjustable to variable heights, 29" minimum and 36" maximum, shall be permitted where rough-in plumbing permits connections of supply and drain pipes for sinks mounted at the height of 29".] Compliant knee and toe clearance shall be provided. [EXCEPTIONS: 2. A lavatory in a toilet room or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to provide knee and toe clearance. 3. In residential dwelling units, cabinetry shall be permitted under lavatories and kitchen sinks provided that all of the following conditions are met: (a) the cabinetry can be removed without removal or replacement of the fixture; (b) the finish floor extends under the cabinetry; and (c) the walls behind and surrounding the cabinetry are finished. 4. A knee clearance of 24" minimum above the finish floor or ground shall be permitted at lavatories and sinks used primarily by children 6 through 12 years where the rim or counter surface is 31" maximum above the finish floor or ground. 5. A parallel approach complying with 305 shall be permitted to lavatories and sinks used primarily by children 5 years and younger. 6. The dip of the overflow shall not be considered in determining knee and toe clearances. 7. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.] Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance and shall comply. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Floor or ground surfaces of a clear floor or ground space shall comply. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] The clear floor or ground space shall be 30" minimum by 48" minimum. Unless otherwise specified, clear floor or ground space shall be permitted to include compliant clear space. Unless otherwise specified, clear floor or ground space shall be positioned for either forward or parallel approach to an element. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. Alcoves shall be 36" wide minimum where the depth exceeds 24". Alcoves shall be 60" wide minimum where the depth exceeds 15".

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419904

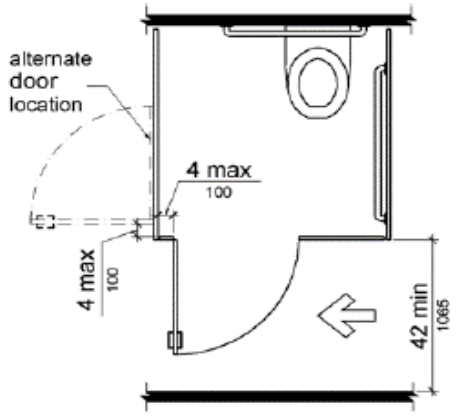





Barrier ID: AX424553

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.2 and 606.3
Barrier Detail	The lavatory is mounted higher than 34" to the higher of the rim or counter.
Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The lavatory is 34 3/4 inches above the floor.

Resolution

Install the lavatory at a compliant height, and provide knee and toe clearance. This barrier must be removed in conjunction with barrier ID 424556. The cost of this barrier removal is covered under ID 424556 and therefore, the cost of this ID is shown as $0. Minimum one lavatory in a restroom shall comply. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. [EXCEPTIONS: 1. A lavatory in a toilet or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling unit kitchens, sinks that are adjustable to variable heights, 29" minimum and 36" maximum, shall be permitted where rough-in plumbing permits connections of supply and drain pipes for sinks mounted at the height of 29".] Compliant knee and toe clearance shall be provided. [EXCEPTIONS: 2. A lavatory in a toilet room or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to provide knee and toe clearance. 3. In residential dwelling units, cabinetry shall be permitted under lavatories and kitchen sinks provided that all of the following conditions are met: (a) the cabinetry can be removed without removal or replacement of the fixture; (b) the finish floor extends under the cabinetry; and (c) the walls behind and surrounding the cabinetry are finished. 4. A knee clearance of 24" minimum above the finish floor or ground shall be permitted at lavatories and sinks used primarily by children 6 through 12 years where the rim or counter surface is 31" maximum above the finish floor or ground. 5. A parallel approach complying with 305 shall be permitted to lavatories and sinks used primarily by children 5 years and younger. 6. The dip of the overflow shall not be considered in determining knee and toe clearances. 7. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.] Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance and shall comply. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Floor or ground surfaces of a clear floor or ground space shall comply. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] The clear floor or ground space shall be 30" minimum by 48" minimum. Unless otherwise specified, clear floor or ground space shall be permitted to include compliant clear space. Unless otherwise specified, clear floor or ground space shall be positioned for either forward or parallel approach to an element. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. Alcoves shall be 36" wide minimum where the depth exceeds 24". Alcoves shall be 60" wide minimum where the depth exceeds 15".

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424553





Barrier ID: AX424554

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	213.3.4, 606.5
Barrier Detail	Pipes are not insulated.
Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The lavatory pipes are not insulated.

Resolution

Insulate water supply and drain pipes under the accessible lavatory. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. Pipes under lavatories and sinks shall be free from sharp or abrasive surfaces. A minimum of one lavatory in a multi-lavatory restroom shall be a compliant lavatory.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424554



Barrier ID: AX424555

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	CBC Chap 11B-606.6; 305

Barrier Detail

CALIFORNIA: The centerline of the lavatory is less than 18" from the side wall or partition wall.

Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The lavatory is centered 10 inches from the sidewall.

Resolution

Relocate the lavatory to provide minimum 18" from the side partition/wall to centerline of lavatory. This barrier must be removed in conjunction with barrier ID 424556. The cost of this barrier removal is covered under ID 424556 and therefore, the cost of this ID is shown as $0. The height of the lavatory to the higher of the rim or counter surface shall be 34" maximum AFF. Provide minimum 30" by minimum 48" clear floor space positioned for a parallel or front approach to the lavatory. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. Alcoves shall be 36" wide minimum where the depth exceeds 24". Alcoves shall be 60" wide minimum where the depth exceeds 15". Floor or ground surfaces of a clear floor or ground space shall comply with 302. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424555



Barrier ID: AX420179

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.2 and 606.3
Barrier Detail	The lavatory is mounted higher than 34" to the higher of the rim or counter.
Location Description	Portable Trailer Restoom Boy's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The lowest lavatory is 34 3/8 inches above the floor to the rim.

Resolution


Install the lavatory at a compliant height, and provide knee and toe clearance. Minimum one lavatory in a restroom shall comply. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. [EXCEPTIONS: 1. A lavatory in a toilet or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling unit kitchens, sinks that are adjustable to variable heights, 29" minimum and 36" maximum, shall be permitted where rough-in plumbing permits connections of supply and drain pipes for sinks mounted at the height of 29".] Compliant knee and toe clearance shall be provided. [EXCEPTIONS: 2. A lavatory in a toilet room or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to provide knee and toe clearance. 3. In residential dwelling units, cabinetry shall be permitted under lavatories and kitchen sinks provided that all of the following conditions are met: (a) the cabinetry can be removed without removal or replacement of the fixture; (b) the finish floor extends under the cabinetry; and (c) the walls behind and surrounding the cabinetry are finished. 4. A knee clearance of 24" minimum above the finish floor or ground shall be permitted at lavatories and sinks used primarily by children 6 through 12 years where the rim or counter surface is 31" maximum above the finish floor or ground. 5. A parallel approach complying with 305 shall be permitted to lavatories and sinks used primarily by children 5 years and younger. 6. The dip of the overflow shall not be considered in determining knee and toe clearances. 7. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.] Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance and shall comply. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Floor or ground surfaces of a clear floor or ground space shall comply. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] The clear floor or ground space shall be 30" minimum by 48" minimum. Unless otherwise specified, clear floor or ground space shall be permitted to include compliant clear space. Unless otherwise specified, clear floor or ground space shall be positioned for either forward or parallel approach to an element. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. Alcoves shall be 36" wide minimum where the depth exceeds 24". Alcoves shall be 60" wide minimum where the depth exceeds 15".

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420179

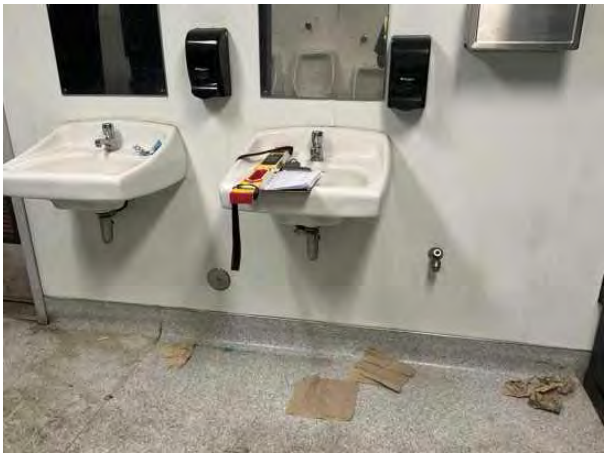



Barrier ID: AX420193

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.2 and 606.3
Barrier Detail	The lavatory is mounted higher than 34" to the higher of the rim or counter.
Location Description	Portable Trailer Restoom Boy's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The lavatory rim is 34 and three-quarter inches above the floor.

Resolution


Install the lavatory at a compliant height, and provide knee and toe clearance. Minimum one lavatory in a restroom shall comply. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. [EXCEPTIONS: 1. A lavatory in a toilet or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling unit kitchens, sinks that are adjustable to variable heights, 29" minimum and 36" maximum, shall be permitted where rough-in plumbing permits connections of supply and drain pipes for sinks mounted at the height of 29".] Compliant knee and toe clearance shall be provided. [EXCEPTIONS: 2. A lavatory in a toilet room or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to provide knee and toe clearance. 3. In residential dwelling units, cabinetry shall be permitted under lavatories and kitchen sinks provided that all of the following conditions are met: (a) the cabinetry can be removed without removal or replacement of the fixture; (b) the finish floor extends under the cabinetry; and (c) the walls behind and surrounding the cabinetry are finished. 4. A knee clearance of 24" minimum above the finish floor or ground shall be permitted at lavatories and sinks used primarily by children 6 through 12 years where the rim or counter surface is 31" maximum above the finish floor or ground. 5. A parallel approach complying with 305 shall be permitted to lavatories and sinks used primarily by children 5 years and younger. 6. The dip of the overflow shall not be considered in determining knee and toe clearances. 7. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.] Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance and shall comply. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Floor or ground surfaces of a clear floor or ground space shall comply. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] The clear floor or ground space shall be 30" minimum by 48" minimum. Unless otherwise specified, clear floor or ground space shall be permitted to include compliant clear space. Unless otherwise specified, clear floor or ground space shall be positioned for either forward or parallel approach to an element. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. Alcoves shall be 36" wide minimum where the depth exceeds 24". Alcoves shall be 60" wide minimum where the depth exceeds 15".

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420193

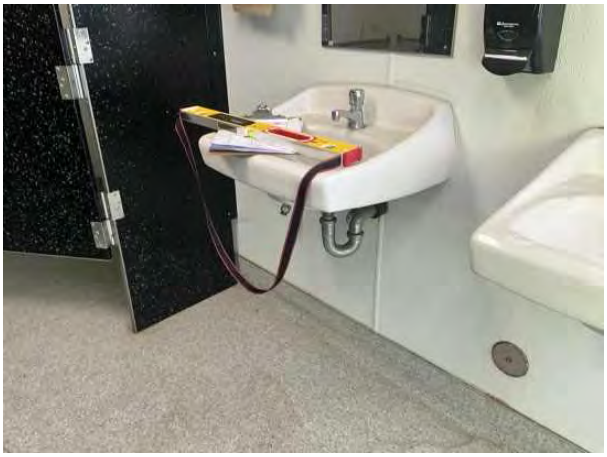



Barrier ID: AX420194

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.4

Barrier Detail

The automatic faucet, when activated, does not remain on for minimum 10 seconds.

Location Description	Portable Trailer Restoom Boy's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The metered faucet stays on for 9.01 seconds.

Resolution

Replace faucets with compliant handles. Hand-operated metering faucets shall remain open for 10 seconds minimum. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420194



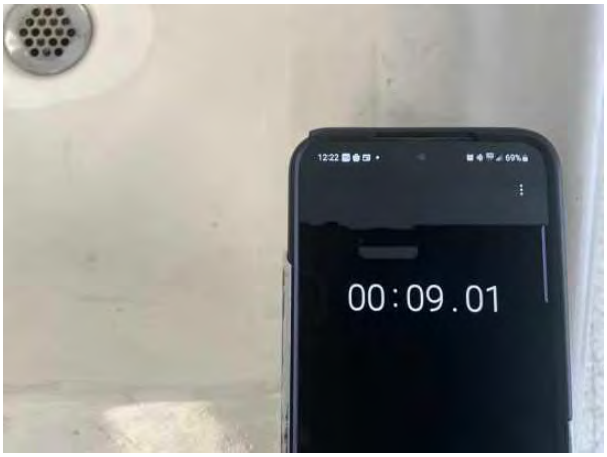

Barrier ID: AX420164

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	CBC Chap 11B-606.6; 305

Barrier Detail

CALIFORNIA: The centerline of the lavatory is less than 18" from the side wall or partition wall.

Location Description	Portable Trailer Restroom Staff
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The lavatory is centered 14 1/2 inches from the side wall.

Resolution


Relocate the lavatory to provide minimum 18" from the side partition/wall to centerline of lavatory. The height of the lavatory to the higher of the rim or counter surface shall be 34" maximum AFF. Provide minimum 30" by minimum 48" clear floor space positioned for a parallel or front approach to the lavatory. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. Alcoves shall be 36" wide minimum where the depth exceeds 24". Alcoves shall be 60" wide minimum where the depth exceeds 15". Floor or ground surfaces of a clear floor or ground space shall comply with 302. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420164

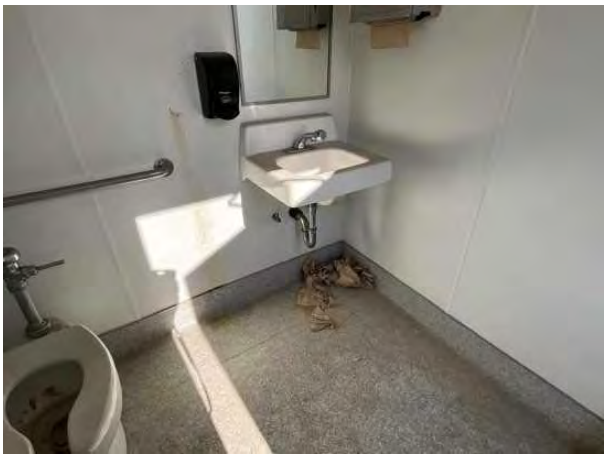



Barrier ID: AX420166

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606; 306
Barrier Detail	The lavatory does not have the required knee clearance.
Location Description	Portable Trailer Restoom Staff
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The 27 inch high knee clearance extends 5 1/2 inches past the apron.

Resolution


Relocate the lavatory to provide compliant knee clearance. A compliant clear floor space, positioned for a forward approach, and compliant knee and toe clearance shall be provided. [EXCEPTIONS: 2. A lavatory in a toilet room or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to provide knee and toe clearance. 3. In residential dwelling units, cabinetry shall be permitted under lavatories and kitchen sinks provided that all of the following conditions are met: (a) the cabinetry can be removed without removal or replacement of the fixture; (b) the finish floor extends under the cabinetry; and (c) the walls behind and surrounding the cabinetry are finished. 4. A knee clearance of 24" minimum above the finish floor or ground shall be permitted at lavatories and sinks used primarily by children 6 through 12 years where the rim or counter surface is 31" maximum above the finish floor or ground. 5. A parallel approach shall be permitted to lavatories and sinks used primarily by children 5 years and younger.6. The dip of the overflow shall not be considered in determining knee and toe clearances. 7. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance. Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance and shall comply. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee and toe clearance shall be 30" wide minimum.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420166

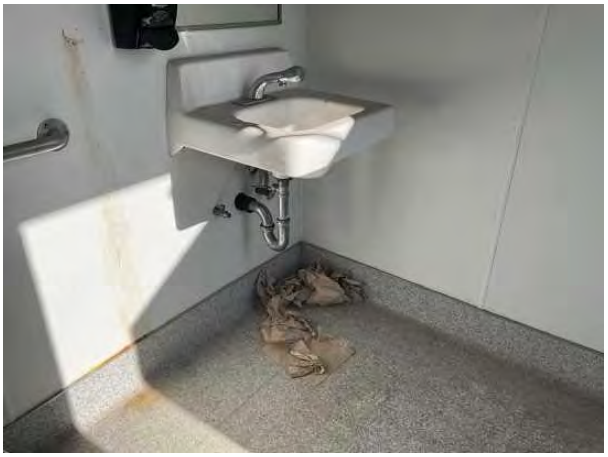





Barrier ID: AX420170

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	606.4

Barrier Detail

The automatic faucet, when activated, does not remain on for minimum 10 seconds.

Location Description	Portable Trailer Restoom Staff
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The metered faucet only provides 5.13 seconds of water flow

Resolution

Replace faucets with compliant handles. Hand-operated metering faucets shall remain open for 10 seconds minimum. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420170



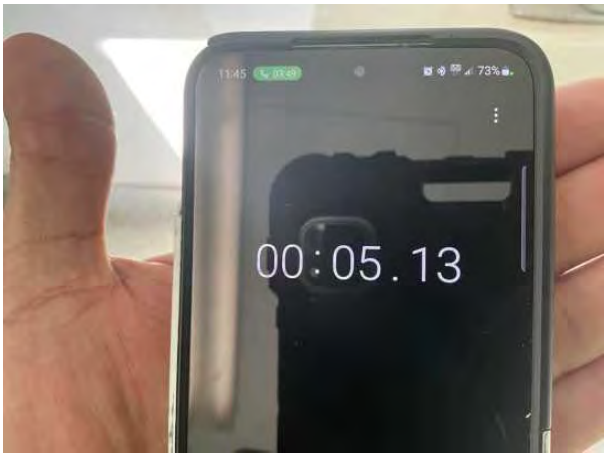

Barrier ID: AX424498

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Mirror
ADA Standard	213.3.5; 603.3

Barrier Detail

The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.

Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The mirror is 48 inches above the floor.

Resolution

Remove and lower the mirror to a compliant height. Where mirrors are provided, at least one shall comply. Mirrors located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 40" maximum above the finish floor or ground. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35" maximum above the finish floor or ground. [ADVISORY: A single full-length mirror can accommodate a greater number of people, including children. In order for mirrors to be usable by people who are ambulatory and people who use wheelchairs, the top edge of mirrors should be 74" minimum from the floor or ground.]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424498



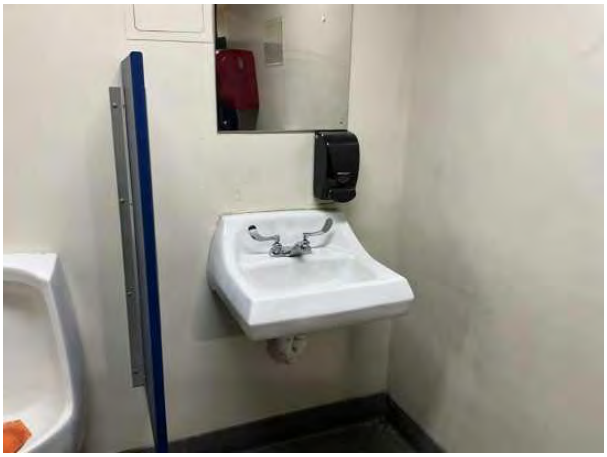

Barrier ID: AX424552

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom - Mirror
ADA Standard	213.3.5; 603.3

Barrier Detail

The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.

Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The mirror is 56 inches above the floor.

Resolution

Remove and lower the mirror to a compliant height. Where mirrors are provided, at least one shall comply. Mirrors located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 40" maximum above the finish floor or ground. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35" maximum above the finish floor or ground. [ADVISORY: A single full-length mirror can accommodate a greater number of people, including children. In order for mirrors to be usable by people who are ambulatory and people who use wheelchairs, the top edge of mirrors should be 74" minimum from the floor or ground.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424552





Barrier ID: AX420181

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Mirror
ADA Standard	213.3.5; 603.3

Barrier Detail

The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.

Location Description	Portable Trailer Restoom Boy's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The mirror bottom edge is 42 1/2 inches above the floor.

Resolution

Remove and lower the mirror to a compliant height. Where mirrors are provided, at least one shall comply. Mirrors located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 40" maximum above the finish floor or ground. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35" maximum above the finish floor or ground. [ADVISORY: A single full-length mirror can accommodate a greater number of people, including children. In order for mirrors to be usable by people who are ambulatory and people who use wheelchairs, the top edge of mirrors should be 74" minimum from the floor or ground.]


Quantity

2 EA

Priority	3

Photos for Barrier ID: AX420181



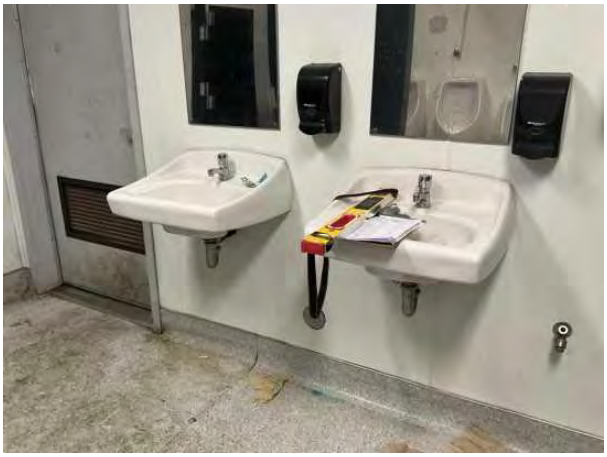

Barrier ID: AX420192

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Mirror
ADA Standard	213.3.5; 603.3

Barrier Detail

The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.

Location Description	Portable Trailer Restoom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The mirror bottom edge is 42 1/2 inches above the floor.

Resolution

Remove and lower the mirror to a compliant height. Where mirrors are provided, at least one shall comply. Mirrors located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 40" maximum above the finish floor or ground. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35" maximum above the finish floor or ground. [ADVISORY: A single full-length mirror can accommodate a greater number of people, including children. In order for mirrors to be usable by people who are ambulatory and people who use wheelchairs, the top edge of mirrors should be 74" minimum from the floor or ground.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420192





Barrier ID: AX420168

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Mirror
ADA Standard	213.3.5; 603.3

Barrier Detail

The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.

Location Description	Portable Trailer Restoom Staff
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The mirror bottom edge is 41 1/2 inches above the floor.

Resolution

Remove and lower the mirror to a compliant height. Where mirrors are provided, at least one shall comply. Mirrors located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 40" maximum above the finish floor or ground. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35" maximum above the finish floor or ground. [ADVISORY: A single full-length mirror can accommodate a greater number of people, including children. In order for mirrors to be usable by people who are ambulatory and people who use wheelchairs, the top edge of mirrors should be 74" minimum from the floor or ground.]


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420168



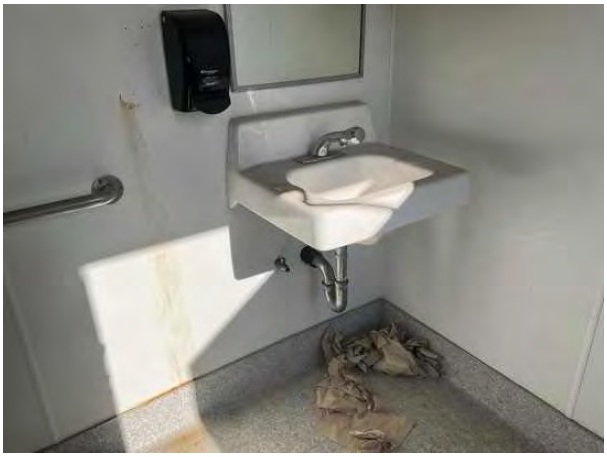

Barrier ID: AX419902

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Roll - In Shower Stall
ADA Standard	CBC Chap 11B- 608.2
Barrier Detail	CALIFORNIA: The roll-in shower stall is not compliant.
Location Description	Building S - S130 Faculty Locker Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The roll-in shower is 53 1/4 inches long.

Resolution


Provide a compliant roll-in shower stall and clear space. Standard roll-in type shower compartments: Standard roll-in type shower compartments shall be 30" wide minimum by 60" deep minimum clear inside dimensions measured at center points of opposing sides with a full opening width on the long side. Clearance for a standard roll-in shower 36" wide minimum by 60" long minimum clearance shall be provided adjacent to the open face of the shower compartment. Alternate roll-in type shower compartments; Alternate roll-in type shower compartments shall be 36" wide and 60" deep minimum clear inside dimensions measured at center points of opposing sides, with a 36" wide minimum entry shall be provided at one end of the long side of the compartment.

Quantity


1 EA


Priority	3

Photos for Barrier ID: AX419902

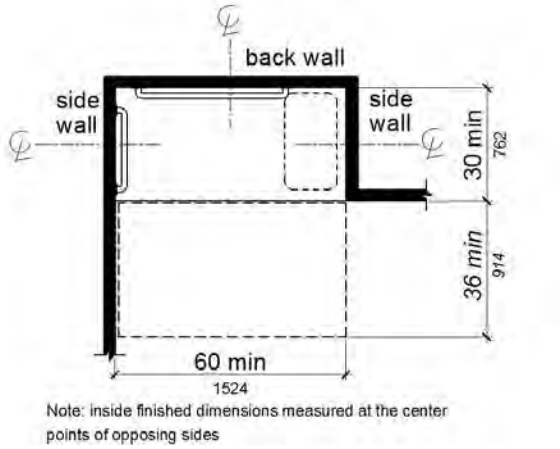



Note: inside finished dimensions measured at the center points of opposing sides

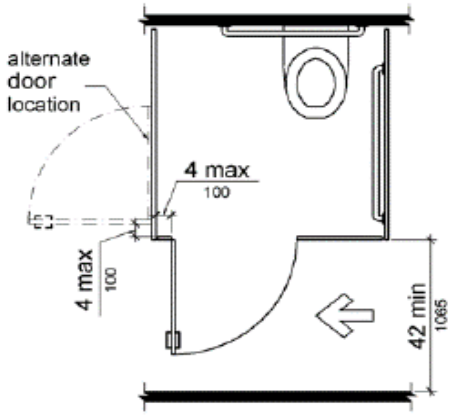

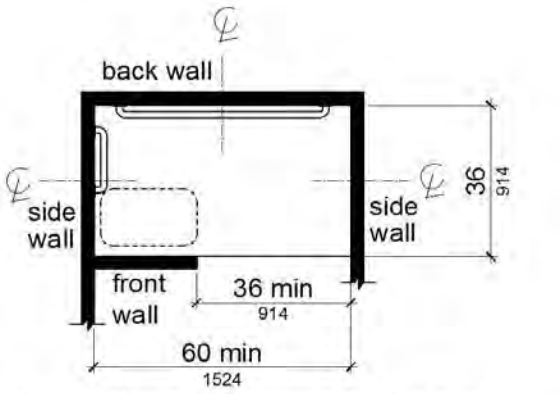

Note: inside finished dimensions measured at the center points of opposing sides

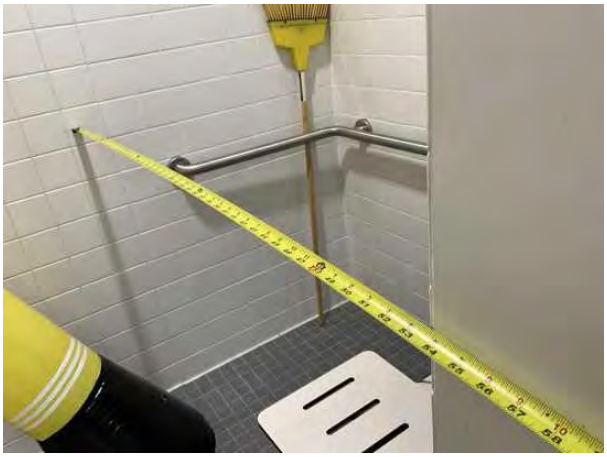

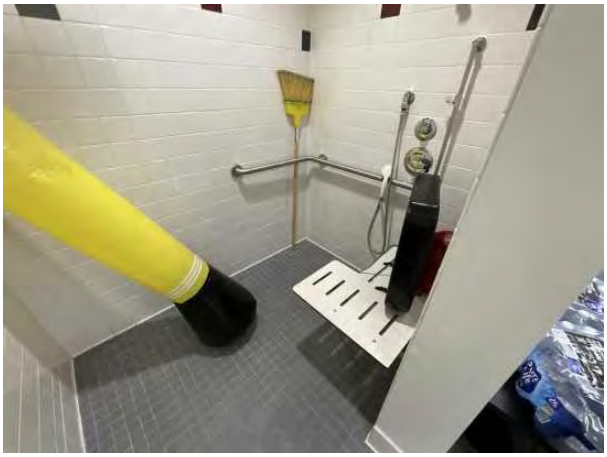



Barrier ID: AX424451

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The unisex restroom does not have compliant signage at the door.

Location Description	Building A - A101A Restroom Unisex
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The restroom door sign is not compliant for an all gender. Use restroom..

Resolution

Install compliant signage at the restroom entrances. Unisex toilet and bathing facilities shall be identified by a circle, ¼" thick and 12" in diameter with a ¼" thick triangle with a vertex pointing upward superimposed on the circle and within the 12" diameter. The triangle symbol shall contrast with the circle symbol, either light on a dark background or dark on a light background. The circle symbol shall contrast with the door, either light on a dark background or dark on a light background. Each doorway leading to restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's, women's or unisex shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: SIgns with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424451



Barrier ID: AX424452

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	216.2, 703.1, 703.2, 703.5, 703.6

Barrier Detail

The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.

Location Description	Building A - A101A Restroom Unisex
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The restroom does not provide a tactile room identification sign

Resolution

Mount compliant signage on the wall at the latch side of the restroom door at a compliant height. All signs for accessible restrooms, including directional signs indicating the restroom location, shall comply with the requirement for the International Symbol of Accessibility (ISA), where not all restrooms are accessible. The pictogram field shall be minimum 6" high. Signage shall include raised letters and Braille, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Accessible restrooms shall have signs with the International Symbol of Accessibility. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424452



Barrier ID: AX424440

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The unisex restroom does not have compliant signage at the door.

Location Description	Building A - A101B Restroom Unisex
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The restroom door sign is not compliant for an all gender use restroom.

Resolution


Install compliant signage at the restroom entrances. Unisex toilet and bathing facilities shall be identified by a circle, ¼" thick and 12" in diameter with a ¼" thick triangle with a vertex pointing upward superimposed on the circle and within the 12" diameter. The triangle symbol shall contrast with the circle symbol, either light on a dark background or dark on a light background. The circle symbol shall contrast with the door, either light on a dark background or dark on a light background. Each doorway leading to restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's, women's or unisex shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: SIgns with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424440

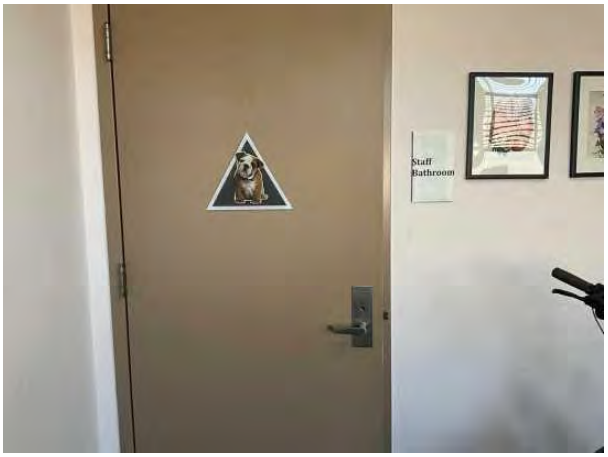

Barrier ID: AX424441

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	216.2, 703.1, 703.2, 703.5, 703.6

Barrier Detail

The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.

Location Description	Building A - A101B Restroom Unisex
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The restroom does not provide an all gender tactile room, identification sign.

Resolution


Mount compliant signage on the wall at the latch side of the restroom door at a compliant height. All signs for accessible restrooms, including directional signs indicating the restroom location, shall comply with the requirement for the International Symbol of Accessibility (ISA), where not all restrooms are accessible. The pictogram field shall be minimum 6" high. Signage shall include raised letters and Braille, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Accessible restrooms shall have signs with the International Symbol of Accessibility. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424441

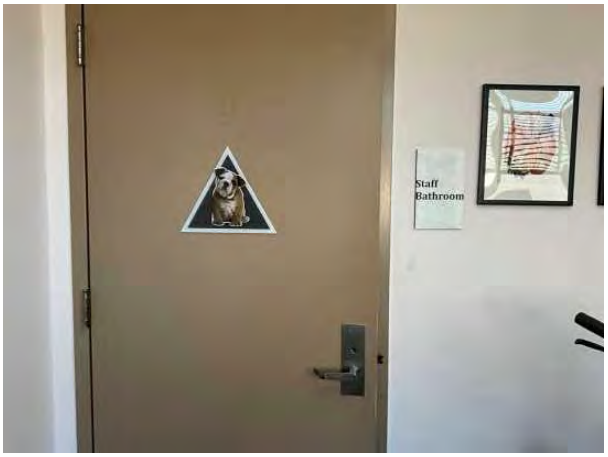

Barrier ID: AX424465

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The unisex restroom does not have compliant signage at the door.

Location Description	Building A - A110 Restroom
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The restroom does not provide the correct unisex, tactile room, identification sign. The triangle does not contrast with the circle.

Resolution

Install compliant signage at the restroom entrances. Unisex toilet and bathing facilities shall be identified by a circle, ¼" thick and 12" in diameter with a ¼" thick triangle with a vertex pointing upward superimposed on the circle and within the 12" diameter. The triangle symbol shall contrast with the circle symbol, either light on a dark background or dark on a light background. The circle symbol shall contrast with the door, either light on a dark background or dark on a light background. Each doorway leading to restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's, women's or unisex shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: SIgns with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424465



Barrier ID: AX418242

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The men's restroom does not have compliant signage at the door.

Location Description	Building B - Restroom Men's B 107
Observed	Dec 10, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The men's restroom does not provide the required geometric door sign for men.

Resolution


Install compliant signage. The men's restroom/bathing room geometric symbol shall be an equilateral triangle 1/4" thick, with edges 12" long and a vertex pointing upward. The triangle shall contrast with the door or doorway, either light on dark or dark on light. Each doorway leading to men's restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: Signs with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418242

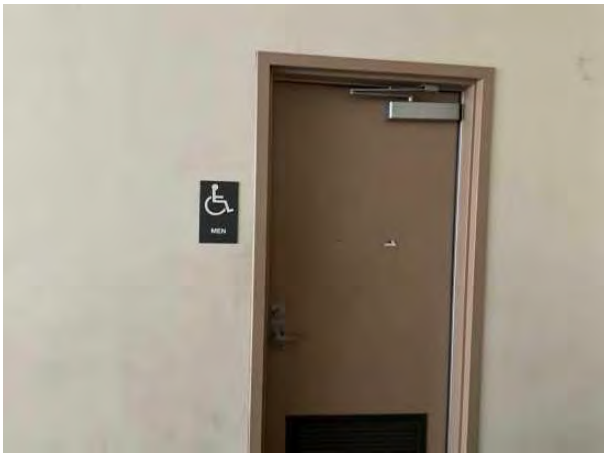

Barrier ID: AX420245

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	216.2, 703.1, 703.2, 703.5, 703.6

Barrier Detail

The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.

Location Description	Building E - 1st Floor Restroom Boy's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The restroom does not provide a tactile room identification sign.

Resolution

Mount compliant signage on the wall at the latch side of the restroom door at a compliant height. All signs for accessible restrooms, including directional signs indicating the restroom location, shall comply with the requirement for the International Symbol of Accessibility (ISA), where not all restrooms are accessible. The pictogram field shall be minimum 6" high. Signage shall include raised letters and Braille, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Accessible restrooms shall have signs with the International Symbol of Accessibility. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420245



Barrier ID: AX420235

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	216.2, 703.1, 703.2, 703.5, 703.6

Barrier Detail

The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.

Location Description	Building E - 1st Floor Restroom Girl's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The restroom does not provide a tactile room identification sign.

Resolution


Mount compliant signage on the wall at the latch side of the restroom door at a compliant height. All signs for accessible restrooms, including directional signs indicating the restroom location, shall comply with the requirement for the International Symbol of Accessibility (ISA), where not all restrooms are accessible. The pictogram field shall be minimum 6" high. Signage shall include raised letters and Braille, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Accessible restrooms shall have signs with the International Symbol of Accessibility. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420235

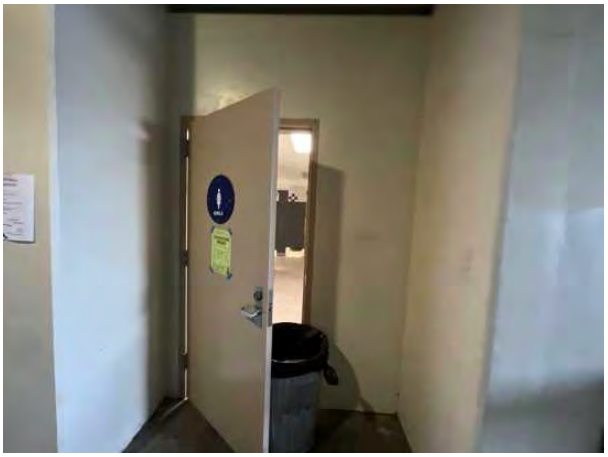

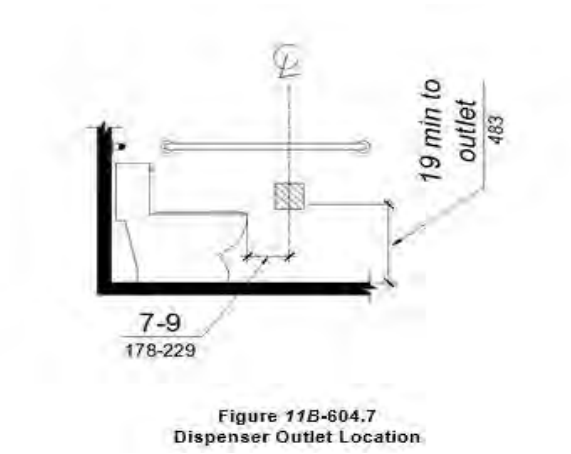


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX420236

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The women's restroom does not have compliant signage at the door.

Location Description	Building E - 1st Floor Restroom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The geometric sign is centered, 62 1/2 inches above the floor.

Resolution

Install compliant signage at the restroom entrance. Women's toilet and bathing facilities shall be identified by a circle, ¼ inch thick and 12 inches in diameter. The circle symbol shall contrast with the door, either light on a dark background or dark on a light background. Each doorway leading to restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating women's shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: SIgns with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420236





Barrier ID: AX419718

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	216.2, 703.1, 703.2, 703.5, 703.6

Barrier Detail

The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.

Location Description	Building H East End - 1st Floor Restroom Boys
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The restroom does not provide a tactile room identification side on the latch side of the door.

Resolution

Mount compliant signage on the wall at the latch side of the restroom door at a compliant height. All signs for accessible restrooms, including directional signs indicating the restroom location, shall comply with the requirement for the International Symbol of Accessibility (ISA), where not all restrooms are accessible. The pictogram field shall be minimum 6" high. Signage shall include raised letters and Braille, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Accessible restrooms shall have signs with the International Symbol of Accessibility. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419718



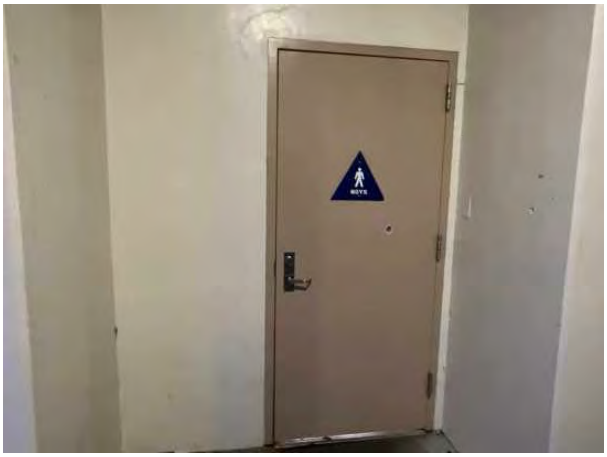

Barrier ID: AX419725

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	216.2, 703.1, 703.2, 703.5, 703.6

Barrier Detail

The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.

Location Description	Building H East End - 1st Floor Restroom Girls
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The restroom does not provide a tactile room identification side on the latch side of the door.

Resolution

Mount compliant signage on the wall at the latch side of the restroom door at a compliant height. All signs for accessible restrooms, including directional signs indicating the restroom location, shall comply with the requirement for the International Symbol of Accessibility (ISA), where not all restrooms are accessible. The pictogram field shall be minimum 6" high. Signage shall include raised letters and Braille, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Accessible restrooms shall have signs with the International Symbol of Accessibility. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419725



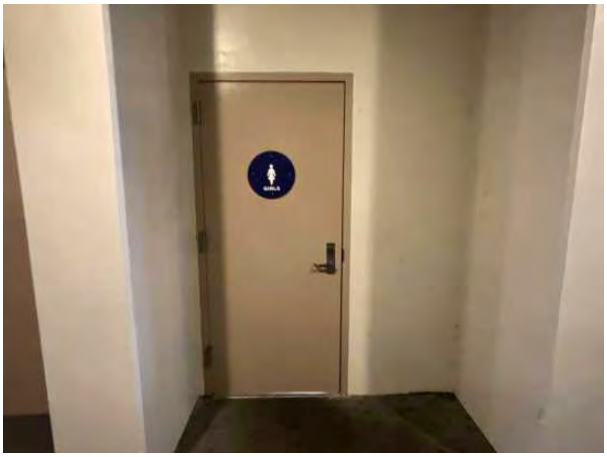

Barrier ID: AX419762

Pasadena High School BUILDING I

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The men's restroom does not have compliant signage at the door.

Location Description	Building I East End - 2nd Floor Restroom Men's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door does not provide the required geometric door sign for men.

Resolution

Install compliant signage. The men's restroom/bathing room geometric symbol shall be an equilateral triangle 1/4" thick, with edges 12" long and a vertex pointing upward. The triangle shall contrast with the door or doorway, either light on dark or dark on light. Each doorway leading to men's restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: Signs with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419762





Barrier ID: AX418653

Pasadena High School BUILDING P

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	216.2, 703.1, 703.2, 703.5, 703.6

Barrier Detail

The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.

Location Description	Building P - Restroom Men's Multi-User
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The restroom does not provide the required, tactile room, identification sign.

Resolution

Mount compliant signage on the wall at the latch side of the restroom door at a compliant height. All signs for accessible restrooms, including directional signs indicating the restroom location, shall comply with the requirement for the International Symbol of Accessibility (ISA), where not all restrooms are accessible. The pictogram field shall be minimum 6" high. Signage shall include raised letters and Braille, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Accessible restrooms shall have signs with the International Symbol of Accessibility. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418653



Barrier ID: AX424542

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The unisex restroom does not have compliant signage at the door.

Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The door does not provide the geometric door sign.

Resolution

Install compliant signage at the restroom entrances. Unisex toilet and bathing facilities shall be identified by a circle, ¼" thick and 12" in diameter with a ¼" thick triangle with a vertex pointing upward superimposed on the circle and within the 12" diameter. The triangle symbol shall contrast with the circle symbol, either light on a dark background or dark on a light background. The circle symbol shall contrast with the door, either light on a dark background or dark on a light background. Each doorway leading to restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's, women's or unisex shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: SIgns with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424542



Barrier ID: AX424543

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	216.2, 703.1, 703.2, 703.5, 703.6

Barrier Detail

The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.

Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The door does not provide the tactile room identification sign.

Resolution

Mount compliant signage on the wall at the latch side of the restroom door at a compliant height. All signs for accessible restrooms, including directional signs indicating the restroom location, shall comply with the requirement for the International Symbol of Accessibility (ISA), where not all restrooms are accessible. The pictogram field shall be minimum 6" high. Signage shall include raised letters and Braille, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Accessible restrooms shall have signs with the International Symbol of Accessibility. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424543



Barrier ID: AX420171

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The men's restroom does not have compliant signage at the door.

Location Description	Portable Trailer Restoom Boy's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The restroom door sign is 64 inches above the floor.

Resolution

Install compliant signage. The men's restroom/bathing room geometric symbol shall be an equilateral triangle 1/4" thick, with edges 12" long and a vertex pointing upward. The triangle shall contrast with the door or doorway, either light on dark or dark on light. Each doorway leading to men's restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: Signs with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420171





Barrier ID: AX420172

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	216.2, 703.1, 703.2, 703.5, 703.6

Barrier Detail

The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.

Location Description	Portable Trailer Restoom Boy's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The restroom does not provide a tactile room identification sign.

Resolution

Mount compliant signage on the wall at the latch side of the restroom door at a compliant height. All signs for accessible restrooms, including directional signs indicating the restroom location, shall comply with the requirement for the International Symbol of Accessibility (ISA), where not all restrooms are accessible. The pictogram field shall be minimum 6" high. Signage shall include raised letters and Braille, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Accessible restrooms shall have signs with the International Symbol of Accessibility. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420172



Barrier ID: AX420182

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The men's restroom does not have compliant signage at the door.

Location Description	Portable Trailer Restoom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The restroom door sign is 64 1/2 inches above the floor.

Resolution

Install compliant signage. The men's restroom/bathing room geometric symbol shall be an equilateral triangle 1/4" thick, with edges 12" long and a vertex pointing upward. The triangle shall contrast with the door or doorway, either light on dark or dark on light. Each doorway leading to men's restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: Signs with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420182



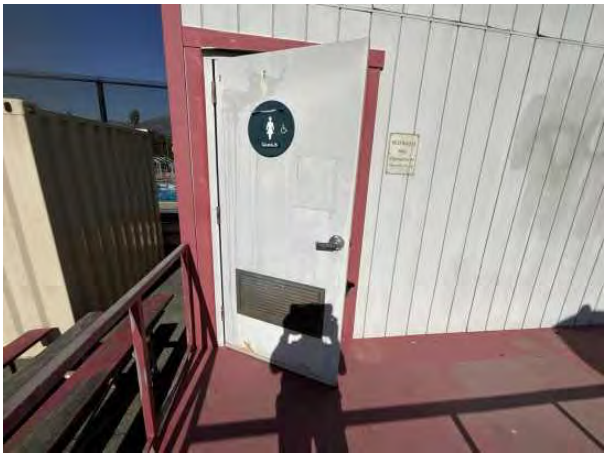

Barrier ID: AX420183

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	216.2, 703.1, 703.2, 703.5, 703.6

Barrier Detail

The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.

Location Description	Portable Trailer Restoom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The restroom does not provide a tactile room identification sign.

Resolution

Mount compliant signage on the wall at the latch side of the restroom door at a compliant height. All signs for accessible restrooms, including directional signs indicating the restroom location, shall comply with the requirement for the International Symbol of Accessibility (ISA), where not all restrooms are accessible. The pictogram field shall be minimum 6" high. Signage shall include raised letters and Braille, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Accessible restrooms shall have signs with the International Symbol of Accessibility. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420183



Barrier ID: AX420159

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The unisex restroom does not have compliant signage at the door.

Location Description	Portable Trailer Restoom Staff
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The staff restroom does not provide a tactile unisex room, identification sign.

Resolution

Install compliant signage at the restroom entrances. Unisex toilet and bathing facilities shall be identified by a circle, ¼" thick and 12" in diameter with a ¼" thick triangle with a vertex pointing upward superimposed on the circle and within the 12" diameter. The triangle symbol shall contrast with the circle symbol, either light on a dark background or dark on a light background. The circle symbol shall contrast with the door, either light on a dark background or dark on a light background. Each doorway leading to restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's, women's or unisex shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: SIgns with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420159





Barrier ID: AX424475

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.8.1.1

Barrier Detail

The wheelchair stall with a floor mounted water closet, in a multi-stall restroom, is less than 60" wide and 59" deep.

Location Description	Building A - A112 Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The stall door swings into the required 59" clear space of the water closet.

Resolution

Redesign to provide compliant wheelchair stall with a floor mounted water closet. Wheelchair accessible compartments with floor mounted water closets shall be 60" wide minimum measured perpendicular to the side wall and 59" deep minimum, measured perpendicular to the rear wall. Wheelchair accessible compartments with wall mounted water closets shall be 60" wide minimum measured perpendicular to the side wall and 56" deep minimum, measured perpendicular to the rear wall. Wheelchair accessible compartments for children's use (ages 3 through 12) shall be 60" wide minimum measured perpendicular to the side wall, and 59" deep minimum for wall hung and floor mounted water closets measured perpendicular to the rear wall.In addition, clear space of minimum 30" by 48" must be provided within the clearance area for transfer from a wheelchair. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 16 minimum to 18" maximum from the side wall or partition. Water closets shall be arranged for a left-hand or right-hand approach. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions, such as lavatories, shall be located within the required water closet clearance. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424475







Barrier ID: AX424476

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building A - A112 Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The wheelchair stall door is not self closing, and does not provide a pull handle on the pull side.

Resolution

Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424476



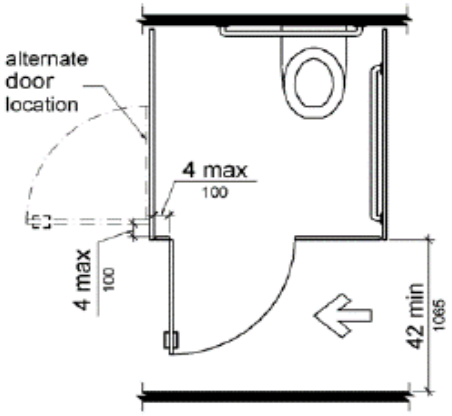



Barrier ID: AX424395

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building A - A253B Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The stall door does not open a full 90° due to the hand dryer. The stall door does not provide a pool handle on the push side and not self closing.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.

Quantity

1 EA


Priority	3

Photos for Barrier ID: AX424395

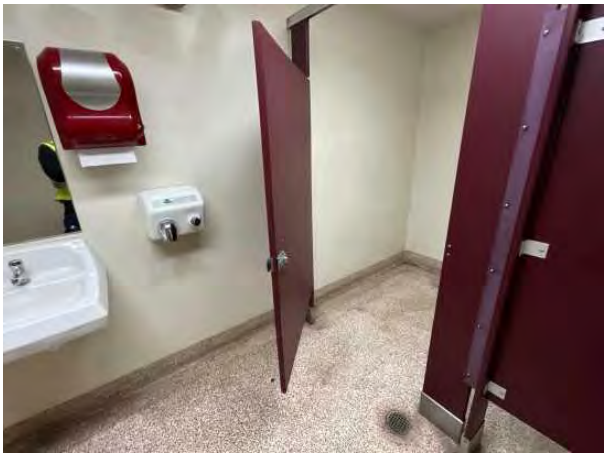





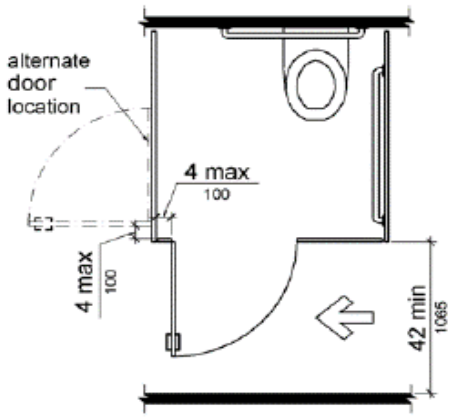



Barrier ID: AX424407

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building A - A255B Restroom Women's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door is 5 1/2 inches from the wall and does not provide a pull handle on the push side.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity


1 EA

Priority	3

Photos for Barrier ID: AX424407

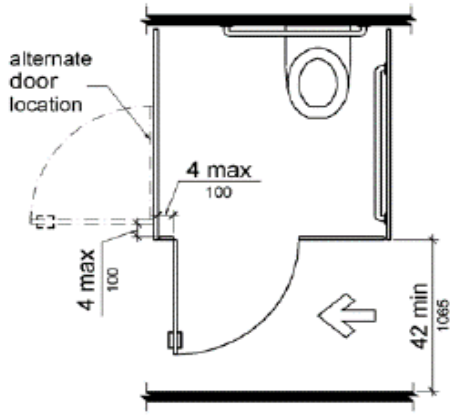

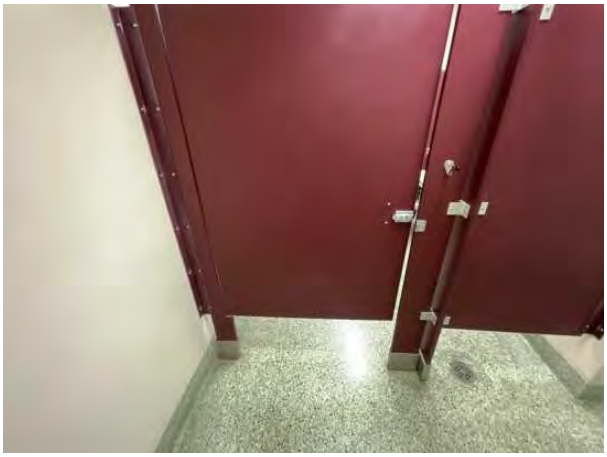

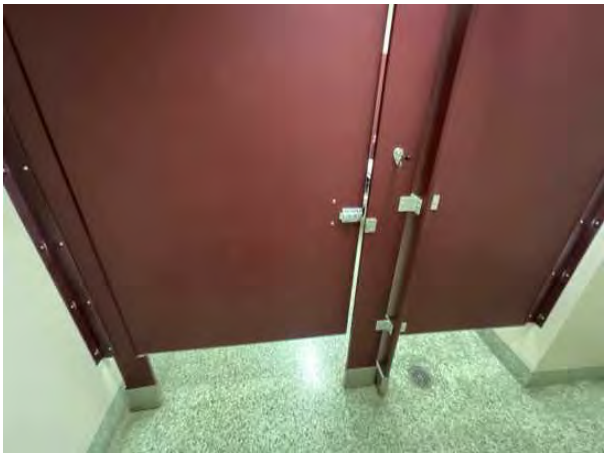



Barrier ID: AX424408

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.8.1.1

Barrier Detail

The wheelchair stall with a wall mounted water closet, in a multi-stall restroom, is less than 60" wide and 56" deep.

Location Description	Building A - A255B Restroom Women's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The wheelchair stall is 56 inches wide from wall to wall.

Resolution

Redesign to provide compliant wheelchair stall with a wall mounted water closet. Wheelchair accessible compartments with wall mounted water closets shall be 60" wide minimum measured perpendicular to the side wall and 56" deep minimum, measured perpendicular to the rear wall. Wheelchair accessible compartments with floor mounted water closets shall be 60" wide minimum measured perpendicular to the side wall and 59" deep minimum, measured perpendicular to the rear wall. Wheelchair accessible compartments for children's use (ages 3 through 12) shall be 60" wide minimum measured perpendicular to the side wall, and 59" deep minimum for wall hung and floor mounted water closets measured perpendicular to the rear wall. In addition, clear space of minimum 30" by 48" must be provided within the clearance area for transfer from a wheelchair. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 16 minimum to 18" maximum from the side wall or partition. Water closets shall be arranged for a left-hand or right-hand approach. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions, such as lavatories, shall be located within the required water closet clearance. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424408









Barrier ID: AX424487

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The stall door does not provide a pull handle on the push side. The door does not open a full 90° due to the paper towel dispenser.

Resolution

Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.

Quantity


1 EA


Priority	3


Photos for Barrier ID: AX424487





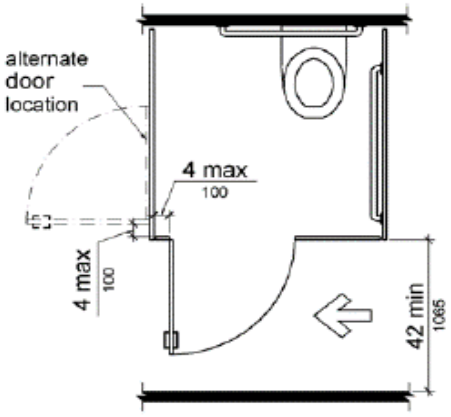

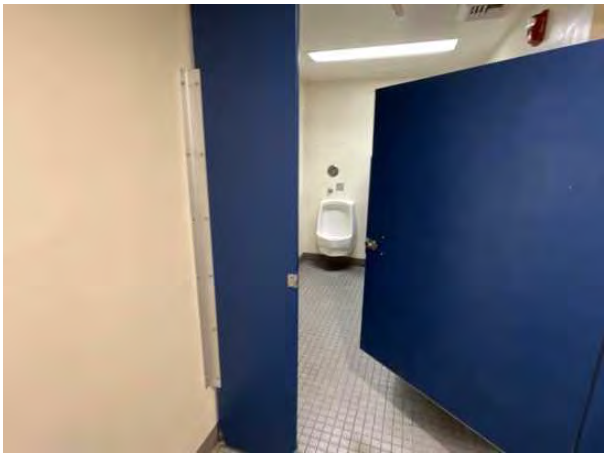

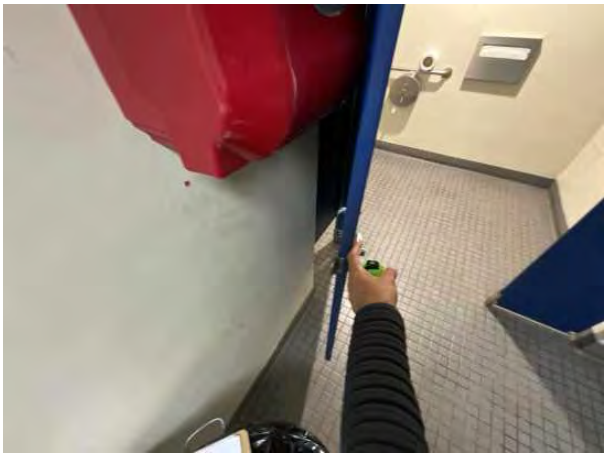

Barrier ID: AX418248

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building B - Restroom Men's B 107
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The door does not have a pull handle on the push side.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418248

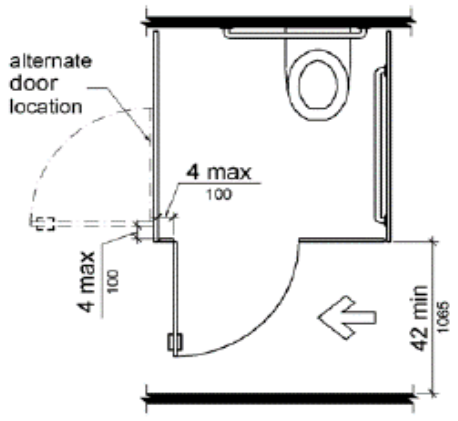

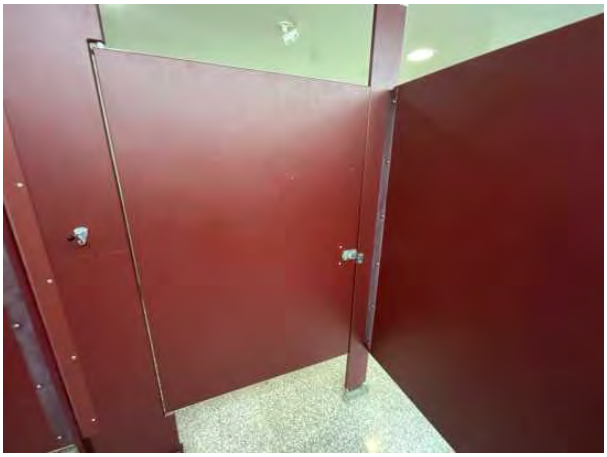

Barrier ID: AX418249

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.5.1; 604.8.1.5
Barrier Detail	The side grab bar is not compliant in the wheelchair stall.
Location Description	Building B - Restroom Men's B 107
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The side grab bar extends 51 inches from the rear wall.

Resolution

Remove and install a compliant side grab bar in the wheelchair stall. The top of the gripping surface of horizontal grab bars shall be located minimum 33" and maximum 36" above the finished floor. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. A continuous grab bar is allowable in lieu of two grab bars (one side and one rear). .[ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418249





Barrier ID: AX418256

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building B - Restroom Women's B 109
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The stall door does not provide a pull handle on the push side. The door is not self closing.

Resolution

Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity


1 EA

Priority	3

Photos for Barrier ID: AX418256



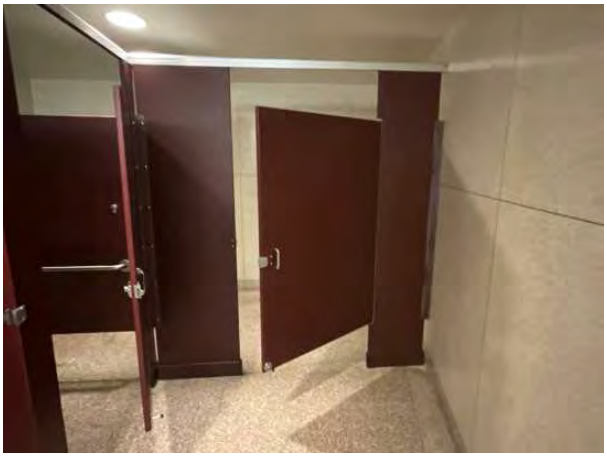

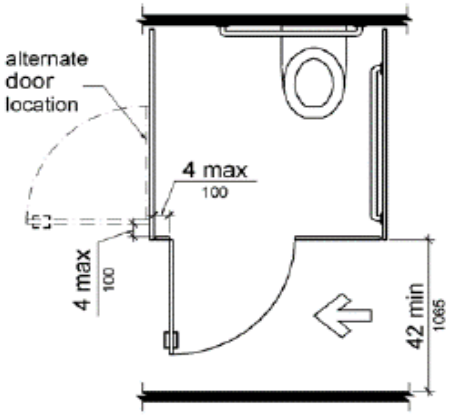

Barrier ID: AX418259

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.5.1; 604.8.1.5
Barrier Detail	The side grab bar is not compliant in the wheelchair stall.
Location Description	Building B - Restroom Women's B 109
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The side grab bar extends 51 inches from the rear wall.

Resolution

Remove and install a compliant side grab bar in the wheelchair stall. The top of the gripping surface of horizontal grab bars shall be located minimum 33" and maximum 36" above the finished floor. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. A continuous grab bar is allowable in lieu of two grab bars (one side and one rear). .[ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418259



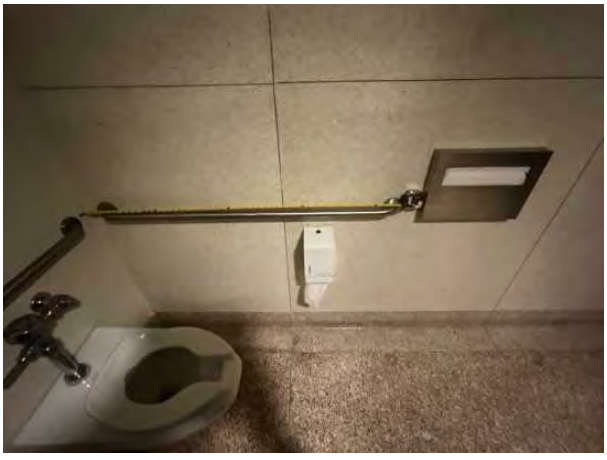

Barrier ID: AX418261

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.8.1.1

Barrier Detail

The wheelchair stall with a wall mounted water closet, in a multi-stall restroom, is less than 60" wide and 56" deep.

Location Description	Building B - Restroom Women's B 109
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The wheelchair stall is 59 inches wide.

Resolution

Redesign to provide compliant wheelchair stall with a wall mounted water closet. Wheelchair accessible compartments with wall mounted water closets shall be 60" wide minimum measured perpendicular to the side wall and 56" deep minimum, measured perpendicular to the rear wall. Wheelchair accessible compartments with floor mounted water closets shall be 60" wide minimum measured perpendicular to the side wall and 59" deep minimum, measured perpendicular to the rear wall. Wheelchair accessible compartments for children's use (ages 3 through 12) shall be 60" wide minimum measured perpendicular to the side wall, and 59" deep minimum for wall hung and floor mounted water closets measured perpendicular to the rear wall. In addition, clear space of minimum 30" by 48" must be provided within the clearance area for transfer from a wheelchair. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 16 minimum to 18" maximum from the side wall or partition. Water closets shall be arranged for a left-hand or right-hand approach. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions, such as lavatories, shall be located within the required water closet clearance. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418261



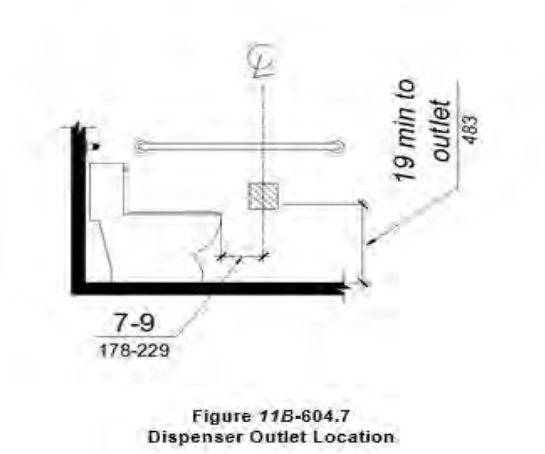


Figure *11B*-604.7
Dispenser Outlet Location



Barrier ID: AX420247

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building E - 1st Floor Restroom Boy's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stall door is not self closing.

Resolution

Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity


1 EA

Priority	3

Photos for Barrier ID: AX420247



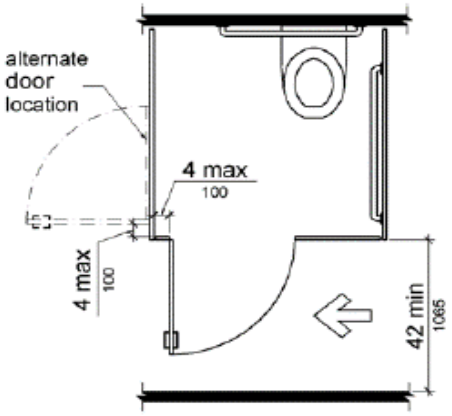

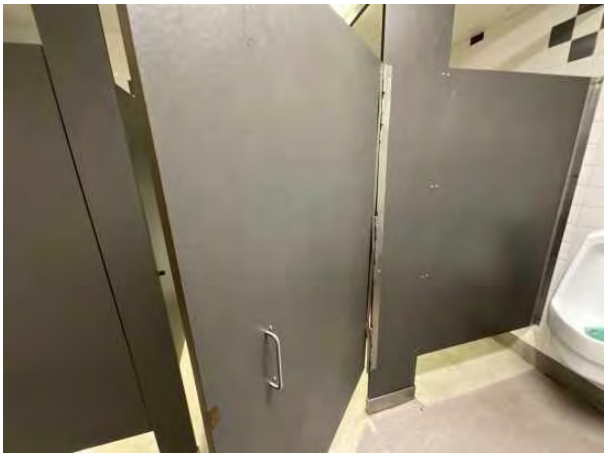

Barrier ID: AX420237

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building E - 1st Floor Restroom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stall door is not self closing.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420237

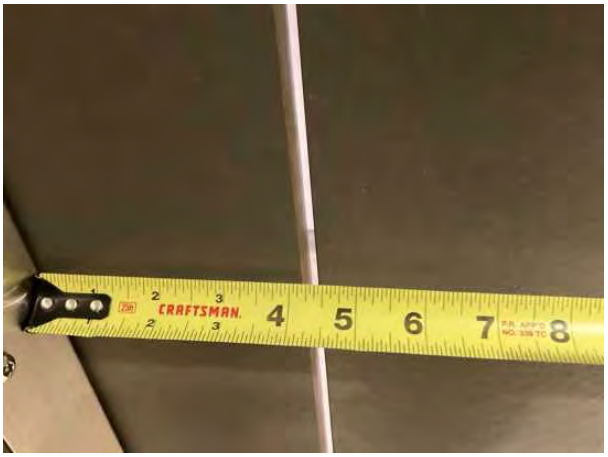

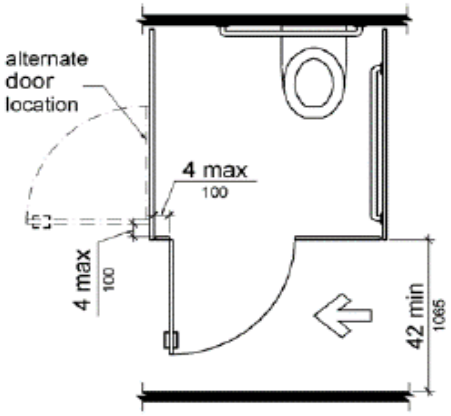



Barrier ID: AX420195

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building E - 1st Floor Restroom Men's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The wheelchair stall door does not self-close.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420195

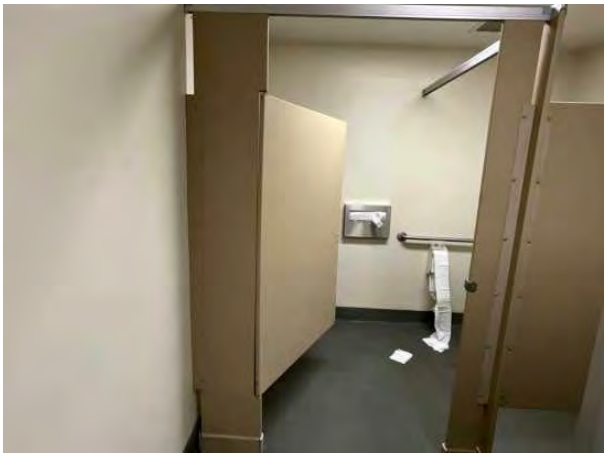

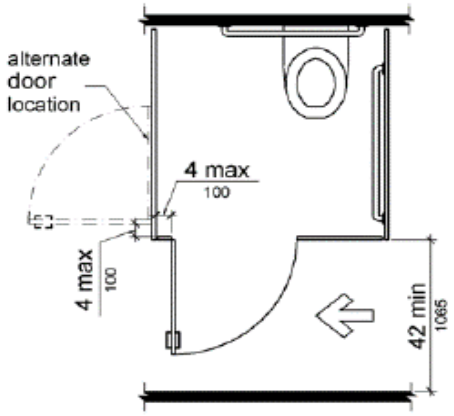





Barrier ID: AX420205

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building E - 1st Floor Restroom Women's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The wheelchair stall door is 5 inches from the wall, and does not provide a pull handle on the push side.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420205

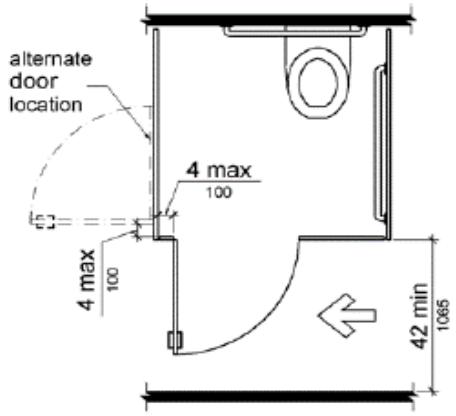

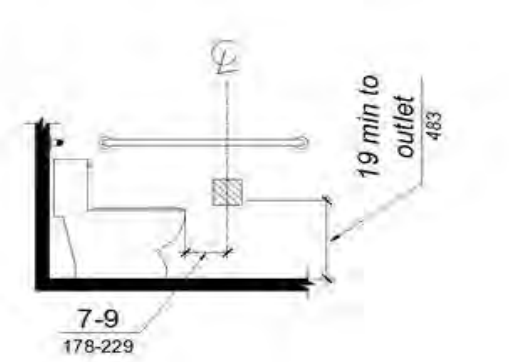


Figure *11B*-604.7
Dispenser Outlet Location





Barrier ID: AX420207

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.5.1; 604.8.1.5
Barrier Detail	The rear grab bar in the wheelchair stall is not compliant.
Location Description	Building E - 1st Floor Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The rear grab bar extends 22 1/2 inches past the centerline of the water closet on the open side.

Resolution


Remove and install a compliant rear grab bar in the wheelchair stall. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on one side and 24" minimum on the other side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Horizontal grab bars shall be installed at a consistent height above finish floor to the top of the gripping surface. The top of the gripping surface shall be minimum 33" and maximum 36" above finish floor. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX420207

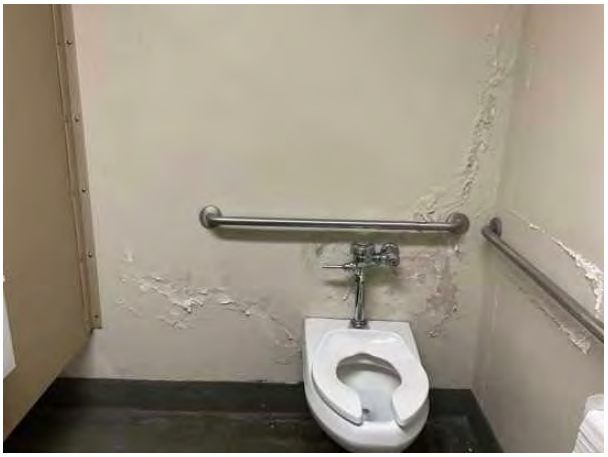



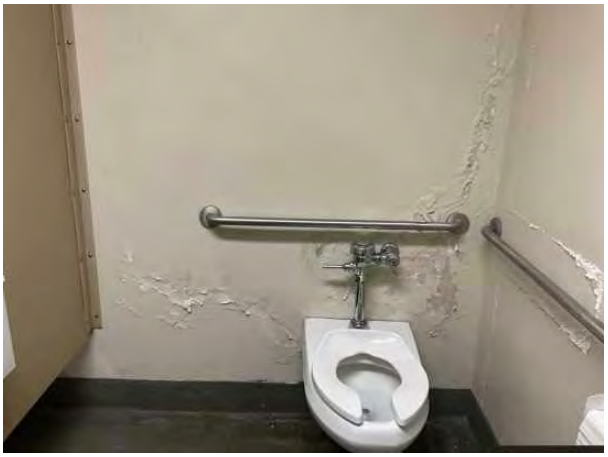

Barrier ID: AX420208

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.5.1; 604.8.1.5
Barrier Detail	The side grab bar is not compliant in the wheelchair stall.
Location Description	Building E - 1st Floor Restroom Women's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The side grab bar extends 50 inches from the rear wall.

Resolution


Remove and install a compliant side grab bar in the wheelchair stall. The top of the gripping surface of horizontal grab bars shall be located minimum 33" and maximum 36" above the finished floor. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. A continuous grab bar is allowable in lieu of two grab bars (one side and one rear). .[ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420208

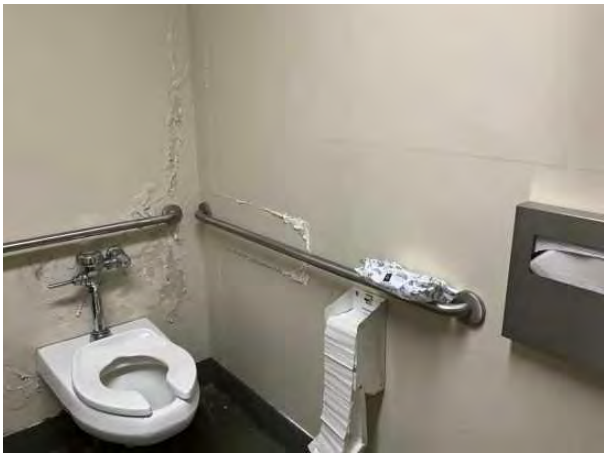



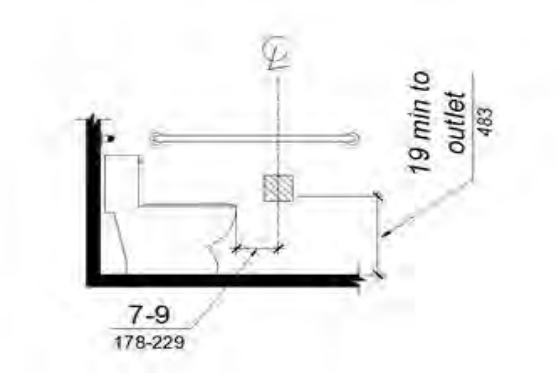


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX418290

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building F - Restroom F121 Women's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The wheelchair stall door is not self closing. The door does not provide a pull handle on the push side.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418290

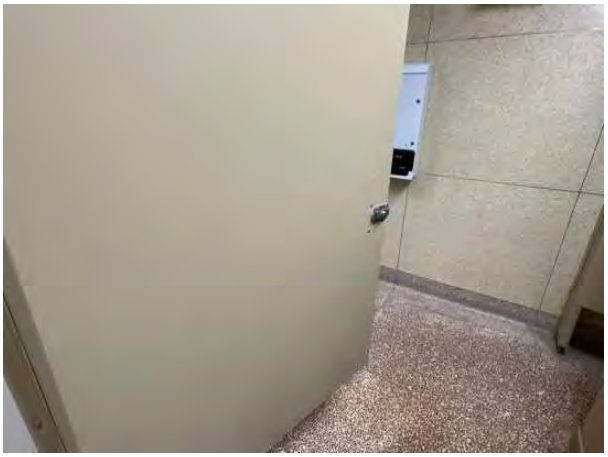

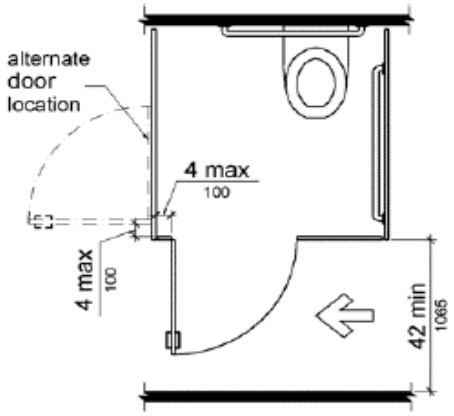





Barrier ID: AX418299

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building F - Restroom F122 Men's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The wheelchair stall door is not self closing. The door does not provide a pull handle on the push side.

Resolution

Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX418299





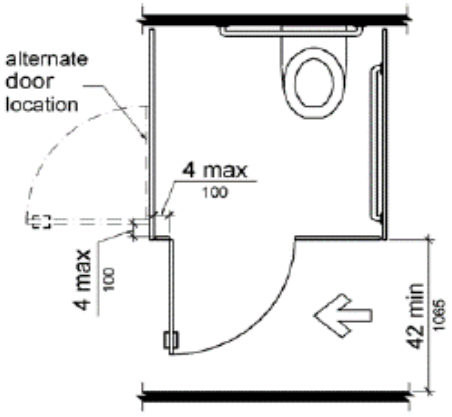

Barrier ID: AX418300

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building F - Restroom F122 Men's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The wheelchair stall is 59 1/4 inches wide at the door support.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418300

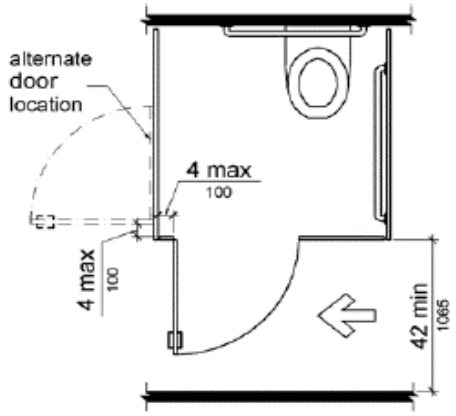







Barrier ID: AX419720

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building H East End - 1st Floor Restroom Boys
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door is not self closing.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419720

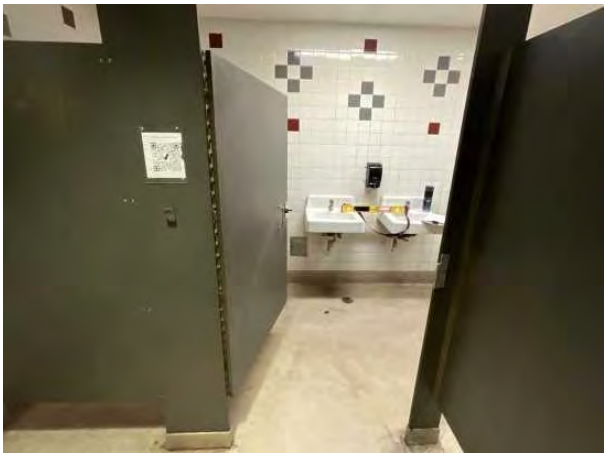

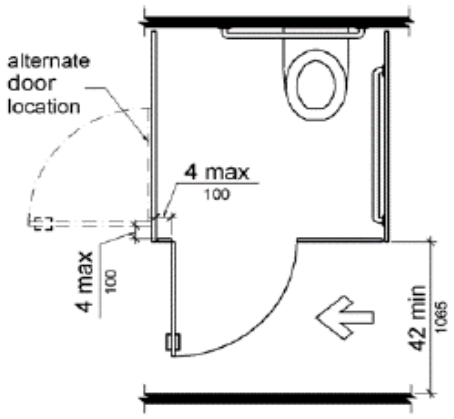

Barrier ID: AX419726

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building H East End - 1st Floor Restroom Girls
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door is not self-closing.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419726

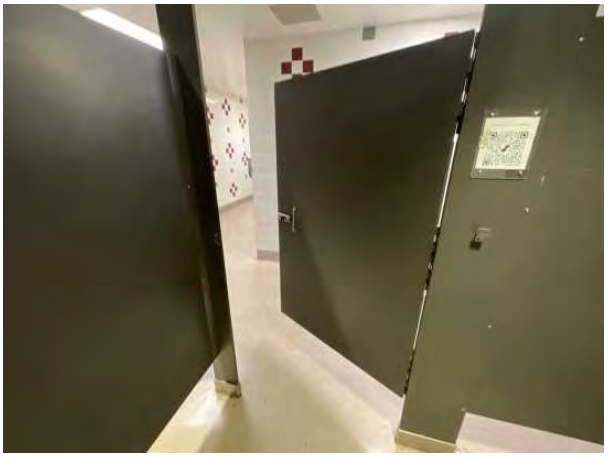

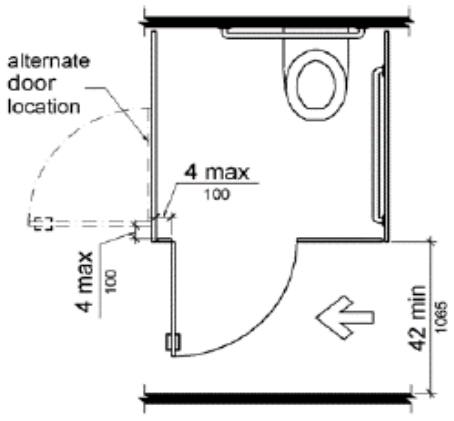

Barrier ID: AX419742

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.8.1.1

Barrier Detail

The wheelchair stall with a wall mounted water closet, in a multi-stall restroom, is less than 60" wide and 56" deep.

Location Description	Building H East End - 1st Floor Restroom Men's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The wheelchair stall is 58 1/2 inches wide at the partition support.

Resolution

Redesign to provide compliant wheelchair stall with a wall mounted water closet. Wheelchair accessible compartments with wall mounted water closets shall be 60" wide minimum measured perpendicular to the side wall and 56" deep minimum, measured perpendicular to the rear wall. Wheelchair accessible compartments with floor mounted water closets shall be 60" wide minimum measured perpendicular to the side wall and 59" deep minimum, measured perpendicular to the rear wall. Wheelchair accessible compartments for children's use (ages 3 through 12) shall be 60" wide minimum measured perpendicular to the side wall, and 59" deep minimum for wall hung and floor mounted water closets measured perpendicular to the rear wall. In addition, clear space of minimum 30" by 48" must be provided within the clearance area for transfer from a wheelchair. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 16 minimum to 18" maximum from the side wall or partition. Water closets shall be arranged for a left-hand or right-hand approach. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions, such as lavatories, shall be located within the required water closet clearance. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419742



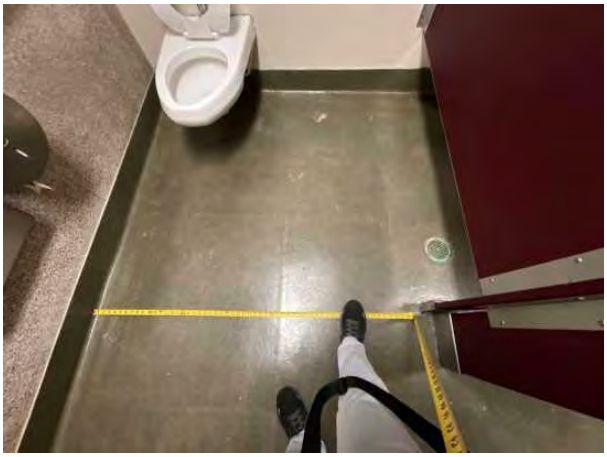

Barrier ID: AX419750

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building H East End - 1st Floor Restroom Women's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The stall door is not-self closing. The door does not provide a pull handle on the push side.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity

1 EA


Priority	3

Photos for Barrier ID: AX419750

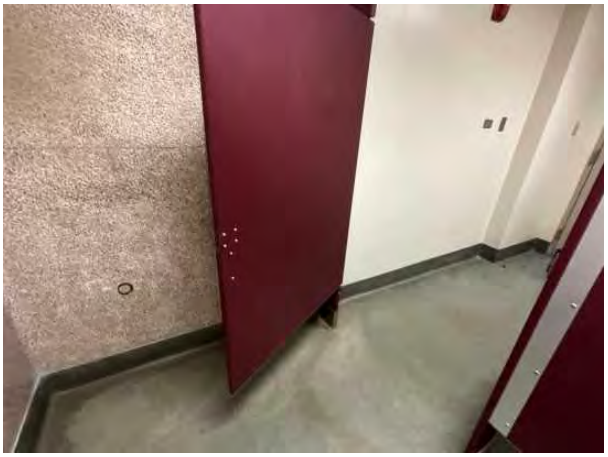

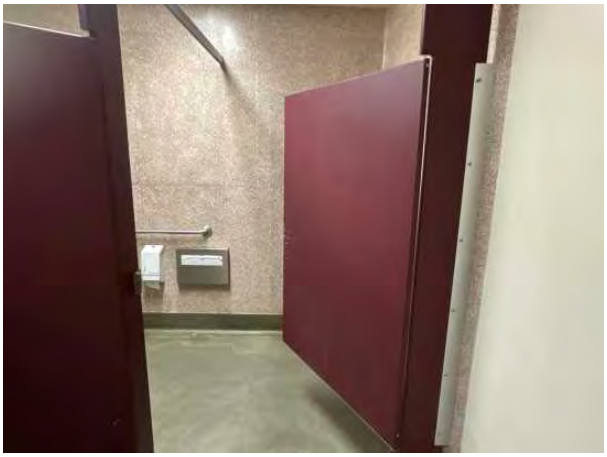



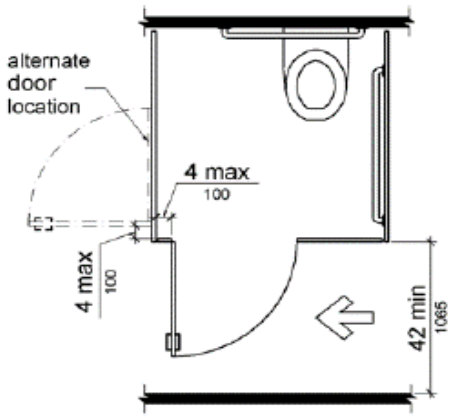

Barrier ID: AX419905

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building S - S123 Restroom Girls
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The stall door is 10 inches from the wall where the door is in the front partition.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity


1 EA

Priority	3

Photos for Barrier ID: AX419905

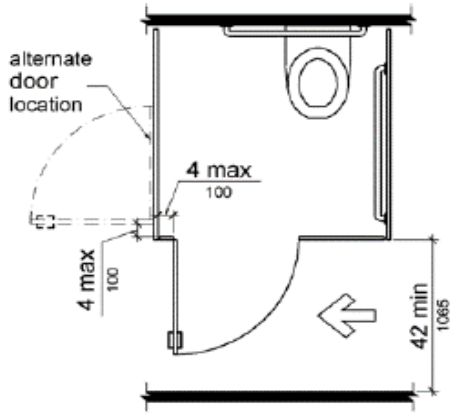

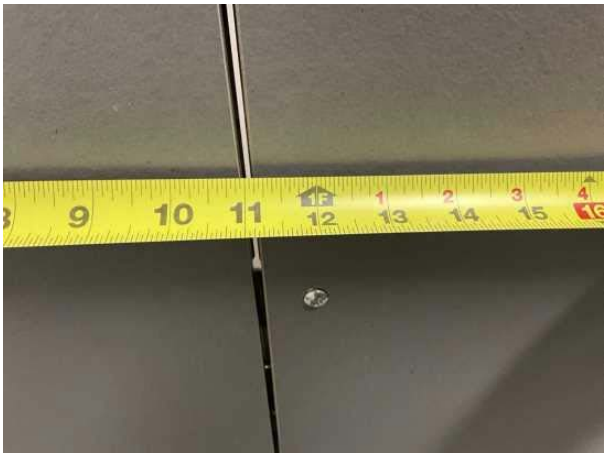

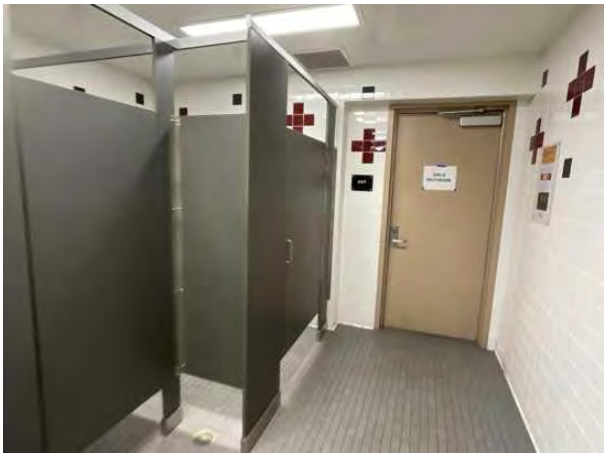

Barrier ID: AX420174

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Portable Trailer Restoom Boy's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stall door is 21 inches from the wall.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420174

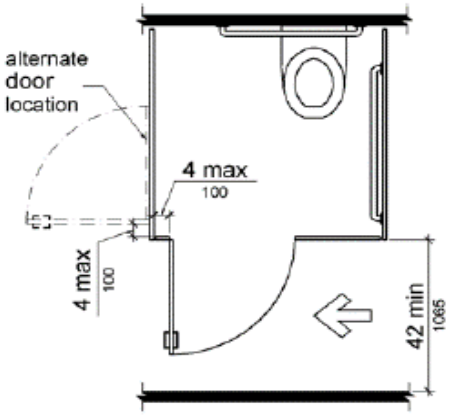





Barrier ID: AX420175

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.5.1; 604.8.2.3
Barrier Detail	The side grab bars are not compliant in the ambulatory stall.
Location Description	Portable Trailer Restoom Boy's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The side grab bar extends 54 inches from the rear wall and 18 inches past the front of the water closet.

Resolution

Remove and install compliant side grab bars on each side of the ambulatory stall. The side wall grab bars shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. [EXCEPTIONS: 1. A water closet in a toilet room for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling units, the height of water closets shall be permitted to be 15" minimum and 19" maximum above the finish floor measured to the top of the seat.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420175







Barrier ID: AX420176

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.8.1.1

Barrier Detail

The wheelchair stall with a floor mounted water closet, in a multi-stall restroom, is less than 60" wide and 59" deep.

Location Description	Portable Trailer Restoom Boy's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The wheelchair stall is 54 inches wide.

Resolution

Redesign to provide compliant wheelchair stall with a floor mounted water closet. Wheelchair accessible compartments with floor mounted water closets shall be 60" wide minimum measured perpendicular to the side wall and 59" deep minimum, measured perpendicular to the rear wall. Wheelchair accessible compartments with wall mounted water closets shall be 60" wide minimum measured perpendicular to the side wall and 56" deep minimum, measured perpendicular to the rear wall. Wheelchair accessible compartments for children's use (ages 3 through 12) shall be 60" wide minimum measured perpendicular to the side wall, and 59" deep minimum for wall hung and floor mounted water closets measured perpendicular to the rear wall.In addition, clear space of minimum 30" by 48" must be provided within the clearance area for transfer from a wheelchair. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 16 minimum to 18" maximum from the side wall or partition. Water closets shall be arranged for a left-hand or right-hand approach. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions, such as lavatories, shall be located within the required water closet clearance. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420176





Barrier ID: AX420185

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Portable Trailer Restoom Girl's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The stall door is 21 inches from the wall and is not self-closing.

Resolution

Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420185



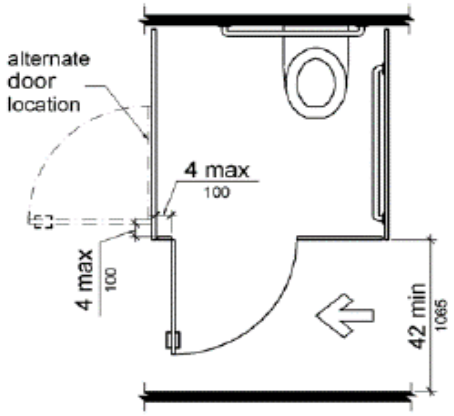





Barrier ID: AX420186

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.8.1.1

Barrier Detail

The wheelchair stall with a floor mounted water closet, in a multi-stall restroom, is less than 60" wide and 59" deep.

Location Description	Portable Trailer Restoom Girl's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The wheelchair stall is 58 inches wide.

Resolution

Redesign to provide compliant wheelchair stall with a floor mounted water closet. Wheelchair accessible compartments with floor mounted water closets shall be 60" wide minimum measured perpendicular to the side wall and 59" deep minimum, measured perpendicular to the rear wall. Wheelchair accessible compartments with wall mounted water closets shall be 60" wide minimum measured perpendicular to the side wall and 56" deep minimum, measured perpendicular to the rear wall. Wheelchair accessible compartments for children's use (ages 3 through 12) shall be 60" wide minimum measured perpendicular to the side wall, and 59" deep minimum for wall hung and floor mounted water closets measured perpendicular to the rear wall.In addition, clear space of minimum 30" by 48" must be provided within the clearance area for transfer from a wheelchair. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 16 minimum to 18" maximum from the side wall or partition. Water closets shall be arranged for a left-hand or right-hand approach. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions, such as lavatories, shall be located within the required water closet clearance. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX420186





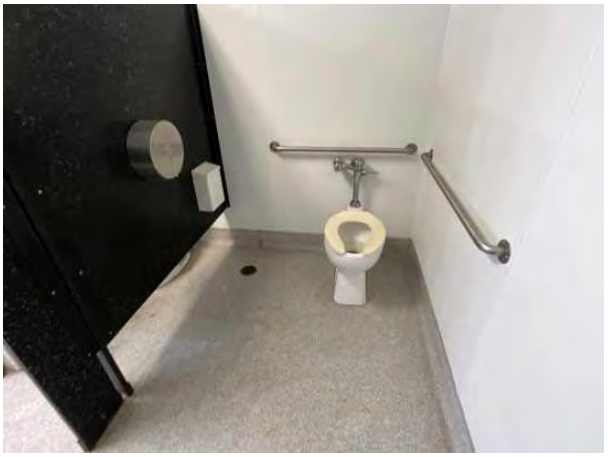

Barrier ID: AX420188

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.5.1; 604.8.2.3
Barrier Detail	The side grab bars are not compliant in the ambulatory stall.
Location Description	Portable Trailer Restoom Girl's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The rear grab bar extends 47 inches from the rear wall and 18 inches past the front of the water closet.

Resolution

Remove and install compliant side grab bars on each side of the ambulatory stall. The side wall grab bars shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. [EXCEPTIONS: 1. A water closet in a toilet room for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling units, the height of water closets shall be permitted to be 15" minimum and 19" maximum above the finish floor measured to the top of the seat.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX420188





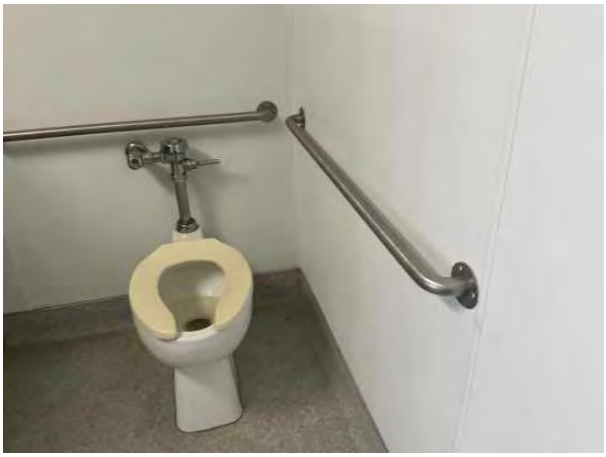

Barrier ID: AX420191

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Toilet Stall
ADA Standard	604.5.1; 604.8.2.3
Barrier Detail	The side grab bars are not compliant in the ambulatory stall.
Location Description	Portable Trailer Restoom Girl's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The paper towel dispenser is 50 inches above the floor and the soap dispenser is 42 1/2 inches above the floor.

Resolution

Remove and install compliant side grab bars on each side of the ambulatory stall. The side wall grab bars shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. [EXCEPTIONS: 1. A water closet in a toilet room for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling units, the height of water closets shall be permitted to be 15" minimum and 19" maximum above the finish floor measured to the top of the seat.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX420191





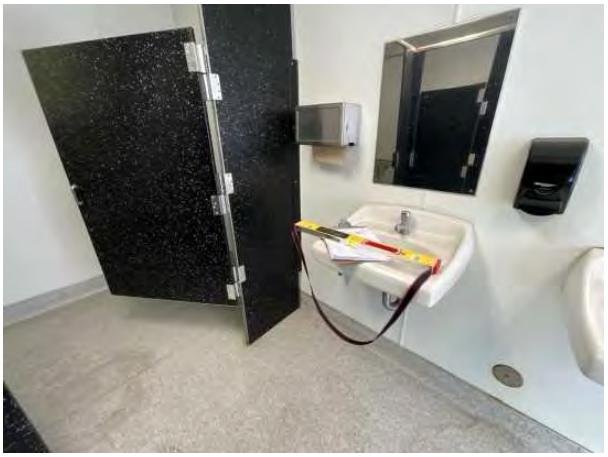

Barrier ID: AX419908

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Transfer Shower Stall
ADA Standard	608.2.1
Barrier Detail	The transfer shower is not exactly 36" by 36".
Location Description	Building S - S117 Girls Locker Room Shower
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The transfer shower is not 36 x 36. The transfer shower measures 38 1/2" x 48".

Resolution

Reconfigure so shower is exactly 36" by 36". Transfer type shower compartments shall be 36" by 36" clear inside dimensions measured at the center points of opposing sides and shall have a 36" wide minimum entry on the face of the shower compartment. Clearance of 36" wide minimum by 48" long minimum measured from the control wall shall be provided.

Quantity

1 EA


Priority	3


Photos for Barrier ID: AX419908







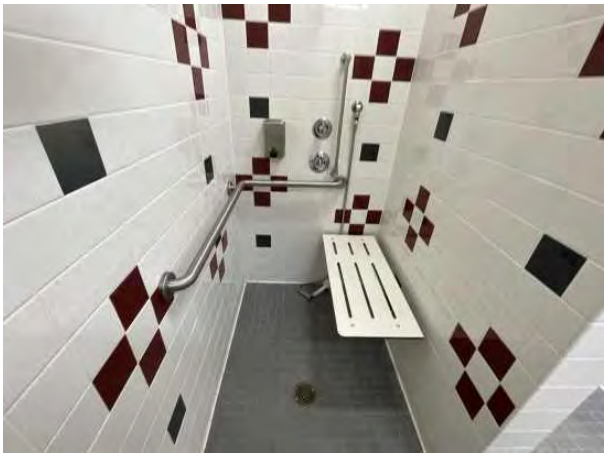

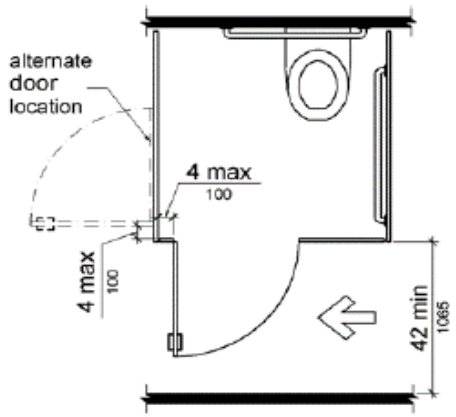

Barrier ID: AX419909

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Transfer Shower Stall
ADA Standard	610.3
Barrier Detail	A seat is not provided in the transfer shower stall.
Location Description	Building S - S117 Girls Locker Room Shower
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat edge does not extend to within 3 inches of the compartment entry.

Resolution


Provide a compliant folding or non-folding seat. The shower seat shall be rectangular or L-shaped. All seats shall have the inside edge 2-1/2" maximum from the seat wall. The side edge of all seats shall be 1-1/2" from the adjacent rear wall. The forward edge of the rectangular seat shall extend 15" minimum to 16" maximum from the seat wall. At the narrower part of the L-shaped seat, the inside edge shall be 2-1/2" maximum from the seat wall, and the outside/front edge 15" minimum and 16" maximum from the seat wall. At the wider part of the L-shaped seat closer to the rear wall, the rear edge of the "L" portion of the seat shall be 1-1/2" maximum from the rear wall and the outside/front edge shall be 22" minimum and 23" maximum from the seat wall. In transfer-type showers, the seat shall extend from the back wall to a point within 3" of the compartment entry. The top of the seat shall be 17" minimum and 19" maximum above the bathroom finish floor.

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX419909

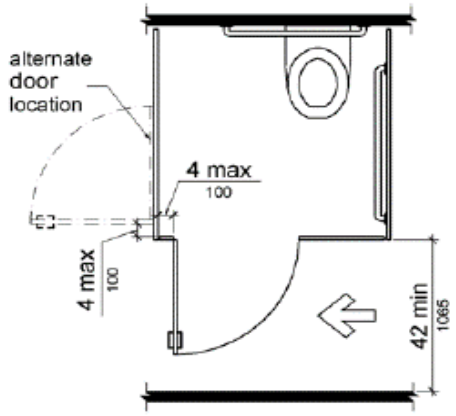



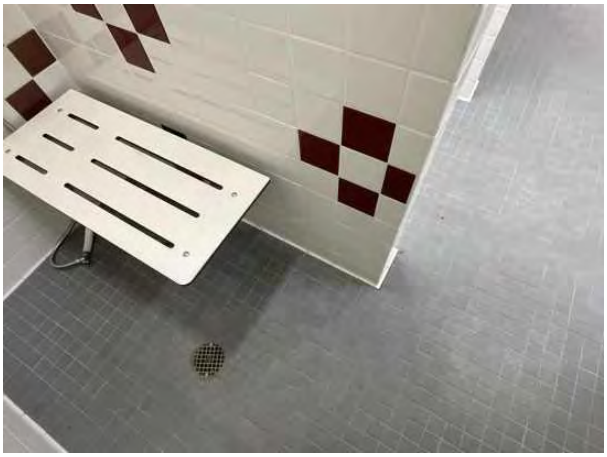

Barrier ID: AX424492

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Urinal
ADA Standard	213.3.3, 605.2
Barrier Detail	The urinal dimensions are not compliant.
Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The urinal rim is 17 5/8 inches above the floor.

Resolution

Replace or relocate the urinal. Urinals shall be the stall-type or the wall-hung type. Wall-hung urinals shall be installed with the rim 17" maximum above the finish floor or ground. Urinals shall be 13-1/2" deep minimum measured from the outer face of the urinal rim to the back of the fixture. Flush controls shall be hand operated or automatic. Flush controls shall be within allowable reach ranges.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424492





Barrier ID: AX418247

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Urinal
ADA Standard	213.3.3, 605.2
Barrier Detail	The urinal dimensions are not compliant.
Location Description	Building B - Restroom Men's B 107
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The urinal is 17 3/4 inches above the floor.

Resolution

Replace or relocate the urinal. Urinals shall be the stall-type or the wall-hung type. Wall-hung urinals shall be installed with the rim 17" maximum above the finish floor or ground. Urinals shall be 13-1/2" deep minimum measured from the outer face of the urinal rim to the back of the fixture. Flush controls shall be hand operated or automatic. Flush controls shall be within allowable reach ranges.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418247





Barrier ID: AX418305

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Urinal
ADA Standard	213.3.3, 605.2
Barrier Detail	The urinal dimensions are not compliant.
Location Description	Building F - Restroom F122 Men's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The urinal rim is 18 3/8 inches above the floor.

Resolution

Replace or relocate the urinal. Urinals shall be the stall-type or the wall-hung type. Wall-hung urinals shall be installed with the rim 17" maximum above the finish floor or ground. Urinals shall be 13-1/2" deep minimum measured from the outer face of the urinal rim to the back of the fixture. Flush controls shall be hand operated or automatic. Flush controls shall be within allowable reach ranges.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418305





Barrier ID: AX420178

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Urinal
ADA Standard	213.3.3, 605.2
Barrier Detail	The urinal dimensions are not compliant.
Location Description	Portable Trailer Restoom Boy's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The lowest urinal is 23 1/2 inches above the floor.

Resolution

Replace or relocate the urinal. Urinals shall be the stall-type or the wall-hung type. Wall-hung urinals shall be installed with the rim 17" maximum above the finish floor or ground. Urinals shall be 13-1/2" deep minimum measured from the outer face of the urinal rim to the back of the fixture. Flush controls shall be hand operated or automatic. Flush controls shall be within allowable reach ranges.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420178



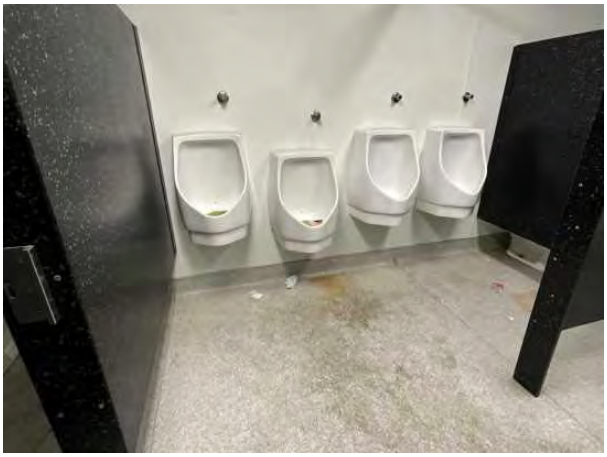

Barrier ID: AX424454

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B- 604.3.1 and 3.2
Barrier Detail	CALIFORNIA- The water closet does not have the required clear floor space.
Location Description	Building A - A101A Restroom Unisex
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The water closet clearance is 31 inches to the portable toilet and 54 inches to the lavatory.

Resolution

Redesign to ensure that the water closet has the minimum required clear floor space. The water closet shall be positioned with a wall or partition to the rear and to one side. Clearance around a water closet shall be 60" minimum measured perpendicular from the side wall and 56" minimum measured perpendicular from the rear wall. A minimum 60" wide and 48' deep maneuvering space shall be provided in front of the water closet. [Exception: In residential dwelling units required to be mobility accessible, maneuvering space in front of the water closet shall be a minimum 60" wide and 36" deep.] The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition, Water closets shall be arranged for a left-hand or right-hand approach, with the flush on the open side. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions shall be located within the required water closet clearance. [Exception: In residential dwelling units, a lavatory shall be permitted on the rear wall 18" minimum from the water closet centerline where the clearance at the water closet is 66" minimum measured perpendicular from the rear wall.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424454









Barrier ID: AX424455

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building A - A101A Restroom Unisex
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 19 inches from the sidewall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424455





Barrier ID: AX424444

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building A - A101B Restroom Unisex
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 21 inches from the side wall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424444





Barrier ID: AX424445

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building A - A101B Restroom Unisex
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The rear grab bar extends 20 1/2 inches past the centerline of the water closet on the open side.

Resolution

Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424445





Barrier ID: AX424446

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.1
Barrier Detail	The side grab bar at the water closet is not compliant.
Location Description	Building A - A101B Restroom Unisex
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The side grab bar extends 53 inches from the rear wall.

Resolution

Remove and install a compliant side grab bar. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424446



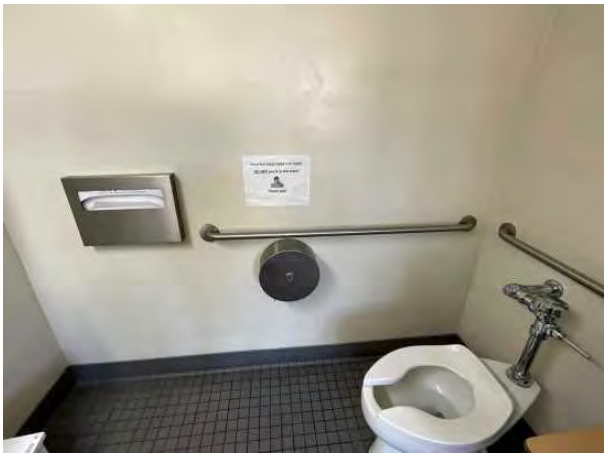

Barrier ID: AX424456

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building A - A101B Restroom Unisex
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The rear grab bar extends 21 1/2 inches past the centerline of the water closet on the open side.

Resolution

Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424456





Barrier ID: AX424467

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B- 604.3.1 and 3.2
Barrier Detail	CALIFORNIA- The water closet does not have the required clear floor space.
Location Description	Building A - A110 Restroom
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The clearance around the water closet is 46 1/2 inches to the lavatory.

Resolution

Redesign to ensure that the water closet has the minimum required clear floor space. The water closet shall be positioned with a wall or partition to the rear and to one side. Clearance around a water closet shall be 60" minimum measured perpendicular from the side wall and 56" minimum measured perpendicular from the rear wall. A minimum 60" wide and 48' deep maneuvering space shall be provided in front of the water closet. [Exception: In residential dwelling units required to be mobility accessible, maneuvering space in front of the water closet shall be a minimum 60" wide and 36" deep.] The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition, Water closets shall be arranged for a left-hand or right-hand approach, with the flush on the open side. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions shall be located within the required water closet clearance. [Exception: In residential dwelling units, a lavatory shall be permitted on the rear wall 18" minimum from the water closet centerline where the clearance at the water closet is 66" minimum measured perpendicular from the rear wall.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity


1 EA

Priority	3

Photos for Barrier ID: AX424467





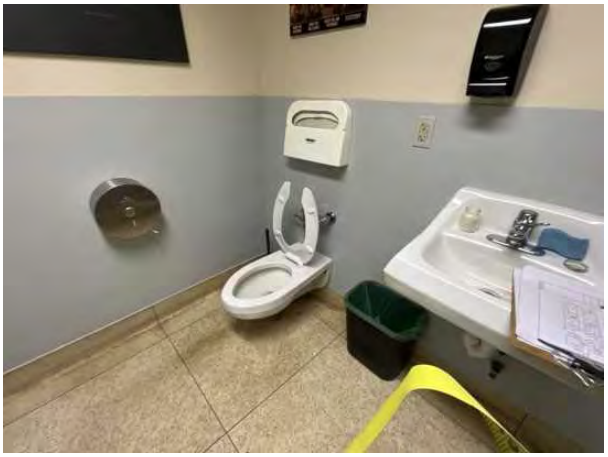

Barrier ID: AX424468

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The grab bars at the water closet are not provided or are not compliant.
Location Description	Building A - A110 Restroom
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet does not have the side and rear grab bar.

Resolution

Remove and install compliant grab bars. Grab bars shall be installed in a horizontal position at height of 33" minimum to 36" maximum above the finish floor, measured to the top of the gripping surface. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on one side and 24" minimum on the other side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424468



Barrier ID: AX424469

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.6

Barrier Detail

The flush control is located on the closed side and/or is not within reach range.

Location Description	Building A - A110 Restroom
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet flush is not on the open side.

Resolution


Remove and install a flush control that is on the open side of the water closet. Flush controls shall be hand operated or automatic. Hand operated flush controls shall be within a compliant reach range. Flush controls shall be located on the open side of the water closet, except in ambulatory accessible compartments.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424469

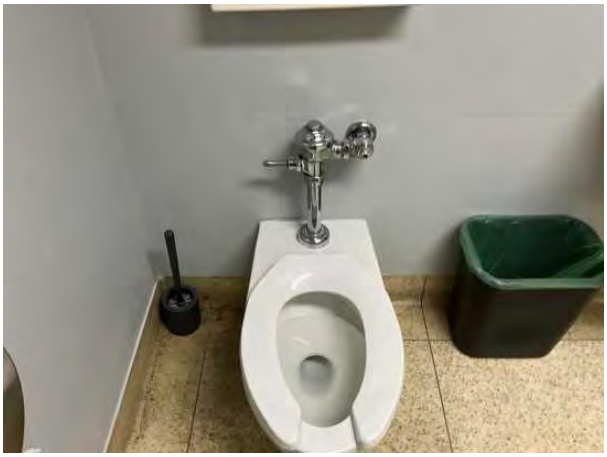

Barrier ID: AX424472

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.4

Barrier Detail

The height of the water closet is not 17" minimum to 19" maximum above finished floor.

Location Description	Building A - A110 Restroom
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet seat height is 16 inches above the floor.

Resolution

Remove and replace with a toilet that has a compliant seat height. The seat height of a water closet shall be 17" minimum and 19" maximum above the finish floor, measured to the top of the seat. Seats shall not be sprung to return to a lifted position. [EXCEPTIONS: 1. A water closet in a toilet room for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling units, the height of water closets shall be permitted to be 15" minimum and 19" maximum above the finish floor measured to the top of the seat.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424472





Barrier ID: AX424477

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building A - A112 Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 19 inches from the sidewall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424477





Barrier ID: AX424478

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building A - A112 Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The rear grab bar extends 19 inches past the centerline of the water closet on the open side.

Resolution

Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424478



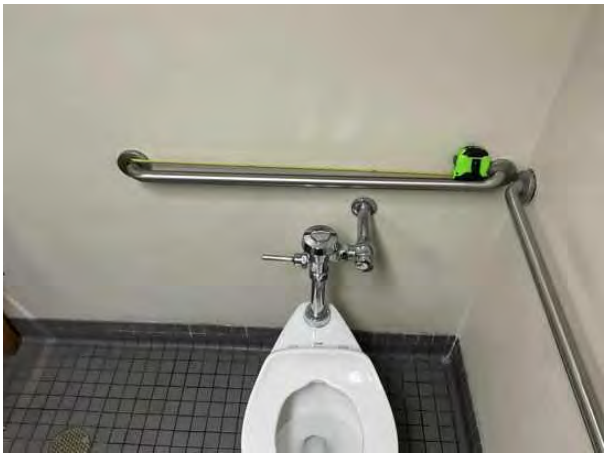

Barrier ID: AX424479

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.1
Barrier Detail	The side grab bar at the water closet is not compliant.
Location Description	Building A - A112 Restroom Women's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The side grab bar extends 50 inches from the rear wall.

Resolution

Remove and install a compliant side grab bar. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424479





Barrier ID: AX424480

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building A - A112 Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The toilet paper dispenser is centered 10 1/2 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424480



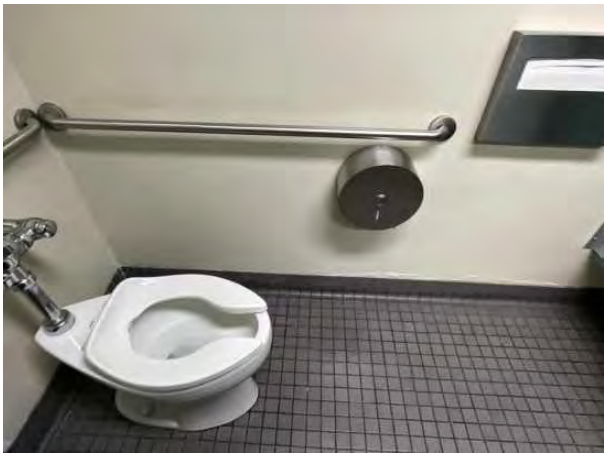

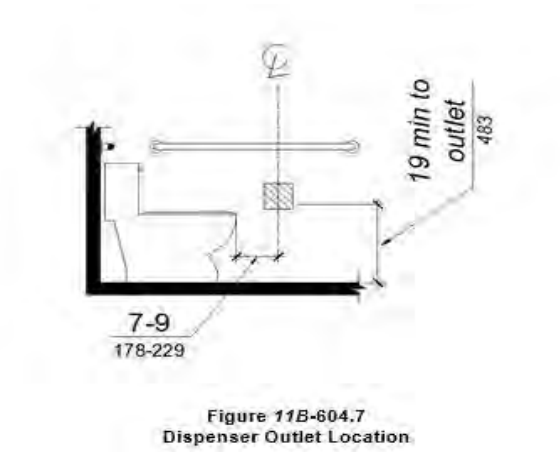


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX424482

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 609.3
Barrier Detail	CALIFORNIA: The disposal unit at the water closet is not compliant.
Location Description	Building A - A112 Restroom Women's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The disposal unit is not between the rear wall and the toilet paper dispenser.

Resolution


Replace the existing disposal unit at the water closet with a compliant disposal unit. Sanitary disposal units, if provided, shall comply with requirements for operable parts, shall be wall mounted and located on the sidewall between the rear wall of the toilet and the toilet paper dispenser, adjacent to the toilet paper dispenser. The disposal unit shall be located below the grab bar with the opening of the disposal unit 19 inches minimum above the finish floor. Sanitary disposal units shall comply. Combination accessory units are not permitted to encroach into the space required for grab bars.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424482

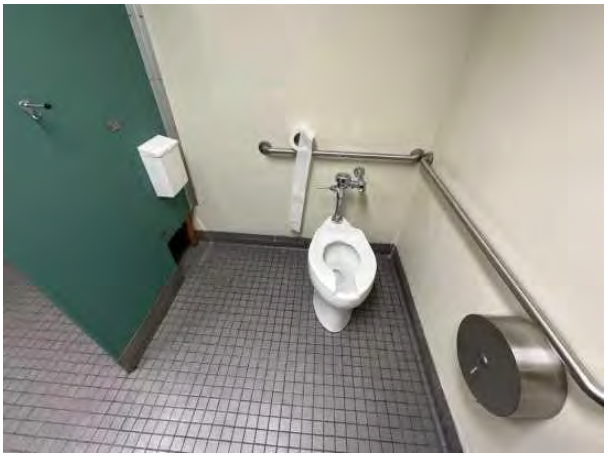

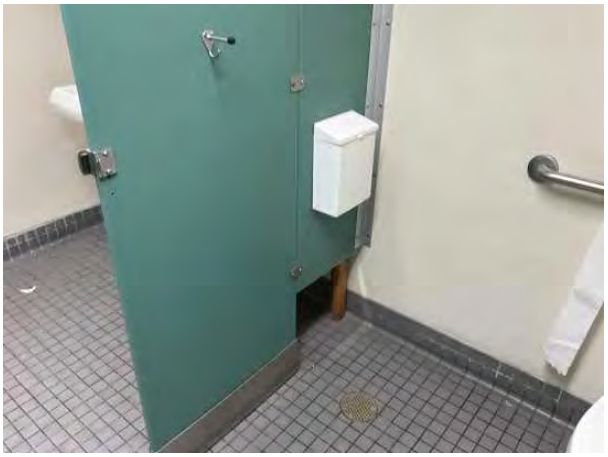

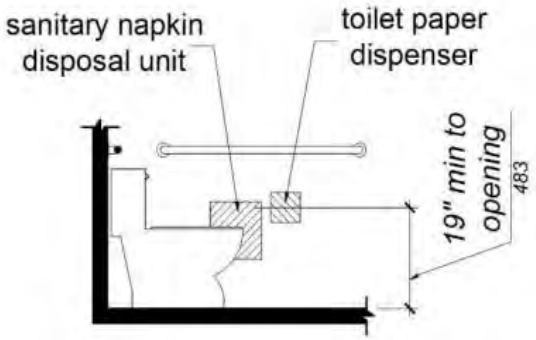


Figure 11B-604.7.2
Disposal Unit Location

Barrier ID: AX424398

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building A - A253B Restroom Men's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered, 18 7/8 inches from the sidewall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424398





Barrier ID: AX424399

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.1
Barrier Detail	The side grab bar at the water closet is not compliant.
Location Description	Building A - A253B Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The side grab or extends 50 inches from the rear wall.

Resolution

Remove and install a compliant side grab bar. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424399





Barrier ID: AX424401

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building A - A253B Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is 11 1/2 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424401



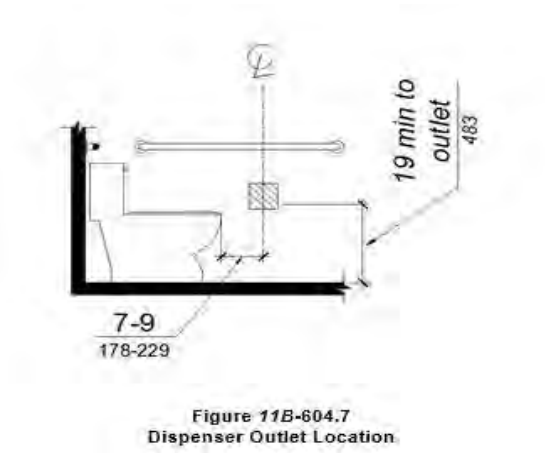


Figure *11B*-604.7
Dispenser Outlet Location



Barrier ID: AX424402

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building A - A253B Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The seat cover dispenser is 41 inches above the floor.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424402



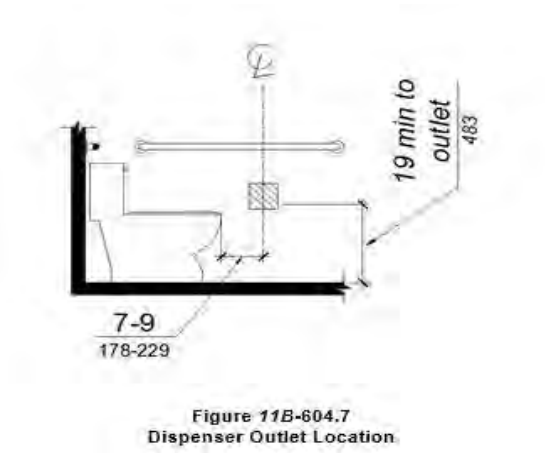


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX424409

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building A - A255B Restroom Women's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered, 18 5/8 of an inch from the sidewall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424409



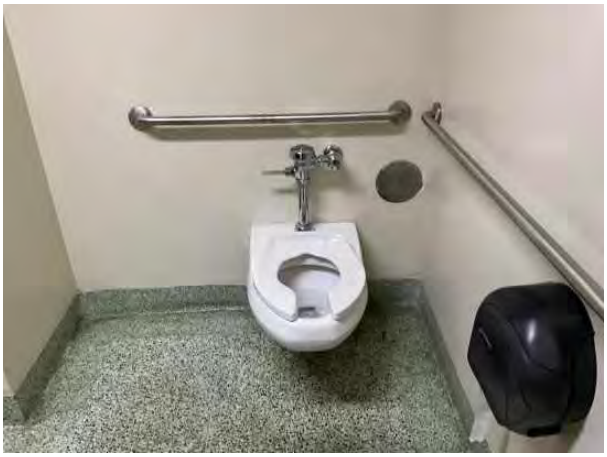

Barrier ID: AX424410

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building A - A255B Restroom Women's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The rear grab bar extends 23 inches past the centerline of the water closet on the open side.

Resolution


Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424410

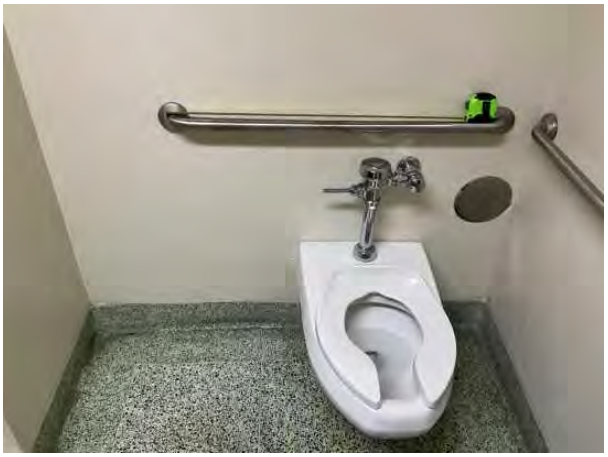





Barrier ID: AX424411

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.1
Barrier Detail	The side grab bar at the water closet is not compliant.
Location Description	Building A - A255B Restroom Women's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The side grab bar extends 50 inches from the rear wall.

Resolution

Remove and install a compliant side grab bar. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424411





Barrier ID: AX424412

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building A - A255B Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered, 13 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424412





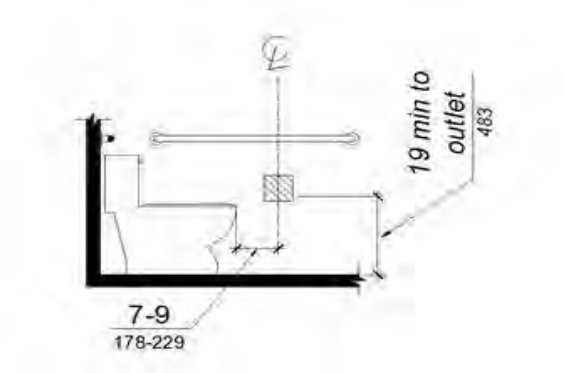


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX424417

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 609.3
Barrier Detail	CALIFORNIA: The disposal unit at the water closet is not compliant.
Location Description	Building A - A255C Restroom Women's
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The disposal unit is not between the rear wall and the toilet paper dispenser.

Resolution

Replace the existing disposal unit at the water closet with a compliant disposal unit. Sanitary disposal units, if provided, shall comply with requirements for operable parts, shall be wall mounted and located on the sidewall between the rear wall of the toilet and the toilet paper dispenser, adjacent to the toilet paper dispenser. The disposal unit shall be located below the grab bar with the opening of the disposal unit 19 inches minimum above the finish floor. Sanitary disposal units shall comply. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424417



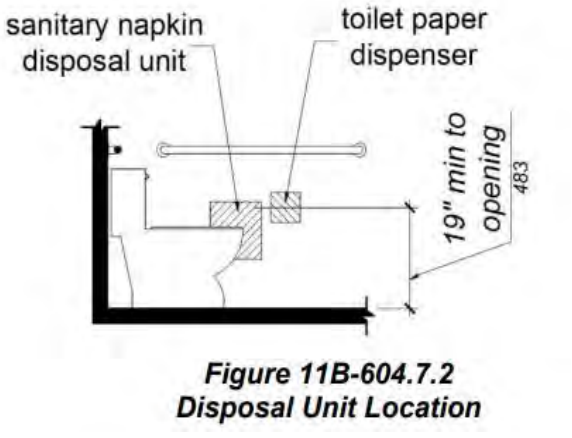


Figure 11B-604.7.2
Disposal Unit Location

Barrier ID: AX424488

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered, 18 3/4 inches from the sidewall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424488



Barrier ID: AX424489

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered 11 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424489





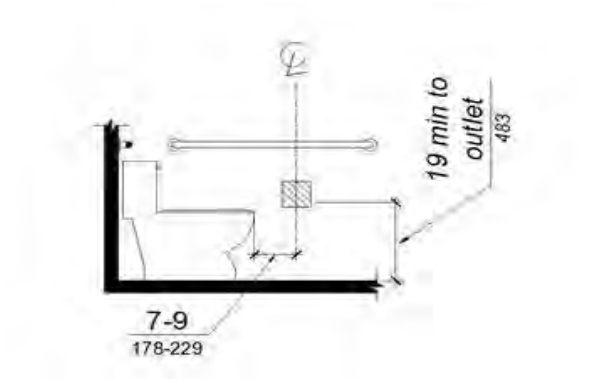


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX424490

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.1
Barrier Detail	The side grab bar at the water closet is not compliant.
Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The side grab bar extends 52 1/2 inches from the rear wall.

Resolution

Remove and install a compliant side grab bar. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424490





Barrier ID: AX424491

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	609.3

Barrier Detail

The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".

Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The clearance below the side grab bar is 3/4 inch to the toilet paper, dispenser.

Resolution

Move the projecting object below or at the ends of the grab bar to a minimum of 1-1/2" from the grab bar. [EXCEPTION: The space between grab bars and shower controls, shower fittings, and other grab bars above shall be permitted to be 1-1/2" minimum.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424491





Barrier ID: AX424493

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building A - Restroom Men's Near Reception Lobby
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The rear grab extends 22 inches past the centerline of the water closet on the open side.

Resolution


Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424493

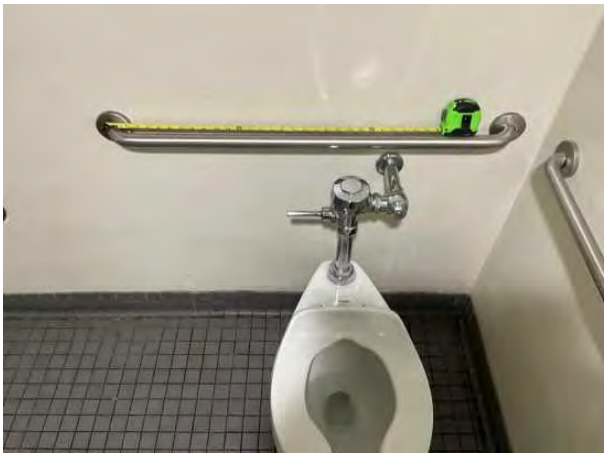



Barrier ID: AX419817

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building B - B110 Girls Dressing
Observed	Dec 10, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 18 3/4 inches from the side wall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419817





Barrier ID: AX419818

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building B - B110 Girls Dressing
Observed	Dec 10, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The toilet paper dispenser is centered 11 1/2 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419818





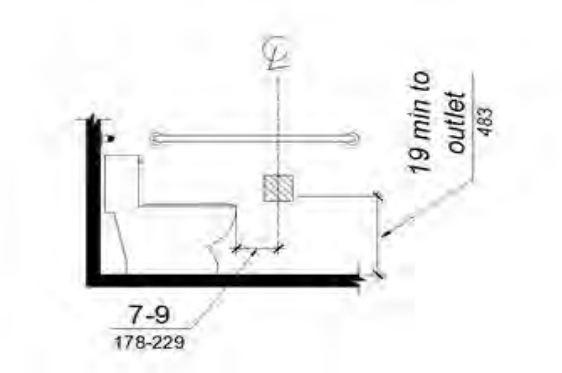


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX419845

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building B - B112 Boys Dressing
Observed	Dec 10, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 18 1/2 inches from the sidewall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419845



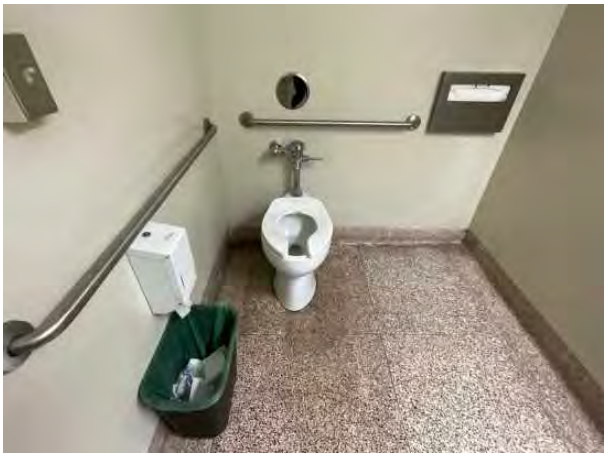

Barrier ID: AX419846

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building B - B112 Boys Dressing
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered 15 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419846



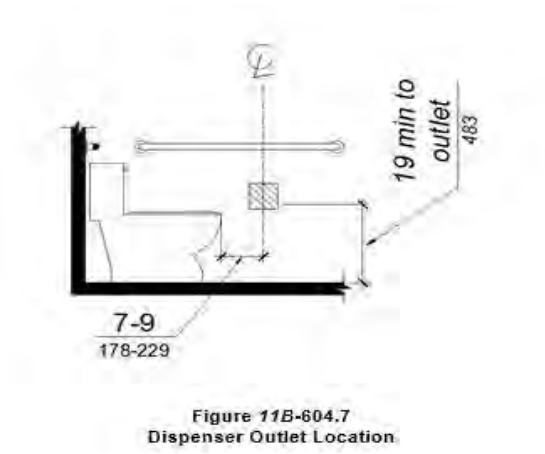


Figure *11B*-604.7
Dispenser Outlet Location



Barrier ID: AX418251

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building B - Restroom Men's B 107
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered, 13 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418251





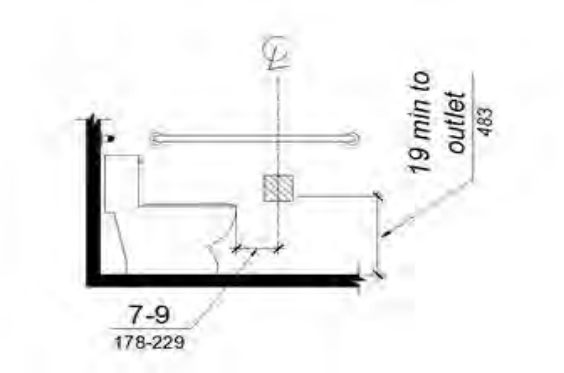


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX418257

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building B - Restroom Women's B 109
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet 19 1/2 inches from the side wall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418257



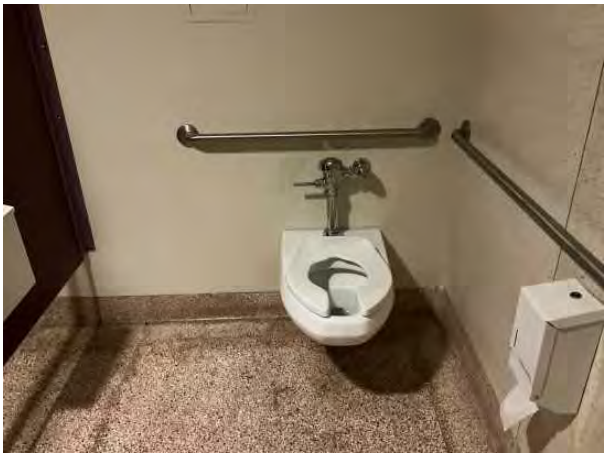

Barrier ID: AX418258

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building B - Restroom Women's B 109
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The grab bar extends 21 1/2 inches past the centerline of the water closet on the open side.

Resolution

Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418258



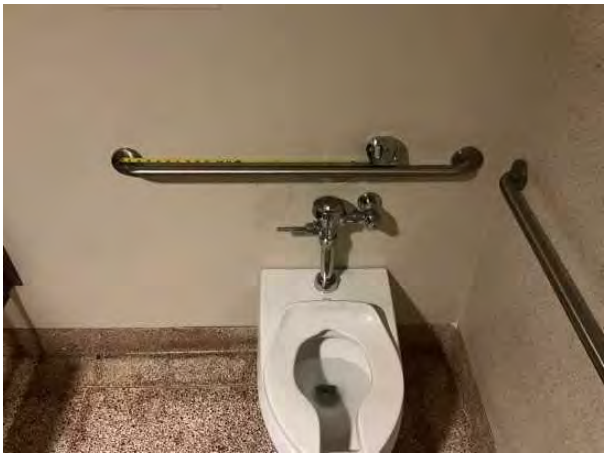

Barrier ID: AX418260

Pasadena High School BUILDING B

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building B - Restroom Women's B 109
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The toilet paper dispenser is centered, 12 1/2 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418260





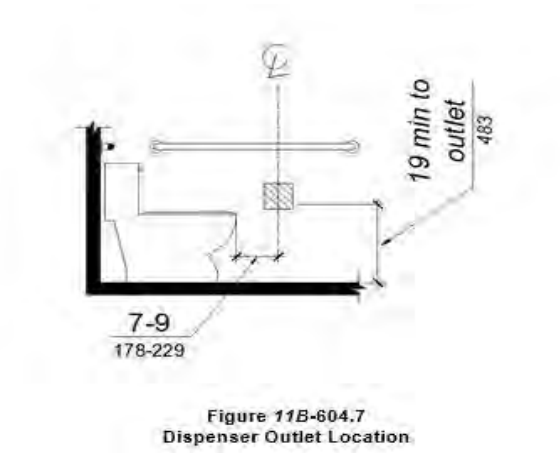


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX419860

Pasadena High School BUILDING C

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	609.3

Barrier Detail

The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".

Location Description	Building C - Restroom Women's
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The clearance below the grab bar is 1 3/8 inches to the plumbing.

Resolution

Move the projecting object below or at the ends of the grab bar to a minimum of 1-1/2" from the grab bar. [EXCEPTION: The space between grab bars and shower controls, shower fittings, and other grab bars above shall be permitted to be 1-1/2" minimum.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419860





Barrier ID: AX419861

Pasadena High School BUILDING C

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 609.3
Barrier Detail	CALIFORNIA: The disposal unit at the water closet is not compliant.
Location Description	Building C - Testroom Women's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The disposal unit is not between the rear wall and the toilet paper dispenser.

Resolution

Replace the existing disposal unit at the water closet with a compliant disposal unit. Sanitary disposal units, if provided, shall comply with requirements for operable parts, shall be wall mounted and located on the sidewall between the rear wall of the toilet and the toilet paper dispenser, adjacent to the toilet paper dispenser. The disposal unit shall be located below the grab bar with the opening of the disposal unit 19 inches minimum above the finish floor. Sanitary disposal units shall comply. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419861



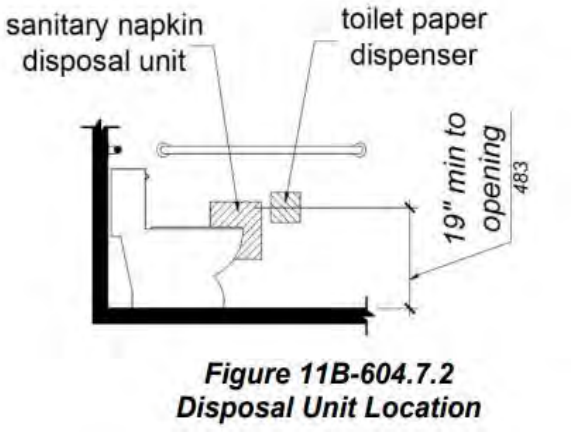


Figure 11B-604.7.2
Disposal Unit Location

Barrier ID: AX418381

Pasadena High School BUILDING D

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building D - Restroom D102A Men
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 19 1/4 inches from the sidewall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418381





Barrier ID: AX418382

Pasadena High School BUILDING D

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building D - Restroom D102A Men
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is 15 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418382





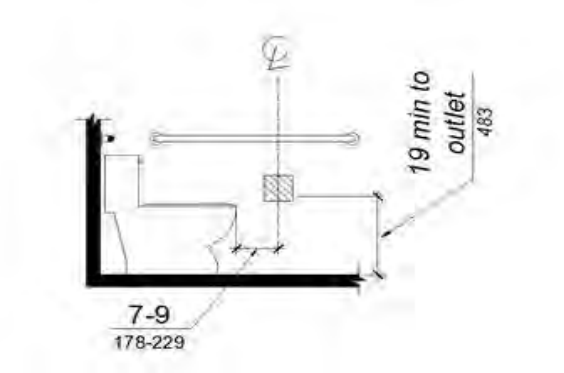


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX418387

Pasadena High School BUILDING D

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building D - Restroom D102B Women
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The grab bar extends 22 1/2 inches past the centerline of the water closet on the open side.

Resolution


Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418387

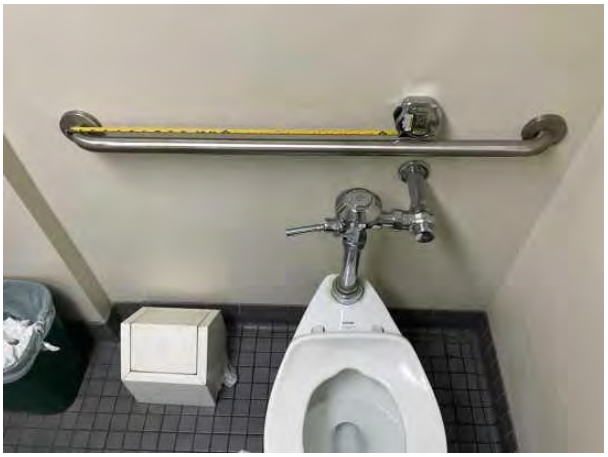



Barrier ID: AX418388

Pasadena High School BUILDING D

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building D - Restroom D102B Women
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is 13 1/2 inches in front of the water closet

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418388

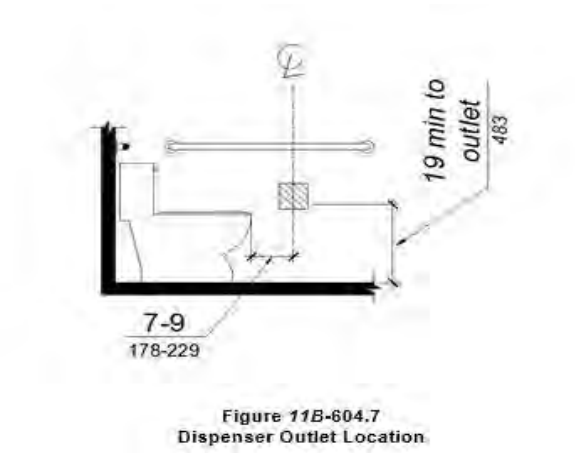


Figure *11B*-604.7
Dispenser Outlet Location





Barrier ID: AX418389

Pasadena High School BUILDING D

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B- 604.3.1 and 3.2
Barrier Detail	CALIFORNIA- The water closet does not have the required clear floor space.
Location Description	Building D - Restroom D102B Women
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The furniture is placed within the 48 inch water closet clear space. The trashcan and disposal unit are placed within the water closets clear space.

Resolution

Relocate the furniture and items to ensure that the water closet has the minimum required clear floor space. The water closet shall be positioned with a wall or partition to the rear and to one side. Clearance around a water closet shall be 60" minimum measured perpendicular from the side wall and 56" minimum measured perpendicular from the rear wall. A minimum 60" wide and 48' deep maneuvering space shall be provided in front of the water closet. [Exception: In residential dwelling units required to be mobility accessible, maneuvering space in front of the water closet shall be a minimum 60" wide and 36" deep.] The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition, Water closets shall be arranged for a left-hand or right-hand approach, with the flush on the open side. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions shall be located within the required water closet clearance. [Exception: In residential dwelling units, a lavatory shall be permitted on the rear wall 18" minimum from the water closet centerline where the clearance at the water closet is 66" minimum measured perpendicular from the rear wall.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418389







Barrier ID: AX418391

Pasadena High School BUILDING D

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 609.3
Barrier Detail	CALIFORNIA: The disposal unit at the water closet is not compliant.
Location Description	Building D - Restroom D102B Women
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The disposal unit is not between the rear wall and the toilet paper dispenser..

Resolution

Replace the existing disposal unit at the water closet with a compliant disposal unit. Sanitary disposal units, if provided, shall comply with requirements for operable parts, shall be wall mounted and located on the sidewall between the rear wall of the toilet and the toilet paper dispenser, adjacent to the toilet paper dispenser. The disposal unit shall be located below the grab bar with the opening of the disposal unit 19 inches minimum above the finish floor. Sanitary disposal units shall comply. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418391


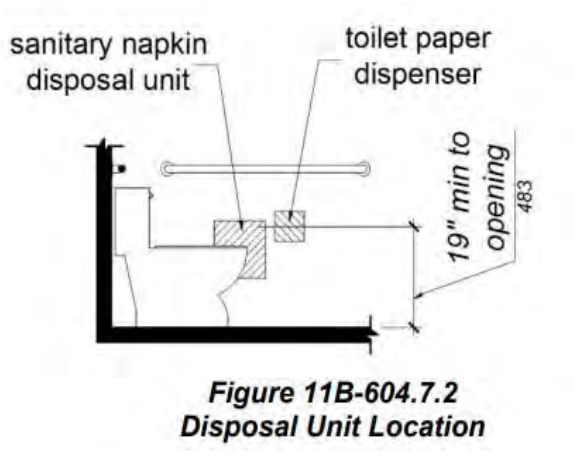


Figure 11B-604.7.2
Disposal Unit Location

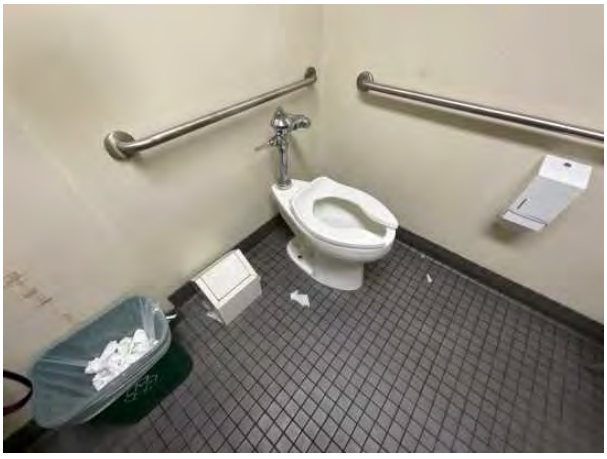

Barrier ID: AX420248

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building E - 1st Floor Restroom Boy's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered 10 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420248





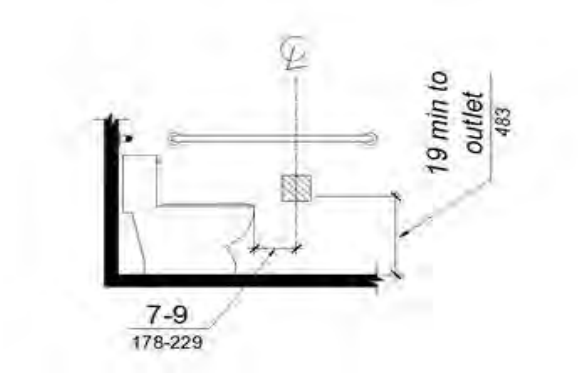


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX420238

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	609.3

Barrier Detail

The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".

Location Description	Building E - 1st Floor Restroom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The grab bar clearance below is 7/8 of an inch to the toilet paper dispenser.

Resolution

Move the projecting object below or at the ends of the grab bar to a minimum of 1-1/2" from the grab bar. [EXCEPTION: The space between grab bars and shower controls, shower fittings, and other grab bars above shall be permitted to be 1-1/2" minimum.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420238





Barrier ID: AX420239

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 609.3
Barrier Detail	CALIFORNIA: The disposal unit at the water closet is not compliant.
Location Description	Building E - 1st Floor Restroom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The disposal unit is not between the rear wall and the toilet paper dispenser.

Resolution


Replace the existing disposal unit at the water closet with a compliant disposal unit. Sanitary disposal units, if provided, shall comply with requirements for operable parts, shall be wall mounted and located on the sidewall between the rear wall of the toilet and the toilet paper dispenser, adjacent to the toilet paper dispenser. The disposal unit shall be located below the grab bar with the opening of the disposal unit 19 inches minimum above the finish floor. Sanitary disposal units shall comply. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420239

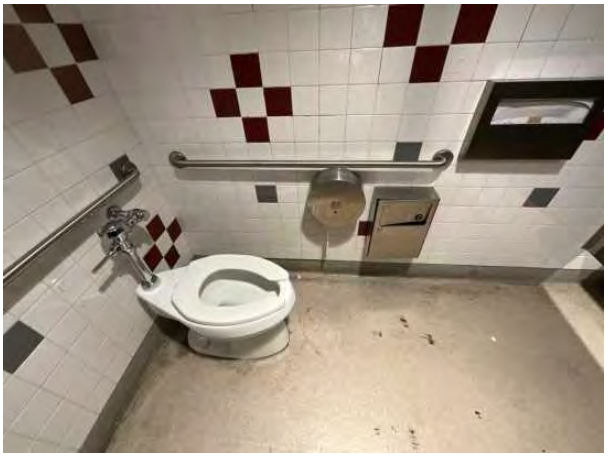



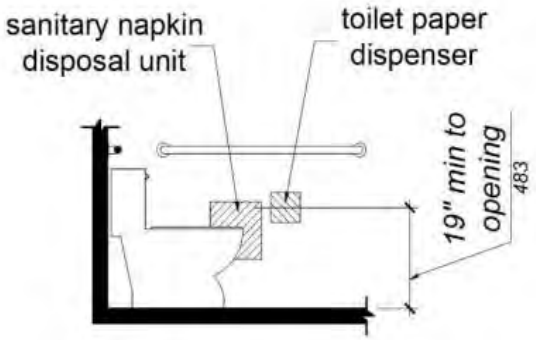


Figure 11B-604.7.2
Disposal Unit Location

Barrier ID: AX420240

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building E - 1st Floor Restroom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper is centered 6 1/2 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420240





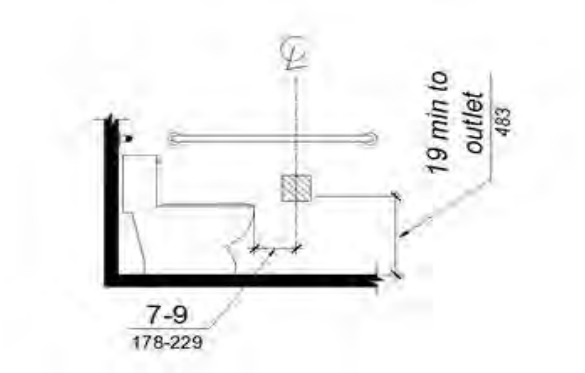


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX420197

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building E - 1st Floor Restroom Men's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 19 inches from the side wall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420197





Barrier ID: AX420198

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	609.3

Barrier Detail

The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".

Location Description	Building E - 1st Floor Restroom Men's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The grab bar clearance below is 1 3/8 inches to the plumbing.

Resolution

Move the projecting object below or at the ends of the grab bar to a minimum of 1-1/2" from the grab bar. [EXCEPTION: The space between grab bars and shower controls, shower fittings, and other grab bars above shall be permitted to be 1-1/2" minimum.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420198





Barrier ID: AX420199

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building E - 1st Floor Restroom Men's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The grab bar extends 22 inches past the centerline of the water closet on the open side.

Resolution

Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420199



Barrier ID: AX420200

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.1
Barrier Detail	The side grab bar at the water closet is not compliant.
Location Description	Building E - 1st Floor Restroom Men's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The side grab bar extends 50 1/2 from the rear wall.

Resolution

Remove and install a compliant side grab bar. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420200





Barrier ID: AX420201

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building E - 1st Floor Restroom Men's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The toilet paper dispenser is centered 12 1/4 inches past the front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420201

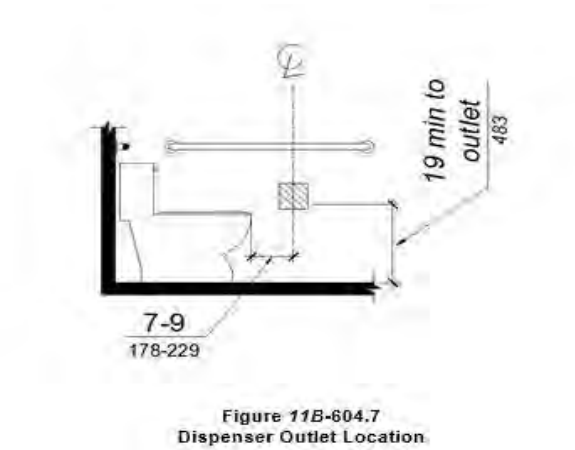


Figure *11B*-604.7
Dispenser Outlet Location





Barrier ID: AX420206

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building E - 1st Floor Restroom Women's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered, 18 7/8 from the sidewall.

Resolution


Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420206

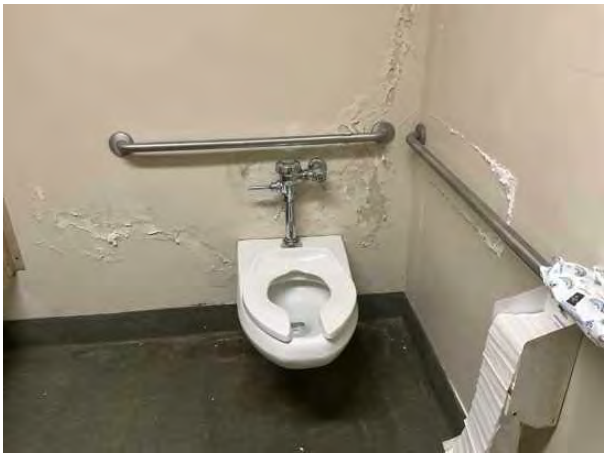



Barrier ID: AX420209

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building E - 1st Floor Restroom Women's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The toilet paper dispenser is centered 11 1/2 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420209





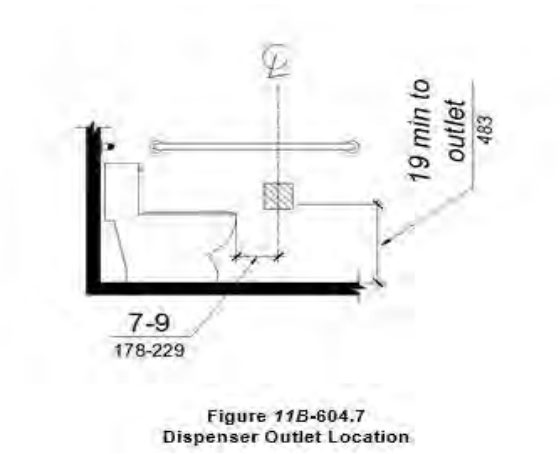


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX420136

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building E - 2nd Floor Restroom Boys
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered, 18 3/8 from the sidewall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420136





Barrier ID: AX420143

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building E - 2nd Floor Restroom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 18 1/2 inches from the side wall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420143







Barrier ID: AX420138

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building E - 2nd Floor Restroom Men's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered 9 3/4 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420138





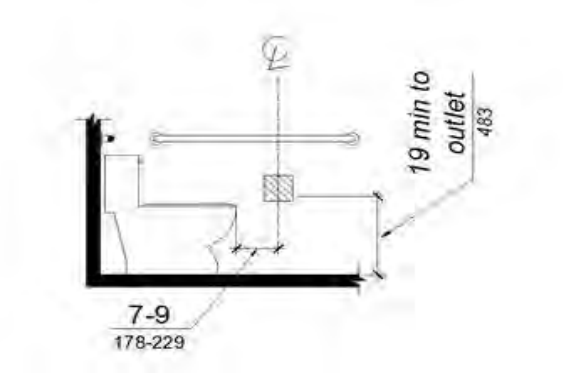


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX420141

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building E - 2nd Floor Restroom Women's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered, 18 3/8 from the sidewall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420141





Barrier ID: AX418320

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building F - Restroom F100B Unisex
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered, 18 3/8 from the sidewall.

Resolution


Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418320

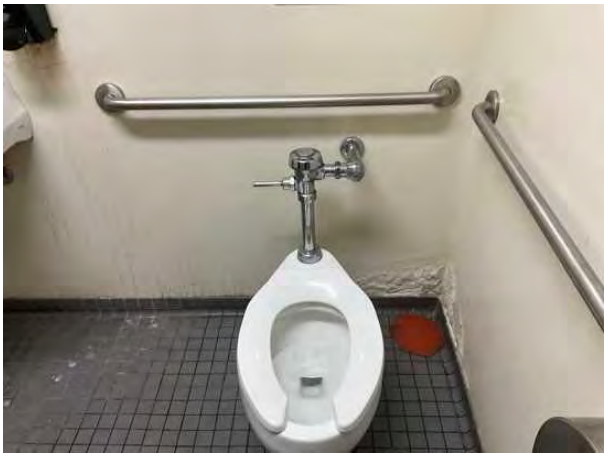



Barrier ID: AX418321

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.4

Barrier Detail

The height of the water closet is not 17" minimum to 19" maximum above finished floor.

Location Description	Building F - Restroom F100B Unisex
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet seat height is 15 3/4 inches above the floor.

Resolution

Remove and replace with a toilet that has a compliant seat height. The seat height of a water closet shall be 17" minimum and 19" maximum above the finish floor, measured to the top of the seat. Seats shall not be sprung to return to a lifted position. [EXCEPTIONS: 1. A water closet in a toilet room for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling units, the height of water closets shall be permitted to be 15" minimum and 19" maximum above the finish floor measured to the top of the seat.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418321





Barrier ID: AX418322

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building F - Restroom F100B Unisex
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is 11 1/4 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418322





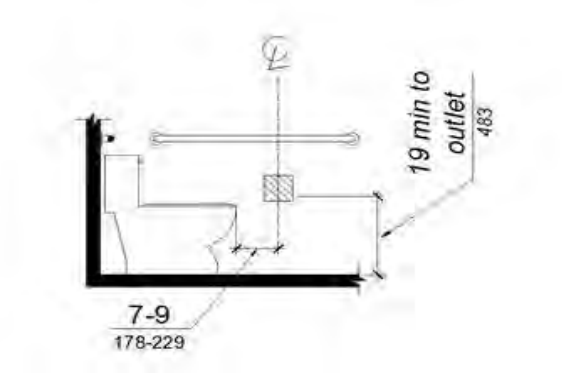


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX418323

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building F - Restroom F100B Unisex
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The grab bar extends 22 inches past the centerline of the water closet on the open side.

Resolution

Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418323





Barrier ID: AX418324

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.1
Barrier Detail	The side grab bar at the water closet is not compliant.
Location Description	Building F - Restroom F100B Unisex
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The side grab bar extends 53 inches from the rear wall.

Resolution

Remove and install a compliant side grab bar. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418324





Barrier ID: AX418325

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B- 604.3.1 and 3.2
Barrier Detail	CALIFORNIA- The water closet does not have the required clear floor space.
Location Description	Building F - Restroom F100B Unisex
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The water closet clearance is 50 inches wide from the sidewalk to the lavatory.

Resolution


Redesign to ensure that the water closet has the minimum required clear floor space. The water closet shall be positioned with a wall or partition to the rear and to one side. Clearance around a water closet shall be 60" minimum measured perpendicular from the side wall and 56" minimum measured perpendicular from the rear wall. A minimum 60" wide and 48' deep maneuvering space shall be provided in front of the water closet. [Exception: In residential dwelling units required to be mobility accessible, maneuvering space in front of the water closet shall be a minimum 60" wide and 36" deep.] The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition, Water closets shall be arranged for a left-hand or right-hand approach, with the flush on the open side. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions shall be located within the required water closet clearance. [Exception: In residential dwelling units, a lavatory shall be permitted on the rear wall 18" minimum from the water closet centerline where the clearance at the water closet is 66" minimum measured perpendicular from the rear wall.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418325

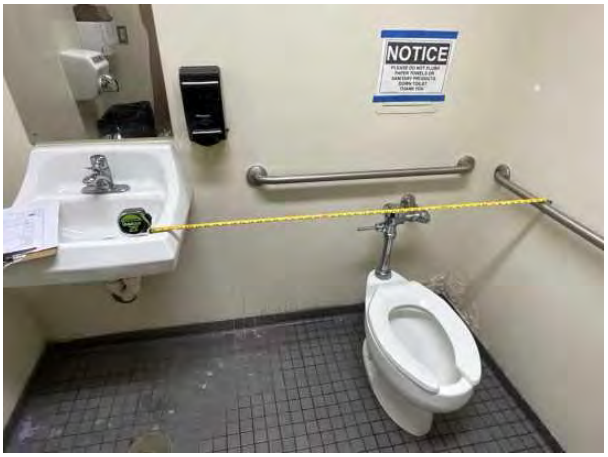



Barrier ID: AX418291

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building F - Restroom F121 Women's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The rear grab bar extends 23 inches past the centerline of the water closet.

Resolution

Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418291





Barrier ID: AX418292

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	609.3

Barrier Detail

The space between the grab bar and projecting objects below and at the ends of the bar is less than 1 1/2" minimum.

Location Description	Building F - Restroom F121 Women's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The grab bar has 1 3/16 of an inch clearance below to the toilet paper dispenser.

Resolution

Move the projecting object below or at the ends of the grab bar to a minimum of 1 1/2" from the grab bar. EXCEPTION: The space between grab bars and shower controls, shower fittings, and other grab bars above shall be permitted to be 1 1/2" minimum.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418292





Barrier ID: AX418293

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building F - Restroom F121 Women's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is 12 1/2 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418293





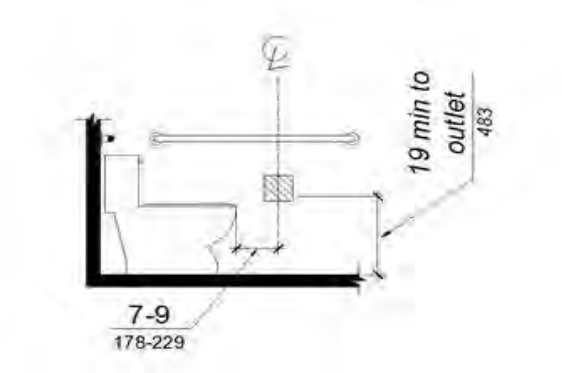


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX418295

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 609.3
Barrier Detail	CALIFORNIA: The disposal unit at the water closet is not compliant.
Location Description	Building F - Restroom F121 Women's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The product dispenser is not located between the toilet paper dispenser and the rear wall.

Resolution

Replace the existing disposal unit at the water closet with a compliant disposal unit. Sanitary disposal units, if provided, shall comply with requirements for operable parts, shall be wall mounted and located on the sidewall between the rear wall of the toilet and the toilet paper dispenser, adjacent to the toilet paper dispenser. The disposal unit shall be located below the grab bar with the opening of the disposal unit 19 inches minimum above the finish floor. Sanitary disposal units shall comply. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418295

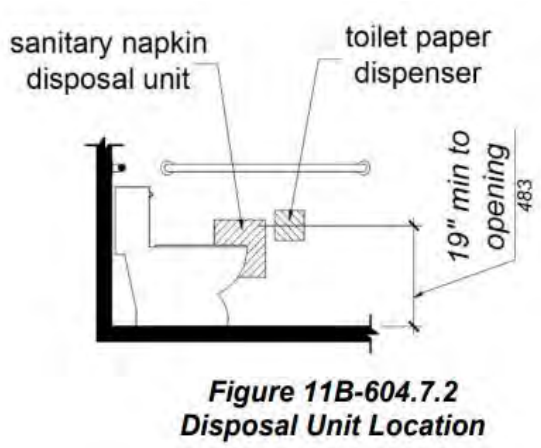


Figure 11B-604.7.2
Disposal Unit Location



Barrier ID: AX418301

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building F - Restroom F122 Men's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The grab bar extends 23 inches past the centerline of the water closet on the open side.

Resolution

Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418301





Barrier ID: AX418302

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.1
Barrier Detail	The side grab bar at the water closet is not compliant.
Location Description	Building F - Restroom F122 Men's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The side grab bar extends 52 inches from the rear wall.

Resolution

Remove and install a compliant side grab bar. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418302





Barrier ID: AX418304

Pasadena High School BUILDING F

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building F - Restroom F122 Men's
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is 12 1/2 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418304







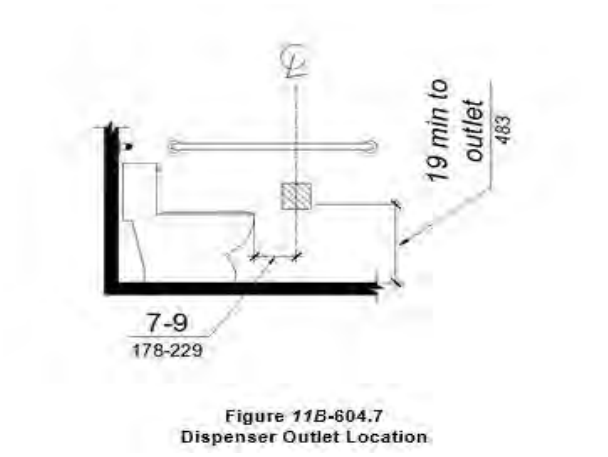


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX419721

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	609.3

Barrier Detail

The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".

Location Description	Building H East End - 1st Floor Restroom Boys
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The grab bar has 5/8 of an inch clearance below to the toilet paper dispenser.

Resolution

Move the projecting object below or at the ends of the grab bar to a minimum of 1-1/2" from the grab bar. [EXCEPTION: The space between grab bars and shower controls, shower fittings, and other grab bars above shall be permitted to be 1-1/2" minimum.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419721





Barrier ID: AX419727

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 609.3
Barrier Detail	CALIFORNIA: The disposal unit at the water closet is not compliant.
Location Description	Building H East End - 1st Floor Restroom Girls
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The disposal unit is not located between the rear wall and the toilet paper dispenser.

Resolution

Replace the existing disposal unit at the water closet with a compliant disposal unit. Sanitary disposal units, if provided, shall comply with requirements for operable parts, shall be wall mounted and located on the sidewall between the rear wall of the toilet and the toilet paper dispenser, adjacent to the toilet paper dispenser. The disposal unit shall be located below the grab bar with the opening of the disposal unit 19 inches minimum above the finish floor. Sanitary disposal units shall comply. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419727


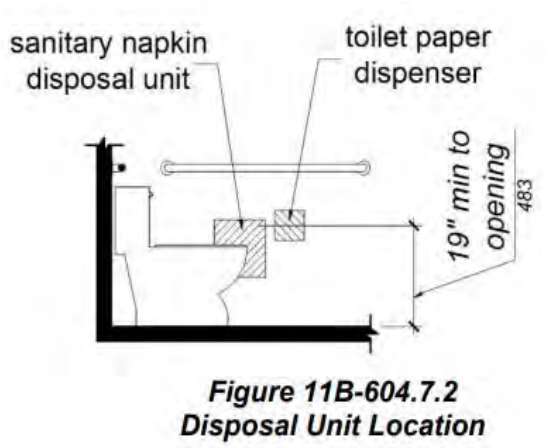


Figure 11B-604.7.2
Disposal Unit Location

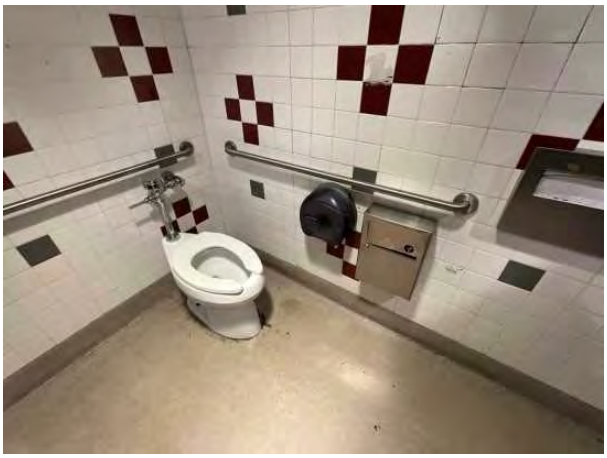

Barrier ID: AX419728

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building H East End - 1st Floor Restroom Girls
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered 5 3/8 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419728



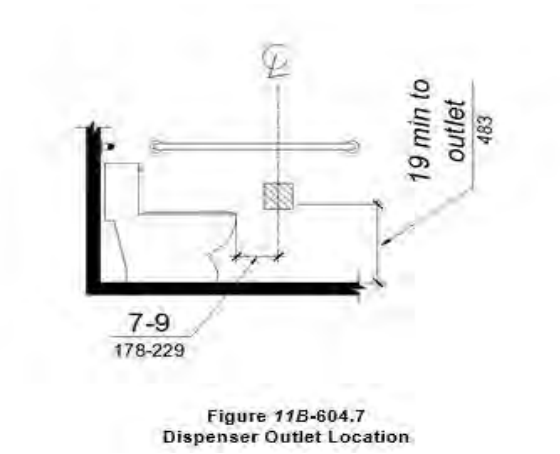


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX419743

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building H East End - 1st Floor Restroom Men's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 18 1/2 inches from the sidewall

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419743





Barrier ID: AX419744

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building H East End - 1st Floor Restroom Men's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The rear grab bar extends 23 inches past the centerline of the water closet on the open side.

Resolution

Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419744





Barrier ID: AX419745

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	609.3

Barrier Detail

The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".

Location Description	Building H East End - 1st Floor Restroom Men's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The grab bar clearance is 1 inch to the plumbing below.

Resolution

Move the projecting object below or at the ends of the grab bar to a minimum of 1-1/2" from the grab bar. [EXCEPTION: The space between grab bars and shower controls, shower fittings, and other grab bars above shall be permitted to be 1-1/2" minimum.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419745





Barrier ID: AX419746

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building H East End - 1st Floor Restroom Men's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is 13 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419746





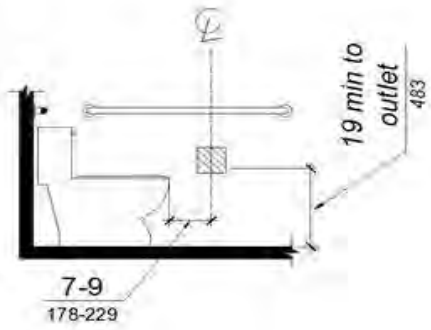


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX419751

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building H East End - 1st Floor Restroom Women's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is 12 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419751





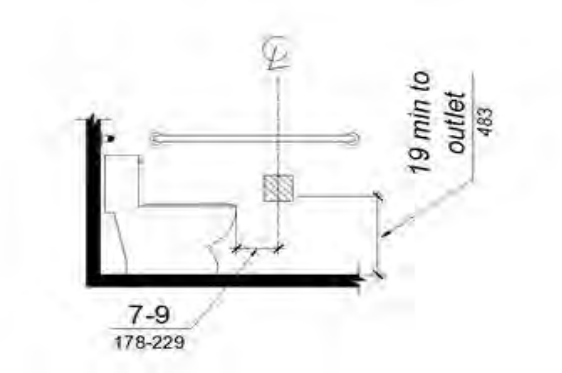


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX419752

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 609.3
Barrier Detail	CALIFORNIA: The disposal unit at the water closet is not compliant.
Location Description	Building H East End - 1st Floor Restroom Women's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The disposal unit is not located between the rear wall and the toilet paper dispenser.

Resolution

Replace the existing disposal unit at the water closet with a compliant disposal unit. Sanitary disposal units, if provided, shall comply with requirements for operable parts, shall be wall mounted and located on the sidewall between the rear wall of the toilet and the toilet paper dispenser, adjacent to the toilet paper dispenser. The disposal unit shall be located below the grab bar with the opening of the disposal unit 19 inches minimum above the finish floor. Sanitary disposal units shall comply. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419752

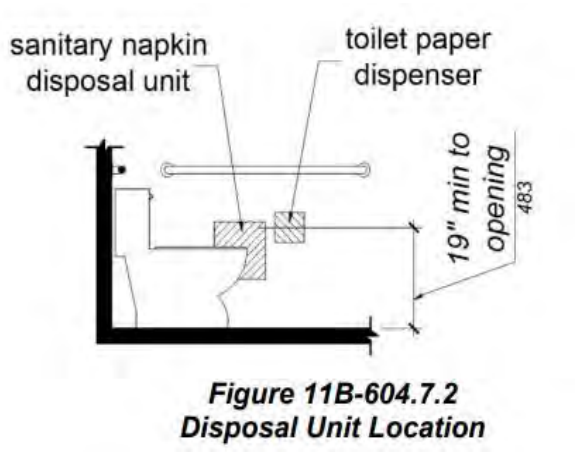


Figure 11B-604.7.2
Disposal Unit Location



Barrier ID: AX419734

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building H East End - 2nd Floor Restroom Boys
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered, 18 3/4 inches from the side wall.

Resolution


Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419734

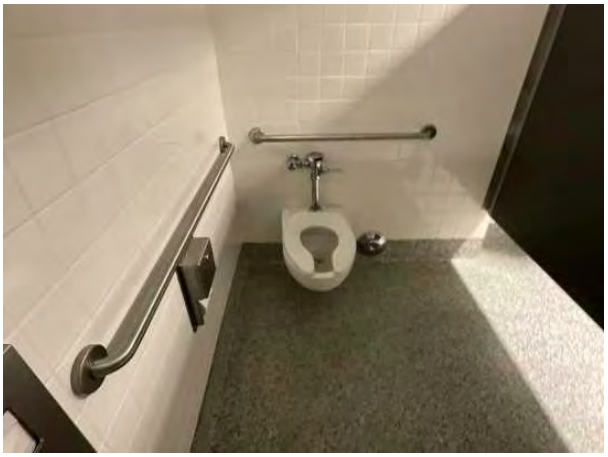



Barrier ID: AX419731

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building H East End - 2nd Floor Restroom Girls
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered 5 1/2 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419731





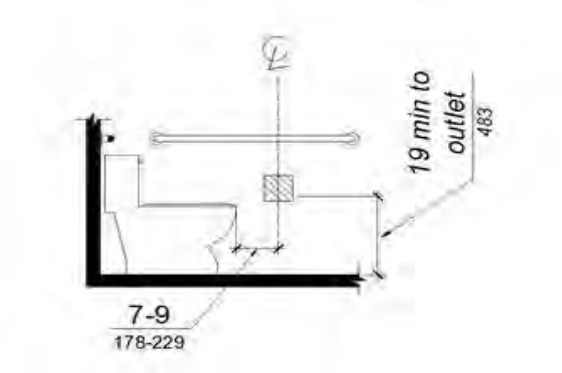


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX419769

Pasadena High School BUILDING I

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building I East End - 2nd Floor Restroom Girls
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered 5 1/2 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419769

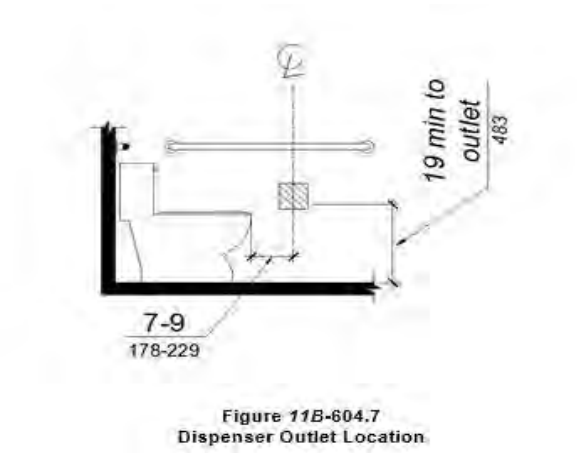


Figure *11B*-604.7
Dispenser Outlet Location





Barrier ID: AX419763

Pasadena High School BUILDING I

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building I East End - 2nd Floor Restroom Men's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered, 6 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419763



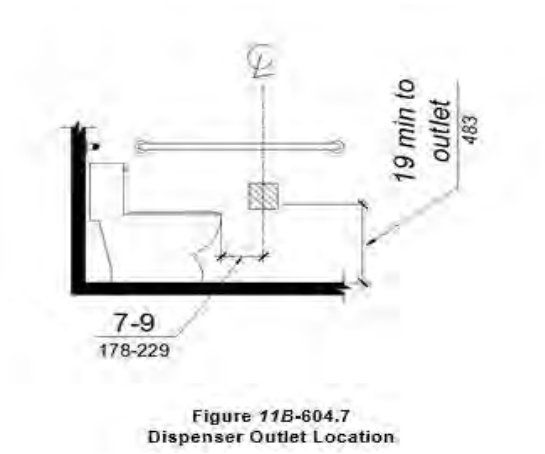


Figure *11B*-604.7
Dispenser Outlet Location



Barrier ID: AX419767

Pasadena High School BUILDING I

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building I East End - 2nd Floor Restroom Women's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 18 1/4 inches from the sidewall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419767







Barrier ID: AX418669

Pasadena High School BUILDING N

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.4

Barrier Detail

The height of the water closet is not 17" minimum to 19" maximum above finished floor.

Location Description	Building N - Restroom Women's Multi-User
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet seat height is 16 3/4 inches above above the floor.

Resolution

Remove and replace with a toilet that has a compliant seat height. The seat height of a water closet shall be 17" minimum and 19" maximum above the finish floor, measured to the top of the seat. Seats shall not be sprung to return to a lifted position. [EXCEPTIONS: 1. A water closet in a toilet room for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling units, the height of water closets shall be permitted to be 15" minimum and 19" maximum above the finish floor measured to the top of the seat.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418669





Barrier ID: AX418670

Pasadena High School BUILDING N

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building N - Restroom Women's Multi-User
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered 6 1/4 inches in front of the water closet.

Resolution


Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418670

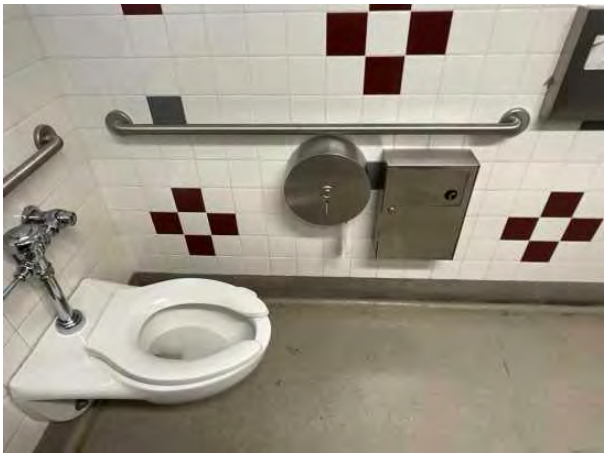



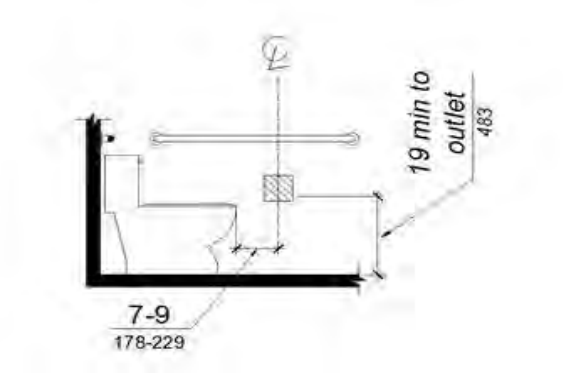


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX418671

Pasadena High School BUILDING N

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	609.3

Barrier Detail

The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".

Location Description	Building N - Restroom Women's Multi-User
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The clearance below the grab bar is 1 1/4 inch to the toilet paper dispenser.

Resolution

Move the projecting object below or at the ends of the grab bar to a minimum of 1-1/2" from the grab bar. [EXCEPTION: The space between grab bars and shower controls, shower fittings, and other grab bars above shall be permitted to be 1-1/2" minimum.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418671





Barrier ID: AX418672

Pasadena High School BUILDING N

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 609.3
Barrier Detail	CALIFORNIA: The disposal unit at the water closet is not compliant.
Location Description	Building N - Restroom Women's Multi-User
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The disposal unit is not between the rear wall and the toilet paper dispenser.

Resolution

Replace the existing disposal unit at the water closet with a compliant disposal unit. Sanitary disposal units, if provided, shall comply with requirements for operable parts, shall be wall mounted and located on the sidewall between the rear wall of the toilet and the toilet paper dispenser, adjacent to the toilet paper dispenser. The disposal unit shall be located below the grab bar with the opening of the disposal unit 19 inches minimum above the finish floor. Sanitary disposal units shall comply. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418672

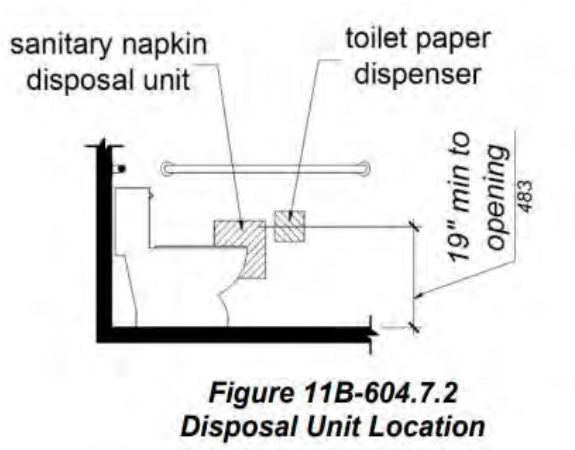


Figure 11B-604.7.2
Disposal Unit Location



Barrier ID: AX418657

Pasadena High School BUILDING P

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.4

Barrier Detail

The height of the water closet is not 17" minimum to 19" maximum above finished floor.

Location Description	Building P - Restroom Men's Multi-User
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet seat height is 16 and 58 inches above above the floor.

Resolution

Remove and replace with a toilet that has a compliant seat height. The seat height of a water closet shall be 17" minimum and 19" maximum above the finish floor, measured to the top of the seat. Seats shall not be sprung to return to a lifted position. [EXCEPTIONS: 1. A water closet in a toilet room for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling units, the height of water closets shall be permitted to be 15" minimum and 19" maximum above the finish floor measured to the top of the seat.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418657





Barrier ID: AX419876

Pasadena High School BUILDING R

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building R Restroom - Men's 104B
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered, 18 3/8 from the sidewall.

Resolution


Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419876

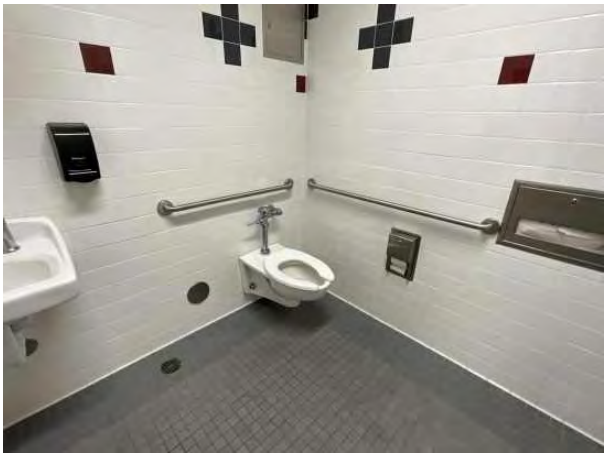



Barrier ID: AX419791

Pasadena High School BUILDING R

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building R - Restroom Men's R105
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered, 18 3/4 inches from the sidewall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419791





Barrier ID: AX419792

Pasadena High School BUILDING R

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.1
Barrier Detail	The side grab bar at the water closet is not compliant.
Location Description	Building R - Restroom Men's R105
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The side grab bar extends 51 inches from the rear wall.

Resolution

Remove and install a compliant side grab bar. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419792





Barrier ID: AX419786

Pasadena High School BUILDING R

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building R - Restroom Women's R105A
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 18 1/4 inches from the side wall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419786



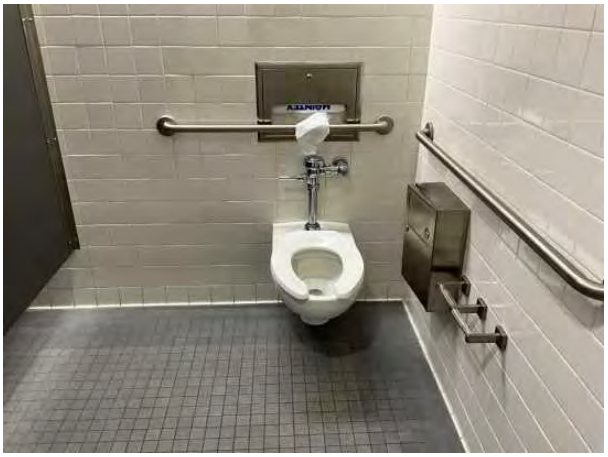

Barrier ID: AX419787

Pasadena High School BUILDING R

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	609.3

Barrier Detail

The space between the grab bar and the wall is greater than or less than 1-1/2".

Location Description	Building R - Restroom Women's R105A
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The clearance behind the grab bar is 1 3/8 inches to the seat cover dispenser.

Resolution

Provide a grab bar which creates a space 1-1/2" between the bar and the wall.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419787





Barrier ID: AX419894

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building S - Girls Restroom Pool Side
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 19 inches from the side wall.

Resolution


Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419894

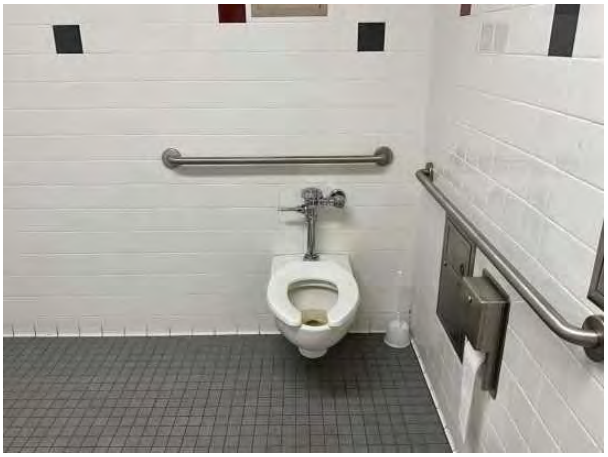



Barrier ID: AX419895

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building S - Girls Restroom Pool Side
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered 9 1/4 in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419895



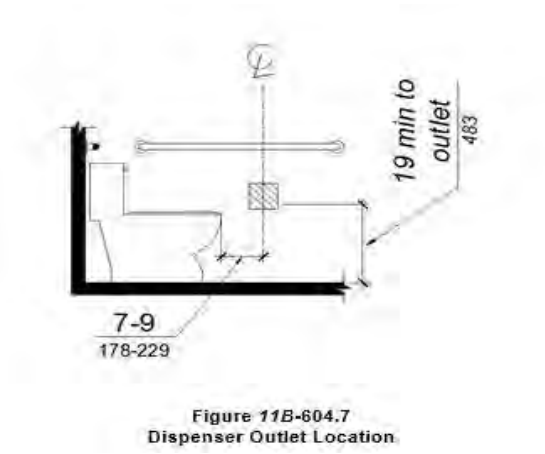


Figure *11B*-604.7
Dispenser Outlet Location



Barrier ID: AX419809

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building S - Restroom Men's S105
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 18 1/2 inches from the sidewall.

Resolution


Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419809

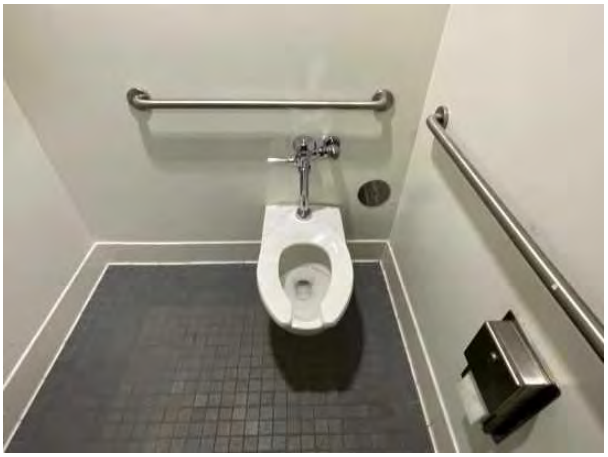



Barrier ID: AX419810

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.4

Barrier Detail

The height of the water closet is not 17" minimum to 19" maximum above finished floor.

Location Description	Building S - Restroom Men's S105
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet seat is 16 1/2 inches above the floor.

Resolution

Remove and replace with a toilet that has a compliant seat height. The seat height of a water closet shall be 17" minimum and 19" maximum above the finish floor, measured to the top of the seat. Seats shall not be sprung to return to a lifted position. [EXCEPTIONS: 1. A water closet in a toilet room for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling units, the height of water closets shall be permitted to be 15" minimum and 19" maximum above the finish floor measured to the top of the seat.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419810





Barrier ID: AX419882

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building S - S112 Restroom Boys Locker Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered 9 1/4 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419882

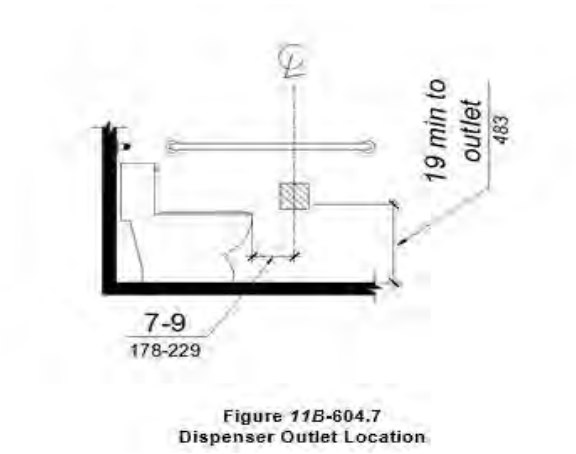


Figure *11B*-604.7
Dispenser Outlet Location







Barrier ID: AX419893

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building S - S128 A Men's Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is 9 1/2 inches in front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419893

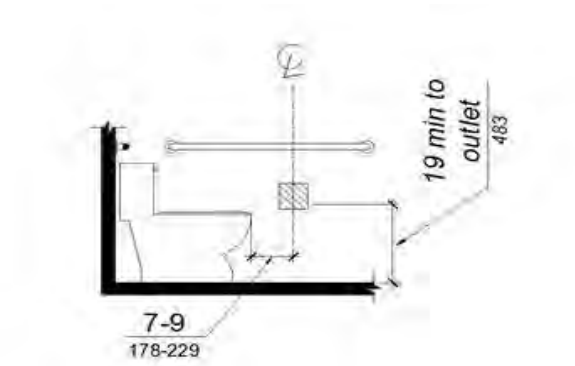


Figure *11B*-604.7
Dispenser Outlet Location





Barrier ID: AX419901

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building S - S130 Faculty Locker Room
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is centered 10 inches in front of water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419901


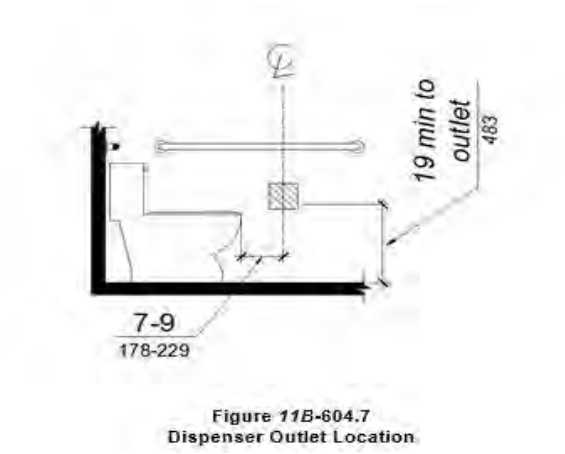


Figure *11B*-604.7
Dispenser Outlet Location





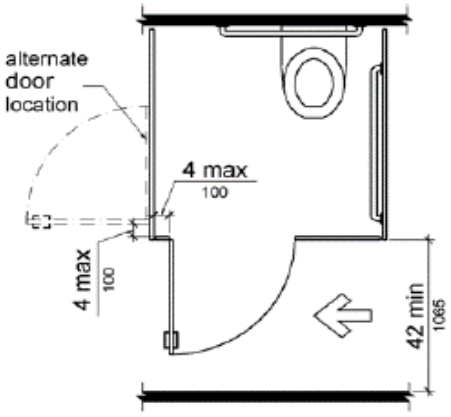

Barrier ID: AX420126

Pasadena High School BUILDING T

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	609.3

Barrier Detail

The space between the grab bar and the wall is greater than or less than 1-1/2".

Location Description	Building T - T110 Restroom Boys
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The seat cover dispenser behind the grab bar is obstructing the 1 1/2 inch clearance behind the grab bar to 1 1/4 inch.

Resolution


Provide a grab bar which creates a space 1-1/2" between the bar and the wall.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420126

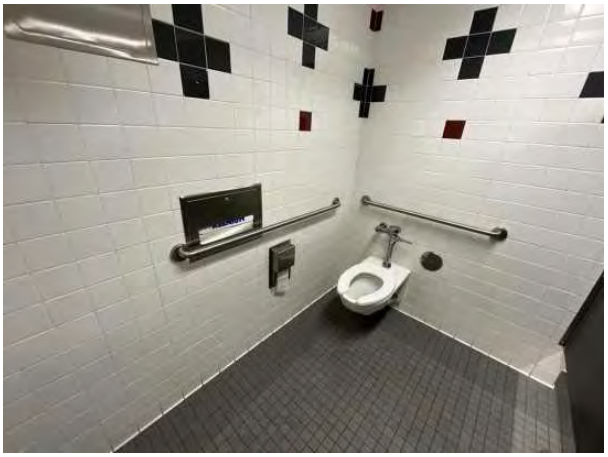





Barrier ID: AX420129

Pasadena High School BUILDING T

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building T - T111 Restroom Girls
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered 18 1/2 inches from the sidewall.

Resolution

Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420129



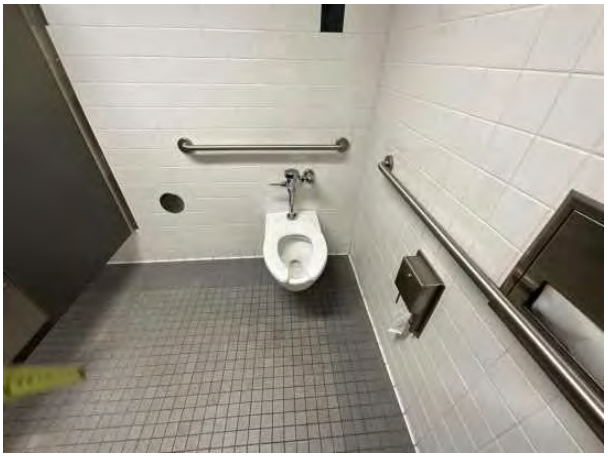

Barrier ID: AX420130

Pasadena High School BUILDING T

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	609.3

Barrier Detail

The space between the grab bar and the wall is greater than or less than 1-1/2".

Location Description	Building T - T111 Restroom Girls
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The seat cover dispenser behind the grab bar is obstructing the 1 1/2 inch clearance behind the grab bar to 1 5/16 inch.

Resolution

Provide a grab bar which creates a space 1-1/2" between the bar and the wall.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420130





Barrier ID: AX420131

Pasadena High School BUILDING T

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 609.3
Barrier Detail	CALIFORNIA: The disposal unit at the water closet is not compliant.
Location Description	Building T - T111 Restroom Girls
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The disposal unit is not located between the rear wall and the toilet paper dispenser.

Resolution

Replace the existing disposal unit at the water closet with a compliant disposal unit. Sanitary disposal units, if provided, shall comply with requirements for operable parts, shall be wall mounted and located on the sidewall between the rear wall of the toilet and the toilet paper dispenser, adjacent to the toilet paper dispenser. The disposal unit shall be located below the grab bar with the opening of the disposal unit 19 inches minimum above the finish floor. Sanitary disposal units shall comply. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420131


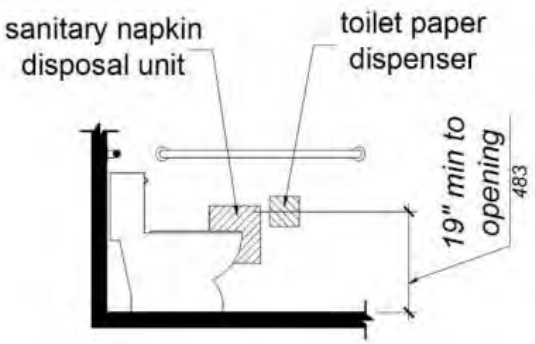


Figure 11B-604.7.2
Disposal Unit Location



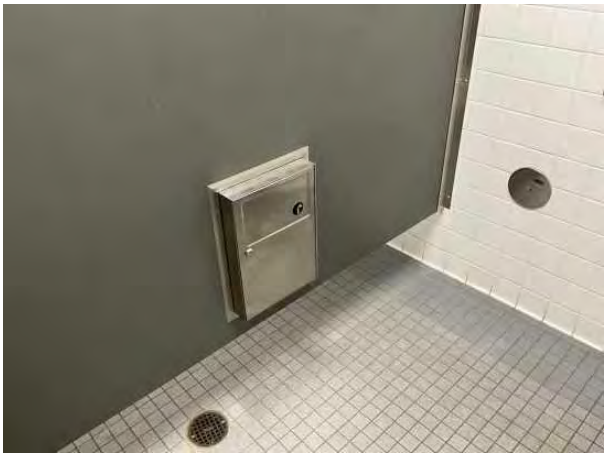

Barrier ID: AX424544

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet is centered, 31 inches from the side wall.

Resolution


Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. This barrier must be removed in conjunction with barrier ID 424556. The cost of this barrier removal is covered under ID 424556 and therefore, the cost of this ID is shown as $0. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424544

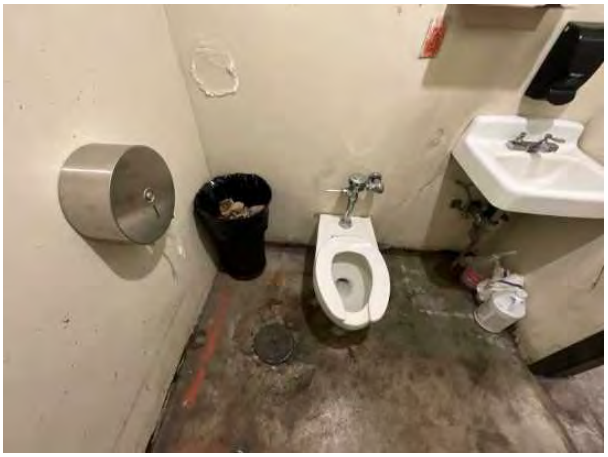



Barrier ID: AX424545

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.4

Barrier Detail

The height of the water closet is not 17" minimum to 19" maximum above finished floor.

Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet seat height is 14 1/4 inches high.

Resolution

Remove and replace with a toilet that has a compliant seat height. The seat height of a water closet shall be 17" minimum and 19" maximum above the finish floor, measured to the top of the seat. This barrier must be removed in conjunction with barrier ID 424556. The cost of this barrier removal is covered under ID 424556 and therefore, the cost of this ID is shown as $0. Seats shall not be sprung to return to a lifted position. [EXCEPTIONS: 1. A water closet in a toilet room for a single occupant accessed only through a private office and not for common use or public use shall not be required to comply. 2. In residential dwelling units, the height of water closets shall be permitted to be 15" minimum and 19" maximum above the finish floor measured to the top of the seat.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424545





Barrier ID: AX424546

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The grab bars at the water closet are not compliant.
Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	Grab bars are not provided.

Resolution


Remove and install compliant grab bars. Grab bars shall be installed in a horizontal position at height of 33" minimum to 36" maximum above the finish floor, measured to the top of the gripping surface. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on one side and 24" minimum on the other side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424546

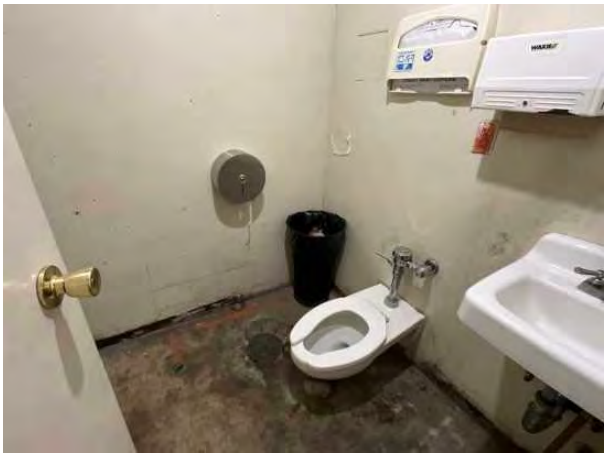

Barrier ID: AX424547

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is behind the front of the water closet.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424547


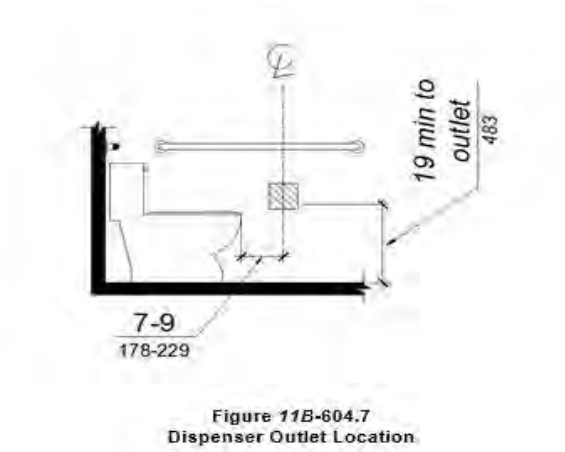


Figure *11B*-604.7
Dispenser Outlet Location

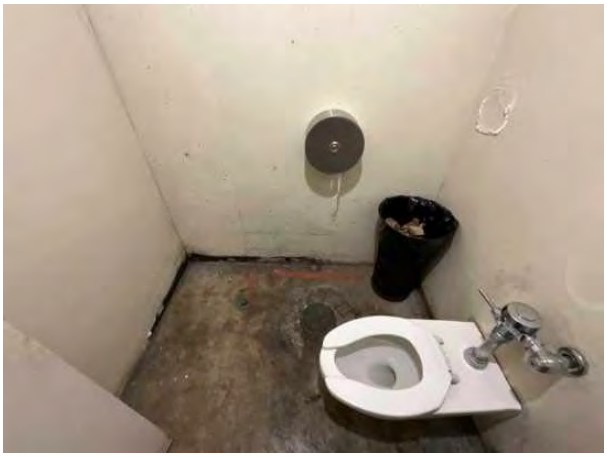

Barrier ID: AX420177

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Portable Trailer Restoom Boy's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is not mounted in the correct location.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420177

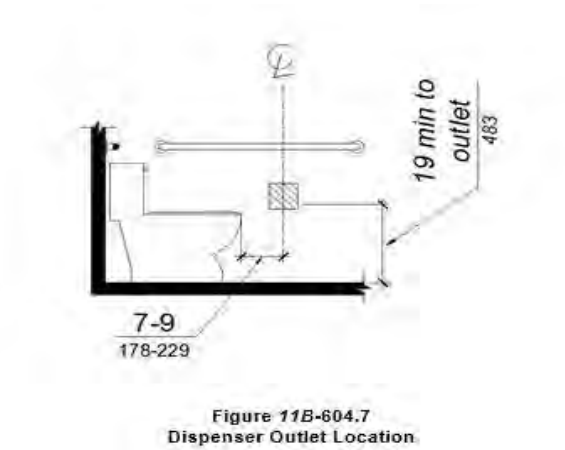


Figure *11B*-604.7
Dispenser Outlet Location



Barrier ID: AX420187

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	609.3

Barrier Detail

The space between the grab bar and projecting objects below and at the ends of the bar is less than 1-1/2".

Location Description	Portable Trailer Restoom Girl's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The clearance below the grab bar is 1 3/4 inch to the plumbing.

Resolution

Move the projecting object below or at the ends of the grab bar to a minimum of 1-1/2" from the grab bar. [EXCEPTION: The space between grab bars and shower controls, shower fittings, and other grab bars above shall be permitted to be 1-1/2" minimum.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420187





Barrier ID: AX420189

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 604.9, 609.3
Barrier Detail	CALIFORNIA: The toilet paper dispenser is not compliant.
Location Description	Portable Trailer Restoom Girl's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet paper dispenser is not in the correct location.

Resolution

Provide a compliant toilet paper dispenser. Toilet paper dispensers shall be 7" minimum and 9" maximum in front of the water closet, measured to the centerline of the dispenser. The outlet of the dispenser shall be below the grab bar and 19" minimum above the finish floor. The toilet paper dispenser shall not be located behind grab bars. The top of projecting toilet paper dispensers shall be located 1-1/2" minimum below the grab bar. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"]. Toilet paper dispensers and sanitary napkin disposal units shall comply with Section 11B-604.7. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420189





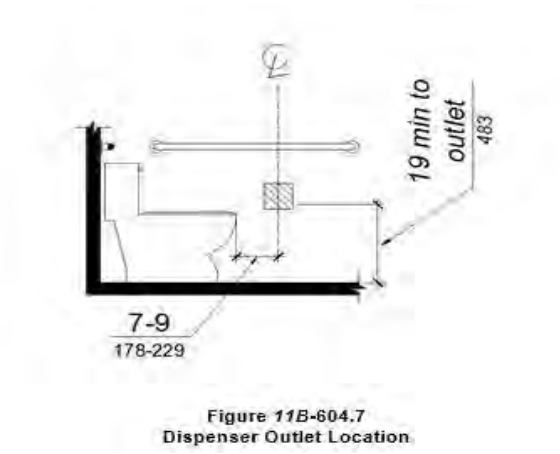


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX420190

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.7, 609.3
Barrier Detail	CALIFORNIA: The disposal unit at the water closet is not compliant.
Location Description	Portable Trailer Restoom Girl's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The disposal unit is not in the correct location between the rear wall and the toilet paper dispenser.

Resolution

Replace the existing disposal unit at the water closet with a compliant disposal unit. Sanitary disposal units, if provided, shall comply with requirements for operable parts, shall be wall mounted and located on the sidewall between the rear wall of the toilet and the toilet paper dispenser, adjacent to the toilet paper dispenser. The disposal unit shall be located below the grab bar with the opening of the disposal unit 19 inches minimum above the finish floor. Sanitary disposal units shall comply. Combination accessory units are not permitted to encroach into the space required for grab bars.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420190


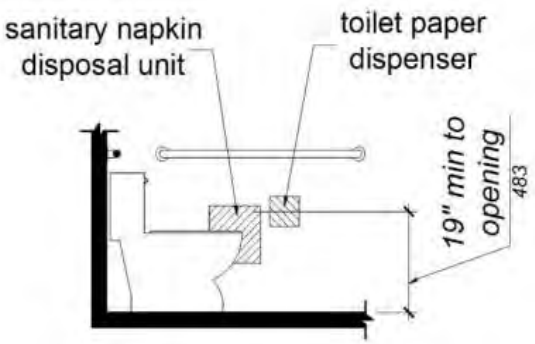


Figure 11B-604.7.2
Disposal Unit Location



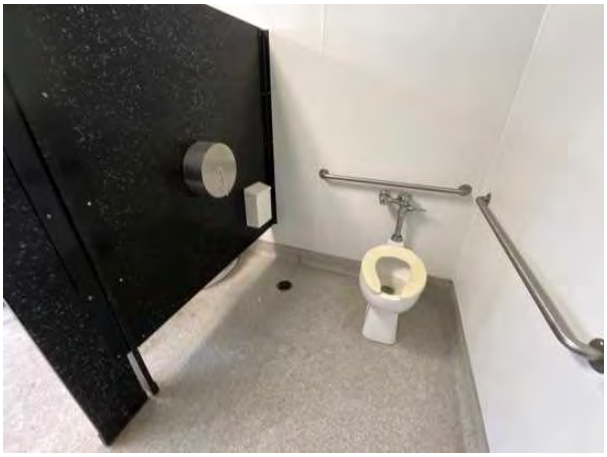

Barrier ID: AX420160

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B-604.3

Barrier Detail

CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.

Location Description	Portable Trailer Restoom Staff
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The toilet is centered 19 1/2 inches from the side wall.

Resolution


Provide a water closet with centerline 17" minimum to 18" maximum from the side wall or partition. The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition in a wheelchair stall. Water closets shall be arranged for a left-hand or right-hand approach. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420160

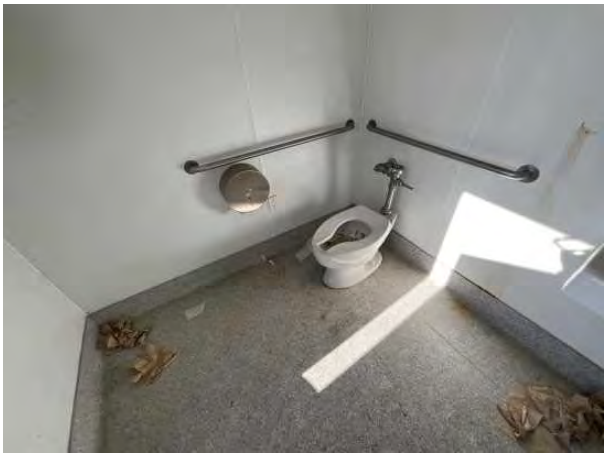



Barrier ID: AX420161

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	CBC Chap 11B- 604.3.1 and 3.2
Barrier Detail	CALIFORNIA- The water closet does not have the required clear floor space.
Location Description	Portable Trailer Restoom Staff
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet clearance is 52 3/4 inches wide to the lavatory.

Resolution

Redesign to ensure that the water closet has the minimum required clear floor space. The water closet shall be positioned with a wall or partition to the rear and to one side. Clearance around a water closet shall be 60" minimum measured perpendicular from the side wall and 56" minimum measured perpendicular from the rear wall. A minimum 60" wide and 48' deep maneuvering space shall be provided in front of the water closet. [Exception: In residential dwelling units required to be mobility accessible, maneuvering space in front of the water closet shall be a minimum 60" wide and 36" deep.] The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition, Water closets shall be arranged for a left-hand or right-hand approach, with the flush on the open side. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions shall be located within the required water closet clearance. [Exception: In residential dwelling units, a lavatory shall be permitted on the rear wall 18" minimum from the water closet centerline where the clearance at the water closet is 66" minimum measured perpendicular from the rear wall.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420161



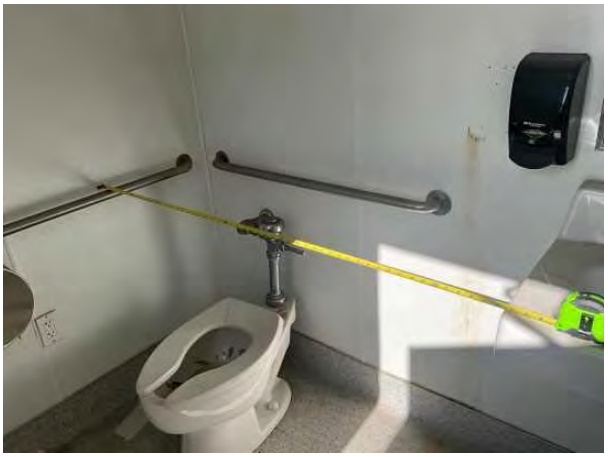

Barrier ID: AX420162

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Portable Trailer Restoom Staff
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The rear grab bar extends 22 1/2 inches past the centerline of the water closet on the open side.

Resolution


Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420162

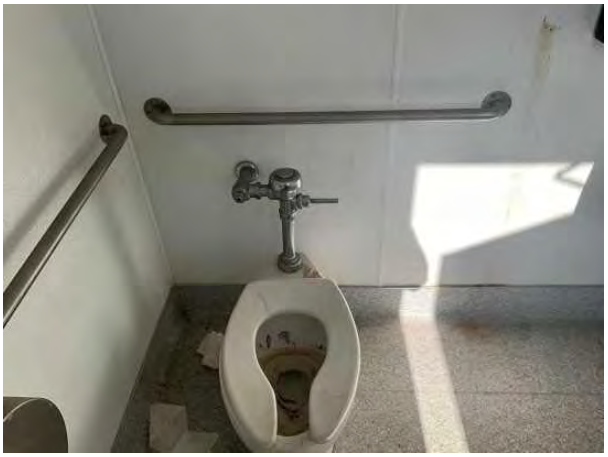



Barrier ID: AX420163

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom - Water Closet
ADA Standard	604.5.1
Barrier Detail	The side grab bar at the water closet is not compliant.
Location Description	Portable Trailer Restroom Staff
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The side grab bar extends 46 inches from the rear wall and 18 inches past the front of the water closet.

Resolution


Remove and install a compliant side grab bar. The side wall grab bar shall be 42" long minimum, located 12" maximum from the rear wall and extending 54" minimum from the rear wall. Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420163

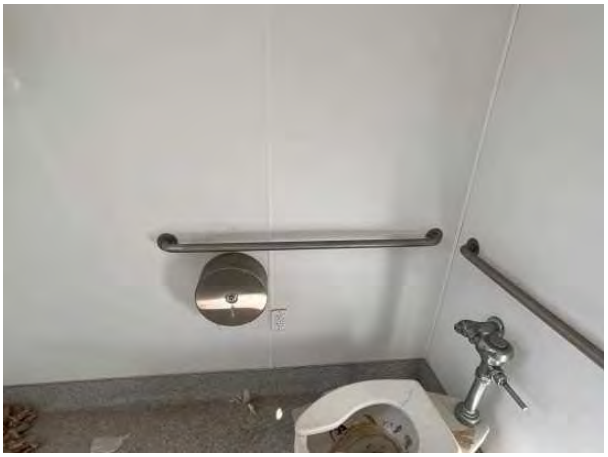







Barrier ID: AX424541

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom-Door

ADA Standard

CBC Chap 11B-309, 404.2.7; State Fire Marshall Referenced Standard Section 12-10-202(f)

Barrier Detail	CALIFORNIA: The hardware at the accessible door is not compliant.
Location Description	Building U - U107 Unisex Restroom
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The door has knob type hardware

Resolution

Remove hardware and replace with hardware that has a shape that is easy to grasp such as lever, push-type or U-shaped handles. Handles, pulls, latches, locks, and other operable parts on doors and gates shall be compliant. Operable parts of such hardware shall be 34" minimum and 44" maximum above the finish floor or ground. Where sliding doors are in the fully open position, operating hardware shall be exposed and usable from both sides. [EXCEPTIONS: 1. Existing locks shall be permitted in any location at existing glazed doors without stiles, existing overhead rolling doors or grilles, and similar existing doors or grilles that are designed with locks that are activated only at the top or bottom rail. 2. Access gates in barrier walls and fences protecting pools, spas, and hot tubs shall be permitted to have operable parts of the release of latch on self-latching devices at 54" maximum above the finish floor or ground provided the self-latching devices are not also self-locking devices and operated by means of a key, electronic opener, or integral combination lock.] [Advisory 404.2.7 Door and gate hardware. Door hardware that can be operated with a closed fist or a loose grip accommodates the greatest range of users. Hardware that requires simultaneous hand and finger movements require greater dexterity and coordination, and is not recommended.] Lever hardware of lever actuated latches or locks shall be curved with a return to within 1/2 inch of the door. [Advisory 11B-404.2.7 Door and gate hardware. In addition to the requirements of this section, designers should be aware of the Part 12, Section 12-10-202(f) requirement for lever hardware as adopted by the State Fire Marshal. The lever of lever actuated latches or locks must be curved with a return to within ½ inch of the door to prevent catching on the clothing of persons during egress.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424541



Barrier ID: AX419724

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom-Lavatory
ADA Standard	606.4

Barrier Detail

The automatic faucet, when activated, does not remain on for minimum 10 seconds.

Location Description	Building H East End - 1st Floor Restroom Boys
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispenser control is 43 1/2 inches above the floor.

Resolution


Replace faucets with compliant handles. Hand-operated metering faucets shall remain open for 10 seconds minimum. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419724

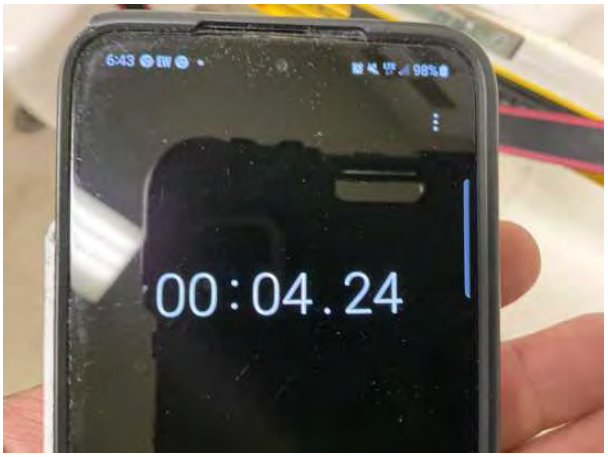





Barrier ID: AX420165

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom-Lavatory
ADA Standard	213.3.4, 606.5
Barrier Detail	Pipes are not insulated.
Location Description	Portable Trailer Restoom Staff
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The pipes are not insulated.

Resolution

Insulate water supply and drain pipes under the accessible lavatory. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. Pipes under lavatories and sinks shall be free from sharp or abrasive surfaces. A minimum of one lavatory in a multi-lavatory restroom shall be a compliant lavatory.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420165



Barrier ID: AX419812

Pasadena High School BUILDING S

Assembly	Restroom
Type	Restroom/Bathroom-Locker
ADA Standard	225.21
Barrier Detail	The locker area does not have accessible lockers.
Location Description	Building S - Restroom Men's S105
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The bottom shelf is 7 inches above the floor and the top shelf is 65 1/2 inches above the floor. The lowest cold hook is 61 inches above the floor. 18 total lockers are provided one accessible lockers required.

Resolution

Provide a minimum of 5% of the total number of lockers as designated accessible lockers, or at least one locker, which are accessible. Accessible lockers have clear space of 30" minimum by 48" minimum centered on the locker. Accessible lockers have operable parts that can be operated with one hand, and do not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds maximum. SHELVES AND COAT HOOKS: Accessible lockers have shelves and clothing hooks within at least one of the allowable reach ranges for a forward or side approach. A minimum of one shelf shall be 40" minimum and 48" maximum above the finish floor or ground. Hooks shall be within an allowable reach range. [ADVISORY for Children's Forward or Side Reach Ranges: High reach (maximum): 36" for ages 3 to 4; 40" for ages 5 to 8; and 44" for ages 9 to 12. Low reach (minimum): 20" for ages 3 to 4; 18" for ages 5 to 8; and 16" for ages 9 to 12.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419812









Barrier ID: AX424450

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom-Mirror
ADA Standard	213.3.5; 603.3

Barrier Detail

The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.

Location Description	Building A - A101B Restroom Unisex
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The mirror is 54 inches above the floor.

Resolution

Remove and lower the mirror to a compliant height. Where mirrors are provided, at least one shall comply. Mirrors located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 40" maximum above the finish floor or ground. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35" maximum above the finish floor or ground. [ADVISORY: A single full-length mirror can accommodate a greater number of people, including children. In order for mirrors to be usable by people who are ambulatory and people who use wheelchairs, the top edge of mirrors should be 74" minimum from the floor or ground.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424450





Barrier ID: AX418704

Pasadena High School BUILDING V

Assembly	Restroom
Type	Restroom/Bathroom-Mirror
ADA Standard	213.3.5; 603.3

Barrier Detail

The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.

Location Description	Building V- V115 Restroom Staff
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The mirror bottom reflective edge is 50 1/2 inches above the floor.

Resolution

Remove and lower the mirror to a compliant height. Where mirrors are provided, at least one shall comply. Mirrors located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 40" maximum above the finish floor or ground. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35" maximum above the finish floor or ground. [ADVISORY: A single full-length mirror can accommodate a greater number of people, including children. In order for mirrors to be usable by people who are ambulatory and people who use wheelchairs, the top edge of mirrors should be 74" minimum from the floor or ground.]

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418704





Barrier ID: AX420246

Pasadena High School BUILDING E

Assembly	Restroom
Type	Restroom/Bathroom-Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The men's restroom does not have compliant signage at the door.

Location Description	Building E - 1st Floor Restroom Boy's
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The geometric sign is centered, 62 1/2 inches above the floor.

Resolution

Install compliant signage. The men's restroom/bathing room geometric symbol shall be an equilateral triangle 1/4" thick, with edges 12" long and a vertex pointing upward. The triangle shall contrast with the door or doorway, either light on dark or dark on light. Each doorway leading to men's restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: Signs with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420246





Barrier ID: AX419765

Pasadena High School BUILDING I

Assembly	Restroom
Type	Restroom/Bathroom-Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The women's restroom does not have compliant signage at the door.

Location Description	Building I East End - 2nd Floor Restroom Women's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The door does not provide the required geometric door sign for Women.

Resolution

Install compliant signage at the restroom entrance. Women’s toilet and bathing facilities shall be identified by a circle, ¼ inch thick and 12 inches in diameter. The circle symbol shall contrast with the door, either light on a dark background or dark on a light background. Each doorway leading to restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating women's shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: SIgns with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419765



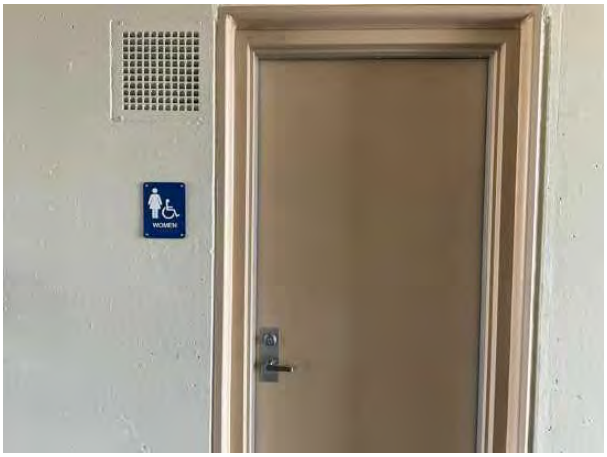

Barrier ID: AX418654

Pasadena High School BUILDING P

Assembly	Restroom
Type	Restroom/Bathroom-Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The men's restroom does not have compliant signage at the door.

Location Description	Building P - Restroom Men's Multi-User
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The men's door sign is not compliant.

Resolution

Install compliant signage. The men's restroom/bathing room geometric symbol shall be an equilateral triangle 1/4" thick, with edges 12" long and a vertex pointing upward. The triangle shall contrast with the door or doorway, either light on dark or dark on light. Each doorway leading to men's restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: Signs with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418654



Barrier ID: AX425253

Pasadena High School BUILDING V

Assembly	Restroom
Type	Restroom/Bathroom-Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The unisex restroom does not have compliant signage at the door.

Location Description	Building V- V115 Restroom Staff
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The geometric sign is not a compliant restroom door sign for a unisex restroom. The circle does not contrast with the triangle.

Resolution

Install compliant signage at the restroom entrances. Unisex toilet and bathing facilities shall be identified by a circle, ¼" thick and 12" in diameter with a ¼" thick triangle with a vertex pointing upward superimposed on the circle and within the 12" diameter. The triangle symbol shall contrast with the circle symbol, either light on a dark background or dark on a light background. The circle symbol shall contrast with the door, either light on a dark background or dark on a light background. Each doorway leading to restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's, women's or unisex shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: SIgns with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX425253





Barrier ID: AX420158

Pasadena High School SPORTS FACILITIES

Assembly	Restroom
Type	Restroom/Bathroom-Signage
ADA Standard	ADA 703.4.2; CBC 216.2, 703.1, 703.2, 703.5

Barrier Detail

CALIFORNIA: The unisex restroom does not have compliant signage at the door.

Location Description	Portable Trailer Restoom Staff
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The staff restroom does not provide a unisex room, identification sign

Resolution


Install compliant signage at the restroom entrances. Unisex toilet and bathing facilities shall be identified by a circle, ¼" thick and 12" in diameter with a ¼" thick triangle with a vertex pointing upward superimposed on the circle and within the 12" diameter. The triangle symbol shall contrast with the circle symbol, either light on a dark background or dark on a light background. The circle symbol shall contrast with the door, either light on a dark background or dark on a light background. Each doorway leading to restrooms and bathing rooms shall have a geometric symbol mounted min. 58"-max. 60" above finish floor or ground, measured to the centerline of the symbol. Where a door is provided, the geometric symbol sign shall be located within 1" of the vertical centerline of the door. The edges of the geometric symbol signs shall be rounded, chafered, or eased. The corners of the geometric sign shall have minimum 1/8" radius. Compliant signage with the International Symbol of Accessibility (ISA) and tactile characters indicating men's, women's or unisex shall be provided. The ISA shall be a white figure on a blue background. The blue shall be Color #15090 in Federal Standard 595B. [EXCEPTION: The enforcing agency may approve other colors of light-on-dark or dark-on-light contrast.] Signage with the International Symbol of Accessibility and Braille shall be located on the latch side of the doorway [EXCEPTION: SIgns with tactile characters are permitted on the push sides of doors with closers and without hold-open devices]. Clear space of 18" minimum by 18" minimum shall be provided at the centerline of the tactile characters; the centerline of the tactile characters shall be minimum 9" distance outside of door swing. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Raised characters shall be complaint and shall be duplicated in Braille. Raised characters shall be as follows: Depth. Raised characters shall be 1/32" minimum above their background. Case - Characters shall be uppercase. Style- Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions - Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height- Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX420158

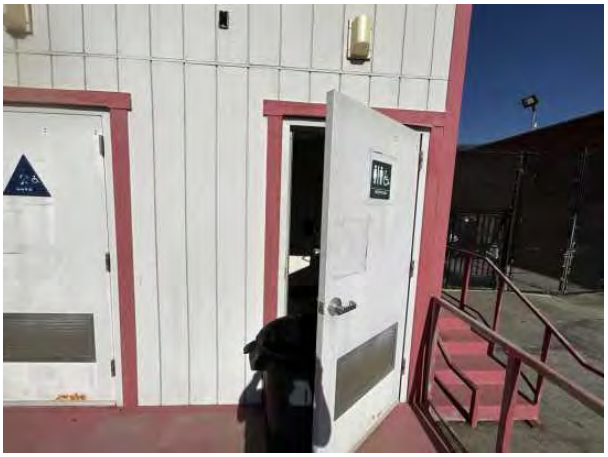

Barrier ID: AX419741

Pasadena High School BUILDING H

Assembly	Restroom
Type	Restroom/Bathroom-Toilet Stall
ADA Standard	309, 404.2.7, 604.8.1.2
Barrier Detail	The wheelchair stall door is not compliant.
Location Description	Building H East End - 1st Floor Restroom Men's
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The door is not self-closing. The door does not provide a pull handle on the push side.

Resolution


Toilet compartment doors for wheelchair stalls, including door hardware, shall comply except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42" minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4" maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4" maximum from the front partition. The door shall be self-closing. A compliant door pull shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area, 60" wide minimum measured perpendicular to the side wall, and 56" deep minimum for a wall hung water closet or 59" deep minimum for a floor mounted water closet measured perpendicular to the rear wall.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX419741

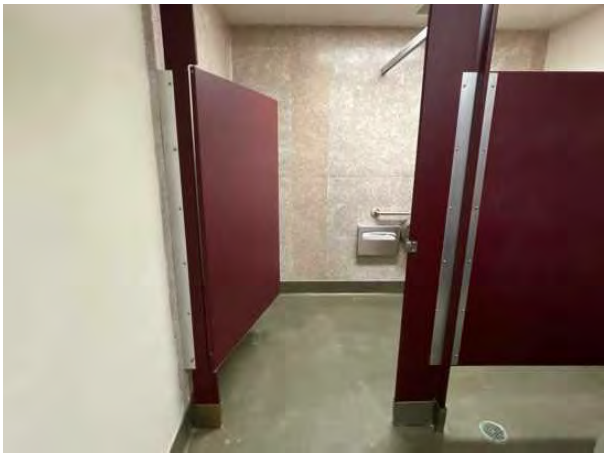


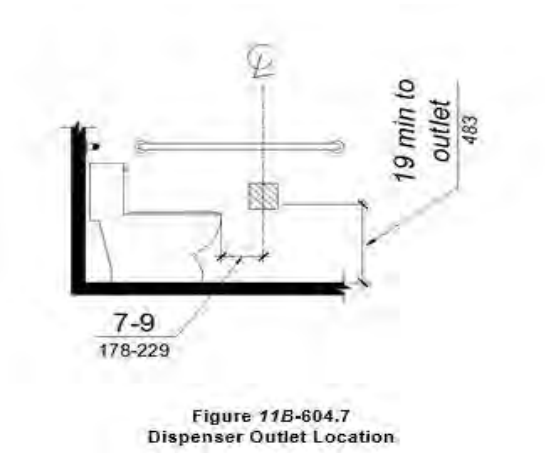


Figure *11B*-604.7
Dispenser Outlet Location



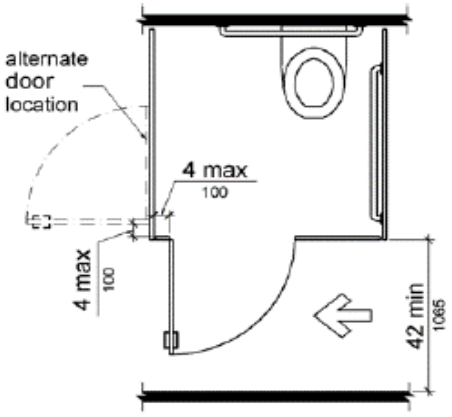

Barrier ID: AX424403

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom-Urinal
ADA Standard	213.3.3, 605.2
Barrier Detail	The urinal dimensions are not compliant.
Location Description	Building A - A253B Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The urinal rim is 18 3/4 inches above the floor.

Resolution

Replace or relocate the urinal. Urinals shall be the stall-type or the wall-hung type. Wall-hung urinals shall be installed with the rim 17" maximum above the finish floor or ground. Urinals shall be 13-1/2" deep minimum measured from the outer face of the urinal rim to the back of the fixture. Flush controls shall be hand operated or automatic. Flush controls shall be within allowable reach ranges.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424403

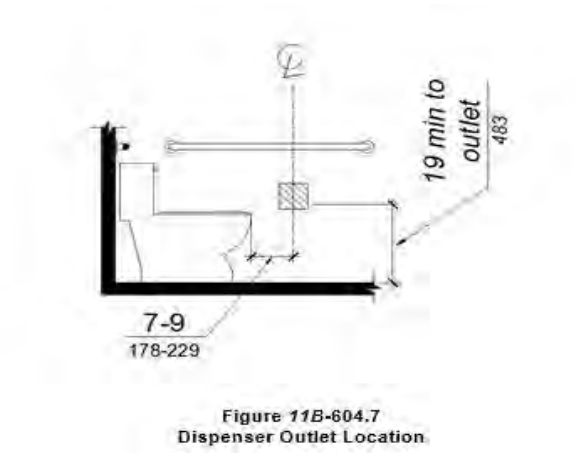


Figure *11B*-604.7
Dispenser Outlet Location





Barrier ID: AX424442

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom-Water Closet
ADA Standard	CBC Chap 11B- 604.3.1 and 3.2
Barrier Detail	CALIFORNIA- The water closet does not have the required clear floor space.
Location Description	Building A - A101B Restroom Unisex
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The water closet clearance is 33 inches wide from the sidewall to the furniture.

Resolution

Redesign to ensure that the water closet has the minimum required clear floor space. The water closet shall be positioned with a wall or partition to the rear and to one side. Clearance around a water closet shall be 60" minimum measured perpendicular from the side wall and 56" minimum measured perpendicular from the rear wall. A minimum 60" wide and 48' deep maneuvering space shall be provided in front of the water closet. [Exception: In residential dwelling units required to be mobility accessible, maneuvering space in front of the water closet shall be a minimum 60" wide and 36" deep.] The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition, Water closets shall be arranged for a left-hand or right-hand approach, with the flush on the open side. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions shall be located within the required water closet clearance. [Exception: In residential dwelling units, a lavatory shall be permitted on the rear wall 18" minimum from the water closet centerline where the clearance at the water closet is 66" minimum measured perpendicular from the rear wall.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424442





Barrier ID: AX424397

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom-Water Closet
ADA Standard	CBC Chap 11B-604.8.1.1

Barrier Detail

CALIFORNIA: The wheelchair stall with in-swinging door does not have the required dimensions.

Location Description	Building A - A253B Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The wheelchair stall is 57 3/4 inches wide to the partition support.

Resolution

Provide a wheelchair stall of compliant dimensions for an in-swinging door: minimum 60" width and minimum 92" depth for a wall hung closet and minimum 95" depth for a floor mounted water closet. For an in-swinging compartment door, additional maneuvering clearance minimum 60" wide by minimum 36" deep must be provided outside of the required clearance around the water closet of 60" minimum wide by 56" or 59" minimum deep. Clearance at the water closet shall be minimum 59" depth from the rear wall for a floor mounted water closet and minimum 56" depth for a wall hung water closet. The 60" minimum wide by 36" minimum deep maneuvering clearance overlaps the required 60" minimum wide by 48" minimum deep clearance required at the front of all water closets.


Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424397



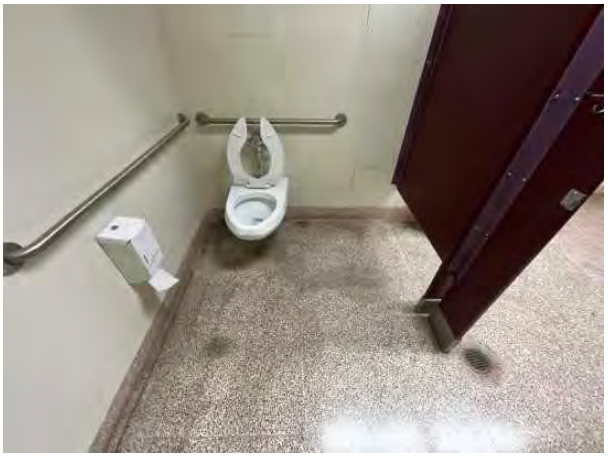

Barrier ID: AX424400

Pasadena High School BUILDING A

Assembly	Restroom
Type	Restroom/Bathroom-Water Closet
ADA Standard	604.5.2
Barrier Detail	The rear grab bar at the water closet is not compliant.
Location Description	Building A - A253B Restroom Men's
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The rear grab bar extends 22 inches past the centerline of the water closet on the open side.

Resolution

Remove and install a compliant rear grab bar. The rear wall grab bar shall be 36" long minimum and extend from the centerline of the water closet 12" minimum on the closed side and 24" minimum on the open side. [EXCEPTIONS: 1. The rear grab bar shall be permitted to be 24" long minimum, centered on the water closet, where wall space does not permit a length of 36" minimum due to the location of a recessed fixture adjacent to the water closet. 2. Where an administrative authority requires flush controls for flush valves to be located in a position that conflicts with the location of the rear grab bar, then the rear grab bar shall be permitted to be split or shifted to the open side of the toilet area.] Grab bars shall be installed in a horizontal position, 33" minimum and 36" maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use, grab bars shall be installed in a horizontal position 18" minimum and 27" maximum above the finish floor measured to the top of the gripping surface. A continuous grab bar is allowable in lieu of rear and side grab bars. [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424400





Barrier ID: AX424549

Pasadena High School BUILDING U

Assembly	Restroom
Type	Restroom/Bathroom-Water Closet
ADA Standard	CBC Chap 11B- 604.3.1 and 3.2
Barrier Detail	CALIFORNIA- The water closet does not have the required clear floor space.
Location Description	Building U - U107 Unisex Restroom
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water closet clearance in front is 35 1/4 inches to the wall.

Resolution

Redesign to ensure that the water closet has the minimum required clear floor space. This barrier must be removed in conjunction with barrier ID 424556. The cost of this barrier removal is covered under ID 424556 and therefore, the cost of this ID is shown as $0. The water closet shall be positioned with a wall or partition to the rear and to one side. Clearance around a water closet shall be 60" minimum measured perpendicular from the side wall and 56" minimum measured perpendicular from the rear wall. A minimum 60" wide and 48' deep maneuvering space shall be provided in front of the water closet. [Exception: In residential dwelling units required to be mobility accessible, maneuvering space in front of the water closet shall be a minimum 60" wide and 36" deep.] The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition, Water closets shall be arranged for a left-hand or right-hand approach, with the flush on the open side. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions shall be located within the required water closet clearance. [Exception: In residential dwelling units, a lavatory shall be permitted on the rear wall 18" minimum from the water closet centerline where the clearance at the water closet is 66" minimum measured perpendicular from the rear wall.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX424549



Barrier ID: AX419738

Pasadena High School BUILDING H

Assembly	Kitchen
Type	Sink
ADA Standard	CBC Chap 11B-606.2; 305

Barrier Detail

CALIFORNIA: The sink does not have the required clear floor space of minimum 30" by minimum 48" for a forward approach with knee and toe clearance.

Location Description	Building H - Classrooms With EyeWash / Shower
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The emergency eyewash and shower is non-compliant. The shower pull handle is 52 1/2 inches above the floor and the eyewash is 36 inches above the floor. The eyewash station does not provide knee and toe clearance.

Resolution

Relocate the lavatory to provide minimum 30" by minimum 48" clear floor space positioned for a forward approach to the lavatory. Compliant knee and toe clearance shall be provided. [EXCEPTIONS: 2. A lavatory in a toilet room or bathing facility for a single occupant accessed only through a private office and not for common use or public use shall not be required to provide knee and toe clearance. 3. In residential dwelling units, cabinetry shall be permitted under lavatories and kitchen sinks provided that all of the following conditions are met: (a) the cabinetry can be removed without removal or replacement of the fixture; (b) the finish floor extends under the cabinetry; and (c) the walls behind and surrounding the cabinetry are finished. 4. A knee clearance of 24" minimum above the finish floor or ground shall be permitted at lavatories and sinks used primarily by children 6 through 12 years where the rim or counter surface is 31" maximum above the finish floor or ground. 5. A parallel approach complying with 305 shall be permitted to lavatories and sinks used primarily by children 5 years and younger. 6. The dip of the overflow shall not be considered in determining knee and toe clearances. 7. No more than one bowl of a multi-bowl sink shall be required to provide knee and toe clearance.] Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance and shall comply. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Floor or ground surfaces of a clear floor or ground space shall comply with 302. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] Unless otherwise specified, clear floor or ground space shall be permitted to include compliant clear space. Unless otherwise specified, clear floor or ground space shall be positioned for either forward or parallel approach to an element. One full unobstructed side of the clear floor or ground space shall adjoin an accessible route or adjoin another clear floor or ground space. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided. Alcoves shall be 36" wide minimum where the depth exceeds 24". Alcoves shall be 60" wide minimum where the depth exceeds 15". Where the accessible sink is located adjacent a side partition or wall, the sink shall be minimum 18" from the side partition/wall to centerline of sink


Quantity

2 EA


Priority	3

Photos for Barrier ID: AX419738



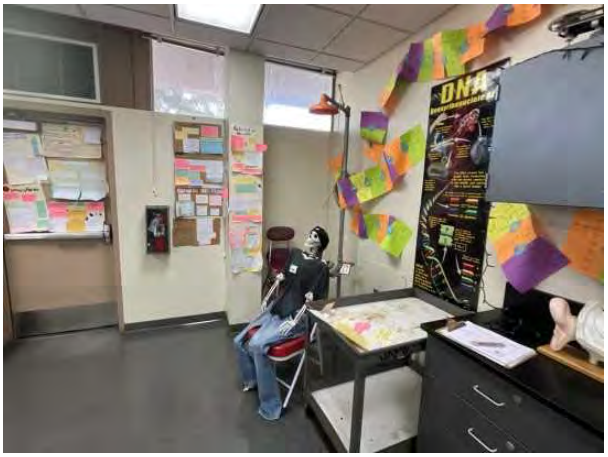



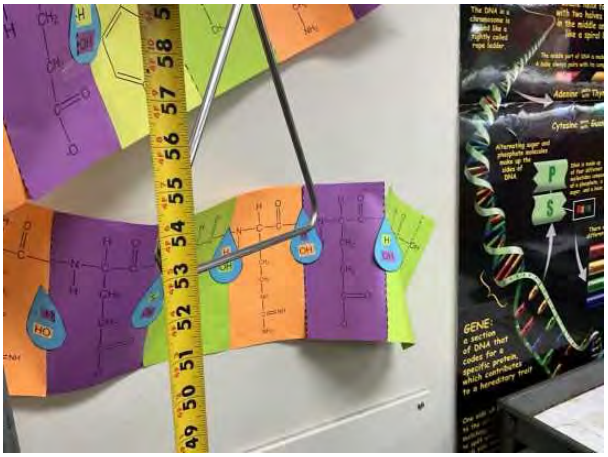



Barrier ID: AX418644

Pasadena High School BUILDING Q

Assembly	Interior Access Route
Type	Sink
ADA Standard	606.4; 309
Barrier Detail	The lavatory faucet hardware is not compliant.
Location Description	Building Q - Q103B
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The sinks have foot controls.

Resolution

Provide push/lever hardware for the faucet. Replace faucet operating hardware with compliant handles. Operable parts, such as faucet hardware, shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds (22.2 N) maximum. Hand-operated metering faucets shall remain open for 10 seconds minimum. Provide a minimum of one accessible sink with push/lever hardware.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418644





Barrier ID: AX418650

Pasadena High School BUILDING Q

Assembly	Interior Access Route
Type	Sink
ADA Standard	213.3.4, 606.5
Barrier Detail	Pipes are not insulated.
Location Description	Building Q - Q109A
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The sink pipes are not insulated or sleeved.

Resolution

Insulate water supply and drain pipes under the accessible lavatory. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. Pipes under lavatories and sinks shall be free from sharp or abrasive surfaces. A minimum of one lavatory in a multi-lavatory restroom shall be a compliant lavatory.

Quantity

1 EA

Priority	3

Photos for Barrier ID: AX418650



Barrier ID: AX419853

Pasadena High School BUILDING B

Assembly	Accessible Route
Type	Controls And Dispensers
ADA Standard	CBC Chap 11B-308.1
Barrier Detail	CALIFORNIA: The location of electrical controls and outlets are not compliant.
Location Description	Building B - B112 Boys Dressing
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The top of the electrical box is 49 1/2 inches above the floor.

Resolution

Relocate the electrical control or electrical outlet to a compliant location. Electrical switches: Controls and switches intended to be used by the occupant of a room or area to control lighting and receptacle outlets, appliances or cooling, heating and ventilating equipment, shall comply with reach range requirements except the low reach shall be measured to the bottom of the outlet box and the high reach shall be measured to the top of the outlet box. Electrical receptacle outlets: Electrical receptacle outlets on branch circuits of 30 amperes or less and communication system receptacles shall comply with reach range requirements except the low reach shall be measured to the bottom of the outlet box and the high reach shall be measured to the top of the outlet box. Unobstructed Forward Reach; Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground. Obstructed High Forward Reach: Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches maximum where the reach depth is 20 inches maximum. Where the reach depth exceeds 20 inches, the high forward reach shall be 44 inches maximum and the reach depth shall be 25 inches maximum. Unobstructed Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. [EXCEPTIONS: 1. An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10 inches maximum. 2. Operable parts of fuel dispensers shall be permitted to be 54 inches maximum measured from the surface of the vehicular way where fuel dispensers are installed on existing curbs.] Obstructed High Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches maximum and the depth of the obstruction shall be 24 inches maximum. The high side reach shall be 48 inches maximum for a reach depth of 10 inches maximum. Where the reach depth exceeds 10 inches, the high side reach shall be 46 inches maximum for a reach depth of 24 inches maximum. [EXCEPTIONS: 1. The top of washing machines and clothes dryers shall be permitted to be 36 inches maximum above the finish floor. 2. Operable parts of fuel dispensers shall be permitted to be 54 inches maximum measured from the surface of the vehicular way where fuel dispensers are installed on existing curbs.]

Quantity

1 EA

Priority	4

Photos for Barrier ID: AX419853





Barrier ID: AX418383

Pasadena High School BUILDING D

Assembly	Accessible Route
Type	Controls And Dispensers
ADA Standard	CBC Chap 11B-308.1
Barrier Detail	CALIFORNIA: The location of electrical controls and outlets are not compliant.
Location Description	Building D - Restroom D102A Men
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The light switch is 50 inches above the floor.

Resolution

Relocate the electrical control or electrical outlet to a compliant location. Electrical switches: Controls and switches intended to be used by the occupant of a room or area to control lighting and receptacle outlets, appliances or cooling, heating and ventilating equipment, shall comply with reach range requirements except the low reach shall be measured to the bottom of the outlet box and the high reach shall be measured to the top of the outlet box. Electrical receptacle outlets: Electrical receptacle outlets on branch circuits of 30 amperes or less and communication system receptacles shall comply with reach range requirements except the low reach shall be measured to the bottom of the outlet box and the high reach shall be measured to the top of the outlet box. Unobstructed Forward Reach; Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground. Obstructed High Forward Reach: Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches maximum where the reach depth is 20 inches maximum. Where the reach depth exceeds 20 inches, the high forward reach shall be 44 inches maximum and the reach depth shall be 25 inches maximum. Unobstructed Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. [EXCEPTIONS: 1. An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10 inches maximum. 2. Operable parts of fuel dispensers shall be permitted to be 54 inches maximum measured from the surface of the vehicular way where fuel dispensers are installed on existing curbs.] Obstructed High Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches maximum and the depth of the obstruction shall be 24 inches maximum. The high side reach shall be 48 inches maximum for a reach depth of 10 inches maximum. Where the reach depth exceeds 10 inches, the high side reach shall be 46 inches maximum for a reach depth of 24 inches maximum. [EXCEPTIONS: 1. The top of washing machines and clothes dryers shall be permitted to be 36 inches maximum above the finish floor. 2. Operable parts of fuel dispensers shall be permitted to be 54 inches maximum measured from the surface of the vehicular way where fuel dispensers are installed on existing curbs.]

Quantity

1 EA

Priority	4

Photos for Barrier ID: AX418383



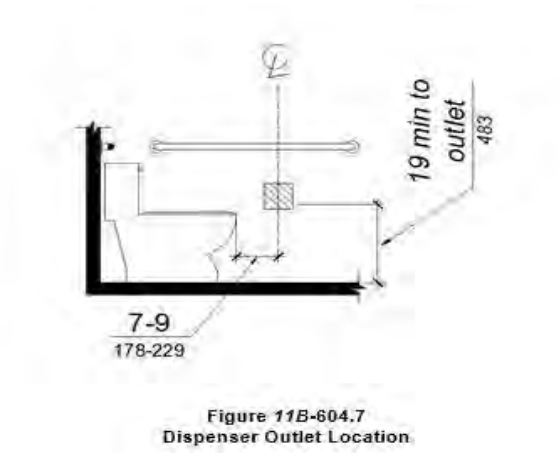


Figure *11B*-604.7
Dispenser Outlet Location

Barrier ID: AX418270

Pasadena High School CAMPUS-WIDE RECURRING BARRIERS

Assembly	Accessible Route
Type	Controls And Dispensers
ADA Standard	CBC Chap 11B-308.1
Barrier Detail	CALIFORNIA: The location of electrical controls and outlets are not compliant.
Location Description	Typical Light Switches Too High Throughout Campus
Observed	Dec 4, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

Light switches throughout the campus are 49 to 57 above the floor measured to the top out the outlet box. Approximately... Building A has 19. Building B has 5. Building C has 9. Building D has 8. Building E has 39. Building G has 37. Building H has 38. Building I has 36. Building N has 4. Building P has 6. Building Q has 10. Building R has 1. Building T has 3. Building V has 9. Building W has 10.

Resolution

Relocate the electrical control or electrical outlet to a compliant location. Electrical switches: Controls and switches intended to be used by the occupant of a room or area to control lighting and receptacle outlets, appliances or cooling, heating and ventilating equipment, shall comply with reach range requirements except the low reach shall be measured to the bottom of the outlet box and the high reach shall be measured to the top of the outlet box. Electrical receptacle outlets: Electrical receptacle outlets on branch circuits of 30 amperes or less and communication system receptacles shall comply with reach range requirements except the low reach shall be measured to the bottom of the outlet box and the high reach shall be measured to the top of the outlet box. Unobstructed Forward Reach; Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground. Obstructed High Forward Reach: Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches maximum where the reach depth is 20 inches maximum. Where the reach depth exceeds 20 inches, the high forward reach shall be 44 inches maximum and the reach depth shall be 25 inches maximum. Unobstructed Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. [EXCEPTIONS: 1. An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10 inches maximum. 2. Operable parts of fuel dispensers shall be permitted to be 54 inches maximum measured from the surface of the vehicular way where fuel dispensers are installed on existing curbs.] Obstructed High Side Reach: Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches maximum and the depth of the obstruction shall be 24 inches maximum. The high side reach shall be 48 inches maximum for a reach depth of 10 inches maximum. Where the reach depth exceeds 10 inches, the high side reach shall be 46 inches maximum for a reach depth of 24 inches maximum. [EXCEPTIONS: 1. The top of washing machines and clothes dryers shall be permitted to be 36 inches maximum above the finish floor. 2. Operable parts of fuel dispensers shall be permitted to be 54 inches maximum measured from the surface of the vehicular way where fuel dispensers are installed on existing curbs.]

Quantity

234 EA


Priority	4	1329

Photos for Barrier ID: AX418270







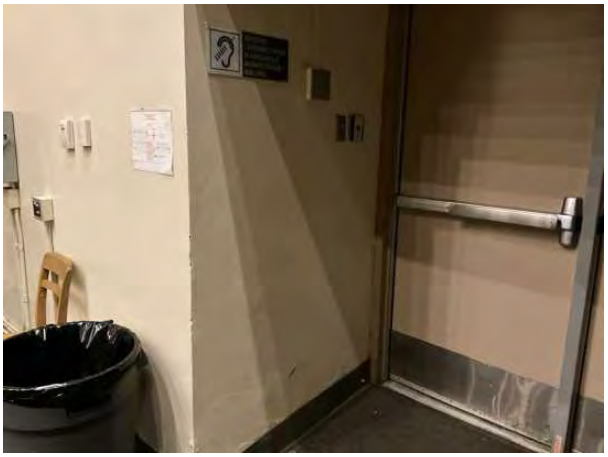



Barrier ID: AX419836

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Door
ADA Standard	304
Barrier Detail	A compliant turning space is not provided.
Location Description	Building E - E102
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The dark room with sink is not accessible.

Resolution

Provide a level turning space 60" minimum by 60" minimum or a T-shaped space within a 60" square minimum with arms and base 36" wide minimum. A circular turning space shall have a 60" minimum diameter. A T-shaped turning space shall be within a 60" square minimum with arms and base 36" wide minimum. Each arm of the T shall be clear of obstructions 12" minimum in each direction and the base shall be clear of obstructions 24" minimum. The space shall be permitted to include knee and toe clearance only at the end of either the base or one arm. The floor surface of a turning space shall be level. Changes in level are not permitted. [EXCEPTION: Slopes not steeper than 1:48 shall be permitted.] The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

100 SF

Priority	4

Photos for Barrier ID: AX419836







Barrier ID: AX418237

Pasadena High School BUILDING B

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	306.3, 602.2
Barrier Detail	Knee and toe clearance is not provided at the lower level fountain.
Location Description	Auditorium Foyer
Observed	Dec 3, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The low drinking fountain knee clearance extends 26 3/4 inches above the floor.

Resolution


Relocate or replace the lower level unit to provide knee and toe clearance. Lower level units shall have a clear floor or ground space minimum 30" by minimum 48" positioned for a forward approach, with the 30" dimension centered on the unit. Knee and toe clearance shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.] For a parallel approach, the 48" dimension shall be centered on the unit. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.


Quantity

1 EA

Priority	4

Photos for Barrier ID: AX418237

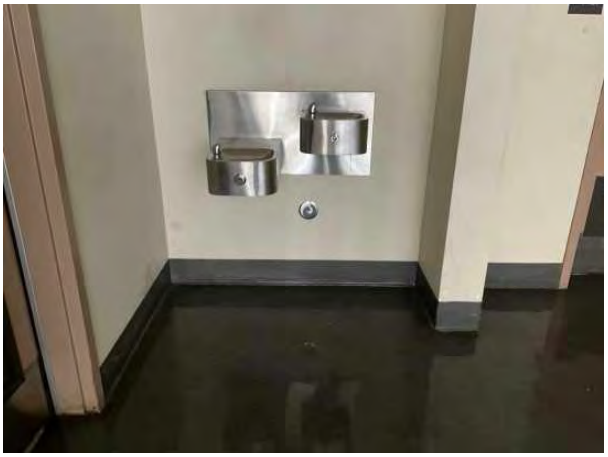

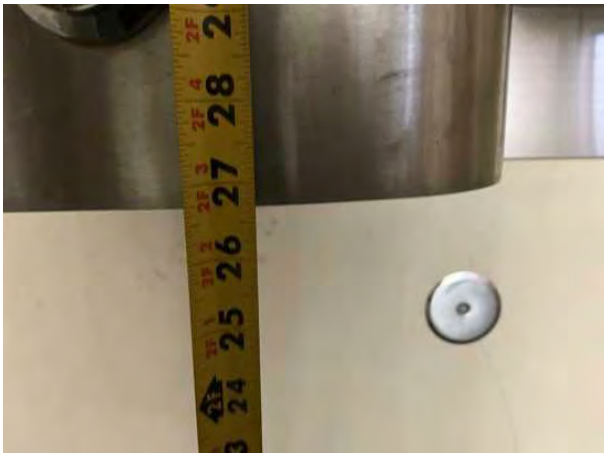

Barrier ID: AX424431

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	602.2, 602.5

Barrier Detail

The spout and/or water flow of the lower level drinking fountain is not compliant.

Location Description	Building A - 1st Floor Drinking Fountain West Side
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water flow reaches half an inch high.

Resolution

Remove and replace with a lower level drinking fountain that has a spout located 5" maximum from the front edge of the fountain. The spout shall be located 15" minimum from the vertical support and 5" maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4" high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3" of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3" and 5" maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.]

Quantity

1 EA

Priority	4

Photos for Barrier ID: AX424431





Barrier ID: AX424427

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	306.3, 602.2
Barrier Detail	Knee and toe clearance is not provided at the lower level fountain.
Location Description	Building A - 2nd Floor Drinking Fountain East Side
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The knee clearance extends 26 7/8 inches above the floor.

Resolution

Relocate or replace the lower level unit to provide knee and toe clearance. Lower level units shall have a clear floor or ground space minimum 30" by minimum 48" positioned for a forward approach, with the 30" dimension centered on the unit. Knee and toe clearance shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.] For a parallel approach, the 48" dimension shall be centered on the unit. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

1 EA

Priority	4

Photos for Barrier ID: AX424427





Barrier ID: AX424433

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	602.2, 602.5

Barrier Detail

The spout and/or water flow of the lower level drinking fountain is not compliant.

Location Description	Building A - Hallway Near Elevator
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The display case protrudes 4 3/16 of an inch from the wall where the bottom edge is 45 1/4 inches above the floor.

Resolution

Remove and replace with a lower level drinking fountain that has a spout located 5" maximum from the front edge of the fountain. The spout shall be located 15" minimum from the vertical support and 5" maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4" high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3" of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3" and 5" maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.]

Quantity


1 EA

Priority	4

Photos for Barrier ID: AX424433





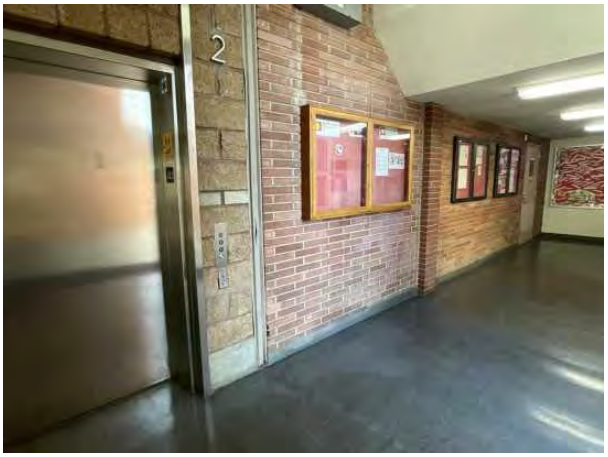

Barrier ID: AX419867

Pasadena High School BUILDING C

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	306.3, 602.2
Barrier Detail	Knee and toe clearance is not provided at the lower level fountain.
Location Description	Building C - Drinking Fountain Adjacent to C110
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The knee clearance extends 26 7/8 of an inch above the floor.

Resolution

Relocate or replace the lower level unit to provide knee and toe clearance. Lower level units shall have a clear floor or ground space minimum 30" by minimum 48" positioned for a forward approach, with the 30" dimension centered on the unit. Knee and toe clearance shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.] For a parallel approach, the 48" dimension shall be centered on the unit. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

1 EA

Priority	4

Photos for Barrier ID: AX419867





Barrier ID: AX419868

Pasadena High School BUILDING C

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	602.2, 602.5

Barrier Detail

The spout and/or water flow of the lower level drinking fountain is not compliant.

Location Description	Building C - Drinking Fountain Adjacent to C110
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The water flow extends 0 inches.

Resolution

Remove and replace with a lower level drinking fountain that has a spout located 5" maximum from the front edge of the fountain. The spout shall be located 15" minimum from the vertical support and 5" maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water 4" high minimum and shall be located 5" maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3" of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3" and 5" maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.]

Quantity

1 EA

Priority	4

Photos for Barrier ID: AX419868





Barrier ID: AX418369

Pasadena High School BUILDING D

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	306.3, 602.2
Barrier Detail	Knee and toe clearance is not provided at the lower level fountain.
Location Description	Building D - Drinking Fountain at D153
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The knee clearance extends 26 3/4 inches above the floor.

Resolution


Relocate or replace the lower level unit to provide knee and toe clearance. Lower level units shall have a clear floor or ground space minimum 30" by minimum 48" positioned for a forward approach, with the 30" dimension centered on the unit. Knee and toe clearance shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.] For a parallel approach, the 48" dimension shall be centered on the unit. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.


Quantity


1 EA

Priority	4

Photos for Barrier ID: AX418369

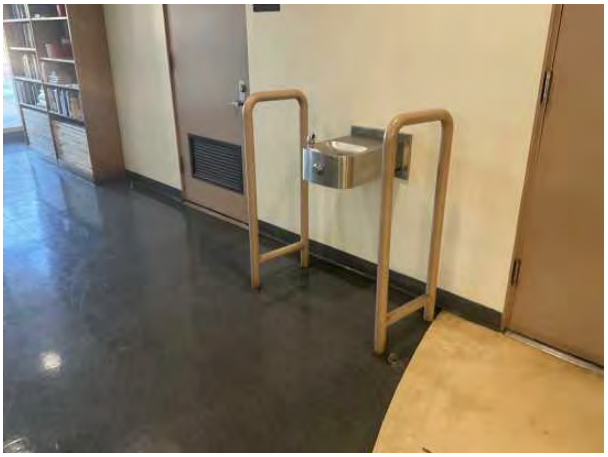

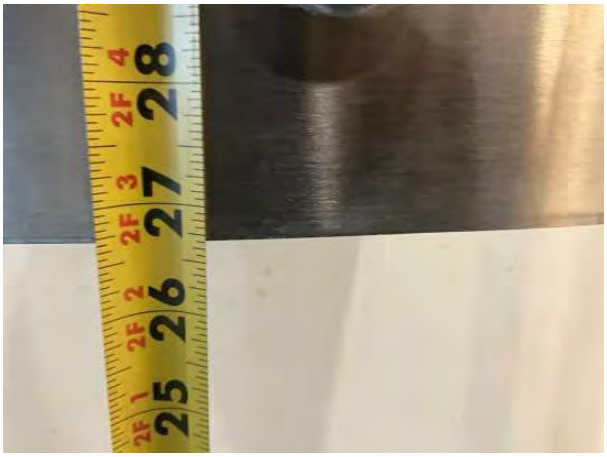

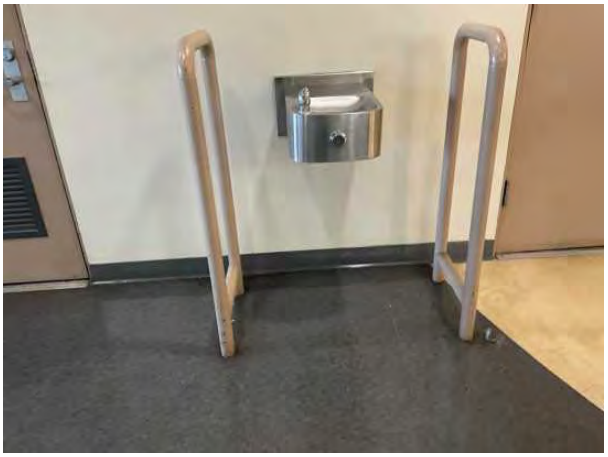

Barrier ID: AX420150

Pasadena High School BUILDING E

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	306.3, 602.2
Barrier Detail	Knee and toe clearance is not provided at the lower level fountain.
Location Description	Building E - Drinking Fountain SE Side
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The low drinking fountain knee clearance extends 26 and three-quarter inches above the floor.

Resolution


Relocate or replace the lower level unit to provide knee and toe clearance. Lower level units shall have a clear floor or ground space minimum 30" by minimum 48" positioned for a forward approach, with the 30" dimension centered on the unit. Knee and toe clearance shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.] For a parallel approach, the 48" dimension shall be centered on the unit. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

23 EA

Priority	4

Photos for Barrier ID: AX420150

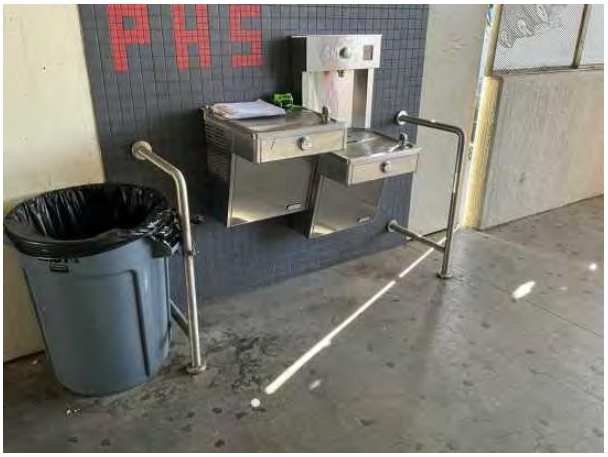



Barrier ID: AX419805

Pasadena High School BUILDING S

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	306.3, 602.2
Barrier Detail	Knee and toe clearance is not provided at the lower level fountain.
Location Description	Building S - Drinking Fountain Adjacent to S102
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The drinking fountain knee clearance extends 26 1/2 inches above the floor.

Resolution

Relocate or replace the lower level unit to provide knee and toe clearance. Lower level units shall have a clear floor or ground space minimum 30" by minimum 48" positioned for a forward approach, with the 30" dimension centered on the unit. Knee and toe clearance shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.] For a parallel approach, the 48" dimension shall be centered on the unit. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.


Quantity

1 EA

Priority	4

Photos for Barrier ID: AX419805



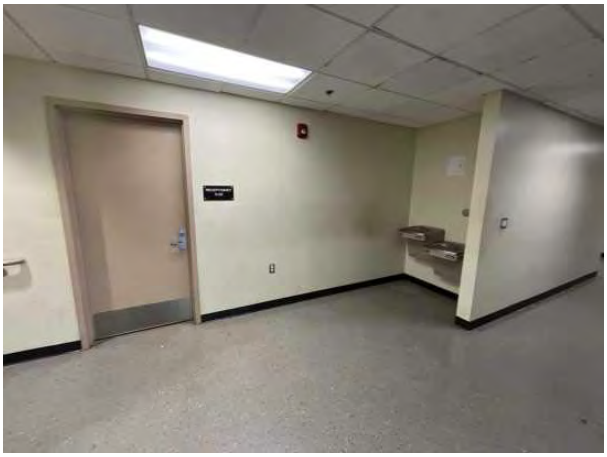

Barrier ID: AX418694

Pasadena High School BUILDING V

Assembly	Interior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	306.3, 602.2
Barrier Detail	Knee and toe clearance is not provided at the lower level fountain.
Location Description	Building V- V101 Drinking Fountain at Student Dining Area
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The knee clearance extends 26 1/2 inches above the floor.

Resolution

Relocate or replace the lower level unit to provide knee and toe clearance. Lower level units shall have a clear floor or ground space minimum 30" by minimum 48" positioned for a forward approach, with the 30" dimension centered on the unit. Knee and toe clearance shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.] For a parallel approach, the 48" dimension shall be centered on the unit. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.


Quantity

1 EA

Priority	4

Photos for Barrier ID: AX418694



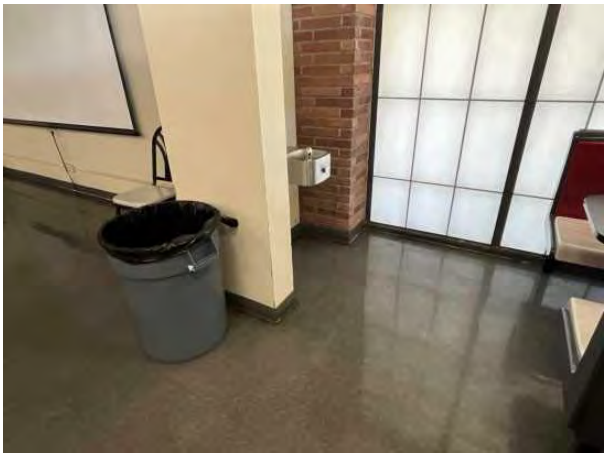

Barrier ID: AX418651

Pasadena High School BUILDING Q

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	306.3, 602.2
Barrier Detail	Knee and toe clearance is not provided at the lower level fountain.
Location Description	Drinking Fountain Adjacent Q109
Observed	Dec 6, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The drinking fountain knee clearance extends 26 inches above the ground.

Resolution


Relocate or replace the lower level unit to provide knee and toe clearance. This barrier must be removed in conjunction with barrier ID 418652. The cost of this barrier removal is covered under ID 418652 and therefore, the cost of this ID is shown as $0. Lower level units shall have a clear floor or ground space minimum 30" by minimum 48" positioned for a forward approach, with the 30" dimension centered on the unit. Knee and toe clearance shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.] For a parallel approach, the 48" dimension shall be centered on the unit. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided for a forward approach to the wheelchair height drinking fountain. For a forward approach, alcoves shall be 36" wide minimum where the depth of the alcove exceeds 24".

Quantity

1 EA

Priority	4

Map for Barrier ID: AX418651

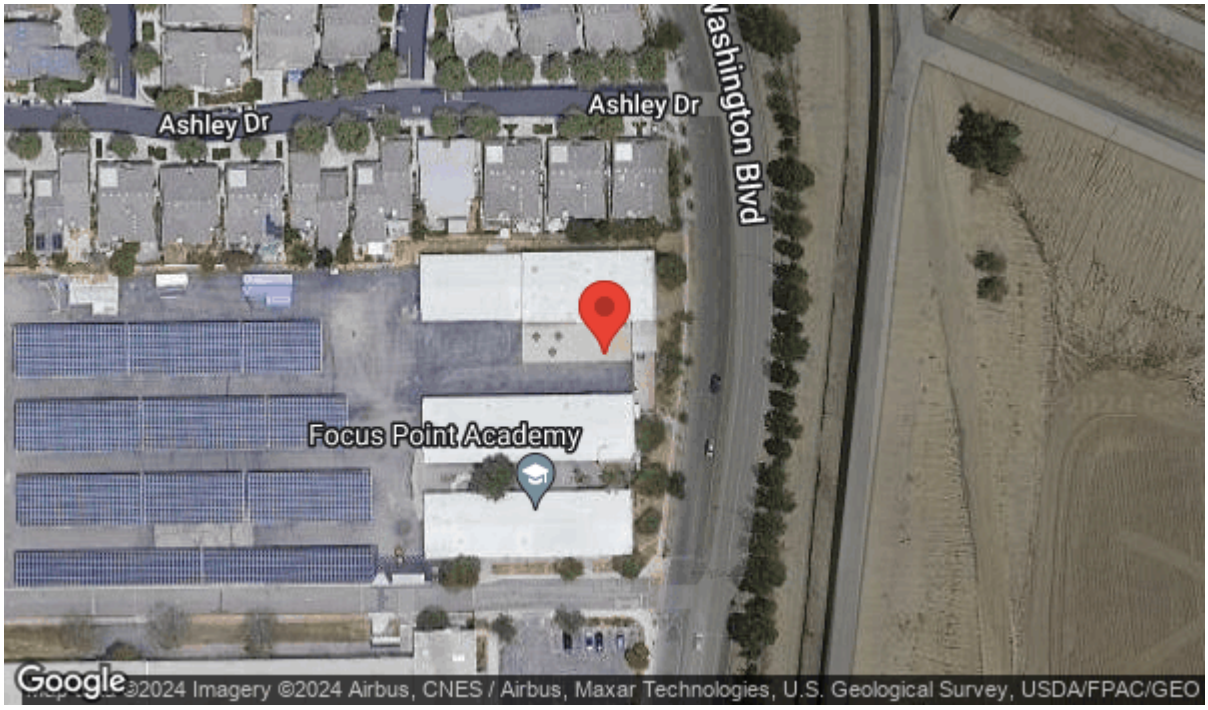

221 +34.163742, -118.090208

Photos for Barrier ID: AX418651





Barrier ID: AX419760

Pasadena High School BUILDING I

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	306.3, 602.2
Barrier Detail	Knee and toe clearance is not provided at the lower level fountain.
Location Description	Drinking Fountain Building I 2nd Floor Breezeway
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The low drinking fountain knee clearance extends 26 7/8 inches above the floor.

Resolution


Relocate or replace the lower level unit to provide knee and toe clearance. Lower level units shall have a clear floor or ground space minimum 30" by minimum 48" positioned for a forward approach, with the 30" dimension centered on the unit. Knee and toe clearance shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.] For a parallel approach, the 48" dimension shall be centered on the unit. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided for a forward approach to the wheelchair height drinking fountain. For a forward approach, alcoves shall be 36" wide minimum where the depth of the alcove exceeds 24".

Quantity

1 EA

Priority	4

Map for Barrier ID: AX419760

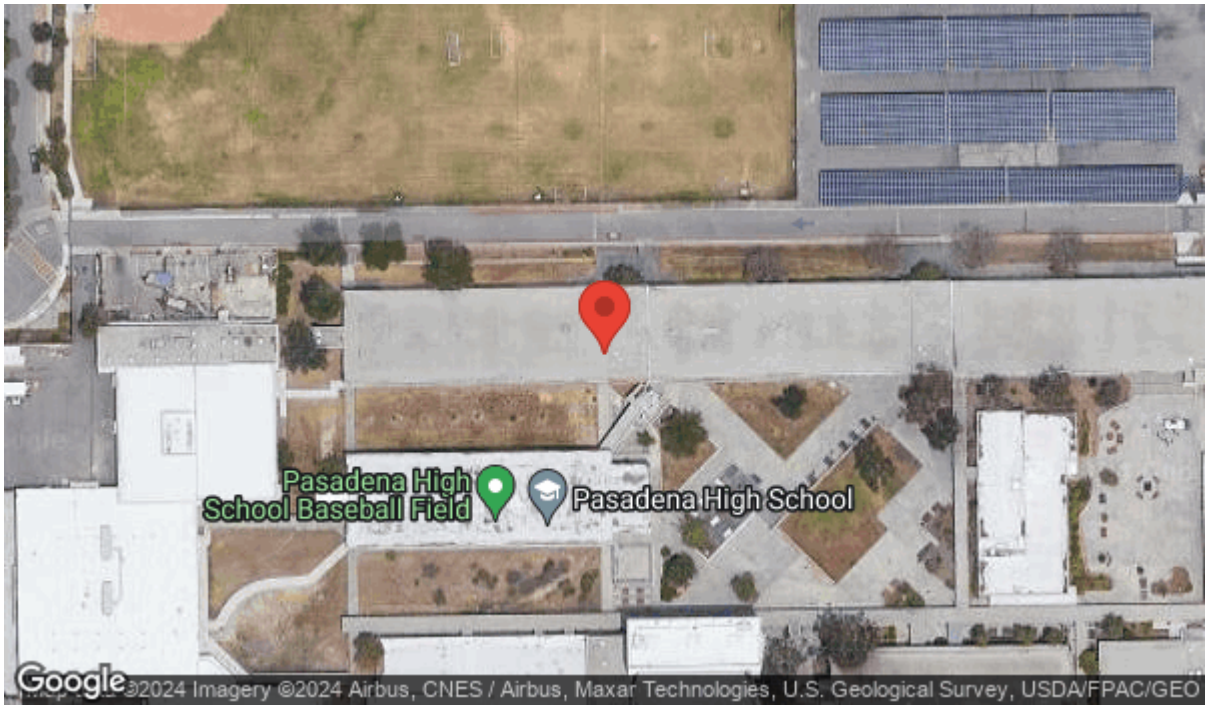

346 +34.162896, -118.092365

Photos for Barrier ID: AX419760





Barrier ID: AX418722

Pasadena High School BUILDING E

Assembly	Exterior Access Route
Type	Drinking Fountain/Water Cooler
ADA Standard	306.3, 602.2
Barrier Detail	Knee and toe clearance is not provided at the lower level fountain.
Location Description	Drinking Fountain Westend of Building E
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The knee clearance extends 26 7/8 inches above the floor.

Resolution

Relocate or replace the lower level unit to provide knee and toe clearance. Lower level units shall have a clear floor or ground space minimum 30" by minimum 48" positioned for a forward approach, with the 30" dimension centered on the unit. Knee and toe clearance shall be provided. [EXCEPTION: A parallel approach shall be permitted at units for children's use where the spout is 30" maximum above the finish floor or ground and is 3-1/2" maximum from the front edge of the unit, including bumpers.] For a parallel approach, the 48" dimension shall be centered on the unit. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum. Where a clear floor or ground space is located in an alcove or otherwise confined on all or part of three sides, additional maneuvering clearance shall be provided for a forward approach to the wheelchair height drinking fountain. For a forward approach, alcoves shall be 36" wide minimum where the depth of the alcove exceeds 24".

Quantity

1 EA

Priority	4


Map for Barrier ID: AX418722



292 +34.162545, -118.093216

Photos for Barrier ID: AX418722



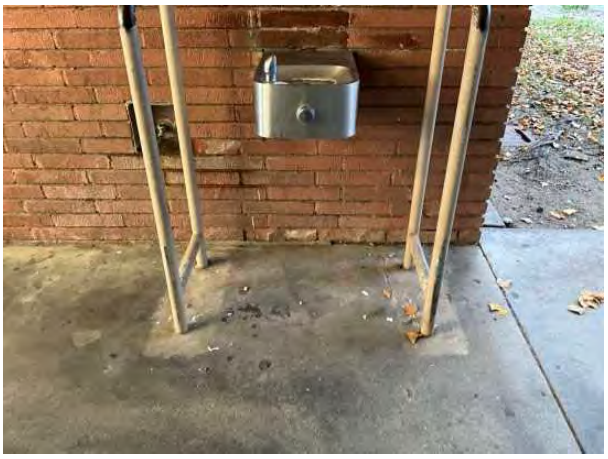

Barrier ID: AX419829

Pasadena High School BUILDING E

Assembly	Kitchen
Type	Kitchen- Range/Cooktop/Oven
ADA Standard	804.6.4; 804.6.5.3
Barrier Detail	The location of the controls requires reaching across burners.
Location Description	Building E - E108
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The stove requires reach over the burners.

Resolution

Replace the stove or oven with a unit that does not require reaching across burners to access the controls. The location of controls shall not require reaching across burners.

Quantity

1 EA

Priority	4

Photos for Barrier ID: AX419829





Barrier ID: AX418707

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - General
ADA Standard	California Building Code Chap 11B-502.8

Barrier Detail

CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.

Location Description	Parking Lot 4 P4
Observed	Dec 11, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	No tow-away sign is provided at the driveway entrance.

Resolution

Provide compliant mounted signage at the entrance drive to the parking facility. An additional sign 17" wide minimum x 22" high minimum with letters 1" minimum height shall be located at: 1. a conspicuous place at each entrance to an off-street parking facility or 2. immediately adjacent to onsite accessible parking and visible from each parking space that states "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards issued for persons with disabilities will be towed away at the owner's expense. Towed vehicles may be reclaimed at:_____ or by telephoning: _____".

Quantity

1 EA

Priority	4

Map for Barrier ID: AX418707



277 +34.162220, -118.090333

Photos for Barrier ID: AX418707



Barrier ID: AX428141

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Space - General
ADA Standard	California Building Code Chap 11B-502.8

Barrier Detail

CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.

Location Description	Parking Lot 6 P6
Observed	Dec 12, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	No tow-away signage is provided at the driveway.

Resolution


Provide compliant mounted signage at the entrance drive to the parking facility. An additional sign 17" wide minimum x 22" high minimum with letters 1" minimum height shall be located at: 1. a conspicuous place at each entrance to an off-street parking facility or 2. immediately adjacent to onsite accessible parking and visible from each parking space that states "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards issued for persons with disabilities will be towed away at the owner's expense. Towed vehicles may be reclaimed at:_____ or by telephoning: _____".

Quantity

1 EA

Priority	4

Map for Barrier ID: AX428141

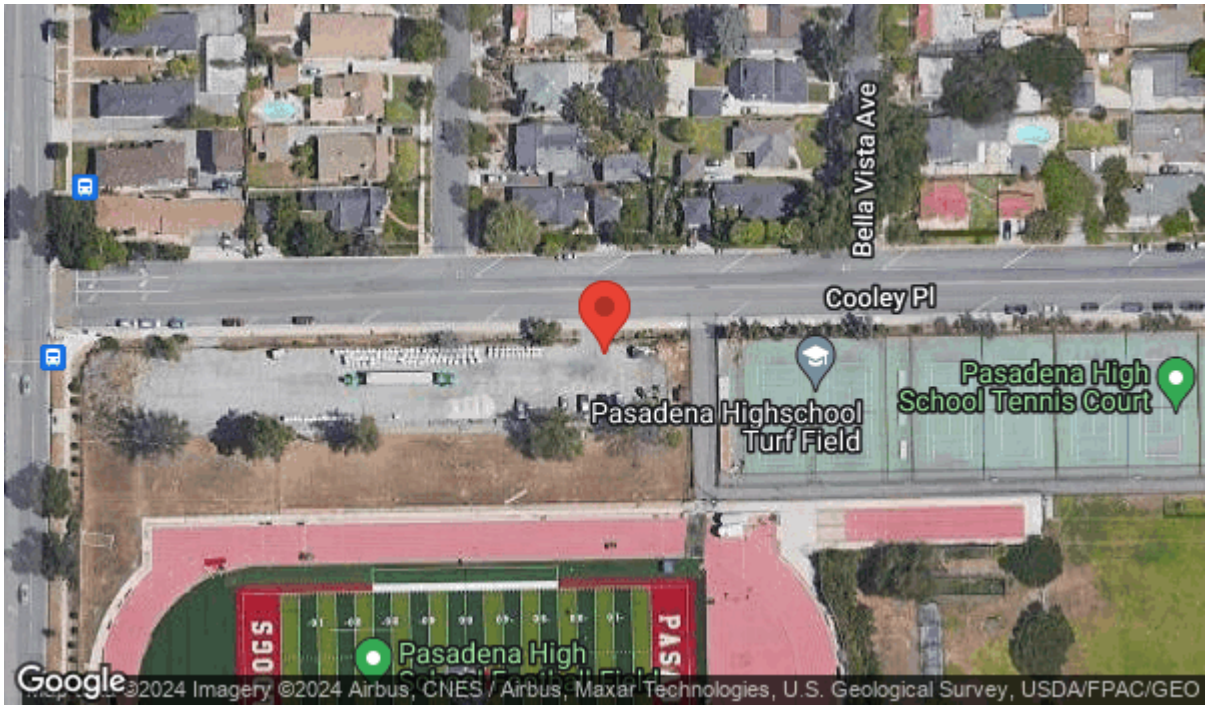

809 +34.162846, -118.096835

Photos for Barrier ID: AX428141









Barrier ID: AX424530

Pasadena High School PARKING

Assembly	Accessible Parking
Type	Parking Spaces-General
ADA Standard	California Building Code Chap 11B-502.8

Barrier Detail

CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.

Location Description	Driveway NW Entrance
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The tow-away sign does not provide compliant verbiage.

Resolution

Provide compliant mounted signage at the entrance drive to the parking facility. An additional sign 17" wide minimum x 22" high minimum with letters 1" minimum height shall be located at: 1. a conspicuous place at each entrance to an off-street parking facility or 2. immediately adjacent to onsite accessible parking and visible from each parking space that states "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards issued for persons with disabilities will be towed away at the owner's expense. Towed vehicles may be reclaimed at:_____ or by telephoning: _____".

Quantity

100 EA

Priority	4

Map for Barrier ID: AX424530



776 +34.163165, -118.093800

Photos for Barrier ID: AX424530





Barrier ID: AX424460

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Signage
ADA Standard	216.2, 703.1., 703.2, 703.5

Barrier Detail

Signage identifying the name of a permanent indoor or outdoor space does not have raised lettering and/or visual characters.

Location Description	Building A - A102 Administration
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The administration office does not provide a tactile room identification sign.

Resolution


Replace the signage with print of compliant character height and provide raised lettering. Raised lettering shall include Braille. Tactile characters shall be located 48" minimum measured from the baseline of the lowest tactile character, and 60" maximum above the finish floor or ground surface measured from the baseline of the highest visual character. Visual characters shall be 40" minimum above grade. The minimum character height shall be 5/8" when the horizontal viewing distance is less than 72" and the signage height to baseline of the character from ground is from 40" to 70". Where the baseline of the characters is located between 70" and 120" from the ground, and the horizontal viewing distance less than 180", the minimum character height is 2".

Quantity

1 EA

Priority	4

Photos for Barrier ID: AX424460

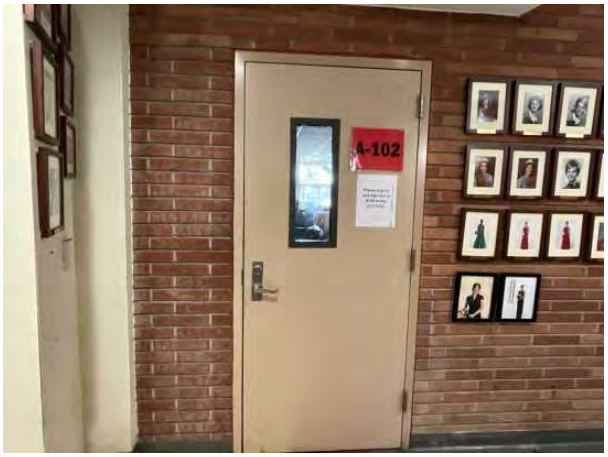

Barrier ID: AX424429

Pasadena High School BUILDING A

Assembly	Interior Access Route
Type	Telephone
ADA Standard	305
Barrier Detail	The highest operable part of the accessible public telephone is not compliant.
Location Description	Building A - 1st Floor Telephone Booth
Observed	Jan 6, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The telephone booth highest operable part is 64 inches above the floor. The telephone booth counter is 42 above the floor.

Resolution

Lower so that the highest operable part of the telephone is within the allowable reach ranges. Where a forward reach is unobstructed, the high forward reach shall be 48" maximum and the low forward reach shall be 15" minimum above the finish floor or ground. the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48" maximum where the reach depth is 20" maximum. Where the reach depth exceeds 20", the high forward reach shall be 44" maximum and the reach depth shall be 25" maximum. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48" maximum and the low side reach shall be 15" minimum above the finish floor or ground. [EXCEPTIONS: 1. An obstruction shall be permitted between the clear floor or ground space and the element where the depth of the obstruction is 10" maximum.] Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34" maximum and the depth of the obstruction shall be 24" (610 mm) maximum. The high side reach shall be 48" maximum for a reach depth of 10" maximum. Where the reach depth exceeds 10", the high side reach shall be 46" maximum for a reach depth of 24" maximum.


Quantity

1 EA

Priority	4

Photos for Barrier ID: AX424429



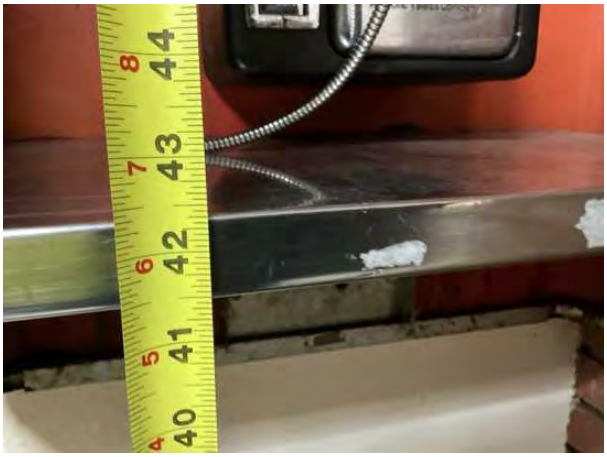



Barrier ID: AX418702

Pasadena High School BUILDING V

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building V- V115 Restroom Staff
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The paper towel dispenser is 57 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	5
Employee Only Space	Yes

Photos for Barrier ID: AX418702





Barrier ID: AX418703

Pasadena High School BUILDING V

Assembly	Restroom
Type	Controls And Dispensers
ADA Standard	California Building Code Chap 11B-603.5
Barrier Detail	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.
Location Description	Building V- V115 Restroom Staff
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The soap dispenser is 46 inches above the floor.

Resolution

Move the dispenser so that the outlet of the dispenser and all operable parts are maximum 40" above finish floor or existing grade. Where accessory dispensers, including towel dispensers, sanitary napkins, waste receptacles, or other accessories are provided, all operable parts and/or openings for the user including coin slots shall be maximum 40" above finish floor. [EXCEPTION: Does not apply to baby changing tables.] [ADVISORY: Where building elements such as coat hooks, lockers, or operable parts are designed for use primarily by children, the suggested dimensions for children shall be permitted. These dimensions apply to either forward or side reaches. Suggested reach ranges for elements which are used primarily by children are as follows: Ages 3 to 4- low/minimum reach 20" and high/maximum reach 36"; Ages 5 through 8- low/minimum reach 18" and high/maximum reach 40"; Ages 9 through 12: low/minimum reach 16" and high/maximum reach 44".]

Quantity

1 EA

Priority	5
Employee Only Space	Yes

Photos for Barrier ID: AX418703





Barrier ID: AX418385

Pasadena High School BUILDING D

Assembly	Interior Access Route
Type	Door
ADA Standard	404.2.10

Barrier Detail

The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.

Location Description	Building D - D104, D108, D109
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

The door bottom, smooth area extends 8 1/2 inches to 9 1/4 inches at 6 doors.

Resolution

Modify or replace the door to provide a smooth surface on the door within 10 inches of the finish floor or ground for the full width of the door on the push side. Parts creating horizontal or vertical joints in these surfaces shall be within 1/16 inch of the same plane as the other and be free of sharp or abrasive edges. Cavities created by added kick plates shall be capped.Swinging door and gate surfaces within 10 inches of the finish floor or ground measured vertically shall have a smooth surface on the push side extending the full width of the door or gate. Parts creating horizontal or vertical joints in these surfaces shall be within 1/16 inch of the same plane as the other. Cavities created by added kick plates shall be capped. [EXCEPTIONS: 1. Sliding doors shall not be required to comply. 2. Tempered glass doors without stiles and having a bottom rail or shoe with the top leading edge tapered at 60 degrees minimum from the horizontal shall not be required to meet the 10 inch bottom smooth surface height requirement. 3. Doors and gates that do not extend to within 10 inches of the finish floor or ground shall not be required to comply. 4. Existing doors and gates without smooth surfaces within 10 inches of the finish floor or ground shall not be required to provide smooth surfaces provided that if added kick plates are installed, cavities created by such kick plates are capped.]


Quantity

6 EA

Priority	5
Employee Only Space	Yes

Photos for Barrier ID: AX418385



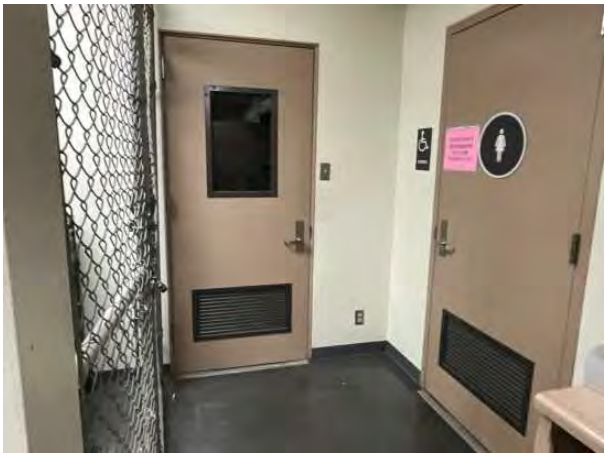









Barrier ID: AX418696

Pasadena High School BUILDING V

Assembly	Interior Access Route
Type	Door
ADA Standard	307.4, 404.2.3
Barrier Detail	The door has less than 32" clear width.
Location Description	Building V- Doors Not Providing 32 inch Clear Width
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Five doors throughout the building do not provide a 32 inch wide clear opening.

Resolution

Remove and replace with a door that has a minimum clear opening of 32". Door openings shall provide a clear width of 32" minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24" deep shall provide a clear opening of 36" minimum. There shall be no projections into the required clear opening width lower than 34" above the finish floor or ground. Projections into the clear opening width between 34" and 80" above the finish floor or ground shall not exceed 4". [EXCEPTIONS: 1. In alterations, a projection of 5/8" maximum into the required clear width shall be permitted for the latch side stop. 2. Door closers and door stops shall be permitted to be 78" minimum above the finish floor or ground.]

Quantity


5 EA

Priority	5
Employee Only Space	Yes


Photos for Barrier ID: AX418696






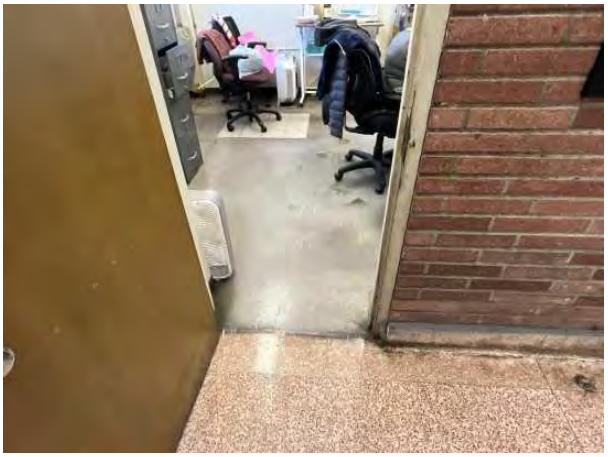



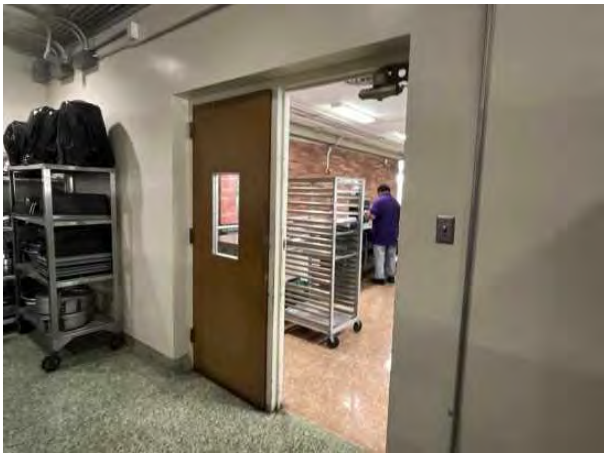

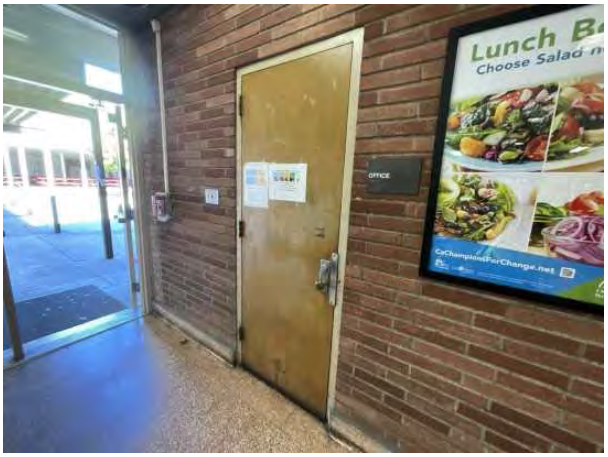

Barrier ID: AX418697

Pasadena High School BUILDING V

Assembly	Interior Access Route
Type	Door

ADA Standard

CBC Chap 11B- 309, 404.2.7, State Fire Marshall Referenced Standard Section 12-10-202(f)

Barrier Detail	CALIFORNIA: The hardware at the accessible door is not compliant.
Location Description	Building V- Doors With Knob Type Hardware
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com

Site Conditions

Five doors throughout the building have door knob type hardware requiring tight grasping and twisting of the wrist to open.

Resolution

Remove hardware and replace with hardware that has a shape that is easy to grasp such as lever, push-type or U-shaped handles. Handles, pulls, latches, locks, and other operable parts on doors and gates shall be compliant. Operable parts of such hardware shall be 34" minimum and 44" maximum above the finish floor or ground. Where sliding doors are in the fully open position, operating hardware shall be exposed and usable from both sides. [EXCEPTIONS: 1. Existing locks shall be permitted in any location at existing glazed doors without stiles, existing overhead rolling doors or grilles, and similar existing doors or grilles that are designed with locks that are activated only at the top or bottom rail. 2. Access gates in barrier walls and fences protecting pools, spas, and hot tubs shall be permitted to have operable parts of the release of latch on self-latching devices at 54" maximum above the finish floor or ground provided the self-latching devices are not also self-locking devices and operated by means of a key, electronic opener, or integral combination lock.] [Advisory 404.2.7 Door and gate hardware. Door hardware that can be operated with a closed fist or a loose grip accommodates the greatest range of users. Hardware that requires simultaneous hand and finger movements require greater dexterity and coordination, and is not recommended.] Lever hardware of lever actuated latches or locks shall be curved with a return to within 1/2 inch of the door. [Advisory 11B-404.2.7 Door and gate hardware. In addition to the requirements of this section, designers should be aware of the Part 12, Section 12-10-202(f) requirement for lever hardware as adopted by the State Fire Marshal. The lever of lever actuated latches or locks must be curved with a return to within ½ inch of the door to prevent catching on the clothing of persons during egress.]

Quantity

5 EA


Priority	5
Employee Only Space	Yes

Photos for Barrier ID: AX418697







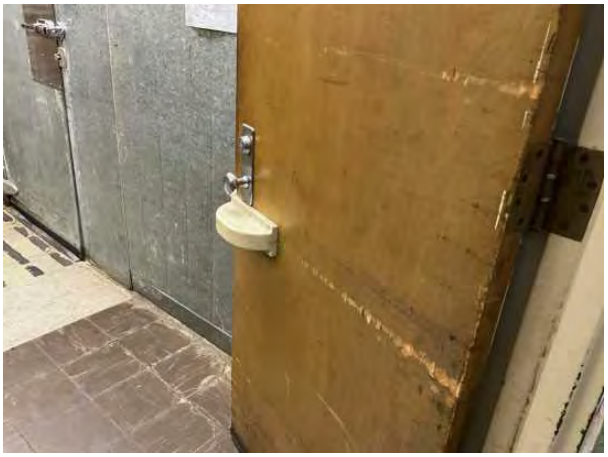



Barrier ID: AX424536

Pasadena High School BUILDING U

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	California Building Code Chap 11B-Chap 11B-405.7
Barrier Detail	CALIFORNIA: The ramp landings are not compliant.
Location Description	Ramp R16 At Building U Entrance
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp bottom landing soaps, 2.8%.

Resolution

Install compliant ramp landings. Ramp landings at bottom of ramp runs shall be minimum 72" length in the direction of the ramp run, minimum 60" wide, and at least as wide as the ramp run. Ramp landings at the top of the ramp shall be 60" minimum length and 60" minimum wide. Ramp landings in the middle of the ramp, where landings are not at a turn shall be 60" minimum length and 60" minimum wide, and at least as wide as ramp. Ramp landings at turns shall be 60" minimum wide by 72" minimum length in the direction of downward travel from the upper ramp run. The maximum rise of a ramp run shall be 30". Doors which overlap landings shall project into required landing widths 3" maximum when fully open. Doors in any position shall allow minimum 42" width and depth of the landing. Ramp landings shall be level with no more than 2% slope in any direction. [Exception: Slopes not steeper than 1:48 shall be permitted.]

Quantity

6 LF

Priority	5
Employee Only Space	Yes

Map for Barrier ID: AX424536



782 +34.162973, -118.093509

Photos for Barrier ID: AX424536







Barrier ID: AX424537

Pasadena High School BUILDING U

Assembly	Exterior Access Route
Type	Ramp
ADA Standard	405.2

Barrier Detail

The ramp has a running slope in excess of 1:12 (8.33%) and/or cross slope in excess of 1:48 (2.08%).

Location Description	Ramp R16 At Building U Entrance
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The ramp has a running slope of 16%.

Resolution

Remove the existing ramp and provide a compliant ramp. Ramp runs shall have a running slope not steeper than 1:12 (8.33%). [EXCEPTION: In existing sites, buildings, and facilities built before January 1992, ramps shall be permitted to have running slopes steeper than 1:12 where such slopes are necessary due to space limitations. Where slopes are steeper than 1:10 but not steeper than 1:8, the rise shall be 3" maximum. Where slopes are steeper than 1:12 but not steeper than 1:10, the rise shall be 6" maximum.] Ramp runs shall have cross slopes not greater than 1:50 (2%). [EXCEPTION: Cross slopes not greater than 1:48 (2.08%) are permitted.] Either regrade to a maximum running slope of 1:20 (5%) for the walking surface, or provide a compliant ramp. The cost estimate for this barrier removal is based on providing a compliant ramp. The quantity and order of magnitude cost estimate provided for this barrier are limited to the extent of the area identified as non-compliant. Additional costs that may be associated with removal of the barrier are not included.

Quantity

21 LF


Priority	5
Employee Only Space	Yes

Map for Barrier ID: AX424537



783 +34.162980, -118.093506

Photos for Barrier ID: AX424537

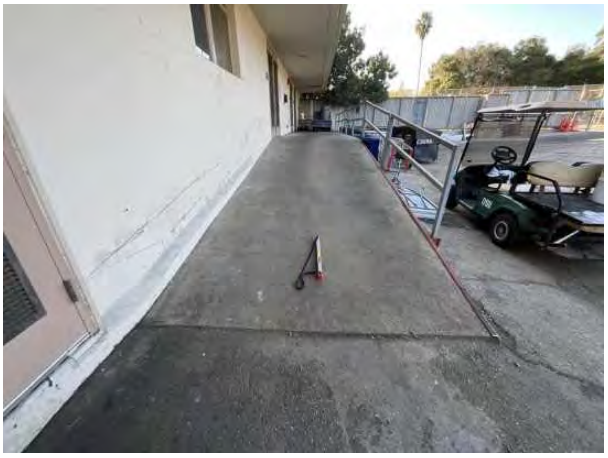



Barrier ID: AX418701

Pasadena High School BUILDING V

Assembly	Restroom
Type	Restroom/Bathroom - Lavatory
ADA Standard	213.3.4, 606.5
Barrier Detail	Pipes are not insulated.
Location Description	Building V- V115 Restroom Staff
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com
Site Conditions	The lavatory pipes are not insulated.

Resolution

Insulate water supply and drain pipes under the accessible lavatory. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. Pipes under lavatories and sinks shall be free from sharp or abrasive surfaces. A minimum of one lavatory in a multi-lavatory restroom shall be a compliant lavatory.

Quantity

1 EA

Priority	5
Employee Only Space	Yes

Photos for Barrier ID: AX418701



Barrier ID: AX418699

Pasadena High School BUILDING V

Assembly	Restroom
Type	Restroom/Bathroom - Signage
ADA Standard	216.2, 703.1, 703.2, 703.5, 703.6

Barrier Detail

The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.

Location Description	Building V- V115 Restroom Staff
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The restroom does not provide the correct tactile room, identification sign for a unisex restroom.

Resolution

Mount compliant signage on the wall at the latch side of the restroom door at a compliant height. All signs for accessible restrooms, including directional signs indicating the restroom location, shall comply with the requirement for the International Symbol of Accessibility (ISA), where not all restrooms are accessible. The pictogram field shall be minimum 6" high. Signage shall include raised letters and Braille, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided. Tactile characters on signs shall be located 48" minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60" maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character. Accessible restrooms shall have signs with the International Symbol of Accessibility. Where a tactile sign is provided at a door, the sign shall be located alongside the door at the latch side. Where a tactile sign is provided at double doors with one active leaf, the sign shall be located on the inactive leaf. Where a tactile sign is provided at double doors with two active leafs, the sign shall be located to the right of the right hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall. Signs containing tactile characters shall be located so that a clear floor space of 18" minimum by 18" minimum, centered on the tactile characters, is provided beyond the arc of any door swing between the closed position and 45 degree open position. [EXCEPTION: Signs with tactile characters shall be permitted on the push side of doors with closers and without hold-open devices.] Raised characters shall be as follows: Depth: Raised characters shall be 1/32" minimum above their background. Case: Characters shall be uppercase. Style: Characters shall be sans serif. Characters shall not be italic, oblique, script, highly decorative, or of other unusual forms. Character Proportions: Characters shall be selected from fonts where the width of the uppercase letter "O" is 55 % minimum and 110 % maximum of the height of the uppercase letter "I". Character Height: Character height measured vertically from the baseline of the character shall be 5/8" minimum and 2" maximum based on the height of the uppercase letter "I". [EXCEPTION: Where separate raised and visual characters with the same information are provided, raised character height shall be permitted to be 1/2" minimum.] The visual characters of the sign shall be installed at minimum 40" above finish floor.

Quantity

1 EA

Priority	5
Employee Only Space	Yes

Photos for Barrier ID: AX418699





Barrier ID: AX418700

Pasadena High School BUILDING V

Assembly	Restroom
Type	Restroom/Bathroom-Water Closet
ADA Standard	CBC Chap 11B- 604.3.1 and 3.2
Barrier Detail	CALIFORNIA- The water closet does not have the required clear floor space.
Location Description	Building V- V115 Restroom Staff
Observed	Dec 5, 2023 by Abel.Machado@bureauveritas.com

Site Conditions

The water closet does not provide the required clearance. 33 inches is provided due to the partition and approximately 43 inches from the sidewall to the lavatory edge is provided.

Resolution

Redesign to ensure that the water closet has the minimum required clear floor space. The water closet shall be positioned with a wall or partition to the rear and to one side. Clearance around a water closet shall be 60" minimum measured perpendicular from the side wall and 56" minimum measured perpendicular from the rear wall. A minimum 60" wide and 48' deep maneuvering space shall be provided in front of the water closet. [Exception: In residential dwelling units required to be mobility accessible, maneuvering space in front of the water closet shall be a minimum 60" wide and 36" deep.] The centerline of the water closet shall be 17" minimum to 18" maximum from the side wall or partition, Water closets shall be arranged for a left-hand or right-hand approach, with the flush on the open side. The required clearance around the water closet shall be permitted to overlap the water closet, associated grab bars, dispensers, sanitary napkin disposal units, coat hooks, shelves, accessible routes, clear floor space and clearances required at other fixtures, and the turning space. No other fixtures or obstructions shall be located within the required water closet clearance. [Exception: In residential dwelling units, a lavatory shall be permitted on the rear wall 18" minimum from the water closet centerline where the clearance at the water closet is 66" minimum measured perpendicular from the rear wall.] [ADVISORY: It is advisable, but not required, to use the specifications for children where children are the primary users of the restroom. Guidance in applying the specifications for children according to the age group served reflects the differences in the size, stature, and reach ranges of children ages 3 to 12. The specifications chosen should correspond to the age of the primary user group. The specifications of one age group should be applied consistently in the installation of a water closet and related elements. Water Closet Centerline: Ages 3 and 4- 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 18". Toilet Seat Height: Ages 3 and 4- 11" to 12"; Ages 5 through 8- 12" to 15"; Ages 9 through 12- 15" to 17". Grab Bar Height: Ages 3 and 4- 18" to 20"; Ages 5 through 8- 20" to 25"; Ages 9 through 12- 25" to 27"; Dispenser Height: Ages 3 and 4- 14"; Ages 5 through 8- 14" to 17"; Ages 9 through 12- 17" to 19"].

Quantity

1 EA

Priority	5
Employee Only Space	Yes

Photos for Barrier ID: AX418700







Barrier ID: AX418375

Pasadena High School BUILDING D

Assembly	Interior Access Route
Type	Sink
ADA Standard	306.2 and 606.3

Barrier Detail

The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).

Location Description	Building D - D101 Student Services
Observed	Jan 8, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The sink is 34 1/4 inches above the floor.

Resolution

Relocate sink to compliant height with knee and toe clearances. This barrier must be removed in conjunction with barrier ID 418273. The cost of this barrier removal is covered under ID 418273 and therefore, the cost of this ID is shown as $0. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

1 EA

Priority	5
Employee Only Space	Yes

Photos for Barrier ID: AX418375





Barrier ID: AX418392

Pasadena High School BUILDING D

Assembly	Interior Access Route
Type	Sink
ADA Standard	306.2 and 606.3

Barrier Detail

The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).

Location Description	Building D - D104 Workroom
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The sink is 34 1/2 inches above the floor

Resolution

Relocate sink to compliant height with knee and toe clearances. This barrier must be removed in conjunction with barrier ID 418273. The cost of this barrier removal is covered under ID 418273 and therefore, the cost of this ID is shown as $0. Lavatories and sinks shall be installed with the front of the higher of the rim or counter surface 34" maximum above the finish floor or ground. Knee Clearance: Space under an element between 9" and 27" above the finish floor or ground shall be considered knee clearance. Knee clearance shall extend 25" maximum under an element at 9" above the finish floor or ground. Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Between 9" and 27" above the finish floor or ground, the knee clearance shall be permitted to reduce at a rate of 1" in depth for each 6" in height. Knee clearance shall be 30" wide minimum. Toe Clearance: Space under an element between the finish floor or ground and 9" above the finish floor or ground shall be considered toe clearance. Toe clearance shall extend 25" maximum under an element. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17" minimum under the element. Space extending greater than 6" beyond the available knee clearance at 9" above the finish floor or ground shall not be considered toe clearance. Toe clearance shall be 30" wide minimum.

Quantity

1 EA

Priority	5
Employee Only Space	Yes

Photos for Barrier ID: AX418392





Barrier ID: AX418698

Pasadena High School BUILDING V

Assembly	Kitchen
Type	Sink
ADA Standard	606.5

Barrier Detail

Exposed pipes lack insulation and/or sharp or abrasive surfaces are present under the sink.

Location Description	Building V- V106 Kitchen
Observed	Jan 7, 2024 by Abel.Machado@bureauveritas.com
Site Conditions	The sink does not have the pipes insulated or sleeved.

Resolution

Provide insulation on all exposed pipes at sinks requiring knee and toe clearance. Modify or insulate sharp or abrasive surfaces under the sink. A minimum of one sink in a multi-sink kitchen shall be compliant.

Quantity

270 EA

Priority	5
Employee Only Space	Yes

Photos for Barrier ID: AX418698

