


Midwest  
Environmental  
Consulting, L.L.C.

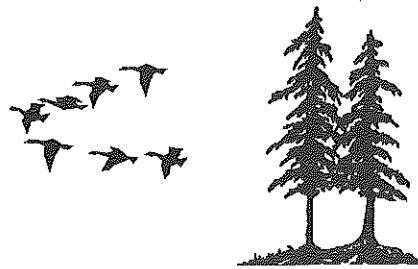

Printed on Recycled Paper

[REDACTED] Johnson Senior High School  
Saint Paul Public Schools

**Lead-Based Paint Inspection**

**Inspection Dates: 4/14/97, 4/15/97, 4/16/97, 4/17/97,  
4/21/97, 4/22/97, 4/23/97, 4/25/97, 4/26/97, 4/29/97**

**submitted to:**

**Saint Paul Public Schools**

**MEC Project # 62/0197Y**

## INTRODUCTION

At the request of Saint Paul Public Schools Environmental Safety Department, Midwest Environmental Consulting, L.L.C. (MEC), conducted a lead-based paint inspection at John A. Johnson Senior High School, 1349 Arcade Street, St. Paul, MN. The purpose of this inspection was to identify lead-based painted, varnished, or otherwise coated building components on the interior and exterior of the school building.

The inspection protocol incorporated applicable portions of the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-based Paint Hazards in Housing* (HUD Guidelines, June 1995) and OSHA 1926.62 requirements (Lead in Construction). The HUD guidelines are formulated to guide agencies in conducting random sampling of the interiors and exteriors of dwellings and common areas in public housing. The OSHA requirement is designed to minimize worker exposure when working with material containing lead.

Confirmatory testing was conducted when inconclusive XRF results were encountered. Inconclusive refers to XRF readings less than 0.2 mg/cm<sup>2</sup> (milligrams per square centimeter). Inconclusive results were confirmed with laboratory analysis of paint chip samples (Appendix B). This report contains a list of such results.

The United States Environmental Protection Agency defines "lead-based paint" as a paint or other surface coating that contains lead equal to or in excess of 1.0 milligrams per square centimeter when analyzed by XRF or more than 0.5% by weight (5000 parts per million) by laboratory analysis of a bulk sample.

Minnesota Department of Labor and Industry (MN OSHA) adopted the EPA lead levels for the purpose of enforcing OSHA 1926.62 federal regulations. Detection of lead in dried paint film by XRF is a dependable indicator of levels of lead and is accepted by MN OSHA.

For this Saint Paul Public Schools Lead Inspection, all building components were tested on site using a Niton XL® X-ray Fluorescence Spectrum Analyzer<sup>(1)</sup>. Building components included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases. Only painted or glazed surfaces or surfaces which were varnished were tested. Suspended ceilings, structural steel, and corrugated decking were not included in the inspection. Neither anodized (e.g., window sashes) nor plastic (e.g., vinyl baseboard and vinyl mini-blinds) were included in the scope of this inspection.

---

<sup>(1)</sup> This is a portable hand held machine that can analyze building components instantly for lead concentrations.

Each building was divided into unique sites based on the year of construction or renovation. Portable classrooms, playgrounds, and other detached buildings were automatically designated as a unique site. Each site was inspected independently assuming differences in painting history and construction characteristics.

## SITE DESCRIPTION AND BUILDING HISTORY

According to information provided to MEC by Saint Paul Public Schools, John A. Johnson Senior High School was constructed in essentially three phases. The initial phase includes the 227,345 square-foot older section of the building and dates from 1963. The second phase is a 2,073 square foot addition dating from 1983. The third phase is a 16,773 square foot addition from 1997.

The 1983 and 1997 phases were not inspected due to the construction dates.

All room and area designations used in this report are depicted on sampling maps found in Appendix A.

## XRF SAMPLE RESULTS TABLE

The results of all samples analyzed are listed in the table at the end of this section. The following is a description of the column headings:

<b>Site</b>	Each school is divided into sites based on their unique construction characteristics. Each site has a unique date of construction or major renovation.
<b>Sample #</b>	Each sample taken was given a unique number to identify the type and location of the sample. The sampling date is an integral part of the sample number.
<b>Analysis</b>	This defines the type of analysis which can be categorized into two types:  1) XRF: This is an on-site analysis using a hand held Niton XL® X-ray Fluorescence Spectrum Analyzer; 2) Bulk or Chip: This is a bulk sample where paint is removed from the substrate and sent to a laboratory for analysis;
<b>Floor</b>	This is the level of the building in which the area tested was found, example, 1 (first floor), 0 (basement), etc.

<b>Area</b>	This further defines the specific functional space inspected such as a classroom, exterior, playground, gym, kitchen, etc.
<b>Room #</b>	This is typically the actual number on the room as identified at the building.
<b>Component</b>	Building "components" included walls, ceilings, floors, moldings, window and door components, door surfaces, and miscellaneous features such as shelves or bookcases.
<b>Feature</b>	Identifies more detailed information of the component.
<b>Condition</b>	This describes condition of the surface, whether it is intact, cracked, peeling, or chalking.
<b>Substrate</b>	This refers to the material the building component is made of (wood, concrete, drywall, metal, etc.).
<b>Result</b>	This is the analysis results for lead. Less than 1.0 mg/cm <sup>2</sup> or less than 0.5% by weight is considered to be non-lead and these building components are below the action levels of EPA and HUD. (All results are in mg/cm <sup>2</sup> except where noted.)

The table of results is designed for quick information on lead concentrations of tested building components. Generally, all repetitions of a test combination within a given room or area, may be assumed to contain similar concentrations of lead to that of the tested sample. For instance, the lead concentration of a tested wooden window sash was found to be above the action level of 1.0 mg/cm<sup>2</sup> in a given classroom. The classroom has five windows, all of wood, the same color and appearing to be of the same era. It can be assumed that the remaining four wooden window sashes each contain lead above the action limit.

Other columns identify the component and the component feature tested, condition of the component, type of substrate and the result of the analytical test.

As an example, the following illustration shows that the wooden door jamb in Room 123, first floor in the 1923 building section was in good, solid condition, and had an XRF test result of 0.3 mg/cm<sup>2</sup>, which is below the action level.

#### Illustration Only

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1923 Bldg.	52		XRF	1	Room	123	Door	Jamb	Solid	Wood	0.3

In a similar manner, the table shows that the plaster walls in room 23, on the second floor has peeling paint with more than 1.0 mg/cm<sup>2</sup> (shaded).

**ILLUSTRATION ONLY**

Site	Sample #	Date	Analysis	Floor	Area	Room #	Component	Feature	Condition	Substrate	Results
1910 Bldg.	16		XRF	2	Room	23	Door	Jamb	Peeling	Wood	0.25
1910 Bldg.	17		XRF	2	Room	23	Wall	Wall	Peeling	Plaster	1.2
1910 Bldg.	18		XRF	2	Room	23	Ceiling	Peeling	Plaster		0.25
1910 Bldg.	19		XRF	2	Room	23	Wall	Baseboard	Peeling	Wood	0.002

**APPLICABLE REGULATIONS**

When building components test above 1.0 mg/cm<sup>2</sup> of lead by XRF or 0.5% lead by weight from laboratory analysis all employees and contractors who will be working with these components in a construction related activity must be notified. The requirements of OSHA 1926.62, Lead in Construction are enforceable. This regulation defines construction work as "work for construction, alteration and/or repair, including painting and decorating." This regulation further defines monitoring requirements to minimize employee exposure to lead during construction activities.

When work is performed on external painted building structures (i.e. flashing, fire escapes, playground equipment, handrails, etc.), regulations of the Minnesota Pollution Control Agency (MPCA) may also be applicable. For removal of lead based paint from steel structures, MN Rules 7025.0200 - 7025.0380 apply to steel materials on the exterior of a building, or on the property when levels exceed 0.5 mg/cm<sup>2</sup> based on the average of three XRF spectrum results of the sample tested, or 5,000 ppm by laboratory analysis. If it is other than a steel surface, then MPCA regulates the painted surfaces under MN Rules 7025.010 - 7025.0080, when surfaces are to be disturbed using abrasive blasting methods.

Please contact MEC directly if you have questions about any portion of this report or the lead-based paint inspection itself.


# **APPENDIX A**

## **XRF TESTING DATA WITH LOCATION MAPS**

OTTAWA	8,000
" KENYON	3,500
" NORD	3,500
" BIRMINGHAM	1,000
" PLAT	0
" SOUPERT	0
SITE SOUPERT UNIT	1,500
NUCLEAR GENERATOR UNIT	1,500
BULEVARD 60' X 40'	8,004
TOTAL GROSS SQ.FT.	44,075
PUBLIC SIDEWALK SQ.FT.	1,042

PENKE, WIL. FT.  
HEAD, WIL. ST.  
SITE, TREES,  
REMOVED TREES.


SILHOUETTE

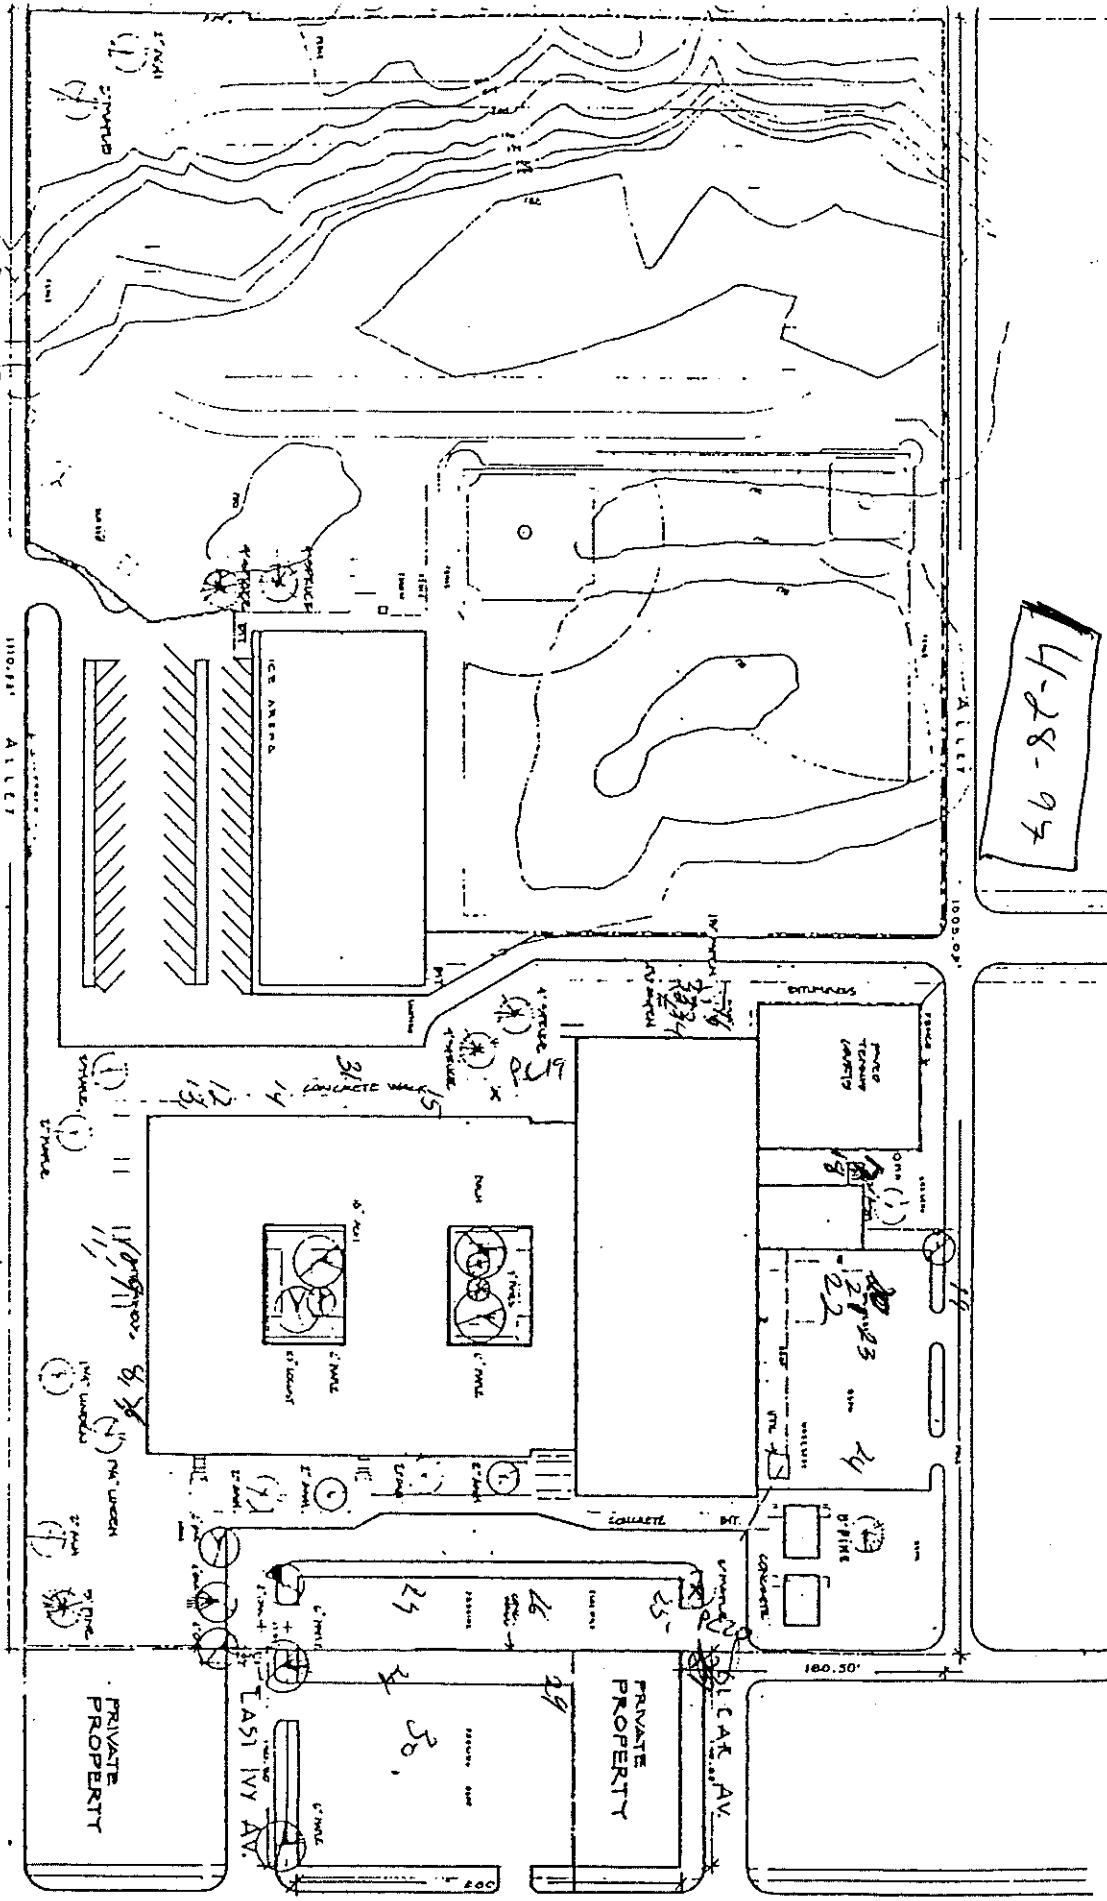


INDEPENDENT SCHOOL DIST. # 625  
360 - CALBORNE STREET  
ST. PAUL, MINNESOTA  
55102

JOHNSON SENIOR HIGH  
1949 ARCADE ST.  
ST. PAUL  
MINNESOTA 55006

CONSTRUCTED: 1963  
ARCHITECT: TOLTEZ, KING,  
D'VALL, & ANDERSON  
DRAWN: 9-23-71 BY 25 PPM.

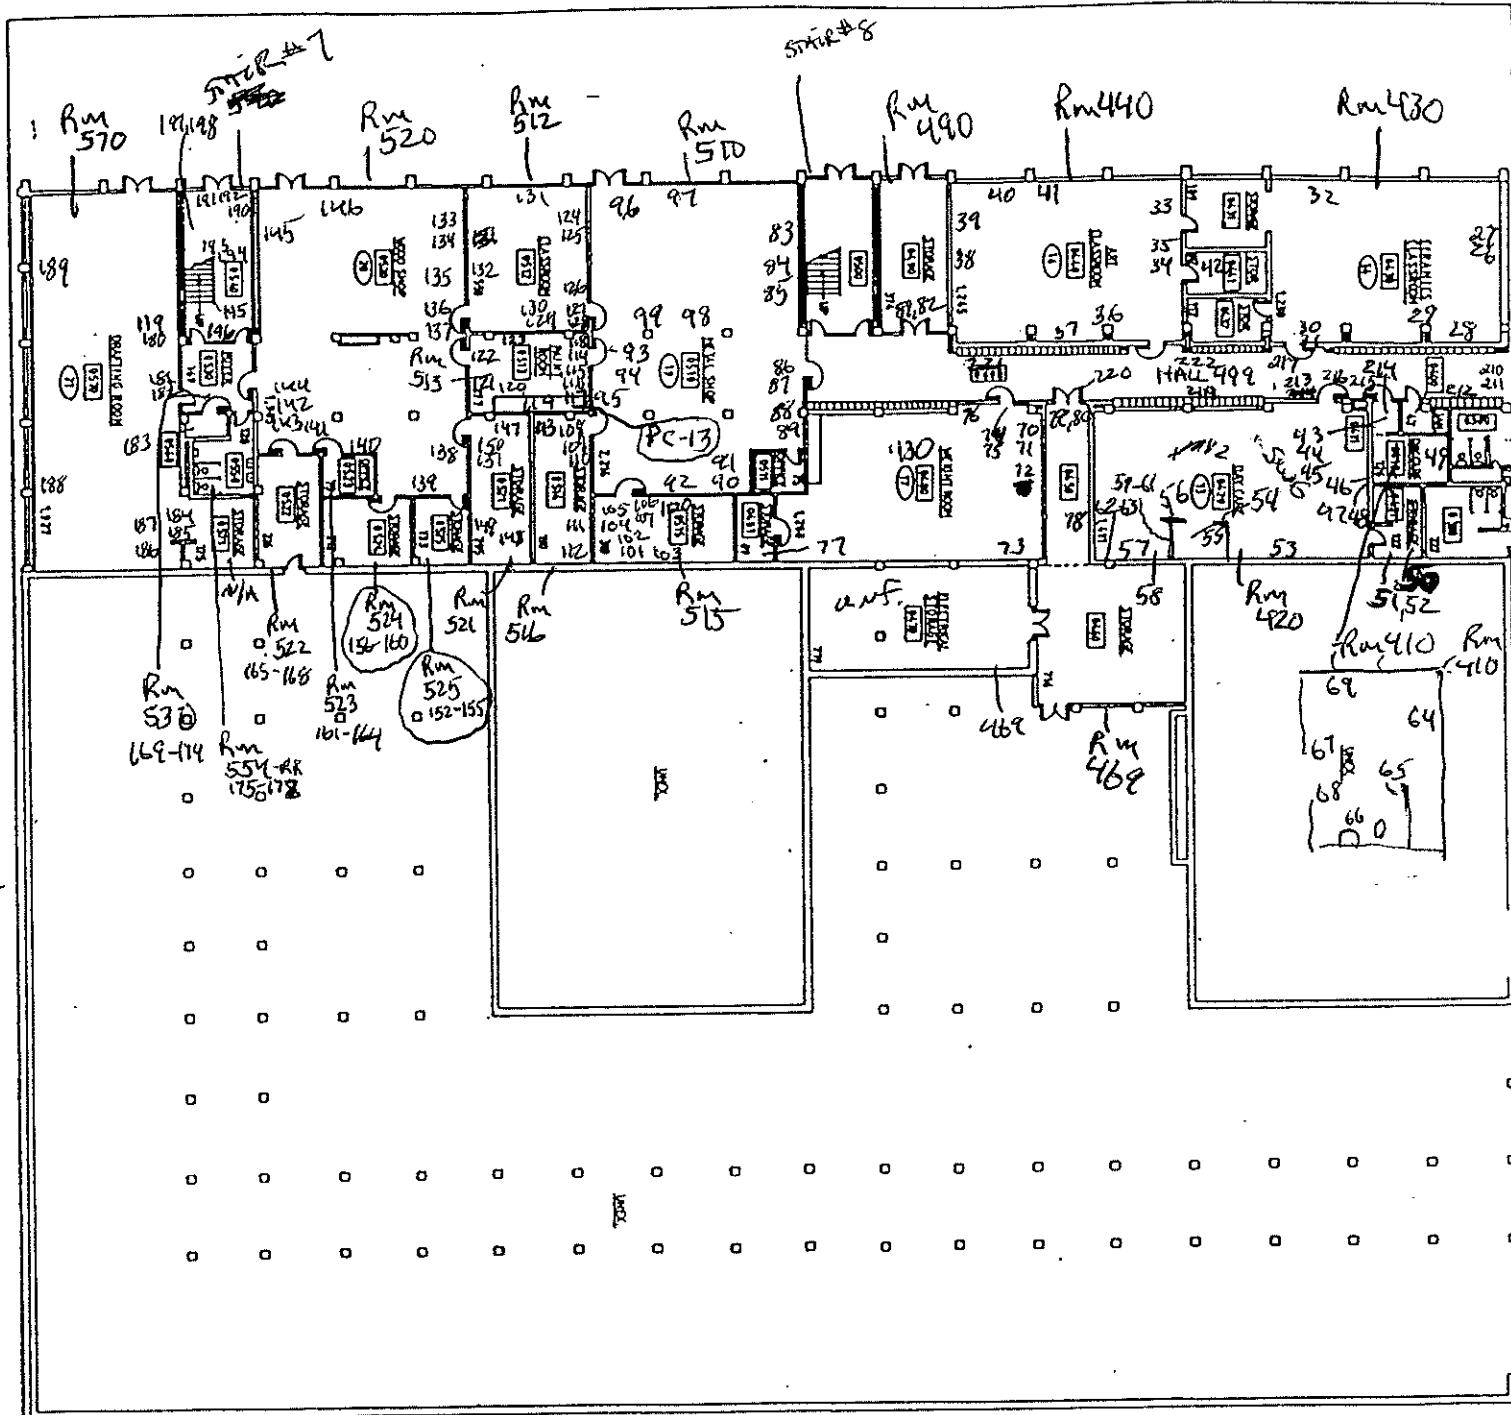

GROUND FLOOR-SOUTH

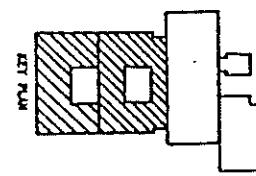

4-17-97




INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

JOHNSON SENIOR HIGH  
1349 ARCADE ST  
ST. PAUL, MN 55106

CONSTRUCTED: 1963

SECTION 5  
9

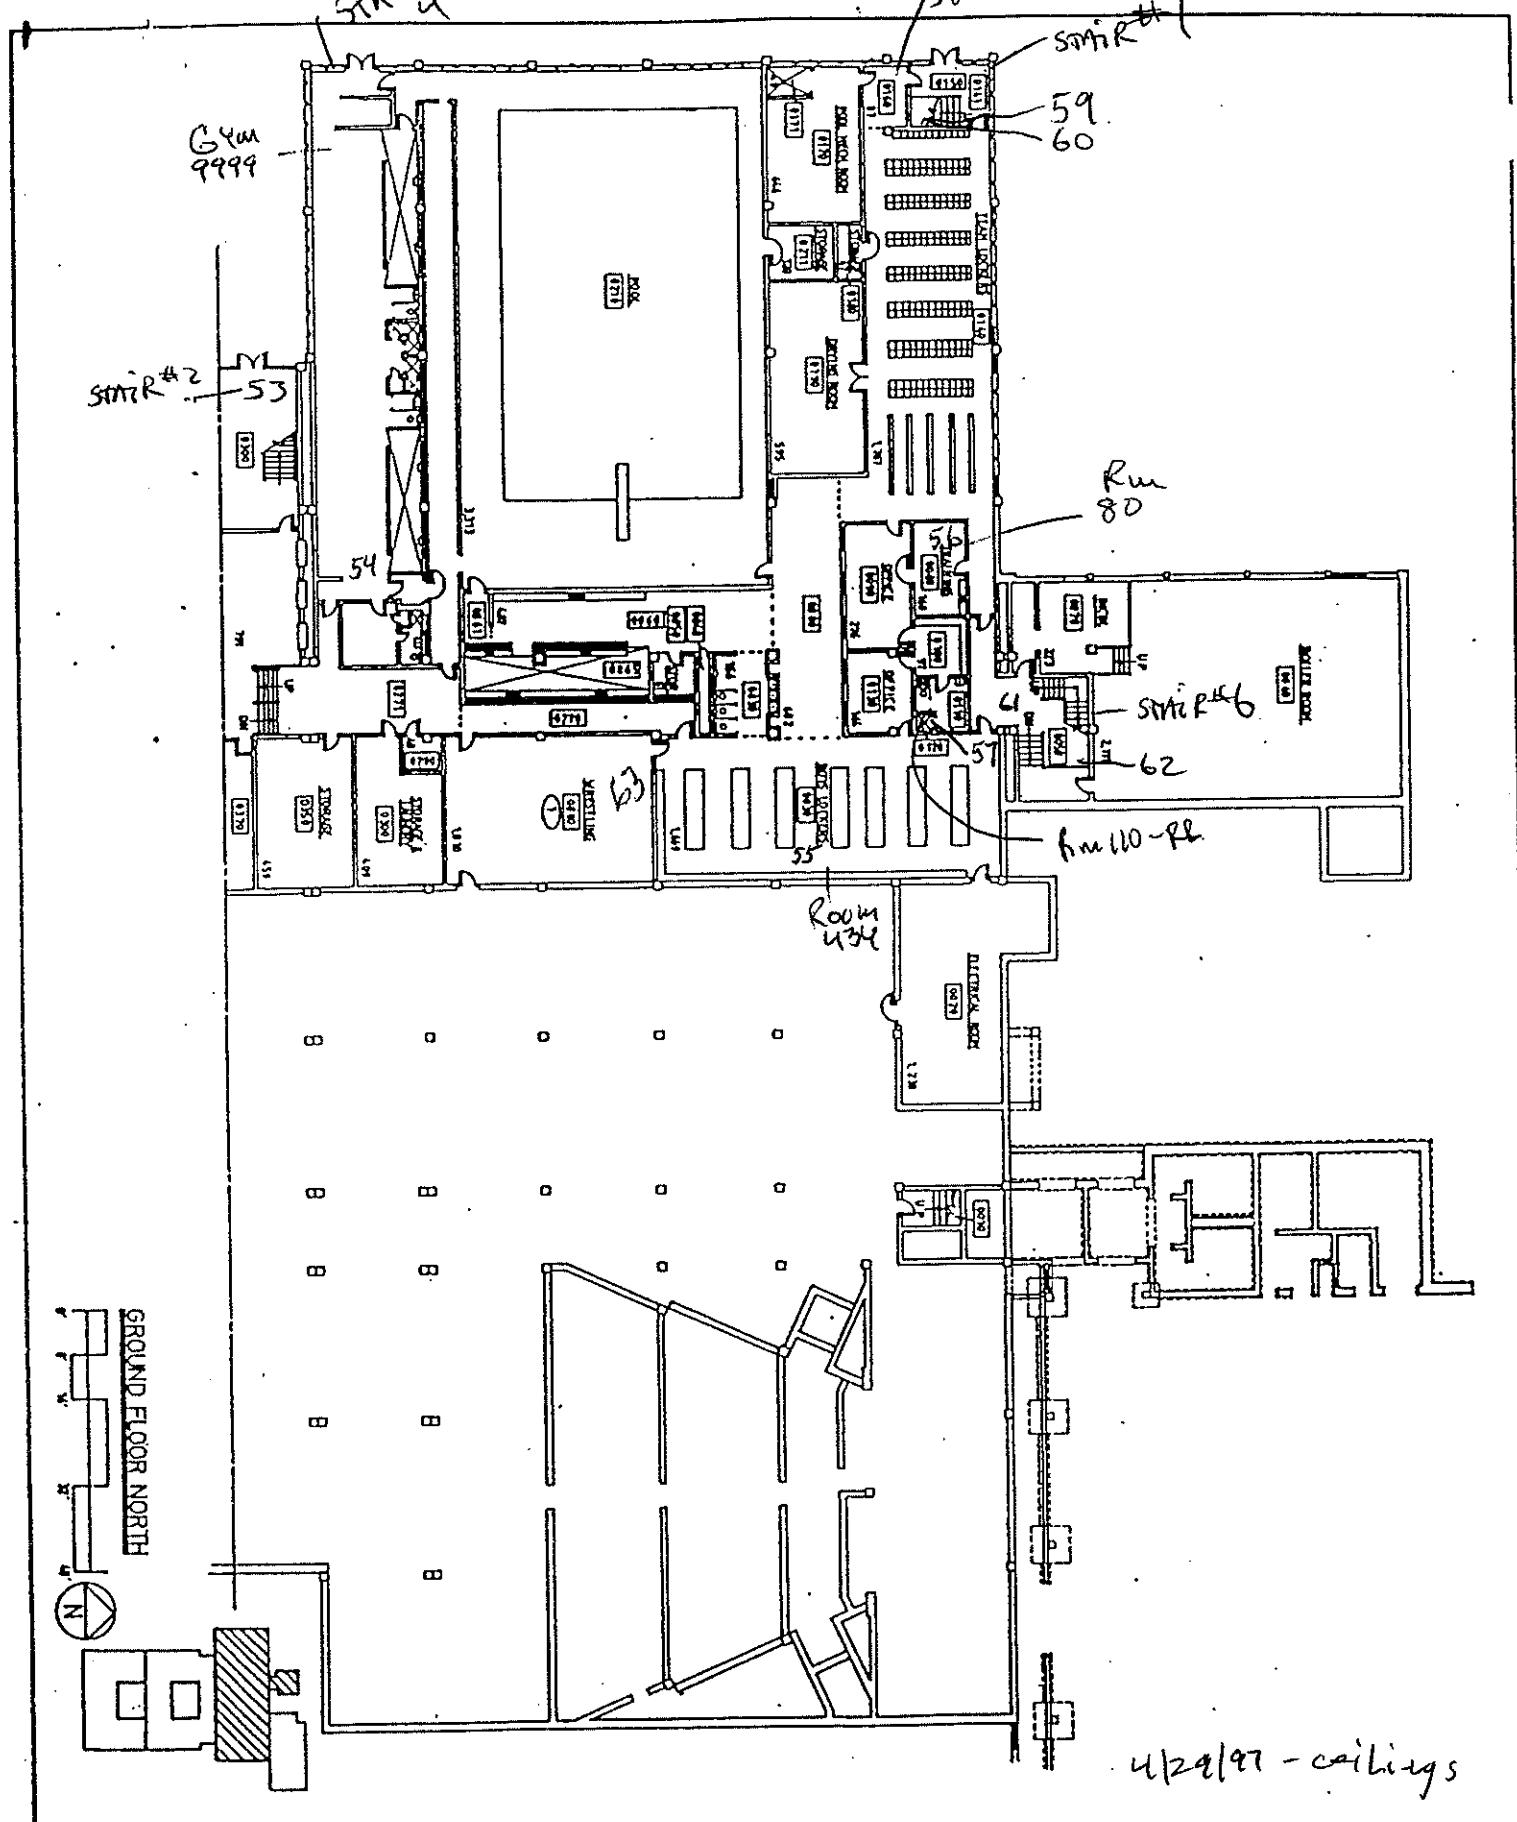


INDEPENDENT SCHOOL DISTRICT #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102


JOHNSON SENIOR HIGH  
1349 ARCADE ST.  
ST. PAUL, MN 55106

1963

2

9

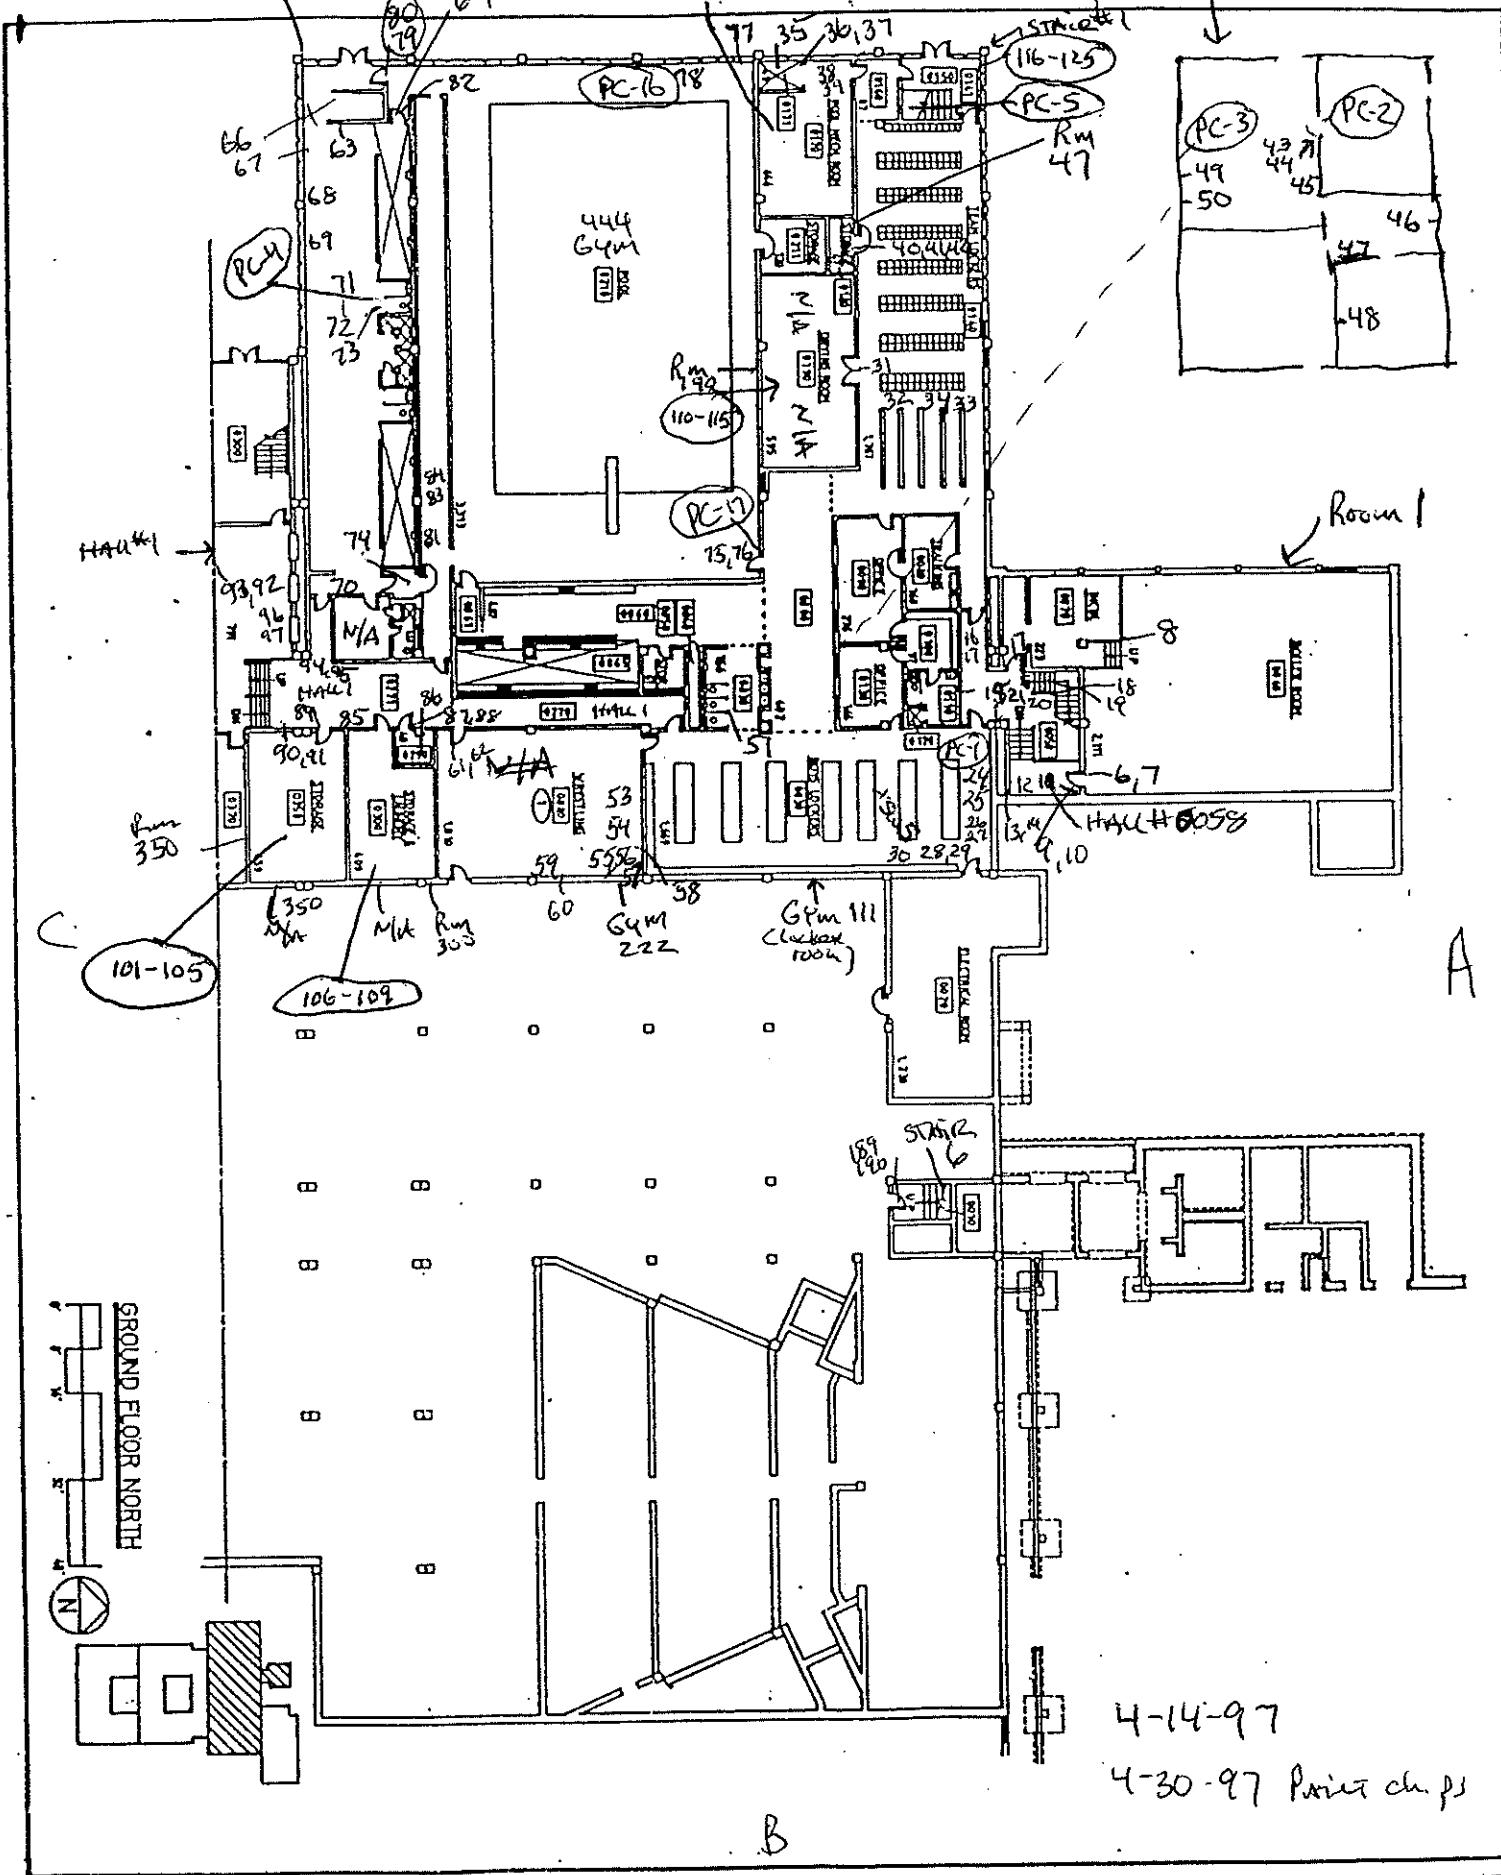

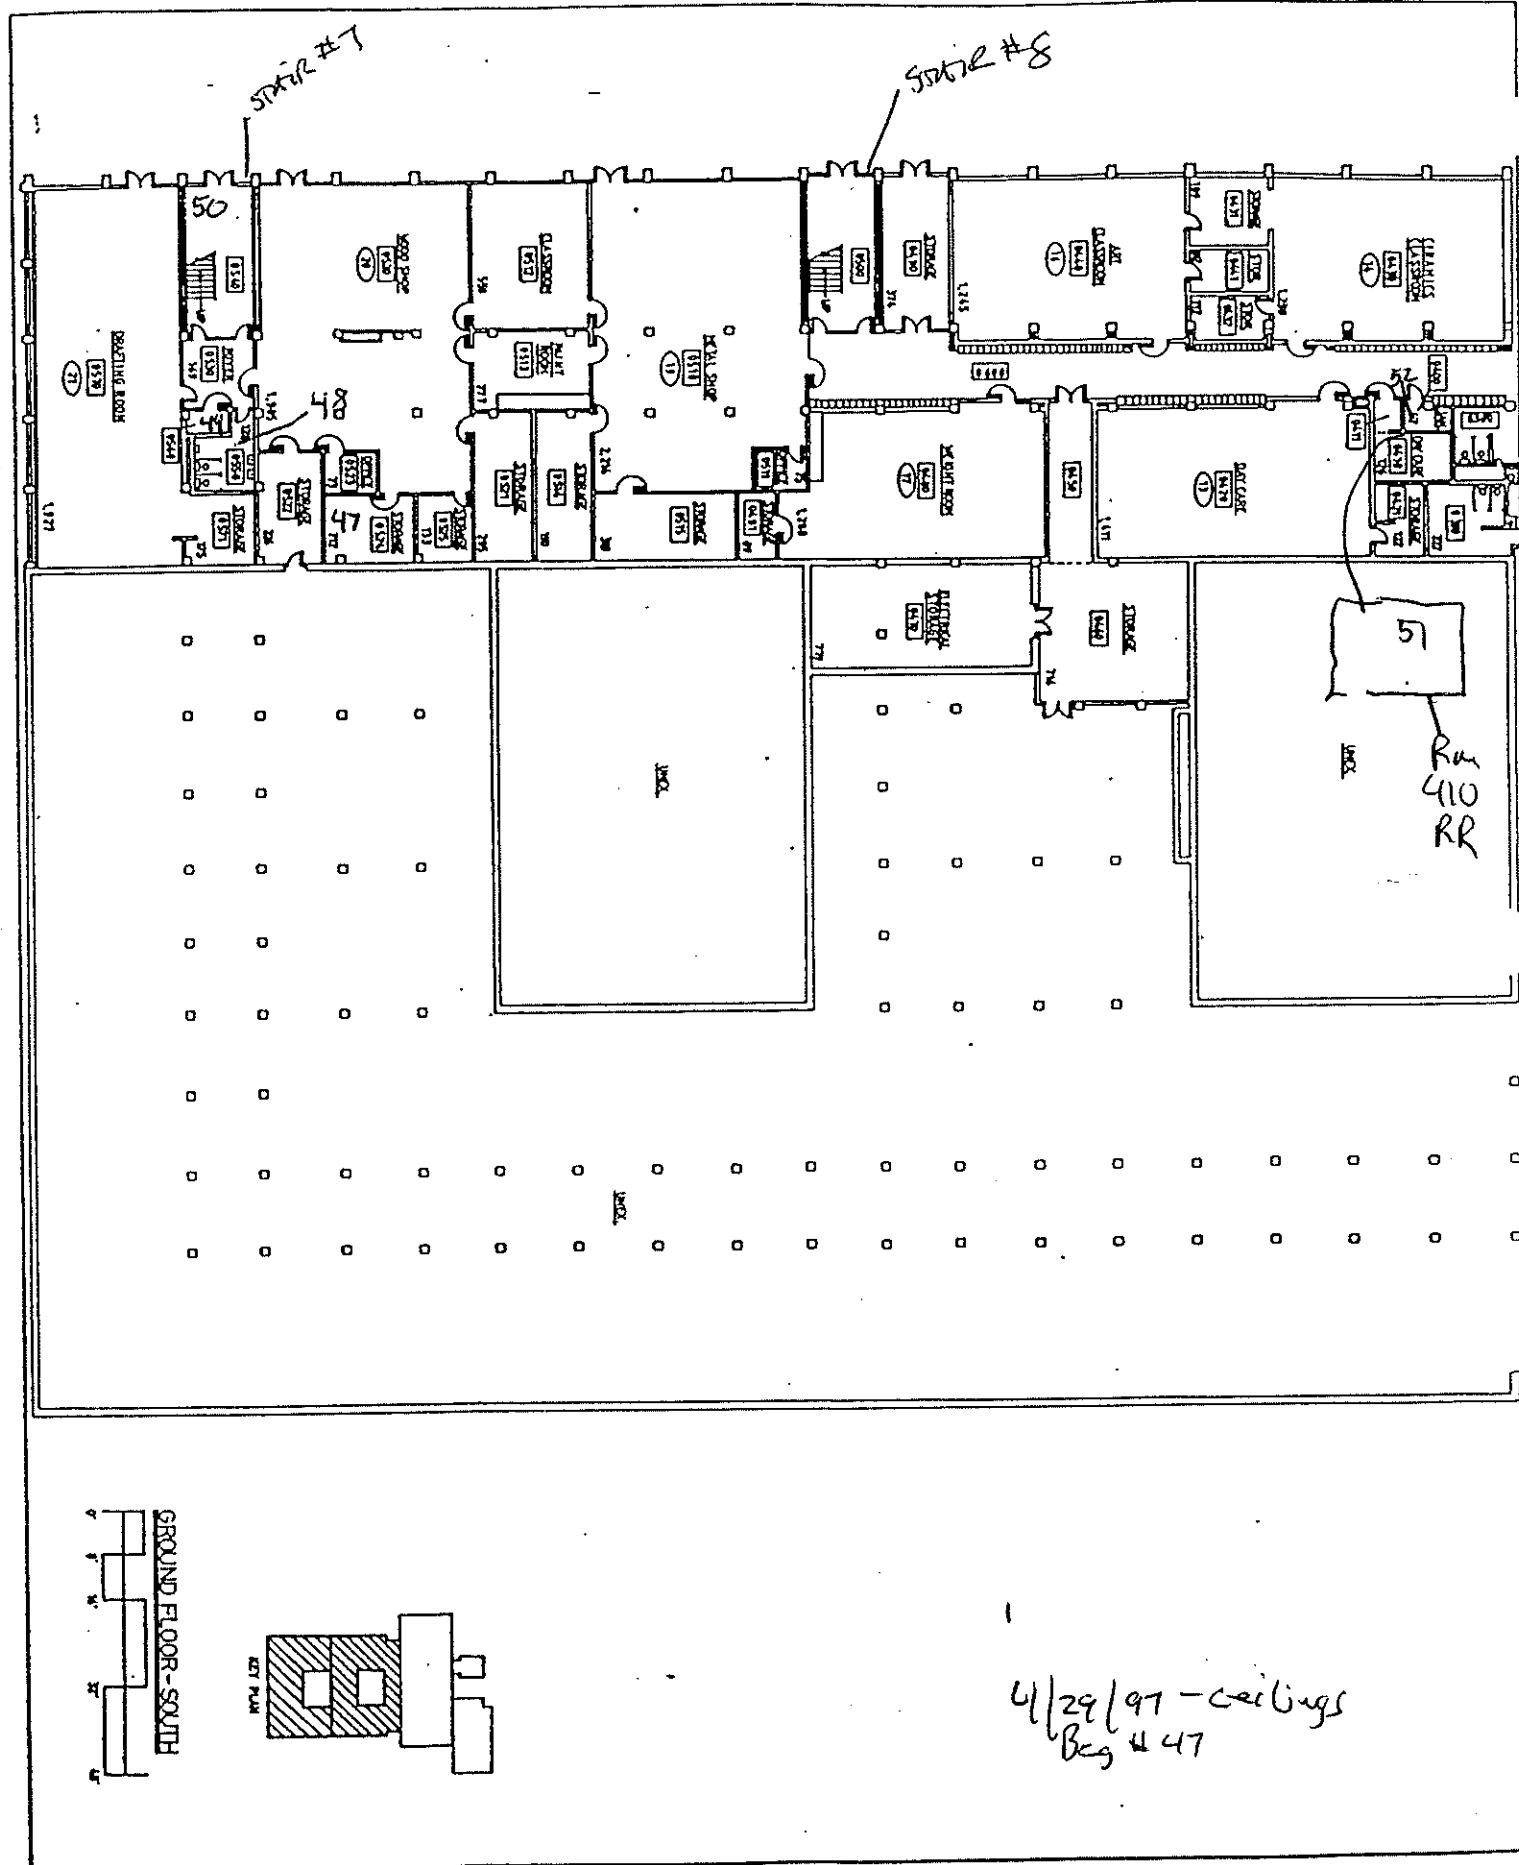


INDEPENDENT SCHOOL DIST. #625  
360 CULBORNE STREET  
ST. PAUL, MINNESOTA 55102

JOHNSON SENIOR HIGH  
1349 ARCADE ST.  
ST. PAUL, MN 55106

CONSTRUCTED: 1963


sheet 5

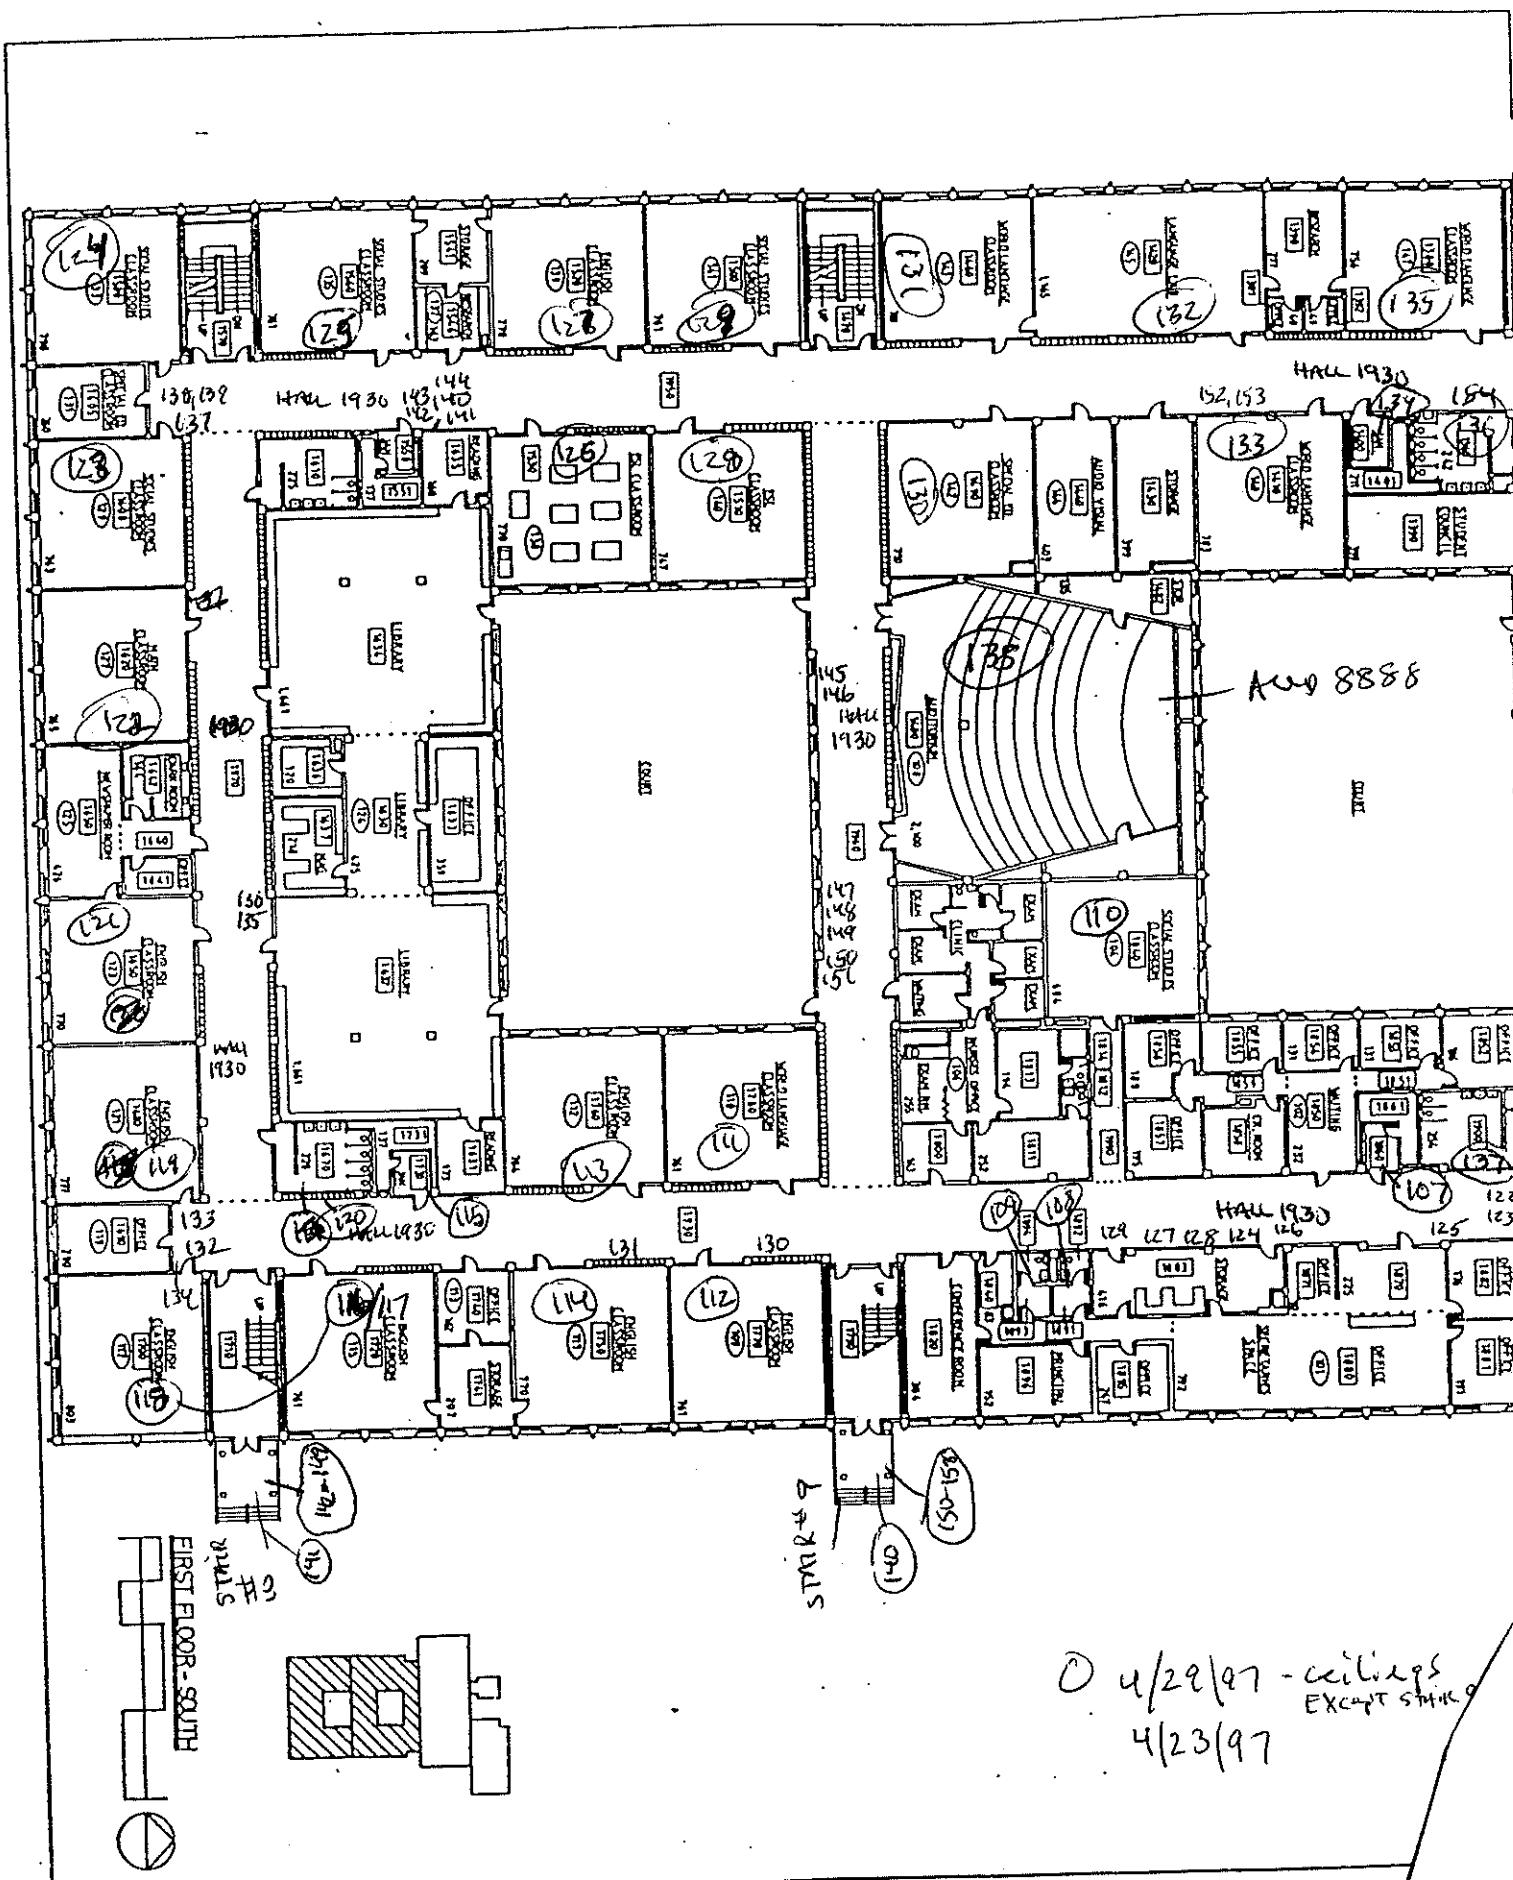

INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

JOHNSON SENIOR HIGH  
1949 ARCADE ST.  
ST. PAUL, MN 55106


CONSTRUCTED: 1963

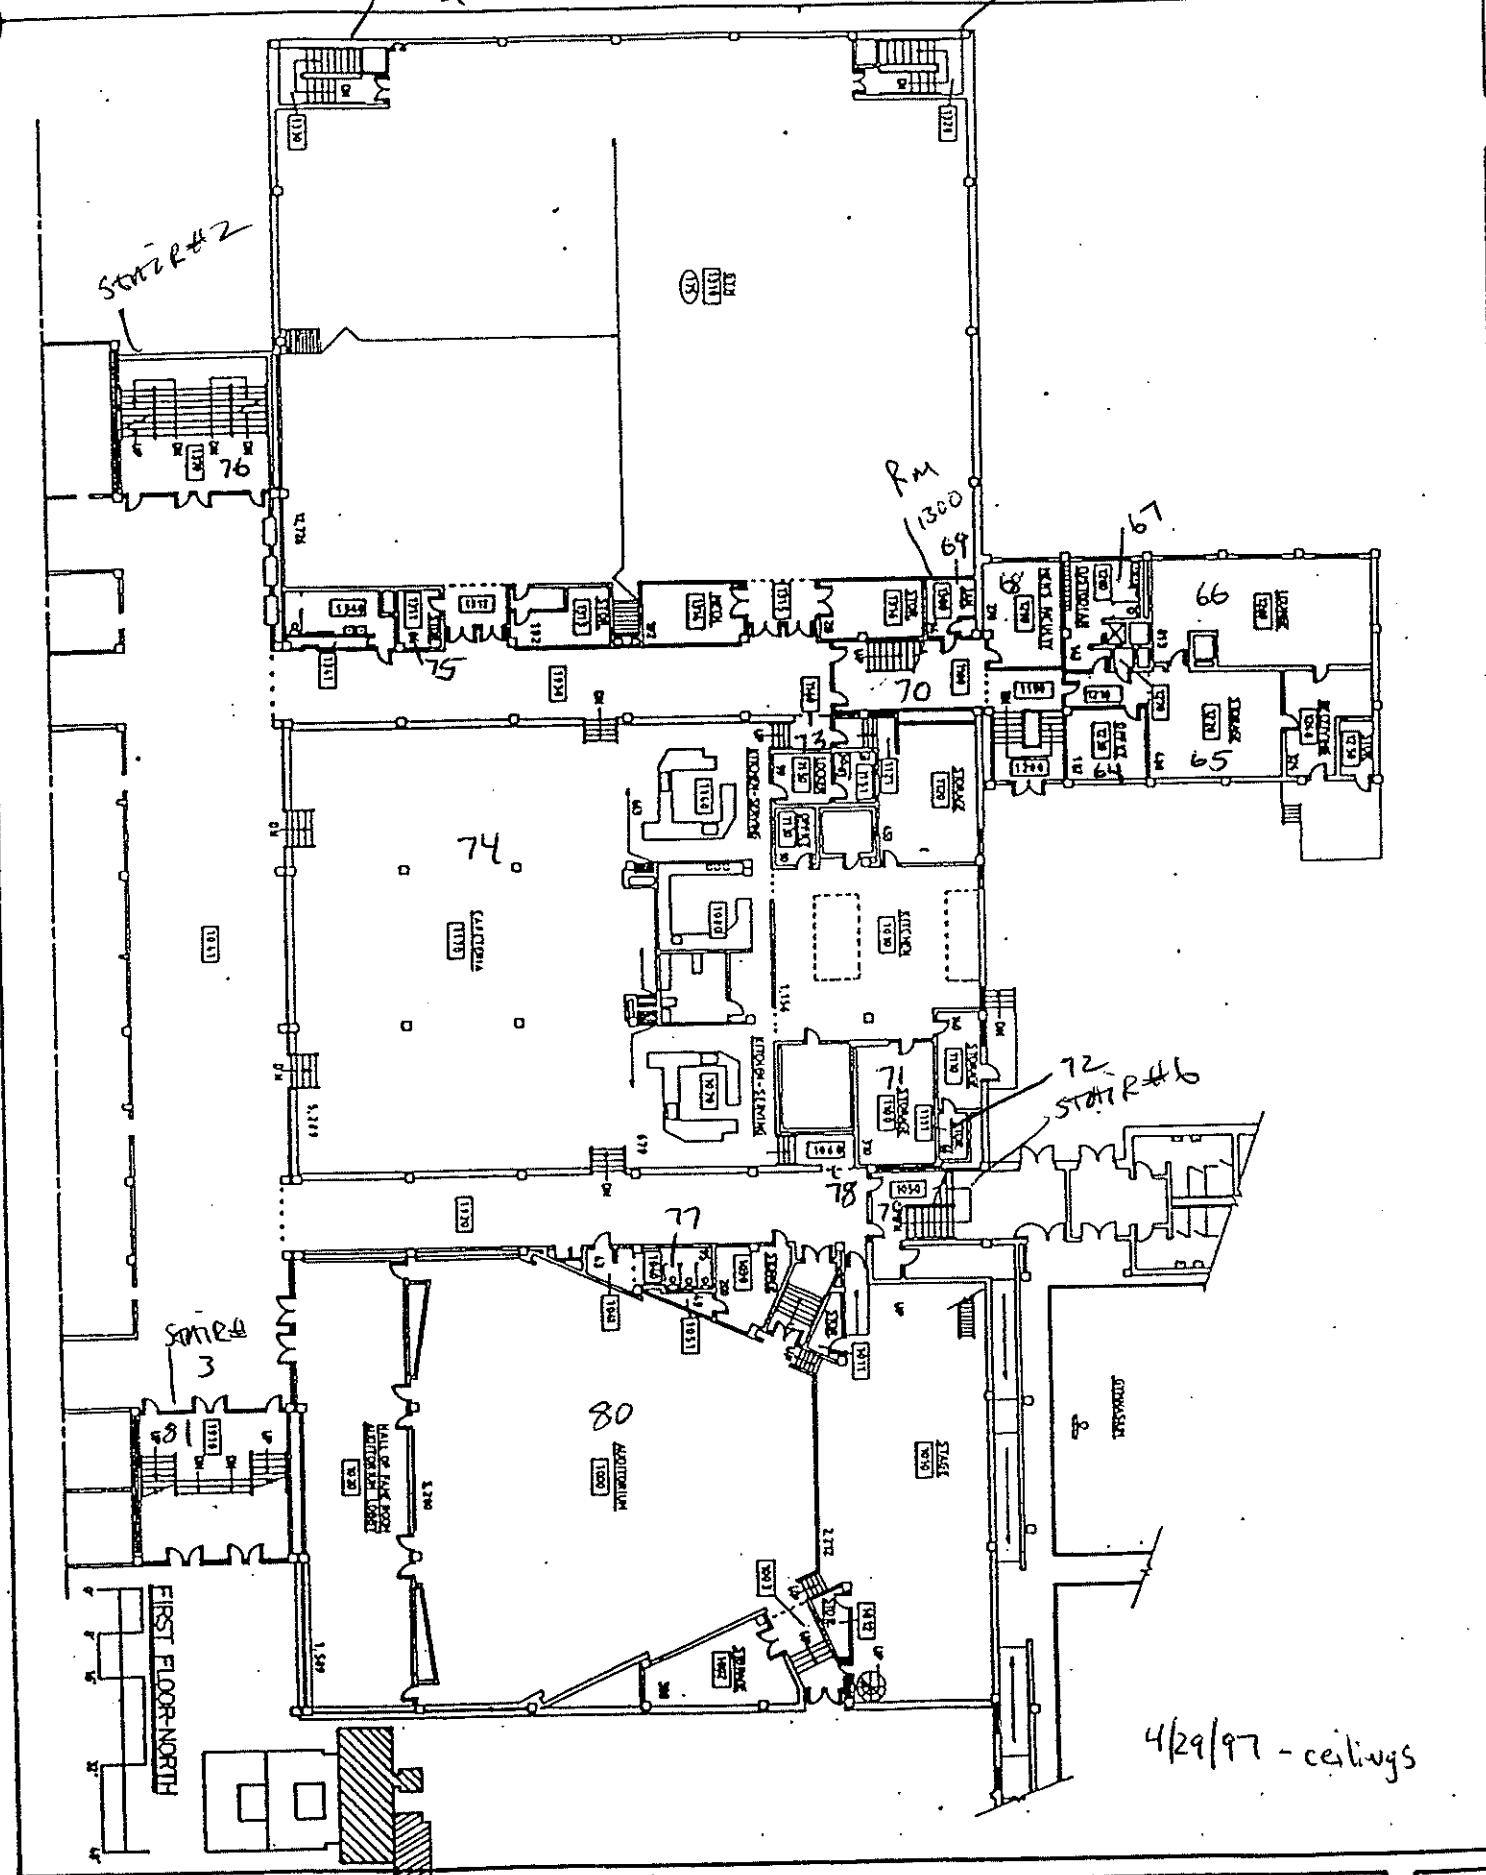

INDEPENDENT SCHOOL DISTRICT #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

JOHNSON SENIOR HIGH  
1949 ARCADE ST.  
ST. PAUL, MN 55106


1963

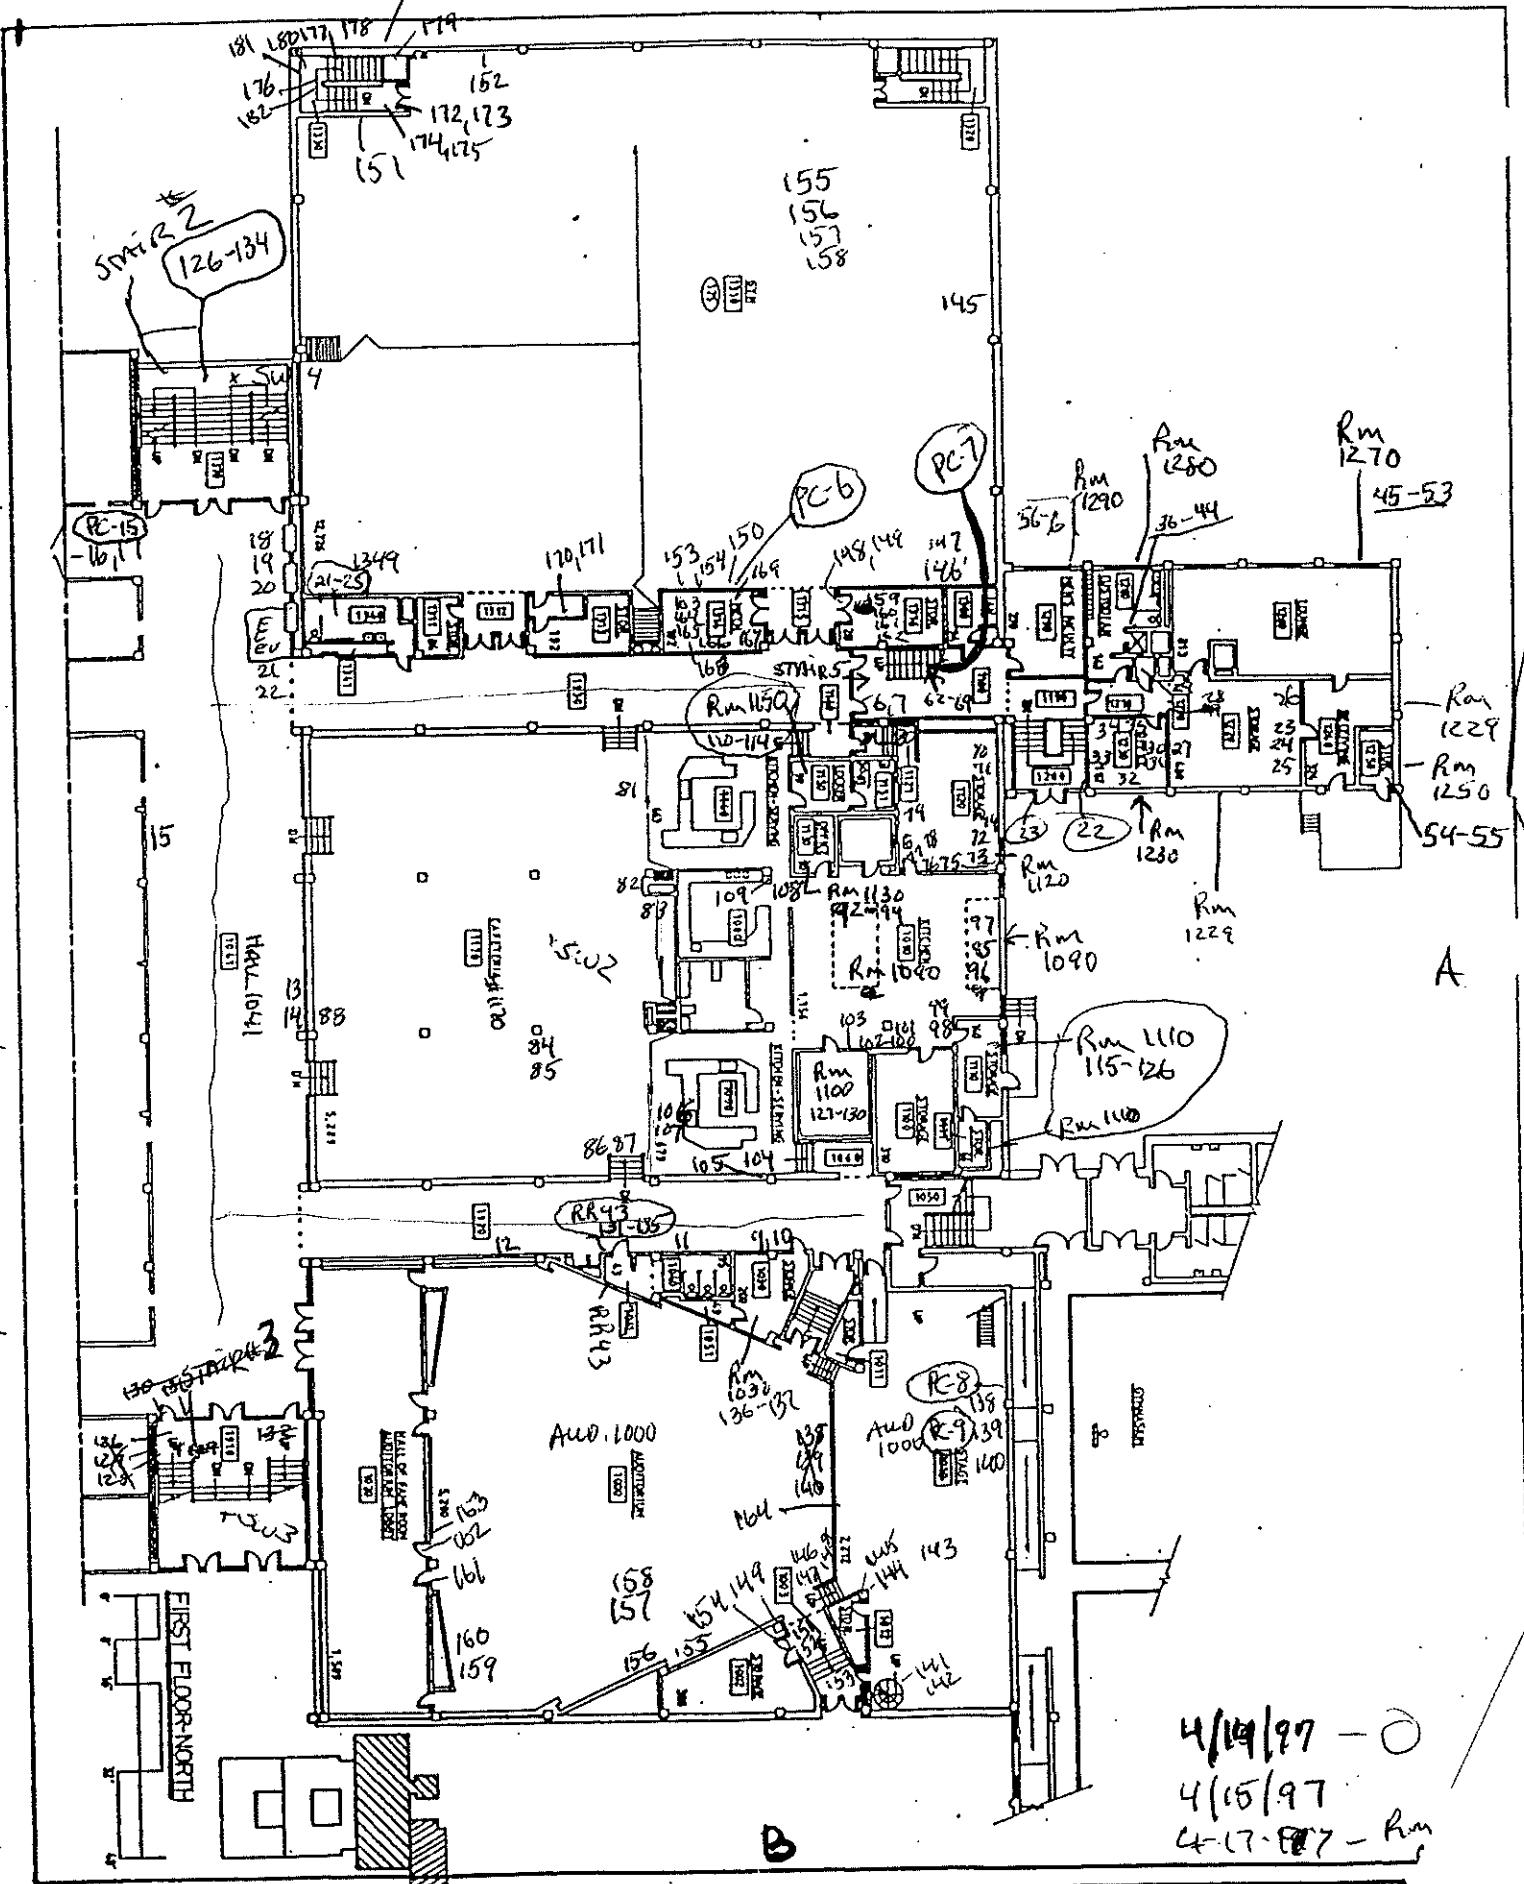

INDEPENDENT SCHOOL DISTRICT #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

JOHNSON SENIOR HIGH  
1949 ARCADE ST.  
ST. PAUL, MN 55106


1963

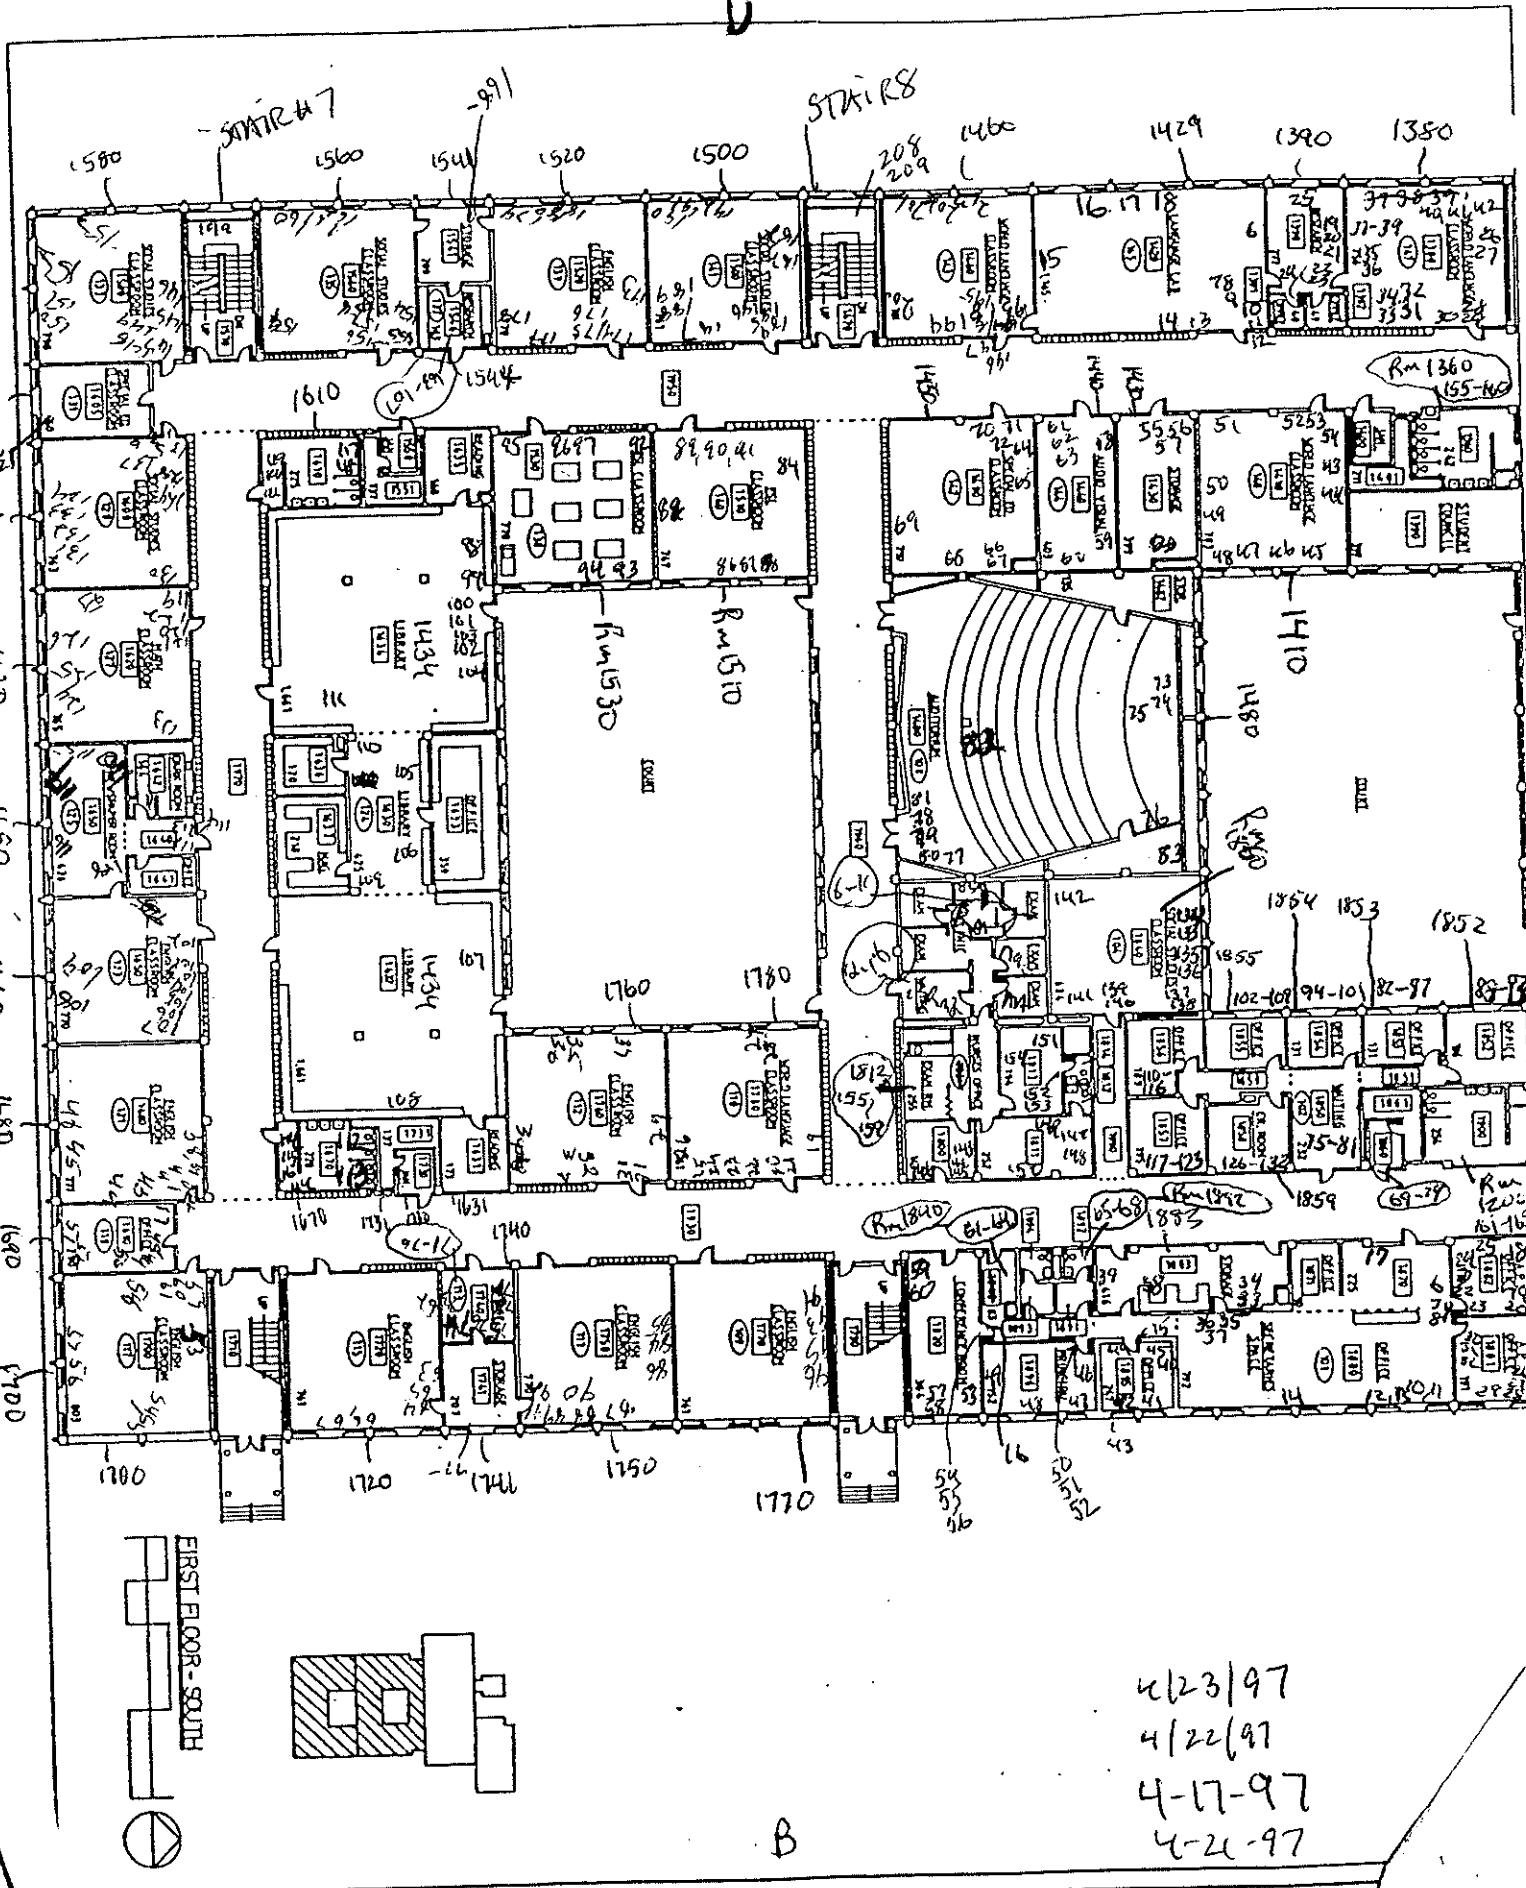

INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

JOHNSON SENIOR HIGH  
1949 ARCADE ST  
ST. PAUL, MN 55106

CONSTRUCTED: 1963

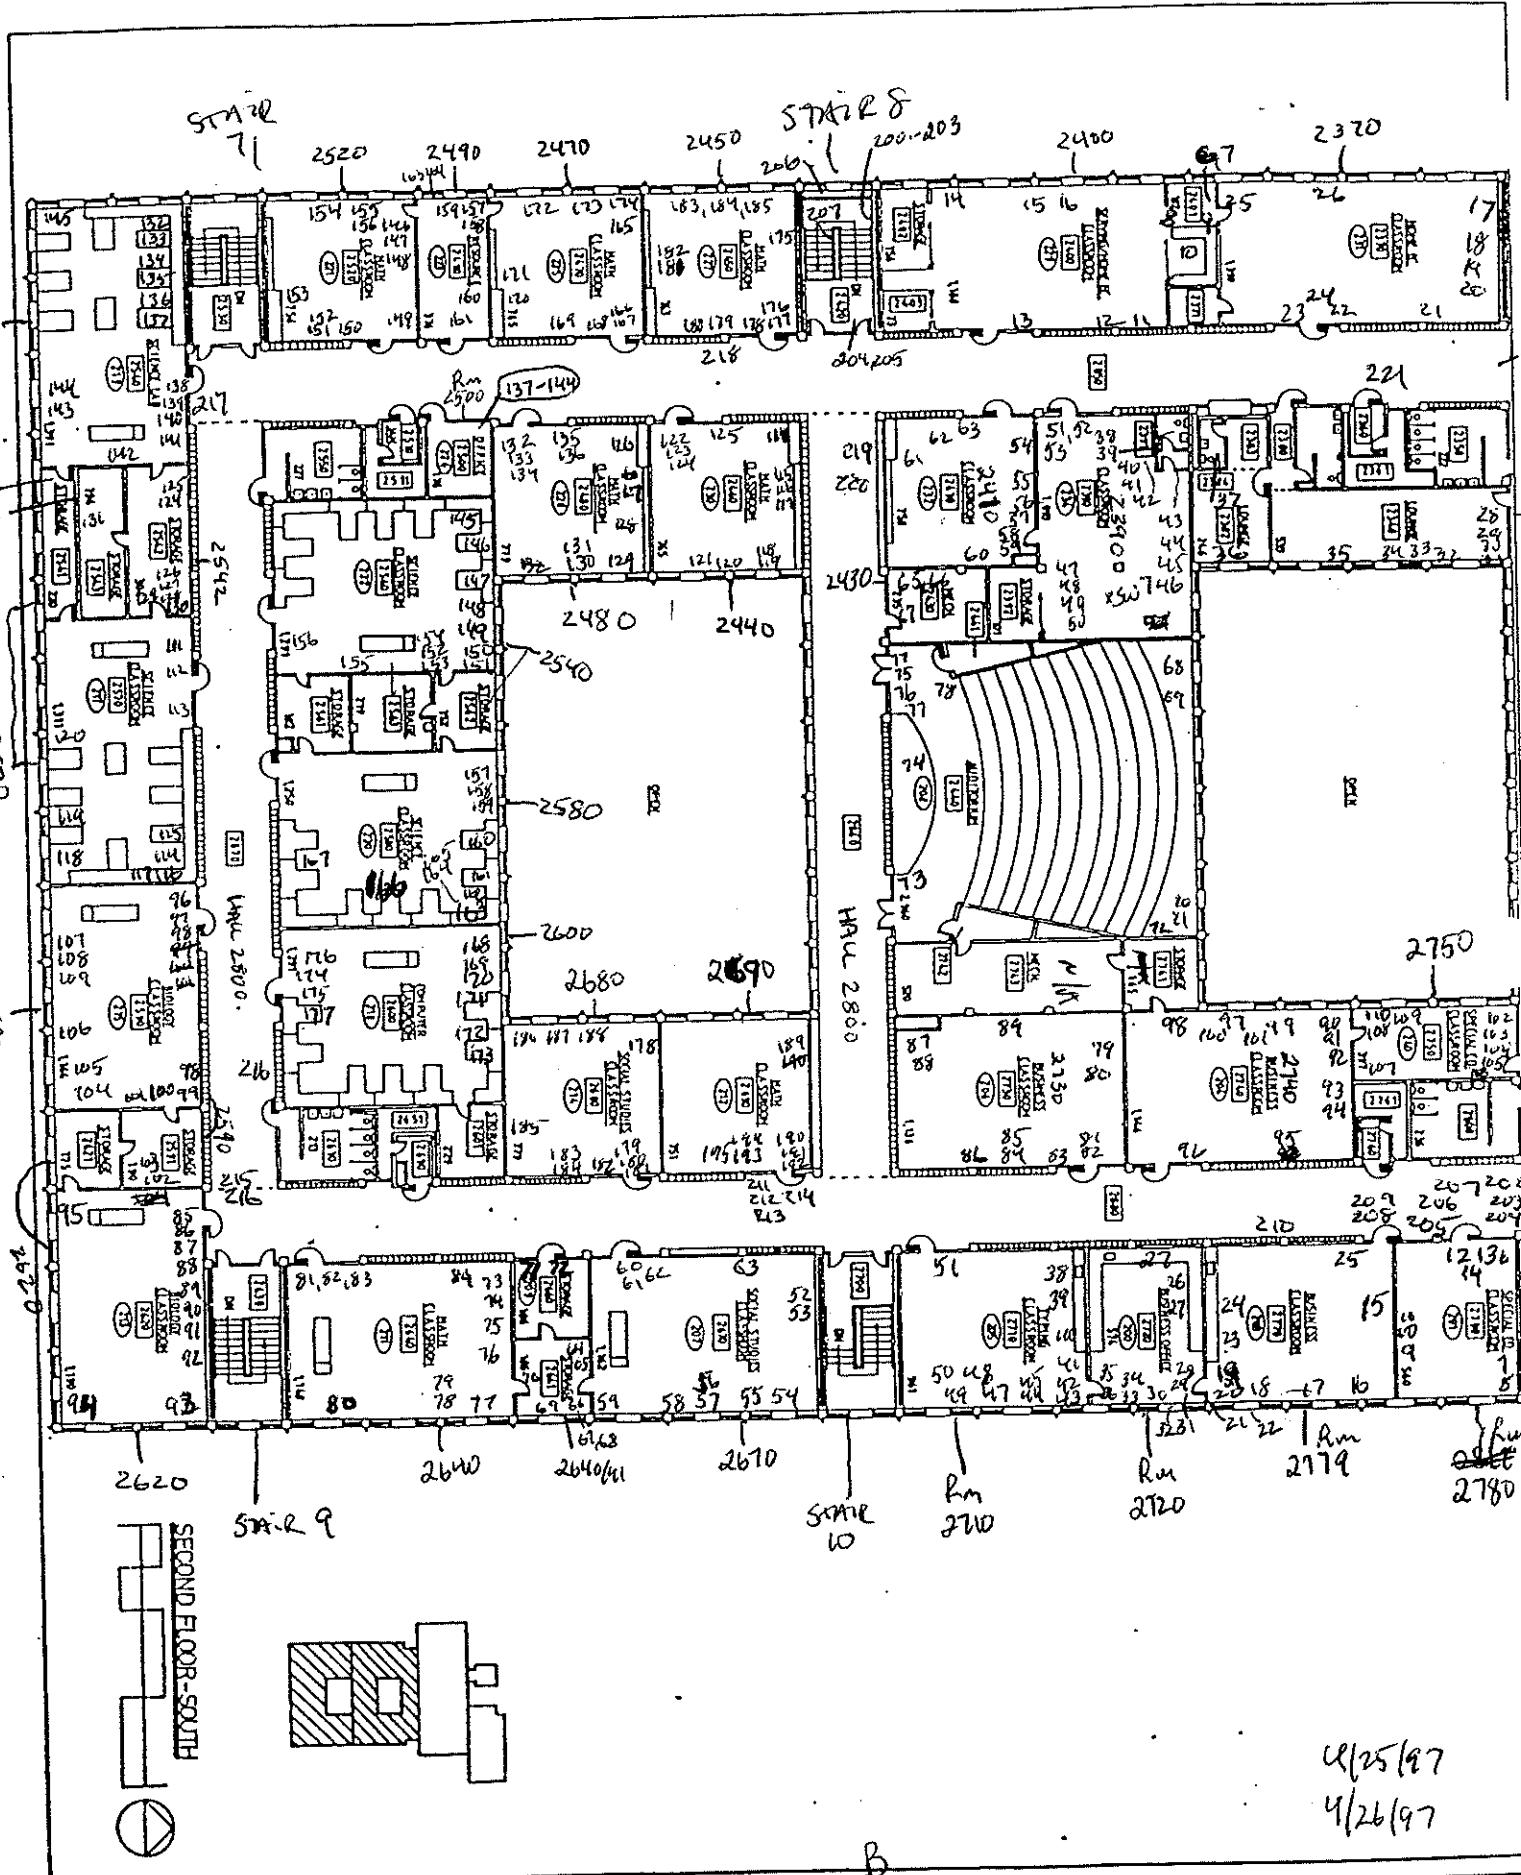


INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

JOHNSON SENIOR HIGH  
1349 ARCADE ST.  
ST. PAUL, MN 55106

CONSTRUCTED: 1963


4/25/97  
4/26/97

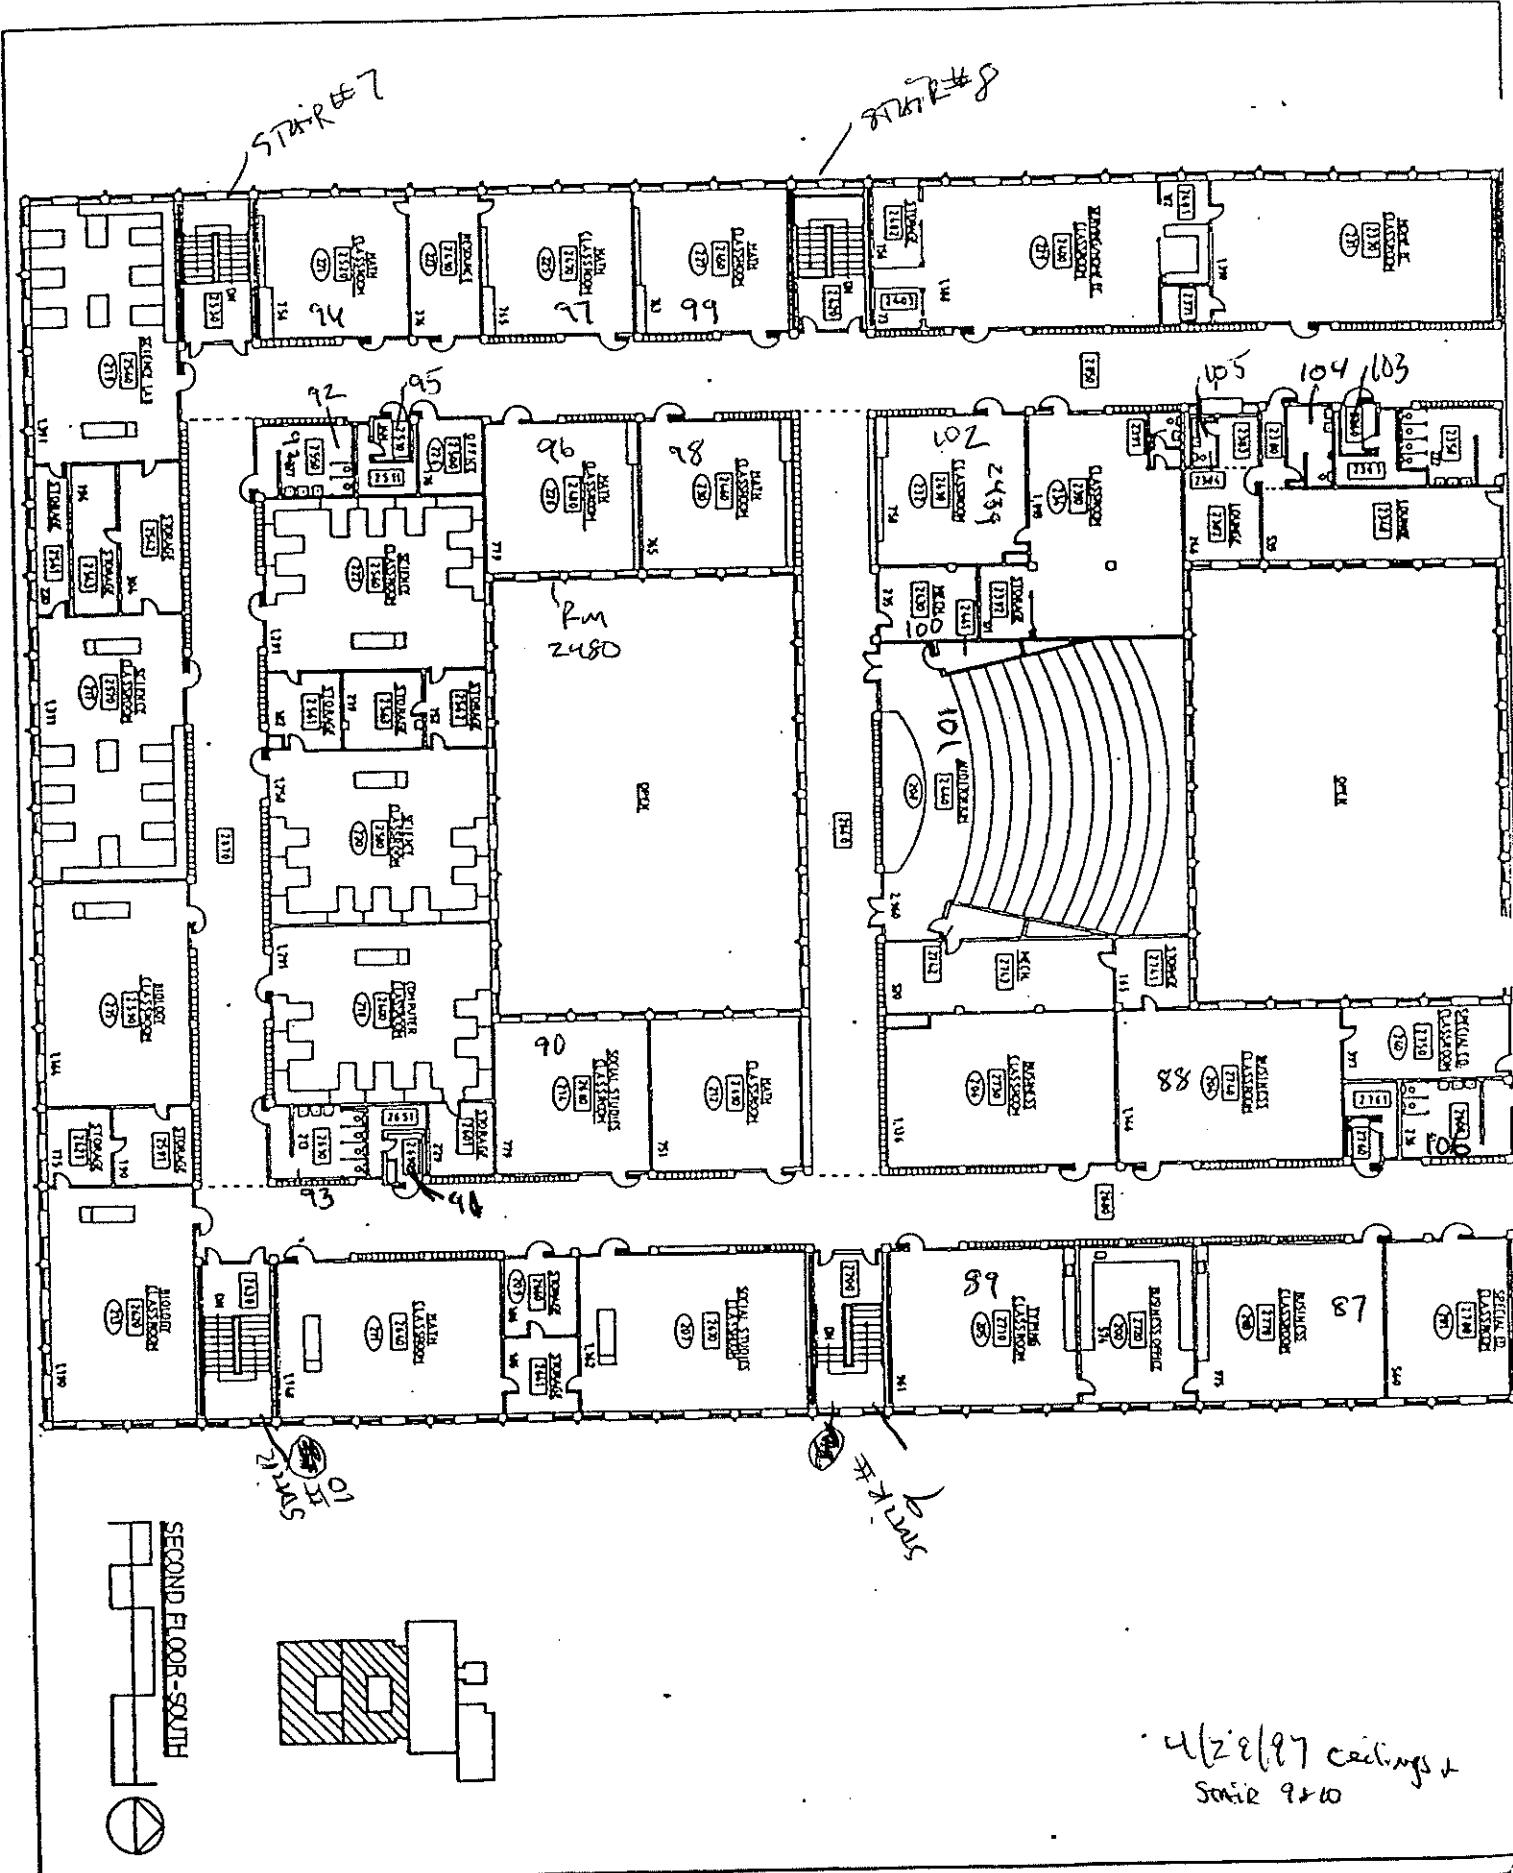

INDEPENDENT SCHOOL DIST. #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

JOHNSON SENIOR HIGH  
1349 ARCADE ST.  
ST. PAUL, MN 55106

CONSTRUCTED: 1963

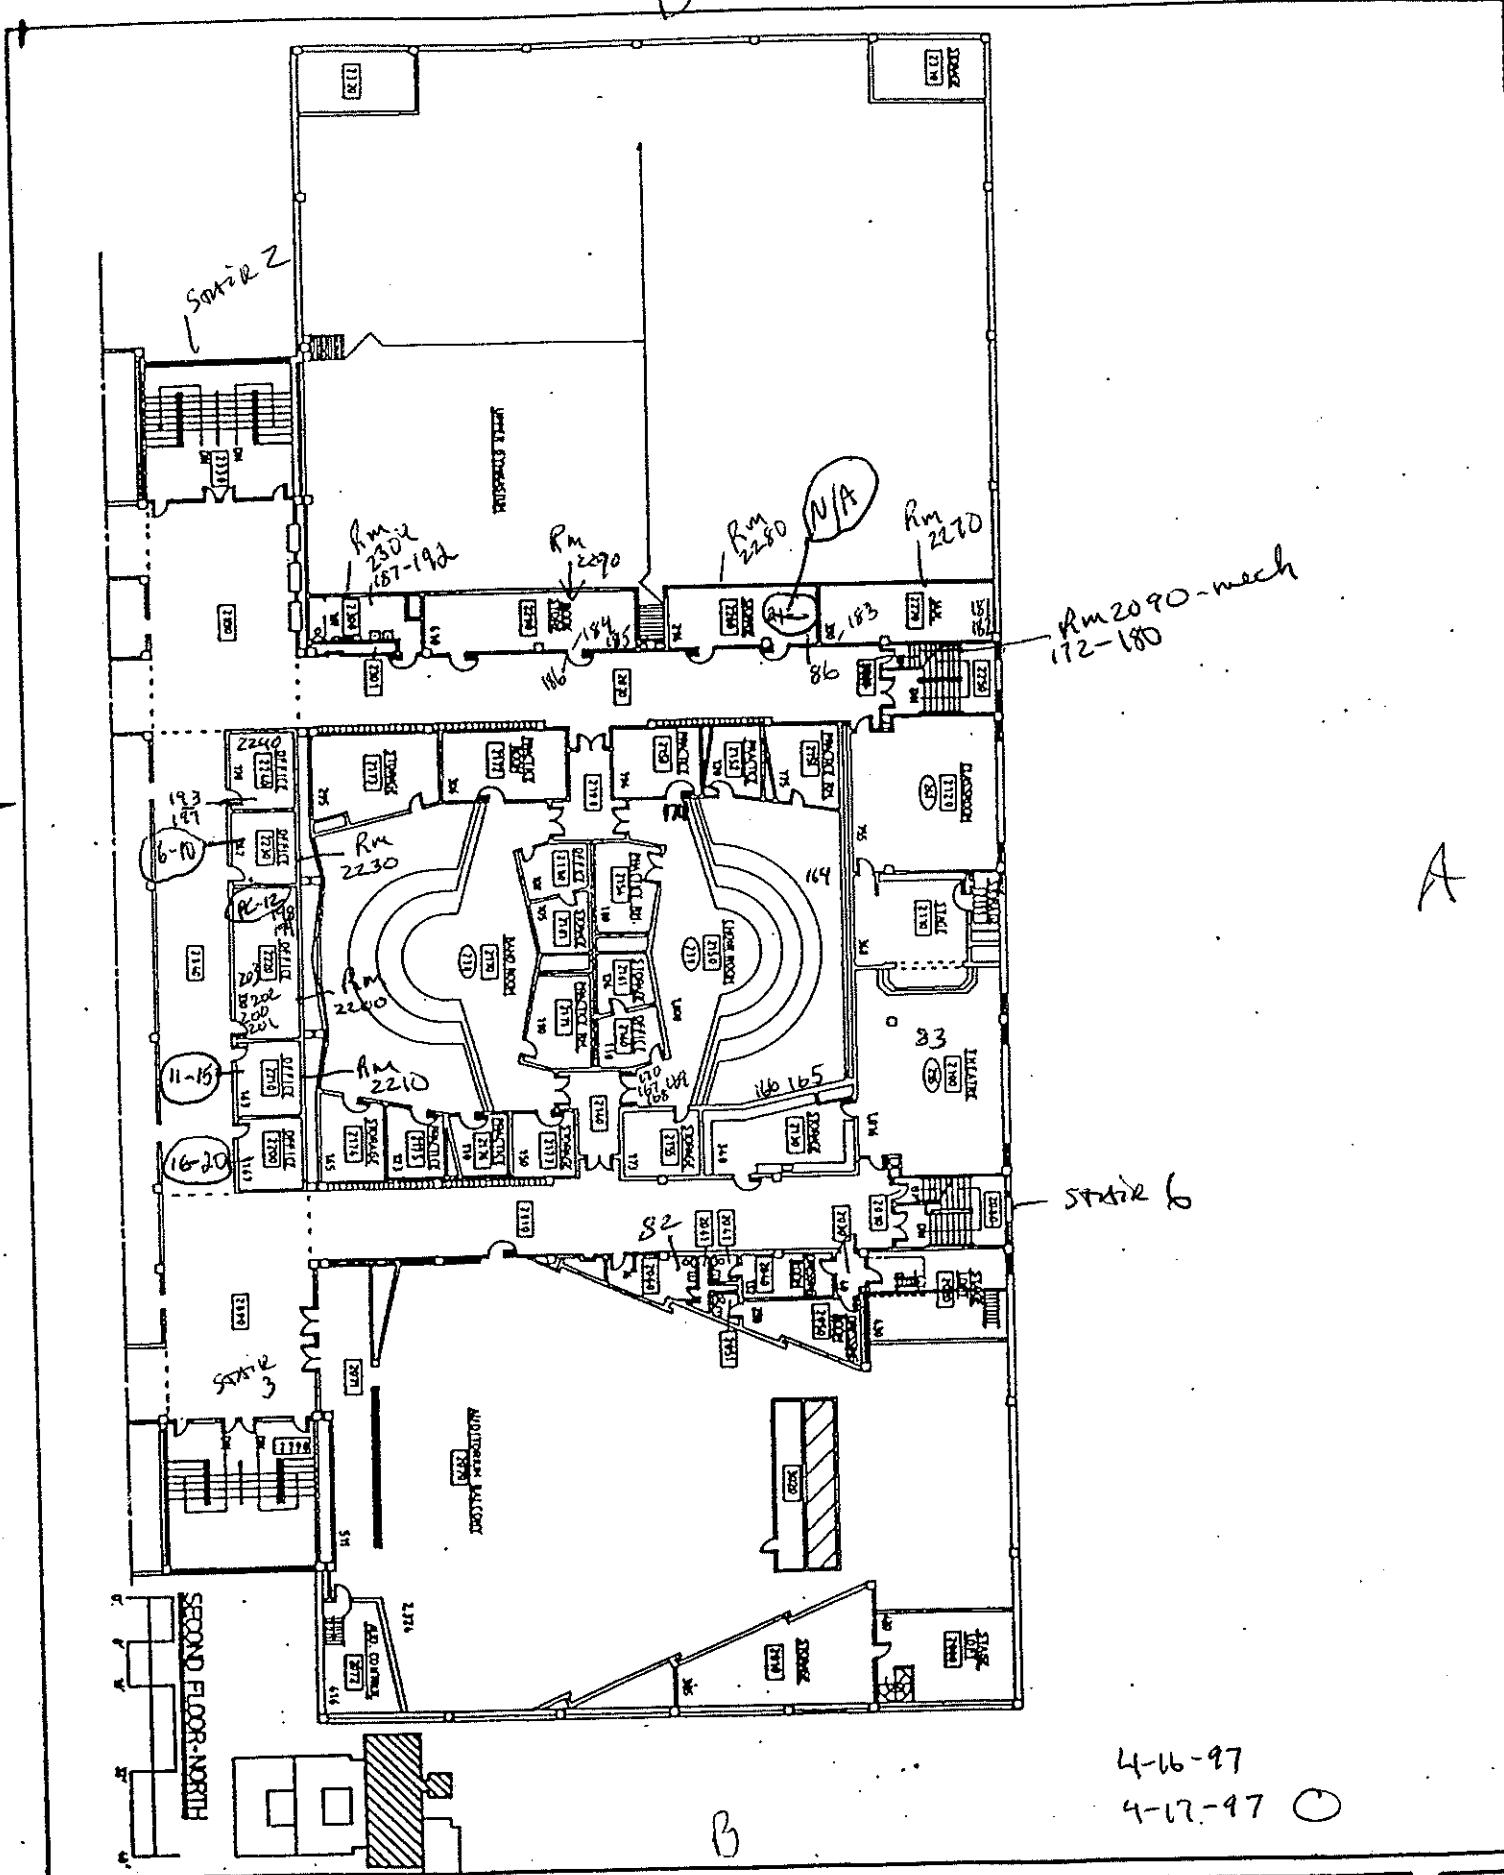


INDEPENDENT SCHOOL DISTRICT #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

JOHNSON SENIOR HIGH  
1349 ARCADE ST  
ST. PAUL, MN 55106

1963

4

9

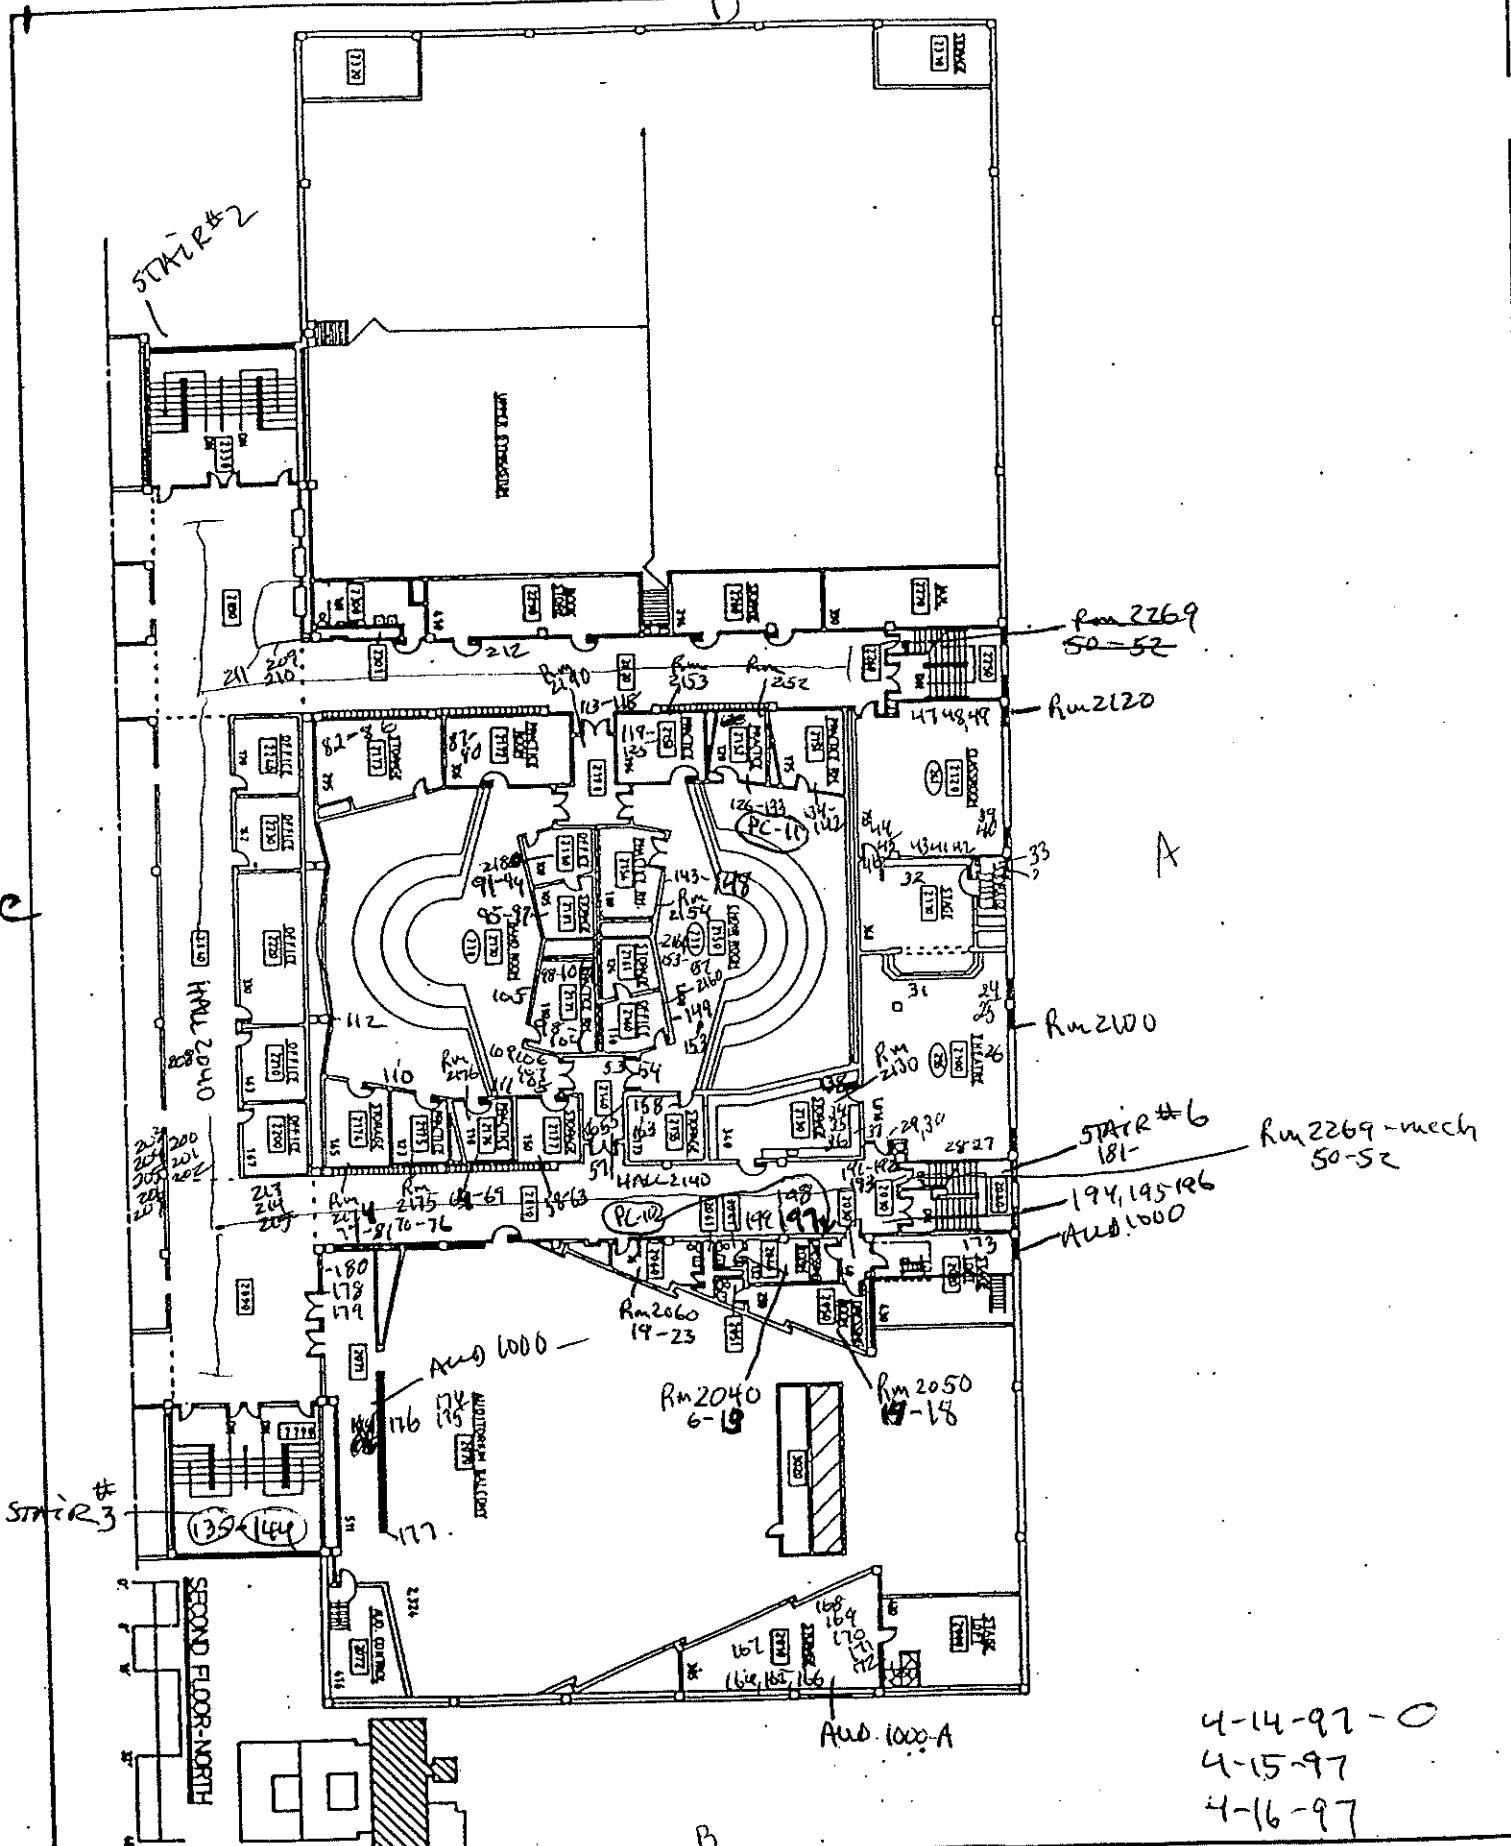

INDEPENDENT SCHOOL DISTRICT #625  
360 COLBORNE STREET  
ST. PAUL, MINNESOTA 55102

JOHNSON SENIOR HIGH  
1349 ARCADE ST  
ST. PAUL, MN 55106

1953

4

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
1	John A. Johnson Senior High School											
2												
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
4	1963 Bldg	138	XRF	4/15/97	1	Auditorium	1000	Wall	Wall	Solid	Concrete	0.1
5	1963 Bldg	139	XRF	4/15/97	1	Auditorium	1000	Wall	Wall	Solid	Concrete	0.05
6	1963 Bldg	140	XRF	4/15/97	1	Auditorium	1000		Radiator	Solid	Metal	0.08
7	1963 Bldg	141	XRF	4/15/97	1	Auditorium	1000	Stairs	Hand rail	Solid	Metal	0.11
8	1963 Bldg	142	XRF	4/15/97	1	Auditorium	1000	Stairs	Tread	Solid	Metal	0.22
9	1963 Bldg	143	XRF	4/15/97	1	Auditorium	1000	Floor		Solid	Wood	0
10	1963 Bldg	144	XRF	4/15/97	1	Auditorium	1000	Window	Casing	Solid	Metal	0.89
11	1963 Bldg	145	XRF	4/15/97	1	Auditorium	1000	Wall	Wall	Solid	Concrete	0.08
12	1963 Bldg	146	XRF	4/15/97	1	Auditorium	1000	Wall	Wall	Solid	Concrete	0.06
13	1963 Bldg	147	XRF	4/15/97	1	Auditorium	1000	Stairs	Baseboar	Solid	Wood	0.01
14	1963 Bldg	148	XRF	4/15/97	1	Auditorium	1000	Stairs	Hand rail	Solid	Wood	0
15	1963 Bldg	149	XRF	4/15/97	1	Auditorium	1000	Wall	Wall	Solid	Concrete	0.13
16	1963 Bldg	150	XRF	4/15/97	1	Auditorium	1000		Radiator	Solid	Metal	0.01
17	1963 Bldg	151	XRF	4/15/97	1	Auditorium	1000	Door	Door	Solid	Metal	0.28
18	1963 Bldg	152	XRF	4/15/97	1	Auditorium	1000	Door	Casing	Solid	Metal	0.21
19	1963 Bldg	153	XRF	4/15/97	1	Auditorium	1000	Stairs	Hand rail	Solid	Wood	0.01
20	1963 Bldg	154	XRF	4/15/97	1	Auditorium	1000	Door	Door	Solid	Wood	0.01
21	1963 Bldg	155	XRF	4/15/97	1	Auditorium	1000		Radiator	Solid	Metal	0.08
22	1963 Bldg	156	XRF	4/15/97	1	Auditorium	1000	Wall	Wall Rgstr	Solid	Metal	0.01
23	1963 Bldg	157	XRF	4/15/97	1	Auditorium	1000	Chair	Arm Rest	Solid	Wood	0
24	1963 Bldg	158	XRF	4/15/97	1	Auditorium	1000	Chair	Back	Solid	Metal	0.01
25	1963 Bldg	159	XRF	4/15/97	1	Auditorium	1000	Wall	Wall	Solid	Concrete	0.04
26	1963 Bldg	160	XRF	4/15/97	1	Auditorium	1000	Wall	Casing	Solid	Wood	0.02
27	1963 Bldg	161	XRF	4/15/97	1	Auditorium	1000	Door	Door	Solid	Wood	0.01
28	1963 Bldg	162	XRF	4/15/97	1	Auditorium	1000	Wall	Midle Wall	Solid	Concrete	0.01
29	1963 Bldg	163	XRF	4/15/97	1	Auditorium	1000	Stage	Wall	Solid	Wood	0.01
30	1963 Bldg	164	XRF	4/15/97	2	Auditorium	1000	Wall	Midle Wall	Solid	Concrete	0
31	1963 Bldg	165	XRF	4/15/97	2	Auditorium	1000	Wall	Midle Wall	Solid	Concrete	0
32	1963 Bldg	166	XRF	4/15/97	2	Auditorium	1000		Radiator	Solid	Metal	0.04
33	1963 Bldg	167	XRF	4/15/97	2	Auditorium	1000	Ceiling		Solid	Plaster	0.01
34	1963 Bldg	168	XRF	4/15/97	2	Auditorium	1000		Locker	Solid	Metal	0.13
35	1963 Bldg	169	XRF	4/15/97	2	Auditorium	1000		Locker	Solid	Metal	0.01
36	1963 Bldg	170	XRF	4/15/97	2	Auditorium	1000		Locker	Solid	Metal	0.01
37	1963 Bldg	171	XRF	4/15/97	2	Auditorium	1000	Door	Door	Solid	Metal	0.37
38	1963 Bldg	172	XRF	4/15/97	2	Auditorium	1000	Door	Casing	Solid	Metal	0.26
39	1963 Bldg	173	XRF	4/15/97	2	Auditorium	1000	Ceiling		Solid	Concrete	0.04
40	1963 Bldg	174	XRF	4/15/97	2	Auditorium	1000	Stairs	Hand rail	Solid	Wood	0
41	1963 Bldg	175	XRF	4/15/97	2	Auditorium	1000	Stairs	Baluster	Solid	Metal	0.02
42	1963 Bldg	176	XRF	4/15/97	2	Auditorium	1000	Door	Crown mol	Solid	Wood	0.01
43	1963 Bldg	177	XRF	4/15/97	2	Auditorium	1000	Wall	Wall	Solid	Concrete	0.02
44	1963 Bldg	178	XRF	4/15/97	2	Auditorium	1000	Door	Door	Solid	Metal	0.25
45	1963 Bldg	179	XRF	4/15/97	2	Auditorium	1000	Door	Casing	Solid	Metal	0.02
46	1963 Bldg	180	XRF	4/15/97	2	Auditorium	1000	Window	Panel	Solid	Wood	0
47	1963 Bldg	80	XRF	4/29/97	1	Auditorium	1000	Ceiling		Solid	Plaster	0.01
48	1963 Bldg	73	XRF	4/23/97	1	Auditorium	1480		Radiator	Solid	Metal	0.08
49	1963 Bldg	74	XRF	4/23/97	1	Auditorium	1480	Wall	Midle Wall	Solid	Concrete	0.08
50	1963 Bldg	75	XRF	4/23/97	1	Auditorium	1480	Ceiling	DC Tile	Solid	Wood	0.01
51	1963 Bldg	76	XRF	4/23/97	1	Auditorium	1480	Wall	Wall	Solid	Concrete	0.02
52	1963 Bldg	77	XRF	4/23/97	1	Auditorium	1480	Wall	Middle Wall	Solid	Wood	0.02
53	1963 Bldg	78	XRF	4/23/97	1	Auditorium	1480	Door	Door	Solid	Wood	0.01
54	1963 Bldg	79	XRF	4/23/97	1	Auditorium	1480	Door	Casing	Solid	Metal	0.07
55	1963 Bldg	80	XRF	4/23/97	1	Auditorium	1480	Door	Header	Solid	Wood	0
56	1963 Bldg	81	XRF	4/23/97	1	Auditorium	1480	Wall	Midle Wall	Solid	Concrete	0.02
57	1963 Bldg	82	XRF	4/23/97	1	Auditorium	1480	Wall	Midle Wall	Solid	Concrete	0.05
58	1963 Bldg	83	XRF	4/23/97	1	Auditorium	1480		Radiator	Solid	Metal	0.06
59	1963 Bldg	68	XRF	4/26/97	2	Auditorium	2440	Door	Casing	Solid	Wood	0.02
60	1963 Bldg	69	XRF	4/26/97	2	Auditorium	2440		Radiator	Solid	Metal	0.1

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
61	1963 Bldg	70	XRF	4/26/97	2	Auditorium	2440	Wall	Midle Wall	Solid	Concrete	0.07
62	1963 Bldg	71	XRF	4/26/97	2	Auditorium	2440	Wall	Wall	Solid	Concrete	0.04
63	1963 Bldg	72	XRF	4/26/97	2	Auditorium	2440	Wall	Baseboar	Solid	Concrete	0.15
64	1963 Bldg	73	XRF	4/26/97	2	Auditorium	2440	Wall	Midle Wall	Solid	Concrete	0.03
65	1963 Bldg	74	XRF	4/26/97	2	Auditorium	2440	Ceiling	Baffle	Solid	Wood	0
66	1963 Bldg	75	XRF	4/26/97	2	Auditorium	2440	Door	Door	Solid	Wood	0.02
67	1963 Bldg	76	XRF	4/26/97	2	Auditorium	2440	Door	Casing	Solid	Metal	0.05
68	1963 Bldg	77	XRF	4/26/97	2	Auditorium	2440	Door	Header	Solid	Wood	0
69	1963 Bldg	78	XRF	4/26/97	2	Auditorium	2440		Elec Pane	Solid	Metal	0.03
70	1963 Bldg	101	XRF	4/29/97	2	Auditorium	2440	Ceiling		Solid	Plaster	0
71	1963 Bldg	138	XRF	4/29/97	1	Auditorium	8888	Ceiling		Solid	Plaster	0
72	1963 Bldg	81	XRF	4/15/97	1	Cafeteria	1170	Door	Door	Solid	Metal	0.51
73	1963 Bldg	82	XRF	4/15/97	1	Cafeteria	1170	Wall	Midle Wall	Solid	Concrete	0
74	1963 Bldg	83	XRF	4/15/97	1	Cafeteria	1170		Elec Pane	Solid	Metal	0.03
75	1963 Bldg	84	XRF	4/15/97	1	Cafeteria	1170	Wall	Wall	Solid	Concrete	0
76	1963 Bldg	85	XRF	4/15/97	1	Cafeteria	1170	Wall	Wall	Solid	Concrete	0
77	1963 Bldg	86	XRF	4/15/97	1	Cafeteria	1170	Stairs	Hand rail	Solid	Wood	0
78	1963 Bldg	87	XRF	4/15/97	1	Cafeteria	1170	Stairs	Newal pos	Solid	Metal	0.02
79	1963 Bldg	88	XRF	4/15/97	1	Cafeteria	1170	Wall	Wall	Solid	Wood	0
80	1963 Bldg	74	XRF	4/29/97	1	Cafeteria	1170	Ceiling		Solid	Concrete	0.02
81	1963 Bldg	26	XRF	4/17/97	1	Classroom	430	Wall	Midle Wall	Solid	Concrete	0.04
82	1963 Bldg	27	XRF	4/17/97	1	Classroom	430	Cabinet	Outside	Solid	Wood	0.01
83	1963 Bldg	28	XRF	4/17/97	1	Classroom	430	Cabinet	Door	Solid	Wood	0
84	1963 Bldg	29	XRF	4/17/97	1	Classroom	430	Wall	Midle Wall	Solid	Concrete	0.02
85	1963 Bldg	30	XRF	4/17/97	1	Classroom	430	Door	Door	Solid	Wood	0.01
86	1963 Bldg	31	XRF	4/17/97	1	Classroom	430	Door	Casing	Solid	Metal	0.04
87	1963 Bldg	32	XRF	4/17/97	1	Classroom	430		Radiator	Solid	Metal	0.09
88	1963 Bldg	70	XRF	4/17/97	1	Classroom	430	Wall	Midle Wall	Solid	Concrete	0.01
89	1963 Bldg	71	XRF	4/17/97	1	Classroom	430	Wall	Midle Wall	Solid	Concrete	0.02
90	1963 Bldg	72	XRF	4/17/97	1	Classroom	430	Wall	Midle Wall	Solid	Concrete	0.03
91	1963 Bldg	73	XRF	4/17/97	1	Classroom	430	Wall	Midle Wall	Solid	Concrete	0.05
92	1963 Bldg	74	XRF	4/17/97	1	Classroom	430	Door	Door	Solid	Wood	0.01
93	1963 Bldg	75	XRF	4/17/97	1	Classroom	430	Door	Casing	Solid	Metal	0.05
94	1963 Bldg	76	XRF	4/17/97	1	Classroom	430	Wall	Midle Wall	Peeling	Concrete	0.03
95	1963 Bldg	77	XRF	4/17/97	1	Classroom	430	Wall	Midle Wall	Solid	Concrete	0.06
96	1963 Bldg	33	XRF	4/17/97	1	Classroom	440	Door	Door	Solid	Wood	0.01
97	1963 Bldg	34	XRF	4/17/97	1	Classroom	440	Door	Casing	Solid	Metal	0.03
98	1963 Bldg	35	XRF	4/17/97	1	Classroom	440		Elec Pane	Solid	Metal	0.05
99	1963 Bldg	36	XRF	4/17/97	1	Classroom	440	Wall	Midle Wall	Solid	Concrete	0.02
100	1963 Bldg	37	XRF	4/17/97	1	Classroom	440	Cabinet	Door	Solid	Wood	0.01
101	1963 Bldg	38	XRF	4/17/97	1	Classroom	440	Wall	Midle Wall	Solid	Concrete	4.04
102	1963 Bldg	39	XRF	4/17/97	1	Classroom	440	Wall	Midle Wall	Solid	Concrete	3.35
103	1963 Bldg	40	XRF	4/17/97	1	Classroom	440	Wall	Midle Wall	Solid	Concrete	0.04
104	1963 Bldg	41	XRF	4/17/97	1	Classroom	440		Radiator	Solid	Metal	0.05
105	1963 Bldg	42	XRF	4/17/97	1	Classroom	440	Wall	Midle Wall	Solid	Concrete	0.07
106	1963 Bldg	83	XRF	4/17/97	1	Classroom	510	Wall	Midle Wall	Solid	Concrete	0.06
107	1963 Bldg	84	XRF	4/17/97	1	Classroom	510	Vent	Wall	Solid	Metal	0.03
108	1963 Bldg	85	XRF	4/17/97	1	Classroom	510	Wall	Midle Wall	Solid	Concrete	0.51
109	1963 Bldg	86	XRF	4/17/97	1	Classroom	510	Door	Door	Solid	Wood	0.01
110	1963 Bldg	87	XRF	4/17/97	1	Classroom	510	Door	Casing	Solid	Metal	0.06
111	1963 Bldg	88	XRF	4/17/97	1	Classroom	510	Wall	Wall	Solid	Concrete	0.06
112	1963 Bldg	89	XRF	4/17/97	1	Classroom	510		Elec Pane	Solid	Metal	0.03
113	1963 Bldg	90	XRF	4/17/97	1	Classroom	510	Wall	Wall	Solid	Drywall	0
114	1963 Bldg	91	XRF	4/17/97	1	Classroom	510	Wall	Panel	Solid	Wood	0
115	1963 Bldg	92	XRF	4/17/97	1	Classroom	510	Door	Door	Solid	Wood	0
116	1963 Bldg	93	XRF	4/17/97	1	Classroom	510	Door	Door	Solid	Wood	0
117	1963 Bldg	94	XRF	4/17/97	1	Classroom	510	Door	Door	Solid	Wood	0.01
118	1963 Bldg	95	XRF	4/17/97	1	Classroom	510		Locker	Solid	Metal	0.05
119	1963 Bldg	96	XRF	4/17/97	1	Classroom	510	Door	Door	Solid	Metal	0.02

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
120	1963 Bldg	97	XRF	4/17/97	1	Classroom	510		Radiator	Solid	Metal	1.17
121	1963 Bldg	98	XRF	4/17/97	1	Classroom	510	Floor		Chalking	Concrte	0.33
122	1963 Bldg	99	XRF	4/17/97	1	Classroom	510	Wall	Baseboar	Solid	Concrte	0.12
123	1963 Bldg	124	XRF	4/17/97	1	Classroom	512	Wall	Midle Wall	Solid	Concrte	0.07
124	1963 Bldg	125	XRF	4/17/97	1	Classroom	512	Wall	Wall	Solid	Concrte	0.01
125	1963 Bldg	126	XRF	4/17/97	1	Classroom	512	Window	Casing	Solid	Metal	0.11
126	1963 Bldg	127	XRF	4/17/97	1	Classroom	512	Door	Door	Solid	Wood	0
127	1963 Bldg	128	XRF	4/17/97	1	Classroom	512	Door	Casing	Solid	Concrte	0.09
128	1963 Bldg	129	XRF	4/17/97	1	Classroom	512	Wall	Midle Wall	Solid	Concrte	0.03
129	1963 Bldg	130	XRF	4/17/97	1	Classroom	512	Wall	Midle Wall	Solid	Concrte	0.01
130	1963 Bldg	131	XRF	4/17/97	1	Classroom	512		Radiator	Solid	Metal	0.05
131	1963 Bldg	132	XRF	4/17/97	1	Classroom	512	Bookcase	Shelf	Solid	Wood	0
132	1963 Bldg	133	XRF	4/17/97	1	Classroom	520	Wall	Midle Wall	Solid	Concrte	0.06
133	1963 Bldg	134	XRF	4/17/97	1	Classroom	520	Wall	Midle Wall	Solid	Concrte	0.07
134	1963 Bldg	135	XRF	4/17/97	1	Classroom	520	Window	Casing	Solid	Metal	0.06
135	1963 Bldg	136	XRF	4/17/97	1	Classroom	520	Door	Door	Solid	Wood	0.01
136	1963 Bldg	137	XRF	4/17/97	1	Classroom	520	Door	Casing	Solid	Metal	0.04
137	1963 Bldg	138	XRF	4/17/97	1	Classroom	520		Locker	Solid	Metal	0.81
138	1963 Bldg	139	XRF	4/17/97	1	Classroom	520	Cabinet	Door	Solid	Wood	0
139	1963 Bldg	140	XRF	4/17/97	1	Classroom	520	Wall	Panel	Solid	Wood	0
140	1963 Bldg	141	XRF	4/17/97	1	Classroom	520	Door	Door	Solid	Wood	0
141	1963 Bldg	142	XRF	4/17/97	1	Classroom	520		Elec Pane	Solid	Metal	0.02
142	1963 Bldg	143	XRF	4/17/97	1	Classroom	520	Wall	Midle Wall	Solid	Concrte	0.03
143	1963 Bldg	144	XRF	4/17/97	1	Classroom	520	Wall	Midle Wall	Solid	Concrte	0.02
144	1963 Bldg	145	XRF	4/17/97	1	Classroom	520	Cabinet	Door	Solid	Wood	0
145	1963 Bldg	146	XRF	4/17/97	1	Classroom	520		Radiator	Solid	Metal	0.72
146	1963 Bldg	179	XRF	4/17/97	1	Classroom	570	Wall	Midle Wall	Solid	Concrte	0.04
147	1963 Bldg	180	XRF	4/17/97	1	Classroom	570	Wall	Midle Wall	Solid	Concrte	0.03
148	1963 Bldg	181	XRF	4/17/97	1	Classroom	570	Door	Door	Solid	Wood	0.01
149	1963 Bldg	182	XRF	4/17/97	1	Classroom	570	Door	Casing	Solid	Metal	0.08
150	1963 Bldg	183	XRF	4/17/97	1	Classroom	570		Elec Pane	Solid	Metal	0.02
151	1963 Bldg	184	XRF	4/17/97	1	Classroom	570	Door	Door	Solid	Metal	0
152	1963 Bldg	185	XRF	4/17/97	1	Classroom	570	Door	Casing	Solid	Metal	0
153	1963 Bldg	186	XRF	4/17/97	1	Classroom	570	Cabinet	Door	Solid	Wood	0.04
154	1963 Bldg	187	XRF	4/17/97	1	Classroom	570	Wall	Midle Wall	Solid	Drywall	0.02
155	1963 Bldg	188	XRF	4/17/97	1	Classroom	570		Radiator	Solid	Metal	0.03
156	1963 Bldg	189	XRF	4/17/97	1	Classroom	570	Cabinet	Door	Solid	Wood	0
157	1963 Bldg	135	XRF	4/29/97	1	Classroom	1311	Ceiling		Solid	Plaster	0
158	1963 Bldg	26	XRF	4/23/97	1	Classroom	1380	Wall	Wall	Solid	Concrte	0.04
159	1963 Bldg	27	XRF	4/23/97	1	Classroom	1380	Wall	Midle Wall	Solid	Drywall	0
160	1963 Bldg	28	XRF	4/23/97	1	Classroom	1380	Door	Door	Solid	Wood	0.01
161	1963 Bldg	29	XRF	4/23/97	1	Classroom	1380	Window	Casing	Solid	Metal	0.03
162	1963 Bldg	30	XRF	4/23/97	1	Classroom	1380	Window	Panel	Solid	Metal	0.04
163	1963 Bldg	31	XRF	4/23/97	1	Classroom	1380	Wall	Midle Wall	Solid	Concrte	0.02
164	1963 Bldg	32	XRF	4/23/97	1	Classroom	1380	Wall	Wall	Solid	Concrte	0.03
165	1963 Bldg	33	XRF	4/23/97	1	Classroom	1380	Wall	Wall	Solid	Concrte	0.04
166	1963 Bldg	34	XRF	4/23/97	1	Classroom	1380	Wall	Wall	Solid	Concrte	0.04
167	1963 Bldg	35	XRF	4/23/97	1	Classroom	1380	Door	Header	Solid	Wood	0
168	1963 Bldg	36	XRF	4/23/97	1	Classroom	1380	Cabinet	Door	Solid	Wood	0.01
169	1963 Bldg	37	XRF	4/23/97	1	Classroom	1380	Wall	Wall	Solid	Concrte	0.05
170	1963 Bldg	38	XRF	4/23/97	1	Classroom	1380	Wall	Wall	Solid	Concrte	0.04
171	1963 Bldg	39	XRF	4/23/97	1	Classroom	1380	Wall	Wall	Solid	Concrte	0.05
172	1963 Bldg	40	XRF	4/23/97	1	Classroom	1380	Window	Stool	Solid	Metal	0.04
173	1963 Bldg	41	XRF	4/23/97	1	Classroom	1380		Radiator	Solid	Metal	0
174	1963 Bldg	42	XRF	4/23/97	1	Classroom	1380		Radiator	Solid	Metal	0.17
175	1963 Bldg	43	XRF	4/23/97	1	Classroom	1410	Wall	Midle Wall	Solid	Concrte	0.04
176	1963 Bldg	44	XRF	4/23/97	1	Classroom	1410	Wall	Wall	Solid	Concrte	0.02
177	1963 Bldg	45	XRF	4/23/97	1	Classroom	1410		Radiator	Solid	Metal	0.16
178	1963 Bldg	46	XRF	4/23/97	1	Classroom	1410		Radiator	Solid	Metal	0

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
179	1963 Bldg	47	XRF	4/23/97	1	Classroom	1410	Window	Stool	Solid	Metal	0.03
180	1963 Bldg	48	XRF	4/23/97	1	Classroom	1410	Wall	Midle Wall	Solid	Concrte	0.1
181	1963 Bldg	49	XRF	4/23/97	1	Classroom	1410	Wall	Wall	Solid	Concrte	0.07
182	1963 Bldg	50	XRF	4/23/97	1	Classroom	1410	Cabinet	Door	Solid	Wood	0.01
183	1963 Bldg	51	XRF	4/23/97	1	Classroom	1410	Wall	Wall	Solid	Concrte	0.02
184	1963 Bldg	52	XRF	4/23/97	1	Classroom	1410	Door	Door	Solid	Wood	0.01
185	1963 Bldg	53	XRF	4/23/97	1	Classroom	1410	Door	Casing	Solid	Metal	0.1
186	1963 Bldg	54	XRF	4/23/97	1	Classroom	1410	Window	Panel	Solid	Metal	0.08
187	1963 Bldg	133	XRF	4/29/97	1	Classroom	1410	Ceiling		Solid	Plaster	0
188	1963 Bldg	132	XRF	4/29/97	1	Classroom	1420	Ceiling		Solid	Plaster	0
189	1963 Bldg	6	XRF	4/23/97	1	Classroom	1429	Wall	Midle Wall	Solid	Concrte	0.04
190	1963 Bldg	7	XRF	4/23/97	1	Classroom	1429	Door	Door	Solid	Wood	0.01
191	1963 Bldg	8	XRF	4/23/97	1	Classroom	1429	Door	Casing	Solid	Metal	0.07
192	1963 Bldg	9	XRF	4/23/97	1	Classroom	1429	Door	Header	Solid	Wood	0
193	1963 Bldg	10	XRF	4/23/97	1	Classroom	1429	Wall	Wall	Solid	Concrte	0.05
194	1963 Bldg	11	XRF	4/23/97	1	Classroom	1429	Window	Casing	Solid	Metal	0.03
195	1963 Bldg	12	XRF	4/23/97	1	Classroom	1429	Window	Panel	Solid	Metal	0.08
196	1963 Bldg	13	XRF	4/23/97	1	Classroom	1429	Wall	Midle Wall	Solid	Concrte	0.03
197	1963 Bldg	14	XRF	4/23/97	1	Classroom	1429	Wall	Wall	Solid	Concrte	0.02
198	1963 Bldg	15	XRF	4/23/97	1	Classroom	1429	Cabinet	Door	Solid	Wood	0
199	1963 Bldg	16	XRF	4/23/97	1	Classroom	1429	Window	Stool	Solid	Metal	0.07
200	1963 Bldg	17	XRF	4/23/97	1	Classroom	1429		Radiator	Solid	Metal	0
201	1963 Bldg	18	XRF	4/23/97	1	Classroom	1429		Radiator	Solid	Metal	0.13
202	1963 Bldg	58	XRF	4/23/97	1	Classroom	1440	Wall	Midle Wall	Solid	Concrte	0.04
203	1963 Bldg	59	XRF	4/23/97	1	Classroom	1440	Wall	Midle Wall	Solid	Concrte	0.08
204	1963 Bldg	60	XRF	4/23/97	1	Classroom	1440	Cabinet	Door	Solid	Wood	0
205	1963 Bldg	61	XRF	4/23/97	1	Classroom	1440	Door	Door	Solid	Wood	0
206	1963 Bldg	62	XRF	4/23/97	1	Classroom	1440	Door	Casing	Solid	Metal	0.04
207	1963 Bldg	63	XRF	4/23/97	1	Classroom	1440	Door	Header	Solid	Wood	0
208	1963 Bldg	64	XRF	4/23/97	1	Classroom	1450	Wall	Wall	Solid	Concrte	0.05
209	1963 Bldg	65	XRF	4/23/97	1	Classroom	1450	Wall	Wall	Solid	Concrte	0.05
210	1963 Bldg	66	XRF	4/23/97	1	Classroom	1450	Wall	Wall	Solid	Plaster	0.06
211	1963 Bldg	67	XRF	4/23/97	1	Classroom	1450	Wall	Wall	Solid	Plaster	0.02
212	1963 Bldg	68	XRF	4/23/97	1	Classroom	1450	Wall	Wall Rgstr	Solid	Metal	0.08
213	1963 Bldg	69	XRF	4/23/97	1	Classroom	1450	Cabinet	Door	Solid	Wood	0.02
214	1963 Bldg	70	XRF	4/23/97	1	Classroom	1450	Door	Door	Solid	Wood	0.01
215	1963 Bldg	71	XRF	4/23/97	1	Classroom	1450	Door	Casing	Solid	Metal	0.03
216	1963 Bldg	72	XRF	4/23/97	1	Classroom	1450	Window	Panel	Solid	Metal	0.09
217	1963 Bldg	193	XRF	4/22/97	1	Classroom	1460	Door	Header	Solid	Wood	0
218	1963 Bldg	194	XRF	4/22/97	1	Classroom	1460	Wall	Midle Wall	Solid	Concrte	0.06
219	1963 Bldg	195	XRF	4/22/97	1	Classroom	1460	Wall	Midle Wall	Solid	Concrte	0.06
220	1963 Bldg	196	XRF	4/22/97	1	Classroom	1460	Door	Door	Solid	Wood	0.01
221	1963 Bldg	197	XRF	4/22/97	1	Classroom	1460	Door	Casing	Solid	Metal	0.08
222	1963 Bldg	198	XRF	4/22/97	1	Classroom	1460	Window	Panel	Solid	Metal	0.16
223	1963 Bldg	199	XRF	4/22/97	1	Classroom	1460	Wall	Midle Wall	Solid	Concrte	0.05
224	1963 Bldg	200	XRF	4/22/97	1	Classroom	1460	Cabinet	Door	Solid	Wood	0.02
225	1963 Bldg	201	XRF	4/22/97	1	Classroom	1460		Radiator	Solid	Metal	0
226	1963 Bldg	202	XRF	4/22/97	1	Classroom	1460		Radiator	Solid	Concrte	0.12
227	1963 Bldg	203	XRF	4/22/97	1	Classroom	1460	Window	Stool	Solid	Metal	0.07
228	1963 Bldg	204	XRF	4/22/97	1	Classroom	1460	Wall	Wall	Solid	Concrte	0.17
229	1963 Bldg	131	XRF	4/29/97	1	Classroom	1460	Ceiling		Solid	Plaster	0
230	1963 Bldg	130	XRF	4/29/97	1	Classroom	1490	Ceiling		Solid	Plaster	0
231	1963 Bldg	182	XRF	4/22/97	1	Classroom	1500	Wall	Wall	Solid	Concrte	0.09
232	1963 Bldg	183	XRF	4/22/97	1	Classroom	1500	Wall	Wall	Solid	Concrte	0.03
233	1963 Bldg	184	XRF	4/22/97	1	Classroom	1500	Door	Door	Solid	Wood	0.01
234	1963 Bldg	185	XRF	4/22/97	1	Classroom	1500	Door	Casing	Solid	Metal	0.11
235	1963 Bldg	186	XRF	4/22/97	1	Classroom	1500	Window	Panel	Solid	Metal	0.1
236	1963 Bldg	187	XRF	4/22/97	1	Classroom	1500	Wall	Midle Wall	Solid	Concrte	0.02
237	1963 Bldg	188	XRF	4/22/97	1	Classroom	1500	Cabinet	Door	Solid	Wood	0.02

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
238	1963 Bldg	189	XRF	4/22/97	1	Classroom	1500	Bookcase	Shelf	Solid	Wood	0
239	1963 Bldg	190	XRF	4/22/97	1	Classroom	1500	Window	Stool	Solid	Metal	0.04
240	1963 Bldg	191	XRF	4/22/97	1	Classroom	1500		Radiator	Solid	Metal	0.01
241	1963 Bldg	192	XRF	4/22/97	1	Classroom	1500		Radiator	Solid	Metal	0.12
242	1963 Bldg	129	XRF	4/29/97	1	Classroom	1500	Ceiling		Solid	Plaster	0
243	1963 Bldg	84	XRF	4/23/97	1	Classroom	1510	Cabinet	Door	Solid	Wood	0.01
244	1963 Bldg	85	XRF	4/23/97	1	Classroom	1510	Window	Stool	Solid	Metal	0.02
245	1963 Bldg	86	XRF	4/23/97	1	Classroom	1510		Radiator	Solid	Metal	0.11
246	1963 Bldg	87	XRF	4/23/97	1	Classroom	1510	Wall	Midle Wall	Solid	Concrte	0.03
247	1963 Bldg	88	XRF	4/23/97	1	Classroom	1510	Wall	Wall	Solid	Concrte	0.11
248	1963 Bldg	89	XRF	4/23/97	1	Classroom	1510	Door	Door	Solid	Wood	0.01
249	1963 Bldg	90	XRF	4/23/97	1	Classroom	1510	Door	Casing	Solid	Metal	0.06
250	1963 Bldg	91	XRF	4/23/97	1	Classroom	1510	Window	Panel	Solid	Metal	0.04
251	1963 Bldg	128	XRF	4/29/97	1	Classroom	1510	Ceiling		Solid	Plaster	0.01
252	1963 Bldg	173	XRF	4/22/97	1	Classroom	1520	Wall	Wall	Solid	Concrte	0.02
253	1963 Bldg	174	XRF	4/22/97	1	Classroom	1520	Door	Door	Solid	Wood	0.02
254	1963 Bldg	175	XRF	4/22/97	1	Classroom	1520	Door	Casing	Solid	Metal	0.05
255	1963 Bldg	176	XRF	4/22/97	1	Classroom	1520	Window	Panel	Solid	Metal	0.12
256	1963 Bldg	177	XRF	4/22/97	1	Classroom	1520	Wall	Midle Wall	Solid	Concrte	0.05
257	1963 Bldg	178	XRF	4/22/97	1	Classroom	1520	Cabinet	Door	Solid	Wood	0.01
258	1963 Bldg	179	XRF	4/22/97	1	Classroom	1520	Window	Stool	Solid	Metal	0.06
259	1963 Bldg	180	XRF	4/22/97	1	Classroom	1520		Radiator	Solid	Metal	0
260	1963 Bldg	181	XRF	4/22/97	1	Classroom	1520		Radiator	Solid	Metal	0.11
261	1963 Bldg	92	XRF	4/23/97	1	Classroom	1530	Wall	Midle Wall	Solid	Concrte	0.09
262	1963 Bldg	93	XRF	4/23/97	1	Classroom	1530	Window	Stool	Solid	Metal	0.05
263	1963 Bldg	94	XRF	4/23/97	1	Classroom	1530		Radiator	Solid	Metal	0.08
264	1963 Bldg	95	XRF	4/23/97	1	Classroom	1530	Door	Door	Solid	Wood	0
265	1963 Bldg	96	XRF	4/23/97	1	Classroom	1530	Door	Casing	Solid	Metal	0.03
266	1963 Bldg	97	XRF	4/23/97	1	Classroom	1530	Window	Casing	Solid	Metal	0.01
267	1963 Bldg	126	XRF	4/29/97	1	Classroom	1530	Ceiling		Solid	Plaster	0.01
268	1963 Bldg	127	XRF	4/29/97	1	Classroom	1530	Ceiling		Solid	Plaster	0.01
269	1963 Bldg	125	XRF	4/29/97	1	Classroom	1540	Ceiling		Solid	Plaster	0.02
270	1963 Bldg	154	XRF	4/22/97	1	Classroom	1560	Wall	Wall	Solid	Concrte	0.23
271	1963 Bldg	155	XRF	4/22/97	1	Classroom	1560	Wall	Midle Wall	Solid	Concrte	0.03
272	1963 Bldg	156	XRF	4/22/97	1	Classroom	1560	Door	Door	Solid	Wood	0
273	1963 Bldg	157	XRF	4/22/97	1	Classroom	1560	Door	Casing	Solid	Metal	0.1
274	1963 Bldg	158	XRF	4/22/97	1	Classroom	1560	Window	Panel	Solid	Metal	0.07
275	1963 Bldg	159	XRF	4/22/97	1	Classroom	1560	Cabinet	Door	Solid	Wood	0.02
276	1963 Bldg	160	XRF	4/22/97	1	Classroom	1560	Window	Stool	Solid	Metal	0.05
277	1963 Bldg	161	XRF	4/22/97	1	Classroom	1560		Radiator	Solid	Metal	0
278	1963 Bldg	162	XRF	4/22/97	1	Classroom	1560		Radiator	Solid	Metal	0.1
279	1963 Bldg	145	XRF	4/22/97	1	Classroom	1580	Wall	Wall	Solid	Concrte	0.02
280	1963 Bldg	146	XRF	4/22/97	1	Classroom	1580	Wall	Midle Wall	Solid	Concrte	0.08
281	1963 Bldg	147	XRF	4/22/97	1	Classroom	1580	Door	Door	Solid	Wood	0.01
282	1963 Bldg	148	XRF	4/22/97	1	Classroom	1580	Door	Casing	Solid	Metal	0.12
283	1963 Bldg	149	XRF	4/22/97	1	Classroom	1580	Window	Panel	Solid	Metal	0
284	1963 Bldg	150	XRF	4/22/97	1	Classroom	1580	Window	Stool	Solid	Metal	0.02
285	1963 Bldg	151	XRF	4/22/97	1	Classroom	1580		Radiator	Solid	Metal	0.12
286	1963 Bldg	152	XRF	4/22/97	1	Classroom	1580	Wall	Midle Wall	Solid	Concrte	0.06
287	1963 Bldg	153	XRF	4/22/97	1	Classroom	1580		Radiator	Solid	Metal	0.01
288	1963 Bldg	124	XRF	4/29/97	1	Classroom	1580	Ceiling		Solid	Plaster	0
289	1963 Bldg	128	XRF	4/22/97	1	Classroom	1600	Wall	Midle Wall	Solid	Concrte	0.03
290	1963 Bldg	129	XRF	4/22/97	1	Classroom	1600	Wall	Wall	Solid	Concrte	0.04
291	1963 Bldg	130	XRF	4/22/97	1	Classroom	1600	Cabinet	Door	Solid	Wood	0.01
292	1963 Bldg	131	XRF	4/22/97	1	Classroom	1600		Radiator	Solid	Metal	0
293	1963 Bldg	132	XRF	4/22/97	1	Classroom	1600		Radiator	Solid	Metal	0.17
294	1963 Bldg	133	XRF	4/22/97	1	Classroom	1600	Window	Stool	Solid	Metal	0.05
295	1963 Bldg	134	XRF	4/22/97	1	Classroom	1600	Wall	Midle Wall	Solid	Concrte	0.03
296	1963 Bldg	135	XRF	4/22/97	1	Classroom	1600	Door	Door	Solid	Wood	0.01

## Saint Paul Public Schools

John A. Johnson Senior High School

Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
297	1963 Bldg	136	XRF	4/22/97	1	Classroom	1600	Door	Casing	Solid	Metal	0.12
298	1963 Bldg	137	XRF	4/22/97	1	Classroom	1600	Door	Panel	Solid	Metal	0.02
299	1963 Bldg	123	XRF	4/29/97	1	Classroom	1600	Ceiling		Solid	Plaster	0.08
300	1963 Bldg	138	XRF	4/22/97	1	Classroom	1605	Wall	Midle Wall	Solid	Concrete	0.02
301	1963 Bldg	139	XRF	4/22/97	1	Classroom	1605	Door	Door	Solid	Wood	0.02
302	1963 Bldg	140	XRF	4/22/97	1	Classroom	1605	Door	Casing	Solid	Metal	0.07
303	1963 Bldg	141	XRF	4/22/97	1	Classroom	1605	Window	Panel	Solid	Metal	0.03
304	1963 Bldg	142	XRF	4/22/97	1	Classroom	1605	Wall	Wall	Solid	Concrete	0.06
305	1963 Bldg	143	XRF	4/22/97	1	Classroom	1605		Radiator	Solid	Metal	0.16
306	1963 Bldg	144	XRF	4/22/97	1	Classroom	1605	Window	Stool	Solid	Metal	0.02
307	1963 Bldg	119	XRF	4/22/97	1	Classroom	1620	Wall	Midle Wall	Solid	Concrete	0.04
308	1963 Bldg	120	XRF	4/22/97	1	Classroom	1620	Door	Door	Solid	Wood	0.02
309	1963 Bldg	121	XRF	4/22/97	1	Classroom	1620	Door	Casing	Solid	Metal	0.16
310	1963 Bldg	122	XRF	4/22/97	1	Classroom	1620	Door	Panel	Solid	Metal	0.09
311	1963 Bldg	123	XRF	4/22/97	1	Classroom	1620	Cabinet	Door	Solid	Wood	0
312	1963 Bldg	124	XRF	4/22/97	1	Classroom	1620		Radiator	Solid	Metal	0.07
313	1963 Bldg	125	XRF	4/22/97	1	Classroom	1620	Window	Stool	Solid	Metal	0.03
314	1963 Bldg	126	XRF	4/22/97	1	Classroom	1620	Wall	Midle Wall	Solid	Concrete	0.02
315	1963 Bldg	127	XRF	4/22/97	1	Classroom	1620	Wall	Wall	Solid	Concrete	0.03
316	1963 Bldg	122	XRF	4/29/97	1	Classroom	1620	Ceiling		Solid	Plaster	0.01
317	1963 Bldg	121	XRF	4/29/97	1	Classroom	1650	Ceiling		Solid	Plaster	0
318	1963 Bldg	101	XRF	4/22/97	1	Classroom	1660	Wall	Midle Wall	Solid	Concrete	0.06
319	1963 Bldg	102	XRF	4/22/97	1	Classroom	1660	Door	Door	Solid	Wood	0
320	1963 Bldg	103	XRF	4/22/97	1	Classroom	1660	Door	Casing	Solid	Metal	0.06
321	1963 Bldg	104	XRF	4/22/97	1	Classroom	1660	Window	Panel	Solid	Metal	0.04
322	1963 Bldg	105	XRF	4/22/97	1	Classroom	1660	Wall	Wall	Solid	Concrte	0.1
323	1963 Bldg	106	XRF	4/22/97	1	Classroom	1660	Wall	Wall	Solid	Concrete	0.04
324	1963 Bldg	107	XRF	4/22/97	1	Classroom	1660	Wall	Wall	Solid	Concrete	0.02
325	1963 Bldg	108	XRF	4/22/97	1	Classroom	1660	Window	Stool	Solid	Metal	0.05
326	1963 Bldg	109	XRF	4/22/97	1	Classroom	1660		Radiator	Solid	Metal	0.05
327	1963 Bldg	38	XRF	4/22/97	1	Classroom	1680	Wall	Midle Wall	Solid	Concrte	0.06
328	1963 Bldg	39	XRF	4/22/97	1	Classroom	1680	Wall	Midle Wall	Solid	Concrte	0.02
329	1963 Bldg	40	XRF	4/22/97	1	Classroom	1680	Door	Door	Solid	Wood	0.02
330	1963 Bldg	41	XRF	4/22/97	1	Classroom	1680	Door	Casing	Solid	Metal	0.05
331	1963 Bldg	42	XRF	4/22/97	1	Classroom	1680	Window	Panel	Solid	Metal	0.01
332	1963 Bldg	43	XRF	4/22/97	1	Classroom	1680	Cabinet	Door	Solid	Wood	0
333	1963 Bldg	44	XRF	4/22/97	1	Classroom	1680	Wall	Wall	Solid	Concrete	0.23
334	1963 Bldg	45	XRF	4/22/97	1	Classroom	1680		Radiator	Solid	Metal	0.08
335	1963 Bldg	46	XRF	4/22/97	1	Classroom	1680	Window	Stool	Solid	Metal	0.04
336	1963 Bldg	119	XRF	4/29/97	1	Classroom	1680	Ceiling		Solid	Plaster	0.09
337	1963 Bldg	53	XRF	4/22/97	1	Classroom	1700	Wall	Midle Wall	Solid	Concrte	0.08
338	1963 Bldg	54	XRF	4/22/97	1	Classroom	1700		Radiator	Solid	Metal	0.14
339	1963 Bldg	55	XRF	4/22/97	1	Classroom	1700	Window	Stool	Solid	Metal	0.06
340	1963 Bldg	56	XRF	4/22/97	1	Classroom	1700	Wall	Midle Wall	Solid	Concrte	0.05
341	1963 Bldg	57	XRF	4/22/97	1	Classroom	1700	Wall	Wall	Solid	Concrete	0.01
342	1963 Bldg	58	XRF	4/22/97	1	Classroom	1700	Cabinet	Door	Solid	Wood	0.01
343	1963 Bldg	59	XRF	4/22/97	1	Classroom	1700	Door	Door	Solid	Wood	0.01
344	1963 Bldg	60	XRF	4/22/97	1	Classroom	1700	Door	Casing	Solid	Metal	0.04
345	1963 Bldg	61	XRF	4/22/97	1	Classroom	1700	Window	Panel	Solid	Metal	0.04
346	1963 Bldg	118	XRF	4/29/97	1	Classroom	1700	Ceiling		Solid	Plaster	0.02
347	1963 Bldg	62	XRF	4/22/97	1	Classroom	1720	Cabinet	Door	Solid	Wood	0
348	1963 Bldg	63	XRF	4/22/97	1	Classroom	1720	Wall	Midle Wall	Solid	Concrete	0.09
349	1963 Bldg	64	XRF	4/22/97	1	Classroom	1720	Door	Door	Solid	Wood	0.01
350	1963 Bldg	65	XRF	4/22/97	1	Classroom	1720	Door	Casing	Solid	Metal	0.07
351	1963 Bldg	66	XRF	4/22/97	1	Classroom	1720		Radiator	Solid	Metal	0.08
352	1963 Bldg	67	XRF	4/22/97	1	Classroom	1720	Window	Stool	Solid	Metal	0.02
353	1963 Bldg	68	XRF	4/22/97	1	Classroom	1720	Wall	Midle Wall	Solid	Concrete	0.03
354	1963 Bldg	69	XRF	4/22/97	1	Classroom	1720	Wall	Wall	Solid	Concrete	0.08
355	1963 Bldg	70	XRF	4/22/97	1	Classroom	1720	Window	Panel	Solid	Metal	0.02

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
356	1963 Bldg	116	XRF	4/29/97	1	Classroom	1720	Ceiling		Solid	Plaster	0
357	1963 Bldg	117	XRF	4/29/97	1	Classroom	1720	Ceiling		Solid	Plaster	0
358	1963 Bldg	84	XRF	4/22/97	1	Classroom	1750	Cabinet	Door	Solid	Wood	0
359	1963 Bldg	85	XRF	4/22/97	1	Classroom	1750	Bookcase	Shelf	Solid	Wood	0
360	1963 Bldg	86	XRF	4/22/97	1	Classroom	1750	Wall	Midle Wall	Solid	Concrte	0.06
361	1963 Bldg	87	XRF	4/22/97	1	Classroom	1750	Window	Stool	Solid	Metal	0.09
362	1963 Bldg	88	XRF	4/22/97	1	Classroom	1750	Wall	Wall Rgstr	Solid	Metal	0.16
363	1963 Bldg	89	XRF	4/22/97	1	Classroom	1750	Wall	Midle Wall	Solid	Concrte	0.07
364	1963 Bldg	90	XRF	4/22/97	1	Classroom	1750	Wall	Wall	Solid	Concrte	0.02
365	1963 Bldg	91	XRF	4/22/97	1	Classroom	1750	Door	Door	Solid	Wood	0.01
366	1963 Bldg	92	XRF	4/22/97	1	Classroom	1750	Door	Casing	Solid	Metal	0.13
367	1963 Bldg	114	XRF	4/29/97	1	Classroom	1750	Ceiling		Solid	Plaster	0
368	1963 Bldg	29	XRF	4/22/97	1	Classroom	1760	Wall	Wall	Solid	Concrte	0.05
369	1963 Bldg	30	XRF	4/22/97	1	Classroom	1760	Door	Door	Solid	Wood	0
370	1963 Bldg	31	XRF	4/22/97	1	Classroom	1760	Door	Casing	Solid	Metal	0.04
371	1963 Bldg	32	XRF	4/22/97	1	Classroom	1760	Wall	Wall	Solid	Concrte	0.01
372	1963 Bldg	33	XRF	4/22/97	1	Classroom	1760	Wall	Wall	Solid	Concrte	0.02
373	1963 Bldg	34	XRF	4/22/97	1	Classroom	1760	Cabinet	Door	Solid	Wood	0
374	1963 Bldg	35	XRF	4/22/97	1	Classroom	1760		Radiator	Solid	Metal	0.09
375	1963 Bldg	36	XRF	4/22/97	1	Classroom	1760	Window	Stool	Solid	Metal	0.03
376	1963 Bldg	37	XRF	4/22/97	1	Classroom	1760	Wall	Wall	Solid	Concrte	0.05
377	1963 Bldg	113	XRF	4/29/97	1	Classroom	1760	Ceiling		Solid	Plaster	0
378	1963 Bldg	93	XRF	4/22/97	1	Classroom	1770	Wall	Midle Wall	Solid	Concrte	0.08
379	1963 Bldg	94	XRF	4/22/97	1	Classroom	1770	Wall	Wall	Solid	Concrte	0.04
380	1963 Bldg	95	XRF	4/22/97	1	Classroom	1770	Wall	Wall	Solid	Concrte	0.02
381	1963 Bldg	96	XRF	4/22/97	1	Classroom	1770	Bookcase	Inside	Solid	Wood	0
382	1963 Bldg	97	XRF	4/22/97	1	Classroom	1770	Window	Stool	Solid	Metal	0.1
383	1963 Bldg	98	XRF	4/22/97	1	Classroom	1770		Radiator	Solid	Metal	0.11
384	1963 Bldg	99	XRF	4/22/97	1	Classroom	1770	Door	Door	Solid	Wood	0.01
385	1963 Bldg	100	XRF	4/22/97	1	Classroom	1770	Door	Casing	Solid	Metal	0.04
386	1963 Bldg	112	XRF	4/29/97	1	Classroom	1770	Ceiling		Solid	Plaster	0.01
387	1963 Bldg	19	XRF	4/22/97	1	Classroom	1780	Wall	Wall	Solid	Concrte	0.06
388	1963 Bldg	20	XRF	4/22/97	1	Classroom	1780	Door	Door	Solid	Wood	0.01
389	1963 Bldg	21	XRF	4/22/97	1	Classroom	1780	Door	Casing	Solid	Metal	0.04
390	1963 Bldg	22	XRF	4/22/97	1	Classroom	1780	Window	Panel	Solid	Metal	0.11
391	1963 Bldg	23	XRF	4/22/97	1	Classroom	1780	Wall	Midle Wall	Solid	Concrte	0.03
392	1963 Bldg	24	XRF	4/22/97	1	Classroom	1780	Wall	Wall	Solid	Concrte	0.03
393	1963 Bldg	25	XRF	4/22/97	1	Classroom	1780	Wall	Wall	Solid	Concrte	0.07
394	1963 Bldg	26	XRF	4/22/97	1	Classroom	1780	Cabinet	Door	Solid	Wood	0
395	1963 Bldg	27	XRF	4/22/97	1	Classroom	1780		Radiator	Solid	Metal	0.13
396	1963 Bldg	28	XRF	4/22/97	1	Classroom	1780	Window	Stool	Solid	Metal	0.04
397	1963 Bldg	111	XRF	4/29/97	1	Classroom	1780	Ceiling		Solid	Plaster	0
398	1963 Bldg	110	XRF	4/29/97	1	Classroom	1840	Ceiling		Solid	Plaster	0.04
399	1963 Bldg	133	XRF	4/21/97	1	Classroom	1860	Window	Stool	Solid	Metal	0.08
400	1963 Bldg	134	XRF	4/21/97	1	Classroom	1860	Wall	Wall	Solid	Concrte	0.09
401	1963 Bldg	135	XRF	4/21/97	1	Classroom	1860		Radiator	Solid	Metal	0.13
402	1963 Bldg	136	XRF	4/21/97	1	Classroom	1860	Wall	Midle Wall	Solid	Concrte	0.05
403	1963 Bldg	137	XRF	4/21/97	1	Classroom	1860	Wall	Midle Wall	Solid	Concrte	0.06
404	1963 Bldg	138	XRF	4/21/97	1	Classroom	1860	Wall	Wall	Solid	Plaster	0
405	1963 Bldg	139	XRF	4/21/97	1	Classroom	1860	Door	Door	Solid	Wood	0.01
406	1963 Bldg	140	XRF	4/21/97	1	Classroom	1860	Door	Casing	Solid	Metal	0.09
407	1963 Bldg	141	XRF	4/21/97	1	Classroom	1860	Cabinet	Door	Solid	Wood	0
408	1963 Bldg	142	XRF	4/21/97	1	Classroom	1860	Wall	Wall	Solid	Plaster	0.01
409	1963 Bldg	88	XRF	4/26/97	2	Classroom	2030	Wall	Diffuser	Solid	Metal	0
410	1963 Bldg	89	XRF	4/26/97	2	Classroom	2030		Radiator	Solid	Metal	0.07
411	1963 Bldg	24	XRF	4/16/97	2	Classroom	2100		Radiator	Solid	Metal	0
412	1963 Bldg	25	XRF	4/16/97	2	Classroom	2100	Window	Stool	Solid	Metal	0.04
413	1963 Bldg	26	XRF	4/16/97	2	Classroom	2100	Wall	Midle Wall	Solid	Concrte	0.07
414	1963 Bldg	27	XRF	4/16/97	2	Classroom	2100	Wall	Midle Wall	Solid	Concrte	0.05

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
415	1963 Bldg	28	XRF	4/16/97	2	Classroom	2100	Bookcase	Inside	Solid	Wood	0.02
416	1963 Bldg	29	XRF	4/16/97	2	Classroom	2100	Door	Door	Solid	Wood	0.01
417	1963 Bldg	30	XRF	4/16/97	2	Classroom	2100	Door	Casing	Solid	Metal	0.07
418	1963 Bldg	31	XRF	4/16/97	2	Classroom	2100	Stairs	Riser	Solid	Wood	0.01
419	1963 Bldg	32	XRF	4/16/97	2	Classroom	2100	Table Leg		Solid	Metal	0.04
420	1963 Bldg	33	XRF	4/16/97	2	Classroom	2100	Wall	Midle Wall	Solid	Drywall	0.04
421	1963 Bldg	83	XRF	4/29/97	2	Classroom	2100	Ceiling		Solid	Plaster	0
422	1963 Bldg	34	XRF	4/16/97	2	Classroom	2130	Door	Door	Solid	Wood	0.01
423	1963 Bldg	35	XRF	4/16/97	2	Classroom	2130	Door	Casing	Solid	Metal	0.04
424	1963 Bldg	36	XRF	4/16/97	2	Classroom	2130	Wall	Midle Wall	Solid	Concrete	0.02
425	1963 Bldg	37	XRF	4/16/97	2	Classroom	2130	Cabinet	Outside	Solid	Wood	0.02
426	1963 Bldg	38	XRF	4/16/97	2	Classroom	2130		Elec Pane	Solid	Metal	0.02
427	1963 Bldg	164	XRF	4/16/97	2	Classroom	2150	Wall	Midle Wall	Solid	Wood	0.02
428	1963 Bldg	165	XRF	4/16/97	2	Classroom	2150	Wall	Wall Rgstr	Solid	Metal	0
429	1963 Bldg	166	XRF	4/16/97	2	Classroom	2150	Wall	Midle Wall	Solid	Concrete	0.04
430	1963 Bldg	167	XRF	4/16/97	2	Classroom	2150	Door	Door	Solid	Wood	0
431	1963 Bldg	168	XRF	4/16/97	2	Classroom	2150	Door	Casing	Solid	Metal	0.09
432	1963 Bldg	169	XRF	4/16/97	2	Classroom	2150	Door	Jamb	Solid	Wood	0.01
433	1963 Bldg	170	XRF	4/16/97	2	Classroom	2150	Door	Door	Solid	Wood	0
434	1963 Bldg	171	XRF	4/16/97	2	Classroom	2150	Wall	Baseboar	Solid	Concrete	0.13
435	1963 Bldg	105	XRF	4/16/97	2	Classroom	2170	Wall	Midle Wall	Solid	Concrete	0.08
436	1963 Bldg	106	XRF	4/16/97	2	Classroom	2170	Door	Door	Solid	Wood	0
437	1963 Bldg	107	XRF	4/16/97	2	Classroom	2170	Door	Casing	Solid	Metal	0.04
438	1963 Bldg	108	XRF	4/16/97	2	Classroom	2170	Door	Jamb	Solid	Wood	0.01
439	1963 Bldg	109	XRF	4/16/97	2	Classroom	2170	Door	Threshold	Solid	Wood	0
440	1963 Bldg	110	XRF	4/16/97	2	Classroom	2170	Wall	Wall	Solid	Concrete	0.06
441	1963 Bldg	111	XRF	4/16/97	2	Classroom	2170	Wall	Baseboar	Solid	Concrete	0.16
442	1963 Bldg	112	XRF	4/16/97	2	Classroom	2170	Wall	Midle Wall	Solid	Wood	0.03
443	1963 Bldg	198	XRF	4/16/97	2	Classroom	2220	Wall	Midle Wall	Solid	Concrete	0.08
444	1963 Bldg	199	XRF	4/16/97	2	Classroom	2220		Radiator	Solid	Metal	0.09
445	1963 Bldg	200	XRF	4/16/97	2	Classroom	2220	Door	Door	Solid	Wood	0.01
446	1963 Bldg	201	XRF	4/16/97	2	Classroom	2220	Door	Casing	Solid	Metal	0.07
447	1963 Bldg	202	XRF	4/16/97	2	Classroom	2220	Door	Header	Solid	Wood	0
448	1963 Bldg	203	XRF	4/16/97	2	Classroom	2220	Wall	Wall	Solid	Concrete	0.03
449	1963 Bldg	17	XRF	4/26/97	2	Classroom	2370	Wall	Midle Wall	Solid	Concrete	0.03
450	1963 Bldg	18	XRF	4/26/97	2	Classroom	2370	Wall	Wall	Solid	Concrete	0.07
451	1963 Bldg	19	XRF	4/26/97	2	Classroom	2370	Cabinet	Door	Solid	Wood	0
452	1963 Bldg	20	XRF	4/26/97	2	Classroom	2370	Wall	Midle Wall	Solid	Concrete	0.03
453	1963 Bldg	21	XRF	4/26/97	2	Classroom	2370	Wall	Midle Wall	Solid	Concrete	0.02
454	1963 Bldg	22	XRF	4/26/97	2	Classroom	2370	Door	Door	Solid	Wood	0.01
455	1963 Bldg	23	XRF	4/26/97	2	Classroom	2370	Door	Casing	Solid	Metal	0.05
456	1963 Bldg	24	XRF	4/26/97	2	Classroom	2370	Window	Panel	Solid	Metal	0.09
457	1963 Bldg	25	XRF	4/26/97	2	Classroom	2370	Door	Header	Solid	Wood	0
458	1963 Bldg	26	XRF	4/26/97	2	Classroom	2370	Window	Stool	Solid	Metal	0
459	1963 Bldg	27	XRF	4/26/97	2	Classroom	2370	Wall	Wall	Solid	Concrete	0.02
460	1963 Bldg	38	XRF	4/26/97	2	Classroom	2390	Wall	Midle Wall	Solid	Concrete	0.04
461	1963 Bldg	39	XRF	4/26/97	2	Classroom	2390	Wall	Wall	Solid	Concrete	0.04
462	1963 Bldg	40	XRF	4/26/97	2	Classroom	2390	Wall	Wall	Solid	Concrete	0.04
463	1963 Bldg	41	XRF	4/26/97	2	Classroom	2390	Wall	Wall	Solid	Concrete	0.05
464	1963 Bldg	42	XRF	4/26/97	2	Classroom	2390	Cabinet	Door	Solid	Wood	0.01
465	1963 Bldg	43	XRF	4/26/97	2	Classroom	2390	Cabinet	Door	Solid	Wood	0.02
466	1963 Bldg	44	XRF	4/26/97	2	Classroom	2390		Radiator	Solid	Metal	0.11
467	1963 Bldg	45	XRF	4/26/97	2	Classroom	2390		Radiator	Solid	Metal	0.01
468	1963 Bldg	46	XRF	4/26/97	2	Classroom	2390	Window	Stool	Solid	Metal	0.05
469	1963 Bldg	47	XRF	4/26/97	2	Classroom	2390	Wall	Wall	Solid	Concrete	0.02
470	1963 Bldg	48	XRF	4/26/97	2	Classroom	2390	Wall	Wall	Solid	Concrete	0.01
471	1963 Bldg	49	XRF	4/26/97	2	Classroom	2390	Wall	Wall	Solid	Concrete	0.03
472	1963 Bldg	50	XRF	4/26/97	2	Classroom	2390	Wall	Wall	Solid	Concrete	0.02
473	1963 Bldg	51	XRF	4/26/97	2	Classroom	2390	Door	Door	Solid	Wood	0

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
474	1963 Bldg	52	XRF	4/26/97	2	Classroom	2390	Door	Casing	Solid	Metal	0.07
475	1963 Bldg	53	XRF	4/26/97	2	Classroom	2390	Window	Panel	Solid	Metal	0.02
476	1963 Bldg	6	XRF	4/26/97	2	Classroom	2400	Wall	Midle Wall	Solid	Concre	0.03
477	1963 Bldg	7	XRF	4/26/97	2	Classroom	2400	Door	Door	Solid	Wood	0.01
478	1963 Bldg	8	XRF	4/26/97	2	Classroom	2400	Door	Casing	Solid	Metal	0.11
479	1963 Bldg	9	XRF	4/26/97	2	Classroom	2400	Door	Header	Solid	Wood	0
480	1963 Bldg	10	XRF	4/26/97	2	Classroom	2400	Wall	Wall	Solid	Concre	0.02
481	1963 Bldg	11	XRF	4/26/97	2	Classroom	2400	Cabinet	Door	Solid	Wood	0
482	1963 Bldg	12	XRF	4/26/97	2	Classroom	2400	Wall	Midle Wall	Solid	Concre	0.06
483	1963 Bldg	13	XRF	4/26/97	2	Classroom	2400	Window	Panel	Solid	Metal	0.09
484	1963 Bldg	14	XRF	4/26/97	2	Classroom	2400	Window	Stool	Solid	Metal	0
485	1963 Bldg	15	XRF	4/26/97	2	Classroom	2400	Wall	Midle Wall	Solid	Concre	0.03
486	1963 Bldg	16	XRF	4/26/97	2	Classroom	2400	Wall	Wall	Solid	Concre	0.01
487	1963 Bldg	54	XRF	4/26/97	2	Classroom	2410	Wall	Midle Wall	Solid	Concre	0.03
488	1963 Bldg	55	XRF	4/26/97	2	Classroom	2410	Window	Panel	Solid	Wood	0
489	1963 Bldg	56	XRF	4/26/97	2	Classroom	2410	Window	Casing	Solid	Metal	0.11
490	1963 Bldg	57	XRF	4/26/97	2	Classroom	2410	Door	Door	Solid	Wood	0.02
491	1963 Bldg	58	XRF	4/26/97	2	Classroom	2410	Wall	Wall	Solid	Concre	0.04
492	1963 Bldg	59	XRF	4/26/97	2	Classroom	2410	Wall	Wall	Solid	Concre	0.05
493	1963 Bldg	60	XRF	4/26/97	2	Classroom	2410		Radiator	Solid	Metal	0.15
494	1963 Bldg	61	XRF	4/26/97	2	Classroom	2410	Cabinet	Door	Solid	Wood	0
495	1963 Bldg	62	XRF	4/26/97	2	Classroom	2410	Wall	Midle Wall	Solid	Concre	0.03
496	1963 Bldg	63	XRF	4/26/97	2	Classroom	2410	Wall	Wall	Solid	Concre	0.03
497	1963 Bldg	64	XRF	4/26/97	2	Classroom	2410	Window	Panel	Solid	Metal	0.08
498	1963 Bldg	102	XRF	4/29/97	2	Classroom	2439	Ceiling		Solid	Plaster	0
499	1963 Bldg	114	XRF	4/26/97	2	Classroom	2440	Cabinet	Door	Solid	Wood	0.03
500	1963 Bldg	115	XRF	4/26/97	2	Classroom	2440	Wall	Wall	Solid	Concre	0.02
501	1963 Bldg	116	XRF	4/26/97	2	Classroom	2440	Wall	Wall	Solid	Concre	0.05
502	1963 Bldg	117	XRF	4/26/97	2	Classroom	2440	Wall	Wall	Solid	Wood	0
503	1963 Bldg	118	XRF	4/26/97	2	Classroom	2440	Window	Stool	Solid	Metal	0.03
504	1963 Bldg	119	XRF	4/26/97	2	Classroom	2440		Radiator	Solid	Metal	0
505	1963 Bldg	120	XRF	4/26/97	2	Classroom	2440	Wall	Midle Wall	Solid	Concre	0.01
506	1963 Bldg	121	XRF	4/26/97	2	Classroom	2440		Radiator	Solid	Metal	0.06
507	1963 Bldg	122	XRF	4/26/97	2	Classroom	2440	Door	Door	Solid	Wood	0.02
508	1963 Bldg	123	XRF	4/26/97	2	Classroom	2440	Door	Casing	Solid	Metal	0.1
509	1963 Bldg	124	XRF	4/26/97	2	Classroom	2440	Window	Panel	Solid	Metal	0.03
510	1963 Bldg	125	XRF	4/26/97	2	Classroom	2440	Wall	Wall	Solid	Concre	0.01
511	1963 Bldg	98	XRF	4/29/97	2	Classroom	2440	Ceiling		Solid	Plaster	0.02
512	1963 Bldg	175	XRF	4/25/97	2	Classroom	2450	Wall	Midle Wall	Solid	Concre	0.09
513	1963 Bldg	176	XRF	4/25/97	2	Classroom	2450	Door	Door	Solid	Wood	0.01
514	1963 Bldg	177	XRF	4/25/97	2	Classroom	2450	Door	Casing	Solid	Metal	0.07
515	1963 Bldg	178	XRF	4/25/97	2	Classroom	2450	Window	Panel	Solid	Metal	0.1
516	1963 Bldg	179	XRF	4/25/97	2	Classroom	2450	Wall	Midle Wall	Solid	Concre	0.01
517	1963 Bldg	180	XRF	4/25/97	2	Classroom	2450	Wall	Wall	Solid	Concre	0.05
518	1963 Bldg	181	XRF	4/25/97	2	Classroom	2450	Cabinet	Door	Solid	Wood	0
519	1963 Bldg	182	XRF	4/25/97	2	Classroom	2450	Wall	Wall	Solid	Concre	0.03
520	1963 Bldg	183	XRF	4/25/97	2	Classroom	2450		Radiator	Solid	Metal	0
521	1963 Bldg	184	XRF	4/25/97	2	Classroom	2450		Radiator	Solid	Metal	0.14
522	1963 Bldg	185	XRF	4/25/97	2	Classroom	2450	Window	Stool	Solid	Metal	0.04
523	1963 Bldg	99	XRF	4/29/97	2	Classroom	2450	Ceiling		Solid	Plaster	0
524	1963 Bldg	165	XRF	4/25/97	2	Classroom	2470	Wall	Wall	Solid	Concre	0.04
525	1963 Bldg	166	XRF	4/25/97	2	Classroom	2470	Wall	Midle Wall	Solid	Concre	0.03
526	1963 Bldg	167	XRF	4/25/97	2	Classroom	2470	Door	Door	Solid	Wood	0.01
527	1963 Bldg	168	XRF	4/25/97	2	Classroom	2470	Door	Casing	Solid	Metal	0.11
528	1963 Bldg	169	XRF	4/25/97	2	Classroom	2470	Wall	Wall	Solid	Concre	0.02
529	1963 Bldg	170	XRF	4/25/97	2	Classroom	2470	Cabinet	Door	Solid	Wood	0
530	1963 Bldg	171	XRF	4/25/97	2	Classroom	2470	Wall	Wall	Solid	Concre	0.04
531	1963 Bldg	172	XRF	4/25/97	2	Classroom	2470		Radiator	Solid	Metal	0
532	1963 Bldg	173	XRF	4/25/97	2	Classroom	2470	Window	Stool	Solid	Metal	0.04

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
533	1963 Bldg	174	XRF	4/25/97	2	Classroom	2470		Radiator	Solid	Metal	0.06
534	1963 Bldg	97	XRF	4/29/97	2	Classroom	2470	Ceiling		Solid	Plaster	0
535	1963 Bldg	126	XRF	4/26/97	2	Classroom	2480	Cabinet	Door	Solid	Wood	0
536	1963 Bldg	127	XRF	4/26/97	2	Classroom	2480	Wall	Wall	Solid	Concrete	0.03
537	1963 Bldg	128	XRF	4/26/97	2	Classroom	2480	Wall	Midle Wall	Solid	Concrete	0.03
538	1963 Bldg	129	XRF	4/26/97	2	Classroom	2480		Radiator	Solid	Metal	0
539	1963 Bldg	130	XRF	4/26/97	2	Classroom	2480	Window	Stool	Solid	Metal	0.06
540	1963 Bldg	131	XRF	4/26/97	2	Classroom	2480		Radiator	Solid	Metal	0.13
541	1963 Bldg	132	XRF	4/26/97	2	Classroom	2480	Door	Door	Solid	Wood	0.01
542	1963 Bldg	133	XRF	4/26/97	2	Classroom	2480	Door	Casing	Solid	Metal	0.1
543	1963 Bldg	134	XRF	4/26/97	2	Classroom	2480	Window	Panel	Solid	Metal	0.11
544	1963 Bldg	135	XRF	4/26/97	2	Classroom	2480	Wall	Wall	Solid	Concrete	0.02
545	1963 Bldg	136	XRF	4/26/97	2	Classroom	2480	Wall	Wall	Solid	Concrete	0.02
546	1963 Bldg	96	XRF	4/29/97	2	Classroom	2480	Ceiling		Solid	Plaster	0
547	1963 Bldg	157	XRF	4/25/97	2	Classroom	2490	Door	Door	Solid	Wood	0.01
548	1963 Bldg	158	XRF	4/25/97	2	Classroom	2490	Window	Panel	Solid	Metal	0
549	1963 Bldg	159	XRF	4/25/97	2	Classroom	2490	Door	Casing	Solid	Metal	0.09
550	1963 Bldg	160	XRF	4/25/97	2	Classroom	2490	Wall	Wall	Solid	Concrete	0.18
551	1963 Bldg	161	XRF	4/25/97	2	Classroom	2490	Door	Header	Solid	Wood	0
552	1963 Bldg	162	XRF	4/25/97	2	Classroom	2490	Cabinet	Door	Solid	Wood	0
553	1963 Bldg	163	XRF	4/25/97	2	Classroom	2490		Radiator	Solid	Metal	0.14
554	1963 Bldg	164	XRF	4/25/97	2	Classroom	2490	Window	Stool	Solid	Metal	0.11
555	1963 Bldg	137	XRF	4/26/97	2	Classroom	2500	Wall	Midle Wall	Solid	Concrete	0.04
556	1963 Bldg	138	XRF	4/26/97	2	Classroom	2500	Wall	Wall	Solid	Concrete	0.03
557	1963 Bldg	139	XRF	4/26/97	2	Classroom	2500	Wall	Wall	Solid	Concrete	0.07
558	1963 Bldg	140	XRF	4/26/97	2	Classroom	2500		Radiator	Solid	Metal	0.11
559	1963 Bldg	141	XRF	4/26/97	2	Classroom	2500	Cabinet	Door	Solid	Wood	0
560	1963 Bldg	142	XRF	4/26/97	2	Classroom	2500	Door	Door	Solid	Wood	0.02
561	1963 Bldg	143	XRF	4/26/97	2	Classroom	2500	Door	Casing	Solid	Metal	0.18
562	1963 Bldg	144	XRF	4/26/97	2	Classroom	2500	Window	Panel	Solid	Metal	0.08
563	1963 Bldg	146	XRF	4/25/97	2	Classroom	2520	Door	Door	Solid	Wood	0.01
564	1963 Bldg	147	XRF	4/25/97	2	Classroom	2520	Door	Casing	Solid	Metal	0.06
565	1963 Bldg	148	XRF	4/25/97	2	Classroom	2520	Wall	Wall	Solid	Concrete	0.08
566	1963 Bldg	149	XRF	4/25/97	2	Classroom	2520	Window	Panel	Solid	Metal	0.01
567	1963 Bldg	150	XRF	4/25/97	2	Classroom	2520	Wall	Midle Wall	Solid	Concrete	0.05
568	1963 Bldg	151	XRF	4/25/97	2	Classroom	2520	Wall	Wall	Solid	Concrete	0.02
569	1963 Bldg	152	XRF	4/25/97	2	Classroom	2520	Wall	Wall	Solid	Concrete	0.03
570	1963 Bldg	153	XRF	4/25/97	2	Classroom	2520	Cabinet	Door	Solid	Wood	0
571	1963 Bldg	154	XRF	4/25/97	2	Classroom	2520		Radiator	Solid	Metal	0
572	1963 Bldg	155	XRF	4/25/97	2	Classroom	2520		Radiator	Solid	Metal	0.14
573	1963 Bldg	156	XRF	4/25/97	2	Classroom	2520	Window	Stool	Solid	Metal	0.1
574	1963 Bldg	94	XRF	4/29/97	2	Classroom	2520	Ceiling		Solid	Plaster	0
575	1963 Bldg	132	XRF	4/25/97	2	Classroom	2540	Wall	Midle Wall	Solid	Concrete	0.03
576	1963 Bldg	133	XRF	4/25/97	2	Classroom	2540	Wall	Wall	Solid	Concrete	0.02
577	1963 Bldg	134	XRF	4/25/97	2	Classroom	2540	Cabinet	Outside	Solid	Wood	0.01
578	1963 Bldg	135	XRF	4/25/97	2	Classroom	2540	Cabinet	Outside	Solid	Wood	0
579	1963 Bldg	136	XRF	4/25/97	2	Classroom	2540	Wall	Midle Wall	Solid	Concrete	0.06
580	1963 Bldg	137	XRF	4/25/97	2	Classroom	2540	Wall	Midle Wall	Solid	Concrete	0.05
581	1963 Bldg	138	XRF	4/25/97	2	Classroom	2540	Door	Door	Solid	Wood	0.01
582	1963 Bldg	139	XRF	4/25/97	2	Classroom	2540	Door	Casing	Solid	Metal	0.08
583	1963 Bldg	140	XRF	4/25/97	2	Classroom	2540	Door	Header	Solid	Wood	0
584	1963 Bldg	141	XRF	4/25/97	2	Classroom	2540		Elec Pane	Solid	Metal	0.03
585	1963 Bldg	142	XRF	4/25/97	2	Classroom	2540	Cabinet	Door	Solid	Wood	0
586	1963 Bldg	143	XRF	4/25/97	2	Classroom	2540	Window	Stool	Solid	Metal	0.03
587	1963 Bldg	144	XRF	4/25/97	2	Classroom	2540	Wall	Wall	Solid	Concrete	0.05
588	1963 Bldg	145	XRF	4/25/97	2	Classroom	2540		Radiator	Solid	Metal	0
589	1963 Bldg	145	XRF	4/26/97	2	Classroom	2540	Wall	Midle Wall	Solid	Concrete	0.03
590	1963 Bldg	146	XRF	4/26/97	2	Classroom	2540	Window	Stool	Solid	Metal	0.04
591	1963 Bldg	147	XRF	4/26/97	2	Classroom	2540	Wall	Wall	Solid	Concrete	0.07

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
592	1963 Bldg	148	XRF	4/26/97	2	Classroom	2540	Wall	Wall	Solid	Concrete	0.03
593	1963 Bldg	149	XRF	4/26/97	2	Classroom	2540	Wall	Wall	Solid	Concrete	0.14
594	1963 Bldg	150	XRF	4/26/97	2	Classroom	2540		Radiator	Solid	Metal	0
595	1963 Bldg	151	XRF	4/26/97	2	Classroom	2540		Radiator	Solid	Metal	0.12
596	1963 Bldg	152	XRF	4/26/97	2	Classroom	2540	Door	Door	Solid	Wood	0.02
597	1963 Bldg	153	XRF	4/26/97	2	Classroom	2540	Door	Casing	Solid	Metal	0.07
598	1963 Bldg	154	XRF	4/26/97	2	Classroom	2540	Window	Panel	Solid	Wood	0
599	1963 Bldg	155	XRF	4/26/97	2	Classroom	2540	Wall	Wall	Solid	Concrete	0.06
600	1963 Bldg	156	XRF	4/26/97	2	Classroom	2540	Cabinet	Door	Solid	Wood	0
601	1963 Bldg	110	XRF	4/25/97	2	Classroom	2570	Wall	Midle Wall	Solid	Concrete	0.04
602	1963 Bldg	111	XRF	4/25/97	2	Classroom	2570		Elec Pane	Solid	Metal	0.03
603	1963 Bldg	112	XRF	4/25/97	2	Classroom	2570	Door	Casing	Solid	Metal	0.14
604	1963 Bldg	113	XRF	4/25/97	2	Classroom	2570	Wall	Midle Wall	Solid	Concrete	0.04
605	1963 Bldg	114	XRF	4/25/97	2	Classroom	2570	Cabinet	Outside	Solid	Wood	0.02
606	1963 Bldg	115	XRF	4/25/97	2	Classroom	2570	Cabinet	Door	Solid	Wood	0
607	1963 Bldg	116	XRF	4/25/97	2	Classroom	2570	Wall	Wall	Solid	Concrete	0.13
608	1963 Bldg	117	XRF	4/25/97	2	Classroom	2570	Wall	Midle Wall	Solid	Metal	0.1
609	1963 Bldg	118	XRF	4/25/97	2	Classroom	2570		Radiator	Solid	Metal	0
610	1963 Bldg	119	XRF	4/25/97	2	Classroom	2570	Window	Stool	Solid	Metal	0.04
611	1963 Bldg	120	XRF	4/25/97	2	Classroom	2570	Wall	Wall	Solid	Concrete	0.22
612	1963 Bldg	121	XRF	4/25/97	2	Classroom	2570	Door	Door	Solid	Wood	0.01
613	1963 Bldg	122	XRF	4/25/97	2	Classroom	2570	Door	Casing	Solid	Metal	0.12
614	1963 Bldg	123	XRF	4/25/97	2	Classroom	2570	Door	Header	Solid	Wood	0
615	1963 Bldg	157	XRF	4/26/97	2	Classroom	2580	Wall	Midle Wall	Solid	Concrete	0.04
616	1963 Bldg	158	XRF	4/26/97	2	Classroom	2580	Window	Stool	Solid	Metal	0.05
617	1963 Bldg	159	XRF	4/26/97	2	Classroom	2580		Radiator	Solid	Metal	0.01
618	1963 Bldg	160	XRF	4/26/97	2	Classroom	2580	Wall	Wall	Solid	Concrete	0.01
619	1963 Bldg	161	XRF	4/26/97	2	Classroom	2580	Wall	Midle Wall	Solid	Concrete	0.1
620	1963 Bldg	162	XRF	4/26/97	2	Classroom	2580	Cabinet	Door	Solid	Wood	0
621	1963 Bldg	163	XRF	4/26/97	2	Classroom	2580	Door	Door	Solid	Wood	0.01
622	1963 Bldg	164	XRF	4/26/97	2	Classroom	2580	Door	Casing	Solid	Metal	0.23
623	1963 Bldg	165	XRF	4/26/97	2	Classroom	2580	Door	Header	Solid	Wood	0.03
624	1963 Bldg	166	XRF	4/26/97	2	Classroom	2580	Wall	Wall	Solid	Concrete	0.02
625	1963 Bldg	167	XRF	4/26/97	2	Classroom	2580		Elec Pane	Solid	Metal	0.05
626	1963 Bldg	96	XRF	4/25/97	2	Classroom	2590	Wall	Midle Wall	Solid	Concrte	0.03
627	1963 Bldg	97	XRF	4/25/97	2	Classroom	2590	Cabinet	Door	Solid	Wood	0
628	1963 Bldg	98	XRF	4/25/97	2	Classroom	2590		Elec Pane	Solid	Metal	0.04
629	1963 Bldg	99	XRF	4/25/97	2	Classroom	2590	Door	Door	Solid	Wood	0.01
630	1963 Bldg	100	XRF	4/25/97	2	Classroom	2590	Door	Casing	Solid	Metal	0.35
631	1963 Bldg	101	XRF	4/25/97	2	Classroom	2590	Door	Header	Solid	Wood	0
632	1963 Bldg	102	XRF	4/25/97	2	Classroom	2590		Radiator	Solid	Metal	0.09
633	1963 Bldg	103	XRF	4/25/97	2	Classroom	2590	Wall	Midle Wall	Solid	Concrete	0.06
634	1963 Bldg	104	XRF	4/25/97	2	Classroom	2590	Cabinet	Door	Solid	Wood	0
635	1963 Bldg	105	XRF	4/25/97	2	Classroom	2590		Radiator	Solid	Metal	0.01
636	1963 Bldg	106	XRF	4/25/97	2	Classroom	2590	Window	Stool	Solid	Metal	0.05
637	1963 Bldg	107	XRF	4/25/97	2	Classroom	2590	Wall	Midle Wall	Solid	Concrte	0.02
638	1963 Bldg	108	XRF	4/25/97	2	Classroom	2590	Wall	Wall	Solid	Concrte	0.05
639	1963 Bldg	109	XRF	4/25/97	2	Classroom	2590	Wall	Wall	Solid	Concrte	0.02
640	1963 Bldg	168	XRF	4/26/97	2	Classroom	2600	Wall	Midle Wall	Solid	Concrete	0.02
641	1963 Bldg	169	XRF	4/26/97	2	Classroom	2600		Radiator	Solid	Metal	0
642	1963 Bldg	170	XRF	4/26/97	2	Classroom	2600	Window	Stool	Solid	Metal	0
643	1963 Bldg	171	XRF	4/26/97	2	Classroom	2600	Wall	Wall	Solid	Concrte	0.02
644	1963 Bldg	172	XRF	4/26/97	2	Classroom	2600	Wall	Wall	Solid	Concrete	0.06
645	1963 Bldg	173	XRF	4/26/97	2	Classroom	2600	Cabinet	Door	Solid	Wood	0
646	1963 Bldg	174	XRF	4/26/97	2	Classroom	2600	Wall	Midle Wall	Solid	Concrete	0.03
647	1963 Bldg	175	XRF	4/26/97	2	Classroom	2600	Door	Door	Solid	Wood	0.01
648	1963 Bldg	176	XRF	4/26/97	2	Classroom	2600	Door	Casing	Solid	Metal	0.35
649	1963 Bldg	177	XRF	4/26/97	2	Classroom	2600	Window	Panel	Solid	Wood	0
650	1963 Bldg	178	XRF	4/26/97	2	Classroom	2600		Elec Pane	Solid	Metal	0.03

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
651	1963 Bldg	85	XRF	4/25/97	2	Classroom	2620	Wall	Midle Wall	Solid	Concrete	0.03
652	1963 Bldg	86	XRF	4/25/97	2	Classroom	2620	Door	Door	Solid	Wood	0.01
653	1963 Bldg	87	XRF	4/25/97	2	Classroom	2620	Door	Casing	Solid	Metal	0.13
654	1963 Bldg	88	XRF	4/25/97	2	Classroom	2620	Door	Header	Solid	Wood	0
655	1963 Bldg	89	XRF	4/25/97	2	Classroom	2620	Wall	Midle Wall	Solid	Concrete	0.03
656	1963 Bldg	90	XRF	4/25/97	2	Classroom	2620	Wall	Wall	Solid	Concrete	0.05
657	1963 Bldg	91	XRF	4/25/97	2	Classroom	2620	Wall	Wall	Solid	Concrete	0.05
658	1963 Bldg	92	XRF	4/25/97	2	Classroom	2620		Elec Pane	Solid	Metal	0.03
659	1963 Bldg	93	XRF	4/25/97	2	Classroom	2620	Window	Stool	Solid	Metal	0.04
660	1963 Bldg	94	XRF	4/25/97	2	Classroom	2620		Radiator	Solid	Metal	0
661	1963 Bldg	95	XRF	4/25/97	2	Classroom	2620	Cabinet	Door	Solid	Wood	0
662	1963 Bldg	73	XRF	4/25/97	2	Classroom	2640	Wall	Wall	Solid	Concrete	0.01
663	1963 Bldg	74	XRF	4/25/97	2	Classroom	2640	Wall	Wall	Solid	Concrete	0.04
664	1963 Bldg	75	XRF	4/25/97	2	Classroom	2640	Cabinet	Door	Solid	Wood	0
665	1963 Bldg	76	XRF	4/25/97	2	Classroom	2640	Cabinet	Door	Solid	Wood	0
666	1963 Bldg	77	XRF	4/25/97	2	Classroom	2640	Window	Stool	Solid	Metal	0.05
667	1963 Bldg	78	XRF	4/25/97	2	Classroom	2640	Wall	Midle Wall	Solid	Concrete	0.02
668	1963 Bldg	79	XRF	4/25/97	2	Classroom	2640	Wall	Midle Wall	Solid	Concrete	0.04
669	1963 Bldg	80	XRF	4/25/97	2	Classroom	2640		Radiator	Solid	Metal	0
670	1963 Bldg	81	XRF	4/25/97	2	Classroom	2640	Door	Door	Solid	Wood	0.01
671	1963 Bldg	82	XRF	4/25/97	2	Classroom	2640	Door	Casing	Solid	Metal	0.1
672	1963 Bldg	83	XRF	4/25/97	2	Classroom	2640	Window	Panel	Solid	Metal	0.07
673	1963 Bldg	84	XRF	4/25/97	2	Classroom	2640		Elec Pane	Solid	Metal	0.02
674	1963 Bldg	52	XRF	4/25/97	2	Classroom	2670	Wall	Wall	Solid	Concrete	0.09
675	1963 Bldg	53	XRF	4/25/97	2	Classroom	2670	Wall	Wall	Solid	Concrete	0.02
676	1963 Bldg	54	XRF	4/25/97	2	Classroom	2670	Window	Stool	Solid	Metal	0.03
677	1963 Bldg	55	XRF	4/25/97	2	Classroom	2670		Radiator	Solid	Metal	0
678	1963 Bldg	56	XRF	4/25/97	2	Classroom	2670	Wall	Midle Wall	Solid	Concrete	0.05
679	1963 Bldg	57	XRF	4/25/97	2	Classroom	2670	Wall	Wall	Solid	Concrete	0.03
680	1963 Bldg	58	XRF	4/25/97	2	Classroom	2670	Cabinet	Door	Solid	Wood	0
681	1963 Bldg	59	XRF	4/25/97	2	Classroom	2670	Door	Header	Solid	Wood	0
682	1963 Bldg	60	XRF	4/25/97	2	Classroom	2670	Door	Door	Solid	Wood	0
683	1963 Bldg	61	XRF	4/25/97	2	Classroom	2670	Door	Casing	Solid	Metal	0.15
684	1963 Bldg	62	XRF	4/25/97	2	Classroom	2670	Window	Panel	Solid	Metal	0.01
685	1963 Bldg	63	XRF	4/25/97	2	Classroom	2670		Elec Pane	Solid	Metal	0.07
686	1963 Bldg	179	XRF	4/26/97	2	Classroom	2680	Wall	Wall	Solid	Concrete	0.06
687	1963 Bldg	180	XRF	4/26/97	2	Classroom	2680	Wall	Midle Wall	Solid	Concrete	0.02
688	1963 Bldg	181	XRF	4/26/97	2	Classroom	2680	Door	Door	Solid	Wood	0.01
689	1963 Bldg	182	XRF	4/26/97	2	Classroom	2680	Door	Casing	Solid	Metal	0.15
690	1963 Bldg	183	XRF	4/26/97	2	Classroom	2680	Window	Panel	Solid	Metal	0.02
691	1963 Bldg	184	XRF	4/26/97	2	Classroom	2680	Wall	Wall	Solid	Concrete	0.02
692	1963 Bldg	185	XRF	4/26/97	2	Classroom	2680	Wall	Wall	Solid	Concrete	0.03
693	1963 Bldg	186	XRF	4/26/97	2	Classroom	2680	Cabinet	Door	Solid	Wood	0
694	1963 Bldg	187	XRF	4/26/97	2	Classroom	2680	Window	Stool	Solid	Metal	0.08
695	1963 Bldg	188	XRF	4/26/97	2	Classroom	2680		Radiator	Solid	Metal	0
696	1963 Bldg	189	XRF	4/26/97	2	Classroom	2680		Radiator	Solid	Metal	0.1
697	1963 Bldg	90	XRF	4/29/97	2	Classroom	2680	Ceiling		Solid	Plaster	0
698	1963 Bldg	190	XRF	4/26/97	2	Classroom	2690	Wall	Midle Wall	Solid	Concrete	0.07
699	1963 Bldg	191	XRF	4/26/97	2	Classroom	2690	Door	Door	Solid	Wood	0
700	1963 Bldg	192	XRF	4/26/97	2	Classroom	2690	Door	Casing	Solid	Metal	0.15
701	1963 Bldg	193	XRF	4/26/97	2	Classroom	2690	Window	Panel	Solid	Metal	0.11
702	1963 Bldg	194	XRF	4/26/97	2	Classroom	2690	Wall	Midle Wall	Solid	Concrete	0.02
703	1963 Bldg	195	XRF	4/26/97	2	Classroom	2690	Wall	Wall	Solid	Concrete	0.03
704	1963 Bldg	196	XRF	4/26/97	2	Classroom	2690	Wall	Wall	Solid	Concrete	0.02
705	1963 Bldg	197	XRF	4/26/97	2	Classroom	2690		Elec Pane	Solid	Metal	0.03
706	1963 Bldg	198	XRF	4/26/97	2	Classroom	2690	Cabinet	Door	Solid	Wood	0
707	1963 Bldg	199	XRF	4/26/97	2	Classroom	2690		Radiator	Solid	Metal	0
708	1963 Bldg	200	XRF	4/26/97	2	Classroom	2690		Radiator	Solid	Metal	0.07
709	1963 Bldg	201	XRF	4/26/97	2	Classroom	2690	Window	Stool	Solid	Metal	0.05

## Saint Paul Public Schools

John A. Johnson Senior High School

Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
710	1963 Bldg	38	XRF	4/25/97	2	Classroom	2710	Cabinet	Door	Solid	Wood	0
711	1963 Bldg	39	XRF	4/25/97	2	Classroom	2710	Wall	Midle Wall	Solid	Concrte	0.05
712	1963 Bldg	40	XRF	4/25/97	2	Classroom	2710	Wall	Wall	Solid	Concrte	0.01
713	1963 Bldg	41	XRF	4/25/97	2	Classroom	2710	Window	Casing	Solid	Metal	0.12
714	1963 Bldg	42	XRF	4/25/97	2	Classroom	2710	Door	Door	Solid	Wood	0.01
715	1963 Bldg	43	XRF	4/25/97	2	Classroom	2710	Door	Casing	Solid	Metal	0.08
716	1963 Bldg	44	XRF	4/25/97	2	Classroom	2710	Door	Header	Solid	Wood	0
717	1963 Bldg	45	XRF	4/25/97	2	Classroom	2710	Window	Stool	Solid	Metal	0.07
718	1963 Bldg	46	XRF	4/25/97	2	Classroom	2710		Radiator	Solid	Metal	0.07
719	1963 Bldg	47	XRF	4/25/97	2	Classroom	2710		Radiator	Solid	Metal	0
720	1963 Bldg	48	XRF	4/25/97	2	Classroom	2710	Wall	Midle Wall	Solid	Concrte	0.02
721	1963 Bldg	49	XRF	4/25/97	2	Classroom	2710	Wall	Wall	Solid	Concrte	0.01
722	1963 Bldg	50	XRF	4/25/97	2	Classroom	2710	Wall	Wall	Solid	Concrte	0.03
723	1963 Bldg	51	XRF	4/25/97	2	Classroom	2710	Window	Panel	Solid	Metal	0.08
724	1963 Bldg	89	XRF	4/29/97	2	Classroom	2710	Ceiling		Solid	Plaster	0
725	1963 Bldg	26	XRF	4/25/97	2	Classroom	2720	Wall	Midle Wall	Solid	Concrte	0.05
726	1963 Bldg	27	XRF	4/25/97	2	Classroom	2720	Window	Casing	Solid	Metal	0.14
727	1963 Bldg	28	XRF	4/25/97	2	Classroom	2720	Door	Door	Solid	Wood	0.01
728	1963 Bldg	29	XRF	4/25/97	2	Classroom	2720	Door	Casing	Solid	Metal	0.15
729	1963 Bldg	30	XRF	4/25/97	2	Classroom	2720	Door	Header	Solid	Wood	0
730	1963 Bldg	31	XRF	4/25/97	2	Classroom	2720	Window	Stool	Solid	Metal	0.05
731	1963 Bldg	32	XRF	4/25/97	2	Classroom	2720		Radiator	Solid	Metal	0.08
732	1963 Bldg	33	XRF	4/25/97	2	Classroom	2720	Wall	Midle Wall	Solid	Concrte	0.02
733	1963 Bldg	34	XRF	4/25/97	2	Classroom	2720	Chalkboard	Rail	Solid	Wood	0.02
734	1963 Bldg	35	XRF	4/25/97	2	Classroom	2720	Wall	Wall	Solid	Concrte	0.06
735	1963 Bldg	36	XRF	4/25/97	2	Classroom	2720	Wall	Wall	Solid	Concrte	0.04
736	1963 Bldg	37	XRF	4/25/97	2	Classroom	2720	Cabinet	Door	Solid	Wood	0.03
737	1963 Bldg	79	XRF	4/26/97	2	Classroom	2730	Wall	Wall	Solid	Concrte	0.05
738	1963 Bldg	80	XRF	4/26/97	2	Classroom	2730	Wall	Wall	Solid	Concrte	0.07
739	1963 Bldg	81	XRF	4/26/97	2	Classroom	2730	Door	Door	Solid	Wood	0.01
740	1963 Bldg	82	XRF	4/26/97	2	Classroom	2730	Door	Casing	Solid	Metal	0.09
741	1963 Bldg	83	XRF	4/26/97	2	Classroom	2730	Window	Panel	Solid	Metal	0.1
742	1963 Bldg	84	XRF	4/26/97	2	Classroom	2730	Wall	Midle Wall	Solid	Concrte	0.03
743	1963 Bldg	85	XRF	4/26/97	2	Classroom	2730	Wall	Wall	Solid	Concrte	0.01
744	1963 Bldg	86	XRF	4/26/97	2	Classroom	2730		Elec Pane	Solid	Metal	0.06
745	1963 Bldg	87	XRF	4/26/97	2	Classroom	2730	Cabinet	Door	Solid	Wood	0
746	1963 Bldg	90	XRF	4/26/97	2	Classroom	2740	Door	Door	Solid	Wood	0.02
747	1963 Bldg	91	XRF	4/26/97	2	Classroom	2740	Door	Casing	Solid	Metal	0.1
748	1963 Bldg	92	XRF	4/26/97	2	Classroom	2740	Cabinet	Door	Solid	Wood	0.01
749	1963 Bldg	93	XRF	4/26/97	2	Classroom	2740	Wall	Midle Wall	Solid	Concrte	0.08
750	1963 Bldg	94	XRF	4/26/97	2	Classroom	2740	Wall	Wall	Solid	Concrte	0.07
751	1963 Bldg	95	XRF	4/26/97	2	Classroom	2740	Wall	Midle Wall	Solid	Concrte	0.02
752	1963 Bldg	96	XRF	4/26/97	2	Classroom	2740	Window	Panel	Solid	Metal	0
753	1963 Bldg	97	XRF	4/26/97	2	Classroom	2740	Window	Stool	Solid	Metal	0.05
754	1963 Bldg	98	XRF	4/26/97	2	Classroom	2740	Door	Header	Solid	Wood	0
755	1963 Bldg	99	XRF	4/26/97	2	Classroom	2740	Wall	Wall	Solid	Concrte	0.03
756	1963 Bldg	100	XRF	4/26/97	2	Classroom	2740		Radiator	Solid	Metal	0.11
757	1963 Bldg	101	XRF	4/26/97	2	Classroom	2740		Radiator	Solid	Metal	0
758	1963 Bldg	88	XRF	4/29/97	2	Classroom	2740	Ceiling		Solid	Plaster	0
759	1963 Bldg	102	XRF	4/26/97	2	Classroom	2750	Wall	Midle Wall	Solid	Concrte	0.05
760	1963 Bldg	103	XRF	4/26/97	2	Classroom	2750	Door	Door	Solid	Wood	0.01
761	1963 Bldg	104	XRF	4/26/97	2	Classroom	2750	Door	Casing	Solid	Metal	0.13
762	1963 Bldg	105	XRF	4/26/97	2	Classroom	2750	Wall	Midle Wall	Solid	Concrte	0.04
763	1963 Bldg	106	XRF	4/26/97	2	Classroom	2750	Bulletin Board		Solid	Wood	0
764	1963 Bldg	107	XRF	4/26/97	2	Classroom	2750	Window	Panel	Solid	Wood	0
765	1963 Bldg	108	XRF	4/26/97	2	Classroom	2750	Window	Stool	Solid	Metal	0.06
766	1963 Bldg	109	XRF	4/26/97	2	Classroom	2750		Radiator	Solid	Metal	0
767	1963 Bldg	110	XRF	4/26/97	2	Classroom	2750		Radiator	Solid	Metal	0.03
768	1963 Bldg	87	XRF	4/29/97	2	Classroom	2770	Ceiling		Solid	Plaster	0

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
769	1963 Bldg	15	XRF	4/25/97	2	Classroom	2779	Wall	Midle Wall	Solid	Concrte	0.04
770	1963 Bldg	16	XRF	4/25/97	2	Classroom	2779	Window	Stool	Solid	Metal	0.03
771	1963 Bldg	17	XRF	4/25/97	2	Classroom	2779		Radiator	Solid	Metal	0.07
772	1963 Bldg	18	XRF	4/25/97	2	Classroom	2779	Wall	Midle Wall	Solid	Concrte	0.04
773	1963 Bldg	19	XRF	4/25/97	2	Classroom	2779	Door	Door	Solid	Wood	0.01
774	1963 Bldg	20	XRF	4/25/97	2	Classroom	2779	Door	Casing	Solid	Metal	0.16
775	1963 Bldg	21	XRF	4/25/97	2	Classroom	2779	Door	Header	Solid	Wood	0
776	1963 Bldg	22	XRF	4/25/97	2	Classroom	2779		Radiator	Solid	Metal	0
777	1963 Bldg	23	XRF	4/25/97	2	Classroom	2779	Wall	Wall	Solid	Concrte	0.06
778	1963 Bldg	24	XRF	4/25/97	2	Classroom	2779	Cabinet	Door	Solid	Wood	0
779	1963 Bldg	25	XRF	4/25/97	2	Classroom	2779	Window	Panel	Solid	Metal	0.07
780	1963 Bldg	6	XRF	4/25/97	2	Classroom	2780	Bookcase	Shelf	Solid	Wood	0
781	1963 Bldg	7	XRF	4/25/97	2	Classroom	2780	Wall	Wall	Solid	Concrte	0.05
782	1963 Bldg	8	XRF	4/25/97	2	Classroom	2780	Chalkboard	Rail	Solid	Wood	0
783	1963 Bldg	9	XRF	4/25/97	2	Classroom	2780	Window	Stool	Solid	Metal	0.02
784	1963 Bldg	10	XRF	4/25/97	2	Classroom	2780		Radiator	Solid	Metal	0.12
785	1963 Bldg	11	XRF	4/25/97	2	Classroom	2780	Wall	Midle Wall	Solid	Concrte	0.02
786	1963 Bldg	12	XRF	4/25/97	2	Classroom	2780	Door	Door	Solid	Wood	0.01
787	1963 Bldg	13	XRF	4/25/97	2	Classroom	2780	Door	Casing	Solid	Metal	0.09
788	1963 Bldg	14	XRF	4/25/97	2	Classroom	2780	Window	Panel	Solid	Metal	0.01
789	1963 Bldg	145	XRF	4/14/97	1	Gym	1	Door	Door	Solid	Wood	0
790	1963 Bldg	146	XRF	4/14/97	1	Gym	1	Wall	Midle Wall	Solid	Concrte	0.09
791	1963 Bldg	147	XRF	4/14/97	1	Gym	1	Wall	Midle Wall	Solid	Wood	0
792	1963 Bldg	148	XRF	4/14/97	1	Gym	1	Door	Door	Solid	Wood	0.02
793	1963 Bldg	149	XRF	4/14/97	1	Gym	1	Door	Casing	Solid	Metal	0.07
794	1963 Bldg	150	XRF	4/14/97	1	Gym	1	Wall	Wall Rgstr	Solid	Metal	0.08
795	1963 Bldg	151	XRF	4/14/97	1	Gym	1	Window	Sill	Solid	Wood	0.05
796	1963 Bldg	152	XRF	4/14/97	1	Gym	1		Radiator	Solid	Metal	0.02
797	1963 Bldg	153	XRF	4/14/97	1	Gym	1	Wall	Midle Wall	Solid	Concrte	0.07
798	1963 Bldg	154	XRF	4/14/97	1	Gym	1		Elec Pane	Solid	Metal	0.05
799	1963 Bldg	155	XRF	4/14/97	1	Gym	1	Floor		Solid	Wood	0
800	1963 Bldg	156	XRF	4/14/97	1	Gym	1	Floor		Solid	Wood	0
801	1963 Bldg	157	XRF	4/14/97	1	Gym	1	Floor		Solid	Wood	0
802	1963 Bldg	158	XRF	4/14/97	1	Gym	1	Floor		Solid	Wood	0
803	1963 Bldg	24	XRF	4/14/97	1	Gym	111		Locker	Solid	Metal	0.15
804	1963 Bldg	25	XRF	4/14/97	1	Gym	111		Locker	Solid	Metal	0
805	1963 Bldg	26	XRF	4/14/97	1	Gym	111	Wall	Wall	Solid	Concrte	0.01
806	1963 Bldg	27	XRF	4/14/97	1	Gym	111	Wall	Wall	Solid	Concrte	0
807	1963 Bldg	28	XRF	4/14/97	1	Gym	111	Door	Door	Solid	Metal	0.01
808	1963 Bldg	29	XRF	4/14/97	1	Gym	111	Door	Casing	Solid	Metal	0.01
809	1963 Bldg	30	XRF	4/14/97	1	Gym	111	Wall	Midle Wall	Solid	Concrte	0.01
810	1963 Bldg	31	XRF	4/14/97	1	Gym	111	Door	Door	Solid	Wood	0
811	1963 Bldg	32	XRF	4/14/97	1	Gym	111		Locker	Solid	Metal	0.36
812	1963 Bldg	33	XRF	4/14/97	1	Gym	111	Bench		Solid	Wood	0
813	1963 Bldg	34	XRF	4/14/97	1	Gym	111	Bench	Rail	Solid	Metal	0.07
814	1963 Bldg	51	XRF	4/14/97	1	Gym	111		Bthrm Stll	Solid	Metal	0
815	1963 Bldg	52	XRF	4/14/97	1	Gym	111	Mirror	Frame	Solid	Wood	0.03
816	1963 Bldg	53	XRF	4/14/97	1	Gym	222	Wall	Midle Wall	Solid	Concrte	0.06
817	1963 Bldg	54	XRF	4/14/97	1	Gym	222	Wall	Midle Wall	Solid	Concrte	0
818	1963 Bldg	55	XRF	4/14/97	1	Gym	222	Door	Door	Solid	Wood	0
819	1963 Bldg	56	XRF	4/14/97	1	Gym	222	Door	Mural	Solid	Wood	0
820	1963 Bldg	57	XRF	4/14/97	1	Gym	222	Door	Casing	Solid	Wood	0
821	1963 Bldg	58	XRF	4/14/97	1	Gym	222	Wall	Midle Wall	Solid	Wood	0
822	1963 Bldg	59	XRF	4/14/97	1	Gym	222	Wall	Mural	Solid	Concrte	0
823	1963 Bldg	60	XRF	4/14/97	1	Gym	222	Wall	Chair rail	Solid	Wood	0
824	1963 Bldg	61	XRF	4/14/97	1	Gym	222	Door	Door	Solid	Wood	0.02
825	1963 Bldg	62	XRF	4/14/97	1	Gym	222	Door	Casing	Solid	Metal	0.03
826	1963 Bldg	63	XRF	4/14/97	1	Gym	333	Wall	Midle Wall	Solid	Concrte	0
827	1963 Bldg	64	XRF	4/14/97	1	Gym	333	Door	Door	Solid	Metal	0.1

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
828	1963 Bldg	65	XRF	4/14/97	1	Gym	333	Door	Casing	Solid	Metal	0.05
829	1963 Bldg	66	XRF	4/14/97	1	Gym	333	Door	Door	Solid	Wood	0.01
830	1963 Bldg	67	XRF	4/14/97	1	Gym	333	Mirror	Frame	Solid	Wood	0
831	1963 Bldg	68	XRF	4/14/97	1	Gym	333		Locker	Solid	Metal	0.24
832	1963 Bldg	69	XRF	4/14/97	1	Gym	333	Window	Panel	Solid	Wood	0
833	1963 Bldg	70	XRF	4/14/97	1	Gym	333	Window	Casing	Solid	Metal	0.16
834	1963 Bldg	71	XRF	4/14/97	1	Gym	333	Bench		Solid	Wood	0
835	1963 Bldg	72	XRF	4/14/97	1	Gym	333	Bench	Post	Solid	Metal	0.89
836	1963 Bldg	73	XRF	4/14/97	1	Gym	333	Door	Stall Door	Solid	Metal	0.15
837	1963 Bldg	74	XRF	4/14/97	1	Gym	333	Bookcase	Inside	Solid	Wood	0.03
838	1963 Bldg	58	XRF	4/29/97	1	Gym	434	Ceiling		Solid	Concrete	0.1
839	1963 Bldg	75	XRF	4/14/97	1	Gym	444	Door	Door	Solid	Metal	0.06
840	1963 Bldg	76	XRF	4/14/97	1	Gym	444	Door	Casing	Solid	Metal	0.04
841	1963 Bldg	77	XRF	4/14/97	1	Gym	444	Wall	Midle Wall	Solid	Wood	0
842	1963 Bldg	78	XRF	4/14/97	1	Gym	444		Radiator	Solid	Metal	0.05
843	1963 Bldg	79	XRF	4/14/97	1	Gym	444	Door	Door	Solid	Wood	0.28
844	1963 Bldg	80	XRF	4/14/97	1	Gym	444	Door	Casing	Solid	Metal	0.24
845	1963 Bldg	81	XRF	4/14/97	1	Gym	444	Door	Door	Solid	Wood	0.02
846	1963 Bldg	82	XRF	4/14/97	1	Gym	444	Door	Door	Solid	Metal	0.18
847	1963 Bldg	83	XRF	4/14/97	1	Gym	444	Bench		Solid	Wood	0
848	1963 Bldg	84	XRF	4/14/97	1	Gym	444	Bench	Post	Solid	Metal	0.07
849	1963 Bldg	54	XRF	4/29/97	1	Gym	9999	Ceiling		Solid	Concrete	0
850	1963 Bldg	85	XRF	4/14/97	1	Hall	1	Wall	Midle Wall	Solid	Concrete	0.07
851	1963 Bldg	86	XRF	4/14/97	1	Hall	1	Bookcase	Shelf	Solid	Wood	0.03
852	1963 Bldg	87	XRF	4/14/97	1	Hall	1	Door	Door	Solid	Wood	0.01
853	1963 Bldg	88	XRF	4/14/97	1	Hall	1	Door	Casing	Solid	Metal	0.06
854	1963 Bldg	89	XRF	4/14/97	1	Hall	1	Door	Door	Solid	Metal	0.03
855	1963 Bldg	90	XRF	4/14/97	1	Hall	1	Wall	Midle Wall	Solid	Concrete	0.01
856	1963 Bldg	91	XRF	4/14/97	1	Hall	1	Wall	Midle Wall	Solid	Wood	0
857	1963 Bldg	92	XRF	4/14/97	1	Hall	1	Door	Door	Solid	Metal	0.07
858	1963 Bldg	93	XRF	4/14/97	1	Hall	1	Door	Casing	Solid	Metal	0
859	1963 Bldg	94	XRF	4/14/97	1	Hall	1	Door	Door	Solid	Metal	0.07
860	1963 Bldg	95	XRF	4/14/97	1	Hall	1	Door	Casing	Solid	Metal	0.06
861	1963 Bldg	96	XRF	4/14/97	1	Hall	1	Door	Mural	Solid	Concrete	0.3
862	1963 Bldg	97	XRF	4/14/97	1	Hall	1	Door	Mural	Solid	Concrete	0.16
863	1963 Bldg	9	XRF	4/14/97	1	Hall	58	Door	Door	Solid	Metal	0.06
864	1963 Bldg	10	XRF	4/14/97	1	Hall	58	Door	Casing	Solid	Metal	0.04
865	1963 Bldg	11	XRF	4/14/97	1	Hall	58	Wall	Midle Wall	Solid	Concrete	0.04
866	1963 Bldg	12	XRF	4/14/97	1	Hall	58	Wall	Midle Wall	Solid	Concrete	0.03
867	1963 Bldg	13	XRF	4/14/97	1	Hall	58	Stairs	Hand rail	Solid	Metal	0.02
868	1963 Bldg	14	XRF	4/14/97	1	Hall	58	Stairs	Hand rail	Solid	Metal	0.05
869	1963 Bldg	15	XRF	4/14/97	1	Hall	58	Wall	Midle Wall	Solid	Concrete	1.29
870	1963 Bldg	16	XRF	4/14/97	1	Hall	58	Door	Door	Solid	Wood	0.01
871	1963 Bldg	17	XRF	4/14/97	1	Hall	58		Elec Pane	Solid	Metal	0.05
872	1963 Bldg	18	XRF	4/14/97	1	Hall	58	Stairs	Hand rail	Solid	Wood	0
873	1963 Bldg	19	XRF	4/14/97	1	Hall	58	Stairs	Baseboar	Solid	Wood	0.11
874	1963 Bldg	20	XRF	4/14/97	1	Hall	58	Stairs	Newal pos	Solid	Metal	0.04
875	1963 Bldg	21	XRF	4/14/97	1	Hall	58	Floor		Solid	Concrete	0.04
876	1963 Bldg	22	XRF	4/14/97	1	Hall	58	Wall	Wall Rgstr	Solid	Metal	0.03
877	1963 Bldg	23	XRF	4/14/97	1	Hall	58	Door	Panel	Solid	Metal	0
878	1963 Bldg	210	XRF	4/17/97	1	Hall	499	Door	Door	Solid	Metal	0.01
879	1963 Bldg	211	XRF	4/17/97	1	Hall	499	Door	Casing	Solid	Metal	0.1
880	1963 Bldg	212	XRF	4/17/97	1	Hall	499		Locker	Solid	Metal	0.18
881	1963 Bldg	213	XRF	4/17/97	1	Hall	499	Wall	Midle Wall	Solid	Concrete	0.02
882	1963 Bldg	214	XRF	4/17/97	1	Hall	499	Wall	Midle Wall	Solid	Concrete	0.02
883	1963 Bldg	215	XRF	4/17/97	1	Hall	499	Bookcase	Shelf	Solid	Wood	0.02
884	1963 Bldg	216	XRF	4/17/97	1	Hall	499	Door	Door	Solid	Wood	0.02
885	1963 Bldg	217	XRF	4/17/97	1	Hall	499	Door	Casing	Solid	Metal	0.01
886	1963 Bldg	218	XRF	4/17/97	1	Hall	499		Locker	Solid	Metal	0.13

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
887	1963 Bldg	219	XRF	4/17/97	1	Hall	499	Wall	Midle Wall	Solid	Concrete	0.11
888	1963 Bldg	220	XRF	4/17/97	1	Hall	499	Door	Door	Solid	Metal	0.1
889	1963 Bldg	221	XRF	4/17/97	1	Hall	499	Wall	Wall Rgstr	Solid	Metal	0.04
890	1963 Bldg	222	XRF	4/17/97	1	Hall	499	Wall	Panel	Solid	Metal	0
891	1963 Bldg	169	XRF	4/17/97	1	Hall	530	Wall	Midle Wall	Solid	Concrete	0.08
892	1963 Bldg	170	XRF	4/17/97	1	Hall	530	Door	Door	Solid	Wood	0.01
893	1963 Bldg	171	XRF	4/17/97	1	Hall	530	Door	Casing	Solid	Metal	0.07
894	1963 Bldg	172	XRF	4/17/97	1	Hall	530	Door	Door	Solid	Metal	0.23
895	1963 Bldg	173	XRF	4/17/97	1	Hall	530	Bookcase	Shelf	Solid	Wood	0.04
896	1963 Bldg	174	XRF	4/17/97	1	Hall	530	Wall	Midle Wall	Solid	Concrete	0
897	1963 Bldg	6	XRF	4/15/97	1	Hall	1041	Door	Door	Solid	Metal	0.28
898	1963 Bldg	7	XRF	4/15/97	1	Hall	1041	Door	Casing	Solid	Metal	0.14
899	1963 Bldg	8	XRF	4/15/97	1	Hall	1041	Wall	Midle Wall	Solid	Concrete	0.04
900	1963 Bldg	9	XRF	4/15/97	1	Hall	1041	Door	Door	Solid	Wood	0.02
901	1963 Bldg	10	XRF	4/15/97	1	Hall	1041	Door	Casing	Solid	Metal	0.01
902	1963 Bldg	11	XRF	4/15/97	1	Hall	1041	Cabinet	Outside	Solid	Wood	0
903	1963 Bldg	12	XRF	4/15/97	1	Hall	1041	Wall	Midle Wall	Solid	Concrete	0.02
904	1963 Bldg	13	XRF	4/15/97	1	Hall	1041	Stairs	Hand rail	Solid	Wood	0
905	1963 Bldg	14	XRF	4/15/97	1	Hall	1041	Wall	Midle Wall	Solid	Wood	0
906	1963 Bldg	15	XRF	4/15/97	1	Hall	1041	Wall	Cage	Solid	Metal	0.02
907	1963 Bldg	16	XRF	4/15/97	1	Hall	1041	Door	Door	Solid	Metal	0.03
908	1963 Bldg	17	XRF	4/15/97	1	Hall	1041	Door	Casing	Solid	Metal	0.02
909	1963 Bldg	18	XRF	4/15/97	1	Hall	1041	Wall	Mural	Solid	Concrete	0.21
910	1963 Bldg	19	XRF	4/15/97	1	Hall	1041	Wall	Mural	Solid	Concrete	0.07
911	1963 Bldg	20	XRF	4/15/97	1	Hall	1041	Wall	Mural	Solid	Concrete	0.1
912	1963 Bldg	21	XRF	4/15/97	1	Hall	1041	Door	Door	Solid	Metal	0.04
913	1963 Bldg	22	XRF	4/15/97	1	Hall	1041	Door	Casing	Solid	Metal	0.06
914	1963 Bldg	70	XRF	4/29/97	1	Hall	1104	Ceiling		Solid	Plaster	0.01
915	1963 Bldg	122	XRF	4/23/97	1	Hall	1930	Door	Door	Solid	Metal	0
916	1963 Bldg	123	XRF	4/23/97	1	Hall	1930	Door	Casing	Solid	Metal	0.05
917	1963 Bldg	124	XRF	4/23/97	1	Hall	1930	Door	Header	Solid	Wood	0
918	1963 Bldg	125	XRF	4/23/97	1	Hall	1930	Cabinet	Outside	Solid	Wood	0
919	1963 Bldg	126	XRF	4/23/97	1	Hall	1930	Door	Door	Solid	Wood	0.02
920	1963 Bldg	127	XRF	4/23/97	1	Hall	1930	Wall	Midle Wall	Solid	Concrete	0.09
921	1963 Bldg	128	XRF	4/23/97	1	Hall	1930	Wall	Midle Wall	Solid	Concrete	0.04
922	1963 Bldg	129	XRF	4/23/97	1	Hall	1930	Door	Casing	Solid	Metal	0.09
923	1963 Bldg	130	XRF	4/23/97	1	Hall	1930		Locker	Solid	Metal	0.12
924	1963 Bldg	131	XRF	4/23/97	1	Hall	1930		Locker	Solid	Metal	0.11
925	1963 Bldg	132	XRF	4/23/97	1	Hall	1930	Wall	Wall	Solid	Concrete	0.06
926	1963 Bldg	133	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.1
927	1963 Bldg	134	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.06
928	1963 Bldg	135	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.02
929	1963 Bldg	136	XRF	4/23/97	1	Hall	1930	Window	Panel	Solid	Wood	0
930	1963 Bldg	137	XRF	4/23/97	1	Hall	1930	Wall	Midle Wall	Solid	Concrete	0.03
931	1963 Bldg	138	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.05
932	1963 Bldg	139	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.03
933	1963 Bldg	140	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.03
934	1963 Bldg	141	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.04
935	1963 Bldg	142	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.04
936	1963 Bldg	143	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.08
937	1963 Bldg	144	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.11
938	1963 Bldg	145	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.05
939	1963 Bldg	146	XRF	4/23/97	1	Hall	1930	Window	Stool	Solid	Metal	0.08
940	1963 Bldg	147	XRF	4/23/97	1	Hall	1930		Radiator	Solid	Metal	0.1
941	1963 Bldg	148	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.13
942	1963 Bldg	149	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.02
943	1963 Bldg	150	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.03
944	1963 Bldg	151	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.05
945	1963 Bldg	152	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.01

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
946	1963 Bldg	153	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.02
947	1963 Bldg	154	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.04
948	1963 Bldg	155	XRF	4/23/97	1	Hall	1930	Wall	Mural	Solid	Concrete	0.05
949	1963 Bldg	191	XRF	4/15/97	2	Hall	2040	Door	Door	Solid	Wood	0.02
950	1963 Bldg	192	XRF	4/15/97	2	Hall	2040	Door	Casing	Solid	Metal	0.06
951	1963 Bldg	193	XRF	4/15/97	2	Hall	2040	Door	Header	Solid	Wood	0
952	1963 Bldg	194	XRF	4/15/97	2	Hall	2040	Door	Door	Solid	Metal	0.35
953	1963 Bldg	195	XRF	4/15/97	2	Hall	2040	Door	Casing	Solid	Metal	0.11
954	1963 Bldg	196	XRF	4/15/97	2	Hall	2040	Wall	Midle Wall	Solid	Concrete	0.02
955	1963 Bldg	197	XRF	4/15/97	2	Hall	2040		Locker	Solid	Metal	0.11
956	1963 Bldg	198	XRF	4/15/97	2	Hall	2040		Locker	Solid	Metal	0.01
957	1963 Bldg	199	XRF	4/15/97	2	Hall	2040		Locker	Solid	Metal	0
958	1963 Bldg	200	XRF	4/15/97	2	Hall	2040		Radiator	Solid	Metal	0.16
959	1963 Bldg	201	XRF	4/15/97	2	Hall	2040	Wall	Mural	Solid	Concrete	0.07
960	1963 Bldg	202	XRF	4/15/97	2	Hall	2040	Wall	Mural	Solid	Concrete	0.03
961	1963 Bldg	203	XRF	4/15/97	2	Hall	2040	Wall	Mural	Solid	Concrete	0.04
962	1963 Bldg	204	XRF	4/15/97	2	Hall	2040	Wall	Mural	Solid	Concrete	0.03
963	1963 Bldg	205	XRF	4/15/97	2	Hall	2040	Wall	Mural	Solid	Concrete	0.02
964	1963 Bldg	206	XRF	4/15/97	2	Hall	2040	Wall	Mural	Solid	Concrete	0.03
965	1963 Bldg	207	XRF	4/15/97	2	Hall	2040	Wall	Mural	Solid	Concrete	0.05
966	1963 Bldg	208	XRF	4/15/97	2	Hall	2040	Window	Stool	Solid	Metal	0.03
967	1963 Bldg	209	XRF	4/15/97	2	Hall	2040	Door	Door	Solid	Metal	0.04
968	1963 Bldg	210	XRF	4/15/97	2	Hall	2040	Door	Casing	Solid	Metal	0.06
969	1963 Bldg	211	XRF	4/15/97	2	Hall	2040	Wall	Midle Wall	Solid	Concrete	0.02
970	1963 Bldg	212	XRF	4/15/97	2	Hall	2040		Locker	Solid	Metal	0.84
971	1963 Bldg	213	XRF	4/15/97	2	Hall	2040	Wall	Mural	Solid	Concrete	0.05
972	1963 Bldg	214	XRF	4/15/97	2	Hall	2040	Wall	Mural	Solid	Concrete	0.05
973	1963 Bldg	215	XRF	4/15/97	2	Hall	2040	Wall	Mural	Solid	Concrete	0.05
974	1963 Bldg	53	XRF	4/16/97	2	Hall	2140	Door	Door	Solid	Wood	0
975	1963 Bldg	54	XRF	4/16/97	2	Hall	2140	Door	Casing	Solid	Metal	0.08
976	1963 Bldg	55	XRF	4/16/97	2	Hall	2140	Wall	Midle Wall	Solid	Concrete	0.1
977	1963 Bldg	56	XRF	4/16/97	2	Hall	2140	Door	Header	Solid	Wood	0
978	1963 Bldg	57	XRF	4/16/97	2	Hall	2140	Door	Threshold	Solid	Wood	0
979	1963 Bldg	113	XRF	4/16/97	2	Hall	2190	Wall	Midle Wall	Solid	Concrete	0.09
980	1963 Bldg	114	XRF	4/16/97	2	Hall	2190	Door	Door	Solid	Wood	0
981	1963 Bldg	115	XRF	4/16/97	2	Hall	2190	Door	Casing	Solid	Metal	0.09
982	1963 Bldg	116	XRF	4/16/97	2	Hall	2190	Door	Jamb	Solid	Wood	0
983	1963 Bldg	117	XRF	4/16/97	2	Hall	2190	Door	Threshold	Solid	Wood	0.03
984	1963 Bldg	118	XRF	4/16/97	2	Hall	2190	Door	Header	Solid	Wood	0
985	1963 Bldg	202	XRF	4/26/97	2	Hall	2800	Door	Door	Solid	Metal	0
986	1963 Bldg	203	XRF	4/26/97	2	Hall	2800	Door	Casing	Solid	Metal	0
987	1963 Bldg	204	XRF	4/26/97	2	Hall	2800	Wall	Midle Wall	Solid	Concrete	0.01
988	1963 Bldg	205	XRF	4/26/97	2	Hall	2800	Wall	Midle Wall	Solid	Concrete	0.05
989	1963 Bldg	206	XRF	4/26/97	2	Hall	2800	Wall	Wall Rgstr	Solid	Metal	0.06
990	1963 Bldg	207	XRF	4/26/97	2	Hall	2800	Door	Door	Solid	Wood	0.01
991	1963 Bldg	208	XRF	4/26/97	2	Hall	2800	Door	Casing	Solid	Metal	0.09
992	1963 Bldg	209	XRF	4/26/97	2	Hall	2800	Window	Panel	Solid	Metal	0.05
993	1963 Bldg	210	XRF	4/26/97	2	Hall	2800		Locker	Solid	Metal	0.2
994	1963 Bldg	211	XRF	4/26/97	2	Hall	2800	Wall	Mural	Solid	Concrete	0.01
995	1963 Bldg	212	XRF	4/26/97	2	Hall	2800	Wall	Mural	Solid	Concrete	0.12
996	1963 Bldg	213	XRF	4/26/97	2	Hall	2800	Wall	Mural	Solid	Concrete	0.03
997	1963 Bldg	214	XRF	4/26/97	2	Hall	2800	Wall	Mural	Solid	Concrete	0.02
998	1963 Bldg	215	XRF	4/26/97	2	Hall	2800	Wall	Mural	Solid	Concrete	0.02
999	1963 Bldg	216	XRF	4/26/97	2	Hall	2800		Locker	Solid	Metal	0.06
1000	1963 Bldg	217	XRF	4/26/97	2	Hall	2800	Wall	Mural	Solid	Concrete	0.02
1001	1963 Bldg	218	XRF	4/26/97	2	Hall	2800	Wall	Mural	Solid	Concrete	0.03
1002	1963 Bldg	219	XRF	4/26/97	2	Hall	2800	Wall	Mural	Solid	Concrete	0.1
1003	1963 Bldg	220	XRF	4/26/97	2	Hall	2800	Wall	Mural	Solid	Concrete	0.06
1004	1963 Bldg	221	XRF	4/26/97	2	Hall	2800	Door	Header	Solid	Wood	0

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L
Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1005	1963 Bldg	98 XRF	4/23/97	1	Library	1434	Bookcase	Inside	Solid	Wood	0
1006	1963 Bldg	99 XRF	4/23/97	1	Library	1434	Wall	Midle Wall	Solid	Concrete	0
1007	1963 Bldg	100 XRF	4/23/97	1	Library	1434	Door	Door	Solid	Wood	0
1008	1963 Bldg	101 XRF	4/23/97	1	Library	1434	Door	Casing	Solid	Metal	0
1009	1963 Bldg	102 XRF	4/23/97	1	Library	1434	Wall	Midle Wall	Solid	Concrete	0.02
1010	1963 Bldg	103 XRF	4/23/97	1	Library	1434	Window	Panel	Solid	Tile	0.84
1011	1963 Bldg	104 XRF	4/23/97	1	Library	1434	Bookcase	Inside	Solid	Wood	0
1012	1963 Bldg	105 XRF	4/23/97	1	Library	1434	Window	Casing	Solid	Metal	0.04
1013	1963 Bldg	106 XRF	4/23/97	1	Library	1434	Door	Door	Solid	Wood	0.01
1014	1963 Bldg	107 XRF	4/23/97	1	Library	1434	Wall	Midle Wall	Solid	Concrete	0.11
1015	1963 Bldg	108 XRF	4/23/97	1	Library	1434	Wall	Wall	Solid	Concrete	0.1
1016	1963 Bldg	109 XRF	4/23/97	1	Library	1434	Door	Header	Solid	Wood	0
1017	1963 Bldg	110 XRF	4/23/97	1	Library	1434	Wall	Midle Wall	Solid	Concrete	0.04
1018	1963 Bldg	111 XRF	4/23/97	1	Library	1434	Bookcase	Shelf	Solid	Wood	0
1019	1963 Bldg	28 XRF	4/26/97	2	Lounge	2340	Door	Door	Solid	Wood	0.01
1020	1963 Bldg	29 XRF	4/26/97	2	Lounge	2340	Door	Casing	Solid	Metal	0.13
1021	1963 Bldg	30 XRF	4/26/97	2	Lounge	2340	Door	Header	Solid	Wood	0
1022	1963 Bldg	31 XRF	4/26/97	2	Lounge	2340	Wall	Midle Wall	Solid	Concrete	0.13
1023	1963 Bldg	32 XRF	4/26/97	2	Lounge	2340	Window	Stool	Solid	Metal	0.11
1024	1963 Bldg	33 XRF	4/26/97	2	Lounge	2340		Radiator	Solid	Metal	0.09
1025	1963 Bldg	34 XRF	4/26/97	2	Lounge	2340	Wall	Midle Wall	Solid	Concrete	0.05
1026	1963 Bldg	35 XRF	4/26/97	2	Lounge	2340		Radiator	Solid	Metal	0.04
1027	1963 Bldg	36 XRF	4/26/97	2	Lounge	2340	Wall	Wall	Solid	Concrete	0.08
1028	1963 Bldg	37 XRF	4/26/97	2	Lounge	2340	Wall	Bthrm Stll	Solid	Metal	0
1029	1963 Bldg	70 XRF	4/15/97	1	Lunch Area	1120	Wall	Midle Wall	Solid	Concrete	0.06
1030	1963 Bldg	71 XRF	4/15/97	1	Lunch Area	1120	Wall	Mural	Solid	Concrete	0.04
1031	1963 Bldg	72 XRF	4/15/97	1	Lunch Area	1120	Wall	Mural	Solid	Concrete	0.04
1032	1963 Bldg	73 XRF	4/15/97	1	Lunch Area	1120		Radiator	Solid	Metal	0.12
1033	1963 Bldg	74 XRF	4/15/97	1	Lunch Area	1120	Window	Stool	Cracked	Wood	0
1034	1963 Bldg	75 XRF	4/15/97	1	Lunch Area	1120	Wall	Panel	Cracked	Wood	0.92
1035	1963 Bldg	76 XRF	4/15/97	1	Lunch Area	1120	Wall	Wall	Solid	Concrete	0.05
1036	1963 Bldg	77 XRF	4/15/97	1	Lunch Area	1120	Door	Door	Solid	Wood	0.01
1037	1963 Bldg	78 XRF	4/15/97	1	Lunch Area	1120	Door	Casing	Solid	Metal	0.02
1038	1963 Bldg	79 XRF	4/15/97	1	Lunch Area	1120	Wall	Midle Wall	Solid	Concrete	0.09
1039	1963 Bldg	80 XRF	4/15/97	1	Lunch Area	1120	Stairs	Hand rail	Solid	Wood	0
1040	1963 Bldg	6 XRF	4/28/97	1	Outside	1	Wall	Wall	Solid	Concrete	0
1041	1963 Bldg	7 XRF	4/28/97	1	Outside	1	Wall	Wall Rgstr	Cracked	Metal	0.14
1042	1963 Bldg	8 XRF	4/28/97	1	Outside	1	Door	Door	Solid	Metal	0.12
1043	1963 Bldg	9 XRF	4/28/97	1	Outside	1	Door	Casing	Solid	Metal	0.02
1044	1963 Bldg	10 XRF	4/28/97	1	Outside	1	Wall	Wall	Solid	Concrte	0.01
1045	1963 Bldg	11 XRF	4/28/97	1	Outside	1	Wall	Baseboar	Peeling	Concrete	0.02
1046	1963 Bldg	12 XRF	4/28/97	1	Outside	1	Door	Door	Solid	Metal	0.01
1047	1963 Bldg	13 XRF	4/28/97	1	Outside	1	Door	Casing	Solid	Metal	0.09
1048	1963 Bldg	14 XRF	4/28/97	1	Outside	1	Wall	Wall	Solid	Wood	0
1049	1963 Bldg	15 XRF	4/28/97	1	Outside	1		Downspou	Solid	Metal	0.31
1050	1963 Bldg	16 XRF	4/28/97	1	Outside	1	Stairs	Hand rail	Solid	Metal	0.01
1051	1963 Bldg	17 XRF	4/28/97	1	Outside	1	Wall	Wall Rgstr	Solid	Metal	0.09
1052	1963 Bldg	18 XRF	4/28/97	1	Outside	1	Vent		Solid	Metal	0.01
1053	1963 Bldg	19 XRF	4/28/97	1	Outside	1	Wall	Wall Rgstr	Solid	Metal	0.1
1054	1963 Bldg	20 XRF	4/28/97	1	Outside	1	Wall	Panel	Solid	Metal	0.97
1055	1963 Bldg	21 XRF	4/28/97	1	Outside	1	Handrail	Post	Solid	Concrete	0.01
1056	1963 Bldg	22 XRF	4/28/97	1	Outside	1	Stairs	Riser	Solid	Metal	0.03
1057	1963 Bldg	23 XRF	4/28/97	1	Outside	1	Stairs	Hand rail	Solid	Metal	0.04
1058	1963 Bldg	24 XRF	4/28/97	1	Outside	1	Wall	Wall	Chalking	Concrete	0.36
1059	1963 Bldg	25 XRF	4/28/97	1	Outside	1	Wall	Column	Solid	Metal	0.1
1060	1963 Bldg	26 XRF	4/28/97	1	Outside	1	Sign		Solid	Metal	0.02
1061	1963 Bldg	27 XRF	4/28/97	1	Outside	1	Stairs	Hand rail	Solid	Metal	0
1062	1963 Bldg	28 XRF	4/28/97	1	Outside	2	Curbing		Solid	Concrete	1.08
1063	1963 Bldg	29 XRF	4/28/97	1	Outside	2	Flag Pole		Chalking	Metal	0.15

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1064	1963 Bldg	30	XRF	4/28/97	1	Outside	2	Light Pole		Solid	Metal	0
1065	1963 Bldg	31	XRF	4/28/97	1	Outside	2	Light Pole	Base	Cracked	Concrete	2.35
1066	1963 Bldg	32	XRF	4/28/97	1	Outside	2	Stairs	Tread	Solid	Metal	0
1067	1963 Bldg	33	XRF	4/28/97	1	Outside	2	Stairs	Hand rail	Solid	Metal	0.1
1068	1963 Bldg	34	XRF	4/28/97	1	Outside	2	Floor		Solid	Concrete	0
1069	1963 Bldg	35	XRF	4/28/97	1	Outside	2	Floor		Solid	Concrete	0
1070	1963 Bldg	36	XRF	4/28/97	1	Outside	2	Floor		Solid	Concrete	0
1071	1963 Bldg	131	XRF	4/15/97	1	Restroom	43	Wall	Midle Wall	Solid	Concrete	0.02
1072	1963 Bldg	132	XRF	4/15/97	1	Restroom	43	Door	Stall Door	Solid	Metal	0
1073	1963 Bldg	133	XRF	4/15/97	1	Restroom	43	Wall	Midle Wall	Solid	Concrete	0
1074	1963 Bldg	134	XRF	4/15/97	1	Restroom	43	Door	Door	Solid	Wood	0.01
1075	1963 Bldg	135	XRF	4/15/97	1	Restroom	43	Door	Casing	Solid	Metal	0.03
1076	1963 Bldg	57	XRF	4/29/97	1	Restroom	110	Ceiling		Solid	Plaster	0.05
1077	1963 Bldg	64	XRF	4/17/97	1	Restroom	410	Wall	Midle Wall	Solid	Concrete	0.06
1078	1963 Bldg	65	XRF	4/17/97	1	Restroom	410	Wall	Bthrm Stll	Solid	Metal	0.01
1079	1963 Bldg	66	XRF	4/17/97	1	Restroom	410	Wall	Bthrm Stll	Solid	Drywall	0
1080	1963 Bldg	67	XRF	4/17/97	1	Restroom	410	Door	Door	Solid	Wood	0
1081	1963 Bldg	68	XRF	4/17/97	1	Restroom	410	Door	Casing	Solid	Metal	0.01
1082	1963 Bldg	69	XRF	4/17/97	1	Restroom	410	Wall	Midle Wall	Solid	Drywall	0
1083	1963 Bldg	51	XRF	4/29/97	1	Restroom	410	Ceiling		Solid	Plaster	0
1084	1963 Bldg	175	XRF	4/17/97	1	Restroom	554		Bthrm Stll	Solid	Metal	0
1085	1963 Bldg	176	XRF	4/17/97	1	Restroom	554	Door	Door	Solid	Wood	0
1086	1963 Bldg	177	XRF	4/17/97	1	Restroom	554	Door	Casing	Solid	Metal	0.03
1087	1963 Bldg	178	XRF	4/17/97	1	Restroom	554	Wall	Midle Wall	Solid	Concrete	0
1088	1963 Bldg	48	XRF	4/29/97	1	Restroom	554	Ceiling		Solid	Plaster	0
1089	1963 Bldg	77	XRF	4/29/97	1	Restroom	1040	Ceiling		Solid	Concrete	0.02
1090	1963 Bldg	161	XRF	4/23/97	1	Restroom	1200	Door	Door	Solid	Wood	0.01
1091	1963 Bldg	162	XRF	4/23/97	1	Restroom	1200	Door	Casing	Solid	Metal	0.1
1092	1963 Bldg	163	XRF	4/23/97	1	Restroom	1200	Wall	Midle Wall	Solid	Concrete	0
1093	1963 Bldg	164	XRF	4/23/97	1	Restroom	1200	Wall	Wall Rgstr	Solid	Metal	0
1094	1963 Bldg	165	XRF	4/23/97	1	Restroom	1200	Wall	Bthrm Stll	Solid	Metal	0.12
1095	1963 Bldg	166	XRF	4/23/97	1	Restroom	1200	Wall	Covering	Solid	Metal	0
1096	1963 Bldg	36	XRF	4/15/97	1	Restroom	1280	Wall	Midle Wall	Solid	Concrete	0
1097	1963 Bldg	37	XRF	4/15/97	1	Restroom	1280	Door	Stall Door	Solid	Metal	0
1098	1963 Bldg	38	XRF	4/15/97	1	Restroom	1280	Wall	Wall	Solid	Concrete	0
1099	1963 Bldg	39	XRF	4/15/97	1	Restroom	1280		Radiator	Solid	Metal	0.07
1100	1963 Bldg	40	XRF	4/15/97	1	Restroom	1280		Locker	Solid	Metal	0
1101	1963 Bldg	41	XRF	4/15/97	1	Restroom	1280	Wall	Midle Wall	Solid	Concrete	0
1102	1963 Bldg	42	XRF	4/15/97	1	Restroom	1280		Chair rail	Solid	Wood	0
1103	1963 Bldg	43	XRF	4/15/97	1	Restroom	1280	Door	Door	Solid	Wood	0.01
1104	1963 Bldg	44	XRF	4/15/97	1	Restroom	1280	Door	Casing	Solid	Metal	0.03
1105	1963 Bldg	67	XRF	4/29/97	1	Restroom	1280	Ceiling		Solid	Plaster	0
1106	1963 Bldg	75	XRF	4/29/97	1	Restroom	1311	Ceiling		Solid	Concrete	0
1107	1963 Bldg	21	XRF	4/17/97	1	Restroom	1349	Wall	Midle Wall	Solid	Concrete	0
1108	1963 Bldg	22	XRF	4/17/97	1	Restroom	1349	Wall	Midle Wall	Solid	Concrete	0.01
1109	1963 Bldg	23	XRF	4/17/97	1	Restroom	1349	Door	Door	Solid	Wood	0.01
1110	1963 Bldg	24	XRF	4/17/97	1	Restroom	1349	Door	Casing	Solid	Metal	0.03
1111	1963 Bldg	25	XRF	4/17/97	1	Restroom	1349	Wall	Bthrm Stll	Solid	Metal	0
1112	1963 Bldg	156	XRF	4/23/97	1	Restroom	1360	Door	Door	Solid	Wood	0
1113	1963 Bldg	157	XRF	4/23/97	1	Restroom	1360	Door	Casing	Solid	Metal	0.09
1114	1963 Bldg	158	XRF	4/23/97	1	Restroom	1360	Wall	Wall Rgstr	Solid	Metal	0.01
1115	1963 Bldg	159	XRF	4/23/97	1	Restroom	1360	Door	Stall Door	Solid	Metal	0.09
1116	1963 Bldg	160	XRF	4/23/97	1	Restroom	1360	Wall	Midle Wall	Solid	Concrete	0
1117	1963 Bldg	136	XRF	4/29/97	1	Restroom	1360	Ceiling		Solid	Plaster	0
1118	1963 Bldg	117	XRF	4/23/97	1	Restroom	1610	Wall	Wall Rgstr	Solid	Metal	0
1119	1963 Bldg	118	XRF	4/23/97	1	Restroom	1610	Door	Stall Door	Solid	Metal	0.28
1120	1963 Bldg	119	XRF	4/23/97	1	Restroom	1610	Wall	Midle Wall	Solid	Concrete	0
1121	1963 Bldg	120	XRF	4/23/97	1	Restroom	1610	Door	Door	Solid	Wood	0
1122	1963 Bldg	121	XRF	4/23/97	1	Restroom	1610	Door	Casing	Solid	Metal	0.14

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1123	1963 Bldg	112	XRF	4/23/97	1	Restroom	1670	Wall	Wall Rgstr	Solid	Metal	0.01
1124	1963 Bldg	113	XRF	4/23/97	1	Restroom	1670	Wall	Bthrm Stll	Solid	Metal	0.08
1125	1963 Bldg	114	XRF	4/23/97	1	Restroom	1670	Wall	Midle Wall	Solid	Concrete	0
1126	1963 Bldg	115	XRF	4/23/97	1	Restroom	1670	Door	Door	Solid	Wood	0.01
1127	1963 Bldg	116	XRF	4/23/97	1	Restroom	1670	Door	Casing	Solid	Metal	0.08
1128	1963 Bldg	120	XRF	4/29/97	1	Restroom	1670	Ceiling		Solid	Plaster	0.01
1129	1963 Bldg	61	XRF	4/21/97	1	Restroom	1840	Wall	Midle Wall	Solid	Concrete	0.01
1130	1963 Bldg	62	XRF	4/21/97	1	Restroom	1840	Door	Door	Solid	Wood	0.02
1131	1963 Bldg	63	XRF	4/21/97	1	Restroom	1840	Door	Casing	Solid	Metal	0.1
1132	1963 Bldg	64	XRF	4/21/97	1	Restroom	1840	Door	Header	Solid	Wood	0
1133	1963 Bldg	65	XRF	4/21/97	1	Restroom	1892	Wall	Midle Wall	Solid	Concrete	0
1134	1963 Bldg	66	XRF	4/21/97	1	Restroom	1892	Door	Door	Solid	Wood	0.02
1135	1963 Bldg	67	XRF	4/21/97	1	Restroom	1892	Door	Casing	Solid	Metal	0.04
1136	1963 Bldg	68	XRF	4/21/97	1	Restroom	1892	Door	Header	Solid	Wood	0
1137	1963 Bldg	108	XRF	4/29/97	1	Restroom	1892	Ceiling		Solid	Plaster	0
1138	1963 Bldg	109	XRF	4/29/97	1	Restroom	1894	Ceiling		Solid	Plaster	0.01
1139	1963 Bldg	137	XRF	4/29/97	1	Restroom	1900	Ceiling		Solid	Plaster	0.01
1140	1963 Bldg	82	XRF	4/29/97	2	Restroom	2040	Ceiling		Solid	Plaster	0.05
1141	1963 Bldg	19	XRF	4/16/97	2	Restroom	2060	Wall	Midle Wall	Solid	Concrete	0.04
1142	1963 Bldg	20	XRF	4/16/97	2	Restroom	2060	Door	Door	Solid	Wood	0.01
1143	1963 Bldg	21	XRF	4/16/97	2	Restroom	2060	Door	Casing	Solid	Metal	0.04
1144	1963 Bldg	22	XRF	4/16/97	2	Restroom	2060	Door	Casing	Solid	Concrete	0.01
1145	1963 Bldg	23	XRF	4/16/97	2	Restroom	2060	Wall	Bthrm Stll	Solid	Metal	0
1146	1963 Bldg	187	XRF	4/16/97	2	Restroom	2304	Wall	Midle Wall	Solid	Concrete	0.02
1147	1963 Bldg	188	XRF	4/16/97	2	Restroom	2304		Radiator	Solid	Metal	0.09
1148	1963 Bldg	189	XRF	4/16/97	2	Restroom	2304	Door	Door	Solid	Wood	0.02
1149	1963 Bldg	190	XRF	4/16/97	2	Restroom	2304	Door	Casing	Solid	Metal	0.1
1150	1963 Bldg	191	XRF	4/16/97	2	Restroom	2304	Door	Header	Solid	Wood	0
1151	1963 Bldg	192	XRF	4/16/97	2	Restroom	2304	Door	Bthrm Stll	Solid	Metal	0.02
1152	1963 Bldg	85	XRF	4/29/97	2	Restroom	2304	Ceiling		Solid	Plaster	0
1153	1963 Bldg	139	XRF	4/29/97	2	Restroom	2354	Ceiling		Solid	Plaster	0
1154	1963 Bldg	104	XRF	4/29/97	2	Restroom	2380	Ceiling		Solid	Plaster	0
1155	1963 Bldg	105	XRF	4/29/97	2	Restroom	2386	Ceiling		Solid	Plaster	0
1156	1963 Bldg	92	XRF	4/29/97	2	Restroom	2550	Ceiling		Solid	Plaster	0
1157	1963 Bldg	93	XRF	4/29/97	2	Restroom	2630	Ceiling		Solid	Plaster	0
1158	1963 Bldg	106	XRF	4/29/97	1	Restroom	2764	Ceiling		Solid	Plaster	0
1159	1963 Bldg	6	XRF	4/14/97	1	Room	1	Door	Door	Solid	Metal	0.04
1160	1963 Bldg	7	XRF	4/14/97	1	Room	1	Door	Casing	Solid	Metal	0.07
1161	1963 Bldg	8	XRF	4/14/97	1	Room	1	Stairs	Hand rail	Solid	Metal	0.04
1162	1963 Bldg	6	XRF	4/22/97	1	Room	1	Wall	Midle Wall	Solid	Concrete	0.03
1163	1963 Bldg	7	XRF	4/22/97	1	Room	1	Wall	Midle Wall	Solid	Drywall	0
1164	1963 Bldg	8	XRF	4/22/97	1	Room	1	Door	Door	Solid	Wood	0
1165	1963 Bldg	9	XRF	4/22/97	1	Room	1	Door	Casing	Solid	Wood	0
1166	1963 Bldg	10	XRF	4/22/97	1	Room	1	Door	Jamb	Solid	Wood	0
1167	1963 Bldg	11	XRF	4/22/97	1	Room	1	Window	Casing	Solid	Wood	0
1168	1963 Bldg	12	XRF	4/22/97	1	Room	2	Door	Casing	Solid	Wood	0
1169	1963 Bldg	13	XRF	4/22/97	1	Room	2	Door	Jamb	Solid	Wood	0
1170	1963 Bldg	14	XRF	4/22/97	1	Room	2	Wall	Midle Wall	Solid	Concrete	0.02
1171	1963 Bldg	15	XRF	4/22/97	1	Room	2	Wall	Midle Wall	Solid	Concrete	0.04
1172	1963 Bldg	16	XRF	4/22/97	1	Room	2	Door	Door	Solid	Wood	0.01
1173	1963 Bldg	17	XRF	4/22/97	1	Room	2	Door	Casing	Solid	Metal	0.12
1174	1963 Bldg	18	XRF	4/22/97	1	Room	2	Window	Panel	Solid	Metal	0.01
1175	1963 Bldg	40	XRF	4/14/97	1	Room	47	Cabinet	Shelf	Solid	Wood	0.03
1176	1963 Bldg	41	XRF	4/14/97	1	Room	47	Door	Door	Solid	Wood	0.02
1177	1963 Bldg	42	XRF	4/14/97	1	Room	47	Door	Casing	Solid	Metal	0.02
1178	1963 Bldg	56	XRF	4/29/97	1	Room	80	Ceiling		Solid	Plaster	0
1179	1963 Bldg	43	XRF	4/14/97	1	Room	130	Door	Door	Solid	Wood	0.01
1180	1963 Bldg	44	XRF	4/14/97	1	Room	130	Door	Casing	Solid	Metal	0.11
1181	1963 Bldg	45	XRF	4/14/97	1	Room	130	Wall	Midle Wall	Solid	Concrete	0.1

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1182	1963 Bldg	46	XRF	4/14/97	1	Room	130		Locker	Solid	Metal	0
1183	1963 Bldg	47	XRF	4/14/97	1	Room	130	Mirror	Frame	Solid	Wood	0
1184	1963 Bldg	48	XRF	4/14/97	1	Room	130		Bthrm Stll	Solid	Metal	0
1185	1963 Bldg	49	XRF	4/14/97	1	Room	130	Window	Casing	Solid	Metal	0.07
1186	1963 Bldg	50	XRF	4/14/97	1	Room	130	Wall	Wall	Solid	Concrte	0.04
1187	1963 Bldg	38	XRF	4/14/97	1	Room	170	Door	Casing	Solid	Metal	0.01
1188	1963 Bldg	39	XRF	4/14/97	1	Room	170	Door	Casing	Solid	Metal	0.13
1189	1963 Bldg	35	XRF	4/14/97	1	Room	171		Radiator	Solid	Metal	0.15
1190	1963 Bldg	36	XRF	4/14/97	1	Room	171	Door	Door	Solid	Wood	0.04
1191	1963 Bldg	37	XRF	4/14/97	1	Room	171	Door	Casing	Solid	Metal	0.21
1192	1963 Bldg	110	XRF	4/14/97	1	Room	190	Wall	Midle Wall	Solid	Concrte	0.03
1193	1963 Bldg	111	XRF	4/14/97	1	Room	190	Wall	Wall	Solid	Concrte	0.06
1194	1963 Bldg	112	XRF	4/14/97	1	Room	190	Wall	Wall	Solid	Concrte	0
1195	1963 Bldg	113	XRF	4/14/97	1	Room	190	Wall	Midle Wall	Solid	Concrte	0
1196	1963 Bldg	114	XRF	4/14/97	1	Room	190	Door	Door	Solid	Wood	0
1197	1963 Bldg	115	XRF	4/14/97	1	Room	190	Door	Casing	Solid	Metal	0.11
1198	1963 Bldg	106	XRF	4/14/97	1	Room	300	Wall	Midle Wall	Solid	Concrte	0.11
1199	1963 Bldg	107	XRF	4/14/97	1	Room	300		Locker	Solid	Wood	0
1200	1963 Bldg	108	XRF	4/14/97	1	Room	300	Door	Door	Solid	Wood	0.02
1201	1963 Bldg	109	XRF	4/14/97	1	Room	300	Door	Casing	Solid	Metal	0.1
1202	1963 Bldg	101	XRF	4/14/97	1	Room	350	Wall	Midle Wall	Solid	Concrte	0.01
1203	1963 Bldg	102	XRF	4/14/97	1	Room	350	Bookcase	Shelf	Solid	Wood	0.01
1204	1963 Bldg	103	XRF	4/14/97	1	Room	350	Wall	Midle Wall	Solid	Concrte	0
1205	1963 Bldg	104	XRF	4/14/97	1	Room	350	Door	Door	Solid	Wood	0.01
1206	1963 Bldg	105	XRF	4/14/97	1	Room	350	Door	Casing	Solid	Metal	0.09
1207	1963 Bldg	52	XRF	4/29/97	1	Room	400	Ceiling		Solid	Plaster	0
1208	1963 Bldg	43	XRF	4/17/97	1	Room	420	Door	Door	Solid	Wood	0.01
1209	1963 Bldg	44	XRF	4/17/97	1	Room	420	Door	Casing	Solid	Wood	0
1210	1963 Bldg	45	XRF	4/17/97	1	Room	420	Door	Jamb	Solid	Wood	0
1211	1963 Bldg	46	XRF	4/17/97	1	Room	420	Door	Casing	Solid	Metal	0
1212	1963 Bldg	47	XRF	4/17/97	1	Room	420	Door	Door	Solid	Wood	0
1213	1963 Bldg	48	XRF	4/17/97	1	Room	420	Wall	Midle Wall	Solid	Concrte	0.03
1214	1963 Bldg	49	XRF	4/17/97	1	Room	420	Wall	Midle Wall	Solid	Concrte	2.49
1215	1963 Bldg	50	XRF	4/17/97	1	Room	420	Wall	Midle Wall	Solid	Concrte	0.11
1216	1963 Bldg	51	XRF	4/17/97	1	Room	420	Wall	Midle Wall	Solid	Concrte	0.07
1217	1963 Bldg	52	XRF	4/17/97	1	Room	420		Radiator	Solid	Metal	0
1218	1963 Bldg	53	XRF	4/17/97	1	Room	420	Wall	Midle Wall	Peeling	Concrte	0.02
1219	1963 Bldg	54	XRF	4/17/97	1	Room	420	Wall	Wall	Solid	Plaster	0.01
1220	1963 Bldg	55	XRF	4/17/97	1	Room	420	Door	Door	Solid	Wood	0
1221	1963 Bldg	56	XRF	4/17/97	1	Room	420	Wall	Midle Wall	Solid	Drywall	0.02
1222	1963 Bldg	57	XRF	4/17/97	1	Room	420	Wall	Midle Wall	Solid	Concrte	0.08
1223	1963 Bldg	58	XRF	4/17/97	1	Room	420	Wall	Midle Wall	Solid	Concrte	0.01
1224	1963 Bldg	59	XRF	4/17/97	1	Room	420	Wall	Mural	Solid	Concrte	0
1225	1963 Bldg	60	XRF	4/17/97	1	Room	420	Wall	Mural	Solid	Concrte	0
1226	1963 Bldg	61	XRF	4/17/97	1	Room	420	Wall	Mural	Solid	Concrte	0
1227	1963 Bldg	62	XRF	4/17/97	1	Room	420	Wall	Midle Wall	Solid	Concrte	1.88
1228	1963 Bldg	63	XRF	4/17/97	1	Room	420	Wall	Midle Wall	Solid	Concrte	1.48
1229	1963 Bldg	55	XRF	4/29/97	1	Room	434	Ceiling		Solid	Concrte	0.02
1230	1963 Bldg	63	XRF	4/29/97	1	Room	440	Ceiling		Solid	Concrte	0
1231	1963 Bldg	78	XRF	4/17/97	1	Room	469		Locker	Solid	Metal	0.02
1232	1963 Bldg	79	XRF	4/17/97	1	Room	469	Door	Door	Solid	Metal	0.05
1233	1963 Bldg	80	XRF	4/17/97	1	Room	469	Door	Casing	Solid	Metal	0.14
1234	1963 Bldg	81	XRF	4/17/97	1	Room	490	Door	Door	Solid	Metal	0.08
1235	1963 Bldg	82	XRF	4/17/97	1	Room	490	Door	Casing	Solid	Metal	0.01
1236	1963 Bldg	114	XRF	4/17/97	1	Room	513	Door	Door	Solid	Wood	0.02
1237	1963 Bldg	115	XRF	4/17/97	1	Room	513	Door	Door	Solid	Wood	0.01
1238	1963 Bldg	116	XRF	4/17/97	1	Room	513	Door	Casing	Solid	Metal	0.08
1239	1963 Bldg	117	XRF	4/17/97	1	Room	513	Wall	Midle Wall	Solid	Concrte	0.04
1240	1963 Bldg	118	XRF	4/17/97	1	Room	513	Wall	Midle Wall	Solid	Concrte	0.07

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1241	1963 Bldg	119	XRF	4/17/97	1	Room	513	Bookcase	Shelf	Solid	Metal	0.17
1242	1963 Bldg	120	XRF	4/17/97	1	Room	513	Work	Bench	Solid	Wood	0.07
1243	1963 Bldg	121	XRF	4/17/97	1	Room	513	Paint	Booth	Solid	Metal	0.3
1244	1963 Bldg	122	XRF	4/17/97	1	Room	513	Door	Door	Solid	Wood	0.01
1245	1963 Bldg	123	XRF	4/17/97	1	Room	513	Wall	Midle Wall	Solid	Concrte	0.13
1246	1963 Bldg	100	XRF	4/17/97	1	Room	515	Door	Door	Solid	Metal	0.01
1247	1963 Bldg	101	XRF	4/17/97	1	Room	515	Cabinet	Door	Solid	Wood	0
1248	1963 Bldg	102	XRF	4/17/97	1	Room	515	Cabinet	Door	Solid	Wood	0
1249	1963 Bldg	103	XRF	4/17/97	1	Room	515	Wall	Midle Wall	Solid	Concrte	0.02
1250	1963 Bldg	104	XRF	4/17/97	1	Room	515	Wall	Midle Wall	Solid	Concrte	0.11
1251	1963 Bldg	105	XRF	4/17/97	1	Room	515	Wall	Midle Wall	Solid	Concrte	0.06
1252	1963 Bldg	106	XRF	4/17/97	1	Room	515	Door	Casing	Solid	Metal	0.09
1253	1963 Bldg	107	XRF	4/17/97	1	Room	515	Door	Door	Solid	Wood	0.01
1254	1963 Bldg	108	XRF	4/17/97	1	Room	516	Door	Door	Solid	Wood	0.01
1255	1963 Bldg	109	XRF	4/17/97	1	Room	516	Door	Casing	Solid	Metal	0.04
1256	1963 Bldg	110	XRF	4/17/97	1	Room	516	Door	Jamb	Solid	Metal	0.09
1257	1963 Bldg	111	XRF	4/17/97	1	Room	516	Wall	Midle Wall	Solid	Concrte	0.07
1258	1963 Bldg	112	XRF	4/17/97	1	Room	516	Wall	Midle Wall	Solid	Concrte	0.04
1259	1963 Bldg	113	XRF	4/17/97	1	Room	516	Wall	Midle Wall	Solid	Concrte	0.04
1260	1963 Bldg	147	XRF	4/17/97	1	Room	521	Cabinet	Shelf	Solid	Wood	0
1261	1963 Bldg	148	XRF	4/17/97	1	Room	521	Wall	Midle Wall	Solid	Concrte	0.02
1262	1963 Bldg	149	XRF	4/17/97	1	Room	521	Wall	Midle Wall	Solid	Concrte	0.05
1263	1963 Bldg	150	XRF	4/17/97	1	Room	521	Door	Door	Solid	Wood	0
1264	1963 Bldg	151	XRF	4/17/97	1	Room	521	Door	Casing	Solid	Metal	0.05
1265	1963 Bldg	165	XRF	4/17/97	1	Room	522	Door	Door	Solid	Metal	0.09
1266	1963 Bldg	166	XRF	4/17/97	1	Room	522	Door	Casing	Solid	Metal	0.03
1267	1963 Bldg	167	XRF	4/17/97	1	Room	522	Wall	Midle Wall	Solid	Concrte	0.04
1268	1963 Bldg	168	XRF	4/17/97	1	Room	522	Door	Door	Solid	Wood	0.01
1269	1963 Bldg	161	XRF	4/17/97	1	Room	523	Window	Casing	Solid	Metal	0.02
1270	1963 Bldg	162	XRF	4/17/97	1	Room	523	Wall	Midle Wall	Solid	Concrte	0.04
1271	1963 Bldg	163	XRF	4/17/97	1	Room	523	Door	Door	Solid	Wood	0.02
1272	1963 Bldg	164	XRF	4/17/97	1	Room	523	Door	Casing	Solid	Metal	0.02
1273	1963 Bldg	156	XRF	4/17/97	1	Room	524	Wall	Midle Wall	Solid	Concrte	0.08
1274	1963 Bldg	157	XRF	4/17/97	1	Room	524	Wall	Midle Wall	Solid	Concrte	0.1
1275	1963 Bldg	158	XRF	4/17/97	1	Room	524	Cabinet	Door	Solid	Wood	0
1276	1963 Bldg	159	XRF	4/17/97	1	Room	524	Door	Door	Solid	Wood	0.02
1277	1963 Bldg	160	XRF	4/17/97	1	Room	524	Door	Casing	Solid	Metal	0.08
1278	1963 Bldg	47	XRF	4/29/97	1	Room	524	Ceiling		Solid	Tile	0
1279	1963 Bldg	152	XRF	4/17/97	1	Room	525	Wall	Midle Wall	Solid	Concrte	0.06
1280	1963 Bldg	153	XRF	4/17/97	1	Room	525	Bookcase	Shelf	Solid	Wood	0
1281	1963 Bldg	154	XRF	4/17/97	1	Room	525	Door	Door	Solid	Wood	0.01
1282	1963 Bldg	155	XRF	4/17/97	1	Room	525	Door	Casing	Solid	Metal	0.09
1283	1963 Bldg	49	XRF	4/29/97	1	Room	560	Ceiling		Solid	Plaster	0.01
1284	1963 Bldg	136	XRF	4/15/97	1	Room	1030	Door	Door	Solid	Wood	0.01
1285	1963 Bldg	137	XRF	4/15/97	1	Room	1030	Door	Casing	Solid	Metal	0.03
1286	1963 Bldg	78	XRF	4/29/97	1	Room	1060	Ceiling		Solid	Plaster	0.01
1287	1963 Bldg	95	XRF	4/15/97	1	Room	1090		Radiator	Solid	Metal	0.06
1288	1963 Bldg	96	XRF	4/15/97	1	Room	1090	Window	Stool	Cracked	Wood	0
1289	1963 Bldg	97	XRF	4/15/97	1	Room	1090	Wall	Panel	Solid	Wood	0.72
1290	1963 Bldg	98	XRF	4/15/97	1	Room	1090	Door	Door	Solid	Wood	0
1291	1963 Bldg	99	XRF	4/15/97	1	Room	1090	Door	Casing	Solid	Metal	0.02
1292	1963 Bldg	100	XRF	4/15/97	1	Room	1090	Door	Door	Solid	Wood	0.02
1293	1963 Bldg	101	XRF	4/15/97	1	Room	1090	Door	Casing	Solid	Metal	0.02
1294	1963 Bldg	102	XRF	4/15/97	1	Room	1090		Elec Pane	Solid	Metal	0.02
1295	1963 Bldg	103	XRF	4/15/97	1	Room	1090	Wall	Midle Wall	Solid	Metal	0
1296	1963 Bldg	104	XRF	4/15/97	1	Room	1090	Floor		Solid	Tile	0.5
1297	1963 Bldg	105	XRF	4/15/97	1	Room	1090	Wall	Midle Wall	Solid	Concrte	0.01
1298	1963 Bldg	106	XRF	4/15/97	1	Room	1090	Door	Door	Solid	Metal	0.49
1299	1963 Bldg	107	XRF	4/15/97	1	Room	1090	Door	Casing	Solid	Wood	0.01

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1300	1963 Bldg	108	XRF	4/15/97	1	Room	1090	Window	Casing	Solid	Metal	0.53
1301	1963 Bldg	109	XRF	4/15/97	1	Room	1090	Wall	Midle Wall	Solid	Metal	0
1302	1963 Bldg	127	XRF	4/15/97	1	Room	1100	Wall	Midle Wall	Solid	Concrete	0.19
1303	1963 Bldg	128	XRF	4/15/97	1	Room	1100	Wall	Midle Wall	Solid	Concrete	0.02
1304	1963 Bldg	129	XRF	4/15/97	1	Room	1100	Door	Door	Solid	Wood	0.01
1305	1963 Bldg	130	XRF	4/15/97	1	Room	1100	Door	Casing	Solid	Metal	0.02
1306	1963 Bldg	71	XRF	4/29/97	1	Room	1100	Ceiling		Solid	Concrete	0.02
1307	1963 Bldg	115	XRF	4/15/97	1	Room	1110		Radiator	Solid	Metal	0.1
1308	1963 Bldg	116	XRF	4/15/97	1	Room	1110	Window	Stool	Solid	Wood	0.04
1309	1963 Bldg	117	XRF	4/15/97	1	Room	1110	Wall	Panel	Solid	Wood	0.8
1310	1963 Bldg	118	XRF	4/15/97	1	Room	1110	Door	Door	Solid	Metal	0.11
1311	1963 Bldg	119	XRF	4/15/97	1	Room	1110	Door	Casing	Solid	Metal	0.11
1312	1963 Bldg	120	XRF	4/15/97	1	Room	1110	Bookcase	Shelf	Solid	Wood	0.03
1313	1963 Bldg	121	XRF	4/15/97	1	Room	1110	Door	Door	Solid	Wood	0.02
1314	1963 Bldg	122	XRF	4/15/97	1	Room	1110	Door	Casing	Solid	Metal	0.03
1315	1963 Bldg	123	XRF	4/15/97	1	Room	1110	Wall	Midle Wall	Solid	Concrete	0.02
1316	1963 Bldg	124	XRF	4/15/97	1	Room	1110	Door	Door	Solid	Wood	0
1317	1963 Bldg	125	XRF	4/15/97	1	Room	1110	Wall	Chair rail	Solid	Wood	0.04
1318	1963 Bldg	126	XRF	4/15/97	1	Room	1110	Wall	Midle Wall	Solid	Concrete	0
1319	1963 Bldg	72	XRF	4/29/97	1	Room	1110	Ceiling		Solid	Plaster	0.01
1320	1963 Bldg	92	XRF	4/15/97	1	Room	1130	Wall	Midle Wall	Solid	Concrete	0.06
1321	1963 Bldg	93	XRF	4/15/97	1	Room	1130	Door	Door	Solid	Wood	0.01
1322	1963 Bldg	94	XRF	4/15/97	1	Room	1130	Door	Casing	Solid	Metal	0.17
1323	1963 Bldg	73	XRF	4/29/97	1	Room	1144	Ceiling		Solid	Plaster	0
1324	1963 Bldg	110	XRF	4/15/97	1	Room	1150	Wall	Midle Wall	Solid	Concrete	0.03
1325	1963 Bldg	111	XRF	4/15/97	1	Room	1150	Door	Door	Solid	Wood	0.01
1326	1963 Bldg	112	XRF	4/15/97	1	Room	1150	Door	Casing	Solid	Metal	0.03
1327	1963 Bldg	113	XRF	4/15/97	1	Room	1150		Locker	Solid	Metal	0
1328	1963 Bldg	114	XRF	4/15/97	1	Room	1150	Door	Bthrm Stil	Solid	Metal	0
1329	1963 Bldg	66	XRF	4/29/97	1	Room	1200	Ceiling		Solid	Plaster	0
1330	1963 Bldg	23	XRF	4/15/97	1	Room	1229	Door	Door	Solid	Wood	0.01
1331	1963 Bldg	24	XRF	4/15/97	1	Room	1229	Door	Casing	Solid	Metal	0.05
1332	1963 Bldg	25	XRF	4/15/97	1	Room	1229	Wall	Midle Wall	Solid	Concrete	0.04
1333	1963 Bldg	26	XRF	4/15/97	1	Room	1229	Wall	Wall	Solid	Concrete	0.04
1334	1963 Bldg	27	XRF	4/15/97	1	Room	1229	Window	Casing	Solid	Metal	0.08
1335	1963 Bldg	28	XRF	4/15/97	1	Room	1229	Door	Door	Solid	Metal	0.05
1336	1963 Bldg	29	XRF	4/15/97	1	Room	1229		Elec Pane	Solid	Metal	0.04
1337	1963 Bldg	65	XRF	4/29/97	1	Room	1229	Ceiling		Solid	Plaster	0
1338	1963 Bldg	30	XRF	4/15/97	1	Room	1230	Window	Casing	Solid	Metal	0.13
1339	1963 Bldg	31	XRF	4/15/97	1	Room	1230	Wall	Midle Wall	Solid	Concrete	0.02
1340	1963 Bldg	32	XRF	4/15/97	1	Room	1230		Radiator	Solid	Metal	0.13
1341	1963 Bldg	33	XRF	4/15/97	1	Room	1230	Wall	Midle Wall	Solid	Concrete	0.01
1342	1963 Bldg	34	XRF	4/15/97	1	Room	1230	Door	Door	Solid	Wood	0.01
1343	1963 Bldg	35	XRF	4/15/97	1	Room	1230	Door	Casing	Solid	Metal	0.11
1344	1963 Bldg	64	XRF	4/29/97	1	Room	1230	Ceiling		Solid	Plaster	0
1345	1963 Bldg	54	XRF	4/15/97	1	Room	1250	Door	Door	Solid	Metal	0.08
1346	1963 Bldg	55	XRF	4/15/97	1	Room	1250	Door	Casing	Solid	Metal	0.12
1347	1963 Bldg	45	XRF	4/15/97	1	Room	1270	Coat	Rack	Solid	Wood	0.9
1348	1963 Bldg	46	XRF	4/15/97	1	Room	1270	Door	Door	Solid	Wood	1.22
1349	1963 Bldg	47	XRF	4/15/97	1	Room	1270	Wall	Wall	Solid	Concrete	0.03
1350	1963 Bldg	48	XRF	4/15/97	1	Room	1270	Door	Door	Solid	Wood	0
1351	1963 Bldg	49	XRF	4/15/97	1	Room	1270	Door	Casing	Solid	Metal	0.11
1352	1963 Bldg	50	XRF	4/15/97	1	Room	1270	Wall	Midle Wall	Solid	Concrete	0.1
1353	1963 Bldg	51	XRF	4/15/97	1	Room	1270		Locker	Solid	Wood	0.03
1354	1963 Bldg	52	XRF	4/15/97	1	Room	1270	Wall	Midle Wall	Solid	Concrete	0.11
1355	1963 Bldg	53	XRF	4/15/97	1	Room	1270	Wall	Wall	Solid	Drywall	0
1356	1963 Bldg	56	XRF	4/15/97	1	Room	1290	Wall	Wall	Solid	Concrete	0.07
1357	1963 Bldg	57	XRF	4/15/97	1	Room	1290	Wall	Wall	Solid	Concrete	0.07
1358	1963 Bldg	58	XRF	4/15/97	1	Room	1290	Wall	Midle Wall	Solid	Concrete	0.07

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

	A	B	C	D	E	F	G	H	I	J	K	L
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1359	1963 Bldg	59	XRF	4/15/97		1 Room	1290	Door	Door	Solid	Wood	0.01
1360	1963 Bldg	60	XRF	4/15/97		1 Room	1290	Door	Casing	Solid	Metal	0.08
1361	1963 Bldg	61	XRF	4/15/97		1 Room	1290		Radiator	Solid	Metal	0.08
1362	1963 Bldg	68	XRF	4/29/97		1 Room	1290	Ceiling		Solid	Plaster	0.01
1363	1963 Bldg	69	XRF	4/29/97		1 Room	1300	Ceiling		Solid	Concrete	0.02
1364	1963 Bldg	134	XRF	4/29/97		1 Room	1300	Ceiling		Solid	Plaster	0
1365	1963 Bldg	170	XRF	4/14/97		1 Room	1313	Door	Door		Wood	0.01
1366	1963 Bldg	171	XRF	4/14/97		1 Room	1313	Door	Casing		Metal	0.11
1367	1963 Bldg	163	XRF	4/14/97		1 Room	1314	Door	Door	Solid	Wood	0.01
1368	1963 Bldg	164	XRF	4/14/97		1 Room	1314	Door	Casing	Solid	Metal	0.03
1369	1963 Bldg	165	XRF	4/14/97		1 Room	1314	Wall	Middle Wall	Solid	Concrete	0
1370	1963 Bldg	166	XRF	4/14/97		1 Room	1314	Wall	Middle Wall	Solid	Concrete	0
1371	1963 Bldg	167	XRF	4/14/97		1 Room	1314	Wall	Middle Wall	Solid	Concrete	0
1372	1963 Bldg	168	XRF	4/14/97		1 Room	1314	Wall	Middle Wall	Solid	Concrete	0.01
1373	1963 Bldg	169	XRF	4/14/97		1 Room	1314	Wall	Chair rail	Solid	Metal	0
1374	1963 Bldg	159	XRF	4/14/97		1 Room	1360	Wall	Middle Wall	Solid	Concrete	0.07
1375	1963 Bldg	160	XRF	4/14/97		1 Room	1360	Wall	Middle Wall	Solid	Concrete	0
1376	1963 Bldg	161	XRF	4/14/97		1 Room	1360	Door	Door	Solid	Wood	0.01
1377	1963 Bldg	162	XRF	4/14/97		1 Room	1360	Door	Casing	Solid	Metal	0.08
1378	1963 Bldg	19	XRF	4/23/97		1 Room	1390	Cabinet	Door	Solid	Wood	0
1379	1963 Bldg	20	XRF	4/23/97		1 Room	1390	Cabinet	Door	Solid	Wood	0.02
1380	1963 Bldg	21	XRF	4/23/97		1 Room	1390	Wall	Middle Wall	Solid	Concrete	0.06
1381	1963 Bldg	22	XRF	4/23/97		1 Room	1390	Door	Door	Solid	Wood	0.02
1382	1963 Bldg	23	XRF	4/23/97		1 Room	1390	Door	Casing	Solid	Metal	0.06
1383	1963 Bldg	24	XRF	4/23/97		1 Room	1390	Door	Header	Solid	Wood	0
1384	1963 Bldg	25	XRF	4/23/97		1 Room	1390	Window	Stool	Solid	Metal	0
1385	1963 Bldg	55	XRF	4/23/97		1 Room	1430	Door	Header	Solid	Wood	0
1386	1963 Bldg	56	XRF	4/23/97		1 Room	1430	Door	Door	Solid	Wood	0.01
1387	1963 Bldg	57	XRF	4/23/97		1 Room	1430	Door	Casing	Solid	Metal	0.04
1388	1963 Bldg	168	XRF	4/22/97		1 Room	1541	Wall	Middle Wall	Solid	Concrete	0.11
1389	1963 Bldg	169	XRF	4/22/97		1 Room	1541	Door	Door	Solid	Wood	0
1390	1963 Bldg	170	XRF	4/22/97		1 Room	1541	Door	Casing	Solid	Metal	0.11
1391	1963 Bldg	171	XRF	4/22/97		1 Room	1541	Wall	Wall	Solid	Concrete	0.06
1392	1963 Bldg	172	XRF	4/22/97		1 Room	1541	Door	Header	Solid	Wood	0
1393	1963 Bldg	163	XRF	4/22/97		1 Room	1544	Cabinet	Door	Solid	Wood	0.01
1394	1963 Bldg	164	XRF	4/22/97		1 Room	1544	Wall	Middle Wall	Solid	Concrete	0.09
1395	1963 Bldg	165	XRF	4/22/97		1 Room	1544	Door	Door	Solid	Wood	0.01
1396	1963 Bldg	166	XRF	4/22/97		1 Room	1544	Door	Casing	Solid	Metal	0.08
1397	1963 Bldg	167	XRF	4/22/97		1 Room	1544	Door	Header	Solid	Wood	0
1398	1963 Bldg	110	XRF	4/22/97		1 Room	1659	Cabinet	Door	Solid	Wood	0
1399	1963 Bldg	111	XRF	4/22/97		1 Room	1659	Wall	Middle Wall	Solid	Concrete	0.15
1400	1963 Bldg	112	XRF	4/22/97		1 Room	1659	Door	Door	Solid	Wood	0.01
1401	1963 Bldg	113	XRF	4/22/97		1 Room	1659	Window	Casing	Solid	Metal	0.11
1402	1963 Bldg	114	XRF	4/22/97		1 Room	1659	Window	Panel	Solid	Metal	0.02
1403	1963 Bldg	115	XRF	4/22/97		1 Room	1659	Wall	Wall	Solid	Wood	0
1404	1963 Bldg	116	XRF	4/22/97		1 Room	1659	Window	Stool	Solid	Metal	0.06
1405	1963 Bldg	117	XRF	4/22/97		1 Room	1659		Radiator	Solid	Metal	0.12
1406	1963 Bldg	118	XRF	4/22/97		1 Room	1659	Wall	Wall	Solid	Concrete	0.13
1407	1963 Bldg	47	XRF	4/22/97		1 Room	1690	Wall	Middle Wall	Solid	Concrete	0.02
1408	1963 Bldg	48	XRF	4/22/97		1 Room	1690	Door	Door	Solid	Wood	0.01
1409	1963 Bldg	49	XRF	4/22/97		1 Room	1690	Door	Casing	Solid	Metal	0.06
1410	1963 Bldg	50	XRF	4/22/97		1 Room	1690	Wall	Wall	Solid	Concrete	0.02
1411	1963 Bldg	51	XRF	4/22/97		1 Room	1690		Radiator	Solid	Metal	0.11
1412	1963 Bldg	52	XRF	4/22/97		1 Room	1690	Window	Stool	Solid	Metal	0.04
1413	1963 Bldg	115	XRF	4/29/97		1 Room	1730	Ceiling		Solid	Plaster	0
1414	1963 Bldg	71	XRF	4/22/97		1 Room	1740	Wall	Middle Wall	Solid	Concrete	0.03
1415	1963 Bldg	72	XRF	4/22/97		1 Room	1740	Cabinet	Door	Solid	Wood	0.01
1416	1963 Bldg	73	XRF	4/22/97		1 Room	1740	Bookcase	Shelf	Solid	Wood	0
1417	1963 Bldg	74	XRF	4/22/97		1 Room	1740	Door	Door	Solid	Wood	0.01

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1418	1963 Bldg	75	XRF	4/22/97	1	Room	1740	Door	Casing	Solid	Metal	0.04
1419	1963 Bldg	76	XRF	4/22/97	1	Room	1740	Door	Header	Solid	Wood	0
1420	1963 Bldg	77	XRF	4/22/97	1	Room	1741	Wall	Panel	Solid	Wood	0.03
1421	1963 Bldg	78	XRF	4/22/97	1	Room	1741	Door	Door	Solid	Wood	0.01
1422	1963 Bldg	79	XRF	4/22/97	1	Room	1741	Door	Casing	Solid	Metal	0.06
1423	1963 Bldg	80	XRF	4/22/97	1	Room	1741		Radiator	Solid	Metal	0.09
1424	1963 Bldg	81	XRF	4/22/97	1	Room	1741	Window	Stool	Solid	Metal	0.05
1425	1963 Bldg	82	XRF	4/22/97	1	Room	1741	Wall	Midle Wall	Solid	Concrete	0.03
1426	1963 Bldg	83	XRF	4/22/97	1	Room	1741	Wall	Midle Wall	Solid	Concrete	0.03
1427	1963 Bldg	143	XRF	4/21/97	1	Room	1800	Wall	Midle Wall	Solid	Concrete	0.03
1428	1963 Bldg	144	XRF	4/21/97	1	Room	1800	Door	Door	Solid	Wood	0.02
1429	1963 Bldg	145	XRF	4/21/97	1	Room	1800	Door	Casing	Solid	Metal	0.08
1430	1963 Bldg	146	XRF	4/21/97	1	Room	1800	Wall	Midle Wall	Solid	Concrete	0.02
1431	1963 Bldg	147	XRF	4/21/97	1	Room	1811	Wall	Midle Wall	Solid	Concrete	0.04
1432	1963 Bldg	148	XRF	4/21/97	1	Room	1811	Door	Door	Solid	Wood	0
1433	1963 Bldg	149	XRF	4/21/97	1	Room	1811	Door	Casing	Solid	Metal	0.02
1434	1963 Bldg	150	XRF	4/21/97	1	Room	1811	Wall	Midle Wall	Solid	Concrete	0.03
1435	1963 Bldg	155	XRF	4/21/97	1	Room	1812	Wall	Midle Wall	Solid	Concrete	0.05
1436	1963 Bldg	156	XRF	4/21/97	1	Room	1812	Door	Door	Solid	Wood	0.01
1437	1963 Bldg	157	XRF	4/21/97	1	Room	1812	Door	Casing	Solid	Metal	0.04
1438	1963 Bldg	158	XRF	4/21/97	1	Room	1812	Cabinet	Door	Solid	Wood	0.02
1439	1963 Bldg	159	XRF	4/21/97	1	Room	1812	Wall	Midle Wall	Solid	Concrete	0.03
1440	1963 Bldg	151	XRF	4/21/97	1	Room	1813	Wall	Midle Wall	Solid	Concrete	0.07
1441	1963 Bldg	152	XRF	4/21/97	1	Room	1813	Door	Door	Solid	Wood	0.01
1442	1963 Bldg	153	XRF	4/21/97	1	Room	1813	Door	Casing	Solid	Metal	0.03
1443	1963 Bldg	154	XRF	4/21/97	1	Room	1813	Wall	Midle Wall	Solid	Concrete	0.03
1444	1963 Bldg	53	XRF	4/21/97	1	Room	1820	Wall	Midle Wall	Solid	Concrete	0.01
1445	1963 Bldg	54	XRF	4/21/97	1	Room	1820	Door	Door	Solid	Wood	0.01
1446	1963 Bldg	55	XRF	4/21/97	1	Room	1820	Door	Casing	Solid	Metal	0.03
1447	1963 Bldg	56	XRF	4/21/97	1	Room	1820	Door	Header	Solid	Wood	0
1448	1963 Bldg	57	XRF	4/21/97	1	Room	1820	Window	Stool	Solid	Metal	0.06
1449	1963 Bldg	58	XRF	4/21/97	1	Room	1820	Cabinet	Door	Solid	Wood	0.02
1450	1963 Bldg	59	XRF	4/21/97	1	Room	1820	Wall	Midle Wall	Solid	Concrete	0.05
1451	1963 Bldg	60	XRF	4/21/97	1	Room	1820	Wall	Panel	Solid	Metal	0.08
1452	1963 Bldg	75	XRF	4/21/97	1	Room	1850	Wall	Midle Wall	Solid	Concrete	0.04
1453	1963 Bldg	76	XRF	4/21/97	1	Room	1850	Door	Door	Solid	Wood	0.01
1454	1963 Bldg	77	XRF	4/21/97	1	Room	1850	Door	Casing	Solid	Metal	0.05
1455	1963 Bldg	78	XRF	4/21/97	1	Room	1850	Window	Casing	Solid	Metal	0.07
1456	1963 Bldg	79	XRF	4/21/97	1	Room	1850	Window	Panel	Solid	Wood	0
1457	1963 Bldg	80	XRF	4/21/97	1	Room	1850	Wall	Wall Rgstr	Solid	Metal	0.05
1458	1963 Bldg	81	XRF	4/21/97	1	Room	1850	Wall	Midle Wall	Solid	Concrete	0.03
1459	1963 Bldg	82	XRF	4/21/97	1	Room	1852	Wall	Midle Wall	Solid	Concrete	0.08
1460	1963 Bldg	88	XRF	4/21/97	1	Room	1852	Wall	Midle Wall	Solid	Concrete	0.54
1461	1963 Bldg	89	XRF	4/21/97	1	Room	1852	Wall	Midle Wall	Solid	Concrete	0.02
1462	1963 Bldg	90	XRF	4/21/97	1	Room	1852	Door	Door	Solid	Wood	0.02
1463	1963 Bldg	91	XRF	4/21/97	1	Room	1852	Door	Casing	Solid	Metal	0.05
1464	1963 Bldg	92	XRF	4/21/97	1	Room	1852	Window	Stool	Solid	Metal	0.05
1465	1963 Bldg	93	XRF	4/21/97	1	Room	1852	Cabinet	Door	Solid	Wood	0.01
1466	1963 Bldg	83	XRF	4/21/97	1	Room	1853	Door	Door	Solid	Wood	0.01
1467	1963 Bldg	84	XRF	4/21/97	1	Room	1853	Door	Casing	Solid	Metal	0.01
1468	1963 Bldg	85	XRF	4/21/97	1	Room	1853	Window	Panel	Solid	Wood	0
1469	1963 Bldg	86	XRF	4/21/97	1	Room	1853	Window	Stool	Solid	Metal	0.03
1470	1963 Bldg	87	XRF	4/21/97	1	Room	1853	Cabinet	Door	Solid	Wood	0.02
1471	1963 Bldg	94	XRF	4/21/97	1	Room	1854	Wall	Midle Wall	Solid	Concrete	0.04
1472	1963 Bldg	95	XRF	4/21/97	1	Room	1854	Door	Door	Solid	Wood	0.01
1473	1963 Bldg	96	XRF	4/21/97	1	Room	1854	Door	Casing	Solid	Metal	0.04
1474	1963 Bldg	97	XRF	4/21/97	1	Room	1854	Wall	Panel	Solid	Wood	0
1475	1963 Bldg	98	XRF	4/21/97	1	Room	1854	Window	Stool	Solid	Metal	0.08
1476	1963 Bldg	99	XRF	4/21/97	1	Room	1854	Cabinet	Door	Solid	Wood	0.01

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1477	1963 Bldg	100	XRF	4/21/97	1	Room	1854	Wall	Midle Wall	Solid	Concre	0.04
1478	1963 Bldg	101	XRF	4/21/97	1	Room	1854	Wall	Midle Wall	Solid	Concre	0.06
1479	1963 Bldg	102	XRF	4/21/97	1	Room	1855	Wall	Midle Wall	Solid	Concre	0.06
1480	1963 Bldg	103	XRF	4/21/97	1	Room	1855	Door	Door	Solid	Wood	0.01
1481	1963 Bldg	104	XRF	4/21/97	1	Room	1855	Door	Casing	Solid	Metal	0.06
1482	1963 Bldg	105	XRF	4/21/97	1	Room	1855	Window	Panel	Solid	Wood	0
1483	1963 Bldg	106	XRF	4/21/97	1	Room	1855	Wall	Midle Wall	Solid	Concre	0.06
1484	1963 Bldg	107	XRF	4/21/97	1	Room	1855	Wall	Midle Wall	Solid	Concre	0.02
1485	1963 Bldg	108	XRF	4/21/97	1	Room	1855	Window	Stool	Solid	Metal	0.03
1486	1963 Bldg	109	XRF	4/21/97	1	Room	1855	Cabinet	Door	Solid	Wood	0.01
1487	1963 Bldg	110	XRF	4/21/97	1	Room	1856	Wall	Midle Wall	Solid	Concre	0.06
1488	1963 Bldg	111	XRF	4/21/97	1	Room	1856	Door	Door	Solid	Wood	0
1489	1963 Bldg	112	XRF	4/21/97	1	Room	1856	Door	Casing	Solid	Metal	0.12
1490	1963 Bldg	113	XRF	4/21/97	1	Room	1856	Door	Header	Solid	Wood	0
1491	1963 Bldg	114	XRF	4/21/97	1	Room	1856	Cabinet	Door	Solid	Wood	0.01
1492	1963 Bldg	115	XRF	4/21/97	1	Room	1856	Wall	Midle Wall	Solid	Concre	0.72
1493	1963 Bldg	116	XRF	4/21/97	1	Room	1856	Wall	Midle Wall	Solid	Concre	0.55
1494	1963 Bldg	117	XRF	4/21/97	1	Room	1857	Wall	Midle Wall	Solid	Concre	0.07
1495	1963 Bldg	118	XRF	4/21/97	1	Room	1857	Cabinet	Door	Solid	Wood	0.01
1496	1963 Bldg	119	XRF	4/21/97	1	Room	1857	Wall	Midle Wall	Solid	Concre	0.08
1497	1963 Bldg	120	XRF	4/21/97	1	Room	1857	Wall	Midle Wall	Solid	Concre	0.05
1498	1963 Bldg	121	XRF	4/21/97	1	Room	1857	Door	Door	Solid	Wood	0.02
1499	1963 Bldg	122	XRF	4/21/97	1	Room	1857	Door	Casing	Solid	Metal	0.09
1500	1963 Bldg	123	XRF	4/21/97	1	Room	1857	Door	Header	Solid	Wood	0
1501	1963 Bldg	124	XRF	4/21/97	1	Room	1859	Window	Casing	Solid	Metal	0.06
1502	1963 Bldg	125	XRF	4/21/97	1	Room	1859	Wall	Midle Wall	Solid	Concre	0.03
1503	1963 Bldg	126	XRF	4/21/97	1	Room	1859	Cabinet	Door	Solid	Wood	0
1504	1963 Bldg	127	XRF	4/21/97	1	Room	1859	Cabinet	Door	Solid	Wood	0
1505	1963 Bldg	128	XRF	4/21/97	1	Room	1859	Wall	Midle Wall	Solid	Concre	0.02
1506	1963 Bldg	129	XRF	4/21/97	1	Room	1859	Wall	Midle Wall	Solid	Concre	0.04
1507	1963 Bldg	130	XRF	4/21/97	1	Room	1859	Door	Door	Solid	Wood	0.01
1508	1963 Bldg	131	XRF	4/21/97	1	Room	1859	Door	Casing	Solid	Metal	0.07
1509	1963 Bldg	132	XRF	4/21/97	1	Room	1859	Door	Header	Solid	Wood	0
1510	1963 Bldg	107	XRF	4/29/97	1	Room	1860	Ceiling		Solid	Plaster	0.06
1511	1963 Bldg	69	XRF	4/21/97	1	Room	1861	Wall	Midle Wall	Solid	Concre	0
1512	1963 Bldg	70	XRF	4/21/97	1	Room	1861	Door	Door	Solid	Wood	0.02
1513	1963 Bldg	71	XRF	4/21/97	1	Room	1861	Door	Casing	Solid	Metal	0.05
1514	1963 Bldg	72	XRF	4/21/97	1	Room	1861	Door	Header	Solid	Wood	0
1515	1963 Bldg	73	XRF	4/21/97	1	Room	1861	Wall	Midle Wall	Solid	Concre	0
1516	1963 Bldg	74	XRF	4/21/97	1	Room	1861	Elec Pane	Solid	Metal	0.05	
1517	1963 Bldg	6	XRF	4/21/97	1	Room	1880	Wall	Midle Wall	Solid	Concre	0.02
1518	1963 Bldg	7	XRF	4/21/97	1	Room	1880	Door	Door	Solid	Wood	0.01
1519	1963 Bldg	8	XRF	4/21/97	1	Room	1880	Door	Casing	Solid	Metal	0.05
1520	1963 Bldg	9	XRF	4/21/97	1	Room	1880	Door	Header	Solid	Wood	0
1521	1963 Bldg	10	XRF	4/21/97	1	Room	1880	Window	Stool	Solid	Metal	0.06
1522	1963 Bldg	11	XRF	4/21/97	1	Room	1880	Cabinet	Door	Solid	Wood	0.02
1523	1963 Bldg	12	XRF	4/21/97	1	Room	1880	Wall	Mural	Solid	Concre	0.08
1524	1963 Bldg	13	XRF	4/21/97	1	Room	1880	Wall	Mural	Solid	Concre	0.04
1525	1963 Bldg	14	XRF	4/21/97	1	Room	1880	Wall	Midle Wall	Solid	Concre	0.02
1526	1963 Bldg	15	XRF	4/21/97	1	Room	1880	Door	Door	Solid	Metal	0.07
1527	1963 Bldg	16	XRF	4/21/97	1	Room	1880	Door	Header	Solid	Wood	0
1528	1963 Bldg	17	XRF	4/21/97	1	Room	1880	Window	Casing	Solid	Metal	0.07
1529	1963 Bldg	26	XRF	4/21/97	1	Room	1881	Wall	Midle Wall	Solid	Concre	0.05
1530	1963 Bldg	27	XRF	4/21/97	1	Room	1881	Wall	Wall	Solid	Concre	0.03
1531	1963 Bldg	28	XRF	4/21/97	1	Room	1881	Wall	Wall	Solid	Concre	0.05
1532	1963 Bldg	29	XRF	4/21/97	1	Room	1881	Cabinet	Door	Solid	Wood	0.01
1533	1963 Bldg	30	XRF	4/21/97	1	Room	1881	Door	Door	Solid	Wood	0.01
1534	1963 Bldg	31	XRF	4/21/97	1	Room	1881	Door	Casing	Solid	Metal	0.1
1535	1963 Bldg	32	XRF	4/21/97	1	Room	1881	Door	Header	Solid	Wood	0

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1536	1963 Bldg	18	XRF	4/21/97	1	Room	1882	Wall	Midle Wall	Solid	Concrete	0.04
1537	1963 Bldg	19	XRF	4/21/97	1	Room	1882	Wall	Wall	Solid	Concrete	0.01
1538	1963 Bldg	20	XRF	4/21/97	1	Room	1882	Wall	Wall	Solid	Concrete	0.05
1539	1963 Bldg	21	XRF	4/21/97	1	Room	1882	Wall	Wall Rgstr	Solid	Metal	0.01
1540	1963 Bldg	22	XRF	4/21/97	1	Room	1882	Door	Door	Solid	Wood	0.01
1541	1963 Bldg	23	XRF	4/21/97	1	Room	1882	Door	Casing	Solid	Metal	0.04
1542	1963 Bldg	24	XRF	4/21/97	1	Room	1882	Door	Header	Solid	Wood	0
1543	1963 Bldg	25	XRF	4/21/97	1	Room	1882	Cabinet	Door	Solid	Wood	0.02
1544	1963 Bldg	33	XRF	4/21/97	1	Room	1883	Wall	Midle Wall	Solid	Concrete	0.07
1545	1963 Bldg	34	XRF	4/21/97	1	Room	1883	Wall	Wall	Solid	Concrete	0.04
1546	1963 Bldg	35	XRF	4/21/97	1	Room	1883	Door	Header	Solid	Wood	0
1547	1963 Bldg	36	XRF	4/21/97	1	Room	1883	Door	Casing	Solid	Metal	0.08
1548	1963 Bldg	37	XRF	4/21/97	1	Room	1883	Door	Door	Solid	Wood	0.01
1549	1963 Bldg	38	XRF	4/21/97	1	Room	1883	Wall	Midle Wall	Solid	Wood	0
1550	1963 Bldg	39	XRF	4/21/97	1	Room	1883	Cabinet	Door	Solid	Wood	0.01
1551	1963 Bldg	40	XRF	4/21/97	1	Room	1895	Wall	Midle Wall	Solid	Concrete	0.04
1552	1963 Bldg	41	XRF	4/21/97	1	Room	1895	Cabinet	Door	Solid	Wood	0.01
1553	1963 Bldg	42	XRF	4/21/97	1	Room	1895	Wall	Midle Wall	Solid	Concrete	0.03
1554	1963 Bldg	43	XRF	4/21/97	1	Room	1895	Window	Stool	Solid	Metal	0.07
1555	1963 Bldg	44	XRF	4/21/97	1	Room	1895	Door	Door	Solid	Metal	0.07
1556	1963 Bldg	45	XRF	4/21/97	1	Room	1895	Door	Casing	Solid	Metal	0.09
1557	1963 Bldg	46	XRF	4/21/97	1	Room	1896	Wall	Midle Wall	Solid	Concrete	0.09
1558	1963 Bldg	47	XRF	4/21/97	1	Room	1896	Window	Stool	Solid	Metal	0.09
1559	1963 Bldg	48	XRF	4/21/97	1	Room	1896	Cabinet	Door	Solid	Wood	0.01
1560	1963 Bldg	49	XRF	4/21/97	1	Room	1896	Wall	Midle Wall	Solid	Concrete	0.06
1561	1963 Bldg	50	XRF	4/21/97	1	Room	1896	Door	Door	Solid	Wood	0.02
1562	1963 Bldg	51	XRF	4/21/97	1	Room	1896	Door	Casing	Solid	Metal	0.11
1563	1963 Bldg	52	XRF	4/21/97	1	Room	1896	Door	Header	Solid	Wood	0
1564	1963 Bldg	6	XRF	4/16/97	2	Room	2040	Door	Door	Solid	Wood	0.01
1565	1963 Bldg	7	XRF	4/16/97	2	Room	2040	Door	Casing	Solid	Metal	0.03
1566	1963 Bldg	8	XRF	4/16/97	2	Room	2040	Wall	Midle Wall	Solid	Concrete	0.05
1567	1963 Bldg	9	XRF	4/16/97	2	Room	2040	Wall	Midle Wall	Solid	Concrete	0.02
1568	1963 Bldg	10	XRF	4/16/97	2	Room	2040	Wall	Chair rail	Solid	Wood	0.01
1569	1963 Bldg	11	XRF	4/16/97	2	Room	2040	Table Leg		Solid	Metal	0.06
1570	1963 Bldg	12	XRF	4/16/97	2	Room	2040	Door	Door	Solid	Metal	0.17
1571	1963 Bldg	13	XRF	4/16/97	2	Room	2040	Door	Header	Solid	Wood	0
1572	1963 Bldg	14	XRF	4/16/97	2	Room	2050	Wall	Midle Wall	Solid	Concrete	0.07
1573	1963 Bldg	15	XRF	4/16/97	2	Room	2050	Mirror Frame		Solid	Wood	0.05
1574	1963 Bldg	16	XRF	4/16/97	2	Room	2050	Table Leg		Solid	Metal	0.05
1575	1963 Bldg	17	XRF	4/16/97	2	Room	2050	Door	Door	Solid	Wood	0.01
1576	1963 Bldg	18	XRF	4/16/97	2	Room	2050	Wall	Chair rail	Solid	Wood	0
1577	1963 Bldg	172	XRF	4/16/97	2	Room	2090	Door	Door	Solid	Metal	0.18
1578	1963 Bldg	173	XRF	4/16/97	2	Room	2090	Door	Casing	Solid	Metal	0.22
1579	1963 Bldg	174	XRF	4/16/97	2	Room	2090	Wall	Midle Wall	Solid	Concrete	0
1580	1963 Bldg	175	XRF	4/16/97	2	Room	2090	Stairs	Hand rail	Solid	Metal	0.07
1581	1963 Bldg	176	XRF	4/16/97	2	Room	2090	Stairs	Riser	Solid	Metal	0.06
1582	1963 Bldg	177	XRF	4/16/97	2	Room	2090	Stairs	Baseboar	Solid	Metal	0.08
1583	1963 Bldg	178	XRF	4/16/97	2	Room	2090	Stairs	Baseboar	Solid	Metal	0.01
1584	1963 Bldg	179	XRF	4/16/97	2	Room	2090	Door	Door	Solid	Wood	0
1585	1963 Bldg	180	XRF	4/16/97	2	Room	2090	Door	Casing	Solid	Metal	0.07
1586	1963 Bldg	39	XRF	4/16/97	2	Room	2120		Radiator	Solid	Metal	0.01
1587	1963 Bldg	40	XRF	4/16/97	2	Room	2120	Window	Stool	Solid	Metal	0.08
1588	1963 Bldg	41	XRF	4/16/97	2	Room	2120	Wall	Wall	Solid	Concrete	0.05
1589	1963 Bldg	42	XRF	4/16/97	2	Room	2120	Wall	Wall	Solid	Concrete	0.08
1590	1963 Bldg	43	XRF	4/16/97	2	Room	2120	Wall	Wall	Solid	Wood	0
1591	1963 Bldg	44	XRF	4/16/97	2	Room	2120	Door	Door	Solid	Wood	0.01
1592	1963 Bldg	45	XRF	4/16/97	2	Room	2120	Door	Casing	Solid	Metal	0.05
1593	1963 Bldg	46	XRF	4/16/97	2	Room	2120	Door	Header	Solid	Wood	0
1594	1963 Bldg	47	XRF	4/16/97	2	Room	2120	Bookcase	Inside	Solid	Wood	0

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1595	1963 Bldg	48	XRF	4/16/97	2	Room	2120	Wall	Wall	Solid	Concrete	0.03
1596	1963 Bldg	49	XRF	4/16/97	2	Room	2120	Wall	Wall	Solid	Concrete	0.03
1597	1963 Bldg	84	XRF	4/29/97	2	Room	2130	Ceiling		Solid	Plaster	0
1598	1963 Bldg	134	XRF	4/16/97	2	Room	2151	Wall	Midle Wall	Solid	Wood	0.02
1599	1963 Bldg	135	XRF	4/16/97	2	Room	2151	Door	Door	Solid	Wood	0
1600	1963 Bldg	136	XRF	4/16/97	2	Room	2151	Door	Casing	Solid	Metal	0.04
1601	1963 Bldg	137	XRF	4/16/97	2	Room	2151	Door	Jamb	Solid	Wood	0.04
1602	1963 Bldg	138	XRF	4/16/97	2	Room	2151	Door	Threshold	Solid	Wood	0.02
1603	1963 Bldg	139	XRF	4/16/97	2	Room	2151	Wall	Wall	Solid	Concrete	0.07
1604	1963 Bldg	140	XRF	4/16/97	2	Room	2151	Wall	Baseboar	Solid	Concrete	0.07
1605	1963 Bldg	141	XRF	4/16/97	2	Room	2151	Wall	Wall	Solid	Concrete	0.14
1606	1963 Bldg	142	XRF	4/16/97	2	Room	2151	Wall	Wall	Solid	Concrete	0.03
1607	1963 Bldg	126	XRF	4/16/97	2	Room	2152	Wall	Midle Wall	Solid	Wood	0
1608	1963 Bldg	127	XRF	4/16/97	2	Room	2152	Wall	Wall	Solid	Concrete	0.08
1609	1963 Bldg	128	XRF	4/16/97	2	Room	2152	Wall	Baseboar	Solid	Concrete	0.13
1610	1963 Bldg	129	XRF	4/16/97	2	Room	2152	Wall	Wall	Solid	Concrete	0.11
1611	1963 Bldg	130	XRF	4/16/97	2	Room	2152	Door	Door	Solid	Wood	0
1612	1963 Bldg	131	XRF	4/16/97	2	Room	2152	Door	Casing	Solid	Metal	0.04
1613	1963 Bldg	132	XRF	4/16/97	2	Room	2152	Door	Jamb	Solid	Wood	0.01
1614	1963 Bldg	133	XRF	4/16/97	2	Room	2152	Door	Threshold	Solid	Wood	0
1615	1963 Bldg	119	XRF	4/16/97	2	Room	2153	Wall	Midle Wall	Solid	Wood	0.01
1616	1963 Bldg	120	XRF	4/16/97	2	Room	2153	Wall	Midle Wall	Solid	Concrete	0.07
1617	1963 Bldg	121	XRF	4/16/97	2	Room	2153	Wall	Wall	Solid	Concrete	0.04
1618	1963 Bldg	122	XRF	4/16/97	2	Room	2153	Door	Door	Solid	Wood	0
1619	1963 Bldg	123	XRF	4/16/97	2	Room	2153	Door	Casing	Solid	Metal	0.05
1620	1963 Bldg	124	XRF	4/16/97	2	Room	2153	Door	Jamb	Solid	Wood	0
1621	1963 Bldg	125	XRF	4/16/97	2	Room	2153	Wall	Wall	Solid	Concrete	0.02
1622	1963 Bldg	143	XRF	4/16/97	2	Room	2154	Door	Door	Solid	Wood	0
1623	1963 Bldg	144	XRF	4/16/97	2	Room	2154	Door	Casing	Solid	Metal	0.07
1624	1963 Bldg	145	XRF	4/16/97	2	Room	2154	Door	Jamb	Solid	Wood	0
1625	1963 Bldg	146	XRF	4/16/97	2	Room	2154	Wall	Midle Wall	Solid	Wood	0.01
1626	1963 Bldg	147	XRF	4/16/97	2	Room	2154	Wall	Wall	Solid	Concrete	0.09
1627	1963 Bldg	148	XRF	4/16/97	2	Room	2154	Wall	Wall	Solid	Concrete	0.07
1628	1963 Bldg	158	XRF	4/16/97	2	Room	2155	Wall	Midle Wall	Solid	Concrete	0.06
1629	1963 Bldg	159	XRF	4/16/97	2	Room	2155	Coat	Rack	Solid	Metal	0.1
1630	1963 Bldg	160	XRF	4/16/97	2	Room	2155	Bookcase	Shelf	Solid	Wood	0
1631	1963 Bldg	161	XRF	4/16/97	2	Room	2155	Wall	Midle Wall	Solid	Concrete	0.06
1632	1963 Bldg	162	XRF	4/16/97	2	Room	2155	Door	Door	Solid	Wood	0.01
1633	1963 Bldg	163	XRF	4/16/97	2	Room	2155	Door	Casing	Solid	Metal	0.04
1634	1963 Bldg	149	XRF	4/16/97	2	Room	2160	Window	Casing	Solid	Metal	0.05
1635	1963 Bldg	150	XRF	4/16/97	2	Room	2160	Door	Door	Solid	Wood	0.01
1636	1963 Bldg	151	XRF	4/16/97	2	Room	2160	Door	Casing	Solid	Metal	0.07
1637	1963 Bldg	152	XRF	4/16/97	2	Room	2160	Cabinet	Door	Solid	Wood	0
1638	1963 Bldg	153	XRF	4/16/97	2	Room	2160	Wall	Midle Wall	Solid	Concrete	0.05
1639	1963 Bldg	154	XRF	4/16/97	2	Room	2161	Cabinet	Door	Solid	Wood	0.02
1640	1963 Bldg	155	XRF	4/16/97	2	Room	2161	Door	Door	Solid	Wood	0.03
1641	1963 Bldg	156	XRF	4/16/97	2	Room	2161	Door	Casing	Solid	Metal	0.08
1642	1963 Bldg	157	XRF	4/16/97	2	Room	2161	Wall	Midle Wall	Solid	Concrete	0.07
1643	1963 Bldg	98	XRF	4/16/97	2	Room	2171	Wall	Midle Wall	Solid	Concrete	0.1
1644	1963 Bldg	99	XRF	4/16/97	2	Room	2171	Wall	Wall	Solid	Concrete	0.03
1645	1963 Bldg	100	XRF	4/16/97	2	Room	2171	Door	Door	Solid	Wood	0
1646	1963 Bldg	101	XRF	4/16/97	2	Room	2171	Door	Casing	Solid	Metal	0.13
1647	1963 Bldg	102	XRF	4/16/97	2	Room	2171	Door	Jamb	Solid	Wood	0.01
1648	1963 Bldg	103	XRF	4/16/97	2	Room	2171	Door	Threshold	Solid	Wood	0
1649	1963 Bldg	104	XRF	4/16/97	2	Room	2171	Wall	Midle Wall	Solid	Wood	0.02
1650	1963 Bldg	87	XRF	4/16/97	2	Room	2172	Wall	Midle Wall	Solid	Concrete	0.08
1651	1963 Bldg	88	XRF	4/16/97	2	Room	2172	Door	Door	Solid	Wood	0.01
1652	1963 Bldg	89	XRF	4/16/97	2	Room	2172	Door	Casing	Solid	Metal	0.06
1653	1963 Bldg	90	XRF	4/16/97	2	Room	2172	Cabinet	Shelf	Solid	Wood	0.01

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1654	1963 Bldg	82	XRF	4/16/97	2	Room	2173	Cabinet	Shelf	Solid	Wood	0.01
1655	1963 Bldg	83	XRF	4/16/97	2	Room	2173	Coat	Rack	Solid	Metal	0.13
1656	1963 Bldg	84	XRF	4/16/97	2	Room	2173	Door	Door	Solid	Wood	0.01
1657	1963 Bldg	85	XRF	4/16/97	2	Room	2173	Door	Casing	Solid	Metal	0.06
1658	1963 Bldg	86	XRF	4/16/97	2	Room	2173	Wall	Midle Wall	Solid	Concrt	0.08
1659	1963 Bldg	77	XRF	4/16/97	2	Room	2174	Wall	Midle Wall	Solid	Concrt	0.08
1660	1963 Bldg	78	XRF	4/16/97	2	Room	2174	Wall	Wall	Solid	Concrt	0.03
1661	1963 Bldg	79	XRF	4/16/97	2	Room	2174	Cabinet	Shelf	Solid	Wood	0
1662	1963 Bldg	80	XRF	4/16/97	2	Room	2174	Door	Door	Solid	Wood	0.01
1663	1963 Bldg	81	XRF	4/16/97	2	Room	2174	Door	Casing	Solid	Metal	0.05
1664	1963 Bldg	70	XRF	4/16/97	2	Room	2175	Wall	Midle Wall	Solid	Wood	0.02
1665	1963 Bldg	71	XRF	4/16/97	2	Room	2175	Wall	Midle Wall	Solid	Concrt	0.06
1666	1963 Bldg	72	XRF	4/16/97	2	Room	2175	Wall	Wall	Solid	Concrt	0.07
1667	1963 Bldg	73	XRF	4/16/97	2	Room	2175	Door	Door	Solid	Wood	0
1668	1963 Bldg	74	XRF	4/16/97	2	Room	2175	Door	Casing	Solid	Metal	0.07
1669	1963 Bldg	75	XRF	4/16/97	2	Room	2175	Door	Jamb	Solid	Wood	0.01
1670	1963 Bldg	76	XRF	4/16/97	2	Room	2175	Door	Threshold	Solid	Wood	0
1671	1963 Bldg	64	XRF	4/16/97	2	Room	2176	Wall	Midle Wall	Solid	Wood	0.26
1672	1963 Bldg	65	XRF	4/16/97	2	Room	2176	Wall	Midle Wall	Solid	Concrt	0.04
1673	1963 Bldg	66	XRF	4/16/97	2	Room	2176	Door	Door	Solid	Wood	0
1674	1963 Bldg	67	XRF	4/16/97	2	Room	2176	Door	Casing	Solid	Metal	0.09
1675	1963 Bldg	68	XRF	4/16/97	2	Room	2176	Door	Jamb	Solid	Wood	0
1676	1963 Bldg	69	XRF	4/16/97	2	Room	2176		Radiator	Solid	Wood	0
1677	1963 Bldg	58	XRF	4/16/97	2	Room	2177	Wall	Midle Wall	Solid	Concrt	0.06
1678	1963 Bldg	59	XRF	4/16/97	2	Room	2177	Wall	Wall	Solid	Concrt	0.05
1679	1963 Bldg	60	XRF	4/16/97	2	Room	2177	Wall	Midle Wall	Solid	Concrt	0.1
1680	1963 Bldg	61	XRF	4/16/97	2	Room	2177	Wall	Midle Wall	Solid	Concrt	0.06
1681	1963 Bldg	62	XRF	4/16/97	2	Room	2177	Door	Door	Solid	Wood	0.01
1682	1963 Bldg	63	XRF	4/16/97	2	Room	2177	Door	Casing	Solid	Metal	0.05
1683	1963 Bldg	91	XRF	4/16/97	2	Room	2180	Wall	Midle Wall	Solid	Concrt	0.12
1684	1963 Bldg	92	XRF	4/16/97	2	Room	2180	Window	Casing	Solid	Metal	0.09
1685	1963 Bldg	93	XRF	4/16/97	2	Room	2180	Door	Door	Solid	Wood	0.01
1686	1963 Bldg	94	XRF	4/16/97	2	Room	2180	Door	Casing	Solid	Metal	0.09
1687	1963 Bldg	95	XRF	4/16/97	2	Room	2181	Wall	Midle Wall	Solid	Concrt	0.04
1688	1963 Bldg	96	XRF	4/16/97	2	Room	2181	Door	Door	Solid	Wood	0.01
1689	1963 Bldg	97	XRF	4/16/97	2	Room	2181	Door	Casing	Solid	Metal	0.08
1690	1963 Bldg	16	XRF	4/17/97	2	Room	2200	Wall	Midle Wall	Solid	Concrt	0.03
1691	1963 Bldg	17	XRF	4/17/97	2	Room	2200		Radiator	Solid	Metal	0.07
1692	1963 Bldg	18	XRF	4/17/97	2	Room	2200	Wall	Wall	Solid	Concrt	0.04
1693	1963 Bldg	19	XRF	4/17/97	2	Room	2200	Door	Door	Solid	Wood	0.01
1694	1963 Bldg	20	XRF	4/17/97	2	Room	2200	Door	Casing	Solid	Metal	0.06
1695	1963 Bldg	11	XRF	4/17/97	2	Room	2210	Wall	Midle Wall	Solid	Concrt	0.08
1696	1963 Bldg	12	XRF	4/17/97	2	Room	2210		Radiator	Solid	Metal	0.06
1697	1963 Bldg	13	XRF	4/17/97	2	Room	2210	Door	Door	Solid	Wood	0.01
1698	1963 Bldg	14	XRF	4/17/97	2	Room	2210	Door	Casing	Solid	Metal	0.14
1699	1963 Bldg	15	XRF	4/17/97	2	Room	2210	Wall	Wall	Solid	Concrt	0.03
1700	1963 Bldg	6	XRF	4/17/97	2	Room	2230		Radiator	Solid	Metal	0.05
1701	1963 Bldg	7	XRF	4/17/97	2	Room	2230	Wall	Midle Wall	Solid	Concrt	0.07
1702	1963 Bldg	8	XRF	4/17/97	2	Room	2230	Wall	Wall	Solid	Concrt	0.03
1703	1963 Bldg	9	XRF	4/17/97	2	Room	2230	Door	Door	Solid	Wood	0.01
1704	1963 Bldg	10	XRF	4/17/97	2	Room	2230	Door	Casing	Solid	Metal	0.05
1705	1963 Bldg	193	XRF	4/16/97	2	Room	2240	Wall	Midle Wall	Solid	Concrt	0.07
1706	1963 Bldg	194	XRF	4/16/97	2	Room	2240	Wall	Wall	Solid	Concrt	0.04
1707	1963 Bldg	195	XRF	4/16/97	2	Room	2240		Radiator	Solid	Metal	0.04
1708	1963 Bldg	196	XRF	4/16/97	2	Room	2240	Door	Door	Solid	Wood	0.01
1709	1963 Bldg	197	XRF	4/16/97	2	Room	2240	Door	Casing	Solid	Metal	0.15
1710	1963 Bldg	50	XRF	4/16/97	2	Room	2269	Stairs	Hand rail	Solid	Metal	0.17
1711	1963 Bldg	51	XRF	4/16/97	2	Room	2269	Door	Door	Solid	Wood	0
1712	1963 Bldg	52	XRF	4/16/97	2	Room	2269	Door	Casing	Solid	Metal	0.07

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1713	1963 Bldg	181	XRF	4/16/97	2	Room	2270	Door	Door	Solid	Metal	0.07
1714	1963 Bldg	182	XRF	4/16/97	2	Room	2270	Door	Casing	Solid	Metal	0.11
1715	1963 Bldg	183	XRF	4/16/97	2	Room	2270	Door	Door	Solid	Wood	0.01
1716	1963 Bldg	86	XRF	4/29/97	2	Room	2280	Ceiling		Solid	Plaster	0
1717	1963 Bldg	184	XRF	4/16/97	2	Room	2290	Door	Door	Solid	Wood	0.01
1718	1963 Bldg	185	XRF	4/16/97	2	Room	2290	Door	Casing	Solid	Metal	0.07
1719	1963 Bldg	186	XRF	4/16/97	2	Room	2290	Door	Header	Solid	Wood	0
1720	1963 Bldg	103	XRF	4/29/97	2	Room	2360	Ceiling		Solid	Plaster	0
1721	1963 Bldg	65	XRF	4/26/97	2	Room	2430	Door	Door	Solid	Wood	0.01
1722	1963 Bldg	66	XRF	4/26/97	2	Room	2430	Door	Casing	Solid	Metal	0.05
1723	1963 Bldg	67	XRF	4/26/97	2	Room	2430	Door	Header	Solid	Wood	0
1724	1963 Bldg	100	XRF	4/29/97	2	Room	2430	Ceiling		Solid	Plaster	0
1725	1963 Bldg	95	XRF	4/29/97	2	Room	2510	Ceiling		Solid	Plaster	0.01
1726	1963 Bldg	124	XRF	4/25/97	2	Room	2542	Wall	Middle Wall	Solid	Concrete	0.02
1727	1963 Bldg	125	XRF	4/25/97	2	Room	2542	Cabinet	Door	Solid	Wood	0
1728	1963 Bldg	126	XRF	4/25/97	2	Room	2542		Radiator	Solid	Metal	0.07
1729	1963 Bldg	127	XRF	4/25/97	2	Room	2542	Wall	Middle Wall	Solid	Concrete	0.06
1730	1963 Bldg	128	XRF	4/25/97	2	Room	2542	Door	Door	Solid	Wood	0
1731	1963 Bldg	129	XRF	4/25/97	2	Room	2542	Door	Casing	Solid	Metal	0.15
1732	1963 Bldg	130	XRF	4/25/97	2	Room	2542	Door	Header	Solid	Wood	0
1733	1963 Bldg	131	XRF	4/25/97	2	Room	2542	Bookcase	Inside	Solid	Wood	0
1734	1963 Bldg	64	XRF	4/25/97	2	Room	2640	Cabinet	Door	Solid	Wood	0
1735	1963 Bldg	65	XRF	4/25/97	2	Room	2640	Wall	Middle Wall	Solid	Concrete	0.02
1736	1963 Bldg	66	XRF	4/25/97	2	Room	2640	Door	Door	Solid	Wood	0.01
1737	1963 Bldg	67	XRF	4/25/97	2	Room	2640	Door	Casing	Solid	Metal	0.31
1738	1963 Bldg	68	XRF	4/25/97	2	Room	2640	Door	Header	Solid	Wood	0
1739	1963 Bldg	69	XRF	4/25/97	2	Room	2640	Window	Stool	Solid	Metal	0.04
1740	1963 Bldg	70	XRF	4/25/97	2	Room	2640	Window	Panel	Solid	Wood	0
1741	1963 Bldg	71	XRF	4/25/97	2	Room	2640	Wall	Wall	Solid	Concrete	0.11
1742	1963 Bldg	72	XRF	4/25/97	2	Room	2640	Door	Header	Solid	Wood	0
1743	1963 Bldg	91	XRF	4/29/97	2	Room	2651	Ceiling		Solid	Concrete	0
1744	1963 Bldg	116	XRF	4/14/97	1	Stairwell	1	Door	Door	Solid	Wood	0.03
1745	1963 Bldg	117	XRF	4/14/97	1	Stairwell	1	Door	Casing	Solid	Metal	0.02
1746	1963 Bldg	118	XRF	4/14/97	1	Stairwell	1	Stairs	Hand rail	Solid	Wood	0
1747	1963 Bldg	119	XRF	4/14/97	1	Stairwell	1	Stairs	Baseboard	Solid	Metal	0.08
1748	1963 Bldg	120	XRF	4/14/97	1	Stairwell	1		Radiator	Solid	Metal	0.01
1749	1963 Bldg	121	XRF	4/14/97	1	Stairwell	1	Stairs	Newel post	Solid	Metal	0.1
1750	1963 Bldg	122	XRF	4/14/97	1	Stairwell	1	Door	Door	Solid	Metal	0.01
1751	1963 Bldg	123	XRF	4/14/97	1	Stairwell	1	Door	Casing	Solid	Metal	0.42
1752	1963 Bldg	124	XRF	4/14/97	1	Stairwell	1	Wall	Wall	Solid	Concrete	0
1753	1963 Bldg	125	XRF	4/14/97	1	Stairwell	1		Radiator	Solid	Metal	0.08
1754	1963 Bldg	59	XRF	4/29/97	1	Stairwell	1	Ceiling		Solid	Concrete	0
1755	1963 Bldg	60	XRF	4/29/97	1	Stairwell	1	Ceiling		Solid	Plaster	0
1756	1963 Bldg	126	XRF	4/14/97	1	Stairwell	2	Wall	Middle Wall	Solid	Concrete	0.02
1757	1963 Bldg	127	XRF	4/14/97	1	Stairwell	2	Stairs	Hand rail	Solid	Wood	0
1758	1963 Bldg	128	XRF	4/14/97	1	Stairwell	2	Stairs	Baseboard	Solid	Metal	0.13
1759	1963 Bldg	129	XRF	4/14/97	1	Stairwell	2	Stairs	Newel post	Solid	Metal	0.05
1760	1963 Bldg	130	XRF	4/14/97	1	Stairwell	2	Door	Door	Solid	Metal	0.33
1761	1963 Bldg	131	XRF	4/14/97	1	Stairwell	2	Window	Casing	Solid	Metal	0.07
1762	1963 Bldg	132	XRF	4/14/97	1	Stairwell	2		Radiator	Solid	Metal	0.02
1763	1963 Bldg	133	XRF	4/14/97	1	Stairwell	2	Wall	Panel	Solid	Wood	0
1764	1963 Bldg	134	XRF	4/14/97	1	Stairwell	2	Wall	Middle Wall	Solid	Wood	0
1765	1963 Bldg	53	XRF	4/29/97	1	Stairwell	2	Ceiling		Solid	Plaster	0
1766	1963 Bldg	76	XRF	4/29/97	1	Stairwell	2	Ceiling		Solid	Plaster	0.07
1767	1963 Bldg	135	XRF	4/14/97	1	Stairwell	3	Wall	Middle Wall	Solid	Concrete	0.01
1768	1963 Bldg	136	XRF	4/14/97	1	Stairwell	3	Stairs	Hand rail	Solid	Wood	0
1769	1963 Bldg	137	XRF	4/14/97	1	Stairwell	3	Stairs	Newel post	Solid	Metal	0.04
1770	1963 Bldg	138	XRF	4/14/97	1	Stairwell	3	Stairs	Baseboard	Solid	Metal	0.04
1771	1963 Bldg	139	XRF	4/14/97	1	Stairwell	3	Door	Door	Solid	Metal	0.26

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1772	1963 Bldg	140	XRF	4/14/97	1	Stairwell	3	Window	Casing	Solid	Metal	0.04
1773	1963 Bldg	141	XRF	4/14/97	1	Stairwell	3		Radiator	Solid	Metal	0.1
1774	1963 Bldg	142	XRF	4/14/97	1	Stairwell	3	Bleachers		Solid	Wood	0
1775	1963 Bldg	143	XRF	4/14/97	1	Stairwell	3	Wall	Midle Wall	Solid	Concrete	0
1776	1963 Bldg	144	XRF	4/14/97	1	Stairwell	3	Wall	Midle Wall	Solid	Concrete	0.07
1777	1963 Bldg	81	XRF	4/29/97	1	Stairwell	3	Ceiling		Solid	Plaster	0
1778	1963 Bldg	172	XRF	4/14/97	1	Stairwell	4	Door	Door		Wood	0.01
1779	1963 Bldg	173	XRF	4/14/97	1	Stairwell	4	Door	Casing		Metal	0.12
1780	1963 Bldg	174	XRF	4/14/97	1	Stairwell	4	Wall	Midle Wall	Solid	Concrete	0.06
1781	1963 Bldg	175	XRF	4/14/97	1	Stairwell	4	Wall	Wall	Solid	Concrete	0.01
1782	1963 Bldg	176	XRF	4/14/97	1	Stairwell	4		Radiator	Solid	Metal	0.07
1783	1963 Bldg	177	XRF	4/14/97	1	Stairwell	4	Stairs	Hand rail	Solid	Wood	0
1784	1963 Bldg	178	XRF	4/14/97	1	Stairwell	4	Stairs	Newal pos	Solid	Metal	0.05
1785	1963 Bldg	179	XRF	4/14/97	1	Stairwell	4	Stairs	Baseboar	Solid	Metal	0.09
1786	1963 Bldg	180	XRF	4/14/97	1	Stairwell	4	Door	Door	Solid	Metal	0.04
1787	1963 Bldg	181	XRF	4/14/97	1	Stairwell	4	Door	Casing	Solid	Metal	0.26
1788	1963 Bldg	182	XRF	4/14/97	1	Stairwell	4	Door	Casing	Solid	Metal	0.26
1789	1963 Bldg	183	XRF	4/14/97	1	Stairwell	4	Wall	Wall Rgstr	Solid	Metal	0.11
1790	1963 Bldg	62	XRF	4/15/97	1	Stairwell	5	Wall	Midle Wall	Solid	Concrete	0.04
1791	1963 Bldg	63	XRF	4/15/97	1	Stairwell	5	Wall	Midle Wall	Solid	Concrete	0.06
1792	1963 Bldg	64	XRF	4/15/97	1	Stairwell	5	Stairs	Hand rail	Solid	Wood	0
1793	1963 Bldg	65	XRF	4/15/97	1	Stairwell	5	Stairs	Baseboar	Solid	Metal	0.06
1794	1963 Bldg	66	XRF	4/15/97	1	Stairwell	5	Stairs	Newal pos	Solid	Metal	0.07
1795	1963 Bldg	67	XRF	4/15/97	1	Stairwell	5		Radiator	Solid	Metal	0.02
1796	1963 Bldg	68	XRF	4/15/97	1	Stairwell	5	Door	Door	Solid	Metal	0.24
1797	1963 Bldg	69	XRF	4/15/97	1	Stairwell	5	Door	Casing	Solid	Metal	0.17
1798	1963 Bldg	181	XRF	4/15/97	2	Stairwell	6	Wall	Midle Wall	Solid	Concrete	0
1799	1963 Bldg	182	XRF	4/15/97	2	Stairwell	6	Wall	Midle Wall	Solid	Concrete	0.02
1800	1963 Bldg	183	XRF	4/15/97	2	Stairwell	6	Stairs	Hand rail	Solid	Wood	0.03
1801	1963 Bldg	184	XRF	4/15/97	2	Stairwell	6	Stairs	Baluster	Solid	Metal	0.11
1802	1963 Bldg	185	XRF	4/15/97	2	Stairwell	6	Stairs	Baseboar	Solid	Metal	0.09
1803	1963 Bldg	186	XRF	4/15/97	2	Stairwell	6	Door	Door	Solid	Metal	0.19
1804	1963 Bldg	187	XRF	4/15/97	2	Stairwell	6	Door	Casing	Solid	Metal	0.14
1805	1963 Bldg	188	XRF	4/15/97	2	Stairwell	6		Radiator	Solid	Metal	0
1806	1963 Bldg	189	XRF	4/15/97	2	Stairwell	6	Door	Door	Solid	Metal	0.1
1807	1963 Bldg	190	XRF	4/15/97	2	Stairwell	6	Door	Casing	Solid	Metal	0.09
1808	1963 Bldg	61	XRF	4/29/97	1	Stairwell	6	Ceiling		Solid	Concrete	0
1809	1963 Bldg	62	XRF	4/29/97	1	Stairwell	6	Ceiling		Solid	Plaster	0
1810	1963 Bldg	79	XRF	4/29/97	1	Stairwell	6	Ceiling		Solid	Plaster	0
1811	1963 Bldg	190	XRF	4/17/97	1	Stairwell	7	Wall	Midle Wall	Solid	Concrete	0.01
1812	1963 Bldg	191	XRF	4/17/97	1	Stairwell	7	Door	Door	Solid	Metal	0.24
1813	1963 Bldg	192	XRF	4/17/97	1	Stairwell	7	Window	Casing	Solid	Metal	0.02
1814	1963 Bldg	193	XRF	4/17/97	1	Stairwell	7	Stairs	Hand rail	Solid	Wood	0.01
1815	1963 Bldg	194	XRF	4/17/97	1	Stairwell	7	Stairs	Baluster	Solid	Metal	0.03
1816	1963 Bldg	195	XRF	4/17/97	1	Stairwell	7	Stairs	Baseboar	Solid	Metal	0.03
1817	1963 Bldg	196	XRF	4/17/97	1	Stairwell	7	Wall	Panel	Solid	Wood	0
1818	1963 Bldg	197	XRF	4/17/97	1	Stairwell	7	Wall	Midle Wall	Solid	Concrete	0
1819	1963 Bldg	198	XRF	4/17/97	1	Stairwell	7	Window	Casing	Solid	Metal	0.41
1820	1963 Bldg	199	XRF	4/17/97	1	Stairwell	7	Window	Stool	Solid	Concrete	0.01
1821	1963 Bldg	50	XRF	4/29/97	1	Stairwell	7	Ceiling		Solid	Plaster	0
1822	1963 Bldg	200	XRF	4/17/97	2	Stairwell	8	Wall	Midle Wall	Solid	Concrete	0.01
1823	1963 Bldg	201	XRF	4/17/97	2	Stairwell	8	Wall	Midle Wall	Solid	Concrete	0.07
1824	1963 Bldg	202	XRF	4/17/97	2	Stairwell	8	Stairs	Hand rail	Solid	Wood	0
1825	1963 Bldg	203	XRF	4/17/97	2	Stairwell	8	Stairs	Baseboar	Solid	Metal	0.05
1826	1963 Bldg	204	XRF	4/17/97	2	Stairwell	8	Door	Door	Solid	Metal	0.22
1827	1963 Bldg	205	XRF	4/17/97	2	Stairwell	8	Door	Casing	Solid	Metal	0.07
1828	1963 Bldg	206	XRF	4/17/97	2	Stairwell	8	Window	Stool	Solid	Concrete	0.02
1829	1963 Bldg	207	XRF	4/17/97	2	Stairwell	8	Stairs	Baluster	Solid	Metal	0.02
1830	1963 Bldg	208	XRF	4/17/97	1	Stairwell	8	Wall	Panel	Solid	Wood	0

Saint Paul Public Schools  
 John A. Johnson Senior High School  
 Lead-Based Paint Inspection

A	B	C	D	E	F	G	H	I	J	K	L	
3	Site	Sample #	Analysis	Date	Floor	Area	Room#	Component	Feature	Condition	Substrate	Result
1831	1963 Bldg	209	XRF	4/17/97	1	Stairwell	8	Window	Casing	Solid	Metal	0.51
1832	1963 Bldg	140	XRF	4/29/97	1	Stairwell	9	Ceiling		Solid	Plaster	0
1833	1963 Bldg	150	XRF	4/29/97	1	Stairwell	9	Stairs	Hand rail	Solid	Wood	0
1834	1963 Bldg	151	XRF	4/29/97	1	Stairwell	9	Stairs	Baseboar	Solid	Metal	0.1
1835	1963 Bldg	152	XRF	4/29/97	1	Stairwell	9	Wall	Midle Wall	Solid	Concre	0
1836	1963 Bldg	153	XRF	4/29/97	1	Stairwell	9	Wall	Midle Wall	Solid	Concre	0
1837	1963 Bldg	154	XRF	4/29/97	1	Stairwell	9	Unlisted	Midle Wall	Solid	Wood	1.15
1838	1963 Bldg	155	XRF	4/29/97	1	Stairwell	9	Stairs	Newal pos	Solid	Metal	0.05
1839	1963 Bldg	156	XRF	4/29/97	1	Stairwell	9		Radiator	Solid	Metal	0.26
1840	1963 Bldg	157	XRF	4/29/97	1	Stairwell	9	Door	Door	Solid	Metal	0.25
1841	1963 Bldg	158	XRF	4/29/97	1	Stairwell	9	Window	Casing	Solid	Metal	0.03
1842	1963 Bldg	141	XRF	4/29/97	1	Stairwell	10	Ceiling		Solid	Plaster	0
1843	1963 Bldg	142	XRF	4/29/97	1	Stairwell	10	Wall	Midle Wall	Solid	Concre	0
1844	1963 Bldg	143	XRF	4/29/97	1	Stairwell	10	Wall	Midle Wall	Solid	Concre	0
1845	1963 Bldg	144	XRF	4/29/97	1	Stairwell	10	Stairs	Hand rail	Solid	Wood	0
1846	1963 Bldg	145	XRF	4/29/97	1	Stairwell	10	Stairs	Baseboar	Solid	Metal	0.15
1847	1963 Bldg	146	XRF	4/29/97	1	Stairwell	10	Stairs	Baluster	Solid	Metal	0.19
1848	1963 Bldg	147	XRF	4/29/97	1	Stairwell	10	Window	Panel	Solid	Wood	0.55
1849	1963 Bldg	148	XRF	4/29/97	1	Stairwell	10	Door	Door	Solid	Metal	0.25
1850	1963 Bldg	149	XRF	4/29/97	1	Stairwell	10	Window	Casing	Solid	Metal	0.07

## **APPENDIX B**

### **LABORATORY SAMPLE ANALYSIS DATA**

**LABORATORY ANALYSIS REPORT****DATE:** June 20, 1997**PAGE:**

1 Of 2

**CLIENT:** Midwest Environmental Cons.  
5385 401st Ave. NW  
Dalbo, MN 55017**PROJECT NO.:** 050697-200888  
**COLLECTION DATE:** 4/30/97-5/01/97  
**COLLECTED BY:** Client  
**RECEIVED DATE:** 5/06/97  
**PROJECT DESCRIPT.:** 62/0197Y**CONTACT:** Greg Myers/Richard Cox

<b>SAMPLE #</b>	<b>DESCP.</b>	<b>MDL</b>	<b>LEAD</b> <i>(6010A)</i>	<b>ANALYSIS</b>	
			<b>RESULTS</b>	<b>Units=mg/kg</b>	<b>DATE</b>
L972668-1	PC-1	9.0	14,000	6/19/97	
L972668-2	PC-2	34	6000	6/19/97	
L972668-3	PC-3	46	2800	6/19/97	
L972668-4	PC-4	79	1400	6/19/97	
L972668-5	PC-5	40	2800	6/19/97	
L972668-6	PC-6	33	2200	6/19/97	
L972668-7	PC-7	83	2000	6/19/97	
L972668-8	PC-8	28	1200	6/19/97	
L972668-9	PC-9	50	1200	6/19/97	
L972668-10	PC-10	44	7000	6/19/97	
L972668-11	PC-11	21	1900	6/19/97	
L972668-12	PC-12	35	2000	6/19/97	
L972668-13	PC-13	190	16,000	6/19/97	
L972668-14	PC-14	13	990	6/19/97	
L972668-15	PC-15	52	ND	6/19/97	
L972668-16	PC-16	45	4400	6/19/97	
L972668-17	PC-17	39	810	6/19/97	
L972668-18	PC-18	40	ND	6/19/97	
L972668-19	PC-19	25	4400	6/19/97	
L972668-20	PC-20	26	190	6/19/97	

**ND** means Not Detected or below reported MDL**MDL** means Method Detection Limit**mg/kg** means Milligrams Per Kilogram which is equivalent to Parts Per Million (ppm)

As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.



A member of The Marmon Group of Companies


**LABORATORY ANALYSIS REPORT**

<b>DATE:</b>	<i>June 20, 1997</i>	<b>PAGE:</b>	<i>2 Of 2</i>
<b>CLIENT:</b>	<i>Midwest Environmental Cons. 5385 401st Ave. NW Dalbo, MN 55017</i>	<b>PROJECT NO.:</b>	<i>050697-200888</i>
		<b>COLLECTION DATE:</b>	<i>4/30/97-5/01/97</i>
		<b>COLLECTED BY:</b>	<i>Client</i>
		<b>RECEIVED DATE:</b>	<i>5/06/97</i>
		<b>PROJECT DESCRIPT.:</b>	<i>62/0197Y</i>

**CONTACT:** *Greg Myers/Richard Cox*

*This report has been reviewed by me for technical accuracy and completeness. The analyses were performed using EPA or other approved methodologies and the results were reported on an "as received" basis unless otherwise noted. Organic soil analyses were reported on a dry weight basis. The results reported relate only to the items tested. Please contact me if you have any questions or comments regarding this report. Spectrum Labs, Inc. appreciates the opportunity to provide this analytical service for you.*

*Report Submitted By,*

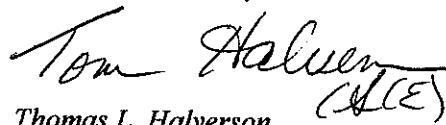  
Thomas L. Halverson  
Laboratory Manager

*TLH:wmc  
mec171-I*

*As a mutual protection, all reports are submitted in confidentiality and may not be reproduced except in full without written authorization.*



A member of The Marmon Group of Companies

# Midwest Environmental Consulting, L.L.C.

5385 401st Ave. NW, Duluth, MN 55017

612-689-3612/612-757-5541/FAX-612-689-5209

Client Address \_\_\_\_\_

Contact Richard Cox



# CHAIN OF CUSTODY RECD

Project Number 62-0191Y

Client ST. Paul Public

Project Toksoo Senior High

Phone/Fax \_\_\_\_\_

Sample ID	Sample Description	Collection Date/Time	Matrix (Vol./Area)	Analysis Requested
PC-1	Gym 1-Bags-Lockers-Red (24)	4-30-97 5:00pm	1.5 sq.in.	Pb in ppm
PC-2	" " /ham30/Dr. Casing-BRN (44)	5:10pm 4-30-97	1.5 sq.in.	"
PC-3	" " " laundry bin (49)	5:15p 4-30-97	2.0 sq.in.	"
PC-4	Gym 333-Wall Paper-Small Box (73) Red	5:20p 4-30-97	2.0 sq.in.	"
PC-5	String-L-radiator-TAN (50)	5:25pm 4-30-97	1.0 sq.in.	"
PC-6	Gym #1-Register-Brown (66)	5:30pm 4-30-97	1.0 sq.in.	"
PC-7	String #5 - Neutral Post - Brown (133)	5:35pm 4-30-97	1.0 sq.in.	"
PC-8	Aud.#1000-L-wall-cover-Black-Brown (140)	5:50pm 4-30-97	1.0 sq.in.	"
PC-9	Aud#1000-Radiators-Metal - Blue (197)	6:10pm 4-30-97	1.0 sq.in.	"
PC-10	Hall#204D-Locket - metal-Burg (129)	6:25pm 4-30-97	1.0 sq.in.	"
PC-11	Rm 2152-Basketball-Cover - E.R.T.Y (199)	6:40pm 4-30-97	1.0 sq.in.	"
PC-12	Rm 2220 - Radiator - metal - White (19)	7:00 pm 4-30-97	2.0 sq.in.	"
PC-13	Rm 513 - Shelf - metal - Green (50)	7:20p 4-30-97	2.0 sq.in.	"
PC-14	Rm 420 - cover Bl - white	7:40 pm 4-30-97	1.5 sq.in.	"

Sampled By: Brian Thompson Date: 4-30-97 Time: 5-10pm

Received By: John Dill Date: 5/6/97 Time: 1:45pm

Received By Lab: Analyst Date: 5/6/97 Time: 1:45pm

Notes: PC = Paint Chip

Delivered By: John Dill Date: 7/05/96 Time: 1:343

Delivered By: John Dill Date: 7/05/96 Time: 1:343

Disposition of Samples \_\_\_\_\_



Midwest Environmental Consulting, L.L.C.

5385 401st Ave NW Duluth MN 55017

5385 401st Ave NW Duluth MN 55017

3300 401ST AVE. NW, DALLAS, TX 75208

512-889-3812/2012-137-333  
Client Address \_\_\_\_\_  
Contact \_\_\_\_\_

CHAIN OF CUSTODY RECORD

Project Number 62-01974

Project Number 62-01874

Client Number: A47-

Client Jolynseas Sewing High  
Project Jolynseas Sewing High  
Design

Sample ID	Sample Description	Collection Date/Time	Matrix (Vol/Area)	Analysis Requested
PC-15	Outside Street #2 ENTRANCE TO GARDEN - WALKING - Blue	(17) 4-30-97 1:55pm	1 sq. in.	Pb in ppm
PC-16	Gum (Pink) Rubber - white - Blue	(75) 4-30-97 8:20pm	1 sq. in.	" in ppm
PC-17	Gum (Pink) DDC - white - Blue	(75) 4-30-97 8:40pm	1 sq. in.	" in ppm
PC-18	<del>Black</del> Black Blue	4-30-97 9:00pm	1 sq. in.	" in ppm
PC-18	outside min est. - column - metal - Burg. 4-30-97 9:15pm	1 sq. in.	Pb in ppm	
PC-19	Flexible metal	5-1-97 5:15pm	1.5 in <sup>2</sup>	Pb in ppm
PC-20	Pipestock Side D	5-1-97 5:35pm	1 in <sup>2</sup>	Pb in ppm

Sampled By: HARREROUE Date: 4-20-97 Time: 5:19

Received By: John Date: 5/1/97 Time: 11:00 AM

Received By Lab: 1200 Date: 7/11 Time: 12:00pm

Notes: Acoustic Clip

B. J. Brock Date: 9/20/2016 Time: 1:343

Delivered By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_

Disposition of Samples \_\_\_\_\_

## **APPENDIX C**

## **INSPECTOR**

**Bob Hargrove**  
**MDH Lead Inspector # 416**