

IEA, INC.

2023 - 2024 Ventilation Assessment



Contact Us:

BROOKLYN PARK OFFICE

9201 W. BROADWAY, #600
BROOKLYN PARK, MN 55445
763-315-7900

MANKATO OFFICE

610 N. RIVERFRONT DRIVE
MANKATO, MN 56001
507-345-8818

ROCHESTER OFFICE

210 WOOD LAKE DRIVE SE
ROCHESTER, MN 55904
507-281-6664

BRAINERD OFFICE

601 NW 5TH STREET SUITE #4
BRAINERD, MN 56401
218-454-0703

MARSHALL OFFICE

1420 EAST COLLEGE DRIVE
MARSHALL, MN 56258
507-476-3599

VIRGINIA OFFICE

5525 EMERALD AVENUE
MOUNTAIN IRON, MN 55768
218-410-9521

www.ieasafety.com

info@ieasafety.com

800-233-9513

Saint Paul Public Schools Riverview West Side School of Excellence

Assessment Date:
Wednesday, April 19, 2023

Project Description

IEA conducted a ventilation inspection in Riverview West Side School of Excellence by IEA representative, Sashya Wandmaker, with the intent of gathering visual observations and overall ventilation information which will assist the District in making informed and proactive decisions to improve and maintain acceptable air quality in the building. This inspection is based upon the Environmental Protection Agency's (EPA's) Tools for Schools IAQ guidelines and the recommended Minnesota Department of Education (MDE) portion of a school district's IAQ management plan. Ventilation verification is also recommended by American Society of Heating, Refrigerating and Air-Conditioning Engineers (ASHRAE).

Some observations gathered during the inspection may identify issues which may require additional testing, evaluation, further investigation, or maintenance on the ventilation systems.

The findings, conclusions and recommendations presented herein are believed to be accurate and representative of the building on the date and time of the inspection.

GENERAL COMMENTS

The analysis and opinions expressed in this report are based upon data obtained from Saint Paul Public Schools at the indicated locations. This report does not reflect variations in conditions that may occur across the site, property, or facility. Actual conditions may vary and may not become evident without further assessment.

The report is prepared for the exclusive use of our client for specific application to the project discussed and has been prepared in accordance with generally accepted indoor air quality practices. Other than as provided in the preceding sentence, no warranties are extended or made.

Building Information

General information regarding the building was collected by IEA during an interview with building maintenance staff. The information gathered during this process is a vital component, as it is helpful in determining how these items may play a role in possible IAQ related issues.

Below is a summary of the information gathered during the interview:

- Automation controls are managed internally.
- A Building Automation System is present. The automation control software program is Tridium and controls can not be accessed remotely.
- Schedules:

Ventilation operation:

Day:	Occupied?	Start Time:	End Time:
Monday-Friday	Yes	6:00 AM	5:00 PM
Saturday	No		
Sunday	No		
Holiday	No		

Typical occupancy:

Day:	Occupied?	Start Time:	End Time:
Monday-Friday	Yes	7:30 AM	4:00 PM
Saturday	No		
Sunday	No		
Holiday	No		


Notes: No afterschool activities

- CO2 sensors are not associated with the ventilation system.
- VAVs are present. They are not fan powered.
- Building has variable frequency drives (VFD).
- The heating system is a hot water boiler.
- A cooling system is present and is a chilled water (air cooled) type system.
- Filters used are:

Filter Type	MERV Rating
Pleated	MERV 11


- Filters are changed quarterly.
- Energy Recovery Units are not present.
- Units do not contain system Enhancements.
- Personal air purifiers are supplied for individual rooms. They are 3M, winix /Filtrete, areowave 2.0.
 - Location: Throughout building
- It is not known whether or not the building was commissioned during the original construction.

Air Handling Unit Designations & Service Zones: 1st Floor

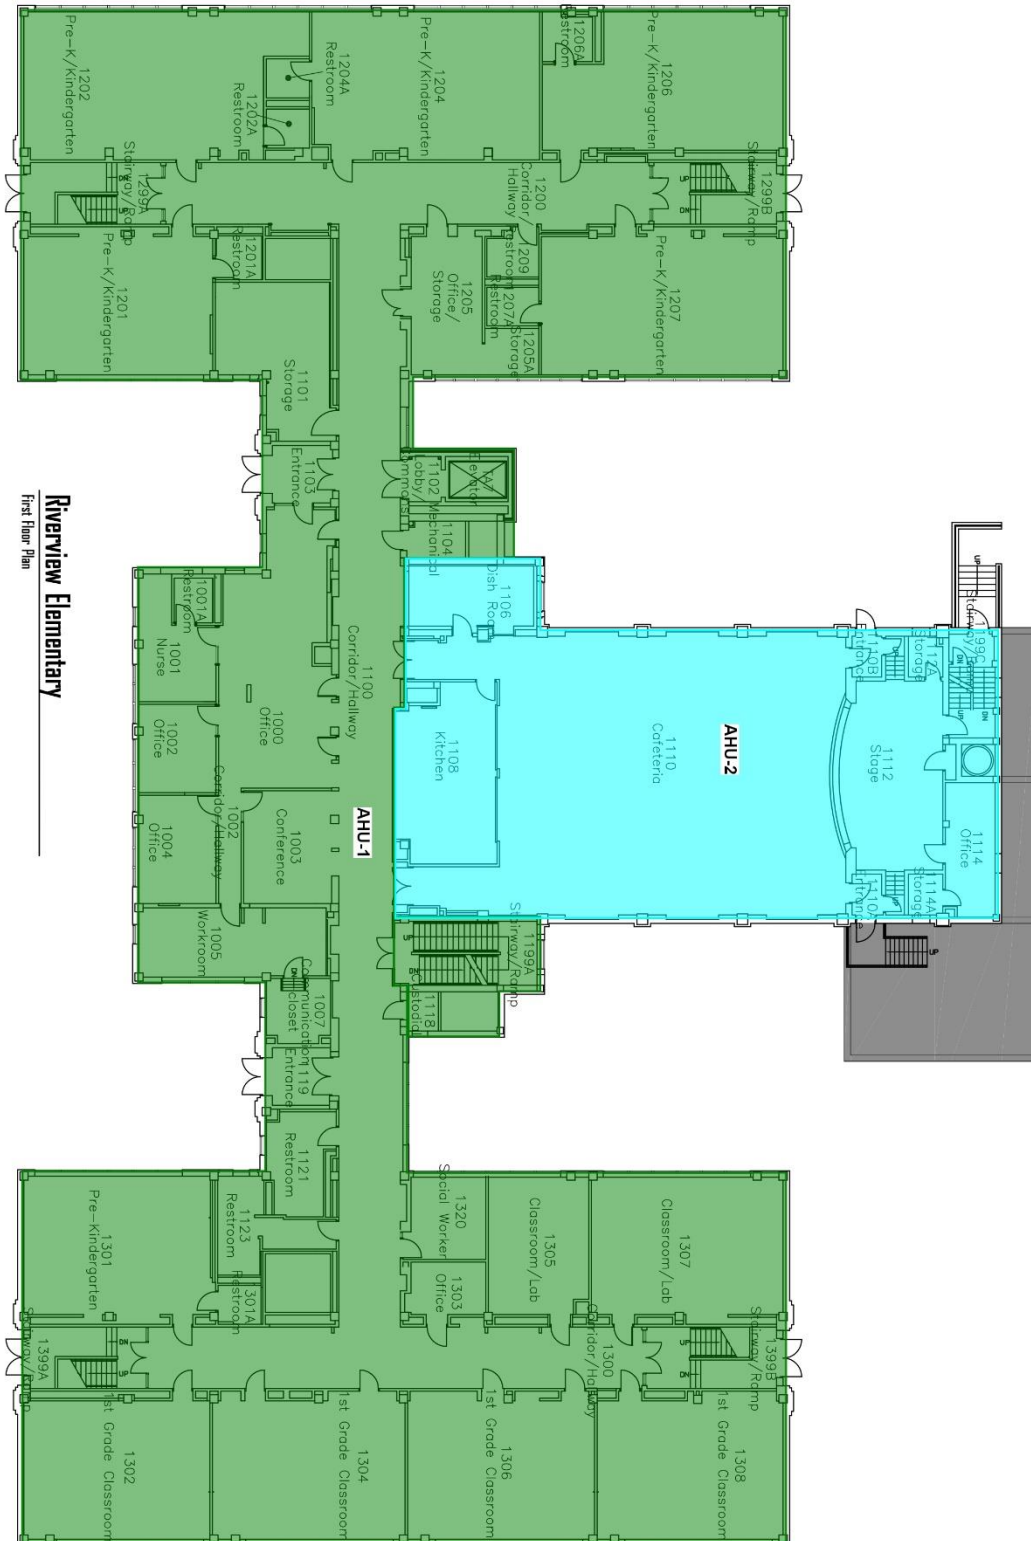


Riverview Elementary
First Floor Plan

Air Handling Unit Designations & Service Zones: 2nd Floor

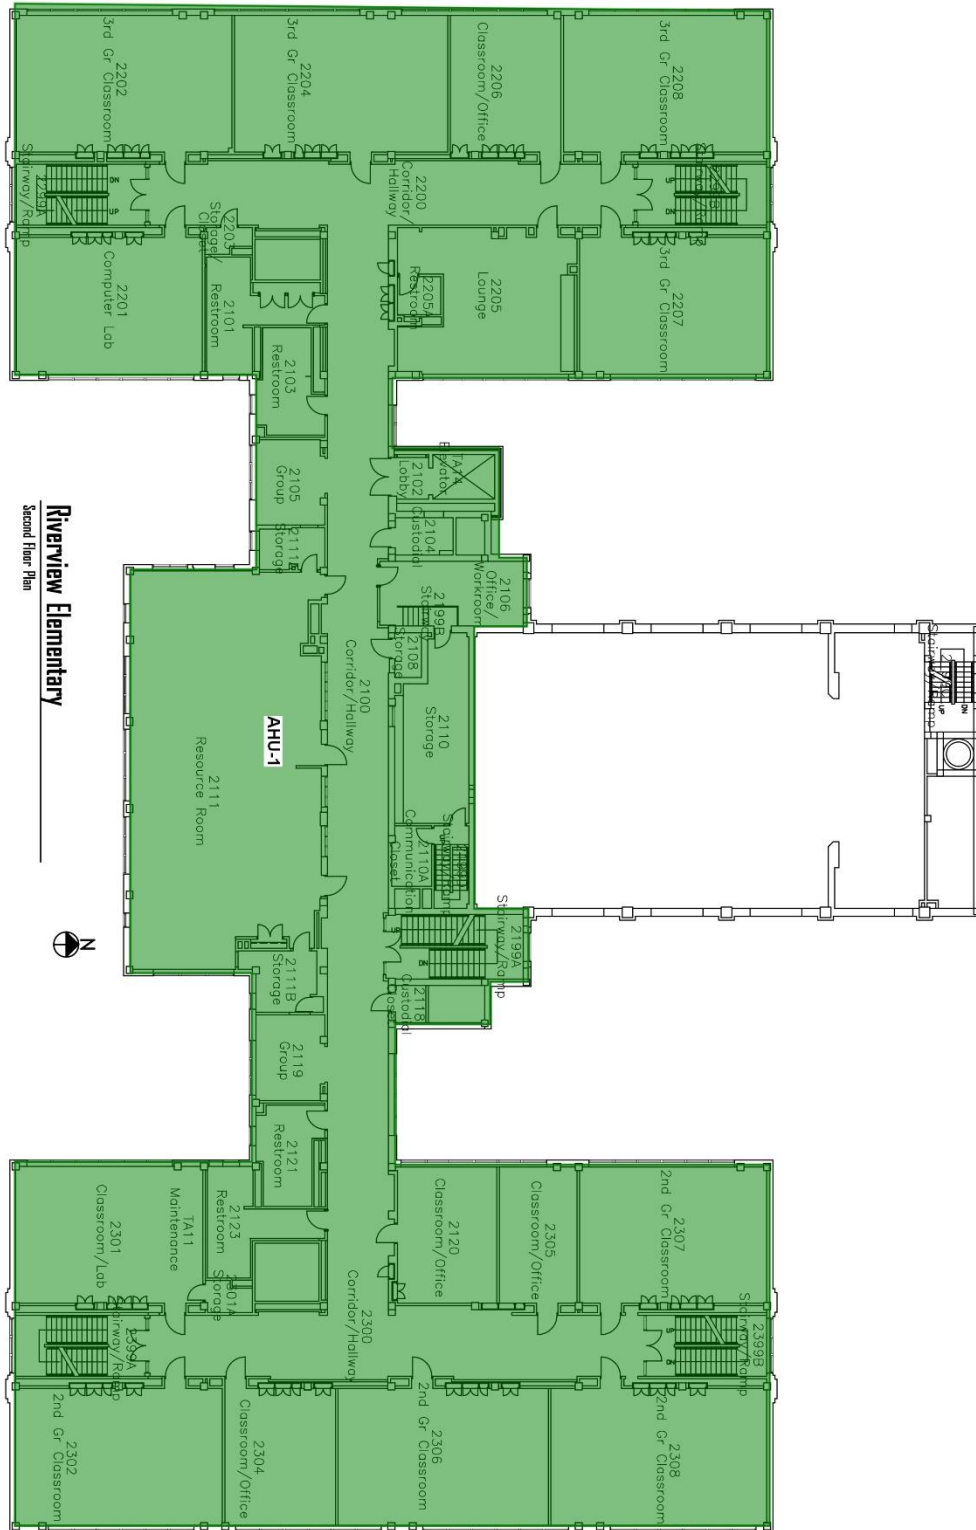

Air Handling Unit Designations & Service Zones: 3rd Floor

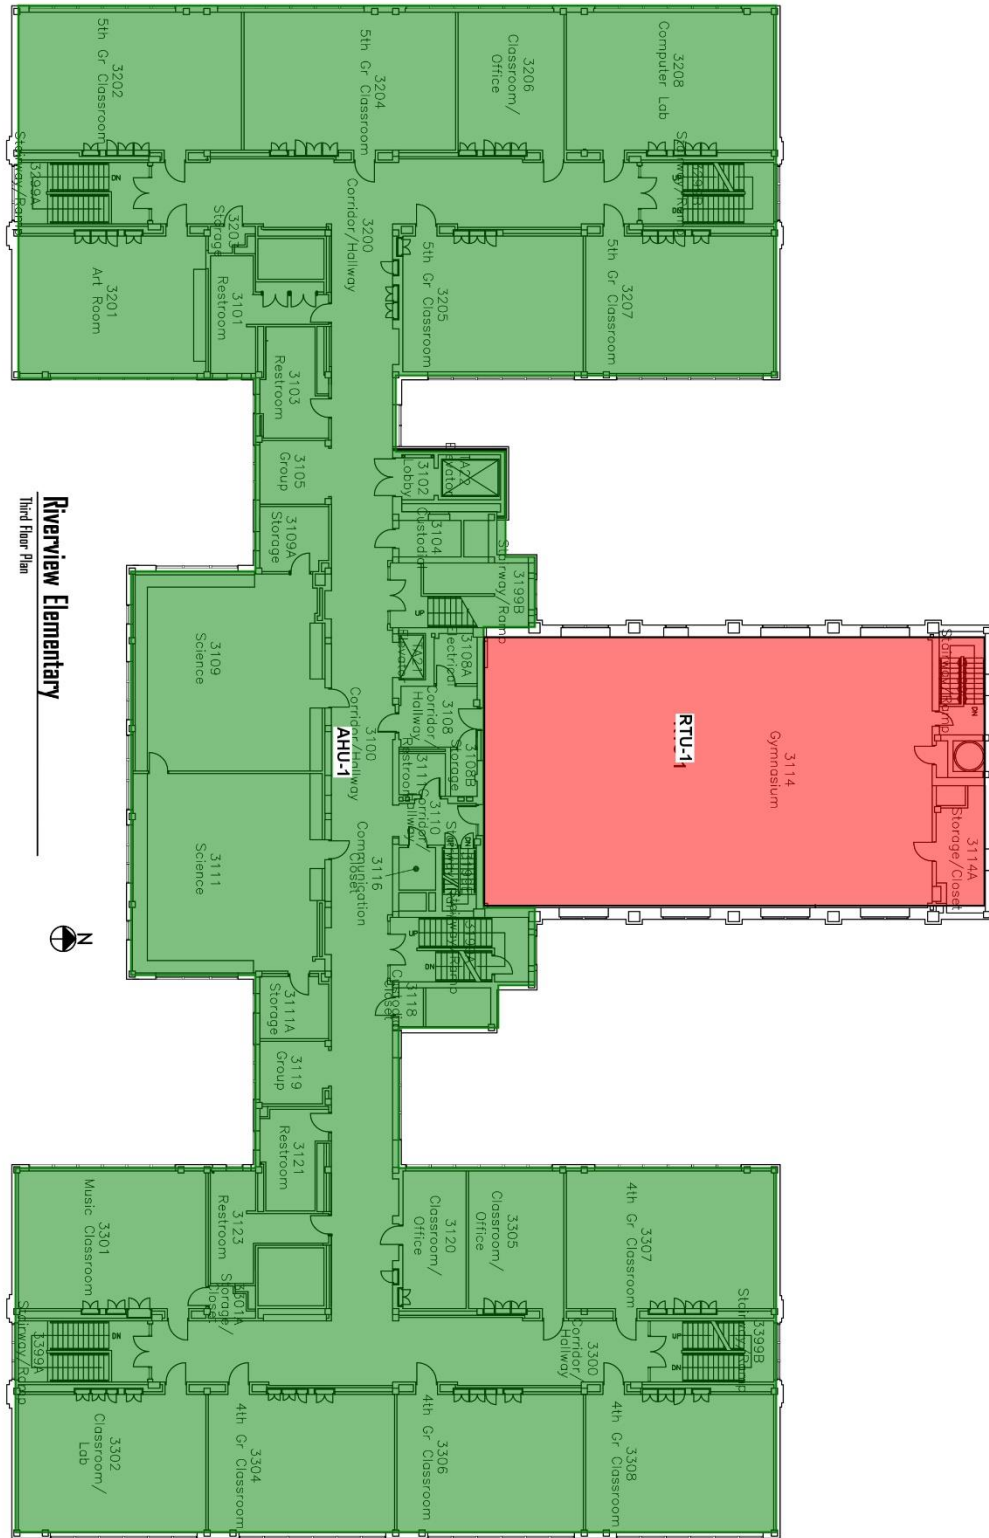

Riverview Elementary
Third Floor Plan

Assessment

Ventilation System

The following information was gathered by IEA on Wednesday, April 19, 2023 with support from the district building representative during the on-site interview. The type of heating, ventilating and air-conditioning (HVAC) system and its assessment is included for each unit below:

Unit Designation:	AHU_01	
Location of Unit:	Mechanical room boiler room	
Areas Served:	E/W Bldg See attached map	
System Enhancements:	None	
Supply System	Outdoor Air	Cleanliness and Observations
Type <ul style="list-style-type: none"> Supply System - VAV Heating - Hot Water Cooling - Chilled Water Energy Recovery Unit (ERU) - None 	<p>Outdoor air intake is inaccessible</p> <p>Outdoor air intake is located in an unknown location.</p> <p>It is not known if there are nearby pollution sources.</p>	<p>Outdoor air filters are not present.</p> <p>Return air filters are not present.</p> <p>Mixed air pre-filters are not present. Mixed air main filters are clean and not in need of replacement (scoring 2 out of 5) and fit well. Mixed air main filters are installed correctly.</p> <p>Drain pans are not plugged. Drain pan condition is good.</p>
Filter Type - Mixed <ul style="list-style-type: none"> Pre-filter: None Main filter: Pleated, MERV 11 	<p>Outdoor air intake is in good condition.</p>	<p>Heating coils are clean and cooling coils are dirty.</p> <p>Heat wheels are not present.</p> <p>Exterior ducting is visible. Exterior ducting insulation is in good condition.</p> <p>Interior ducting is not visible. Interior ducting insulation is in an unknown condition. Interior ducting is of unknown cleanliness.</p> <p>Air handling room is free of trash/chemicals.</p> <p>Outside damper is inaccessible, and its condition is not known.</p> <p>Return damper is inaccessible, and its condition is not known.</p> <p>The general condition of the unit is good.</p>

Unit Designation:	AHU_02	
Location of Unit:	Mechanical room boiler room	
Areas Served:	Cafeteria See attached map	
System Enhancements:	None	
Supply System	Outdoor Air	Cleanliness and Observations
Type <ul style="list-style-type: none"> Supply System - Constant Volume Heating - Hot Water Cooling - Chilled Water Energy Recovery Unit (ERU) - None Filter Type - Mixed <ul style="list-style-type: none"> Pre-filter: None Main filter: Pleated, MERV 11 	<p>Outdoor air intake is inaccessible</p> <p>Outdoor air intake is located in an unknown location.</p> <p>It is not known if there are nearby pollution sources.</p> <p>Outdoor air intake is in good condition.</p>	<p>Outdoor air filters are not present.</p> <p>Return air filters are not present.</p> <p>Mixed air pre-filters are not present. Mixed air main filters are clean and not in need of replacement (scoring 1 out of 5) and fit well. Mixed air main filters are installed correctly.</p> <p>Drain pans are not plugged. Drain pan condition is good.</p> <p>Heating coils are clean and cooling coils are clean.</p> <p>Heat wheels are not present.</p> <p>Exterior ducting is visible. Exterior ducting insulation is in good condition.</p> <p>Interior ducting is not visible. Interior ducting insulation is in an unknown condition. Interior ducting is of unknown cleanliness.</p> <p>Air handling room is free of trash/chemicals.</p> <p>Outside damper is inaccessible, and its condition is not known.</p> <p>Return damper is inaccessible, and its condition is not known.</p> <p>The general condition of the unit is good.</p>

Unit Designation:	RTU_01	
Location of Unit:	Mechanical room rooftop south	
Areas Served:	Gym See attached map	
System Enhancements:	None	
Supply System	Outdoor Air	Cleanliness and Observations
Type <ul style="list-style-type: none"> Supply System - Constant Volume Heating - None Cooling - None Energy Recovery Unit (ERU) - None 	Outdoor air intake is accessible Outdoor air intake is located on the roof. No nearby pollution sources were found.	Outdoor air filters are not present. Return air filters are not present. Mixed air pre-filters are not present. Mixed air main filters are clean and not in need of replacement (scoring 1 out of 5) and fit well. Mixed air main filters are installed correctly. Drain pans are not applicable or not present. Drain pan condition is not known.
Filter Type - Mixed <ul style="list-style-type: none"> Pre-filter: None Main filter: Pleated, MERV 11 	Outdoor air intake is in good condition.	Heat wheels are not present. Exterior ducting is visible. Exterior ducting insulation is not present. Interior ducting is not visible. Interior ducting insulation is in an unknown condition. Interior ducting is of unknown cleanliness. Air handling room is free of trash/chemicals. Outside damper is open, and its condition is good. Return damper is inaccessible, and its condition is not known. The general condition of the unit is good.

Recommendations

Dirty Coils were observed on unit AHU_01 during the ventilation inspection.

Recommendation: Impacted/dirty coils can result in poor ventilation air supply as well as be a source for mold and bacterial growth on the coils. Coils should be cleaned annually, or as needed, as identified in the operations and maintenance program.

Appendix A

Photo Documentation



AHU_01
Cooling Coils