CONFIDENTIAL AND PRIVILEGED
COMPREHENSIVE ASBESTOS MATERIAL SURVEY

For the Property located at:

15151 Columbia Ln
Huntington Beach, California 92647

Prepared for:

Westminster School District
14121 Cedarwood Ave
Westminster, CA 92683
Attn: Brad Seaver

Prepared by:

Ambient Environmental Inc.
8141 East Kaiser Blvd. Suite 110
Anaheim California 92808

Date: March 27, 2026

Ambient Environmental Inc. Project #26-0253

Reviewed By:

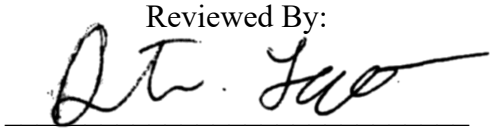

Justin C Lavezzoli
California Certified
Asbestos Consultant #24-7772

TABLE OF CONTENTS

1.0 EXECUTIVE SUMMARY

2.0 SURVEY PROCEDURES

3.0 BULK SAMPLING PROCEDURES

4.0 ASBESTOS SAMPLE RESULTS AND LOCATIONS

5.0 DISCLAIMER

APPENDIX A	CHAIN OF CUSTODY AND BULK SAMPLE LOG
APPENDIX B	LABORATORY CERTIFICATES OF ANALYSIS
APPENDIX C	SAMPLE LOCATION DRAWING
APPENDIX D	CERTIFICATION

1.0 EXECUTIVE SUMMARY

Ambient Environmental Inc. was retained by Westminster School District to perform a comprehensive asbestos materials survey for the property located at: 15151 Columbia Ln in Huntington Beach, California. The survey was performed on March 25, 2026 by Mr. Daniel Gonzales Site Surveillance Technician (#06-4103) under the direction of Justin C Lavezzoli California Certified Asbestos Consultant #24-7772. The property consists of a single-story school buildings with no limitation to the property access. Also, there was no visual damage or fire damage observed at the time of the survey.

The purpose of the asbestos materials survey was to locate and identify interior and exterior materials for detectable levels of asbestos prior to the renovation, pre-demolition activities or any other activity that will involve disturbance to materials. Once a visual inspection was performed, representative bulk samples were obtained from each homogeneous material. Homogeneous materials are defined as materials that are uniform in texture, construction or application date and general appearance. Also, each homogeneous material was divided into three main categories: Surfacing Materials, Thermal System Insulation and Miscellaneous Materials. Each sample location, material type, friability and condition of material were also documented.

Asbestos bulk samples were obtained in accordance with USEPA established guidelines document, “Guidance for Controlling Asbestos-Containing Materials in Buildings” (USEPA 560/5-85-024, 1985) and USEPA 40 CFR Part 763.86 “Asbestos-Containing Materials in Schools, Final Rule” (AHERA). Each bulk sample was submitted for analysis of asbestos content by Polarized Light Microscopy (PLM) in accordance with EPA Method 40 CFR Part 763, Appendix E to Subpart E and EPA Method 600/R-93-116 Visual Area Estimation. When required by project specifications or client directives, select materials such as mastics, adhesives, or other organically bound materials may also be submitted for confirmatory analysis by Transmission Electron Microscopy (TEM) through an accredited laboratory. Laboratory analysis revealed detectable levels of asbestos or assumed asbestos in the following materials. Materials not identified in this report may be present within hidden or concealed areas of the property or outside the scope of services.

- **Vinyl Floor Tile and Mastic**
- **Exterior Stucco (Trace <1%)**

Locations and conditions of the materials assessed and sampled can be found in the Material Inventory (Tables).

2.0 SURVEY PROCEDURES

Materials identification was performed by assessing all structural/mechanical materials. If materials were installed at various times or if there is any reason to suspect material might be different through appearance, Ambient separated each material into a new homogeneous sampling area. Friable and Non-friable materials assessments was performed for each homogeneous material using hand pressure as defined in USEPA 40 CFR Part 763 "Asbestos-Containing Materials in Schools, Final Rule" (AHERA). Friable material is defined as any material that by means of hand pressure can be crumbled into a powder.

When each homogeneous sampling area was identified, a random sampling grid was utilized for sample collection of each material as described in the EPA guidance document, Asbestos in Building: Simplified Sampling Scheme for Friable Surfacing Materials (EPA 560/5-85-030a, October 1985 Random Number Diagrams). The minimum number of samples was obtained for each identified homogeneous area based upon the overall square footage of material. The physical condition, friability, accessibility, activity and damage materials were also assessed and documented. The following procedures were performed during the survey:

- Perform a visual assessment to identify the location and type of friable/non-friable materials.
- Obtain representative bulk samples from suspect materials.
- Samples were analyzed by an independent accredited laboratory for the presence of asbestos by PLM analysis.
- Present all survey results in a written report including recommendations, locations and laboratory results. All findings, recommendations, and analytical data presented in this report are based on the information (assessment and sampling data) obtained by our inspector during the survey.

3.0 BULK SAMPLING PROCEDURES

Each suspect material identified during the visual survey was sampled in accordance with sampling guidelines established by the USEPA. The following summarizes the sampling procedures utilized.

- Materials were categorized into homogeneous materials[1].
- A random sampling scheme was developed based upon the location and quantities of the various homogeneous materials[2].
- Bulk samples were collected by extracting a representative section of each selected material, placing the selected material into a sampling container and assigning a unique sample number to each sample. The samples were then placed into a sealed shipping container for delivery to an accredited laboratory for analysis by PLM[3].
- Each material was also categorized into friable and non-friable materials[4].
- Personnel performed proper decontamination procedures to prevent the spread of secondary contamination.
- Each bulk sample was recorded on a bulk sample log and possession of the samples was tracked by a chain of custody.
- The physical condition, friability, accessibility, activity and damage materials were also assessed and documented.

The reported laboratory results in this report are a visual estimate by area of asbestos concentration. Results for heterogeneous samples examined by component are reported as a composite. The lower limit of reliable detection for this method is 1%. Samples which contain above 1% asbestos are reported in 5% range. Samples which contain asbestos in a concentration lower than the limit of reliable detection (<1%) are "Trace."

All bulk samples from the time they were collected to the time they were relinquished to the laboratory were under proper custody and secured. Samples were relinquished to SGS/Forensic Analytical located at: 20535 South Belshaw Avenue in Carson, California (310) 763-2374. SGS/Forensic Analytical is accredited by the American Industrial Hygiene Association (AIHA), National Voluntary Laboratory Accreditation Program (NVLAP #101459-1), National Institute of Standards and Testing (NIST), and is a successful participant in the Proficiency Analytical

Testing Program (PAT). All findings, recommendations, and analytical data presented in this report are based on the information (assessment and sampling data) obtained by our inspector during the survey.

[1]Homogeneous materials are defined as materials that are uniform in texture, construction or application date and general appearance.

[2]A random sampling grid was utilized for sample collection for each material as described in the EPA guidance document, Asbestos in Building: Simplified Sampling Scheme for Friable Surfacing Materials (EPA 560/5-85-030a, October 1985 Random Number Diagrams). The minimum numbers of samples were obtained for each identified homogeneous area based upon the overall square footage of material in table-1.

Sample Table-1

Size of Sampling Area	Number of Samples Collected
Less Than 1,000 sq. ft.	3 – Samples
Between 1,000 & 5,000 sq. ft.	5 – Samples
Greater than 5,000 sq. Ft.	*7 – Samples

*The recommended number of samples per AHERA is nine for materials areas greater than 5,000 square feet, or at least one additional sample per additional 1,000 square feet for friable materials.

[3]Each sample was analyzed by an independent accredited laboratory for the presence of asbestos by Polarized Light Microscopy (PLM) method in accordance with the "Interim Method for the Determination of Asbestos in Bulk Insulation Samples EPA - 600/R-93-116 dated December 1982 and adopted by the National Voluntary Laboratory Accreditation Program (NVLAP) Title 15, part 7 of the Code of Federal Register as affiliated with the National Institute for Standards and Testing (NIST) and USEPA 40 CFR Part 763.87. The Quality Control (QC) program was strictly enforced to assure the accuracy of each sample result.

[4]Friable and Non-friable materials assessments were conducted for each homogeneous material using hand pressure as defined in USEPA 40 CFR Part 763 “Asbestos-Containing Materials in Schools, Final Rule” (AHERA). Friable material is defined as any material that by means of hand pressure can be crumbled into a powder.

4.0 ASBESTOS SAMPLE RESULTS AND LOCATIONS

Table Identifying the homogenous asbestos-containing material (ACM)

Material	Sample Number	Asbestos Content	Square Footage	Location of Material	Friable	Damage
Under Carpet Vinyl Foor Tile and Black Mastic	22-24	5% Chrysotile (Black Mastic)	2700 SF	A4, B1, D1 Floors	No	No

Table Identifying the homogenous trace (<1%) asbestos-containing material (ACM)

Material	Sample Number	Asbestos Content	Square Footage	Location of Material	Friable	Damage
Vinyl Foor Tile and Carpet Mastic	25-30	<1% Chrysotile	4000 SF	A, B, C, Walkway Ceilings	No	No

The asbestos-containing material identified above is subject to SCAQMD Rule 1403. This asbestos containing material table above is designed to aid the building owner, architect, construction manager, general contractors and potential asbestos abatement contractors in locating asbestos containing materials within the scope of work identified in section 1.0 of this report. All square footage identified in the above table are approximate and under no circumstances should these square footages be used for bidding or notification purposes. All asbestos containing material square footage above should be field verified prior to submitting any removal quotes. All material conditions above were identified during the time of the survey. The above asbestos containing materials could be located anywhere throughout the scope of work.

Table identifying the homogenous suspect building material as non-asbestos containing material

Material	Sample Number	Asbestos Content	Square Footage	Location of Material	Friable	Damage
Plaster	1-9	N/A	N/A	N/A	N/A	N/A
Plaster with Button board	10-12	N/A	N/A	N/A	N/A	N/A
Texture	13-15	N/A	N/A	N/A	N/A	N/A
Acoustic Ceiling	16-18	N/A	N/A	N/A	N/A	N/A
1x1 Ceiling Tiles	19-21	N/A	N/A	N/A	N/A	N/A

5.0 DISCLAIMER

Personnel should be made aware of the presence of asbestos containing materials identified in this report and instructed them not to disturb and/or damage these materials.

Asbestos Containing Materials-Current regulations (SCAQMD Rule 1403) require if during any removal, renovation or demolition activities asbestos containing materials will be disturbed for any reason, then only a state certified asbestos contractor with state certified trained personnel in the correct handling of asbestos containing materials perform any repair or removal activities. A SCAQMD asbestos notification will have to be submitted for any removal of 100 square feet or more of asbestos containing materials above 1% asbestos. All environmental work should proceed under the guidance or direction of an independent State Certified Consultant.

All samples obtained during the survey were obtained per EPA, ASTM SE2356-14 or any other regulation pertaining to asbestos bulk sampling (sample all layers of materials down to the joist level, frame level or substrates levels). Because SCAQMD Rule 1403-Procedure-5 work plan states any square footage of damaged asbestos containing materials warrants a P-5 work plan to be written, every effort was made to evaluate and sample any materials (not to cause any damage to the surrounding material sampled) down to the joist level, frame level, substrate level and any other substrate level. Due to this ruling, some well-hidden suspect asbestos containing materials may have escaped evaluation, areas like shafts, chase, wall voids, ceiling voids, floor voids or any other areas potentially containing asbestos materials may not have been sampled. For this reason, other asbestos containing materials may exist at the property and/or outside the scope of work. If other materials that are not identified in this report are discovered, all work should (stop) and these materials should be sampled prior to any removal activities. Also, if any changes to any regulation governing asbestos occurred after the date of this report, Ambient cannot be responsible for these changes.

Any recommendations in this report are professional opinions based solely on visual observations and analytical analyses, as described in this report. Opinions and/or recommendations presented herein apply to site conditions existing at the time of our investigation and cannot necessarily apply to site conditions of which this office is not aware of and/or has not had the opportunity to evaluate.

APPENDIX A

CHAIN OF CUSTODY
AND BULK SAMPLE LOG

AMBIENTENVIRONMENTAL, INC.
Consulting/ Engineering/Remediation

8141 E Kaiser Blvd., Suite 110
Anaheim, California 92808
Phone: (951) 272-4730

ASBESTOS BULK SAMPLE LOG

Client Name: WESTMINSTER SCHOOL DISTRICT

Project Location: 15151 COLUMBIA LN (HB)

Date: 3/25/26 **Field Technician:** DANIEL GONZALES

Project Number: 26-0253 **Priority: 3 Hour**____ **24 HR** X **3 Days**____ **5 Days:** ____

Sample Number	Sample Location	Material Description	Square Footage	F/NF	Condition
1	K1 - STORAGE / CEILING	PLASTER	10,000 SF	NF	INTACT
2	WALL				
3					
4	ADMIN - BATHROOM /				
5	- COPY ROOM /				
6					
7	B - STORAGE /				
8					
9	/ CEILING				

Chain of Custody **Analytical Method:** PLM: X **TEM:** _____ **Point Count:** _____
Samples Relinquished: **Hand Delivered:** X **Shipped:** _____ **Secured Lox Box:** X

	Signature	Print	Date	Time
Sampled By	Daniel Gonzales	DANIEL GONZALES	3/25/26	1530
Relinquished By	Daniel Gonzales	DANIEL GONZALES	3/25/26	2000
Received By		Shirlyra Tieng	3/26/26	800 D/O
Relinquished By				
Received By				

Date: 3/25/26 Field Technician: DANIEL GONZALES

Project Number: 26-0253 Priority: 3 Hour ___ 24 HR X 3 Days ___ 5 Days: ___

Sample Number	Sample Location	Material Description	Square Footage	F/NF	Condition
10	D - STORAGE / CEILING	PLASTER W/ BUTTON BOARD	950 SF	NF	INTACT
11	WALL				
12					
13	A - STORAGE/CEILING	TEXTURE	80 SF	F	INTACT
14					
15					
16	MPR - ENTRY/	ACOUSTIC CEILING	350 SF	F	INTACT
17					
18					
19	TYPICAL C-C1 /	1x1 CEILING TILES	900 SF	F	INTACT
20					
21					
22	A4 / FLOOR	UNDER CARPET FLOOR TILE W/ BLACK FLOOR MASTIC	2,700 SF	NF	INTACT
23	B1.				
24	D1				

	Signature	Print	Date	Time
Sampled By	Daniel Gonzales	DANIEL GONZALES	3/25/26	1530
Relinquished By	Daniel Gonzales	DANIEL GONZALES	3/25/26	1600
Received By		Shivlyra Tieng	3/26/26	800 D/O
Relinquished By				
Received By				

Date: 3/25/26 Field Technician: DANIEL GONZALES

Project Number: 26-0253 Priority: 3 Hour ____ 24 HR X 3 Days ____ 5 Days: ____

Sample Number	Sample Location	Material Description	Square Footage	F/NF	Condition
25	A / CEILING	EXTERIOR STUCCO	4000 SF	NF	INTACT
26	B /				
27	C /				
28	WALLS/WALLS/				
29					
30					

	Signature	Print	Date	Time
Sampled By	Daniel Gal	DANIEL GONZALES	3/25/26	1530
Relinquished By	Daniel Gal	DANIEL GONZALES	3/25/26	2000
Received By		Shirlyra Tieng	3/26/26	800 D/O
Relinquished By				
Received By				

APPENDIX B

LABORATORY
CERTIFICATES OF ANALYSIS

Bulk Asbestos Analysis

(EPA Method 40CFR, Part 763, Appendix E to Subpart E and EPA 600/R-93-116, Visual Area Estimation)
NVLAP Lab Code: 101459-1

Ambient Environmental Inc.
Robert Valousky
8141 E. Kaiser Blvd.
Suite 110
Anaheim, CA 92808

Client ID: 5697
Report Number: B382345
Date Received: 03/26/26
Date Analyzed: 03/26/26
Date Printed: 03/27/26
First Reported: 03/27/26

Job ID/Site: 26-0253; 15151 Columbia Ln (HB)

Date(s) Collected: 03/25/2026

SGSFL Job ID: 5697
Total Samples Submitted: 30
Total Samples Analyzed: 30

Sample ID	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
1	51927145						
Layer: Grey Plaster			**ND**				
Layer: White Plaster			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
2	51927146						
Layer: Grey Plaster			**ND**				
Layer: White Plaster			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
3	51927147						
Layer: Grey Plaster			**ND**				
Layer: White Plaster			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
4	51927148						
Layer: Grey Plaster			**ND**				
Layer: White Plaster			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
5	51927149						
Layer: Grey Plaster			**ND**				
Layer: White Plaster			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
6	51927150						
Layer: Grey Plaster			**ND**				
Layer: White Plaster			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							

Sample ID	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
7	51927151						
Layer: Grey Plaster			**ND**				
Layer: White Plaster			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
8	51927152						
Layer: Grey Plaster			**ND**				
Layer: White Plaster			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
9	51927153						
Layer: Grey Plaster			**ND**				
Layer: White Plaster			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
10	51927154						
Layer: White Drywall			**ND**				
Layer: Grey Plaster			**ND**				
Layer: White Plaster			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (5 %)							
11	51927155						
Layer: White Drywall			**ND**				
Layer: Grey Plaster			**ND**				
Layer: White Plaster			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (5 %)							
12	51927156						
Layer: White Drywall			**ND**				
Layer: Grey Plaster			**ND**				
Layer: White Plaster			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (5 %)							
13	51927157						
Layer: Grey Cementitious Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
14	51927158						
Layer: Grey Cementitious Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							

20535 South Belshaw Avenue, Carson, CA 90746 | phone: 310.763.2374 | https://www.sgs-ehsusa.com/

Report Number: B382345

Client Name: Ambient Environmental Inc. **Date Printed:** 03/27/26

Sample ID	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
15	51927159						
Layer: Grey Cementitious Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
16	51927160						
Layer: White Non-Fibrous Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
17	51927161						
Layer: White Non-Fibrous Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
18	51927162						
Layer: White Non-Fibrous Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
19	51927163						
Layer: Brown Fibrous Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (95 %)							
20	51927164						
Layer: Brown Fibrous Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (95 %)							
21	51927165						
Layer: Brown Fibrous Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (95 %)							
22	51927166						
Layer: Tan Mastic			**ND**				
Layer: Grey Non-Fibrous Material			**ND**				
Layer: Black Mastic		Chrysotile	**5 %**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							

20535 South Belshaw Avenue, Carson, CA 90746 | phone: 310.763.2374 | https://www.sgs-ehsusa.com/

Report Number: B382345

Client Name: Ambient Environmental Inc. **Date Printed:** 03/27/26

Sample ID	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
23	51927167						
Layer: Tan Mastic			**ND**				
Layer: Grey Non-Fibrous Material			**ND**				
Layer: Black Mastic		Chrysotile	**5 %**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
24	51927168						
Layer: Green Mastic			**ND**				
Layer: Grey Non-Fibrous Material			**ND**				
Layer: Black Mastic		Chrysotile	**5 %**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
25	51927169						
Layer: Grey Cementitious Material		Chrysotile	**Trace**				
Layer: Tan Cementitious Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
26	51927170						
Layer: Grey Cementitious Material		Chrysotile	**Trace**				
Layer: Tan Cementitious Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
27	51927171						
Layer: Grey Cementitious Material		Chrysotile	**Trace**				
Layer: Tan Cementitious Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
28	51927172						
Layer: Grey Cementitious Material		Chrysotile	**Trace**				
Layer: Tan Cementitious Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							
29	51927173						
Layer: Grey Cementitious Material		Chrysotile	**Trace**				
Layer: Tan Cementitious Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							

20535 South Belshaw Avenue, Carson, CA 90746 | phone: 310.763.2374 | https://www.sgs-ehsusa.com/

Report Number: B382345

Client Name: Ambient Environmental Inc. **Date Printed:** 03/27/26

Sample ID	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
30	51927174						
Layer: Grey Cementitious Material		Chrysotile	**Trace**				
Layer: Tan Cementitious Material			**ND**				
Layer: Paint			**ND**				
Total Percentage Values of Non-Asbestos Fibrous Components: Cellulose (Trace)							

Vincent To, Laboratory Supervisor, Carson Laboratory

Note: Limit of Quantification ('LOQ') = 1%. 'Trace' denotes the presence of asbestos below the LOQ. 'ND' = 'None Detected'.

Inhomogeneous samples are separated into homogenous subsamples and analyzed individually. Analytical results and reports are generated by SGS at the request of and for the exclusive use of the person or entity (client) named on such report. Results, reports or copies of same will not be released by SGS to any third party without prior written request from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full, unless approved by SGS. The client is solely responsible for the use and interpretation of test results and reports requested from SGS. This report must not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. Government. SGS is not able to assess the degree of hazard resulting from materials analyzed. SGS reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. All samples were received in acceptable condition unless otherwise noted.

20535 South Belshaw Avenue, Carson, CA 90746 | phone: 310.763.2374 | https://www.sgs-ehsusa.com/

APPENDIX C

SITE DRAWING WITH SAMPLE LOCATION

L-4, L-6
13, 14, 15

22

Schroeder Elementary School 2020-2021
Site Plan — Westminster School District

Schroeder Elementary School
15151 Columbia Lane
Huntington Beach, CA 92647
(714) 894-7268

3/25/26
WESTMINSTER SCHOOL DISTRICT
26-0253
DANIEL GONZALES

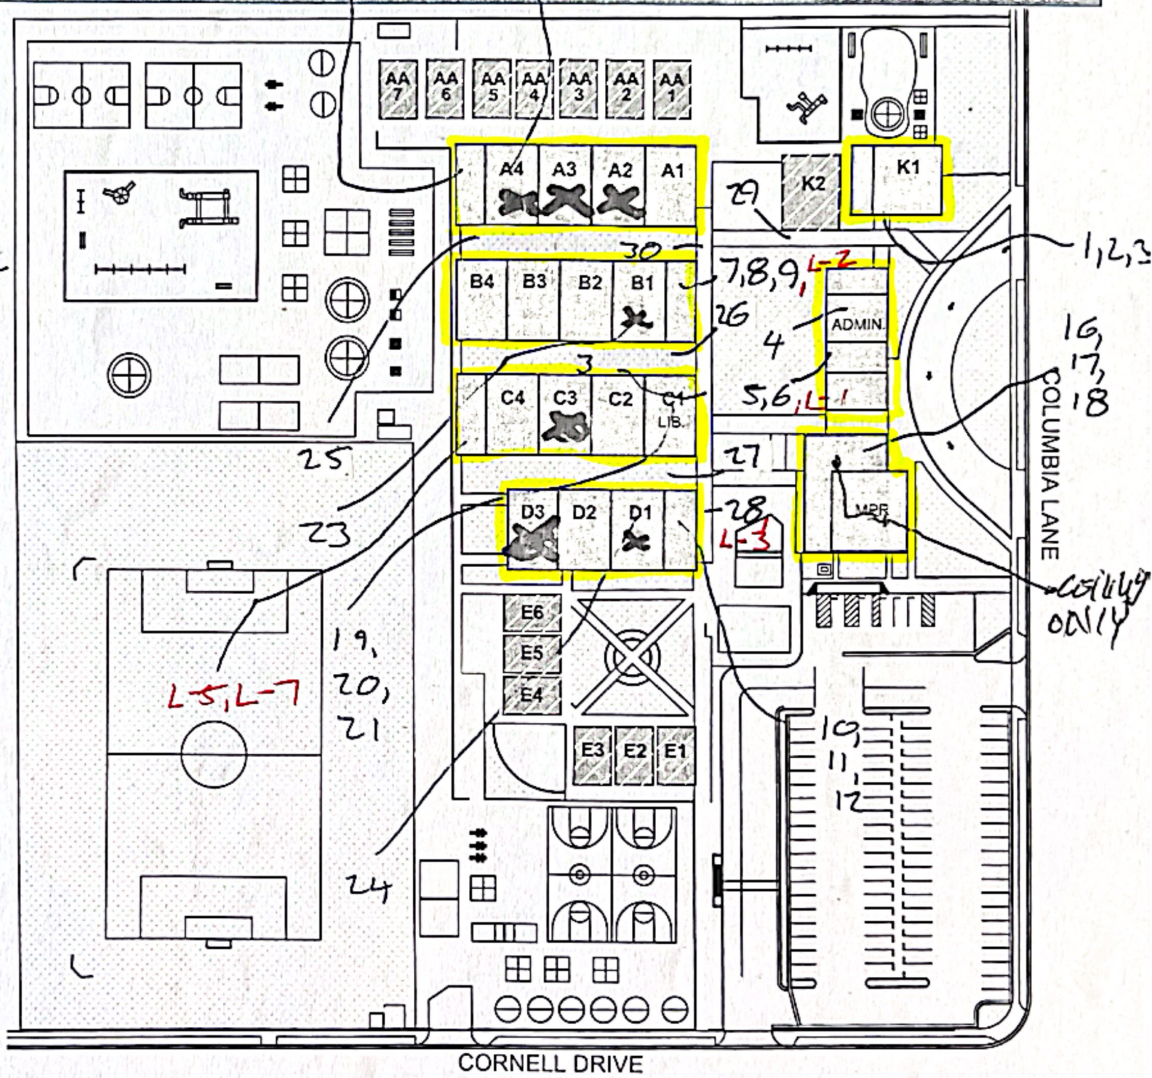

X FLOOR TILE UNDER CARPET

APPENDIX D

CERTIFICATION

Certificate Of Completion

Asbestos Contractor/Supervisor Refresher Course

DOSH #:CA-015-04

Daniel Gonzales

ASR0221250006N44243

Mauro Arias
Principal Instructor

Michael W. Horner
Training Director

Course Start Date	Course End Date	Exam Date	Expiration Date
2/21/2025	2/21/2025	2/21/2025	2/21/2026

This course satisfies the education requirements for Asbestos accreditation under the Toxic Substances Control Act, Title II. This course has been approved by the Department of Industrial Relations, Division of Occupational Safety and Health of the State of California

NATEC International, Inc.
National Association of Training and Environmental Consulting
1100 Technology Circle, Suite A, Anaheim, CA 92805 • www.natecintl.com • 800-969-3228

Important Industry Contacts
CAL-OSHA: PH# (916) 574-2993 (916) 483-0572 Fax Notification Web: www.dir.ca.gov or calosha.com
CDPH/CLPPB: PH# (510) 620-5600 Web: www.cdph.ca.gov/programs/CLPPB
SCAQMD: PH# (909) 396-3739 Fax#(909) 396-3342
BAAQMD: PH# (415) 749-4762

NATEC International, Inc.
National Association of Training and Environmental Consulting
Asbestos · Lead · Mold · HAZWOPER
PO Box 8657, Fountain Valley, CA 92728
(714) 678-2750, (800) 969-3228, Fax (714) 678-2757
www.natecintl.com

NATEC International, Inc.
National Association of Training and Environmental Consulting
This Card Acknowledges That Daniel Gonzales
Holds Training Certification For Asbestos Contractor/Supervisor Refresher Course
Expiration: 2/21/2026
Training Date: 2/21/2025 Michael W. Horner
Certificate No. ASR0221250006N44243 Training Director

Certificate Of Completion

Asbestos Building Inspector Refresher Course

DOSH #:CA-015-06

Daniel E. Gonzales III

ABIR0220250002N44311

Norm Kramer
Principal Instructor

Michael W. Horner
Training Director

Course Start Date	Course End Date	Exam Date	Expiration Date
2/20/2025	2/20/2025	2/20/2025	2/20/2026

This course satisfies the education requirements for Asbestos accreditation under the Toxic Substances Control Act, Title II. This course has been approved by the Department of Industrial Relations, Division of Occupational Safety and Health of the State of California

NATEC International, Inc.
National Association of Training and Environmental Consulting
1100 Technology Circle, Suite A, Anaheim, CA 92805 • www.natecintl.com • 800-969-3228

Important Industry Contacts
CAL-OSHA: PH# (916) 574-2993 (916) 483-0572 Fax Notification Web: www.dir.ca.gov or calosha.com
CDPH/CLPPB: PH# (510) 620-5600 Web: www.cdph.ca.gov/programs/CLPPB
SCAQMD: PH# (909) 396-3739 Fax#(909) 396-3342
BAAQMD: PH# (415) 749-4762

NATEC International, Inc.
National Association of Training and Environmental Consulting
Asbestos · Lead · Mold · HAZWOPER
PO Box 8657, Fountain Valley, CA 92728
(714) 678-2750, (800) 969-3228, Fax (714) 678-2757
www.natecintl.com

NATEC International, Inc.
National Association of Training and Environmental Consulting
This Card Acknowledges That Daniel E. Gonzales III
Holds Training Certification For Asbestos Building Inspector Refresher Course
Expiration: 2/20/2026
Training Date: 2/20/2025 Michael W. Horner
Certificate No. ABIR0220250002N44311 Training Director

Certificate of Attendance

CERTIFICATE NUMBER **46324**

This is to Certify that

DANIEL E. GONZALES III

Has Completed the Course of

AIR SAMPLING & ANALYSIS OF AIRBORNE ASBESTOS (NIOSH-582 EQUIVALENT)

For purposes of accreditation under section 206 of the Toxic Substances Control Act (TSCA) and compliance with AHAP in accordance with 40 FR 5226 effective April 1994

ARMANDO DUCOING
DIRECTOR

April 30, 2006	E042206NIOSH582	042206	
COMPLETION DATE	CLASS NUMBER / STARTING DATE		CERTIFICATE EXPIRES

Ecologics Training Institute

550 N. Parkcenter Drive, Suite 102 . Santa Ana. CA 92705 . Ph. (714) 480-0111 . Fax (714) 480-0222

STATE OF CALIFORNIA
DEPARTMENT OF INDUSTRIAL RELATIONS
Division of Occupational Safety and Health-Asbestos & Carcinogen Unit
1750 Howe Avenue, Suite 460
Sacramento, CA 95825
(916) 574-2993 Office http://www.dir.ca.gov/dosh/asbestos.html actu@dir.ca.gov

Gavin Newsom, Governor

611034103T

9/24/2025

Daniel Gonzales
5958 Berdie Drive
La Verne CA 91750

Dear Certified Asbestos Consultant or Technician:

Enclosed is your certification card. **To maintain your certification, you must abide by the rules printed on th back of the certification card.**

Your certification is valid for a period of one year. If you wish to renew your certification, you must apply for renewal at least 60 days before the expiration date shown on your card. [8 CCR 341.15(h)(1)].

Please hold and do not send copies of your required AHERA refresher renewal certificates to our office until you apply for renewal of your certification.

Certificates must be kept current if you are actively working as a CAC or CSST. The grace period is only for those who are not actively working as an asbestos consultant or site surveillance technician.

Please contact our office at the above address or email w any changes in your contact/mailing information within 15 days of the change.

Sincerely,

Dean Mochrie, CAC
Senior Safety Engineer

Attachment: Certification Card

cc: File

Renewal – Card Attached (08/24)

State of California
Division of Occupational Safety and Health
Certified Site Surveillance Technician
Daniel E Gonzales



Certification No. 06-4103
Expires on 11/15/2026

CDPH
California Department of Public Health

STATE OF CALIFORNIA
DEPARTMENT OF PUBLIC HEALTH

LEAD-RELATED CONSTRUCTION CERTIFICATE

INDIVIDUAL:	CERTIFICATE TYPE:	NUMBER:	EXPIRATION DATE:
	Lead Sampling Technician	LRC-00003833	2/12/2027

Daniel Gonzales

Disclaimer: This document alone should not be relied upon to confirm certification status. Compare the individual's photo and name to another valid form of government issued photo identification. Verify the individual's certification status by searching for Lead-Related Construction Professionals at www.cdph.ca.gov/programs/clppb or calling (800) 597-LEAD



Asbestos Training Program

This is to certify

Justin Lavezzoli
4633

Has successfully completed 4 hours of formal training required by section 206 of TSCA II entitled

Building Inspector
Refresher

Presented By
Environmental Compliance Training
PO BOX 16555
San Diego, CA 92176-6555
(858) 558-7465

Director:
Walter T. Amenta, CIH, Approval Number CA-029-06

Class Dates: 07-08-2025
Exam Date: n/a
Expiration Date: 07-08-2026
Certification Number: 0725ABCA192304

Asbestos Training Program

This is to certify

Justin Lavezzoli
4633

Has successfully completed 8 hours of formal training required by section 206 of TSCA II entitled

Project Designer
Refresher

Presented By
Environmental Compliance Training
PO BOX 16555
San Diego, CA 92176-6555
(858) 558-7465

Director:
Walter T. Amenta, CIH, Approval Number CA-029-10

Class Dates: 07-09-2025
Exam Date: n/a
Expiration Date: 07-09-2026
Certification Number: 0725ABCA192504

State of California
Division of Occupational Safety and Health
Certified Asbestos Consultant
Justin C Lavezzoli

Certification No. 24-7772
Expires on 10/18/2026

This certification was issued by the Division of Occupational Safety and Health as authorized by Sections 7180 et seq of the Business and Professions Code.

Asbestos Training Program

This is to certify

Justin Lavezzoli
4633

Has successfully completed 4 hours of formal training required by section 206 of TSCA II entitled

Management Planner
Refresher

Presented By
Environmental Compliance Training
PO BOX 16555
San Diego, CA 92176-6555
(858) 558-7465

Director:
Walter T. Amenta, CIH, Approval Number CA-029-08

Class Dates: 07-08-2025
Exam Date: n/a
Expiration Date: 07-08-2026
Certification Number: 0725ABCA192404

Asbestos Training Program

This is to certify

Justin Lavezzoli
4633

Has successfully completed 8 hours of formal training required by section 206 of TSCA II entitled

Contractor/Supervisor
Refresher

Presented By
Environmental Compliance Training
PO BOX 16555
San Diego, CA. 92176-6555
(858) 558-7465

Director:
Walter T. Amenta, CIH, Approval Number CA-029-04

Class Dates: 07-07-2025
Exam Date: n/a
Expiration Date: 07-07-2026
Certification Number: 0725ABCA192204

Asbestos Training Program

This is to certify

Justin Lavezzoli
4633

Has successfully completed 40 hours of formal training entitled

NIOSH 582
Equivalency

Presented By
Environmental Compliance Training
PO BOX 16555
San Diego, CA. 92176
(858) 558-7465

Director:
Walter T. Amenta, CIH

Class Dates: 04/18-22/2022
Expiration Date: N/A
Certification Number: 0422N582E-01

CDPH
California Department of Public Health

STATE OF CALIFORNIA
DEPARTMENT OF PUBLIC HEALTH

LEAD-RELATED CONSTRUCTION CERTIFICATE

INDIVIDUAL:	CERTIFICATE TYPE:	NUMBER:	EXPIRATION DATE:
	Lead Project Monitor	LRC-00013824	2/26/2027
	Lead Sampling Technician	LRC-00009043	7/27/2026

Justin Lavezzoli

Disclaimer: This document alone should not be relied upon to confirm certification status. Compare the individual's photo and name to another valid form of government issued photo identification. Verify the individual's certification status by searching for Lead-Related Construction Professionals at www.cdph.ca.gov/programs/clppb or calling (800) 597-LEAD

United States Department of Commerce
National Institute of Standards and Technology

Certificate of Accreditation to ISO/IEC 17025:2017

NVLAP LAB CODE: 101459-1

SGS Forensic Laboratories

Carson, CA

is accredited by the National Voluntary Laboratory Accreditation Program for specific services, listed on the Scope of Accreditation, for:

Asbestos Fiber Analysis

This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2017. This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality management system (refer to joint ISO-ILAC-IAF Communique on ISO/IEC 17025).

2025-07-01 through 2026-06-30

Effective Dates

For the National Voluntary Laboratory Accreditation Program

SCOPE OF ACCREDITATION TO ISO/IEC 17025:2017

SGS Forensic Laboratories
20535 S. Belshaw Ave.
Carson, CA 90746
Ryan Sutliffe
Phone: 702-332-1937
Email: ryan.sutliffe@sgs.com

ASBESTOS FIBER ANALYSIS — NVLAP LAB CODE 101459-1

Bulk Asbestos Analysis

Code	*Description*
18/A01	EPA -- 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples
18/A03	EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials

For the National Voluntary Laboratory Accreditation Program