

SAFETY DATA SHEET

Issue Date: 06/25/2015

SECTION 1. PRODUCT AND COMPANY IDENTIFICATION

Material name : Brighton Professional™ Dust Mop and Dust Cloth Treatment

Material number : BPR810A18-A

Manufacturer or supplier's details

Company : Staples Contract & Commercial, Inc.

Address : 500 Staples Drive

Framingham, MA 01702 USA

Telephone : 1-888-322-0912

Emergency : **1-888-322-0912** (24-HRS, 7 DAYS A WEEK)

Note: Products labeled as a consumer product in accordance with the United States Consumer Product Safety Commission regulations: The warnings presented below in this Safety Data Sheet (SDS) comply with the 2012 OSHA Hazard Communication Standard (GHS - Globally Harmonized System of Classification and Labeling). The requirements for the labeling and warnings of consumer products may differ from those required for GHS based hazard communication.

SECTION 2. HAZARDS IDENTIFICATION

Emergency Overview

Appearance	Aerosol containing a liquefied gas
Colour	white
Odour	characteristic

GHS Classification

Flammable aerosols : Category 2
 Gases under pressure : Liquefied gas
 Skin irritation : Category 2

GHS Label element

Hazard pictograms : 

Signal word : Warning

Hazard statements : H223 Flammable aerosol.
 H280 Contains gas under pressure; may explode if heated.
 H315 Causes skin irritation.

Precautionary statements : **Prevention:**
 P210 Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking.
 P211 Do not spray on an open flame or other ignition source.

SAFETY DATA SHEET BRIGHTON DUST MOP/CLOTH TREATMENT

(BPR810A18-A)

Version 1.0

Revision Date 06/25/2015

P251 Pressurized container: Do not pierce or burn, even after use.

P264 Wash skin thoroughly after handling.

P280 Wear protective gloves.

Response:

P302 + P352 IF ON SKIN: Wash with plenty of soap and water.

P332 + P313 If skin irritation occurs: Get medical advice/attention.

P362 Take off contaminated clothing and wash before reuse.

Storage:

P410 + P412 Protect from sunlight. Do not expose to temperatures exceeding 50 °C/ 122 °F.

Potential Health Effects

Carcinogenicity:

IARC

No component of this product present at levels greater than or equal to 0.1% is identified as probable, possible or confirmed human carcinogen by IARC.

ACGIH

No component of this product present at levels greater than or equal to 0.1% is identified as a carcinogen or potential carcinogen by ACGIH.

OSHA

No component of this product present at levels greater than or equal to 0.1% is identified as a carcinogen or potential carcinogen by OSHA.

NTP

No component of this product present at levels greater than or equal to 0.1% is identified as a known or anticipated carcinogen by NTP.

SECTION 3. COMPOSITION/INFORMATION ON INGREDIENTS

Hazardous components

Chemical Name	CAS-No.	Concentration [%]
Distillates (petroleum), hydrotreated heavy naphthenic	64742-52-5	>= 10 - < 20
Distillates (petroleum), hydrotreated light	64742-47-8	>= 5 - < 10
butane	106-97-8	>= 5 - < 10
Stoddard solvent	8052-41-3	>= 5 - < 10
propane	74-98-6	>= 1 - < 5

SECTION 4. FIRST AID MEASURES

- General advice : Show this safety data sheet to the doctor in attendance.
Do not leave the victim unattended.
- If inhaled : If unconscious place in recovery position and seek medical advice.
If symptoms persist, call a physician.
- In case of skin contact : If skin irritation persists, call a physician.
Wash off immediately with plenty of water for at least 15 minutes.
If on clothes, remove clothes.

SAFETY DATA SHEET

BRIGHTON DUST MOP/CLOTH TREATMENT

(BPR810A18-A)

Version 1.0

Revision Date 06/25/2015

- In case of eye contact : Remove contact lenses.
Flush eyes with water at least 15 minutes. Get medical attention if eye irritation develops or persists.
- If swallowed : Keep respiratory tract clear.
DO NOT induce vomiting unless directed to do so by a physician or poison control center.
-

SECTION 5. FIREFIGHTING MEASURES

- Suitable extinguishing media : Alcohol-resistant foam
Carbon dioxide (CO₂)
Dry chemical
Water spray jet
- Unsuitable extinguishing media : High volume water jet
- Specific hazards during firefighting : Do not allow run-off from fire fighting to enter drains or water courses.
- Hazardous combustion products : Carbon dioxide (CO₂)
Carbon monoxide
Smoke
- Specific extinguishing methods : Use extinguishing measures that are appropriate to local circumstances and the surrounding environment.
- Further information : Collect contaminated fire extinguishing water separately. This must not be discharged into drains.
Fire residues and contaminated fire extinguishing water must be disposed of in accordance with local regulations.
For safety reasons in case of fire, cans should be stored separately in closed containments.
Use a water spray to cool fully closed containers.
- Special protective equipment for firefighters : Wear self-contained breathing apparatus for firefighting if necessary.
-

SECTION 6. ACCIDENTAL RELEASE MEASURES

- Personal precautions, protective equipment and emergency procedures : Use personal protective equipment.
Ensure adequate ventilation.
Remove all sources of ignition.
Evacuate personnel to safe areas.
Beware of vapours accumulating to form explosive concentrations. Vapours can accumulate in low areas.
- Environmental precautions : Prevent product from entering drains.
Prevent further leakage or spillage if safe to do so.
If the product contaminates rivers and lakes or drains inform respective authorities.
- Methods and materials for containment and cleaning up : Soak up with inert absorbent material (e.g. sand, silica gel, acid binder, universal binder, sawdust).
-

SAFETY DATA SHEET
BRIGHTON DUST MOP/CLOTH TREATMENT

(BPR810A18-A)

Version 1.0

Revision Date 06/25/2015

Sweep up or vacuum up spillage and collect in suitable container for disposal.

SECTION 7. HANDLING AND STORAGE

- Advice on safe handling : Avoid contact with skin and eyes.
 For personal protection see section 8.
 Smoking, eating and drinking should be prohibited in the application area.
 Take precautionary measures against static discharges.
 Provide sufficient air exchange and/or exhaust in work rooms.
 Open drum carefully as content may be under pressure.
 Always replace cap after use.
 Dispose of rinse water in accordance with local and national regulations.
 Do not breathe vapours or spray mist.
- Conditions for safe storage : BEWARE: Aerosol is pressurized. Keep away from direct sun exposure and temperatures over 50 °C. Do not open by force or throw into fire even after use. Do not spray on flames or red-hot objects.
 No smoking.
 Containers which are opened must be carefully resealed and kept upright to prevent leakage.
 Observe label precautions.
 Electrical installations / working materials must comply with the technological safety standards.
 Keep in a dry, cool and well-ventilated place.
- Materials to avoid : Strong oxidizing agents

SECTION 8. EXPOSURE CONTROLS/PERSONAL PROTECTION

Components with workplace control parameters

Components	CAS-No.	Value type (Form of exposure)	Control parameters / Permissible concentration	Basis
Distillates (petroleum), hydrotreated heavy naphthenic	64742-52-5	TWA (Mist)	5 mg/m3	OSHA Z-1
		TWA (Inhalable fraction)	5 mg/m3	ACGIH
Distillates (petroleum), hydrotreated light	64742-47-8	TWA	500 ppm 2,000 mg/m3	OSHA Z-1
		TWA	400 ppm 1,600 mg/m3	OSHA P0
butane	106-97-8	TWA	800 ppm 1,900 mg/m3	NIOSH REL
		TWA	800 ppm 1,900 mg/m3	OSHA P0
Stoddard solvent	8052-41-3	TWA	100 ppm	ACGIH
		TWA	350 mg/m3	NIOSH REL
		C	1,800 mg/m3	NIOSH REL

SAFETY DATA SHEET
BRIGHTON DUST MOP/CLOTH TREATMENT

(BPR810A18-A)

Version 1.0

Revision Date 06/25/2015

		TWA	500 ppm 2,900 mg/m3	OSHA Z-1
		TWA	100 ppm 525 mg/m3	OSHA P0
propane	74-98-6	TWA	1,000 ppm	ACGIH
		TWA	1,000 ppm 1,800 mg/m3	NIOSH REL
		TWA	1,000 ppm 1,800 mg/m3	OSHA Z-1
		TWA	1,000 ppm 1,800 mg/m3	OSHA P0

Personal protective equipment

- Respiratory protection : In case of insufficient ventilation, wear suitable respiratory equipment.
- Hand protection
Remarks : The suitability for a specific workplace should be discussed with the producers of the protective gloves.
- Eye protection : Safety glasses
Ensure that eyewash stations and safety showers are close to the workstation location.
- Skin and body protection : impervious clothing
Choose body protection according to the amount and concentration of the dangerous substance at the work place.
- Hygiene measures : When using do not eat or drink.
When using do not smoke.
Wash hands before breaks and at the end of workday.

SECTION 9. PHYSICAL AND CHEMICAL PROPERTIES

- Appearance : Aerosol containing a liquefied gas
- Colour : white
- Odour : characteristic
- Odour Threshold : no data available
- pH : not applicable
- Melting point/freezing point : no data available
- Boiling point : no data available
- Flash point :
not applicable
- Evaporation rate : no data available
- Flammability (solid, gas) : Extremely flammable aerosol.
- Upper explosion limit : no data available
- Lower explosion limit : no data available

SAFETY DATA SHEET

BRIGHTON DUST MOP/CLOTH TREATMENT

(BPR810A18-A)

Version 1.0

Revision Date 06/25/2015

Vapour pressure	: no data available
Relative vapour density	: no data available
Density	: 0.93 g/cm ³
Solubility(ies)	
Water solubility	: emulsifiable
Partition coefficient: n-octanol/water	: no data available
Auto-ignition temperature	: not determined
Thermal decomposition	: no data available
Viscosity	
Viscosity, kinematic	: no data available

SECTION 10. STABILITY AND REACTIVITY

Reactivity	: Stable
Chemical stability	: Stable under normal conditions.
Possibility of hazardous reactions	: No decomposition if stored and applied as directed. Vapours may form explosive mixture with air.
Conditions to avoid	: Heat, flames and sparks. Extremes of temperature and direct sunlight.
Incompatible materials	: Oxidizing agents
Hazardous decomposition products	: Carbon dioxide (CO ₂) Carbon monoxide

SECTION 11. TOXICOLOGICAL INFORMATION

Acute toxicity

Components:

Distillates (petroleum), hydrotreated heavy naphthenic:

Acute oral toxicity	: LD50 rat: > 5,000 mg/kg
Acute inhalation toxicity	: LC50 rat: > 5 mg/l Exposure time: 4 h
Acute dermal toxicity	: LD50 rabbit: > 5,000 mg/kg

Distillates (petroleum), hydrotreated light:

Acute oral toxicity	: LD50 rat: > 5,000 mg/kg
---------------------	---------------------------

SAFETY DATA SHEET
BRIGHTON DUST MOP/CLOTH TREATMENT

(BPR810A18-A)

Version 1.0

Revision Date 06/25/2015

Acute inhalation toxicity : LC50 rat: > 4.6 mg/l
Exposure time: 6 h

Acute dermal toxicity : LD50 rat: > 2,000 mg/kg

butane:
Acute inhalation toxicity : LC50 mouse: 1,237 mg/l
Exposure time: 2 h

LC50 rat: 1,355 mg/l

propane:
Acute inhalation toxicity : LC50 mouse: 1,237 mg/l
Exposure time: 2 h

LC50 rat: 658 mg/l
Exposure time: 4 h

LC50 rat: 1,355 mg/l

Skin corrosion/irritation

Product:

Remarks: May cause skin irritation in susceptible persons.

Serious eye damage/eye irritation

Product:

Remarks: Vapours may cause irritation to the eyes, respiratory system and the skin.

Respiratory or skin sensitisation

no data available

Germ cell mutagenicity

no data available

Carcinogenicity

no data available

Reproductive toxicity

no data available

Distillates (petroleum), hydrotreated heavy naphthenic:

Distillates (petroleum), hydrotreated light:

butane:

Stoddard solvent:

propane:

STOT - single exposure

no data available

STOT - repeated exposure

no data available

SAFETY DATA SHEET
BRIGHTON DUST MOP/CLOTH TREATMENT

(BPR810A18-A)

Version 1.0

Revision Date 06/25/2015

Aspiration toxicity

no data available

Further information

Product:

Remarks: no data available

Components:

Distillates (petroleum), hydrotreated light:

Remarks: no data available

SECTION 12. ECOLOGICAL INFORMATION

Ecotoxicity

no data available

Persistence and degradability

no data available

Bioaccumulative potential

Product:

Partition coefficient: n-octanol/water : Remarks: no data available

Components:

butane :

Partition coefficient: n-octanol/water : Pow: 2.89

Mobility in soil

no data available

Other adverse effects

no data available

Product:

Regulation 40 CFR Protection of Environment; Part 82 Protection of Stratospheric Ozone - CAA Section 602 Class I Substances

Remarks This product neither contains, nor was manufactured with a Class I or Class II ODS as defined by the U.S. Clean Air Act Section 602 (40 CFR 82, Subpt. A, App.A + B).

Additional ecological information : An environmental hazard cannot be excluded in the event of unprofessional handling or disposal., Harmful to aquatic life with long lasting effects.

Components:

Distillates (petroleum), hydrotreated light :

Additional ecological information : no data available

SAFETY DATA SHEET BRIGHTON DUST MOP/CLOTH TREATMENT

(BPR810A18-A)

Version 1.0

Revision Date 06/25/2015

SECTION 13. DISPOSAL CONSIDERATIONS

Disposal methods

- Waste from residues : Dispose of in accordance with local regulations.
The product should not be allowed to enter drains, water courses or the soil.
Do not contaminate ponds, waterways or ditches with chemical or used container.
- Contaminated packaging : Empty remaining contents.
Dispose of as unused product.
Do not re-use empty containers.
Do not burn, or use a cutting torch on, the empty drum.

SECTION 14. TRANSPORT INFORMATION

Transportation Regulation: 49 CFR (USA):
ORM-D, LIMITED QUANTITY

Transportation Regulation: IMDG (Vessel):
UN1950, AEROSOLS, 2.1, - Limited quantity

Transportation Regulation: IATA (Cargo Air):
UN1950, Aerosols, flammable, 2.1, - Limited quantity

Transportation Regulation: IATA (Passenger Air):
UN1950, Aerosols, flammable, 2.1, - Limited quantity

Transportation Regulation: TDG (Canada):
UN1950, AEROSOLS, 2.1, - Limited quantity

SECTION 15. REGULATORY INFORMATION

EPCRA - Emergency Planning and Community Right-to-Know Act

CERCLA Reportable Quantity

Components	CAS-No.	Component RQ (lbs)	Calculated product RQ (lbs)
xylenes	1330-20-7	100	*

*: Calculated RQ exceeds reasonably attainable upper limit.

SARA 304 Extremely Hazardous Substances Reportable Quantity

This material does not contain any components with a section 304 EHS RQ.

- SARA 311/312 Hazards** : Fire Hazard
Sudden Release of Pressure Hazard
Acute Health Hazard

SAFETY DATA SHEET BRIGHTON DUST MOP/CLOTH TREATMENT

(BPR810A18-A)

Version 1.0

Revision Date 06/25/2015

SARA 302 : SARA 302: No chemicals in this material are subject to the reporting requirements of SARA Title III, Section 302.

SARA 313 : SARA 313: This material does not contain any chemical components with known CAS numbers that exceed the threshold (De Minimis) reporting levels established by SARA Title III, Section 313.

California Prop 65 This product does not contain any chemicals known to State of California to cause cancer, birth defects, or any other reproductive harm.

The components of this product are reported in the following inventories:

TSCA On TSCA Inventory
DSL This product contains one or several components that are not on the Canadian DSL nor NDSL.
AICS Not in compliance with the inventory
NZIoC Not in compliance with the inventory
PICCS Not in compliance with the inventory
IECSC Not in compliance with the inventory

Inventory Acronym and Validity Area Legend:

AICS (Australia), DSL (Canada), IECSC (China), REACH (European Union), ENCS (Japan), ISHL (Japan), KECI (Korea), NZIoC (New Zealand), PICCS (Philippines), TSCA (USA)

WHMIS Classification(s):

Class A - Compressed Gas
Class B5 - Flammable Aerosol
Class D2B - Skin/Eye Irritant


WHMIS Hazard Symbols:



SECTION 16. OTHER INFORMATION

Further information

NFPA:

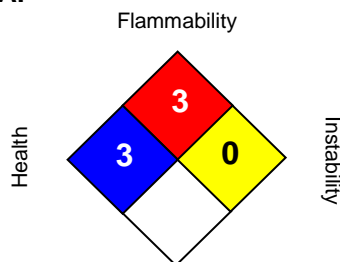

HMIS III:

HEALTH	3
FLAMMABILITY	3

0 = not significant, 1 =Slight,
2 = Moderate, 3 = High
4 = Extreme, * = Chronic

SAFETY DATA SHEET BRIGHTON DUST MOP/CLOTH TREATMENT

Version 1.0

Revision Date 06/25/2015

(BPR810A18-A)

OSHA GHS Label Information:

Hazard pictograms



Signal word

Hazard statements

Precautionary statements

: **Warning:**
: Flammable aerosol. Contains gas under pressure; may explode if heated. Causes skin irritation.
: **Prevention:** Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking. Do not spray on an open flame or other ignition source.
Pressurized container: Do not pierce or burn, even after use. Wash skin thoroughly after handling. Wear protective gloves.
Response: IF ON SKIN: Wash with plenty of soap and water. If skin irritation occurs: Get medical advice/ attention. Take off contaminated clothing and wash before reuse.
Storage: Protect from sunlight. Do not expose to temperatures exceeding 50 °C/ 122 °F.

Prepared By: Regulatory Specialist, Staples Brand Group, (508) 253-5000

Always follow label directions carefully when using this or any other chemical product. If information about this product is required, please contact Staples at 1-888-322-0912 or visit our website at www.staplesadvantage.com. Keep Safety Data Sheets filed and organized in an area accessible to workers according to all applicable regulations.

All information contained in this SDS is provided to the best of Staples Contract & Commercial Inc's knowledge. No warranty is made with respect to this information expressed or implied, including warranties of merchantability or fitness for a particular purpose. Users are responsible for verifying the information under their own operating conditions to determine whether the products listed in the SDS are suitable for their intended use. Users are responsible for compliance with all laws and regulations as may be required by their receipt of the information and use of the products provided with this SDS.

1045850