

Rye City School District
Districtwide Lead in Drinking Water
Sampling and Remediation Plan

2020



ENVIROSCIENCE
CONSULTANTS INC.

2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project # 20317

**Districtwide Lead in Drinking Water
Sampling and Remediation Plan**

Performed for:

**Rye City School District
555 Theodore Fremd Avenue
Suite B-101
Rye, NY 10580**

November 2020

Prepared by:

**Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191**

Project #20317

President



Glenn Neuschwender

Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

I. Executive Summary

II. Sampling Methodology

III. Initial Results

Appendix A – Midland School

Appendix B – Milton School

Appendix C – Osborn School

Appendix D – Rye High School and Rye Middle School

December 7, 2020

Robert Gimigliano
Rye City School District
555 Theodore Fremd Avenue
Suite B-100
Rye, NY 10580

I. Executive Summary

The Rye City School District has developed their 2020 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

Within the Rye City School District, the following locations have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Student bathroom sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Rye City School District were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks;
- 2) Art Room sinks;
- 3) Other classroom sinks;
- 4) Other Bathroom sinks;
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the District has placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Other classroom sinks - classrooms in this category often include elementary classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Bathroom sinks - in intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Procedures:

In accordance with the regulation, Enviroscience Consultants, Inc. performed initial water sampling throughout the Rye City School District from November 10-13, 2020. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more that 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.


Fixture Type Codes

BF	Bottle Filler
HB	Hose Bib
IM	Ice Machine
OS	Other Source
PF	Pot Filler
SK	Sink
SL	Supply Line
SP	Spigot
SPY	Spray
SS	Slop Sink
V	Valve
WC	Water Cooler
WF	Water Fountain

Source Designations

App	Applicable
N/A	Non-applicable

Sampling Location Schematics

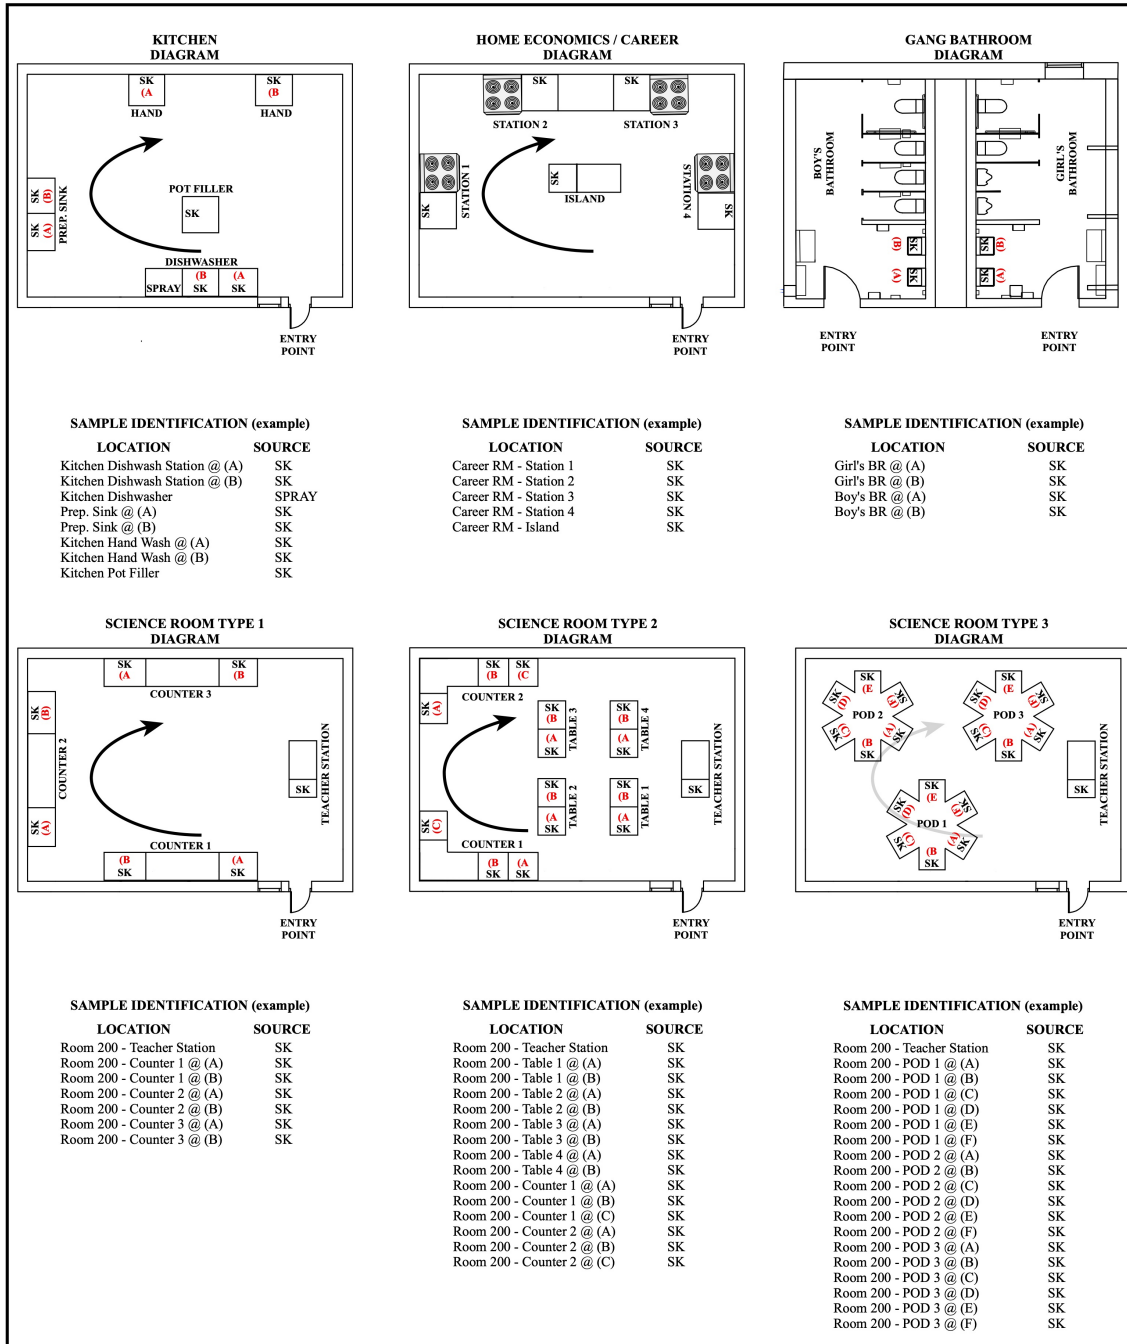

III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through D).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb, the remedial action taken and final results where applicable:

Midland School

Music Room 18	SK	70.1
Band Room 20 @ B	SK	53.7

Milton School

Faculty Room ES10 Women's Bathroom	SK	28.3
---------------------------------------	----	------

Osborn School

Kitchen 3-Bay @ A	SK	481
Kitchen 3-Bay @ B	SK	31.9
Room 1/2	SK	79.2

Rye Middle and High School

Room 111 Principals Office Bathroom	SK	21.2
Room 120 English Office Kitchenette	SK	15.4
2nd Fl. Kitchen Pot Filler	SP	44.3
Prep Room 458 @ A (by Room 460)	SK	30.7
Prep Room 458 @ B (by Room 456)	SK	35.9

Appendix A

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Serving Line Handwash	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1001-2	Kitchen 3 Bay	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1001-3	Kitchen Prep	SK	App	9.27	11/10/2020	-	-	-	None	-	-	-
1001-4	Kitchen Handwash	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1001-5	Kitchen Bathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1001-6	Kitchen Custodial Closet	SS	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1002-1	Cafeteria	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1002-2	Cafeteria	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1002-3	Cafeteria Handwash	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1002-4	Cafeteria Boy's Bathroom	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1002-5	Cafeteria Girl's Bathroom	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1003-1	Room 13C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1033-2	Room 13C	SPY	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1004-1	Unisex ADA Bsathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1005-1	Unisex Bathroom across from Room 14	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1006-1	Boy's Bathroom by Room 1 @ A	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1006-2	Boy's Bathroom by Room 1 @ B	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1007-1	Custodial Closet by Room 1	SS	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1008-1	Girl's Bathroom by Room 1 @ A	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1008-2	Girl's Bathroom by Room 1 @ B	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1009-1	Hall by Room 2	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1009-2	Hall by Room 2	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1010-1	Room 1	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1011-1	Room 2	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1012-1	Room 3	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1013-1	Room 4	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1014-1	Room 5	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1015-1	Room 6	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1016-1	Room 7	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1017-1	Room 8	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1018-1	Room 9	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1019-1	Room 10	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1020-1	Room 11	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1021-1	Girl's Bathroom by Room 14 @ A	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1021-2	Girl's Bathroom by Room 14 @ B	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1022-1	Custodial Closed by Room 14	SS	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1023-1	Hall by Room 14	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1023-2	Hall by Room 14	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1024-1	Isolation Room (Former Faculty Room)	SK	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1024-1	Isolation Room Bathroom	SK	App	1.13	11/10/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1025-1	Boy's Bathroom by Room 14 @A	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1025-2	Boy's Bathroom by Room 14 @ B	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1026-1	Music Room 18	SK	App	70.1	11/10/2020				Additional Sampling Required			
1027-1	Gym Storage/Office @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1027-2	Gym Storage/Office @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1028-1	Library Office	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-1	Band Room 20 @ A	SK	App	9.12	11/10/2020	-	-	-	None	-	-	-
1029-2	Band Room 20 @ B	SK	App	53.7	11/10/2020				Additional Sampling Required			
1030-1	Main Office Copy Room sink	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1030-2	Principal's Office Bathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-1	Hall by Main Lobby	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1031-2	Hall by Main Lobby	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1032-1	Girl's Bathroom by Main Lobby	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1033-1	Boy's Bathroom by Main Lobby	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1034-1	Hall by Room 24	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1034-2	Hall by Room 24	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1035-1	Room 19	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-1	Room 21	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1037-1	Room 24	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-1	Room 23	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1039-1	Room 26	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1040-1	Room 25	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1041-1	Room 28	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1042-1	Room 27	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1043-1	Room 30	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1044-1	Hall by Room 30	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1044-2	Hall by Room 30	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1045-1	Boy's Bathroom by Room 32 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1045-2	Boy's Bathroom by Room 32 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1046-1	Hall by Room 32	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1046-2	Hall by Room 32	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1047-1	Girl's Bathroom by Room 32 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1047-2	Girl's Bathroom by Room 32 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1048-1	Room 32	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1049-1	Room 36	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1050-1	Art Room 29 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1050-2	Art Room 29 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1051-1	Custodial Closet by Room 32	SS	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1052-1	Kindergarten Cut Through Hall	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-1	Room 40	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1054-1	Kindergarten Cut Through Hall Bathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1055-1	Room 52	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1056-1	Room 50/52 Bathroom	SK	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1057-1	Room 50	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1058-1	Room 48	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1059-1	Hall by Room 48	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1059-2	Hall by Room 48	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1060-1	Room 46	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1061-1	Room 44	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1062-1	Room 42	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1063-1	Nurse's Office	SK	App	3.36	11/10/2020	-	-	-	None	-	-	-
1063-2	Nurse's Office Bathroom	SK	N/A		11/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1064-1	Unisex Bathroom by Nurse's Office	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1065-1	Portable 1 Bathroom - left	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1065-2	Portable 1 Bathroom - right	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1066-1	Portable 2 Bathroom - left	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1066-2	Portable 2 Bathroom - right	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1067-1	Portable 3 Bathroom - left	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1067-2	Portable 3 Bathroom - right	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1068-1	Portable 4 Bathroom - left	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1068-2	Portable 4 Bathroom - right	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2204509-16169

November 13, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Midland Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on November 10, 2020. New York Environmental analyzed the samples on November 12, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	10 Nov 2020
Date Received:	10 Nov 2020
Date Analyzed:	12 Nov 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201110N139	1	Kitchen Prep-SK; Initial	1.00	9.27	µg/L	
201110N140	2	Cafeteria -BF; Initial	1.00	<1.00	µg/L	
201110N141	3	Hall by Room 2-BF; Initial	1.00	<1.00	µg/L	
201110N142	4	Hall by Room 14-BF; Initial	1.00	<1.00	µg/L	
201110N143	5	Isolation Room (Former Faculty Room)-SK; Initial	1.00	<1.00	µg/L	
201110N144	6	Isolation Room Bathroom-SK; Initial	1.00	1.13	µg/L	
201110N145	7	Music Room 18-SK; Initial	1.00	70.1	µg/L	E,H
201110N146	8	Band Room 20 @ A-SK; Initial	1.00	9.12	µg/L	
201110N147	9	Band Room 20 @ B-SK; Initial	1.00	53.7	µg/L	E,H
201110N148	10	Hall by Main Lobby-BF; Initial	1.00	<1.00	µg/L	
201110N149	11	Hall by Room 24-BF; Initial	1.00	<1.00	µg/L	
201110N150	12	Hall by Room 30-BF; Initial	1.00	<1.00	µg/L	
201110N151	13	Room 50/52 Bathroom-SK; Initial	1.00	<1.00	µg/L	
201110N152	14	Hall by Room 48-BF; Initial	1.00	<1.00	µg/L	
201110N153	15	Nurse's Office-SK; Initial	1.00	3.36	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix B

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2001-1	Hall by Room 202 (Right)	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
2001-2	Hall by Room 202 (Left)	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
2002-1	Room 201	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
2003-1	Room 202	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
2004-1	Room 203	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
2005-1	Room 204A	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
2006-1	Room 206	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
2007-1	Room 205	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
2008-1	Room 207	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
2009-1	Hall by Room 207 (Left) Bottle Filler	BF	App	<1.0	11/13/2020	-	-	-	None	-	-	-
2009-2	Hall by Room 207 (Right)	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
2010-1	Boys Bathroom by Room 207 @ A	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2010-2	Boys Bathroom by Room 207 @ B	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2010-3	Boys Bathroom by Room 207 @ C	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2011-1	Custodial Closet by Room 207	SS	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
2012-1	Girls Bathroom by Room 207 @ A	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2012-2	Girls Bathroom by Room 207 @ B	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2013-1	Womens Bathroom by Room 208	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2014-1	Room 208	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
2015-1	Mens Bathroom by Room 208	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2016-1	Room 210	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
2017-1	Hall by Room 209	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
2018-1	Room 209	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
2019-1	Room 211	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
2020-1	Room 213	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1001-1	Art Room 110 @ A (Left)	SK	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
1001-2	Art Room 110 @ B (Left Middle)	SK	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
1001-3	Art Room 110 @ C (Righ Middle)	SK	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
1001-4	Art Room 110 @ D (Right)	SK	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
1002-1	Media Center 114 Storage Closet	SK	N/A		11/13/2020	-	-	-	None	Removed From Service	-	-
1003-1	Mens Bathroom by Room 109	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1004-1	Room 108	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1005-1	Womens Bathroom by Room 108	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1006-1	Girls Bathroom by Room 108 @ A	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1006-2	Girls Bathroom by Room 108 @ B	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1006-3	Girls Bathroom by Room 108 @ C	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1007-1	Custodial Closet by Room 108	SS	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
1008-1	Boys Bathroom by Room 108 @ A	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1008-2	Boys Bathroom by Room 108 @ B	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1008-3	Boys Bathroom by Room 108 @ C	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1009-1	Hall by Room 107 (Right)	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
1009-2	Hall by Room 107 (Left)	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
1010-1	Room 107	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1011-1	Room 105	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1012-1	Room 104	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1013-1	Room 103	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1014-1	Room 102	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1015-1	Room 101	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1016-1	Hall by Room 101 (Right)	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
1016-2	Hall by Room 101 (Left)	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
0001-1	Hall by Nurses Office (Left)	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
0001-2	Hall by Nurses Office (Right)	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
0001-3	Hall by Nurses Office (Right) Bottle Filler	BF	App	<1.0	11/13/2020	-	-	-	None	-	-	-
0002-1	Womens Bathroom by Nurses Office	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0003-1	Mens Bathroom by Nurses Office	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0004-1	Nurses Office	SK	App		11/13/2020	-	-	-	None	SIGN	-	-
0004-2	Nurses Office Storage Closet Fridge	SP	App	<1.0	11/13/2020	-	-	-	None	-	-	-
0004-3	Nurses Office Bathroom	SK	App	<1.0	11/13/2020	-	-	-	None	SIGN	-	-
0005-1	Kitchen Handwash @ A	SK	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
0005-2	Kitchen Prep	SK	App	5.45	11/13/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0005-3	Kitchen Handwash @ B	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0005-4	Kitchen 3 Bay (Left)	SK	App	2.73	11/13/2020	-	-	-	None	-	-	-
0005-5	Kitchen 3 Bay (Right)	SPY	App	8.91	11/13/2020	-	-	-	None	-	-	-
0005-6	Kitchen Custodial Area	SS	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
0005-7	Kitchen Bathroom	SK	App		11/13/2020	-	-	-	None	-	-	-
0006-1	Girls Bathroom by Kitchen @ A	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0006-2	Girls Bathroom by Kitchen @ B	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0006-3	Girls Bathroom by Kitchen @ C	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0007-1	Boys Bathroom by Kitchen @ A	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0007-2	Boys Bathroom by Kitchen @ B	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0007-3	Boys Bathroom by Kitchen @ C	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0008-1	Room G-02	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
0008-2	Room G-02	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0008-3	Room G-02 Bathroom	SK	App	1.66	11/13/2020	-	-	-	None	-	-	-
0009-1	Main Office Bathroom	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0010-1	Room G-03	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
0010-2	Room G-03	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0010-3	Room G-03 Bathroom	SK	App	4.36	11/13/2020	-	-	-	None	SIGN	-	-
0011-1	Room G-04	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
0011-2	Room G-04	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0011-3	Room G-04 Bathroom	SK	App	2.01	11/13/2020	-	-	-	None	SIGN	-	-
0012-1	Boys Bathroom by Room G-04 @ A	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
0012-2	Boys Bathroom by Room G-04 @ B	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
0012-3	Boys Bathroom by Room G-04 @ C	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
0012-4	Boys Bathroom by Room G-04 @ D	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
0013-1	Custodial Closet by Room G-04	SS	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
0014-1	Girls Bathroom by Room G-04 @ A	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
0014-2	Girls Bathroom by Room G-04 @ B	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
0015-1	Boiler Room	SS	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
0016-1	Hall by Room ES1	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
0017-1	Room ES1	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
0017-2	Room ES1 Bathroom	SK	App	<1.0	11/13/2020	-	-	-	None	-	-	-
0018-1	Faculty Room ES10	SK	App	<1.0	11/13/2020	-	-	-	None	-	-	-
0018-2	Faculty Room ES10 Mens Bathroom	SK	App	6.8	11/13/2020	-	-	-	None	SIGN	-	-
0018-3	Faculty Room ES10 Womens Bathroom	SK	App	28.3	11/13/2020				Sign Required			
0019-1	Room ES9	SK	N/A		11/13/2020	-	-	-	Sign Required	-	-	-

Laboratory Report

NYE Report #: 2204543-16183

November 16, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Milton Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on November 13, 2020. New York Environmental analyzed the samples on November 16, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	13 Nov 2020
Date Received:	13 Nov 2020
Date Analyzed:	16 Nov 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201113L001	1	Hall by Room 207 (Left) Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201113L002	2	Hall by Nurses Office (Right) Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201113L003	3	Nurses Office-SK; Initial	1.00	1.01	µg/L	
201113L004	4	Nurses Office Storage Closet Fridge-SP; Initial	1.00	<1.00	µg/L	
201113L005	5	Nurses Office Bathroom-SK; Initial	1.00	<1.00	µg/L	
201113L006	6	Kitchen Prep -SK; Initial	1.00	5.45	µg/L	
201113L007	7	Kitchen 3 Bay (Left)-SK; Initial	1.00	2.73	µg/L	
201113L008	8	Kitchen 3 Bay (Right)-SPY; Initial	1.00	8.91	µg/L	
201113L009	9	Room G-02 Bathroom-SK; Initial	1.00	1.66	µg/L	
201113L010	10	Room G-03 Bathroom-SK; Initial	1.00	4.36	µg/L	
201113L011	11	Room G-04 Bathroom-SK; Initial	1.00	2.01	µg/L	
201113L012	12	Room ES1 Bathroom-SK; Initial	1.00	<1.00	µg/L	
201113L013	13	Faculty Room ES10-SK; Initial	1.00	<1.00	µg/L	
201113L014	14	Faculty Room ES10 Mens Bathroom-SK; Initial	1.00	6.80	µg/L	
201113L015	15	Faculty Room ES10 Womens Bathroom-SK; Initial	1.00	28.3	µg/L	H

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Bathroom	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1001-2	Kitchen Handwash	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1001-3	Kitchen Prep	SK	App	7.13	11/13/2020	-	-	-	None	SIGN	-	-
1001-4	Kitchen Prep	SPY	App	5.69	11/13/2020	-	-	-	None	SIGN	-	-
1001-5	Kitchen 3-Bay @ A	SK	App	481	11/13/2020				Additional Sampling Required			
1001-6	Kitchen 3-Bay @ B	SK	App	31.9	11/13/2020				Additional Sampling Required			
1002-1	Faculty Room	SK	App	4.86	11/13/2020	-	-	-	None	-	-	-
1003-1	Faculty Bathroom by Faculty Room	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1004-1	Hall by Faculty Room	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
1004-2	Hall by Faculty Room	BF	App	<1.0	11/13/2020	-	-	-	None	-	-	-
1005-1	Faculty Bathroom by Gym	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1006-1	Custodial Closet by Gym	SS	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
1007-1	Gym Coach's Office Bathroom	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1008-1	Boy's Bathroom by Media Center @ A	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1008-2	Boy's Bathroom by Media Center @ B	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1008-3	Boy's Bathroom by Media Center @ C	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1009-1	Custodial Closet by Media Center	SS	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
1010-1	Hall by Media Center	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
1010-2	Hall by Media Center	BF	App	<1.0	11/13/2020	-	-	-	None	-	-	-
1011-1	Girl's Bathroom by Media Center @ A	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1011-2	Girl's Bathroom by Media Center @ B	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1011-3	Girl's Bathroom by Media Center @ C	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1011-4	Girl's Bathroom by Media Center @ D	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1012-1	Room 4	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1013-1	Room 5	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1014-1	Room 6	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1015-1	Room 7	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1016-1	Room 8	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1017-1	Room 9	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1018-1	Room 10	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1019-1	Room 11	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1020-1	Room 12	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1021-1	Room 13	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1022-1	Media Center	SK	App	12	11/13/2020	-	-	-	None	SIGN	-	-
1023-1	Faculty Bathroom by Computer Room	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1024-1	Custodial Closet by Computer Room	SS	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
1025-1	Boy's Bathroom by Computer Room @ A	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1025-2	Boy's Bathroom by Computer Room @ B	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1026-1	Hall by Computer Room	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
1026-2	Hall by Computer Room	BF	App	<1.0	11/13/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1027-1	Girl's Bathroom by Computer Room @ A	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1027-2	Girl's Bathroom by Computer Room @ B	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1027-3	Girl's Bathroom by Computer Room @ C	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1028-1	Room 16	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1029-1	Room 17	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1030-1	Room 18	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1031-1	Room 19	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1032-1	Room 20	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1033-1	Room 21	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1034-1	Room 22	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1035-1	Room 23	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1036-1	Boy's Bathroom by Room 29 @ A	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1036-2	Boy's Bathroom by Room 29 @ B	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1036-3	Boy's Bathroom by Room 29 @ C	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1036-4	Boy's Bathroom by Room 29 @ D	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1037-1	Custodial Closet by Room 29	SS	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
1038-1	Hall by Room 29 Left	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
1038-2	Hall by Room 29 Right	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
1039-1	Girl's Bathroom by Room 29 @ A	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1039-2	Girl's Bathroom by Room 29 @ B	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1039-3	Girl's Bathroom by Room 29 @ C	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1039-4	Girl's Bathroom by Room 29 @ D	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1040-1	Band Room	SK	App	5.2	11/13/2020	-	-	-	None	SIGN	-	-
1041-1	Orchestra Room	SK	App	13.3	11/13/2020	-	-	-	None	SIGN	-	-
1042-1	Room 31	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1043-1	Bathroom by Room 31/33	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1044-1	Room 33	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1045-1	Room 32 Left	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1045-2	Room 32 Right	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1045-3	Room 32 Bathroom	SK	App	6.01	11/13/2020	-	-	-	None	SIGN	-	-
1046-1	Hall by Room 32	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
1046-2	Hall by Room 32	BF	App	<1.0	11/13/2020	-	-	-	None	-	-	-
1047-1	Room 34 Left	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1047-2	Room 34 Right	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1047-3	Room 34 Bathroom	SK	N/A	12.4	11/13/2020	-	-	-	None	SIGN	-	-
1048-1	Room 35	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1049-1	Bathroom by Room 35/36	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1050-1	Room 36	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1051-1	Room P1 Bathroom	SK	N/A	<1.0	11/13/2020	-	-	-	None	SIGN	-	-
1052-1	Room P2 Bathroom	SK	N/A	<1.0	11/13/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1053-1	Room P3 Bathroom	SK	N/A	<1.0	11/13/2020	-	-	-	None	SIGN	-	-
1054-1	Room P4 Bathroom	SK	N/A	1.17	11/13/2020	-	-	-	None	SIGN	-	-
1055-1	Room 42	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1056-1	Hall by Room 42	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
1056-2	Hall by Room 42	BF	App	<1.0	11/13/2020	-	-	-	None	-	-	-
1057-1	Room 41	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1058-1	Room 40	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1059-1	Room 39	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1060-1	Room 38	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1061-1	Hall by Room 38	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
1061-2	Hall by Room 38	BF	App	<1.0	11/13/2020	-	-	-	None	-	-	-
1062-1	Isolation Room	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1063-1	Nurse's Office	SK	N/A		11/13/2020	-	-	-	Mixed Valve Sampling Not Required	SIGN	-	-
1063-2	Nurse's Office Bathroom	SK	App	3.28	11/13/2020	-	-	-	None	SIGN	-	-
1064-1	Bathroom by Psychologist	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1065-1	Main Office Work Room	SK	App	11.1	11/13/2020	-	-	-	None	SIGN	-	-
1066-1	Custodial Closet by Room 3	SS	N/A		11/13/2020	-	-	-	Sign Required	-	-	-
1067-1	Room 3	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1067-2	Room 3 Unit @ A	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1067-3	Room 3 Unit @ B	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1067-4	Room 3 Unit @ C	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1068-1	Hall by Gym	WF	App		11/13/2020	-	-	-	None	Removed From Service	-	-
1068-2	Hall by Gym	BF	App	<1.0	11/13/2020	-	-	-	None	-	-	-
1069-1	Room 2 Unit 1 @ A	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1069-2	Room 2 Unit 1 @ B	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1069-3	Room 2 Unit 1 @ C	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1069-4	Room 2 Unit 2 @ A	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1069-5	Room 2 Unit 2 @ B	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1069-6	Room 2 Unit 2 @ C	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-
1069-7	Room 2 Bathroom	SK	App	8.94	11/13/2020	-	-	-	None	SIGN	-	-
1070-1	Room 1/2	SK	App	79.2	11/13/2020				Sign Required	SIGN		
1070-2	Room 1/2 Bathroom	SK	App	3.97	11/13/2020	-	-	-	None	SIGN	-	-
1071-1	Room 1	SK	N/A		11/13/2020	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2204544-16184

November 16, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Osborn Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on November 13, 2020. New York Environmental analyzed the samples on November 16, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	13 Nov 2020
Date Received:	13 Nov 2020
Date Analyzed:	16 Nov 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201113L016	1	Kitchen Prep-SK; Initial	1.00	7.13	µg/L	
201113L017	2	Kitchen Prep-SPY; Initial	1.00	5.69	µg/L	
201113L018	3	Kitchen 3-Bay @ A-SK; Initial	1.00	481	µg/L	E,H
201113L019	4	Kitchen 3-Bay @ B-SK; Initial	1.00	31.9	µg/L	H
201113L020	5	Faculty Room-SK; Initial	1.00	4.86	µg/L	
201113L021	6	Hall by Faculty Room-BF; Initial	1.00	<1.00	µg/L	
201113L022	7	Hall by Media Center-BF; Initial	1.00	<1.00	µg/L	
201113L023	8	Media Center-SK; Initial	1.00	12.0	µg/L	
201113L024	9	Hall by Computer Room-BF; Initial	1.00	<1.00	µg/L	
201113L025	10	Band Room-SK; Initial	1.00	5.20	µg/L	
201113L026	11	Orchestra Room-SK; Initial	1.00	13.3	µg/L	
201113L027	12	Room 32 Bathroom-SK; Initial	1.00	6.01	µg/L	
201113L028	13	Hall by Room 32-BF; Initial	1.00	<1.00	µg/L	
201113L029	14	Room 34 Bathroom-SK; Initial	1.00	12.4	µg/L	
201113L030	15	Room P1 Bathroom-SK; Initial	1.00	<1.00	µg/L	
201113L031	16	Room P2 Bathroom-SK; Initial	1.00	<1.00	µg/L	
201113L032	17	Room P3 Bathroom-SK; Initial	1.00	<1.00	µg/L	
201113L033	18	Room P4 Bathroom-SK; Initial	1.00	1.17	µg/L	
201113L034	19	Hall by Room 42-BF; Initial	1.00	<1.00	µg/L	
201113L035	20	Hall by Room 38-BF; Initial	1.00	<1.00	µg/L	
201113L036	21	Nurse's Office Bathroom-SK; Initial	1.00	3.28	µg/L	
201113L037	22	Main Office Work Room-SK; Initial	1.00	11.1	µg/L	
201113L038	23	Hall by Gym-BF; Initial	1.00	<1.00	µg/L	
201113L039	24	Room 2 Bathroom-SK; Initial	1.00	8.94	µg/L	
201113L040	25	Room 1/2-SK; Initial	1.00	79.2	µg/L	E,H
201113L041	26	Room 1/2 Bathroom-SK; Initial	1.00	3.97	µg/L	



Date Collected:	13 Nov 2020
Date Received:	13 Nov 2020
Date Analyzed:	16 Nov 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID **CID** **Sample Location/Description** **LOQ** **Result** **Units** **Flag**

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix D

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Custodial Office Bathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1002-1	Bathroom by Boiler Room	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1003-1	Custodial Closet by Boiler Room	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
1004-1	Room 111 Principal's Office Kitchenette	SK	App	2.62	11/10/2020	-	-	-	None	-	-	-
1004-2	Room 111 Principal's Office Bathroom	SK	App	21.2	11/10/2020				Sign Required			
1005-1	Hall by Room 111 Principal's Office	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1006-1	Assistant Principal's Office Bathroom	SK	App	2.64	11/10/2020	-	-	-	None	-	-	-
1007-1	Boys Bathroom by Assistant Principal's Office @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1007-2	Boys Bathroom by Assistant Principal's Office @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1008-1	Girls Bathroom by Assistant Principal's Office @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1008-2	Girls Bathroom by Assistant Principal's Office @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1008-3	Girls Bathroom by Assistant Principal's Office @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1009-1	Faculty Women's Bathroom by Auditorium #1	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1009-2	Faculty Women's Bathroom by Auditorium #2	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1010-1	Faculty Men's Bathroom by Auditorium #1	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1010-2	Faculty Men's Bathroom by Auditorium #2	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1011-1	Hall by Room 102	WF	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1012-1	Room 118 Nurses Office	SK	App	3.31	11/10/2020	-	-	-	None	-	-	-
1012-2	Room 118 Nurses Office Bathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1013-1	Room 120 English Office Kitchenette	SK	App	15.4	11/10/2020				Sign Required			
1014-1	Media Center/Library Office	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1015-1	Hall by Room 192 Nurses Office	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1015-2	Hall by Room 192 Nurses Office Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1016-1	Room 192 Nurses Office	SK	App	4.1	11/10/2020	-	-	-	None	-	-	-
1017-1	Women's Bathroom 188 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1017-2	Women's Bathroom 188 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1017-3	Women's Bathroom 188 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1018-1	Auditorium Stage Wood Shop	SS	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1019-1	Band Room 185	SK	App	1.98	11/10/2020	-	-	-	None	-	-	-
1020-1	Boys Bathroom by Gym @ A	SK	App	1.41	11/10/2020	-	-	-	None	-	-	-
1020-2	Boys Bathroom by Gym @ B	SK	App	1.05	11/10/2020	-	-	-	None	-	-	-
1021-1	Hall by Boys Bathroom by Gym	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1021-2	Hall by Boys Bathroom by Gym Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1022-1	Hall by Girls Bathroom by Gym	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1022-2	Hall by Girls Bathroom by Gym Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1023-1	Girls Bathroom by Gym @ A	SK	App	6.58	11/10/2020	-	-	-	None	-	-	-
1023-2	Girls Bathroom by Gym @ B	SK	App	3.88	11/10/2020	-	-	-	None	-	-	-
1023-3	Girls Bathroom by Gym @ C	SK	App		11/10/2020	-	-	-	Hot Water Only Sign Required	-	-	-
1024-1	Women's Bathroom by Room 412 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1024-2	Women's Bathroom by Room 412 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1025-1	Custodial Closet 418	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
1026-1	Men's Bathroom by Room 412 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1026-2	Men's Bathroom by Room 412 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1027-1	Work Room Faculty Bathroom 412	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1028-1	Hall by Room 411	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1028-2	Hall by Room 411 Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1029-1	Science Room 411 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-2	Science Room 411 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-3	Science Room 411 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-4	Science Room 411 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-5	Science Room 411 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-6	Science Room 411 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-7	Science Room 411 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-8	Science Room 411 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-9	Science Room 411 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-10	Science Room 411 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-11	Science Room 411 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-12	Science Room 411 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-13	Science Room 411 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1029-14	Science Room 411 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1030-1	Prep Room 409 @ A (by Room 411)	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1030-2	Prep Room 409 @ B (by Room 407)	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-1	Science Room 407 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1031-2	Science Room 407 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-3	Science Room 407 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-4	Science Room 407 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-5	Science Room 407 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-6	Science Room 407 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-7	Science Room 407 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-8	Science Room 407 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-9	Science Room 407 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-10	Science Room 407 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-11	Science Room 407 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-12	Science Room 407 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-13	Science Room 407 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1031-14	Science Room 407 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-1	Science Room 410 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-2	Science Room 410 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-3	Science Room 410 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-4	Science Room 410 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-5	Science Room 410 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-6	Science Room 410 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-7	Science Room 410 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-8	Science Room 410 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1032-9	Science Room 410 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-10	Science Room 410 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-11	Science Room 410 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-12	Science Room 410 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-13	Science Room 410 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1032-14	Science Room 410 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1033-1	Prep Room 408 @ A (by Room 410)	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1033-2	Prep Room 408 @ B (by Room 406)	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-1	Science Room 406 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-2	Science Room 406 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-3	Science Room 406 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-4	Science Room 406 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-5	Science Room 406 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-6	Science Room 406 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-7	Science Room 406 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-8	Science Room 406 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-9	Science Room 406 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-10	Science Room 406 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-11	Science Room 406 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-12	Science Room 406 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1034-13	Science Room 406 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1035-1	Hall by Room 406	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1035-2	Hall by Room 406 Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1036-1	Science Room 405 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-2	Science Room 405 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-3	Science Room 405 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-4	Science Room 405 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-5	Science Room 405 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-6	Science Room 405 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-7	Science Room 405 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-8	Science Room 405 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-9	Science Room 405 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-10	Science Room 405 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-11	Science Room 405 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-12	Science Room 405 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-13	Science Room 405 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1036-14	Science Room 405 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1037-1	Prep Room 403 @ A (by Room 405)	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1037-2	Prep Room 403 @ B (by Room 401)	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-1	Science Room 401 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-2	Science Room 401 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-3	Science Room 401 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1038-4	Science Room 401 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-5	Science Room 401 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-6	Science Room 401 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-7	Science Room 401 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-8	Science Room 401 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-9	Science Room 401 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-10	Science Room 401 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-11	Science Room 401 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-12	Science Room 401 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-13	Science Room 401 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1038-14	Science Room 401 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1039-1	Gym Vestibule by Boys Locker Room @ A	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1039-2	Gym Vestibule by Boys Locker Room @ B	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1040-1	Auxiliary Gym Men's Bathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1041-1	Auxiliary Gym Women's Bathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1042-1	Auxiliary Gym Office	IM	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1043-1	Boys Locker Room Storage Closet Bathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1043-2	Boys Locker Room Custodial Closet	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
1043-3	Boys Locker Room Bathroom @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1043-4	Boys Locker Room Bathroom @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1043-5	Boys Locker Room Bathroom @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1043-6	Boys Locker Room (Right)	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1043-7	Boys Locker Room (Right) Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1043-8	Boys Locker Room (Left)	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1043-9	Boys Locker Room PE Office 173A Bathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1044-1	Hall by Room 178	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1044-2	Hall by Room 178 Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1045-1	Tutoring Center Room 178 Women's Bathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1046-1	Tutoring Center Room 178 Men's Bathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1047-1	Art Room 171 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1047-2	Art Room 171 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1047-3	Art Room 171 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1047-4	Art Room 171 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1048-1	Art Room 169 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1048-2	Art Room 169 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1048-3	Art Room 169 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1048-4	Art Room 169 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1049-1	Room 167A @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1049-2	Room 167A @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1050-1	Room 167 Dark Room #1	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1050-2	Room 167 Dark Room #2 Trough @ A	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1050-3	Room 167 Dark Room #2 Trough @ B	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1051-1	Room 165 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1051-2	Room 165 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1051-3	Room 165 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1051-4	Room 165 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1052-1	Room 163 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1052-2	Room 163 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1052-3	Room 163 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-1	Science Room 142 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-2	Science Room 142 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-3	Science Room 142 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-4	Science Room 142 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-5	Science Room 142 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-6	Science Room 142 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-7	Science Room 142 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-8	Science Room 142 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-9	Science Room 142 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-10	Science Room 142 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-11	Science Room 142 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-12	Science Room 142 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1053-13	Science Room 142 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1054-1	Art Room 162 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1054-2	Art Room 162 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1055-1	Technology Room 161	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1056-1	Women's Bathroom by Room 143	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1057-1	Hall by Room 143	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1057-2	Hall by Room 143 Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1058-1	Men's Bathroom by Room 143	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1059-1	Room 145 Middle School Teacher's Lounge	SK	App	2.09	11/10/2020	-	-	-	None	-	-	-
1060-1	Girls Bathroom by Room 136 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1060-2	Girls Bathroom by Room 136 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1060-3	Girls Bathroom by Room 136 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1060-4	Girls Bathroom by Room 136 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1061-1	Hall by Middle School Gym	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1061-2	Hall by Middle School Gym Bottle Filler	BF	App	1.19	11/10/2020	-	-	-	None	-	-	-
1062-1	Middle School Café Custodial Closet	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
1062-2	Middle School Café	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1062-3	Middle School Café	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1062-4	Middle School Café Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1063-1	Middle School Kitchen 1 Bay	SK	App	1.42	11/10/2020	-	-	-	None	-	-	-
1063-2	Middle School Kitchen 3 Bay	SK	App	1.75	11/10/2020	-	-	-	None	-	-	-
1063-3	Middle School Kitchen Handwash	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1063-4	Middle School Kitchen Bathroom	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1064-1	Girls Bathroom by Middle School Café	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1065-1	Boys Bathroom by Middle School Café	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1066-1	Custodial Closet by Middle School Gym	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
1067-1	Middle School Room 130 Nurses Office	SK	App	4.93	11/10/2020	-	-	-	None	-	-	-
1067-2	Middle School Room 130 Nurses Office Bathroom	SK	App	8.12	11/10/2020	-	-	-	None	-	-	-
1068-1	Middle School Boys Locker Room Coaches Bathroom	SK	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1068-2	Middle School Boys Locker Room Bathroom @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1068-3	Middle School Boys Locker Room Bathroom @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
1068-4	Middle School Boys Locker Room	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1068-5	Middle School Boys Locker Room Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1069-1	Hall by Room 125A	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1069-2	Hall by Room 125A Bathroom	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1070-1	Hall by Room 152	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
1070-2	Hall by Room 152 Bathroom	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
1071-1	Custodial Closet by Room 152	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
2001-1	2nd Fl. Kitchen Handwash @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2001-2	2nd Fl. Kitchen Ice Machine	IM	App	<1.0	11/10/2020	-	-	-	None	-	-	-
2001-3	2nd Fl. Kitchen Handwash @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2001-4	2nd Fl. Kitchen Island by Stove	SK	App	14.5	11/10/2020	-	-	-	None	-	-	-
2001-5	2nd Fl. Kitchen Pot Filler	SP	App	44.3	11/10/2020				Additional Sampling Required			
2001-6	2nd Fl. Kitchen Steamer Oven	ST	App	<1.0	11/10/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2001-7	2nd Fl. Kitchen Custodian Bucket Filler	SS	N/A		11/10/2020	-	-	-	Sign Required	-	-	-
2001-9	2nd Fl. Kitchen 3 Bay @ A	SK	App	2.34	11/10/2020	-	-	-	None	-	-	-
2001-9	2nd Fl. Kitchen 3 Bay @ A	SPY	App	2.09	11/10/2020	-	-	-	None	-	-	-
2001-10	2nd Fl. Kitchen 3 Bay @ B	SK	App	<1.0	11/10/2020	-	-	-	None	-	-	-
2001-11	2nd Fl. Kitchen Island by Windows	SK	App	3.23	11/10/2020	-	-	-	None	-	-	-
2002-1	Hall by Room 204	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
2002-2	Hall by Room 204 Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
2003-1	Room 204 Faculty Room	SK	App	3.09	11/10/2020	-	-	-	None	-	-	-
2004-1	Custodial Closet by Room 202	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
2005-1	Men's Bathroom 251 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2005-2	Men's Bathroom 251 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2005-3	Men's Bathroom 251 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2006-1	Unisex ADA Bathroom by Room 200	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2007-1	Room 200 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2007-2	Room 200 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2007-3	Room 200 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2008-1	Room 250	SK	App	1.88	11/10/2020	-	-	-	None	-	-	-
2009-1	Boys Bathroom by Room 246 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2009-2	Boys Bathroom by Room 246 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2010-1	Girls Bathroom by Room 246 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2010-2	Girls Bathroom by Room 246 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2010-3	Girls Bathroom by Room 246 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2011-1	Unisex ADA Bathroom by Room 246	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2012-1	Hall by Room 246	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
2012-2	Hall by Room 246 Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
2013-1	Custodial Closet by Room 246A	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
2014-1	Women's Bathroom by Room 461 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2014-2	Women's Bathroom by Room 461 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2015-1	Custodial Closet 468	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
2016-1	Men's Bathroom by Room 461 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2016-2	Men's Bathroom by Room 461 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2017-1	Hall by Room 461	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
2017-2	Hall by Room 461 Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
2018-1	Science Room 461 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2018-2	Science Room 461 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2018-3	Science Room 461 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2018-4	Science Room 461 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2018-5	Science Room 461 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2018-6	Science Room 461 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2018-7	Science Room 461 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2018-8	Science Room 461 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2018-9	Science Room 461 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-10	Science Room 461 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2018-11	Science Room 461 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2018-12	Science Room 461 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2018-13	Science Room 461 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2018-14	Science Room 461 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2019-1	Prep Room 459 @ A (by Room 461)	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2019-2	Prep Room 459 @ B (by Room 457)	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-1	Science Room 457 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-2	Science Room 457 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-3	Science Room 457 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-4	Science Room 457 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-5	Science Room 457 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-6	Science Room 457 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-7	Science Room 457 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-8	Science Room 457 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-9	Science Room 457 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-10	Science Room 457 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-11	Science Room 457 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-12	Science Room 457 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-13	Science Room 457 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2020-14	Science Room 457 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2021-1	Science Room 460 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-2	Science Room 460 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-3	Science Room 460 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-4	Science Room 460 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-5	Science Room 460 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-6	Science Room 460 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-7	Science Room 460 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-8	Science Room 460 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-9	Science Room 460 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-10	Science Room 460 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-11	Science Room 460 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-12	Science Room 460 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-13	Science Room 460 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2021-14	Science Room 460 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2022-1	Prep Room 458 @ A (by Room 460)	SK	App	30.7	11/10/2020				Sign Required			
2022-2	Prep Room 458 @ B (by Room 456)	SK	App	35.9	11/10/2020				Sign Required			
2023-1	Science Room 456 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2023-2	Science Room 456 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2023-3	Science Room 456 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2023-4	Science Room 456 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2023-5	Science Room 456 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2023-6	Science Room 456 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2023-7	Science Room 456 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2023-8	Science Room 456 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2023-9	Science Room 456 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2023-10	Science Room 456 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2023-11	Science Room 456 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2023-12	Science Room 456 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2023-13	Science Room 456 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2023-14	Science Room 456 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-1	Science Room 455 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-2	Science Room 455 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-3	Science Room 455 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-4	Science Room 455 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-5	Science Room 455 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-6	Science Room 455 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-7	Science Room 455 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-8	Science Room 455 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-9	Science Room 455 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-10	Science Room 455 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-11	Science Room 455 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-12	Science Room 455 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2024-13	Science Room 455 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2024-14	Science Room 455 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2025-1	Prep Room 453 @ A (by Room 455)	SK	App	3.51	11/10/2020	-	-	-	None	-	-	-
2025-2	Prep Room 453 @ B (by Room 451)	SK	App	6.58	11/10/2020	-	-	-	None	-	-	-
2026-1	Science Room 451 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-2	Science Room 451 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-3	Science Room 451 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-4	Science Room 451 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-5	Science Room 451 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-6	Science Room 451 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-7	Science Room 451 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-8	Science Room 451 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-9	Science Room 451 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-10	Science Room 451 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-11	Science Room 451 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-12	Science Room 451 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-13	Science Room 451 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2026-14	Science Room 451 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2027-1	Hall by Room 456	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
2027-2	Hall by Room 456 Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
2028-1	2nd Fl. Girls Locker Room Coaches Office Bathroom	SK	App	1.03	11/10/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2028-2	2nd Fl. Girls Locker Room Bathroom @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2028-3	2nd Fl. Girls Locker Room Bathroom @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2028-4	2nd Fl. Girls Locker Room Bathroom @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2028-5	2nd Fl. Girls Locker Room (Left)	WF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
2028-6	2nd Fl. Girls Locker Room (Right)	WF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
2028-7	2nd Fl. Girls Locker Room (Right) Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
2029-1	Hall by Room 233	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
2029-2	Hall by Room 233 Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
2030-1	Custodial Closet by Room 233	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
2031-1	Science Room 231 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2031-2	Science Room 231 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2031-3	Science Room 231 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2031-4	Science Room 231 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2031-5	Science Room 231 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2031-6	Science Room 231 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2031-7	Science Room 231 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2031-8	Science Room 231 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2031-9	Science Room 231 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2031-10	Science Room 231 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2031-11	Science Room 231 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2031-12	Science Room 231 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2031-13	Science Room 231 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2031-14	Science Room 231 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2032-1	Prep Room by Room 231	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2032-2	Prep Room by Room 231 Fume Hood	SP	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-1	Science Room 229 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-2	Science Room 229 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-3	Science Room 229 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-4	Science Room 229 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-5	Science Room 229 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-6	Science Room 229 @ E	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-7	Science Room 229 @ F	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-8	Science Room 229 @ G	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-9	Science Room 229 @ H	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-10	Science Room 229 @ I	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-11	Science Room 229 @ J	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-12	Science Room 229 @ K	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2033-13	Science Room 229 @ L	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2034-1	Hall by Room 227	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
2034-2	Hall by Room 227 Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-
2035-1	Men's Faculty Bathroom by Room 218	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2036-1	Custodial Closet by Room 218	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2037-1	Science Room 218 Teacher's Station @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-2	Science Room 218 Teacher's Station @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-3	Science Room 218 POD 1 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-4	Science Room 218 POD 1 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-5	Science Room 218 POD 2 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-6	Science Room 218 POD 2 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-7	Science Room 218 POD 3 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-8	Science Room 218 POD 3 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-9	Science Room 218 POD 4 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-10	Science Room 218 POD 4 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-11	Science Room 218 POD 5 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-12	Science Room 218 POD 5 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-13	Science Room 218 POD 6 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2037-14	Science Room 218 POD 6 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-1	Science Room 220 Teacher's Station @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-2	Science Room 220 Teacher's Station @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-3	Science Room 220 POD 1 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-4	Science Room 220 POD 1 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-5	Science Room 220 POD 2 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-6	Science Room 220 POD 2 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-7	Science Room 220 POD 3 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2038-8	Science Room 220 POD 3 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-9	Science Room 220 POD 4 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-10	Science Room 220 POD 4 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-11	Science Room 220 POD 5 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-12	Science Room 220 POD 5 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-13	Science Room 220 POD 6 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2038-14	Science Room 220 POD 6 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2039-1	Science Room 222 Teacher's Station @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2039-2	Science Room 222 Teacher's Station @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2039-3	Science Room 222 Counter 1 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2039-4	Science Room 222 Counter 1 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2039-5	Science Room 222 Counter 2 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2039-6	Science Room 222 Counter 2 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2040-1	Room 230 Counter 1 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2040-2	Room 230 Counter 1 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2040-3	Room 230 Counter 2 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2040-4	Room 230 Counter 2 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2041-1	Women's Faculty Bathroom by Room 221	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2042-1	Boys Bathroom by Room 221 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2042-2	Boys Bathroom by Room 221 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2042-3	Boys Bathroom by Room 221 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2042-4	Boys Bathroom by Room 221 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-1	Science Room 214 Teacher's Station	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-2	Science Room 214 POD 1 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-3	Science Room 214 POD 1 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-4	Science Room 214 POD 2 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-5	Science Room 214 POD 2 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-6	Science Room 214 POD 3 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-7	Science Room 214 POD 3 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-8	Science Room 214 POD 4 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-9	Science Room 214 POD 4 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-10	Science Room 214 POD 5 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-11	Science Room 214 POD 5 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-12	Science Room 214 POD 6 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2043-13	Science Room 214 POD 6 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2044-1	Hall by Room 214	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
2045-1	Room 216 Counter 1	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2045-2	Room 216 Counter 2	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2046-1	Custodial Closet by Room 217	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
2047-1	Custodial Closet 217	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
2048-1	Women's Bathroom by Custodial Closet 217 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2048-2	Women's Bathroom by Custodial Closet 217 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2048-3	Women's Bathroom by Custodial Closet 217 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2048-4	Women's Bathroom by Custodial Closet 217 @ D	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2049-1	Unisex ADA Bathroom by Room 212	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2050-1	Room 212	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2051-1	Room 208 @ A	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2051-2	Room 208 @ B	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
2051-3	Room 208 @ C	SK	N/A		11/10/2020	-	-	-	None	SIGN	-	-
3001-1	Kitchen Staff Bathroom	SK	App	1.48	11/10/2020	-	-	-	None	-	-	-
0001-1	Boiler Room	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
0002-1	Weight Room	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
0003-1	Custodial Closet by Weight Room	SS	N/A		11/10/2020	-	-	-	None	Locked Door	-	-
0004-1	Middle School Girl's Locker Room PE office Bathroom	SK	App	<1.0	11/10/2020	-	-	-	None	-	-	-
0004-2	Middle School Basement Boys Locker Room Bathroom @ A	SK	App	2.86	11/10/2020	-	-	-	None	-	-	-
0004-3	Middle School Basement Boys Locker Room Bathroom @ B	SK	App	3.39	11/10/2020	-	-	-	None	-	-	-
0004-4	Middle School Basement Boys Locker Room	WF	App		11/10/2020	-	-	-	None	Removed From Service	-	-
0004-5	Middle School Basement Boys Locker Room Bottle Filler	BF	App	<1.0	11/10/2020	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2204508-16168

November 13, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Rye High School/ Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on November 10, 2020. New York Environmental analyzed the samples on November 12, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	10 Nov 2020
Date Received:	10 Nov 2020
Date Analyzed:	12 Nov 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201110N074	1	Room 111 Principals Office Kitchenette-SK; Initial	1.00	2.62	µg/L	
201110N075	2	Room 111 Principals Office Bathroom-SK; Initial	1.00	21.2	µg/L	H
201110N076	3	Assistant Principals Office Bathroom-SK; Initial	1.00	2.64	µg/L	
201110N077	4	Room 118 Nurses Office-SK; Initial	1.00	3.31	µg/L	
201110N078	5	Room 120 English Office Kitchenette-SK; Initial	1.00	15.4	µg/L	H
201110N079	6	Media Center/Library Office-SK; Initial	1.00	2.50	µg/L	
201110N080	7	Hall by Room 192 Nurses Office Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N081	8	Room 192 Nurses Office -SK; Initial	1.00	4.10	µg/L	
201110N082	9	Band Room 185-SS; Initial	1.00	1.98	µg/L	
201110N083	10	Hall by Boys Bathroom by Gym Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N084	11	Hall by Girls Bathroom by Gym Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N085	12	Hall by Room 411 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N086	13	Hall by Room 406 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N087	14	Gym Vestibule by Boys Locker Room @ A-BF; Initial	1.00	<1.00	µg/L	
201110N088	15	Gym Vestibule by Boys Locker Room @ B-BF; Initial	1.00	<1.00	µg/L	
201110N089	16	Auxillary Gym Office-IM; Initial	1.00	<1.00	µg/L	
201110N090	17	Girls Bathroom by Gym @ A-SK; Initial	1.00	6.58	µg/L	
201110N091	18	Girls Bathroom by Gym @ B-SK; Initial	1.00	3.88	µg/L	
201110N092	19	Boys Bathroom by Gym @ A-SK; Initial	1.00	1.41	µg/L	
201110N093	20	Boys Bathroom by Gym @ B-SK; Initial	1.00	1.05	µg/L	
201110N094	21	Boys Locker Room (Right)-WF; Initial	1.00	<1.00	µg/L	
201110N095	22	Boys Locker Room (Right) Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N096	23	Boys Locker Room (Left)-WF; Initial	1.00	<1.00	µg/L	
201110N097	24	Hall by Room 178 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N098	25	Hall by Room 143 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N099	26	Room 145 Middle School Teachers Lounge-SK; Initial	1.00	2.09	µg/L	



Date Collected:	10 Nov 2020
Date Received:	10 Nov 2020
Date Analyzed:	12 Nov 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201110N100	27	Hall by Middle School Gym Bottle Filler-BF; Initial	1.00	1.19	µg/L	
201110N101	28	Middle School Café Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N102	29	Middle School Kitchen 1 Bay-SK; Initial	1.00	1.42	µg/L	
201110N103	30	Middle School Kitchen 3 Bay-SK; Initial	1.00	1.75	µg/L	
201110N104	31	Middle School Room 130 Nurses Office-SK; Initial	1.00	4.93	µg/L	
201110N105	32	Middle School Room 130 Nurses Office Bathroom-SK; Initial	1.00	8.12	µg/L	
201110N106	33	Middle School Boys Locker Room Coaches Bathroom-SK; Initial	1.00	<1.00	µg/L	
201110N107	34	Middle School Boys Locker Room Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N108	35	Hall by Room 125A Bathroom-BF; Initial	1.00	<1.00	µg/L	
201110N109	36	Hall by Room 152 Bathroom-BF; Initial	1.00	<1.00	µg/L	
201110N110	37	2nd Fl. Kitchen Ice Machine-IM; Initial	1.00	<1.00	µg/L	
201110N111	38	2nd Fl. Kitchen Island by Stove-SK; Initial	1.00	14.5	µg/L	
201110N112	39	2nd Fl. Kitchen Pot Filler-SP; Initial	1.00	44.3	µg/L	H
201110N113	40	2nd Fl. Kitchen Steamer Oven-ST; Initial	1.00	<1.00	µg/L	
201110N114	41	2nd Fl. Kitchen 3 Bay @ A-SPY; Initial	1.00	2.09	µg/L	
201110N115	42	2nd Fl. Kitchen 3 Bay @ A-SK; Initial	1.00	2.34	µg/L	
201110N116	43	2nd Fl. Kitchen 3 Bay @ B-SK; Initial	1.00	<1.00	µg/L	
201110N117	44	2nd Fl. Kitchen Island by Windows-SK; Initial	1.00	3.23	µg/L	
201110N118	45	Hall by Room 204 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N119	46	Room 204 Faculty Room-SK; Initial	1.00	3.09	µg/L	
201110N120	47	Room 250-SK; Initial	1.00	1.88	µg/L	
201110N121	48	Hall by Room 461 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N122	49	Prep Room 458 @ A (by Room 460)-SK; Initial	1.00	30.7	µg/L	H
201110N123	50	Prep Room 458 @ B (by Room 456)-SK; Initial	1.00	35.9	µg/L	H
201110N124	51	Prep Room 453 @ A (by Room 455)-SK; Initial	1.00	3.51	µg/L	
201110N125	52	Prep Room 453 @ B (by Room 451)-SK; Initial	1.00	6.58	µg/L	
201110N126	53	Hall by Room 456 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	



Date Collected:	10 Nov 2020
Date Received:	10 Nov 2020
Date Analyzed:	12 Nov 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201110N127	54	2nd Fl. Girls Locker Room Coaches Office Bathroom-SK; Initial	1.00	1.03	µg/L	
201110N128	55	2nd Fl. Girls Locker Room (Left)-WF; Initial	1.00	<1.00	µg/L	
201110N129	56	2nd Fl. Girls Locker Room (Right)-WF; Initial	1.00	<1.00	µg/L	
201110N130	57	2nd Fl. Girls Locker Room (Right) Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N131	58	Hall by Room 233 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N132	59	Hall by Room 227 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N133	60	Kitchen Staff Bathroom-SK; Initial	1.00	1.48	µg/L	
201110N134	61	Middle School Girl's Locker Room PE office Bathroom-SK; Initial	1.00	<1.00	µg/L	
201110N135	62	Middle School Basement Boys Locker Room Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201110N136	63	Middle School Basement Boys Locker Room Bathroom @ A-SK; Initial	1.00	2.86	µg/L	
201110N137	64	Middle School Basement Boys Locker Room Bathroom @ B-SK; Initial	1.00	3.39	µg/L	
201110N138	65	Hall by Room 246 Bottle Filler-BF; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.