

Hendrick Hudson Central School District

**Districtwide Lead in Drinking Water
Sampling and Remediation Plan**

2020-2021



ENVIROSCIENCE
CONSULTANTS INC.

2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project #20662

Districtwide Lead in Drinking Water
Sampling and Remediation Plan

Performed for:

Hendrick Hudson Central School District
61 Trolley Road
Montrose, NY 11548

March 2021

Prepared by:

Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #20662

President



Glenn Neuschwender

Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

I. Executive Summary

II. Sampling Methodology

III. Initial Results

Appendix A – Buchanan-Verplanck Elementary School

Appendix B – Frank G. Lindsey Elementary School

Appendix C – Furnace Woods Elementary School

Appendix D – Blue Mountain Middle School

Appendix E – Hendrick Hudson High School

March 31, 2021

Anthony Merlini
Hendrick Hudson CSD
61 Trolley Road
Montrose, NY 11548

I. Executive Summary

The Hendrick Hudson Central School District has developed their 2020 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

Within the Hendrick Hudson Central School District, the following locations have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Elementary School classroom sinks
- 5) Bathroom sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Hendrick Hudson Central School District were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks;
- 2) Art Room sinks;
- 3) Other classroom sinks;
- 4) Other Bathroom sinks;
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the District has placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Other classroom sinks - classrooms in this category often include classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Other bathroom sinks – this category often includes mixed valve outlets or staff bathrooms. In intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Procedures:

In accordance with the regulation, Enviroscience Consultants, Inc. performed initial water sampling throughout the Hendrick Hudson Central School District from March 24-26, 2021. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more that 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.

Fixture Type Codes

BF Bottle Filler
 HB Hose Bib
 IM Ice Machine
 OS Other Source
 PF Pot Filler
 SK Sink
 SL Supply Line
 SP Spigot
 SPY Spray
 SS Slop Sink
 V Valve
 WC Water Cooler
 WF Water Fountain


Source Designations

App Applicable
 N/A Non-applicable

Remediation Type Codes

FR Fixture Replacement
 FRSLV Fixture, supply line or valve replacement
 FRSLVPA Fixture, supply line or valve replacement plumbing assessment
 SIGN Non-potable water sign posted
 CAPPED Supply line capped or fixture removed

Sampling Location Schematics

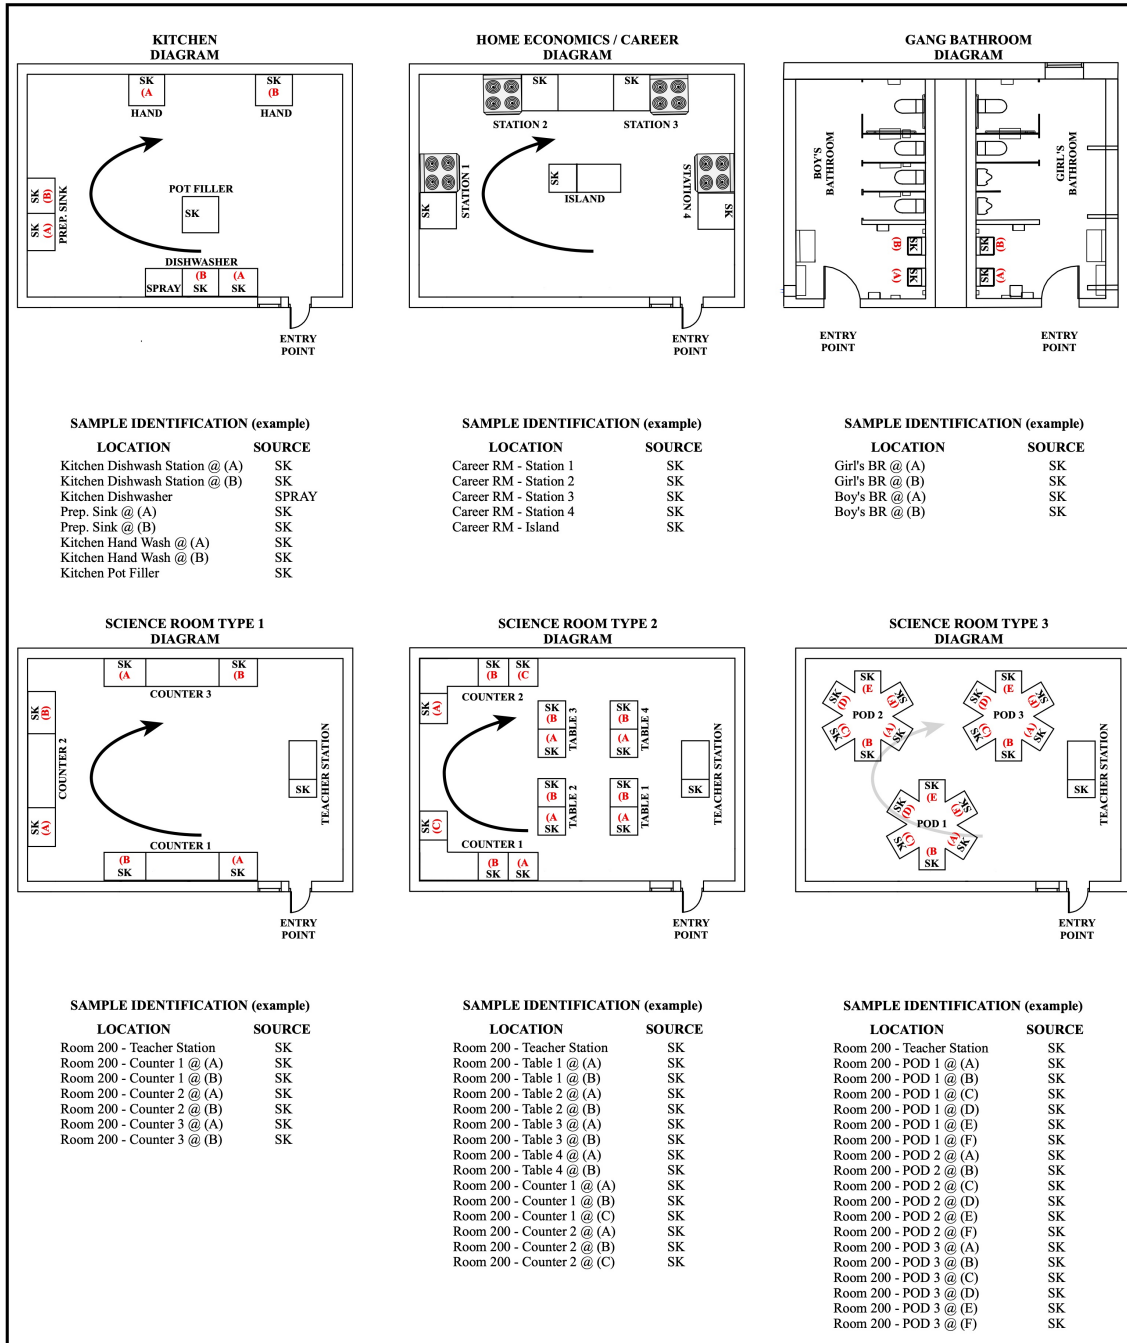

III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through E).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested before returning to service. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

Buchanan-Verplanck Elementary School

Kitchen by Serving Line	SK	53
Kitchen Prep	SK	19.3
Kitchen Handwash	SK	88.5
Art Room 29 Front (right)	SK	54.2
Art Room 29 Back (left)	SK	69.5
Gym Phys Ed Office Bathroom	SK	21.8
Room 3	WF	18.9
Library Work Room	SK	30.1
Room 10	WF	21.1
Room 10	SK	19.2
Room 21	SK	21.9
Room 17	WF	24.4
Support Services Bathroom (left)	SK	62.2
Support Services Bathroom (right)	SK	37.2

Frank G. Lindsey Elementary School

Girl's Bathroom by Room B1 (right)	SK	72.6
Art Room Counter @ D	SK	58.9
Art Room Counter @ F	SK	69.1
Room 10	SPY	173
Room 15	SK	116
Girl's Bathroom by Room B1 (right)	SK	28.5

Furnace Woods Elementary School

Kitchen Island	SK	16.2
Kitchen 3-Bay (left)	SK	47.9
Room 22	SK	37
Room 25	SK	15.9
Room 25	WF	15.1
Room 23	SK	71.2
Room 21	SK	304
Men's Bathroom by Art Room (left)	SK	25.2
Room 2 Bathroom	SK	16.2

Blue Mountain Middle School

Room 205	SPY	151
Kitchen Women's Bathroom	SK	17.5
Kitchen Serving Line #1	SK	409
Kitchen Handwash by Serving Line #1	SK	35.6
Girls Bathroom by Room 312 @ B	SK	15.4
Girls Bathroom by Room 312 @ C	SK	84.8

Hendrick Hudson High School

Art Room 006 Counter 2	SK	49.1
Art Room 005 @B	SK	42.3
Kitchen 127 Pot Filler	SP	384
Kitchen 127 Bathroom	SK	15.6
Staff Lounge 218 Right Staff Bathroom	SK	37.5
Unisex Bathroom by Room 223 @A	SK	65.9
Unisex Bathroom by Room 223 @B	SK	22.4
Boys Locker Room Under Dome @A	SK	93.2
Boys Locker Room Under Dome @B	SK	20.3
Boys Locker Room Under Dome @C	SK	31.3
Boys Locker Room Under Dome @D	SK	134
Girls Locker Room (Left)	WF	75.8

Appendix A

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Boiler Room	SP	N/A		3/24/2021	-	-	-	Sign Required	-	-	-
1002-1	Kitchen 3-Bay (left)	SK	App	1.32	3/24/2021	-	-	-	None	-	-	-
1002-2	Kitchen 3-Bay (middle)	SK	App	4.15	3/24/2021	-	-	-	None	-	-	-
1002-3	Kitchen 3-Bay (right)	SK	App	3.94	3/24/2021	-	-	-	None	-	-	-
1002-4	Kitchen 3-Bay (right)	SK	App	1.05	3/24/2021	-	-	-	None	-	-	-
1002-5	Kitchen Island	SK	App	8.13	3/24/2021	-	-	-	None	-	-	-
1002-6	Kitchen by Stove	SK	N/A		3/24/2021	-	-	-	None	Capped	-	-
1002-7	Kitchen by Serving Line	SK	App	53	3/24/2021				Additional Sampling Required			
1002-8	Kitchen Prep	SK	App	19.3	3/24/2021				Additional Sampling Required			
1002-9	Kitchen Handwash	SK	App	88.5	3/24/2021				Additional Sampling Required			
1002-10	Kitchen Custodial Closet	SS	N/A		3/24/2021	-	-	-	None	Locked Door	-	-
1002-11	Kitchen Staff Bathroom	SK	App	11.6	3/24/2021	-	-	-	None	-	-	-
1003-1	Auditoria	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1003-2	Auditoria	BF	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1004-1	Custodial Office Bathroom	SK	App	1.67	3/24/2021	-	-	-	None	-	-	-
1005-1	Art Room 29 Front (left)	SK	App	5.25	3/24/2021	-	-	-	None	-	-	-
1005-2	Art Room 29 Front (right)	SK	App	54.2	3/24/2021				Additional Sampling Required			
1005-3	Art Room 29 Back (left)	SK	App	69.5	3/24/2021				Additional Sampling Required			
1005-4	Art Room 29 Back (right)	SK	App	14.1	3/24/2021	-	-	-	None	-	-	-
1006-1	Hall by Art Room 29	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1006-2	Hall by Art Room 29	BF	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1007-1	Gym Locker Room	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1007-2	Gym Locker Room Bathroom (left)	SK	App	10	3/24/2021	-	-	-	None	-	-	-
1007-3	Gym Locker Room Bathroom (right)	SK	App	6.41	3/24/2021	-	-	-	None	-	-	-
1007-4	Gym Phys Ed Office Bathroom	SK	App	21.8	3/24/2021				Additional Sampling Required			
1008-1	Unisex Bathroom by Nurse's Office	SK	App		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1009-1	Nurse's Office	SK	App	2.56	3/24/2021	-	-	-	None	-	-	-
1009-2	Nurse's Office Bathroom	SK	App	4.09	3/24/2021	-	-	-	None	-	-	-
1010-1	Main Office Kitchenette	SK	App	1.56	3/24/2021	-	-	-	None	-	-	-
1011-1	Unisex Bathroom by Main Office	SK	App		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1012-1	Room 1	WF	App	5.41	3/24/2021	-	-	-	None	-	-	-
1012-2	Room 1	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1013-1	Room 2	WF	App	1.31	3/24/2021	-	-	-	None	-	-	-
1013-2	Room 2	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1014-1	Room 3	WF	App	18.9	3/24/2021				Additional Sampling Required			
1014-2	Room 3	SK	App	11.1	3/24/2021	-	-	-	None	-	-	-
1015-1	Room 4	WF	App	5.74	3/24/2021	-	-	-	None	-	-	-
1015-2	Room 4	SK	App	5.57	3/24/2021	-	-	-	None	-	-	-
1016-1	Room 5	WF	App	6.05	3/24/2021	-	-	-	None	-	-	-
1016-2	Room 5	SK	App	3.27	3/24/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1017-1	Room 13	WF	App	7.76	3/24/2021	-	-	-	None	-	-	-
1017-2	Room 13	SK	App	4.44	3/24/2021	-	-	-	None	-	-	-
1018-1	Room 14	WF	App	10.1	3/24/2021	-	-	-	None	-	-	-
1018-2	Room 14	SK	App	2.56	3/24/2021	-	-	-	None	-	-	-
1019-1	Room 6	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1019-2	Room 6	SK	App	3.68	3/24/2021	-	-	-	None	-	-	-
1020-1	Room 7	WF	App	10.4	3/24/2021	-	-	-	None	-	-	-
1020-2	Room 7	SK	App	2.23	3/24/2021	-	-	-	None	-	-	-
1021-1	Library Work Room	SK	App	30.1	3/24/2021				Additional Sampling Required			
1022-1	Room 8	WF	App	7.02	3/24/2021	-	-	-	None	-	-	-
1022-2	Room 8	SK	App	5.96	3/24/2021	-	-	-	None	-	-	-
1023-1	Room 9	WF	App	3.96	3/24/2021	-	-	-	None	-	-	-
1023-2	Room 9	SK	App	4.21	3/24/2021	-	-	-	None	-	-	-
1024-1	Unisex Bathroom by Library	SK	App		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1025-1	Custodial Closet by Library	SS	N/A		3/24/2021	-	-	-	None	Locked Door	-	-
1026-1	Room 10	WF	App	21.1	3/24/2021				Additional Sampling Required			
1026-2	Room 10	SK	App	19.2	3/24/2021				Additional Sampling Required			
1027-1	Room 11	WF	App	1.32	3/24/2021	-	-	-	None	-	-	-
1027-2	Room 11	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1028-1	Room 12	WF	App	<1.0	3/24/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1028-2	Room 12	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1029-1	Room 15	WF	App	3.76	3/24/2021	-	-	-	None	-	-	-
1029-2	Room 15	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1030-1	Hall by Room 15	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1030-2	Hall by Room 15	BF	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1031-1	Room 16	WF	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1031-2	Room 16	S	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1032-1	Room 22	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1032-2	Room 22	SK	App	9.11	3/24/2021	-	-	-	None	-	-	-
1033-1	Room 21	WF	App	13.1	3/24/2021	-	-	-	None	-	-	-
1033-2	Room 21	SK	App	21.9	3/24/2021				Additional Sampling Required			
1034-1	Room 20	WF	App	9.66	3/24/2021	-	-	-	None	-	-	-
1034-2	Room 20	SK	App	10.4	3/24/2021	-	-	-	None	-	-	-
1035-1	Custodial Closet by Room 20	SS	N/A		3/24/2021	-	-	-	None	Locked Door	-	-
1036-1	Hall by Room 20	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1036-2	Hall by Room 20	BF	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1037-1	Room 19	WF	App	1.53	3/24/2021	-	-	-	None	-	-	-
1037-2	Room 19	SK	App	2.49	3/24/2021	-	-	-	None	-	-	-
1038-1	Room 18	WF	App	13.6	3/24/2021	-	-	-	None	-	-	-
1038-2	Room 18	SK	App	12.1	3/24/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1039-1	Room 23	WF	App	6.14	3/24/2021	-	-	-	None	-	-	-
1039-2	Room 23	SK	App	3.93	3/24/2021	-	-	-	None	-	-	-
1040-1	Room 17	WF	App	24.4	3/24/2021				Additional Sampling Required			
1040-2	Room 17	SK	App	7.82	3/24/2021	-	-	-	None	-	-	-
1041-1	Custodial Closet by Room 17	SS	N/A		3/24/2021	-	-	-	None	Locked Door	-	-
1042-1	Support Services Bathroom (left)	SK	App	62.2	3/24/2021				Additional Sampling Required			
1042-2	Support Services Bathroom (right)	SK	App	37.2	3/24/2021				Additional Sampling Required			
1043-1	Men's Bathroom by Room 17 (left)	SK	App	1.43	3/24/2021	-	-	-	None	-	-	-
1043-2	Men's Bathroom by Room 17 (right)	SK	App	3.72	3/24/2021	-	-	-	None	-	-	-
1044-1	Custodial Closet by Support Services	SS	N/A		3/24/2021	-	-	-	None	Locked Door	-	-
1045-1	Women's Bathroom by Room 17 (left)	SK	App	10.1	3/24/2021	-	-	-	None	-	-	-
1045-2	Women's Bathroom by Room 17 (right)	SK	App	7.44	3/24/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2211244-17293

March 29, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Buchanan-Verplanck Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on March 25, 2021. New York Environmental analyzed the samples on March 26, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	24 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210325P203	1	Kitchen 3-Bay (left)-SK; Initial	1.00	1.32	µg/L	
210325P204	2	Kitchen 3-Bay (middle)-SK; Initial	1.00	4.15	µg/L	
210325P205	3	Kitchen 3-Bay (right)-SK; Initial	1.00	3.94	µg/L	
210325P206	4	Kitchen 3-Bay (right)-SK; Initial	1.00	1.05	µg/L	
210325P207	5	Kitchen Island-SK; Initial	1.00	8.13	µg/L	
210325P208	6	Kitchen by Serving Line-SK; Initial	1.00	53.0	µg/L	E,H
210325P209	7	Kitchen Prep-SK; Initial	1.00	19.3	µg/L	H
210325P210	8	Kitchen Handwash-SK; Initial	1.00	88.5	µg/L	E,H
210325P211	9	Kitchen Staff Bathroom-SK; Initial	1.00	11.6	µg/L	
210325P212	10	Auditoria-BF; Initial	1.00	<1.00	µg/L	
210325P213	11	Custodial Office Bathroom-SK; Initial	1.00	1.67	µg/L	
210325P214	12	Art Room 29 Front (left)-SK; Initial	1.00	5.25	µg/L	
210325P215	13	Art Room 29 Front (right)-SK; Initial	1.00	54.2	µg/L	E,H
210325P216	14	Art Room 29 Back (left)-SK; Initial	1.00	69.5	µg/L	E,H
210325P217	15	Art Room 29 Back (right)-SK; Initial	1.00	14.1	µg/L	
210325P218	16	Hall by Art Room 29-BF; Initial	1.00	<1.00	µg/L	
210325P219	17	Gym Locker Room Bathroom (left)-SK; Initial	1.00	10.0	µg/L	
210325P220	18	Gym Locker Room Bathroom (right)-SK; Initial	1.00	6.41	µg/L	
210325P221	20	Main Office Kitchenette-SK; Initial	1.00	1.56	µg/L	
210325P222	22	Room 1-WF; Initial	1.00	5.41	µg/L	
210325P223	23	Room 1-SK; Initial	1.00	<1.00	µg/L	
210325P224	24	Room 2-WF; Initial	1.00	1.31	µg/L	
210325P225	25	Room 2-SK; Initial	1.00	<1.00	µg/L	
210325P226	26	Room 3-WF; Initial	1.00	18.9	µg/L	H
210325P227	27	Room 3-SK; Initial	1.00	11.1	µg/L	
210325P228	28	Room 4-WF; Initial	1.00	5.74	µg/L	



Date Collected:	24 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210325P229	29	Room 4-SK; Initial	1.00	5.57	µg/L	
210325P230	30	Room 5-WF; Initial	1.00	6.05	µg/L	
210325P231	31	Room 5-SK; Initial	1.00	3.27	µg/L	
210325P232	32	Room 13-WF; Initial	1.00	7.76	µg/L	
210325P233	33	Room 13-SK; Initial	1.00	4.44	µg/L	
210325P234	34	Room 14-WF; Initial	1.00	10.1	µg/L	
210325P235	35	Room 14-SK; Initial	1.00	2.56	µg/L	
210325P236	36	Room 6-SK; Initial	1.00	3.68	µg/L	
210325P237	37	Room 7-WF; Initial	1.00	10.4	µg/L	
210325P238	38	Room 7-SK; Initial	1.00	2.23	µg/L	
210325P239	39	Library Work Room-SK; Initial	1.00	30.1	µg/L	H
210325P240	40	Room 8-WF; Initial	1.00	7.02	µg/L	
210325P241	41	Room 8-SK; Initial	1.00	5.96	µg/L	
210325P242	42	Room 9-WF; Initial	1.00	3.96	µg/L	
210325P243	45	Room 9-SK; Initial	1.00	4.21	µg/L	
210325P244	46	Room 10-WF; Initial	1.00	21.1	µg/L	H
210325P245	47	Room 10-SK; Initial	1.00	19.2	µg/L	H
210325P246	48	Room 11-WF; Initial	1.00	1.32	µg/L	
210325P247	49	Room 11-SK; Initial	1.00	<1.00	µg/L	
210325P248	50	Room 12-WF; Initial	1.00	<1.00	µg/L	
210325P249	51	Room 12-SK; Initial	1.00	<1.00	µg/L	
210325P250	52	Room 15-WF; Initial	1.00	3.76	µg/L	
210325P251	53	Room 15-SK; Initial	1.00	<1.00	µg/L	
210325P252	54	Hall by Room 15-BF; Initial	1.00	<1.00	µg/L	
210325P253	55	Room 16-WF; Initial	1.00	<1.00	µg/L	
210325P254	56	Room 16-S; Initial	1.00	<1.00	µg/L	
210325P255	57	Room 22-SK; Initial	1.00	9.11	µg/L	



Date Collected:	24 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210325P256	58	Room 21-WF; Initial	1.00	13.1	µg/L	
210325P257	59	Room 21-SK; Initial	1.00	21.9	µg/L	H
210325P258	60	Room 20-WF; Initial	1.00	9.66	µg/L	
210325P259	61	Room 20-SK; Initial	1.00	10.4	µg/L	
210325P260	62	Hall by Room 20-BF; Initial	1.00	<1.00	µg/L	
210325P261	63	Room 19-WF; Initial	1.00	1.53	µg/L	
210325P262	64	Room 19-SK; Initial	1.00	2.49	µg/L	
210325P263	65	Room 18-WF; Initial	1.00	13.6	µg/L	
210325P264	66	Room 18-SK; Initial	1.00	12.1	µg/L	
210325P265	67	Room 23-WF; Initial	1.00	6.14	µg/L	
210325P266	68	Room 23-SK; Initial	1.00	3.93	µg/L	
210325P267	69	Room 17-WF; Initial	1.00	24.4	µg/L	H
210325P268	70	Room 17-SK; Initial	1.00	7.82	µg/L	
210325P269	71	Support Services Bathroom (left)-SK; Initial	1.00	62.2	µg/L	E,H
210325P270	72	Support Services Bathroom (right)-SK; Initial	1.00	37.2	µg/L	H
210325P271	73	Men's Bathroom by Room 17 (left)-SK; Initial	1.00	1.43	µg/L	
210325P272	74	Men's Bathroom by Room 17 (right)-SK; Initial	1.00	3.72	µg/L	
210325P273	75	Women's Bathroom by Room 17 (left)-SK; Initial	1.00	10.1	µg/L	
210325P274	76	Women's Bathroom by Room 17 (right)-SK; Initial	1.00	7.44	µg/L	
210325P275	77	Nurse's Office-SK; Initial	1.00	2.56	µg/L	
210325P276	78	Nurse's Office Bathroom-SK; Initial	1.00	4.09	µg/L	
210325P277	79	Gym Phys Ed Office Bathroom-SK; Initial	1.00	21.8	µg/L	H

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.



Appendix B

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Room B4	SK	App	3.99	3/24/2021	-	-	-	None	-	-	-
0001-2	Room B4	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
0002-1	Girl's Bathroom by Room B1 (left)	SK	App	2.58	3/24/2021	-	-	-	None	-	-	-
0002-2	Girl's Bathroom by Room B1 (right)	SK	App	72.6	3/24/2021				Additional Sampling Required			
0003-1	Hall by Room B1	WF	App	2.64	3/24/2021	-	-	-	None	-	-	-
0004-1	Boy's Bathroom by Room B1 (left)	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
0004-2	Boy's Bathroom by Room B1 (right)	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
0005-1	Boiler Room	SS	N/A		3/24/2021	-	-	-	None	Locked Door	-	-
0006-1	Art Room Counter @ A	SK	App	5.22	3/24/2021	-	-	-	None	-	-	-
0006-2	Art Room Counter @ B	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
0006-3	Art Room Counter @ C	SK	App	2.6	3/24/2021	-	-	-	None	-	-	-
0006-4	Art Room Counter @ D	SK	App	58.9	3/24/2021				Additional Sampling Required			
0006-5	Art Room Counter @ E	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
0006-6	Art Room Counter @ F	SK	App	69.1	3/24/2021				Additional Sampling Required			
1001-1	Nurse's Office	SK	App	1.89	3/24/2021	-	-	-	None	-	-	-
1001-2	Nurse's Office Bathroom	SK	App	4.51	3/24/2021	-	-	-	None	-	-	-
1001-3	Nurse's Office Exam Room	SK	App	9.87	3/24/2021	-	-	-	None	-	-	-
1002-1	Faculty Room	SK	App	1.4	3/24/2021	-	-	-	None	-	-	-
1002-2	Faculty Room Bathroom	SK	App	1.59	3/24/2021	-	-	-	None	-	-	-
1003-1	Main Office Bathroom	SK	App	2.54	3/24/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1004-1	Hall by Main Office	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1005-1	Men's Bathroom by Main Office	SK	N/A		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1006-1	Women's Bathroom by Main Office	SK	N/A		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1007-1	Kitchen Island	SK	App	1.92	3/24/2021	-	-	-	None	-	-	-
1007-2	Kitchen Ice Machine	IM	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1007-3	Kitchen 3-Bay (left)	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1007-4	Kitchen 3-Bay (left)	SPY	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1007-5	Kitchen 3-Bay (right)	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1007-6	Kitchen Handwash	SK	N/A		3/24/2021	-	-	-	Sign Required	-	-	-
1008-1	Custodial Alcove by Kitchen	SS	N/A		3/24/2021	-	-	-	Sign Required	-	-	-
1009-1	Kitchen Staff Bathroom	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1010-1	Hall by Room SP1	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1010-2	Hall by Room SP1	BF	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1011-1	Room SP1	SS	N/A		3/24/2021	-	-	-	Sign Required	-	-	-
1012-1	Custodial Office	SK	N/A		3/24/2021	-	-	-	None	Sign Posted	-	-
1013-1	Room 6	SK	App		3/24/2021	-	-	-	None	Sign Posted	-	-
1013-2	Room 6	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1014-1	Room 7	SK	App	2.83	3/24/2021	-	-	-	None	-	-	-
1015-1	Room 8	SK	App		3/24/2021	-	-	-	None	SIGN	-	-
1016-1	Room 9	SK	App	1.38	3/24/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1016-2	Room 9	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1017-1	Room 10	SK	App	1.84	3/24/2021	-	-	-	None	-	-	-
1017-2	Room 10	SPY	App	173	3/24/2021				Additional Sampling Required			
1018-1	Room 5	SK	App	5.27	3/24/2021	-	-	-	None	-	-	-
1018-2	Room 5 Bathroom (left)	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1018-3	Room 5 Bathroom (right)	SK	App	1.14	3/24/2021	-	-	-	None	-	-	-
1018-4	Room 5	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1019-1	Room 4	SK	App	2.22	3/24/2021	-	-	-	None	-	-	-
1019-2	Room 4 Bathroom (left)	SK	App	7.03	3/24/2021	-	-	-	None	-	-	-
1019-3	Room 4 Bathroom (right)	SK	App	1.44	3/24/2021	-	-	-	None	-	-	-
1019-4	Room 4	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1020-1	Room 3	SK	App	4.01	3/24/2021	-	-	-	None	-	-	-
1020-2	Room 3 Bathroom	SK	App	1.75	3/24/2021	-	-	-	None	-	-	-
1020-3	Room 3	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1021-1	Room 2	SK	App		3/24/2021	-	-	-	None	Sign Posted	-	-
1021-2	Room 2 Bathroom (left)	SK	App		3/24/2021	-	-	-	Hot Water Only Sign Required	-	-	-
1021-3	Room 2 Bathroom (right)	SK	App	3.71	3/24/2021	-	-	-	None	-	-	-
1021-4	Room 2	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1022-1	Room 1	SK	App		3/24/2021	-	-	-	None	Sign Posted	-	-
1022-2	Room 1 Bathroom (left)	SK	App	1.59	3/24/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1022-3	Room 1 Bathroom (right)	SK	App		3/24/2021	-	-	-	Hot Water Only Sign Required	-	-	-
1022-4	Room 1	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1023-1	Room SW1	SK	App		3/24/2021	-	-	-	None	Sign Posted	-	-
1024-1	Psychologist's Suite Bathroom	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1025-1	Old Boy's Locker Room	SK	App	3.23	3/24/2021	-	-	-	None	-	-	-
1026-1	Hall by Room 11	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1026-2	Hall by Room 11	BF	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1027-1	Room 11	SK	App	2.29	3/24/2021	-	-	-	None	-	-	-
1027-2	Room 11	WF	App	3.63	3/24/2021	-	-	-	None	-	-	-
1028-1	Room 12	SK	App	9.34	3/24/2021	-	-	-	None	-	-	-
1028-2	Room 12	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1029-1	Girl's Bathroom (left)	SK	N/A		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1029-2	Girl's Bathroom (right)	SK	N/A		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1030-1	Hall by Room 13	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1030-2	Hall by Room 13	BF	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1031-1	Boy's Bathroom by Room 13 (left)	SK	N/A		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1031-2	Boy's Bathroom by Room 13 (right)	SK	N/A		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1032-1	Room 13	SK	App	1.73	3/24/2021	-	-	-	None	-	-	-
1032-2	Room 13	WF	App	11	3/24/2021	-	-	-	None	-	-	-
1033-1	Room 17	SK	App	1.42	3/24/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1033-2	Room 17	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1034-1	Custodial Closet by Room 13	SS	N/A		3/24/2021	-	-	-	None	Locked Door	-	-
1035-1	Room 14	SK	App	2.12	3/24/2021	-	-	-	None	-	-	-
1035-2	Room 14	WF	App	1.71	3/24/2021	-	-	-	None	-	-	-
1036-1	Room 18	SK	App	2.01	3/24/2021	-	-	-	None	-	-	-
1036-2	Room 18	WF	App	<1.0	3/24/2021	-	-	-	None	-	-	-
1037-1	Room 15	SK	App	116	3/24/2021				Additional Sampling Required			
1037-2	Room 15	WF	App	3.67	3/24/2021	-	-	-	None	-	-	-
1038-1	Room 16	SK	App		3/24/2021	-	-	-	None	Sign Posted	-	-
1038-2	Room 16	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
1039-1	Room 19	SK	App	1.43	3/24/2021	-	-	-	None	-	-	-
1039-2	Room 19	WF	App	1.52	3/24/2021	-	-	-	None	-	-	-
2001-1	Room 28	SK	App	28.5	3/24/2021				Additional Sampling Required			
2002-1	Room 25	SK	App	2.07	3/24/2021	-	-	-	None	-	-	-
2002-2	Room 25	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
2003-1	Room 24	SK	App	3.17	3/24/2021	-	-	-	None	-	-	-
2003-2	Room 24	WF	App	1.15	3/24/2021	-	-	-	None	-	-	-
2004-1	Room 27	SK	App	1.93	3/24/2021	-	-	-	None	-	-	-
2005-1	Room 23	SK	App	1.79	3/24/2021	-	-	-	None	-	-	-
2005-2	Room 23	WF	App	1.51	3/24/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2006-1	Room 26	SK	App	1.51	3/24/2021	-	-	-	None	-	-	-
2007-1	Boy's Bathroom by Room 26 (left)	SK	N/A		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2007-2	Boy's Bathroom by Room 26 (right)	SK	N/A		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2008-1	Custodial Closet by Room 26	SS	N/A		3/24/2021	-	-	-	None	Locked Door	-	-
2009-1	Girl's Bathroom by Room 26 (left)	SK	N/A		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2009-2	Girl's Bathroom by Room 26 (right)	SK	N/A		3/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2010-1	Hall by Room 26	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
2010-2	Hall by Room 26	BF	App	<1.0	3/24/2021	-	-	-	None	-	-	-
2011-1	Room 22	SK	App	<1.0	3/24/2021	-	-	-	None	-	-	-
2011-2	Room 22	WF	App		3/24/2021	-	-	-	None	Removed from Service	-	-
2012-1	Library Office	SK	N/A		3/24/2021	-	-	-	None	Sign Posted	-	-

Laboratory Report

NYE Report #: 2211242-17291

March 29, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Frank G. Lindsey Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on March 25, 2021. New York Environmental analyzed the samples on March 26, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	24 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210325P081	1	Nurse's Office-SK; Initial	1.00	1.89	µg/L	
210325P082	2	Nurse's Office Bathroom-SK; Initial	1.00	4.51	µg/L	
210325P083	3	Nurse's Office Exam Room-SK; Initial	1.00	9.87	µg/L	
210325P084	4	Faculty Room-SK; Initial	1.00	1.40	µg/L	
210325P085	5	Faculty Room Bathroom-SK; Initial	1.00	1.59	µg/L	
210325P086	6	Main Office Bathroom-SK; Initial	1.00	2.54	µg/L	
210325P087	7	Kitchen Island-SK; Initial	1.00	1.92	µg/L	
210325P088	8	Kitchen Ice Machine-IM; Initial	1.00	<1.00	µg/L	
210325P089	9	Kitchen 3-Bay (left)-SK; Initial	1.00	<1.00	µg/L	
210325P090	10	Kitchen 3-Bay (left)-SPY; Initial	1.00	<1.00	µg/L	
210325P091	11	Kitchen 3-Bay (right)-SK; Initial	1.00	<1.00	µg/L	
210325P092	12	Kitchen Staff Bathroom-SK; Initial	1.00	<1.00	µg/L	
210325P093	13	Hall by Room SP1-BF; Initial	1.00	<1.00	µg/L	
210325P094	14	Room 7-SK; Initial	1.00	2.83	µg/L	
210325P095	15	Room 9-SK; Initial	1.00	1.38	µg/L	
210325P096	16	Room 10-SK; Initial	1.00	1.84	µg/L	
210325P097	17	Room 10-SPY; Initial	1.00	173	µg/L	E,H
210325P098	18	Room 5-SK; Initial	1.00	5.27	µg/L	
210325P099	19	Room 5 Bathroom (left)-SK; Initial	1.00	<1.00	µg/L	
210325P100	20	Room 5 Bathroom (right)-SK; Initial	1.00	1.14	µg/L	
210325P101	21	Room 4-SK; Initial	1.00	2.22	µg/L	
210325P102	22	Room 4 Bathroom (left)-SK; Initial	1.00	7.03	µg/L	
210325P103	23	Room 4 Bathroom (right)-SK; Initial	1.00	1.44	µg/L	
210325P104	24	Room 3-SK; Initial	1.00	4.01	µg/L	
210325P105	25	Room 3 Bathroom -SK; Initial	1.00	1.75	µg/L	
210325P106	26	Room 2 Bathroom (right)-SK; Initial	1.00	3.71	µg/L	



Date Collected:	24 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210325P107	27	Room 1 Bathroom (left)-SK; Initial	1.00	1.59	µg/L	
210325P108	28	Psychologist's Suite Bathroom-SK; Initial	1.00	<1.00	µg/L	
210325P109	29	Old Boy's Locker Room-SK; Initial	1.00	3.23	µg/L	
210325P110	30	Hall by Room 11-BF; Initial	1.00	<1.00	µg/L	
210325P111	31	Room 11-SK; Initial	1.00	2.29	µg/L	
210325P112	32	Room 11-WF; Initial	1.00	3.63	µg/L	
210325P113	33	Room 12-SK; Initial	1.00	9.34	µg/L	
210325P114	34	Hall by Room 13-BF; Initial	1.00	<1.00	µg/L	
210325P115	35	Room 13-SK; Initial	1.00	1.73	µg/L	
210325P116	36	Room 13-WF; Initial	1.00	11.0	µg/L	
210325P117	37	Room 17-SK; Initial	1.00	1.42	µg/L	
210325P118	38	Room 14-SK; Initial	1.00	2.12	µg/L	
210325P119	39	Room 14-WF; Initial	1.00	1.71	µg/L	
210325P120	40	Room 18-SK; Initial	1.00	2.01	µg/L	
210325P121	41	Room 18-WF; Initial	1.00	<1.00	µg/L	
210325P122	42	Room 15-SK; Initial	1.00	116	µg/L	E,H
210325P123	43	Room 15-WF; Initial	1.00	3.67	µg/L	
210325P124	44	Room 19-SK; Initial	1.00	1.43	µg/L	
210325P125	45	Room 19-WF; Initial	1.00	1.52	µg/L	
210325P126	46	Room 28-SK; Initial	1.00	28.5	µg/L	H
210325P127	47	Room 25-SK; Initial	1.00	2.07	µg/L	
210325P128	48	Room 24-SK; Initial	1.00	3.17	µg/L	
210325P129	49	Room 24-WF; Initial	1.00	1.15	µg/L	
210325P130	50	Room 27-SK; Initial	1.00	1.93	µg/L	
210325P131	51	Room 23-SK; Initial	1.00	1.79	µg/L	
210325P132	52	Room 23-WF; Initial	1.00	1.51	µg/L	
210325P133	53	Room 26-SK; Initial	1.00	1.51	µg/L	



Date Collected:	24 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210325P134	54	Hall by Room 26-BF; Initial	1.00	<1.00	µg/L	
210325P135	55	Room 22-SK; Initial	1.00	<1.00	µg/L	
210325P136	56	Room B4-SK; Initial	1.00	3.99	µg/L	
210325P137	57	Girl's Bathroom by Room B1 (left)-SK; Initial	1.00	2.58	µg/L	
210325P138	58	Girl's Bathroom by Room B1 (right)-SK; Initial	1.00	72.6	µg/L	E,H
210325P139	59	Hall by Room B1-WF; Initial	1.00	2.64	µg/L	
210325P140	60	Boy's Bathroom by Room B1 (left)-SK; Initial	1.00	<1.00	µg/L	
210325P141	61	Boy's Bathroom by Room B1 (right)-SK; Initial	1.00	<1.00	µg/L	
210325P142	62	Art Room Counter @ A-SK; Initial	1.00	5.22	µg/L	
210325P143	63	Art Room Counter @ B-SK; Initial	1.00	<1.00	µg/L	
210325P144	64	Art Room Counter @ C-SK; Initial	1.00	2.60	µg/L	
210325P145	65	Art Room Counter @ D-SK; Initial	1.00	58.9	µg/L	E,H
210325P146	66	Art Room Counter @ E-SK; Initial	1.00	<1.00	µg/L	
210325P147	67	Art Room Counter @ F-SK; Initial	1.00	69.1	µg/L	E,H

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Custodial Office Bathroom	SK	App	1.91	3/25/2021	-	-	-	None	-	-	-
1002-1	Custodial Closet by Kitchen	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-
1003-1	Kitchen Staff Bathroom	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
1003-2	Kitchen Island	SK	App	16.2	3/25/2021				Additional Sampling Required			
1003-3	Kitchen 3-Bay (left)	SK	App	47.9	3/25/2021				Additional Sampling Required			
1003-4	Kitchen 3-Bay (center)	SPY	App	2.57	3/25/2021	-	-	-	None	-	-	-
1003-5	Kitchen 3-Bay (right)	SK	App	1.6	3/25/2021	-	-	-	None	-	-	-
1003-6	Dishwashing Station	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
1004-1	Boy's Locker Room Vestibule	WF	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1004-2	Boy's Locker Room Vestibule	BF	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1005-1	Boy's Locker Room Rear Bathroom	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
1006-1	Custodial Closet by Gym	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-
1007-1	Custodial Closet by Cafeteria	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-
1008-1	Room 20	SK	App	11	3/25/2021	-	-	-	None	-	-	-
1008-2	Room 20	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
1009-1	Room 22	SK	App	37	3/25/2021				Additional Sampling Required			
1009-2	Room 22	WF	App	6.88	3/25/2021	-	-	-	None	-	-	-
1010-1	Room 24	SK	App	7.28	3/25/2021	-	-	-	None	-	-	-
1010-2	Room 24	WF	App	6.48	3/25/2021	-	-	-	None	-	-	-
1011-1	Room 26	SK	App	8.49	3/25/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1011-2	Room 26	WF	App	5.03	3/25/2021	-	-	-	None	-	-	-
1012-1	Room 28	SK	App	1.01	3/25/2021	-	-	-	None	-	-	-
1012-2	Room 28	WF	App	1.94	3/25/2021	-	-	-	None	-	-	-
1013-1	Room 30	SK	App	2.53	3/25/2021	-	-	-	None	-	-	-
1013-2	Room 30	WF	App	1.21	3/25/2021	-	-	-	None	-	-	-
1014-1	Room 29	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1014-2	Room 29	WF	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1015-1	Room 27	SK	App	1.1	3/25/2021	-	-	-	None	-	-	-
1015-2	Room 27	WF	App	1.67	3/25/2021	-	-	-	None	-	-	-
1016-1	Room 25	SK	App	15.9	3/25/2021				Additional Sampling Required			
1016-2	Room 25	WF	App	15.1	3/25/2021				Additional Sampling Required			
1017-1	Room 23	SK	App	71.2	3/25/2021				Additional Sampling Required			
1017-2	Room 23	WF	App	6.41	3/25/2021	-	-	-	None	-	-	-
1018-1	Room 21	SK	App	304	3/25/2021				Additional Sampling Required			
1018-2	Room 21	WF	App		3/25/2021	-	-	-	None	Sign Posted	-	-
1019-1	Boy's Bathroom by Room 22 @ A	SK	N/A		3/25/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1019-2	Boy's Bathroom by Room 22 @ B	SK	N/A		3/25/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1019-3	Boy's Bathroom by Room 22 @ C	SK	N/A		3/25/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1019-4	Boy's Bathroom by Room 22 @ D	SK	N/A		3/25/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1020-1	Custodial Closet by Room 22	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1021-1	Girl's Bathroom by Room @ A	SK	N/A		3/25/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1021-2	Girl's Bathroom by Room @ B	SK	N/A		3/25/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1021-3	Girl's Bathroom by Room @ C	SK	N/A		3/25/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1021-4	Girl's Bathroom by Room @ D	SK	N/A		3/25/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1022-1	Women's Bathroom by Art Room (left)	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
1022-2	Women's Bathroom by Art Room (right)	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
1023-1	Men's Bathroom by Art Room (left)	SK	App	25.2	3/25/2021				Additional Sampling Required			
1023-2	Men's Bathroom by Art Room (right)	SK	App	4.14	3/25/2021	-	-	-	None	-	-	-
1024-1	Art Room (front)	SK	App	13.5	3/25/2021	-	-	-	None	-	-	-
1024-2	Art Room (rear)	SK	App	6.1	3/25/2021	-	-	-	None	-	-	-
1025-1	Library	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
1025-2	Library	SPY	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
1026-1	ADA Bathroom by Staff Room	SK	App	4.85	3/25/2021	-	-	-	None	-	-	-
1027-1	Staff Room Bathroom	SK	App	2.62	3/25/2021	-	-	-	None	-	-	-
1027-2	Staff Room	SK	App	6.05	3/25/2021	-	-	-	None	-	-	-
1027-3	Staff Room	SPY	App	4.62	3/25/2021	-	-	-	None	-	-	-
1028-1	Room 7	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1029-1	Room 9	SK	App	4.81	3/25/2021	-	-	-	None	-	-	-
1030-1	Room 11	SK	App	3.73	3/25/2021	-	-	-	None	-	-	-
1031-1	Room 13	SK	App	2.45	3/25/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1031-2	Room 13	WF	App	1.56	3/25/2021	-	-	-	None	-	-	-
1032-1	Room 14	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1032-2	Room 14	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
1033-1	Room 12	SK	App	6.98	3/25/2021	-	-	-	None	-	-	-
1034-1	Room 10	SK	App	10.4	3/25/2021	-	-	-	None	-	-	-
1035-1	Room 8	SK	App	5.28	3/25/2021	-	-	-	None	-	-	-
1035-2	Room 8	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
1036-1	Nurse's Office	SK	App	1.23	3/25/2021	-	-	-	None	-	-	-
1036-2	Nurse's Office Bathroom	SK	App	6.33	3/25/2021	-	-	-	None	-	-	-
1037-1	Main Office Bathroom	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
1037-2	Main Office	WF	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1037-3	Main Office	BF	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1038-1	Room 4	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1039-1	Room 3	SK	App	2.33	3/25/2021	-	-	-	None	-	-	-
1039-2	Room 3	WF	App	6.42	3/25/2021	-	-	-	None	-	-	-
1039-3	Room 3 Bathroom	SK	App		3/25/2021	-	-	-	None	Removed from Service	-	-
1040-1	Room 2	SK	App	3.47	3/25/2021	-	-	-	None	-	-	-
1040-2	Room 2	WF	App	6.01	3/25/2021	-	-	-	None	-	-	-
1040-3	Room 2 Bathroom	SK	App	64.9	3/25/2021				Additional Sampling Required			
1041-1	Room 1	SK	App	4.02	3/25/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1041-2	Room 1	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
1041-3	Room 1 Bathroom	SK	App		3/25/2021	-	-	-	None	Removed from Service	-	-

Laboratory Report

NYE Report #: 2211243-17292

March 29, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Furnace Woods Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on March 25, 2021. New York Environmental analyzed the samples on March 26, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	25 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210325P148	1	Custodial Office Bathroom-SK; Initial	1.00	1.91	µg/L	
210325P149	2	Kitchen Island-SK; Initial	1.00	16.2	µg/L	H
210325P150	3	Kitchen 3-Bay (left)-SK; Initial	1.00	47.9	µg/L	H
210325P151	4	Kitchen 3-Bay (center)-SPY; Initial	1.00	2.57	µg/L	
210325P152	5	Kitchen 3-Bay (right)-SK; Initial	1.00	1.60	µg/L	
210325P153	6	Boy's Locker Room Vestibule-WF; Initial	1.00	<1.00	µg/L	
210325P154	7	Boy's Locker Room Vestibule-BF; Initial	1.00	<1.00	µg/L	
210325P155	8	Room 20-SK; Initial	1.00	11.0	µg/L	
210325P156	9	Room 22-SK; Initial	1.00	37.0	µg/L	H
210325P157	10	Room 22-WF; Initial	1.00	6.88	µg/L	
210325P158	11	Room 24-SK; Initial	1.00	7.28	µg/L	
210325P159	12	Room 24-WF; Initial	1.00	6.48	µg/L	
210325P160	13	Room 26-SK; Initial	1.00	8.49	µg/L	
210325P161	14	Room 26-WF; Initial	1.00	5.03	µg/L	
210325P162	15	Room 28-SK; Initial	1.00	1.01	µg/L	
210325P163	16	Room 28-WF; Initial	1.00	1.94	µg/L	
210325P164	17	Room 30-SK; Initial	1.00	2.53	µg/L	
210325P165	18	Room 30-WF; Initial	1.00	1.21	µg/L	
210325P166	19	Room 29-SK; Initial	1.00	<1.00	µg/L	
210325P167	20	Room 29-WF; Initial	1.00	<1.00	µg/L	
210325P168	21	Room 27-SK; Initial	1.00	1.10	µg/L	
210325P169	22	Room 27-WF; Initial	1.00	1.67	µg/L	
210325P170	23	Room 25-SK; Initial	1.00	15.9	µg/L	H
210325P171	24	Room 25-WF; Initial	1.00	15.1	µg/L	H
210325P172	25	Room 23-SK; Initial	1.00	71.2	µg/L	E,H
210325P173	26	Room 23-WF; Initial	1.00	6.41	µg/L	



Date Collected:	25 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210325P174	27	Room 21-SK; Initial	1.00	304	µg/L	E,H
210325P175	28	Men's Bathroom by Art Room (left)-SK; Initial	1.00	25.2	µg/L	H
210325P176	29	Men's Bathroom by Art Room (right)-SK; Initial	1.00	4.14	µg/L	
210325P177	30	Art Room (front)-SK; Initial	1.00	13.5	µg/L	
210325P178	31	Art Room (rear)-SK; Initial	1.00	6.10	µg/L	
210325P179	32	ADA Bathroom by Staff Room-SK; Initial	1.00	4.85	µg/L	
210325P180	33	Staff Room Bathroom-SK; Initial	1.00	2.62	µg/L	
210325P181	34	Staff Room -SK; Initial	1.00	6.05	µg/L	
210325P182	35	Staff Room -SPY; Initial	1.00	4.62	µg/L	
210325P183	36	Room 7-SK; Initial	1.00	<1.00	µg/L	
210325P184	37	Room 9-SK; Initial	1.00	4.81	µg/L	
210325P185	38	Room 11-SK; Initial	1.00	3.73	µg/L	
210325P186	39	Room 13-SK; Initial	1.00	2.45	µg/L	
210325P187	40	Room 13-WF; Initial	1.00	1.56	µg/L	
210325P188	41	Room 14-SK; Initial	1.00	<1.00	µg/L	
210325P189	42	Room 12-SK; Initial	1.00	6.98	µg/L	
210325P190	43	Room 10-SK; Initial	1.00	10.4	µg/L	
210325P191	44	Room 8-SK; Initial	1.00	5.28	µg/L	
210325P192	45	Nurse's Office-SK; Initial	1.00	1.23	µg/L	
210325P193	46	Nurse's Office Bathroom-SK; Initial	1.00	6.33	µg/L	
210325P194	47	Main Office -WF; Initial	1.00	<1.00	µg/L	
210325P195	48	Main Office -BF; Initial	1.00	<1.00	µg/L	
210325P196	49	Room 4-SK; Initial	1.00	<1.00	µg/L	
210325P197	50	Room 3 -SK; Initial	1.00	2.33	µg/L	
210325P198	51	Room 3 -WF; Initial	1.00	6.42	µg/L	
210325P199	52	Room 2-SK; Initial	1.00	3.47	µg/L	
210325P200	53	Room 2-WF; Initial	1.00	6.01	µg/L	



Date Collected:	25 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210325P201	54	Room 2 Bathroom-SK; Initial	1.00	64.9	µg/L	E,H
210325P202	55	Room 1-SK; Initial	1.00	4.02	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix D

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Custodial Locker Room Bathroom	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1002-1	Custodial Office 106 Kitchenette	SK	App	1.1	3/25/2021	-	-	-	None	-	-	-
1002-2	Custodial Office 106 Kitchenette	SPY	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1003-1	Custodial Closet by Custodial Office 106	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-
1004-1	Boys Locker Room Bathroom (Left)	SK	N/A		3/25/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1004-2	Boys Locker Room Bathroom (Right)	SK	N/A		3/25/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1004-3	Boys Locker Room	WF	App	3.46	3/25/2021	-	-	-	None	-	-	-
1005-1	Shop 'A' Room 103	SK	App	3.34	3/25/2021	-	-	-	None	-	-	-
1006-1	Hall by Room 101	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
1006-2	Hall by Room 101 (Bottle Filler)	BF	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1007-1	Boys Bathroom by Room 101	SK	App	10.9	3/25/2021	-	-	-	None	-	-	-
1008-1	Girls Bathroom by Room 101 (Left)	SK	App	10.2	3/25/2021	-	-	-	None	-	-	-
1008-2	Girls Bathroom by Room 101 (Right)	SK	App	9.47	3/25/2021	-	-	-	None	-	-	-
1009-1	Fitness Center Room 101	WF	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1010-1	Health Room 102	SK	App	4.01	3/25/2021	-	-	-	None	-	-	-
1011-1	Boys Coaches Office Bathroom	SK	App	9.18	3/25/2021	-	-	-	None	-	-	-
1012-1	Girls Coaches Office Bathroom	SK	App	4.82	3/25/2021	-	-	-	None	-	-	-
1013-1	Girls Locker Room	WF	App	8.83	3/25/2021	-	-	-	None	-	-	-
1013-2	Girls Locker Room Bathroom (Left)	SK	N/A		3/25/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1013-3	Girls Locker Room Bathroom (Right)	SK	N/A		3/25/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1014-1	Womens Staff Bathroom by Gym	SK	App	3.36	3/25/2021	-	-	-	None	-	-	-
1015-1	Mens Staff Bathroom by Gym	SK	App	7.07	3/25/2021	-	-	-	None	-	-	-
1016-1	Custodial Closet by Water Meter Room	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-
1017-1	Nurses Office	SK	App	4.03	3/25/2021	-	-	-	None	-	-	-
1017-2	Nurses Office Bathroom	SK	App	3.31	3/25/2021	-	-	-	None	-	-	-
1018-1	Teachers Lounge Kitchenette	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1019-1	Boys Bathroom by Room 153 (Left)	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1019-2	Boys Bathroom by Room 153 (Right)	SK	App	6.72	3/25/2021	-	-	-	None	-	-	-
1020-1	Hall by Room 153 (Left)	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
1020-2	Hall by Room 153 (Right)	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
1021-1	Girls Bathroom by Room 153 (Left)	SK	App	2.21	3/25/2021	-	-	-	None	-	-	-
1021-2	Girls Bathroom by Room 153 (Right)	SK	App	1.94	3/25/2021	-	-	-	None	-	-	-
1022-1	Science Room 153 Teachers Station	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
1022-2	Science Room 153 Counter @ A	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
1022-3	Science Room 153 Counter @ B	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
1022-4	Science Room 153 Counter @ C	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
1023-1	Custodial Closet Room 152	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-
1024-1	Staff Bathroom in PPS Office	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
2001-1	Custodial Closet by Room 251	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-
2002-1	Boys Bathroom by Room 256 (Left)	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2002-2	Boys Bathroom by Room 256 (Right)	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
2003-1	Hall by Room 256 (Left)	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
2003-2	Hall by Room 256 (Right)	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
2004-1	Girls Bathroom by Room 256 (Left)	SK	App	1.58	3/25/2021	-	-	-	None	-	-	-
2004-2	Girls Bathroom by Room 256 (Right)	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
2005-1	Science Room 256 Teachers Station	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
2005-2	Science Room 256 Counter @ A	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
2005-3	Science Room 256 Counter @ B	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
2005-4	Science Room 256 Counter @ C	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
2006-1	Girls Bathroom by Room 211 @ A	SK	App	6.49	3/25/2021	-	-	-	None	-	-	-
2006-2	Girls Bathroom by Room 211 @ B	SK	App	2.95	3/25/2021	-	-	-	None	-	-	-
2006-3	Girls Bathroom by Room 211 @ C	SK	App	1.23	3/25/2021	-	-	-	None	-	-	-
2006-4	Girls Bathroom by Room 211 @ D	SK	App	1.74	3/25/2021	-	-	-	None	-	-	-
2006-5	Girls Bathroom by Room 211 @ E	SK	App	5.14	3/25/2021	-	-	-	None	-	-	-
2007-1	Hall by Room 211	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
2008-1	Custodial Closet in Music Hallway	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-
2009-1	Band Room 200 Kitchenette	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
2010-1	Hall by Band Room 209	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
2010-2	Hall by Band Room 209 (Bottle Filler)	BF	App	<1.0	3/25/2021	-	-	-	None	-	-	-
2011-1	Room 210	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2012-1	Hall by Room 204	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
2012-2	Hall by Room 204 (Bottle Filler)	BF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
2013-1	Boys Bathroom by Room 204 @ A	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
2013-2	Boys Bathroom by Room 204 @ B	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
2013-3	Boys Bathroom by Room 204 @ C	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
2013-4	Boys Bathroom by Room 204 @ D	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
2014-1	Custodial Closet by Room 204	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-
2015-1	Room 204 Counter @ A	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
2015-2	Room 204 Counter @ B	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
2016-1	Home Economics Rom 203 Station 1	SK	App		3/25/2021	-	-	-	None	Removed from Service	-	-
2016-2	Home Economics Rom 203 Station 2	SK	App		3/25/2021	-	-	-	None	Sign Posted	-	-
2016-3	Home Economics Rom 203 Station 3	SK	App		3/25/2021	-	-	-	None	Sign Posted	-	-
2016-4	Home Economics Rom 203 Station 4	SK	App		3/25/2021	-	-	-	None	Sign Posted	-	-
2017-1	Art Room 202 Unit 1 @ A	SK	App	12	3/25/2021	-	-	-	None	-	-	-
2017-2	Art Room 202 Unit 1 @ B	SK	App	2.46	3/25/2021	-	-	-	None	-	-	-
2017-3	Art Room 202 Unit 1 @ C	SK	App	3.04	3/25/2021	-	-	-	None	-	-	-
2017-4	Art Room 202 Unit 2 @ A	SK	App	4.36	3/25/2021	-	-	-	None	-	-	-
2017-5	Art Room 202 Unit 2 @ B	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
2017-6	Art Room 202 Unit 2 @ C	SK	App	3.4	3/25/2021	-	-	-	None	-	-	-
2018-1	Art Room 201 Unit @ A	SK	App	5.93	3/25/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-2	Art Room 201 Unit @ B	SK	App	2.5	3/25/2021	-	-	-	None	-	-	-
2019-1	Hall by Room 206	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
2020-1	Room 205	SK	App	1.54	3/25/2021	-	-	-	None	-	-	-
2020-2	Room 205	SPY	App	151	3/25/2021				Additional Sampling Required			
2021-1	Kitchen Womens Bathroom	SK	App	17.5	3/25/2021				Additional Sampling Required			
2021-2	Kitchen Faculty Lounge	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
2021-3	Kitchen Custodial Closet	SP	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
2021-4	Kitchen Serving Line #1	SK	App	409	3/25/2021				Additional Sampling Required			
2021-5	Kitchen Handwash by Serving Line #1	SK	App	35.6	3/25/2021				Additional Sampling Required			
2021-6	Kitchen 2 Bay	SK	App	1.86	3/25/2021	-	-	-	None	-	-	-
2021-7	Kitchen 3 Bay (Left)	SK	App	14.4	3/25/2021	-	-	-	None	-	-	-
2021-8	Kitchen 3 Bay (Middle)	SPY	N/A		3/25/2021	-	-	-	Hot Water Only Sign Required	-	-	-
2021-9	Kitchen 3 Bay (Middle)	SK	N/A		3/25/2021	-	-	-	Hot Water Only Sign Required	-	-	-
2021-10	Kitchen 3 Bay (Right)	SK	App	3.73	3/25/2021	-	-	-	None	-	-	-
2021-11	Kitchen 1 Bay	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
2021-12	Kitchen Serving Line #2 Handwash	SK	App	2.72	3/25/2021	-	-	-	None	-	-	-
3001-1	Hall by Room 308A	WF	App	2.57	3/25/2021	-	-	-	None	-	-	-
3001-2	Hall by Room 308A (Bottle Filler)	BF	App	2.13	3/25/2021	-	-	-	None	-	-	-
3002-1	Room 308A	SK	App	6.09	3/25/2021	-	-	-	None	-	-	-
3003-1	Custodial Closet by Room 306	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3004-1	Mens Staff Bathroom by Room 306	SK	App	8.89	3/25/2021	-	-	-	None	-	-	-
3005-1	Hall by Room 306	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
3006-1	Womens Staff Bathroom by Room 306 (Left)	SK	App	3.87	3/25/2021	-	-	-	None	-	-	-
3006-2	Womens Staff Bathroom by Room 306 (Right)	SK	App	1.57	3/25/2021	-	-	-	None	-	-	-
3007-1	Room 301	SK	App	2.9	3/25/2021	-	-	-	None	-	-	-
3008-1	Science Room 312 Counter 1 @ A	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3008-2	Science Room 312 Counter 1 @ B	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3008-3	Science Room 312 Counter 2 @ A	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3009-1	Girls Bathroom by Room 312 @ A	SK	App	2.55	3/25/2021	-	-	-	None	-	-	-
3009-2	Girls Bathroom by Room 312 @ B	SK	App	15.4	3/25/2021				Additional Sampling Required			
3009-3	Girls Bathroom by Room 312 @ C	SK	App	84.8	3/25/2021				Additional Sampling Required			
3009-4	Girls Bathroom by Room 312 @ D	SK	App	4.82	3/25/2021	-	-	-	None	-	-	-
3010-1	Science Room 314 Counter @ A	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3010-2	Science Room 314 Counter @ B	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3010-3	Science Room 314 Counter @ C	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3010-4	Science Room 314 Counter @ D	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3011-1	Room 313	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
3012-1	Science Room 315 Teachers Station	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
3012-2	Science Room 315 Counter 1	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
3012-3	Science Room 315 Counter 2	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3013-1	Science Prep Room 300 Counter 1	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
3013-2	Science Prep Room 300 Counter 2	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
3014-1	Science Room 317 Teachers Station	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
3014-2	Science Room 317 Counter 1	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
3014-3	Science Room 317 Counter 2	SK	N/A		3/25/2021	-	-	-	None	Sign Posted	-	-
3015-1	Science Room 318 Counter @ A	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3015-2	Science Room 318 Counter @ B	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3015-3	Science Room 318 Counter @ C	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3015-4	Science Room 318 Counter @ D	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3016-1	Hall by Room 316	WF	App	<1.0	3/25/2021	-	-	-	None	-	-	-
3016-2	Hall by Room 316 (Bottle Filler)	BF	App	<1.0	3/25/2021	-	-	-	None	-	-	-
3017-1	Boys Bathroom by Room 319 @ A	SK	App	5.69	3/25/2021	-	-	-	None	-	-	-
3017-2	Boys Bathroom by Room 319 @ B	SK	App	2.62	3/25/2021	-	-	-	None	-	-	-
3017-3	Boys Bathroom by Room 319 @ C	SK	App	9.03	3/25/2021	-	-	-	None	-	-	-
3017-4	Boys Bathroom by Room 319 @ D	SK	App	4.41	3/25/2021	-	-	-	None	-	-	-
3018-1	Science Room 319 Counter @ A	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3018-2	Science Room 319 Counter @ B	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3018-3	Science Room 319 Counter @ C	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3018-4	Science Room 319 Counter @ D	SK	N/A		3/25/2021	-	-	-	Sign Required	-	-	-
3019-1	Custodial Closet by Room 322	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3020-1	Faculty Room 'B' by Room 322	SK	App	2.92	3/25/2021	-	-	-	None	-	-	-
3021-1	Hall by Room 326	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
3022-1	Custodial Closet by Office 362	SS	N/A		3/25/2021	-	-	-	None	Locked Door	-	-
3023-1	Office 362	SK	App	1.01	3/25/2021	-	-	-	None	-	-	-
3024-1	Mens Bathroom by Office 362 (Left)	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
3024-2	Mens Bathroom by Office 362 (Right)	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
3025-1	Hall by Office 362 (Left)	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
3025-2	Hall by Office 362 (Right)	WF	App		3/25/2021	-	-	-	None	Removed from Service	-	-
3026-1	Womens Bathroom by Office 362 (Left)	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
3026-2	Womens Bathroom by Office 362 (Right)	SK	App	<1.0	3/25/2021	-	-	-	None	-	-	-
1025-1	Ice Machine Room	IM	App	<1.0	3/25/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2211241-17290

March 29, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Blue Mountain Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on March 25, 2021. New York Environmental analyzed the samples on March 26, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	25 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210325P001	1	Custodial Locker Room Bathroom-SK; Initial	1.00	<1.00	µg/L	
210325P002	2	Custodial Office 106 Kitchenette-SK; Initial	1.00	1.10	µg/L	
210325P003	3	Custodial Office 106 Kitchenette-SPY; Initial	1.00	<1.00	µg/L	
210325P004	4	Boys Locker Room-WF; Initial	1.00	3.46	µg/L	
210325P005	5	Shop 'A' Room 103-SK; Initial	1.00	3.34	µg/L	
210325P006	6	Hall by Room 101 (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210325P007	7	Boys Bathroom by Room 101-SK; Initial	1.00	10.9	µg/L	
210325P008	8	Girls Bathroom by Room 101 (Left)-SK; Initial	1.00	10.2	µg/L	
210325P009	9	Girls Bathroom by Room 101 (Right)-SK; Initial	1.00	9.47	µg/L	
210325P010	10	Fitness Center Room 101-WF; Initial	1.00	<1.00	µg/L	
210325P011	11	Health Room 102-SK; Initial	1.00	4.01	µg/L	
210325P012	12	Boys Coaches Office Bathroom-SK; Initial	1.00	9.18	µg/L	
210325P013	13	Girls Coaches Office Bathroom-SK; Initial	1.00	4.82	µg/L	
210325P014	14	Girls Locker Room-WF; Initial	1.00	8.83	µg/L	
210325P015	15	Womens Staff Bathroom by Gym-SK; Initial	1.00	3.36	µg/L	
210325P016	16	Mens Staff Bathroom by Gym-SK; Initial	1.00	7.07	µg/L	
210325P017	17	Nurses Office -SK; Initial	1.00	4.03	µg/L	
210325P018	18	Nurses Office Bathroom-SK; Initial	1.00	3.31	µg/L	
210325P019	19	Teachers Lounge Kitchenette-SK; Initial	1.00	<1.00	µg/L	
210325P020	20	Boys Bathroom by Room 153 (Left)-SK; Initial	1.00	<1.00	µg/L	
210325P021	21	Boys Bathroom by Room 153 (Right)-SK; Initial	1.00	6.72	µg/L	
210325P022	22	Girls Bathroom by Room 153 (Left)-SK; Initial	1.00	2.21	µg/L	
210325P023	23	Girls Bathroom by Room 153 (Right)-SK; Initial	1.00	1.94	µg/L	
210325P024	24	Staff Bathroom in PPS Office-SK; Initial	1.00	<1.00	µg/L	
210325P025	25	Boys Bathroom by Room 256 (Left)-SK; Initial	1.00	<1.00	µg/L	
210325P026	26	Boys Bathroom by Room 256 (Right)-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	25 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210325P027	27	Girls Bathroom by Room 256 (Left)-SK; Initial	1.00	1.58	µg/L	
210325P028	28	Girls Bathroom by Room 256 (Right)-SK; Initial	1.00	<1.00	µg/L	
210325P029	29	Girls Bathroom by Room 211 @ A-SK; Initial	1.00	6.49	µg/L	
210325P030	30	Girls Bathroom by Room 211 @ B-SK; Initial	1.00	2.95	µg/L	
210325P031	31	Girls Bathroom by Room 211 @ C-SK; Initial	1.00	1.23	µg/L	
210325P032	32	Girls Bathroom by Room 211 @ D-SK; Initial	1.00	1.74	µg/L	
210325P033	33	Girls Bathroom by Room 211 @ E-SK; Initial	1.00	5.14	µg/L	
210325P034	34	Hall by Band Room 209 (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210325P035	35	Boys Bathroom by Room 204 @ A-SK; Initial	1.00	<1.00	µg/L	
210325P036	36	Boys Bathroom by Room 204 @ B-SK; Initial	1.00	<1.00	µg/L	
210325P037	37	Boys Bathroom by Room 204 @ C-SK; Initial	1.00	<1.00	µg/L	
210325P038	38	Boys Bathroom by Room 204 @ D-SK; Initial	1.00	<1.00	µg/L	
210325P039	39	Art Room 202 Unit 1 @ A-SK; Initial	1.00	12.0	µg/L	
210325P040	40	Art Room 202 Unit 1 @ B-SK; Initial	1.00	2.46	µg/L	
210325P041	41	Art Room 202 Unit 1 @ C-SK; Initial	1.00	3.04	µg/L	
210325P042	42	Art Room 202 Unit 2 @ A-SK; Initial	1.00	4.36	µg/L	
210325P043	43	Art Room 202 Unit 2 @ B-SK; Initial	1.00	<1.00	µg/L	
210325P044	44	Art Room 202 Unit 2 @ C-SK; Initial	1.00	3.40	µg/L	
210325P045	45	Art Room 201 Unit @ A-SK; Initial	1.00	5.93	µg/L	
210325P046	46	Art Room 201 Unit @ B-SK; Initial	1.00	2.50	µg/L	
210325P047	47	Room 205-SK; Initial	1.00	1.54	µg/L	
210325P048	48	Room 205-SPY; Initial	1.00	151	µg/L	E,H
210325P049	49	Kitchen Womens Bathroom-SK; Initial	1.00	17.5	µg/L	H
210325P050	50	Kitchen Serving Line #1-SK; Initial	1.00	409	µg/L	E,H
210325P051	51	Kitchen Handwash by Serving Line #1-SK; Initial	1.00	35.6	µg/L	H
210325P052	52	Kitchen 2 Bay-SK; Initial	1.00	1.86	µg/L	
210325P053	53	Kitchen 3 Bay (Left)-SK; Initial	1.00	14.4	µg/L	



Date Collected:	25 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210325P054	54	Kitchen 3 Bay (Right)-SK; Initial	1.00	3.73	µg/L	
210325P055	55	Kitchen 1 Bay-SK; Initial	1.00	<1.00	µg/L	
210325P056	56	Kitchen Serving Line #2 Handwash-SK; Initial	1.00	2.72	µg/L	
210325P057	57	Hall by Room 308A-WF; Initial	1.00	2.57	µg/L	
210325P058	58	Hall by Room 308A (Bottle Filler)-BF; Initial	1.00	2.13	µg/L	
210325P059	59	Room 308A-SK; Initial	1.00	6.09	µg/L	
210325P060	60	Mens Staff Bathroom by Room 306-SK; Initial	1.00	8.89	µg/L	
210325P061	61	Womens Staff Bathroom by Room 306 (Left)-SK; Initial	1.00	3.87	µg/L	
210325P062	62	Womens Staff Bathroom by Room 306 (Right)-SK; Initial	1.00	1.57	µg/L	
210325P063	63	Room 301-SK; Initial	1.00	2.90	µg/L	
210325P064	64	Girls Bathroom by Room 312 @ A-SK; Initial	1.00	2.55	µg/L	
210325P065	65	Girls Bathroom by Room 312 @ B-SK; Initial	1.00	15.4	µg/L	H
210325P066	66	Girls Bathroom by Room 312 @ C-SK; Initial	1.00	84.8	µg/L	E,H
210325P067	67	Girls Bathroom by Room 312 @ D-SK; Initial	1.00	4.82	µg/L	
210325P068	68	Hall by Room 316-WF; Initial	1.00	<1.00	µg/L	
210325P069	69	Hall by Room 316 (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210325P070	70	Boys Bathroom by Room 319 @ A-SK; Initial	1.00	5.69	µg/L	
210325P071	71	Boys Bathroom by Room 319 @ B-SK; Initial	1.00	2.62	µg/L	
210325P072	72	Boys Bathroom by Room 319 @ C-SK; Initial	1.00	9.03	µg/L	
210325P073	73	Boys Bathroom by Room 319 @ D-SK; Initial	1.00	4.41	µg/L	
210325P074	74	Faculty Room 'B' by Room 322-SK; Initial	1.00	2.92	µg/L	
210325P075	75	Office 362-SK; Initial	1.00	1.01	µg/L	
210325P076	76	Mens Bathroom by Office 362 (Left)-SK; Initial	1.00	<1.00	µg/L	
210325P077	77	Mens Bathroom by Office 362 (Right)-SK; Initial	1.00	<1.00	µg/L	
210325P078	78	Womens Bathroom by Office 362 (Left)-SK; Initial	1.00	<1.00	µg/L	
210325P079	79	Womens Bathroom by Office 362 (Right)-SK; Initial	1.00	<1.00	µg/L	
210325P080	80	Ice Machine Room-IM; Initial	1.00	<1.00	µg/L	



Date Collected:	25 Mar 2021
Date Received:	25 Mar 2021
Date Analyzed:	26 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID **CID** **Sample Location/Description** **LOQ** **Result** **Units** **Flag**

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix E

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Open Shop Area Room 009 @A	SK	App	6.49	3/26/2021	-	-	-	None	-	-	-
0001-2	Open Shop Area Room 009 @B	SK	App	9.08	3/26/2021	-	-	-	None	-	-	-
0001-3	Open Shop Area Room 009 @C	SK	App	1.51	3/26/2021	-	-	-	None	-	-	-
0002-1	Custodial Closet by Room 010	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
0003-1	Art Room 008 Counter 1	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
0003-2	Art Room 008 Counter 2	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
0004-1	Custodial Closet J02 by Art Room 006	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
0005-1	Hall by Art Room 006	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-
0006-1	Boys Bathroom by Art Room 006	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
0007-1	Art Room 006 Counter 1	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
0007-2	Art Room 006 Counter 2	SK	App	49.1	3/26/2021				Additional Sampling Required			
0008-1	Art Room 004 Counter 1	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
0008-2	Art Room 004 Counter 2	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
0009-1	Girls Bathroom by Art Room 005 @A	SK	App	4.62	3/26/2021	-	-	-	None	-	-	-
0009-2	Girls Bathroom by Art Room 005 @B	SK	App	6.91	3/26/2021	-	-	-	None	-	-	-
0010-1	Hall by Art Room 005	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-
0011-1	Art Room 005 @A	SK	App	8.68	3/26/2021	-	-	-	None	-	-	-
0011-2	Art Room 005 @B	SK	App	42.3	3/26/2021				Additional Sampling Required			
0012-1	Room 003	SK	App	2.79	3/26/2021	-	-	-	None	-	-	-
0012-2	Room 003	SPY	App	2.71	3/26/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Staff Room 113A	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1002-1	Hall by Room 113	WF	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1002-2	Hall by Room 113 (Bottle Filler)	BF	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1003-1	Nurses Office 110	SK	App	1.28	3/26/2021	-	-	-	None	-	-	-
1003-2	Nurses Office 110 Bathroom	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1004-1	Hall by Nurses Office 110	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-
1005-1	Custodial Closet by Nurses Office 110	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
1006-1	Mens Bathroom by Nurses Office 110 @A	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1006-2	Mens Bathroom by Nurses Office 110 @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1007-1	Principal Office Bathroom	SK	App	1.15	3/26/2021	-	-	-	None	-	-	-
1008-1	Womens Bathroom by Asst. Principal Office @A	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1008-2	Womens Bathroom by Asst. Principal Office @B	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1009-1	Library Office	SK	App	2.49	3/26/2021	-	-	-	None	-	-	-
1010-1	Old Tech Room 162	SK	App	1.17	3/26/2021	-	-	-	None	-	-	-
1011-1	Teachers Dining Room 125B	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1011-2	Teachers Dining Room 125B	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1011-3	Teachers Dining Room 125B Bathroom	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1012-1	Mens Bathroom by Room 125B @A	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1012-2	Mens Bathroom by Room 125B @B	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1013-1	Hall by Room 125B	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1014-1	Womens Bathroom by Room 125B (Right)	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1014-2	Womens Bathroom by Room 125B (Left)	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1015-1	Hall by Café Area 125	WF	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1015-2	Hall by Café Area 125 (Bottle Filler)	BF	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1016-1	Kitchen Serving Area 126	IM	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1016-2	Kitchen Serving Area 126 Handwash	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1017-1	Kitchen 127 3 Bay (Left)	SK	App	4.41	3/26/2021	-	-	-	None	-	-	-
1017-2	Kitchen 127 3 Bay (Left)	SPY	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1017-3	Kitchen 127 3 Bay (Right)	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1017-4	Kitchen 127 1 Bay (Left of Pot Filler)	SK	App	1.58	3/26/2021	-	-	-	None	-	-	-
1017-5	Kitchen 127 1 Bay (Right of Pot Filler)	SK	App	1.12	3/26/2021	-	-	-	None	-	-	-
1017-6	Kitchen 127 Pot Filler	SP	App	384	3/26/2021				Additional Sampling Required			
1017-7	Kitchen 127 Bathroom	SK	App	15.6	3/26/2021				Additional Sampling Required			
1018-1	Custodial Closet J15 by Room 133	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
1019-1	Womens Bathroom by Room 133 Unit @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1019-2	Womens Bathroom by Room 133 Unit @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1019-3	Womens Bathroom by Room 133 Unit @C	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1020-1	Hall by Room 133 (Right)	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-
1020-2	Hall by Room 133 (Left)	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-
1021-1	Mens Bathroom by Room 133 Unit 1 @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1021-2	Mens Bathroom by Room 133 Unit 1 @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1021-3	Mens Bathroom by Room 133 Unit 2 @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1021-4	Mens Bathroom by Room 133 Unit 2 @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1022-1	Custodial Closet J13 by Staircase 8 (1R)	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
1023-1	Mens Bathroom by Staircase 8 (1R) Unit 1 @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-2	Mens Bathroom by Staircase 8 (1R) Unit 1 @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-3	Mens Bathroom by Staircase 8 (1R) Unit 1 @C	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-4	Mens Bathroom by Staircase 8 (1R) Unit 2 @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-5	Mens Bathroom by Staircase 8 (1R) Unit 2 @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1024-1	Womens Bathroom by Staircase 8 (1R) Unit 1 @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1024-2	Womens Bathroom by Staircase 8 (1R) Unit 1 @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1024-3	Womens Bathroom by Staircase 8 (1R) Unit 1 @C	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1024-4	Womens Bathroom by Staircase 8 (1R) Unit 2 @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1024-5	Womens Bathroom by Staircase 8 (1R) Unit 2 @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1025-1	Room 121	SK	App	5.07	3/26/2021	-	-	-	None	-	-	-
1026-1	Womens Bathroom by Athletic Director 117 @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1026-2	Womens Bathroom by Athletic Director 117 @B	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1026-3	Womens Bathroom by Athletic Director 117 @C	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1027-1	Custodial Closet J12 by Athletic Director 117	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
1028-1	Storage Closet by Athletic Director 117	IM	App	<1.0	3/26/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1029-1	Mens Bathroom by Athletic Office 115A @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1029-2	Mens Bathroom by Athletic Office 115A @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1030-1	Storage Bathroom by Athletic Office 115A	SK	N/A		3/26/2021	-	-	-	None	No Access	-	-
1031-1	Security Office Bathroom	SK	App	3.63	3/26/2021	-	-	-	None	-	-	-
1032-1	Coaches Office Bathroom by Gym 115	SK	App	3.39	3/26/2021	-	-	-	None	-	-	-
1033-1	Hall by Gym 115	WF	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1033-2	Hall by Gym 115 (Bottle Filler)	BF	App	<1.0	3/26/2021	-	-	-	None	-	-	-
1034-1	Mens Bathroom by Athletic Dome @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1034-2	Mens Bathroom by Athletic Dome @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1035-1	Womens Bathroom by Athletic Dome @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1035-2	Womens Bathroom by Athletic Dome @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1036-1	Concession Stand 116B	SK	App	2.38	3/26/2021	-	-	-	None	-	-	-
1037-1	Hall by Athletic Dome 116	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-
1038-1	Athletic Trainers Office 117	SK	App	1.17	3/26/2021	-	-	-	None	-	-	-
2001-1	Mens Bathroom by Room 224 @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2001-2	Mens Bathroom by Room 224 @B	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
2002-1	Custodial Closet J24 by Room 224	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
2003-1	Womens Bathroom by Room 224 @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2003-2	Womens Bathroom by Room 224 @B	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
2003-3	Womens Bathroom by Room 224 @C	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2004-1	Hall by Room 224	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-
2004-2	Hall by Room 224 (Bottle Filler)	BF	App	<1.0	3/26/2021	-	-	-	None	-	-	-
2005-1	Custodial Closet J25 by Room 233	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
2006-1	Womens Bathroom by Room 233 Unit @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2006-2	Womens Bathroom by Room 233 Unit @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2006-3	Womens Bathroom by Room 233 Unit @C	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2007-1	Hall by Room 233 (Right)	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-
2007-2	Hall by Room 233 (Left)	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-
2008-1	Mens Bathroom by Room 233 Unit 1 @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2008-2	Mens Bathroom by Room 233 Unit 1 @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2008-3	Mens Bathroom by Room 233 Unit 2 @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2008-4	Mens Bathroom by Room 233 Unit 2 @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2009-1	Science Room 225 Teacher Station	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-2	Science Room 225 Counter @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-3	Science Room 225 Table 1 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-4	Science Room 225 Table 1 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-5	Science Room 225 Table 2 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-6	Science Room 225 Table 2 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-7	Science Room 225 Counter @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-8	Science Room 225 Table 3 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2009-9	Science Room 225 Table 3 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-10	Science Room 225 Table 4 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-11	Science Room 225 Table 4 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-12	Science Room 225 Table 5 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-13	Science Room 225 Table 5 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-14	Science Room 225 Table 6 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2009-15	Science Room 225 Table 6 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2010-1	Science Prep Room 236A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-1	Science Room 237 Teachers Station	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-2	Science Room 237 Counter @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-3	Science Room 237 Table 1 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-4	Science Room 237 Table 1 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-5	Science Room 237 Table 2 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-6	Science Room 237 Table 2 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-7	Science Room 237 Table 3 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-8	Science Room 237 Table 3 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-9	Science Room 237 Counter @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-10	Science Room 237 Table 4 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-11	Science Room 237 Table 4 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-12	Science Room 237 Table 5 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2011-13	Science Room 237 Table 5 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-14	Science Room 237 Table 6 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2011-15	Science Room 237 Table 6 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-1	Science Room 236 Teachers Station	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-2	Science Room 236 Counter 1	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-3	Science Room 236 Table 1 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-4	Science Room 236 Table 1 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-5	Science Room 236 Table 2 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-6	Science Room 236 Table 2 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-7	Science Room 236 Table 3 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-8	Science Room 236 Table 3 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-9	Science Room 236 Table 4 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-10	Science Room 236 Table 4 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-11	Science Room 236 Table 5 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-12	Science Room 236 Table 5 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-13	Science Room 236 Table 6 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-14	Science Room 236 Table 6 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2012-15	Scienc Room 236 Counter 2	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-1	Science Room 235 Teachers Station	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-2	Science Room 235 Counter @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2013-3	Science Room 235 Table 1 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-4	Science Room 235 Table 1 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-5	Science Room 235 Table 2 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-6	Science Room 235 Table 2 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-7	Science Room 235 Table 3 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-8	Science Room 235 Table 3 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-9	Science Room 235 Counter @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-10	Science Room 235 Table 4 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-11	Science Room 235 Table 4 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-12	Science Room 235 Table 5 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-13	Science Room 235 Table 5 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-14	Science Room 235 Table 6 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2013-15	Science Room 235 Table 6 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2014-1	Science Prep Room Between 238 & 239 (Left)	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2014-2	Science Prep Room Between 238 & 239 (Right)	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-1	Science Room 239 Teachers Station	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-2	Science Room 239 Table 1 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-3	Science Room 239 Table 1 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-4	Science Room 239 Table 2 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-5	Science Room 239 Table 2 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2015-6	Science Room 239 Table 3 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-7	Science Room 239 Table 3 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-8	Science Room 239 Counter @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-9	Science Room 239 Table 4 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-10	Science Room 239 Table 4 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-11	Science Room 239 Table 5 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-12	Science Room 239 Table 5 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-13	Science Room 239 Table 6 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-14	Science Room 239 Table 6 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2015-15	Science Room 239 Counter @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-1	Science Room 217 Teachers Station	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-2	Science Room 217 Table 1 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-3	Science Room 217 Table 1 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-4	Science Room 217 Table 2 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-5	Science Room 217 Table 2 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-6	Science Room 217 Counter @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-7	Science Room 217 Table 3 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-8	Science Room 217 Table 3 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-9	Science Room 217 Table 4 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-10	Science Room 217 Table 4 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2016-11	Science Room 217 Counter @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-12	Science Room 217 Table 5 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-13	Science Room 217 Table 5 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-14	Science Room 217 Table 6 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2016-15	Science Room 217 Table 6 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2017-1	Science Prep Room by 217	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2017-2	Science Prep Room by 217 (Fume Hood)	SP	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2017-3	Science Prep Room by 215	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2017-4	Science Prep Room by 215 (Fume Hood)	SP	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-1	Science Room 215 Teachers Station	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-2	Science Room 215 Counter @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-3	Science Room 215 Table 1 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-4	Science Room 215 Table 1 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-5	Science Room 215 Table 2 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-6	Science Room 215 Table 2 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-7	Science Room 215 Table 3 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-8	Science Room 215 Table 3 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-9	Science Room 215 Counter @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-10	Science Room 215 Table 4 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-11	Science Room 215 Table 4 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-12	Science Room 215 Table 5 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-13	Science Room 215 Table 5 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-14	Science Room 215 Table 6 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2018-15	Science Room 215 Table 6 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2019-1	Custodial Closet J20 by Room 201	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
2020-1	Hall by Room 202	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-
2021-1	Womens Bathroom by Room 202 @A	SK	App	1.81	3/26/2021	-	-	-	None	-	-	-
2021-2	Womens Bathroom by Room 202 @B	SK	App	3.81	3/26/2021	-	-	-	None	-	-	-
2022-1	Mens Bathroom by Room 205 @A	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
2022-2	Mens Bathroom by Room 205 @B	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
2023-1	Custodial Closet J21 by Room 206	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
2024-1	Hall by Room 206	WF	App	<1.0	3/26/2021	-	-	-	None	-	-	-
2025-1	Hall by Room 211	WF	App	<1.0	3/26/2021	-	-	-	None	-	-	-
2025-2	Hall by Room 211 (Bottle Filler)	BF	App	<1.0	3/26/2021	-	-	-	None	-	-	-
2026-1	Faculty Womens Bathroom by Room 211 @A	SK	N/A		3/26/2021	-	-	-	Hot Water Only Sign Required	-	-	-
2026-2	Faculty Womens Bathroom by Room 211 @B	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
2027-1	Womens Bathroom by Staircase 8 (2R) Unit @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2027-2	Womens Bathroom by Staircase 8 (2R) Unit @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2027-3	Womens Bathroom by Staircase 8 (2R) Unit @C	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2028-1	Mens Bathroom by Staircase 8 (2R) Unit @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2028-2	Mens Bathroom by Staircase 8 (2R) Unit @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2028-3	Mens Bathroom by Staircase 8 (2R) Unit @C	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2029-1	Custodial Closet J23 by Staircase 8 (2R)	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
2030-1	Staff Lounge 218 Kitchenette	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
2030-2	Staff Lounge 218 Left Staff Bathroom	SK	App	<1.0	3/26/2021	-	-	-	None	-	-	-
2030-3	Staff Lounge 218 Right Staff Bathroom	SK	App	37.5	3/26/2021				Additional Sampling Required			
2031-1	Science Prep Room 220A in Teachers Workroom 220	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-1	Science Room 222 Teachers Station	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-2	Science Room 222 Table 1 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-3	Science Room 222 Table 1 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-4	Science Room 222 Counter @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-5	Science Room 222 Table 2 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-6	Science Room 222 Table 2 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-7	Science Room 222 Table 3 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-8	Science Room 222 Table 3 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-9	Science Room 222 Counter @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-10	Science Room 222 Table 4 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-11	Science Room 222 Table 4 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-12	Science Room 222 Table 5 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-13	Science Room 222 Table 5 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2032-14	Science Room 222 Table 6 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2032-15	Science Room 222 Table 6 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2033-1	Unisex Bathroom by Room 223 @A	SK	App	65.9	3/26/2021				Additional Sampling Required			
2033-2	Unisex Bathroom by Room 223 @B	SK	App	22.4	3/26/2021				Additional Sampling Required			
2034-1	Hall by Room 223	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-
2035-1	Old Mens Bathroom/New Records Room @A	SK	App		3/26/2021	-	-	-	None	No Access	-	-
2035-2	Old Mens Bathroom/New Records Room @B	SK	App		3/26/2021	-	-	-	None	No Access	-	-
2035-3	Old Mens Bathroom/New Records Room @C	SK	App		3/26/2021	-	-	-	None	No Access	-	-
2036-1	Science Room 223 Teachers Station	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-2	Science Room 223 Table 1 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-3	Science Room 223 Table 1 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-4	Science Room 223 Table 2 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-5	Science Room 223 Table 2 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-6	Science Room 223 Table 3 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-7	Science Room 223 Table 3 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-8	Science Room 223 Counter 1	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-9	Science Room 223 Counter 2	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-10	Science Room 223 Table 4 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-11	Science Room 223 Table 4 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-12	Science Room 223 Table 5 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2036-13	Science Room 223 Table 5 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-14	Science Room 223 Table 6 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2036-15	Science Room 223 Table 6 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2037-1	Custodial Closet J22 by Room 223	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
2038-1	Science Room 221 Teachers Station	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-2	Science Room 221 Table 1 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-3	Science Room 221 Table 1 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-4	Science Room 221 Table 2 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-5	Science Room 221 Table 2 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-6	Science Room 221 Table 3 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-7	Science Room 221 Table 3 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-8	Science Room 221 Counter 1	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-9	Science Room 221 Counter 2	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-10	Science Room 221 Table 4 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-11	Science Room 221 Table 4 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-12	Science Room 221 Table 5 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-13	Science Room 221 Table 5 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-14	Science Room 221 Table 6 @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2038-15	Science Room 221 Table 6 @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2039-1	Science Room 219 Teachers Station	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2039-2	Science Room 219 Counter @A	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
2039-3	Science Room 219 Counter @B	SK	N/A		3/26/2021	-	-	-	Sign Required	-	-	-
0013-1	Boys Locker Room Under Dome @A	SK	App	93.2	3/26/2021				Additional Sampling Required			
0013-2	Boys Locker Room Under Dome @B	SK	App	20.3	3/26/2021				Additional Sampling Required			
0013-3	Boys Locker Room Under Dome @C	SK	App	31.3	3/26/2021				Additional Sampling Required			
0013-4	Boys Locker Room Under Dome @D	SK	App	134	3/26/2021				Additional Sampling Required			
0013-5	Boys Locker Room Under Dome Custodial Closet	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
0014-1	Boys Locker Room Bathroom	SK	App	2.1	3/26/2021	-	-	-	None	-	-	-
0015-1	Custodial Closet J04 by Boys & Girls Locker Room	SS	N/A		3/26/2021	-	-	-	None	Locked door	-	-
0016-1	Girls Locker Room Bathroom @A	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0016-2	Girls Locker Room Bathroom @B	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0016-3	Girls Locker Room Bathroom @C	SK	N/A		3/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0016-4	Girls Locker Room (Left)	WF	App	75.8	3/26/2021				Additional Sampling Required			
0016-5	Girls Locker Room (Right)	WF	App		3/26/2021	-	-	-	None	Removed from Service	-	-
0017-1	Custodian Office	WF	App	1.01	3/26/2021	-	-	-	None	-	-	-
0017-2	Custodian Office Bathroom	SK	App	1.08	3/26/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2211269-17316

March 30, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Hendrick Hudson High School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on March 26, 2021. New York Environmental analyzed the samples on March 29, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	26 Mar 2021
Date Received:	26 Mar 2021
Date Analyzed:	29 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210326O001	1	Open Shop Area Room 009 @A-SK; Initial	1.00	6.49	µg/L	
210326O002	2	Open Shop Area Room 009 @B-SK; Initial	1.00	9.08	µg/L	
210326O003	3	Open Shop Area Room 009 @C-SK; Initial	1.00	1.51	µg/L	
210326O004	4	Art Room 008 Counter 1-SK; Initial	1.00	<1.00	µg/L	
210326O005	5	Art Room 008 Counter 2-SK; Initial	1.00	<1.00	µg/L	
210326O006	6	Boys Bathroom by Art Room 006-SK; Initial	1.00	<1.00	µg/L	
210326O007	7	Art Room 006 Counter 1-SK; Initial	1.00	<1.00	µg/L	
210326O008	8	Art Room 006 Counter 2-SK; Initial	1.00	49.1	µg/L	H
210326O009	9	Art Room 004 Counter 1-SK; Initial	1.00	<1.00	µg/L	
210326O010	10	Art Room 004 Counter 2-SK; Initial	1.00	<1.00	µg/L	
210326O011	11	Girls Bathroom by Art Room 005 @A-SK; Initial	1.00	4.62	µg/L	
210326O012	12	Girls Bathroom by Art Room 005 @B-SK; Initial	1.00	6.91	µg/L	
210326O013	13	Art Room 005 @A-SK; Initial	1.00	8.68	µg/L	
210326O014	14	Art Room 005 @B-SK; Initial	1.00	42.3	µg/L	H
210326O015	15	Room 003-SK; Initial	1.00	2.79	µg/L	
210326O016	16	Room 003-SPY; Initial	1.00	2.71	µg/L	
210326O017	17	Staff Room 113A-SK; Initial	1.00	<1.00	µg/L	
210326O018	18	Hall by Room 113-WF; Initial	1.00	<1.00	µg/L	
210326O019	19	Hall by Room 113 (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210326O020	20	Nurses Office 110-SK; Initial	1.00	1.28	µg/L	
210326O021	21	Mens Bathroom by Nurses Office 110 @A-SK; Initial	1.00	<1.00	µg/L	
210326O022	22	Principal Office Bathroom-SK; Initial	1.00	1.15	µg/L	
210326O023	23	Womens Bathroom by Asst. Principal Office @A-SK; Initial	1.00	<1.00	µg/L	
210326O024	24	Womens Bathroom by Asst. Principal Office @B-SK; Initial	1.00	<1.00	µg/L	
210326O025	25	Library Office-SK; Initial	1.00	2.49	µg/L	
210326O026	26	Old Tech Room 162-SK; Initial	1.00	1.17	µg/L	



Date Collected:	26 Mar 2021
Date Received:	26 Mar 2021
Date Analyzed:	29 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210326O027	27	Teachers Dining Room 125B Bathroom-SK; Initial	1.00	<1.00	µg/L	
210326O028	28	Mens Bathroom by Room 125B @A-SK; Initial	1.00	<1.00	µg/L	
210326O029	29	Mens Bathroom by Room 125B @B-SK; Initial	1.00	<1.00	µg/L	
210326O030	30	Womens Bathroom by Room 125B (Right)-SK; Initial	1.00	<1.00	µg/L	
210326O031	31	Hall by Café Area 125-WF; Initial	1.00	<1.00	µg/L	
210326O032	32	Hall by Café Area 125 (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210326O033	33	Kitchen Serving Area 126-IM; Initial	1.00	<1.00	µg/L	
210326O034	34	Kitchen Serving Area 126 Handwash-SK; Initial	1.00	<1.00	µg/L	
210326O035	35	Kitchen 127 3 Bay (Left)-SK; Initial	1.00	4.41	µg/L	
210326O036	36	Kitchen 127 3 Bay (Left)-SPY; Initial	1.00	<1.00	µg/L	
210326O037	37	Kitchen 127 3 Bay (Right)-SK; Initial	1.00	<1.00	µg/L	
210326O038	38	Kitchen 127 1 Bay (Left of Pot Filler)-SK; Initial	1.00	1.58	µg/L	
210326O039	39	Kitchen 127 1 Bay (Right of Pot Filler)-SK; Initial	1.00	1.12	µg/L	
210326O040	40	Kitchen 127 Pot Filler-SP; Initial	1.00	384	µg/L	E,H
210326O041	41	Kitchen 127 Bathroom-SK; Initial	1.00	15.6	µg/L	H
210326O042	42	Room 121-SK; Initial	1.00	5.07	µg/L	
210326O043	43	Womens Bathroom by Athletic Director 117 @B-SK; Initial	1.00	<1.00	µg/L	
210326O044	44	Womens Bathroom by Athletic Director 117 @C-SK; Initial	1.00	<1.00	µg/L	
210326O045	45	Storage Closet by Athletic Director 117-IM; Initial	1.00	<1.00	µg/L	
210326O046	46	Security Office Bathroom-SK; Initial	1.00	3.63	µg/L	
210326O047	47	Coaches Office Bathroom by Gym 115-SK; Initial	1.00	3.39	µg/L	
210326O048	48	Hall by Gym 115-WF; Initial	1.00	<1.00	µg/L	
210326O049	49	Hall by Gym 115 (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210326O050	50	Concession Stand 116B-SK; Initial	1.00	2.38	µg/L	
210326O051	51	Athletic Trainers Office 117-SK; Initial	1.00	1.17	µg/L	
210326O052	52	Mens Bathroom by Room 224 @B-SK; Initial	1.00	<1.00	µg/L	
210326O053	53	Womens Bathroom by Room 224 @B-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	26 Mar 2021
Date Received:	26 Mar 2021
Date Analyzed:	29 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210326O054	54	Womens Bathroom by Room 224 @C-SK; Initial	1.00	<1.00	µg/L	
210326O055	55	Hall by Room 224 (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210326O056	56	Womens Bathroom by Room 202 @A-SK; Initial	1.00	1.81	µg/L	
210326O057	57	Womens Bathroom by Room 202 @B-SK; Initial	1.00	3.81	µg/L	
210326O058	58	Mens Bathroom by Room 205 @A-SK; Initial	1.00	<1.00	µg/L	
210326O059	59	Mens Bathroom by Room 205 @B-SK; Initial	1.00	<1.00	µg/L	
210326O060	60	Hall by Room 206-WF; Initial	1.00	<1.00	µg/L	
210326O061	61	Hall by Room 211-WF; Initial	1.00	<1.00	µg/L	
210326O062	62	Hall by Room 211 (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210326O063	63	Faculty Womens Bathroom by Room 211 @B-SK; Initial	1.00	<1.00	µg/L	
210326O064	64	Staff Lounge 218 Kitchenette-SK; Initial	1.00	<1.00	µg/L	
210326O065	65	Staff Lounge 218 Left Staff Bathroom-SK; Initial	1.00	<1.00	µg/L	
210326O066	66	Staff Lounge 218 Right Staff Bathroom-SK; Initial	1.00	37.5	µg/L	H
210326O067	67	Unisex Bathroom by Room 223 @A-SK; Initial	1.00	65.9	µg/L	E,H
210326O068	68	Unisex Bathroom by Room 223 @B-SK; Initial	1.00	22.4	µg/L	H
210326O069	69	Boys Locker Room Under Dome @A-SK; Initial	1.00	93.2	µg/L	E,H
210326O070	70	Boys Locker Room Under Dome @B-SK; Initial	1.00	20.3	µg/L	H
210326O071	71	Boys Locker Room Under Dome @C-SK; Initial	1.00	31.3	µg/L	H
210326O072	72	Boys Locker Room Under Dome @D-SK; Initial	1.00	134	µg/L	E,H
210326O073	73	Boys Locker Room Bathroom-SK; Initial	1.00	2.10	µg/L	
210326O074	74	Girls Locker Room (Left)-WF; Initial	1.00	75.8	µg/L	E,H
210326O075	75	Custodian Office-WF; Initial	1.00	1.01	µg/L	
210326O076	76	Custodian Office Bathroom-SK; Initial	1.00	1.08	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

