

**Districtwide Lead in Drinking Water
Sampling and Remediation Plan**

2023-2025

South Country CSD

**May 2024
(updated October 2024)**

Enviroscience Project #23553



DISTRICTWIDE LEAD IN DRINKING WATER SAMPLING AND REMEDIATION PLAN

2023-2025

MAY 2024
(Updated October 2024)

ENVIROSCIENCE PROJECT #23553

Prepared for: SOUTH COUNTRY CSD
189 N. Dunton Avenue
East Patchogue, New York 11772

Prepared by: ENVIROSCIENCE CONSULTANTS, LLC
2150 Smithtown Avenue
Ronkonkoma, New York 11779
(631) 580-3191

TABLE OF CONTENTS

<u>Section</u>	<u>Title</u>
1.0	Executive Summary
2.0	Sampling Methodology
3.0	Initial Results

Appendices

Appendix A	Bellport High School
Appendix B	Bellport Middle School
Appendix C	Frank P. Long Intermediate School
Appendix D	Brookhaven Elementary School
Appendix E	Kreamer Elementary School
Appendix F	South Haven Elementary School
Appendix G	Verne W. Critz Elementary School
Appendix H	Administration Annex Building
Appendix I	Family Engagement Center Building at Head Start
Appendix J	Head Start Building
Appendix K	Central Administration Building

1.0 EXECUTIVE SUMMARY

The South Country Central School District has developed their 2023-2025 Lead in Drinking Water Sampling and Remediation Plan, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 5 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

The following locations within the South Country CSD buildings have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Home Economics classroom sinks
- 5) Nurse's Office and Faculty Room sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. The chains of custody are available upon request. For results at or below 5 ppb, no further action is required until 2025. For locations above 5 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the South Country CSD buildings were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks
- 2) Art Room sinks
- 3) Technical Classroom sinks
- 4) Other Classroom sinks
- 5) Bathroom sinks
- 6) Outside spigots
- 7) Custodial Closet sinks
- 8) Mixed Valve sinks (or hot only)

In these cases, the South Country CSD staff have placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Technical Classroom sinks - classrooms in this category often include wood shop or auto mechanics classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

- 4) Other classroom sinks - classrooms in this category often include elementary classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Bathroom sinks - in intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms, so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 7) Custodial Closet sinks - these locations should be accessed by custodial personnel only and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 8) Mixed Valve sinks (or hot only) – per Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water mixed valve or hot water only sources are not required to be sampled. Signage is required for these sources. Signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.


All locations deemed non-applicable, but do not have signs, should be taken offline until signs have been posted. Signs are suggested to have pictures that instruct for handwashing only, do not drink.



2.0 SAMPLING METHODOLOGY

In accordance with the regulation, Enviroscience Consultants, LLC performed initial water sampling at the South Country CSD buildings. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used at least 8 hours and not more than 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes, source designations, and the sampling location schematics are shown below.

Code Key for Lead in Water			
Fixture Type Codes			
BF	Bottle Filler	SK	Sink
HB	Hose Bib	SL	Supply Line
IM	Ice Machine	SP	Spigot
OS	Other Source	SPY	Spray
PF	Pot Filler	SS	Slop Sink
		V	Valve
		WC	Water Cooler
		WF	Water Fountain
Source Designations			
App	Applicable	N/A	Non-applicable

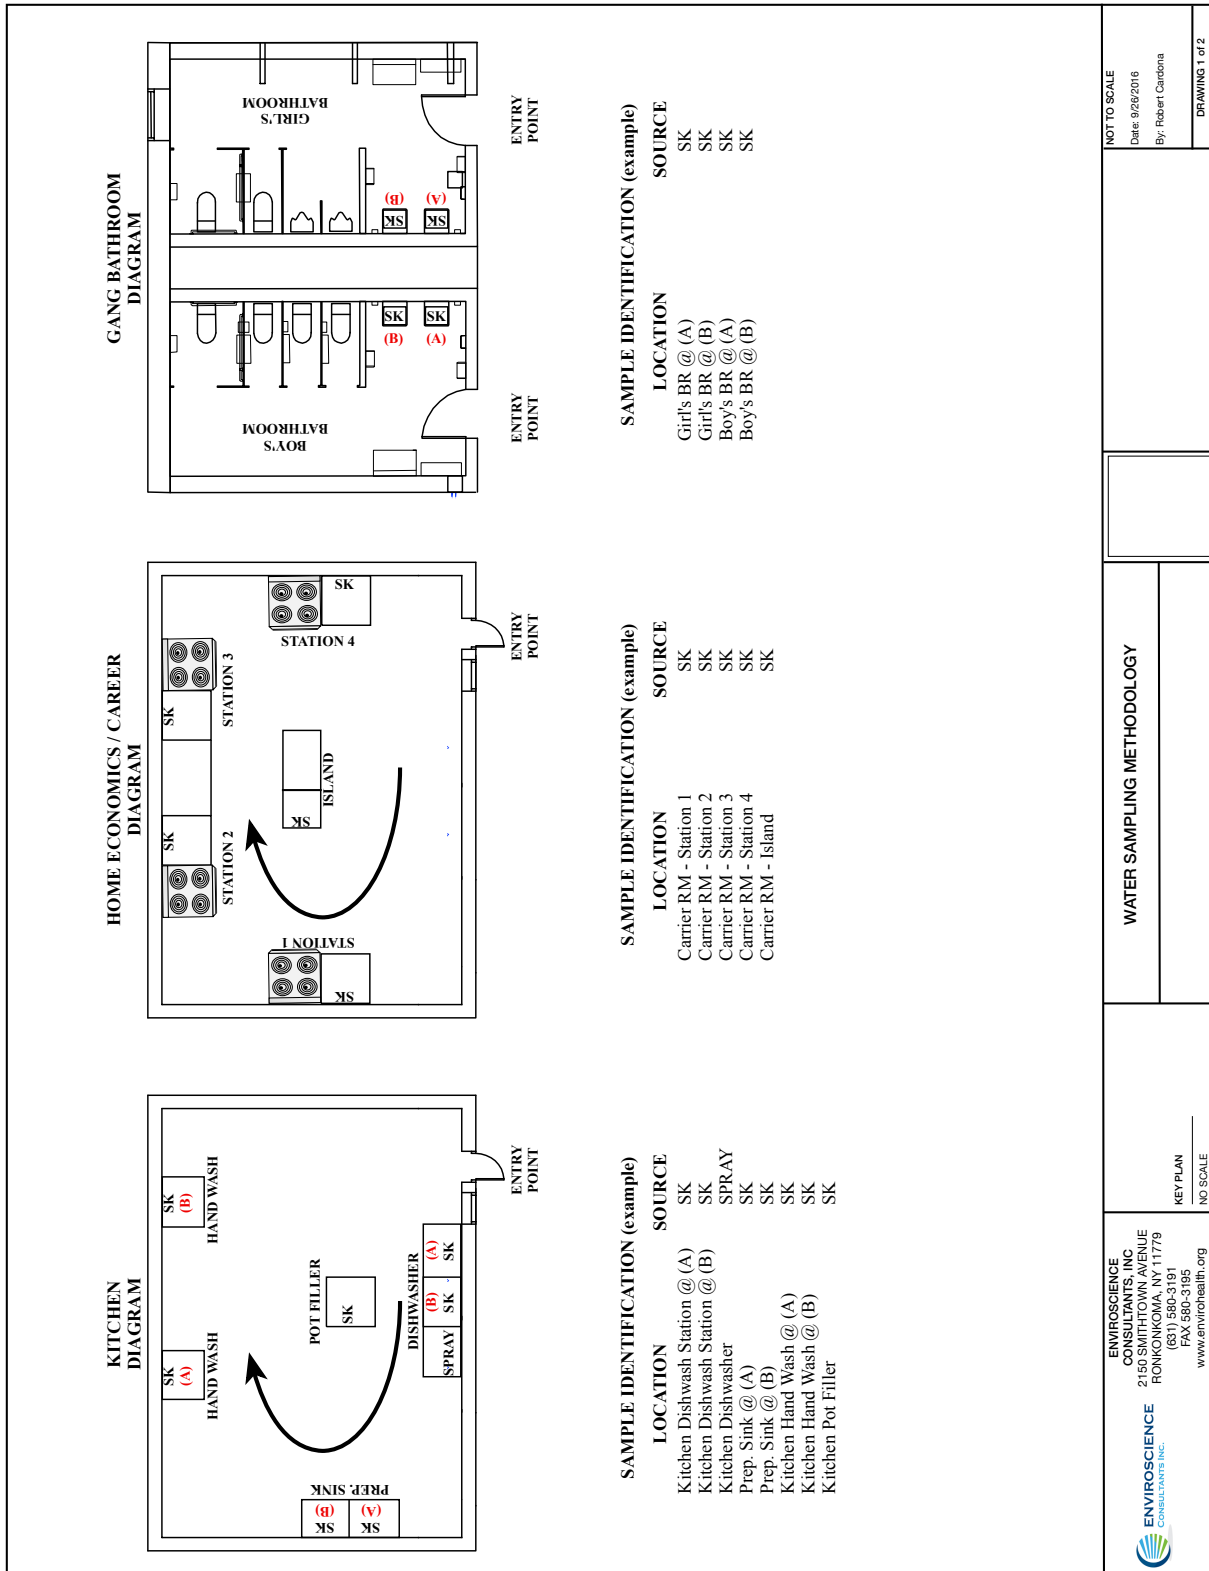

SCIENCE ROOM TYPE 1 DIAGRAM	SCIENCE ROOM TYPE 2 DIAGRAM	SCIENCE ROOM TYPE 3 DIAGRAM																																																																																								
SAMPLE IDENTIFICATION (example) <table><tr><th>LOCATION</th><th>SOURCE</th></tr><tr><td>Room 200 - Teacher Station</td><td>SK</td></tr><tr><td>Room 200 - Counter 1 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - Counter 1 @ (B)</td><td>SK</td></tr><tr><td>Room 200 - Counter 2 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - Counter 2 @ (B)</td><td>SK</td></tr><tr><td>Room 200 - Counter 3 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - Counter 3 @ (B)</td><td>SK</td></tr></table>	LOCATION	SOURCE	Room 200 - Teacher Station	SK	Room 200 - Counter 1 @ (A)	SK	Room 200 - Counter 1 @ (B)	SK	Room 200 - Counter 2 @ (A)	SK	Room 200 - Counter 2 @ (B)	SK	Room 200 - Counter 3 @ (A)	SK	Room 200 - Counter 3 @ (B)	SK	SAMPLE IDENTIFICATION (example) <table><tr><th>LOCATION</th><th>SOURCE</th></tr><tr><td>Room 200 - Teacher Station</td><td>SK</td></tr><tr><td>Room 200 - Table 1 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - Table 1 @ (B)</td><td>SK</td></tr><tr><td>Room 200 - Table 2 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - Table 2 @ (B)</td><td>SK</td></tr><tr><td>Room 200 - Table 3 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - Table 3 @ (B)</td><td>SK</td></tr><tr><td>Room 200 - Table 4 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - Table 4 @ (B)</td><td>SK</td></tr><tr><td>Room 200 - Counter 1 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - Counter 1 @ (B)</td><td>SK</td></tr><tr><td>Room 200 - Counter 2 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - Counter 2 @ (B)</td><td>SK</td></tr><tr><td>Room 200 - Counter 3 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - Counter 3 @ (B)</td><td>SK</td></tr></table>	LOCATION	SOURCE	Room 200 - Teacher Station	SK	Room 200 - Table 1 @ (A)	SK	Room 200 - Table 1 @ (B)	SK	Room 200 - Table 2 @ (A)	SK	Room 200 - Table 2 @ (B)	SK	Room 200 - Table 3 @ (A)	SK	Room 200 - Table 3 @ (B)	SK	Room 200 - Table 4 @ (A)	SK	Room 200 - Table 4 @ (B)	SK	Room 200 - Counter 1 @ (A)	SK	Room 200 - Counter 1 @ (B)	SK	Room 200 - Counter 2 @ (A)	SK	Room 200 - Counter 2 @ (B)	SK	Room 200 - Counter 3 @ (A)	SK	Room 200 - Counter 3 @ (B)	SK	SAMPLE IDENTIFICATION (example) <table><tr><th>LOCATION</th><th>SOURCE</th></tr><tr><td>Room 200 - Teacher Station</td><td>SK</td></tr><tr><td>Room 200 - POD 1 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - POD 1 @ (B)</td><td>SK</td></tr><tr><td>Room 200 - POD 1 @ (C)</td><td>SK</td></tr><tr><td>Room 200 - POD 1 @ (D)</td><td>SK</td></tr><tr><td>Room 200 - POD 1 @ (E)</td><td>SK</td></tr><tr><td>Room 200 - POD 1 @ (F)</td><td>SK</td></tr><tr><td>Room 200 - POD 2 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - POD 2 @ (B)</td><td>SK</td></tr><tr><td>Room 200 - POD 2 @ (C)</td><td>SK</td></tr><tr><td>Room 200 - POD 2 @ (D)</td><td>SK</td></tr><tr><td>Room 200 - POD 2 @ (E)</td><td>SK</td></tr><tr><td>Room 200 - POD 2 @ (F)</td><td>SK</td></tr><tr><td>Room 200 - POD 3 @ (A)</td><td>SK</td></tr><tr><td>Room 200 - POD 3 @ (B)</td><td>SK</td></tr><tr><td>Room 200 - POD 3 @ (C)</td><td>SK</td></tr><tr><td>Room 200 - POD 3 @ (D)</td><td>SK</td></tr><tr><td>Room 200 - POD 3 @ (E)</td><td>SK</td></tr><tr><td>Room 200 - POD 3 @ (F)</td><td>SK</td></tr></table>	LOCATION	SOURCE	Room 200 - Teacher Station	SK	Room 200 - POD 1 @ (A)	SK	Room 200 - POD 1 @ (B)	SK	Room 200 - POD 1 @ (C)	SK	Room 200 - POD 1 @ (D)	SK	Room 200 - POD 1 @ (E)	SK	Room 200 - POD 1 @ (F)	SK	Room 200 - POD 2 @ (A)	SK	Room 200 - POD 2 @ (B)	SK	Room 200 - POD 2 @ (C)	SK	Room 200 - POD 2 @ (D)	SK	Room 200 - POD 2 @ (E)	SK	Room 200 - POD 2 @ (F)	SK	Room 200 - POD 3 @ (A)	SK	Room 200 - POD 3 @ (B)	SK	Room 200 - POD 3 @ (C)	SK	Room 200 - POD 3 @ (D)	SK	Room 200 - POD 3 @ (E)	SK	Room 200 - POD 3 @ (F)	SK
LOCATION	SOURCE																																																																																									
Room 200 - Teacher Station	SK																																																																																									
Room 200 - Counter 1 @ (A)	SK																																																																																									
Room 200 - Counter 1 @ (B)	SK																																																																																									
Room 200 - Counter 2 @ (A)	SK																																																																																									
Room 200 - Counter 2 @ (B)	SK																																																																																									
Room 200 - Counter 3 @ (A)	SK																																																																																									
Room 200 - Counter 3 @ (B)	SK																																																																																									
LOCATION	SOURCE																																																																																									
Room 200 - Teacher Station	SK																																																																																									
Room 200 - Table 1 @ (A)	SK																																																																																									
Room 200 - Table 1 @ (B)	SK																																																																																									
Room 200 - Table 2 @ (A)	SK																																																																																									
Room 200 - Table 2 @ (B)	SK																																																																																									
Room 200 - Table 3 @ (A)	SK																																																																																									
Room 200 - Table 3 @ (B)	SK																																																																																									
Room 200 - Table 4 @ (A)	SK																																																																																									
Room 200 - Table 4 @ (B)	SK																																																																																									
Room 200 - Counter 1 @ (A)	SK																																																																																									
Room 200 - Counter 1 @ (B)	SK																																																																																									
Room 200 - Counter 2 @ (A)	SK																																																																																									
Room 200 - Counter 2 @ (B)	SK																																																																																									
Room 200 - Counter 3 @ (A)	SK																																																																																									
Room 200 - Counter 3 @ (B)	SK																																																																																									
LOCATION	SOURCE																																																																																									
Room 200 - Teacher Station	SK																																																																																									
Room 200 - POD 1 @ (A)	SK																																																																																									
Room 200 - POD 1 @ (B)	SK																																																																																									
Room 200 - POD 1 @ (C)	SK																																																																																									
Room 200 - POD 1 @ (D)	SK																																																																																									
Room 200 - POD 1 @ (E)	SK																																																																																									
Room 200 - POD 1 @ (F)	SK																																																																																									
Room 200 - POD 2 @ (A)	SK																																																																																									
Room 200 - POD 2 @ (B)	SK																																																																																									
Room 200 - POD 2 @ (C)	SK																																																																																									
Room 200 - POD 2 @ (D)	SK																																																																																									
Room 200 - POD 2 @ (E)	SK																																																																																									
Room 200 - POD 2 @ (F)	SK																																																																																									
Room 200 - POD 3 @ (A)	SK																																																																																									
Room 200 - POD 3 @ (B)	SK																																																																																									
Room 200 - POD 3 @ (C)	SK																																																																																									
Room 200 - POD 3 @ (D)	SK																																																																																									
Room 200 - POD 3 @ (E)	SK																																																																																									
Room 200 - POD 3 @ (F)	SK																																																																																									
ENVIROSCIENCE CONSULTANTS, INC. 2150 SMITHTOWN AVENUE RONKONKOMA, NY 11779 (831) 580-3191 FAX 580-3195 www.envirohealth.org	KEY PLAN NO SCALE	WATER SAMPLING METHODOLOGY																																																																																								

3.0 Initial Results

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at non-applicable sources is documented in the School Water Outlet Inventory for each building.

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested before returning to service. All locations deemed non-applicable, but do not have signs, should be taken offline until signs have been posted. Signs are suggested to have pictures that instruct for handwashing only, do not drink.

Bellport High School

Sampling was performed on May 3, 2023 for bottle fillers and water fountains at Bellport High School.

Initial building wide sampling performed on May 9 and May 10, 2024 at Bellport High School.

Sampling was performed on June 11 and June 14, 2024 for formerly non-functional and elevated fixtures at Bellport High School.

Bellport Middle School

Sampling was performed on May 3, 2023 for bottle fillers and water fountains at Bellport Middle School.

Initial building wide sampling performed on May 9, 2024 at Bellport Middle School.

Sampling was performed on June 11, 2024 for formerly non-functional fixtures at Bellport Middle School.

Frank P. Long Intermediate School

Sampling was performed on May 3 and May 8, 2023, for newly installed bottle fillers / water fountains at Frank P. Long Intermediate School.

Sampling was performed on June 11, 2024 for a formerly non-functional fixture at Frank P. Long Intermediate School.

Initial building wide sampling was performed on May 8, 2024 at Frank P. Long Intermediate School.

Brookhaven Elementary School

Sampling was performed on May 3, 2023 for newly installed bottle fillers / water fountains at Brookhaven Elementary School.

Initial building wide sampling was performed on May 7, 2024 at Brookhaven Elementary School.

Kreamer Elementary School

Sampling was performed on May 3, 2023 for newly installed bottle fillers / water fountains at Kreamer Elementary School.

Initial building wide sampling was performed on May 7, 2024 at Kreamer Street Elementary.

South Haven Elementary School

Initial building wide sampling performed on May 9, 2024 at South Haven Elementary School.

Sampling was performed on June 11, 2024 for non-functional / elevated fixtures at South Haven Elementary School.

Verne W. Critz Elementary School

Sampling was performed on May 3, 2023 for a newly installed bottle filler / water fountain at Verne W. Critz Elementary School.

Initial building wide sampling performed on May 7, 2024 at Verne W. Critz Elementary School.

Sampling was performed on June 11, 2024 for non-functional / elevated fixtures at Verne W. Critz Elementary School.

Administration Annex Building

No Sampling was required in the Administration Annex Building.

Family Engagement Center Building at Head Start

No Sampling was required in the Family Engagement Center Building.

Head Start Building

Initial building wide sampling was performed on May 7 and May 30, 2024 at the Head Start Building.

Sampling was performed on June 11, 2024 for elevated fixtures at the Head Start Building.

Central Administration Building

Sampling was performed on May 3, 2023, for a newly installed bottle filler / water fountain at Central Administration Building.

No further sampling required at the Central Administration Building.

The following is a summary of results in parts per billion (ppb) of locations in the South Country CSD where sample results were found above 5 ppb:

Bellport High School				
AHERA SPACE #	SAMPLE LOCATION	RESULT	SAMPLE DATE	REMARKS
0027A	Boy's Baseball Locker Room - Left-WF	32.0 ppb	5/9/2024	Removed from Service; Pending Remediation
	Boy's Baseball Locker Room - Right-WF	26.0 ppb	5/9/2024	Removed from Service; Pending Remediation
1076	East Commons Kitchen Food Prep @A-SK	20.0 ppb	5/9/2024	Removed from Service; Pending Remediation
	East Commons Kitchen Food Prep @B-SK	6.0 ppb	5/9/2024	Removed from Service; Pending Remediation
1078	Room 132 - Home Economics @C-SK	1.0 ppb	6/14/2024	Remediation Complete
		12.0 ppb	5/9/2024	Removed from Service; Pending Remediation
	Room 132 - Home Economics @D-SK	17.0 ppb	6/14/2024	Removed from Service; Pending Remediation
		9.0 ppb	5/9/2024	Removed from Service; Pending Remediation
1079	Room 133 - Culinary @A-SK	6.0 ppb	5/9/2024	Removed from Service; Pending Remediation
	Room 133 - Culinary @D-SK	9.0 ppb	5/9/2024	Removed from Service; Pending Remediation

Bellport Middle School				
AHERA SPACE #	SAMPLE LOCATION	RESULT	SAMPLE DATE	REMARKS
1020A	East Kitchen Island Prep-SK	12.0 ppb	5/9/2024	Removed from Service; Pending Remediation
1020A	East Kitchen Pot Filler-PF	30.0 ppb	5/9/2024	Removed from Service; Pending Remediation
1064A	West Kitchen-Prep-1 Sink Unit-SK	28.0 ppb	5/9/2024	Removed from Service; Pending Remediation
1038	Room 125-Home Economics @A-SK	7.0 ppb	5/9/2024	Removed from Service; Pending Remediation
1038	Room 125-Home Economics @B-SK	7.0 ppb	5/9/2024	Removed from Service; Pending Remediation
1038	Room 125-Home Economics @D-SK	12.0 ppb	5/9/2024	Removed from Service; Pending Remediation

Frank P. Long Intermediate School				
AHERA SPACE #	SAMPLE LOCATION	RESULT	SAMPLE DATE	REMARKS
-	No Elevated Fixtures	-	-	-

Brookhaven Elementary School				
AHERA SPACE #	SAMPLE LOCATION	RESULT	SAMPLE DATE	REMARKS
1058A	Kitchen Prep Island-SK	25.0 ppb	5/7/2024	Removed from Service; Pending Remediation
	Kitchen Prep Unit-SK	136.0 ppb	5/7/2024	Removed from Service; Pending Remediation
1061	Faculty Room-SK	6.0 ppb	5/7/2024	Removed from Service; Pending Remediation

Kreamer Elementary School				
AHERA SPACE #	SAMPLE LOCATION	RESULT	SAMPLE DATE	REMARKS
-	No Elevated Fixtures	-	-	-

South Haven Elementary School				
AHERA SPACE #	SAMPLE LOCATION	RESULT	SAMPLE DATE	REMARKS
1016	Kitchen-SK	6.0 ppb	6/14/2024	Removed from Service; Pending Remediation
		10.0 ppb	5/9/2024	Removed from Service; Pending Remediation
	Kitchen-SPY	90.0 ppb	5/9/2024	Removed from Service; Pending Remediation

Verne W. Critz Elementary School				
AHERA SPACE #	SAMPLE LOCATION	RESULT	SAMPLE DATE	REMARKS
1013	Kitchen Prep-SK	12.0 ppb	6/14/2024	Removed from Service; Pending Remediation
		12.0 ppb	5/7/2024	Removed from Service; Pending Remediation

Administration Annex Building				
AHERA SPACE #	SAMPLE LOCATION	RESULT	SAMPLE DATE	REMARKS
-	No Samples Taken	-	-	-

Central Administration Building				
AHERA SPACE #	SAMPLE LOCATION	RESULT	SAMPLE DATE	REMARKS
-	No Elevated Fixtures	-	-	-

Family Engagement Center				
AHERA SPACE #	SAMPLE LOCATION	RESULT	SAMPLE DATE	REMARKS
-	No Samples Taken	-	-	-

Head Start Building				
AHERA SPACE #	SAMPLE LOCATION	RESULT	SAMPLE DATE	REMARKS
1005	Room 3-SK	<1.0 ppb	6/11/2024	Remediation Complete
		7.0 ppb	5/30/2024	Sign; Pending Remediation
2002	Room 1 -SK	<1.0 ppb	6/11/2024	Remediation Complete
		21.0 ppb	5/30/2024	Sign; Pending Remediation

Appendix A

Bellport High School

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
0001-01	Room 52 - Art	SK	N/A		5/9/2024	-	-	-	Sign
0002-01	Room 56 - Art	SS	N/A		5/9/2024	-	-	-	Sign
0003-01	Room 58 - Art - Unit 1 @A	SK	N/A		5/9/2024	-	-	-	Sign
0003-02	Room 58 - Art - Unit 1 @B	SK	N/A		5/9/2024	-	-	-	Sign
0003-03	Room 58 - Art - Counter	SK	N/A		5/9/2024	-	-	-	Sign
0004-01	Room 60 - Art - Unit 1 @A	SK	N/A		5/9/2024	-	-	-	Sign
0004-02	Room 60 - Art - Unit 1 @B	SK	N/A		5/9/2024	-	-	-	Sign
0004-03	Room 60 - Art - Counter	SK	N/A		5/9/2024	-	-	-	Sign
0005-01	Room 61 - Art - Counter	SK	N/A		5/9/2024	-	-	-	Sign
0005-02	Room 61 - Art - Unit 1 @A	SK	N/A		5/9/2024	-	-	-	Sign
0005-03	Room 61 - Art - Unit 1 @B	SK	N/A		5/9/2024	-	-	-	Sign
0005-04	Room 61 - Art - Dark Room - Photo Sink	SP	N/A		5/9/2024	-	-	-	Sign
0006-01	Girl's Bathroom in Art Area @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
0006-02	Girl's Bathroom in Art Area @B	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
0007-01	Hall in Art Area	WF	App	<1.0	5/3/2023	-	-	-	-
0007-02	Hall in Art Area	BF	App	<1.0	5/3/2023	-	-	-	-
0007	Hall in Art Area	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
0008-01	Boy's Bathroom in Art Area @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
0008-02	Boy's Bathroom in Art Area @B	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
0009-01	Room 53 Band Room Office	SK	N/A		5/9/2024	-	-	-	Sign
0010-01	Custodial Closet by Room 50	SS	N/A		5/9/2024	-	-	-	Sign
0011-01	Girl's Bathroom in Gym Lobby @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
0011-02	Girl's Bathroom in Gym Lobby @B	SK	N/A		5/9/2024	-	-	-	Removed from Service; Fixture Removed
0011-03	Girl's Bathroom in Gym Lobby @C	SK	N/A		5/9/2024	-	-	-	Removed from Service; Fixture Removed
0012-01	Boy's Bathroom in Gym Lobby @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
0012-02	Boy's Bathroom in Gym Lobby @B	SK	N/A		5/9/2024	-	-	-	Removed from Service; Fixture Removed
0012-03	Boy's Bathroom in Gym Lobby @C	SK	N/A		5/9/2024	-	-	-	Removed from Service; Fixture Removed
0013-01	Boy's Coaches Office Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
0013-02	Boy's Coaches Office - Far Ice Machine	IM	App	<1.0	5/9/2024	-	-	-	-
0013-03	Boy's Coaches Office - Btwn Ice Machines	SP	N/A		5/9/2024	-	-	-	Removed from Service; Fixture Removed
0013-04	Boy's Coaches Office - Ice Machine	IM	App	<1.0	6/11/2024	-	-	-	-
0014-01	Boiler Room	SS	N/A		5/9/2024	-	-	-	Sign
0015-01	Boy's Locker Room Custodial Closet	SS	N/A		5/9/2024	-	-	-	Sign
0015-02	Boy's Locker Room Bathroom @A	SK	N/A		5/9/2024	-	-	-	Sign
0015-03	Boy's Locker Room Bathroom @B	SK	N/A		5/9/2024	-	-	-	Sign
0015-04	Boy's Locker Room Bathroom @C	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
0015-05	Boy's Locker Room Bathroom @D	SK	N/A		5/9/2024	-	-	-	Sign
0015-06	Boy's Football Locker Room Bathroom @A	SK	N/A		5/9/2024	-	-	-	Sign
0015-07	Boy's Football Locker Room Bathroom @B	SK	N/A		5/9/2024	-	-	-	Sign
0015-08	Boy's Baseball Locker Room - Left	WF	App	<1.0	8/30/2024				Remediation Complete
				32.0	5/9/2024				Removed from Service; Pending Remediation
0015-10	Boy's Baseball Locker Room - Right	BF	App	1.0	8/30/2024	-	-	-	-
0015-09	Boy's Locker Room Hall	BF	App	2.0	5/10/2024	-	-	-	-
0016-01	Football Coaches Office Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
0017-01	Girl's Locker Room Vestibule	BF	App	<1.0	5/9/2024	-	-	-	-
0017-02	Girl's Locker Room Vestibule	WF	App	<1.0	5/9/2024	-	-	-	-
0017-03	Girl's Locker Room - PE Office Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
0017-04	Girl's Locker Room Bathroom @A	SK	N/A		5/9/2024	-	-	-	Sign
0017-05	Girl's Locker Room Bathroom @B	SK	N/A		5/9/2024	-	-	-	Sign
0017-06	Girl's Locker Room Bathroom @C	SK	N/A		5/9/2024	-	-	-	Sign
0017-07	Girl's Locker Room Bathroom @D	SK	N/A		5/9/2024	-	-	-	Sign
0017-08	Girl's Locker Room Lobby Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
0018-01	Girl's Gym Lobby @A	WF	App	<1.0	5/9/2024	-	-	-	-
0018-02	Girl's Gym Lobby @B	WF	App	<1.0	5/9/2024	-	-	-	-

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
0018-03	Girl's Gym Lobby Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
0019-01	Hall by Girl's Locker Room	WF	App	<1.0	5/3/2023	-	-	-	-
0020-01	Custodial Closet by Girl's Locker Room	SS	N/A		5/9/2024	-	-	-	Sign
0021-01	Old Boiler Room	SS	N/A		5/9/2024	-	-	-	Sign
0022-01	Room 16	SK	N/A		5/9/2024	-	-	-	Sign
0023-01	Custodial Closet by Room 14	SS	N/A		5/9/2024	-	-	-	Sign
0024-01	Room 14 - Wood Shop	SK	N/A		5/9/2024	-	-	-	Sign
0025-01	Hall by Room 14	BF	App	<1.0	5/9/2024	-	-	-	-
0025-02	Hall by Room 14	WF	App	<1.0	5/9/2024	-	-	-	-
0026-01	Room 12	SK	N/A		5/9/2024	-	-	-	Sign
0027-01	Room 10 - Orchestra	SK	N/A		5/9/2024	-	-	-	Sign
0028-01	Custodial Locker/Break Room Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
1000-01	Room 152 Office	SK	N/A		5/9/2024	-	-	-	Sign
1001-01	Hall by Room 156	WF	App	<1.0	5/3/2023	-	-	-	-
1001-02	Hall by Room 156	BF	App	<1.0	5/3/2023	-	-	-	-
1001	Hall by Room 156	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
1002-01	Custodial Closet by Room 156	SS	N/A		5/9/2024	-	-	-	Sign
1003-01	Girl's Bathroom by Room 155 @A	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1003-02	Girl's Bathroom by Room 155 @ B	SK	N/A		5/9/2024	-	-	-	Sign
1004-01	Boy's Bathroom by Room 155 @A	SK	N/A		5/9/2024	-	-	-	Sign
1004-02	Boy's Bathroom by Room 155 @B	SK	N/A		5/9/2024	-	-	-	Sign
1005-01	West Commons Cafeteria - North Side	BF	App	<1.0	5/9/2024	-	-	-	-
1005-02	West Commons Cafeteria - North Side	WF	App	<1.0	6/14/2024	-	-	-	-
1006-01	West Commons Kitchen Handwash @A	SK	N/A		5/9/2024	-	-	-	-
1006-02	West Commons Kitchen Custodial Closet	SS	N/A		5/9/2024	-	-	-	Sign
1006-03	West Commons Kitchen Handwash @Dishwa	SK	N/A		5/9/2024	-	-	-	Sign
1006-04	West Commons Kitchen Dishwash	SPY	N/A		5/9/2024	-	-	-	Sign
1006-05	West Commons Kitchen Dishwash @A	SK	N/A		5/9/2024	-	-	-	Sign
1006-06	West Commons Kitchen Dishwash @B	SK	N/A		5/9/2024	-	-	-	Sign
1007-01	West Commons Cafeteria - South Side	BF	App	<1.0	5/9/2024	-	-	-	-
1007-02	West Commons Cafeteria - South Side	WF	App	<1.0	6/14/2024	-	-	-	-
1008-01	Hall by Room 107	WF	App	<1.0	5/3/2023	-	-	-	-
1008-02	Hall by Room 107	BF	App	<1.0	5/3/2023	-	-	-	-
1008	Hall by Room 106	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
1008	Hall by Room 107	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
1009-01	Custodial Closet by Main Office	SS	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1010-01	Main Office Secretary Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
1010-02	Main Offices Hall	WF	App	<1.0	8/30/2024	-	-	-	Non-functional; Sampling Required
1010-03	Main Offices Secretarial Lounge	SK	N/A		5/9/2024	-	-	-	Sign
1010-04	Main Office Visitors Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
1010-05	Principal's Office Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
1011-01	Women's Bathroom by Main Office @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1011-02	Women's Bathroom by Main Office @B	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1011-03	Women's Bathroom by Main Office @C	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1011-04	Women's Bathroom by Main Office @D	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1011-05	Women's Bathroom by Main Office @E	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1012-01	Men's Bathroom by Main Office @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1012-02	Men's Bathroom by Main Office @B	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1012-03	Men's Bathroom by Main Office @C	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1013-01	Hall by Main Office	WF	App	<1.0	5/9/2024	-	-	-	-
1014-01	Nurses Office Bathroom	SK	App	<1.0	5/9/2024	-	-	-	-
1015-01	Boy's Bathroom by Room 111 @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1015-02	Boy's Bathroom by Room 111 @B	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1015-03	Boy's Bathroom by Room 111 @C	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1016-01	Custodial Closet by Room 111	SS	N/A		5/9/2024	-	-	-	Sign
1017-01	Girl's Bathroom by Room 111 @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1017-02	Girl's Bathroom by Room 111 @B	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1017-03	Girl's Bathroom by Room 111 @C	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1017-04	Girl's Bathroom by Room 111 @D	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1017-05	Girl's Bathroom by Room 111 @E	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1018-01	Room 114	SK	N/A		5/9/2024	-	-	-	Sign
1019-01	Hall by Room 118	WF	App	<1.0	5/3/2023	-	-	-	-
1019-02	Hall by Room 117	WF	N/A		5/9/2024	-	-	-	Removed from Service; Fixture Removed
1020-01	Faculty Room 122	SK	App	4.0	5/9/2024	-	-	-	-
1021-01	Women's Bathroom by East Commons @A	SK	N/A		5/9/2024	-	-	-	-
1021-02	Women's Bathroom by East Commons @B	SK	N/A		5/9/2024	-	-	-	-
1022-01	Hall by Women's Bathroom	WF	App	<1.0	5/9/2024	-	-	-	-
1022-02	Hall by Men's Bathroom	WF	App	<1.0	5/9/2024	-	-	-	-
1023-01	Men's Bathroom by East Commons @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1023-02	Men's Bathroom by East Commons @B	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1024-01	Men's Bathroom in Music Suite	SK	N/A		5/9/2024	-	-	-	Sign
1024-02	Women's Bathroom in Music Suite	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1025-01	East Commons Cafeteria	BF	App	<1.0	5/9/2024	-	-	-	-
1025-02	East Commons Cafeteria	WF	App	<1.0	5/9/2024	-	-	-	-
1026-01	East Commons Kitchen - Coffee Filler	PF	App	2.0	5/9/2024	-	-	-	-
1026-02	East Commons Kitchen Dishwasher @A	SK	N/A		5/9/2024	-	-	-	Sign
1026-03	East Commons Kitchen Dishwasher @B	SK	N/A		5/9/2024	-	-	-	Sign
1026-04	East Commons Kitchen Dishwasher @C	SK	N/A		5/9/2024	-	-	-	Sign
1026-05	East Commons Kitchen Food Prep @A	SK	App	3.0	9/6/2024	-			Remediation Complete
				13.0	8/30/2024	<1.0	<1.0	8/30/24	Removed from Service; Pending Remediation
				20.0	5/9/2024				Removed from Service; Pending Remediation
1026-06	East Commons Kitchen Food Prep @B	SK	App	<1.0	8/30/2024	<1.0	2	8/30/24	Remediation Complete
				6.0	5/9/2024				Removed from Service; Pending Remediation
1026-07	East Commons Kitchen Handwash	SK	N/A		5/9/2024	-	-	-	Sign
1026-08	East Commons Serving Area Dishwash	SK	N/A		5/9/2024	-	-	-	Sign
1026-09	East Commons Serving Area Dishwasher	SPY	N/A		5/9/2024	-	-	-	Sign
1026-10	East Commons Kitchen Island Handwash	SK	N/A		5/9/2024	-	-	-	-
1026-11	East Commons Kitchen Pot Filler	PF	App	3.0	5/9/2024	-	-	-	-
1026-12	East Commons Kitchen Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
1026-13	East Commons Kitchen Custodial	SS	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1027-01	Room 132 - Home Economics @A	SK	App	4.0	5/9/2024	-	-	-	-
1027-05	Room 132 - Home Economics @A	SPY	App	1.0	5/9/2024	-	-	-	-
1027-02	Room 132 - Home Economics @B	SK	App	4.0	5/9/2024	-	-	-	-
1027-03	Room 132 - Home Economics @C	SK	App	1.0	6/14/2024	<1.0	1.0	6/14/2024	Remediation Complete
				12.0	5/9/2024				Removed from Service; Pending Remediation
1027-06	Room 132 - Home Economics @C	SPY	App	2.0	6/14/2024	-	-	-	-
				2.0	5/9/2024	-	-	-	-
1027-04	Room 132 - Home Economics @D	SK	App	4.0	10/30/2024				Remediation Complete
				11.0	9/6/2024	-	-	-	Removed from Service; dishwashing only pending remediation
				9.0	8/30/2024	1.0	<1.0	8/30/2024	Removed from Service; Pending Remediation
				17.0	6/14/2024	1.0	<1.0	6/14/2024	Removed from Service; Pending Remediation
				9.0	5/9/2024				Removed from Service; Pending Remediation
1027-04	Room 132 - Home Economics @D	SPY	App	<1.0	6/14/2024	-	-	-	Removed from Service; Pending Remediation
1028-01	Room 133 - Culinary @A	SK	App	1.0	8/30/2024	-	-	-	
				6.0	5/9/2024	-	-	-	Removed from Service; Pending Remediation
1028-02	Room 133 - Culinary @A	SPY	App	5.0	5/9/2024	-	-	-	-
1028-03	Room 133 - Culinary @B	SK	App	2.0	5/9/2024	-	-	-	-
1028-04	Room 133 - Culinary @C	SK	App	3.0	5/9/2024	-	-	-	-

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1028-05	Room 133 - Culinary @C	SPY	App	1.0	5/9/2024	-	-	-	-
1028-06	Room 133 - Culinary @D	SK	App	2.0	8/30/2024	-	-	-	
				9.0	5/9/2024	-	-	-	Removed from Service; Pending Remediation
1028-07	Room 133 - Culinary @D	SPY	App	1.0	5/9/2024	-	-	-	-
1028-08	Room 133 - Culinary @E	SK	App	2.0	5/9/2024	-	-	-	-
1029-01	Room 131 Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
1030-01	Custodial Closet by East Commons	SS	N/A		5/9/2024	-	-	-	Sign
1031-01	Women's Bathroom by Room 124	SK	N/A		5/9/2024	-	-	-	Sign
1032-01	Men's Bathroom by Room 124	SK	N/A		5/9/2024	-	-	-	Sign
2000-01	Room 256 Office	SK	N/A		5/9/2024	-	-	-	Sign
2000-02	Room 256 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2000-03	Room 256 Counter @A	SK	N/A		5/9/2024	-	-	-	Sign
2000-04	Room 256 Counter @B	SK	N/A		5/9/2024	-	-	-	Sign
2000-05	Room 256 Counter @C	SK	N/A		5/9/2024	-	-	-	Sign
2001-01	Room 258 Office	SK	N/A		5/9/2024	-	-	-	Sign
2001-02	Room 258 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2001-03	Room 256 Counter @A	SK	N/A		5/9/2024	-	-	-	Sign
2001-04	Room 256 Counter @B	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
2001-05	Room 256 Counter @C	SK	N/A		5/9/2024	-	-	-	Sign
2002-01	Custodial Closet by Room 258	SS	N/A		5/9/2024	-	-	-	Sign
2003-01	Hall by Room 260	WF	App	<1.0	5/3/2023	-	-	-	-
2003-02	Hall by Room 260	BF	App	<1.0	5/3/2023	-	-	-	-
2003	Hall by Room 260	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
2004-01	Room 258 Office	SK	N/A		5/9/2024	-	-	-	Sign
2004-02	Room 258 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2004-03	Room 258 Counter @A	SK	N/A		5/9/2024	-	-	-	Sign
2004-04	Room 258 Counter @B	SK	N/A		5/9/2024	-	-	-	Sign
2004-05	Room 258 Counter @C	SK	N/A		5/9/2024	-	-	-	Sign
2005-01	Room 262 Office	SK	N/A		5/9/2024	-	-	-	Sign
2005-02	Room 262 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2005-03	Room 262 Counter @A	SK	N/A		5/9/2024	-	-	-	Sign
2005-04	Room 262 Counter @B	SK	N/A		5/9/2024	-	-	-	Sign
2005-05	Room 262 Counter @C	SK	N/A		5/9/2024	-	-	-	Sign
2006-01	Room 264 Office	SK	N/A		5/9/2024	-	-	-	Sign
2006-02	Room 262 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2006-03	Room 262 Counter @A	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
2006-04	Room 262 Counter @B	SK	N/A		5/9/2024	-	-	-	Sign
2006-05	Room 262 Counter @c	SK	N/A		5/9/2024	-	-	-	Sign
2006-06	Room 262 Counter @D	SK	N/A		5/9/2024	-	-	-	Sign
2007-01	Room 263 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2008-01	Room 261 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2008-02	Room 261 Counter @A	SK	N/A		5/9/2024	-	-	-	Sign
2008-03	Room 261 Counter @B	SK	N/A		5/9/2024	-	-	-	Sign
2008-04	Room 261 Counter @C	SK	N/A		5/9/2024	-	-	-	Sign
2008-05	Room 261 Counter @D	SK	N/A		5/9/2024	-	-	-	Sign
2009-01	Girl's Bathroom by Room 261 @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
2009-02	Girl's Bathroom by Room 261 @B	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
2010-01	Boy's Bathroom by Room 261 @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
2010-02	Boy's Bathroom by Room 261 @B	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
2011-01	Women's Bathroom by Room 255	SK	N/A		5/9/2024	-	-	-	Sign
2012-01	Hall by Room 255	WF	App	<1.0	5/3/2023	-	-	-	-
2012-02	Hall by Room 255	BF	App	<1.0	5/3/2023	-	-	-	-
2012	Hall by Room 255	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
2013-01	Men's Bathroom by Room 255	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
2014-01	Library Office	SK	N/A		5/9/2024	-	-	-	Sign
2014-02	Library Office - Spray	SPY	N/A		5/9/2024	-	-	-	Sign
2015-01	Women's Bathroom by Room 209	SK	N/A		5/9/2024	-	-	-	Sign
2016-01	Men's Bathroom by Room 209	SK	N/A		5/9/2024	-	-	-	Sign
2017-01	Room 207 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2017-02	Room 207 Counter @A	SK	N/A		5/9/2024	-	-	-	Sign
2017-03	Room 207 Counter @ B	SK	N/A		5/9/2024	-	-	-	Sign
2017-04	Room 207 Counter @C	SK	N/A		5/9/2024	-	-	-	Sign
2018-01	Room 205 Office	SK	N/A		5/9/2024	-	-	-	Sign
2018-02	Room 205 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2018-03	Room 205 Counter @A	SK	N/A		5/9/2024	-	-	-	Sign
2019-01	Room 203 Office	SK	N/A		5/9/2024	-	-	-	Sign
2019-02	Room 203 Table 1 @A	SK	N/A		5/9/2024	-	-	-	Sign
2019-03	Room 203 Table 1 @B	SK	N/A		5/9/2024	-	-	-	Sign
2019-04	Room 203 Table 1 @C	SK	N/A		5/9/2024	-	-	-	Sign
2019-05	Room 203 Table 2 @A	SK	N/A		5/9/2024	-	-	-	Sign
2019-06	Room 203 Table 2 @B	SK	N/A		5/9/2024	-	-	-	Sign
2019-07	Room 203 Table 3 @A	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
2019-08	Room 203 Table 3 @B	SK	N/A		5/9/2024	-	-	-	Sign
2019-09	Room 203 Table 4 @A	SK	N/A		5/9/2024	-	-	-	Sign
2019-10	Room 203 Table 4 @B	SK	N/A		5/9/2024	-	-	-	Sign
2019-11	Room 203 Table 5 @A	SK	N/A		5/9/2024	-	-	-	Sign
2019-12	Room 203 Table 5 @B	SK	N/A		5/9/2024	-	-	-	Sign
2019-13	Room 203 Table 6 @A	SK	N/A		5/9/2024	-	-	-	Sign
2019-14	Room 203 Table 6 @B	SK	N/A		5/9/2024	-	-	-	Sign
2019-15	Room 203 Table 6 @C	SS	N/A		5/9/2024	-	-	-	Sign
2020-01	Room 201 Office	SK	N/A		5/9/2024	-	-	-	Sign
2020-02	Room 201 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2021-01	Room 204 Office	SK	N/A		5/9/2024	-	-	-	Sign
2021-02	Room 204 Greenhouse	SP	N/A		5/9/2024	-	-	-	Sign
2021-03	Room 204 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2021-04	Room 204 Counter @A	SK	N/A		5/9/2024	-	-	-	Sign
2021-05	Room 204 Counter @B	SK	N/A		5/9/2024	-	-	-	Sign
2021-06	Room 204 Counter @C	SK	N/A		5/9/2024	-	-	-	Sign
2021-07	Room 204 Counter @D	SK	N/A		5/9/2024	-	-	-	Sign
2022-01	Room 206 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
2022-02	Room 206 Counter @A	SK	N/A		5/9/2024	-	-	-	Sign
2022-03	Room 206 Counter @B	SK	N/A		5/9/2024	-	-	-	Sign
2022-04	Room 206 Counter @C	SK	N/A		5/9/2024	-	-	-	Sign
2022-05	Room 206 Counter @D	SK	N/A		5/9/2024	-	-	-	Sign
2023-01	Hall by Room 208	WF	App	<1.0	5/3/2023	-	-	-	-
2023-02	Hall by Room 208	BF	App	<1.0	5/3/2023	-	-	-	-
2023	Hall by Electrical Closet	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
2023	Hall by Room 208	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
2024-01	Room 208 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2024-02	Room 208 Counter @A	SK	N/A		5/9/2024	-	-	-	Sign
2024-03	Room 208 Counter @B	SK	N/A		5/9/2024	-	-	-	Sign
2024-04	Room 208 Counter @C	SK	N/A		5/9/2024	-	-	-	Sign
2024-05	Room 208 Counter @D	SK	N/A		5/9/2024	-	-	-	Sign
2025-01	Room 208A	SK	N/A		5/9/2024	-	-	-	Sign
2026-01	Boy's Bathroom by Room 208 @A	SK	N/A		5/9/2024	-	-	-	Sign
2026-02	Boy's Bathroom by Room 208 @B	SK	N/A		5/9/2024	-	-	-	Sign
2026-03	Boy's Bathroom by Room 208 @C	SK	N/A		5/9/2024	-	-	-	Sign
2027-01	Custodial Closet by Room 208A	SS	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
2028-01	Girl's Bathroom by Room 208A @A	SK	N/A		5/9/2024	-	-	-	Sign
2028-02	Girl's Bathroom by Room 208A @B	SK	N/A		5/9/2024	-	-	-	Sign
2028-03	Girl's Bathroom by Room 208A @C	SK	N/A		5/9/2024	-	-	-	Sign
2028-04	Girl's Bathroom by Room 208A @D	SK	N/A		5/9/2024	-	-	-	Sign

Laboratory Report (Revised)

NYE Report #: 232134-24952R

May 4, 2023

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Bellport High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 03, 2023. New York Environmental analyzed the samples on May 04, 2023 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	03 May 2023
Date Received:	03 May 2023
Date Analyzed:	04 May 2023

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
230503N001	1	Hall by Girl's Locker Room-WF, Initial	0.001	<0.001	mg/L	
230503N002	2	Hall in Art Area-WF, Initial	0.001	<0.001	mg/L	
230503N003	3	Hall in Art Area-BF, Initial	0.001	0.001	mg/L	
230503N004	4	Hall by Room 156-WF, Initial	0.001	<0.001	mg/L	
230503N005	5	Hall by Room 156-BF, Initial	0.001	<0.001	mg/L	
230503N006	6	Hall by Room 118-WF, Initial	0.001	<0.001	mg/L	
230503N007	7	Hall by Room 107-WF, Initial	0.001	<0.001	mg/L	
230503N008	8	Hall by Room 107-BF, Initial	0.001	<0.001	mg/L	
230503N009	9	Hall by Room 255-WF, Initial	0.001	<0.001	mg/L	
230503N010	10	Hall by Room 255-BF, Initial	0.001	<0.001	mg/L	
230503N011	11	Hall by Room 260-WF, Initial	0.001	<0.001	mg/L	
230503N012	12	Hall by Room 260-BF, Initial	0.001	<0.001	mg/L	
230503N013	13	Hall by Room 218-BF, Initial	0.001	<0.001	mg/L	
230503N014	14	Hall by Room 218-WF, Initial	0.001	<0.001	mg/L	
230503N015	15	Hall by Room 208-WF, Initial	0.001	<0.001	mg/L	
230503N016	16	Hall by Room 208-BF, Initial	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Revision History:

Report revised on 5/4/2023 at 17:25, replaces report generated on 5/4/2023 at 14:26.
 - Sample Descriptions for Lab Sample IDs 230503N009 and 230503N010 revised.

Laboratory Report

NYE Report #: 2402992-29604

May 14, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Bellport High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 09, 2024. New York Environmental analyzed the samples on May 10, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	09 May 2024
Date Received:	09 May 2024
Date Analyzed:	10 May 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240510I001	1	East Commons Kitchen Food Prep @A-SK, Initial	0.001	0.020	mg/L	H
240510I002	2	East Commons Kitchen Food Prep @B-SK, Initial	0.001	0.006	mg/L	H
240510I003	3	East Commons Kitchen Pot Filler-PF, Initial	0.001	0.003	mg/L	
240510I004	4	East Commons Cafeteria-BF, Initial	0.001	<0.001	mg/L	
240510I005	5	East Commons Cafeteria-WF, Initial	0.001	<0.001	mg/L	
240510I006	6	East Commons Kitchen - Coffee Filler -PF, Initial	0.001	0.002	mg/L	
240510I007	7	Girl's Gym Lobby @A-WF, Initial	0.001	<0.001	mg/L	
240510I008	8	Girl's Gym Lobby @B-WF, Initial	0.001	<0.001	mg/L	
240510I009	9	Boy's Coaches Office - Far Ice Machine-IM, Initial	0.001	<0.001	mg/L	
240510I010	10	Boy's Baseball Locker Room - Left-WF, Initial	0.001	0.032	mg/L	H
240510I011	11	Boy's Baseball Locker Room - Right-WF, Initial	0.001	0.026	mg/L	H
240510I012	12	Girl's Locker Room Vestibule-BF, Initial	0.001	<0.001	mg/L	
240510I013	13	Girl's Locker Room Vestibule-WF, Initial	0.001	<0.001	mg/L	
240510I014	14	Hall by Room 14-BF, Initial	0.001	<0.001	mg/L	
240510I015	15	Hall by Room 14-WF, Initial	0.001	<0.001	mg/L	
240510I016	16	West Commons Cafeteria - North Side-BF, Initial	0.001	<0.001	mg/L	
240510I017	17	West Commons Cafeteria - South Side-BF, Initial	0.001	<0.001	mg/L	
240510I018	18	Faculty Room 122-SK, Initial	0.001	0.004	mg/L	
240510I019	19	Hall by Men's Bathroom-WF, Initial	0.001	<0.001	mg/L	
240510I020	20	Hall by Women's Bathroom-WF, Initial	0.001	<0.001	mg/L	
240510I021	21	Hall by Main Office-WF, Initial	0.001	<0.001	mg/L	
240510I022	22	Nurses Office Bathroom-SK, Initial	0.001	<0.001	mg/L	
240510I023	23	Room 132 - Home Economics @A-SK, Initial	0.001	0.004	mg/L	
240510I024	24	Room 132 - Home Economics @A-SPY, Initial	0.001	0.001	mg/L	
240510I025	25	Room 132 - Home Economics @B-SK, Initial	0.001	0.004	mg/L	
240510I026	26	Room 132 - Home Economics @C-SK, Initial	0.001	0.012	mg/L	H



Date Collected:	09 May 2024
Date Received:	09 May 2024
Date Analyzed:	10 May 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240510I027	27	Room 132 - Home Economics @C-SPY, Initial	0.001	0.002	mg/L	
240510I028	28	Room 132 - Home Economics @D-SK, Initial	0.001	0.009	mg/L	H
240510I029	29	Room 133 - Culinary @A-SK, Initial	0.001	0.006	mg/L	H
240510I030	30	Room 133 - Culinary @A-SPY, Initial	0.001	0.005	mg/L	
240510I031	31	Room 133 - Culinary @B-SK, Initial	0.001	0.002	mg/L	
240510I032	32	Room 133 - Culinary @C-SK, Initial	0.001	0.003	mg/L	
240510I033	33	Room 133 - Culinary @C-SPY, Initial	0.001	0.001	mg/L	
240510I034	34	Room 133 - Culinary @D-SK, Initial	0.001	0.009	mg/L	H
240510I035	35	Room 133 - Culinary @D-SPY, Initial	0.001	0.001	mg/L	
240510I036	36	Room 133 - Culinary @E-SK, Initial	0.001	0.002	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2403039-29634

May 14, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Bellport High School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 13, 2024. New York Environmental analyzed the samples on May 14, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	10 May 2024
Date Received:	13 May 2024
Date Analyzed:	14 May 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240513K047	1	Boy's Locker Room Vestibule-BF, Initial	0.001	0.002	mg/L	

Comment:
CID: Client ID LOQ: Limit of Quantitation



Laboratory Report

NYE Report #: 2404030-30198

June 13, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country Csd; Bellport High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 12, 2024. New York Environmental analyzed the samples on June 13, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	11 Jun 2024
Date Received:	12 Jun 2024
Date Analyzed:	13 Jun 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240612O243	1BHS	Boys Coaches Office-Ice Machine (R)-IM, Initial	0.001	<0.001	mg/L	

Comment:
CID: Client ID LOQ: Limit of Quantitation



Laboratory Report

NYE Report #: 2404143-30261

June 17, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Bellport High School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 14, 2024. New York Environmental analyzed the samples on June 17, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	14 Jun 2024
Date Received:	14 Jun 2024
Date Analyzed:	17 Jun 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240614Q006	1A	Room 132 - Home Economics @C-SK, Initial	0.001	0.001	mg/L	
240614Q007	1B	Room 132 - Home Economics @C-SK, 15 Sec Flush	0.001	<0.001	mg/L	
240614Q008	1C	Room 132 - Home Economics @C-SK, 60 Sec Flush	0.001	0.001	mg/L	
240614Q009	2	Room 132 - Home Economics @C-SPY, Initial	0.001	0.002	mg/L	
240614Q010	3A	Room 132 - Home Economics @D-SK, Initial	0.001	0.017	mg/L	H
240614Q011	3B	Room 132 - Home Economics @D-SK, 15 Sec Flush	0.001	0.001	mg/L	
240614Q012	3C	Room 132 - Home Economics @D-SK, 60 Sec Flush	0.001	<0.001	mg/L	
240614Q013	4	Room 132 - Home Economics @D-SPY, Initial	0.001	<0.001	mg/L	
240614Q014	5	West Commons Cafeteria - South Side-WF, Initial	0.001	<0.001	mg/L	
240614Q015	6	West Commons Cafeteria - North Side-WF, Initial	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2405557-31043

September 4, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South County CSD; Bellport High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on August 30, 2024. New York Environmental analyzed the samples on September 03, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	30 Aug 2024
Date Received:	30 Aug 2024
Date Analyzed:	03 Sep 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240830O001	1	Boy's Baseball Locker Room-Left-WF, Initial	0.001	<0.001	mg/L	
240830O002	2	Main Offices Hall-WF, Initial	0.001	<0.001	mg/L	
240830O003	3A	East Commons Kitchen Food Prep @A-SK, Initial	0.001	0.013	mg/L	H
240830O004	3B	East Commons Kitchen Food Prep @A-SK, 15 Sec Flush	0.001	<0.001	mg/L	
240830O005	3C	East Commons Kitchen Food Prep @A-SK, 60 Sec Flush	0.001	<0.001	mg/L	
240830O006	4A	East Commons Kitchen Food Prep @B-SK, Initial	0.001	0.002	mg/L	
240830O007	4B	East Commons Kitchen Food Prep @B-SK, 15 Sec Flush	0.001	<0.001	mg/L	
240830O008	4C	East Commons Kitchen Food Prep @B-SK, 60 Sec Flush	0.001	<0.001	mg/L	
240830O009	5A	Room 132-Home Economics @D-SK, Initial	0.001	0.009	mg/L	H
240830O010	5B	Room 132-Home Economics @D-SK, 15 Sec Flush	0.001	0.003	mg/L	
240830O011	5C	Room 132-Home Economics @D-SK, 60 Sec Flush	0.001	0.002	mg/L	
240830O012	6A	Room 133-Culinary @A-SK, Initial	0.001	0.001	mg/L	
240830O013	6B	Room 133-Culinary @A-SK, 15 Sec Flush	0.001	NA	mg/L	
240830O014	6C	Room 133-Culinary @A-SK, 60 Sec Flush	0.001	NA	mg/L	
240830O015	7A	Room 133-Culinary @D-SK, Initial	0.001	0.002	mg/L	
240830O016	7B	Room 133-Culinary @D-SK, 15 Sec Flush	0.001	NA	mg/L	
240830O017	7C	Room 133-Culinary @D-SK, 60 Sec Flush	0.001	NA	mg/L	
240830O018	8	Boy's Baseball Locker Room-Left-BF, Initial	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

NA: Sample not analyzed per customer request.

H: Sample result exceeds applicable regulatory limit.



Laboratory Report

NYE Report #: 2405556-31042

September 4, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South County CSD; Bellport Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on August 30, 2024. New York Environmental analyzed the samples on September 03, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	30 Aug 2024
Date Received:	30 Aug 2024
Date Analyzed:	03 Sep 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240830N002	1A	East Kitchen Pot Filler-PF, Initial	0.001	0.008	mg/L	H
240830N003	1B	East Kitchen Pot Filler-PF, 15 Sec Flush	0.001	<0.001	mg/L	
240830N004	1C	East Kitchen Pot Filler-PF, 60 Sec Flush	0.001	<0.001	mg/L	
240830N005	3A	Room 125-Home Economics @A-SK, Initial	0.001	0.004	mg/L	
240830N006	3B	Room 125-Home Economics @A-SK, 15 Sec Flush	0.001	NA	mg/L	
240830N007	3C	Room 125-Home Economics @A-SK, 60 Sec Flush	0.001	NA	mg/L	
240830N008	4A	Room 125-Home Economics @B-SK, Initial	0.001	<0.001	mg/L	
240830N009	4B	Room 125-Home Economics @B-SK, 15 Sec Flush	0.001	NA	mg/L	
240830N010	4C	Room 125-Home Economics @B-SK, 60 Sec Flush	0.001	NA	mg/L	
240830N011	5A	Room 125-Home Economics @D-SK, Initial	0.001	0.013	mg/L	H
240830N012	5B	Room 125-Home Economics @D-SK, 15 Sec Flush	0.001	0.002	mg/L	
240830N013	5C	Room 125-Home Economics @D-SK, 60 Sec Flush	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

NA: Sample not analyzed per customer request.

H: Sample result exceeds applicable regulatory limit.

Laboratory Report
NYE Report #: 2405681-31107

September 9, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Bellport High School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on September 06, 2024. New York Environmental analyzed the samples on September 09, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	06 Sep 2024
Date Received:	06 Sep 2024
Date Analyzed:	09 Sep 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240906M012	1	East Commons Kitchen Food Prep; Initial	0.001	0.003	mg/L	
240906M013	2	Room 132 - Home Economics @ D; Initial	0.001	0.011	mg/L	H

Comment:
CID: Client ID LOQ: Limit of Quantitation
H: Sample result exceeds applicable regulatory limit.



Laboratory Report

NYE Report #: 2406674-31585

November 1, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Bellport High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 31, 2024. New York Environmental analyzed the samples on November 01, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	30 Oct 2024
Date Received:	31 Oct 2024
Date Analyzed:	01 Nov 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
241031N005	1	Room 132 - Home Economics @D Sink; Initial	0.001	0.004	mg/L	
241031N006	2	Room 132 - Home Economics @D Sink; 15s Flush	0.001	NA	mg/L	
241031N007	3	Room 132 - Home Economics @D Sink; 30s Flush	0.001	NA	mg/L	

Comment:
CID: Client ID LOQ: Limit of Quantitation
NA: Sample not analyzed per customer request.



Appendix B

Bellport Middle School

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
0001-1	Boiler Room	SS	N/A		5/9/2024	-	-	-	Sign
1000-1	East Kitchen Serving Area Handwash	SK	N/A		5/9/2024	-	-	-	Sign
1000-2	East Kitchen Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
1000-3	East Kitchen Custodial Closet	SS	N/A		5/9/2024	-	-	-	Sign
1000-4	East Kitchen Food Prep Sink	SK	App	4.0	5/9/2024	-	-	-	-
1000-5	East Kitchen Handwash	SK	N/A		5/9/2024	-	-	-	Sign
1000-6	East Kitchen Dishwash-3 Sink	SK	N/A		5/9/2024	-	-	-	Sign
1000-7	East Kitchen Dishwash-3 Sink	SPY	N/A		5/9/2024	-	-	-	Sign
1000-8	East Kitchen Island Prep	SK	App	12.0	5/9/2024				Removed from Service; Pending Remediation
1000-9	East Kitchen Pot Filler	PF	App	4.0	9/6/2024				Remediation Complete
				8.0	8/30/2024	<1.0	<1.0		Removed from Service; Pending Remediation
				30.0	5/9/2024				Removed from Service; Pending Remediation
1001-1	Band Room	SK	App	2.0	5/9/2024	-	-	-	-
1002-1	Boy's Bathroom by Music Suite @A	SK	N/A		5/9/2024	-	-	-	Sign
1002-2	Boy's Bathroom by Music Suite @B	SK	N/A		5/9/2024	-	-	-	Sign
1002-3	Boy's Bathroom by Music Suite @C	SK	N/A		5/9/2024	-	-	-	Sign
1002-4	Boy's Bathroom by Music Suite @D	SK	N/A		5/9/2024	-	-	-	Sign
1003-1	Hall by Boy's Bathroom	WF	App	<1.0	5/3/2023	-	-	-	-

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1003-2	Hall by Boy's Bathroom	BF	App	<1.0	5/3/2023	-	-	-	-
1003	Hall by Boy's Bathroom	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
1003	Hall by Custodial Closet	WF	N/A		5/9/2024	-	-	-	Removed from Service
1004-1	Custodial Closet by Room 108	SS	N/A		5/9/2024	-	-	-	Sign
1005-1	Girl's Bathroom by Room 108 @A	SK	N/A		5/9/2024	-	-	-	Sign
1005-2	Girl's Bathroom by Room 108 @B	SK	N/A		5/9/2024	-	-	-	Sign
1005-3	Girl's Bathroom by Room 108 @C	SK	N/A		5/9/2024	-	-	-	Sign
1005-4	Girl's Bathroom by Room 108 @D	SK	N/A		5/9/2024	-	-	-	Sign
1006-1	Hall by Room 103	WF	App	<1.0	5/3/2023	-	-	-	-
1006	Hall by Room 102	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
1006	Hall by Room 103	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
1007-1	Room 104	SK	N/A		5/9/2024	-	-	-	Sign
1008-1	East Cafeteria	WF	App	<1.0	5/9/2024	-	-	-	-
1008-2	East Cafeteria	BF	App	<1.0	5/9/2024	-	-	-	-
1008	East Cafeteria	SK	N/A		5/9/2024	-	-	-	Removed from Service
1009-1	Principal's Office Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
1010-1	Hall by Main Office	WF	App	<1.0	5/3/2023	-	-	-	-
1010	Hall by Main Office-Left	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1010	Hall by Main Office-Right	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
1011-1	Nurses's Office	SK	App		5/9/2024	-	-	-	-
1011-2	Nurses's Office Bathroom	SK	N/A		5/9/2024	-	-	-	-
1011-3	Nurses's Office	IM	App	<1.0	5/9/2024	-	-	-	-
1012-1	All Gender Bathroom by Faculty Room	SK	N/A		5/9/2024	-	-	-	-
1013-1	Faculty Room	SK	App	<1.0	5/9/2024	-	-	-	-
1013-2	Faculty Room	SPY	App		5/9/2024	-	-	-	Non-functional; Sampling Required
1013-3	Women's Bathroom in Faculty Room	SK	N/A		5/9/2024	-	-	-	Sign
1013-4	Unisex Bathroom in Faculty Room	SK	N/A		5/9/2024	-	-	-	Sign
1014-1	Room 127-Wood Shop @A	SS	N/A		5/9/2024	-	-	-	Sign
1014-2	Room 127-Wood Shop @B	SS	N/A		5/9/2024	-	-	-	Sign
1014-3	Room 127-Wood Shop @C	SS	N/A		5/9/2024	-	-	-	Sign
1015-1	Room 128-Wood Shop @A	SS	N/A		5/9/2024	-	-	-	Sign
1015-2	Room 128-Wood Shop @B	SS	N/A		5/9/2024	-	-	-	Sign
1015-3	Room 128-Wood Shop @C	SS	N/A		5/9/2024	-	-	-	Sign
1016-1	Boy's Locker Room Bathroom @A	SK	N/A		5/9/2024	-	-	-	Sign
1016-2	Boy's Locker Room Bathroom @B	WF	App	<1.0	5/9/2024	-	-	-	-
1016-3	Boy's Locker Coach's Office Bathroom	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1017-1	Hall by Girl's Locker Room	WF	App	<1.0	5/3/2023	-	-	-	-
1017	Hall by Boy's Locker Room	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
1017	Hall by Girl's Locker Room	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
1018-1	Girl's Locker Room Bathroom @A	SK	N/A		5/9/2024	-	-	-	Sign
1018-2	Girl's Locker Room Bathroom @B	SK	N/A		5/9/2024	-	-	-	Sign
1018-3	Girl's Locker Room Bathroom @C	SK	N/A		5/9/2024	-	-	-	Removed from Service
1018-4	Girl's Locker Room-Left by Coach's Office	BF	App	<1.0	5/9/2024	-	-	-	-
1018-4	Girl's Locker Room-Left by Coach's Office	WF	App	<1.0	6/14/2024	-	-	-	-
1018-5	Girl's Locker Room-Right	WF	App		5/9/2024	-	-	-	Non-functional; Sampling Required
1019-1	Girl's Coach's Office Bathroom	SK	N/A		5/9/2024	-	-	-	Sign
1020-1	Room 129	SS	N/A		5/9/2024	-	-	-	Sign
1021-1	Men's Bathroom by West Gym @A	SK	N/A		5/9/2024	-	-	-	Sign
1021-2	Men's Bathroom by West Gym @B	SK	N/A		5/9/2024	-	-	-	Sign
1022-1	Hall by West Gym Men's Bathroom	WF	App	<1.0	5/3/2023	-	-	-	-
1022-2	Hall by West Gym Men's Bathroom	BF	App	<1.0	5/3/2023	-	-	-	-
1022	Hall by West Gym Men's Bathroom	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
1023-1	Women's Bathroom by West Gym @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1023-2	Women's Bathroom by West Gym @B	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1024-1	Custodial Closet by West Gym	SK	N/A		5/9/2024	-	-	-	Sign
1025-1	Hall West Gym Women's Room/Auditorium	WF	App	<1.0	6/14/2024	-	-	-	-
1025-2	Hall West Gym Women's Room/Auditorium	BF	App	<1.0	5/9/2024	-	-	-	-
1026-1	Men's Handicap Bathroom @A	SK	N/A		5/9/2024	-	-	-	Sign
1026-2	Men's Handicap Bathroom @B	SK	N/A		5/9/2024	-	-	-	Sign
1026-3	Men's Handicap Bathroom @C	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1026-4	Custodial Closet in Men's Handicap Room	SS	N/A		5/9/2024	-	-	-	Sign
1027-1	Women's Handicap Bathroom @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1027-2	Women's Handicap Bathroom @B	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1027-3	Women's Handicap Bathroom @C	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1028-1	Hall by Women's in Auditorium-Upper	WF	App	<1.0	5/9/2024	-	-	-	-
1028-2	Hall by Women's in Auditorium-Lower	WF	App	1.0	5/9/2024	-	-	-	-
1029-1	Boy's Bathroom by Room 144 @A	SK	N/A		5/9/2024	-	-	-	Removed from Service
1029-2	Boy's Bathroom by Room 144 @B	SK	N/A		5/9/2024	-	-	-	Removed from Service
1030-1	Hall by Library	WF	App	<1.0	5/3/2023	-	-	-	-
1030	Hall by Library	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
1031-1	Custodial Closet by Library	SS	N/A		5/9/2024	-	-	-	-
1032-1	Girl's Bathroom by Library @A	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1032-2	Girl's Bathroom by Library @B	SK	N/A		5/9/2024	-	-	-	Sign
1033-1	West Kitchen-Serving Area	SK	App	2.0	5/9/2024	-	-	-	-
1033-2	West Kitchen-Dishwasher-3 Sink Unit	SK	N/A		5/9/2024	-	-	-	Sign
1033-3	West Kitchen-Prep-1 Sink Unit	SK	App	28.0	5/9/2024				Removed from Service; Pending Remediation
1033-4	West Kitchen-Handwash	SK	N/A		5/9/2024	-	-	-	Sign
1034-1	Hall by Boiler Room	BF	App	<1.0	5/9/2024	-	-	-	-
1034-2	Hall by Boiler Room	WF	App	<1.0	5/9/2024	-	-	-	-
1035-1	Boiler Room	SS	N/A		5/9/2024	-	-	-	Sign
1036-1	Boy's Bathroom by Internet Tech @A	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
1036-2	Boy's Bathroom by Internet Tech @B	SK	N/A		5/9/2024	-	-	-	Sign
1036-3	Custodial Closet in Boy's Bathroom	SS	N/A		5/9/2024	-	-	-	Sign
1037-1	Hall by Boy's Bathroom by Room 126	WF	App		5/9/2024	-	-	-	Removed from Service
1037-2	Hall by Girl's Bathroom by Room 126	WF	App		5/9/2024	-	-	-	Removed from Service
1038-1	Girl's Bathroom by Room 126 @A	SK	N/A		5/9/2024	-	-	-	Sign
1038-2	Girl's Bathroom by Room 126 @B	SK	N/A		5/9/2024	-	-	-	Sign
1039-1	Room 125-Home Economics @A	SK	App	4.0	8/30/2024				Remediation Complete
				7.0	5/9/2024				Removed from Service; Pending Remediation
1039-2	Room 125-Home Economics @B	SK	App	<1.0	8/30/2024				Remediation Complete

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1039-2	Room 125-Home Economics @B	SK	App	7.0	5/9/2024				Removed from Service; Pending Remediation
1039-3	Room 125-Home Economics @C	SK	App	2.0	5/9/2024	-	-	-	-
1039-4	Room 125-Home Economics @D	SK	App	3.0	10/30/2024				Remediation Complete
				30.0	9/6/2024				Removed from Service, dishwashing only, pending remediation
				13.0	8/30/2024	2	<1.0	8/30/2024	Removed from Service; Pending Remediation
				12.0	5/9/2024				Removed from Service; Pending Remediation
1040-1	Room 122-Home Economics @A	SK	App	2.0	5/9/2024	-	-	-	-
1040-2	Room 122-Home Economics @B	SK	App	2.0	5/9/2024	-	-	-	-
1040-3	Room 122-Home Economics @C	SK	App	2.0	5/9/2024	-	-	-	-
1040-4	Room 122-Home Economics @D	SK	App	2.0	5/9/2024	-	-	-	-
1041-1	Room 123	SK	App	3.0	5/9/2024	-	-	-	-
1041-2	Room 123	SPY	App	2.0	5/9/2024	-	-	-	-
2001-1	Room 242 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2001-2	Room 242 @A	SK	N/A		5/9/2024	-	-	-	Sign
2001-3	Room 242 @B	SK	N/A		5/9/2024	-	-	-	Sign
2001-4	Room 242 @C	SK	N/A		5/9/2024	-	-	-	Sign
2001-5	Room 242 @D	SK	N/A		5/9/2024	-	-	-	Sign
2001-6	Room 242 @E	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
2001-7	Room 242 @F	SK	N/A		5/9/2024	-	-	-	Sign
2001-8	Room 242 Fume Hood	SP	N/A		5/9/2024	-	-	-	Sign
2002-1	Room 242/230 Prep Room	OS	N/A		5/9/2024	-	-	-	Sign
2003-1	Room 230 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2003-2	Room 230 @A	SK	N/A		5/9/2024	-	-	-	Sign
2003-3	Room 230 @B	SK	N/A		5/9/2024	-	-	-	Sign
2003-4	Room 230 @C	SK	N/A		5/9/2024	-	-	-	Sign
2003-5	Room 230 @D	SK	N/A		5/9/2024	-	-	-	Sign
2003-6	Room 230 @E	SK	N/A		5/9/2024	-	-	-	Sign
2003-7	Room 230 @F	SK	N/A		5/9/2024	-	-	-	Sign
2004-1	Room 232/234 Prep Room	SK	N/A		5/9/2024	-	-	-	Sign
2005-1	Room 234 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2005-2	Room 234 @A	SK	N/A		5/9/2024	-	-	-	Sign
2005-3	Room 234 @B	SK	N/A		5/9/2024	-	-	-	Sign
2005-4	Room 234 @C	SK	N/A		5/9/2024	-	-	-	Sign
2005-5	Room 234 @D	SK	N/A		5/9/2024	-	-	-	Sign
2005-6	Room 234 @E	SK	N/A		5/9/2024	-	-	-	Sign
2005-7	Room 234 @F	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
2005-8	Room 234 Fume Hood	SK	N/A		5/9/2024	-	-	-	Sign
2006-1	Women's Faculty Bathroom by Room 230	SK	N/A		5/9/2024	-	-	-	Sign
2007-1	Hall by Room 230	WF	App	<1.0	5/3/2023	-	-	-	-
2007	Hall by Room 230	WF	N/A		5/9/2024	-	-	-	Removed from Service; Renovated Spring 2023
2008-1	Boy's Bathroom by Room 243 @A	SK	N/A		5/9/2024	-	-	-	Sign
2008-2	Boy's Bathroom by Room 243 @B	SK	N/A		5/9/2024	-	-	-	Sign
2009-1	Girl's Bathroom by Room 245 @A	SK	N/A		5/9/2024	-	-	-	Sign
2009-2	Girl's Bathroom by Room 245 @B	SK	N/A		5/9/2024	-	-	-	Sign
2009-3	Girl's Bathroom by Room 245 @C	SK	N/A		5/9/2024	-	-	-	Sign
2010-1	Custodial Closet by Room 219	SS	N/A		5/9/2024	-	-	-	Sign
2011-1	Hall by Room 219	WF	App	<1.0	5/9/2024	-	-	-	-
2011-2	Hall by Room 219	BF	App	<1.0	5/9/2024	-	-	-	-
2012-1	Men's Faculty Bathroom by Room 219	SK	N/A		5/9/2024	-	-	-	Sign
2013-1	Custodial Closet in Boy's Bathroom	SS	N/A		5/9/2024	-	-	-	Sign
2014-1	Boy's Bathroom by Room 225 @A	SK	N/A		5/9/2024	-	-	-	Sign
2014-2	Boy's Bathroom by Room 225 @B	SK	N/A		5/9/2024	-	-	-	Mixed Valve; Sign
2015-1	Hall by Room 225	WF	App	<1.0	5/3/2023	-	-	-	-
2015-2	Hall by Room 225	BF	App	<1.0	5/3/2023	-	-	-	-

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
2015	Hall by Room 225-Right	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
2015	Hall by Room 225-Left	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
2016-1	Girl's Bathroom by Room 224 @A	SK	N/A		5/9/2024	-	-	-	Sign
2016-2	Girl's Bathroom by Room 224 @B	SK	N/A		5/9/2024	-	-	-	Sign
2016-3	Girl's Bathroom by Room 224 @C	SK	N/A		5/9/2024	-	-	-	Sign
2016-4	Girl's Bathroom by Room 224 @D	SK	N/A		5/9/2024	-	-	-	Sign
2017-1	Room 225 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2017-2	Room 225 Pod 1 @A	SK	N/A		5/9/2024	-	-	-	Sign
2017-3	Room 225 Pod 1 @B	SK	N/A		5/9/2024	-	-	-	Sign
2017-4	Room 225 Pod 2 @A	SK	N/A		5/9/2024	-	-	-	Sign
2017-5	Room 225 Pod 2 @B	SK	N/A		5/9/2024	-	-	-	Sign
2017-6	Room 225 Pod 3 @A	SK	N/A		5/9/2024	-	-	-	Sign
2017-7	Room 225 Pod 3 @B	SK	N/A		5/9/2024	-	-	-	Sign
2017-8	Room 225 Pod 4 @A	SK	N/A		5/9/2024	-	-	-	Sign
2017-9	Room 225 Pod 4 @B	SK	N/A		5/9/2024	-	-	-	Sign
2017-10	Room 225 Pod 5 @A	SK	N/A		5/9/2024	-	-	-	Sign
2017-11	Room 225 Pod 5 @B	SK	N/A		5/9/2024	-	-	-	Sign
2017-12	Room 225 Pod 6 @A	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
2017-13	Room 225 Pod 6 @B	SK	N/A		5/9/2024	-	-	-	Sign
2017-14	Room 225 Fume Hood	SK	N/A		5/9/2024	-	-	-	Sign
2018-1	Room 213 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Sign
2018-2	Room 213 Pod 1 @A	SK	N/A		5/9/2024	-	-	-	Sign
2018-3	Room 213 Pod 1 @B	SK	N/A		5/9/2024	-	-	-	Sign
2018-4	Room 213 Pod 2 @A	SK	N/A		5/9/2024	-	-	-	Sign
2018-5	Room 213 Pod 2 @B	SK	N/A		5/9/2024	-	-	-	Sign
2018-6	Room 213 Pod 3 @A	SK	N/A		5/9/2024	-	-	-	Sign
2018-7	Room 213 Pod 3 @B	SK	N/A		5/9/2024	-	-	-	Sign
2018-8	Room 213 Pod 4 @A	SK	N/A		5/9/2024	-	-	-	Sign
2018-9	Room 213 Pod 4 @B	SK	N/A		5/9/2024	-	-	-	Sign
2018-10	Room 213 Pod 5 @A	SK	N/A		5/9/2024	-	-	-	Sign
2018-11	Room 213 Pod 5 @B	SK	N/A		5/9/2024	-	-	-	Sign
2018-12	Room 213 Pod 6 @A	SK	N/A		5/9/2024	-	-	-	Sign
2018-13	Room 213 Pod 6 @B	SK	N/A		5/9/2024	-	-	-	Sign
2019-1	Room 211 @A	SK	N/A		5/9/2024	-	-	-	Sign
2019-2	Room 211 @B	SK	N/A		5/9/2024	-	-	-	Sign
2019-3	Room 211 @C	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
2019-4	Room 211 @D	SK	N/A		5/9/2024	-	-	-	Sign
2020-1	Room 211 Dark Room @A	SS	N/A		5/9/2024	-	-	-	Sign
2020-2	Room 211 Dark Room @B	SS	N/A		5/9/2024	-	-	-	Sign
2021-1	Room 210 @A	SK	N/A		5/9/2024	-	-	-	Sign
2021-2	Room 210 @B	SK	N/A		5/9/2024	-	-	-	Sign
2021-3	Room 210 @C	SK	N/A		5/9/2024	-	-	-	Sign
2022-1	Men's Bathroom by Room 208 @A	SK	N/A		5/9/2024	-	-	-	Sign
2022-2	Men's Bathroom by Room 208 @B	SK	N/A		5/9/2024	-	-	-	Sign
2022-3	Men's Bathroom by Room 208 @C	SK	N/A		5/9/2024	-	-	-	Sign
2022-4	Men's Bathroom by Room 208 @D	SK	N/A		5/9/2024	-	-	-	Sign
2023-1	Custodial Closet by Room 208	SS	N/A		5/9/2024	-	-	-	Sign
2024-1	Women's Bathroom by Room 208 @A	SK	N/A		5/9/2024	-	-	-	Sign
2024-2	Women's Bathroom by Room 208 @B	SK	N/A		5/9/2024	-	-	-	Sign
2024-3	Women's Bathroom by Room 208 @C	SK	N/A		5/9/2024	-	-	-	Sign
2024-4	Women's Bathroom by Room 208 @D	SK	N/A		5/9/2024	-	-	-	Sign
2025-1	Room 208 @A	SK	N/A		5/9/2024	-	-	-	Sign
2025-2	Room 208 @B	SK	N/A		5/9/2024	-	-	-	Sign
2025-3	Room 208 @C	SK	N/A		5/9/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
2025-4	Room 208 @D	SK	N/A		5/9/2024	-	-	-	Sign
2026-1	Room 204-Old Science Room	SK	N/A		5/9/2024	-	-	-	Sign
2027-1	Room 203 Teacher's Station	SK	N/A		5/9/2024	-	-	-	Removed from Service
2027-2	Room 203 @A	SK	N/A		5/9/2024	-	-	-	Sign
2027-3	Room 203 @B	SK	N/A		5/9/2024	-	-	-	Sign
2027-4	Room 203 @C	SK	N/A		5/9/2024	-	-	-	Sign
2027-5	Room 203 @D	SK	N/A		5/9/2024	-	-	-	Sign
2027-6	Room 203 @E	SK	N/A		5/9/2024	-	-	-	Sign
2027-7	Room 203 @F	SK	N/A		5/9/2024	-	-	-	Sign
2028-1	Hall by Room 203	WF	App	<1.0	5/3/2023	-	-	-	-
2028-2	Hall by Room 203	BF	App	<1.0	5/3/2023	-	-	-	-
2028	Hall by Room 203-Right	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023
2028	Hall by Room 203-Left	WF	N/A		5/3/2023	-	-	-	Removed from Service; Renovated Spring 2023

Laboratory Report

NYE Report #: 232138-24956

May 4, 2023

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Bellport Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 03, 2023. New York Environmental analyzed the samples on May 04, 2023 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	03 May 2023
Date Received:	03 May 2023
Date Analyzed:	04 May 2023

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
230503N030	1	Hall by Main Office-WF, Initial	0.001	<0.001	mg/L	
230503N031	2	Hall by Boy's Bathroom-WF, Initial	0.001	<0.001	mg/L	
230503N032	3	Hall by Boy's Bathroom-BF, Initial	0.001	<0.001	mg/L	
230503N033	4	Hall by Room 103-WF, Initial	0.001	<0.001	mg/L	
230503N034	5	Hall by Room 203-WF, Initial	0.001	<0.001	mg/L	
230503N035	6	Hall by Room 203-BF, Initial	0.001	<0.001	mg/L	
230503N036	7	Hall by Room 225-WF, Initial	0.001	<0.001	mg/L	
230503N037	8	Hall by Room 225-BF, Initial	0.001	<0.001	mg/L	
230503N038	9	Hall by Room 230-WF, Initial	0.001	<0.001	mg/L	
230503N039	10	Hall by Library-WF, Initial	0.001	<0.001	mg/L	
230503N040	11	Hall by Girl's Locker Room-WF, Initial	0.001	<0.001	mg/L	
230503N041	12	Hall by West Gym Men's Bathroom-WF, Initial	0.001	<0.001	mg/L	
230503N042	13	Hall by West Gym Men's Bathroom-BF, Initial	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Laboratory Report

NYE Report #: 2402995-29607

May 14, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Bellport Middle School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 09, 2024. New York Environmental analyzed the samples on May 10, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	09 May 2024
Date Received:	09 May 2024
Date Analyzed:	10 May 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240510I054	1	East Kitchen Food Prep Sink-SK, Initial	0.001	0.004	mg/L	
240510I055	2	East Kitchen Island Prep-SK, Initial	0.001	0.012	mg/L	H
240510I056	3	East Kitchen Pot Filler-PF, Initial	0.001	0.030	mg/L	H
240510I057	4	East Cafeteria-WF, Initial	0.001	<0.001	mg/L	
240510I058	5	East Cafeteria-BF, Initial	0.001	<0.001	mg/L	
240510I059	6	Nurses's Office-IM, Initial	0.001	<0.001	mg/L	
240510I060	7	Faculty Room-SK, Initial	0.001	<0.001	mg/L	
240510I061	8	Boy's Locker Room Bathroom @B-WF, Initial	0.001	<0.001	mg/L	
240510I062	9	Girl's Locker Room-Left by Coach's Office-BF, Initial	0.001	<0.001	mg/L	
240510I063	10	Hall West Gym Women's Room/Auditorium-BF, Initial	0.001	<0.001	mg/L	
240510I064	11	Hall by Women's in Auditorium-Upper-WF, Initial	0.001	<0.001	mg/L	
240510I065	12	Hall by Women's in Auditorium-Lower-WF, Initial	0.001	0.001	mg/L	
240510I066	13	West Kitchen-Serving Area-SK, Initial	0.001	0.002	mg/L	
240510I067	14	West Kitchen-Prep-1 Sink Unit-SK, Initial	0.001	0.028	mg/L	H
240510I068	15	Hall by Boiler Room-BF, Initial	0.001	<0.001	mg/L	
240510I069	16	Hall by Boiler Room-WF, Initial	0.001	<0.001	mg/L	
240510I070	17	Room 125-Home Economics @A-SK, Initial	0.001	0.007	mg/L	H
240510I071	18	Room 125-Home Economics @B-SK, Initial	0.001	0.007	mg/L	H
240510I072	19	Room 125-Home Economics @C-SK, Initial	0.001	0.002	mg/L	
240510I073	20	Room 125-Home Economics @D-SK, Initial	0.001	0.012	mg/L	H
240510I074	21	Room 122-Home Economics @A-SK, Initial	0.001	0.002	mg/L	
240510I075	22	Room 122-Home Economics @B-SK, Initial	0.001	0.002	mg/L	
240510I076	23	Room 122-Home Economics @C-SK, Initial	0.001	0.002	mg/L	
240510I077	24	Room 122-Home Economics @D-SK, Initial	0.001	0.002	mg/L	
240510I078	25	Room 123-SK, Initial	0.001	0.003	mg/L	
240510I079	26	Room 123-SPY, Initial	0.001	0.002	mg/L	



Date Collected:	09 May 2024
Date Received:	09 May 2024
Date Analyzed:	10 May 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240510I080	27	Hall by Room 219-WF, Initial	0.001	<0.001	mg/L	
240510I081	28	Hall by Room 219-BF, Initial	0.001	<0.001	mg/L	
240510I082	29	Band Room-SK, Initial	0.001	0.002	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2404147-30265

June 17, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Bellport Middle School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 14, 2024. New York Environmental analyzed the samples on June 17, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	14 Jun 2024
Date Received:	14 Jun 2024
Date Analyzed:	17 Jun 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240614R010	3	Hall West Gym Women's Rm / Auditorium-WF, Initial	0.001	<0.001	mg/L	
240614R011	4	Girl's Locker Rom-Left by Coach's Office-WF, Initial	0.001	<0.001	mg/L	

Comment:
CID: Client ID LOQ: Limit of Quantitation



Laboratory Report
NYE Report #: 2405680-31106

September 9, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Bellport Middle School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on September 06, 2024. New York Environmental analyzed the samples on September 09, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	06 Sep 2024
Date Received:	06 Sep 2024
Date Analyzed:	09 Sep 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240906M010	1	East Kitchen - Potfiller; Initial	0.001	0.004	mg/L	
240906M011	2	Room 125 - Home Economics @D Sink; Initial	0.001	0.030	mg/L	H

Comment:
CID: Client ID LOQ: Limit of Quantitation
H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2406673-31584

November 1, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Bellport Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 31, 2024. New York Environmental analyzed the samples on November 01, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	30 Oct 2024
Date Received:	31 Oct 2024
Date Analyzed:	01 Nov 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
241031N002	1A	Room 125 - Home Economics @ D; SK Initial	0.001	0.003	mg/L	
241031N003	1B	Room 125 - Home Economics @ D; SK 30s Flush	0.001	NA	mg/L	
241031N004	1C	Room 125 - Home Economics @ D; SK 60s Flush	0.001	NA	mg/L	

Comment:
CID: Client ID LOQ: Limit of Quantitation
NA: Sample not analyzed per customer request.



Appendix C

Frank P. Long Intermediate School

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1001-1	Kitchen Handwash	SK	N/A		5/8/2024	-	-	-	Sign
1001-2	Kitchen Sanitizer	SK	N/A		5/8/2024	-	-	-	Sign
1001-3	Kitchen Food Prep	SK	App	<1.0	5/8/2024	-	-	-	-
1001-4	Kitchen Island Handwash	SK	App	3.0	5/8/2024	-	-	-	-
1001-5	Kitchen Bathroom	SK	N/A		5/8/2024	-	-	-	Sign
1001-6	Custodial Closet in Kitchen	SK	N/A		5/8/2024	-	-	-	Sign
1001-7	Kitchen Serving Line Handwash	SK	N/A		5/8/2024	-	-	-	Sign
1002-1	Cafeteria	BF	App	<1.0	5/8/2024	-	-	-	-
1002-2	Cafeteria	SK	App	<1.0	5/8/2024	-	-	-	-
1003-1	Custodial Bathroom	SK	N/A		5/8/2024	-	-	-	Sign
1004-1	Room 1	SK	N/A		5/8/2024	-	-	-	Sign
1005-1	Room 22 (Band Room)	SK	N/A		5/8/2024	-	-	-	Sign
1006-1	Unisex Bathroom by Room 22	SK	N/A		5/8/2024	-	-	-	Sign
1007-1	Hall by Room 22	BF	App	<1.0	5/8/2024	-	-	-	-
1007-2	Hall by Room 22	WF	App	<1.0	6/14/2024	-	-	-	-
1008-1	Unisex Bathroom by Room 20	SK	N/A		5/8/2024	-	-	-	Sign
1009-1	Room 20 (Orchestra)	SK	N/A		5/8/2024	-	-	-	Sign
1010-1	Main Office Bathroom	SK	N/A		5/8/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1010-2	Main Office Principal's Bathroom	SK	N/A		5/8/2024	-	-	-	Sign
1011-1	Men's Bathroom by Main Office	SK	N/A		5/8/2024	-	-	-	Sign
1012-1	Hall by Principal's Office	BF	App	<1.0	5/8/2024	-	-	-	-
1012-2	Hall by Principal's Office	WF	App	<1.0	8/30/2024	-	-	-	
1013-1	Women's Bathroom by Nurse's Office @ A	SK	N/A		5/8/2024	-	-	-	Sign
1014-1	Women's Bathroom by Nurse's Office @ B	SK	N/A		5/8/2024	-	-	-	Sign
1014-2	Nurse's Office	SK	App	1.0	5/8/2024	-	-	-	-
1015-1	Nurse's Office Bathroom	SK	N/A		5/8/2024	-	-	-	Sign
1016-1	Girl's PE Office	SK	N/A		5/8/2024	-	-	-	Sign
1017-1	Faculty Room	SK	App	2.0	5/8/2024	-	-	-	-
1018-1	Boy's PE Office	SK	N/A		5/8/2024	-	-	-	Sign
1018-1	Boy's Locker Room	WF	App		5/8/2024	-	-	-	Non-functional; Sampling Required
1018-2	Boy's Locker Room	SK	N/A		5/8/2024	-	-	-	Sign
1019-1	Art Room Unit @ A	SK	N/A		5/8/2024	-	-	-	Sign
1019-2	Art Room Unit @ B	SK	N/A		5/8/2024	-	-	-	Sign
1019-3	Art Room Unit @ C	SK	N/A		5/8/2024	-	-	-	Sign
1019-4	Art Room Unit @ D	SK	N/A		5/8/2024	-	-	-	Sign
1019-5	Art Room Unit @ E	SK	N/A		5/8/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1019-6	Art Room Unit @ F	SK	N/A		5/8/2024	-	-	-	Sign
1019-7	Art Room Storage	SK	N/A		5/8/2024	-	-	-	Sign
1020-1	Custodial By Art Storage Closet	SS	N/A		5/8/2024	-	-	-	Sign
1021-1	Room 2 Music	SK	N/A		5/8/2024	-	-	-	Sign
1021-2	Room 2 Music	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1021-3	Room 2 Music Bathroom	SK	N/A		5/8/2024	-	-	-	Sign
1022-1	Room 1	SK	N/A		5/8/2024	-	-	-	Sign
1022-2	Room 1	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1022-3	Room 1 Bathroom	SK	N/A		5/8/2024	-	-	-	Sign
1023-1	Room 3	Sk	N/A		5/8/2024	-	-	-	Sign
1023-2	Room 3	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1024-1	Room 3A	SK	N/A		5/8/2024	-	-	-	Sign
1025-1	Room 4	SK	N/A		5/8/2024	-	-	-	Sign
1025-2	Room 4	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1026-1	Room 5	SK	N/A		5/8/2024	-	-	-	Sign
1026-2	Room 5	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1027-1	Room 6	SK	N/A		5/8/2024	-	-	-	Sign
1027-2	Room 6	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1028-1	Room 7	SK	N/A		5/8/2024	-	-	-	Sign
1028-2	Room 7	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1029-1	Room 8	SK	N/A		5/8/2024	-	-	-	Sign
1029-2	Room 8	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1030-1	Room 9	SK	N/A		5/8/2024	-	-	-	Sign
1030-2	Room 9	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1031-1	Room 10	SK	N/A		5/8/2024	-	-	-	Sign
1031-2	Room 10	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1032-1	Room 11	SK	N/A		5/8/2024	-	-	-	Sign
1032-2	Room 11	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1033-1	Room 106	SK	N/A		5/8/2024	-	-	-	Sign
1034-1	Room 105	SK	N/A		5/8/2024	-	-	-	Sign
1034-2	Room 105	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1035-1	Room 110	Sk	N/A		5/8/2024	-	-	-	Sign
1035-2	Room 110	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1036-1	Staff Restroom	SK	N/A		5/8/2024	-	-	-	Sign
1037-1	Staff Restroom	SK	N/A		5/8/2024	-	-	-	Sign
1038-1	Room (AF) 107	SK	N/A		5/8/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1038-2	Room (AF) 107	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1039-1	Room A1	SK	App		5/8/2024	-	-	-	Sign
1039-2	Room A1	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1040-1	Room A2	SK	N/A		5/8/2024	-	-	-	Sign
1040-2	Room A2	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1041-1	Room A3	SK	N/A		5/8/2024	-	-	-	Sign
1041-2	Room A3	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1042-1	Room A4	SK	N/A		5/8/2024	-	-	-	Sign
1042-2	Room A4	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1043-1	Boy's Bathroom by Room A4 @ A	SK	N/A		5/8/2024	-	-	-	Sign
1043-2	Boy's Bathroom by Room A4 @ B	SK	N/A		5/8/2024	-	-	-	Sign
1044-1	Custodial Closet by Room A4	SS	N/A		5/8/2024	-	-	-	Sign
1045-1	Girl's Bathroom by Room A4 @ A	SK	N/A		5/8/2024	-	-	-	Sign
1045-2	Girl's Bathroom by Room A4 @ B	SK	N/A		5/8/2024	-	-	-	Sign
1046-1	Room B1	SK	N/A		5/8/2024	-	-	-	Sign
1046-2	Room B1	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1047-1	Room B2	SK	N/A		5/8/2024	-	-	-	Sign
1047-2	Room B2	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1048-1	Room B3	SK	N/A		5/8/2024	-	-	-	Sign
1048-2	Room B3	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1049-1	Room B4	SK	N/A		5/8/2024	-	-	-	Sign
1049-2	Room B4	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1050-1	Reading Room by C Cluster	SK	N/A		5/8/2024	-	-	-	Sign
1051-1	Room C1	SK	N/A		5/8/2024	-	-	-	Sign
1051-2	Room C1	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1052-1	Room C2	SK	N/A		5/8/2024	-	-	-	Sign
1052-2	Room C2	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1053-1	Room C3	SK	N/A		5/8/2024	-	-	-	Sign
1053-2	Room C3	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1054-1	Room C4	SK	N/A		5/8/2024	-	-	-	Sign
1054-2	Room C4	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1055-1	Room 25	SK	N/A		5/8/2024	-	-	-	Sign
1055-2	Room 25 Bathroom	SK	N/A		5/8/2024	-	-	-	Sign
1056-1	Staff Bathroom by Room 24	SK	N/A		5/8/2024	-	-	-	Sign
1057-1	Hall by Room 25 Left	WF	App		5/8/2024	-	-	-	Removed from Service
1057-2	Hall by Room 27 Right	WF	App		5/8/2024	-	-	-	Removed from Service

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1057-1	Hall by Room 25	WF	App	<1.0	5/3/2023	-	-	-	-
1057-2	Hall by Room 25	BF	App	<1.0	5/3/2023	-	-	-	-
1058-1	Room 27	SK	N/A		5/8/2024	-	-	-	Sign
1058-2	Room 27 Bathroom	SK	N/A		5/8/2024	-	-	-	Sign
1059-1	Room 26	SK	N/A		5/8/2024	-	-	-	Sign
1059-2	Room 26 Bathroom	SK	N/A		5/8/2024	-	-	-	Sign
1060-1	Boiler Room	SS	N/A		5/8/2024	-	-	-	Sign
1061-1	Room 18	SK	N/A		5/8/2024	-	-	-	Sign
1061-2	Room 18	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1062-1	Room 19	SK	N/A		5/8/2024	-	-	-	Sign
1062-2	Room 19	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1063-1	Room 16	SK	N/A		5/8/2024	-	-	-	Sign
1063-2	Room 16	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1064-1	Room 17	SK	N/A		5/8/2024	-	-	-	Sign
1064-2	Room 17	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1065-1	Room 14	SK	N/A		5/8/2024	-	-	-	Sign
1065-2	Room 14	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1066-1	Room 15	SK	N/A		5/8/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1066-2	Room 15	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1067-1	Room 12	SK	App	1.0	5/8/2024	-	-	-	-
1067-2	Room 12	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1068-1	Room 13	SK	N/A		5/8/2024	-	-	-	Sign
1068-2	Room 13	WF	N/A		5/8/2024	-	-	-	Removed from Service; Capped
1069-1	Girl's Bathroom by Room 13 @ A	SK	N/A		5/8/2024	-	-	-	Sign
1069-2	Girl's Bathroom by Room 13 @ B	SK	N/A		5/8/2024	-	-	-	Sign
1070-1	Hall by Room 13	BF	App	<1.0	5/8/2024	-	-	-	-
1070-2	Hall by Room 13	WF	App	<1.0	5/8/2024	-	-	-	-
1071-1	Boy's Bathroom by Room 13	SS	N/A		5/8/2024	-	-	-	Sign
1071-2	Boy's Bathroom by Room 13 @A	SK	N/A		5/8/2024	-	-	-	Sign
1071-3	Boy's Bathroom by Room 13 @B	SK	N/A		5/8/2024	-	-	-	Sign
1071-4	Boy's Bathroom by Room 13 @C	SK	N/A		5/8/2024	-	-	-	Sign
1072-1	Social Worker	SK	N/A		5/8/2024	-	-	-	Sign
1073-1	Girl's Locker Room	WF	App	5.0	5/8/2024	-	-	-	-
1073-2	Girl's Locker Room	SK	N/A		5/8/2024	-	-	-	Sign
1074-1	ISS Room	SK	N/A		5/8/2024	-	-	-	Sign
0001-1	Boiler Room	SS	N/A		5/8/2024	-	-	-	Sign

Laboratory Report

NYE Report #: 232133-24951

May 4, 2023

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Frank P. Long Intermediate School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 03, 2023. New York Environmental analyzed the samples on May 04, 2023 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	03 May 2023
Date Received:	03 May 2023
Date Analyzed:	04 May 2023

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
230503M159	1	Hall by Room 25-WF, Initial	0.001	<0.001	mg/L	
230503M160	2	Hall by Room 25-BF, Initial	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Laboratory Report

NYE Report #: 2402994-29606

May 14, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Frank P Long Intermediate School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 09, 2024. New York Environmental analyzed the samples on May 10, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	08 May 2024
Date Received:	09 May 2024
Date Analyzed:	10 May 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240510I042	1	Kitchen Food Prep-SK, Initial	0.001	<0.001	mg/L	
240510I043	2	Kitchen Island Handwash-SK, Initial	0.001	0.003	mg/L	
240510I044	3	Cafeteria-BF, Initial	0.001	<0.001	mg/L	
240510I045	4	Cafeteria-SK, Initial	0.001	<0.001	mg/L	
240510I046	5	Hall by Room 22-BF, Initial	0.001	<0.001	mg/L	
240510I047	6	Hall by Principal's Office-BF, Initial	0.001	<0.001	mg/L	
240510I048	7	Nurse's Office-SK, Initial	0.001	0.001	mg/L	
240510I049	8	Faculty Room-SK, Initial	0.001	0.002	mg/L	
240510I050	9	Room 12-SK, Initial	0.001	0.001	mg/L	
240510I051	10	Hall by Room 13-BF, Initial	0.001	<0.001	mg/L	
240510I052	11	Hall by Room 13-WF, Initial	0.001	<0.001	mg/L	
240510I053	12	Girl's Locker Room-WF, Initial	0.001	0.005	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Laboratory Report

NYE Report #: 2404145-30263

June 17, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Frank P. Long Intermediate School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 14, 2024. New York Environmental analyzed the samples on June 17, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	14 Jun 2024
Date Received:	14 Jun 2024
Date Analyzed:	17 Jun 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240614R004	1	Hall by Room 22-WF, Initial	0.001	<0.001	mg/L	

Comment:
CID: Client ID LOQ: Limit of Quantitation



Laboratory Report

NYE Report #: 2405555-31041

September 4, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South County CSD; Frank P. Long Intermediate School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on August 30, 2024. New York Environmental analyzed the samples on September 03, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	30 Aug 2024
Date Received:	30 Aug 2024
Date Analyzed:	03 Sep 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240830N001	1	Hall by Principal's Office-WF, Initial	0.001	<0.001	mg/L	

Comment:
CID: Client ID LOQ: Limit of Quantitation



Appendix D

Brookhaven Elementary School

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1000-1	Kitchen-Serving Area	SK	N/A		5/7/2024	-	-	-	Sign
1000-2	Kitchen-Dishwash Unit 1	SPY	N/A		5/7/2024	-	-	-	Sign
1000-3	Kitchen-Dishwash Unit 2	SK	N/A		5/7/2024	-	-	-	Sign
1000-4	Kitchen-Dishwash Unit 3	SK	N/A		5/7/2024	-	-	-	Sign
1000-5	Kitchen Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1000-6	Kitchen Prep Island	SK	App	3.0	9/6/2024				
				60.0	8/30/2024	11	3	8/30/2024	Remediation Complete
				25.0	5/7/2024				Removed from Service; Pending Remediation
1000-7	Kitchen Pot Filler	PF	App		5/7/2024	-	-	-	Non-functional; Sampling Required
1000-8	Kitchen Handwash	SK	N/A		5/7/2024	-	-	-	Sign
1000-9	Kitchen Prep Unit	SK	App	136.0	5/7/2024				Sign
1001-1	Cafeteria Handwash	SK	N/A		5/7/2024	-	-	-	Sign
1001-2	Cafeteria	BF	App	<1.0	5/3/2023	-	-	-	-
1001-3	Cafeteria	WF	App	<1.0	5/3/2023	-	-	-	-
1002-1	Room 53	SK	N/A		5/7/2024	-	-	-	Sign
1002-2	Room 53	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1003-1	Women's Bathroom by Kitchen @A	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1003-2	Women's Bathroom by Kitchen @B	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1004-1	Handicap Bathroom by Kitchen	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1005-1	Hallway by Kitchen	BF	App	<1.0	5/3/2023	-	-	-	-
1005-2	Hallway by Kitchen	WF	App	<1.0	5/3/2023	-	-	-	-
1006-1	Men's Bathroom by Kitchen @A	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1006-2	Men's Bathroom by Kitchen @B	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1007-1	Faculty Room	SK	App	6.0	5/7/2024				Removed from Service; Pending Remediation
1007-2	Faculty Room	SPY	App	<1.0	5/7/2024	-	-	-	-
1008-1	Main Office Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1009-1	Custodial Closet in Boy's Bathroom by Main Office	SS	N/A		5/7/2024	-	-	-	Sign
1009-2	Boy's Bathroom by Main Office @A	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1009-3	Boy's Bathroom by Main Office @B	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1010-1	Hallway by Main Office	WF	App	<1.0	5/7/2024	-	-	-	-
1010-2	Hallway by Main Office	BF	App	<1.0	5/3/2023	-	-	-	-
1011-1	Girl's Bathroom by Main Office @A	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1011-2	Girl's Bathroom by Main Office @B	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1011-3	Girl's Bathroom by Main Office @C	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1012-1	Nurse's Office Bathroom	SK	App	2.0	5/7/2024	-	-	-	-
1012-2	Nurse's Office Bathroom Eyewash	OS	N/A		5/7/2024	-	-	-	#N/A

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1012-3	Nurse's Office Bathroom by Windows	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1013-1	PE Office Bathroom in Gym	SK	N/A		5/7/2024	-	-	-	Sign
1014-1	Room 3-Art	SK	N/A		5/7/2024	-	-	-	Sign
1014-2	Room 3-Art	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1014-3	Room 3-Art-Unit @A	SK	N/A		5/7/2024	-	-	-	Sign
1014-4	Room 3-Art-Unit @B	SK	N/A		5/7/2024	-	-	-	Sign
1014-5	Room 3-Art-Unit @C	SK	N/A		5/7/2024	-	-	-	Sign
1014-6	Room 3-Art-Unit @D	SK	N/A		5/7/2024	-	-	-	Sign
1015-1	Room 4	SK	N/A		5/7/2024	-	-	-	Sign
1015-2	Room 4	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped; Former Music
1016-1	Room 60	SK	N/A		5/7/2024	-	-	-	Sign
1016-2	Room 60	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1016-3	Room 60 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1017-1	Room 61	SK	N/A		5/7/2024	-	-	-	Sign
1017-2	Room 61	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1017-3	Room 61 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1018-1	Room 62	SK	N/A		5/7/2024	-	-	-	Sign
1018-2	Room 62	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1018-3	Room 62 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1019-1	Hallway by Room 65	WF	App	<1.0	5/3/2023	-	-	-	-
1019-2	Hallway by Room 65	BF	App	<1.0	5/3/2023	-	-	-	-
1020-1	Custodial Closet by Room 65	SS	N/A		5/7/2024	-	-	-	Sign
1021-1	Room 67	SK	N/A		5/7/2024	-	-	-	Sign
1021-2	Room 67	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1021-3	Room 67 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1022-1	Room 66	SK	N/A		5/7/2024	-	-	-	Sign
1022-2	Room 66	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1022-3	Room 66 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1023-1	Room 65	SK	N/A		5/7/2024	-	-	-	Sign
1023-2	Room 65	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1023-3	Room 65 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1024-1	Room 64	SK	N/A		5/7/2024	-	-	-	Sign
1024-2	Room 64	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1024-3	Room 64 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1025-1	Room 63	SK	N/A		5/7/2024	-	-	-	Sign
1025-2	Room 63	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1025-3	Room 63 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1026-1	Room 6	SK	N/A		5/7/2024	-	-	-	Sign
1026-2	Room 6	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1027-1	Room 7	SK	N/A		5/7/2024	-	-	-	Sign
1027-2	Room 7	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1028-1	Room 10	SK	N/A		5/7/2024	-	-	-	Sign
1028-2	Room 10	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1029-1	Room 11	SK	N/A		5/7/2024	-	-	-	Sign
1029-2	Room 11	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1030-1	Room 13	SK	N/A		5/7/2024	-	-	-	Sign
1030-2	Room 13	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1031-1	Room 15	SP	N/A		5/7/2024	-	-	-	Sign
1031-2	Room 15	SP	N/A		5/7/2024	-	-	-	Sign
1032-1	Room 14	SK	N/A		5/7/2024	-	-	-	Sign
1032-2	Room 14	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1033-1	Room 16	SK	N/A		5/7/2024	-	-	-	Sign
1033-2	Room 16	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1034-1	Custodial Closet by Room 17	SS	N/A		5/7/2024	-	-	-	Sign

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1035-1	Room 17	SK	N/A		5/7/2024	-	-	-	Sign
1035-2	Room 17	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1036-1	Room 19	SK	N/A		5/7/2024	-	-	-	Sign
1036-2	Room 19	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1037-1	Room 20	SK	N/A		5/7/2024	-	-	-	Sign
1037-2	Room 20	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1038-1	Room 24	SK	N/A		5/7/2024	-	-	-	Sign
1038-2	Room 24	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1039-1	Room 25	SK	N/A		5/7/2024	-	-	-	Sign
1039-2	Room 25	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1040-1	Room 26	SK	N/A		5/7/2024	-	-	-	Sign
1040-2	Room 26	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1041-1	Room 27	SK	N/A		5/7/2024	-	-	-	Sign
1041-2	Room 27	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1042-1	Room 29A	SK	N/A		5/7/2024	-	-	-	#N/A
1042-2	Room 29A	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1043-1	Room 30	SK	N/A		5/7/2024	-	-	-	Sign
1043-2	Room 30	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1044-1	Room 31	SK	N/A		5/7/2024	-	-	-	Sign
1044-2	Room 31	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1045-1	Room 32	SK	N/A		5/7/2024	-	-	-	Sign
1045-2	Room 32	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1046-1	Room 33	SK	N/A		5/7/2024	-	-	-	Sign
1046-2	Room 33	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1047-1	Room 36	SK	N/A		5/7/2024	-	-	-	Sign
1047-2	Room 36	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1048-1	Room 35	SK	N/A		5/7/2024	-	-	-	Sign
1048-2	Room 35	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1049-1	Room 38	SK	N/A		5/7/2024	-	-	-	Sign
1049-2	Room 38	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1050-1	Room 39	SK	N/A		5/7/2024	-	-	-	Sign
1050-2	Room 39	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1051-1	Room 40	SK	N/A		5/7/2024	-	-	-	Sign
1051-2	Room 40	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1052-1	Room 41	SK	N/A		5/7/2024	-	-	-	Sign
1052-2	Room 41	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1053-1	Library Office	SK	N/A		5/7/2024	-	-	-	Sign
1054-1	Room 43	SK	N/A		5/7/2024	-	-	-	Sign
1054-2	Room 43	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1055-1	Room 44	SK	N/A		5/7/2024	-	-	-	Sign
1055-2	Room 44	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1056-1	Room 48	SK	N/A		5/7/2024	-	-	-	Sign
1056-2	Room 48	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1057-1	Room 49	SK	N/A		5/7/2024	-	-	-	Sign
1057-2	Room 49	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1058-1	Room 50	SK	N/A		5/7/2024	-	-	-	Sign
1058-2	Room 50	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1059-1	Room 51	SK	N/A		5/7/2024	-	-	-	Sign
1059-2	Room 51	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1060-1	Custodial Office Receiving Room	SS	N/A		5/7/2024	-	-	-	Sign
1060-2	Custodial Office Bathroom	SK	N/A		5/7/2024	-	-	-	Sign

Laboratory Report

NYE Report #: 232139-24957

May 4, 2023

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Brookhaven Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 03, 2023. New York Environmental analyzed the samples on May 04, 2023 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	03 May 2023
Date Received:	03 May 2023
Date Analyzed:	04 May 2023

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
230503N044	1	Hall by Kitchen-WF, Initial	0.001	<0.001	mg/L	
230503N045	2	Hall by Kitchen-BF, Initial	0.001	<0.001	mg/L	
230503N046	3	Cafeteria-WF, Initial	0.001	<0.001	mg/L	
230503N047	4	Cafeteria-BF, Initial	0.001	<0.001	mg/L	
230503N048	5	Hall by Main Office-BF, Initial	0.001	<0.001	mg/L	
230503N049	6	Hall by Room 65-WF, Initial	0.001	<0.001	mg/L	
230503N050	7	Hall by Room 65-BF, Initial	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Laboratory Report

NYE Report #: 2402960-29584

May 10, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Brookhaven Elementary School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 08, 2024. New York Environmental analyzed the samples on May 09, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	07 May 2024
Date Received:	08 May 2024
Date Analyzed:	09 May 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240508N019	4	Kitchen Prep Island-SK, Initial	0.001	0.025	mg/L	H
240508N020	5	Kitchen Prep Unit-SK, Initial	0.001	0.136	mg/L	E,H
240508N021	8	Faculty Room-SK, Initial	0.001	0.006	mg/L	H
240508N022	9	Faculty Room-SPY, Initial	0.001	<0.001	mg/L	
240508N023	10	Hallway by Main Office-WF, Initial	0.001	<0.001	mg/L	
240508N024	11	Nurse's Office Bathroom-SK, Initial	0.001	0.002	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2405560-31046

September 4, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Brookhaven Elementary School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on August 30, 2024. New York Environmental analyzed the samples on September 03, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

A handwritten signature in black ink, appearing to read 'Li Tsang', is written over a horizontal line.

Li Tsang, Laboratory Director

Date Collected:	30 Aug 2024
Date Received:	30 Aug 2024
Date Analyzed:	03 Sep 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240830O040	1A	Kitchen Prep Island-SK, Initial	0.001	0.060	mg/L	E,H
240830O041	1B	Kitchen Prep Island-SK, 15 Sec Flush	0.001	0.011	mg/L	H
240830O042	1C	Kitchen Prep Island-SK, 60 Sec Flush	0.001	0.003	mg/L	

Comment:
 CID: Client ID LOQ: Limit of Quantitation
 E: Sample result exceeds instrument calibration, value is estimated.
 H: Sample result exceeds applicable regulatory limit.



Laboratory Report
NYE Report #: 2405679-31105

September 9, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Brookhaven Elementary School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on September 06, 2024. New York Environmental analyzed the samples on September 09, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	06 Sep 2024
Date Received:	06 Sep 2024
Date Analyzed:	09 Sep 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240906M007	1A	Kitchen Prep Island; Initial	0.001	0.003	mg/L	
240906M008	1B	Kitchen Prep Island; 15s Flush	0.001	NA	mg/L	
240906M009	1C	Kitchen Prep Island; 60s Flush	0.001	NA	mg/L	

Comment:
CID: Client ID LOQ: Limit of Quantitation
NA: Sample not analyzed per customer request.

Appendix E

Kreamer Elementary School

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1001-01	Kitchen Prep 3-Bay @A	SK	App	<1.0	5/7/2024	-	-	-	Former Kitchen Dishwasher Station @A
1001-02	Kitchen Prep 3-Bay @B	SK	App	<1.0	5/7/2024	-	-	-	Former Kitchen Dishwasher Station @B
1001-03	Kitchen 2-Bay @A	SK	App	<1.0	5/7/2024	-	-	-	Former Kitchen Sanitizer Station @A
1001-04	Kitchen 2-Bay @B	SK	N/A		5/7/2024	-	-	-	Removed from Service; Fixture Removed
1001-05	Kitchen Dishwasher Station	SPY	N/A		5/7/2024	-	-	-	Sign
1001-06	Kitchen Handwash	SK	App	<1.0	5/7/2024	-	-	-	-
1001-07	Kitchen Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1002-01	Cafeteria	WF	App	<1.0	5/3/2023	-	-	-	-
1002-02	Cafeteria	BF	App	<1.0	5/3/2023	-	-	-	-
1003-01	STEM Computer Lab	SK	N/A		5/7/2024	-	-	-	Sign
1004-01	Room 22	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1004-02	Room 22	SK	N/A		5/7/2024	-	-	-	Sign
1004-03	Room 22 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1005-01	Room 24	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1005-02	Room 24	SK	N/A		5/7/2024	-	-	-	Sign
1005-03	Room 24 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1006-01	Room 26 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1006-02	Room 26	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped

South Country CSD
Kreamer Elementary School

School Water Outlet Inventory

Lead in School Drinking Water Program 2023 - 2025

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1006-03	Room 26	SK	N/A		5/7/2024	-	-	-	Sign
1007-01	Room 25	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1007-02	Room 25	SK	N/A		5/7/2024	-	-	-	Sign
1007-03	Room 25 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1008-01	Room 23 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1008-02	Room 23	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1008-03	Room 23	SK	N/A		5/7/2024	-	-	-	Sign
1009-01	Custodial Closet by Room 22	SS	N/A		5/7/2024	-	-	-	Sign
1010-01	Faculty Bathroom by Room 21A	SK	N/A		5/7/2024	-	-	-	Sign
1011-01	Room 14	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped; Former Room 12
1011-02	Room 14	SK	N/A		5/7/2024	-	-	-	Former Room 12
1044-01	Room 10	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1044-02	Room 10	SK	N/A		5/7/2024	-	-	-	Sign
1012-01	Girl's Bathroom by Room 10 @A	SK	N/A		5/7/2024	-	-	-	Sign
1012-02	Girl's Bathroom by Room 10 @B	SK	N/A		5/7/2024	-	-	-	Sign
1012-03	Girl's Bathroom by Room 10 @C	SK	N/A		5/7/2024	-	-	-	Sign
1013-01	Hallway by Room 10-Left	WF	App	<1.0	5/3/2023	-	-	-	-
1013-02	Hallway by Room 10-Left	BF	App	<1.0	5/3/2023	-	-	-	-

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1013-03	Hallway by Room 10-Right	WF	App	<1.0	5/3/2023	-	-	-	-
1013-04	Hallway by Room 10-Right	BF	App	<1.0	5/3/2023	-	-	-	-
1014-01	Boy's Bathroom by Room 10 @A	SK	N/A		5/7/2024	-	-	-	Sign
1014-02	Boy's Bathroom by Room 10 @B	SK	N/A		5/7/2024	-	-	-	Sign
1015-01	Room 8	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1015-02	Room 8	SK	N/A		5/7/2024	-	-	-	Sign
1016-01	Room 14	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1016-02	Room 14	SK	N/A		5/7/2024	-	-	-	Sign
1017-01	Room 16	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1017-02	Room 16	SK	N/A		5/7/2024	-	-	-	Sign
1018-01	Room 18	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1018-02	Room 18	SK	N/A		5/7/2024	-	-	-	Sign
1019-01	Room 20	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1019-02	Room 20	SK	N/A		5/7/2024	-	-	-	Sign
1020-01	Room 30	SK	N/A		5/7/2024	-	-	-	Sign
1021-01	Room 29	SK	N/A		5/7/2024	-	-	-	Sign
1022-01	Room 27	SK	N/A		5/7/2024	-	-	-	Sign
1023-01	Girls Bathroom 3rd Grade Wing @A	SK	N/A		5/7/2024	-	-	-	Sign; Former Women's Bathroom

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1023-02	Girl's Bathroom 3rd Grade Wing @B	SK	N/A		5/7/2024	-	-	-	Sign; Former Women's Bathroom
1024-01	Custodial Closet 3rd Grade Wing	SS	N/A		5/7/2024	-	-	-	Sign
1025-01	Boy's Bathroom 3rd Grade Wing @A	SK	N/A		5/7/2024	-	-	-	Sign; Former Men's Bathroom
1025-02	Boy's Bathroom 3rd Grade Wing @B	SK	N/A		5/7/2024	-	-	-	Sign; Former Men's Bathroom
1026-01	Room 19	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1026-02	Room 19	SK	N/A		5/7/2024	-	-	-	Sign
1027-01	Room 17	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1027-02	Room 17	SK	N/A		5/7/2024	-	-	-	Sign
1028-01	Room 15	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1028-02	Room 15	SS	N/A		5/7/2024	-	-	-	Sign
1029-01	Custodial Office	SS	N/A		5/7/2024	-	-	-	Sign
1030-01	Lady's Faculty by Room 13	SK	N/A		5/7/2024	-	-	-	Sign
1031-01	Faculty Room	SK	App	<1.0	5/7/2024	-	-	-	-
1031-02	Faculty Bathroom inside Faculty Room	SK	N/A		5/7/2024	-	-	-	Sign
1032-01	Room 7	SK	N/A		5/7/2024	-	-	-	Sign
1033-01	Men's Faculty Bathroom by Cafeteria	SK	N/A		5/7/2024	-	-	-	Sign
1034-01	Hallway by Cafeteria-Left	WF	App	<1.0	5/3/2023	-	-	-	-
1034-02	Hallway by Cafeteria-Left	BF	App	<1.0	5/3/2023	-	-	-	-

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1034-03	Hallway by Cafeteria-Right	WF	App	<1.0	5/3/2023	-	-	-	-
1034	Hallway by Cafeteria-Left	WF	N/A		5/7/2024	-	-	-	Removed from Service;Renovated Spring 2023
1034	Hallway by Cafeteria-Right	WF	N/A		5/7/2024	-	-	-	Removed from Service;Renovated Spring 2023
1035-01	Custodial Closet by Principal's Office	SS	N/A		5/7/2024	-	-	-	Sign
1036-01	Girl's Bathroom by Principal's Office @A	SK	N/A		5/7/2024	-	-	-	Sign
1036-02	Girl's Bathroom by Principal's Office @B	SK	N/A		5/7/2024	-	-	-	Sign
1036-03	Girl's Bathroom by Principal's Office @C	SK	N/A		5/7/2024	-	-	-	Sign
1037-01	Room 3	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1037-02	Room 3	SK	N/A		5/7/2024	-	-	-	Sign
1038-01	Room 1	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1038-02	Room 1	SK	N/A		5/7/2024	-	-	-	Sign
1039-01	Room K2	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1039-02	Room K2	SK	N/A		5/7/2024	-	-	-	Sign
1039-03	Room K2 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1040-01	Room K1 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1040-02	Room K1	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1040-03	Room K1	SK	N/A		5/7/2024	-	-	-	Sign
1041-01	Room 2	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1041-02	Room 2	SK	N/A		5/7/2024	-	-	-	Sign
1042-01	Nurse's Office	SK	App	<1.0	5/7/2024	-	-	-	-
1042-02	Nurse's Office Bathroom	SK	App	<1.0	5/7/2024	-	-	-	-
1043-01	Principal's Office Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
						-	-	-	-

Laboratory Report

NYE Report #: 232137-24955

May 4, 2023

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Kreamer St Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 03, 2023. New York Environmental analyzed the samples on May 04, 2023 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	03 May 2023
Date Received:	03 May 2023
Date Analyzed:	04 May 2023

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
230503N021	1	Hall by Cafeteria-Right-WF, Initial	0.001	<0.001	mg/L	
230503N022	2	Hall by Cafeteria-Left-BF, Initial	0.001	<0.001	mg/L	
230503N023	3	Hall by Cafeteria-Left-WF, Initial	0.001	<0.001	mg/L	
230503N024	4	Hall by Room 10-Left-WF, Initial	0.001	<0.001	mg/L	
230503N025	5	Hall by Room 10-Left-BF, Initial	0.001	<0.001	mg/L	
230503N026	6	Hall by Room 10-Right-WF, Initial	0.001	<0.001	mg/L	
230503N027	7	Hall by Room 10-Right-BF, Initial	0.001	<0.001	mg/L	
230503N028	8	Cafeteria-WF, Initial	0.001	<0.001	mg/L	
230503N029	9	Cafeteria-BF, Initial	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Laboratory Report

NYE Report #: 2402958-29582

May 10, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Kreamer Street Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 08, 2024. New York Environmental analyzed the samples on May 09, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	07 May 2024
Date Received:	08 May 2024
Date Analyzed:	09 May 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240508N011	1	Kitchen Prep 3-Bay @A-SK, Initial	0.001	<0.001	mg/L	
240508N012	2	Kitchen Prep 3-Bay @B-SK, Initial	0.001	<0.001	mg/L	
240508N013	3	Kitchen 2-Bay @A-SK, Initial	0.001	<0.001	mg/L	
240508N014	4	Kitchen Handwash-SK, Initial	0.001	0.001	mg/L	
240508N015	5	Faculty Room-SK, Initial	0.001	0.003	mg/L	
240508N016	6	Nurse's Office-SK, Initial	0.001	<0.001	mg/L	
240508N017	7	Nurse's Office Bathroom-SK, Initial	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix F

South Haven Elementary School

AHERA Space #	Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1016	1001-1	Kitchen	SK	App	6.0	6/14/2024	<1.0	<1.0	6/14/2024	Removed from Service; Pending Remediation
1016					10.0	5/9/2024				Removed from Service; Pending Remediation
1016	1001-2	Kitchen	SPY	App	90.0	5/9/2024				Removed from Service; Pending Remediation
1015	1002-1	Room 106	SK	N/A		5/9/2024	-	-	-	Sign
1014	1003-1	Room 105	SK	N/A		5/9/2024	-	-	-	Sign
1013	1004-1	Room 104	SK	N/A		5/9/2024	-	-	-	Sign
1012	1005-1	Custodial Closet by Room 103	SS	N/A		5/9/2024	-	-	-	Sign
1010	1006-1	Hallway by Room 103	BF	App	2.0	5/9/2024	-	-	-	-
1010	1006-2	Hallway by Room 103	WF	App	<1.0	6/14/2024	-	-	-	-
1011	1007-1	Bathroom by Room 103	SK	N/A		5/9/2024	-	-	-	Sign
1008	1008-1	Men's Bathroom by Boiler Room	SK	N/A		5/9/2024	-	-	-	Sign
1010	1006-3	Hallway by Boiler Room	BF	App	<1.0	5/9/2024	-	-	-	-
1010	1006-4	Hallway by Boiler Room	WF	App	<1.0	6/14/2024	-	-	-	-
1007	1009-1	Women's Bathroom by Boiler Room	SK	N/A		5/9/2024	-	-	-	Sign
1001	1010-1	Nurse's Office	SK	App	3.0	5/9/2024	-	-	-	-
1003	1011-1	Room 101	SK	N/A		5/9/2024	-	-	-	Sign
1005	1012-1	Room 102	SK	N/A		5/9/2024	-	-	-	Sign
0001	0001-1	Boiler Room	SK	N/A		5/9/2024	-	-	-	Sign
Exterior	2001-1	Exterior by Room 102	SP	N/A		5/9/2024	-	-	-	Sign
Exterior	2001-2	Exterior by Room 106	SP	N/A		5/9/2024	-	-	-	Sign

AHERA Space #	Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
Exterior	2001-3	Exterior by Room 103	SP	N/A		5/9/2024	-	-	-	Sign
Exterior	2001-4	Exterior by Men's Bathroom	SP	N/A		5/9/2024	-	-	-	Sign

Laboratory Report

NYE Report #: 2402993-29605

May 14, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; South Haven School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 09, 2024. New York Environmental analyzed the samples on May 10, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	09 May 2024
Date Received:	09 May 2024
Date Analyzed:	10 May 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240510I037	1	Kitchen-SK, Initial	0.001	0.010	mg/L	H
240510I038	2	Kitchen-SPY, Initial	0.001	0.090	mg/L	E,H
240510I039	3	Hallway by Room 103-BF, Initial	0.001	0.002	mg/L	
240510I040	4	Hallway by Boiler Room-BF, Initial	0.001	<0.001	mg/L	
240510I041	5	Nurse's Office-SK, Initial	0.001	0.003	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2404146-30264

June 17, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; South Haven Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 14, 2024. New York Environmental analyzed the samples on June 17, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	14 Jun 2024
Date Received:	14 Jun 2024
Date Analyzed:	17 Jun 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240614R005	1A	Kitchen-SK, Initial	0.001	0.006	mg/L	H
240614R006	1B	Kitchen-SK, 15 Sec Flush	0.001	<0.001	mg/L	
240614R007	1C	Kitchen-SK, 60 Sec Flush	0.001	<0.001	mg/L	
240614R008	2	Hallway by Room 103-WF, Initial	0.001	<0.001	mg/L	
240614R009	3	Hallway by Boiler Room-WF, Initial	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Appendix G
Verne W. Critz Elementary School

School District
School Name

School Water Outlet Inventory

Lead in School Drinking Water Program 2023 - 2025

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1001-1	Kitchen Prep	SK	App	2	8/30/2024				Remediation Complete
				12.0	6/14/2024	<1.0	<1.0	6/14/2024	Removed from Service; Pending Remediation
				12.0	5/7/2024				Removed from Service; Pending Remediation
1001-2	Kitchen Handwash	SK	N/A		5/7/2024	-	-	-	Sign
1001-3	Kitchen Dishwasher Station	SK	App	1.0	5/7/2024	-	-	-	-
1001-4	Kitchen Sanitizer Station	SK	N/A		5/7/2024	-	-	-	Sign
1001-5	Kitchen Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1002-1	Cafeteria	WF	App	<1.0	5/7/2024	-	-	-	-
1002-2	Cafeteria	BF	App	<1.0	5/7/2024	-	-	-	-
1003-1	Room 8	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1003-2	Room 8	SK	N/A		5/7/2024	-	-	-	Sign Required
1004-1	Room 6	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1004-2	Room 6	SK	N/A		5/7/2024	-	-	-	Sign Required
1005-1	Room 4	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1005-2	Room 4	SK	N/A		5/7/2024	-	-	-	Sign Required
1006-1	Room 2-Social Worker	SK	N/A		5/7/2024	-	-	-	Sign Required
1007-1	Room 1	SK	N/A		5/7/2024	-	-	-	Sign Required
1008-1	Room 3	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped

School District
School Name

School Water Outlet Inventory

Lead in School Drinking Water Program 2023 - 2025

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1008-2	Room 3	SK	N/A		5/7/2024	-	-	-	Sign Required
1009-1	Room 5	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1009-2	Room 5	SK	N/A		5/7/2024	-	-	-	Sign Required
1010-1	Psychiatrist's Office Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1011-1	Girl's Bathroom by Room 8 @A	SK	N/A		5/7/2024	-	-	-	Sign
1011-2	Girl's Bathroom by Room 8 @B	SK	N/A		5/7/2024	-	-	-	Sign
1011-3	Girl's Bathroom by Room 8 @C	SK	N/A		5/7/2024	-	-	-	Sign
1011-4	Girl's Bathroom by Room 8 @D	SK	N/A		5/7/2024	-	-	-	Sign
1011-5	Girl's Bathroom by Room 8 @E	SK	N/A		5/7/2024	-	-	-	Sign
1012-1	Boy's Bathroom by Room 8 @A	SK	N/A		5/7/2024	-	-	-	Sign
1012-2	Boy's Bathroom by Room 8 @B	SK	N/A		5/7/2024	-	-	-	Sign
1012-3	Boy's Bathroom by Room 8 @C	SK	N/A		5/7/2024	-	-	-	Sign
1012-4	Boy's Bathroom by Room 8 @D	SK	N/A		5/7/2024	-	-	-	Sign
1012-5	Boy's Bathroom by Room 8 @E	SK	N/A		5/7/2024	-	-	-	Sign
1013-1	Custodial Closet Inside Boy's Bathroom	SS	N/A		5/7/2024	-	-	-	Sign
1014-1	Room 7	SK	N/A		5/7/2024	-	-	-	Sign Required
1015-1	Faculty Room	SK	App	<1.0	5/7/2024	-	-	-	-
1016-1	Women's Bathroom by Faculty Room	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign

School District
School Name

School Water Outlet Inventory

Lead in School Drinking Water Program 2023 - 2025

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1017-1	Men's Bathroom by Faculty Room	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1018-1	Principal's Office Bathroom	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1051-1	Main Hall by Nurse's Office / Room 12	WF	App	<1.0	5/3/2023	-	-	-	-
1051-2	Main Hall by Nurse's Office / Room 12	BF	App	<1.0	5/3/2023	-	-	-	-
1019-1	Social Worker's Office	SK	N/A		5/7/2024	-	-	-	Sign
1019-2	Social Worker's Office Bathroom	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1020-1	Room 9	SK	N/A		5/7/2024	-	-	-	Sign Required
1021-1	Girl's Bathroom by Room 12 @A	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1021-2	Girl's Bathroom by Room 12 @B	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1021-3	Girl's Bathroom by Room 12 @C	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1022-1	Boy's Bathroom by Room 12 @A	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1022-2	Boy's Bathroom by Room 12 @B	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1022-3	Boy's Bathroom by Room 12 @C	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1023-1	Custodial Closet Inside Boy's Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1024-1	Room 11 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1025-1	Room 13	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1026-1	Room 15	SK	N/A		5/7/2024	-	-	-	Sign
1026-2	Art Room 15	SPY	N/A		5/7/2024	-	-	-	Sign

School District
School Name

School Water Outlet Inventory

Lead in School Drinking Water Program 2023 - 2025

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1026-3	Room 15	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1026-4	Room 15 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1027-1	Nurse's Office Room 17B	SK	App	<1.0	5/7/2024	-	-	-	-
1028-1	Library Office	SK	N/A		5/7/2024	-	-	-	Sign
1029-1	Room 19-Middle of Room	WF	N/A		5/7/2024	-	-	-	Removed from Service; Locked
1029-2	Room 19 @ Counter	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1029-3	Room 19 @ Counter	SK	N/A		5/7/2024	-	-	-	Sign Required
1029-4	Room 19 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1030-1	Room 21	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1030-2	Room 21	SK	N/A		5/7/2024	-	-	-	Sign Required
1030-3	Room 21 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1031-1	Boy's Bathroom by Room 33 @A	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1031-2	Boy's Bathroom by Room 33 @B	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1031-3	Boy's Bathroom by Room 33 @C	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1032-1	Custodial Closet by Room 33	SS	N/A		5/7/2024	-	-	-	Sign
1033-1	Hall by Room 33-Lower	WF	App	<1.0	5/7/2024	-	-	-	-
1033-2	Hall by Room 33-Lower	BF	App	<1.0	5/7/2024	-	-	-	-
1033-3	Hall by Room 33-Upper	WF	App	<1.0	5/7/2024	-	-	-	-

School District
School Name

School Water Outlet Inventory

Lead in School Drinking Water Program 2023 - 2025

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1033-4	Hall by Room 33-Upper	BF	App	<1.0	5/7/2024	-	-	-	-
1033	Hall by Room 33-Lower	WF	N/A		5/7/2024	-	-	-	Removed from Service; Renovated
1033	Hall by Room 33-Upper	WF	N/A		5/7/2024	-	-	-	Removed from Service; Renovated
1034-1	Girl's Bathroom by Room 33 @A	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1034-2	Girl's Bathroom by Room 33 @B	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1035-1	Adult's Bathroom by Room 25	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1036-1	Room 25	WF	N/A		5/7/2024	-	-	-	Removed from Service; Fixture Removed
1036-2	Room 25 Bathroom	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1037-1	Room 27	WF	N/A		5/7/2024	-	-	-	Removed from Service
1037-2	Room 27 Bathroom	SK	N/A		5/7/2024	-	-	-	Mixed Valve; Sign
1038-1	Room 29 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1038-2	Room 29	WF	N/A		5/7/2024	-	-	-	Removed from Service; Waterline Turned Off
1038-3	Room 29	SK	N/A		5/7/2024	-	-	-	Sign Required
1039-1	Room 31	WF	N/A		5/7/2024	-	-	-	Removed from Service; Waterline Turned Off
1039-2	Room 31	SK	N/A		5/7/2024	-	-	-	Sign Required
1039-3	Room 31 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1040-1	Room 30 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1040-2	Room 30	WF	N/A		5/7/2024	-	-	-	Removed from Service; Waterline Turned Off

School District
School Name

School Water Outlet Inventory

Lead in School Drinking Water Program 2023 - 2025

Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1040-3	Room 30	SK	N/A		5/7/2024	-	-	-	Sign Required
1041-1	Room 28	WF	N/A		5/7/2024	-	-	-	Removed from Service; Waterline Turned Off
1041-2	Room 28	SK	N/A		5/7/2024	-	-	-	Sign Required
1041-3	Room 28 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1042-1	Room 26	WF	N/A		5/7/2024	-	-	-	Removed from Service; Waterline Turned Off
1042-2	Room 26 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1043-1	Room 24	WF	N/A		5/7/2024	-	-	-	Removed from Service; Locked
1043-2	Room 24 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1044-1	Custodial Office	SS	N/A		5/7/2024	-	-	-	Sign
1045-1	Women's Bathroom by Room 18 @A	SK	N/A		5/7/2024	-	-	-	Sign
1045-2	Women's Bathroom by Room 18 @B	SK	N/A		5/7/2024	-	-	-	Sign
1046-1	Room 18	WF	N/A		5/7/2024	-	-	-	Removed from Service; Waterline Turned Off
1046-2	Room 18 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1047-1	Room 16	SK	N/A		5/7/2024	-	-	-	Sign Required
1048-1	Room 14	SK	N/A		5/7/2024	-	-	-	Sign Required
1049-1	Room 12	SK	N/A		5/7/2024	-	-	-	Sign Required
1050-1	Physical Education Office	SK	N/A		5/7/2024	-	-	-	Sign

Laboratory Report

NYE Report #: 232135-24953

May 4, 2023

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Verne W. Critz Elementary School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 03, 2023. New York Environmental analyzed the samples on May 04, 2023 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	03 May 2023
Date Received:	03 May 2023
Date Analyzed:	04 May 2023

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
230503N017	1	Main Hall by Nurse's Office-WF, Initial	0.001	<0.001	mg/L	
230503N018	2	Main Hall by Nurse's Office-BF, Initial	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Laboratory Report

NYE Report #: 2402957-29581

May 10, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Verne W. Critz Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 08, 2024. New York Environmental analyzed the samples on May 09, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	07 May 2024
Date Received:	08 May 2024
Date Analyzed:	09 May 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240508N001	1	Kitchen Prep-SK, Initial	0.001	0.012	mg/L	H
240508N002	2	Kitchen Dishwasher Station-SK, Initial	0.001	0.001	mg/L	
240508N003	3	Cafeteria-WF, Initial	0.001	<0.001	mg/L	
240508N004	4	Cafeteria-BF, Initial	0.001	<0.001	mg/L	
240508N005	13	Faculty Room-SK, Initial	0.001	<0.001	mg/L	
240508N006	14	Nurse's Office Room 17B-SK, Initial	0.001	<0.001	mg/L	
240508N007	17	Hall by Room 33-Lower-WF, Initial	0.001	<0.001	mg/L	
240508N008	18	Hall by Room 33-Lower-BF, Initial	0.001	<0.001	mg/L	
240508N009	19	Hall by Room 33-Upper-WF, Initial	0.001	<0.001	mg/L	
240508N010	20	Hall by Room 33-Upper-BF, Initial	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2404144-30262

June 17, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Verne W. Critz Elementary School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 14, 2024. New York Environmental analyzed the samples on June 17, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	14 Jun 2024
Date Received:	14 Jun 2024
Date Analyzed:	17 Jun 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240614R001	1A	Kitchen Prep, Initial	0.001	0.012	mg/L	H
240614R002	1B	Kitchen Prep, 15 Sec Flush	0.001	<0.001	mg/L	
240614R003	1C	Kitchen Prep, 60 Sec Flush	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2405607-31072

September 6, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Vern Critz Elementary

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on September 03, 2024. New York Environmental analyzed the samples on September 04, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	30 Aug 2024
Date Received:	03 Sep 2024
Date Analyzed:	04 Sep 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240903P001	1A	Kitchen Prep-SK, Initial	0.001	0.002	mg/L	
240903P002	1B	Kitchen Prep-SK, 15 Sec Flush	0.001	NA	mg/L	
240903P003	1C	Kitchen Prep-SK, 60 Sec Flush	0.001	NA	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation
NA: Sample not analyzed per customer request.



Appendix H

Administration Annex Building

AHERA Space #	Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1010	1001-1	Room 70	SK	N/A		5/7/2024	-	-	-	Sign
	1001-2	Room 70	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
	1001-3	Room 70 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1009	1002-1	Room 71	SK	N/A		5/7/2024	-	-	-	Sign
	1002-2	Room 71	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
	1002-3	Room 71 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1012	1003-1	Bathroom by Room 71	SK	N/A		5/7/2024	-	-	-	Sign
1007	1004-1	Room 69	SK	N/A		5/7/2024	-	-	-	Sign
	1004-2	Room 69	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
	1004-3	Room 69 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1006	1005-1	Faculty Room	SK	N/A		5/7/2024	-	-	-	Sign
1004	1006-1	Room 72	SK	N/A		5/7/2024	-	-	-	Sign
	1006-2	Room 72	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
1003	1007-1	Room 73	SK	N/A		5/7/2024	-	-	-	Sign
	1007-2	Room 73	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
	1007-3	Room 73 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1001	1008-1	Room 68	SK	N/A		5/7/2024	-	-	-	Sign
	1008-2	Room 68	WF	N/A		5/7/2024	-	-	-	Removed from Service; Capped
	1008-3	Room 68 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign

Appendix I

Family Engagement Center Building at Head Start

AHERA Space #	Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1007	1001-1	Bathroom by Copy Room	SK	N/A		5/7/2024	-	-	-	Sign
1011	1002-1	Kitchen Downstairs	SK	N/A		5/7/2024	-	-	-	Sign
-	1003-1	Men's Bathroom Downstairs	SK	N/A		5/7/2024	-	-	-	Sign
-	1003-2	Men's Bathroom Downstairs	SS	N/A		5/7/2024	-	-	-	Sign
-	1004-1	Women's Bathroom Downstairs	SK	N/A		5/7/2024	-	-	-	Sign

Appendix J

Head Start Building

AHERA Space #	Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
1003	1001-1	Kitchen	SK	App	<1.0	5/7/2024	-	-	-	-
1002	1002-1	Custodial Closet	SS	N/A		5/7/2024	-	-	-	Sign
1004	1003-1	First Floor Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1005	1004-1	Room 3	SK	App	1.0	6/11/2024	<1.0	<1.0	6/11/2024	Remediation Complete
					7.0	5/30/2024				Sign; Pending Remediation
1005A	1004-2	Room 3 Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
1006	1005-1	Room 2	SK	App	<1.0	5/30/2024	-	-	-	-
2001A	2001-1	Foyer Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
2002	2002-2	Room 1	SK	App	<1.0	6/11/2024	<1.0	<1.0	6/11/2024	Remediation Complete
					21.0	5/30/2024				Sign; Pending Remediation

Laboratory Report

NYE Report #: 2402959-29583

May 10, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Headstart Building

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 08, 2024. New York Environmental analyzed the samples on May 09, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	07 May 2024
Date Received:	08 May 2024
Date Analyzed:	09 May 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240508N018	1	Kitchen-SK, Initial	0.001	0.001	mg/L	

Comment:
CID: Client ID LOQ: Limit of Quantitation



Laboratory Report

NYE Report #: 2403586-29963

June 3, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Headstart Building

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 31, 2024. New York Environmental analyzed the samples on June 01, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	30 May 2024
Date Received:	31 May 2024
Date Analyzed:	01 Jun 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240531L001	1	Room 3-SK, Initial	0.001	0.007	mg/L	H
240531L002	2	Room 2-SK, Initial	0.001	<0.001	mg/L	
240531L003	3	Room 1-SK, Initial	0.001	0.021	mg/L	H

Comment:
CID: Client ID LOQ: Limit of Quantitation
H: Sample result exceeds applicable regulatory limit.



Laboratory Report

NYE Report #: 2404031-30199

June 13, 2024

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country Csd; Headstart Building

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 12, 2024. New York Environmental analyzed the samples on June 13, 2024 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	11 Jun 2024
Date Received:	12 Jun 2024
Date Analyzed:	13 Jun 2024

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
240612P001	1A	Room 1-SK, Initial	0.001	0.001	mg/L	
240612P002	1B	Room 1-SK, 15 Sec Flush	0.001	<0.001	mg/L	
240612P003	1C	Room 1-SK, 60 Sec Flush	0.001	<0.001	mg/L	
240612P004	2A	Room 3-SK, Initial	0.001	<0.001	mg/L	
240612P005	2B	Room 3-SK, 15 Sec Flush	0.001	<0.001	mg/L	
240612P006	2C	Room 3-SK, 60 Sec Flush	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix K

Central Administration Building

South Country CSD
Central Administration Building

School Water Outlet Inventory

Lead in School Drinking Water Program 2023 - 2025

AHERA Space #	Fixture #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remarks
-	1003-1	Men's Bathroom @ A	SK	App		5/7/2024	-	-	-	Sign
-	1003-2	Men's Bathroom @ B	SK	App		5/7/2024	-	-	-	Sign
-	1003-3	Men's Bathroom @ C	SK	App		5/7/2024	-	-	-	Sign
-	1004-1	Main Hall	WF	App	<1.0	5/3/2023	-	-	-	-
-	1004-2	Main Hall	BF	App	<1.0	5/3/2023	-	-	-	-
-	1004	Main Hall	WF	N/A		5/3/2023	-	-	-	Removed from Service;Renovated Spring 2023
-	1005-1	Women's Bathroom @ A	SK	N/A		5/7/2024	-	-	-	Sign
-	1005-2	Women's Bathroom @ B	SK	N/A		5/7/2024	-	-	-	Sign
-	1001-1	Human Resource's Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
-	1002-1	Superintendent's Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
-	1002-2	Superintendent's Kitchen	SK	N/A		5/7/2024	-	-	-	Sign
-	1002-3	Superintendent's Kitchen	SPY	N/A		5/7/2024	-	-	-	Sign
-	1007-1	Kitchen	SK	N/A		5/7/2024	-	-	-	Sign
-	1008-1	Rear Superintendent's Secretary Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
-	1008-2	Rear Superintendent's Bathroom	SK	N/A		5/7/2024	-	-	-	Sign
-	1008-3	Rear Superintendent's Bathroom	SS	N/A		5/7/2024	-	-	-	Sign
-	1006-1	Boardroom	SK	N/A		5/7/2024	-	-	-	Sign
-	1006-2	Boardroom	SPY	N/A		5/7/2024	-	-	-	Sign

Laboratory Report

NYE Report #: 232136-24954

May 4, 2023

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: South Country CSD; Central Administration Building

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 03, 2023. New York Environmental analyzed the samples on May 04, 2023 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	03 May 2023
Date Received:	03 May 2023
Date Analyzed:	04 May 2023

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
230503N019	1	Main Hall-WF, Initial	0.001	<0.001	mg/L	
230503N020	2	Main Hall-BF, Initial	0.001	<0.001	mg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation