Mold Air Sampling Memo

VISTA ENVIRONMENTAL CONSULTING

1531 Grand Ave., Suite C. San Marcos, CA 92078 Tel 760.290.3076

2984 Teagarden Street San Leandro, CA 94577 Tel 510.346.8860

1054 N. Tustin Ave. Anaheim, CA 92807 Tel 714.289.2600

Client: HUSD **Date:** 3/4/25

Location: Elmhurst Administration Building **Project Number:** 240041022

Vista Environmental Consulting, Inc. collected non-viable mold spore trap samples on 2/14/25, 2/24/25, 2/28/25 *(Date)*

Select One

☐ Background Air Samples ☒ Post Abatement Air Samples

From: Rooms 17, 18, 19, 20, 21, 23, 24, 25, 26, 27, 29 and Hallway *(Location)*

The results of the aforementioned air monitoring indicate that indoor airborne mold spore levels compared to outdoor airborne mold spore levels were:

Select One

☐ **Higher than (Fail)**
☒ **Lower than or Similar to (Pass)**

Select One

☒ These results indicate a low probability that the spores originated from indoor sources.

☐ These results indicate a moderate likelihood that the spores originated from indoor sources.

☐ These results indicate a high probability that the spores originated from indoor sources.

Based on the results of the sample analysis the following further actions are required:

Select One

☒ None.
☐ Other:

Comments: Dates Passed: 2/14/25 - 18, 26, 27; 2/24/25 - 17, 19, 21, 23, 24, 25, 29; 2/28/25 - 20 and Hallway

Analytical Method: ☒ ***AIHA Spore Trap Analysis: Non-Viable Mold Spores***

☐ ***Other (specify):***

Laboratory analytical results are attached.

Chris Burns		3/4/25
Print Name	**Signature**	**Date**

eurofins | Built Environment Testing

VISTA ENVIRONMENTAL CONSULTING
SINCE 2007 A STELLAR PAST • A BRIGHTER FUTURE

Report for:

Mr. Chris Burns
Vista Environmental
2984 Teagarden St
San Leandro, CA 94577

Regarding: Eurofins Built Environment Testing West, LLC
Project: HUSD_Admin Bldg_240041022
EML ID: 3947974

Approved by:

Murali R Putty

Technical Manager
Murali Putty

Dates of Analysis:
Spore trap analysis: 02-14-2025

Service SOPs: Spore trap analysis (EB-MY-S-1038)
AIHA LAP, LLC accredited service, Lab ID #102856

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. Due to the nature of the analyses performed, field blank correction of results is not applied. The results relate only to the samples as received and tested. Information supplied by the client which can affect the validity of results: sample air volume.

Eurofins Built Environment Testing West, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.
Eurofins Built Environment Testing West, LLC's LabServe® reporting system includes automated fail-safes to ensure that all AIHA LAP, LLC quality requirements are met and notifications are added to reports when any quality steps remain pending.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

SPORE TRAP REPORT: NON-VIABLE METHODOLOGY

Location:	6318824: (Interior of Bldg.) Rm# 17-ATC Lab		6318526: (Interior of Bldg.) Rm# 23		6318540: (Interior of Bldg.) Rm# 27		6318346: (Interior of Bldg.) Rm# 26-Staff BR	
Comments (see below)	A		B		None		C	
Lab ID-Version‡:	19606293-1		19606294-1		19606295-1		19606296-1	
Analysis Date:	02/14/2025		02/14/2025		02/14/2025		02/14/2025	
	raw ct.	spores/m3	raw ct.	spores/m3	raw ct.	spores/m3	raw ct.	spores/m3
Ascospores			3	80			1	27
Basidiospores	1	27	1	27				
Chaetomium								
Cladosporium	3	80	9	240			1	27
Epicoccum								
Fusarium								
Myrothecium								
Nigrospora								
Other brown	1	7	3	20				
Other colorless								
Penicillium/Aspergillus types†	96	1,100	151	2,800	2	53	34	430
Pithomyces								
Rusts								
Smuts, Periconia, Myxomycetes			1	7				
Stachybotrys								
Stemphylium								
Torula								
Ulocladium								
Zygomycetes								
Background debris (1-4+)	3+		3+		2+		2+	
Hyphal fragments/m3	7		20		< 7		< 7	
Pollen/m3	< 7		< 7		< 7		< 7	
Skin cells (1-4+)	1+		1+		1+		1+	
Sample volume (liters)	150		150		150		150	
§ TOTAL SPORES/m3		1,300		3,200		53		480

Comments: A) 71 of the raw count *Penicillium/Aspergillus* type spores were present as a single clump. B) 62 of the raw count *Penicillium/Aspergillus* type spores were present as a single clump. C) 24 of the raw count *Penicillium/Aspergillus* type spores were present as a single clump.

Spore types listed without a count or data entry were not detected during the course of the analysis for the respective sample, indicating a raw count of <1 spore.
† The spores of *Aspergillus* and *Penicillium* (and others such as *Acremonium*, *Paecilomyces*) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods. Also, some species with very small spores are easily missed, and may be undercounted.
††Background debris indicates the amount of non-biological particulate matter present on the trace (dust in the air) and the resulting visibility for the analyst. It is rated from 1+ (low) to 4+ (high). Counts from areas with 4+ background debris should be regarded as minimal counts and may be higher than reported. It is important to account for samples volumes when evaluating dust levels.

The analytical sensitivity is the spores/m^3 divided by the raw count, expressed in spores/m^3, per spore and per sample.

For more information regarding analytical sensitivity, please contact QA by calling the laboratory.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".
§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

SPORE TRAP REPORT: NON-VIABLE METHODOLOGY

Location:	6318347: (Interior of Bldg.) Rm# 24		5788680: (Interior of Bldg.) Rm# 18		6257792: (Interior of Bldg.) Hallway N'		6318793: (Interior of Bldg.) Hallway Center	
Comments (see below)	None		None		None		A	
Lab ID-Version‡:	19606297-1		19606298-1		19606299-1		19606300-1	
Analysis Date:	02/14/2025		02/14/2025		02/14/2025		02/14/2025	
	raw ct.	spores/m3	raw ct.	spores/m3	raw ct.	spores/m3	raw ct.	spores/m3
Ascospores			3	80	1	27	1	27
Basidiospores	14	370	6	160	3	80		
Chaetomium								
Cladosporium	9	240	7	190	9	240	2	53
Curvularia								
Epicoccum								
Fusarium								
Myrothecium								
Nigrospora								
Other brown			1	7	1	7	1	7
Other colorless								
Penicillium/Aspergillus types†	148	3,900	33	880	127	3,400	235	4,800
Pithomyces								
Rusts								
Smuts, Periconia, Myxomycetes								
Stachybotrys								
Stemphylium								
Torula								
Ulocladium								
Zygomycetes								
Background debris (1-4+)	2+		2+		3+		3+	
Hyphal fragments/m3	< 7		13		27		13	
Pollen/m3	< 7		< 7		< 7		< 7	
Skin cells (1-4+)	1+		1+		1+		2+	
Sample volume (liters)	150		150		150		150	
§ TOTAL SPORES/m3		4,600		1,300		3,700		4,900

Comments: A) 71 of the raw count *Penicillium/Aspergillus* type spores were present as a single clump.

Spore types listed without a count or data entry were not detected during the course of the analysis for the respective sample, indicating a raw count of <1 spore.
† The spores of *Aspergillus* and *Penicillium* (and others such as *Acremonium*, *Paecilomyces*) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods. Also, some species with very small spores are easily missed, and may be undercounted.
††Background debris indicates the amount of non-biological particulate matter present on the trace (dust in the air) and the resulting visibility for the analyst. It is rated from 1+ (low) to 4+ (high). Counts from areas with 4+ background debris should be regarded as minimal counts and may be higher than reported. It is important to account for samples volumes when evaluating dust levels.

The analytical sensitivity is the spores/m^3 divided by the raw count, expressed in spores/m^3, per spore and per sample.

For more information regarding analytical sensitivity, please contact QA by calling the laboratory.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".
§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

SPORE TRAP REPORT: NON-VIABLE METHODOLOGY

Location:	6318796: (Interior of Bldg.) Hallway S'		6318798: Exterior of Bldg.		6257643: Exterior of Bldg.	
Comments (see below)	None		None		None	
Lab ID-Version‡:	19606301-1		19606302-1		19606303-1	
Analysis Date:	02/14/2025		02/14/2025		02/14/2025	
	raw ct.	spores/m3	raw ct.	spores/m3	raw ct.	spores/m3
Ascospores	1	27	24	640	42	1,100
Basidiospores	1	27	64	1,700	106	2,800
Chaetomium						
Cladosporium	6	160	5	130	34	910
Curvularia						
Epicoccum						
Fusarium						
Myrothecium						
Nigrospora						
Other brown	2	13	1	7	1	7
Other colorless						
Penicillium/Aspergillus types†	116	3,100	12	320	16	430
Pithomyces						
Rusts						
Smuts, Periconia, Myxomycetes			1	7		
Stachybotrys						
Stemphylium						
Torula						
Ulocladium						
Zygomycetes						
Background debris (1-4+)	3+		3+		2+	
Hyphal fragments/m3	33		7		13	
Pollen/m3	< 7		< 7		< 7	
Skin cells (1-4+)	1+		< 1+		< 1+	
Sample volume (liters)	150		150		150	
§ TOTAL SPORES/m3		3,300		2,800		5,300

Comments:

Spore types listed without a count or data entry were not detected during the course of the analysis for the respective sample, indicating a raw count of <1 spore.
† The spores of *Aspergillus* and *Penicillium* (and others such as *Acremonium*, *Paecilomyces*) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods. Also, some species with very small spores are easily missed, and may be undercounted.
††Background debris indicates the amount of non-biological particulate matter present on the trace (dust in the air) and the resulting visibility for the analyst. It is rated from 1+ (low) to 4+ (high). Counts from areas with 4+ background debris should be regarded as minimal counts and may be higher than reported. It is important to account for samples volumes when evaluating dust levels.

The analytical sensitivity is the spores/m^3 divided by the raw count, expressed in spores/m^3, per spore and per sample.

For more information regarding analytical sensitivity, please contact QA by calling the laboratory.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".
§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

SPORE TRAP REPORT: NON-VIABLE METHODOLOGY

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

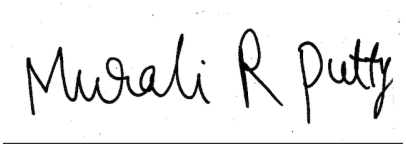

Analyst: Murali Putty

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by AIHA LAP, LLC, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldRANGE™: Extended Outdoor Comparison

Outdoor Location: 6318798, Exterior of Bldg.

Fungi Identified	Outdoor data	Typical Outdoor Data for: February in California† (n‡=36946)						Typical Outdoor Data for: The entire year in California† (n‡=446850)					
	spores/m3	very low	low	med	high	very high	freq %	very low	low	med	high	very high	freq %
Generally able to grow indoors*													
Alternaria	-	13	13	18	53	67	34	13	13	27	53	110	50
Bipolaris/Drechslera group	-	7	13	13	27	53	6	8	13	13	27	53	11
Chaetomium	-	8	13	13	27	40	10	10	13	13	27	40	19
Cladosporium	130	67	120	370	1,100	1,800	92	110	210	590	1,600	2,700	96
Curvularia	-	7	13	13	27	40	2	7	13	13	27	53	6
Nigrospora	-	7	13	13	14	40	5	8	13	13	40	53	9
Other brown	7	13	13	13	40	53	30	13	13	13	40	53	34
Penicillium/Aspergillus types	320	53	80	210	590	960	75	53	93	210	640	1,100	77
Stachybotrys	-	13	13	13	40	80	3	8	13	13	40	67	4
Torula	-	10	13	13	40	53	5	10	13	13	40	67	10
Seldom found growing indoors**													
Ascospores	640	27	53	160	570	1,100	69	27	53	110	410	800	68
Basidiospores	1,700	53	110	370	1,800	3,800	92	53	67	230	1,000	2,500	90
Rusts	-	10	13	13	40	80	13	13	13	13	53	89	24
Smuts, Periconia, Myxomycetes	7	13	13	27	67	110	55	13	13	40	120	230	68
§ TOTAL SPORES/m3	2,800												

†The 'Typical Outdoor Data' represents the typical outdoor spore levels for the location and time frame indicated. The last column represents the frequency of occurrence. The very low, low, med, high, and very high values represent the 10, 20, 50, 80, and 90 percentile values of the spore type when it is detected. For example, if the frequency of occurrence is 63% and the low value is 53, it would mean that the given spore type is detected 63% of the time and, when detected, 20% of the time it is present in levels above the detection limit and below 53 spores/m3. These values are updated periodically, and if enough data is not available to make a statistically meaningful assessment, it is indicated with a dash.

§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

‡n = number of samples used to calculate data.

Interpretation of the data contained in this report is left to the client or the persons who conducted the field work. This report is provided for informational and comparative purposes only and should not be relied upon for any other purpose. "Typical outdoor data" are based on the results of the analysis of samples delivered to and analyzed by Eurofins Built Environment Testing and assumptions regarding the origins of those samples. Sampling techniques, contaminants infecting samples, unrepresentative samples and other similar or dissimilar factors may affect these results. In addition, Eurofins Built Environment Testing may not have received and tested a representative number of samples for every region or time period. Eurofins Built Environment Testing hereby disclaims any liability for any and all direct, indirect, punitive, incidental, special or consequential damages arising out of the use or interpretation of the data contained in, or any actions taken or omitted in reliance upon, this report.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldRANGE™: Extended Outdoor Comparison

Outdoor Location: 6257643, Exterior of Bldg.

Fungi Identified	Outdoor data	Typical Outdoor Data for: February in California† (n‡=36946)						Typical Outdoor Data for: The entire year in California† (n‡=446850)					
	spores/m3	very low	low	med	high	very high	freq %	very low	low	med	high	very high	freq %
Generally able to grow indoors*													
Alternaria	-	13	13	18	53	67	34	13	13	27	53	110	50
Bipolaris/Drechslera group	-	7	13	13	27	53	6	8	13	13	27	53	11
Chaetomium	-	8	13	13	27	40	10	10	13	13	27	40	19
Cladosporium	910	67	120	370	1,100	1,800	92	110	210	590	1,600	2,700	96
Curvularia	-	7	13	13	27	40	2	7	13	13	27	53	6
Nigrospora	-	7	13	13	14	40	5	8	13	13	40	53	9
Other brown	7	13	13	13	40	53	30	13	13	13	40	53	34
Penicillium/Aspergillus types	430	53	80	210	590	960	75	53	93	210	640	1,100	77
Stachybotrys	-	13	13	13	40	80	3	8	13	13	40	67	4
Torula	-	10	13	13	40	53	5	10	13	13	40	67	10
Seldom found growing indoors**													
Ascospores	1,100	27	53	160	570	1,100	69	27	53	110	410	800	68
Basidiospores	2,800	53	110	370	1,800	3,800	92	53	67	230	1,000	2,500	90
Rusts	-	10	13	13	40	80	13	13	13	13	53	89	24
Smuts, Periconia, Myxomycetes	-	13	13	27	67	110	55	13	13	40	120	230	68
§ TOTAL SPORES/m3	5,300												

†The 'Typical Outdoor Data' represents the typical outdoor spore levels for the location and time frame indicated. The last column represents the frequency of occurrence. The very low, low, med, high, and very high values represent the 10, 20, 50, 80, and 90 percentile values of the spore type when it is detected. For example, if the frequency of occurrence is 63% and the low value is 53, it would mean that the given spore type is detected 63% of the time and, when detected, 20% of the time it is present in levels above the detection limit and below 53 spores/m3. These values are updated periodically, and if enough data is not available to make a statistically meaningful assessment, it is indicated with a dash.

§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

‡n = number of samples used to calculate data.

Interpretation of the data contained in this report is left to the client or the persons who conducted the field work. This report is provided for informational and comparative purposes only and should not be relied upon for any other purpose. "Typical outdoor data" are based on the results of the analysis of samples delivered to and analyzed by Eurofins Built Environment Testing and assumptions regarding the origins of those samples. Sampling techniques, contaminants infecting samples, unrepresentative samples and other similar or dissimilar factors may affect these results. In addition, Eurofins Built Environment Testing may not have received and tested a representative number of samples for every region or time period. Eurofins Built Environment Testing hereby disclaims any liability for any and all direct, indirect, punitive, incidental, special or consequential damages arising out of the use or interpretation of the data contained in, or any actions taken or omitted in reliance upon, this report.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldRANGE™: Extended Outdoor Comparison

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

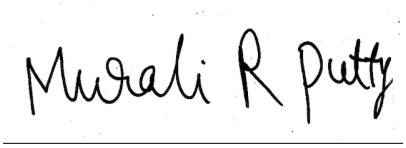

Analyst: Murali Putty

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

Outdoor Sample: 6318798 Exterior of Bldg.

Fungi Identified	Outdoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3
Generally able to grow indoors*			
Alternaria		ND	< 7
Bipolaris/Drechslera group		ND	< 7
Chaetomium		ND	< 7
Cladosporium		5	130
Curvularia		ND	< 7
Nigrospora		ND	< 7
Other brown		1	7
Penicillium/Aspergillus types†		12	320
Stachybotrys		ND	< 7
Torula		ND	< 7
Seldom found growing indoors**			
Ascospores		24	640
Basidiospores		64	1,700
Rusts		ND	< 7
Smuts, Periconia, Myxomycetes		1	7
Total			**2,813**

Location: 6318824 (Interior of Bldg.) Rm# 17-ATC Lab

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		3	80		101
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Other brown		1	7		102
Penicillium/Aspergillus types†		96	1,100		232
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		1	27		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**1,253**	**Final MoldSCORE**	**232**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

Location: 6318526 (Interior of Bldg.) Rm# 23

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		9	240		107
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Other brown		3	20		105
Penicillium/Aspergillus types†		151	2,800		297
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		3	80		100
Basidiospores		1	27		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		1	7		100
Total			**3,160**	**Final MoldSCORE**	**297**

Location: 6318540 (Interior of Bldg.) Rm# 27

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		2	53		107
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**53**	**Final MoldSCORE**	**107**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

Location: 6318346 (Interior of Bldg.) Rm# 26-Staff BR

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		1	27		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		34	430		158
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		1	27		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**480**	**Final MoldSCORE**	**158**

Location: 6318347 (Interior of Bldg.) Rm# 24

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		9	240		107
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		148	3,900		300
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		14	370		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**4,560**	**Final MoldSCORE**	**300**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

Location: 5788680 (Interior of Bldg.) Rm# 18

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		7	190		108
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Other brown		1	7		102
Penicillium/Aspergillus types†		33	880		207
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		3	80		100
Basidiospores		6	160		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**1,313**	**Final MoldSCORE**	**207**

Location: 6257792 (Interior of Bldg.) Hallway N'

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		9	240		107
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Other brown		1	7		100
Penicillium/Aspergillus types†		127	3,400		300
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		1	27		100
Basidiospores		3	80		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**3,740**	**Final MoldSCORE**	**300**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

Location: 6318793 (Interior of Bldg.) Hallway Center

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		2	53		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Other brown		1	7		100
Penicillium/Aspergillus types†		235	4,800		300
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		1	27		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**4,933**	**Final MoldSCORE**	**300**

Location: 6318796 (Interior of Bldg.) Hallway S'

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		6	160		102
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Other brown		2	13		102
Penicillium/Aspergillus types†		116	3,100		299
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		1	27		100
Basidiospores		1	27		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**3,320**	**Final MoldSCORE**	**299**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

†The spores of Aspergillus and Penicillium (and others such as Acremonium, Paecilomyces) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods.

‡Rated on a scale from 100 to 300. A rating less than 150 is low and indicates a low probability of spores originating inside. A rating greater than 250 is high and indicates a high probability that the spores originated from inside, presumably from indoor mold growth. A rating between 150 and 250 indicates a moderate likelihood of indoor fungal growth. MoldSCORE is NOT intended for wall cavity samples. It is intended for ambient air samples in residences. Using the analysis on other samples (like wall cavity samples) will lead to misleading results.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

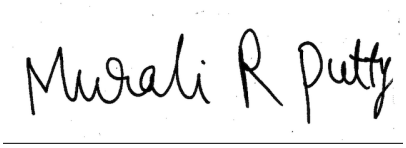

Analyst: Murali Putty

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

Outdoor Sample: 6257643 Exterior of Bldg.

Fungi Identified	Outdoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3
Generally able to grow indoors*			
Alternaria		ND	< 7
Bipolaris/Drechslera group		ND	< 7
Chaetomium		ND	< 7
Cladosporium		34	910
Curvularia		ND	< 7
Nigrospora		ND	< 7
Other brown		1	7
Penicillium/Aspergillus types†		16	430
Stachybotrys		ND	< 7
Torula		ND	< 7
Seldom found growing indoors**			
Ascospores		42	1,100
Basidiospores		106	2,800
Rusts		ND	< 7
Smuts, Periconia, Myxomycetes		ND	< 7
Total			**5,287**

Location: 6318824 (Interior of Bldg.) Rm# 17-ATC Lab

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		3	80		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Other brown		1	7		102
Penicillium/Aspergillus types†		96	1,100		236
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		1	27		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**1,253**	**Final MoldSCORE**	**236**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

Location: 6318526 (Interior of Bldg.) Rm# 23

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		9	240		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Other brown		3	20		106
Penicillium/Aspergillus types†		151	2,800		298
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		3	80		100
Basidiospores		1	27		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		1	7		101
Total			**3,160**	**Final MoldSCORE**	**298**

Location: 6318540 (Interior of Bldg.) Rm# 27

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		2	53		108
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**53**	**Final MoldSCORE**	**108**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

Location: 6318346 (Interior of Bldg.) Rm# 26-Staff BR

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		1	27		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		34	430		161
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		1	27		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**480**	**Final MoldSCORE**	**161**

Location: 6318347 (Interior of Bldg.) Rm# 24

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		9	240		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		148	3,900		300
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		14	370		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**4,560**	**Final MoldSCORE**	**300**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

Location: 5788680 (Interior of Bldg.) Rm# 18

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		7	190		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Other brown		1	7		102
Penicillium/Aspergillus types†		33	880		212
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		3	80		100
Basidiospores		6	160		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**1,313**	**Final MoldSCORE**	**212**

Location: 6257792 (Interior of Bldg.) Hallway N'

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		9	240		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Other brown		1	7		101
Penicillium/Aspergillus types†		127	3,400		300
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		1	27		100
Basidiospores		3	80		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**3,740**	**Final MoldSCORE**	**300**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

Location: 6318793 (Interior of Bldg.) Hallway Center

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		2	53		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Other brown		1	7		100
Penicillium/Aspergillus types†		235	4,800		300
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		1	27		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**4,933**	**Final MoldSCORE**	**300**

Location: 6318796 (Interior of Bldg.) Hallway S'

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		6	160		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Other brown		2	13		104
Penicillium/Aspergillus types†		116	3,100		299
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		1	27		100
Basidiospores		1	27		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**3,320**	**Final MoldSCORE**	**299**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

†The spores of Aspergillus and Penicillium (and others such as Acremonium, Paecilomyces) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods.

‡Rated on a scale from 100 to 300. A rating less than 150 is low and indicates a low probability of spores originating inside. A rating greater than 250 is high and indicates a high probability that the spores originated from inside, presumably from indoor mold growth. A rating between 150 and 250 indicates a moderate likelihood of indoor fungal growth. MoldSCORE is NOT intended for wall cavity samples. It is intended for ambient air samples in residences. Using the analysis on other samples (like wall cavity samples) will lead to misleading results.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-14-2025
Date of Receipt: 02-14-2025
Date of Report: 02-14-2025

MoldSCORE™: Spore Trap Report

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

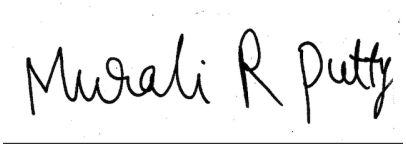

Analyst: Murali Putty

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY

eurofins | Built Environment Testing

www.eurofinsus.com/Built

East: (866) 871-1984
Central: (800) 651-4802
West: (866) 888-6653

SF, CA Location: 111 Anza Blvd. Burlingame, CA, 94010, Suite #122, (866) 888-6653

Weather		Fog	Rain	Snow	Wind	Clear
Level	None	☐	☐	☐	☐	☒
	Light	☐	☐	☐	☐	
	Moderate	☐	☐	☐	☐	
	Heavy	☐	☐	☐	☐	

FUNGAL

REQUEST (Check

003947974

CONTACT INFORMATION

Company:	Vista Environmental Consulting, Inc.	Address:	2984 Teagarden St., San Leandro, CA 94577
Contact:	Christopher R. Burns	Special Instructions:	email results to: chrisburns@vista-env.com, labreports@vista-env.com javier@vista-env.com nocaladmin@vista-env.com
Phone:			

PROJECT INFORMATION

Project ID:	HUSD_Admin Bldg_240041022		
Project Description:			
Project Zip Code:		Sampling Date & Time:	02/14/2025
PO Number:		Sampled By:	AH

TURN AROUND TIME CODES (TAT)

STD – Standard (DEFAULT)
ND – Next Business Day
SD – Same Business Day Rush
WH – Weekend / Holiday

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Sample ID	Description	Sample Type (Below)	TAT (Above)	Total Volume / Area (as applicable)	Notes (Time of day, Temp, RH, etc.)
6318824	(Interior of Bldg.) Rm# 17-ATC Lab	ST	WH	150L	02/14/2025
6318526	(Interior of Bldg.) Rm# 23	ST	WH	150L	02/14/2025
6318540	(Interior of Bldg.) Rm# 27	ST	WH	150L	02/14/2025
6318346	(Interior of Bldg.) Rm# 26-Staff BR	ST	WH	150L	02/14/2025
6318347	(Interior of Bldg.) Rm# 24	ST	WH	150L	02/14/2025
5788680	(Interior of Bldg.) Rm# 18	ST	WH	150L	02/14/2025
6257792	(Interior of Bldg.) Hallway N'	ST	WH	150L	02/14/2025
6318793	(Interior of Bldg.) Hallway Center	ST	WH	150L	02/14/2025
6318796	(Interior of Bldg.) Hallway S'	ST	WH	150L	02/14/2025
6318798	Exterior of Bldg.	ST	WH	150L	02/14/2025
6257643	Exterior of Bldg.	ST	WH	150L	02/14/2025

Non-Culturable																				
Spore Trap		Tape Swab Bulk			BioCassette™, Water, Bulk, Dust, Soil, Contact Plates															Other
Spore Trap Analysis	Spore Trap Analysis – Other particles	Direct Microscopic Exam (Qualitative)	Quantitative Spore Count Direct Exam	Dust Characterization	Air Fungi (Genus ID + Asp. speciation)	Air Fungi - Full speciation Pen. & Clad. genus only	Air Fungi - Full speciation	1-Media Surface Fungi (Genus ID + Asp. speciation)	1-Media Surface Fungi - Full spec. Pen/Clad genus only	1-Media Surface Fungi - Full speciation	2-Media Surface Fungi (Genus ID + Asp. speciation)	2-Media Surface Fungi - Full spec. Pen/Clad genus only	2-Media Surface Fungi - Full speciation	3-Media Surface Fungi (Genus ID + Asp. speciation)	3-Media Surface Fungi - Full spec. Pen/Clad genus only	3-Media Surface Fungi - Full speciation	Mold Score Report
☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒

SAMPLE TYPE CODES			
BC – BioCassette ™	**CP** – Contact Plate	**T** – Tape	**D** – Dust
A1S – Anderson	**ST** – Spore Trap: Zefon, Allergenco, Burkard ...	**SW** – Swab	**W** – Water
SAS – Surface Air Sampler		**B** – Bulk	**SO** – Soil
O – Other:			

	DATE & TIME	RECEIVED BY	DATE & TIME
	02/14/20205-0945 0956		2-14-25 9:5ba

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at: https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms

Copyright © 2019 Eurofins EPK Built Environment Testing, LLC

eurofins | Built Environment Testing

VISTA ENVIRONMENTAL CONSULTING
SINCE 2007 A STELLAR PAST • A BRIGHTER FUTURE

Report for:

Mr. Chris Burns
Vista Environmental
2984 Teagarden St
San Leandro, CA 94577

Regarding: Eurofins Built Environment Testing West, LLC
Project: HUSD_Admin Bldg_240041022
EML ID: 3958219

Approved by:

Technical Manager
Murali Putty

Dates of Analysis:
Spore trap analysis: 02-24-2025

Service SOPs: Spore trap analysis (EB-MY-S-1038)
AIHA LAP, LLC accredited service, Lab ID #102856

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. Due to the nature of the analyses performed, field blank correction of results is not applied. The results relate only to the samples as received and tested. Information supplied by the client which can affect the validity of results: sample air volume.

Eurofins Built Environment Testing West, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.
Eurofins Built Environment Testing West, LLC's LabServe® reporting system includes automated fail-safes to ensure that all AIHA LAP, LLC quality requirements are met and notifications are added to reports when any quality steps remain pending.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

SPORE TRAP REPORT: NON-VIABLE METHODOLOGY

Location:	6318486: Interior of bldg, rm # 19		6318455: Interior of bldg, rm # 21		6318472: Interior of bldg, rm # 23		6318495: Interior of bldg, rm # 25	
Comments (see below)	None		None		None		None	
Lab ID-Version‡:	19661590-1		19661594-1		19661596-1		19661614-1	
Analysis Date:	02/24/2025		02/24/2025		02/24/2025		02/24/2025	
	raw ct.	spores/m3	raw ct.	spores/m3	raw ct.	spores/m3	raw ct.	spores/m3
Alternaria								
Ascospores								
Basidiospores								
Chaetomium								
Cladosporium								
Epicoccum								
Fusarium								
Myrothecium								
Nigrospora								
Other colorless								
Penicillium/Aspergillus types†								
Pithomyces								
Rusts								
Smuts, Periconia, Myxomycetes								
Stachybotrys								
Stemphylium								
Torula								
Ulocladium								
Zygomycetes								
Background debris (1-4+)	1+		1+		3+		1+	
Hyphal fragments/m3	< 7		< 7		< 7		< 7	
Pollen/m3	< 7		< 7		< 7		< 7	
Skin cells (1-4+)	< 1+		< 1+		< 1+		< 1+	
Sample volume (liters)	150		150		150		150	
§ TOTAL SPORES/m3		< 7		< 7		< 7		< 7

Comments:

Spore types listed without a count or data entry were not detected during the course of the analysis for the respective sample, indicating a raw count of <1 spore.
† The spores of *Aspergillus* and *Penicillium* (and others such as *Acremonium*, *Paecilomyces*) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods. Also, some species with very small spores are easily missed, and may be undercounted.
††Background debris indicates the amount of non-biological particulate matter present on the trace (dust in the air) and the resulting visibility for the analyst. It is rated from 1+ (low) to 4+ (high). Counts from areas with 4+ background debris should be regarded as minimal counts and may be higher than reported. It is important to account for samples volumes when evaluating dust levels.

The analytical sensitivity is the spores/m^3 divided by the raw count, expressed in spores/m^3, per spore and per sample.

For more information regarding analytical sensitivity, please contact QA by calling the laboratory.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".
§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

SPORE TRAP REPORT: NON-VIABLE METHODOLOGY

Location:	6318473: Interior of bldg, rm # 29		6318513: Interior of bldg, rm # 24		6318461: Interior of bldg, rm # 20		6318521: Interior of bldg, rm # 17-ATC Lab	
Comments (see below)	None		None		None		None	
Lab ID-Version‡:	19661653-1		19661686-1		19661706-1		19661705-1	
Analysis Date:	02/24/2025		02/24/2025		02/24/2025		02/24/2025	
	raw ct.	spores/m3	raw ct.	spores/m3	raw ct.	spores/m3	raw ct.	spores/m3
Alternaria								
Ascospores								
Basidiospores								
Chaetomium								
Cladosporium								
Epicoccum								
Fusarium								
Myrothecium								
Nigrospora								
Other colorless								
Penicillium/Aspergillus types†					95	2,500	1	27
Pithomyces								
Rusts								
Smuts, Periconia, Myxomycetes								
Stachybotrys								
Stemphylium								
Torula								
Ulocladium								
Zygomycetes								
Background debris (1-4+)	1+		1+		1+		1+	
Hyphal fragments/m3	< 7		< 7		< 7		< 7	
Pollen/m3	< 7		< 7		< 7		< 7	
Skin cells (1-4+)	< 1+		< 1+		< 1+		< 1+	
Sample volume (liters)	150		150		150		150	
§ TOTAL SPORES/m3		< 7		< 7		2,500		27

Comments:

Spore types listed without a count or data entry were not detected during the course of the analysis for the respective sample, indicating a raw count of <1 spore.
† The spores of *Aspergillus* and *Penicillium* (and others such as *Acremonium*, *Paecilomyces*) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods. Also, some species with very small spores are easily missed, and may be undercounted.
††Background debris indicates the amount of non-biological particulate matter present on the trace (dust in the air) and the resulting visibility for the analyst. It is rated from 1+ (low) to 4+ (high). Counts from areas with 4+ background debris should be regarded as minimal counts and may be higher than reported. It is important to account for samples volumes when evaluating dust levels.

The analytical sensitivity is the spores/m^3 divided by the raw count, expressed in spores/m^3, per spore and per sample.

For more information regarding analytical sensitivity, please contact QA by calling the laboratory.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".
§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

SPORE TRAP REPORT: NON-VIABLE METHODOLOGY

Location:	6318534: Exterior of bldg N		6318479: Exterior of bldg S	
Comments (see below)	None		None	
Lab ID-Version‡:	19661648-1		19661597-1	
Analysis Date:	02/24/2025		02/24/2025	
	raw ct.	spores/m3	raw ct.	spores/m3
Alternaria			1	7
Ascospores	46	1,200	22	590
Basidiospores	299	8,000	92	2,500
Botrytis				
Chaetomium	2	13		
Cladosporium	15	400	30	800
Curvularia				
Epicoccum				
Fusarium				
Myrothecium				
Nigrospora				
Other colorless				
Penicillium/Aspergillus types†	6	160		
Pithomyces				
Rusts				
Smuts, Periconia, Myxomycetes	2	13		
Stachybotrys				
Stemphylium				
Torula				
Ulocladium				
Zygomycetes				
Background debris (1-4+)	3+		3+	
Hyphal fragments/m3	< 7		< 7	
Pollen/m3	20		27	
Skin cells (1-4+)	< 1+		< 1+	
Sample volume (liters)	150		150	
§ TOTAL SPORES/m3		9,800		3,800

Comments:

Spore types listed without a count or data entry were not detected during the course of the analysis for the respective sample, indicating a raw count of <1 spore.
† The spores of *Aspergillus* and *Penicillium* (and others such as *Acremonium*, *Paecilomyces*) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods. Also, some species with very small spores are easily missed, and may be undercounted.
††Background debris indicates the amount of non-biological particulate matter present on the trace (dust in the air) and the resulting visibility for the analyst. It is rated from 1+ (low) to 4+ (high). Counts from areas with 4+ background debris should be regarded as minimal counts and may be higher than reported. It is important to account for samples volumes when evaluating dust levels.

The analytical sensitivity is the spores/m^3 divided by the raw count, expressed in spores/m^3, per spore and per sample.

For more information regarding analytical sensitivity, please contact QA by calling the laboratory.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".
§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

SPORE TRAP REPORT: NON-VIABLE METHODOLOGY

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

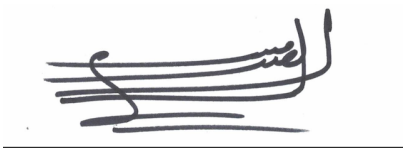

Analyst: Amin Suliman

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by AIHA LAP, LLC, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldRANGE™: Extended Outdoor Comparison

Outdoor Location: 6318534, Exterior of bldg N

Fungi Identified	Outdoor data	Typical Outdoor Data for: February in California† (n‡=36946)						Typical Outdoor Data for: The entire year in California† (n‡=446850)					
	spores/m3	very low	low	med	high	very high	freq %	very low	low	med	high	very high	freq %
Generally able to grow indoors*													
Alternaria	-	13	13	18	53	67	34	13	13	27	53	110	50
Bipolaris/Drechslera group	-	7	13	13	27	53	6	8	13	13	27	53	11
Chaetomium	13	8	13	13	27	40	10	10	13	13	27	40	19
Cladosporium	400	67	120	370	1,100	1,800	92	110	210	590	1,600	2,700	96
Curvularia	-	7	13	13	27	40	2	7	13	13	27	53	6
Nigrospora	-	7	13	13	14	40	5	8	13	13	40	53	9
Penicillium/Aspergillus types	160	53	80	210	590	960	75	53	93	210	640	1,100	77
Stachybotrys	-	13	13	13	40	80	3	8	13	13	40	67	4
Torula	-	10	13	13	40	53	5	10	13	13	40	67	10
Seldom found growing indoors**													
Ascospores	1,200	27	53	160	570	1,100	69	27	53	110	410	800	68
Basidiospores	8,000	53	110	370	1,800	3,800	92	53	67	230	1,000	2,500	90
Rusts	-	10	13	13	40	80	13	13	13	13	53	89	24
Smuts, Periconia, Myxomycetes	13	13	13	27	67	110	55	13	13	40	120	230	68
§ TOTAL SPORES/m3	9,800												

†The 'Typical Outdoor Data' represents the typical outdoor spore levels for the location and time frame indicated. The last column represents the frequency of occurrence. The very low, low, med, high, and very high values represent the 10, 20, 50, 80, and 90 percentile values of the spore type when it is detected. For example, if the frequency of occurrence is 63% and the low value is 53, it would mean that the given spore type is detected 63% of the time and, when detected, 20% of the time it is present in levels above the detection limit and below 53 spores/m3. These values are updated periodically, and if enough data is not available to make a statistically meaningful assessment, it is indicated with a dash.

§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

‡n = number of samples used to calculate data.

Interpretation of the data contained in this report is left to the client or the persons who conducted the field work. This report is provided for informational and comparative purposes only and should not be relied upon for any other purpose. "Typical outdoor data" are based on the results of the analysis of samples delivered to and analyzed by Eurofins Built Environment Testing and assumptions regarding the origins of those samples. Sampling techniques, contaminants infecting samples, unrepresentative samples and other similar or dissimilar factors may affect these results. In addition, Eurofins Built Environment Testing may not have received and tested a representative number of samples for every region or time period. Eurofins Built Environment Testing hereby disclaims any liability for any and all direct, indirect, punitive, incidental, special or consequential damages arising out of the use or interpretation of the data contained in, or any actions taken or omitted in reliance upon, this report.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldRANGE™: Extended Outdoor Comparison

Outdoor Location: 6318479, Exterior of bldg S

Fungi Identified	Outdoor data	Typical Outdoor Data for: February in California† (n‡=36946)						Typical Outdoor Data for: The entire year in California† (n‡=446850)					
	spores/m3	very low	low	med	high	very high	freq %	very low	low	med	high	very high	freq %
Generally able to grow indoors*													
Alternaria	7	13	13	18	53	67	34	13	13	27	53	110	50
Bipolaris/Drechslera group	-	7	13	13	27	53	6	8	13	13	27	53	11
Chaetomium	-	8	13	13	27	40	10	10	13	13	27	40	19
Cladosporium	800	67	120	370	1,100	1,800	92	110	210	590	1,600	2,700	96
Curvularia	-	7	13	13	27	40	2	7	13	13	27	53	6
Nigrospora	-	7	13	13	14	40	5	8	13	13	40	53	9
Penicillium/Aspergillus types	-	53	80	210	590	960	75	53	93	210	640	1,100	77
Stachybotrys	-	13	13	13	40	80	3	8	13	13	40	67	4
Torula	-	10	13	13	40	53	5	10	13	13	40	67	10
Seldom found growing indoors**													
Ascospores	590	27	53	160	570	1,100	69	27	53	110	410	800	68
Basidiospores	2,500	53	110	370	1,800	3,800	92	53	67	230	1,000	2,500	90
Rusts	-	10	13	13	40	80	13	13	13	13	53	89	24
Smuts, Periconia, Myxomycetes	-	13	13	27	67	110	55	13	13	40	120	230	68
§ TOTAL SPORES/m3	3,800												

†The 'Typical Outdoor Data' represents the typical outdoor spore levels for the location and time frame indicated. The last column represents the frequency of occurrence. The very low, low, med, high, and very high values represent the 10, 20, 50, 80, and 90 percentile values of the spore type when it is detected. For example, if the frequency of occurrence is 63% and the low value is 53, it would mean that the given spore type is detected 63% of the time and, when detected, 20% of the time it is present in levels above the detection limit and below 53 spores/m3. These values are updated periodically, and if enough data is not available to make a statistically meaningful assessment, it is indicated with a dash.

§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

‡n = number of samples used to calculate data.

Interpretation of the data contained in this report is left to the client or the persons who conducted the field work. This report is provided for informational and comparative purposes only and should not be relied upon for any other purpose. "Typical outdoor data" are based on the results of the analysis of samples delivered to and analyzed by Eurofins Built Environment Testing and assumptions regarding the origins of those samples. Sampling techniques, contaminants infecting samples, unrepresentative samples and other similar or dissimilar factors may affect these results. In addition, Eurofins Built Environment Testing may not have received and tested a representative number of samples for every region or time period. Eurofins Built Environment Testing hereby disclaims any liability for any and all direct, indirect, punitive, incidental, special or consequential damages arising out of the use or interpretation of the data contained in, or any actions taken or omitted in reliance upon, this report.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldRANGE™: Extended Outdoor Comparison

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

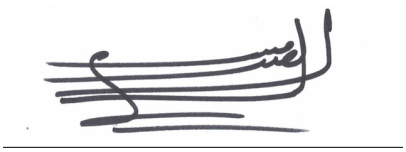

Analyst: Amin Suliman

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldSCORE™: Spore Trap Report

Outdoor Sample: 6318534 Exterior of bldg N

Fungi Identified	Outdoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3
Generally able to grow indoors*			
Alternaria		ND	< 7
Bipolaris/Drechslera group		ND	< 7
Chaetomium		2	13
Cladosporium		15	400
Curvularia		ND	< 7
Nigrospora		ND	< 7
Penicillium/Aspergillus types†		6	160
Stachybotrys		ND	< 7
Torula		ND	< 7
Seldom found growing indoors**			
Ascospores		46	1,200
Basidiospores		299	8,000
Rusts		ND	< 7
Smuts, Periconia, Myxomycetes		2	13
Total			**9,787**

Location: 6318486 Interior of bldg, rm #19

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldSCORE™: Spore Trap Report

Location: 6318455 Interior of bldg, rm #21

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Location: 6318472 Interior of bldg, rm #23

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldSCORE™: Spore Trap Report

Location: 6318495 Interior of bldg, rm #25

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Location: 6318473 Interior of bldg, rm #29

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldSCORE™: Spore Trap Report

Location: 6318513 Interior of bldg, rm #24

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Location: 6318461 Interior of bldg, rm #20

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		95	2,500		297
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**2,533**	**Final MoldSCORE**	**297**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldSCORE™: Spore Trap Report

Location: 6318521 Interior of bldg, rm #17-ATC Lab

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		1	27		104
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**27**	**Final MoldSCORE**	**104**

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

†The spores of Aspergillus and Penicillium (and others such as Acremonium, Paecilomyces) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods.

‡Rated on a scale from 100 to 300. A rating less than 150 is low and indicates a low probability of spores originating inside. A rating greater than 250 is high and indicates a high probability that the spores originated from inside, presumably from indoor mold growth. A rating between 150 and 250 indicates a moderate likelihood of indoor fungal growth. MoldSCORE is NOT intended for wall cavity samples. It is intended for ambient air samples in residences. Using the analysis on other samples (like wall cavity samples) will lead to misleading results.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldSCORE™: Spore Trap Report

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

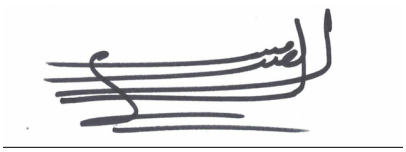

Analyst: Amin Suliman

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldSCORE™: Spore Trap Report

Outdoor Sample: 6318479 Exterior of bldg S

Fungi Identified	Outdoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3
Generally able to grow indoors*			
Alternaria		1	7
Bipolaris/Drechslera group		ND	< 7
Chaetomium		ND	< 7
Cladosporium		30	800
Curvularia		ND	< 7
Nigrospora		ND	< 7
Penicillium/Aspergillus types†		ND	< 7
Stachybotrys		ND	< 7
Torula		ND	< 7
Seldom found growing indoors**			
Ascospores		22	590
Basidiospores		92	2,500
Rusts		ND	< 7
Smuts, Periconia, Myxomycetes		ND	< 7
Total			**3,847**

Location: 6318486 Interior of bldg, rm #19

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldSCORE™: Spore Trap Report

Location: 6318455 Interior of bldg, rm #21

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Location: 6318472 Interior of bldg, rm #23

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldSCORE™: Spore Trap Report

Location: 6318495 Interior of bldg, rm #25

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Location: 6318473 Interior of bldg, rm #29

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldSCORE™: Spore Trap Report

Location: 6318513 Interior of bldg, rm #24

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Location: 6318461 Interior of bldg, rm #20

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		95	2,500		298
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**2,533**	**Final MoldSCORE**	**298**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldSCORE™: Spore Trap Report

Location: 6318521 Interior of bldg, rm #17-ATC Lab

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		1	27		104
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**27**	**Final MoldSCORE**	**104**

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

†The spores of Aspergillus and Penicillium (and others such as Acremonium, Paecilomyces) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods.

‡Rated on a scale from 100 to 300. A rating less than 150 is low and indicates a low probability of spores originating inside. A rating greater than 250 is high and indicates a high probability that the spores originated from inside, presumably from indoor mold growth. A rating between 150 and 250 indicates a moderate likelihood of indoor fungal growth. MoldSCORE is NOT intended for wall cavity samples. It is intended for ambient air samples in residences. Using the analysis on other samples (like wall cavity samples) will lead to misleading results.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_Admin Bldg_240041022

Date of Sampling: 02-24-2025
Date of Receipt: 02-24-2025
Date of Report: 02-24-2025

MoldSCORE™: Spore Trap Report

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

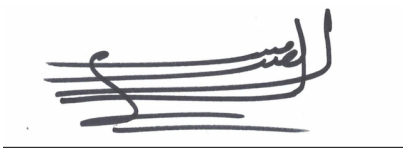

Analyst: Amin Suliman

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

53 Degrees
92% Humidity

003958219

CHAIN OF CUSTODY

eurofins | Built Environment Testing

www.eurofinsus.com/Built

East: (866) 871-1984
Central: (800) 651-4802
West: (866) 888-8653

SF, CA Location: 111 Anza Blvd. Burlingame, CA, 94010, Suite #122, (866) 888-6653

Weather	Fog	Rain	Snow	Wind	Clear
Level: None	☐	☐	☐	☐	☐
Level: Light	☒	☐	☐	☐	
Level: Moderate	☐	☐	☐	☐	
Level: Heavy	☐	☐	☐	☐	

FUNGAL ANA

CONTACT INFORMATION

Company:	Vista Environmental Consulting, Inc.	Address:	2984 Teagarden St., San Leandro, CA 94577
Contact:	Christopher R. Burns	Special Instructions:	email results to: chrisburns@vista-env.com, labreports@vista-env.com javier@vista-env.com nocaladmin@vista-env.com
Phone:			

PROJECT INFORMATION

Project ID:	HUSD_Admin Bldg_240041022		
Project Description:	**3HR TURNAROUND PLEASE		
Project Zip Code:		Sampling Date & Time:	02/24/2025
PO Number:		Sampled By:	A. Anderson

TURN AROUND TIME CODES (TAT)

STD – Standard (DEFAULT)
ND – Next Business Day
SD – Same Business Day Rush
WH – Weekend / Holiday

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

REQUESTED SERVICES (Check boxes below)

Sample ID	Description	Sample Type (Below)	TAT (Above)	Total Volume / Area (as applicable)	Notes (Time of day, Temp, RH, etc.)	Non-Culturable: Spore Trap: Spore Trap Analysis	Non-Culturable: Spore Trap: Spore Trap Analysis – Other particles	Non-Culturable: Tape Swab Bulk: Direct Microscopic Exam (Qualitative)	Non-Culturable: Tape Swab Bulk: Quantitative Spore Count Direct Exam	Non-Culturable: Tape Swab Bulk: Dust Characterization	Culturable: BioCassette™, Andersen, SAS, Swab, Water, Bulk, Dust, Soil, Contact Plates: Air Fungi (Genus ID + Asp. speciation)	Air Fungi - Full speciation Pen. & Clad. genus only	Air Fungi - Full speciation	1-Media Surface Fungi (Genus ID + Asp. speciation)	1-Media Surface Fungi - Full spec. Pen/Clad genus only	1-Media Surface Fungi - Full speciation	2-Media Surface Fungi (Genus ID + Asp. speciation)	2-Media Surface Fungi - Full spec. Pen/Clad genus only	2-Media Surface Fungi - Full speciation	3-Media Surface Fungi (Genus ID + Asp. speciation)	3-Media Surface Fungi - Full spec. Pen/Clad genus only	3-Media Surface Fungi - Full speciation	Other: Mold Score Report
6318486	(Interior of Bldg.) Rm# 19	ST	SD	150L	02/24/2025	☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
6318455	(Interior of Bldg.) Rm# 21	ST	SD	150L	02/24/2025	☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
6318472	(Interior of Bldg.) Rm# 23	ST	SD	150L	02/24/2025	☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
6318495	(Interior of Bldg.) Rm# 25	ST	SD	150L	02/24/2025	☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
6318473	(Interior of Bldg.) Rm# 29	ST	SD	150L	02/24/2025	☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
6318513	(Interior of Bldg.) Rm# 24	ST	SD	150L	02/24/2025	☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
6318461	(Interior of Bldg.) Rm#20	ST	SD	150L	02/24/2025	☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
6318521	(Interior of Bldg.) Rm#17-ATC Lab	ST	SD	150L	02/24/2025	☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
6318534	Exterior of Bldg. N'	ST	SD	150L	02/24/2025	☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
6318479	Exterior of Bldg. S'	ST	SD	150L	02/24/2025	☒	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☒
						☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐	☐

SAMPLE TYPE CODES

BC – BioCassette ™	**CP** – Contact Plate	**T** – Tape	**D** – Dust
A1S – Andersen	**ST** – Spore Trap: Zefon, Allergenco, Burkard,...	**SW** – Swab	**W** – Water
SAS – Surface Air Sampler		**B** – Bulk	**SO** – Soil
O – Other:			

RELINQUISHED BY	DATE & TIME	RECEIVED BY	DATE & TIME
Alarcon	02/24/2025	LG 2/24/25	950

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at: https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms

Copyright © 2019 Eurofins EPK Built Environment Testing, LLC

eurofins | Built Environment Testing

VISTA ENVIRONMENTAL CONSULTING
SINCE 2007 A STELLAR PAST • A BRIGHTER FUTURE

Report for:

Mr. Chris Burns
Vista Environmental
2984 Teagarden St
San Leandro, CA 94577

Regarding: Eurofins Built Environment Testing West, LLC
Project: HUSD_District Office_240041022
EML ID: 3965320

Approved by:

Technical Manager
Murali Putty

Dates of Analysis:
Spore trap analysis: 02-28-2025

Service SOPs: Spore trap analysis (EB-MY-S-1038)
AIHA LAP, LLC accredited service, Lab ID #102856

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. Due to the nature of the analyses performed, field blank correction of results is not applied. The results relate only to the samples as received and tested. Information supplied by the client which can affect the validity of results: sample air volume.

Eurofins Built Environment Testing West, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.
Eurofins Built Environment Testing West, LLC's LabServe® reporting system includes automated fail-safes to ensure that all AIHA LAP, LLC quality requirements are met and notifications are added to reports when any quality steps remain pending.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

SPORE TRAP REPORT: NON-VIABLE METHODOLOGY

Location:	6318507: Interior of Bldg, Hallway W		6318517: Interior of Bldg, Hallway Center		6318489: Interior of Bldg, Hallway E	
Comments (see below)	None		None		None	
Lab ID-Version‡:	19706441-1		19706442-1		19706443-1	
Analysis Date:	02/28/2025		02/28/2025		02/28/2025	
	raw ct.	spores/m3	raw ct.	spores/m3	raw ct.	spores/m3
Alternaria						
Ascospores						
Basidiospores	19	510				
Botrytis						
Chaetomium						
Cladosporium	3	80				
Epicoccum						
Fusarium						
Myrothecium						
Nigrospora						
Oidium						
Other colorless						
Penicillium/Aspergillus types†	2	53				
Pithomyces						
Rusts						
Smuts, Periconia, Myxomycetes						
Stachybotrys						
Stemphylium						
Torula						
Ulocladium						
Zygomycetes						
Background debris (1-4+)	3+		4+		3+	
Hyphal fragments/m3	< 7		< 7		< 7	
Pollen/m3	< 7		< 7		< 7	
Skin cells (1-4+)	1+		< 1+		2+	
Sample volume (liters)	150		150		150	
§ TOTAL SPORES/m3		640		< 7		< 7

Comments:

Spore types listed without a count or data entry were not detected during the course of the analysis for the respective sample, indicating a raw count of <1 spore.
† The spores of *Aspergillus* and *Penicillium* (and others such as *Acremonium*, *Paecilomyces*) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods. Also, some species with very small spores are easily missed, and may be undercounted.
††Background debris indicates the amount of non-biological particulate matter present on the trace (dust in the air) and the resulting visibility for the analyst. It is rated from 1+ (low) to 4+ (high). Counts from areas with 4+ background debris should be regarded as minimal counts and may be higher than reported. It is important to account for samples volumes when evaluating dust levels.

The analytical sensitivity is the spores/m^3 divided by the raw count, expressed in spores/m^3, per spore and per sample.

For more information regarding analytical sensitivity, please contact QA by calling the laboratory.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".
§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

SPORE TRAP REPORT: NON-VIABLE METHODOLOGY

Location:	6318514: Interior of Bldg, Rm #20		6318497: Exterior of Bldg. NE		6318480: Exterior of Bldg. NW	
Comments (see below)	None		None		None	
Lab ID-Version‡:	19706444-1		19706445-1		19706446-1	
Analysis Date:	02/28/2025		02/28/2025		02/28/2025	
	raw ct.	spores/m3	raw ct.	spores/m3	raw ct.	spores/m3
Alternaria			2	13	2	13
Ascospores			9	500	6	160
Basidiospores			315	8,400	268	7,100
Botrytis			2	13		
Chaetomium						
Cladosporium			108	2,900	85	2,300
Curvularia						
Epicoccum					1	7
Fusarium						
Myrothecium						
Nigrospora						
Oidium					1	7
Other colorless						
Penicillium/Aspergillus types†			21	1,200	31	830
Pithomyces						
Rusts						
Smuts, Periconia, Myxomycetes			3	20	2	13
Stachybotrys						
Stemphylium						
Torula			1	7	1	7
Ulocladium						
Zygomycetes						
Background debris (1-4+)	1+		3+		3+	
Hyphal fragments/m3	< 7		27		20	
Pollen/m3	< 7		33		100	
Skin cells (1-4+)	< 1+		< 1+		< 1+	
Sample volume (liters)	150		150		150	
§ TOTAL SPORES/m3		< 7		13,000		10,000

Comments:

Spore types listed without a count or data entry were not detected during the course of the analysis for the respective sample, indicating a raw count of <1 spore.
† The spores of *Aspergillus* and *Penicillium* (and others such as *Acremonium*, *Paecilomyces*) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods. Also, some species with very small spores are easily missed, and may be undercounted.
††Background debris indicates the amount of non-biological particulate matter present on the trace (dust in the air) and the resulting visibility for the analyst. It is rated from 1+ (low) to 4+ (high). Counts from areas with 4+ background debris should be regarded as minimal counts and may be higher than reported. It is important to account for samples volumes when evaluating dust levels.

The analytical sensitivity is the spores/m^3 divided by the raw count, expressed in spores/m^3, per spore and per sample.

For more information regarding analytical sensitivity, please contact QA by calling the laboratory.
‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".
§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

SPORE TRAP REPORT: NON-VIABLE METHODOLOGY

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

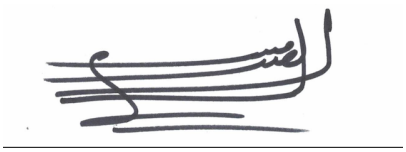

Analyst: Amin Suliman

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by AIHA LAP, LLC, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldRANGE™: Extended Outdoor Comparison

Outdoor Location: 6318497, Exterior of Bldg. NE

Fungi Identified	Outdoor data	Typical Outdoor Data for: February in California† (n‡=36946)						Typical Outdoor Data for: The entire year in California† (n‡=446850)					
	spores/m3	very low	low	med	high	very high	freq %	very low	low	med	high	very high	freq %
Generally able to grow indoors*													
Alternaria	13	13	13	18	53	67	34	13	13	27	53	110	50
Bipolaris/Drechslera group	-	7	13	13	27	53	6	8	13	13	27	53	11
Chaetomium	-	8	13	13	27	40	10	10	13	13	27	40	19
Cladosporium	2,900	67	120	370	1,100	1,800	92	110	210	590	1,600	2,700	96
Curvularia	-	7	13	13	27	40	2	7	13	13	27	53	6
Epicoccum	-	8	13	13	27	53	11	10	13	13	40	53	17
Nigrospora	-	7	13	13	14	40	5	8	13	13	40	53	9
Penicillium/Aspergillus types	1,200	53	80	210	590	960	75	53	93	210	640	1,100	77
Stachybotrys	-	13	13	13	40	80	3	8	13	13	40	67	4
Torula	7	10	13	13	40	53	5	10	13	13	40	67	10
Seldom found growing indoors**													
Ascospores	500	27	53	160	570	1,100	69	27	53	110	410	800	68
Basidiospores	8,400	53	110	370	1,800	3,800	92	53	67	230	1,000	2,500	90
Botrytis	13	13	13	17	53	80	13	13	13	20	53	80	13
Oidium	-	13	13	13	40	67	14	13	13	13	53	80	19
Rusts	-	10	13	13	40	80	13	13	13	13	53	89	24
Smuts, Periconia, Myxomycetes	20	13	13	27	67	110	55	13	13	40	120	230	68
§ TOTAL SPORES/m3	13,000												

†The 'Typical Outdoor Data' represents the typical outdoor spore levels for the location and time frame indicated. The last column represents the frequency of occurrence. The very low, low, med, high, and very high values represent the 10, 20, 50, 80, and 90 percentile values of the spore type when it is detected. For example, if the frequency of occurrence is 63% and the low value is 53, it would mean that the given spore type is detected 63% of the time and, when detected, 20% of the time it is present in levels above the detection limit and below 53 spores/m3. These values are updated periodically, and if enough data is not available to make a statistically meaningful assessment, it is indicated with a dash.

§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

‡n = number of samples used to calculate data.

Interpretation of the data contained in this report is left to the client or the persons who conducted the field work. This report is provided for informational and comparative purposes only and should not be relied upon for any other purpose. "Typical outdoor data" are based on the results of the analysis of samples delivered to and analyzed by Eurofins Built Environment Testing and assumptions regarding the origins of those samples. Sampling techniques, contaminants infecting samples, unrepresentative samples and other similar or dissimilar factors may affect these results. In addition, Eurofins Built Environment Testing may not have received and tested a representative number of samples for every region or time period. Eurofins Built Environment Testing hereby disclaims any liability for any and all direct, indirect, punitive, incidental, special or consequential damages arising out of the use or interpretation of the data contained in, or any actions taken or omitted in reliance upon, this report.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldRANGE™: Extended Outdoor Comparison

Outdoor Location: 6318480, Exterior of Bldg. NW

Fungi Identified	Outdoor data	Typical Outdoor Data for: February in California† (n‡=36946)						Typical Outdoor Data for: The entire year in California† (n‡=446850)					
	spores/m3	very low	low	med	high	very high	freq %	very low	low	med	high	very high	freq %
Generally able to grow indoors*													
Alternaria	13	13	13	18	53	67	34	13	13	27	53	110	50
Bipolaris/Drechslera group	-	7	13	13	27	53	6	8	13	13	27	53	11
Chaetomium	-	8	13	13	27	40	10	10	13	13	27	40	19
Cladosporium	2,300	67	120	370	1,100	1,800	92	110	210	590	1,600	2,700	96
Curvularia	-	7	13	13	27	40	2	7	13	13	27	53	6
Epicoccum	7	8	13	13	27	53	11	10	13	13	40	53	17
Nigrospora	-	7	13	13	14	40	5	8	13	13	40	53	9
Penicillium/Aspergillus types	830	53	80	210	590	960	75	53	93	210	640	1,100	77
Stachybotrys	-	13	13	13	40	80	3	8	13	13	40	67	4
Torula	7	10	13	13	40	53	5	10	13	13	40	67	10
Seldom found growing indoors**													
Ascospores	160	27	53	160	570	1,100	69	27	53	110	410	800	68
Basidiospores	7,100	53	110	370	1,800	3,800	92	53	67	230	1,000	2,500	90
Botrytis	-	13	13	17	53	80	13	13	13	20	53	80	13
Oidium	7	13	13	13	40	67	14	13	13	13	53	80	19
Rusts	-	10	13	13	40	80	13	13	13	13	53	89	24
Smuts, Periconia, Myxomycetes	13	13	13	27	67	110	55	13	13	40	120	230	68
§ TOTAL SPORES/m3	10,000												

†The 'Typical Outdoor Data' represents the typical outdoor spore levels for the location and time frame indicated. The last column represents the frequency of occurrence. The very low, low, med, high, and very high values represent the 10, 20, 50, 80, and 90 percentile values of the spore type when it is detected. For example, if the frequency of occurrence is 63% and the low value is 53, it would mean that the given spore type is detected 63% of the time and, when detected, 20% of the time it is present in levels above the detection limit and below 53 spores/m3. These values are updated periodically, and if enough data is not available to make a statistically meaningful assessment, it is indicated with a dash.

§ Total Spores/m3 has been rounded to two significant figures to reflect analytical precision.

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

‡n = number of samples used to calculate data.

Interpretation of the data contained in this report is left to the client or the persons who conducted the field work. This report is provided for informational and comparative purposes only and should not be relied upon for any other purpose. "Typical outdoor data" are based on the results of the analysis of samples delivered to and analyzed by Eurofins Built Environment Testing and assumptions regarding the origins of those samples. Sampling techniques, contaminants infecting samples, unrepresentative samples and other similar or dissimilar factors may affect these results. In addition, Eurofins Built Environment Testing may not have received and tested a representative number of samples for every region or time period. Eurofins Built Environment Testing hereby disclaims any liability for any and all direct, indirect, punitive, incidental, special or consequential damages arising out of the use or interpretation of the data contained in, or any actions taken or omitted in reliance upon, this report.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldRANGE™: Extended Outdoor Comparison

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

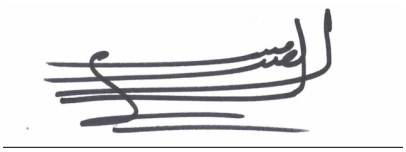

Analyst: Amin Suliman

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldSCORE™: Spore Trap Report

Outdoor Sample: 6318497 Exterior of Bldg. NE

Fungi Identified	Outdoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3
Generally able to grow indoors*			
Alternaria		2	13
Bipolaris/Drechslera group		ND	< 7
Chaetomium		ND	< 7
Cladosporium		108	2,900
Curvularia		ND	< 7
Nigrospora		ND	< 7
Penicillium/Aspergillus types†		21	1,200
Stachybotrys		ND	< 7
Torula		1	7
Seldom found growing indoors**			
Ascospores		9	500
Basidiospores		315	8,400
Botrytis		2	13
Rusts		ND	< 7
Smuts, Periconia, Myxomycetes		3	20
Total			**13,000**

Location: 6318507 Interior of Bldg, Hallway W

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		3	80		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		2	53		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		19	510		110
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**640**	**Final MoldSCORE**	**110**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldSCORE™: Spore Trap Report

Location: 6318517 Interior of Bldg, Hallway Center

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Location: 6318489 Interior of Bldg, Hallway E

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldSCORE™: Spore Trap Report

Location: 6318514 Interior of Bldg, Rm #20

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

†The spores of Aspergillus and Penicillium (and others such as Acremonium, Paecilomyces) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods.

‡Rated on a scale from 100 to 300. A rating less than 150 is low and indicates a low probability of spores originating inside. A rating greater than 250 is high and indicates a high probability that the spores originated from inside, presumably from indoor mold growth. A rating between 150 and 250 indicates a moderate likelihood of indoor fungal growth. MoldSCORE is NOT intended for wall cavity samples. It is intended for ambient air samples in residences. Using the analysis on other samples (like wall cavity samples) will lead to misleading results.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldSCORE™: Spore Trap Report

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

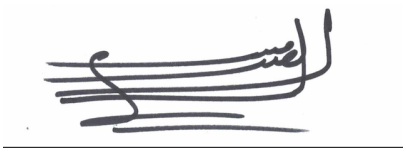

Analyst: Amin Suliman

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldSCORE™: Spore Trap Report

Outdoor Sample: 6318480 Exterior of Bldg. NW

Fungi Identified	Outdoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3
Generally able to grow indoors*			
Alternaria		2	13
Bipolaris/Drechslera group		ND	< 7
Chaetomium		ND	< 7
Cladosporium		85	2,300
Curvularia		ND	< 7
Epicoccum		1	7
Nigrospora		ND	< 7
Penicillium/Aspergillus types†		31	830
Stachybotrys		ND	< 7
Torula		1	7
Seldom found growing indoors**			
Ascospores		6	160
Basidiospores		268	7,100
Oidium		1	7
Rusts		ND	< 7
Smuts, Periconia, Myxomycetes		2	13
Total			**10,447**

Location: 6318507 Interior of Bldg, Hallway W

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		3	80		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		2	53		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		19	510		108
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**640**	**Final MoldSCORE**	**108**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldSCORE™: Spore Trap Report

Location: 6318517 Interior of Bldg, Hallway Center

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Location: 6318489 Interior of Bldg, Hallway E

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldSCORE™: Spore Trap Report

Location: 6318514 Interior of Bldg, Rm #20

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

†The spores of Aspergillus and Penicillium (and others such as Acremonium, Paecilomyces) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods.

‡Rated on a scale from 100 to 300. A rating less than 150 is low and indicates a low probability of spores originating inside. A rating greater than 250 is high and indicates a high probability that the spores originated from inside, presumably from indoor mold growth. A rating between 150 and 250 indicates a moderate likelihood of indoor fungal growth. MoldSCORE is NOT intended for wall cavity samples. It is intended for ambient air samples in residences. Using the analysis on other samples (like wall cavity samples) will lead to misleading results.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldSCORE™: Spore Trap Report

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

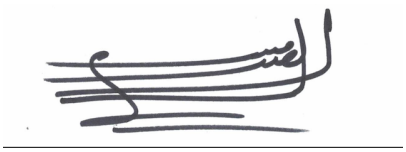

Analyst: Amin Suliman

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldSCORE™: Spore Trap Report

Outdoor Sample: 6318480 Exterior of Bldg. NW

Fungi Identified	Outdoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3
Generally able to grow indoors*			
Alternaria		2	13
Bipolaris/Drechslera group		ND	< 7
Chaetomium		ND	< 7
Cladosporium		85	2,300
Curvularia		ND	< 7
Epicoccum		1	7
Nigrospora		ND	< 7
Penicillium/Aspergillus types†		31	830
Stachybotrys		ND	< 7
Torula		1	7
Seldom found growing indoors**			
Ascospores		6	160
Basidiospores		268	7,100
Oidium		1	7
Rusts		ND	< 7
Smuts, Periconia, Myxomycetes		2	13
Total			**10,447**

Location: 6318507 Interior of Bldg, Hallway W

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		3	80		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		2	53		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		19	510		108
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**640**	**Final MoldSCORE**	**108**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldSCORE™: Spore Trap Report

Location: 6318517 Interior of Bldg, Hallway Center

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Location: 6318489 Interior of Bldg, Hallway E

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built

Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldSCORE™: Spore Trap Report

Location: 6318514 Interior of Bldg, Rm #20

Fungi Identified	Indoor sample spores/m3 <100 1K 10K >100K	Raw count	Spores/ m3	MoldSCORE‡ 100 200 300	Score
Generally able to grow indoors*					
Alternaria		ND	< 7		100
Bipolaris/Drechslera group		ND	< 7		100
Chaetomium		ND	< 7		100
Cladosporium		ND	< 7		100
Curvularia		ND	< 7		100
Nigrospora		ND	< 7		100
Penicillium/Aspergillus types†		ND	< 7		100
Stachybotrys		ND	< 7		100
Torula		ND	< 7		100
Seldom found growing indoors**					
Ascospores		ND	< 7		100
Basidiospores		ND	< 7		100
Rusts		ND	< 7		100
Smuts, Periconia, Myxomycetes		ND	< 7		100
Total			**N/A**	**Final MoldSCORE**	**100**

* The spores in this category are generally capable of growing on wet building materials in addition to growing outdoors. Building related growth is dependent upon the fungal type, moisture level, type of material, and other factors. *Cladosporium* is one of the predominant spore types worldwide and is frequently present in high numbers. *Penicillium/Aspergillus* species colonize both outdoor and indoor wet surfaces rapidly and are very easily dispersed. Other genera are usually present in lesser numbers.

** These fungi are generally not found growing on wet building materials. For example, the rusts and smuts are obligate plant pathogens. However, in each group there are notable exceptions. For example, agents of wood decay are members of the basidiomycetes and high counts of a single morphological type of basidiospore on an inside sample should be considered significant.

†The spores of Aspergillus and Penicillium (and others such as Acremonium, Paecilomyces) are small and round with very few distinguishing characteristics. They cannot be differentiated by non-viable sampling methods.

‡Rated on a scale from 100 to 300. A rating less than 150 is low and indicates a low probability of spores originating inside. A rating greater than 250 is high and indicates a high probability that the spores originated from inside, presumably from indoor mold growth. A rating between 150 and 250 indicates a moderate likelihood of indoor fungal growth. MoldSCORE is NOT intended for wall cavity samples. It is intended for ambient air samples in residences. Using the analysis on other samples (like wall cavity samples) will lead to misleading results.

Eurofins Built Environment Testing West, LLC
111 Anza Boulevard, Suite 122, Burlingame, CA 94010
(833) 465-5857 www.eurofinsus.com/Built


Client: Vista Environmental
C/O: Mr. Chris Burns
Re: HUSD_District Office_240041022

Date of Sampling: 02-28-2025
Date of Receipt: 02-28-2025
Date of Report: 02-28-2025

MoldSCORE™: Spore Trap Report

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst

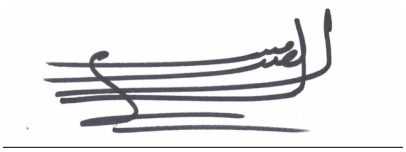

Analyst: Amin Suliman

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".