

Glen Cove City School District
Districtwide Lead in Drinking Water
Sampling and Remediation Plan

2020-2021



ENVIROSCIENCE
CONSULTANTS INC.

2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project #20972

Districtwide Lead in Drinking Water
Sampling and Remediation Plan

Performed for:

Glen Cove City School District
150 Dosoris Lane
Glen Cove, NY 11542

June 2021

Prepared by:

Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #20972

President



Glenn Neuschwender

Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

I. Executive Summary

II. Sampling Methodology

III. Initial Results

Appendix A – Connolly Elementary School

Appendix B – Deasy Elementary School

Appendix C – Gribbin Elementary School

Appendix D – Landing Elementary School

Appendix E – R.M. Finley Middle School

Appendix F – Glen Cove High School

June 28, 2021

Viktor Tymchynyuk
Glen Cove City School District
150 Dosoris Lane
Glen Cove, NY 11542

I. Executive Summary

The Glen Cove City School District has developed their 2020 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

Within the Glen Cove City School District, the following locations have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Home Economics and Culinary Arts classroom sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Glen Cove City School District were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks;
- 2) Art Room sinks;
- 3) Classroom sinks;
- 4) Bathroom sinks;
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the District has placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Classroom sinks - classrooms in this category often include classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Bathroom sinks – this category includes mixed valve outlets or staff bathrooms. In intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Procedures:

In accordance with the regulation, Enviroscience Consultants, Inc. performed initial water sampling throughout the Glen Cove City School District on June 8, 9 and 22, 2021. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more that 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.

Fixture Type Codes

BF Bottle Filler
 HB Hose Bib
 IM Ice Machine
 OS Other Source
 PF Pot Filler
 SK Sink
 SL Supply Line
 SP Spigot
 SPY Spray
 SS Slop Sink
 V Valve
 WC Water Cooler
 WF Water Fountain


Source Designations

App Applicable
 N/A Non-applicable

Remediation Type Codes

FR Fixture Replacement
 FRSLV Fixture, supply line or valve replacement
 FRSLVPA Fixture, supply line or valve replacement plumbing assessment
 SIGN Non-potable water sign posted
 CAPPED Supply line capped or fixture removed

Sampling Location Schematics

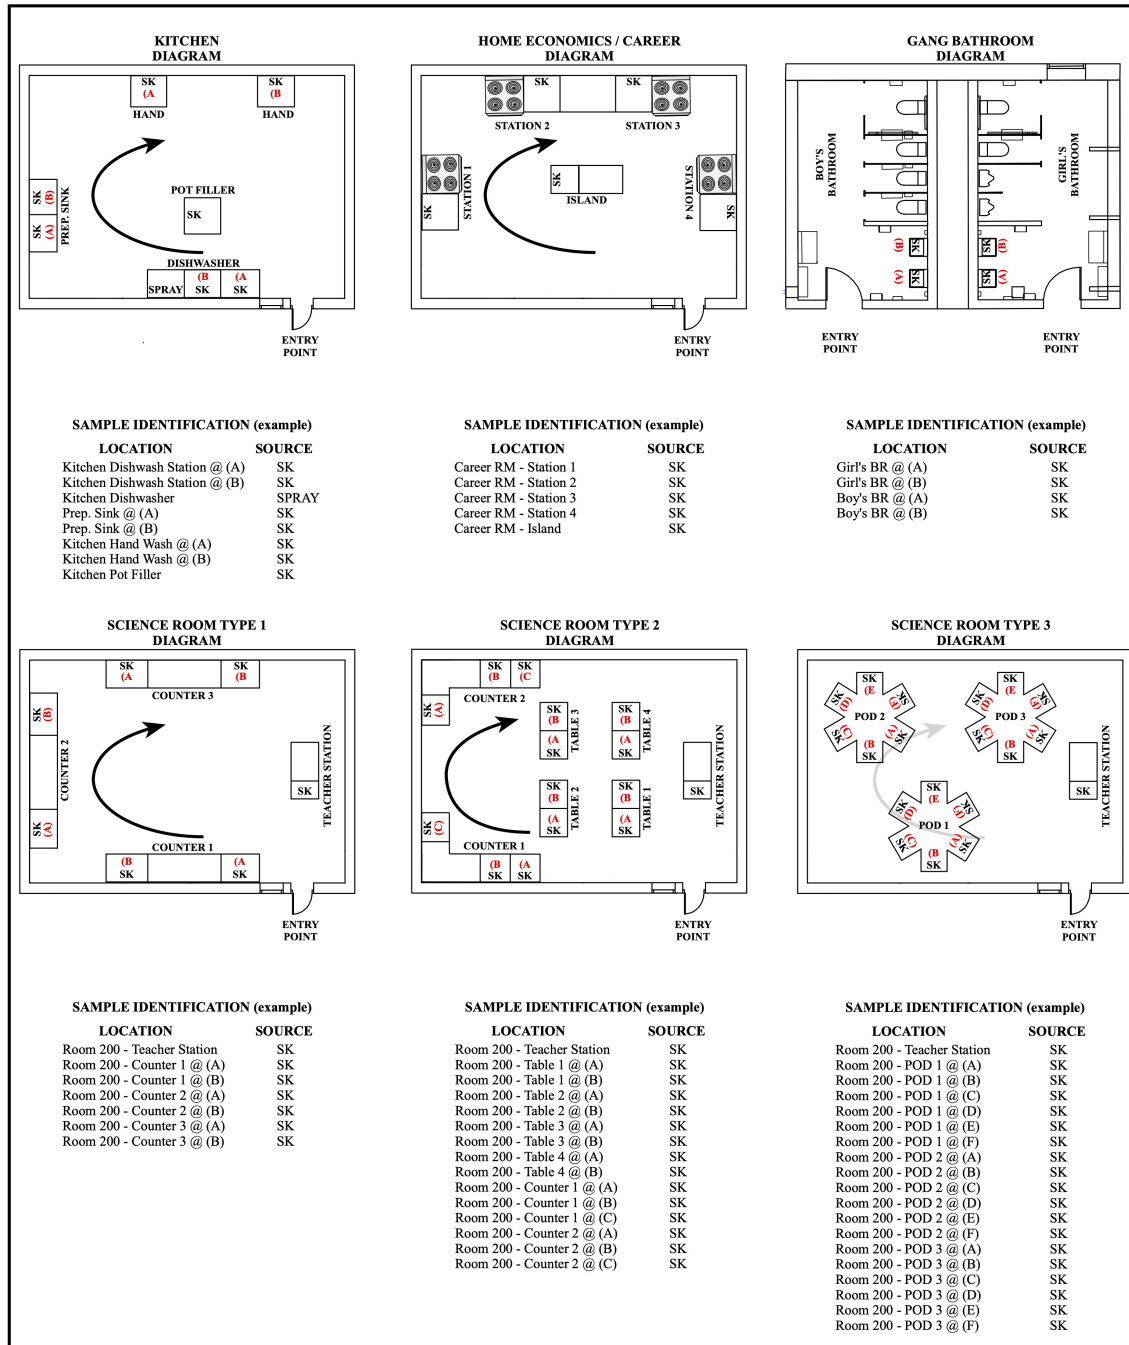

III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through D).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested before returning to service. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

R. M. Finley Middle School

Lower Level Auditorium Dressing Room-East	SK	16.3
Lower Level Auditorium Dressing Room-West	SK	18.8
Kitchen-Dishwash-2 Bay Unit-Left	SK	59.3
Kitchen-Dishwash-2 Bay Unit-Right	SK	45.3
Kitchen-Right Prep by Freezer	SK	18.4
Serving Area-Left Closest to Kitchen	SK	16
Serving Area-Right Closest to Dishwash Area	SK	29.4
Room 502	SK	101
Home & Career @A	SK	26.4
Home & Career @B	SK	18.3
Room 126	SK	58.3
Room 404-Prep Room	SK	20.3
Room 405-Prep Room	SK	72
Hallway by Room 213	WF	96.7

Glen Cove High School

Kitchen 2-Bay	SK	33.1
Kitchen Island	SK	67
Room 222 Prep Room	SK	39.7
Kitchen Coffee Maker Supply Line	SL	260
Thayer House - Kitchen	SK	68.7

Appendix A

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-01	Kitchen Custodial Closet	SS	N/A		6/9/2021	-	-	-	Locked Door	-	-	-
0001-02	Kitchen Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0001-03	Kitchen Potfiller	PF	App	13.7	6/9/2021	-	-	-	None	-	-	-
0001-04	Kitchen 2-Bay Left	SK	App	5.22	6/9/2021	-	-	-	None	-	-	-
0001-05	Kitchen 2-Bay Right	SK	App	4.38	6/9/2021	-	-	-	None	-	-	-
0001-06	Kitchen Handwash	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0002-01	Cafeteria	BF	App	<1.0	6/9/2021	-	-	-	None	-	-	-
0002-02	Cafeteria	WF	App		6/9/2021	-	-	-	None	Removed From Service	-	-
0003-01	Custodial Closet BY Room 117	SS	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0004-01	Room 117B Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0005-01	Room 124	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0005-02	Room 124	WF	N/A		6/9/2021	-	-	-	None	Removed From Service	-	-
0005-03	Room 124 Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0006-01	Room 118	SK	N/A		6/9/2021	-	-	-	Locked Door	-	-	-
0006-02	Room 118 Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0007-01	Room 120 Left	SK	N/A		6/9/2021				Mixed Valve Sign Required			
0007-02	Room 120 Middle	SK	N/A		6/9/2021				Mixed Valve Sign Required			
0007-03	Room 120 Right	SK	N/A		6/9/2021				Mixed Valve Sign Required			
1001-01	Room 116	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1002-01	Room 114	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1003-01	Room 112	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1004-01	Room 110	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1005-01	Library	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1006-01	Room 108 Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1007-01	Room 106	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1008-01	Room 104	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1009-01	Room 102A	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1009-02	Room 102B Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1010-01	Room 100 Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1011-01	Room 99 Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1012-01	Room 101A	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1012-02	Room 101B Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1013-01	Room 103	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1014-01	Room 105	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1015-01	Room 107	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1016-01	Custodial Closet by Main Entrance	SS	N/A		6/9/2021	-	-	-	Locked Door	-	-	-
1017-01	Faculty Room	SK	App	7.39	6/9/2021	-	-	-	Mixed Valve	-	-	-
1018-01	Women's Bathroom by Faculty Room	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1019-01	Hall by Gym	BF	App	<1.0	6/9/2021	-	-	-	None	-	-	-
1019-02	Hall by Gym	WF	App		6/9/2021	-	-	-	None	Removed From Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1020-01	Men's Bathroom by Gym	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1021-01	Room 111	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1022-01	Girl's Bathroom by Room 112 Left	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1022-02	Girl's Bathroom by Room 112 Middle	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1022-03	Girl's Bathroom by Room 112 Right	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-01	Boy's Bathroom by Room 112 Custodial Closet	SS	N/A		6/9/2021	-	-	-	Locked Door	-	-	-
1023-02	Boy's Bathroom by Room 112 Left	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-03	Boy's Bathroom by Room 112 Middle	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-04	Boy's Bathroom by Room 112 Right	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1024-01	Room 113	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1025-01	Room 115	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2001-01	Nurse's Office	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2001-02	Nurse's Office	BF	App	1.39	6/9/2021	-	-	-	None	-	-	-
2001-03	Nurse's Office Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2001-04	Nurse's Office Custodial Closet	SS	N/A		6/9/2021	-	-	-	Locked Door	-	-	-

Laboratory Report

NYE Report #: 2212663-18155

June 10, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Margaret A Connolly Elementary School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 09, 2021. New York Environmental analyzed the samples on June 10, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	09 Jun 2021
Date Received:	09 Jun 2021
Date Analyzed:	10 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210609L004	1	Kitchen Potfiller-PF; Initial	1.00	13.7	µg/L	
210609L005	2	Kitchen 2-Bay Left-SK; Initial	1.00	5.22	µg/L	
210609L006	3	Kitchen 2-Bay Right-SK; Initial	1.00	4.38	µg/L	
210609L007	4	Cafeteria-BF; Initial	1.00	<1.00	µg/L	
210609L008	5	Hall by Gym-BF; Initial	1.00	<1.00	µg/L	
210609L009	6	Faculty Room-SK; Initial	1.00	7.39	µg/L	
210609L010	7	Nurse's Office-BF; Initial	1.00	1.39	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix B

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Principal Office Bathroom	SK	N/A		6/8/2021	-	-	-	None	SIGN	-	-
1002-1	1st Floor Hallway by Stairwell 'A'	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
1002-2	1st Floor Hallway by Stairwell 'A'	BF	App	<1.0	6/8/2021	-	-	-	None	-	-	-
1003-1	1st Floor Boys Bathroom by Stairwell 'A' @ A	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1003-2	1st Floor Boys Bathroom by Stairwell 'A' @ B	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1003-3	1st Floor Boys Bathroom by Stairwell 'A' @ C	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1004-1	1st Floor Janitor Closet in Boys Bathroom by Stairwell 'A'	SS	N/A		6/8/2021	-	-	-	None	SIGN	-	-
1005-1	1st Floor Hallway by Stairwell 'B'	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
1006-1	1st Floor Girls Bathroom by Stairwell 'B' @ A	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1006-2	1st Floor Girls Bathroom by Stairwell 'B' @ B	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1006-3	1st Floor Girls Bathroom by Stairwell 'B' @ C	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1007-1	Unisex Bathroom by Room 104	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1008-1	Unisex Bathroom by Room 105	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2001-1	2nd Floor Girls Bathroom by Stairwell 'B' @ A	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2001-2	2nd Floor Girls Bathroom by Stairwell 'B' @ B	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2001-3	2nd Floor Girls Bathroom by Stairwell 'B' @ C	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2002-1	2nd Floor Hallway by Stairwell 'B'	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
2002-2	2nd Floor Hallway by Stairwell 'B'	BF	App	<1.0	6/8/2021	-	-	-	None	-	-	-
2003-1	2nd Floor Hallway by Stairwell 'A'	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
2004-1	Nurses Office Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2005-1	2nd Floor Boys Bathroom by Stairwell 'A' @ A	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2005-2	2nd Floor Boys Bathroom by Stairwell 'A' @ B	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2005-3	2nd Floor Boys Bathroom by Stairwell 'A' @ C	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2006-1	2nd Floor Janitor Closet in Boys Bathroom by Stairwell 'A'	SS	N/A		6/8/2021	-	-	-	None	Locked Door	-	-
0001-1	Faculty Lounge	SK	App	5.83	6/8/2021	-	-	-	None	-	-	-
0002-1	Faculty Lounge Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0003-1	Basement Hallway by Stairwell 'A'	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
0004-1	Basement Men Bathroom by Stairwell 'A' @ A	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0004-2	Basement Men Bathroom by Stairwell 'A' @ B	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0005-1	Basement Women Bathroom by Stairwell 'A' @ A	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0005-2	Basement Women Bathroom by Stairwell 'A' @ B	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0006-1	Basement Hallway by Stairwell 'B'	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
0006-2	Basement Hallway by Stairwell 'B'	BF	App	<1.0	6/8/2021	-	-	-	None	-	-	-
0007-1	Basement Mechanical Equipment Room	SS	N/A		6/8/2021	-	-	-	None	SIGN	-	-
0008-1	Art Room	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
0008-2	Art Room Counter @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
0008-3	Art Room Counter @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
0008-4	Art Room Counter @ C	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
0009-1	Pre K Room 2	WF	App	5.65	6/8/2021	-	-	-	None	-	-	-
0009-2	Pre K Room 2	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0010-1	Pre K Girls Bathroom @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
0010-2	Pre K Girls Bathroom @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
0010-3	Pre K Girls Bathroom @ C	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0011-1	Pre K Hallway by Custodial Closet	WF	App		6/8/2021	-	-	-	None	Locked Door	-	-
0012-1	Pre K Custodial Closet	SS	N/A		6/8/2021	-	-	-	None	Locked Door	-	-
0013-1	Pre K Boys Bathroom @ A	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0013-2	Pre K Boys Bathroom @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
0013-3	Pre K Boys Bathroom @ C	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
0014-1	Pre K Room 1	WF	App	3.01	6/8/2021	-	-	-	None	-	-	-
0014-2	Pre K Room 1	SK	N/A		6/8/2021	-	-	-	None	SIGN	-	-
0015-1	Pre K Library	SK	N/A		6/8/2021	-	-	-	None	SIGN	-	-
0015-2	Pre K Library	SPY	N/A		6/8/2021	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2212647-18143

June 9, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Deasy Elementary School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 08, 2021. New York Environmental analyzed the samples on June 09, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	08 Jun 2021
Date Received:	08 Jun 2021
Date Analyzed:	09 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210608N001	1	1st Floor Hallway by Stairwell 'A'-BF; Initial	1.00	<1.00	µg/L	
210608N002	2	2nd Floor Hallway by Stairwell 'B'-BF; Initial	1.00	<1.00	µg/L	
210608N003	3	Faculty Lounge-SK; Initial	1.00	5.83	µg/L	
210608N004	4	Basement Hallway by Stairwell 'B'-BF; Initial	1.00	<1.00	µg/L	
210608N005	5	Pre K Room 2-WF; Initial	1.00	5.65	µg/L	
210608N006	6	Pre K Room 1-WF; Initial	1.00	3.01	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen	SK	App	3.61	6/9/2021	-	-	-	None	-	-	-
1001-2	Kitchen Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1001-3	Kitchen Dishwash 3-Bay Left	SK	App	11.6	6/9/2021	-	-	-	None	-	-	-
1001-4	Kitchen Dishwash 3-Bay Right	SK	App	5.08	6/9/2021	-	-	-	None	-	-	-
1002-1	Boiler Room	SS	N/A		6/9/2021	-	-	-	None	Locked door	-	-
1003-1	Custodial Office Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1004-1	Nurse's Office	SK	App	7.45	6/9/2021	-	-	-	None	-	-	-
1004-2	Nurse's Office Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1005-1	Custodial Closet by Nurse's Office	SS	N/A		6/9/2021	-	-	-	None	Locked door	-	-
1006-1	Speech Room 005	SK	N/A		6/9/2021	-	-	-	Sign Required	-	-	-
1006-2	Speech Room 005	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1007-1	Womens Bathroom by Gymnasium	SK	N/A		6/9/2021	-	-	-	Sign Required	-	-	-
1008-1	Hallway by Faculty Lounge	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1008-2	Hallway by Faculty Lounge	BF	App	<1.0	6/9/2021	-	-	-	None	-	-	-
1009-1	Mens Bathroom by Faculty Lounge	SK	N/A		6/9/2021	-	-	-	Sign Required	-	-	-
1010-1	Faculty Lounge	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1011-1	Art Room by Faculty	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1011-2	Art Room by Faculty	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1012-1	Room 20	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1012-2	Room 20	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1013-1	Room 19	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1013-2	Room 19	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1014-1	Room 18	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1014-2	Room 18	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1015-1	Room 17	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1015-2	Room 17	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1016-1	Room 16	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1016-2	Room 16	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1017-1	Hallway by Room 10	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1017-2	Hallway by Room 10	BF	App	<1.0	6/9/2021	-	-	-	None	-	-	-
1018-1	Room 15	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1018-2	Room 15	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1019-1	Room 14	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1019-2	Room 14	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1020-1	Room 13	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1020-2	Room 13	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1021-1	Room 12	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1021-2	Room 12	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1022-1	Room 11	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1022-2	Room 11	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1023-1	Room 10	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-2	Room 10	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
2001-1	Room 110	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2001-2	Room 110	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
2002-1	Room 111	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2002-2	Room 111	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
2003-1	Custodial Closet Across From Room 116	SS	N/A		6/9/2021	-	-	-	None	Locked door	-	-
2004-1	Room 112	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2004-2	Room 112	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
2005-1	Room 113	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2005-2	Room 113	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
2006-1	Room 114	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2006-2	Room 114	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
2007-1	Room 115	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2007-2	Room 115	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
2008-1	Room 116	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2008-2	Room 116	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
2009-1	Hallway by Room 111	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
2009-2	Hallway by Room 111	BF	App	<1.0	6/9/2021	-	-	-	None	-	-	-
2010-1	Room 117	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2010-2	Room 117	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
3001-1	Portable Nurse's Office	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
3001-2	Portable Nurse's Office	BF	App	2.25	6/9/2021	-	-	-	None	-	-	-
3001-3	Portable Nurse's Office Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
3001-4	Portable Nurse's Office Storage Closet	SS	N/A		6/9/2021	-	-	-	None	Locked door	-	-

Laboratory Report

NYE Report #: 2212664-18156

June 10, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Eugene J Gribbon Elementary School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 09, 2021. New York Environmental analyzed the samples on June 10, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	09 Jun 2021
Date Received:	09 Jun 2021
Date Analyzed:	10 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210609L011	1	Kitchen-SK; Initial	1.00	3.61	µg/L	
210609L012	2	Kichen Dishwash 3-Bay Left-SK; Initial	1.00	11.6	µg/L	
210609L013	3	Kichen Dishwash 3-Bay Right-SK; Initial	1.00	5.08	µg/L	
210609L014	4	Nurse's Office-SK; Initial	1.00	7.45	µg/L	
210609L015	5	Hallway by Faculty Lounge-BF; Initial	1.00	<1.00	µg/L	
210609L016	6	Hallway by Room 10-BF; Initial	1.00	<1.00	µg/L	
210609L017	7	Hallway by Room 111-BF; Initial	1.00	<1.00	µg/L	
210609L018	8	Portable Nurse's Office-BF; Initial	1.00	2.25	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix D

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Room 005 Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0002-1	Room 002 Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
0003-1	Boiler Room	SS	N/A		6/9/2021	-	-	-	None	Locked door	-	-
0004-1	Art Room 001-2 Bay Unit Left	SK	N/A		6/9/2021	-	-	-	Sign Required	-	-	-
0004-2	Art Room 001-2 Bay Unit Right	SK	N/A		6/9/2021	-	-	-	Sign Required	-	-	-
1001-1	Kitchen-Handwash	SK	N/A		6/9/2021	-	-	-	Sign Required	-	-	-
1002-1	STEM Room 120-2 Bay Unit Left	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1002-2	STEM Room 120-2 Bay Unit Right	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1003-1	Room 114	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1004-1	Faculty Bathroom by Room 119	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1005-1	Room 115 Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1006-1	Room 116	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1007-1	Room 119	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1008-1	Custodial Closet by Custodial Office	SS	N/A		6/9/2021	-	-	-	None	Locked door	-	-
1009-1	Girl's Bathroom by Custodial Office Left	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1009-2	Girl's Bathroom by Custodial Office Right	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1010-1	Hallway by Room 102	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1011-1	Principal's Office Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1012-1	Hallway by Room 104	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
1012-2	Hallway by Room 104	BF	App	<1.0	6/9/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1013-1	Old Nurse's Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1014-1	Boy's Bathroom by Room 106 Left	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1014-2	Boy's Bathroom by Room 106 Right	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1015-1	Custodial Closet by Room 106	SS	N/A		6/9/2021	-	-	-	None	Locked door	-	-
2001-1	Boy's Bathroom by Room 206 Left	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2001-2	Boy's Bathroom by Room 206 Right	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2002-1	Custodial Closet by Room 206	SS	N/A		6/9/2021	-	-	-	None	Locked door	-	-
2003-1	Hallway by Room 205	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
2003-2	Hallway by Room 206	BF	App	<1.0	6/9/2021	-	-	-	None	-	-	-
2004-1	Room 207	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2005-1	Room 204	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2006-1	Faculty Room 203 Kitchenette	SK	App	6.3	6/9/2021	-	-	-	None	-	-	-
2006-2	Faculty Room 203 Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2007-1	Girl's Bathroom by Room 202 Left	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2007-2	Girl's Bathroom by Room 202 Right	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2007-3	Girl's Bathroom Custodial Closet	SS	N/A		6/9/2021	-	-	-	None	Locked door	-	-
2008-1	Hallway by Room 202	WF	App		6/9/2021	-	-	-	None	Removed from service	-	-
3001-1	Portable - Nurse's Office	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-
3001-2	Portable - Nurse's Office	BF	App	<1.0	6/22/2021							
3001-3	Portable - Nurse's Office Bathroom	SK	N/A		6/9/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3001-4	Portable - Nurse's Office Custodial Closet	SK	N/A		6/9/2021	-	-	-	Sign Required	-	-	-

Laboratory Report

NYE Report #: 2212662-18154

June 10, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Landing Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 09, 2021. New York Environmental analyzed the samples on June 10, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	09 Jun 2021
Date Received:	09 Jun 2021
Date Analyzed:	10 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210609L001	2	Hallway by Room 104-BF; Initial	1.00	<1.00	µg/L	
210609L002	5	Hallway by Room 206-BF; Initial	1.00	<1.00	µg/L	
210609L003	6	Faculty Room 203 Kitchenette-SK; Initial	1.00	6.30	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Laboratory Report

NYE Report #: 2212922-18310

June 24, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Landing Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 23, 2021. New York Environmental analyzed the samples on June 24, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	22 Jun 2021
Date Received:	23 Jun 2021
Date Analyzed:	24 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210623M003	1	Portable - Nurse's Office-BF; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix E

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Lower Level Auditorium Dressing Room-East	SK	App	16.3	6/8/2021				None	Temporary sign posted pending replacment with mixed valve faucet and permanent sign		
0001-2	Lower Level Auditorium Dressing Room-East Bathroom	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
0002-1	Lower Level Auditorium Dressing Room-West	SK	App	18.8	6/8/2021				None	Temporary sign posted pending replacment with mixed valve faucet and permanent sign		
0002-2	Lower Level Auditorium Dressing Room-West Bathroom	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1001-1	Kitchen-Dishwash-2 Bay Unit-Left	SK	App	59.3	6/8/2021				None	Permanent Sign Posted		
1001-2	Kitchen-Dishwash-2 Bay Unit-Right	SK	App	45.3	6/8/2021				None	Permanent Sign Posted		
1001-3	Kitchen-Handwash	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1001-4	Kitchen-2 Bay Unit-Left	SK	App	4.15	6/8/2021	-	-	-	None	-	-	-
1001-5	Kitchen-2 Bay Unit-Right	SK	App	11	6/8/2021	-	-	-	None	-	-	-
1001-6	Kitchen-Single Unit	SK	App	4.98	6/8/2021	-	-	-	None	-	-	-
1001-7	Kitchen-Custodial Closet	SS	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1001-8	Kitchen-Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1001-9	Kitchen-Left Prep by Oven	SK	App	9.04	6/8/2021	-	-	-	None	-	-	-
1001-10	Kitchen-Right Prep by Freezer	SK	App	18.4	6/8/2021				Additional Sampling Required	Temporary Sign Posted		
1001-11	Kitchen-Pot Filler-Left	PF	App	2.07	6/8/2021	-	-	-	None	-	-	-
1001-12	Kitchen-Pot Filler-Right	PF	App	4.07	6/8/2021	-	-	-	None	-	-	-
1001-13	Serving Area Dishwash -Left (Closest to Kitchen)	SK	App	16	6/8/2021				None	Permanent Sign Posted		
1001-14	Serving Area Dishwash -Right (Closest to Dishwash Area)	SK	App	29.4	6/8/2021				None	Permanent Sign Posted		
1002-1	Cafeteria by Kitchen	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
1002-2	Cafeteria by Kitchen	BF	App	<1.0	6/8/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1003-1	Cafeteria by Faculty Room	SK	App	1.14	6/8/2021	-	-	-	None	-	-	-
1004-1	Vestibule to Faculty Room	SK	App	13.8	6/8/2021	-	-	-	None	-	-	-
1005-1	Women's Bathroom by Faculty Room	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1006-1	Men's Bathroom by Faculty Room	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1007-1	Custodial Closet in Cafeteria	SS	N/A		6/8/2021	-	-	-	None	Locked Door	-	-
1008-1	Teacher's Association Office Bathroom	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1009-1	Girl's Bathroom in Cafeteria	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1010-1	Boy's Bathroom in Cafeteria	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1011-1	Lower Gym	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
1012-1	Lower Gym-Storage	SS	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1013-1	Women's Bathroom by Room 502-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1013-2	Women's Bathroom by Room 502-Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1013-3	Women's Bathroom by Room 502-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1014-1	Custodial Closet by Room 502	SS	N/A		6/8/2021	-	-	-	None	Locked Door	-	-
1015-1	Men's Bathroom by Room 502-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1015-2	Men's Bathroom by Room 502-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1016-1	Hallway by Room 502	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
1016-2	Hallway by Room 502	BF	App	<1.0	6/8/2021	-	-	-	None	-	-	-
1017-1	Room 502-Science Room	SK	App	101	6/8/2021				None	Permanent Sign Posted		
1018-1	Hallway by Room 504	WF	App	10.9	6/8/2021	-	-	-	None		-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1019-1	Hallway by Room 307	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
1020-1	Boy's Bathroom by Room 307-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1020-2	Boy's Bathroom by Room 307-Left Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1020-3	Boy's Bathroom by Room 307-Right Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1020-4	Boy's Bathroom by Room 307-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1021-1	Custodial Closet by Room 307	SS	N/A		6/8/2021	-	-	-	None	Locked Door	-	-
1022-1	Girl's Bathroom by Room 307-Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1022-2	Girl's Bathroom by Room 307-Left Middle	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1022-3	Girl's Bathroom by Room 307-Right Middle	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1022-4	Girl's Bathroom by Room 307-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-1	Hallway by Room 306-Left	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
1023-2	Hallway by Room 306-Right	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
1024-1	Room 303-Teacher's Station	SK	N/A		6/8/2021	-	-	-	None	Removed from Service	-	-
1025-1	Room 304-Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1025-2	Room 304-Counter @A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1025-3	Room 304-Counter @B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1025-4	Room 304-Counter @C	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1025-5	Room 304-Prep	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1026-1	Room 305-Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1026-2	Room 305-Counter @A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1026-3	Room 305-Counter @B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1026-4	Room 305-Counter @C	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1026-5	Room 305-Prep	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1027-1	Room 306-Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1028-1	Hallway by Room 119	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
1029-1	Girl's Bathroom by Room 117-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1029-2	Girl's Bathroom by Room 117-Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1029-3	Girl's Bathroom by Room 117-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1030-1	Hallway by Room 114	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
1031-1	Room 114-2 Bay Unit 1 -Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1031-2	Room 114-2 Bay Unit 1 -Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1031-3	Room 114-2 Bay Unit 2 -Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1031-4	Room 114-2 Bay Unit 2 -Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1032-1	Ceramics-Counter @A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1032-2	Ceramics-Counter @B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1033-1	Room 114B-Counter	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1033-2	Room 114B-Single Unit-Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1033-3	Room 114B-Single Unit-Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1034-1	Home & Career @ A Handwash	SK	App	26.4	6/8/2021				None	Permanent Sign Posted		
1034-2	Home & Career @ B Dishwash	SK	App	18.3	6/8/2021				None	Permanent Sign Posted		
1034-3	Home & Career @ C	SK	App	3.38	6/8/2021	-	-	-	None	-	-	-
1034-4	Home & Career @D	SK	App	2.87	6/8/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1035-1	Room 113-Tech Room-2 Bay Unit-Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1035-2	Room 113-Tech Room-2 Bay Unit-Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1036-1	Hallway by Main Office	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
1036-2	Hallway by Main Office	BF	App	<1.0	6/8/2021	-	-	-	None	-	-	-
1037-1	Men's Bathroom by Room 110-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1037-2	Men's Bathroom by Room 110-Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1037-3	Men's Bathroom by Room 110-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1038-1	Room 101	SK	App		6/8/2021	-	-	-	None	-	-	-
1039-1	Garage by Room 103	SS	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1040-1	Custodial Closet by Room 101	SS	N/A		6/8/2021	-	-	-	None	Locked Door	-	-
1041-1	Main Office Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1042-1	Principal's Office Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1043-1	Assistant Principal's Office Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1044-1	Room 116-Nurse's Office	SK	App	5.96	6/8/2021	-	-	-	None	-	-	-
1044-2	Room 116-Nurse's Office Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1045-1	Custodial Closet by Room 121	SS	N/A		6/8/2021	-	-	-	None	Locked Door	-	-
1046-1	Women's Bathroom by Main Lobby-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1046-2	Women's Bathroom by Main Lobby-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1047-1	Men's Bathroom by Main Lobby-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1047-2	Men's Bathroom by Main Lobby-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1048-1	Custodial Closet by Main Lobby	SS	N/A		6/8/2021	-	-	-	None	Locked Door	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1049-1	Room 126-Band Room	SK	N/A	58.3	6/8/2021				None	Handwashing Sink Only Permanent Sign Posted		
2001-1	Upper Gym	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
2002-1	Upper Gym-Custodial Closet	IM	App	1.18	6/8/2021	-	-	-	None	-	-	-
2002-2	Upper Gym-Custodial Closet	SS	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2003-1	Girl's Locker Room Office Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2003-2	Girl's Locker Room	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
2003-3	Girl's Locker Room Bathroom-Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2003-4	Girl's Locker Room Bathroom-Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2003-5	Girl's Locker Room Bathroom-Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2004-1	Boy's Locker Room Office Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2004-2	Boy's Locker Room	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
2004-3	Boy's Locker Room Bathroom-Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2004-4	Boy's Locker Room Bathroom-Middle	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2004-5	Boy's Locker Room Bathroom-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2005-1	Girl's Bathroom by Room 604-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2005-2	Girl's Bathroom by Room 604-Middle	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2005-3	Girl's Bathroom by Room 604-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2006-1	Custodial Closet by Room 604	SS	N/A		6/8/2021	-	-	-	None	Locked Door	-	-
2007-1	Boy's Bathroom by Room 604-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2007-2	Boy's Bathroom by Room 604-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2008-1	Hallway by Room 604	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2008-2	Hallway by Room 604	BF	App	<1.0	6/8/2021	-	-	-	None	-	-	-
2009-1	Hallway by Room 605	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
2010-1	Room 608	SK	App	7.88	6/8/2021	-	-	-	None	-	-	-
2011-1	Hallway by Room 407	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
2011-2	Hallway by Room 407	BF	App	<1.0	6/8/2021	-	-	-	None	-	-	-
2012-1	Boy's Bathroom by Room 407-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2012-2	Boy's Bathroom by Room 407-Left Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2012-3	Boy's Bathroom by Room 407-Right Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2012-4	Boy's Bathroom by Room 407-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2013-1	Custodial Closet by Room 407	SS	N/A		6/8/2021	-	-	-	None	Locked Door	-	-
2014-1	Girl's Bathroom by Room 407-Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2014-2	Girl's Bathroom by Room 407-Left Middle	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2014-3	Girl's Bathroom by Room 407-Right Middle	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2014-4	Girl's Bathroom by Room 407-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2015-1	Hallway by Room 406-Left	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
2015-2	Hallway by Room 406-Right	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
2016-1	Room 404-Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-2	Room 404-Counter @A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-3	Room 404-Counter @B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-4	Room 404-Counter @C	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-5	Room 404-Prep Room	SK	App	20.3	6/8/2021				None	Permanent Sign Posted		

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2017-1	Room 405-Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2017-2	Room 405-Counter @A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2017-3	Room 405-Counter @B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2017-4	Room 405-Counter @C	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2017-5	Room 405-Prep Room	SK	App	72	6/8/2021				None	Permanent Sign Posted		
2018-1	Hallway by Room 213	WF	App	96.7	6/8/2021				None	Removed from Service pending fixture replacement with Elkay water fountain/bottle filler		
2019-1	Room 211B	SK	N/A		6/8/2021	-	-	-	None	SIGN	-	-
2020-1	Boy's Bathroom by Room 211A-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2020-2	Boy's Bathroom by Room 211A-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2021-1	Girl's Bathroom by Room 209-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2021-2	Girl's Bathroom by Room 209-Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2021-3	Girl's Bathroom by Room 209-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2022-1	Custodial Closet by Room 209	SS	N/A		6/8/2021	-	-	-	None	Locked Door	-	-
2023-1	Hallway by Room 201	WF	App		6/8/2021	-	-	-	None	Removed from service	-	-
2024-1	Room 202-Counter @A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2024-2	Room 202-Counter @B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2024-3	Room 202-Counter @C	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2025-1	Faculty Lounge	SK	App	9.54	6/8/2021	-	-	-	None	-	-	-
2025-2	Faculty Lounge Bathroom	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2026-1	Room 220 Bathroom	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2027-1	Custodial Closet by Room 221	SS	N/A		6/8/2021	-	-	-	None	Locked Door	-	-
2028-1	Unisex Bathroom by Room 221-Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2028-2	Unisex Bathroom by Room 221-Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2028-3	Unisex Bathroom by Room 221-Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2029-1	Room 218	SK	App	14	6/8/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212649-18145

June 10, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Robert M Finley Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 08, 2021. New York Environmental analyzed the samples on June 09, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	08 Jun 2021
Date Received:	08 Jun 2021
Date Analyzed:	09 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210608N026	1	Kitchen-Dishwash-2 Bay Unit-Left-SK; Initial	1.00	59.3	µg/L	E,H
210608N027	2	Kitchen-Dishwash-2 Bay Unit-Right-SK; Initial	1.00	45.3	µg/L	H
210608N028	3	Kitchen-2 Bay Unit-Left-SK; Initial	1.00	4.15	µg/L	
210608N029	4	Kitchen-2 Bay Unit-Right-SK; Initial	1.00	11.0	µg/L	
210608N030	5	Kitchen-Single Unit-SK; Initial	1.00	4.98	µg/L	
210608N031	6	Kitchen-Left Prep by Oven-SK; Initial	1.00	9.04	µg/L	
210608N032	7	Kitchen-Right Prep by Freezer-SK; Initial	1.00	18.4	µg/L	H
210608N033	8	Kitchen-Pot Filler-Left-PF; Initial	1.00	2.07	µg/L	
210608N034	9	Kitchen-Pot Filler-Left-PF; Initial	1.00	4.07	µg/L	
210608N035	10	Serving Area-Left Closest to Kitchen-SK; Initial	1.00	16.0	µg/L	H
210608N036	11	Serving Area-Right Closest to Dishwash Area-SK; Initial	1.00	29.4	µg/L	H
210608N037	12	Cafeteria by Kitchen-BF; Initial	1.00	<1.00	µg/L	
210608N038	13	Cafeteria by Faculty Room-SK; Initial	1.00	1.14	µg/L	
210608N039	14	Vestibule to Faculty Room-SK; Initial	1.00	13.8	µg/L	
210608N040	15	Upper Gym-Custodial Closet-IM; Initial	1.00	1.18	µg/L	
210608N041	16	Hallway by Room 502-BF; Initial	1.00	<1.00	µg/L	
210608N042	17	Room 502-SK; Initial	1.00	101	µg/L	E,H
210608N043	18	Hallway by Room 504-WF; Initial	1.00	10.9	µg/L	
210608N044	19	Hallway by Room 604-BF; Initial	1.00	<1.00	µg/L	
210608N045	20	Room 608-SK; Initial	1.00	7.88	µg/L	
210608N046	21	Hallway by Room 407-BF; Initial	1.00	<1.00	µg/L	
210608N047	22	Room 404-Prep Room-SK; Initial	1.00	20.3	µg/L	H
210608N048	23	Room 405-Prep Room-SK; Initial	1.00	72.0	µg/L	E,H
210608N049	24	Hallway by Room 213-WF; Initial	1.00	96.7	µg/L	E,H
210608N050	25	Faculty Lounge-SK; Initial	1.00	9.54	µg/L	
210608N051	26	Room 218-SK; Initial	1.00	14.0	µg/L	



Date Collected:	08 Jun 2021
Date Received:	08 Jun 2021
Date Analyzed:	09 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210608N052	27	Home & Career @A-SK; Initial	1.00	26.4	µg/L	H
210608N053	28	Home & Career @B-SK; Initial	1.00	18.3	µg/L	H
210608N054	29	Home & Career @C-SK; Initial	1.00	3.38	µg/L	
210608N055	30	Home & Career @D-SK; Initial	1.00	2.87	µg/L	
210608N056	31	Hallway by Main Office-BF; Initial	1.00	<1.00	µg/L	
210608N057	32	Room 116-Nurse's Office-SK; Initial	1.00	5.96	µg/L	
210608N058	33	Room 126-SK; Initial	1.00	58.3	µg/L	E,H
210608N059	34	Lower Level Auditorium Dressing Room-East-SK; Initial	1.00	16.3	µg/L	H
210608N060	35	Lower Level Auditorium Dressing Room-West-SK; Initial	1.00	18.8	µg/L	H

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix F

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-01	Kitchen Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1001-02	Kitchen 2-Bay-Food Prep	SK	App	33.1	6/8/2021				Additional Sampling Required	Temporary Sign Posted		
1001-03	Kitchen	IM	App	1.49	6/8/2021	-	-	-	None	-	-	-
1001-04	Kitchen by Dishwash	SK	N/A		6/8/2021	-	-	-	None	SIGN	-	-
1001-05	Kitchen Dishwash	SPY	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1001-06	Kitchen Dishwash Machine	OS	N/A		6/8/2021				None			
1001-07	Kitchen Handwash	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1001-08	Kitchen 2-Bay Dishwash Left	SK	App	8.08	6/8/2021	-	-	-	None	-	-	-
1001-09	Kitchen 2-Bay Dishwash Right	SK	App	6.58	6/8/2021	-	-	-	None	-	-	-
1001-10	Kitchen Island-Food Prep	SK	App	67	6/8/2021				Additional Sampling Required	Temporary Sign Posted		
1001-11	Kitchen Potfiller Right	PF/SPY	App	3.3	6/8/2021	-	-	-	None	-	-	-
1001-12	Kitchen Potfiller Left	PF	App	9.41	6/22/2021	-	-	-	None	-	-	-
1001-13	Kitchen Steamer	SPY	App	11.6	6/8/2021	-	-	-	None	-	-	-
1001-14	Kitchen Coffee Maker Supply Line	OS	App	260	6/22/2021				Additional Sampling Required	Temporary Sign Posted		
1002-01	Boy's Bathroom 156 by Cafeteria 2	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1003-01	Custodial Locker Room	IM	App	<1.0	6/8/2021	-	-	-	None	-	-	-
1003-02	Custodial Locker Room	SS	N/A		6/8/2021	-	-	-	Locked Door	-	-	-
1004-01	Girl's Bathroom 159 by Cafeteria 2 Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1004-02	Girl's Bathroom 159 by Cafeteria 2 Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1005-01	Hall by Gym	BF	App	<1.0	6/8/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1005-02	Hall by Gym	WF	App		6/8/2021	-	-	-	None	Removed From Service	-	-
1006-01	Boy's Locker Room 160 Left	WF	App		6/8/2021	-	-	-	None	Removed From Service	-	-
1006-02	Boy's Locker Room 160 Right	WF	App		6/8/2021	-	-	-	None	Removed From Service	-	-
1006-03	Boy's Locker Room Bathroom 160 Left	SK	App	1.79	6/8/2021	-	-	-	None	-	-	-
1006-04	Boy's Locker Room Bathroom 160 Middle	SK	App	1.39	6/8/2021	-	-	-	None	-	-	-
1006-05	Boy's Locker Room Bathroom 160 Right	SK	App	1.66	6/8/2021	-	-	-	None	-	-	-
1006-06	Boy's Locker Room Coach's Office Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1006-07	Boy's Locker Room Custodial Closet	SS	N/A		6/8/2021	-	-	-	Locked Door	-	-	-
1007-01	Hall by Boy's Locker Room	WF	App		6/8/2021	-	-	-	None	Removed From Service	-	-
1008-01	Girl's Locker Room 170 Left	WF	App		6/8/2021	-	-	-	None	Removed From Service	-	-
1008-02	Girl's Locker Room 170 Right	WF	App		6/8/2021	-	-	-	None	Removed From Service	-	-
1008-03	Girl's Locker Room Bathroom 170 Left	SK	App	4.51	6/8/2021	-	-	-	None	-	-	-
1008-04	Girl's Locker Room Bathroom 170 Right	SK	App	2.48	6/8/2021	-	-	-	None	-	-	-
1009-01	Girl's Coach's Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1010-01	Hall by Cafeteria 2	BF	App	<1.0	6/8/2021	-	-	-	None	-	-	-
1010-02	Hall by Cafeteria 2	SK	App		6/8/2021	-	-	-	None	-	-	-
1011-01	Art Room 132 Unit 1 Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1011-02	Art Room 132 Unit 1 Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1011-03	Art Room 132 Unit 1 Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1011-04	Art Room 132 Unit 2 Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1011-05	Art Room 132 Unit 2 Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1011-06	Art Room 132 Unit 2 Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1012-01	Art Room 134 Unit 1 Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1012-02	Art Room 134 Unit 1 Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1012-03	Art Room 134 Unit 1 Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1012-04	Art Room 134 Unit 2 Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1012-05	Art Room 134 Unit 2 Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1012-06	Art Room 134 Unit 2 Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1013-01	Art Room 143 Counter Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1013-02	Art Room 143 Counter Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1014-01	Faculty Bathroom 134B Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1014-02	Faculty Bathroom 134B Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1015-01	Women's Faculty Bathroom 134A Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1015-02	Women's Faculty Bathroom 134A Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1016-01	Room 138 Unit Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1016-02	Room 138 Unit Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1017-01	Custodial Closet 152	SS	N/A		6/8/2021	-	-	-	Locked Door	-	-	-
1018-01	Bathroom 152B	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1019-01	Hall by Main Office	WF	App		6/8/2021	-	-	-	None	-	-	-
1020-01	Main Office Bathroom	SK	N/A		6/8/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1020-02	Main Office Women's Bathroom	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1021-01	Hall by Room 100A	WF	App		6/8/2021	-	-	-	None	-	-	-
1022-01	Men's Faculty Bathroom by Room 100A	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1023-01	Girl's Bathroom by Room 100A Unit	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1024-01	Women's Faculty Bathroom by Room 100B	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1025-01	Boy's Bathroom by Room 100B Unit	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1026-01	Nurse's Office 100A	SK	App	13.6	6/8/2021	-	-	-	None	-	-	-
1026-02	Nurse's Office 100A Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1027-01	Custodial Closet 119B	SS	N/A		6/8/2021	-	-	-	Locked Door	-	-	-
1028-01	Hall by Room 123	WF	App		6/8/2021	-	-	-	None	-	-	-
1029-01	Room 130 Left	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1029-02	Room 130 Right	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
1030-01	Men's Faculty Bathroom 130A by Room 131 Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1030-02	Men's Faculty Bathroom 130A by Room 131 Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1031-01	Custodial Closet 130B	SS	N/A		6/8/2021	-	-	-	Locked Door	-	-	-
1032-01	Girl's Bathroom 130C Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1032-02	Girl's Bathroom 130C Left Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1032-03	Girl's Bathroom 130C Right Middle	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1032-04	Girl's Bathroom 130C Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2001-01	Hall by Room 204B	BF	App		6/8/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2001-02	Hall by Room 204B	WF	App		6/8/2021	-	-	-	None	Removed From Service	-	-
2002-01	Custodial Closet 204A	SS	N/A		6/8/2021	-	-	-	Locked Door	-	-	-
2003-01	Men's Faculty Bathroom by Faculty Room 213A Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	SIGN	-	-
2003-02	Men's Faculty Bathroom by Faculty Room 213A Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	SIGN	-	-
2004-01	Women's Faculty Bathroom by Faculty Room 213A Left	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2004-02	Women's Faculty Bathroom by Faculty Room 213A Right	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2005-01	Faculty Room 213A	SK	App		6/8/2021	-	-	-	None	Removed From Service	-	-
2006-01	Custodial Closet 219B	SS	N/A		6/8/2021	-	-	-	Locked Door	-	-	-
2007-01	Room 220 Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2007-02	Room 220 Counter 1 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2007-03	Room 220 Counter 1 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2007-04	Room 220 Counter 1 @ C	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2007-05	Room 220 Counter 1 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2007-06	Room 220 Counter 1 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2007-07	Room 220 Counter 1 @ C	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2007-08	Room 220 Counter 3	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2008-01	Room 221 Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2008-02	Room 221 Counter 1 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2008-03	Room 221 Counter 1 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2008-04	Room 221 Counter 1 @ C	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2009-01	Room 222 Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2009-02	Room 222 Counter	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2009-03	Room 222 Pod 1 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2009-04	Room 222 Pod 1 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2009-05	Room 222 Pod 2 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2009-06	Room 222 Pod 2 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2009-07	Room 222 Pod 3 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2009-08	Room 222 Pod 3 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2009-09	Room 222 Prep Room	SK	App	39.7	6/8/2021				None	Permanent Sign Posted		
2010-01	Room 223 Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2010-02	Room 223 Counter 1 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2010-03	Room 223 Counter 1 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2010-04	Room 223 Counter 1 @ C	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2011-01	Room 224	SS	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2012-01	Hall by Room 224	WF	App		6/8/2021	-	-	-	None	-	-	-
2013-01	Room 225 Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2013-02	Room 225 Counter	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2013-03	Room 225 Pod 1 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2013-04	Room 225 Pod 1 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2013-05	Room 225 Pod 2 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2013-06	Room 225 Pod 2 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2013-07	Room 225 Pod 3 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2013-08	Room 225 Pod 3 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2014-01	Room 226 Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2014-02	Room 226 Counter 1	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2014-03	Room 226 Counter 2	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2014-04	Room 226 Counter 3 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2014-05	Room 226 Counter 3 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-01	Room 227 Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-02	Room 227 Pod 1 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-03	Room 227 Pod 1 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-04	Room 227 Pod 2 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-05	Room 227 Pod 2 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-06	Room 227 Pod 3 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-07	Room 227 Pod 3 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-08	Room 227 Pod 4 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-09	Room 227 Pod 4 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-10	Room 227 Pod 5 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-11	Room 227 Pod 5 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-12	Room 227 Pod 6 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2015-13	Room 227 Pod 6 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2015-14	Prep Room 227 / 229	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-01	Room 229 Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-02	Room 229 Counter	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-03	Room 229 Pod 1 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-04	Room 229 Pod 1 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-05	Room 229 Pod 2 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-06	Room 229 Pod 2 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-07	Room 229 Pod 3 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-08	Room 229 Pod 3 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-09	Room 229 Pod 4 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2016-10	Room 229 Pod 4 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2017-01	Room 228A Fumehood	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2017-02	Room 228A Counter 1	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2017-03	Room 228A Counter 2	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2018-01	Room 226 Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2018-02	Room 226 Counter 1 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2018-03	Room 226 Counter 1 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2018-04	Room 226 Counter 2	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2018-05	Room 226 Counter 3 @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-06	Room 226 Counter 3 @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2019-01	Room 230	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2020-01	Room 231 Teacher's Station	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2020-02	Room 231 Counter @ A	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2020-03	Room 231 Counter @ B	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2020-04	Room 231 Prep Room	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2021-01	Room 232	SS	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
2022-01	Custodial Closet 232B	SS	N/A		6/8/2021	-	-	-	Locked Door	-	-	-
2023-01	Hall by Room 234	WF	App		6/8/2021	-	-	-	None	Removed From Service	-	-
2024-01	Library Office	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
	Thayer House - Men's Bathroom	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
	Thayer House - Women's Bathroom	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
	Thayer House - Kitchen	SK	App	68.7	6/8/2021				Additional Sampling Required	Temporary Sign Posted		
	Thayer House - Superintendent's Bathroom	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
	Thayer House - Assistant Superintendent's Bathroom	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
	Thayer House - Attic Bathroom	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
	Carriage House - 1st Floor Bathroom	SK	N/A		6/8/2021	-	-	-	Mixed Valve Sign Required	-	-	-
	Carriage House - 2nd Floor Bathroom	SK	N/A		6/8/2021	-	-	-	Sign Required	-	-	-
	Tennis Courts Office Bathroom	SK	N/A		6/22/2021	-	-	-	Will be Mixed Valve Sign Required	-	-	-
	Tennis Courts Women's Bathroom	SK	N/A		6/22/2021	-	-	-	Will be Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
	Tennis Courts Men's Bathroom	SK	N/A		6/22/2021	-	-	-	Will be Mixed Valve Sign Required	-	-	-
	Tennis Court	WF	App		6/22/2021	-	-	-	None	Removed From Service	-	-
	Booster Club Kitchen	SK	App	6.27	6/22/2021	-	-	-	None	-	-	-
	Booster Club Boy's Bathroom	SK	N/A		6/22/2021	-	-	-	Will be Mixed Valve Sign Required	-	-	-
	Booster Club Girl's Bathroom (left)	SK	N/A		6/22/2021	-	-	-	Will be Mixed Valve Sign Required	-	-	-
	Booster Club Girl's Bathroom (right)	SK	N/A		6/22/2021	-	-	-	Will be Mixed Valve Sign Required	-	-	-

Laboratory Report

NYE Report #: 2212648-18144

June 9, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Glen Cove High School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 08, 2021. New York Environmental analyzed the samples on June 09, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	08 Jun 2021
Date Received:	08 Jun 2021
Date Analyzed:	09 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210608N007	1	Kitchen 2-Bay-SK; Initial	1.00	33.1	µg/L	H
210608N008	2	Kitchen-IM; Initial	1.00	1.49	µg/L	
210608N009	3	Kitchen 2-Bay Left-SK; Initial	1.00	8.08	µg/L	
210608N010	4	Kitchen 2-Bay Right-SK; Initial	1.00	6.58	µg/L	
210608N011	5	Kitchen Island-SK; Initial	1.00	67.0	µg/L	E,H
210608N012	6	Kitchen Potfiller-SPY; Initial	1.00	3.30	µg/L	
210608N013	7	Kitchen Steamer-SPY; Initial	1.00	11.6	µg/L	
210608N014	8	Custodial Locker Room-IM; Initial	1.00	<1.00	µg/L	
210608N015	9	Hall by Gym-BF; Initial	1.00	<1.00	µg/L	
210608N016	10	Boy's Locker Room Bathroom 160 Left-SK; Initial	1.00	1.79	µg/L	
210608N017	11	Boy's Locker Room Bathroom 160 Middle-SK; Initial	1.00	1.39	µg/L	
210608N018	12	Boy's Locker Room Bathroom 160 Right-SK; Initial	1.00	1.66	µg/L	
210608N019	13	Girl's Locker Room Bathroom 170 Left-SK; Initial	1.00	4.51	µg/L	
210608N020	14	Girl's Locker Room Bathroom 170 Right-SK; Initial	1.00	2.48	µg/L	
210608N021	15	Hall by Cafeteria 2-BF; Initial	1.00	<1.00	µg/L	
210608N022	16	Nurse's Office 100A-SK; Initial	1.00	13.6	µg/L	
210608N023	17	Hall by Room 204B-BF; Initial	1.00	<1.00	µg/L	
210608N024	18	Room 222 Prep Room-SK; Initial	1.00	39.7	µg/L	H
210608N025	19	Thayer House-Kitchen-SK; Initial	1.00	68.7	µg/L	E,H

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

#NAME?

June 24, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Glen Cove High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 23, 2021. New York Environmental analyzed the samples on June 24, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

#NAME?

Date Collected:	22 Jun 2021
Date Received:	23 Jun 2021
Date Analyzed:	24 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210623M004	1	Kitchen Potfiller (left)-PF; Initial	1.00	9.41	µg/L	
210623M005	2	Kitchen Coffee Maker Supply Line-OS; Initial	1.00	260	µg/L	E,H
210623M006	3	Booster Club Kitchen-SK; Initial	1.00	6.27	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.