



February 11, 2025

Joe Crelier
Director of Risk Management
Portland Public Schools

Via email: jcrelier@pps.net

Regarding: Short Term Radon Testing
Cleveland High School
3400 SE 26th Avenue
Portland, Oregon 97202

Mr. Crelier:

From January 27 to 30, 2025, PBS Engineering and Environmental Inc. (PBS) performed short-term radon testing at the Cleveland High School building in Portland, Oregon. PBS understands that the District completed initial radon testing in the building in 2016/2017 and has requested this sampling because the facility is due for the next round of testing.

METHODOLOGY

The Environmental Protection Agency (EPA) recommends, and the Oregon Health Authority (OHA) requires, that school buildings be tested for radon, and that any radon concentrations be maintained below 4.0 picocuries per liter (pCi/L) of air. PBS used Radonova, Inc., brand single-use, short-term radon test kits to measure radon levels in frequently occupied rooms that are in contact with the ground or above unoccupied basements or crawlspaces. These rooms include classrooms, offices, break rooms, conference rooms, gyms, and cafeterias. Bathrooms, hallways, stairwells, storage rooms, and closets are not tested. Testing is conducted during the winter heating season and during the school week when building uses and operations are normal.

PBS endeavored to use sample location names based on existing room numbers or common-sense descriptions, but in buildings where no room number or other designation was available, PBS assigned names or numbers to the rooms. In some circumstances, small numbers of test kits go missing during the testing period and those locations are not tested. PBS will evaluate whether or not the missing area should be retested based on the results of surrounding areas.

RESULTS

Laboratory results found concentrations below the EPA action level in all tested locations in the building. See the attached laboratory analysis report for more details and the attached informal sample location map for approximate locations of where samples were collected.

In addition to the EPA recommendation that radon concentrations not exceed 4.0 pCi/L, OHA recommends that the following steps be conducted based on the results of a room's initial short-term test:

- **If the result is less than 2.0 pCi/L**, school districts are required to test again every 10 years, per Oregon Revised Statute 332.166-167.

- **If the result is between 2.0 pCi/L and 4.0 pCi/L**, consider fixing (i.e., lowering) the radon in that room.
- **If the result is from 4.0 pCi/L to 8.0 pCi/L**, perform a follow-up measurement of that room using a long-term test. This test should be conducted over as much of a nine-month school year as possible, when the room is likely to be occupied. If that result is equal to or greater than 4.0 pCi/L, the radon in the room should be fixed (i.e., lowered).
- **If the initial short-term test result is equal to or greater than 8.0 pCi/L**, conduct a second short-term test and average its result with the initial short-term test result. If the average of the two is equal to or greater than 4.0 pCi/L, radon in the room should be fixed (i.e., lowered).

Note: A great difference in the results of the short-term tests may indicate a flaw in the testing process. Investigate and consider retesting. For situations in which one of the test results is equal to or greater than 4.0 pCi/L, if the higher result is two or more times the lower result, repeat the test.

LIMITATIONS OF SCOPE

This study was limited to the tests and locations as previously indicated. The site as a whole may have other environmental concerns that will not be characterized by this study. The findings and conclusions of this work are not scientific certainties, but probabilities based on professional judgment concerning the significance of the data gathered during the course of this investigation. PBS is not able to represent conditions on the site or adjoining sites beyond those detected or observed by PBS.

Please feel free to contact me at 503.515.7489 or james.mastanduno@pbsusa.com with any questions or comments.

Sincerely,




James Mastanduno
Project Manager

Attachment: Informal Sample Location Map
Radonova Laboratory Analysis Report

Portland Public Schools

FACILITIES AND ASSET MANAGEMENT

Cleveland High School 3400 SE 26th Avenue 97202 *Facility Plan*

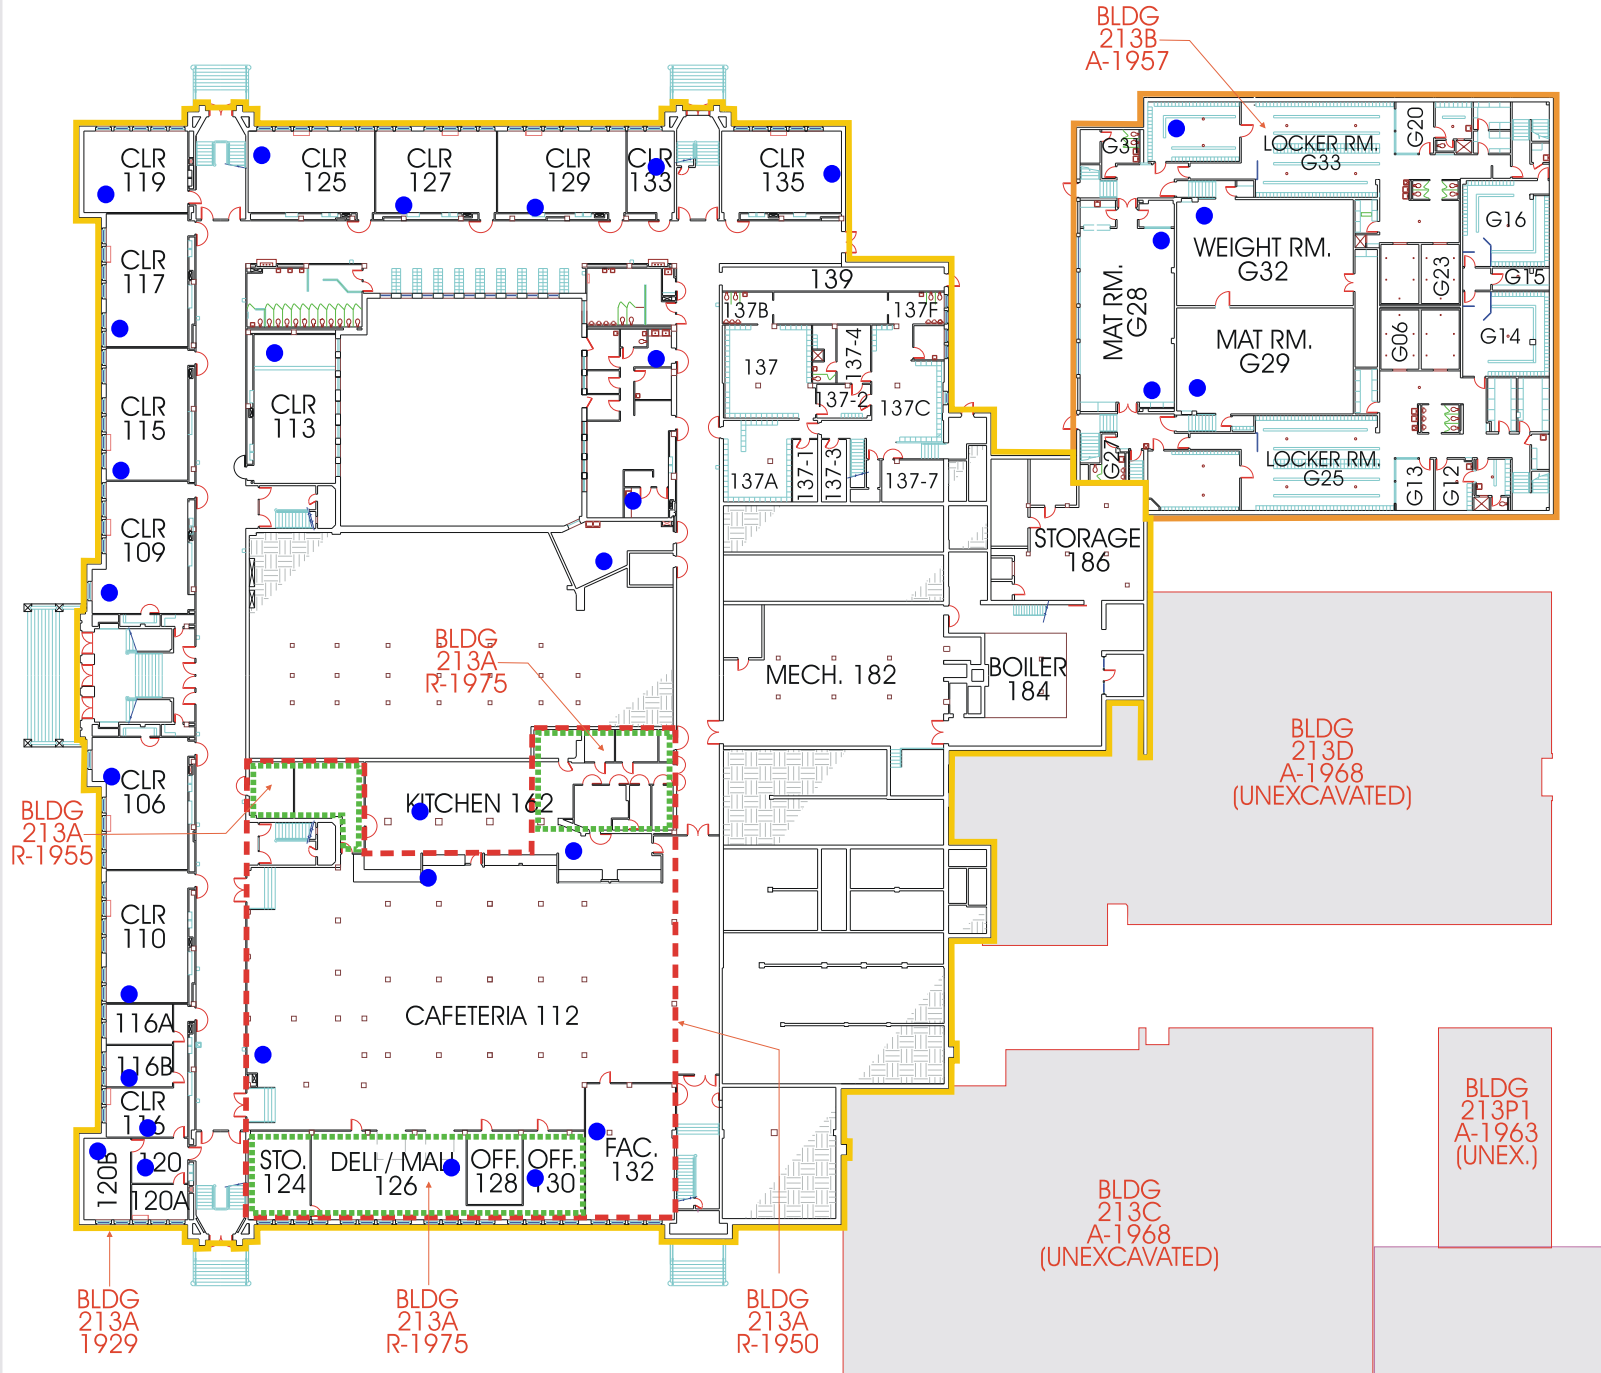

Short-Term Radon Testing Locations

**PBS Engineering and Environmental,
Inc.**

01/27-01/30/2025

• - Test Locations




BASEMENT PLAN

Portland Public Schools

FACILITIES AND ASSET MANAGEMENT

Cleveland High School 3400 SE 26th Avenue 97202 *Facility Plan*

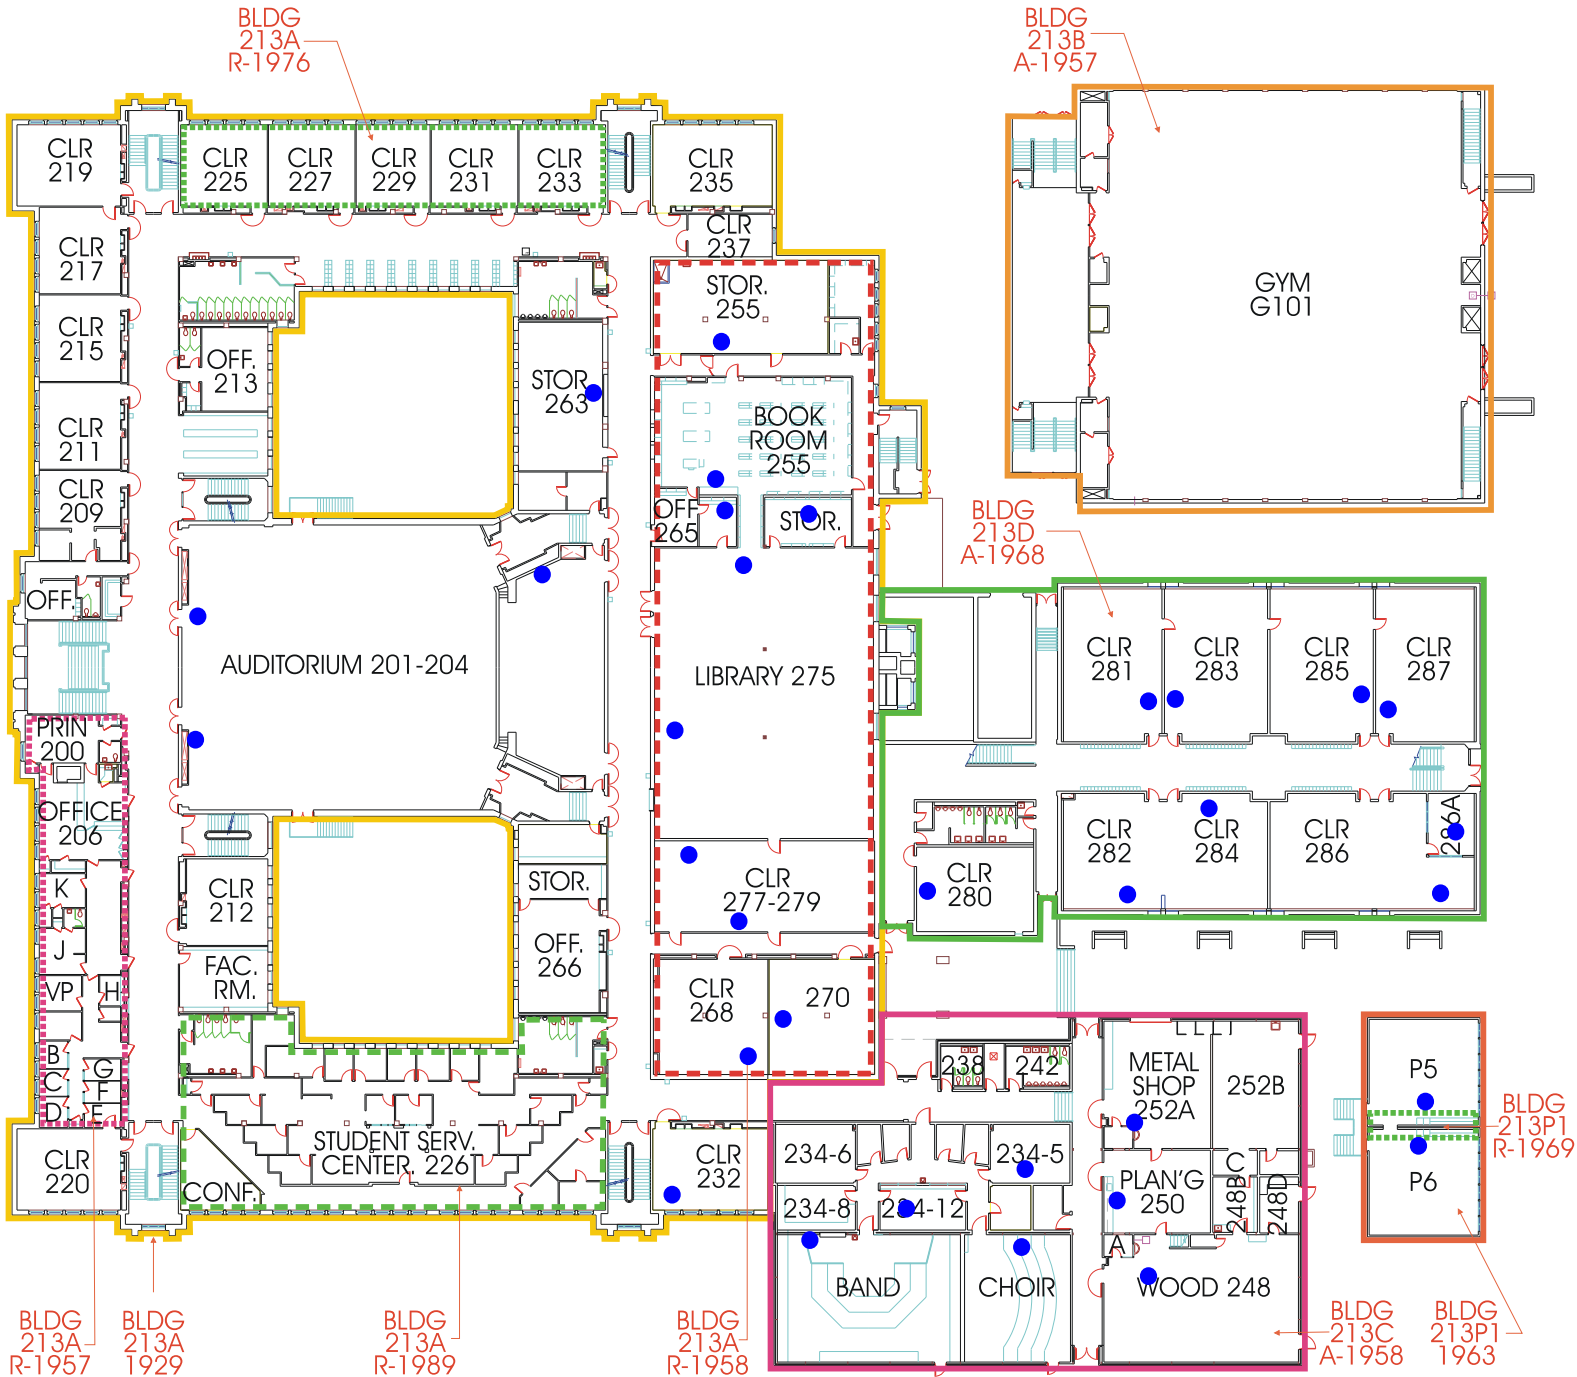

FIRST FLOOR PLAN

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with Activated Charcoal Adsorption by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **02/03/2025**.
They were measured **02/03/2025**.

The detectors were deployed by James Mastanduno and retrieved by James Mastanduno

Property data and address

MEASURE SITE ADDRESS

Cleveland
3400 SE 26th Avenue
97202

BUILDING ID

Test results

DETECTOR	MEASUREMENT PERIOD	DESCRIPTION / LOCATION	ROOM	FLOOR	RADON RESULT
RK147039 [QuickScreen]	01/27/2025 03:05 PM – 01/30/2025 04:30 PM	Floor 0 109, Standard			< 0.7 pCi/L
RK147031 [QuickScreen]	01/27/2025 03:06 PM – 01/30/2025 04:31 PM	Floor 0 113, Standard			0.6 ± 0.5 pCi/L
RK146978 [QuickScreen]	01/27/2025 03:07 PM – 01/30/2025 04:32 PM	Floor 0 115, Standard			< 0.6 pCi/L
RK146972 [QuickScreen]	01/27/2025 03:08 PM – 01/30/2025 04:33 PM	Floor 0 117, Standard			0.7 ± 0.5 pCi/L
RK146986 [QuickScreen]	01/27/2025 03:09 PM – 01/30/2025 04:34 PM	Floor 0 117 DUP, Duplicate			< 0.5 pCi/L
RK150354 [QuickScreen]	01/27/2025 03:10 PM – 01/30/2025 04:35 PM	Floor 0 119, Standard			0.9 ± 0.5 pCi/L
RK150729 [QuickScreen]	01/27/2025 03:11 PM – 01/30/2025 04:36 PM	Floor 0 125, Standard			0.8 ± 0.6 pCi/L

Comment to the results

Steve Leslie (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

1 EAST 22nd STREET, SUITE 200
LOMBARD, IL 60148
331.814.2200, help@radonova.com

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with Activated Charcoal Adsorption by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **02/03/2025**.
They were measured **02/03/2025**.

The detectors were deployed by James Mastanduno and retrieved by James Mastanduno

Property data and address

MEASURE SITE ADDRESS

Cleveland
3400 SE 26th Avenue
97202

BUILDING ID

DETECTOR	MEASUREMENT PERIOD	DESCRIPTION / LOCATION	ROOM	FLOOR	RADON RESULT
RK150331 [QuickScreen]	01/27/2025 03:12 PM – 01/30/2025 04:37 PM	Floor 0 127, Standard			1.5 ± 0.6 pCi/L
RK150307 [QuickScreen]	01/27/2025 03:13 PM – 01/30/2025 04:38 PM	Floor 0 129, Standard			< 0.9 pCi/L
RK147027 [QuickScreen]	01/27/2025 03:14 PM – 01/30/2025 04:39 PM	Floor 0 133, Standard			0.8 ± 0.5 pCi/L
RK146967 [QuickScreen]	01/27/2025 03:15 PM – 01/30/2025 04:40 PM	Floor 0 135, Standard			0.6 ± 0.5 pCi/L
RK147035 [QuickScreen]	01/27/2025 03:16 PM – 01/30/2025 04:41 PM	Floor 0 163, Standard			0.8 ± 0.5 pCi/L
RK146991 [QuickScreen]	01/27/2025 03:17 PM – 01/30/2025 04:42 PM	Floor 0 163, Standard			1.0 ± 0.4 pCi/L
RK146975 [QuickScreen]	01/27/2025 03:18 PM – 01/30/2025 04:43 PM	Floor 0 173, Standard			0.9 ± 0.4 pCi/L
RK150362 [QuickScreen]	01/27/2025 03:19 PM – 01/30/2025 04:44 PM	Floor 0 162, Standard			< 0.6 pCi/L
RK150316 [QuickScreen]	01/27/2025 03:20 PM – 01/30/2025 04:45 PM	Floor 0 162, Standard			0.7 ± 0.6 pCi/L

Comment to the results

Steve Leslie (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

1 EAST 22nd STREET, SUITE 200
LOMBARD, IL 60148
331.814.2200, help@radonova.com

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with Activated Charcoal Adsorption by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **02/03/2025**.
They were measured **02/03/2025**.

The detectors were deployed by James Mastanduno and retrieved by James Mastanduno

Property data and address

MEASURE SITE ADDRESS
Cleveland
3400 SE 26th Avenue
97202

BUILDING ID

DETECTOR	MEASUREMENT PERIOD	DESCRIPTION / LOCATION	ROOM	FLOOR	RADON RESULT
RK149014 [QuickScreen]	01/27/2025 03:21 PM – 01/30/2025 04:46 PM	Floor 0 cafeteria, Standard			1.1 ± 0.6 pCi/L
RK149033 [QuickScreen]	01/27/2025 03:22 PM – 01/30/2025 04:47 PM	Floor 0 cafeteria, Standard			1.2 ± 0.6 pCi/L
RK150587 [QuickScreen]	01/27/2025 03:23 PM – 01/30/2025 04:48 PM	Floor 0 132, Standard			< 0.9 pCi/L
RK150335 [QuickScreen]	01/27/2025 03:24 PM – 01/30/2025 04:49 PM	Floor 0 132 DUP, Duplicate			0.7 ± 0.5 pCi/L
RK148990 [QuickScreen]	01/27/2025 03:25 PM – 01/30/2025 04:50 PM	Floor 0 130, Standard			1.0 ± 0.8 pCi/L
RK148996 [QuickScreen]	01/27/2025 03:26 PM – 01/30/2025 04:51 PM	Floor 0 126, Standard			< 0.7 pCi/L
RK150521 [QuickScreen]	01/27/2025 03:27 PM – 01/30/2025 04:52 PM	Floor 0 120, Standard			< 0.7 pCi/L
RK148997 [QuickScreen]	01/27/2025 03:28 PM – 01/30/2025 04:53 PM	Floor 0 120B, Standard			1.4 ± 0.7 pCi/L
RK148988 [QuickScreen]	01/27/2025 03:29 PM – 01/30/2025 04:54 PM	Floor 0 116, Standard			1.4 ± 0.6 pCi/L

Comment to the results

Steve Leslie (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

1 EAST 22nd STREET, SUITE 200
LOMBARD, IL 60148
331.814.2200, help@radonova.com

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with Activated Charcoal Adsorption by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **02/03/2025**.
They were measured **02/03/2025**.

The detectors were deployed by James Mastanduno and retrieved by James Mastanduno

Property data and address

MEASURE SITE ADDRESS
Cleveland
3400 SE 26th Avenue
97202

BUILDING ID

DETECTOR	MEASUREMENT PERIOD	DESCRIPTION / LOCATION	ROOM	FLOOR	RADON RESULT
RK149061 [QuickScreen]	01/27/2025 03:30 PM – 01/30/2025 04:55 PM	Floor 0 116B, Standard			1.0 ± 0.6 pCi/L
RK149005 [QuickScreen]	01/27/2025 03:31 PM – 01/30/2025 04:56 PM	Floor 0 110, Standard			< 0.9 pCi/L
RK149041 [QuickScreen]	01/27/2025 03:32 PM – 01/30/2025 04:57 PM	Floor 0 106, Standard			1.8 ± 0.6 pCi/L
RK149017 [QuickScreen]	01/27/2025 03:33 PM – 01/30/2025 04:58 PM	Floor 0 mat room, Standard			< 1.1 pCi/L
RK146983 [QuickScreen]	01/27/2025 03:34 PM – 01/30/2025 04:59 PM	Floor 0 mat room office, Standard			< 0.5 pCi/L
RK150593 [QuickScreen]	01/27/2025 03:35 PM – 01/30/2025 05:00 PM	Floor 0 mat room DUP, Duplicate			< 0.7 pCi/L
RK147009 [QuickScreen]	01/27/2025 03:36 PM – 01/30/2025 05:01 PM	Floor 0 633, Standard			2.4 ± 0.5 pCi/L
RK150789 [QuickScreen]	01/27/2025 03:37 PM – 01/30/2025 05:02 PM	Floor 0 632, Standard			0.8 ± 0.5 pCi/L
RK150378 [QuickScreen]	01/27/2025 03:38 PM – 01/30/2025 05:03 PM	Floor 0 629, Standard			0.9 ± 0.5 pCi/L

Comment to the results

Steve Leslie (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

1 EAST 22nd STREET, SUITE 200
LOMBARD, IL 60148
331.814.2200, help@radonova.com

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with Activated Charcoal Adsorption by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **02/03/2025**.
They were measured **02/03/2025**.

The detectors were deployed by James Mastanduno and retrieved by James Mastanduno

Property data and address

MEASURE SITE ADDRESS

Cleveland
3400 SE 26th Avenue
97202

BUILDING ID

DETECTOR	MEASUREMENT PERIOD	DESCRIPTION / LOCATION	ROOM	FLOOR	RADON RESULT
RK150363 [QuickScreen]	01/27/2025 03:39 PM – 01/30/2025 05:04 PM	Floor 1 255 storage, Standard			0.9 ± 0.6 pCi/L
RK150295 [QuickScreen]	01/27/2025 03:40 PM – 01/30/2025 05:05 PM	Floor 1 255 book room, Standard			< 0.6 pCi/L
RK150792 [QuickScreen]	01/27/2025 03:41 PM – 01/30/2025 05:06 PM	Floor 1 255 book room DUP, Duplicate			< 0.7 pCi/L
RK150552 [QuickScreen]	01/27/2025 03:42 PM – 01/30/2025 05:07 PM	Floor 1 263, Standard			< 0.7 pCi/L
RK150537 [QuickScreen]	01/27/2025 03:43 PM – 01/30/2025 05:08 PM	Floor 1 stage, Standard			< 0.6 pCi/L
RK150512 [QuickScreen]	01/27/2025 03:44 PM – 01/30/2025 05:09 PM	Floor 1 auditorium, Standard			0.9 ± 0.7 pCi/L
RK150520 [QuickScreen]	01/27/2025 03:45 PM – 01/30/2025 05:10 PM	Floor 1 auditorium, Standard			1.1 ± 0.6 pCi/L
RK150576 [QuickScreen]	01/27/2025 03:46 PM – 01/30/2025 05:11 PM	Floor 1 library, Standard			0.7 ± 0.5 pCi/L
RK147760 [QuickScreen]	01/27/2025 03:47 PM – 01/30/2025 05:12 PM	Floor 1 library, Standard			< 0.8 pCi/L

Comment to the results

Steve Leslie (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

1 EAST 22nd STREET, SUITE 200
LOMBARD, IL 60148
331.814.2200, help@radonova.com

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with Activated Charcoal Adsorption by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **02/03/2025**.
They were measured **02/03/2025**.

The detectors were deployed by James Mastanduno and retrieved by James Mastanduno

Property data and address

MEASURE SITE ADDRESS
Cleveland
3400 SE 26th Avenue
97202

BUILDING ID

DETECTOR	MEASUREMENT PERIOD	DESCRIPTION / LOCATION	ROOM	FLOOR	RADON RESULT
RK150770 [QuickScreen]	01/27/2025 03:48 PM – 01/30/2025 05:13 PM	Floor 1 275T, Standard			< 0.6 pCi/L
RK147026 [QuickScreen]	01/27/2025 03:49 PM – 01/30/2025 05:14 PM	Floor 1 275C, Standard			< 0.6 pCi/L
RK147010 [QuickScreen]	01/27/2025 03:50 PM – 01/30/2025 05:15 PM	Floor 1 277, Standard			< 0.8 pCi/L
RK147015 [QuickScreen]	01/27/2025 03:51 PM – 01/30/2025 05:16 PM	Floor 1 268, Standard			< 0.7 pCi/L
RK147057 [QuickScreen]	01/27/2025 03:52 PM – 01/30/2025 05:17 PM	Floor 1 279, Standard			< 0.6 pCi/L
RK147017 [QuickScreen]	01/27/2025 03:53 PM – 01/30/2025 05:18 PM	Floor 1 270, Standard			< 0.5 pCi/L
RK147029 [QuickScreen]	01/27/2025 03:54 PM – 01/30/2025 05:19 PM	Floor 1 270 DUP, Duplicate			< 0.6 pCi/L
RK150757 [QuickScreen]	01/27/2025 03:55 PM – 01/30/2025 05:20 PM	Floor 1 232, Standard			< 0.9 pCi/L
RK150306 [QuickScreen]	01/27/2025 03:56 PM – 01/30/2025 05:21 PM	Floor 1 234-2, Standard			1.4 ± 0.5 pCi/L

Comment to the results

Steve Leslie (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

1 EAST 22nd STREET, SUITE 200
LOMBARD, IL 60148
331.814.2200, help@radonova.com

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with Activated Charcoal Adsorption by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **02/03/2025**.
They were measured **02/03/2025**.

The detectors were deployed by James Mastanduno and retrieved by James Mastanduno

Property data and address

MEASURE SITE ADDRESS
Cleveland
3400 SE 26th Avenue
97202

BUILDING ID

DETECTOR	MEASUREMENT PERIOD	DESCRIPTION / LOCATION	ROOM	FLOOR	RADON RESULT
RK150778 [QuickScreen]	01/27/2025 03:57 PM – 01/30/2025 05:22 PM	Floor 1 234, Standard			1.0 ± 0.6 pCi/L
RK147012 [QuickScreen]	01/27/2025 03:58 PM – 01/30/2025 05:23 PM	Floor 1 234-5, Standard			2.2 ± 0.5 pCi/L
RK150379 [QuickScreen]	01/27/2025 03:59 PM – 01/30/2025 05:24 PM	Floor 1 236, Standard			1.3 ± 0.5 pCi/L
RK150740 [QuickScreen]	01/27/2025 04:00 PM – 01/30/2025 05:25 PM	Floor 1 236 DUP, Duplicate			1.7 ± 0.6 pCi/L
RK150794 [QuickScreen]	01/27/2025 04:01 PM – 01/30/2025 05:26 PM	Floor 1 248, Standard			< 0.7 pCi/L
RK150356 [QuickScreen]	01/27/2025 04:02 PM – 01/30/2025 05:27 PM	Floor 1 250, Standard			0.6 ± 0.5 pCi/L
RK150324 [QuickScreen]	01/27/2025 04:03 PM – 01/30/2025 05:28 PM	Floor 1 252A, Standard			1.2 ± 0.5 pCi/L
RK150753 [QuickScreen]	01/27/2025 04:04 PM – 01/30/2025 05:29 PM	Floor 1 280, Standard			< 0.6 pCi/L
RK150351 [QuickScreen]	01/27/2025 04:05 PM – 01/30/2025 05:30 PM	Floor 1 281, Standard			< 0.6 pCi/L

Comment to the results

Steve Leslie (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

1 EAST 22nd STREET, SUITE 200
LOMBARD, IL 60148
331.814.2200, help@radonova.com

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with Activated Charcoal Adsorption by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **02/03/2025**.
They were measured **02/03/2025**.

The detectors were deployed by James Mastanduno and retrieved by James Mastanduno

Property data and address

MEASURE SITE ADDRESS
Cleveland
3400 SE 26th Avenue
97202

BUILDING ID

DETECTOR	MEASUREMENT PERIOD	DESCRIPTION / LOCATION	ROOM	FLOOR	RADON RESULT
RK150733 [QuickScreen]	01/27/2025 04:06 PM – 01/30/2025 05:31 PM	Floor 1 283, Standard			< 0.9 pCi/L
RK150313 [QuickScreen]	01/27/2025 04:07 PM – 01/30/2025 05:32 PM	Floor 1 283 DUP, Duplicate			< 1.0 pCi/L
RK150780 [QuickScreen]	01/27/2025 04:08 PM – 01/30/2025 05:33 PM	Floor 1 282, Standard			< 0.8 pCi/L
RK150381 [QuickScreen]	01/27/2025 04:09 PM – 01/30/2025 05:34 PM	Floor 1 284, Standard			< 0.5 pCi/L
RK109045 [QuickScreen]	01/27/2025 04:10 PM – 01/30/2025 05:35 PM	Floor 1 285, Standard			< 0.6 pCi/L
RK125692 [QuickScreen]	01/27/2025 04:11 PM – 01/30/2025 05:36 PM	Floor 1 287, Standard			0.9 ± 0.5 pCi/L
RK152208 [QuickScreen]	01/27/2025 04:12 PM – 01/30/2025 05:37 PM	Floor 1 286, Standard			1.3 ± 0.6 pCi/L
RK151880 [QuickScreen]	01/27/2025 04:13 PM – 01/30/2025 05:38 PM	Floor 1 286A, Standard			< 0.6 pCi/L
RK151648 [QuickScreen]	01/27/2025 04:14 PM – 01/30/2025 05:39 PM	Floor 1 P1, Standard			< 0.5 pCi/L

Comment to the results

Steve Leslie (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

1 EAST 22nd STREET, SUITE 200
LOMBARD, IL 60148
331.814.2200, help@radonova.com

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with Activated Charcoal Adsorption by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **02/03/2025**.
They were measured **02/03/2025**.

The detectors were deployed by James Mastanduno and retrieved by James Mastanduno

Property data and address

MEASURE SITE ADDRESS
Cleveland
3400 SE 26th Avenue
97202

BUILDING ID

DETECTOR	MEASUREMENT PERIOD	DESCRIPTION / LOCATION	ROOM	FLOOR	RADON RESULT
RK151878 [QuickScreen]	01/27/2025 04:15 PM – 01/30/2025 05:40 PM	Floor 1 P2, Standard			1.2 ± 0.6 pCi/L
RK152138 [QuickScreen]	01/27/2025 04:15 PM – 01/30/2025 05:40 PM	Blank, Blank			< 0.8 pCi/L
RK147008 [QuickScreen]	01/27/2025 04:15 PM – 01/30/2025 05:40 PM	Blank, Blank			< 0.9 pCi/L
RK147030 [QuickScreen]	01/27/2025 04:15 PM – 01/30/2025 05:40 PM	Blank, Blank			< 0.8 pCi/L

Comment to the results

Steve Leslie (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

1 EAST 22nd STREET, SUITE 200
LOMBARD, IL 60148
331.814.2200, help@radonova.com

What Does My Result Mean?

The United States Environmental Protection Agency (EPA) recommends remediation if the results of one long-term test (greater than 90 days) or one short-term test with a continuous monitor or the average of two passive short-term (less than 90 days) tests* conducted in the lowest lived-in level of the home report at or above 4.0 pCi/L. *If an initial short-term test result is less than 4 pCi/L, a follow-up measurement is probably not needed. If an initial short-term test result is between 4 pCi/L and 8 pCi/L, a long-term or a short-term follow-up measurement is recommended. If an initial short-term test result is greater than 8 pCi/L, a short-term follow-up measurement is recommended. For more information, or to find a certified mitigation professional, contact your state radon office, the National Radon Proficiency Program (www.nrpp.info) or the National Radon Safety Board (www.nrsb.org).

Result (pCi/L) Recommended Action

Less than 2.0	Retest the building at least every 5 years
2.0 - 3.9	Consider Mitigation, retest the building at least every 5 years
4.0 or Higher	Mitigate, test again at least every 2 years to ensure that the system remains effective

Measurement method: Activated Charcoal Adsorption

For this method using the QuickScreen detector, the airtight container with activated charcoal is opened in the area to be sampled and radon in the air adsorbs onto the charcoal granules. At the end of the sampling period, the container is sealed and may be sent to a laboratory for analysis. The gamma decay from the radon adsorbed to the charcoal is counted on a scintillation detector and a calculation based on calibration information is used to calculate the radon concentration at the sample site.

Measured radon concentrations

For each detector, the measured value of the radon concentration is provided. For each value an uncertainty associated with the measurement to a 95% confidence level is also provided. For example a measurement result of 4.0 ± 0.5 pCi/L means that the radon concentration is most likely contained in the range 3.5 - 4.5 pCi/L. If the start or end date of the measurement has not been provided, the radon concentration cannot be calculated. In such cases, the total exposure in pCi*days/L will be reported. The reported measured values are related to the detectors as received by Radonova Laboratories. Detector deployment is not performed by Radonova Laboratories. Measurement information such as monitoring period (dates) and placement location is provided to Radonova Laboratories by the end user. The presented result applies only to the sample tested as received by the laboratory.

Codes on non-reportable detectors

DNR	Not Reported – Detector Not Returned
ERR	Not Reported – See comment

Measurement method versions used when the report was created

ANSI/AARST MAH-2023, Protocol for Conducting Measurements of Radon and Radon Decay Products in Homes

ANSI/AARST MA-MFLB-2023, Protocol for Measurements of Radon in Multifamily, School, Commercial and Mixed-Use Buildings

Radon measurements in the US

The United States Environmental Protection Agency (EPA) recommends remediation if the results of one long-term test or the average of two short-term tests conducted in the lowest lived-in level of the home report at or above 4.0 pCi/L. The average yearly residential indoor radon level in the US is estimated to be around 1.3 pCi/L. Long-term tests are conducted for more than 90 days. Short-term tests are conducted between 2 and 90 days and should be performed under closed building conditions. If an initial short-term test result is less than 4 pCi/L, a follow-up measurement is probably not needed. If an initial short-term test result is greater than 10 pCi/L, a short-term follow-up measurement is recommended in order to get a fast result. If an initial short-term test result is between 4 pCi/L and 10 pCi/L, a long-term or a short-term follow-up measurement is recommended. For more information about the interpretation of your test results or about other radon related issues we suggest contacting your state radon office.

Your state radon office should have the available EPA publications:

- A Citizen's Guide to Radon
- Home Buyer's and Seller's Guide to Radon
- Consumer's Guide to Radon Reduction

Signature on the report

With the signature on the report, the Measurement specialist at Radonova Laboratories certifies that the quality control procedures follows the guidance in accordance with the AARST/ANSI Measurement Protocols. Measurement information displayed in italics on report has been provided by the customer.

Certification no:

101132-AL, 107830-RMP, NY ELAP ID: 11430

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

1 EAST 22nd STREET, SUITE 200
LOMBARD, IL 60148
331.814.2200, help@radonova.com