

Prepared for:

Kyrene Elementary School District  
8700 South Kyrene Road  
Tempe, Arizona 85284

**AHERA ASBESTOS  
INSPECTION REPORT**

**FOR**

**KYRENE DE LA BRISAS ELEMENTARY SCHOOL  
777 N. DESERT BREEZE BOULEVARD E#1  
CHANDLER, ARIZONA 85226**

**PURCHASE ORDER NO. 251702**

Prepared by:



**DOMINION**

Dominion Environmental Consultants, Inc.  
20045 North 19<sup>th</sup> Avenue, Building 7  
Phoenix, Arizona 85027  
(623) 516-1415

Dominion Project Number: AZ1418.35

Initial AHERA Inspection Date: March 3, 2025

## **TABLE OF CONTENTS**

|                                                    |                   |
|----------------------------------------------------|-------------------|
| <b>LIMITATIONS.....</b>                            | <b>SECTION 1</b>  |
| <b>INSPECTION PROCESS .....</b>                    | <b>SECTION 2</b>  |
| <b>EXECUTIVE SUMMARY .....</b>                     | <b>SECTION 3</b>  |
| <b>SITE LOCATION MAP.....</b>                      | <b>SECTION 4</b>  |
| <b>HOMOGENEOUS MATERIALS INVENTORY LISTS .....</b> | <b>SECTION 5</b>  |
| <b>PLM BULK SAMPLE SHEETS .....</b>                | <b>SECTION 6</b>  |
| <b>PLM BULK SAMPLE LOCATION MAPS.....</b>          | <b>SECTION 7</b>  |
| <b>ASSUMED ACBM LOCATION MAPS.....</b>             | <b>SECTION 8</b>  |
| <b>LABORATORY REPORTS .....</b>                    | <b>SECTION 9</b>  |
| <b>INSPECTOR ACCREDITATIONS .....</b>              | <b>SECTION 10</b> |
| <b>LABORATORY ACCREDITATIONS .....</b>             | <b>SECTION 11</b> |

SECTION 1



LIMITATIONS

## **LIMITATIONS**

The conclusions and results contained herein are based solely on the information presented in this report. The sampling, testing, and observations described in the report represent conditions only at the specified times and locations. Additional materials or information which were hidden, undiscovered, inaccessible, or not a part of the findings presented herein, would result in the modification of the conclusions and recommendations made herein. Any response action guidelines are based solely on the findings contained herein. The response action guidelines are presented as a courtesy and are not to be considered a complete or detailed set of specifications. Dominion performed this survey as directed by the client and in compliance with applicable regulations.

Dominion is not responsible for the accuracy of information provided by others, or for conditions or consequences arising from relevant facts that were withheld, concealed, undiscovered, or not fully disclosed. Dominion is not a law firm, and therefore, makes no representations regarding any potential liability of any person or entity for site conditions. Further, Dominion is not qualified to present medical advice. If any present or future health issues are in question, it is recommended that the findings in this report be presented to a qualified medical professional for evaluation.

Kyrene De Las Brisas is currently being used daily, therefore, to avoid conspicuous damage and a possible trip and fall hazard, Dominion was only able to check for secondary flooring layers in the corners of each room. Therefore, if the carpets are to be replaced, additional investigation should be performed under other areas of the flooring to assure that an undetected second layer of flooring does not exist. Any necessary samples should be collected by a certified inspector prior to a disturbance of any discovered un-sampled flooring.

## SECTION 2



# INSPECTION PROCESS

## **INSPECTION PROCESS**

The Environmental Protection Agency (EPA) in 40 CFR 763, the Asbestos Hazard Emergency Response Act (AHERA), requires Local Education Agencies (LEAs) to identify friable and non-friable asbestos-containing building material (ACBM) in public and private elementary and secondary schools by visually inspecting school buildings for such materials and by sampling all identified suspect materials if they are not assumed to be ACBM. Those samples are then to be analyzed using appropriate analysis techniques, by a qualified laboratory, as referred to in the regulations. AHERA requires LEAs to only utilize accredited personnel when conducting inspections, re-inspections, developing management plans, or performing response actions. This regulation also includes record-keeping requirements. LEAs may contractually delegate their duties under this rule, but they remain responsible for the proper performance of those duties. LEAs are encouraged to consult with EPA Regional Asbestos Coordinators, or if applicable a State's lead agency designated by the State Governor, for assistance in complying with this rule.

This report complies with AHERA based protocols outlined in 40 CFR 763.85, specifically:

- The campus was visually inspected to identify the locations of all suspected ACBM.
- All suspect materials were touched to determine friability and condition.
- Bulk samples were collected of all homogeneous areas of friable suspected ACBM and all homogeneous areas of non-friable suspected ACBM.
- The date of the inspection, the name and signature of the person making the inspection, State of accreditation, his or her accreditation number and any changes in the condition of known or assumed ACBM are included in this report, if applicable.
- The exact locations where samples were collected during the inspection are marked, as well as a description of the manner used to determine sampling locations, the name and signature of each accredited inspector who collected the samples, State of accreditation and if applicable, his or her accreditation number.
- Also included within the report are any assessments or reassessments made of friable material, the name and signature of the accredited inspector making the assessments, State of accreditation and if applicable, his or her accreditation number.

The sampling protocol outlined in 40 CFR 763.86 is as follows:

Surfacing material is material in a school building that is sprayed-on, troweled-on, or otherwise applied to surfaces, such as acoustical plaster on ceilings and fireproofing materials on structural members, or other materials on surfaces for acoustical, fireproofing, or other purposes. Surfacing materials are collected in a statistically random manner as follows:

- At least three (3) bulk samples shall be collected from each homogeneous area that is one thousand (1,000) square feet.

- At least five (5) bulk samples shall be collected from each homogeneous area that is greater than one thousand (1,000) square feet but less than or equal to five thousand (5,000) square feet.
- At least seven (7) bulk samples shall be collected from each homogeneous area that is greater than five thousand (5,000) square feet.

Thermal system insulation (TSI) in a school building means materials applied to pipes, fittings, boilers, breeching, tanks, ducts, or other interior structural components to prevent heat loss or gain, or water condensation, or for other purposes. TSI samples are collected in a randomly distributed manner as follows:

- A minimum of three (3) bulk samples are collected from each homogeneous area of TSI that is not assumed to be ACBM.
- Collect at least one (1) bulk sample from each homogeneous area of patched TSI that is not assumed to be ACBM if the patched section is less than six (6) linear or square feet.
- In a manner sufficient to determine whether the material is ACBM or not ACBM, collect bulk samples from each insulated mechanical system that is not assumed to be ACBM where cement or plaster is used on fittings such as tees, elbows, or valves.
- Bulk samples are not required to be collected from any homogeneous area where the accredited inspector has determined that the TSI is fiberglass, foam glass, rubber, or other non-ACBM.

Miscellaneous material is sampled in a manner sufficient to determine whether the material is ACBM or not ACBM. An accredited inspector shall collect bulk samples from each homogeneous area of friable miscellaneous material that is not “assumed” to be ACBM. Therefore, Dominion will collect a minimum of three (3) samples of each miscellaneous material, as a matter of industry standards.

## **ASSESSMENT OF MATERIALS**

In compliance with 40 CFR 763.88, Dominion inspectors have classified the ACBM and suspected ACBM in the school buildings into one of the following categories:

- (1) Damaged or significantly damaged Thermal System Insulation ACBM
- (2) Damaged friable surfacing ACBM
- (3) Significantly damaged friable surfacing ACBM
- (4) Damaged or significantly damaged friable miscellaneous ACBM
- (5) ACBM with potential for damage
- (6) ACBM with potential for significant damage
- (7) Any remaining friable ACBM or friable suspected ACBM

As part of the assessment, the following issues have been taken into consideration:

- i. Location and the amount of the material, both in total quantity and as a percentage of the functional space.
- ii. The type of damage or significant damage (e.g., flaking, blistering, water damage, or other signs of physical damage).
- iii. The severity of damage (e.g., major flaking, severely torn jackets, as opposed to occasional flaking, minor tears to jackets).
- iv. Extent or spread of damage over large areas or large percentages of the homogeneous area.
- v. Whether the material is accessible.
- vi. The material's potential for disturbance.
- vii. Known or suspected causes of damage or significant damage (e.g., air erosion, vandalism, vibration, water).
- viii. Preventive measures which might eliminate the reasonable likelihood of undamaged ACBM from becoming significantly damaged.

## SECTION 3



## EXECUTIVE SUMMARY

## **EXECUTIVE SUMMARY**

### **INTRODUCTION**

Dominion Environmental Consultants, Inc. (Dominion) was authorized, by Mr. Mason Meade with the Kyrene Elementary School District (KESD), to perform the Initial AHERA Asbestos Inspection of Kyrene De Las Brisas Elementary School, located at 777 N. Desert Breeze Boulevard in Chandler, Arizona, via a written Purchase Order #251702, dated February 4, 2025.

Due to budgetary constraints, Dominion was directed by Mr. Meade to first sample the accessible building materials inside the building until a pre-determined number of samples were collected. Once the allotted number of samples per building had been collected, Dominion was then directed to "assume as asbestos-containing" the remaining suspect building materials. Pursuant to Mr. Meade's directions, the sampling order of importance was determined first on materials with the largest square footage, then least accessible materials, ceramic tiles, and materials least likely to be disturbed.

Dominion was also instructed by Mr. Meade, to the extent reasonable, utilize Dominion's previous Limited Asbestos Reports for the Main Building, Projects Numbers AZ1418.11, AZ1418.15, & AZ1418.16 dated March 11, 2024. Dominion was instructed to utilize the information from these previous reports and to collect additional bulk samples of any previously unsampled building materials that are identified during the inspection.

Kyrene De Kyrene De Las Brisas Elementary School campus consists of two (2) single stories, slab on grade, block structures: The Main Building & Library. No below grade levels were observed for any of the buildings on campus.

### **BACKGROUND INFORMATION**

#### **INITIAL AHERA ASBESTOS SURVEY - MARCH 2024**

Dominion's Limited Asbestos Inspection of the Kyrene de las Brisas Main Building was conducted on March 11, 2024, by Ms. Tracey Carpenter & Mr. Xin Lou, both AHERA accredited Asbestos Building Inspectors (State of Arizona # ON-4644-14588-090523, expiration date September 5, 2024 & State of Arizona # ON-4644-548-092323, expiration date September 23, 2024).

#### **RE-INSPECTION AHERA INSPECTION – MARCH 2025**

Dominion's AHERA Asbestos Inspection, of the Kyrene De Las Brisas Elementary School was conducted on March 3, 2025, by Mr. Isai Portillo, an AHERA accredited Asbestos Building Inspector. (State of Arizona #ON-188748-19438-121224, expiration date December 12, 2025)

## **COLLECTION OF BULK SAMPLES**

### **AHERA Asbestos Survey – March 2024**

A total of seventy-two (72) bulk samples were collected from thirty-four (34) homogeneous building materials within the Main Building.

Identified in the following list are the thirty-four (34) suspect homogeneous building materials sampled during the March 2024 limited asbestos inspections.

#### **Main Building - 34 Materials – 0 ACBM**

- Blue Pipe Tape
- Cream Sealant for Blue Pipe Tape
- Gray 12"x 12" Kitchen Ceramic Floor Tile
- Gray Grout for Gray 12"x 12" Ceramic Floor Tile
- Gray Ceramic Cove Base Tile
- Tan Mastic for Gray Ceramic Cove Base Tile
- White Compound for Gray Cove Base Tile
- Gray Grout for Gray Cove Base Tile
- Orange Peel Drywall System- Tan
- White Fiberglass Reinforced Plastic (FRP)
- Cream Mastic for FRP
- White Counter Caulking
- White Sink Caulking
- White Door Fram Caulking
- ~~2' x 2' Ceiling Tile (Removed)~~
- Yellow Insulation
- Silver Backing for Yellow Insulation
- Blue 4" x 4" Ceramic Wall Tile
- Yellow Mastic for Blue 4" x 4" Ceramic Wall Tile
- Beige 4" x 4" Ceramic Wall Tile
- Yellow Mastic for Beige 4" x 4" Ceramic Wall Tile
- Gray 4" x 4" Ceramic Wall Tile
- Yellow Mastic for Gray 4" x 4" Ceramic Wall Tile
- Beige Grout for 4" x 4" Ceramic Wall Tiles
- Gray 2" x 2" Ceramic Floor Tile
- Yellow Mastic for Gray 2" x 2" Ceramic Floor Tile
- Gray Mortar for Gray 2" x 2" Ceramic Floor Tile
- Gray Grout for Gray 2" x 2" Ceramic Floor Tile
- White Cabinet Caulking
- White Fixture Caulking
- White Door Frame Caulking
- Orange Peel Drywall System - Peach (Paint, Texture, Tape, Joint Compound, & Drywall)
- Unfinished Drywall System - Peach/Cream (Paint, Texture, Tape, Joint Compound, & Drywall)

- 2' x 2' Ceiling Tile

## **2025 AHERA Re-Inspection with Limited Asbestos Sampling -March 3, 2025**

During the Initial 2025 AHERA Asbestos Inspection, a total of forty-five (45) bulk samples were collected from twenty-three (23) homogeneous building materials (multiple layers) throughout the Kyrene De Las Brisas Main Building & Library. Identified in the following list, separated by building, are the twenty-three (23) suspect homogeneous materials Dominion sampled during the 2025 AHERA inspection.

### Main Building - 15 Materials – 0 ACBM

- 2"x 2" Off-White Ceiling Tile
- 2"x 2" White Ceiling Tile
- Blue Cove Base
- Yellow Mastic for Blue Cove Base
- Gray/Blue Carpet Squares
- Yellow Mastic for Gray/Blue Carpet Squares
- Black Window Sealant
- Light Brown w/Tan Specs 12" x 12" VCT
- Semi-Transparent Mastic for Light Brown w/Tan Specs 12" x 12" VCT
- White w/Black Specs 12" x 12" VCT
- Yellow Mastic for White w/Black Specs 12" x 12" VCT
- Gray w/Tan Specs 12" x 12" VCT
- Yellow Mastic with Gray w/Tan Specs 12" x 12" VCT
- White Texture 2" x 2" Ceiling Tiles
- Beige Smooth Vinyl 2" x 2" Ceiling Tiles

### Library - 8 Materials – 0 ACBM

- Blue Cove Base
- Beige Mastic for Blue Cove Base
- 2' x 2' White Rough Texture Ceiling Tile
- 2' x 2' White Ceiling Tile
- Orange Peel Drywall System (Paint, Texture, Tape, Joint Compound, & Drywall)
- Blue/Gray Carpet Squares
- Yellow Mastic for Blue/Gray Carpet Squares
- Brown Sheet Flooring for Blue/Gray Carpet Squares

All the suspect bulk samples collected from Kyrene De Las Brisas Elementary School were submitted to EMLab P&K (EMLab) in Phoenix, Arizona for analysis using Polarized Light Microscopy (PLM) methods. EMLab used the methods prescribed in Method 40 CFR, Part 763, in the Code of Federal Register in analyzing bulk samples. EMLab is certified by the National *Institute of Standards and Technology* as a National Voluntary Laboratory Accreditation

Program (NVLAP), Number 500031-0. The suspect asbestos bulk samples were collected and submitted to the laboratory using established chain-of-custody procedures.

Bulk samples were collected utilizing safety and health practices as required by the Occupational Safety and Health Administration (OSHA). At the time of sample collection, the buildings were not occupied by students. Only limited administrative and custodial staff were present on campus.

### **ASSUMED ACBM**

Due to budgetary constraints, KESD instructed Dominion to assume any identified, unsampled suspect building materials as asbestos containing until budget constraints will allow further asbestos bulk sampling. Therefore, listed below, separated by building, are the sixty-four (64) identified suspect building materials that were **assumed** to contain greater than one percent (>1%) asbestos.

#### **Main Building**

- Black Weather Stripping
- Gray Metal Door Frame Sealant
- Clear 9" x 9" Block Mortar
- 2' x 2' Black Carpet Squares
- Mastic for 2' x 2' Black Carpet Squares
- Counter/Cabinet Caulking
- Gray Sink Coating
- Off-White 4" x 4" Ceramic Wall Tile
- Gray 4" x 4" Ceramic Wall Tile
- Black 4" x 4" Ceramic Wall Tile
- Grout for 4" x 4" Ceramic Wall Tiles
- Mastic for 4" x 4" Ceramic Wall Tiles
- Navy Blue Cove Base Tile
- Grout for Navy Blue Cove Tile
- Mastic for Navy Blue Cove Tile
- Fixture Caulking
- Gray 4" Cove Base
- Mastic for Gray 4" Cove Base
- Mop Sink Caulking
- White Pipe Wrap/Coating for Insulation
- Light Pink 4" x 4" Ceramic Wall Tile
- Grout for Light Pink 4" x 4" Ceramic Wall Tile
- Mastic for Light Pink 4" x 4" Ceramic Wall Tile
- Gray Granite Countertop
- Smooth Drywall System
- White 4" x 4" Ceramic Wall Tile

- Grout for 4" x 4" Ceramic Wall Tile
- Mastic for 4" x 4" Ceramic Wall Tile
- Tac Board
- Wrap for Tac Board
- Silver Sink Caulking
- Red 12" x 12" VCT
- Blue 12" x 12" VCT
- Green 12" x 12" VCT
- Yellow 12" x 12" VCT
- Mastic for Red, Blue, Green, & Yellow 12" x 12" VCT
- Brown Door/Window Frame Sealant
- 6" Black Cove Base
- 4" Black Cove Base
- Mastic for Black Cove Base
- 48" x 12" Black Vinyl
- Mastic for 48" x 12" Black Vinyl
- Brown 16" x 4" Decorative Block
- Mortar for Brown 16" x 4" Decorative Block
- Brown 16" x 8" Block
- Mortar for 16" x 8" Block
- Gray Duct Mastic
- Silver Flex Duct Wrap
- Silver Duct Wrap
- Red Fire Stop Caulking
- Ceiling Insulation Wrap
- Black Foam Insulation
- Black HVAC Damper

#### Library

- Gray Sink Coating
- Tac Board
- Wrap for Tac Board
- Counter/Cabinet Caulking
- Black Window Sealant
- Clear 9" x 9" Block Grout
- White Door Sealant
- Gray Duct Mastic
- Silver Wrap for Flex Duct Insulation
- Silver Wrap for Duct Insulation
- Unfinished Drywall

## **INSPECTION FINDINGS**

### **Limited Asbestos Survey – March 2024**

All thirty-four (34) of the identified homogeneous building materials sampled during the March 2024 inspections within the Main Building were reported by the laboratory using the PLM analysis method to be “none detected” for asbestos content.

### **2025 AHERA Asbestos Sampling -March 3, 2025**

All twenty-three (23) of the identified homogeneous materials sampled during the 2025 AHERA inspection were reported by the laboratory using the PLM analysis method, to be “none detected” for asbestos content.

Sixty-four (64) of the identified suspect homogeneous building materials were *assumed* to contain greater than one percent (>1%) asbestos.

## **RECOMMENDATIONS**

Any building material within the Kyrene De Las Brisas Elementary School campus not identified in this inspection report that is not wood, glass, or metal, is a suspect ACBM and should not be removed, sanded, ground, abraded, or otherwise disturbed by any person without being first properly trained as per 40 CFR 763.92 and, or 29 CFR 1926.1101. For detailed recommendations, please refer to the Kyrene De Las Brisas Elementary School AHERA Management Plan.

The ACBM or assumed ACBM located within the structures of the Kyrene De Las Brisas Elementary School campus can be managed in compliance with the Kyrene Elementary School District AHERA Management Plan until such a time as these building materials become degraded, have become friable, or will be disturbed by ongoing maintenance, renovation, or a demolition activity. Prior to a renovation or demolition activity, the previously listed assumed ACBM should be sampled by an AHERA Certified Building Inspector to determine the presence of asbestos.

At least once every six (6) months after a management plan is in effect, the KESD should conduct periodic surveillance in each building that it leases, owns, or otherwise uses as a school building that contains ACBM.

At least once every three (3) years after a management plan is in effect, the KESD should conduct an inspection of all ACBM on the school campus.

The AHERA inspection is limited to only the interior of the buildings and the underside of any covered walkways. This would mean that the additional suspect building materials found on the exterior of the buildings or structures, that are not regulated by AHERA are regulated by EPA NESHAP and OSHA. Therefore, prior to any disturbance of these un-sampled or newly installed suspect building materials, Dominion recommends that these suspect materials be sampled by an

AHERA Certified Building Inspector and analyzed for asbestos content by a qualified laboratory prior to any disturbance.

The property owner or his representatives should retain the services of an independent asbestos consulting firm to monitor the performance of any asbestos abatement activities. The consulting firm should oversee the completeness of any asbestos removal and verify the quality of the air during the removal work and perform final clearance air sampling in accordance with the AHERA guidelines.

All documentation is being provided to the Kyrene Elementary School District and must be retained as a permanent record. Should you have any questions regarding the procedures that were followed on this project, please contact Dominion at any time. Thank you for the opportunity to provide these environmental consulting services.

A handwritten signature in blue ink, appearing to read 'Isai Portillo', with a stylized flourish at the end.

2025 AHERA Building Inspector

**Isai Portillo**

AHERA Certificate Number: ON-188748-19438-121224

Expires: December 12, 2025




## SECTION 4



## SITE LOCATION MAP

# Kyrene de las Brisas

777 N. Desert Breeze Blvd. E. #1 Chandler, AZ 85226  
Phone: 480-541-2000

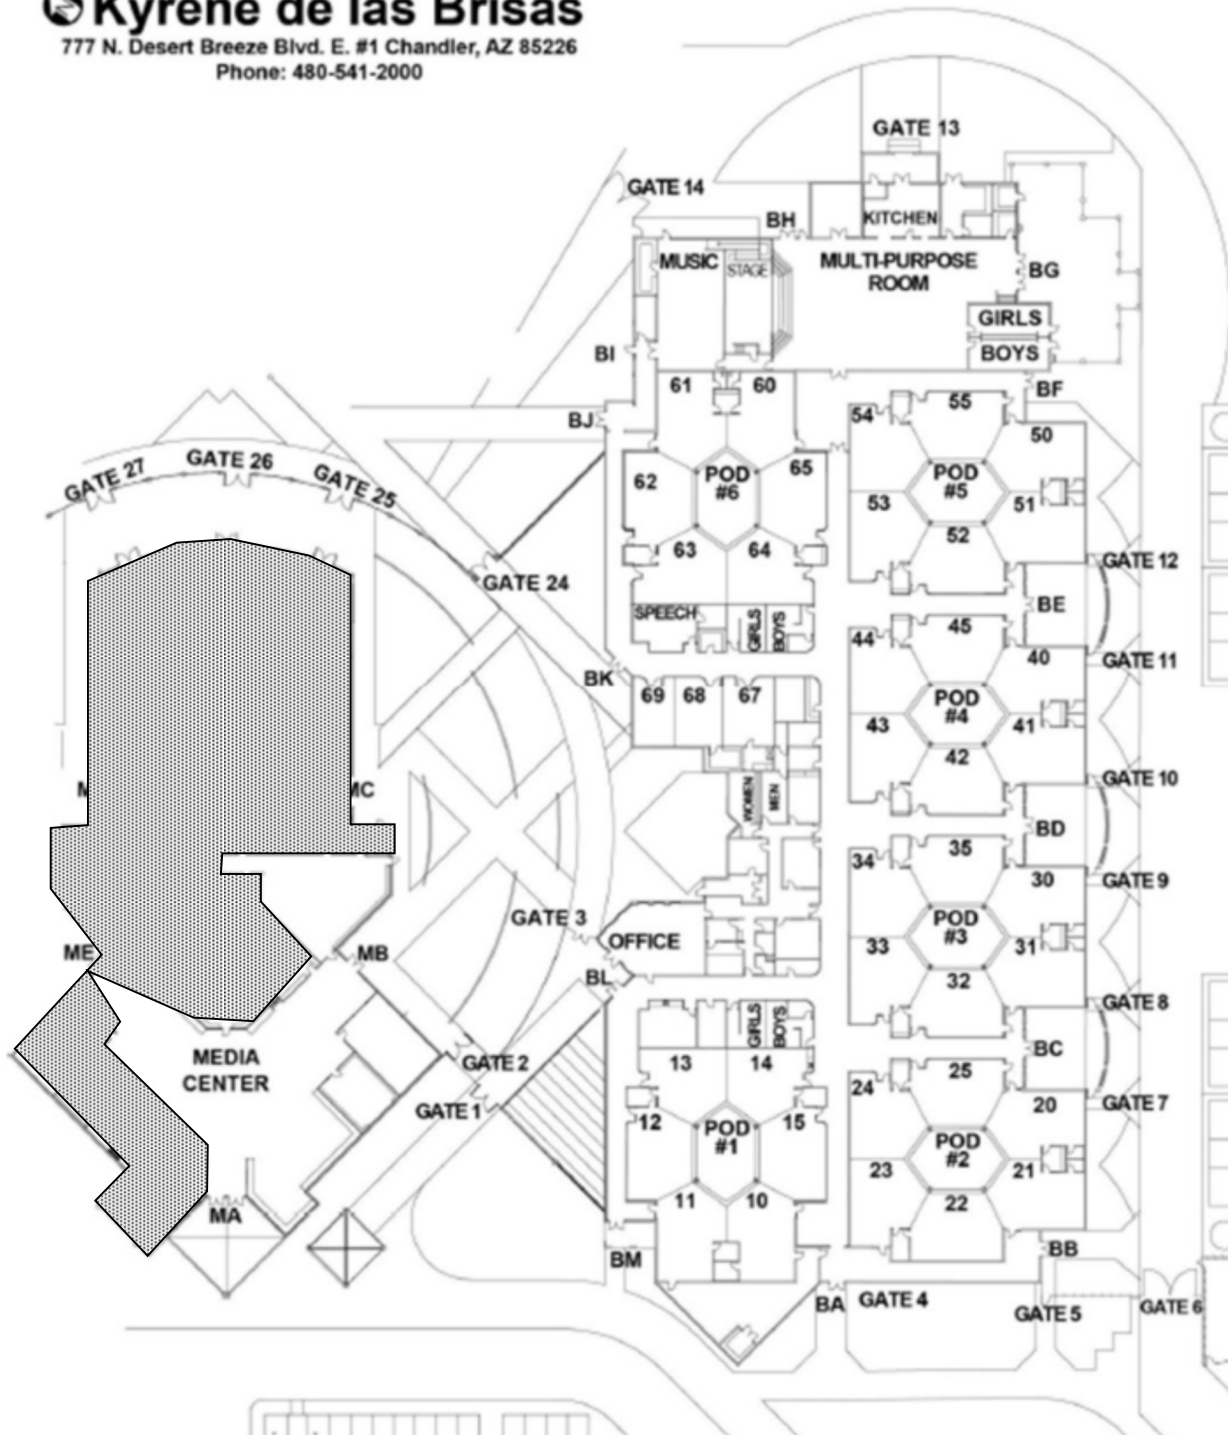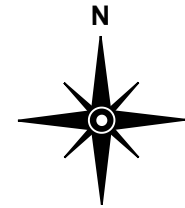

Area Used by Kyrene Aprende  
Middle School

Site Plan  
Kyrene De Las Brisas Elementary School  
777 N. Desert Breeze Blvd. E#1, Chandler, AZ 85226  
Main Building

Project No. AZ1418.35

## SECTION 5



# HOMOGENEOUS MATERIALS INVENTORY LISTS

**Dominion Environmental Consultants, Inc.**  
**AHERA Suspect ACBM Homogeneous Building Materials Inventory List**

| Dominion Project Numbers: AZ1418.11/1418.15/1415.16/1418.35                                                      |                                                     |                                  | Client: Kyrene Elementary School District         |                |                   |                                |
|------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------|----------------------------------|---------------------------------------------------|----------------|-------------------|--------------------------------|
| Inspection Dates: March 11, 2024 + March 3, 2025                                                                 |                                                     |                                  | Site: Kyrene de las Brisas Elementary- Main Bldg. |                |                   |                                |
| Homogeneous Material #                                                                                           | Material Description                                | Location(s)                      | ACBM Yes/No/ Assumed                              | Friable Yes/No | Material Category | Approximate Quantity (sq. ft.) |
| Inspection Date: March 11, 2024 - AHERA Building Inspector: Tracey Carpenter ( Certification #4380-14588-091422) |                                                     |                                  |                                                   |                |                   |                                |
| 1                                                                                                                | Blue Pipe Tape                                      | Fire Riser Room/Custodial Office | No                                                | Yes            | TSI               | 20                             |
| 2                                                                                                                | Cream Sealant for Blue Tape                         |                                  | No                                                | No             | M                 |                                |
| Inspection Date: March 11, 2024 - AHERA Building Inspector: Xin Lou ( Certification #ON-4644-548-092323)         |                                                     |                                  |                                                   |                |                   |                                |
| 3                                                                                                                | Gray 12" x 12" Ceramic Floor Tile                   | Kitchen                          | No                                                | No             | M                 | 800                            |
| 4                                                                                                                | Gray Grout for Gray 12" x 12" Ceramic Floor Tile    |                                  | No                                                | No             | M                 |                                |
| 5                                                                                                                | Gray Ceramic Cove Base Tile                         | Kitchen                          | No                                                | No             | M                 | 110                            |
| 6                                                                                                                | Tan Mastic for Gray Ceramic Cove Base Tile          |                                  | No                                                | No             | M                 |                                |
| 7                                                                                                                | White Compound for Gray Ceramic Cove Base Tile      |                                  | No                                                | No             | M                 |                                |
| 8                                                                                                                | Gray Grout for Gray Ceramic Cove Base Tile          |                                  | No                                                | No             | M                 |                                |
| 9                                                                                                                | Orange Peel Drywall System - Tan Paint              | Kitchen                          | No                                                | No             | M                 | 1,500                          |
|                                                                                                                  | White Compound                                      |                                  | No                                                | No             | M                 |                                |
|                                                                                                                  | Tan Paint Layer #2                                  |                                  | No                                                | No             | M                 |                                |
|                                                                                                                  | White Compound Layer #2                             |                                  | No                                                | No             | M                 |                                |
|                                                                                                                  | Tape                                                |                                  | No                                                | No             | M                 |                                |
|                                                                                                                  | Joint Compound                                      |                                  | No                                                | No             | M                 |                                |
|                                                                                                                  | Drywall                                             |                                  | No                                                | No             | M                 |                                |
| 10                                                                                                               | White Fiberglass Reinforced Plastic (FRP)           | Kitchen & Custodial Office       | No                                                | No             | M                 | 110                            |
| 11                                                                                                               | Cream Mastic for FRP                                |                                  | No                                                | No             | M                 |                                |
| 12                                                                                                               | White Counter Caulking                              | Kitchen                          | No                                                | No             | M                 | 10                             |
| 13                                                                                                               | White Sink Caulking                                 | Kitchen                          | No                                                | No             | M                 | 5                              |
| 14                                                                                                               | White Door Frame Caulking                           | Kitchen                          | No                                                | No             | M                 | 10                             |
| 15                                                                                                               | 2' x 2' Ceiling Tile                                | Kitchen-(Removed)                | No                                                | Yes            | M                 | 800                            |
| 16                                                                                                               | Yellow Insulation                                   | Kitchen                          | No                                                | Yes            | M                 | 1,500                          |
| 17                                                                                                               | Silver Backing for Yellow Insulation                |                                  | No                                                | No             | M                 |                                |
| Inspection Date: March 11, 2024 - AHERA Building Inspector: Xin Lou ( Certification #ON-4644-548-092323)         |                                                     |                                  |                                                   |                |                   |                                |
| 18                                                                                                               | Gray 12" x 12" Ceramic Floor Tile                   | Pre-K Classroom Restrooms        | No                                                | No             | M                 | 200                            |
| 19                                                                                                               | Yellow Mastic for Gray 12" x 12" Ceramic Floor Tile |                                  | No                                                | No             | M                 |                                |

**Inspector: Isai Portillo**  
**Certificate Number: ON-188748-19438-121224**  
**State: Arizona**

**KEY:**  
**S = Surfacing**  
**M = Miscellaneous**  
**TSI = Thermal System Insulation**

**Dominion Environmental Consultants, Inc.**  
**AHERA Suspect ACBM Homogeneous Building Materials Inventory List**

| <b>Dominion Project Numbers: AZ1418.11/1418.15/1415.16/1418.35</b>                                                        |                                                   |                                    |                             | <b>Client: Kyrene Elementary School District</b>         |                          |                                       |
|---------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------|------------------------------------|-----------------------------|----------------------------------------------------------|--------------------------|---------------------------------------|
| <b>Inspection Dates: March 11, 2024 + March 3, 2025</b>                                                                   |                                                   |                                    |                             | <b>Site: Kyrene de las Brisas Elementary- Main Bldg.</b> |                          |                                       |
| <b>Homogeneous Material #</b>                                                                                             | <b>Material Description</b>                       | <b>Location(s)</b>                 | <b>ACBM Yes/No/ Assumed</b> | <b>Friable Yes/No</b>                                    | <b>Material Category</b> | <b>Approximate Quantity (sq. ft.)</b> |
| 20                                                                                                                        | Beige 4" x 4" Ceramic Wall Tile                   | Pre-K Classroom Restrooms          | No                          | No                                                       | M                        | 350                                   |
| 21                                                                                                                        | Yellow Mastic for Beige 4" x 4" Ceramic Wall Tile |                                    | No                          | No                                                       | M                        |                                       |
| 22                                                                                                                        | Gray 4" x 4" Ceramic Wall Tile                    | Pre-K Classroom Restrooms          | No                          | No                                                       | M                        | 50                                    |
| 23                                                                                                                        | Yellow Mastic for Gray 4" x 4" Ceramic Wall Tile  |                                    | No                          | No                                                       | M                        |                                       |
| 24                                                                                                                        | Beige Grout for Gray 4" x 4" Ceramic Wall Tile    |                                    | No                          | No                                                       | M                        |                                       |
| 25                                                                                                                        | Gray 2" x 2" Ceramic Floor Tile                   | Restrooms Throughout               | No                          | No                                                       | M                        | 4,000                                 |
| 26                                                                                                                        | Yellow Mastic for Gray 2" x 2" Ceramic Floor Tile |                                    | No                          | No                                                       | M                        |                                       |
| 27                                                                                                                        | Gray Mortar for Gray 2" x 2" Ceramic Floor Tile   |                                    | No                          | No                                                       | M                        |                                       |
| 28                                                                                                                        | Gray Grout for Gray 2" x 2" Ceramic Floor Tile    |                                    | No                          | No                                                       | M                        |                                       |
| 29                                                                                                                        | White Cabinet Caulking                            | Pre-K Classroom Restrooms          | No                          | No                                                       | M                        | 5                                     |
| 30                                                                                                                        | White Fixture Caulking                            | Pre-K Classroom Restrooms          | No                          | No                                                       | M                        | 5                                     |
| 31                                                                                                                        | White Door Frame Caulking                         | Pre-K Classroom Restrooms          | No                          | No                                                       | M                        | 5                                     |
| 32                                                                                                                        | Orange Peel Drywall System - Peach Paint          | Pre-K Classroom Restrooms          | No                          | No                                                       | M                        | 400                                   |
|                                                                                                                           | Texture                                           |                                    | No                          | No                                                       | M                        |                                       |
|                                                                                                                           | Tape                                              |                                    | No                          | No                                                       | M                        |                                       |
|                                                                                                                           | Joint Compound                                    |                                    | No                          | No                                                       | M                        |                                       |
|                                                                                                                           | Drywall                                           |                                    | No                          | No                                                       | M                        |                                       |
| 33                                                                                                                        | Unfinished Drywall System - Peach Paint           | Pre-K Classroom Restrooms          | No                          | No                                                       | M                        | 200                                   |
|                                                                                                                           | Texture                                           |                                    | No                          | No                                                       | M                        |                                       |
|                                                                                                                           | Cream Paint                                       |                                    | No                          | No                                                       | M                        |                                       |
|                                                                                                                           | Drywall                                           |                                    | No                          | No                                                       | M                        |                                       |
| 34                                                                                                                        | 2' x 2' Ceiling Tile                              | Pre-K, Room 21 & Room 50 Restrooms | No                          | Yes                                                      | M                        | 200                                   |
| <b>Inspection Date: March 3, 2025 - AHERA Building Inspector: Isai Portillo ( Certification # ON-188748-19438-121224)</b> |                                                   |                                    |                             |                                                          |                          |                                       |
| 35                                                                                                                        | Off-White 2' x 2' Ceiling Tile                    | Throughout Building                | No                          | Yes                                                      | M                        | 65,000                                |
| 36                                                                                                                        | Blue 4" Cove Base                                 | Classrooms & Offices Throughout    | No                          | No                                                       | M                        | 3,000                                 |
| 37                                                                                                                        | Yellow Mastic for Blue 4" Cove Base               |                                    | No                          | No                                                       | M                        |                                       |
| 38                                                                                                                        | Gray/Blue Carpet Square                           | Classrooms & Offices Throughout    | No                          | No                                                       | M                        | 60,000                                |
| 39                                                                                                                        | Yellow Mastic for Gray/Blue Carpet Square         |                                    | No                          | No                                                       | M                        |                                       |
| 40                                                                                                                        | Black Window Sealant                              | Classroom Windows                  | No                          | No                                                       | M                        | 200                                   |

**Inspector: Isai Portillo**  
**Certificate Number: ON-188748-19438-121224**  
**State: Arizona**

**KEY:**  
**S = Surfacing**  
**M = Miscellaneous**  
**TSI = Thermal System Insulation**

**Dominion Environmental Consultants, Inc.**  
**AHERA Suspect ACBM Homogeneous Building Materials Inventory List**

| <b>Dominion Project Numbers: AZ1418.11/1418.15/1415.16/1418.35</b> |                                                      |                                 |                             | <b>Client: Kyrene Elementary School District</b>         |                          |                                       |
|--------------------------------------------------------------------|------------------------------------------------------|---------------------------------|-----------------------------|----------------------------------------------------------|--------------------------|---------------------------------------|
| <b>Inspection Dates: March 11, 2024 + March 3, 2025</b>            |                                                      |                                 |                             | <b>Site: Kyrene de las Brisas Elementary- Main Bldg.</b> |                          |                                       |
| <b>Homogeneous Material #</b>                                      | <b>Material Description</b>                          | <b>Location(s)</b>              | <b>ACBM Yes/No/ Assumed</b> | <b>Friable Yes/No</b>                                    | <b>Material Category</b> | <b>Approximate Quantity (sq. ft.)</b> |
| 41                                                                 | Light Brown w/ Tan Specs 12" x 12" VCT               | Room 20 & Storage Areas         | No                          | No                                                       | M                        | 20,000                                |
| 42                                                                 | Transparent Mastic for Brown w/ Specs 12" x 12" VCT  |                                 | No                          | No                                                       | M                        |                                       |
| 43                                                                 | White w/ Black Specs 12" x 12" VCT                   | Room 21 & Multipurpose Room     | No                          | No                                                       | M                        | 5,000                                 |
| 44                                                                 | Yellow Mastic for White w/ Black Specs 12" x 12" VCT |                                 | No                          | No                                                       | M                        |                                       |
| 45                                                                 | Gray w/ Tan Specs 12" x 12" VCT                      | Pod 1                           | No                          | No                                                       | M                        | 1,000                                 |
| 46                                                                 | Yellow Mastic for Gray w/ Tan Specs 12" x 12" VCT    |                                 | No                          | No                                                       | M                        |                                       |
| 47                                                                 | White Texture 2' x 2' Ceiling Tile                   | Multipurpose Room               | No                          | Yes                                                      | M                        | 800                                   |
| 48                                                                 | Beige Smooth Vinyl 2' x 2' Ceiling Tile              | Kitchen                         | No                          | Yes                                                      | M                        | 800                                   |
| 49                                                                 | 12"X12" Gray/white Ceramic Floor Tile                | Kitchen                         | No                          | Yes                                                      | M                        | 800                                   |
| 50                                                                 | Grout for 12"X12" Floor Tile                         | Kitchen                         | No                          | Yes                                                      | M                        | 800                                   |
| 51                                                                 | 4" Gray/White Ceramic Cove Base                      | Kitchen                         | No                          | Yes                                                      | M                        | 110                                   |
| 52                                                                 | Grout for 4" Ceramic Cove Base                       | Kitchen                         | No                          | Yes                                                      | M                        | 110                                   |
| <b>ASSUMED ACBM</b>                                                |                                                      |                                 |                             |                                                          |                          |                                       |
| 53                                                                 | Black Weather Stripping                              | Office                          | Assumed                     | No                                                       | M                        | 50                                    |
| 54                                                                 | Gray Metal Door Frame Sealant                        | Exterior Doors                  | Assumed                     | No                                                       | M                        | 20                                    |
| 55                                                                 | Clear 9" x 9" Block Mortar                           | Entryways                       | Assumed                     | No                                                       | M                        | 100                                   |
| 56                                                                 | 2' x 2' Black Carpet Squares                         | Entryways                       | Assumed                     | No                                                       | M                        | 200                                   |
| 57                                                                 | Mastic for 2' x 2' Black Carpet Squares              |                                 | Assumed                     | No                                                       | M                        |                                       |
| 58                                                                 | Counter/Cabinet Caulking                             | Classrooms & Offices Throughout | Assumed                     | No                                                       | M                        | 100                                   |
| 59                                                                 | Gray Sink Coating                                    | Sinks Throughout                | Assumed                     | No                                                       | M                        | 200                                   |
| 60                                                                 | Off-White 4" x 4" Ceramic Wall Tile                  | Restrooms Throughout            | Assumed                     | No                                                       | M                        | 8,000                                 |
| 61                                                                 | Gray 4" x 4" Ceramic Wall Tile                       |                                 | Assumed                     | No                                                       | M                        | 1,000                                 |
| 62                                                                 | Black 4" x 4" Ceramic Wall Tile                      |                                 | Assumed                     | No                                                       | M                        | 500                                   |
| 63                                                                 | Grout for 4" x 4" Ceramic Wall Tiles                 |                                 | Assumed                     | No                                                       | M                        | 950                                   |
| 64                                                                 | Mastic for 4" x 4" Ceramic Wall Tiles                |                                 | Assumed                     | No                                                       | M                        | 9,500                                 |
| 65                                                                 | Navy Blue Cove Base Tile                             | Restrooms Throughout            | Assumed                     | No                                                       | M                        | 1,000                                 |
| 66                                                                 | Grout for Navy Blue Cove Base Tile                   |                                 | Assumed                     | No                                                       | M                        | 100                                   |
| 67                                                                 | Mastic for Navy Blue Cove Base Tile                  |                                 | Assumed                     | No                                                       | M                        | 1,000                                 |
| 68                                                                 | Fixture Caulking                                     | Restrooms Throughout            | Assumed                     | No                                                       | M                        | 200                                   |

**Inspector: Isai Portillo**  
**Certificate Number: ON-188748-19438-121224**  
**State: Arizona**

**KEY:**  
**S = Surfacing**  
**M = Miscellaneous**  
**TSI = Thermal System Insulation**

**Dominion Environmental Consultants, Inc.**  
**AHERA Suspect ACBM Homogeneous Building Materials Inventory List**

| Dominion Project Numbers: AZ1418.11/1418.15/1415.16/1418.35 |                                                     |                                             |                      | Client: Kyrene Elementary School District         |                   |                                |
|-------------------------------------------------------------|-----------------------------------------------------|---------------------------------------------|----------------------|---------------------------------------------------|-------------------|--------------------------------|
| Inspection Dates: March 11, 2024 + March 3, 2025            |                                                     |                                             |                      | Site: Kyrene de las Brisas Elementary- Main Bldg. |                   |                                |
| Homogeneous Material #                                      | Material Description                                | Location(s)                                 | ACBM Yes/No/ Assumed | Friable Yes/No                                    | Material Category | Approximate Quantity (sq. ft.) |
| 69                                                          | Gray 4" Cove Base                                   | Custodial Office                            | Assumed              | No                                                | M                 | 100                            |
| 70                                                          | Mastic for Gray 4" Cove Base                        |                                             | Assumed              | No                                                | M                 |                                |
| 71                                                          | Mop Sink Caulking                                   | Custodial Office                            | Assumed              | No                                                | M                 | 10                             |
| 72                                                          | White Pipe Wrap/Coating for Insulation              | Above Ceiling Grid                          | Assumed              | No                                                | TSI               | 500                            |
| 73                                                          | 4" x 4" Light Pink Ceramic Wall Tile                | Room 20 Restroom                            | Assumed              | No                                                | M                 | 200                            |
| 74                                                          | Grout for 4" x 4" Light Pink Ceramic Wall Tile      |                                             | Assumed              | No                                                | M                 | 20                             |
| 75                                                          | Mastic for 4" x 4" Light Pink Ceramic Wall Tile     |                                             | Assumed              | No                                                | M                 | 200                            |
| 76                                                          | Gray Granite Countertop                             | Room 21 & Room 50 Restrooms                 | Assumed              | No                                                | M                 | 20                             |
| 77                                                          | Smooth Drywall System                               | Electrical Room (Inside Boy's RR)           | Assumed              | No                                                | M                 | 700                            |
| 78                                                          | White 4" x 4" Ceramic Wall Tile                     | Water Fountain Area<br>(Near Rooms 14 & 64) | Assumed              | No                                                | M                 | 60                             |
| 79                                                          | Grout for White 4" x 4" Ceramic Wall Tile           |                                             | Assumed              | No                                                | M                 | 6                              |
| 80                                                          | Mastic for White 4" x 4" Ceramic Wall Tile          |                                             | Assumed              | No                                                | M                 | 60                             |
| 81                                                          | Tac Board                                           | Hallways & Pods<br>Throughout Building      | Assumed              | No                                                | M                 | 8,200                          |
| 82                                                          | Wrap for Tac Board                                  |                                             | Assumed              | No                                                | M                 |                                |
| 83                                                          | Silver Sink Caulking                                | Kitchen                                     | Assumed              | No                                                | M                 | 10                             |
| 84                                                          | Red 12" x 12" VCT                                   | Kitchen                                     | Assumed              | No                                                | M                 | 20                             |
| 85                                                          | Blue 12" x 12" VCT                                  |                                             | Assumed              | No                                                | M                 | 20                             |
| 86                                                          | Green 12" x 12" VCT                                 |                                             | Assumed              | No                                                | M                 | 20                             |
| 87                                                          | Yellow 12" x 12" VCT                                |                                             | Assumed              | No                                                | M                 | 20                             |
| 88                                                          | Mastic for Red, Blue, Green, & Yellow 12" x 12" VCT |                                             | Assumed              | No                                                | M                 | 80                             |
| 89                                                          | Brown Door/Window Frame Sealant                     | Multipurpose Room                           | Assumed              | No                                                | M                 | 40                             |
| 90                                                          | 6" Black Cove Base                                  | Multipurpose Room & Stage                   | Assumed              | No                                                | M                 | 50                             |
| 91                                                          | Black 4" Cove Base                                  | Multipurpose Room                           | Assumed              | No                                                | M                 | 250                            |
| 92                                                          | Mastic for Black Cove Base                          |                                             | Assumed              | No                                                | M                 |                                |
| 93                                                          | 48" x 12" Black Vinyl                               | Multipurpose Room/Stage Stairs              | Assumed              | No                                                | M                 | 300                            |
| 94                                                          | Mastic for 48" x 12" Black Vinyl                    |                                             | Assumed              | No                                                | M                 |                                |
| 95                                                          | Brown 16" x 4" Decorative Block                     | Multipurpose Room/Stage Stairs              | Assumed              | No                                                | M                 | 500                            |
| 96                                                          | Mortar for Brown 16" x 4" Decorative Block          |                                             | Assumed              | No                                                | M                 |                                |

**Inspector: Isai Portillo**  
**Certificate Number: ON-188748-19438-121224**  
**State: Arizona**

**KEY:**  
**S = Surfacing**  
**M = Miscellaneous**  
**TSI = Thermal System Insulation**

**Dominion Environmental Consultants, Inc.**  
**AHERA Suspect ACBM Homogeneous Building Materials Inventory List**

| <b>Dominion Project Numbers: AZ1418.11/1418.15/1415.16/1418.35</b> |                                 |                    |                             | <b>Client: Kyrene Elementary School District</b>         |                          |                                       |
|--------------------------------------------------------------------|---------------------------------|--------------------|-----------------------------|----------------------------------------------------------|--------------------------|---------------------------------------|
| <b>Inspection Dates: March 11, 2024 + March 3, 2025</b>            |                                 |                    |                             | <b>Site: Kyrene de las Brisas Elementary- Main Bldg.</b> |                          |                                       |
| <b>Homogeneous Material #</b>                                      | <b>Material Description</b>     | <b>Location(s)</b> | <b>ACBM Yes/No/ Assumed</b> | <b>Friable Yes/No</b>                                    | <b>Material Category</b> | <b>Approximate Quantity (sq. ft.)</b> |
| 97                                                                 | Brown 16" x 8" Block            | Multipurpose Room  | Assumed                     | No                                                       | M                        | 13,000                                |
| 98                                                                 | Mortar for Brown 16" x 8" Block |                    | Assumed                     | No                                                       | M                        |                                       |
| 99                                                                 | Gray Duct Mastic                | Above Ceiling Grid | Assumed                     | No                                                       | M                        | 400                                   |
| 100                                                                | Silver Flex Duct Wrap           |                    | Assumed                     | No                                                       | M                        | 1,000                                 |
| 101                                                                | Silver Duct Wrap                |                    | Assumed                     | No                                                       | M                        | 1,500                                 |
| 102                                                                | Red Fire Stop Caulking          |                    | Assumed                     | No                                                       | M                        | 100                                   |
| 103                                                                | Ceiling Insulation Wrap         |                    | Assumed                     | No                                                       | M                        | 20,000                                |
| 104                                                                | Black Foam Pipe Insulation      |                    | Assumed                     | No                                                       | TSI                      | 300                                   |
| 105                                                                | Black HVAC Damper               |                    | Assumed                     | No                                                       | M                        | 200                                   |

**Inspector: Isai Portillo**  
**Certificate Number: ON-188748-19438-121224**  
**State: Arizona**

**KEY:**  
**S = Surfacing**  
**M = Miscellaneous**  
**TSI = Thermal System Insulation**

**Dominion Environmental Consultants, Inc.**  
**AHERA Suspect ACBM Homogeneous Building Materials Inventory List**

| Dominion Project Number(s): AZ1418.35                                                                              |                                                  |                                 | Client: Kyrene Elementary School District       |                |                   |                    |
|--------------------------------------------------------------------------------------------------------------------|--------------------------------------------------|---------------------------------|-------------------------------------------------|----------------|-------------------|--------------------|
| Inspection Date(s): March 3, 2025                                                                                  |                                                  |                                 | Site: Kyrene de las Brisas Elementary - Library |                |                   |                    |
| Homogeneous Material #                                                                                             | Material Description                             | Location(s)                     | ACBM Yes/No/ Assumed                            | Friable Yes/No | Material Category | Quantity (sq. ft.) |
| Inspection Date: March 3, 2025 - AHERA Building Inspector: Isai Portillo ( Certification # ON-188748-19438-121224) |                                                  |                                 |                                                 |                |                   |                    |
| 1                                                                                                                  | Blue 4" Cove Base                                | Throughout Library              | No                                              | No             | M                 | 150                |
| 2                                                                                                                  | Beige Mastic for Blue 4" Cove Base               |                                 | No                                              | No             | M                 |                    |
| 3                                                                                                                  | White Rough Texture 2' x 2' Ceiling Tile         | Library South Section & Offices | No                                              | Yes            | M                 | 1,200              |
| 4                                                                                                                  | White 2' x 2' Ceiling Tile                       | Library North Section           | No                                              | Yes            | M                 | 2,400              |
| 5                                                                                                                  | Orange Peel Drywall System - White Paint         | Throughout Library              | No                                              | No             | M                 | 7,000              |
|                                                                                                                    | Texture                                          |                                 | No                                              | No             | M                 |                    |
|                                                                                                                    | Tape                                             |                                 | No                                              | No             | M                 |                    |
|                                                                                                                    | Joint Compound                                   |                                 | No                                              | No             | M                 |                    |
|                                                                                                                    | Drywall                                          |                                 | No                                              | No             | M                 |                    |
| 6                                                                                                                  | Gray/Blue Carpet Square                          | Throughout Library              | No                                              | No             | M                 | 6,600              |
| 7                                                                                                                  | Yellow Mastic for Gray/Blue Carpet Square        |                                 | No                                              | No             | M                 |                    |
| 8                                                                                                                  | Brown Sheet Flooring for Gray/Blue Carpet Square |                                 | No                                              | No             | M                 |                    |
| ASSUMED ACBM                                                                                                       |                                                  |                                 |                                                 |                |                   |                    |
| 9                                                                                                                  | Gray Sink Coating                                | Sinks Throughout                | Assumed                                         | No             | M                 | 5                  |
| 10                                                                                                                 | Tac Board                                        | Throughout Library              | Assumed                                         | No             | M                 | 800                |
| 11                                                                                                                 | Wrap for Tac Board                               |                                 | Assumed                                         | No             | M                 |                    |
| 12                                                                                                                 | Counter/Cabinet Caulking                         | Throughout Library              | Assumed                                         | No             | M                 | 5                  |
| 13                                                                                                                 | Black Window Sealant                             | Windows Throughout              | Assumed                                         | No             | M                 | 20                 |
| 14                                                                                                                 | Clear 9" x 9" Block Grout                        | Entryways                       | Assumed                                         | No             | M                 | 20                 |
| 15                                                                                                                 | White Door Sealant                               | Entryway Doors                  | Assumed                                         | No             | M                 | 40                 |
| 16                                                                                                                 | Gray Duct Mastic                                 | Above Ceiling Grid              | Assumed                                         | No             | M                 | 50                 |
| 17                                                                                                                 | Silver Wrap for Flex Duct Insulation             |                                 | Assumed                                         | No             | M                 | 100                |
| 18                                                                                                                 | Silver Wrap for Duct Insulation                  |                                 | Assumed                                         | No             | M                 | 200                |
| 19                                                                                                                 | Unfinished Drywall                               |                                 | Assumed                                         | No             | M                 | 2,100              |

**Inspector: Isai Portillo**  
**Certificate Number: ON-188748-19438-121224**  
**State: Arizona**

**KEY:**  
**S = Surfacing**  
**M = Miscellaneous**  
**TSI = Thermal System Insulation**

## SECTION 6



## PLM BULK SAMPLE SHEETS

**Dominion Environmental Consultants, Inc.**  
**AHERA PLM Bulk Sample Summary**

| Dominion Project Numbers: AZ1418.11/1418.15/1415.16/1418.35                                                     |     |                                                | Client: Kyrene Elementary School District             |                    |                  |
|-----------------------------------------------------------------------------------------------------------------|-----|------------------------------------------------|-------------------------------------------------------|--------------------|------------------|
| Sample Dates: March 11, 2024 + March 3, 2025                                                                    |     |                                                | Site: Kyrene de las Brisas Elementary - Main Building |                    |                  |
| Sample Number                                                                                                   | HM# | Material Description                           | Sample Location                                       | Manner of Sampling | Asbestos Content |
| Sample Date: March 11, 2024 - AHERA Building Inspector: Tracey Carpenter ( Certification #ON-4644-14588-090523) |     |                                                |                                                       |                    |                  |
| AZ1418.11-PLM-1                                                                                                 | 1   | Blue Tape                                      | Fire Riser/Custodial Office - Southwest               | Convenient         | None Detected    |
|                                                                                                                 | 2   | Cream Sealant for Blue Tape                    |                                                       | Convenient         | None Detected    |
| AZ1418.11-PLM-2                                                                                                 | 1   | Blue Tape                                      | Fire Riser/Custodial Office - Southwest               | Convenient         | None Detected    |
|                                                                                                                 | 2   | Cream Sealant for Blue Tape                    |                                                       | Convenient         | None Detected    |
| AZ1418.11-PLM-3                                                                                                 | 1   | Blue Tape                                      | Fire Riser/Custodial Office - Southwest               | Convenient         | None Detected    |
|                                                                                                                 | 2   | Cream Sealant for Blue Tape                    |                                                       | Convenient         | None Detected    |
| Sample Date: March 11, 2024 - AHERA Building Inspector: Xin Lou ( Certification #ON-4644-548-092323)            |     |                                                |                                                       |                    |                  |
| AZ1418.15-PLM-1                                                                                                 | 3   | Gray 12" x 12" Ceramic Floor Tile              | Kitchen - West                                        | Convenient         | None Detected    |
| AZ1418.15-PLM-2                                                                                                 |     | Gray 12" x 12" Ceramic Floor Tile              | Kitchen - Northeast                                   | Convenient         | None Detected    |
| AZ1418.15-PLM-3                                                                                                 |     | Gray 12" x 12" Ceramic Floor Tile              | Kitchen - Southeast                                   | Convenient         | None Detected    |
| AZ1418.15-PLM-4                                                                                                 | 4   | Gray Grout                                     | Kitchen - West                                        | Convenient         | None Detected    |
| AZ1418.15-PLM-5                                                                                                 |     | Gray Grout                                     | Kitchen - Northeast                                   | Convenient         | None Detected    |
| AZ1418.15-PLM-6                                                                                                 |     | Gray Grout                                     | Kitchen - Southeast                                   | Convenient         | None Detected    |
| AZ1418.15-PLM-7                                                                                                 | 5   | Gray Ceramic Cove Base Tile                    | Kitchen - North                                       | Convenient         | None Detected    |
|                                                                                                                 | 6   | Tan Mastic for Gray Ceramic Cove Base Tile     |                                                       | Convenient         | None Detected    |
|                                                                                                                 | 7   | White Compound for Gray Ceramic Cove Base Tile |                                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-8                                                                                                 | 5   | Gray Ceramic Cove Base Tile                    | Kitchen - Southwest                                   | Convenient         | None Detected    |
|                                                                                                                 | 6   | Tan Mastic for Gray Ceramic Cove Base Tile     |                                                       | Convenient         | None Detected    |
|                                                                                                                 | 7   | White Compound for Gray Ceramic Cove Base Tile |                                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-9                                                                                                 | 5   | Gray Ceramic Cove Base Tile                    | Kitchen - East                                        | Convenient         | None Detected    |
|                                                                                                                 | 6   | Tan Mastic for Gray Ceramic Cove Base Tile     |                                                       | Convenient         | None Detected    |
|                                                                                                                 | 7   | White Compound for Gray Ceramic Cove Base Tile |                                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-10                                                                                                | 8   | Gray Grout                                     | Kitchen - North                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-11                                                                                                |     | Gray Grout                                     | Kitchen - Southwest                                   | Convenient         | None Detected    |
| AZ1418.15-PLM-12                                                                                                |     | Gray Grout                                     | Kitchen - East                                        | Convenient         | None Detected    |

Inspector: Isai Portillo

Certificate Number: ON-188748-19438-121224

State: Arizona



**Dominion Environmental Consultants, Inc.**  
**AHERA PLM Bulk Sample Summary**

| Dominion Project Numbers: AZ1418.11/1418.15/1415.16/1418.35 |     |                                        | Client: Kyrene Elementary School District             |                    |                  |
|-------------------------------------------------------------|-----|----------------------------------------|-------------------------------------------------------|--------------------|------------------|
| Sample Dates: March 11, 2024 + March 3, 2025                |     |                                        | Site: Kyrene de las Brisas Elementary - Main Building |                    |                  |
| Sample Number                                               | HM# | Material Description                   | Sample Location                                       | Manner of Sampling | Asbestos Content |
| AZ1418.15-PLM-13                                            | 9   | Orange Peel Drywall System - Tan Paint | Kitchen - Northwest                                   | Convenient         | None Detected    |
|                                                             |     | White Compound                         |                                                       | Convenient         | None Detected    |
|                                                             |     | Tan Paint Layer #2                     |                                                       | Convenient         | None Detected    |
|                                                             |     | White Compound Layer #2                |                                                       | Convenient         | None Detected    |
|                                                             |     | Tape                                   |                                                       | Convenient         | None Detected    |
|                                                             |     | Joint Compound                         |                                                       | Convenient         | None Detected    |
|                                                             |     | Drywall                                |                                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-14                                            | 9   | Orange Peel Drywall System - Tan Paint | Kitchen - Northeast                                   | Convenient         | None Detected    |
|                                                             |     | White Compound                         |                                                       | Convenient         | None Detected    |
|                                                             |     | Tan Paint Layer #2                     |                                                       | Convenient         | None Detected    |
|                                                             |     | White Compound Layer #2                |                                                       | Convenient         | None Detected    |
|                                                             |     | Tape                                   |                                                       | Convenient         | None Detected    |
|                                                             |     | Joint Compound                         |                                                       | Convenient         | None Detected    |
|                                                             |     | Drywall                                |                                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-15                                            | 9   | Orange Peel Drywall System - Tan Paint | Kitchen - Southeast                                   | Convenient         | None Detected    |
|                                                             |     | White Compound                         |                                                       | Convenient         | None Detected    |
|                                                             |     | Tan Paint Layer #2                     |                                                       | Convenient         | None Detected    |
|                                                             |     | White Compound Layer #2                |                                                       | Convenient         | None Detected    |
|                                                             |     | Tape                                   |                                                       | Convenient         | None Detected    |
|                                                             |     | Joint Compound                         |                                                       | Convenient         | None Detected    |
|                                                             |     | Drywall                                |                                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-16                                            | 10  | White Fiberglass Reinforced Plastic    | Kitchen - Northwest                                   | Convenient         | None Detected    |
|                                                             | 11  | Cream Mastic for FRP                   |                                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-17                                            | 10  | White Fiberglass Reinforced Plastic    | Kitchen - Northeast                                   | Convenient         | None Detected    |
|                                                             | 11  | Cream Mastic for FRP                   |                                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-18                                            | 10  | White Fiberglass Reinforced Plastic    | Kitchen - Southeast                                   | Convenient         | None Detected    |
|                                                             | 11  | Cream Mastic for FRP                   |                                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-19                                            | 12  | White Counter Caulking                 | Kitchen - North                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-20                                            |     | White Counter Caulking                 | Kitchen - Northeast                                   | Convenient         | None Detected    |
| AZ1418.15-PLM-21                                            |     | White Counter Caulking                 | Kitchen - Southeast                                   | Convenient         | None Detected    |

Inspector: Isai Portillo

Certificate Number: ON-188748-19438-121224

State: Arizona



**Dominion Environmental Consultants, Inc.**  
**AHERA PLM Bulk Sample Summary**

| Dominion Project Numbers: AZ1418.11/1418.15/1415.16/1418.35                                          |     |                                                   | Client: Kyrene Elementary School District             |                    |                  |
|------------------------------------------------------------------------------------------------------|-----|---------------------------------------------------|-------------------------------------------------------|--------------------|------------------|
| Sample Dates: March 11, 2024 + March 3, 2025                                                         |     |                                                   | Site: Kyrene de las Brisas Elementary - Main Building |                    |                  |
| Sample Number                                                                                        | HM# | Material Description                              | Sample Location                                       | Manner of Sampling | Asbestos Content |
| AZ1418.15-PLM-22                                                                                     | 13  | White Sink Caulking                               | Kitchen - North                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-23                                                                                     |     | White Sink Caulking                               | Kitchen - South                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-24                                                                                     |     | White Sink Caulking                               | Kitchen - South                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-25                                                                                     | 14  | White Door Frame Caulking                         | Kitchen - North                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-26                                                                                     |     | White Door Frame Caulking                         | Kitchen - North                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-27                                                                                     |     | White Door Frame Caulking                         | Kitchen - South                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-28                                                                                     | 15  | 2' x 2' Ceiling Tile                              | Kitchen - Center North                                | Convenient         | None Detected    |
| AZ1418.15-PLM-29                                                                                     |     | 2' x 2' Ceiling Tile                              | Kitchen - Center Southwest                            | Convenient         | None Detected    |
| AZ1418.15-PLM-30                                                                                     |     | 2' x 2' Ceiling Tile                              | Kitchen - Center Southeast                            | Convenient         | None Detected    |
| AZ1418.15-PLM-31                                                                                     | 16  | Yellow Insulation                                 | Kitchen - Center North                                | Convenient         | None Detected    |
|                                                                                                      | 17  | Silver Backing for Yellow Insulation              |                                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-32                                                                                     | 16  | Yellow Insulation                                 | Kitchen - Center Southwest                            | Convenient         | None Detected    |
|                                                                                                      | 17  | Silver Backing for Yellow Insulation              |                                                       | Convenient         | None Detected    |
| AZ1418.15-PLM-33                                                                                     | 16  | Yellow Insulation                                 | Kitchen -Center Southeast                             | Convenient         | None Detected    |
|                                                                                                      | 17  | Silver Backing for Yellow Insulation              |                                                       | Convenient         | None Detected    |
| Sample Date: March 11, 2024 - AHERA Building Inspector: Xin Lou ( Certification #ON-4644-548-092323) |     |                                                   |                                                       |                    |                  |
| AZ1418.16-PLM-1                                                                                      | 18  | Blue 4" x 4" Ceramic Wall Tile                    | Pre K Room 11 RR Southeast                            | Convenient         | None Detected    |
|                                                                                                      | 19  | Yellow Mastic for Blue 4" x 4" Ceramic Wall Tile  |                                                       | Convenient         | None Detected    |
| AZ1418.16-PLM-2                                                                                      | 18  | Blue 4" x 4" Ceramic Wall Tile                    | Pre K Room 11 RR Southwest                            | Convenient         | None Detected    |
|                                                                                                      | 19  | Yellow Mastic for Blue 4" x 4" Ceramic Wall Tile  |                                                       | Convenient         | None Detected    |
| AZ1418.16-PLM-3                                                                                      | 18  | Blue 4" x 4" Ceramic Wall Tile                    | Pre K Room 10 RR North                                | Convenient         | None Detected    |
|                                                                                                      | 19  | Yellow Mastic for Blue 4" x 4" Ceramic Wall Tile  |                                                       | Convenient         | None Detected    |
| AZ1418.16-PLM-4                                                                                      | 20  | Beige 4" x 4" Ceramic Wall Tile                   | Pre K Room 11 RR Southeast                            | Convenient         | None Detected    |
|                                                                                                      | 21  | Yellow Mastic for Beige 4" x 4" Ceramic Wall Tile |                                                       | Convenient         | None Detected    |
| AZ1418.16-PLM-5                                                                                      | 20  | Beige 4" x 4" Ceramic Wall Tile                   | Pre K Room 11 RR Southwest                            | Convenient         | None Detected    |
|                                                                                                      | 21  | Yellow Mastic for Beige 4" x 4" Ceramic Wall Tile |                                                       | Convenient         | None Detected    |
| AZ1418.16-PLM-6                                                                                      | 20  | Beige 4" x 4" Ceramic Wall Tile                   | Pre K Room 10 RR North                                | Convenient         | None Detected    |
|                                                                                                      | 21  | Yellow Mastic for Beige 4" x 4" Ceramic Wall Tile |                                                       | Convenient         | None Detected    |
| AZ1418.16-PLM-7                                                                                      | 22  | Gray 4" x 4" Ceramic Wall Tile                    | Pre K Room 11 RR Southeast                            | Convenient         | None Detected    |
|                                                                                                      | 23  | Yellow Mastic for Gray 4" x 4" Ceramic Wall Tile  |                                                       | Convenient         | None Detected    |

**Dominion Environmental Consultants, Inc.**  
**AHERA PLM Bulk Sample Summary**

| Dominion Project Numbers: AZ1418.11/1418.15/1415.16/1418.35 |     |                                                   | Client: Kyrene Elementary School District             |                    |                  |
|-------------------------------------------------------------|-----|---------------------------------------------------|-------------------------------------------------------|--------------------|------------------|
| Sample Dates: March 11, 2024 + March 3, 2025                |     |                                                   | Site: Kyrene de las Brisas Elementary - Main Building |                    |                  |
| Sample Number                                               | HM# | Material Description                              | Sample Location                                       | Manner of Sampling | Asbestos Content |
| AZ1418.16-PLM-8                                             | 22  | Gray 4" x 4" Ceramic Wall Tile                    | Pre K Room 11 RR Southwest                            | Convenient         | None Detected    |
|                                                             | 23  | Yellow Mastic for Gray 4" x 4" Ceramic Wall Tile  |                                                       | Convenient         | None Detected    |
| AZ1418.16-PLM-9                                             | 22  | Gray 4" x 4" Ceramic Wall Tile                    | Pre K Room 10 RR North                                | Convenient         | None Detected    |
|                                                             | 23  | Yellow Mastic for Gray 4" x 4" Ceramic Wall Tile  |                                                       | Convenient         | None Detected    |
| AZ1418.16-PLM-10                                            | 24  | Beige Grout                                       | Pre K Room 11 RR Southeast                            | Convenient         | None Detected    |
| AZ1418.16-PLM-11                                            |     | Beige Grout                                       | Pre K Room 11 RR Southwest                            | Convenient         | None Detected    |
| AZ1418.16-PLM-12                                            |     | Beige Grout                                       | Pre K Room 10 RR North                                | Convenient         | None Detected    |
| AZ1418.16-PLM-13                                            | 25  | Gray 2" x 2" Ceramic Floor Tile                   | Pre K Room 11 RR Southeast                            | Convenient         | None Detected    |
|                                                             | 26  | Yellow Mastic for Gray 2" x 2" Ceramic Floor Tile |                                                       | Convenient         | None Detected    |
|                                                             | 27  | Gray Mortar for Gray 2" x 2" Ceramic Floor Tile   |                                                       | Convenient         | None Detected    |
| AZ1418.16-PLM-14                                            | 25  | Gray 2" x 2" Ceramic Floor Tile                   | Pre K Room 11 RR Southwest                            | Convenient         | None Detected    |
|                                                             | 26  | Gray Mortar for Gray 2" x 2" Ceramic Floor Tile   |                                                       | Convenient         | None Detected    |
| AZ1418.16-PLM-15                                            | 25  | Gray 2" x 2" Ceramic Floor Tile                   | Pre K Room 10 RR North                                | Convenient         | None Detected    |
|                                                             | 26  | Yellow Mastic for Gray 2" x 2" Ceramic Floor Tile |                                                       | Convenient         | None Detected    |
|                                                             | 27  | Gray Mortar for Gray 2" x 2" Ceramic Floor Tile   |                                                       | Convenient         | None Detected    |
| AZ1418.16-PLM-16                                            | 28  | Gray Grout                                        | Pre K Room 11 RR Southeast                            | Convenient         | None Detected    |
| AZ1418.16-PLM-17                                            |     | Gray Grout                                        | Pre K Room 11 RR Southwest                            | Convenient         | None Detected    |
| AZ1418.16-PLM-18                                            |     | Gray Grout                                        | Pre K Room 10 RR North                                | Convenient         | None Detected    |
| AZ1418.16-PLM-19                                            | 29  | White Cabinet Caulking                            | Pre K Room 11 RR East                                 | Convenient         | None Detected    |
| AZ1418.16-PLM-20                                            |     | White Cabinet Caulking                            | Pre K Room 11 RR East                                 | Convenient         | None Detected    |
| AZ1418.16-PLM-21                                            |     | White Cabinet Caulking                            | Pre K Room 10 RR Northwest                            | Convenient         | None Detected    |
| AZ1418.16-PLM-22                                            | 30  | White Fixture Caulking                            | Pre K Room 11 RR East                                 | Convenient         | None Detected    |
| AZ1418.16-PLM-23                                            |     | White Fixture Caulking                            | Pre K Room 10 RR Southwest                            | Convenient         | None Detected    |
| AZ1418.16-PLM-24                                            |     | White Fixture Caulking                            | Pre K Room 10 RR Southwest                            | Convenient         | None Detected    |
| AZ1418.16-PLM-25                                            | 31  | White Door Frame Caulking                         | Pre K Room 11 RR Northwest                            | Convenient         | None Detected    |
| AZ1418.16-PLM-26                                            |     | White Door Frame Caulking                         | Pre K Room 11 RR Northwest                            | Convenient         | None Detected    |
| AZ1418.16-PLM-27                                            |     | White Door Frame Caulking                         | Pre K Room 10 RR Northeast                            | Convenient         | None Detected    |

Inspector: Isai Portillo

Certificate Number: ON-188748-19438-121224

State: Arizona



**Dominion Environmental Consultants, Inc.**  
**AHERA PLM Bulk Sample Summary**

| <b>Dominion Project Numbers: AZ1418.11/1418.15/1415.16/1418.35</b> |            |                                          | <b>Client: Kyrene Elementary School District</b>             |                           |                         |
|--------------------------------------------------------------------|------------|------------------------------------------|--------------------------------------------------------------|---------------------------|-------------------------|
| <b>Sample Dates: March 11, 2024 + March 3, 2025</b>                |            |                                          | <b>Site: Kyrene de las Brisas Elementary - Main Building</b> |                           |                         |
| <b>Sample Number</b>                                               | <b>HM#</b> | <b>Material Description</b>              | <b>Sample Location</b>                                       | <b>Manner of Sampling</b> | <b>Asbestos Content</b> |
| AZ1418.16-PLM-28                                                   | 32         | Orange Peel Drywall System - Peach Paint | Pre K Room 11 RR Southeast                                   | Convenient                | None Detected           |
|                                                                    |            | Texture                                  |                                                              | Convenient                | None Detected           |
|                                                                    |            | Peach Paint Layer #2                     |                                                              | Convenient                | None Detected           |
|                                                                    |            | Texture Layer #2                         |                                                              | Convenient                | None Detected           |
|                                                                    |            | Tape                                     |                                                              | Convenient                | None Detected           |
|                                                                    |            | Joint Compound                           |                                                              | Convenient                | None Detected           |
|                                                                    |            | Drywall                                  |                                                              | Convenient                | None Detected           |
| AZ1418.16-PLM-29                                                   | 32         | Orange Peel Drywall System - Peach Paint | Pre K Room 11 RR Southwest                                   | Convenient                | None Detected           |
|                                                                    |            | Texture                                  |                                                              | Convenient                | None Detected           |
|                                                                    |            | Peach Paint Layer #2                     |                                                              | Convenient                | None Detected           |
|                                                                    |            | Texture Layer #2                         |                                                              | Convenient                | None Detected           |
|                                                                    |            | Tape                                     |                                                              | Convenient                | None Detected           |
|                                                                    |            | Joint Compound                           |                                                              | Convenient                | None Detected           |
|                                                                    |            | Drywall                                  |                                                              | Convenient                | None Detected           |
| AZ1418.16-PLM-30                                                   | 32         | Orange Peel Drywall System - Peach Paint | Pre K Room 10 RR North                                       | Convenient                | None Detected           |
|                                                                    |            | Texture                                  |                                                              | Convenient                | None Detected           |
|                                                                    |            | Peach Paint Layer #2                     |                                                              | Convenient                | None Detected           |
|                                                                    |            | Texture Layer #2                         |                                                              | Convenient                | None Detected           |
|                                                                    |            | Tape                                     |                                                              | Convenient                | None Detected           |
|                                                                    |            | Joint Compound                           |                                                              | Convenient                | None Detected           |
|                                                                    |            | Drywall                                  |                                                              | Convenient                | None Detected           |
| AZ1418.16-PLM-31                                                   | 33         | Unfinished Drywall System - Peach Paint  | Pre K Room 11 RR Southeast                                   | Convenient                | None Detected           |
|                                                                    |            | Texture                                  |                                                              | Convenient                | None Detected           |
|                                                                    |            | Drywall                                  |                                                              | Convenient                | None Detected           |
| AZ1418.16-PLM-32                                                   | 33         | Unfinished Drywall System - Peach Paint  | Pre K Room 11 RR Southwest                                   | Convenient                | None Detected           |
|                                                                    |            | Texture                                  |                                                              | Convenient                | None Detected           |
|                                                                    |            | Texture Layer #2                         |                                                              | Convenient                | None Detected           |
|                                                                    |            | Drywall                                  |                                                              | Convenient                | None Detected           |

**Dominion Environmental Consultants, Inc.**  
**AHERA PLM Bulk Sample Summary**

| Dominion Project Numbers: AZ1418.11/1418.15/1415.16/1418.35                                                    |     |                                                          | Client: Kyrene Elementary School District             |                    |                  |
|----------------------------------------------------------------------------------------------------------------|-----|----------------------------------------------------------|-------------------------------------------------------|--------------------|------------------|
| Sample Dates: March 11, 2024 + March 3, 2025                                                                   |     |                                                          | Site: Kyrene de las Brisas Elementary - Main Building |                    |                  |
| Sample Number                                                                                                  | HM# | Material Description                                     | Sample Location                                       | Manner of Sampling | Asbestos Content |
| AZ1418.16-PLM-33                                                                                               | 33  | Unfinished Drywall System - Cream Paint                  | Pre K Room 10 RR North                                | Convenient         | None Detected    |
|                                                                                                                |     | Texture                                                  |                                                       | Convenient         | None Detected    |
|                                                                                                                |     | Peach Paint Layer                                        |                                                       | Convenient         | None Detected    |
|                                                                                                                |     | Texture Layer #2                                         |                                                       | Convenient         | None Detected    |
|                                                                                                                |     | Drywall                                                  |                                                       | Convenient         | None Detected    |
| AZ1418.16-PLM-34                                                                                               | 34  | 2' x 2' Ceiling Tile                                     | Pre K Room 11 RR Center                               | Convenient         | None Detected    |
| AZ1418.16-PLM-35                                                                                               |     | 2' x 2' Ceiling Tile                                     | Pre K Room 11 RR Center                               | Convenient         | None Detected    |
| AZ1418.16-PLM-36                                                                                               |     | 2' x 2' Ceiling Tile                                     | Pre K Room 10 RR Center                               | Convenient         | None Detected    |
| Sample Date: March 3, 2025 - AHERA Building Inspector: Isai Portillo ( Certification # ON-188748-19438-121224) |     |                                                          |                                                       |                    |                  |
| AZ1418.35-PLM-1                                                                                                | 35  | Off-White 2' x 2' Ceiling Tile                           | Room 55 - Northwest                                   | Random             | None Detected    |
| AZ1418.35-PLM-2                                                                                                |     | Off-White 2' x 2' Ceiling Tile                           | Office - Northeast                                    | Random             | None Detected    |
| AZ1418.35-PLM-3                                                                                                |     | Off-White 2' x 2' Ceiling Tile                           | Room 62 - Northeast                                   | Random             | None Detected    |
| AZ1418.35-PLM-4                                                                                                | 36  | White 2' x 2' Ceiling Tile                               | Room 35 - South                                       | Random             | None Detected    |
| AZ1418.35-PLM-5                                                                                                |     | White 2' x 2' Ceiling Tile                               | Room 51 - Southeast                                   | Random             | None Detected    |
| AZ1418.35-PLM-6                                                                                                |     | White 2' x 2' Ceiling Tile                               | Room East of Office - Northeast                       | Random             | None Detected    |
| AZ1418.35-PLM-7                                                                                                | 37  | Blue 4" Cove Base                                        | Room 25 - Northeast                                   | Convenient         | None Detected    |
|                                                                                                                | 38  | Yellow Mastic for Blue 4" Cove Base                      |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-8                                                                                                | 37  | Blue 4" Cove Base                                        | Room 64 - South                                       | Convenient         | None Detected    |
|                                                                                                                | 38  | Yellow Mastic for Blue 4" Cove Base                      |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-9                                                                                                | 37  | Blue 4" Cove Base                                        | Room 69 - South                                       | Convenient         | None Detected    |
|                                                                                                                | 38  | Yellow Mastic for Blue 4" Cove Base                      |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-10                                                                                               | 39  | Gray/Blue Carpet Square                                  | Room 13 - Northeast                                   | Convenient         | None Detected    |
|                                                                                                                | 40  | Yellow Mastic for Gray/Blue Carpet Square                |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-11                                                                                               | 39  | Gray/Blue Carpet Square                                  | Room 43 - West                                        | Convenient         | None Detected    |
|                                                                                                                | 40  | Yellow Mastic for Gray/Blue Carpet Square                |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-12                                                                                               | 39  | Gray/Blue Carpet Square                                  | Room 60 - Northeast                                   | Convenient         | None Detected    |
|                                                                                                                | 40  | Yellow Mastic for Gray/Blue Carpet Square                |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-13                                                                                               | 41  | Black Window Sealant                                     | BJ- Entryway                                          | Convenient         | None Detected    |
| AZ1418.35-PLM-14                                                                                               |     | Black Window Sealant                                     | Room 43 - South                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-15                                                                                               |     | Black Window Sealant                                     | Room 54 - North                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-16                                                                                               | 42  | Light Brown w/ Tan Specs 12" x 12" VCT                   | Room 20 - Northeast                                   | Convenient         | None Detected    |
|                                                                                                                | 43  | Semi-Transparent Mastic for Brown w/ Specs 12" x 12" VCT |                                                       | Convenient         | None Detected    |

Inspector: Isai Portillo

Certificate Number: ON-188748-19438-121224

State: Arizona



**Dominion Environmental Consultants, Inc.**  
**AHERA PLM Bulk Sample Summary**

| Dominion Project Numbers: AZ1418.11/1418.15/1415.16/1418.35 |     |                                                          | Client: Kyrene Elementary School District             |                    |                  |
|-------------------------------------------------------------|-----|----------------------------------------------------------|-------------------------------------------------------|--------------------|------------------|
| Sample Dates: March 11, 2024 + March 3, 2025                |     |                                                          | Site: Kyrene de las Brisas Elementary - Main Building |                    |                  |
| Sample Number                                               | HM# | Material Description                                     | Sample Location                                       | Manner of Sampling | Asbestos Content |
| AZ1418.35-PLM-17                                            | 42  | Light Brown w/ Tan Specs 12" x 12" VCT                   | Storage East of Office - Southwest                    | Convenient         | None Detected    |
|                                                             | 43  | Semi-Transparent Mastic for Brown w/ Specs 12" x 12" VCT |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-18                                            | 42  | Light Brown w/ Tan Specs 12" x 12" VCT                   | Storage Southeast of Room 68 - Center                 | Convenient         | None Detected    |
|                                                             | 43  | Semi-Transparent Mastic for Brown w/ Specs 12" x 12" VCT |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-19                                            | 44  | White w/ Black Specs 12" x 12" VCT                       | Room 21 - East                                        | Convenient         | None Detected    |
|                                                             | 45  | Yellow Mastic for White w/ Black Specs 12" x 12" VCT     |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-20                                            | 44  | White w/ Black Specs 12" x 12" VCT                       | Multipurpose Room - Northwest                         | Convenient         | None Detected    |
|                                                             | 45  | Yellow Mastic for White w/ Black Specs 12" x 12" VCT     |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-21                                            | 44  | White w/ Black Specs 12" x 12" VCT                       | Multipurpose Room - Northeast                         | Convenient         | None Detected    |
|                                                             | 45  | Yellow Mastic for White w/ Black Specs 12" x 12" VCT     |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-22                                            | 46  | Gray w/ Tan Specs 12" x 12" VCT                          | Pod #1 - South                                        | Convenient         | None Detected    |
|                                                             | 47  | Yellow Mastic for Gray w/ Tan Specs 12" x 12" VCT        |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-23                                            | 46  | Gray w/ Tan Specs 12" x 12" VCT                          | Pod #1 - Northeast                                    | Convenient         | None Detected    |
|                                                             | 47  | Yellow Mastic for Gray w/ Tan Specs 12" x 12" VCT        |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-24                                            | 46  | Gray w/ Tan Specs 12" x 12" VCT                          | Pod #1 - Northwest                                    | Convenient         | None Detected    |
|                                                             | 47  | Yellow Mastic for Gray w/ Tan Specs 12" x 12" VCT        |                                                       | Convenient         | None Detected    |
| AZ1418.35-PLM-25                                            | 48  | White Texture 2' x 2' Ceiling Tile                       | Multipurpose Room - Southwest                         | Convenient         | None Detected    |
| AZ1418.35-PLM-26                                            |     | White Texture 2' x 2' Ceiling Tile                       | Multipurpose Room - Southeast                         | Convenient         | None Detected    |
| AZ1418.35-PLM-27                                            |     | White Texture 2' x 2' Ceiling Tile                       | Multipurpose Room - Scenter                           | Convenient         | None Detected    |
| AZ1418.35-PLM-28                                            | 49  | Beige Smooth Vinyl 2' x 2' Ceiling Tile                  | Kitchen - Southwest                                   | Convenient         | None Detected    |
| AZ1418.35-PLM-29                                            |     | Beige Smooth Vinyl 2' x 2' Ceiling Tile                  | Kitchen - Northeast                                   | Convenient         | None Detected    |
| AZ1418.35-PLM-30                                            |     | Beige Smooth Vinyl 2' x 2' Ceiling Tile                  | Kitchen - Southeast                                   | Convenient         | None Detected    |

**Dominion Environmental Consultants, Inc.**  
**AHERA PLM Bulk Sample Summary**

| <b>Dominion Project Numbers: AZ1418.35</b>                                                                            |            |                                          | <b>Client: Kyrene Elementary School District</b>       |                           |                         |
|-----------------------------------------------------------------------------------------------------------------------|------------|------------------------------------------|--------------------------------------------------------|---------------------------|-------------------------|
| <b>Sample Dates: March 3, 2025</b>                                                                                    |            |                                          | <b>Site: Kyrene de las Brisas Elementary - Library</b> |                           |                         |
| <b>Sample Number</b>                                                                                                  | <b>HM#</b> | <b>Material Description</b>              | <b>Sample Location</b>                                 | <b>Manner of Sampling</b> | <b>Asbestos Content</b> |
| <b>Sample Date: March 3, 2025 - AHERA Building Inspector: Isai Portillo ( Certification # ON-188748-19438-121224)</b> |            |                                          |                                                        |                           |                         |
| AZ1418.35-PLM-1                                                                                                       | 1          | Blue 4" Cove Base                        | North Section - East                                   | Convenient                | None Detected           |
|                                                                                                                       | 2          | Beige Mastic for Blue 4" Cove Base       |                                                        | Convenient                | None Detected           |
| AZ1418.35-PLM-2                                                                                                       | 1          | Blue 4" Cove Base                        | North Section - West                                   | Convenient                | None Detected           |
|                                                                                                                       | 2          | Beige Mastic for Blue 4" Cove Base       |                                                        | Convenient                | None Detected           |
| AZ1418.35-PLM-3                                                                                                       | 1          | Blue 4" Cove Base                        | Large East Office - South                              | Convenient                | None Detected           |
|                                                                                                                       | 2          | Beige Mastic for Blue 4" Cove Base       |                                                        | Convenient                | None Detected           |
| AZ1418.35-PLM-4                                                                                                       | 3          | White Rough Texture 2' x 2' Ceiling Tile | South Section - East                                   | Random                    | None Detected           |
| AZ1418.35-PLM-5                                                                                                       |            | White Rough Texture 2' x 2' Ceiling Tile | South Section - Northeast                              | Random                    | None Detected           |
| AZ1418.35-PLM-6                                                                                                       |            | White Rough Texture 2' x 2' Ceiling Tile | South Section - South                                  | Random                    | None Detected           |
| AZ1418.35-PLM-7                                                                                                       | 4          | White 2' x 2' Ceiling Tile               | Large East Office - West                               | Random                    | None Detected           |
| AZ1418.35-PLM-8                                                                                                       |            | White 2' x 2' Ceiling Tile               | Small East Office - South                              | Random                    | None Detected           |
| AZ1418.35-PLM-9                                                                                                       |            | White 2' x 2' Ceiling Tile               | North Section - Southwest                              | Random                    | None Detected           |
| AZ1418.35-PLM-10                                                                                                      | 5          | Orange Peel Drywall System - White Paint | Large East Office - North                              | Convenient                | None Detected           |
|                                                                                                                       |            | Texture                                  |                                                        | Convenient                | None Detected           |
|                                                                                                                       |            | Tape                                     |                                                        | Convenient                | None Detected           |
|                                                                                                                       |            | Joint Compound                           |                                                        | Convenient                | None Detected           |
|                                                                                                                       |            | Drywall                                  |                                                        | Convenient                | None Detected           |
| AZ1418.35-PLM-11                                                                                                      | 5          | Orange Peel Drywall System - White Paint | Small East Office - North                              | Convenient                | None Detected           |
|                                                                                                                       |            | Texture                                  |                                                        | Convenient                | None Detected           |
|                                                                                                                       |            | Tape                                     |                                                        | Convenient                | None Detected           |
|                                                                                                                       |            | Joint Compound                           |                                                        | Convenient                | None Detected           |
|                                                                                                                       |            | Drywall                                  |                                                        | Convenient                | None Detected           |
| AZ1418.35-PLM-12                                                                                                      | 5          | Orange Peel Drywall System - White Paint | North Section - Northeast                              | Convenient                | None Detected           |
|                                                                                                                       |            | Texture                                  |                                                        | Convenient                | None Detected           |
|                                                                                                                       |            | Tape                                     |                                                        | Convenient                | None Detected           |
|                                                                                                                       |            | Joint Compound                           |                                                        | Convenient                | None Detected           |
|                                                                                                                       |            | Drywall                                  |                                                        | Convenient                | None Detected           |

**Inspector: Isai Portillo**  
**Certificate Number: ON-188748-19438-121224**  
**State: Arizona**




**Dominion Environmental Consultants, Inc.**  
**AHERA PLM Bulk Sample Summary**

| <b>Dominion Project Numbers: AZ1418.35</b> |            |                                                  | <b>Client: Kyrene Elementary School District</b>       |                           |                         |
|--------------------------------------------|------------|--------------------------------------------------|--------------------------------------------------------|---------------------------|-------------------------|
| <b>Sample Dates: March 3, 2025</b>         |            |                                                  | <b>Site: Kyrene de las Brisas Elementary - Library</b> |                           |                         |
| <b>Sample Number</b>                       | <b>HM#</b> | <b>Material Description</b>                      | <b>Sample Location</b>                                 | <b>Manner of Sampling</b> | <b>Asbestos Content</b> |
| AZ1418.35-PLM-13                           | 6          | Gray/Blue Carpet Square                          | North Section - Center                                 | Convenient                | None Detected           |
|                                            | 7          | Yellow Mastic for Gray/Blue Carpet Square        |                                                        | Convenient                | None Detected           |
|                                            | 8          | Brown Sheet Flooring for Gray/Blue Carpet Square |                                                        | Convenient                | None Detected           |
| AZ1418.35-PLM-14                           | 6          | Gray/Blue Carpet Square                          | South Section - North                                  | Convenient                | None Detected           |
|                                            | 7          | Yellow Mastic for Gray/Blue Carpet Square        |                                                        | Convenient                | None Detected           |
|                                            | 8          | Brown Sheet Flooring for Gray/Blue Carpet Square |                                                        | Convenient                | None Detected           |
| AZ1418.35-PLM-15                           | 6          | Gray/Blue Carpet Square                          | South Section - South                                  | Convenient                | None Detected           |
|                                            | 7          | Yellow Mastic for Gray/Blue Carpet Square        |                                                        | Convenient                | None Detected           |
|                                            | 8          | Brown Sheet Flooring for Gray/Blue Carpet Square |                                                        | Convenient                | None Detected           |

## SECTION 7



### PLM BULK SAMPLE LOCATION MAPS

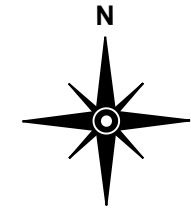



Sample Date: March 11, 2024

- ◆ Project AZ1418.11
- Project AZ1418.15
- Project AZ1418.16


PLM Bulk Sample Location Map (1 of 2)  
Kyrene De Las Brisas Elementary School  
777 N. Desert Breeze Blvd. E#1, Chandler, AZ 85226

Project No. AZ1418.35

Main Building

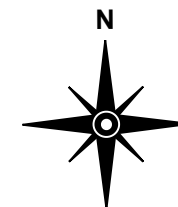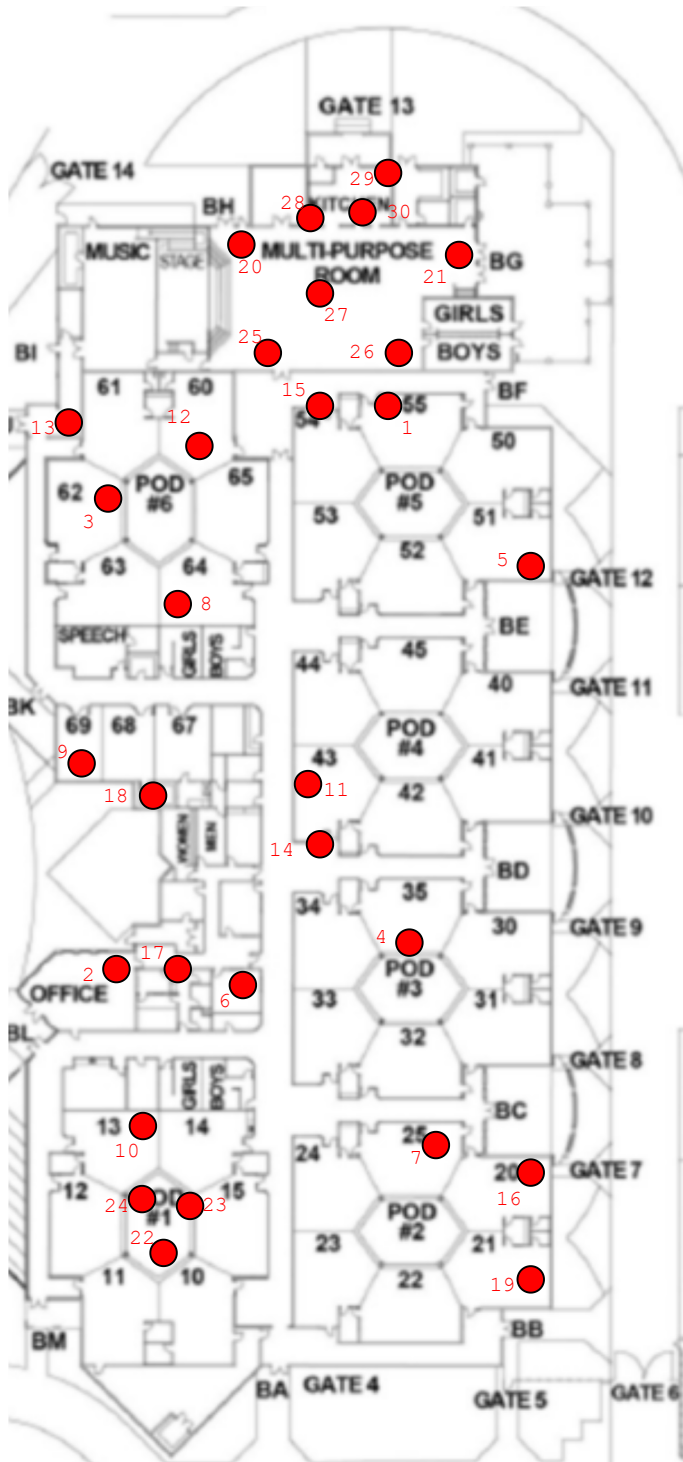

● Sample Date: March 3, 2025


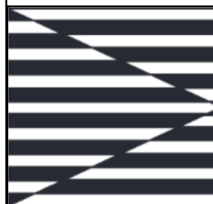


PLM Bulk Sample Location Map (2 of 2)  
Kyrene De Las Brisas Elementary School  
777 N. Desert Breeze Blvd. E#1, Chandler, AZ 85226


Project No. AZ1418.35

Main Building

Dominion Environmental Consultants, Inc.  
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

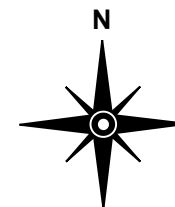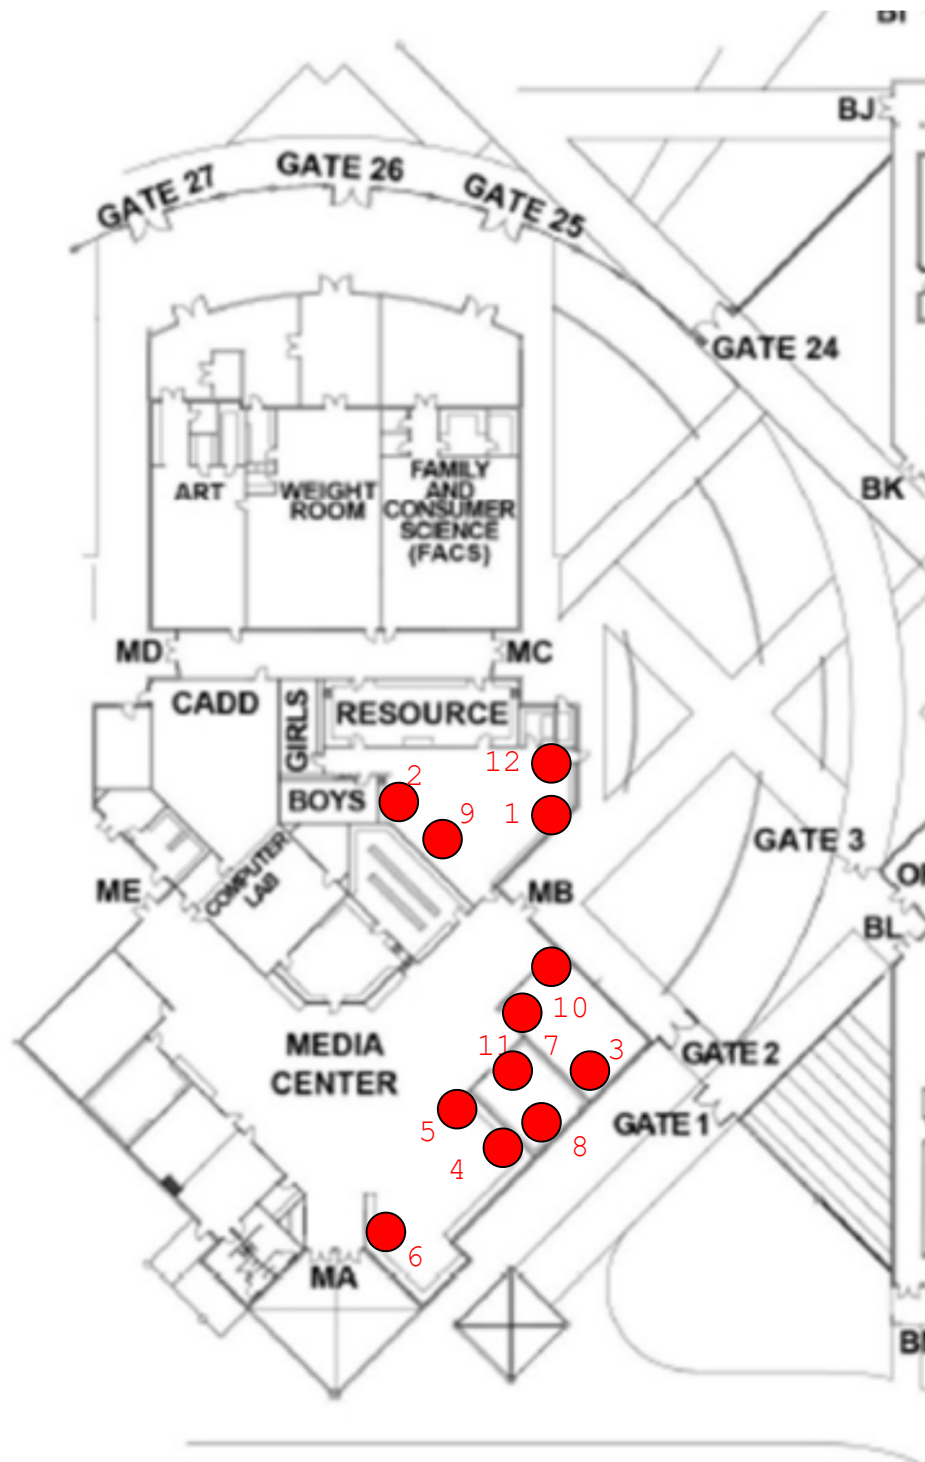

● Sample Date: March 3, 2025

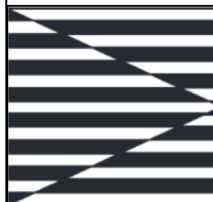

PLM Bulk Sample Location Map  
Kyrene De Las Brisas Elementary School  
777 N. Desert Breeze Blvd. E#1, Chandler, AZ 85226

Project No. AZ1418.35


Library

Dominion Environmental Consultants, Inc.  
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

## SECTION 8



## ASSUMED ACBM LOCATION MAPS

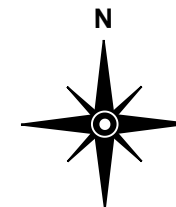

Assumed Asbestos Containing  
Black Weather Stripping



Assumed Asbestos Containing  
Off-White 4" x 4" Ceramic Wall Tile  
Gray 4" x 4" Ceramic Wall Tile  
Black 4" x 4" Ceramic Wall Tile  
Navy Blue Ceramic Cove Base Tile  
Grout & Mastic for Wall & Cove Base Tiles  
and Fixture Caulking



Assumed Asbestos Containing  
Light Pink 4" x 4" Ceramic Wall Tile +  
Grout & Mastic for Wall Tiles



Assumed Asbestos Containing  
Gray Granite Countertops



Assumed Asbestos Containing  
White 4" x 4" Ceramic Water Fountain  
Wall Tile + Grout & Mastic for  
Water Fountain Wall Tile



Assumed Asbestos Containing  
Red, Blue, Green, & Yellow 12" x 12" VCT  
+ Mastic for 12" x 12" VCT  
and Silver Sink Caulking





Assumed Asbestos Containing  
Brown Door Sealant,  
Black 4" Cove Base + Mastic,  
and Brown 16" x 8" Block + Mortar

Assumed ACBM Location Map (1 of 3)  
Kyrene De Las Brisas Elementary School  
777 N. Desert Breeze Blvd. E#1, Chandler, AZ 85226

Project No. AZ1418.35

Main Building

Dominion Environmental Consultants, Inc.  
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

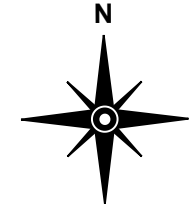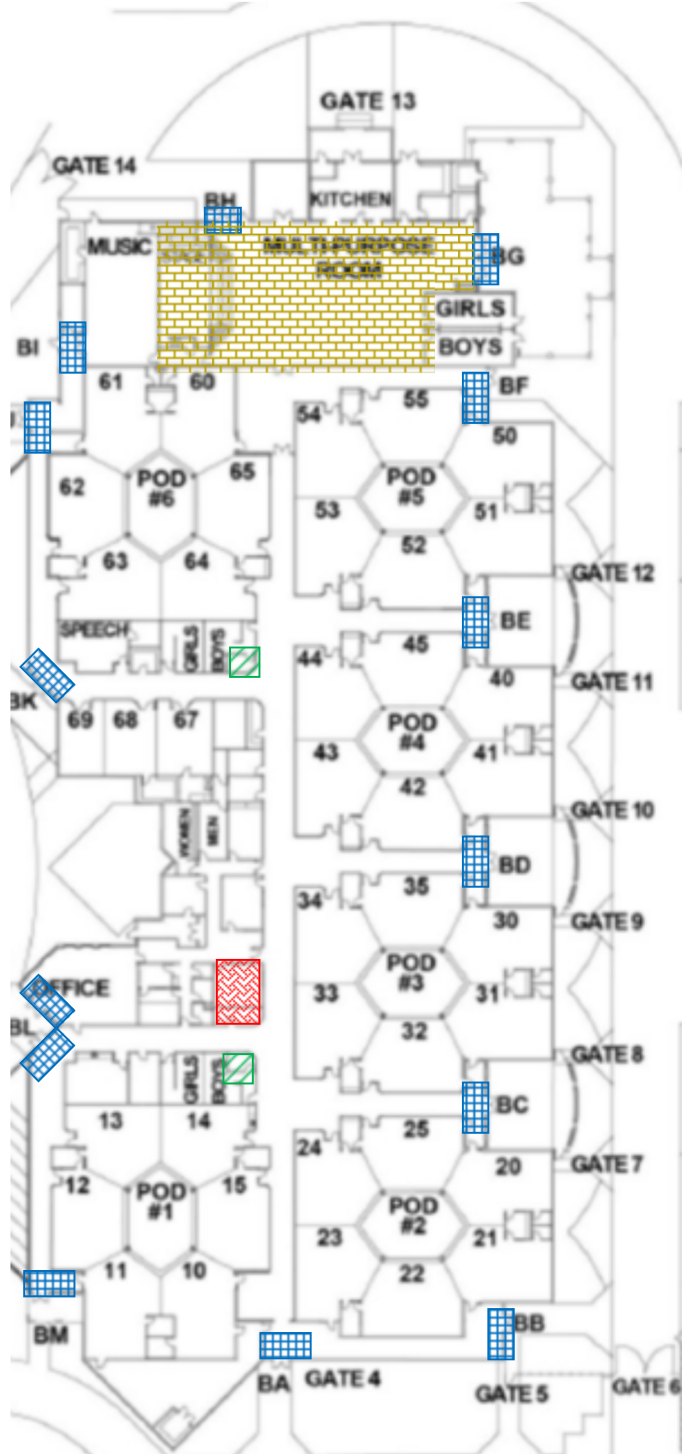



- 
 Assumed Asbestos Containing  
 Gray Metal Door Sealant,  
 Clear 9" x 9" Block Mortar,  
 and Black 2' x 2' Carpet Squares + Mastic
- 
 Assumed Asbestos Containing  
 Gray 4" Cove Base + Mastic,  
 and Mop Sink Caulking
- 
 Assumed Asbestos Containing  
 Smooth Drywall System
- 
 Assumed Asbestos Containing  
 Black 6" Cove Base + Mastic,  
 48" x 12" Black Vinyl + Mastic,  
 Brown 16" x 4" Decorative Block + Mortar

Assumed ACBM Location Map (2 of 3)  
 Kyrene De Las Brisas Elementary School  
 777 N. Desert Breeze Blvd. E#1, Chandler, AZ 85226


Project No. AZ1418.35

Main Building

Dominion Environmental Consultants, Inc.  
 20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

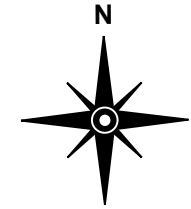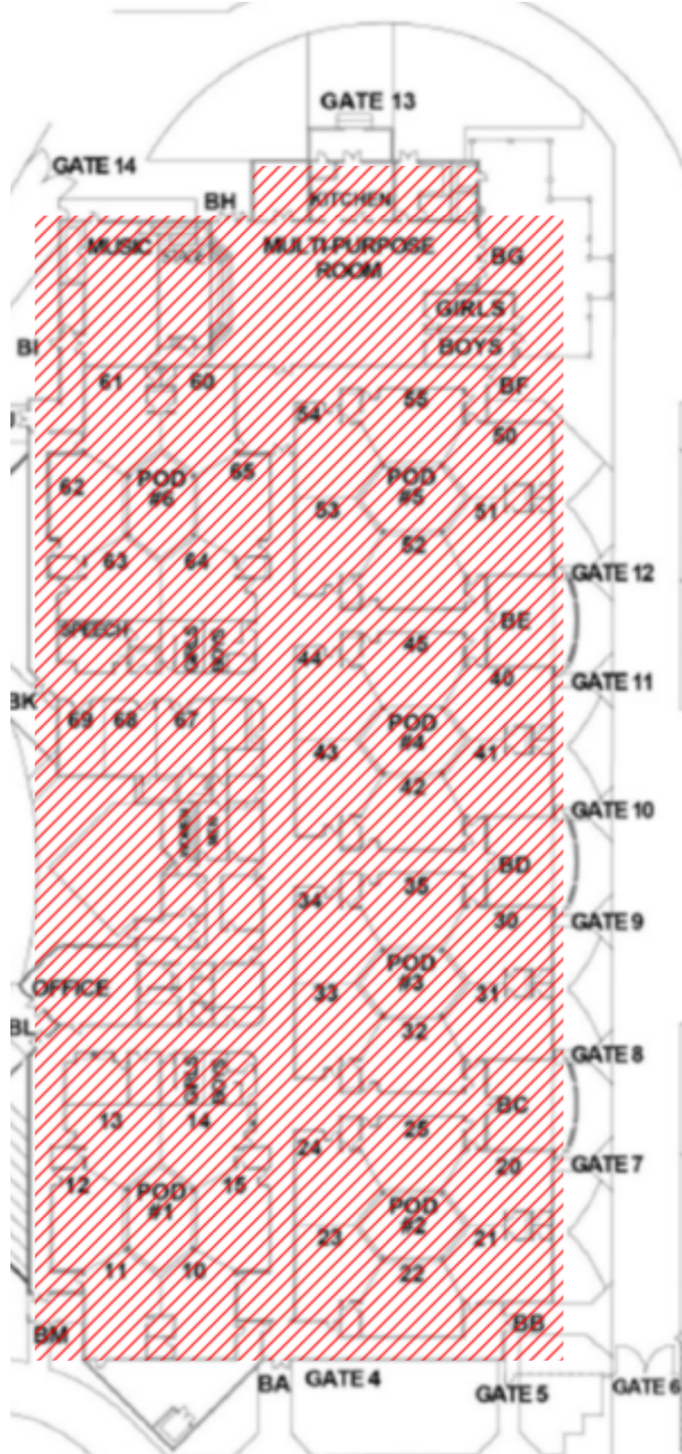

Assumed Asbestos Containing  
Counter Cabinet Caulking,  
Sink Coating,  
Tac Board + Wrap,  
White Wrap/Coating For Insulation,  
Gray Duct Mastic,  
Silver Flex Duct Wrap,  
Silver Duct Wrap,  
Red Fire Stop Caulking,  
Ceiling Insulation Wrap,  
Black Foam Pipe Insulation,  
Black HVAC Damper


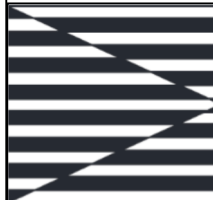


Assumed ACBM Location Map (3 of 3)  
Kyrene De Las Brisas Elementary School  
777 N. Desert Breeze Blvd. E#1, Chandler, AZ 85226

Project No. AZ1418.35

Main Building


Dominion Environmental Consultants, Inc.  
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

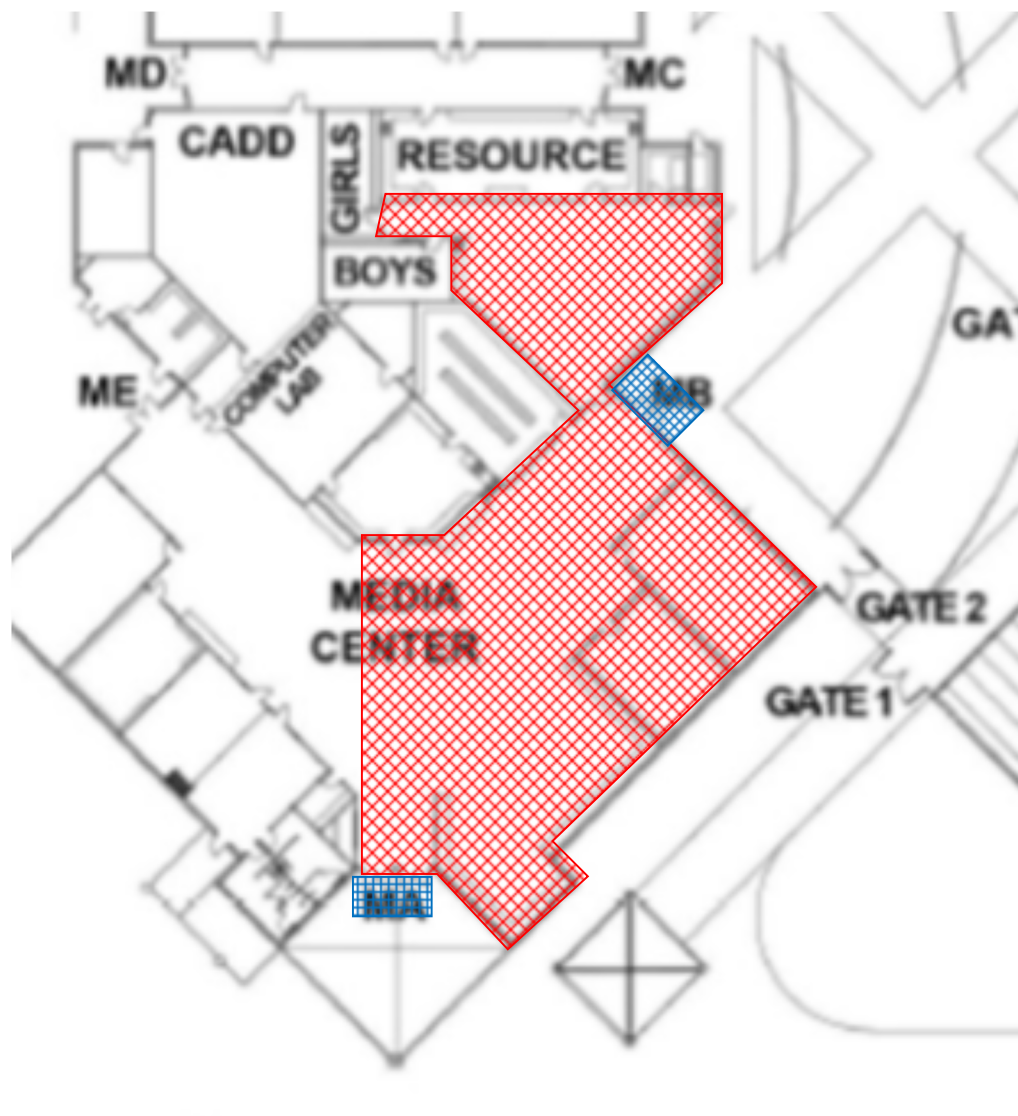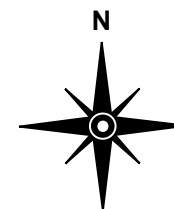

Assumed Asbestos Containing  
White Door Sealant and  
Clear 9" x 9" Block Mortar



Assumed Asbestos Containing  
Gray Sink Coating,  
Tac Board + Wrap,  
Counter/Cabinet Caulking,  
Window Sealant,  
Gray Duct Mastic,  
Silver Wrap for Flex Duct Insulation,  
Silver Wrap for Duct Insulation,  
and Unfinished Drywall

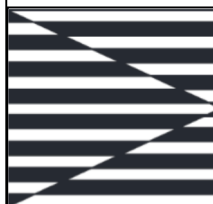

Assumed ACBM Location Map  
Kyrene De Las Brisas Elementary School  
777 N. Desert Breeze Blvd. E#1, Chandler, AZ 85226

Project No. AZ1418.35

Library

Dominion Environmental Consultants, Inc.  
20045 North 19th Avenue - Building 7 - Phoenix, Arizona 85027 - (623) 516-1415

## SECTION 9



## LABORATORY REPORTS

Report for:

**Xin Lou**  
**Dominion Environmental Consultants, Inc.**  
20045 N. 19th Ave, Bldg 7  
Phoenix, AZ 85027

---

Regarding: Eurofins Aerotech Built Environment Testing, Inc.  
Project: AZ1418.15; Kyrene Brisas Kitchen Remodel  
EML ID: 3569276

Approved by:

Dates of Analysis:  
Asbestos PLM: 03-13-2024



Approved Signatory  
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)  
NVLAP Lab Code 500031-0

---

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, Inc. ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.15; Kyrene Brisas Kitchen Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

**Total Samples Submitted:** 33

**Total Samples Analyzed:** 33

**Total Samples with Layer Asbestos Content > 1%:** 0

### Location: PLM-1, 12"x12" Gray Ceramic Floor Tile

Lab ID-Version‡: 17442746-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Ceramic Tile                         | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

### Location: PLM-2, 12"x12" Gray Ceramic Floor Tile

Lab ID-Version‡: 17442747-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Ceramic Tile                         | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

### Location: PLM-3, 12"x12" Gray Ceramic Floor Tile

Lab ID-Version‡: 17442748-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Ceramic Tile                         | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

### Location: PLM-4, Grout

Lab ID-Version‡: 17442749-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Grout                                | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

### Location: PLM-5, Grout

Lab ID-Version‡: 17442750-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Grout                                | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.15; Kyrene Brisas Kitchen Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-6, Grout

Lab ID-Version‡: 17442751-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Grout                                | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

### Location: PLM-7, Gray Ceramic Tile Base

Lab ID-Version‡: 17442752-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Ceramic Tile                         | ND               |
| Gray Grout                                | ND               |
| Tan Mastic                                | ND               |
| White Compound                            | ND               |
| <b>Sample Composite Homogeneity:</b> Poor |                  |

### Location: PLM-8, Gray Ceramic Tile Base

Lab ID-Version‡: 17442753-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Ceramic Tile                         | ND               |
| Tan Mastic                                | ND               |
| White Compound                            | ND               |
| <b>Sample Composite Homogeneity:</b> Poor |                  |

### Location: PLM-9, Gray Ceramic Tile Base

Lab ID-Version‡: 17442754-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Ceramic Tile                         | ND               |
| Tan Mastic                                | ND               |
| White Compound                            | ND               |
| <b>Sample Composite Homogeneity:</b> Poor |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.15; Kyrene Brisas Kitchen Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-10, Grout

Lab ID-Version‡: 17442755-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Grout                           | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-11, Grout

Lab ID-Version‡: 17442756-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Grout                           | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-12, Grout

Lab ID-Version‡: 17442757-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Grout                           | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-13, Orange Peel Drywall

Lab ID-Version‡: 17442758-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Tan Paint #1                           | ND               |
| White Compound #1                      | ND               |
| Tan Paint #2                           | ND               |
| White Compound #2                      | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Poor             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.15; Kyrene Brisas Kitchen Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-14, Orange Peel Drywall

Lab ID-Version‡: 17442759-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Tan Paint #1                           | ND               |
| White Compound #1                      | ND               |
| Tan Paint #2                           | ND               |
| White Compound #2                      | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Poor             |

### Location: PLM-15, Orange Peel Drywall

Lab ID-Version‡: 17442760-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Tan Paint #1                           | ND               |
| White Compound #1                      | ND               |
| Tan Paint #2                           | ND               |
| White Compound #2                      | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Poor             |

### Location: PLM-16, FRP, Mastic

Lab ID-Version‡: 17442761-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Fiberglass Reinforced Plastic    | ND               |
| Cream Mastic                           | ND               |
| <b>Composite Non-Asbestos Content:</b> | 20% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.15; Kyrene Brisas Kitchen Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

**Location: PLM-17, FRP, Mastic**

Lab ID-Version‡: 17442762-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Fiberglass Reinforced Plastic    | ND               |
| Cream Mastic                           | ND               |
| <b>Composite Non-Asbestos Content:</b> | 20% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.15; Kyrene Brisas Kitchen Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-18, FRP, Mastic

Lab ID-Version‡: 17442763-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Fiberglass Reinforced Plastic    | ND               |
| Cream Mastic                           | ND               |
| <b>Composite Non-Asbestos Content:</b> | 20% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good             |

### Location: PLM-19, Counter Caulking

Lab ID-Version‡: 17442764-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Caulk                          | ND               |
| Silver Caulk                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

### Location: PLM-20, Counter Caulking

Lab ID-Version‡: 17442765-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Caulk                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-21, Counter Caulking

Lab ID-Version‡: 17442766-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Caulk                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.15; Kyrene Brisas Kitchen Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-22, Sink Caulking

Lab ID-Version‡: 17442767-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| White Caulk                   | ND               |
| Sample Composite Homogeneity: | Good             |

### Location: PLM-23, Sink Caulking

Lab ID-Version‡: 17442768-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| White Caulk                   | ND               |
| Sample Composite Homogeneity: | Good             |

### Location: PLM-24, Sink Caulking

Lab ID-Version‡: 17442769-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| White Caulk                   | ND               |
| Sample Composite Homogeneity: | Good             |

### Location: PLM-25, Door Frame Caulking

Lab ID-Version‡: 17442770-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| White Caulk                   | ND               |
| Sample Composite Homogeneity: | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.15; Kyrene Brisas Kitchen Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-26, Door Frame Caulking

Lab ID-Version‡: 17442771-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Caulk                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-27, Door Frame Caulking

Lab ID-Version‡: 17442772-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Caulk                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-28, 2"x2" Ceiling Tile

Lab ID-Version‡: 17442773-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Gray Ceiling Tile with White Surface   | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate                          |

### Location: PLM-29, 2"x2" Ceiling Tile

Lab ID-Version‡: 17442774-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Gray Ceiling Tile with White Surface   | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate                          |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.15; Kyrene Brisas Kitchen Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-30, 2"x2" Ceiling Tile

Lab ID-Version‡: 17442775-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Gray Ceiling Tile with White Surface   | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate                          |

### Location: PLM-31, Insulation Backing

Lab ID-Version‡: 17442776-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Yellow Insulation                      | ND                                |
| Silver Insulation Backing              | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 60% Glass Fibers<br>20% Cellulose |
| <b>Sample Composite Homogeneity:</b>   | Moderate                          |

### Location: PLM-32, Insulation Backing

Lab ID-Version‡: 17442777-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Yellow Insulation                      | ND                                |
| Silver Insulation Backing              | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 60% Glass Fibers<br>20% Cellulose |
| <b>Sample Composite Homogeneity:</b>   | Moderate                          |

### Location: PLM-33, Insulation Backing

Lab ID-Version‡: 17442778-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Yellow Insulation                      | ND                                |
| Silver Insulation Backing              | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 60% Glass Fibers<br>20% Cellulose |
| <b>Sample Composite Homogeneity:</b>   | Moderate                          |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY  eurofins

www.eurofinsus.com/Built

Built Environment Testing

East: (866) 871-1984  
Central: (800) 651-4802  
West: (866) 888-6653

| LEVEL | WEATHER  | Fog | Rain | Snow | Wind | Clear |
|-------|----------|-----|------|------|------|-------|
|       | None     |     |      |      |      |       |
|       | Light    |     |      |      |      |       |
|       | Moderate |     |      |      |      |       |
|       | Heavy    |     |      |      |      |       |

## REQUESTED SERVICES



003569276

ests

## CONTACT INFORMATION

|          |                        |                       |
|----------|------------------------|-----------------------|
| Company: | Dominion Environmental | Address:              |
| Contact: | Xin Lou                | Special Instructions: |
| Phone:   | 602-810-8581           |                       |

## PROJECT INFORMATION

## TURN AROUND TIME CODES - (TAT)

|                      |                               |                           |                                                                                                                                                    |
|----------------------|-------------------------------|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|
| Project ID:          | A21418.15                     | STD - Standard (Default)  | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |
| Project Description: | Kynone Briggs Kitchen Remodel | ND - Next Business Day    |                                                                                                                                                    |
| Project Date/Time:   | 3/11/24                       | SD - Same Business Day    |                                                                                                                                                    |
| Zip Code:            |                               | WH - Weekend/Holiday/ASAP |                                                                                                                                                    |
| PO Number:           | 315778                        | Sampled By:               | KL                                                                                                                                                 |

| SAMPLE ID | DESCRIPTION                     | Sample Type (Below) | TAT (Above) | Total Volume/Area (as applicable) | NOTES (Time of day, Temp, RH, etc.) |
|-----------|---------------------------------|---------------------|-------------|-----------------------------------|-------------------------------------|
| PLM-1-3   | 12"x12" Gray Ceramic Floor Tile | B                   | STD         |                                   |                                     |
| 4-6       | Grout                           |                     |             |                                   |                                     |
| 7-9       | Gray Ceramic Tile Base          |                     |             |                                   |                                     |
| 10-12     | Grout                           |                     |             |                                   |                                     |
| 13-15     | Orange Peel Drywall             |                     |             |                                   |                                     |
| 16-18     | FRP Mastic                      |                     |             |                                   |                                     |
| 19-21     | Counter Caulking                |                     |             |                                   |                                     |
| 22-24     | Sink Caulking                   |                     |             |                                   |                                     |
| 25-27     | Door Frame Caulking             |                     |             |                                   |                                     |
| 28-30     | 2'x2' ceiling tile              |                     |             |                                   |                                     |
| 31-33     | Duct Insulation Backing         |                     |             |                                   |                                     |

## SAMPLE TYPE CODES

## RELINQUISHED BY

## DATE &amp; TIME

## RECEIVED BY

## DATE &amp; TIME

|                           |                    |           |            |
|---------------------------|--------------------|-----------|------------|
| BC - BioCassette™         | CP - Contact Plate | T - Tape  | O - Other: |
| A1S - Andersen            | ST - Spore Trap    | SW - Swab |            |
| SAS - Surface Air Sampler | B - Bulk           | SO - Soil |            |
| NP - Non-potable Water    | P - Potable Water  | D - Dust  |            |

3/11/24

3-11-24  
3:15 PM

Report for:

**Xin Lou**  
**Dominion Environmental Consultants, Inc.**  
20045 N. 19th Ave, Bldg 7  
Phoenix, AZ 85027

---

Regarding: Eurofins Aerotech Built Environment Testing, Inc.  
Project: AZ1418.16; Kyrene Brisas RR Remodel  
EML ID: 3569281

Approved by:

Dates of Analysis:  
Asbestos PLM: 03-13-2024



Approved Signatory  
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)  
NVLAP Lab Code 500031-0

---

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, Inc. ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.16; Kyrene Brisas RR Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

**Total Samples Submitted:** 36

**Total Samples Analyzed:** 36

**Total Samples with Layer Asbestos Content > 1%:** 0

### Location: PLM-1, 4"X4" Blue Ceramic Wall Tile, Mastic

Lab ID-Version‡: 17442570-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Blue Ceramic Tile                    | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

### Location: PLM-2, 4"X4" Blue Ceramic Wall Tile, Mastic

Lab ID-Version‡: 17442571-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Blue Ceramic Tile                    | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

### Location: PLM-3, 4"X4" Blue Ceramic Wall Tile, Mastic

Lab ID-Version‡: 17442572-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Blue Ceramic Tile                    | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

### Location: PLM-4, 4"X4" Beige Ceramic Wall Tile, Mastic

Lab ID-Version‡: 17442573-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Beige Ceramic Tile                   | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.16; Kyrene Brisas RR Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

**Location: PLM-5, 4"X4" Beige Ceramic Wall Tile, Mastic**

Lab ID-Version‡: 17442574-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Beige Ceramic Tile                            | ND               |
| Yellow Mastic                                 | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

**Location: PLM-6, 4"X4" Beige Ceramic Wall Tile, Mastic**

Lab ID-Version‡: 17442575-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Beige Ceramic Tile                            | ND               |
| Yellow Mastic                                 | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

**Location: PLM-7, 4"X4" Gray Ceramic Wall Tile, Mastic**

Lab ID-Version‡: 17442576-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Gray Ceramic Tile                             | ND               |
| Yellow Mastic                                 | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

**Location: PLM-8, 4"X4" Gray Ceramic Wall Tile, Mastic**

Lab ID-Version‡: 17442577-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Gray Ceramic Tile                             | ND               |
| Yellow Mastic                                 | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.16; Kyrene Brisas RR Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

**Location: PLM-9, 4"X4" Gray Ceramic Wall Tile, Mastic**

Lab ID-Version‡: 17442578-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Ceramic Tile                    | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: PLM-10, Grout**

Lab ID-Version‡: 17442579-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Beige Grout                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: PLM-11, Grout**

Lab ID-Version‡: 17442580-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Beige Grout                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: PLM-12, Grout**

Lab ID-Version‡: 17442581-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Beige Grout                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.16; Kyrene Brisas RR Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-13, 2"x2" Gray Ceramic Floor Tile

Lab ID-Version‡: 17442582-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Ceramic Tile                  | ND               |
| Yellow Mastic                      | ND               |
| Gray Mortar                        | ND               |
| Sample Composite Homogeneity: Poor |                  |

### Location: PLM-14, 2"x2" Gray Ceramic Floor Tile

Lab ID-Version‡: 17442583-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Gray Ceramic Tile                      | ND               |
| Gray Mortar                            | ND               |
| Sample Composite Homogeneity: Moderate |                  |

### Location: PLM-15, 2"x2" Gray Ceramic Floor Tile

Lab ID-Version‡: 17442584-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Ceramic Tile                  | ND               |
| Yellow Mastic                      | ND               |
| Gray Mortar                        | ND               |
| Sample Composite Homogeneity: Poor |                  |

### Location: PLM-16, Grout

Lab ID-Version‡: 17442585-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Grout                         | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.16; Kyrene Brisas RR Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-17, Grout

Lab ID-Version‡: 17442586-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Grout                         | ND               |
| Sample Composite Homogeneity: Good |                  |

### Location: PLM-18, Grout

Lab ID-Version‡: 17442587-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Grout                         | ND               |
| Sample Composite Homogeneity: Good |                  |

### Location: PLM-19, Cabinet Caulking

Lab ID-Version‡: 17442588-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Caulk                        | ND               |
| Sample Composite Homogeneity: Good |                  |

### Location: PLM-20, Cabinet Caulking

Lab ID-Version‡: 17442589-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Caulk                        | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.16; Kyrene Brisas RR Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-21, Cabinet Caulking

Lab ID-Version‡: 17442590-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| White Caulk                   | ND               |
| Sample Composite Homogeneity: | Good             |

### Location: PLM-22, Fixture Caulking

Lab ID-Version‡: 17442591-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| White Caulk                   | ND               |
| Sample Composite Homogeneity: | Good             |

### Location: PLM-23, Fixture Caulking

Lab ID-Version‡: 17442592-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| White Caulk                   | ND               |
| Sample Composite Homogeneity: | Good             |

### Location: PLM-24, Fixture Caulking

Lab ID-Version‡: 17442593-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| White Caulk                   | ND               |
| Sample Composite Homogeneity: | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.16; Kyrene Brisas RR Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-25, Door Frame Caulking

Lab ID-Version‡: 17442594-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Caulk                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-26, Door Frame Caulking

Lab ID-Version‡: 17442595-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Caulk                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-27, Door Frame Caulking

Lab ID-Version‡: 17442596-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Caulk                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-28, Orange Peel Drywall

Lab ID-Version‡: 17442597-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Peach Paint #1                         | ND               |
| White Texture #1                       | ND               |
| Peach Paint #2                         | ND               |
| White Texture #2                       | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.16; Kyrene Brisas RR Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-29, Orange Peel Drywall

Lab ID-Version‡: 17442598-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Peach Paint #1                         | ND               |
| White Texture #1                       | ND               |
| Peach Paint #2                         | ND               |
| White Texture #2                       | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Moderate         |

### Location: PLM-30, Orange Peel Drywall

Lab ID-Version‡: 17442599-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Peach Paint #1                         | ND               |
| White Texture #1                       | ND               |
| Peach Paint #2                         | ND               |
| White Texture #2                       | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Moderate         |

### Location: PLM-31, Unfinished Drywall

Lab ID-Version‡: 17442600-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Peach Paint                            | ND               |
| White Texture                          | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Poor             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.16; Kyrene Brisas RR Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

**Location: PLM-32, Unfinished Drywall**

Lab ID-Version‡: 17442601-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Texture #1                       | ND               |
| Peach Paint                            | ND               |
| White Texture #2                       | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Poor             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Xin Lou  
Re: AZ1418.16; Kyrene Brisas RR Remodel

Date of Sampling: 03-11-2024  
Date of Receipt: 03-11-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

### Location: PLM-33, Unfinished Drywall

Lab ID-Version‡: 17442602-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Cream Paint                            | ND               |
| White Texture #1                       | ND               |
| Peach Paint                            | ND               |
| White Texture #2                       | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Poor             |

### Location: PLM-34, 2"x2" Ceiling Tile

Lab ID-Version‡: 17442603-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Brown Ceiling Tile                     | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 35% Cellulose<br>35% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

### Location: PLM-35, 2"x2" Ceiling Tile

Lab ID-Version‡: 17442604-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Brown Ceiling Tile                     | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 35% Cellulose<br>35% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

### Location: PLM-36, 2"x2" Ceiling Tile

Lab ID-Version‡: 17442605-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Brown Ceiling Tile                     | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 35% Cellulose<br>35% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

CHAIN OF CUSTODY  eurofins

www.eurofinsus.com/Built

Built Environment Testing

East: (866) 871-1984  
Central: (800) 651-4802  
West: (866) 888-6653

| LEVEL | WEATHER  |      |      |      |       |  |
|-------|----------|------|------|------|-------|--|
|       | Fog      | Rain | Snow | Wind | Clear |  |
|       | None     |      |      |      |       |  |
|       | Light    |      |      |      |       |  |
|       | Moderate |      |      |      |       |  |
|       | Heavy    |      |      |      |       |  |

|                       |                  |                                                                                     |
|-----------------------|------------------|-------------------------------------------------------------------------------------|
| <b>Non-Culturable</b> |                  | <b>Bio Sw</b>                                                                       |
| Spore Trap            | Tape, Swab, Bulk |                                                                                     |
|                       |                  |  |
|                       |                  | 003569281                                                                           |
|                       |                  | 1-Media Surface Fungi (Genus ID + Asp. spp.)                                        |
|                       |                  | Culturable Air Fungi (Genus ID + Asp. spp.)                                         |
|                       |                  | Gram Stain and Counts (Culturable Air and Surface Backlog)                          |
|                       |                  | Legionella culture                                                                  |
|                       |                  | Total Coliform, E. coli (Presence/Absence)                                          |
|                       |                  | Quantitative Tray-Sewage Screen                                                     |
|                       |                  | OTHER: (please specify test)                                                        |
|                       |                  | Asbestos in Air - PCM Airborne Fiber Count (NIOSH 7400)                             |
|                       |                  | Asbestos Bulk - PLM                                                                 |
|                       |                  | Lead (Pb) - Flame AA                                                                |
|                       |                  | PCR (please specify test)                                                           |
|                       |                  | Allergens (please specify test)                                                     |

| CONTACT INFORMATION |                        |                       |
|---------------------|------------------------|-----------------------|
| Company:            | Dominion Environmental | Address:              |
| Contact:            | Xin Lou                | Special Instructions: |
| Phone:              | 602-810-8581           |                       |

| PROJECT INFORMATION  |                          |                     | TURN AROUND TIME CODES - (TAT) |                                                                                                                                                    |
|----------------------|--------------------------|---------------------|--------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|
| Project ID:          | AZ1418.16                |                     | STD - Standard (Default)       | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |
| Project Description: | Kyrene Brisas RR Remodel |                     | ND - Next Business Day         |                                                                                                                                                    |
| Project Zip Code:    |                          |                     | SD - Same Business Day         |                                                                                                                                                    |
| PO Number:           | 315777                   |                     | WH - Weekend/Holiday/ASAP      |                                                                                                                                                    |
|                      |                          | Sampling Date/Time: | 3/11/24                        |                                                                                                                                                    |
|                      |                          | Sampled By:         | KL                             |                                                                                                                                                    |

| SAMPLE ID | DESCRIPTION                          | Sample Type (Below) | TAT (Above) | Total Volume/Area (as applicable) | NOTES (Time of day, Temp, RH, etc.) |
|-----------|--------------------------------------|---------------------|-------------|-----------------------------------|-------------------------------------|
| PLM 1-3   | 4"x4" Blue Ceramic wall tile, Mask B | STD                 |             |                                   |                                     |
| 4-6       | ↓ Beige ↓                            |                     |             |                                   |                                     |
| 7-9       | ↓ Gray ↓                             |                     |             |                                   |                                     |
| 10-12     | Cement                               |                     |             |                                   |                                     |
| 13-15     | 2"x2" Gray Ceramic Floor Tile        |                     |             |                                   |                                     |
| 16-18     | Grout                                |                     |             |                                   |                                     |
| 19-21     | Cabinet Caulking                     |                     |             |                                   |                                     |
| 22-24     | Fixture Caulking                     |                     |             |                                   |                                     |
| 25-27     | Door Frame Caulking                  |                     |             |                                   |                                     |
| 28-30     | Orange Peel Drywall                  |                     |             |                                   |                                     |
| 31-33     | Unfinished Drywall                   |                     |             |                                   |                                     |
| 34-36     | 2'x2' ceiling tile                   |                     |             |                                   |                                     |

| SAMPLE TYPE CODES         |                    |           |            | RELINQUISHED BY | DATE & TIME | RECEIVED BY | DATE & TIME |
|---------------------------|--------------------|-----------|------------|-----------------|-------------|-------------|-------------|
| BC - BioCassette™         | CP - Contact Plate | T - Tape  | O - Other: |                 | 3/11/24     |             | 3-11-24     |
| A1S - Andersen            | ST - Spore Trap    | SW - Swab |            |                 |             |             | 3:15 PM     |
| SAS - Surface Air Sampler | B - Bulk           | SO - Soil |            |                 |             |             |             |
| NP - Non-potable Water    | P - Potable Water  | D - Dust  |            |                 |             |             |             |

Report for:

**Tracey Carpenter**  
**Dominion Environmental Consultants, Inc.**  
20045 N. 19th Ave, Bldg 7  
Phoenix, AZ 85027

---

Regarding: Eurofins Aerotech Built Environment Testing, Inc.  
Project: 1418.11; Brisas ES- Fire Riser  
EML ID: 3571409

Approved by:

Dates of Analysis:  
Asbestos PLM: 03-13-2024



Approved Signatory  
Renee Luna-Trepczynski

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)  
NVLAP Lab Code 500031-0

---

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Aerotech Built Environment Testing, Inc. ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Dominion Environmental Consultants, Inc.  
C/O: Tracey Carpenter  
Re: 1418.11; Brisas ES- Fire Riser

Date of Sampling: 03-11-2024  
Date of Receipt: 03-13-2024  
Date of Report: 03-13-2024

## ASBESTOS PLM REPORT

**Total Samples Submitted:** 3

**Total Samples Analyzed:** 3

**Total Samples with Layer Asbestos Content > 1%:** 0

### Location: PLM-1, Pipe Sealant & Tape

Lab ID-Version‡: 17454095-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Blue Tape                              | ND               |
| Cream Sealant                          | ND               |
| <b>Composite Non-Asbestos Content:</b> | 20% Wollastonite |
| <b>Sample Composite Homogeneity:</b>   | Moderate         |

### Location: PLM-2, Pipe Sealant & Tape

Lab ID-Version‡: 17454096-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Blue Tape                              | ND               |
| Cream Sealant                          | ND               |
| <b>Composite Non-Asbestos Content:</b> | 20% Wollastonite |
| <b>Sample Composite Homogeneity:</b>   | Moderate         |

### Location: PLM-3, Pipe Sealant & Tape

Lab ID-Version‡: 17454097-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Blue Tape                              | ND               |
| Cream Sealant                          | ND               |
| <b>Composite Non-Asbestos Content:</b> | 20% Wollastonite |
| <b>Sample Composite Homogeneity:</b>   | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Marlton, NJ: 3000 Lincoln Dr E, Ste. A, Marlton, NJ 08053 \* (866) 871-1984  
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802  
SSF, CA: 6000 Shoreline Ct, Ste. 205, S. San Francisco, CA 94080 \* (866) 888-6653

EMLab P&amp;K

| WEATHER |          | Fog | Rain | Snow | Wind | Clear |
|---------|----------|-----|------|------|------|-------|
| LEVEL   | None     |     |      |      |      |       |
|         | Light    |     |      |      |      |       |
|         | Moderate |     |      |      |      |       |
|         | Heavy    |     |      |      |      |       |



003571409

ICES

## CONTACT INFORMATION

|          |                                                              |                                                                               |
|----------|--------------------------------------------------------------|-------------------------------------------------------------------------------|
| Company: | <div> <div> Dominion Environmental Consultants </div> </div> | Address: 20045 N. 19th Ave, Bldg 7, Phoenix, AZ 85027                         |
| Contact: | <div> <div>Tracey Carpenter</div> </div>                     | Special Instructions:                                                         |
| Phone:   | <div> <div>(602) 989-9992</div> </div>                       | <div> <div>email results:</div> <div>+carpenter@dominion-env.com</div> </div> |

### PROJECT INFORMATION

|                      |                        |                     |                |
|----------------------|------------------------|---------------------|----------------|
| Project ID:          | 1418.11                |                     |                |
| Project Description: | Brisas ES - Fire Riser |                     |                |
| Project Zip Code:    | 85044                  | Sampling Date/Time: | 3/11/24 @ 11AM |
| PO Number:           | 315744                 | Sampled By:         | TUC            |

TURN AROUND TIME CODES - (TAT)

|                                  |                                                                                                                                                                   |
|----------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>STD</b> - Standard (Default)  | Rushes received after 2pm<br>or on weekends, will be<br>considered received the<br>next business day. Please<br>alert us in advance of<br>weekend analysis needs. |
| <b>ND</b> - Next Business Day    |                                                                                                                                                                   |
| <b>SD</b> - Same Business Day    |                                                                                                                                                                   |
| <b>WH</b> - Weekend/Holiday/ASAP |                                                                                                                                                                   |

[illegible]

### SAMPLE TYPE CODES

|                           |                    |           |            |
|---------------------------|--------------------|-----------|------------|
| BC - BioCassette™         | CP - Contact Plate | T - Tape  | O - Other: |
| A1S - Andersen            | ST - Spore Trap    | SW - Swab |            |
| SAS - Surface Air Sampler | B - Bulk           | SO - Soil |            |
| NP - Non-potable Water    | P - Potable Water  | D - Dust  |            |

## RELINQUISHED BY

|                 |                  |
|-----------------|------------------|
| RELINQUISHED BY | DATE & TIME      |
| Shirley Corp    | 3/8/24<br>@ 8 AM |

## DATE &amp; TIME

## RECEIVED BY

| RECEIVED BY | DATE & TIME  |
|-------------|--------------|
| Patty Wgo   | 3/13/24 8:10 |

## DATE &amp; TIME

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at <http://www.emlab.com/s/main/serviceterms.html>

Report for:

**Isai Portillo**  
**Dominion Environmental Consultants, Inc.**  
20045 N. 19th Ave, Bldg 7  
Phoenix, AZ 85027

---

Regarding: Eurofins Built Environment Testing West, LLC  
Project: AZ1418.35; Kyrene De la Brisas ES Main Bldg  
EML ID: 4022533

Approved by:

Dates of Analysis:  
Asbestos PLM: 04-11-2025



Approved Signatory  
Roshanak Kalantari

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)  
NVLAP Lab Code 200945-0

---

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Built Environment Testing West, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 03-03-2025  
C/O: Isai Portillo Date of Receipt: 04-09-2025  
Re: AZ1418.35; Kyrene De la Brisas ES Main Bldg Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

**Total Samples Submitted:** 30

**Total Samples Analyzed:** 30

**Total Samples with Layer Asbestos Content > 1%:** 0

### Location: PLM-1, Off-White 2'x2' Ceiling Tile

Lab ID-Version‡: 20024919-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Gray Ceiling Tile with White Surface   | ND               |
| <b>Composite Non-Asbestos Content:</b> | 65% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

### Location: PLM-2, Off-White 2'x2' Ceiling Tile

Lab ID-Version‡: 20024920-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Gray Ceiling Tile with White Surface   | ND               |
| <b>Composite Non-Asbestos Content:</b> | 65% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

### Location: PLM-3, Off-White 2'x2' Ceiling Tile

Lab ID-Version‡: 20024921-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Gray Ceiling Tile with White Surface   | ND               |
| <b>Composite Non-Asbestos Content:</b> | 65% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

### Location: PLM-4, White 2'x2' Ceiling Tile

Lab ID-Version‡: 20024922-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Gray Ceiling Tile with White Surface   | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Isai Portillo  
Re: AZ1418.35; Kyrene De la Brisas ES Main Bldg

Date of Sampling: 03-03-2025  
Date of Receipt: 04-09-2025  
Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

### Location: PLM-5, White 2'x2' Ceiling Tile

Lab ID-Version‡: 20024923-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Gray Ceiling Tile with White Surface   | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

### Location: PLM-6, White 2'x2' Ceiling Tile

Lab ID-Version‡: 20024924-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Gray Ceiling Tile with White Surface   | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

### Location: PLM-7, Blue 4" Cove Base & Mastic

Lab ID-Version‡: 20024925-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Blue Cove Base                       | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

### Location: PLM-8, Blue 4" Cove Base & Mastic

Lab ID-Version‡: 20024926-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Blue Cove Base                       | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.      Date of Sampling: 03-03-2025  
C/O: Isai Portillo      Date of Receipt: 04-09-2025  
Re: AZ1418.35; Kyrene De la Brisas ES Main Bldg      Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

### Location: PLM-9, Blue 4" Cove Base & Mastic

Lab ID-Version‡: 20024927-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Blue Cove Base                       | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

### Location: PLM-10, Gray/Blue Square Carpet & Mastic

Lab ID-Version‡: 20024928-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Multicolored Carpet                    | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 40% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate             |

### Location: PLM-11, Gray/Blue Square Carpet & Mastic

Lab ID-Version‡: 20024929-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Multicolored Carpet                    | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 40% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate             |

### Location: PLM-12, Gray/Blue Square Carpet & Mastic

Lab ID-Version‡: 20024930-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Multicolored Carpet                    | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 40% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.      Date of Sampling: 03-03-2025  
C/O: Isai Portillo      Date of Receipt: 04-09-2025  
Re: AZ1418.35; Kyrene De la Brisas ES Main Bldg      Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

### Location: PLM-13, Black Window Sealant

Lab ID-Version‡: 20024931-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Black Sealant                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-14, Black Window Sealant

Lab ID-Version‡: 20024932-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Black Sealant                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-15, Black Window Sealant

Lab ID-Version‡: 20024933-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Black Sealant                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-16, Light Brown w/Tan Specs 12"x12" VCT & Mastic

Lab ID-Version‡: 20024934-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Light Brown Floor Tile               | ND               |
| Semi-Transparent Mastic              | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 03-03-2025  
C/O: Isai Portillo Date of Receipt: 04-09-2025  
Re: AZ1418.35; Kyrene De la Brisas ES Main Bldg Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

### Location: PLM-17, Light Brown w/Tan Specs 12"x12" VCT & Mastic

Lab ID-Version‡: 20024935-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Light Brown Floor Tile                 | ND               |
| Semi-Transparent Mastic                | ND               |
| Sample Composite Homogeneity: Moderate |                  |

### Location: PLM-18, Light Brown w/Tan Specs 12"x12" VCT & Mastic

Lab ID-Version‡: 20024936-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Light Brown Floor Tile                 | ND               |
| Semi-Transparent Mastic                | ND               |
| Sample Composite Homogeneity: Moderate |                  |

### Location: PLM-19, White w/Black Specs 12"x12" VCT & Mastic

Lab ID-Version‡: 20024937-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Floor Tile                       | ND               |
| Yellow Mastic                          | ND               |
| Sample Composite Homogeneity: Moderate |                  |

### Location: PLM-20, White w/Black Specs 12"x12" VCT & Mastic

Lab ID-Version‡: 20024938-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Floor Tile                       | ND               |
| Yellow Mastic                          | ND               |
| Sample Composite Homogeneity: Moderate |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc. Date of Sampling: 03-03-2025  
C/O: Isai Portillo Date of Receipt: 04-09-2025  
Re: AZ1418.35; Kyrene De la Brisas ES Main Bldg Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

**Location: PLM-21, White w/Black Specs 12"x12" VCT & Mastic**

Lab ID-Version‡: 20024939-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| White Floor Tile                              | ND               |
| Yellow Mastic                                 | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

**Location: PLM-22, Gray w/Tan Specs 12"x12" VCT & Mastic**

Lab ID-Version‡: 20024940-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Light Gray Floor Tile                         | ND               |
| Yellow Mastic                                 | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

**Location: PLM-23, Gray w/Tan Specs 12"x12" VCT & Mastic**

Lab ID-Version‡: 20024941-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Light Gray Floor Tile                         | ND               |
| Yellow Mastic                                 | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

**Location: PLM-24, Gray w/Tan Specs 12"x12" VCT & Mastic**

Lab ID-Version‡: 20024942-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Light Gray Floor Tile                         | ND               |
| Yellow Mastic                                 | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Isai Portillo  
Re: AZ1418.35; Kyrene De la Brisas ES Main Bldg

Date of Sampling: 03-03-2025  
Date of Receipt: 04-09-2025  
Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

### Location: PLM-25, White Texture 2'x2' Ceiling Tile

Lab ID-Version‡: 20024943-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Gray Ceiling Tile with White Surface   | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

### Location: PLM-26, White Texture 2'x2' Ceiling Tile

Lab ID-Version‡: 20024944-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Gray Ceiling Tile with White Surface   | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

### Location: PLM-27, White Texture 2'x2' Ceiling Tile

Lab ID-Version‡: 20024945-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Gray Ceiling Tile with White Surface   | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

### Location: PLM-28, Beige Vinyl Smooth 2'x2' Ceiling

Lab ID-Version‡: 20024946-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Gray Ceiling Tile with White Surface   | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Isai Portillo  
Re: AZ1418.35; Kyrene De la Brisas ES Main Bldg

Date of Sampling: 03-03-2025  
Date of Receipt: 04-09-2025  
Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

**Location: PLM-29, Beige Vinyl Smooth 2'x2' Ceiling**

Lab ID-Version‡: 20024947-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Gray Ceiling Tile with White Surface   | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

**Location: PLM-30, Beige Vinyl Smooth 2'x2' Ceiling**

Lab ID-Version‡: 20024948-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Gray Ceiling Tile with White Surface   | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Isai Portillo  
Re: AZ1418.35; Kyrene De la Brisas ES Main Bldg

Date of Sampling: 03-03-2025  
Date of Receipt: 04-09-2025  
Date of Report: 04-11-2025

**ASBESTOS PLM REPORT**

**PROJECT ANALYST AND SIGNATORY REPORT**

**Project Analyst**



**Analyst:** Buapha Laophio

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

East: (866) 871-1984  
Central: (800) 651-4802  
West: (866) 888-6653

| CONTACT INFORMATION  |                                                |                     |                                                               |                                 |                                                                                                                                                    |
|----------------------|------------------------------------------------|---------------------|---------------------------------------------------------------|---------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|
| Company:             | Dominion Environmental                         |                     | Address:                                                      |                                 |                                                                                                                                                    |
| Contact:             | Isa Pichillo                                   |                     | Special Instructions:                                         |                                 |                                                                                                                                                    |
| Phone:               | 602-882-6710                                   |                     |                                                               |                                 |                                                                                                                                                    |
| PROJECT INFORMATION  |                                                |                     | TURN AROUND TIME CODES (TAT)                                  |                                 |                                                                                                                                                    |
| Project ID:          | A21418-35                                      |                     | STD - Standard (DEFAULT)                                      |                                 | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |
| Project Description: | Kyrone De La Brisas E.S. Main Bldg             |                     | ND - Next Business Day                                        |                                 |                                                                                                                                                    |
| Project Zip Code:    | Sampling Date & Time:                          | 3/03/25             | SD - Same Business Day Rush*                                  |                                 |                                                                                                                                                    |
| PO Number:           | 10334                                          | Sampled By:         | *Please call Client Services for locations with Rush services |                                 |                                                                                                                                                    |
| Sample ID            | Description                                    | Sample Type (Below) | TAT (Above)                                                   | Total Volume (Air Samples only) | Notes                                                                                                                                              |
| Plm-1-3              | off-white 2'x2' Ceiling Tile                   | B                   | STD                                                           |                                 |                                                                                                                                                    |
| 4-6                  | white 2'x2' Ceiling Tile                       |                     |                                                               |                                 |                                                                                                                                                    |
| 7-9                  | Blue 4" Cove Base & Mastic                     |                     |                                                               |                                 |                                                                                                                                                    |
| 10-12                | gray/blue square carpet & mastic               |                     |                                                               |                                 |                                                                                                                                                    |
| 13-15                | Black Window Sealant                           |                     |                                                               |                                 |                                                                                                                                                    |
| 16-18                | Light Brown w/ tan spears 12"x12" VGT & Mastic |                     |                                                               |                                 |                                                                                                                                                    |
| 19-21                | white w/ black spears 12"x12" VGT & Mastic     |                     |                                                               |                                 |                                                                                                                                                    |
| 22-24                | gray w/ tan spears 12"x12" VGT & Mastic        |                     |                                                               |                                 |                                                                                                                                                    |
| 25-27                | white texture 2'x2' Ceiling Tile               |                     |                                                               |                                 |                                                                                                                                                    |
| 28-30                | Beige Vinyl Smooth 2'x2' Ceiling Tile          |                     |                                                               |                                 |                                                                                                                                                    |

| ASBESTOS ANALYSIS               |                          |                          |                                   |                                   |                                    |                                     |                                      |                                   |                                    |                          |                          |                          |                          |
|---------------------------------|--------------------------|--------------------------|-----------------------------------|-----------------------------------|------------------------------------|-------------------------------------|--------------------------------------|-----------------------------------|------------------------------------|--------------------------|--------------------------|--------------------------|--------------------------|
| REQUESTED ? (check boxes below) |                          |                          |                                   |                                   |                                    |                                     |                                      |                                   |                                    |                          |                          |                          |                          |
| PCM Air                         |                          |                          |                                   |                                   |                                    |                                     |                                      |                                   |                                    |                          |                          |                          |                          |
| Fiber Count (NIOSH 7400)        | OSHA with TWA            | Asbestos Bulk PLM        | EPA Point Count (200 Point Count) | EPA Point Count (400 Point Count) | EPA Point Count (1000 Point Count) | Gravimetric Point Count (400 Pt Co) | Gravimetric Point Count (1000 Pt Co) | CARB 435 Method (400 Point Count) | CARB 435 Method (1000 Point Count) | Lead Analysis - Flame AA |                          |                          |                          |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>        | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>          | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/>            | <input type="checkbox"/>             | <input type="checkbox"/>          | <input type="checkbox"/>           | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |



| SAMPLE TYPE CODES |            | RELINQUISHED BY | DATE & TIME | RECEIVED BY | DATE & TIME      |
|-------------------|------------|-----------------|-------------|-------------|------------------|
| A - Air           | W - Wipe   |                 | 03/03/25    |             | 4/9/25<br>8:15am |
| B - Bulk          | T - Tape   |                 |             |             |                  |
| D - Dust          | R - Rock   |                 |             |             |                  |
| SO - Soil         | O - Other: |                 |             |             |                  |

Report for:

**Isai Portillo**  
**Dominion Environmental Consultants, Inc.**  
20045 N. 19th Ave, Bldg 7  
Phoenix, AZ 85027

---

Regarding: Eurofins Built Environment Testing West, LLC  
Project: AZ1418.35; Kyrene De La Brisas ES-Library  
EML ID: 4022527

Approved by:

Dates of Analysis:  
Asbestos PLM: 04-11-2025



Approved Signatory  
Roshanak Kalantari

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)  
NVLAP Lab Code 200945-0

---

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Built Environment Testing West, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Dominion Environmental Consultants, Inc.  
C/O: Isai Portillo  
Re: AZ1418.35; Kyrene De La Brisas ES-Library

Date of Sampling: 03-03-2025  
Date of Receipt: 04-09-2025  
Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

**Total Samples Submitted:** 15

**Total Samples Analyzed:** 15

**Total Samples with Layer Asbestos Content > 1%:** 0

### Location: PLM-1, Blue 4" Cove Base & Mastic

Lab ID-Version‡: 20024959-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Blue Cove Base                       | ND               |
| Beige Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-2, Blue 4" Cove Base & Mastic

Lab ID-Version‡: 20024960-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Blue Cove Base                       | ND               |
| Beige Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-3, Blue 4" Cove Base & Mastic

Lab ID-Version‡: 20024961-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Blue Cove Base                       | ND               |
| Beige Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

### Location: PLM-4, White Rough Texture 2" x2" Ceiling Tile

Lab ID-Version‡: 20024962-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Yellow Ceiling Tile with White Surface | ND               |
| <b>Composite Non-Asbestos Content:</b> | 65% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Isai Portillo  
Re: AZ1418.35; Kyrene De La Brisas ES-Library

Date of Sampling: 03-03-2025  
Date of Receipt: 04-09-2025  
Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

### Location: PLM-5, White Rough Texture 2"x2" Ceiling Tile

Lab ID-Version‡: 20024963-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Yellow Ceiling Tile with White Surface | ND               |
| <b>Composite Non-Asbestos Content:</b> | 65% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good             |

### Location: PLM-6, White Rough Texture 2"x2" Ceiling Tile

Lab ID-Version‡: 20024964-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Yellow Ceiling Tile with White Surface | ND               |
| <b>Composite Non-Asbestos Content:</b> | 65% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good             |

### Location: PLM-7, White 2"x2" Ceiling Tile

Lab ID-Version‡: 20024965-1

| Sample Layers                              | Asbestos Content |
|--------------------------------------------|------------------|
| Light Gray Ceiling Tile with White Surface | ND               |
| <b>Composite Non-Asbestos Content:</b>     | 80% Cellulose    |
| <b>Sample Composite Homogeneity:</b>       | Good             |

### Location: PLM-8, White 2"x2" Ceiling Tile

Lab ID-Version‡: 20024966-1

| Sample Layers                              | Asbestos Content |
|--------------------------------------------|------------------|
| Light Gray Ceiling Tile with White Surface | ND               |
| <b>Composite Non-Asbestos Content:</b>     | 80% Cellulose    |
| <b>Sample Composite Homogeneity:</b>       | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Isai Portillo  
Re: AZ1418.35; Kyrene De La Brisas ES-Library

Date of Sampling: 03-03-2025  
Date of Receipt: 04-09-2025  
Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

**Location: PLM-9, White 2"x2" Ceiling Tile**

Lab ID-Version‡: 20024967-1

| Sample Layers                              | Asbestos Content |
|--------------------------------------------|------------------|
| Light Gray Ceiling Tile with White Surface | ND               |
| <b>Composite Non-Asbestos Content:</b>     | 80% Cellulose    |
| <b>Sample Composite Homogeneity:</b>       | Good             |

**Location: PLM-10, Orange Peel DW(pt,txt,tp,jc,dw)**

Lab ID-Version‡: 20024968-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Paint                            | ND               |
| White Texture                          | ND               |
| White Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: PLM-11, Orange Peel DW(pt,txt,tp,jc,dw)**

Lab ID-Version‡: 20024969-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Paint                            | ND               |
| White Texture                          | ND               |
| White Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Isai Portillo  
Re: AZ1418.35; Kyrene De La Brisas ES-Library

Date of Sampling: 03-03-2025  
Date of Receipt: 04-09-2025  
Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

**Location: PLM-12, Orange Peel DW(pt,txt,tp,jc,dw)**

Lab ID-Version‡: 20024970-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Paint                            | ND               |
| White Texture                          | ND               |
| White Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
 C/O: Isai Portillo  
 Re: AZ1418.35; Kyrene De La Brisas ES-Library

Date of Sampling: 03-03-2025  
 Date of Receipt: 04-09-2025  
 Date of Report: 04-11-2025

## ASBESTOS PLM REPORT

### Location: PLM-13, Gray & Blue Square Carpet & Mastic

Lab ID-Version‡: 20024971-1

| Sample Layers                          | Asbestos Content                        |
|----------------------------------------|-----------------------------------------|
| Multicolored Carpet                    | ND                                      |
| Yellow Mastic                          | ND                                      |
| Brown Sheet Flooring                   | ND                                      |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers<br>2% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                                    |

### Location: PLM-14, Gray & Blue Square Carpet & Mastic

Lab ID-Version‡: 20024972-1

| Sample Layers                          | Asbestos Content                        |
|----------------------------------------|-----------------------------------------|
| Multicolored Carpet                    | ND                                      |
| Yellow Mastic                          | ND                                      |
| Brown Sheet Flooring                   | ND                                      |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers<br>2% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                                    |

### Location: PLM-15, Gray & Blue Square Carpet & Mastic

Lab ID-Version‡: 20024973-1

| Sample Layers                          | Asbestos Content                        |
|----------------------------------------|-----------------------------------------|
| Multicolored Carpet                    | ND                                      |
| Yellow Mastic                          | ND                                      |
| Brown Sheet Flooring                   | ND                                      |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers<br>2% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                                    |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Dominion Environmental Consultants, Inc.  
C/O: Isai Portillo  
Re: AZ1418.35; Kyrene De La Brisas ES-Library

Date of Sampling: 03-03-2025  
Date of Receipt: 04-09-2025  
Date of Report: 04-11-2025

**ASBESTOS PLM REPORT**

**PROJECT ANALYST AND SIGNATORY REPORT**

**Project Analyst**



**Analyst:** Roshanak Kalantari

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at: <https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/>  
Copyright © 2022 Eurofins EPK Built Environment Testing, LLC

## SECTION 10



## INSPECTOR ACCREDITATIONS

---

---

# THE ASBESTOS INSTITUTE

*Certifies that*

## Tracey Carpenter

has attended and received instruction in the EPA approved course

### AHERA Building Inspector Refresher

on

### September 05, 2023

and successfully completed and passed the competency exam.

Certificate:  
ON-4644-14588-090523

Date of Examination:  
5-Sep-2023

Date of Expiration:  
05-Sep-2024



William T. Cavness  
Director



Approved Instructor

**THE ASBESTOS INSTITUTE**

20033 N. 19<sup>th</sup> Ave, Building 6, Phoenix, AZ 85027  
602-864-6564 – [www.theasbestosinstitute.com](http://www.theasbestosinstitute.com)

*The person receiving this certificate has completed the requisite training for asbestos accreditation under TSCA Title II.*

---

---

# THE ASBESTOS INSTITUTE

*Certifies that*

## Xin Lou

has attended and received instruction in the EPA approved course

### AHERA Building Inspector Refresher

on

### September 23, 2023

and successfully completed and passed the competency exam.

Certificate:  
ON-4644-548-092323

Date of Examination:  
23-Sep-2023

Date of Expiration:  
23-Sep-2024



William T. Cavness  
Director



Approved Instructor

**THE ASBESTOS INSTITUTE**

20033 N. 19<sup>th</sup> Ave, Building 6, Phoenix, AZ 85027  
602-864-6564 – [www.theasbestosinstitute.com](http://www.theasbestosinstitute.com)

*The person receiving this certificate has completed the requisite training for asbestos accreditation under TSCA Title II.*

---

---

# THE ASBESTOS INSTITUTE

*Certifies that*

## Isai Portillo

has attended and received instruction in the EPA approved course

### AHERA Building Inspector Refresher

on


### December 12, 2024

and successfully completed and passed the competency exam.

Certificate:  
ON-188748-19438-121224

Date of Examination:  
12-Dec-2024

Date of Expiration:  
12-Dec-2025



---

J. Cavness  
Director



---

Approved Instructor

**THE ASBESTOS INSTITUTE**

20033 N. 19<sup>th</sup> Ave, Building 6, Phoenix, AZ 85027  
602-864-6564 – [www.theasbestosinstitute.com](http://www.theasbestosinstitute.com)

FL Course # CRS228

*The person receiving this certificate has completed the requisite training for asbestos accreditation under TSCA Title II.*

## SECTION 11



## LABORATORY ACCREDITATIONS

United States Department of Commerce  
National Institute of Standards and Technology



---

**Certificate of Accreditation to ISO/IEC 17025:2017**

---

**NVLAP LAB CODE: 500031-0**

**Eurofins EMLab P&K**

Phoenix, AZ

*is accredited by the National Voluntary Laboratory Accreditation Program for specific services,  
listed on the Scope of Accreditation, for:*

**Asbestos Fiber Analysis**

*This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2017.  
This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality  
management system (refer to joint ISO-ILAC-IAF Communique dated January 2009).*

---

2024-01-01 through 2024-12-31

*Effective Dates*



A handwritten signature in blue ink, reading 'Dana S. Laman'. The signature is written over a horizontal line.

*For the National Voluntary Laboratory Accreditation Program*

**SCOPE OF ACCREDITATION TO ISO/IEC 17025:2017**

**Eurofins EMLab P&K**

1501 W. Knudsen Dr.

Phoenix, AZ 85027-1307

Claudia Palermo

Phone: 856-334-1001

Email: [claudia.palermo@et.eurofinsus.com](mailto:claudia.palermo@et.eurofinsus.com)

<https://www.eurofinsus.com/environment-testing/built-environment/>

**ASBESTOS FIBER ANALYSIS**

**NVLAP LAB CODE 500031-0**

**Bulk Asbestos Analysis**

**Code**


**Description**

18/A01

EPA -- 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples

18/A03

EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials

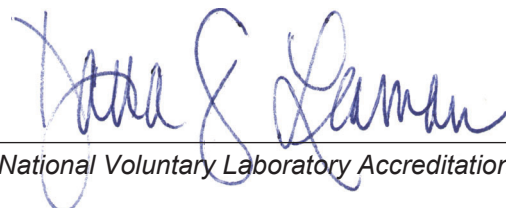

*For the National Voluntary Laboratory Accreditation Program*

United States Department of Commerce  
National Institute of Standards and Technology



---

## Certificate of Accreditation to ISO/IEC 17025:2017

---

NVLAP LAB CODE: 500031-0

**Eurofins EMLab P&K**

Phoenix, AZ

*is accredited by the National Voluntary Laboratory Accreditation Program for specific services,  
listed on the Scope of Accreditation, for:*

**Asbestos Fiber Analysis**

*This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2017.  
This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality  
management system (refer to joint ISO-ILAC-IAF Communiqué on ISO/IEC 17025).*

---

2025-01-01 through 2025-12-31

*Effective Dates*



A handwritten signature in blue ink, reading "Dana S. Laman".

---

*For the National Voluntary Laboratory Accreditation Program*

**SCOPE OF ACCREDITATION TO ISO/IEC 17025:2017**

**Eurofins EMLab P&K**

1501 W. Knudsen Dr.

Phoenix, AZ 85027-1307

Joshua Snyder

Phone: 800-651-4802

Email: [joshua.snyder@et.eurofinsus.com](mailto:joshua.snyder@et.eurofinsus.com)

<https://www.eurofinsus.com/environment-testing/built-environment/>

**ASBESTOS FIBER ANALYSIS**

**NVLAP LAB CODE 500031-0**

**Bulk Asbestos Analysis**

**Code**


**Description**

18/A01

EPA -- 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples

18/A03

EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials

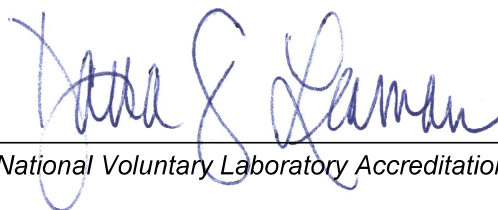

*For the National Voluntary Laboratory Accreditation Program*