



October 21, 2025

Service Request No:R2512676

Cory Stamp  
Labella Associates, PC  
300 State Street, 2nd Floor  
Suite 201  
Rochester, NY 14614

**Laboratory Results for: Monroe 1 BOCES 39 O'Connor Rd**

Dear Cory,

Enclosed are the results of the sample(s) submitted to our laboratory October 04, 2025  
For your reference, these analyses have been assigned our service request number **R2512676**.

All testing was performed according to our laboratory's quality assurance program and met the requirements of the TNI standards except as noted in the case narrative report. Any testing not included in the lab's accreditation is identified on a Non-Certified Analytes report. All results are intended to be considered in their entirety. ALS Environmental is not responsible for use of less than the complete report. Results apply only to the individual samples submitted to the lab for analysis, as listed in the report. The measurement uncertainty of the results included in this report is within that expected when using the prescribed method(s), and represented by Laboratory Control Sample control limits. Any events, such as QC failures or Holding Time exceedances, which may add to the uncertainty are explained in the report narrative or are flagged with qualifiers. The flags are explained in the Report Qualifiers and Definitions page of this report.

Please contact me if you have any questions. My extension is 7475. You may also contact me via email at [Meghan.Pedro@alsglobal.com](mailto:Meghan.Pedro@alsglobal.com).

Respectfully submitted,

**ALS Group USA, Corp. dba ALS Environmental**

Meghan Pedro  
Project Manager

**ADDRESS** 1565 Jefferson Road, Building 300, Suite 360, Rochester, NY 14623  
**PHONE** +1 585 288 5380 | **FAX** +1 585 288 8475  
ALS Group USA, Corp.  
dba ALS Environmental



# Narrative Documents

**ALS Environmental—Rochester Laboratory**  
1565 Jefferson Road, Building 300, Suite 360, Rochester, NY 14623  
Phone (585) 288-5380 Fax (585) 288-8475  
[www.alsglobal.com](http://www.alsglobal.com)



**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd  
**Sample Matrix:** Drinking Water

**Service Request:** R2512676  
**Date Received:** 10/04/2025

**CASE NARRATIVE**

All analyses were performed consistent with the quality assurance program of ALS Environmental. This report contains analytical results for samples for the Tier II level requested by the client.

**Sample Receipt:**

Seventeen drinking water samples were received for analysis at ALS Environmental on 10/04/2025. Any discrepancies upon initial sample inspection are annotated on the sample receipt and preservation form included within this report. The samples were stored at minimum in accordance with the analytical method requirements.

**Metals:**

No significant anomalies were noted with this analysis.

A handwritten signature in black ink that reads "Meghan Pedro".

Approved by \_\_\_\_\_

Date 10/21/2025



### SAMPLE DETECTION SUMMARY

This form includes only detections above the reporting levels. For a full listing of sample results, continue to the Sample Results section of this Report.

CLIENT ID: 38-Y12-1		Lab ID: R2512676-014				
Analyte	Results	Flag	MDL	MRL	Units	Method
Lead, Total	1.4			1.0	ug/L	200.8

CLIENT ID: 38-Y11-1		Lab ID: R2512676-015				
Analyte	Results	Flag	MDL	MRL	Units	Method
Lead, Total	12.0			1.0	ug/L	200.8



## Sample Receipt Information

**ALS Environmental—Rochester Laboratory**  
1565 Jefferson Road, Building 300, Suite 360, Rochester, NY 14623  
Phone (585) 288-5380 Fax (585) 288-8475  
[www.alsglobal.com](http://www.alsglobal.com)

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288

**Service Request:**R2512676

**SAMPLE CROSS-REFERENCE**

<u>SAMPLE #</u>	<u>CLIENT SAMPLE ID</u>	<u>DATE</u>	<u>TIME</u>
R2512676-001	38-W01-1	10/3/2025	0820
R2512676-002	38-W01-2	10/3/2025	0821
R2512676-003	38-W05-3	10/3/2025	0823
R2512676-004	38-X09-2	10/3/2025	0813
R2512676-005	38-X09-1	10/3/2025	0812
R2512676-006	38-X10-2	10/3/2025	0811
R2512676-007	38-X10-1	10/3/2025	0810
R2512676-008	38-Y002-2	10/3/2025	0751
R2512676-009	38-Y02-1	10/3/2025	0750
R2512676-010	38-Y07-2	10/3/2025	0757
R2512676-011	38-07-1	10/3/2025	0756
R2512676-012	38-Y08-2	10/3/2025	0805
R2512676-013	38-Y08-1	10/3/2025	0804
R2512676-014	38-Y12-1	10/3/2025	0801
R2512676-015	38-Y11-1	10/3/2025	0808
R2512676-016	38-XH-2	10/3/2025	0815
R2512676-017	38-XH-1	10/3/2025	0816



ALS Environmental

# Chain of Custody Form

Laboratory location:  
Rochester NY

Page 1 of     

Customer Information		Project Information		Parameter/Method Request for Analysis												
Purchase Order		Project Name	Monroe 1 BOCES	A	EPA 200.8 Lead in Drinking Water											
Work Order		Project Number	2254288	B												
Company Name	LaBella Associates	Bill To Company	LaBella Associates	C												
Send Report To	Cory Stamp	Invoice Attn	Cory Stamp	D												
Address	300 State Street, Suite 200	Address	300 State Street, Suite 200	E												
				F												
City/State/Zip	Rochester, NY 14614	City/State/Zip	Rochester, NY 14614	G												
Phone	(607) 591-7516	Phone	(607) 591-7516	H												
Fax		Fax		I												
e-Mail Address	cstamp@labellapc.com	e-Mail Address	cstamp@labellapc.com	J												

No	Sample Description	Date	Time	Matrix	Pres.	# Bottles	A	B	C	D	E	F	G	H	I	J	Hold
1	See attached spreadsheets for sample				N/A		X										
2	descriptions. All samples are 250 mL				N/A		X										
3	plastic bottles, drinking water, with				N/A		X										
4	no preservative																
5																	
6																	
7																	
8																	
9																	
10																	

Sample(s): Please Print & Sign *Cory Stamp* Shipment Method: **Delivered** Required Turnaround Time:  STD 10 Wk Days  5 Wk Days  2 Wk Days  24 Hour  Other Results Due Date:


Relinquished by: *[Signature]* Date: *[Blank]* Time: *[Blank]* Received by: *[Blank]* Notes: *[Blank]*

Relinquished by: *[Signature]* Date: 10/4/25 Time: 9:22 Received by (Laboratory): *[Signature]*

QC Package: (Check Box Below)

<input type="checkbox"/> Level II: Standard QC	TRRP-Checklist
<input type="checkbox"/> Level III: Std QC + Raw Data	TRRP Level IV
<input type="checkbox"/> Level IV: SW846 CLP-Like	
Other: <b>R2512676</b>	<b>5</b>

Note: Any changes must be made in writing once samples and COC Form have been submitted to ALS Laboratory Group. Signature denotes acceptance of ALS Group USA, Corp. Terms and Conditions - Please click the link below for detailed Terms & Conditions: <https://www.alsglobal.com/ALSGroupUSACorpTC> ALS copyright © 2024. All rights reserved.

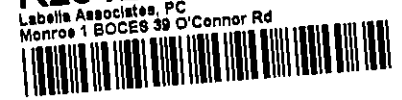

**Monroe One BOCES  
Bldg 4,5,6 EMCC & Bldg 7 Security  
38 O'Connor Rd, Fairport NY 14450**

NYS Action  
Level =  
5 ppb

**Testing  
Date:  
10/3/2025**

Building	Fir	Room	Rm Description	Fixture	Fixture Class	Test	Chain of Custody Sample Number	Result Lead ppb	Lab Sample ID	Report Page #	Time Sampled
Security	1	A-3	Kitchette	Water Dispenser	Drink		S-A03-1				

38 O'Connor Rd	4M	W-01	Bottle Filler	Bottle Filler	Drink		38-W01-1				8:20 AM
38 O'Connor Rd	4M	W-01	Bottle Filler	Bottle Filler	Drink		38-W01-2				8:21 AM
38 O'Connor Rd	4M	W-05	Bottle Filler	Bottle Filler	Drink		38-W05-3				8:23 AM
38 O'Connor Rd	5M	X-09	Auto Sv Lab	Bottle Filler	Drink		38-X09-2				8:13 AM
38 O'Connor Rd	5M	X-09	Auto Sv Lab	Bottle Filler DF	Drink		38-X09-1				8:12 AM
38 O'Connor Rd	5M	X-10	Auto Sv Lab	Bottle Filler	Drink		38-X10-2				8:11 AM
38 O'Connor Rd	5M	X-10	Auto Sv Lab	Bottle Filler DF	Drink		38-X10-1				8:10 AM
38 O'Connor Rd	6M	Y-02	Machine Shop	Bottle Filler	Drink		38-Y02-2				7:51 AM
38 O'Connor Rd	6M	Y-02	Machine Shop	Bottle Filler DF	Drink		38-Y02-1				7:50 AM
38 O'Connor Rd	6M	Y-07	Welding Shop	Bottle Filler	Drink		38-Y07-2				7:57 AM
38 O'Connor Rd	6M	Y-07	Welding Shop	Bottle Filler DF	Drink		38-Y07-1				7:56 AM
38 O'Connor Rd	6M	Y-08	Auto Mechanic Lab	Bottle Filler	Drink		38-Y08-2				8:05 AM
38 O'Connor Rd	6M	Y-08	Auto Mechanic Lab	Bottle Filler DF	Drink		38-Y08-1				8:04 AM
38 O'Connor Rd	6M	Y-12	Auto Mechanic Clsrm	Sink	Drink		38-Y12-1				8:01 AM
38 O'Connor Rd	6M	Y-11	Auto Body Lab	Sink	Drink		38-Y11-1				8:08 AM
38 O'Connor Rd	5M	X-Hall	Drinking Ftn by X-06	Bottle Filler	Drink		38-XH-2				8:15
38 O'Connor Rd	5M	X-Hall	Drinking Ftn by X-06	Bottle Filler DF	Drink		38-XH-1				8:16

16  
17



# Cooler Receipt and Preservation

**R2512676** **5**  
 Labella Associates, PC  
 Monroe 1 BOCES 38 O'Connor Rd

Project/Client Labella Associates Folder Number \_\_\_\_\_

Cooler received on 10/4/25 by: MM COURIER: ALS UPS FEDEX VELOCITY CLIENT

1. Were Custody seals on outside of cooler?	Y <input checked="" type="radio"/> N <input type="radio"/>	5a. Did VOA vials have sig* bubbles?	Y <input type="radio"/> N <input checked="" type="radio"/> NA <input type="radio"/>
2. Custody papers properly completed (ink, signed)?	Y <input checked="" type="radio"/> N <input type="radio"/>	5b. Sig* bubbles: Alk? Y <input type="radio"/> N <input checked="" type="radio"/> NA <input type="radio"/>	Sulfide? Y <input type="radio"/> N <input checked="" type="radio"/> NA <input type="radio"/>
3. Did all bottles arrive in good condition (unbroken)?	Y <input checked="" type="radio"/> N <input type="radio"/>	6. Where did the bottles originate?	<u>ALS/ROC</u> <u>CLIENT</u>
4. Circle: Wet Ice Dry Ice Gel packs present?	Y <input checked="" type="radio"/> N <input type="radio"/>	7. Soil VOA received as:	Bulk <input type="radio"/> Encore <input type="radio"/> 5035set <input checked="" type="radio"/> NA <input type="radio"/>

8. Temperature Readings Date: 10/4/25 Time: 9:25 ID: IR#12 IR#11 From: Temp Blank Sample Bottle

Temp (°C)	<u>17.3</u>						
Within 0-6°C?	Y <input checked="" type="radio"/> N <input type="radio"/>	Y <input type="radio"/> N <input type="radio"/>	Y <input type="radio"/> N <input type="radio"/>	Y <input type="radio"/> N <input type="radio"/>	Y <input type="radio"/> N <input type="radio"/>	Y <input type="radio"/> N <input type="radio"/>	Y <input type="radio"/> N <input type="radio"/>
If <0°C, were samples frozen?	Y <input type="radio"/> N <input type="radio"/>	Y <input type="radio"/> N <input type="radio"/>	Y <input type="radio"/> N <input type="radio"/>	Y <input type="radio"/> N <input type="radio"/>	Y <input type="radio"/> N <input type="radio"/>	Y <input type="radio"/> N <input type="radio"/>	Y <input type="radio"/> N <input type="radio"/>

If out of Temperature, note packing/ice condition: No Ice needed Ice melted Poorly Packed (described below) Same Day Rule  
 & Client Approval to Run Samples: \_\_\_\_\_ Standing Approval Client aware at drop-off Client notified by: \_\_\_\_\_

All samples held in storage location: SMA by MM on 10/4/25 at 9:35  
 5035 samples placed in storage location: \_\_\_\_\_ by \_\_\_\_\_ on \_\_\_\_\_ at \_\_\_\_\_ within 48 hours of sampling? Y  N

Cooler Breakdown/Preservation Check\*\*: Date: 10/9 Time: 2:19 by: AS

- 9. Were all bottle labels complete (i.e. analysis, preservation, etc.)? YES  NO
- 10. Did all bottle labels and tags agree with custody papers? YES  NO
- 11. Were correct containers used for the tests indicated? YES  NO
- 12. Were 5035 vials acceptable (no extra labels, not leaking)? YES  NO  N/A
- 13. Were dissolved metals filtered in the field? YES  NO  N/A
- 14. Air Samples: Cassettes / Tubes Intact Y / N with MS Y / N Canisters Pressurized Tedlar® Bags Inflated N/A

pH	Lot of test paper	Reagent	Preserved?		Lot Received	Exp	Sample ID Adjusted	Vol. Added	Lot Added	Final pH
			Yes	No						
≥12		NaOH								
<u>2</u>	<u>202225</u>	HNO <sub>3</sub>		<u>x</u>	<u>Client bottles</u>		<u>All</u>	<u>4ml</u>		<u>≤ 2</u>
<u>2</u>		H <sub>2</sub> SO <sub>4</sub>								
<u>4</u>		NaHSO <sub>4</sub>								
5-9		For 608pest			No=Notify for 3day					
Residual Chlorine (-)		For CN, Phenol, 625, 608pest, 522			If +, contact PM to add Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (625, 608, CN), ascorbic (phenol).					
		Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub>								
		ZnAcetate	-	-						
		HCl	**	**						

\*\*VOAs and 1664 Not to be tested before analysis. Otherwise, all bottles of all samples with chemical preservatives are checked (not just representatives).

Bottle lot numbers: Client bottles  
 Explain all Discrepancies/ Other Comments:

HPROD	BULK
HTR	FLDT
SUB	HGFB
ALS	LL3541

Labels secondary reviewed by: AS \*significant air bubbles: VOA > 5-6 mm : WC > 1 in. diameter



## Miscellaneous Forms

**ALS Environmental—Rochester Laboratory**  
1565 Jefferson Road, Building 300, Suite 360, Rochester, NY 14623  
Phone (585) 288-5380 Fax (585) 288-8475  
[www.alsglobal.com](http://www.alsglobal.com)



## REPORT QUALIFIERS AND DEFINITIONS

- U Analyte was analyzed for but not detected. The sample quantitation limit has been corrected for dilution and for percent moisture, unless otherwise noted in the case narrative.
- J Estimated value due to either being a Tentatively Identified Compound (TIC) or that the concentration is between the MRL and the MDL. Concentrations are not verified within the linear range of the calibration. For DoD: concentration >40% difference between two GC columns (pesticides/Aroclors).
- B Analyte was also detected in the associated method blank at a concentration that may have contributed to the sample result.
- E Inorganics- Concentration is estimated due to the serial dilution was outside control limits.
- E Organics- Concentration has exceeded the calibration range for that specific analysis.
- D Concentration is a result of a dilution, typically a secondary analysis of the sample due to exceeding the calibration range or that a surrogate has been diluted out of the sample and cannot be assessed.
- \* Indicates that a quality control parameter has exceeded laboratory limits. Under the "Notes" column of the Form I, this qualifier denotes analysis was performed out of Holding Time.
- H Analysis was performed out of hold time for tests that have an "immediate" hold time criteria.
- # Spike was diluted out.
- + Correlation coefficient for MSA is <0.995.
- N Inorganics- Matrix spike recovery was outside laboratory limits.
- N Organics- Presumptive evidence of a compound (reported as a TIC) based on the MS library search.
- S Concentration has been determined using Method of Standard Additions (MSA).
- W Post-Digestion Spike recovery is outside control limits and the sample absorbance is <50% of the spike absorbance.
- P Concentration >40% difference between the two GC columns.
- C Confirmed by GC/MS
- Q DoD reports: indicates a pesticide/Aroclor is not confirmed ( $\geq 100\%$  Difference between two GC columns).
- X See Case Narrative for discussion.
- MRL Method Reporting Limit. Also known as:
- LOQ Limit of Quantitation (LOQ)  
The lowest concentration at which the method analyte may be reliably quantified under the method conditions.
- MDL Method Detection Limit. A statistical value derived from a study designed to provide the lowest concentration that will be detected 99% of the time. Values between the MDL and MRL are estimated (see J qualifier).
- LOD Limit of Detection. A value at or above the MDL which has been verified to be detectable.
- ND Non-Detect. Analyte was not detected at the concentration listed. Same as U qualifier.

### Rochester Lab ID # for State Accreditations<sup>1</sup>



NELAP States
Florida ID # E87674
New Hampshire ID # 2941
New York ID # 10145
Pennsylvania ID# 68-786
Texas ID#T104704581
Virginia #460167

Non-NELAP States
Connecticut ID #PH0556
Delaware Approved
Maine ID #NY01587
North Carolina #36701
North Carolina #676
Rhode Island LAO00333

<sup>1</sup> Analyses were performed according to our laboratory's NELAP-approved quality assurance program and any applicable state or agency requirements. The test results meet requirements of the current NELAP/TNI standards or state or agency requirements, where applicable, except as noted in the case narrative. Since not all analyte/method/matrix combinations are offered for state/NELAC accreditation, this report may contain results which are not accredited. For a specific list of accredited analytes, contact the laboratory. To verify NH accredited analytes, go to <https://www4.des.state.nh.us/CertifiedLabs/Certified-Method.aspx>.

# ALS Laboratory Group

---

## Acronyms

ASTM	American Society for Testing and Materials
A2LA	American Association for Laboratory Accreditation
CARB	California Air Resources Board
CAS Number	Chemical Abstract Service registry Number
CFC	Chlorofluorocarbon
CFU	Colony-Forming Unit
DEC	Department of Environmental Conservation
DEQ	Department of Environmental Quality
DHS	Department of Health Services
DOE	Department of Ecology
DOH	Department of Health
EPA	U. S. Environmental Protection Agency
ELAP	Environmental Laboratory Accreditation Program
GC	Gas Chromatography
GC/MS	Gas Chromatography/Mass Spectrometry
LUFT	Leaking Underground Fuel Tank
M	Modified
MCL	Maximum Contaminant Level is the highest permissible concentration of a substance allowed in drinking water as established by the USEPA.
MDL	Method Detection Limit
MPN	Most Probable Number
MRL	Method Reporting Limit
NA	Not Applicable
NC	Not Calculated
NCASI	National Council of the Paper Industry for Air and Stream Improvement
ND	Not Detected
NIOSH	National Institute for Occupational Safety and Health
PQL	Practical Quantitation Limit
RCRA	Resource Conservation and Recovery Act
SIM	Selected Ion Monitoring
TPH	Total Petroleum Hydrocarbons
tr	Trace level is the concentration of an analyte that is less than the PQL but greater than or equal to the MDL.

ALS Group USA, Corp.  
dba ALS Environmental

Analyst Summary report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288

**Service Request:** R2512676

**Sample Name:** 38-W01-1  
**Lab Code:** R2512676-001  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-W01-2  
**Lab Code:** R2512676-002  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-W05-3  
**Lab Code:** R2512676-003  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-X09-2  
**Lab Code:** R2512676-004  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-X09-1  
**Lab Code:** R2512676-005  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

ALS Group USA, Corp.  
dba ALS Environmental

Analyst Summary report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288

**Service Request:** R2512676

**Sample Name:** 38-X10-2  
**Lab Code:** R2512676-006  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-X10-1  
**Lab Code:** R2512676-007  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-Y002-2  
**Lab Code:** R2512676-008  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-Y02-1  
**Lab Code:** R2512676-009  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-Y07-2  
**Lab Code:** R2512676-010  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

ALS Group USA, Corp.  
dba ALS Environmental

Analyst Summary report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288

**Service Request:** R2512676

**Sample Name:** 38-07-1  
**Lab Code:** R2512676-011  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-Y08-2  
**Lab Code:** R2512676-012  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-Y08-1  
**Lab Code:** R2512676-013  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-Y12-1  
**Lab Code:** R2512676-014  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-Y11-1  
**Lab Code:** R2512676-015  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**ALS Group USA, Corp.**

dba ALS Environmental

Analyst Summary report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288

**Service Request:** R2512676

**Sample Name:** 38-XH-2  
**Lab Code:** R2512676-016  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN

**Sample Name:** 38-XH-1  
**Lab Code:** R2512676-017  
**Sample Matrix:** Drinking Water

**Date Collected:** 10/3/25  
**Date Received:** 10/4/25

**Analysis Method**  
200.8

**Extracted/Digested By**

**Analyzed By**  
NMANSEN



## PREPARATION METHODS

The preparation methods associated with this report are found in these tables unless discussed in the case narrative.

### INORGANIC

#### Water/Liquid Matrix

Analytical Method	Preparation Method
200.7 / 200.8	200.2
6010D	3005A/3010A
6020B	ILM05.3
9034 Sulfide Acid Soluble	9030B
SM 4500-CN-N-2016 Amenable and Residual Cyanide	SM 4500-CN-G and SM 4500-CN-B,C-2016
SM 4500-CN-E WAD Cyanide	SM 4500-CN-I

#### Solid/Soil/Non-Aqueous Matrix

Analytical Method	Preparation Method
6010D	3050B
6010D TCLP (1311) extract	3005A/3010A
6010D SPLP (1312) extract	3005A/3010A
7199	3060A
300.0 Anions/ 350.1/ 353.2/ SM 2320B/ SM 5210B/ 9056A Anions	DI extraction
For analytical methods not listed, the preparation method is the same as the analytical method reference.	

### ORGANIC

**Preparation Methods for Organic methods are listed in the header of the Results pages.**

#### Regarding "Bulk/5035A":

For soil/solid samples submitted in soil jars for Volatiles analysis, the prep method is listed as "Bulk/5035A". The lab follows the closed-system EPA 5035A protocols once the sample is transferred to a sealed vial, but collection in bulk in soil jars does not follow the collection protocols listed in EPA 5035A. In accordance with the NYSDOH technical notice of October 2012, all results or reporting limits <200 ug/kg are to be considered estimated due to potential low bias.



# Sample Results

**ALS Environmental—Rochester Laboratory**  
1565 Jefferson Road, Building 300, Suite 360, Rochester, NY 14623  
Phone (585) 288-5380 Fax (585) 288-8475  
[www.alsglobal.com](http://www.alsglobal.com)



# Metals

**ALS Environmental—Rochester Laboratory**  
1565 Jefferson Road, Building 300, Suite 360, Rochester, NY 14623  
Phone (585) 288-5380 Fax (585) 288-8475  
[www.alsglobal.com](http://www.alsglobal.com)

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-W01-1  
**Lab Code:** R2512676-001

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:20  
**Date Received:** 10/04/25 09:22  
**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 18:59	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-W01-2  
**Lab Code:** R2512676-002

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:21  
**Date Received:** 10/04/25 09:22

**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:03	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-W05-3  
**Lab Code:** R2512676-003

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:23  
**Date Received:** 10/04/25 09:22

**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:04	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-X09-2  
**Lab Code:** R2512676-004

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:13  
**Date Received:** 10/04/25 09:22

**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:06	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-X09-1  
**Lab Code:** R2512676-005

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:12  
**Date Received:** 10/04/25 09:22

**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:07	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-X10-2  
**Lab Code:** R2512676-006

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:11  
**Date Received:** 10/04/25 09:22  
**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:09	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-X10-1  
**Lab Code:** R2512676-007

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:10  
**Date Received:** 10/04/25 09:22  
**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:13	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-Y002-2  
**Lab Code:** R2512676-008

**Service Request:** R2512676  
**Date Collected:** 10/03/25 07:51  
**Date Received:** 10/04/25 09:22

**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:14	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-Y02-1  
**Lab Code:** R2512676-009

**Service Request:** R2512676  
**Date Collected:** 10/03/25 07:50  
**Date Received:** 10/04/25 09:22  
**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:16	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-Y07-2  
**Lab Code:** R2512676-010

**Service Request:** R2512676  
**Date Collected:** 10/03/25 07:57  
**Date Received:** 10/04/25 09:22  
**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:17	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-07-1  
**Lab Code:** R2512676-011

**Service Request:** R2512676  
**Date Collected:** 10/03/25 07:56  
**Date Received:** 10/04/25 09:22

**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:19	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-Y08-2  
**Lab Code:** R2512676-012

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:05  
**Date Received:** 10/04/25 09:22

**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:20	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-Y08-1  
**Lab Code:** R2512676-013

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:04  
**Date Received:** 10/04/25 09:22  
**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:22	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-Y12-1  
**Lab Code:** R2512676-014

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:01  
**Date Received:** 10/04/25 09:22  
**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.4	ug/L	1.0	1	10/20/25 19:23	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-Y11-1  
**Lab Code:** R2512676-015

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:08  
**Date Received:** 10/04/25 09:22  
**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	12.0	ug/L	1.0	1	10/20/25 19:24	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-XH-2  
**Lab Code:** R2512676-016

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:15  
**Date Received:** 10/04/25 09:22  
**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:26	

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** 38-XH-1  
**Lab Code:** R2512676-017

**Service Request:** R2512676  
**Date Collected:** 10/03/25 08:16  
**Date Received:** 10/04/25 09:22

**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 19:30	



## QC Summary Forms

**ALS Environmental—Rochester Laboratory**  
1565 Jefferson Road, Building 300, Suite 360, Rochester, NY 14623  
Phone (585) 288-5380 Fax (585) 288-8475  
[www.alsglobal.com](http://www.alsglobal.com)



# Metals

**ALS Environmental—Rochester Laboratory**  
1565 Jefferson Road, Building 300, Suite 360, Rochester, NY 14623  
Phone (585) 288-5380 Fax (585) 288-8475  
[www.alsglobal.com](http://www.alsglobal.com)

ALS Group USA, Corp.  
dba ALS Environmental

Analytical Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water  
**Sample Name:** Method Blank  
**Lab Code:** R2512676-MB

**Service Request:** R2512676  
**Date Collected:** NA  
**Date Received:** NA  
**Basis:** NA

Inorganic Parameters

Analyte Name	Analysis Method	Result	Units	MRL	Dil.	Date Analyzed	Q
Lead, Total	200.8	1.0 U	ug/L	1.0	1	10/20/25 18:56	

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water

**Service Request:** R2512676  
**Date Collected:** 10/03/25  
**Date Received:** 10/04/25  
**Date Analyzed:** 10/20/25

**Duplicate Matrix Spike Summary  
Inorganic Parameters**

**Sample Name:** 38-W01-1  
**Lab Code:** R2512676-001  
**Analysis Method:** 200.8

**Units:** ug/L  
**Basis:** NA

Analyte Name	Sample Result	Result	Matrix Spike R2512676-001MS		Duplicate Matrix Spike R2512676-001DMS		% Rec Limits	RPD	RPD Limit	
			Spike Amount	% Rec	Result	Spike Amount				% Rec
Lead, Total	1.0 U	19.4	20.0	97	19.7	20.0	99	70-130	2	20

Results flagged with an asterisk (\*) indicate values outside control criteria.

Results flagged with a pound (#) indicate the control criteria is not applicable.

Percent recoveries and relative percent differences (RPD) are determined by the software using values in the calculation which have not been rounded.

Matrix Spike and Matrix Spike Duplicate Data is presented for information purposes only. The matrix may or may not be relevant to samples reported in this report. The laboratory evaluates system performance based on the LCS and LCSD control limits.

ALS Group USA, Corp.  
dba ALS Environmental

QA/QC Report

**Client:** Labella Associates, PC  
**Project:** Monroe 1 BOCES 39 O'Connor Rd/2254288  
**Sample Matrix:** Drinking Water

**Service Request:** R2512676  
**Date Analyzed:** 10/20/25

**Lab Control Sample Summary**  
**Inorganic Parameters**

**Units:**ug/L  
**Basis:**NA

**Lab Control Sample**  
R2512676-LCS

<b>Analyte Name</b>	<b>Analytical Method</b>	<b>Result</b>	<b>Spike Amount</b>	<b>% Rec</b>	<b>% Rec Limits</b>
Lead, Total	200.8	21.4	20.0	107	85-115