

Third-Party Lead Clearance Testing Report

Performed On: August 19, 2025, 9:34 AM,
August 26, 2025, 10:10 AM, and August 28, 2025, 7:30 AM

Site:

Humboldt Park Public School (223)
3230 S Adams Avenue
Milwaukee, WI 53207

Owner:

Milwaukee Public Schools



Lead Safe Renovator:

JCP Construction LLC – DHS LSR Certification #: 2540270
1849 N MLK Drive, Suite 200
Milwaukee, WI 53212

LSR Supervisor: Brian Aldeen – DHS Certification #: LASI2506x473373

Clearance Testing Performed By:

Devin Gareis, DHS Certification #: LRA-297222
Jeremiah Hayes, DHS Certification #: LRA-300119
The Sigma Group, Inc.
1300 West Canal Street
Milwaukee, WI 53233
414-643-4200

DHS Lead Company Certification #: 17570

Table of Contents

1.	LEAD PAINT STABILIZATION / RENOVATION SCOPE OF WORK	1
2.	VISUAL INSPECTION OF THE INTERIOR	1
3.	VISUAL INSPECTION OF THE EXTERIOR.....	1
4.	LEAD CLEARANCE TESTING SCOPE OF WORK	1
5.	SUMMARY OF RESULTS	3
6.	QUALIFICATIONS OF REPORT	3
7.	MONITORING / MAINTENANCE	4
8.	DISCLOSURE REQUIREMENT	4
9.	CERTIFICATION STATEMENT	4

APPENDIX

APPENDIX A – Lead Dust Wipe Sample Results

APPENDIX B – Laboratory Analytical Results

APPENDIX C – Floor Plans with Each Sample Location Marked

APPENDIX D – Inspectors’ Certificates

1. LEAD PAINT STABILIZATION / RENOVATION SCOPE OF WORK

As communicated by Milwaukee Public Schools (MPS), interim control/renovation work performed by the lead safe renovation (LSR) contractor was completed in August 2025. The renovation work generally addressed the following:

Paint Hazards

- Windows – Interim controls applied to deteriorated interior casings and sills.
- Walls – Interim controls applied to deteriorated walls.

Dust Hazards

- Windows – Interior sills cleaned throughout the dwelling.
- Floors – Interior floors cleaned throughout the dwelling.

2. VISUAL INSPECTION OF THE INTERIOR

It is Sigma's understanding that, following the completion of renovation activities, the LSR firm completed a visual clearance for quality of work, cleanliness, post cleaning verification color card test in accordance to Wis. Admin. Code § DHS 163.14(11)(L). After passing the visual and verification tests, MPS staff completed enhanced cleaning in accordance with their Lead Dust Cleaning Standard Operating Procedure (SOP). Following the enhanced cleaning by MPS staff, MPS management conducted a quality and cleanliness visual inspection of the school. Upon passing the MPS quality and cleanliness visual inspection of a school, MPS, in coordination with the Milwaukee Health Department (MHD), directed Sigma to perform the visual and dust wipe clearance inspections.

Prior to clearance sample collection, Sigma conducted visual inspections throughout occupied areas including but not limited to DHS 163 and non-DHS 163 spaces (e.g., classrooms, offices, bathrooms, storage rooms, hallways, and other interior school areas) during the initial event on August 19, 2025, and two resampling events on August 26, 2025, and August 28, 2025.

While limited areas of deteriorated paint (e.g., cracking, flaking, chipping, and/or peeling) were observed; based on information provided by MPS and the LSR SOP, it was understood that the stabilization and cleaning activities of applicable accessible LBP surfaces had been completed prior to clearance. No visible dust, debris, or paint chips were observed on floors or other horizontal surfaces within or adjacent to the areas sampled.

3. VISUAL INSPECTION OF THE EXTERIOR

No exterior visual inspection nor testing was completed.

4. LEAD CLEARANCE TESTING SCOPE OF WORK

The third-party dust-wipe clearance protocol was performed at select MPS schools where renovation and repair work were completed in Summer 2025. Sigma personnel were instructed, as relayed verbally by the MHD in a meeting on Tuesday August 12, 2025, to follow the following specified protocol for dust wipe clearance sampling that was developed by MHD and MPS personnel.

Initial Clearance Testing

Dust-wipe samples were collected in accordance with Wis. Adm. Code § DHS 163.14(5)(c) and the specifications outlined by MPS and MHD, following Appendix 13.1, *Wipe Sampling of Settled Dust for Lead Determination*, found in the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing*, using disposable template guides, pre-moistened wipes, gloves, and documented sample handling and chain-of-custody procedures.

Specifically, dust wipe clearance sampling was completed in:

- At least four classrooms on each building level.
- Kindergarten classrooms with additional focus on special needs rooms and spatially across the building level (kindergarten and special needs rooms were identified in the field based on discussions with the school Engineer and on the size and type of furniture/equipment observed).
- A girls' and boys' bathroom on each floor.
- Corridors with sample locations focused on corridor intersections, ends, and lower stairwell landings.

The field collection of settled dust samples using wipe sampling methods is used to determine the presence of lead dust hazards on floors, windowsills, and window troughs in a child-occupied structure. The laboratory results were interpreted according to Wis. Adm. Code § DHS 163.14(5)(c)8 to meet the following clearance standards: less than (<) 10 micrograms per square foot ($\mu\text{g}/\text{ft}^2$) on floors, < 100 $\mu\text{g}/\text{ft}^2$ on windowsills, < 100 $\mu\text{g}/\text{ft}^2$ in window troughs, and < 40 $\mu\text{g}/\text{ft}^2$ on exterior porches.

Lead wipe samples were analyzed by:

BATTA Laboratories, LLC

Delaware Industrial Park
6 Garfield Way, Newark, DE 19713
Ph. 302-737-3376
Accreditation ID: LAP-100448

Follow-up Clearance Testing – Following Failure of a Clearance Limit on a Building Surfaces

Additional directions for dust-wipe clearance re-sampling were provided on August 20, 2025, by MPS in consultation with MHD and included the following:

- The building surfaces (floor or sill) that failed.
- The same building surfaces in three adjacent or nearby rooms to obtain a total of four samples.

The lead wipe samples from the third resampling event were analyzed by:

City of Milwaukee Health Department Public Health Laboratory

841 North Broadway, Room 205
Milwaukee, WI 53202
(414) 286-3526
Accreditation ID: 102186

5. SUMMARY OF RESULTS

The initial clearance sampling event was conducted on August 19, 2025, and included 57 dust-wipe samples collected from select classrooms, offices, bathrooms, storage rooms, hallways, and other interior school areas in accordance with Wisconsin DHS 163 and the specified MPS/MHD protocol.

Laboratory analysis identified lead dust hazards in seven samples, including five floor samples (Rooms 022, 013B, 013C, 012, and Corridor G-1 N) and two windowsills (Rooms 015 and 003), each with lead-dust concentrations exceeding the applicable clearance standards. Upon receipt of results, it is Sigma's understanding, the Owner notified the contractor to re-clean the failed building surfaces as well as similar surfaces in untested adjacent rooms.

After re-cleaning, as notified by MPS, a resampling event was conducted on August 26, 2025, to retest three of the seven previously failed locations (floors of Rooms 022 and 012, and the windowsill in Room 003) along with 17 additional samples from adjacent or nearby rooms. Laboratory results from the resampling event indicated that all three retested samples from the previously failed locations passed clearance, while two of the 17 additional sample locations (Rooms 021 and 033) failed.

Following these results, the contractor was again notified by the Owner of their responsibility to re-clean the failed components and similar components in untested rooms. A second resampling event was conducted on August 28, 2025, to retest the two failed floor locations and collect six additional floor samples from adjacent or surrounding rooms. One field blank sample (B001) was also collected and analyzed as a quality-control check. Laboratory results indicated that the two previously failed locations (Rooms 021 and 033) passed clearance, while one of the six adjacent floor samples (Room 036A) exceeded the 10 µg/ft² clearance standard and therefore failed.

Sigma was not instructed to collect retest samples from the initially failed Rooms 013B, 013C, Corridor G-1 N, or the windowsill in Room 015, nor was any additional sampling conducted by Sigma beyond the August 28, 2025, event. As these locations remain out of compliance, additional cleaning and subsequent clearance testing were recommended prior to occupancy.

The attached **Appendix A** provides a summary of the sample locations, surface types, laboratory detected lead concentrations, regulatory clearance levels, and pass/fail results. Notes regarding units, sampling notation, and applicable DHS 163 regulatory clearance levels are also included. The laboratory results are provided in **Appendix B**. The school floor plan showing sample locations is included in **Appendix C**, and the inspectors' certifications are provided in **Appendix D**.

6. QUALIFICATIONS OF REPORT

The clearance examination and associated sampling described above were conducted in accordance with the requirements of Wis. Admin. Code DHS 163 and applicable MPS/MHD protocols. The findings presented herein represent the condition of tested surfaces only at the time of sample collection and do not guarantee that lead dust hazards will not recur due to future activities, deterioration, or disturbance of lead-based paint or lead-containing materials. This clearance examination was conducted to determine whether lead dust was present on the floors and/or window sills within the areas subject to clearance testing in this child-occupied facility.

Floors and window sills not specifically mentioned in this report were not evaluated. Specifically, Sigma was instructed to not collect dust-wipe samples from:

- Window sills higher than a 6-year old child could reach.
- Stairwells, faculty rooms and bathrooms, and offices.
- Mechanical, electrical, boiler, and storage rooms, data closets, attics, and/or plumbing chases.
- Window troughs.
- Radiators.
- The exterior (including building components and soil).

The results are limited to the areas and components sampled and do not constitute a determination that the entire property is lead-free or that future conditions will remain free of lead dust hazards.

7. MONITORING / MAINTENANCE

New hazards may arise from renovation, deterioration, or other activities; ongoing monitoring and maintenance are recommended. Regular ongoing monitoring, maintenance and visual inspection should be conducted to identify any areas of new deterioration. This may be done by the building owner or a certified risk assessor or hazard investigator. Close attention should be given to areas that received interim control measures, enclosure or encapsulation. New lead hazards may develop over time. Document any new deterioration, rot, and substrate or component failure. These conditions should be corrected promptly using approved lead-safe work practices as part of an ongoing property maintenance program.


8. DISCLOSURE REQUIREMENT

A copy of this summary must be provided to new lessees (tenants) and purchasers of this property under Federal Law Section 1018 of Title X before they become obligated under a lease or sales contract. The complete report must also be provided to new purchasers and be made available to new tenants. Landlords (lessors) and sellers are also required to distribute an educational pamphlet and include standard warning language in their leases or sales contracts to ensure that parents have the information they need to protect their children from lead-based paint hazards.


9. CERTIFICATION STATEMENT

I certify that this clearance examination was conducted following the dust-wipe sampling methodology outlined in Appendix 13.1 of the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing* and the specifications provided by MPS and MHD. Based on visual inspection and laboratory analysis of dust-wipe samples, select areas subject to this clearance examination have not passed in accordance with the clearance values and interpretation criteria specified in Wis. Adm. Code § DHS 163.14(5)(c)8.

Clearance Investigator: Devin Gareis

Signature:  Date: September 10, 2025

Clearance Investigator: Jeremiah Hayes

Signature:  Date: September 10, 2025

APPENDIX A

Lead Dust Wipe Sample Results

LEAD INVESTIGATION DUST WIPE SAMPLE RESULTS
MILWAUKEE PUBLIC SCHOOLS

Lead

Renovation

Contractor: JCP Construction LLC

Site: 223 - Humboldt Park Elementary

Site Address: 3230 S Adams Avenue, Milwaukee

Inspection Type: Clearance - Lead Dust Wipe

Sigma Project #: 24270

Sample Date: 08/19/25

Risk Assessors: Devin Gareis and Yilda Torres

Resample Date: 08/26/25

Risk Assessors: Jeremiah Hayes and Jason Drews

Resample Date: 08/28/25

Risk Assessor: Devin Gareis

Sample No.	Description	Surface Type		Wipe Sample Detected Lead Concentration (ug/ft ²)						DHS Regulatory Clearance Level (ug/ft ²) ^{a,b,c}
		Floor	Window Sill	8/19/25	Pass / Fail	8/26/25	Pass / Fail	8/28/25	Pass / Fail	
031F	Room 031 Floor	X		<5	Pass	---	---	---	---	10
031S	Room 031 Sill		X	16	Pass	---	---	---	---	100
034F	Room 034 Floor	X		<5	Pass	<5	Pass	---	---	10
034S	Room 034 Sill		X	<5	Pass	---	---	---	---	100
034B F	Room 034B Floor	X		27	Pass	---	---	---	---	10
036F	Room 036 Floor	X		<5	Pass	---	---	---	---	10
036S	Room 036 Sill		X	11	Pass	---	---	---	---	100
042F	Room 042 Floor	X		5.90	Pass	<5	Pass	---	---	10
039F	Room 039 Floor	X		<5	Pass	---	---	---	---	10
Corr 3-3 N	Corridor 3-3 North Floor	X		<5	Pass	---	---	---	---	10
Corr 3-2 E	Corridor 3-2 East Floor	X		<5	Pass	---	---	---	---	10
Corr 3-2 W	Corridor 3-2 West Floor	X		<5	Pass	---	---	---	---	10
Corr 3-1 N	Corridor 3-1 North Floor	X		<5	Pass	---	---	---	---	10
Corr 2-1 N	Corridor 2-1 North Floor	X		<5	Pass	---	---	---	---	10
Corr 2-2 E	Corridor 2-2 East Floor	X		<5	Pass	---	---	---	---	10
Corr 2-2W	Corridor 2-2 West Floor	X		<5	Pass	---	---	---	---	10
Corr 2-3 N	Corridor 2-3 North Floor	X		<5	Pass	---	---	---	---	10
021F	Room 021 Floor	X		<5	Pass	13	Fail	<5	Pass	10
021S	Room 021 Sill		X	23	Pass	---	---	---	---	100
022F	Room 022 Floor	X		83	Fail	<5	Pass	---	---	10
022S	Room 022 Sill		X	10	Pass	---	---	---	---	100
024S	Room 024 Sill		X	17	Pass	---	---	---	---	100
024F	Room 024 Floor	X		<5	Pass	8.3	Pass	---	---	10
027F	Room 027 Floor	X		<5	Pass	---	---	---	---	10
027S	Room 027 Sill		X	59	Pass	---	---	---	---	100
Corr 1-1 N	Corridor 1-1 North Floor	X		<5	Pass	---	---	---	---	10
Corr 1-2 E	Corridor 1-2 East Floor	X		<5	Pass	---	---	---	---	10
Corr 1-2 W	Corridor 1-2 West Floor	X		<5	Pass	---	---	---	---	10
Corr 1-3 E	Corridor 1-3 East Floor	X		<5	Pass	---	---	---	---	10
015S	Room 015 Sill		X	120	Fail	---	---	---	---	100
015F	Room 015 Floor	X		<5	Pass	---	---	---	---	10
017F	Room 017 Floor	X		<5	Pass	---	---	---	---	10
017S	Room 017 Sill		X	93	Pass	---	---	---	---	100
013S	Room 013 Sill		X	37	Pass	---	---	---	---	100
013F	Room 013 Floor	X		6.2	Pass	<5	Pass	---	---	10

LEAD INVESTIGATION DUST WIPE SAMPLE RESULTS
MILWAUKEE PUBLIC SCHOOLS

Lead

Renovation

Contractor: JCP Construction LLC

Site: 223 - Humboldt Park Elementary

Site Address: 3230 S Adams Avenue, Milwaukee

Inspection Type: Clearance - Lead Dust Wipe

Sigma Project #: 24270

Sample Date: 08/19/25

Risk Assessors: Devin Gareis and Yilda Torres

Resample Date: 08/26/25

Risk Assessors: Jeremiah Hayes and Jason Drews

Resample Date: 08/28/25

Risk Assessor: Devin Gareis

Sample No.	Description	Surface Type		Wipe Sample Detected Lead Concentration (ug/ft ²)						DHS Regulatory Clearance Level (ug/ft ²) ^{a,b,c}
		Floor	Window Sill	8/19/25	Pass / Fail	8/26/25	Pass / Fail	8/28/25	Pass / Fail	
013B F	Room 013B Floor	X		16	Fail	---	---	---	---	10
013B S	Room 013B Sill		X	23	Pass	---	---	---	---	100
013C F	Room 013C Floor	X		41	Fail	---	---	---	---	10
013C A	Room 013C Sill		X	<3	Pass	---	---	---	---	100
012S	Room 012 Sill		X	30.00	Pass	---	---	---	---	100
012F	Room 012 Floor	X		18	Fail	5.2	Pass	---	---	10
003F	Room 003 Floor	X		<5	Pass	<5	Pass	---	---	10
003S	Room 003 Sill		X	300	Fail	61	Pass	---	---	100
Corr G-3 N	Corridor G-3 North Floor	X		<5	Pass	---	---	---	---	10
Corr G-2 E	Corridor G-2 East Floor	X		<5	Pass	---	---	---	---	10
Corr G-2 W	Corridor G-2 West Floor	X		<5	Pass	---	---	---	---	10
Corr G-1 N	Corridor G-1 North Floor	X		17	Fail	---	---	---	---	10
004F	Room 004 Floor	X		<5	Pass	<5	Pass	---	---	10
004S	Room 004 Sill		X	12	Pass	9.2	Pass	---	---	100
005S	Room 005 Sill		X	3.80	Pass	7.2	Pass	---	---	100
005F	Room 005 Floor	X		<5	Pass	<5	Pass	---	---	10
006F	Room 006 Floor	X		<5	Pass	---	---	---	---	10
006S	Room 006 Sill		X	25	Pass	---	---	---	---	100
007F	Room 007 Floor	X		<5	Pass	---	---	---	---	10
008B F	Room 008B Floor	X		<5	Pass	---	---	---	---	10
008A F	Room 008A Floor	X		8.1	Pass	---	---	---	---	10
B001F	Room B001 Floor	X		<5	Pass	---	---	---	---	10
001F	Room 001 Floor	X		---	---	<5	Pass	---	---	10
001S	Room 001 Sill		X	---	---	23	Pass	---	---	100
011F	Room 011 Floor	X		---	---	<5	Pass	---	---	10
018F	Room 018 Floor	X		---	---	<5	Pass	---	---	10
023F	Room 023 Floor	X		---	---	<5	Pass	---	---	10
032F	Room 032 Floor	X		---	---	<5	Pass	---	---	10
033F	Room 033 Floor	X		---	---	18	Fail	<5	Pass	10
024A F	Room 024A Floor	X		---	---	---	---	5.4	Pass	10
024C F	Room 024C Floor	X		---	---	---	---	<5	Pass	10
028D F	Room 028D Floor	X		---	---	---	---	7.3	Pass	10
034A F	Room 034A Floor	X		---	---	---	---	<5	Pass	10
032B F	Room 032B Floor	X		---	---	---	---	<5	Pass	10

LEAD INVESTIGATION DUST WIPE SAMPLE RESULTS
MILWAUKEE PUBLIC SCHOOLS

Lead

Renovation

Contractor: JCP Construction LLC

Site: 223 - Humboldt Park Elementary

Site Address: 3230 S Adams Avenue, Milwaukee

Inspection Type: Clearance - Lead Dust Wipe

Sigma Project #: 24270

Sample Date: 08/19/25

Risk Assessors: Devin Gareis and Yilda Torres

Resample Date: 08/26/25

Risk Assessors: Jeremiah Hayes and Jason Drews

Resample Date: 08/28/25

Risk Assessor: Devin Gareis

Sample No.	Description	Surface Type		Wipe Sample Detected Lead Concentration (ug/ft ²)						DHS Regulatory Clearance Level (ug/ft ²) ^{a,b,c}
		Floor	Window Sill	8/19/25	Pass / Fail	8/26/25	Pass / Fail	8/28/25	Pass / Fail	
036A F	Room 036A Floor	X		---	---	---	---	22	Fail	10

Notes:

ft² = cubic feet; ug/ft² = micrograms per square foot

--- = no sample collected

DHS 163 - Wisconsin Department of Health Services Ch. 163 Certification for the Identification, removal, and reduction of lead-based paint hazards

a. DHS 163 Regulatory Clearance Levels DHS 163.14(5)(c)8.a. = 10 µg/ft² on an interior floor.

b. DHS 163 Regulatory Clearance Levels DHS 163.14(5)(c)8.b. = 100 µg/ft² on an interior windowsill.

c. DHS 163 Regulatory Clearance Levels DHS 163.14(5)(c)8.c. = 100 µg/ft² on window wells or troughs.

APPENDIX B

Laboratory Analytical Results



RP25082011

EPA Lab ID #DE004

Dedicated to a Cleaner
Environment Since 1982**batta**
LABORATORIESBATTALABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764Newark, DE - Columbia, MD -
Philadelphia, PAWeb: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com**NVLAP**
Lab Code: 101032-DNY ELAP# 11993
PCM, PLM, TEM & LEAD

REPORT OF ANALYSIS

Report#: RP25082011

Project Number: 250820001

Project Name: The Sigma Group, Inc.

Project Location: 3230 S. Adams Ave Milwaukee, WI

Analyte Requested: Lead

Method: Test Method: NIOSH 9100 / NIOSH 7082

Matrix: Wipe

Date Sampled: 08/19/2025

Sampled By: Client

Date Received: 08/20/2025

Date Analyzed: 08/20/2025

Date Report Issued: 08/20/2025

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250820001.0 01	031F	Room 031	Flr.	1.00	<5	<5	5
250820001.0 02	031S	Room 031	Stl.	1.06	17.00	16.00	5
250820001.0 03	034F	Room 034	Flr.	1.00	<5	<5	5
250820001.0 04	034S	Room 034	Sill	1.06	29.00	27.00	5
250820001.0 05	034BF	Room 034B	Flr.	1.00	<5	<5	5
250820001.0 06	036F	Room 036	Flr.	1.00	<5	<5	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 µg/sq ft, window sills not to exceed 100 µg/sq ft, and window troughs not to exceed 400 µg/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLCCH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10µg/sq ft, window sills not to exceed 100µg/sq ft, window troughs not to exceed 100µg/sq ft and porch floors not to exceed 40µg/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTALABORATORIES.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY:
N.C. Batta/A. Lewis (QA/QC Officer)

Dedicated to a Cleaner
Environment Since 1982



NY ELAP# 11993
PCM, PLM, TEM & LEAD



BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302) 737-3376 Fax (302)-737-5764
Newark, DE - Columbia, MD -
Philadelphia, PA

Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com

RP25082011

EPA Lab ID #DE004



NVLAP
Lab Code: 101032-D

REPORT OF ANALYSIS

Report#:	RP25082011	Date Sampled:	08/19/2025
Project Number:	250820001	Sampled By:	Client
Project Name:	The Sigma Group, Inc.	Date Received:	08/20/2025
Project Location:	3230 S. Adams Ave Milwaukee, WI	Date Analyzed:	08/20/2025
Analyte Requested:	Lead	Date Report Issued:	08/20/2025
Method	Test Method: NIOSH 9100 / NIOSH 7082		
Matrix:	Wipe		

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250820001.0 07	036S	Room 036	Stl.	1.06	12.00	11.00	5
250820001.0 08	042F	Room 042	Flr.	1.00	5.90	5.90	5
250820001.0 09	039F	Room 039	Flr.	1.00	<5	<5	5
250820001.0 10	CORR 3-3 N	Corridor 3-3 North	Flr.	1.00	<5	<5	5
250820001.0 11	CORR 3-2 E	Corridor 3-2 East	Flr.	1.00	<5	<5	5
250820001.0 12	CORR 3-2 W	Corridor 3-2 West	Flr.	1.00	<5	<5	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY: 
N.C. Batta/A. Lewis (QA/QC Officer)

Dedicated to a Cleaner
Environment Since 1982



NY ELAP# 11993
PCM, PLM, TEM & LEAD



BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764
Newark, DE - Columbia, MD -
Philadelphia, PA

Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com

RP25082011

EPA Lab ID #DE004



NVLAP
Lab Code: 101032-D

REPORT OF ANALYSIS

Report#:	RP25082011	Date Sampled:	08/19/2025
Project Number:	250820001	Sampled By:	Client
Project Name:	The Sigma Group, Inc.	Date Received:	08/20/2025
Project Location:	3230 S. Adams Ave Milwaukee, WI	Date Analyzed:	08/20/2025
Analyte Requested:	Lead	Date Report Issued:	08/20/2025
Method	Test Method: NIOSH 9100 / NIOSH 7082		
Matrix:	Wipe		

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250820001.0 13	CORR 3-1 N	Corridor 3-1 North	Flr.	1.00	<5	<5	5
250820001.0 14	CORR 2-1 N	Corridor 2-1 North	Flr.	1.00	<5	<5	5
250820001.0 15	CORR 2-2 E	Corridor 2-2 East	Flr.	1.00	<5	<5	5
250820001.0 16	CORR 2-2 W	Corridor 2-2 West	Flr.	1.00	<5	<5	5
250820001.0 17	CORR 2-3 N	Corridor 2-3 North	Flr.	1.00	<5	<5	5
250820001.0 18	021F	Room 021	Flr.	1.00	<5	<5	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY: 
N.C. Batta/A. Lewis (QA/QC Officer)

Dedicated to a Cleaner
Environment Since 1982



NY ELAP# 11993
PCM, PLM, TEM & LEAD

batta
LABORATORIES

BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764
Newark, DE - Columbia, MD -
Philadelphia, PA

Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com

RP25082011

EPA Lab ID #DE004



NVLAP

Lab Code: 101032-D

REPORT OF ANALYSIS

Report#: RP25082011
Project Number: 250820001
Project Name: The Sigma Group, Inc.
Project Location: 3230 S. Adams Ave Milwaukee, WI
Analyte Requested: Lead
Method: Test Method: NIOSH 9100 / NIOSH 7082
Matrix: Wipe

Date Sampled: 08/19/2025
Sampled By: Client
Date Received: 08/20/2025
Date Analyzed: 08/20/2025
Date Report Issued: 08/20/2025

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250820001.0 19	021 S	Room 021	Stl.	1.06	24.00	23.00	5
250820001.0 20	022 F	Room 022	Flr.	1.00	83.00	83.00	5
250820001.0 21	022 S	Room 022	Stl.	1.06	11.00	10.00	5
250820001.0 22	024 S	Room 024	Stl.	1.06	18.00	17.00	5
250820001.0 23	024 F	Room 024	Flr.	1.00	<5	<5	5
250820001.0 24	027F	Room 027	Flr.	1.00	<5	<5	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY: A. Lewis
N.C. Batta/A. Lewis (QA/QC Officer)

Dedicated to a Cleaner
Environment Since 1982



NY ELAP# 11993
PCM, PLM, TEM & LEAD



BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764

Newark, DE - Columbia, MD -
Philadelphia, PA

Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com



RP25082011

EPA Lab ID #DE004



Lab Code: 101032-D

REPORT OF ANALYSIS

Report#:	RP25082011	Date Sampled:	08/19/2025
Project Number:	250820001	Sampled By:	Client
Project Name:	The Sigma Group, Inc.	Date Received:	08/20/2025
Project Location:	3230 S. Adams Ave Milwaukee, WI	Date Analyzed:	08/20/2025
Analyte Requested:	Lead	Date Report Issued:	08/20/2025
Method	Test Method: NIOSH 9100 / NIOSH 7082		
Matrix:	Wipe		

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250820001.0 25	027 S	Room 027	Stl.	1.06	63.00	59.00	5
250820001.0 26	CORR 1-1 N	Corridor 1-1 North	Flr.	1.00	<5	<5	5
250820001.0 27	CORR 1-2 W	Corridor 1-2 West	Flr.	1.00	<5	<5	5
250820001.0 28	CORR 1-2 E	Corridor 1-2 East	Flr.	1.00	<5	<5	5
250820001.0 29	CORR 1-3 N	Corridor 1-3 North	Flr.	1.00	<5	<5	5
250820001.0 30	015 S	Room 015	Stl.	1.06	130.00	120.00	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY: 
N.C. Batta/A. Lewis (QA/QC Officer)

Dedicated to a Cleaner
Environment Since 1982



NY ELAP# 11993
PCM, PLM, TEM & LEAD



BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764
Newark, DE - Columbia, MD -
Philadelphia, PA
Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com



RP25082011

EPA Lab ID #DE004



Lab Code: 101032-D

REPORT OF ANALYSIS

Report#:	RP25082011	Date Sampled:	08/19/2025
Project Number:	250820001	Sampled By:	Client
Project Name:	The Sigma Group, Inc.	Date Received:	08/20/2025
Project Location:	3230 S. Adams Ave Milwaukee, WI	Date Analyzed:	08/20/2025
Analyte Requested:	Lead	Date Report Issued:	08/20/2025
Method	Test Method: NIOSH 9100 / NIOSH 7082		
Matrix:	Wipe		

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250820001.0 31	015 F	Room 015	Flr.	1.00	<5	<5	5
250820001.0 32	017 F	Room 017	Flr.	1.00	<5	<5	5
250820001.0 33	017 S	Room 017	Stl.	1.06	99.00	93.00	5
250820001.0 34	013 S	Room 013	Stl.	1.06	39.00	37.00	5
250820001.0 35	013 F	Room 013	Flr.	1.00	6.20	6.20	5
250820001.0 36	013 BF	Room 013B	Flr.	1.00	16.00	16.00	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY: 
N.C. Batta/A. Lewis (QA/QC Officer)



RP25082011

Dedicated to a Cleaner
Environment Since 1982NY ELAP# 11993
PCM, PLM, TEM & LEAD**batta**
LABORATORIESBATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764Newark, DE - Columbia, MD -
Philadelphia, PAWeb: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com

EPA Lab ID #DE004

NVLAP

Lab Code: 101032-D

REPORT OF ANALYSIS

Report#:	RP25082011	Date Sampled:	08/19/2025
Project Number:	250820001	Sampled By:	Client
Project Name:	The Sigma Group, Inc.	Date Received:	08/20/2025
Project Location:	3230 S. Adams Ave Milwaukee, WI	Date Analyzed:	08/20/2025
Analyte Requested:	Lead	Date Report Issued:	08/20/2025
Method	Test Method: NIOSH 9100 / NIOSH 7082		
Matrix:	Wipe		

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250820001.0 37	013 BS	Room 013B	Stl.	1.47	34.00	23.00	5
250820001.0 38	013 CF	Room 013C	Flr.	1.00	41.00	41.00	5
250820001.0 39	013 CS	Room 013C	Stl.	1.95	<5	<3	5
250820001.0 40	012 S	Room 012	Stl.	1.06	32.00	30.00	5
250820001.0 41	012 F	Room 012	Flr.	1.00	18.00	18.00	5
250820001.0 42	003 F	Room 003	Flr.	1.00	<5	<5	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY:

N.C. Batta/A. Lewis (QA/QC Officer)



RP25082011

EPA Lab ID #DE004

Dedicated to a Cleaner
Environment Since 1982NY ELAP# 11993
PCM, PLM, TEM & LEAD**batta**
LABORATORIESBATTALABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764Newark, DE - Columbia, MD -
Philadelphia, PAWeb: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com**NVLAP**[®]

Lab Code: 101032-D

REPORT OF ANALYSIS

Report#:	RP25082011	Date Sampled:	08/19/2025
Project Number:	250820001	Sampled By:	Client
Project Name:	The Sigma Group, Inc.	Date Received:	08/20/2025
Project Location:	3230 S. Adams Ave Milwaukee, WI	Date Analyzed:	08/20/2025
Analyte Requested:	Lead	Date Report Issued:	08/20/2025
Method	Test Method: NIOSH 9100 / NIOSH 7082		
Matrix:	Wipe		

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250820001.0 43	003 S	Room 003	Stl.	0.97	290.00	300.00	5
250820001.0 44	CORR G-3 N	Corridor G-3 North	Flr.	1.00	<5	<5	5
250820001.0 45	CORR G-2 E	Corridor G-2 East	Flr.	1.00	<5	<5	5
250820001.0 46	CORR G-2 W	Corridor G-2 West	Flr.	1.00	<5	<5	5
250820001.0 47	CORR G-1 N	Corridor G-1 North	Flr.	1.00	17.00	17.00	5
250820001.0 48	004 F	Room 004	Flr.	1.00	<5	<5	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTALABORATORIES.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY: *A. Lewis*

N.C. Batta/A. Lewis (QA/QC Officer)



RP25082011

EPA Lab ID #DE004

Dedicated to a Cleaner
Environment Since 1982**batta**
LABORATORIES

BATTA LABORATORIES, LLC

Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817

Tel. (302)737-3376 Fax (302)-737-5764

Newark, DE - Columbia, MD -
Philadelphia, PAWeb: <http://www.battaenv.com>E-mail: battaenv@battaenv.com**NVLAP**

Lab Code: 101032-D

NY ELAP# 11993
PCM, PLM, TEM & LEAD

REPORT OF ANALYSIS

Report#: RP25082011

Project Number: 250820001

Project Name: The Sigma Group, Inc.

Project Location: 3230 S. Adams Ave Milwaukee, WI

Analyte Requested: Lead

Method: Test Method: NIOSH 9100 / NIOSH 7082

Matrix: Wipe

Date Sampled: 08/19/2025

Sampled By: Client

Date Received: 08/20/2025

Date Analyzed: 08/20/2025

Date Report Issued: 08/20/2025

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250820001.0 49	004 S	Room 004	Stl.	1.06	13.00	12.00	5
250820001.0 50	005 S	Room 005	Stl.	2.66	10.00	3.80	5
250820001.0 51	005 F	Room 005	Flr.	1.00	<5	<5	5
250820001.0 52	006 F	Room 006	Flr.	1.00	<5	<5	5
250820001.0 53	006 S	Room 006	Stl.	1.09	27.00	25.00	5
250820001.0 54	007 F	Room 007	Flr.	1.00	<5	<5	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY:
N.C. Batta/A. Lewis (QA/QC Officer)

Dedicated to a Cleaner
Environment Since 1982



NY ELAP# 11993
PCM, PLM, TEM & LEAD



BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764

**Newark, DE - Columbia, MD -
Philadelphia, PA**

Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com



EPA Lab ID #DE004



Lab Code: 101032-D

REPORT OF ANALYSIS

Report#:	RP25082011	Date Sampled:	08/19/2025
Project Number:	250820001	Sampled By:	Client
Project Name:	The Sigma Group, Inc.	Date Received:	08/20/2025
Project Location:	3230 S. Adams Ave Milwaukee, WI	Date Analyzed:	08/20/2025
Analyte Requested:	Lead	Date Report Issued:	08/20/2025
Method	Test Method: NIOSH 9100 / NIOSH 7082		
Matrix:	Wipe		

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250820001.0 55	008 BF	Room 008b	Flr.	1.00	<5	<5	5
250820001.0 56	008 AF	Room 008A	Flr.	1.00	8.10	8.10	5
250820001.0 57	Room B001	Room B001	Flr.	1.00	<5	<5	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLCHH, LBPCH and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY: 
N.C. Batta/A. Lewis (QA/QC Officer)



Corporate Headquarters
6 Garfield Way
Newark, DE. 19713

Ph: (855) 86-BATTA Email: BattaLaboratories@battaenv.com
Fx: (302) 737-5764 Web: https://battaenv.com



NVLAP: 101032
AIHA LAP, LLC: 100448
NY ELAP: 11993
EPA Lab: DE004
MD Lab: 263

Page 1 of 6



CHAIN OF CUSTODY

BL Project #: R102215

Customer Billing Information		Shipping Information		Turnaround Times (please refer to notes)		Method of Payment						
Name: <u>The Sigma Group</u>		☐ Picked up by BATTA ☐ Delivered by customer ☒ Shipped by customer	☒ 6-12 Hours / Rush (*Note 1) ☐ 24 Hours (*Note 2) ☐ 48 Hours (*Note 3) ☐ 72 Hours (*Note 4) ☐ 5 Days (*Note 5) ☐ 10 Days (*Note 6) <u>ETD generated on 8/20/25</u>	☐ Cash ☐ Visa/MasterCard/Discover ☐ Money Order ☐ Purchase Order # ☐ Check # ☐ Other ☐ Unit Price/Quote ☐ Total Payment ☐ Reference #:								
Billing Address 1: <u>1300 W Canal St</u>												
Billing Address 2: <u>Milwaukee, WI</u>												
Phone: <u>414-643-4200</u>												
Email: <u>Berniebm@milwaukee.k12.wi.us</u>												
Results To: <u>Brian Berner</u>												
* Notes Regarding Turnaround Times (TATs) Specific TATs depend on the test requested. TATs may not be available for all types of analysis. *Note 1 Client must make arrangements with lab to guarantee 6-12 Hour/RUSH TAT - Call (855)-862-2882 *Note 2 Unless a specific time is requested, results are guaranteed by 5pm on the following business day *Note 3 Unless a specific time is requested, results are guaranteed by 5pm on the 2nd business day *Note 4 Unless a specific time is requested, results are guaranteed by 5pm on the 3rd business day *Note 5 Unless a specific time is requested, results are guaranteed by 5pm on the 5th business day *Note 6 Unless a specific time is requested, results are guaranteed by 5pm on the 10th business day												
Client Project Information												
Project Name: <u>Lead ce nettes</u>	Project Location: <u>3730 S /</u>	If solid waste, will results be used for disposal in NJ? Yes ☐ No ☐ Were the samples collected in New York state? Yes ☐ No ☒		Project #: <u>Sigma #24270</u>	Sampled By: <u>Devin Gares</u> <u>Yilda Torres</u>							
Sample Information												
Lab Use Only	Field Sample ID#	Sample Location & Description	Sampling Date & Time	Sampling Info for Air /Surface Samples				Sample Type	Test Method	Laboratory Use Only		
				width (in)	length (in)	area (in ²)	area (feet ²)			Results	Date of Analysis	Analyst
001	031 F	Room 031 Floor	8/14/25 9:34am	12	12		1	dust wipe				
002	031 S	Room 031 S-11	9:36am	4 1/2	34		1	dust wipe				
003	034 F	Room 034 Floor	9:12am	12	12		1	dust wipe				
004	034 S	Room 034 S-11	9:16am	4 1/2	34		1	dust wipe				
005	034B F	Room 034B Floor	9:20am	12	12		1	dust wipe				
006	036 F	Room 036 Floor	9:28am	12	12		1	dust wipe				
007	036 S	Room 036 S-11	9:31am	4 1/2	34		1	dust wipe				
008	042 F	Room 042 Floor	9:32am	12	12		1	dust wipe				
009	039 F	Room 039 Floor	9:35am	12	12		1	dust wipe				
010	Corr 3-3 N	Corridor 3-3 North Floor	9:40am	12	12		1	dust wipe				
Special Instructions From Client:								Laboratory Use Only				
Sample Relinquished By: <u>XD</u> <u>Devin Gares</u>				Date: <u>8/14/25</u>	Time: <u>2:45pm</u>	Logged-in by: <u>CM</u>		Log-in Date: <u>8/20/25</u>	Date: <u>10:35</u>	Field Samples Acceptable ☒ Yes ☐ No ☐ On Ice		
Sample Received By: <u>ACM</u>				Date: <u>8/20/25</u>	Time: <u>0820</u>					Sample #: Sample Condition:		

For drinking water samples: for results to be valid, lab must receive samples on ice and within 48 hours of collection. For air samples collected by NIOSH 7400 and 7402: in accordance with these NIOSH methods, two field blanks. (or 10% of the number of field samples submitted, whichever is greater) must be submitted and be analyzed with field samples.

For solid waste samples: Before solid waste materials such as soil, ash, sludge, dredge spoils, etc. are disposed in New Jersey, they must undergo analysis following TCLP protocol. BATTA Labs is not responsible for waste disposal misrepresentations on this document. Document Control Item AM5

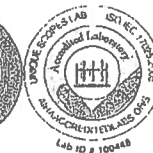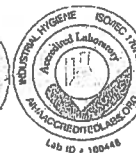**Corporate Headquarters**6 Garfield Way
Newark, DE. 19713Ph: (855) 86-BATTA Email: BattaLaboratories@battaenv.com
Fx: (302) 737-5764 Web: https://battaenv.comNVLAP: 101032
AIHA LAP, LLC: 100448
NY ELAP: 11993
EPA Lab: DE004
MD Lab: 263

Page 2 of 6

CHAIN OF CUSTODY

BL Project #: R102215

Customer Billing Information	Shipping Information	Turnaround Times (enter date, day, month)	Method of Payment
Name:	☐ Picked up by BATTA ☐ Delivered by customer ☐ Shipped by customer	☐ 6-12 Hours / Rush (*Note 1)	☐ Cash
Billing Address 1:		☐ 24 Hours (*Note 2)	☐ Visa/MasterCard/Discover
Billing Address 2:		☐ 48 Hours (*Note 3)	☐ Money Order
Phone:		☐ 72 Hours (*Note 4)	☐ Purchase Order #
Email:		☐ 5 Days (*Note 5)	☐ Check #
Results To:	☐ 10 Days (*Note 6)	☐ Other	☐ Unit Price/Quote
			☐ Total Payment
			☐ Reference #:

*** Notes Regarding Turnaround Times (TATs)**

Specific TATs depend on the test requested. TATs may not be available for all types of analysis.

*Note 1: Client must make arrangements with lab to guarantee 6-12 Hour/RUSH TAT - Call (855)-882-2882

*Note 2: Unless a specific time is requested, results are guaranteed by 5pm on the following business day.

*Note 3: Unless a specific time is requested, results are guaranteed by 5pm on the 2nd business day.

*Note 4: Unless a specific time is requested, results are guaranteed by 5pm on the 3rd business day.

*Note 5: Unless a specific time is requested, results are guaranteed by 5pm on the 5th business day.

*Note 6: Unless a specific time is requested, results are guaranteed by 5pm on the 10th business day.

Client Project Information

Project Name:	Project Location:	If solid waste, will results be used for disposal in NJ? Yes ☐ No ☐	Project #: Sigma #24270	Sampled By:
		Were the samples collected in New York state? Yes ☐ No ☒		

Sample Information

Lab Use Only	Field Sample ID#	Sample Location & Description	Sampling Date & Time	Sampling Info for Air / Surface Samples				Sample Type	Test Method	Laboratory Use Only		
				width (in)	length (in)	area (in ²)	area (feet ²)			Results	Date of Analysis	Analyst
011	Corr 3-2 E	Corridor 3-2 East Floor	8/19/25 9:12am	12	12			dust wipe			8/20	SH
012	Corr 3-2 W	Corridor 3-2 West Floor	9:15am	12	12			dust wipe				
013	Corr 3-1 N	Corridor 3-1 North Floor	9:16am	12	12			dust wipe				
014	Corr 2-1 N	Corridor 2-1 North Floor	9:59am	12	12			dust wipe				
015	Corr 2-2 E	Corridor 2-2 East Floor	9:06am	12	12			dust wipe				
016	Corr 2-2 W	Corridor 2-2 West Floor	9:11am	12	12			dust wipe				
017	Corr 2-3 N	Corridor 2-3 North Floor	9:13am	12	12			dust wipe				
018	021 F	Room 021 Floor	10:16am	12	12			dust wipe				
019	021 S	Room 021 Sill	10:21am	4 1/2	31			dust wipe				
020	022 F	Room 022 Floor	10:18am	12	12			dust wipe				

Special Instructions From Client:

Sample Relinquished By: X

Date:

Time:

Sample Received By: ACM

Date: 8/20/25

Time: 0820

Laboratory Use Only

Logged-In by:

Log-In Date:

Date:

Field Samples Acceptable ☒ Yes ☐ No ☐ On Ice

Sample #:

Sample Condition:


For drinking water samples: for results to be valid, lab must receive samples on ice and within 48 hours of collection. For air samples collected by NIOSH 7400 and 7402: in accordance with these NIOSH methods, two field blanks. (or 10% of the number of field samples submitted, whichever is greater) must be submitted and be analyzed with field samples.

For solid waste samples: Before solid waste materials such as soil, ash, sludge, dredge spoils, etc. are disposed in New Jersey, they must undergo analysis following TCLP protocol. BATTA Labs is not responsible for waste disposal misrepresentations on this document. Document Control Item AM5



Corporate Headquarters
6 Garfield Way
Newark, DE. 19713

Ph: (855) 86-BATTA Email: BattaLaboratories@battaenv.com
Fx: (302) 737-5764 Web: https://battaenv.com

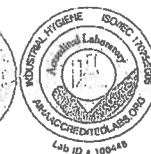

NVLAP: 101032
AIHA LAP, LLC: 100448
NY ELAP: 11993
EPA Lab: DE004
MD Lab: 263

Page 3 of 6

CHAIN OF CUSTODY

BL Project #: R102215

Customer Billing Information	Shipping Information	Turnaround Times	Method of Payment
Name:	☐ Picked up by BATTA ☐ Delivered by customer ☐ Shipped by customer	☐ 6-12 Hours / Rush (*Note 1)	☐ Cash
Billing Address 1:		☐ 24 Hours (*Note 2)	☐ Visa/MasterCard/Discover
Billing Address 2:		☐ 48 Hours (*Note 3)	☐ Money Order
Phone:		☐ 72 Hours (*Note 4)	☐ Purchase Order #
Email:		☐ 5 Days (*Note 5)	☐ Check #
Results To:		☐ 10 Days (*Note 6)	☐ Other

* Notes Regarding Turnaround Times (TATs)

Specific TATs depend on the test requested. TATs may not be available for all types of analysis.

*Note 1: Client must make arrangements with lab to guarantee 6-12 Hour/RUSH TAT - Call (855)-862-2882

*Note 2: Unless a specific time is requested, results are guaranteed by 5pm on the following business day.

*Note 3: Unless a specific time is requested, results are guaranteed by 5pm on the 2nd business day.

*Note 4: Unless a specific time is requested, results are guaranteed by 5pm on the 3rd business day.

*Note 5: Unless a specific time is requested, results are guaranteed by 5pm on the 5th business day.

*Note 6: Unless a specific time is requested, results are guaranteed by 5pm on the 10th business day.

Client Project Information

Project Name:	Project Location:	If solid waste, will results be used for disposal in NJ? Yes ☐ No ☐	Project #: Sigma #24270	Sampled By:
		Were the samples collected in New York state? Yes ☐ No ☒		

Sample Information

Lab Use Only	Field Sample ID#	Sample Location & Description	Sampling Date & Time	Sampling Info for Air / Surface Samples				Sample Type	Test Method	Laboratory Use Only		
				width (in)	length (in)	area (in ²)	area (feet ²)			Results	Date of Analysis	Analyst
021	022 S	Room 022 Sill	8/19/25 10:22am	4 1/2	34			dust wipe			8/20	SH
022	024 S	Room 024 Sill	10:10am	4 1/2	34			dust wipe				
023	024 F	Room 024 Floor	10:14am	12	12			dust wipe				
024	027 F	Room 027 Floor	10:03am	12	12			dust wipe				
025	027 S	Room 027 Sill	10:06am	4 1/2	34			dust wipe				
026	Corr 1-1 N	Corridor 1-1 North Floor	10:45am	12	12			dust wipe				
027	Corr 1-2 W	Corridor 1-2 West Floor	10:45am	12	12			dust wipe				
028	Corr 1-2 E	Corridor 1-2 East Floor	10:45am	12	12			dust wipe				
029	Corr 1-3 N	Corridor 1-3 North Floor	10:45am	12	12			dust wipe				
030	015 S	Room 015 Sill	10:51am	4 1/2	34			dust wipe				

Special Instructions From Client:

Sample Relinquished By: X

Date: Time:

Sample Received By: Aem

Date: 8/20/25 Time: 10:35

Laboratory Use Only

Logged-in by: cm	Log-In Date: 8/20/25	Date: 10:35	Field Samples Acceptable ☒ Yes ☐ No ☐ On Ice
Sample #:			Sample Condition:

For drinking water samples: for results to be valid, lab must receive samples on ice and within 48 hours of collection. For air samples collected by NIOSH 7400 and 7402: In accordance with these NIOSH methods, two field blanks. (or 10% of the number of field samples submitted, whichever is greater) must be submitted and be analyzed with field samples.

For solid waste samples: Before solid waste materials such as soil, ash, sludge, dredge spoils, etc. are disposed in New Jersey, they must undergo analysis following TCLP protocol. BATTA Labs is not responsible for waste disposal misrepresentations on this document. Document Control Item AM5



Corporate Headquarters
6 Garfield Way
Newark, DE. 19713

Ph: (855) 86-BATTA Email: BattaLaboratories@battaenv.com
F: (302) 737-5764 Web: https://battaenv.com



NVLAP: 101032
AIHA LAP, LLC: 100448
NY ELAP: 11993
EPA Lab: DE004
MD Lab: 263



Page 4 of 6

CHAIN OF CUSTODY

BL Project #: R102215

Customer Billing Information	Shipping Information	Turnaround Times	Method of Payment
Name:	☐ Picked up by BATTA ☐ Delivered by customer ☐ Shipped by customer	☐ 6-12 Hours / Rush (*Note 1)	☐ Cash
Billing Address 1:		☐ 24 Hours (*Note 2)	☐ Visa/MasterCard/Discover
Billing Address 2:		☐ 48 Hours (*Note 3)	☐ Money Order
Phone:		☐ 72 Hours (*Note 4)	☐ Purchase Order #
Email:		☐ 5 Days (*Note 5)	☐ Check #
Results To:	☐ 10 Days (*Note 6)	☐ Other	☐ Unit Price/Quote
			☐ Total Payment
			☐ Reference #:

* Notes Regarding Turnaround Times (TATs)

Specific TATs depend on the test requested. TATs may not be available for all types of analysis.

*Note 1: Client must make arrangements with lab to guarantee 6-12 Hour/RUSH TAT - Call (855)-862-2882

*Note 2: Unless a specific time is requested, results are guaranteed by 5pm on the following business day.

*Note 3: Unless a specific time is requested, results are guaranteed by 5pm on the 2nd business day.

*Note 4: Unless a specific time is requested, results are guaranteed by 5pm on the 3rd business day.

*Note 5: Unless a specific time is requested, results are guaranteed by 5pm on the 5th business day.

*Note 6: Unless a specific time is requested, results are guaranteed by 5pm on the 10th business day.

Client Project Information

Project Name:	Project Location:	If solid waste, will results be used for disposal in NJ? Yes ☐ No ☐	Project #: Sigma #24270	Sampled By:
		Were the samples collected in New York state? Yes ☐ No ☒		

Sample Information

Lab Use Only	Field Sample ID#	Sample Location & Description	Sampling Date & Time	Sampling Info for Air/Surface Samples				Sample Type	Test Method	Laboratory Use Only		
				width (in)	length (in)	area (in ²)	area (feet ²)			Results	Date of Analysis	Analyst
031	015 F	Room 015 Floor	8/19/25 10:51am	12	12		1	dust wipe			8/20	SM
032	017 F	Room 017 Floor	10:56am	12	12		1	dust wipe				
033	017 S	Room 017 Sill	10:56am	4 1/2	34		1	dust wipe				
034	013 S	Room 013 Sill	11:03am	4 1/2	34		1	dust wipe				
035	013 F	Room 013 Floor	11:04am	12	12		1	dust wipe				
036	013B F	Room 013B Floor	11:06am	12	12		1	dust wipe				
037	013B S	Room 013B Sill	11:06am	8	26 1/2		1.47	dust wipe				
038	013C F	Room 013C Floor	11:06am	12	12		1	dust wipe				
039	013C S	Room 013C Sill	11:07am	8 1/4	34		1.95	dust wipe				
040	012 S	Room 012 Sill	11:16am	4 1/2	34		1	dust wipe				

Special Instructions From Client:

Sample Relinquished By: X	Date:	Time:	Logged-in by: CM	Log-In Date: 8/20/25	Date: 10:35	Field Samples Acceptable ☒ Yes ☐ No ☐ On Ice
Sample Received By: ADM	Date: 8/24/25	Time: 0820	Sample #: Sample Condition:			

For drinking water samples: for results to be valid, lab must receive samples on ice and within 48 hours of collection. For air samples collected by NIOSH 7400 and 7402: In accordance with these NIOSH methods, two field blanks. (or 10% of the number of field samples submitted, whichever is greater) must be submitted and be analyzed with field samples.

For solid waste samples: Before solid waste materials such as soil, ash, sludge, dredge spoils, etc. are disposed in New Jersey, they must undergo analysis following TCLP protocol. BATTA Labs is not responsible for waste disposal misrepresentations on this document. Document Control Item AM5



CHAIN OF CUSTODY

BL Project #: R102215

Customer Billing Information	Shipping Information	Turnaround Times (working days, refer to notes)	Method of Payment
Name:	☐ Picked up by BATTA ☐ Delivered by customer ☐ Shipped by customer	☐ 6-12 Hours / Rush (*Note 1) ☐ 24 Hours (*Note 2) ☐ 48 Hours (*Note 3) ☐ 72 Hours (*Note 4) ☐ 5 Days (*Note 5) ☐ 10 Days (*Note 6)	☐ Cash
Billing Address 1:			☐ Visa/MasterCard/Discover
Billing Address 2:			☐ Money Order
Phone:			☐ Purchase Order #
Email:			☐ Check #
Results To:			☐ Other

* Notes Regarding Turnaround Times (TATs)

Specific TATs depend on the test requested. TATs may not be available for all types of analysis.

*Note 1: Client must make arrangements with lab to guarantee 6-12 Hour/RUSH TAT - Call (855)-862-2882

*Note 2: Unless a specific time is requested, results are guaranteed by 5pm on the following business day.

*Note 3: Unless a specific time is requested, results are guaranteed by 5pm on the 2nd business day.

*Note 4: Unless a specific time is requested, results are guaranteed by 5pm on the 3rd business day.

*Note 5: Unless a specific time is requested, results are guaranteed by 5pm on the 5th business day.

*Note 6: Unless a specific time is requested, results are guaranteed by 5pm on the 10th business day.

Client Project Information

Project Name:	Project Location:	If solid waste, will results be used for disposal in NJ? Yes ☐ No ☐ Were the samples collected in New York state? Yes ☐ No ☒	Project #: Sigma #24270	Sampled By:
---------------	-------------------	--	-------------------------	-------------

Sample Information

Lab Use Only	Field Sample ID#	Sample Location & Description	Sampling Date & Time	Sampling Info for Air /Surface Samples				Sample Type	Test Method	Laboratory Use Only		
				width (in)	length (in)	area (in ²)	area (feet ²)			Results	Date of Analysis	Analyst
041	012 F	Room 012 Floor	8/19/25 11:17am	12	12		1	dust wipe			8/20	SH
042	003 F	Room 003 Floor	11:35am	12	12		1	dust wipe				
043	003 S	Room 003 Sill	11:36am	4	35		.97	dust wipe				
044	Corr G-3 N	Corridor G-3 North Floor	11:38am	12	12		1	dust wipe				
045	Corr G-2 E	Corridor G-2 East Floor	11:38am	12	12		1	dust wipe				
046	Corr G-2 W	Corridor G-2 West Floor	11:41am	12	12		1	dust wipe				
047	Corr G-1 N	Corridor G-1 North Floor	11:42am	12	12		1	dust wipe				
048	004 F	Room 004 Floor	11:44am	12	12		1	dust wipe				
049	004 S	Room 004 Sill	11:46am	4 1/2	34		1	dust wipe				
050	005 S	Room 005 Sill	11:50am	12 3/4	36		2.65	dust wipe				

Special Instructions From Client:

Sample Relinquished By: <u>X</u>	Date:	Time:
Sample Received By: <u>Atom</u>	Date: <u>8/20/25</u>	Time: <u>0820</u>

Laboratory Use Only

Logged-in by: <u>Om</u>	Log-In Date: <u>8/20/25</u>	Date: <u>10:35</u>	Field Samples Acceptable ☒ Yes ☐ No ☐ On Ice
Sample #:			Sample Condition:

For drinking water samples: for results to be valid, lab must receive samples on ice and within 48 hours of collection. For air samples collected by NIOSH 7400 and 7402: in accordance with these NIOSH methods, two field blanks. (or 10% of the number of field samples submitted, whichever is greater) must be submitted and be analyzed with field samples.

For solid waste samples: Before solid waste materials such as soil, ash, sludge, dredge spoils, etc. are disposed in New Jersey, they must undergo analysis following TCLP protocol. BATTA Labs is not responsible for waste disposal misrepresentations on this document. Document Control Item AM5



Corporate Headquarters
6 Garfield Way
Newark, DE. 19713

Ph: (855) 86-BATTA Email: BattaLaboratories@battaenv.com
Fx: (302) 737-5764 Web: https://battaenv.com



NVLAP: 101032
AIHA LAP, LLC: 100448
NY ELAP: 11993
EPA Lab: DE004
MD Lab: 263

Page 6 of 6

CHAIN OF CUSTODY

BL Project #: R108215

Customer Billing Information	Shipping Information	Turnaround Times (Check one, refer to notes)	Method of Payment
Name:	☐ Picked up by BATTA ☐ Delivered by customer ☐ Shipped by customer	☐ 6-12 Hours / Rush (*Note 1) ☐ 24 Hours (*Note 2) ☐ 48 Hours (*Note 3) ☐ 72 Hours (*Note 4) ☐ 5 Days (*Note 5) ☐ 10 Days (*Note 6)	☐ Cash
Billing Address 1:			☐ Visa/MasterCard/Discover
Billing Address 2:			☐ Money Order
Phone:			☐ Purchase Order #
Email:			☐ Check #
Results To:			☐ Other
* Notes Regarding Turnaround Times (TATs) Specific TATs depend on the test requested. TATs may not be available for all types of analysis *Note 1: Client must make arrangements with lab to guarantee 6-12 Hour/RUSH TAT - Call (855)-862-2862 *Note 2: Unless a specific time is requested, results are guaranteed by 5pm on the following business day *Note 3: Unless a specific time is requested, results are guaranteed by 5pm on the 2nd business day *Note 4: Unless a specific time is requested, results are guaranteed by 5pm on the 3rd business day. *Note 5: Unless a specific time is requested, results are guaranteed by 5pm on the 5th business day. *Note 6: Unless a specific time is requested, results are guaranteed by 5pm on the 10th business day			☐ Unit Price/Quote ☐ Total Payment ☐ Reference #:

Client Project Information			
Project Name:	Project Location:	If solid waste, will results be used for disposal in NJ? Yes ☐ No ☐ Were the samples collected in New York state? Yes ☐ No ☒	Project #: Sigma #24270 Sampled By:

Sample Information												
Lab Use Only	Field Sample ID#	Sample Location & Description	Sampling Date & Time	Sampling Info for Air /Surface Samples				Sample Type	Test Method	Laboratory Use Only		
				width (in)	length (in)	area (in ²)	area (feet ²)			Results	Date of Analysis	Analyst
OS1	005 F	Room 005 Floor	8-19-25 11:30am	12	12		1	dust wipe			8/20	SH
OS2	006 F	Room 006 Floor	11:52am	12	12		1	dust wipe				
OS3	006 S	Room 006 Sill	11:52am	5 1/4	30		1.09	dust wipe				
OS4	007 F	Room 007 Floor	11:56am	12	12		1	dust wipe				
OS5	008B F	Room 008B Floor	11:57am	12	12		1	dust wipe				
OS6	008A F	Room 008A Floor	11:57am	12	12		1	dust wipe				
OS7	Room B001	Room B001	12:03pm	12	12		1	dust wipe				
								dust wipe				
								dust wipe				
								dust wipe				

Special Instructions From Client:				Laboratory Use Only			
Sample Relinquished By: X	Date:	Time:		Logged-in by: Cm	Log-in Date: 8/20/25	Date: 10:35	Field Samples Acceptable ☒ Yes ☐ No ☐ On Ice
Sample Received By: Aam	Date: 8/20/25	Time: 0820					Sample #:
							Sample Condition:

For drinking water samples: for results to be valid, lab must receive samples on ice and within 48 hours of collection. For air samples collected by NIOSH 7400 and 7402: in accordance with these NIOSH methods, two field blanks. (or 10% of the number of field samples submitted, whichever is greater) must be submitted and be analyzed with field samples.

For solid waste samples: Before solid waste materials such as soil, ash, sludge, dredge spoils, etc. are disposed in New Jersey, they must undergo analysis following TCLP protocol. BATTA Labs is not responsible for waste disposal misrepresentations on this document. Document Control Item AM5



RP25082723

Dedicated to a Cleaner
Environment Since 1982NY ELAP# 11993
PCM, PLM, TEM & LEAD**batta**
LABORATORIESBATTALABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764
Newark, DE - Columbia, MD -
Philadelphia, PAWeb: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com

EPA Lab ID #DE004

NVLAP

Lab Code: 101032-D

REPORT OF ANALYSIS

Report#: RP25082723

Project Number: 250827003

Project Name: The Sigma Group, Inc.

Project Location: Humboldt Park Elementary - 3230 S Adams Ave Milwaukee, WI

Analyte Requested: Lead

Method Test Method: NIOSH 9100 / NIOSH 7082

Matrix: Wipe

Date Sampled: 08/26/2025

Sampled By: Client

Date Received: 08/27/2025

Date Analyzed: 08/27/2025

Date Report Issued: 08/27/2025

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250827003.001	004F	Room 004	Flr.	1.00	<5	<5	5
250827003.002	003F	Room 003	Flr.	1.00	<5	<5	5
250827003.003	005F	Room 005	Flr.	1.00	<5	<5	5
250827003.004	001F	Room 001	Flr.	1.00	<5	<5	5
250827003.005	004S	Room 004	Stl.	1.41	13.00	9.20	5
250827003.006	003S	Room 003	Stl.	1.41	86.00	61.00	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTALABORATORIES.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY: N.C. Batta/A. Lewis

N.C. Batta/A. Lewis (QA/QC Officer)

Dedicated to a Cleaner
Environment Since 1982



NY ELAP# 11993
PCM, PLM, TEM & LEAD

batta
LABORATORIES

BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764

Newark, DE - Columbia, MD -
Philadelphia, PA

Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com



RP25082723

EPA Lab ID #DE004

NVLAP

Lab Code: 101032-D

REPORT OF ANALYSIS

Report#: RP25082723
Project Number: 250827003
Project Name: The Sigma Group, Inc.
Project Location: Humboldt Park Elementary - 3230 S Adams Ave Milwaukee, WI
Analyte Requested: Lead
Method: Test Method: NIOSH 9100 / NIOSH 7082
Matrix: Wipe
Date Sampled: 08/26/2025
Sampled By: Client
Date Received: 08/27/2025
Date Analyzed: 08/27/2025
Date Report Issued: 08/27/2025

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250827003.0 07	005S	Room 005	Stl.	1.01	7.30	7.20	5
250827003.0 08	001S	Room 001	Stl.	1.15	27.00	23.00	5
250827003.0 09	012F	Room 012	Flr.	1.00	5.20	5.20	5
250827003.0 10	013F	Room 013	Flr.	1.00	<5	<5	5
250827003.0 11	011F	Room 011	Flr.	1.00	<5	<5	5
250827003.0 12	018F	Room 018	Flr.	1.00	<5	<5	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY: *[Signature]*

N.C. Batta/A. Lewis (QA/QC Officer)

Dedicated to a Cleaner
Environment Since 1982



NY ELAP# 11993
PCM, PLM, TEM & LEAD



BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764

**Newark, DE - Columbia, MD -
Philadelphia, PA**

Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com



EPA Lab ID #DE004



Lab Code: 101032-D

REPORT OF ANALYSIS

Report#:	RP25082723	Date Sampled:	08/26/2025
Project Number:	250827003	Sampled By:	Client
Project Name:	The Sigma Group, Inc.	Date Received:	08/27/2025
Project Location:	Humboldt Park Elementary - 3230 S Adams Ave Milwaukee, WI	Date Analyzed:	08/27/2025
Analyte Requested:	Lead	Date Report Issued:	08/27/2025
Method	Test Method: NIOSH 9100 / NIOSH 7082		
Matrix:	Wipe		

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250827003.0 13	022F	Room 022	Flr.	1.00	<5	<5	5
250827003.0 14	021F	Room 021	Flr.	1.00	13.00	13.00	5
250827003.0 15	023F	Room 023	Flr.	1.00	<5	<5	5
250827003.0 16	024F	Room 024	Flr.	1.00	8.30	8.30	5
250827003.0 17	032F	Room 032	Flr.	1.00	<5	<5	5
250827003.0 18	033F	Room 033	Flr.	1.00	18.00	18.00	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY: 
N.C. Batta/A. Lewis (QA/QC Officer)

Dedicated to a Cleaner
Environment Since 1982



NY ELAP# 11993
PCM, PLM, TEM & LEAD



BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764
Newark, DE - Columbia, MD -
Philadelphia, PA

Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com



RP25082723

EPA Lab ID #DE004

NVLAP

Lab Code: 101032-D

REPORT OF ANALYSIS

Report#:	RP25082723	Date Sampled:	08/26/2025
Project Number:	250827003	Sampled By:	Client
Project Name:	The Sigma Group, Inc.	Date Received:	08/27/2025
Project Location:	Humboldt Park Elementary - 3230 S Adams Ave Milwaukee, WI	Date Analyzed:	08/27/2025
Analyte Requested:	Lead	Date Report Issued:	08/27/2025
Method	Test Method: NIOSH 9100 / NIOSH 7082		
Matrix:	Wipe		

Lab Sample #	Client Sample ID	Sample Description	Sample Location	Sampled Area (ft ²)	µg / sample	µg/ft ²	Reporting Limit (µg/sample)
250827003.0 19	034F	Room 034	Flr.	1.00	<5	<5	5
250827003.0 20	042F	Room 042	Flr.	1.00	<5	<5	5

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. Composite wipes are not covered by AIHA ELLAP under NLLAP Accreditation Program. 10. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Sarah Hopkins

End of Report

QA/QC BY:
N.C. Batta/A. Lewis (QA/QC Officer)

CHAIN OF CUSTODY

BL Project #: _____

Customer Billing Information:				Shipping Information		Turnaround Times (check one, refer to notes*)		Method of Payment					
Name: <u>The Sigma Group</u>				☐ Picked up by BATTA ☐ Delivered by customer ☒ Shipped by customer		☒ 6-12 Hours / Rush (*Note 1) ☐ 24 Hours (*Note 2) ☐ 48 Hours (*Note 3) ☐ 72 Hours (*Note 4) ☐ 5 Days (*Note 5) ☐ 10 Days (*Note 6)		☐ Cash					
Billing Address 1: <u>1300 W. Canal St</u>								☐ Visa/MasterCard/Discover					
Billing Address 2: <u>Milwaukee, WI 53233</u>								☐ Money Order					
Phone: <u>414-643-4200</u>								☐ Purchase Order #					
Email: <u>Bernie.bm@milwaukee.k12.wi.us</u>								☐ Check #					
Results To: <u>Brian Berner</u>								☐ Other					
* Notes Regarding Turnaround Times (TATs) Specific TATs depend on the test requested. TATs may not be available for all types of analysis. *Note 1: Client must make arrangements with lab to guarantee 6-12 Hour/RUSH TAT - Call (855)-862-2882 *Note 2: Unless a specific time is requested, results are guaranteed by 5pm on the following business day. *Note 3: Unless a specific time is requested, results are guaranteed by 5pm on the 2nd business day. *Note 4: Unless a specific time is requested, results are guaranteed by 5pm on the 3rd business day. *Note 5: Unless a specific time is requested, results are guaranteed by 5pm on the 5th business day. *Note 6: Unless a specific time is requested, results are guaranteed by 5pm on the 10th business day.													
Client Project Information													
Project Name: <u>Re Wipe Sampling</u>		Project Location: <u>(Humboldt Park Elementary) 3230 S Adams Ave Milwaukee</u>		If solid waste, will results be used for disposal in NJ? Yes ☐ No ☐ Were the samples collected in New York state? Yes ☐ No ☐		Project #: <u>24770</u>		Sampled By: <u>Jeremiah Hayes</u> <u>Jason Drews</u>					
Sample Information													
Lab Use Only	Field Sample ID#	Sample Location & Description	Sampling Date & Time	Sampling Info for Air / Surface Samples				Sample Type	Test Method	Laboratory Use Only			
				Start Time	Stop Time	Flow Rate	Volume/Area			Results	Date of Analysis	Analyst	
01	004F	Room 004	8-26-25 / 10:10 AM				50 FT ²				8/27	SH	
02	003F	Room 003											
03	005F	Room 005											
04	001F	Room 001											
05	004S	Room 004					4.625 x 44" = 203.5 in ²						
	~~004F~~						203.5 in ²						
06	003S	Room 003					1.44 x 25 sq ft						
07	005S	Room 005					16.5 sq ft						
08	001S	Room 001											
Special Instructions From Client:											Laboratory Use Only		
Sample Relinquished By: <u>X [Signature]</u>				Date: <u>8/26/25</u> Time: <u>3:07 PM</u>		Logged-In by: <u>CM</u> Log-In Date: <u>8/27/25</u> Date: <u>12:55</u>		Field Samples Acceptable ☒ Yes ☐ No ☐ On Ice					
Sample Received By: <u>CM</u>				Date: <u>8/27/25</u> Time: <u>8:40</u>				Sample #: _____ Sample Condition: _____					

For drinking water samples: for results to be valid, lab must receive samples on ice and within 48 hours of collection. For air samples collected by NIOSH 7400 and 7402: in accordance with these NIOSH methods, two field blanks. (or 10% of the number of field samples submitted, whichever is greater) must be submitted and be analyzed with field samples.

For solid waste samples: Before solid waste materials such as soil, ash, sludge, dredge spoils, etc. are disposed in New Jersey, they must undergo analysis following TCLP protocol. BATTA Labs is not responsible for waste disposal misrepresentations on this document. Document Control Item A5

CHAIN OF CUSTODY

BL Project #: _____

Customer Billing Information:				Shipping Information		Turnaround Times (check one, refer to notes *)		Method of Payment				
Name:				☐ Picked up by BATTA ☐ Delivered by customer ☐ Shipped by customer		☐ 6-12 Hours / Rush (*Note 1) ☐ 24 Hours (*Note 2) ☐ 48 Hours (*Note 3) ☐ 72 Hours (*Note 4) ☐ 5 Days (*Note 5) ☐ 10 Days (*Note 6)		☐ Cash				
Billing Address 1:								☐ Visa/MasterCard/Discover				
Billing Address 2:								☐ Money Order				
Phone:								☐ Purchase Order #				
Email:								☐ Check #				
Results To:								☐ Other				
* Notes Regarding Turnaround Times (TATs) Specific TATs depend on the test requested. TATs may not be available for all types of analysis. *Note 1: Client must make arrangements with lab to guarantee 6-12 Hour/RUSH TAT - Call (855)-862-2882 *Note 2: Unless a specific time is requested, results are guaranteed by 5pm on the following business day. *Note 3: Unless a specific time is requested, results are guaranteed by 5pm on the 2nd business day. *Note 4: Unless a specific time is requested, results are guaranteed by 5pm on the 3rd business day. *Note 5: Unless a specific time is requested, results are guaranteed by 5pm on the 5th business day. *Note 6: Unless a specific time is requested, results are guaranteed by 5pm on the 10th business day.												
Client Project Information												
Project Name:		Project Location:		If solid waste, will results be used for disposal in NJ? Yes ☐ No ☐		Project #:		Sampled By:				
				Were the samples collected in New York state? Yes ☐ No ☐								
Sample Information												
Lab Use Only	Field Sample ID#	Sample Location & Description	Sampling Date & Time	Sampling Info for Air /Surface Samples				Sample Type	Test Method	Laboratory Use Only		
				Start Time	Stop Time	Flow Rate	Volume/Area			Results	Date of Analysis	Analyst
09	012 F	Room 012	8-26-25/10:53AM				Sq Ft			8/27	SM	
10	013 F	Room 013	↓	↓			↓					
11	011 F	Room 011	↓	↓			↓					
12	018 F	Room 018	↓	↓			↓					
13	022 F	Room 022	↓	11:04AM			↓					
14	021 F	Room 021	↓	↓			↓					
15	023 F	Room 023	↓	↓			↓					
16	024 F	Room 024	↓	↓			↓					
Special Instructions From Client:											Laboratory Use Only	
Sample Relinquished By: X				Date:	Time:	Logged-In by: OM		Log-In Date: 8/27/25	Date: 12:55	Field Samples Acceptable ☒ Yes ☐ No ☐ On Ice		
Sample Received By: OM				Date: 8/27/25	Time: 8:40					Sample #: _____ Sample Condition: _____		

For drinking water samples: for results to be valid, lab must receive samples on ice and within 48 hours of collection. For air samples collected by NIOSH 7400 and 7402: in accordance with these NIOSH methods, two field blanks. (or 10% of the number of field samples submitted, whichever is greater) must be submitted and be analyzed with field samples.

For solid waste samples: Before solid waste materials such as soil, ash, sludge, dredge spoils, etc. are disposed in New Jersey, they must undergo analysis following TCLP protocol. BATTA Labs is not responsible for waste disposal misrepresentations on this document. Document Control Item AM5



CHAIN OF CUSTODY

BL Project #: _____

Customer Billing Information:		Shipping Information		Turnaround Times (check one, refer to notes)		Method of Payment						
Name:		☐ Picked up by BATTA ☐ Delivered by customer ☐ Shipped by customer	☐ 6-12 Hours / Rush (*Note 1) ☐ 24 Hours (*Note 2) ☐ 48 Hours (*Note 3) ☐ 72 Hours (*Note 4) ☐ 5 Days (*Note 5) ☐ 10 Days (*Note 6)		☐ Cash ☐ Visa/MasterCard/Discover ☐ Money Order ☐ Purchase Order # ☐ Check # ☐ Other							
Billing Address 1:												
Billing Address 2:												
Phone:												
Email:												
Results To:						☐ Unit Price/Quote ☐ Total Payment ☐ Reference #:						
* Notes Regarding Turnaround Times (TATs) Specific TATs depend on the test requested. TATs may not be available for all types of analysis. *Note 1: Client must make arrangements with lab to guarantee 6-12 Hour/RUSH TAT - Call (855)-862-2882 *Note 2: Unless a specific time is requested, results are guaranteed by 5pm on the following business day. *Note 3: Unless a specific time is requested, results are guaranteed by 5pm on the 2nd business day. *Note 4: Unless a specific time is requested, results are guaranteed by 5pm on the 3rd business day. *Note 5: Unless a specific time is requested, results are guaranteed by 5pm on the 5th business day. *Note 6: Unless a specific time is requested, results are guaranteed by 5pm on the 10th business day.												
Client Project Information												
Project Name:		Project Location:		If solid waste, will results be used for disposal in NJ? Yes ☐ No ☐		Project #:						
				Were the samples collected in New York state? Yes ☐ No ☐		Sampled By:						
Sample Information												
Lab Use Only	Field Sample ID#	Sample Location & Description	Sampling Date & Time	Sampling Info for Air /Surface Samples				Sample Type	Test Method	Laboratory Use Only		
				Start Time	Stop Time	Flow Rate	Volume/Area			Results	Date of Analysis	Analyst
	~~032F~~											
17	032F	Room 032	10-26-25	11:15AM			sq Ft				8/27	SM
18	033F	Room 033	↓	↓			↓					
19	034F	Room 034										
20	042F	Room 042										
Special Instructions From Client:				Laboratory Use Only								
Sample Relinquished By: X				Date:	Time:	Logged-In by: Om		Log-In Date: 8/27/25	Date: 12:55	Field Samples Acceptable ☒ Yes ☐ No ☐ On Ice		
Sample Received By: Om				Date: 8/27/25	Time: 8:40					Sample #: _____		
										Sample Condition: _____		

For drinking water samples: for results to be valid, lab must receive samples on ice and within 48 hours of collection. For air samples collected by NIOSH 7400 and 7402: in accordance with these NIOSH methods, two field blanks. (or 10% of the number of field samples submitted, whichever is greater) must be submitted and be analyzed with field samples.

For solid waste samples: Before solid waste materials such as soil, ash, sludge, dredge spoils, etc. are disposed in New Jersey, they must undergo analysis following TCLP protocol. BATTA Labs is not responsible for waste disposal misrepresentations on this document. Document Control Item AM5

City of Milwaukee Health Department Public Health Laboratory

Frank P. Zeidler Municipal Building
841 North Broadway, Room 205
Milwaukee, WI 53202-3653
Fax: (414) 286-5098
Phone: (414) 286-3526
www.milwaukee.gov/health

Fax Transmission

To: **Fax Number:** LEADADMIN@MILWAUKEE.GOV,RPINHAN@MILWAUK
Company/Person: LDR
Location: MHD LEAD PROGRAM

Date/Time: 08/28/25 05:13 PM CDT **Number of pages:** 4

CONFIDENTIALITY NOTICE:

The documents accompanying this fax transmission may contain information that is confidential and/or legally privileged. It is intended for use only by the person to whom it is directed. If you are not the person to whom this transmission is directed, you are hereby notified that any disclosure, copying, distribution and/or the taking of any action based upon its contents is strictly prohibited. If you have received this transmission in error, please notify us immediately by telephone at (414) 286-3526 to arrange for the return of the original documents to us.

CITY OF MILWAUKEE
HEALTH DEPARTMENT

City of Milwaukee-Public Health Laboratories
841 North Broadway, Room 205 Milwaukee, WI 53202-3653
Phone Number: (414)286-3526 Fax Number: (414)286-5098
Autoreporting Lab

Submitter copy to:

HOME ENVIRONMENTAL HEALTH LEAD PROGRAM
841 N Broadway Ave
1st Floor
Milwaukee, WI 53202

Order ID : Z6280007

LRN : 0000325531

Auxiliary ID : 223

Date Collected: 08/28/25

Date Received : 08/28/25

Requested by: UNKNOWN, DOCTOR

FINAL

Patient Name: CP/S/ADAMSAV, 3230

DOB:

Age:

Sex:

Ord. Comm: 8 Clearance Dust Wipes
Job # 223

Lead in Dust Wipes

TEST-NAME	RESULT	AB	NRML-RANGE	UNITS	DATE-TIME
COLLECTED 08/28/25 07:30 RECEIVED 08/28/25 10:11					

Sample 1

Dust Wipe 1	*<5.0			ug/sq.ft.	08/28/25 17:12
Width	*12.00			in.	08/28/25 17:12
Length	*12.00			in.	08/28/25 17:12

Sample 2

Dust Wipe 2	*5.4			ug/sq.ft.	08/28/25 17:12
Width	*12.00			in.	08/28/25 17:12
Length	*12.00			in.	08/28/25 17:12

Sample 3

Dust Wipe 3	*<5.0			ug/sq.ft.	08/28/25 17:12
Width	*12.00			in.	08/28/25 17:12
Length	*12.00			in.	08/28/25 17:12

Sample 4

Dust Wipe 4	*7.3			ug/sq.ft.	08/28/25 17:12
Width	*12.00			in.	08/28/25 17:12
Length	*12.00			in.	08/28/25 17:12

Sample 5

Dust Wipe 5	*<5.0			ug/sq.ft.	08/28/25 17:12
Width	*12.00			in.	08/28/25 17:12

continued on next page

Legends: L-Low, H-High, AB-Abnormal, P-Panic, C-Critical, X-Extreme

David Payne, PhD.
Laboratory Director

Printed: 08/28/2025 17:13

PAGE: 1 of 3

CITY OF MILWAUKEE
HEALTH DEPARTMENT

City of Milwaukee-Public Health Laboratories
841 North Broadway, Room 205 Milwaukee, WI 53202-3653
Phone Number: (414)286-3526 Fax Number: (414)286-5098
Autoreporting Lab

Submitter copy to:

HOME ENVIRONMENTAL HEALTH LEAD PROGRAM
 841 N Broadway Ave
 1st Floor
 Milwaukee, WI 53202

Order ID : Z6280007

LRN : 0000325531

Auxiliary ID : 223

Date Collected: 08/28/25

Date Received : 08/28/25

Requested by: UNKNOWN, DOCTOR

FINAL

Patient Name: CP/S/ADAMSAV, 3230

DOB:

Age:

Sex:

Ord. Comm: 8 Clearance Dust Wipes
 Job # 223

continued

Lead in Dust Wipes

TEST-NAME	RESULT	AB	NRML-RANGE	UNITS	DATE-TIME
Length	*12.00			in.	08/28/25 17:12
Sample 6					
Dust Wipe 6	*<5.0			ug/sq.ft.	08/28/25 17:12
Width	*12.00			in.	08/28/25 17:12
Length	*12.00			in.	08/28/25 17:12
Sample 7					
Dust Wipe 7	*<5.0			ug/sq.ft.	08/28/25 17:12
Width	*12.00			in.	08/28/25 17:12
Length	*12.00			in.	08/28/25 17:12
Sample 8					
Dust Wipe 8	*22			ug/sq.ft.	08/28/25 17:12
Width	*12.00			in.	08/28/25 17:12
Length	*12.00			in.	08/28/25 17:12

Legends: L-Low, H-High, AB-Abnormal, P-Panic, C-Critical, X-Extreme

David Payne, PhD.
 Laboratory Director

Printed: 08/28/2025 17:13

PAGE: 2 of 3

CITY OF MILWAUKEE
HEALTH DEPARTMENT

City of Milwaukee-Public Health Laboratories
841 North Broadway, Room 205 Milwaukee, WI 53202-3653
Phone Number: (414)286-3526 Fax Number: (414)286-5098
Autoreporting Lab

Submitter copy to:

HOME ENVIRONMENTAL HEALTH LEAD PROGRAM
 841 N Broadway Ave
 1st Floor
 Milwaukee, WI 53202

Order ID : Z6280007

LRN : 0000325531

Auxiliary ID : 223

Date Collected: 08/28/25

Date Received : 08/28/25

Requested by: UNKNOWN, DOCTOR

FINAL

Patient Name: CP/S/ADAMSAV, 3230

DOB:

Age:

Sex:

Ord. Comm: 8 Clearance Dust Wipes
 Job # 223

Lead in Dust Wipes

TEST-NAME	RESULT	AB	NRML-RANGE	UNITS	DATE-TIME
-----------	--------	----	------------	-------	-----------

Test Method

Test Method

*see below

08/28/25 10:43

Sample Preparation: Modified ASTM E1644 per PbSOP

Analytical Method: Modified EPA Method 7000B per PbSOP

Minimum Reporting Limit: 5.0 ug/sqft

Minimum Detection Limit: 2.5 ug/sqft

Sample results have not been corrected for field blank or analytical blank. Results related only to those samples tested. All sample area information is provided to the lab by the client unless otherwise stated.

QC results associated with these samples were acceptable unless otherwise noted.

Data reviewed and approved by the QA Coordinator/Technical Manager.

Accrediting body: AIHA-LAP, LLC; Lab ID #102186.

Legends: L-Low, H-High, AB-Abnormal, P-Panic, C-Critical, X-Extreme

David Payne, PhD.

Laboratory Director

Printed: 08/28/2025 17:13

PAGE: 3 of 3

Milwaukee Health Department - CHAIN OF CUSTODY

Company: MPS

Test Request: PB

Type Test: Dust Wipe

Date/ Time Collected: 8/28/25 7:30am

Job #: _____

Address: 3230 S. Adams Ave, Milwaukee

Sampler Name: Devin Gareis

Sampler Signature: [Signature] *Humboldt*

Grantee: The Sigma Group

Sample #	Location	Type	Size
1-223	021 F	Dust Wipe	12"x12" = 1ft ²
2-223	024A F	↓	↓
3-223	024C F		
4-223	028D F		
5-223	033 F		
6-223	034A F		
7-223	032B F		
8-223	036A F		

Relinquished By: [Signature] Devin Gareis

Date/ Time: 8/28/25

Received By: _____

Date/ Time: _____

Relinquished By: _____

Date/ Time: _____


Received By: _____

Date/ Time: _____

GOVT:OTM 00 010 200


APPENDIX C

Floor Plans with All Sample Locations Marked


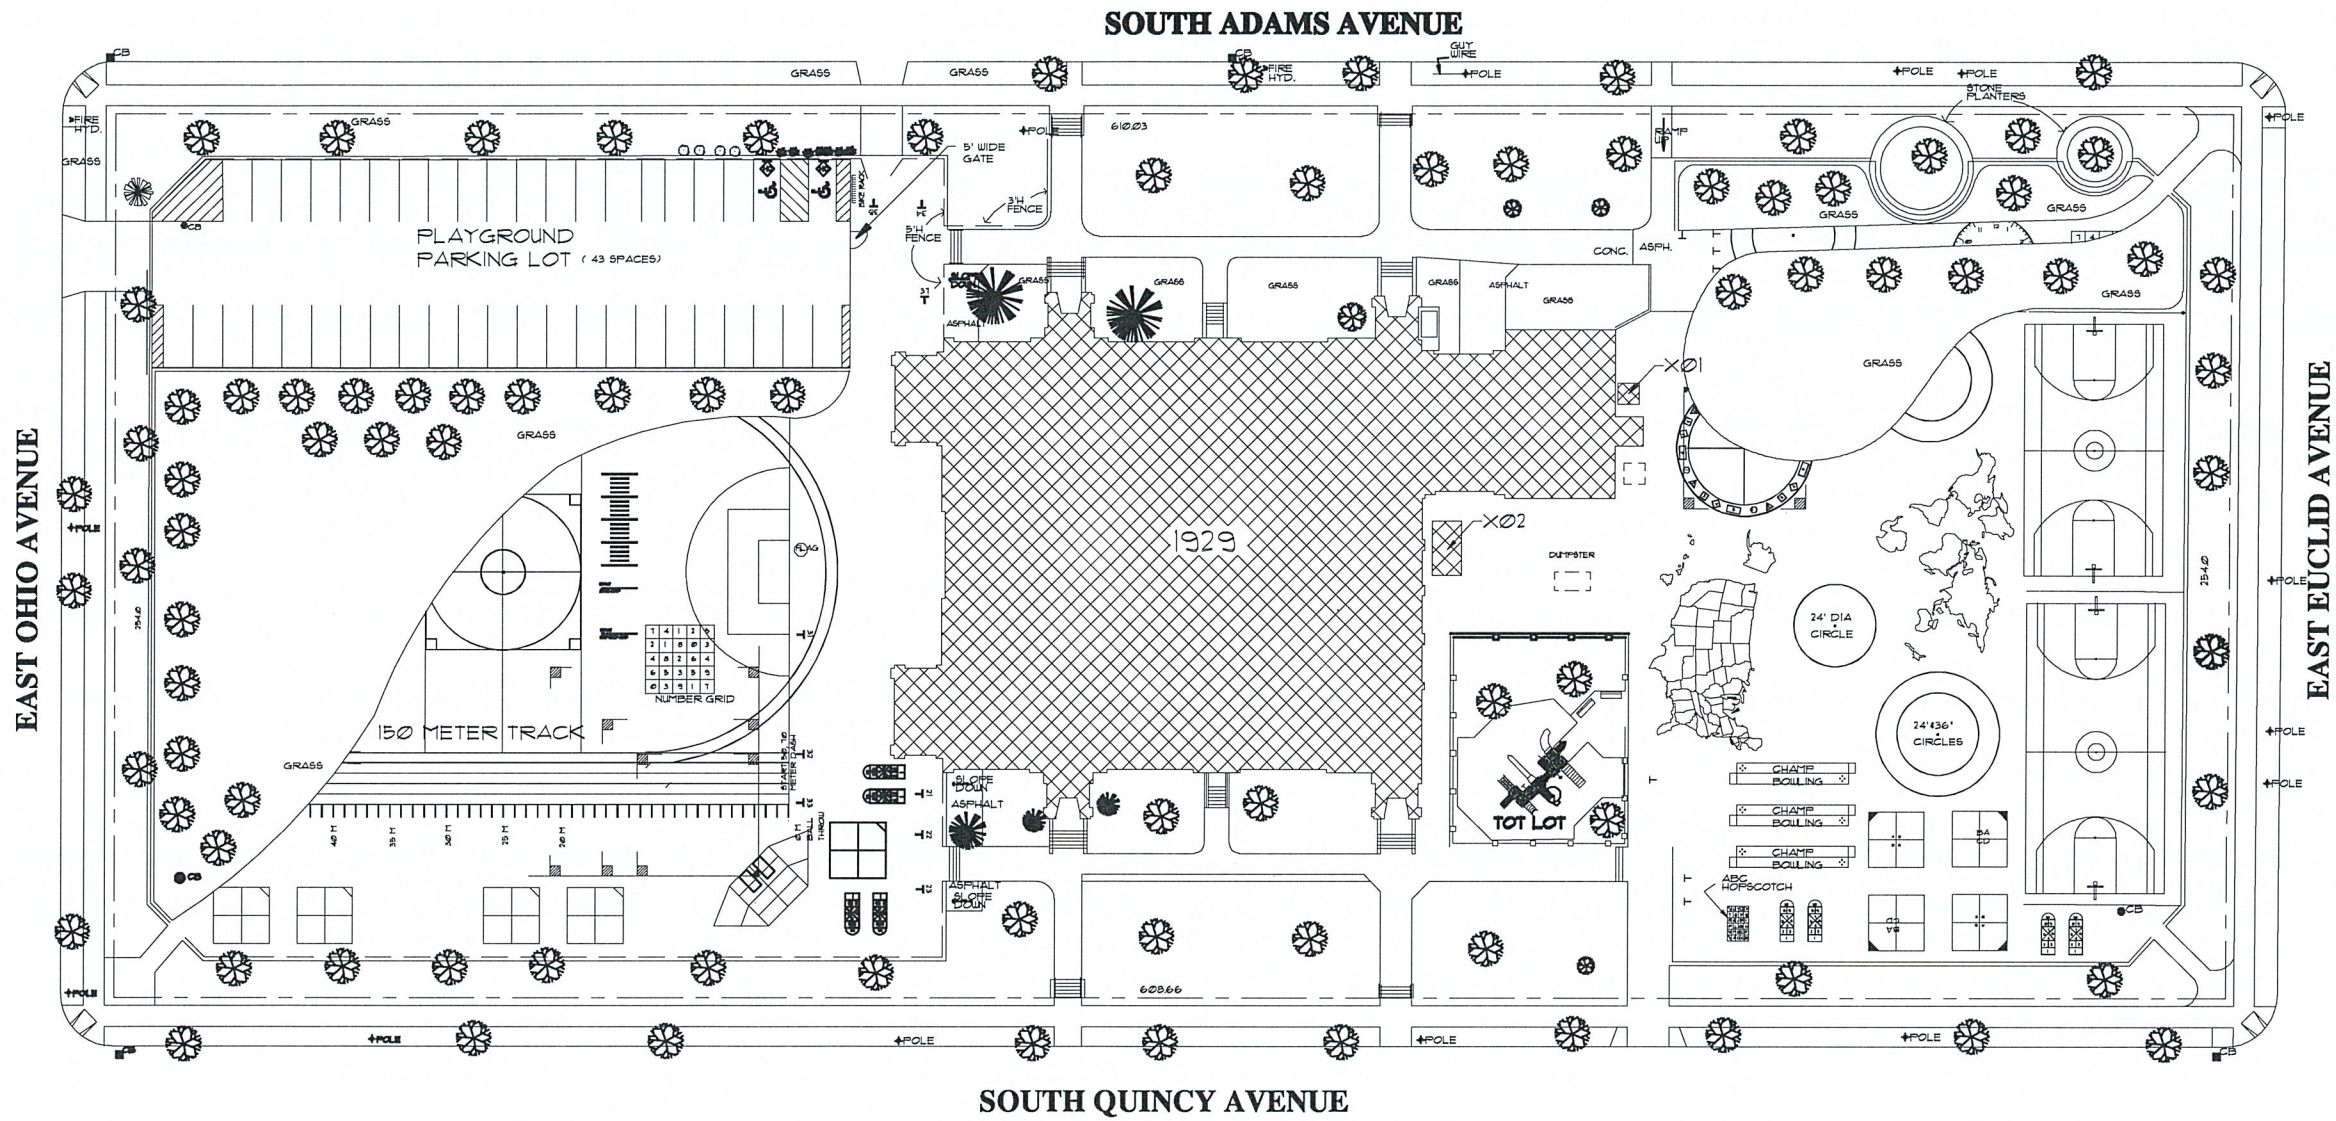


SITE PLAN

SITE NO. 223 - HUMBOLDT PARK ELEMENTARY SCHOOL
3230 S. ADAMS AVE., MILW., WI., 53207
DATE: 12/14/09

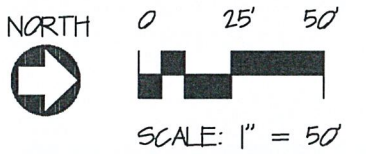



Milwaukee Public Schools
Division of Facilities and Maintenance Services
1124 North 11th Street
P.O. BOX 0289
Milwaukee, Wisconsin 53205-0289
Phone: 414-283-4800
Fax: 414-283-4662

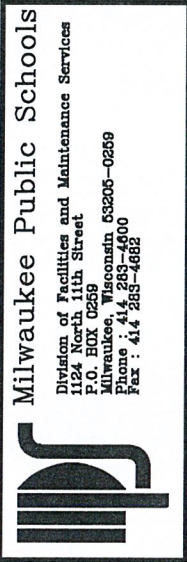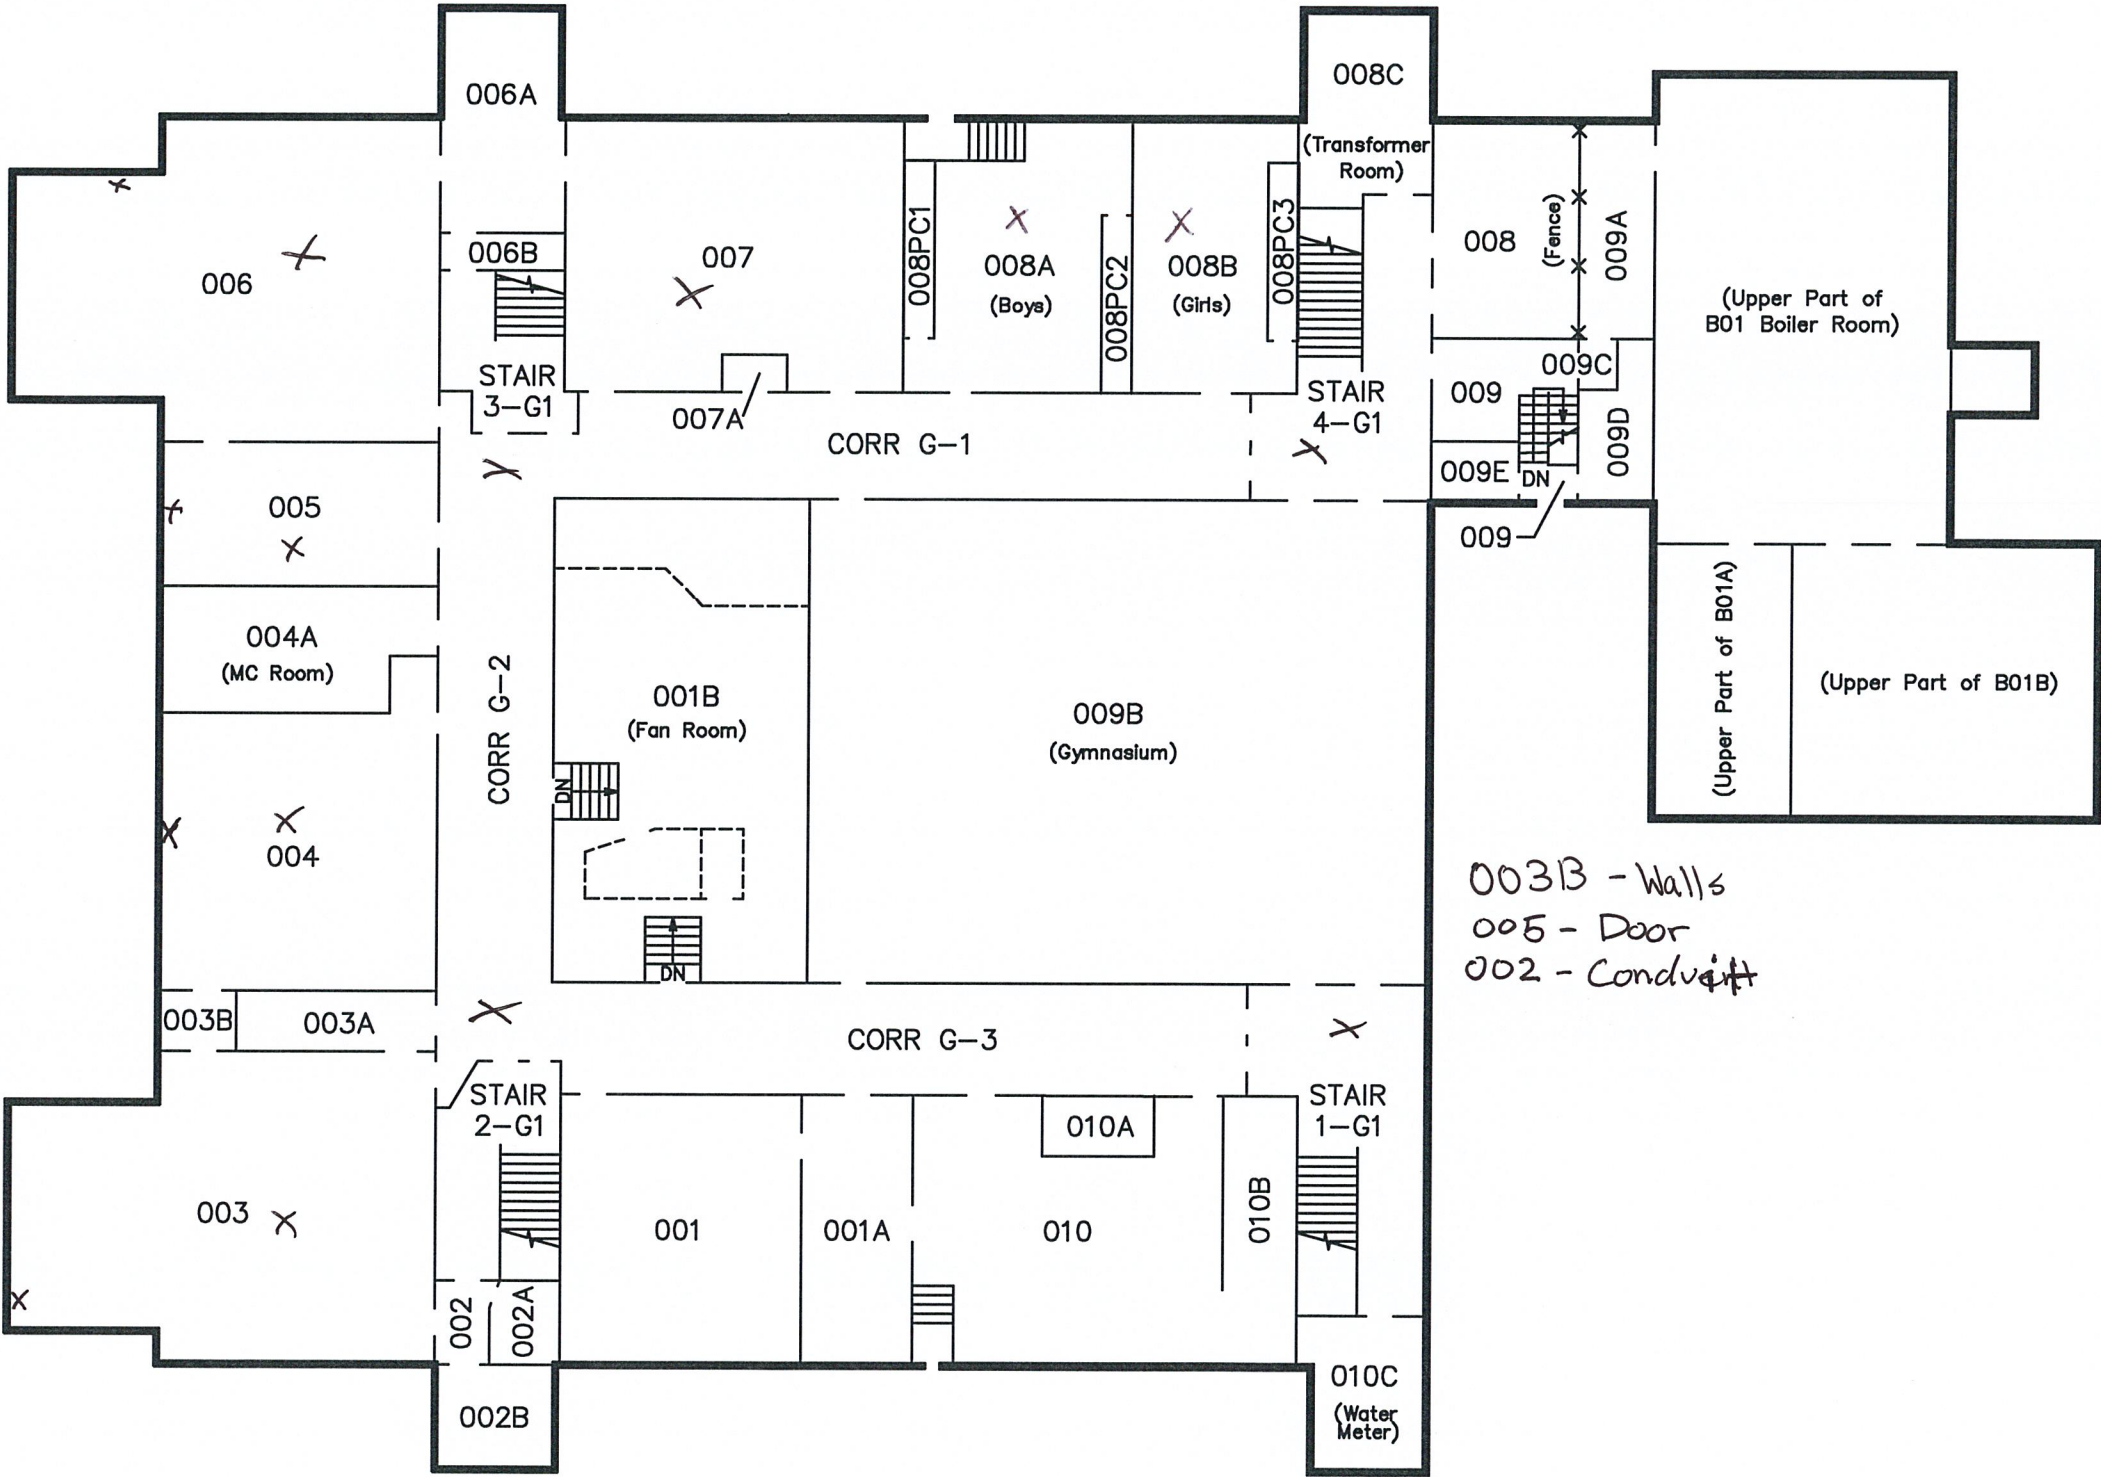

GROUND FLOOR PLAN

SITE NO. 223 - HUMBOLDT PARK ELEMENTARY SCHOOL
3230 S. ADAMS AVE., MILW., WI., 53207
DATE: 8/18/08

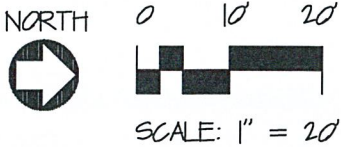


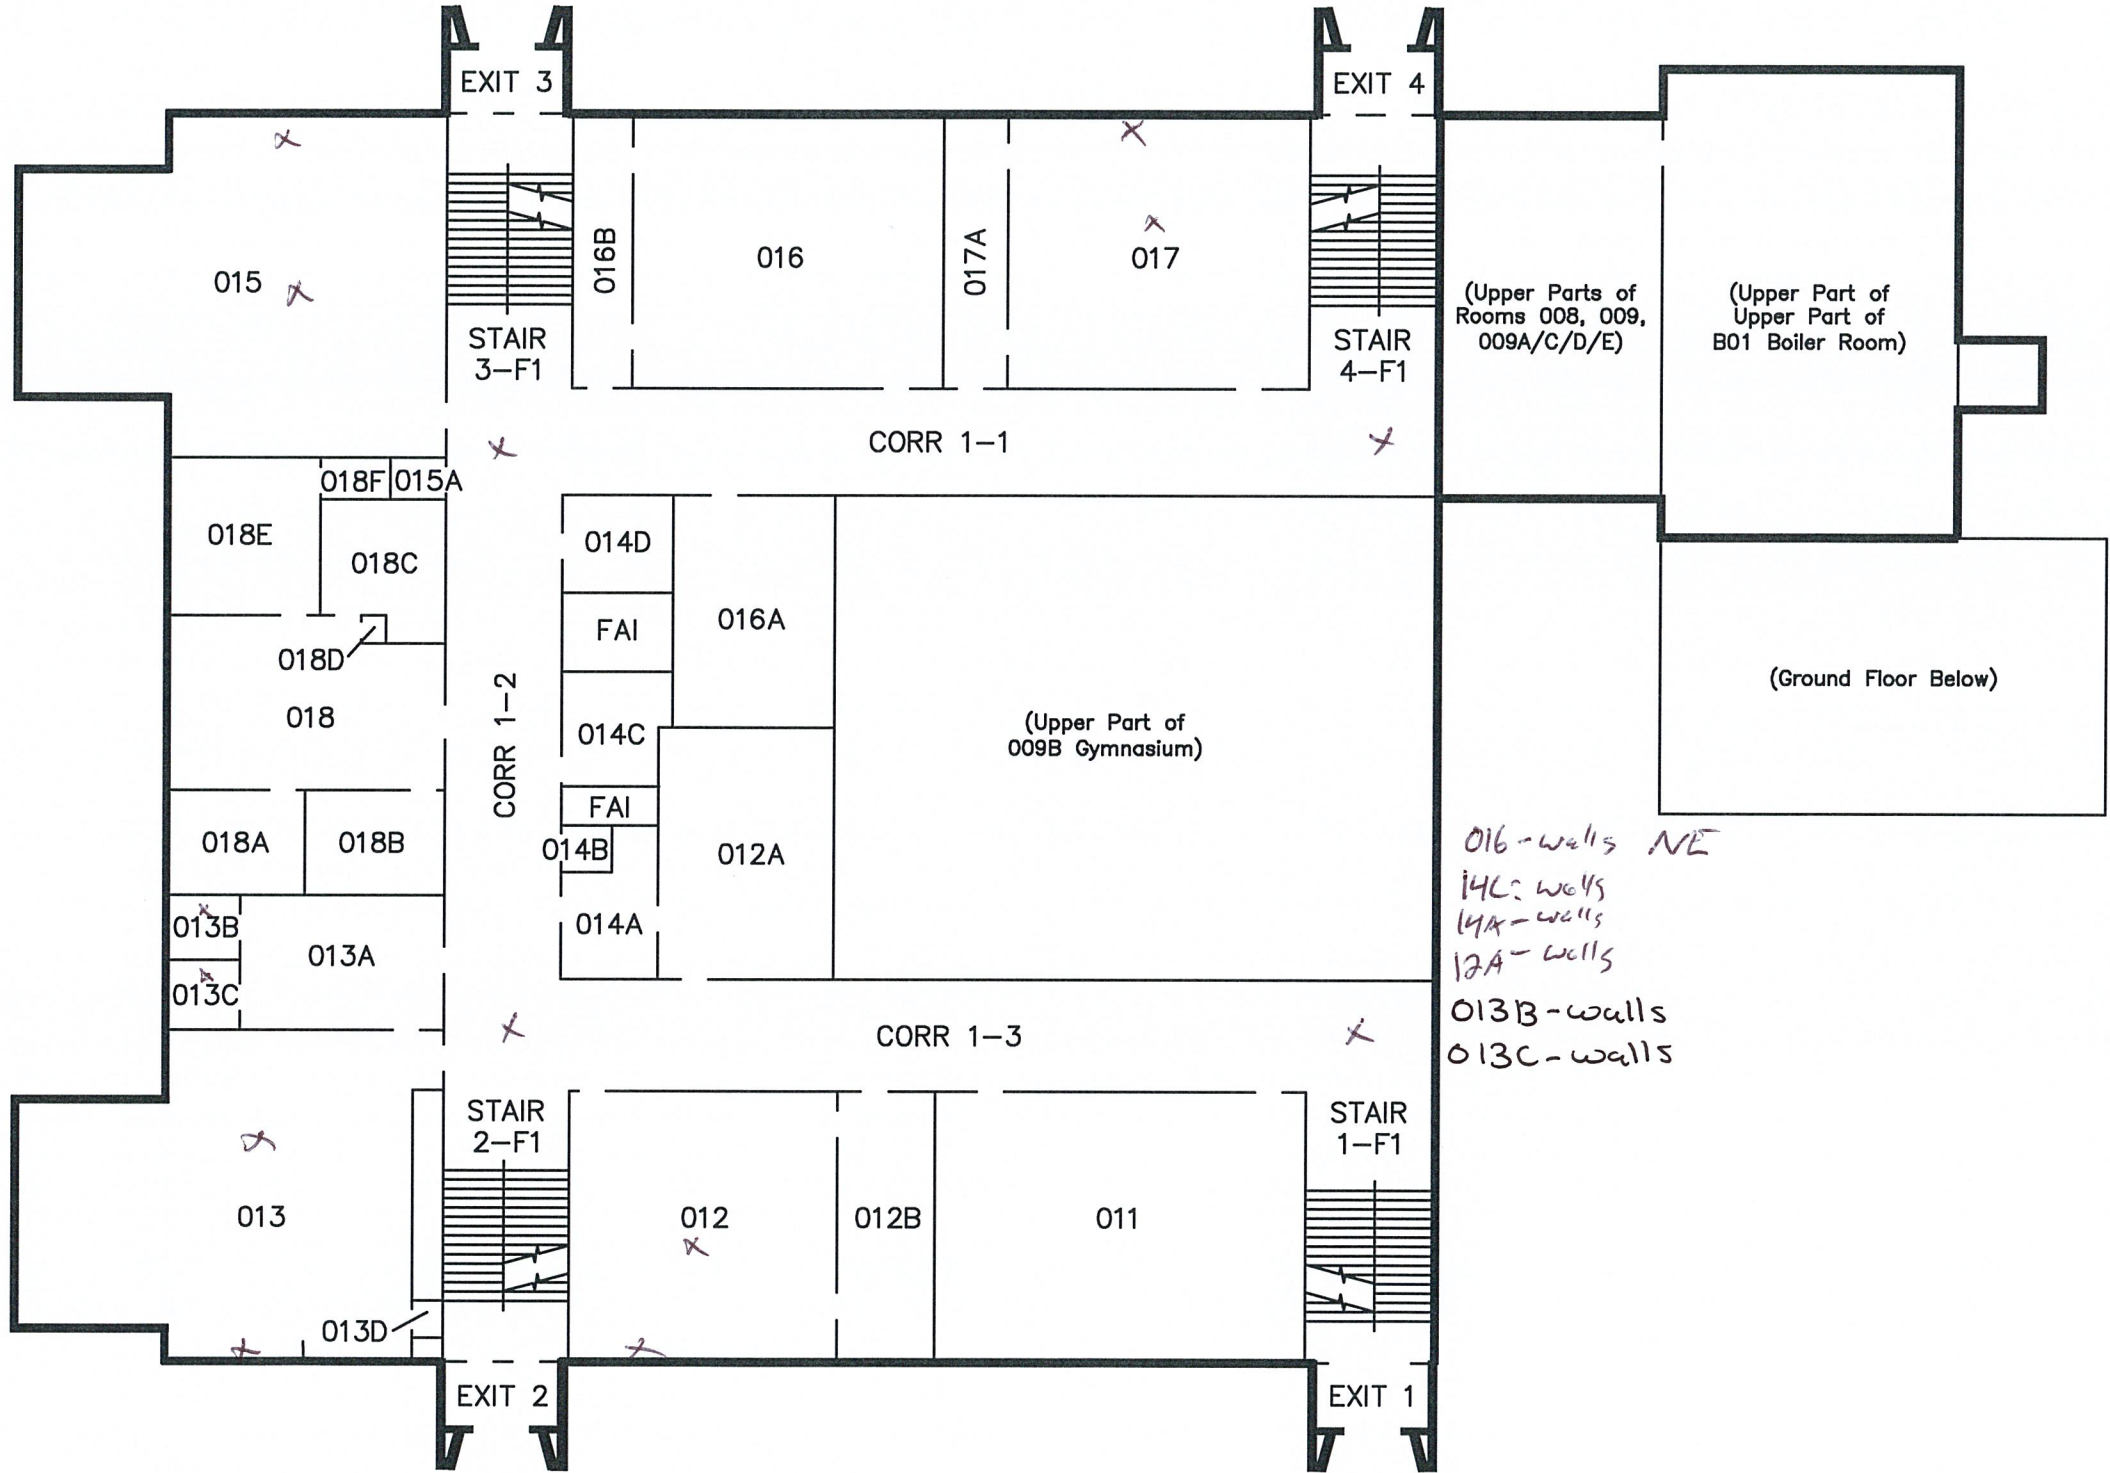


016-walls NE
14C-walls
14A-walls
12A-walls
013B-walls
013C-walls

FIRST FLOOR PLAN

SITE NO. 223 - HUMBOLDT PARK ELEMENTARY SCHOOL
3230 S. ADAMS AVE., MILW., WI., 53207
DATE: 8/28/08

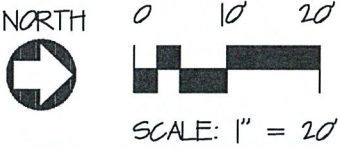


Milwaukee Public Schools
Division of Facilities and Maintenance Services
124 West Lincoln Street
P.O. Box 985
Milwaukee, Wisconsin 53205-0259
Phone : 414 283-4600
Fax : 414 283-4662

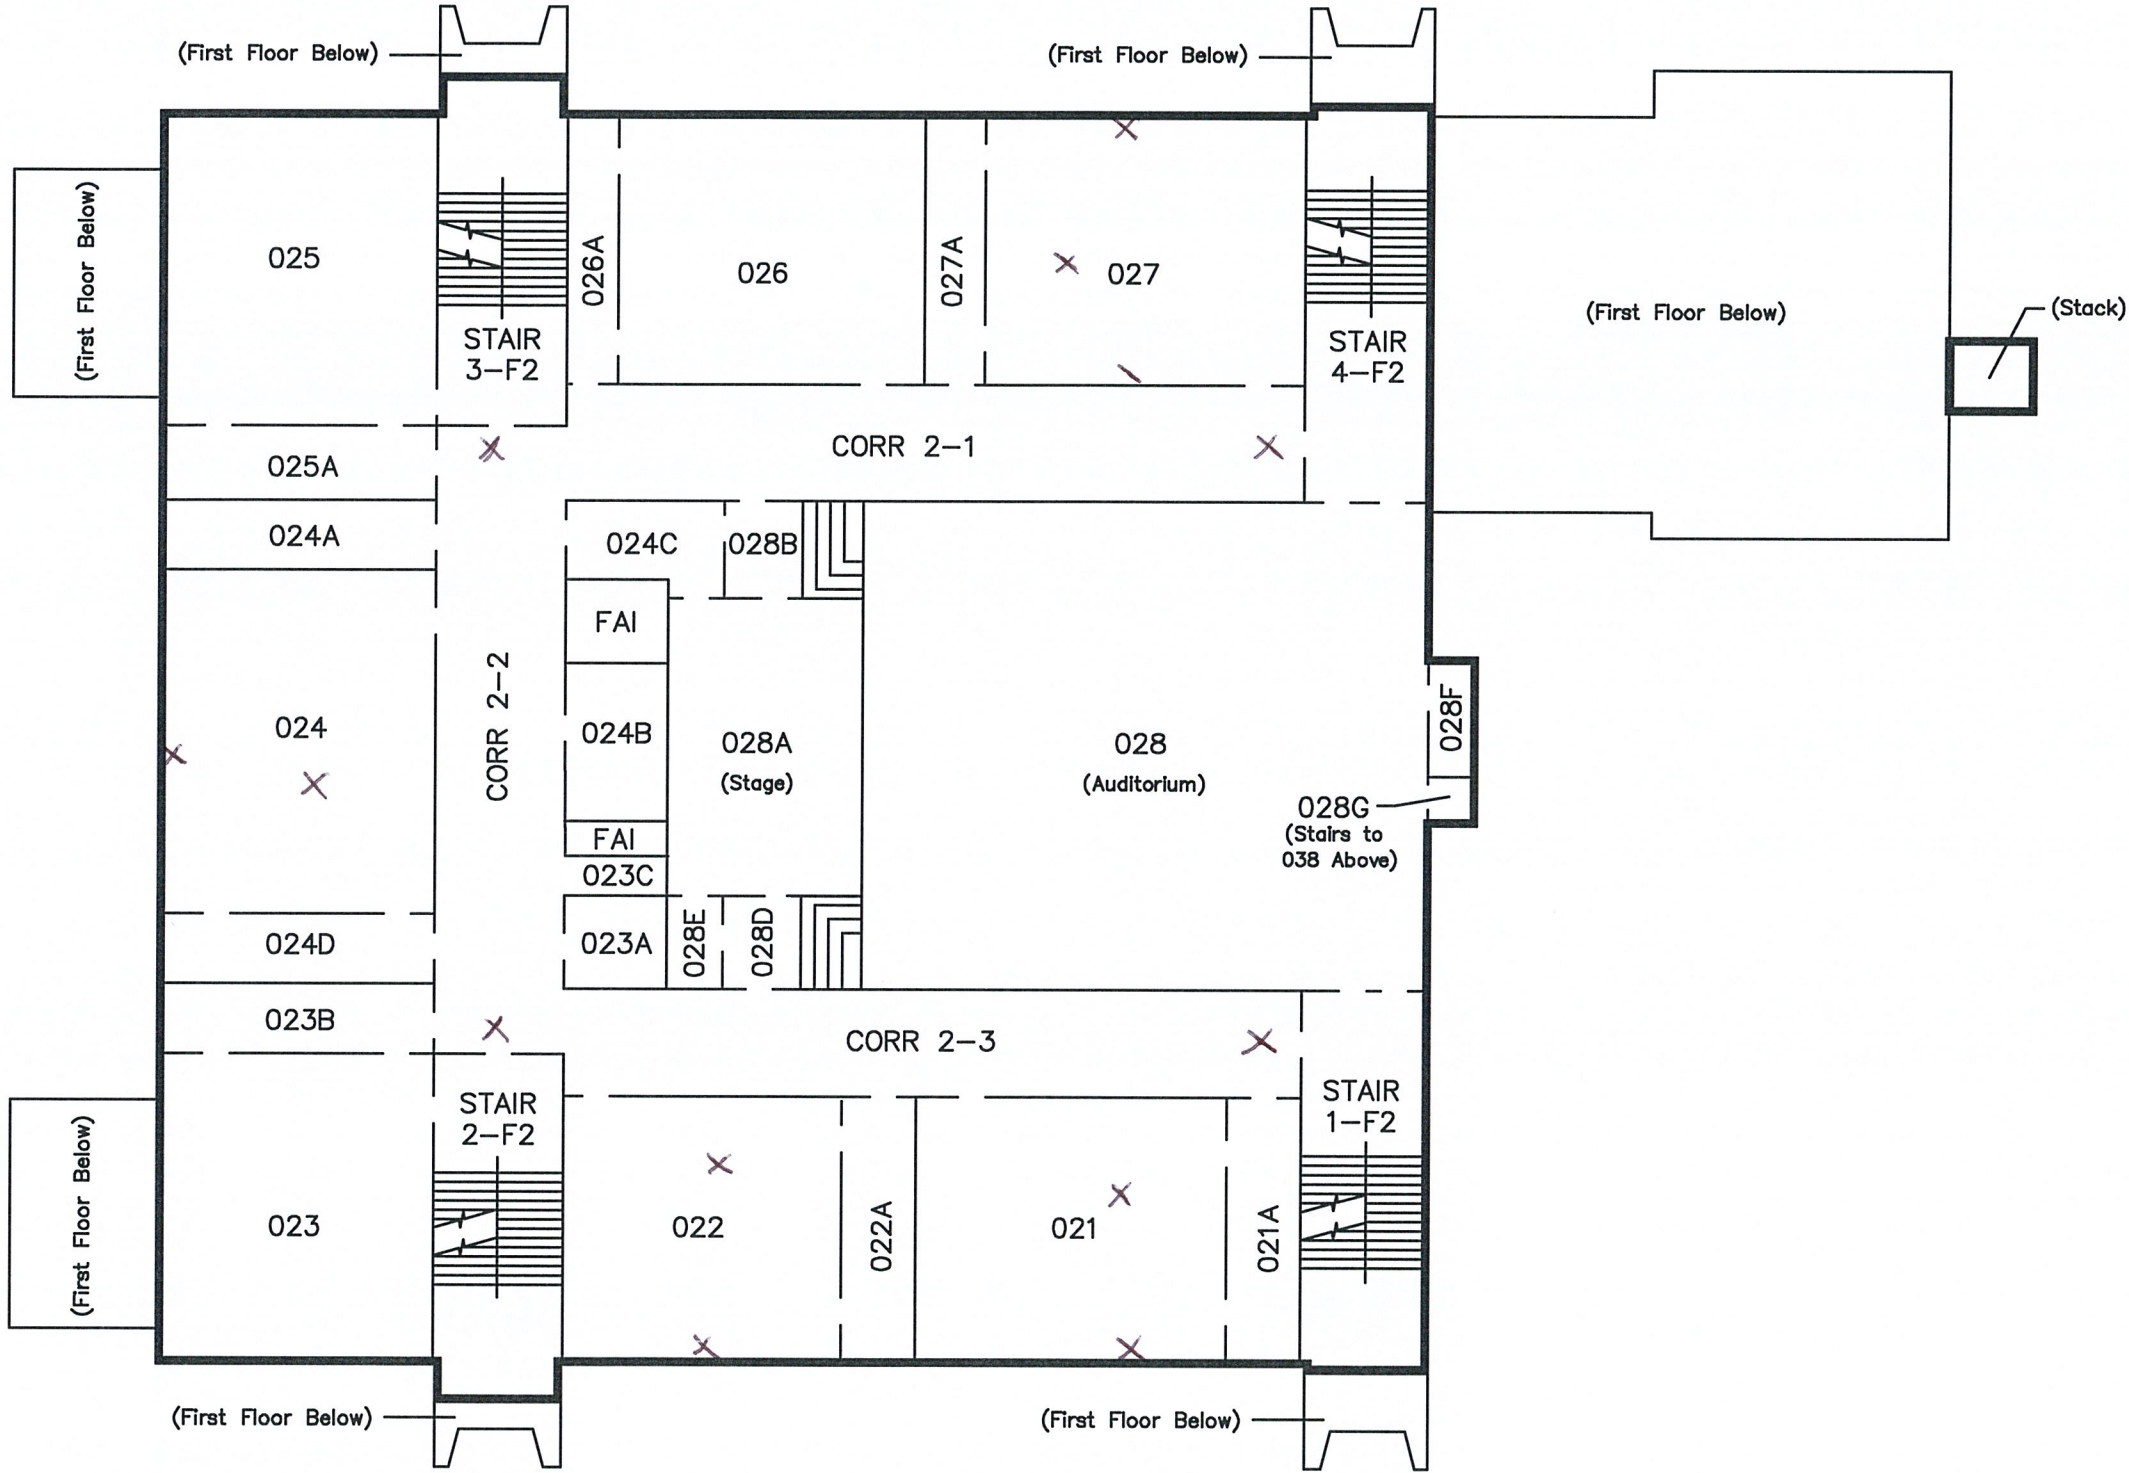



SECOND FLOOR PLAN

SITE NO. 223 - HUMBOLDT PARK ELEMENTARY SCHOOL
3230 S. ADAMS AVE., MILW., WI., 53207
DATE: 8/28/08

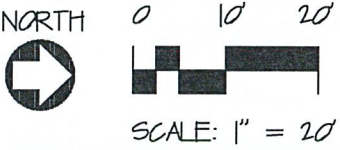



Milwaukee Public Schools
Division of Facilities and Maintenance Services
124 West Lincoln Street
P.O. Box 0250
Milwaukee, Wisconsin 53205-0259
Phone : 414 283-4800
Fax : 414 283-4662

 Milwaukee Public Schools
Division of Facilities and Maintenance Services
1124 North 11th Street
P.O. BOX 0259
Milwaukee, Wisconsin 53205-0259
Phone : 414 283-4800
Fax : 414 283-4682

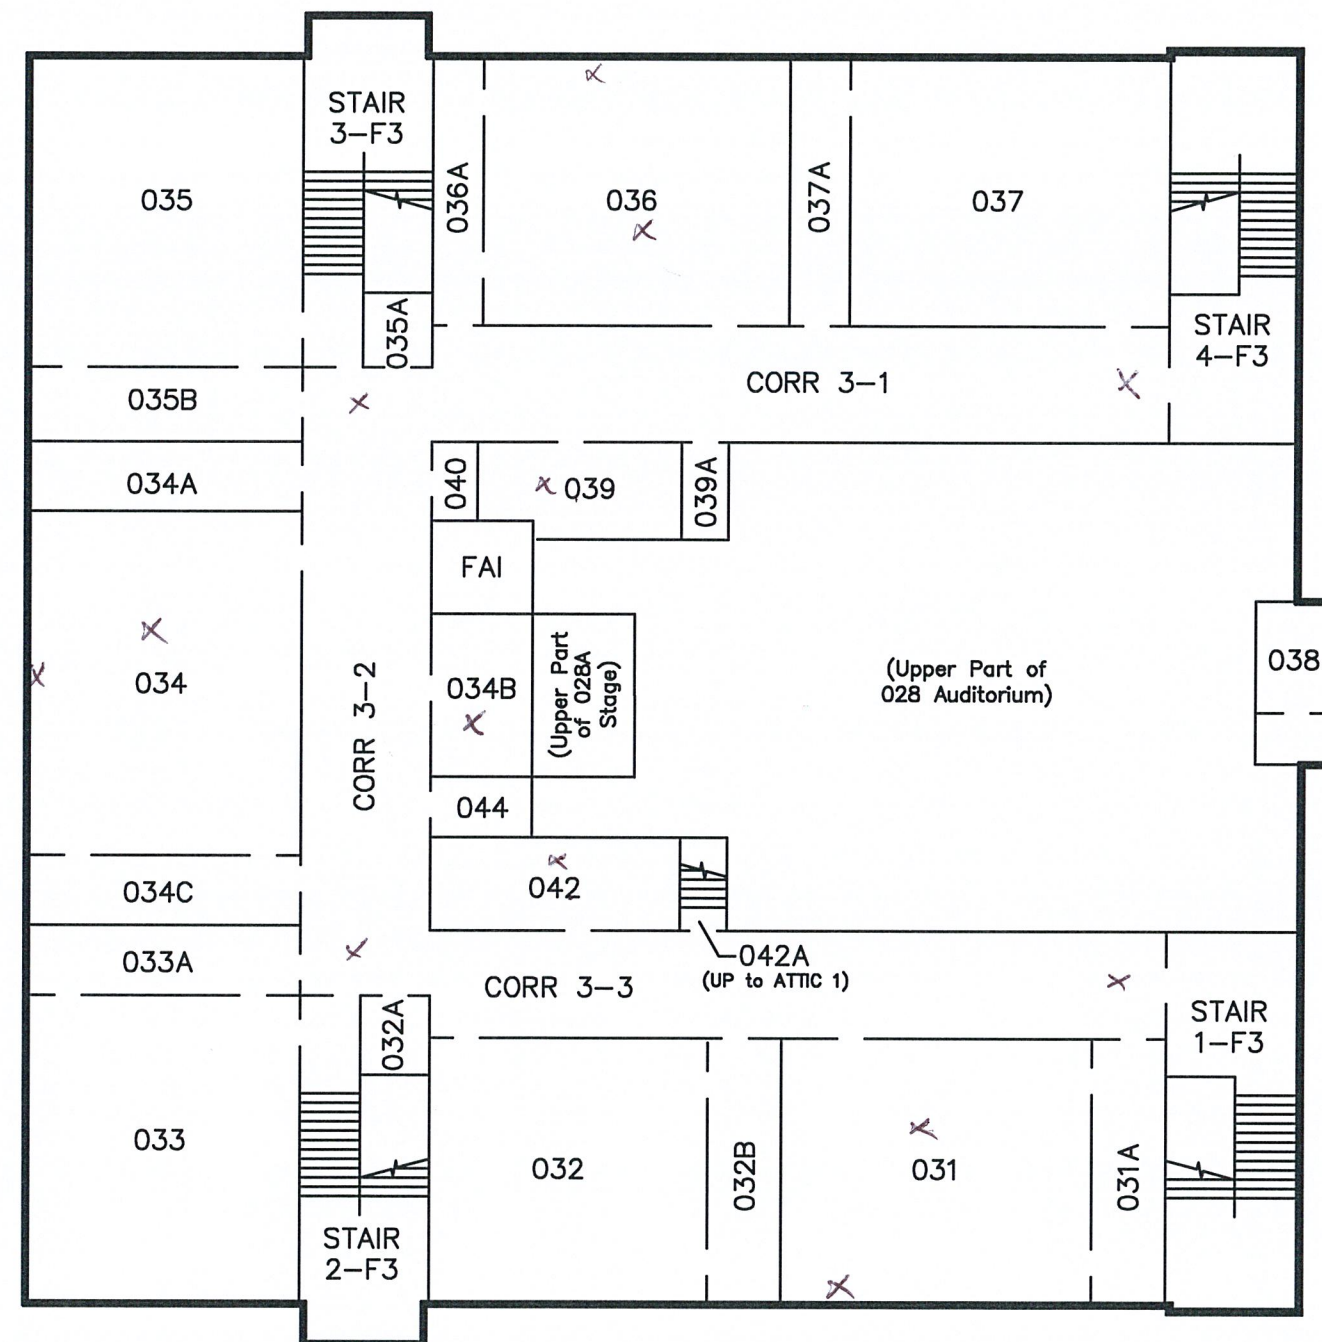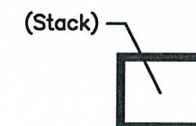

SITE NO. 223 - HUMBOLDT PARK ELEMENTARY SCHOOL
3230 S. ADAMS AVE., MILW., WI., 53207
DATE: 8/28/08

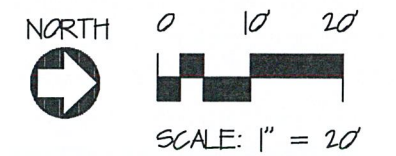

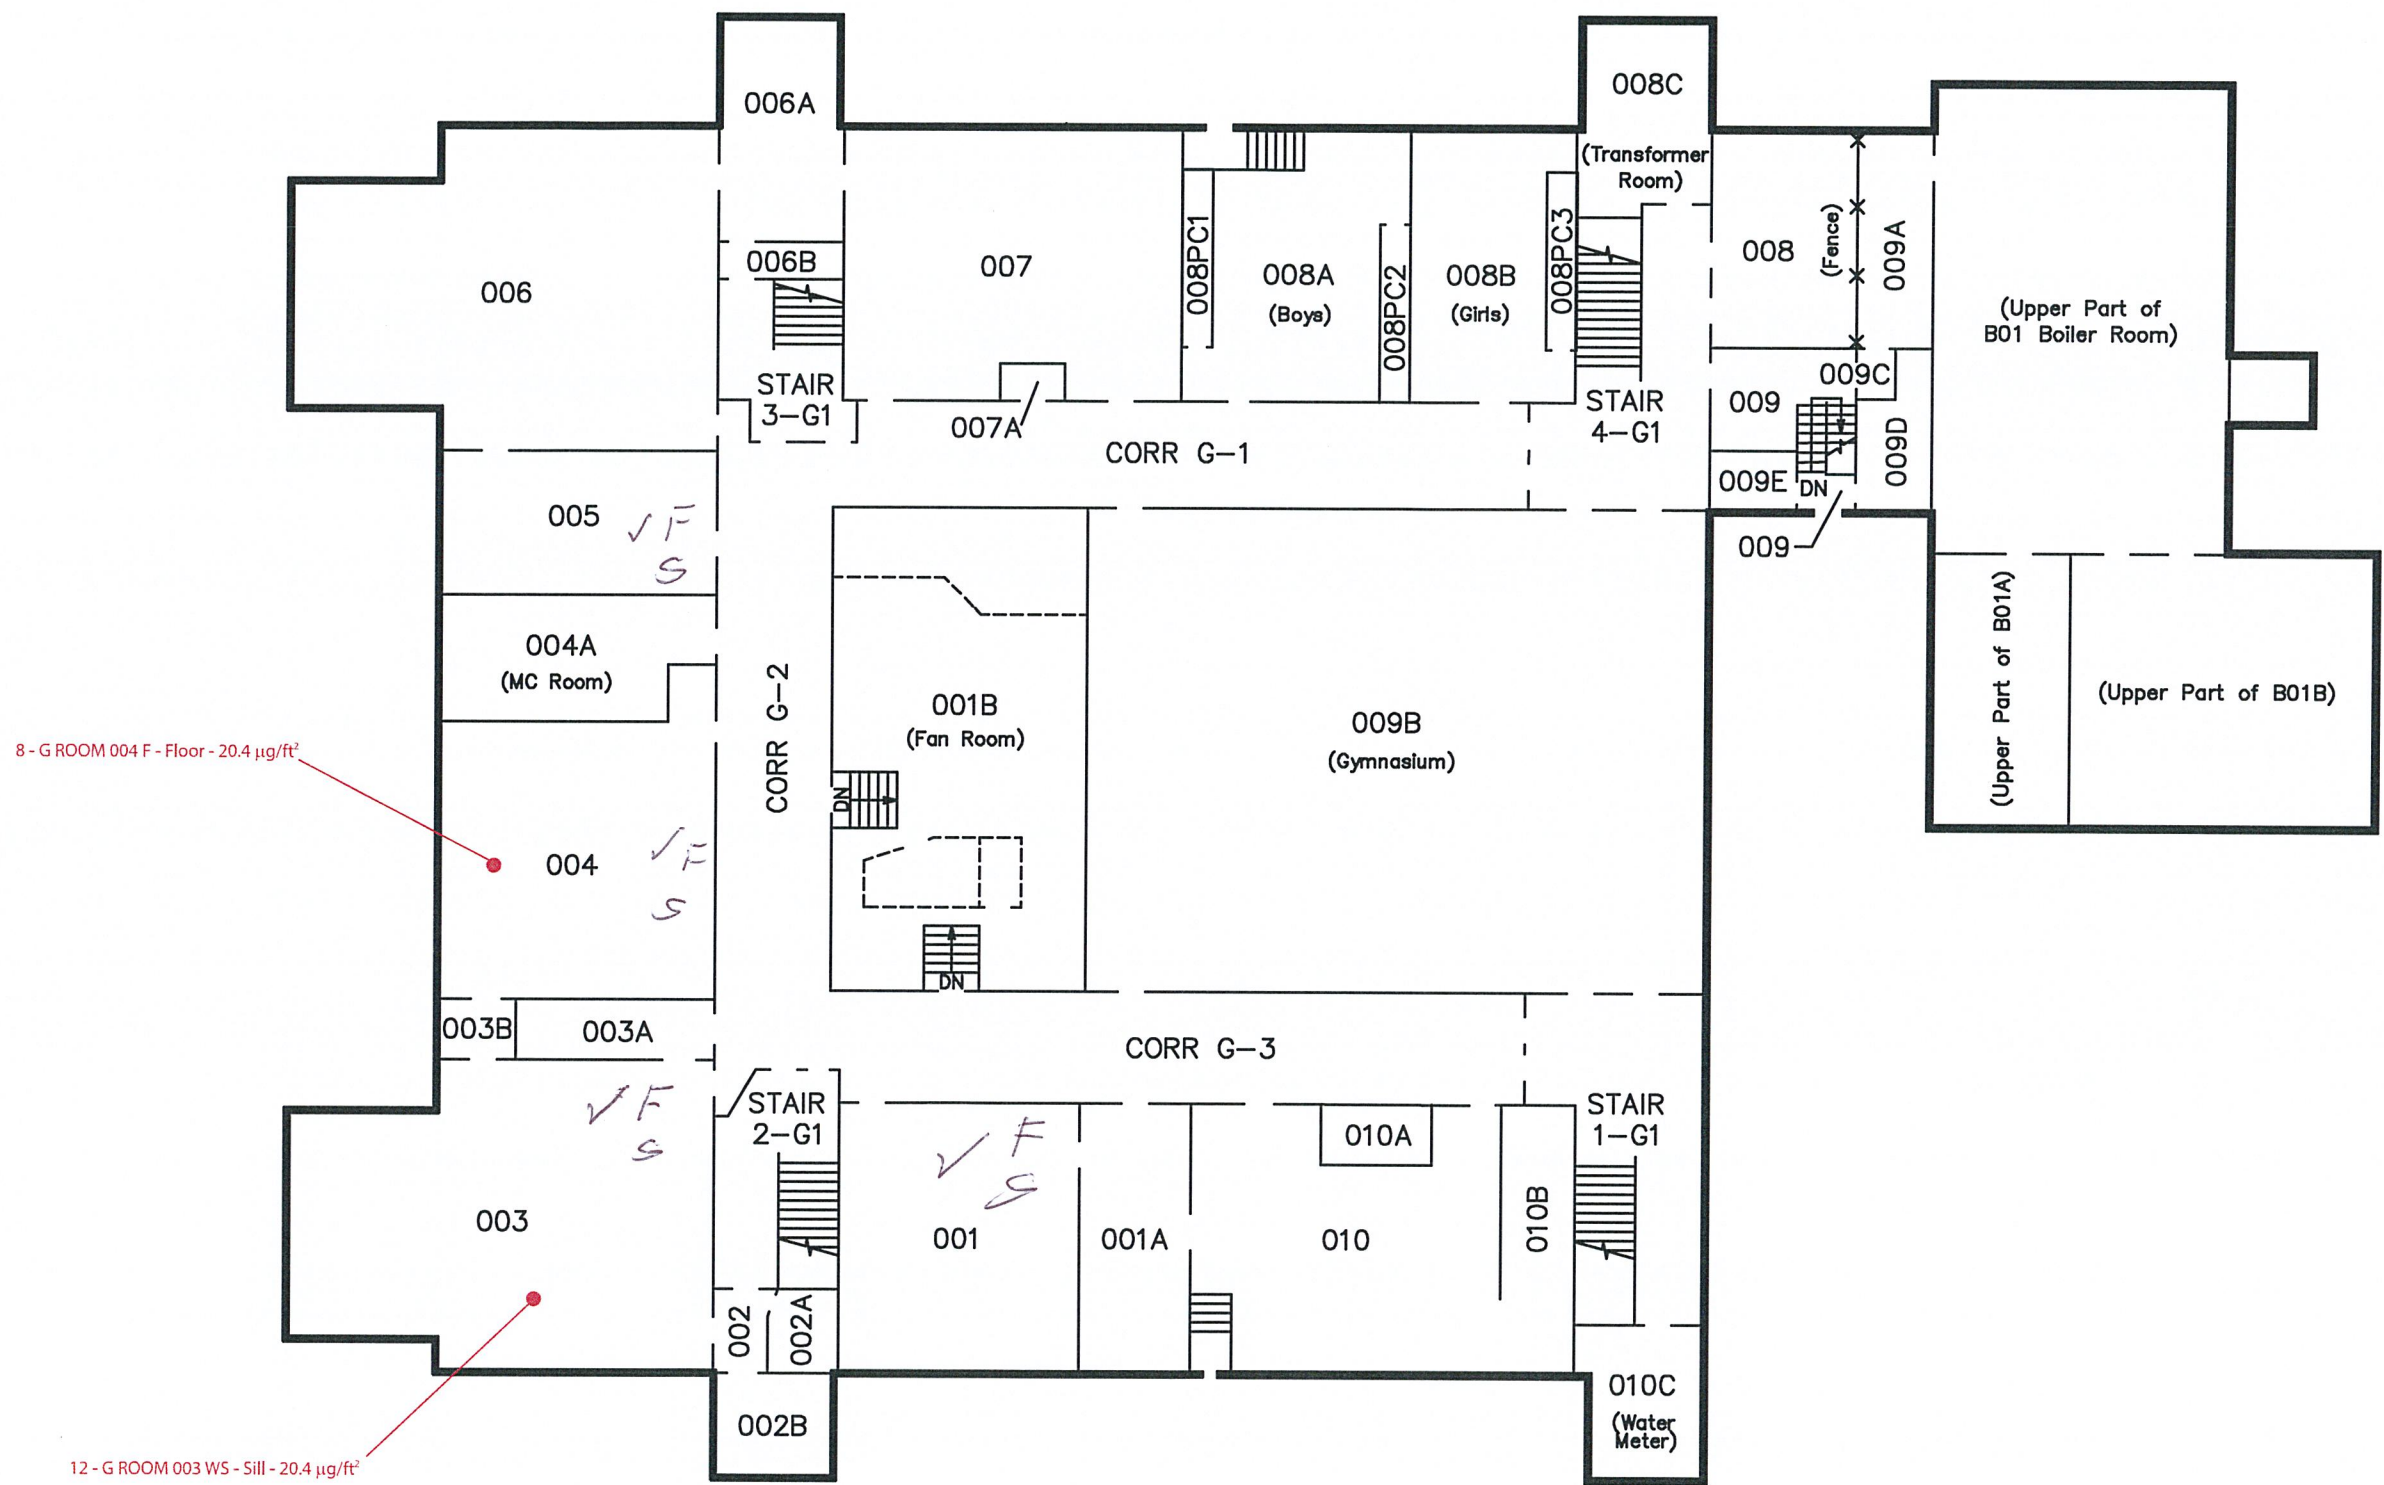


Milwaukee Public Schools
Division of Facilities and Maintenance Services
124 North 14th Street
P.O. Box 0850
Milwaukee, WI 53208
Phone : 414 283-4600
Fax : 414 283-4662

GROUND FLOOR PLAN


SITE NO. 223 - HUMBOLDT PARK ELEMENTARY SCHOOL
3230 S. ADAMS AVE., MILW., WI., 53207
DATE: 8/23/08

NORTH
0 10 20
SCALE: 1" = 20'

Milwaukee Public Schools
Division of Facilities and Maintenance Services
1124 North 11th Street
P.O. BOX 0269
Milwaukee, Wisconsin 53205-0269
Phone : 414 223-7600
Fax : 414 263-4682

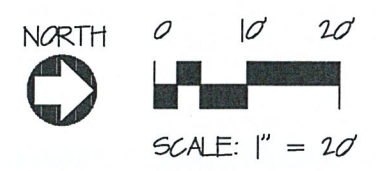

SITE NO. 223 - HUMBOLDT PARK ELEMENTARY SCHOOL
3230 S. ADAMS AVE., MILW., WI., 53207
DATE: 8/28/08

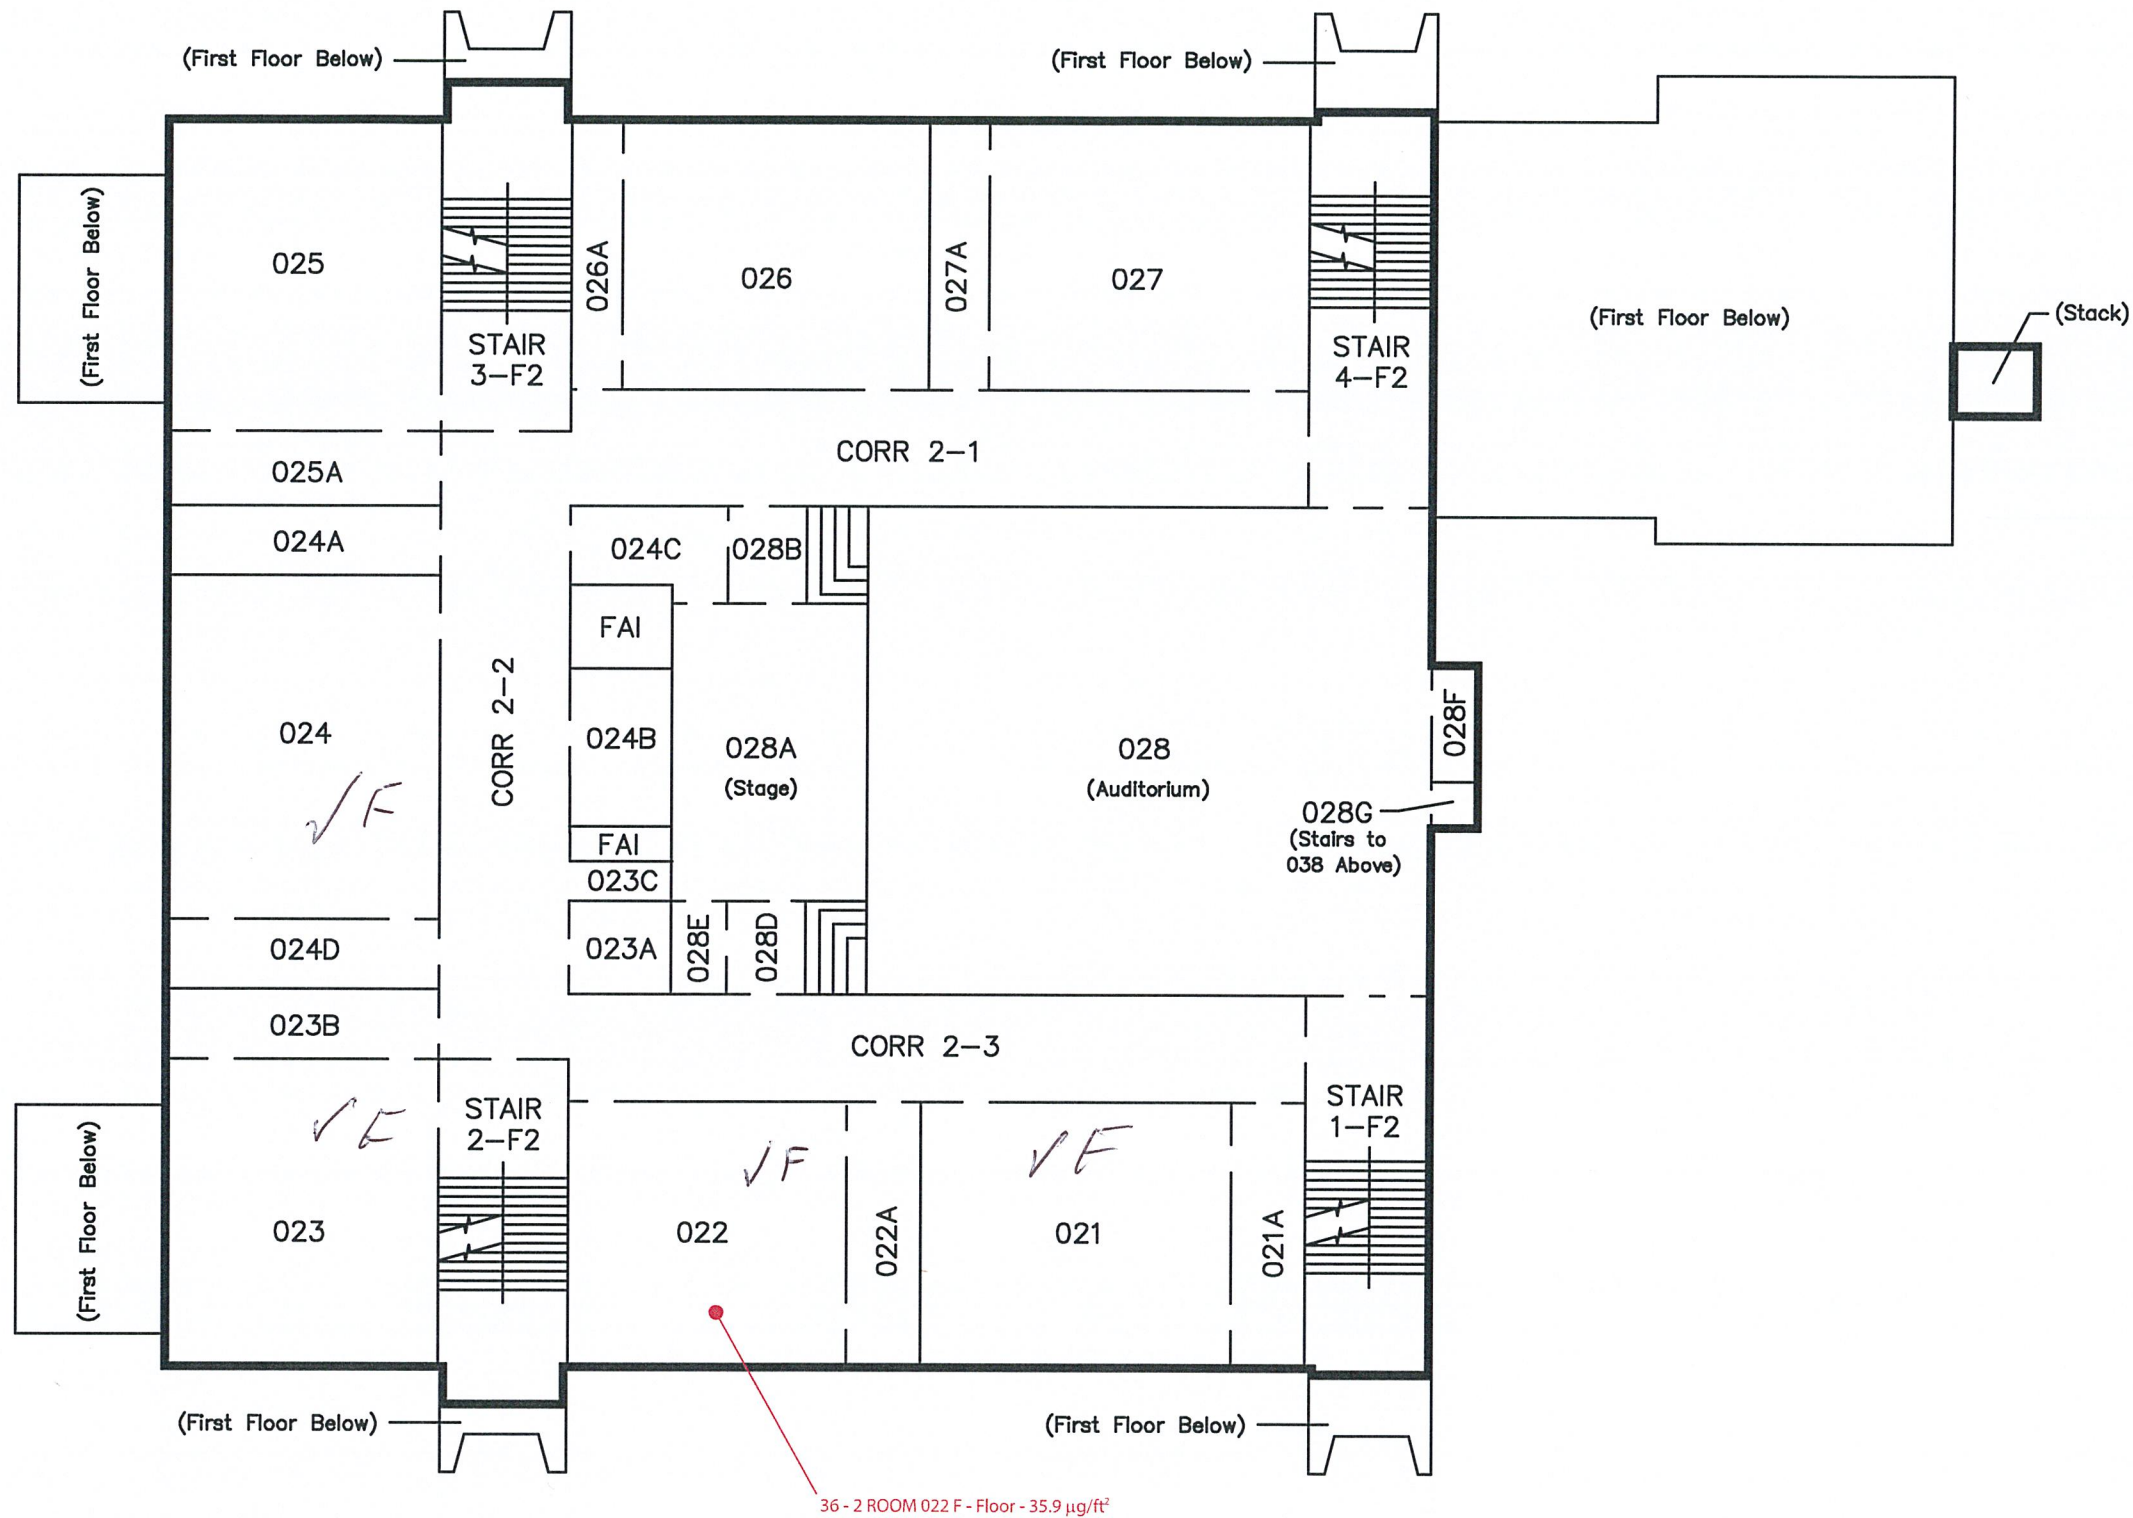


Milwaukee Public Schools
Division of Facilities and Maintenance Services
1124 North 11th Street
P.O. BOX 0269
Milwaukee, Wisconsin 53206-0269
Phone : 414.283-4600
Fax : 414.283-4662

SECOND FLOOR PLAN


SITE NO. 223 - HUMBOLDT PARK ELEMENTARY SCHOOL
3230 S. ADAMS AVE., MILW., WI., 53207
DATE: 8/28/08



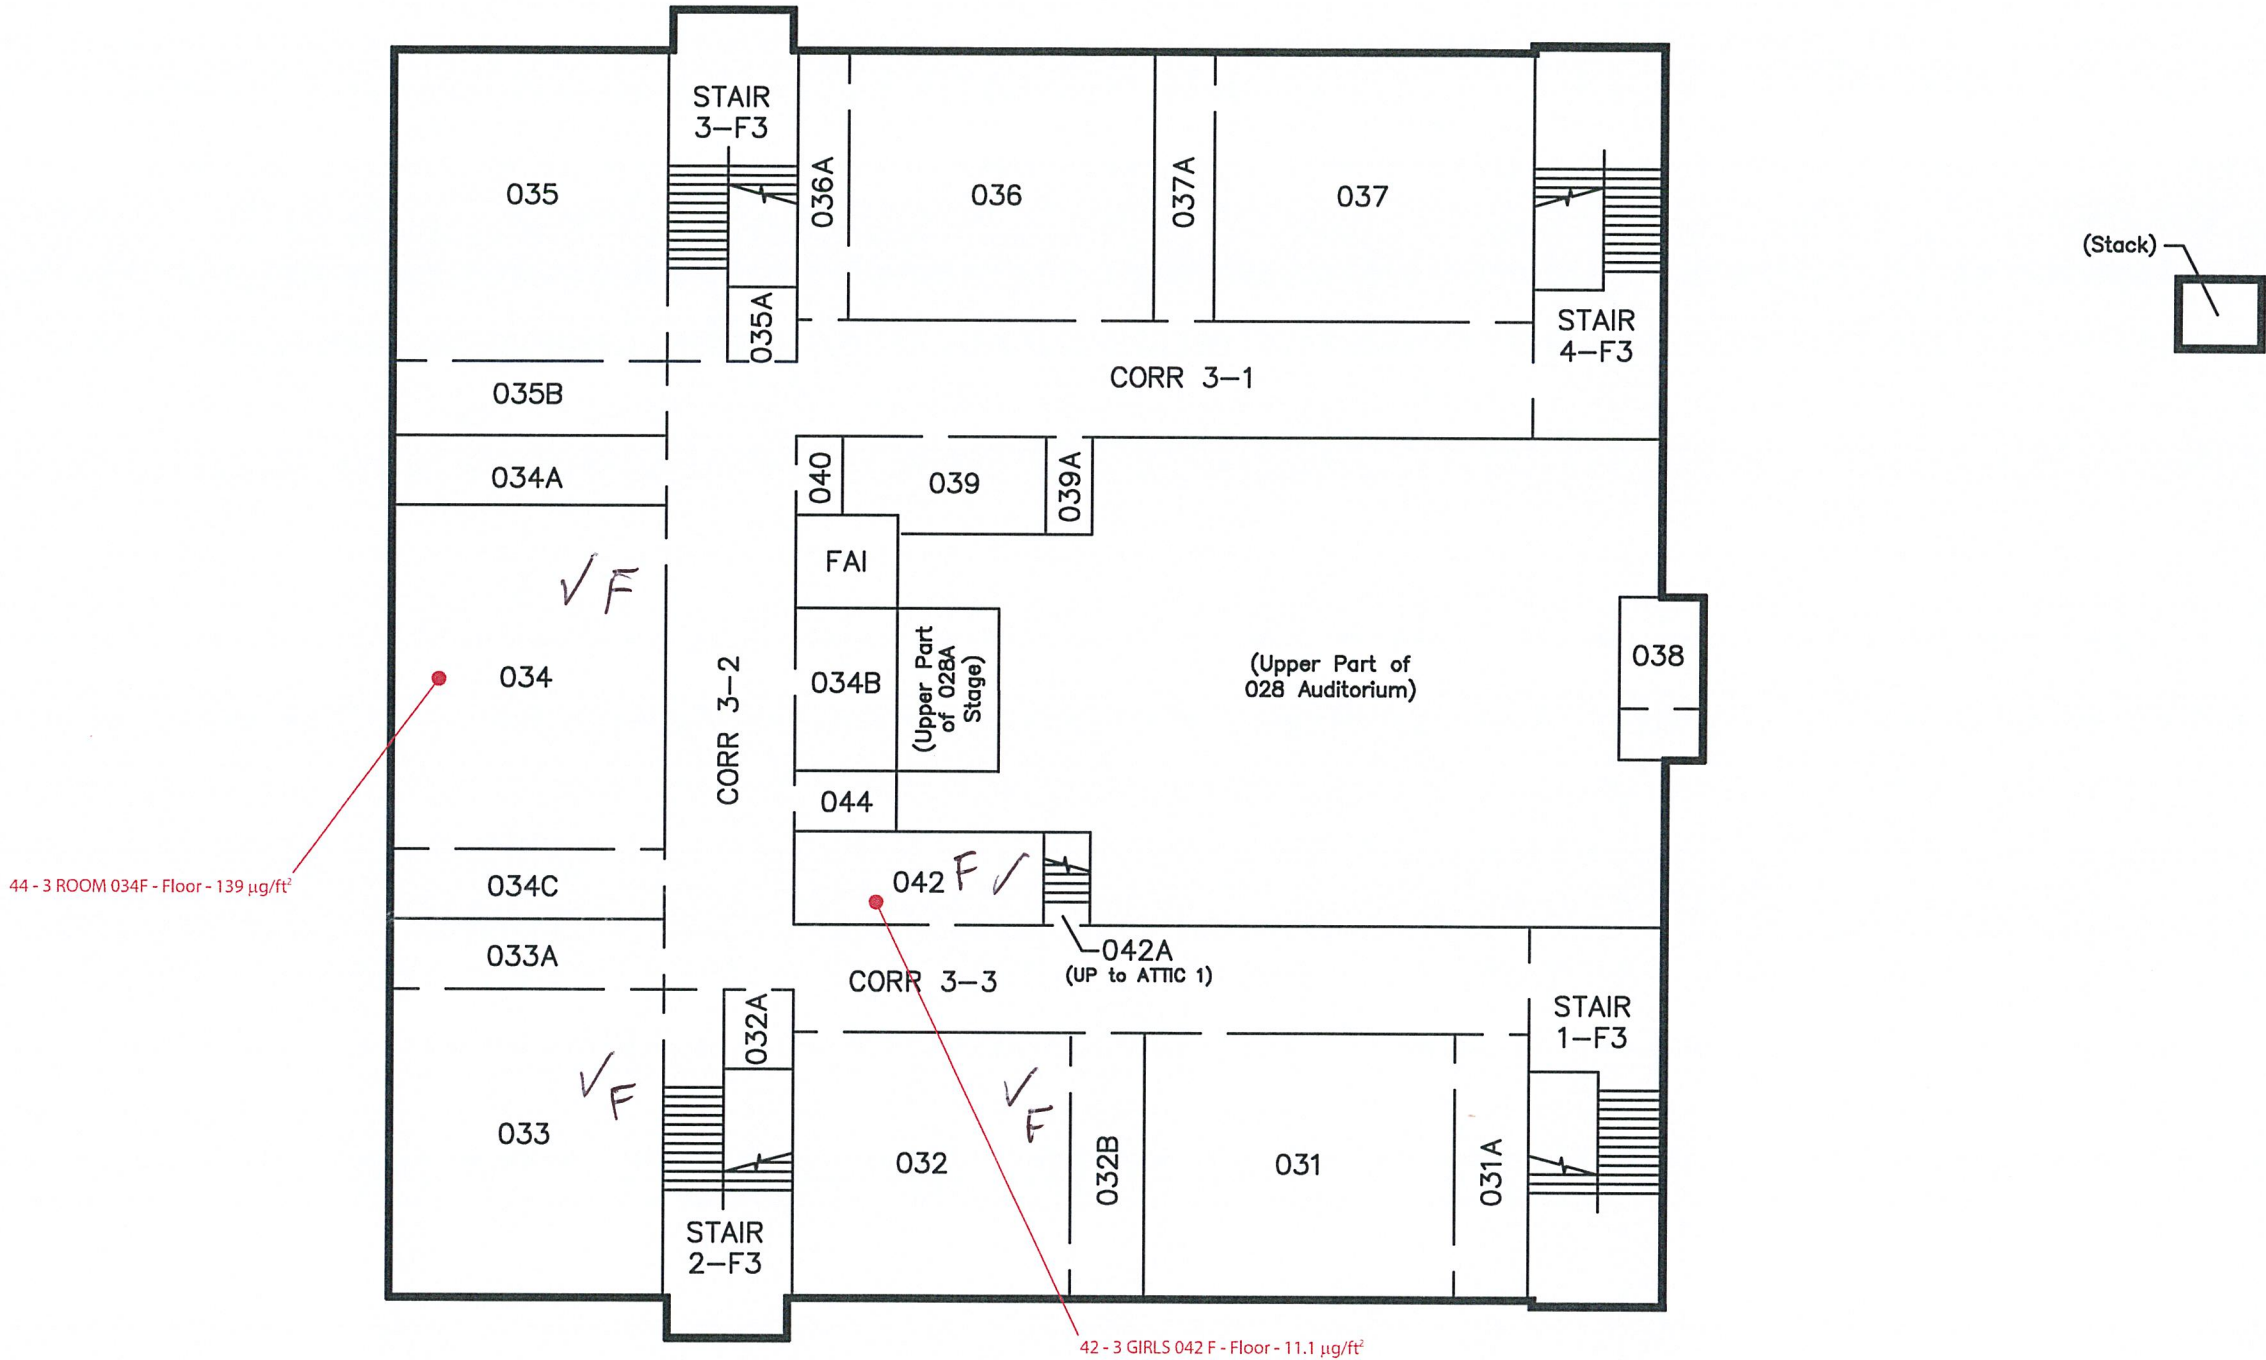

THIRD FLOOR PLAN


SITE NO. 223 - HUMBOLDT PARK ELEMENTARY SCHOOL
3230 S. ADAMS AVE., MILW., WI., 53207
DATE: 8/28/08

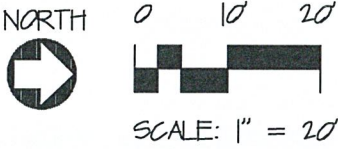

Milwaukee Public Schools
Division of Facilities and Maintenance Services
1125 West Wisconsin Avenue
P.O. BOX 0249
Milwaukee, Wisconsin 53206-0249
Phone : 414 283-4900
Fax : 414 283-4862


No 131

08/28/2025

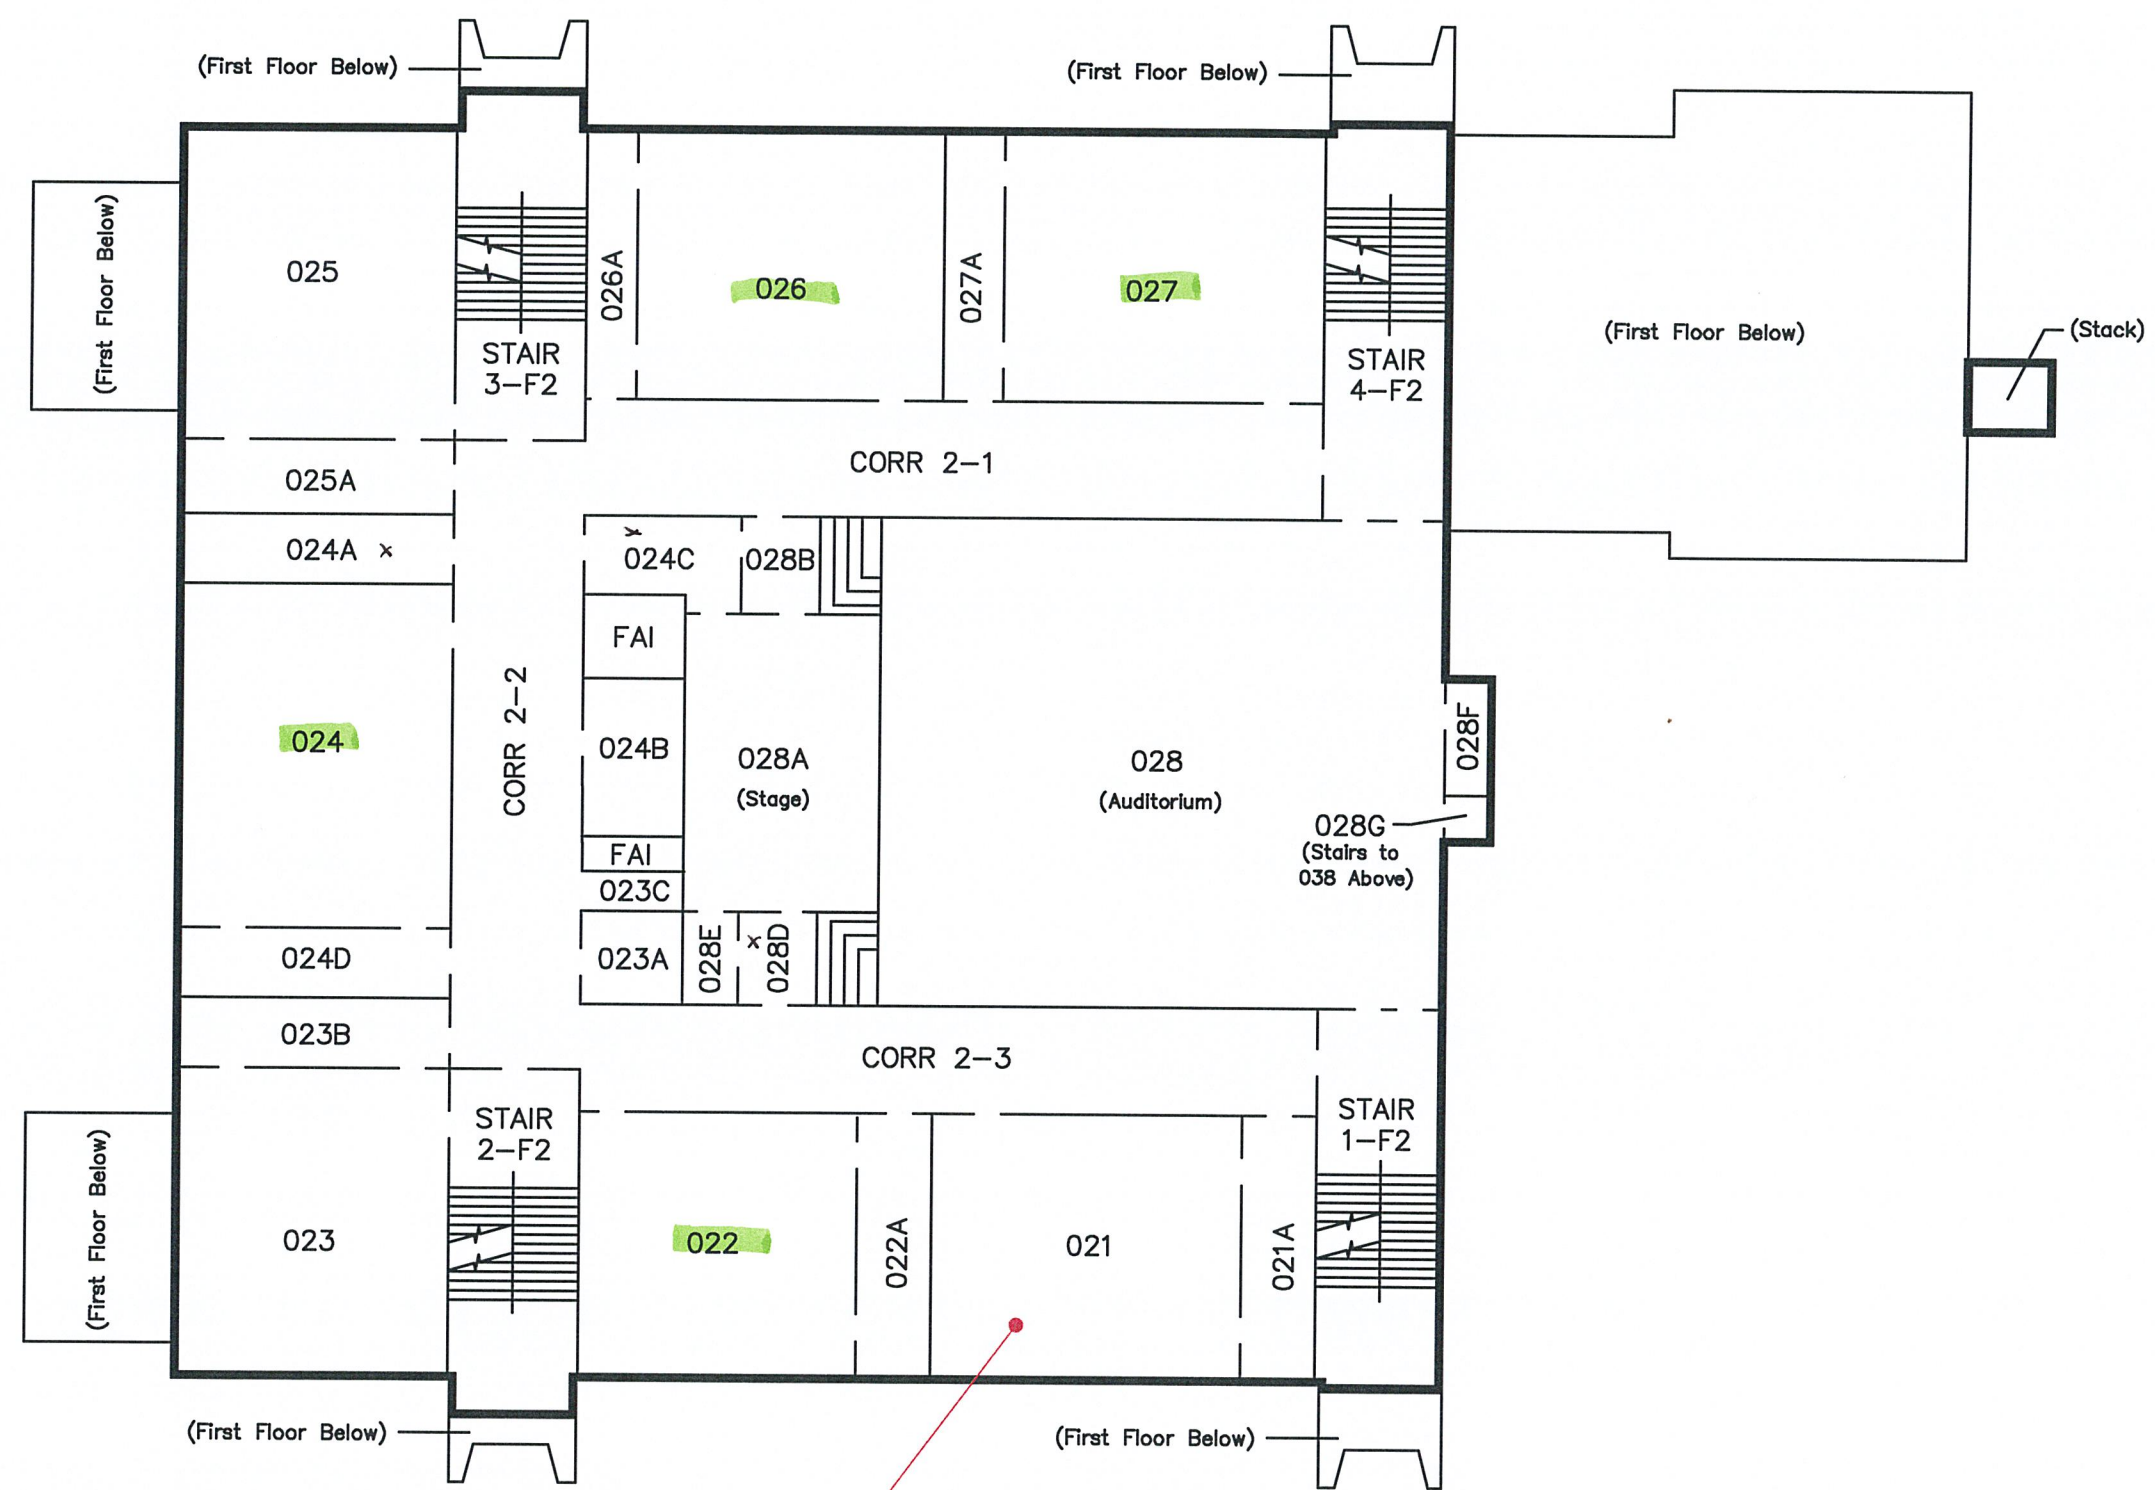

SECOND FLOOR PLAN


SITE NO. 223 - HUMBOLDT PARK ELEMENTARY SCHOOL
3230 S. ADAMS AVE., MILW., WI., 53207
DATE: 8/18/08

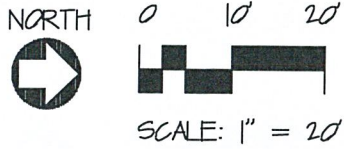

Milwaukee Public Schools
Division of Facilities and Maintenance Services
1124 North 11th Street
P.O. BOX 0209
Milwaukee, Wisconsin 53205-0209
Phone: 414-283-4600
Fax: 414-283-4602



Milwaukee Public Schools
Division of Facilities and Maintenance Services
1124 North 1st Street
P.O. BOX 0259
Milwaukee, Wisconsin 53206-0259
Phone : 414 283-4800
Fax : 414 283-4882

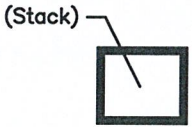

REWIPE SAMPLE (8/25/2025) - 033F - Room 033 - Floor - 18 µg/ft²



THIRD FLOOR PLAN

SITE NO. 223 - HUMBOLDT PARK ELEMENTARY SCHOOL
3130 S. ADAMS AVE., MILW., WI., 53207
DATE: 8/28/08

NORTH



0 10' 20'



SCALE: 1" = 20'

APPENDIX D

Inspectors' Certificates

Lead Inspector Certification

		LEAD(PB) RISK ASSESSOR	
		Issued By	
		STATE OF WISCONSIN	
		Dept. of Health Services	
		Devin Michael Gareis	
		1300 W Canal St	
		Milwaukee WI 53233-2669	
		225 lbs	6' 01"
LRA-297222	Exp: 01/17/2027	09/14/1994	
Training due by: 01/17/2027			

Lead Inspector Certification



LEAD(PB) RISK ASSESSOR

Issued By

STATE OF WISCONSIN

Dept. of Health Services

Yilda Beatriz Torres Rodriguez

587 Hartridge Dr

Hartland WI 53029-2659

		lbs	
LRA-301689	Exp: 06/23/2027	07/19/1993	

Training due by: 06/23/2027

Milwaukee Lead/Asbestos Information Center

A division of Midwest Certified Training, Inc.

5381 North 118th Court, Milwaukee, WI 53225 Phone: 414-481-9070



Jeremiah James Hayes

*has successfully passed the required course test and completed all other requirements
for the 16-hour*

Lead Hazard Investigation Initial Course

on June 20 & 23, 2025 in The Sigma Group, 1300 West Canal Street, Milwaukee, WI 53233.

Course Test Date: June 23, 2025

Date Course Certificate Issued: June 23, 2025

Expiration Date: June 23, 2027

Course Certificate #: LHII25062073502

DCQ Course ID #: 8811



Rocky Everly, Training Manager MLAIC

*This training course complies with the requirements of and is accredited by the State of Wisconsin, Department of Health Services
under ch. DHS 163, WI. Admin. Code.*