


Lead in Drinking Water Testing Churchville-Chili Senior High School

Location:

Churchville-Chili Senior High School
5786 Buffalo Road
Churchville, New York 14428

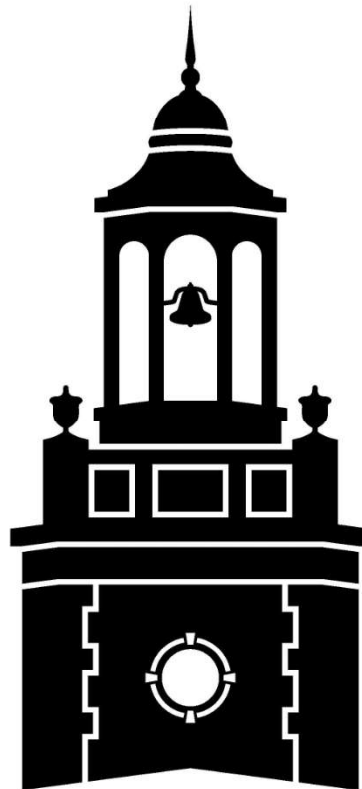

LaBella Project No.

2254751

December 19, 2025



Sample #	Location	Outlet Type	Notes	Date	Time	Concentration (ug/L)
SHS-1034H-01	Hallway by Room 1034	Drinking Fountain	---	10/21/2025	0533	<1.0
SHS-1034H-02	Hallway by Room 1034	Bottle Filler	---	10/21/2025	0534	<1.0
SHS-1047H-01	Hallway by Room 1047	Drinking Fountain	---	10/21/2025	0528	<1.0
SHS-1047H-02	Hallway by Room 1047	Bottle Filler	---	10/21/2025	0529	<1.0
SHS-1049-01	Vocal Music 1049	Tap	---	10/21/2025	0530	3.3
SHS-CAFÉ-01	Cafeteria	Drinking Fountain	---	10/21/2025	0522	<1.0
SHS-CAFÉ-02	Cafeteria	Bottle Filler	---	10/21/2025	0523	<1.0
SHS-KIT-01	Kitchen	Sprayer	A-Wall	10/21/2025	0510	33.4
SHS-KIT-02	Kitchen	Tap	A-Wall	10/21/2025	0511	19.2
SHS-KIT-03	Kitchen	Tap	B-Wall, Left	10/21/2025	0512	3.2
SHS-KIT-04	Kitchen	Tap	B-Wall, Right	10/21/2025	0513	2.4
SHS-KIT-05	Kitchen	Ice Machine	---	10/21/2025	0514	<1.0
SHS-KIT-06	Kitchen	Tap	C-Wall, Left	10/21/2025	0515	14.6
SHS-KIT-07	Kitchen	Tap	C-Wall, Right	10/21/2025	0516	14.9
SHS-KIT-08	Kitchen	Tap	Island	10/21/2025	0517	11.9
SHS-1023-01	Faculty Room 1023	Tap	---	10/21/2025	0520	16.1
SHS-1023-02	Faculty Room 1023	Sprayer	---	10/21/2025	0521	5.3
SHS-1324H-01	Hallway by Room 1324	Drinking Fountain	---	10/21/2025	0613	<1.0
SHS-1324H-02	Hallway by Room 1324	Bottle Filler	---	10/21/2025	0614	<1.0
SHS-1344H-01	Hallway by Room 1344	Drinking Fountain	---	10/21/2025	0525	<1.0
SHS-1344H-02	Hallway by Room 1344	Bottle Filler	---	10/21/2025	0526	<1.0
SHS-1406H-01	Hallway by Room 1406	Drinking Fountain	---	10/21/2025	0603	<1.0
SHS-1406H-02	Hallway by Room 1406	Bottle Filler	---	10/21/2025	0604	<1.0
SHS-1405-01	Library 1405	Tap	---	10/21/2025	0606	<1.0
SHS-11147H-01	Hallway by Room 1147	Drinking Fountain	---	10/21/2025	0545	<1.0
SHS-1147H-02	Hallway by Room 1147	Bottle Filler	---	10/21/2025	0546	<1.0
SHS-POOL-01	Pool	Drinking Fountain	Near Entryway	NT	X	X
SHS-POOL-02	Pool	Bottle Filler	Near Entryway	NT	X	X
SHS-POOL-03	Pool	Drinking Fountain	Pool Deck	10/21/2025	0600	<1.0
SHS-POOL-04	Pool	Bottle Filler	Pool Deck	10/21/2025	0601	<1.0
SHS-1601-01	Concessions 1601B-1		---	10/21/2025	0624	<1.0
SHS-GMA-01	Gym A	Drinking Fountain	Boy's Vestibule	10/21/2025	0555	<1.0

NW = Not Working, NT= Not Tested

Sample #	Location	Outlet Type	Notes	Date	Time	Concentration (ug/L)
SHS-GMA-02	Gym A	Bottle Filler	Boy's Vestibule	10/21/2025	0556	<1.0
SHS-GMA-03	Gym A	Drinking Fountain	Girl's Vestibule	10/21/2025	0552	<1.0
SHS-GMA-04	Gym A	Bottle Filler	Girl's Vestibule	10/21/2025	0553	<1.0
SHS-GYMBH-01	Hallway by Gym B	Drinking Fountain	---	10/21/2025	0550	<1.0
SHS-GYMBH-02	Hallway by Gym B	Bottle Filler	---	10/21/2025	0551	<1.0
SHS-1155H-01	Hallway by Room 1155	Drinking Fountain	---	10/21/2025	0640	<1.0
SHS-1155H-02	Hallway by Room 1155	Bottle Filler	---	10/21/2025	0641	<1.0
SHS-1128H-01	Hallway by Room 1128	Drinking Fountain	---	10/21/2025	0543	<1.0
SHS-1128H-02	Hallway by Room 1128	Bottle Filler	---	10/21/2025	0544	<1.0
SHS-1114H-01	Hallway by Room 1114	Drinking Fountain	---	10/21/2025	0540	<1.0
SHS-1114H-02	Hallway by Room 1114	Bottle Filler	---	10/21/2025	0541	<1.0
SHS-NUR-01	Nurse's Office 1013	Tap	---	10/21/2025	0536	<1.0
SHS-1010H-01	Hallway by Room 1010	Drinking Fountain	---	10/21/2025	0537	<1.0
SHS-1010H-02	Hallway by Room 1010	Bottle Filler	---	10/21/2025	0538	<1.0
SHS-CON-01	Concessions Booth	Sprayer	A-Wall	10/21/2025	0658	<1.0
SHS-CON-02	Concessions Booth	Faucet	Left	10/21/2025	0659	<1.0
SHS-CON-03	Concessions Booth	Faucet	Right	10/21/2025	0700	<1.0
SHS-CON-04	Concessions Booth	Tap	B-Wall	10/21/2025	0701	<1.0
SHS-CON-05	Concessions Booth	Tap	C-Wall	10/21/2025	0702	<1.0
SHS-CON-06	Outside Concessions Booth	Drinking Fountain	Left	10/21/2025	0703	<1.0
SHS-CON-07	Outside Concessions Booth	Drinking Fountain	Right	10/21/2025	0704	<1.0
SHS-CON-08	Outside Concessions Booth	Bottle Filler	---	10/21/2025	0705	<1.0

NW = Not Working, NT= Not Tested