



**ENTEK  
CONSULTING GROUP, INC.**

3435 American River Drive, Suite C, Sacramento, CA 95864 Phone (916) 632-6800 [www.entekgroup.com](http://www.entekgroup.com)

**HAZARDOUS MATERIALS SURVEY  
FINAL REPORT**

**OWNER/CLIENT**

**Sacramento City Unified School District  
425 1<sup>st</sup> Avenue  
Sacramento, CA 95818**

**CONTACT**

**Mr. Chris Ralston, Assistant Superintendent  
Facilities Support Services**

**SURVEY ADDRESS**

**Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820**

**BUILDING(S) SURVEYED**

**Full Campus Survey  
Renovation Project**

**PREPARED BY**

**Jose Hernandez  
CAC #22-6995 & CDPH I/A #10754  
Entek Consulting Group, Inc.  
3435 American River Drive, Suite C  
Sacramento, CA 95864**

**Entek Project #25-7963**

**January 16, 2026**

## TABLE OF CONTENTS

|                                                                       |                           |
|-----------------------------------------------------------------------|---------------------------|
| Executive Summary. . . . .                                            | <a href="#"><u>3</u></a>  |
| Introduction. . . . .                                                 | <a href="#"><u>6</u></a>  |
| Building Descriptions. . . . .                                        | <a href="#"><u>6</u></a>  |
| Asbestos Inspection and Sample Collection Protocols. . . . .          | <a href="#"><u>7</u></a>  |
| Asbestos Bulk Sample Results. . . . .                                 | <a href="#"><u>8</u></a>  |
| Asbestos Regulatory Requirements. . . . .                             | <a href="#"><u>15</u></a> |
| Lead Inspection, Sampling, & Results. . . . .                         | <a href="#"><u>16</u></a> |
| Fluorescent Light Tubes and Polychlorinated Biphenyls (PCBs). . . . . | <a href="#"><u>19</u></a> |
| Freon and Fluorocarbons. . . . .                                      | <a href="#"><u>20</u></a> |
| Limitations.. . . .                                                   | <a href="#"><u>20</u></a> |

### Appendices

- A. Asbestos Related Documents
- B. Lead Related Documents
- C. Backup Documents

## **Executive Summary**

The United States Environmental Protection Agency, National Emission Standards for Hazardous Air Pollutants (US EPA NESHAP), 40 CFR Part 61 - Nov. 20, 1990, requires an owner or operator of a demolition or renovation project to thoroughly inspect the affected facility or part of the facility where the demolition or renovation operation will occur for the presence of asbestos-containing materials (ACM) prior to the commencement of that project.

This inspection report was requested by Mr. Wayne Sjolund, Program/Construction Management with Premier Management Group, Inc. (PMG) the construction manager on behalf of Mr. Chris Ralston, Assistant Superintendent with the Sacramento City Unified School District (SCUSD).

The purpose of the inspection was to comply with US EPA NESHAP requirements and the Sacramento Metropolitan Air Quality Management District (SMAQMD) which has jurisdiction for this project site to determine if asbestos containing materials are present which may be impacted during an upcoming Renovation/Demolition Project, which will include renovation and/or demolition of 18 buildings at Earl Warren Elementary School located at 5420 Lowell Street in Sacramento, California.

Paints, coatings, and glazed ceramic tiles were also tested for lead content for compliance with Cal/OSHA lead in construction regulations.

The attached drawings show approximate sample locations and also identify those bulk sample materials analyzed and found to contain asbestos greater than 1% with a (+) after the sample number. Materials analyzed and found to contain less than 1% asbestos or reported as none detected have a (-) after each sample number.

Contractors and other individuals who view the sample locations and associated results indicated with either a (-) or a (+) on the drawings to make determinations take the risk of misidentifying a material and may arrive at determinations which are in direct conflict with the written findings of this report. This use of the drawings and the information provided on it relating to individual sample results in determining if a material does or does not contain asbestos is not recommended.

This is a summary of the report. The report must be read in its entirety, and the reader must review all the detailed information provided in the body of the report prior to making any interpretations, or conclusions pertaining to the information. Any conclusions made by the reader about the information provided in the body of this report which are contradictory or not included in this report are the responsibility of the reader.

### Asbestos

On November 26, 2025, December 11, 2025, December 20, 2025, and January 11, 2026, Entek conducted a survey specific to areas designated by the Owner which included all interior and exterior areas of all the buildings at the Earl Warren Elementary School campus.

The results of testing for asbestos during this survey indicate asbestos is present in multiple materials throughout the campus. A quick summary is detailed in the following bullet points, with specifics pertaining to individual materials found in later sections of this report.

#### Materials Found or Assumed to Contain Asbestos:

##### *Throughout Campus*

- Asbestos cement “transite” water or drain pipe - Assumed to exist below surface grade where found.
- Hydronic pipe insulation - Assumed to exist on abandoned hot water pipes from old central boiler system in ceiling or wall cavities or below surface grade where found.
- Metal door insulation - Assumed to exist in doors at old boiler rooms/mechanical spaces.
- Roofing debris - Assumed to exist throughout attic & ceiling joist spaces LIMITED ATTIC ACCESS WAS FOUND - ADDITIONAL INVESTIGATION SHOULD BE MADE IF CEILINGS WILL BE REMOVED DURING PROJECT.

##### *Building with Admin Office and Classrooms 5-8*

- 4" Hard Pack Pipe Insulation – Above ceiling in Copy Room where found. Assumed to exist within wall/ceiling cavities throughout the building.

##### *Portables 18 and 19*

- Metal roof mastic – At roof seams, holes, and edges.

##### *Portable A4*

- Black mastic associated with the orange carpet – Throughout Portable A4 where found.
- Brown resilient sheet flooring with paper backing – Portable A4 at southeast closet where found.
- Red vinyl floor tile and black mastic – Portable A4 at southeast closet under the Brown resilient sheet flooring where found.
- Black/White penetration mastic - At roof penetrations where found.

#### Lead

Entek investigated existing paints and applied coatings to determine if lead was present in these materials. The materials detailed in the following list were all found or assumed to contain more than 5,000 parts per million (ppm) lead and are classified as lead-based paint (LBP). If more than 100 square feet of these materials are impacted by a “trigger task”, prior notification to Cal/OSHA will be required.

- White colored paint - Interior wooden vertical columns - Throughout permanent classroom buildings where found.
- White colored paint - Interior smooth plaster and drywall walls/ceilings - Throughout restrooms, janitor’s closets, and storage rooms of permanent classroom buildings where found.
- White colored paint - Interior wooden wall panels - Throughout the Library’s Psych Room inside the MPR building where found.
- Blue colored paint - Exterior metal round support columns - Throughout permanent

- buildings where found.
- Off-White colored paint - Exterior wooden components - Throughout permanent buildings where found.

The materials detailed in the following list were all found or assumed to contain lead in amounts less than 5,000 ppm and are classified as lead containing paint (LCP). Any work designated by California Occupational Safety Health Administration (Cal/OSHA) as a “trigger task” which will impact these paints, coatings, or materials must be done by properly trained personnel, in compliance with all lead related Cal/OSHA regulations and requirements.

- White colored paint - Interior smooth plaster and drywall wall/ceiling systems - Throughout Admin building where found.
- Beige colored paint - Interior wooden doors/door frames - Throughout Admin Office building where found.
- Blue colored paint - Interior wooden doors/door frames - Throughout Admin Office building where found.
- Ceramic glazing - 4" Off-White ceramic wall tile - Throughout permanent buildings where found.
- Beige colored paint - Interior plaster/wooden components - Throughout Boy's and Girl's restrooms inside the permanent buildings where found.
- Off-White colored paint - Exterior stucco - Throughout permanent buildings where found.
- Blue colored paint - Exterior wooden components - Throughout permanent buildings where found.
- Light Brown colored paint - Interior wood wall paneling - Throughout MPR building where found.
- Light Brown colored paint - Interior wood wall paneling - Throughout MPR building where found.
- Dark Brown colored paint - Interior wood trim - Throughout MPR building where found.
- Tan colored paint - Interior plaster walls/ceilings - Throughout Kitchen inside the MPR building where found.
- White colored paint - Interior wood doors/door frames/trim - Throughout MPR building where found.
- White colored paint - Interior wood wall paneling - Throughout Stage inside the MPR building where found.
- Blue colored paint - Exterior wood doors/door frames - Throughout permanent buildings where found.
- Blue colored paint - Exterior metal doors/door frames - Throughout portable buildings where found.
- Blue colored paint - Exterior metal hand rails - Throughout portable buildings where found.
- Off-White colored paint - Exterior metal down spouts - Throughout portable buildings where found.
- Blue colored paint - Exterior metal down spouts - Throughout permanent buildings where found.
- Blue colored paint - Exterior metal gutters - Throughout permanent buildings where

- found.
- Blue colored paint - Exterior metal roof edge trim - Throughout permanent buildings where found.

All other sampled paints and materials were determined not to contain lead above the analysis method detection limit of 39, 40, and 51 ppm.

### Other Hazardous Materials

Entek did not specifically inspect for mercury containing fluorescent light tubes or light ballasts which may contain polychlorinated biphenyls (PCBs) or equipment or systems which may contain Freon or other fluorocarbons. However, due to the age of the school, information pertaining to these materials is included in this report for your use and reference.

### **Introduction**

This report presents results of an asbestos and lead survey performed by Entek which included all accessible interior and exterior areas of all buildings for an upcoming campus renovation/demolition project at Earl Warren Elementary School located at 5420 Lowell Street in Sacramento, California. It is our understanding that all structures are planned for either renovation or demolition.

The inspection was conducted by Mr. Jose Hernandez on November 26, 2025, December 11, 2025, December 20, 2025, and January 11, 2026, Mr. Hernandez is a Cal/OSHA Certified Asbestos Consultant (CAC) and State of California Department of Public Health (CDPH) certified Lead Inspector/Assessor.

This report was requested by Mr. Wayne Sjolund, Program/Construction Management with PMG on behalf of Mr. Chris Ralston, Assistant Superintendent with the SCUSD.

### **Building Descriptions**

For the purposes of this survey, the Earl Warren Elementary School campus has been divided up into 18 distinct buildings or sections. These buildings or sections are referred to as follows:

- Building with Admin Office/Classrooms 5-8
- Building with Classrooms 1-4
- Building with Classrooms 9-12
- Building with Classrooms 14-17
- MPR Building/Library
- Portable Building with Classrooms P1 & P2
- Portable Building with Classroom 25 (Student Support Center)
- Portable Building with Classroom 18
- Portable Building with Classroom 19
- Portable Building with Classroom 20
- Portable Building with Classroom 21
- Portable Building with Classroom 22

- Portable Building with Classroom 23
- Portable Building with Classroom 24
- Portable Building with Classrooms A1, A2, and A3
- Portable Building with Room A4
- Shed 1
- Shed 2

Interior finish materials found throughout this campus include carpet, vinyl floor tiles, ceramic floor tiles, sheet vinyl flooring, rubber vinyl base cove, drywall walls/ceilings, plaster walls/ceilings, ceramic wall tile, wood or fiberboard wall panels, and acoustic ceiling panels.

Exterior finish materials include stucco, wood and metal components, and painted wood siding. The standalone classroom buildings have aluminum framed windows. Roof systems on the majority of the buildings consisted of asphaltic roofing with various roofing mastics around penetrations. Mechanical systems are on roof and wall mounted HVAC units.

The roofs from the majority of the portable buildings consisted of metal panels with mastics at the seams/edges/fasteners. Select portable buildings have single ply roofing.

The two sheds located on the northern side of the campus had there respective roof shingle and asphalt roofing.

### **Asbestos Inspection and Sample Collection Protocols**

Entek included all accessible interior and exterior areas of the buildings included in this report, but used only limited methods to look within enclosed wall or ceiling cavities during this investigation. Entek did include all suspect materials observed in, on, or associated with the areas included in this report.

Bulk samples were collected of various materials suspected to contain asbestos by utilizing a power drill and coring tube, cutting the materials with a razor knife, or use of other appropriate hand tools.

Surfacing materials were collected in a statistically random manner representative of the associated homogenous area as required in 40 CFR Part 763, Asbestos-Containing Materials in Schools; Final Rule and Notice, published October 30, 1987, and the Sacramento Metropolitan Air Quality Management District (SMAQMD) Compliance Assistance Advisory published in June 2010.

Thermal system insulation (TSI) materials were collected in a randomly distributed manner from each homogenous area that was not assumed to be ACM as required in 40 CFR Part 763, Asbestos-Containing Materials in Schools; Final Rule and Notice, published October 30, 1987.

Miscellaneous materials were collected from each homogenous area in a manner sufficient to determine whether the material is or is not ACM as required in 40 CFR Part 763, Asbestos-Containing Materials in Schools; Final Rule and Notice, published October 30, 1987.

Approximate locations of all samples collected during this inspection are indicated on the chain of custody for the samples, and on the building diagrams attached to this report.

### Asbestos Bulk Sample Results

There were several materials observed which are considered "suspect" under US EPA guidelines. Under current US EPA guidelines for conducting building inspections for ACM, all "suspect" materials must be assumed to contain asbestos until otherwise determined by laboratory testing.

The samples of materials suspected of containing asbestos were submitted to Eurofins/EMlab P&K, a NVLAP accredited laboratory located in Folsom, California. Select samples were then sent from there to their Burlingame location for analysis. These samples were subsequently analyzed by polarized light microscopy (PLM) with dispersion staining.

The US EPA NESHAP and SMAQMD uses the terms Regulated Asbestos Containing Material (RACM), Category I, and Category II when identifying materials which contain asbestos in amounts greater than 1%. Cal/OSHA uses the term ACCM which indicates a manufactured construction material contains greater than 0.1% asbestos by weight by the PLM method. This definition can be found in Title 8, 1529.

A total of 370 bulk samples were collected of all the materials considered to be "suspect" which are expected to be impacted by the demolition project. Some of those samples contained multiple layers which were individually analyzed to determine their asbestos content. Analysis of all samples collected was by PLM with dispersion staining. Results of the analysis are listed in the following tables:

| Suspect Materials Found or Assumed TO Contain Asbestos Throughout Campus |                                 |                                  |                                                                                                                 |                                 |                          |
|--------------------------------------------------------------------------|---------------------------------|----------------------------------|-----------------------------------------------------------------------------------------------------------------|---------------------------------|--------------------------|
| Sample ID#'s                                                             | Suspect Material                | Asbestos Content/Type (%) by PLM | Location                                                                                                        | NESHAP/ Cal/OSHA Classification | Total Estimated Quantity |
| n/a                                                                      | Asbestos Cement "Transite" Pipe | Assumed to Contain Asbestos      | Throughout campus below surface grade at water or drainage pipe                                                 | CAT-II                          | Unknown if Present       |
| n/a                                                                      | Hydronic Pipe Insulation        | Assumed to Contain Asbestos      | Interior ceiling or wall cavities, exterior below surface grade at old hot water pipe from central boiler units | RACM                            | Unknown if Present       |

| Suspect Materials Found or Assumed TO Contain Asbestos Throughout Campus                                                                                                                                                                                         |                      |                                  |                                                                                                                  |                                 |                          |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|----------------------------------|------------------------------------------------------------------------------------------------------------------|---------------------------------|--------------------------|
| Sample ID#’s                                                                                                                                                                                                                                                     | Suspect Material     | Asbestos Content/Type (%) by PLM | Location                                                                                                         | NESHAP/ Cal/OSHA Classification | Total Estimated Quantity |
| n/a                                                                                                                                                                                                                                                              | Roofing Debris       | Assumed to Contain Asbestos      | Attic & ceiling joist spaces throughout campus at permanent buildings - Leftover from previous roofing projects. | CAT-I                           | Unknown if Present       |
| Limited access to above ceilings spaces was obtained throughout campus. It is unknown if roofing debris from previous roof removal projects is present in any area. Additional investigation of above ceiling spaces should be made if ceilings will be removed. |                      |                                  |                                                                                                                  |                                 |                          |
| n/a                                                                                                                                                                                                                                                              | Door Core Insulation | Assumed to Contain Asbestos      | Doors to old boiler and mechanical spaces                                                                        | RACM                            | Unknown if Present       |

| Suspect Materials Found or Assumed TO Contain Asbestos Admin Office/Classrooms 5-8 Building                                                                                                                                                        |                                 |                                              |                                                                                                                     |                       |                                                                                                      |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------|----------------------------------------------|---------------------------------------------------------------------------------------------------------------------|-----------------------|------------------------------------------------------------------------------------------------------|
| Sample ID#’s                                                                                                                                                                                                                                       | Suspect Material                | Asbestos Content/Type (%) by PLM             | Location                                                                                                            | NESHAP Classification | Total Estimated Quantity                                                                             |
| 12A-C                                                                                                                                                                                                                                              | 4" OD Hard Pack Pipe Insulation | 8% <b>CHRYSTILE</b><br><br>5% <b>AMOSITE</b> | Above ceiling in the Copy Room, where found - Assumed to exist in wall and ceiling cavities throughout the building | RACM                  | ~20 Ln.<br>(Quantity is not exact since it is undetermined how much material is inside the building) |
| Please see sample series 01-11, and 13-27 in Appendix A for materials found not to contain asbestos in this area. Please refer to table labeled Suspect Materials Found or Assumed TO Contain Asbestos Throughout Campus for additional materials. |                                 |                                              |                                                                                                                     |                       |                                                                                                      |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Building with Classrooms 1-4                 |                  |                                  |          |                                 |                          |
|--------------------------------------------------------------------------------------------------------|------------------|----------------------------------|----------|---------------------------------|--------------------------|
| Sample ID#'s                                                                                           | Suspect Material | Asbestos Content/Type (%) by PLM | Location | NESHAP/ Cal/OSHA Classification | Total Estimated Quantity |
| None                                                                                                   | None             | None                             | None     | None                            | None                     |
| Please see sample series 28-43 in Appendix A for materials found not to contain asbestos in this area. |                  |                                  |          |                                 |                          |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Building with Classrooms 9-12                |                  |                                  |          |                                 |                          |
|--------------------------------------------------------------------------------------------------------|------------------|----------------------------------|----------|---------------------------------|--------------------------|
| Sample ID#'s                                                                                           | Suspect Material | Asbestos Content/Type (%) by PLM | Location | NESHAP/ Cal/OSHA Classification | Total Estimated Quantity |
| None                                                                                                   | None             | None                             | None     | None                            | None                     |
| Please see sample series 44-57 in Appendix A for materials found not to contain asbestos in this area. |                  |                                  |          |                                 |                          |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Building with Classrooms 14-17               |                  |                                  |          |                                 |                          |
|--------------------------------------------------------------------------------------------------------|------------------|----------------------------------|----------|---------------------------------|--------------------------|
| Sample ID#'s                                                                                           | Suspect Material | Asbestos Content/Type (%) by PLM | Location | NESHAP/ Cal/OSHA Classification | Total Estimated Quantity |
| None                                                                                                   | None             | None                             | None     | None                            | None                     |
| Please see sample series 58-77 in Appendix A for materials found not to contain asbestos in this area. |                  |                                  |          |                                 |                          |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>MPR Building/Library                          |                  |                                  |          |                                 |                          |
|---------------------------------------------------------------------------------------------------------|------------------|----------------------------------|----------|---------------------------------|--------------------------|
| Sample ID#'s                                                                                            | Suspect Material | Asbestos Content/Type (%) by PLM | Location | NESHAP/ Cal/OSHA Classification | Total Estimated Quantity |
| None                                                                                                    | None             | None                             | None     | None                            | None                     |
| Please see sample series 78-107 in Appendix A for materials found not to contain asbestos in this area. |                  |                                  |          |                                 |                          |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Portable Buildings with Classrooms 20, 21, & 25 (Student Support Center) |                  |                                  |          |                                 |                          |
|------------------------------------------------------------------------------------------------------------------------------------|------------------|----------------------------------|----------|---------------------------------|--------------------------|
| Sample ID#'s                                                                                                                       | Suspect Material | Asbestos Content/Type (%) by PLM | Location | NESHAP/ Cal/OSHA Classification | Total Estimated Quantity |
| None                                                                                                                               | None             | None                             | None     | None                            | None                     |
| Please see sample series 108, 109, & 114-120 in Appendix A for materials found not to contain asbestos in this area.               |                  |                                  |          |                                 |                          |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Portable Buildings with Classrooms 18-19                  |                        |                                  |                                       |                                 |                          |
|---------------------------------------------------------------------------------------------------------------------|------------------------|----------------------------------|---------------------------------------|---------------------------------|--------------------------|
| Sample ID#'s                                                                                                        | Suspect Material       | Asbestos Content/Type (%) by PLM | Location                              | NESHAP/ Cal/OSHA Classification | Total Estimated Quantity |
| 121A-B                                                                                                              | Gray Metal Roof Mastic | <b>5% CHRYSOTILE</b>             | Metal roof at seams, holes, and edges | CAT-II                          | 100 Sq. Distributed      |
| Please see sample series 110-113, & 118-119 in Appendix A for materials found not to contain asbestos in this area. |                        |                                  |                                       |                                 |                          |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Portable Building A4 |                                                |                                                                                                       |                         |                       |                                                                                          |
|--------------------------------------------------------------------------------|------------------------------------------------|-------------------------------------------------------------------------------------------------------|-------------------------|-----------------------|------------------------------------------------------------------------------------------|
| Sample ID#'s                                                                   | Suspect Material                               | Asbestos Content/Type (%) by PLM                                                                      | Location                | NESHAP Classification | Total Estimated Quantity                                                                 |
| 151A-B                                                                         | Orange Carpet, Yellow Mastic, and Black Mastic | NONE DETECTED (Orange Carpet)<br>NONE DETECTED (Yellow Mastic)<br><b>5% CHRYSOTILE</b> (Black Mastic) | Portable A4 where found | CAT-I (Black Mastic)  | Up to 480 Sq. (Unable to verify total quantity due to carpet covering the black mastic.) |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Portable Building A4                                                                                                                                                                                                                                                                                                                                                                                                                   |                                                                                                          |                                                                                                                                                         |                                 |                                                                         |                                                                                |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------|-------------------------------------------------------------------------|--------------------------------------------------------------------------------|
| Sample ID#’s                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Suspect Material                                                                                         | Asbestos Content/Type (%) by PLM                                                                                                                        | Location                        | NESHAP Classification                                                   | Total Estimated Quantity                                                       |
| 152A-B                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | 12" Beige Vinyl Floor Tile and Black Mastic                                                              | NONE DETECTED (Beige Floor Tile)<br>Assumed >1% Asbestos (Black Mastic)                                                                                 | Portable A4 where found         | CAT-I (Black Mastic)                                                    | ~344 Sq.                                                                       |
| 153A-B                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | Brown Resilient Sheet Flooring with Paper Backing, Yellow Mastic, Red Vinyl Floor Tile, and Black Mastic | <b>20% CHRYSOTILE</b> (Sheet Flooring)<br>NONE DETECTED (Yellow Mastic)<br><b>5% CHRYSOTILE</b> (Red Floor Tile)<br><b>2% CHRYSOTILE</b> (Black Mastic) | Portable A4 where found         | RACM (Sheet Flooring)<br>CAT-I (Red Floor Tile)<br>CAT-I (Black Mastic) | ~66 Sq. (Sheet Flooring)<br>~66 Sq. (Red Floor Tile)<br>~66 Sq. (Black Mastic) |
| 166A-B                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | Black/White Penetration Mastic                                                                           | <b>4% CHRYSOTILE</b>                                                                                                                                    | Roof of Portable A4 where found | CAT-II                                                                  | ~4 Sq.                                                                         |
| <p>Please note that the asbestos black mastic is assumed to exist under all the flooring inside Portable Building A4, therefore all flooring materials must be treated/disposed of as &gt;1% asbestos containing materials.</p> <p>Please see sample series 154, 165, &amp; 167-168 in Appendix A for materials found not to contain asbestos in this area. Please refer to table labeled Suspect Materials Found or Assumed TO Contain Asbestos Throughout Campus for additional materials.</p> |                                                                                                          |                                                                                                                                                         |                                 |                                                                         |                                                                                |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Portable Buildings with Classroom 22                  |                  |                                  |          |                       |                          |
|-----------------------------------------------------------------------------------------------------------------|------------------|----------------------------------|----------|-----------------------|--------------------------|
| Sample ID#’s                                                                                                    | Suspect Material | Asbestos Content/Type (%) by PLM | Location | NESHAP Classification | Total Estimated Quantity |
| None                                                                                                            | None             | None                             | None     | None                  | None                     |
| Please see sample series 122-126, & 162 in Appendix A for materials found not to contain asbestos in this area. |                  |                                  |          |                       |                          |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Portable Buildings with Classrooms 23-24              |                  |                                  |          |                       |                          |
|-----------------------------------------------------------------------------------------------------------------|------------------|----------------------------------|----------|-----------------------|--------------------------|
| Sample ID#'s                                                                                                    | Suspect Material | Asbestos Content/Type (%) by PLM | Location | NESHAP Classification | Total Estimated Quantity |
| None                                                                                                            | None             | None                             | None     | None                  | None                     |
| Please see sample series 127-133, & 163 in Appendix A for materials found not to contain asbestos in this area. |                  |                                  |          |                       |                          |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Portable Building with P1 & P2                 |                  |                                  |          |                       |                          |
|----------------------------------------------------------------------------------------------------------|------------------|----------------------------------|----------|-----------------------|--------------------------|
| Sample ID#'s                                                                                             | Suspect Material | Asbestos Content/Type (%) by PLM | Location | NESHAP Classification | Total Estimated Quantity |
| None                                                                                                     | None             | None                             | None     | None                  | None                     |
| Please see sample series 134-143 in Appendix A for materials found not to contain asbestos in this area. |                  |                                  |          |                       |                          |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Portable Building with Classrooms A1, A2, & A3        |                  |                                  |          |                       |                          |
|-----------------------------------------------------------------------------------------------------------------|------------------|----------------------------------|----------|-----------------------|--------------------------|
| Sample ID#'s                                                                                                    | Suspect Material | Asbestos Content/Type (%) by PLM | Location | NESHAP Classification | Total Estimated Quantity |
| None                                                                                                            | None             | None                             | None     | None                  | None                     |
| Please see sample series 144-148, & 164 in Appendix A for materials found not to contain asbestos in this area. |                  |                                  |          |                       |                          |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Shed 1                                     |                  |                                  |          |                       |                          |
|------------------------------------------------------------------------------------------------------|------------------|----------------------------------|----------|-----------------------|--------------------------|
| Sample ID#'s                                                                                         | Suspect Material | Asbestos Content/Type (%) by PLM | Location | NESHAP Classification | Total Estimated Quantity |
| None                                                                                                 | None             | None                             | None     | None                  | None                     |
| Please see sample series 149 in Appendix A for materials found not to contain asbestos in this area. |                  |                                  |          |                       |                          |

| Suspect Materials Found or Assumed TO Contain Asbestos<br>Shed 2                                     |                  |                                  |          |                       |                          |
|------------------------------------------------------------------------------------------------------|------------------|----------------------------------|----------|-----------------------|--------------------------|
| Sample ID#'s                                                                                         | Suspect Material | Asbestos Content/Type (%) by PLM | Location | NESHAP Classification | Total Estimated Quantity |
| None                                                                                                 | None             | None                             | None     | None                  | None                     |
| Please see sample series 150 in Appendix A for materials found not to contain asbestos in this area. |                  |                                  |          |                       |                          |

NOTE: Any CAT-I or CAT-II materials identified in the previous tables which will be subjected to mechanical removal, must be considered RACM for the purposes of notification to SMAQMD and classification of waste. Removal of any CAT-I or CAT-II materials prior to demolition of a building is dependent upon how the materials will be impacted and if the impact will cause the materials to become friable. If any remaining CAT-I or CAT-II materials will become friable they must be removed prior to the initiation of demolition.

NOTE: Cal/OSHA regulates all materials containing greater than 0.1% asbestos. As a result, impact to materials identified as ACCM and ACM must be performed by properly asbestos trained personnel utilizing appropriate personal protection, work practices, as well as, properly constructed and demarcated work areas or containments, in accordance with Cal/OSHA asbestos regulations.

All sample number noted in the tables above start with ECG-25-7963-

The tables above provide an estimate of the amount of materials in square feet (Sq.) or linear feet (Ln.). **Contractors are responsible for quantifying the exact quantity of materials impacted by the renovation or demolition and shall not rely on the quantities in the above tables.**

US EPA AHERA uses three terms when determining the classification of a material for the purpose of sampling. These terms include miscellaneous, surfacing, and thermal system insulation (TSI).

Miscellaneous materials are building materials on structural components, structural members or fixtures, such as floor and ceiling tiles, and does not include surfacing material or TSI.

Surfacing materials are materials that are sprayed-on, troweled-on, or otherwise applied to surfaces, such as acoustical plaster on ceiling and fireproofing materials on structural members, or other materials on surfaces for acoustical, fireproofing, or other purposes.

TSI is material applied to pipes, fittings, boilers, breeching, tanks, ducts, or other structural components to prevent heat loss or gain, water condensation, or for other purposes.

The information provided in this report are for use by the Owner in determining where asbestos containing materials are located, and whether or not any future work may impact those materials. The information is also provided for use by any contractor who may perform work in areas impacting the materials listed in this report, and for use as appropriate by asbestos abatement contractors to provide costs related to work impacting ACM.

Any building materials which are considered “suspect” for containing asbestos which have not been identified in this report must be assumed to contain asbestos in amounts >1% until properly investigated and/or tested.

Materials commonly excluded from being suspected for containing asbestos include, but are not limited to: unwrapped pink and yellow fiberglass insulating materials or products, foam insulation, bare concrete, wood, metal, plastic, or glass. All other types of building materials or coatings on the materials listed above are commonly listed as “suspect” and must be tested prior to impact by a Contractor. Work impacting these untested or newly discovered materials must cease until an investigation can be completed.

## **Asbestos Regulatory Requirements**

### US EPA

The property included in this survey report is located in Sacramento County. Sacramento Metropolitan Air Quality Management District (SMAQMD) has been given authority for enforcement of the NESHAP regulations by means of their own rules (Rule 902).

A demolition is the wrecking, taking out, or burning of any load supporting structural member. A renovation is everything else. Ten day written notification to the SMAQMD is required prior to the performance of any demolition project regardless of asbestos being present or not. This notification would also apply to any renovation project which involves the wrecking, taking out, or burning of any load bearing structural member during a renovation as well.

There is a sufficient amount of ACM present to require a 10 day notification to the SMAQMD be submitted prior to starting work which will impact materials identified as RACM or Category I and Category II materials if they are made friable. If more than 160 square feet, 260 linear feet or 35 cubic feet of RACM is planned for removal on the project, formal written notification to SMAQMD is required.

### Cal/OSHA

Disturbance of any ACM or ACCM could generate airborne asbestos fibers and would be regulated by Cal/OSHA. Cal/OSHA worker health and safety regulations apply during any disturbance of ACM or ACCM by a person while in the employ of another. This is true regardless of friability or quantity disturbed.

Since it has been estimated more than 100 square feet of ACCM and ACM does exist and may be impacted during the upcoming project, a licensed asbestos contractor, certified by the State of California, and registered with Cal/OSHA is recommended to perform the asbestos related removal work.

For compliance with Title 8, Section 341.9, the asbestos contractor must send written notice at least one day (24 hours) prior to start of any work which will impact any amount of asbestos to the local office for the State of California, Department of Occupational Safety and Health, and perform all work in accordance with Cal/OSHA requirements.

### Lead Inspection, Sampling, & Results

An X-Ray Fluorescence (XRF) instrument was utilized as a screening tool in order to determine the presence or absence of lead in paints, coatings, and glazed ceramic tiles throughout the campus. Results shown in the following tables have a margin of error as indicated on the data sheet found in Appendix B.

A total of nine (9) bulk samples of the painted surfaces from various locations throughout the site that had inconclusive XRF results were collected and submitted to Eurofins/EMlab P&K a laboratory located in Tustin, CA. These samples were subsequently analyzed by atomic absorption spectrometry (AAS). Results of the XRF readings and laboratory results are listed in the following tables:

| Paints/Coatings/ Materials Determined to be Lead Based Paint (LBP) |                                          |                                                                                                                                                        |
|--------------------------------------------------------------------|------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------|
| Paint/Coating Color or Material                                    | Lead Content (mg/cm <sup>2</sup> or ppm) | Component/Location                                                                                                                                     |
| White Paint                                                        | 5,800 ppm                                | Interior Wood Columns / Throughout Permanent Buildings, Where Found                                                                                    |
| White Paint                                                        | 12,221 ppm                               | Interior Smooth Plaster/Drywall Walls and Ceiling Systems / Throughout Janitor's Closets and Storage Rooms inside the Permanent Buildings, Where Found |
| White Paint                                                        | 15,074 ppm                               | Interior Wood Wall Panels / Throughout the Library's Psych Room inside the MPR Building, Where Found                                                   |
| Blue Paint                                                         | 75,666 ppm                               | Exterior Metal Round Support Columns / Throughout Covered Walkways                                                                                     |
| Off-White Paint                                                    | 10,477 ppm                               | Exterior Wooden Structural Components / Throughout Permanent Buildings and Covered Walkways, Where Found                                               |
| Off-White/Gray Paint                                               | 11,128 ppm                               | Exterior Metal Down Spouts / Throughout Permanent Buildings, Where Found                                                                               |

LBP - Materials/coatings/paints meeting the definition of lead-based paint as defined by the CDPH and the US EPA, currently defined as containing lead in concentrations equal to or greater than 1.0 mg/cm<sup>2</sup>, 5,000 ppm, or 0.5% by weight.

| <b>Paints/Coatings/ Materials Determined to be Lead Containing Paint (LCP)</b> |                                                |                                                                                                                     |
|--------------------------------------------------------------------------------|------------------------------------------------|---------------------------------------------------------------------------------------------------------------------|
| <b>Paint/Coating Color or Material</b>                                         | <b>Lead Content (mg/cm<sup>2</sup> or ppm)</b> | <b>Component/Location<br/><br/>why so big??</b>                                                                     |
| White Paint                                                                    | 0.2 mg/cm <sup>2</sup>                         | Interior Plaster/Drywall Wall and Ceiling Systems / Throughout Admin Office Building, Where Found                   |
| Beige Paint                                                                    | 706 ppm                                        | Interior Wood Doors/Door Frames / Throughout Admin Office Building, Where Found                                     |
| Blue Paint                                                                     | 342 ppm                                        | Interior Wood Doors/Door Frames/Trim / Throughout Permanent Buildings, Where Found                                  |
| Ceramic Glazing                                                                | 214 ppm                                        | 4"x4" Off-White Ceramic Wall Tile / Throughout Restrooms inside the Permanent Buildings, Where Found                |
| Beige Paint                                                                    | 2,629 ppm                                      | Interior Plaster/Wood Walls & Ceiling Components / Throughout Restrooms inside the Permanent Buildings, Where Found |
| Off-White Paint                                                                | 113 ppm                                        | Exterior Stucco / Throughout Permanent Buildings, Where Found                                                       |
| Blue Paint                                                                     | 1,126 ppm                                      | Exterior Wooden Components / Throughout Permanent Buildings, Where Found                                            |
| Light Brown Paint                                                              | 172 ppm                                        | Interior Wood Paneling / Throughout MPR Building, Where Found                                                       |
| Dark Brown Paint                                                               | 168 ppm                                        | Interior Wood Trim / Throughout MPR Building, Where Found                                                           |
| Tan Paint                                                                      | 240 ppm                                        | Interior Plaster Wall and Ceiling Systems / Throughout MPR Building, Where Found                                    |
| White Paint                                                                    | 600 ppm                                        | Interior Door Frame and Trim / Throughout MPR Building, Where Found                                                 |
| White Paint                                                                    | 468 ppm                                        | Interior Wood Wall Panels / Throughout Stage of the MPR Building, Where Found                                       |
| Blue Paint                                                                     | 594 ppm                                        | Exterior Wood Doors/Door Frames / Throughout Permanent Buildings, Where Found                                       |
| Blue Paint                                                                     | 65 ppm                                         | Exterior Metal Doors/Door Frames / Throughout Portable Buildings, Where Found                                       |
| Blue Paint                                                                     | 86 ppm                                         | Exterior Metal Hand Rails / Throughout Portable Buildings, Where Found                                              |
| Off-White                                                                      | 105 ppm                                        | Exterior Metal Gutters and Down Spouts / Throughout Portable Buildings, Where Found                                 |
| Blue Paint                                                                     | 1,539 ppm                                      | Exterior Metal Down Spouts / Throughout Permanent Buildings, Where Found                                            |
| Blue Paint                                                                     | 73 ppm                                         | Exterior Metal Down Spout / Throughout Permanent Buildings, Where Found                                             |

| Paints/Coatings/ Materials Determined to be Lead Containing Paint (LCP) |                                          |                                                                                                    |
|-------------------------------------------------------------------------|------------------------------------------|----------------------------------------------------------------------------------------------------|
| Paint/Coating Color or Material                                         | Lead Content (mg/cm <sup>2</sup> or ppm) | Component/Location<br><br>why so big??                                                             |
| Blue Paint                                                              | 97 ppm                                   | Exterior Metal Roof Edge Trim / Throughout Permanent Buildings and Covered Walkways, Where Found   |
| Off-White Paint                                                         | 1,100 ppm                                | Interior Plaster Wall/Ceiling Systems / Throughout Kitchen inside of the MPR Building, Where Found |
| White Paint                                                             | 120 ppm                                  | Interior Plaster Wall/Ceiling Systems / Throughout Stage inside the MPR Building, Where Found      |
| Brown Paint                                                             | 354 ppm                                  | Interior Wooden Stage Components / MPR Building, Where Found                                       |
| White Paint                                                             | 96 ppm                                   | Interior Concrete Walls / MPR Building, Where Found                                                |

LCP - Materials/coatings/paints which contain measurable amounts of lead. The disturbance of these materials/coatings/paints is regulated by Cal/OSHA.

All other sampled paints and materials were determined not to contain lead above the analysis method detection limits of 39, 40, and 51 ppm.

### Lead Regulatory Compliance

Any upcoming project which may result in the disturbance of lead containing products or surfaces, but is not intended to remediate a lead hazard or specifically designed to remove LBP to reduce or eliminate a known hazard, would be considered “lead related construction work”.

Lead related construction work does not fit the classification of a “lead abatement project” under CDPH Title 17 regulations. “*Abatement*” is defined in Title 17, Division 1, Chapter 8, Article 1 as “any set of measures designed to reduce or eliminate lead hazards or LBP for public and residential buildings, but does not include containment or cleaning.” A *lead hazard* is defined in Title 17, Division 1, Chapter 8, Article 1 as “deteriorated LBP, lead contaminated dust, lead contaminated soil, disturbing LBP or presumed LBP without containment, or any other nuisance which may result in persistent and quantifiable lead exposure.”

*Lead related construction work* means any “construction, alteration, painting, demolition, salvage, renovation, repair, or maintenance of any residential or public building, including preparation and cleanup, that, by using or disturbing lead-containing material or soil, may result in significant exposure of adults or children to lead”. (Title 17, California Code of Regulations, Division 1, Chapter 8, Article 1).

Currently, Cal/OSHA has not established a definition for LBP, nor have they established minimum concentrations where their regulations do not apply. Cal/OSHA regulates all Hazardous Materials Survey Report – Earl Warren Elementary School - Renovation/Demolition Project 18

construction activities involving materials containing lead, including LBP. These regulations are found in CCR, Title 8 Section 1532.1 (§1532.1) Lead in Construction.

Since Cal/OSHA has not established a concentration of lead in a product where their regulations do not apply, any disturbance to products containing lead come under the jurisdiction of Cal/OSHA and their regulations. Disturbance of paints/coatings or materials determined to be LBP may trigger a pre-work notification to Cal/OSHA if “trigger tasks” disturb 100 square feet or more of those paints/coatings or materials. Trigger tasks are described in Title 8 CCR 1532.1.

### **Fluorescent Light Tubes and Polychlorinated Biphenyls (PCBs)**

Fluorescent light tubes which contain mercury are considered a universal waste and must be packaged and recycled appropriately if they are removed from a building and not used again. The regulation, called the Universal Waste Rule, are in the California Code of Regulations (CCR), Title 22, Division 4.5, Chapter 23.

Fluorescent light tubes are the bulb or tube portion of an electric lighting device and are commonly referred to as “lamps”. Examples of other common electric lamps considered to be universal wastes include, but are not limited to, high intensity discharge, neon, mercury vapor, high pressure sodium, and metal halide lamps. Any lamp which is not spent and has been designated to be reused is not classified as a waste and does not meet the requirements of a hazardous waste or a universal waste.

Spent lamps typically contain concentrations of mercury exceeding the established Total Threshold Limit Concentration (TTLC) and/or the Soluble Threshold Limit Concentration (STLC) values. Therefore, these lamps must be sent to an authorized recycle facility or to a universal waste consolidator for shipment to an authorized recycling facility.

At a minimum, if removed lamps will not be reused they must be packaged in boxes/packages/containers which are structurally sound, adequate to prevent breakage, and compatible with the content of the lamps. These packages must remain closed and be free of damage which could cause leakage under reasonably foreseeable conditions. Each container must be labeled or marked clearly with one of the following phrases: “Universal Waste Lamp(s),” or “Waste Lamp(s),” or “Used Lamp(s).” Entek recommends shipping any lamp not designated for reuse to a universal waste recycling facility once they have been packaged.

PCB containing light ballasts are to be considered a hazardous waste, and must be properly manifested for transport to a hazardous waste facility. Any contractor who may perform PCB related work (inspection, removal, clean-up) must be trained and qualified to do so. All workers must also follow current OSHA regulations including 29 CFR 1910.120 and 8 CCR 5192, as well as, other applicable federal, state, and local laws, and regulations. While light ballasts marked “No PCB” are not considered a hazardous waste, they are considered a universal waste. As a result, removal, packaging, and disposal/recycling of these types of ballasts must be conducted in accordance with current regulations of Title 22.

## Freon and Fluorocarbons

Freon and other fluorocarbon products associated with HVAC systems, refrigerators, etc. may be present in or on the exterior of the buildings included in this investigation. Prior to demolition of a structure or removal of existing HVAC systems, refrigerators, or any other type of equipment which typically uses these types of coolant products shall have the coolant materials investigated prior to their demolition and removed from the mechanical systems and recycled in accordance with Cal/EPA requirements.

## Limitations

Entek inspected all specified interior and exterior areas of all buildings located at the Earl Warren Elementary School campus. The information provided in this inspection report may not be used to extend the inspection results to areas not included in this report without additional review and sampling as necessary.

Entek did not perform destructive sampling to look into ceiling and wall cavities. As a result, it may be possible for materials to be hidden in these areas which are not included in this report. Entek also did not employ any destructive measures on floors of interior spaces or exterior areas covered with asphalt, concrete, or dirt.

If any new materials not listed as having been sampled, or listed as assumed for containing asbestos in this report are discovered, the new material must be assumed to contain asbestos until properly inspected and tested for asbestos content.

Entek's policy is to retain a full copy of these written documents for three (3) years once the file is closed. At the end of the 3 year period the written files will be destroyed without further notice. It is suggested copies of the file(s) are maintained as per the District's policy.

Entek will be providing only this electronic copy of the report and its attachments for your use. Thank you for choosing Entek for your environmental needs. Please call me at (916) 632-6800 if you have any questions regarding this report.

Prepared By:



Jose Hernandez, CAC, I/A  
Project Manager

Reviewed By:



Blake Howes, CAC, I/A  
Vice President

## Appendices

- A. Asbestos Related Documents
- B. Lead Related Documents
- C. Backup Documents

## **APPENDIX A**

### **ASBESTOS RELATED DOCUMENTS**

- Bulk Asbestos Analysis Report From Eurofins/EMLab P&K
- Bulk Asbestos Material Analysis Request Form for Entek
- Asbestos Bulk Sample Location Drawings
- SMAQMD Asbestos Survey Form
- SMAQMD Demolition/Renovation Form  
(To be completed by Owner)

Report for:

**Jose Hernandez, Mathew Watson**  
**Entek Consulting Group**  
3435 American River Drive  
Suite C  
Sacramento, CA 95864

---

Regarding: Eurofins Built Environment Testing West, LLC  
Project: 25-7963; Sacramento City USD - Earl Warren Elementary School  
EML ID: 4358740

Approved by:

Dates of Analysis:  
Asbestos PLM: 12-30-2025 and 12-31-2025



Approved Signatory  
James Schatz

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)  
NVLAP Lab Code 600255-0

---

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Built Environment Testing West, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Total Samples Submitted:** 102**Total Samples Analyzed:** 100**Total Samples with Layer Asbestos Content > 1%:** 1**Location: ECG-25-7963-01A, Blue Mottled Carpet with Yellow Mastic - Admin Bldg,  
South of File Storage**

Lab ID-Version‡: 21841032-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-01B, Blue Mottled Carpet with Yellow Mastic - Admin Bldg,  
Utility Closet**

Lab ID-Version‡: 21841033-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-02A, Green/Blue Mottled Carpet with Yellow Mastic - Admin  
Bldg, West Side of Admin Area**

Lab ID-Version‡: 21841034-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue-Green Carpet                      | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-02B, Green/Blue Mottled Carpet with Yellow Mastic - Admin  
Bldg, Southeast Side near Main Entrance**

Lab ID-Version‡: 21841035-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue-Green Carpet                      | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-03A, Twelve inch Green Mottled Vinyl Floor Tile with Yellow  
Mastic - Admin Bldg, Southeast Side near Main Entrance**

Lab ID-Version‡: 21841036-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Green Floor Tile                     | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-03B, Twelve inch Green Mottled Vinyl Floor Tile with Yellow  
Mastic - Admin Bldg, Supply Room**

Lab ID-Version‡: 21841037-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Green Floor Tile                     | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-04A, Two inch Beige Speckled Ceramic Floor Tile with Grout  
and Mortar - Admin Bldg, Northwest Restroom**

Lab ID-Version‡: 21841038-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Beige Ceramic Tile                   | ND               |
| Tan Grout                            | ND               |
| Brown Mortar                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-04B, Two inch Beige Speckled Ceramic Floor Tile with Grout  
and Mortar - Admin Bldg, Southeast Restroom**

Lab ID-Version‡: 21841039-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Beige Ceramic Tile                        | ND               |
| Tan Grout                                 | ND               |
| Brown Mortar                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-05A, Concrete Foundation - Admin Bldg. File Storage**

Lab ID-Version‡: 21841040-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Concrete                             | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-05B, Concrete Foundation - Admin Bldg. Classroom 8**

Lab ID-Version‡: 21841041-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Concrete                             | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-06A, Four inch Blue Vinyl Base Cove with White Mastic -  
Admin Bldg, East Wall of Admin Area**

Lab ID-Version‡: 21841042-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Blue Cove Base                            | ND               |
| White Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-06B, Four inch Blue Vinyl Base Cove with White Mastic -  
Admin Bldg, Nurses Office**

Lab ID-Version‡: 21841043-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Blue Cove Base                            | ND               |
| White Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-07A, Plaster - Admin Bldg, West Wall of Copy Room**

Lab ID-Version‡: 21841044-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Off-White Plaster                         | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-07B, Plaster - Admin Bldg, East Wall near Main Entrance**

Lab ID-Version‡: 21841045-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Off-White Plaster                         | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-07C, Plaster - Admin Bldg, Northwest Wall of Admin Area**

Lab ID-Version‡: 21841046-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Off-White Plaster                         | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-07D, Plaster - Admin Bldg, Southeast Ceiling of Copy Room**

Lab ID-Version‡: 21841047-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Off-White Plaster                         | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-07E, Plaster - Admin Bldg, North Ceiling of Copy Room**

Lab ID-Version‡: 21841048-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Off-White Plaster                         | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-08A, Drywall with Joint Compound - Admin Bldg, Northeast  
Restroom**

Lab ID-Version‡: 21841049-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Off-White Compound                        | ND               |
| Cream Tape                                | ND               |
| Off-White Joint Compound                  | ND               |
| White Drywall with Brown Paper            | ND               |
| <b>Composite Non-Asbestos Content:</b>    | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-08B, Drywall with Joint Compound - Admin Bldg, Principal's  
Office**

Lab ID-Version‡: 21841050-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Off-White Compound                        | ND               |
| Cream Tape                                | ND               |
| Off-White Joint Compound                  | ND               |
| White Drywall with Brown Paper            | ND               |
| <b>Composite Non-Asbestos Content:</b>    | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-08C, Drywall with Joint Compound - Admin Bldg, Southeast Restroom**

Lab ID-Version‡: 21841051-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Compound                     | ND               |
| Cream Tape                             | ND               |
| Off-White Joint Compound               | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-09A, Four inch Off-White Ceramic Wall Tile with Grout and Mortar - Admin Bldg, Southeast Restroom**

Lab ID-Version‡: 21841052-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Off-White Ceramic Tile               | ND               |
| Brown Grout                          | ND               |
| White Mortar                         | ND               |
| Off-White Compound                   | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-09B, Four inch Off-White Ceramic Wall Tile with Grout and Mortar - Admin Bldg, Southeast Restroom**

Lab ID-Version‡: 21841053-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Off-White Ceramic Tile               | ND               |
| Brown Grout                          | ND               |
| White Mortar                         | ND               |
| Off-White Compound                   | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-10A, 2'x4' Ceiling Panel - Admin Bldg, Admin Area**

Lab ID-Version‡: 21841054-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Beige Ceiling Tile with White Surface  | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>15% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

**Location: ECG-25-7963-10B, 2'x4' Ceiling Panel - Admin Bldg, Nurses Office**

Lab ID-Version‡: 21841055-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Beige Ceiling Tile with White Surface  | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>15% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

**Location: ECG-25-7963-11A, Roofing Debris - Admin Bldg, Above Copy Room**

Lab ID-Version‡: 21841056-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Black Roofing Material                 | ND               |
| <b>Composite Non-Asbestos Content:</b> | 5% Glass Fibers  |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-11B, Roofing Debris - Admin Bldg, Above Copy Room**

Lab ID-Version‡: 21841057-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Black Roofing Material                 | ND               |
| <b>Composite Non-Asbestos Content:</b> | 5% Glass Fibers  |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-12A, Four inch Hard Pack Pipe Run Insulation - Admin Bldg,  
Above Copy Room**

Lab ID-Version‡: 21841058-1

| Sample Layers                        | Asbestos Content            |
|--------------------------------------|-----------------------------|
| White Insulation                     | 8% Chrysotile<br>5% Amosite |
| <b>Sample Composite Homogeneity:</b> | Good                        |

**Comments:** -12b and -12c were not analyzed due to prior positive series.**Location: ECG-25-7963-13A, Green/Blue Mottled Carpet with Yellow Mastic -  
Classroom 5**

Lab ID-Version‡: 21841061-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue-Green Carpet                      | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-13B, Green/Blue Mottled Carpet with Yellow Mastic -  
Classroom 6**

Lab ID-Version‡: 21841062-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue-Green Carpet                      | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-14A, Twelve inch Green Mottled Vinyl Floor Tile with Yellow  
Mastic - Classroom 6**

Lab ID-Version‡: 21841063-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Green Floor Tile                     | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-14B, Twelve inch Green Mottled Vinyl Floor Tile with Yellow  
Mastic - Classroom 7**

Lab ID-Version‡: 21841064-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Green Floor Tile                          | ND               |
| Yellow Mastic                             | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-15A, Four inch Blue Vinyl Base Cove with White Mastic -  
Classroom 6**

Lab ID-Version‡: 21841065-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Blue Cove Base                            | ND               |
| White Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-15B, Four inch Blue Vinyl Base Cove with White Mastic -  
Classroom 7**

Lab ID-Version‡: 21841066-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Blue Cove Base                            | ND               |
| White Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-16A, Under Sink Coating - Classroom 6**

Lab ID-Version‡: 21841067-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Sink Undercoating                    | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-16B, Under Sink Coating - Classroom 7**

Lab ID-Version‡: 21841068-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Sink Undercoating               | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-17A, Tan-Beige Wall Paper with Glue - Classroom 6**

Lab ID-Version‡: 21841069-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Tan Wallpaper with Glue                | ND               |
| <b>Composite Non-Asbestos Content:</b> | 50% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-17B, Tan-Beige Wall Paper with Glue - Classroom 7**

Lab ID-Version‡: 21841070-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Tan Wallpaper with Glue                | ND               |
| <b>Composite Non-Asbestos Content:</b> | 50% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-18A, Drywall with Joint Compound - Classroom 5**

Lab ID-Version‡: 21841071-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Joint Compound with Paint    | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-18B, Drywall with Joint Compound - Classroom 6**

Lab ID-Version‡: 21841072-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Joint Compound with Paint    | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-19A, Orange Peel Texture - Classroom 5**

Lab ID-Version‡: 21841073-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Texture                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-19B, Orange Peel Texture - Classroom 6**

Lab ID-Version‡: 21841074-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Texture                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-19C, Orange Peel Texture - Classroom 7**

Lab ID-Version‡: 21841075-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Texture                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-19D, Orange Peel Texture - Classroom 8**

Lab ID-Version‡: 21841076-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Texture                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-19E, Orange Peel Texture - Classroom 8**

Lab ID-Version‡: 21841077-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Texture                      | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-20A, Drywall with Joint Compound - Boy's Restroom adjacent  
to Classroom 8**

Lab ID-Version‡: 21841078-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Compound with Paint          | ND               |
| Cream Tape                             | ND               |
| Off-White Joint Compound               | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-20B, Drywall with Joint Compound - Girl's Restroom adjacent  
to Classroom 8**

Lab ID-Version‡: 21841079-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Compound with Paint          | ND               |
| Cream Tape                             | ND               |
| Off-White Joint Compound               | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-21A, Skim Coat - Boy's Restroom adjacent to Classroom 8**

Lab ID-Version‡: 21841080-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Skim Coat                      | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-21B, Skim Coat - Boy's Restroom adjacent to Classroom 8**

Lab ID-Version‡: 21841081-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Skim Coat                      | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-21C, Skim Coat - Girl's Restroom adjacent to Classroom 8**

Lab ID-Version‡: 21841082-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Skim Coat                    | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-22A, Drywall with Joint Compound - HVAC Closet inside  
Classroom 6**

Lab ID-Version‡: 21841083-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Off-White Compound with Paint                 | ND               |
| Cream Tape                                    | ND               |
| Off-White Joint Compound                      | ND               |
| White Drywall with Brown Paper                | ND               |
| Composite Non-Asbestos Content: 15% Cellulose |                  |
| Sample Composite Homogeneity: Good            |                  |

**Location: ECG-25-7963-22B, Drywall with Joint Compound - HVAC Closet inside  
Classroom 7**

Lab ID-Version‡: 21841084-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Off-White Compound with Paint                 | ND               |
| Cream Tape                                    | ND               |
| Off-White Joint Compound                      | ND               |
| White Drywall with Brown Paper                | ND               |
| Composite Non-Asbestos Content: 15% Cellulose |                  |
| Sample Composite Homogeneity: Good            |                  |

**Location: ECG-25-7963-23A, Gray HVAC Duct Mastic - HVAC Closet inside Classroom  
7**

Lab ID-Version‡: 21841085-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Mastic                        | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-23B, Gray HVAC Duct Mastic - HVAC Closet inside Classroom****8**

Lab ID-Version‡: 21841086-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| Gray Mastic                   | ND               |
| Sample Composite Homogeneity: | Good             |

**Location: ECG-25-7963-24A, HVAC Vibration Dampener - HVAC Closet inside****Classroom 7**

Lab ID-Version‡: 21841087-1

| Sample Layers                   | Asbestos Content |
|---------------------------------|------------------|
| Black Wrap                      | ND               |
| Composite Non-Asbestos Content: | 40% Glass Fibers |
| Sample Composite Homogeneity:   | Good             |

**Location: ECG-25-7963-24B, HVAC Vibration Dampener - HVAC Closet inside****Classroom 8**

Lab ID-Version‡: 21841088-1

| Sample Layers                   | Asbestos Content |
|---------------------------------|------------------|
| Black Wrap                      | ND               |
| Composite Non-Asbestos Content: | 40% Glass Fibers |
| Sample Composite Homogeneity:   | Good             |

**Location: ECG-25-7963-25A, Rough Textured Plaster - Equipment Room adjacent to****Classroom 8, South Wall**

Lab ID-Version‡: 21841089-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| Off-White Plaster             | ND               |
| Sample Composite Homogeneity: | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-25B, Rough Textured Plaster - Equipment Room adjacent to  
Classroom 8, North Wall**

Lab ID-Version‡: 21841090-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Off-White Plaster                  | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-25C, Rough Textured Plaster - Equipment Room adjacent to  
Classroom 8, North Wall**

Lab ID-Version‡: 21841091-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Off-White Plaster                  | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-25D, Rough Textured Plaster - Equipment Room adjacent to  
Classroom 8, West Wall**

Lab ID-Version‡: 21841092-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Off-White Plaster                  | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-25E, Rough Textured Plaster - Equipment Room adjacent to  
Classroom 8, Southwest Wall**

Lab ID-Version‡: 21841093-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Off-White Plaster                  | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-26A, Skim Coat on Tagboard Ceiling - Boy's Restroom adjacent  
to Classroom 8**

Lab ID-Version‡: 21841094-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Skim Coat with Paper             | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-26B, Skim Coat on Tagboard Ceiling - Boy's Restroom adjacent  
to Classroom 8**

Lab ID-Version‡: 21841095-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Skim Coat with Paper             | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-26C, Skim Coat on Tagboard Ceiling - Girl's Restroom adjacent  
to Classroom 8**

Lab ID-Version‡: 21841096-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Skim Coat with Paper             | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-27A, 2'x4' Ceiling Panel - Classroom 5**

Lab ID-Version‡: 21841097-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Beige Ceiling Tile with White Surface  | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>15% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-27B, 2'x4' Ceiling Panel - Classroom 8**

Lab ID-Version‡: 21841098-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Beige Ceiling Tile with White Surface  | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>15% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

**Location: ECG-25-7963-28A, Blue Mottled Carpet with Yellow Mastic - Classroom 3**

Lab ID-Version‡: 21841099-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-28B, Blue Mottled Carpet with Yellow Mastic - Classroom 2**

Lab ID-Version‡: 21841100-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-29A, Twelve inch Green Mottled Vinyl Floor Tile with Yellow  
Mastic - Classroom 3**

Lab ID-Version‡: 21841101-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Green Floor Tile                     | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-29B, Twelve inch Green Mottled Vinyl Floor Tile with Yellow  
Mastic - Restroom Foyer between Classrooms 1 & 2**

Lab ID-Version‡: 21841102-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Green Floor Tile                          | ND               |
| Yellow Mastic                             | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-30A, Two inch Beige Speckled Ceramic Floor Tile with Grout  
and Mortar - Girl's Restroom adjacent to Classroom 4**

Lab ID-Version‡: 21841103-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Beige Ceramic Tile                            | ND               |
| Gray Grout                                    | ND               |
| Light Gray Mortar                             | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

**Location: ECG-25-7963-30B, Two inch Beige Speckled Ceramic Floor Tile with Grout  
and Mortar - Boy's Restroom adjacent to Classroom 4**

Lab ID-Version‡: 21841104-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Beige Ceramic Tile                            | ND               |
| Gray Grout                                    | ND               |
| Light Gray Mortar                             | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

**Location: ECG-25-7963-31A, Concrete Foundation - HVAC Closet inside Classroom 1**

Lab ID-Version‡: 21841105-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Concrete                             | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-31B, Concrete Foundation - HVAC Closet inside Classroom 4**

Lab ID-Version‡: 21841106-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Concrete                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-32A, Four inch Blue Vinyl Base Cove with White Mastic -  
Classroom 2**

Lab ID-Version‡: 21841107-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Blue Cove Base                     | ND               |
| White Mastic                       | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-32B, Four inch Blue Vinyl Base Cove with White Mastic -  
Classroom 4**

Lab ID-Version‡: 21841108-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Blue Cove Base                     | ND               |
| White Mastic                       | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-33A, Tan-Beige Wall Paper with Glue - Classroom 3**

Lab ID-Version‡: 21841109-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Tan Wallpaper with Glue            | ND               |
| Composite Non-Asbestos Content:    | 40% Cellulose    |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-33B, Tan-Beige Wall Paper with Glue - Classroom 1**

Lab ID-Version‡: 21841110-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Tan Wallpaper with Glue                | ND               |
| <b>Composite Non-Asbestos Content:</b> | 40% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-34A, Gray HVAC Duct Mastic - HVAC Closet inside Classroom**

2

Lab ID-Version‡: 21841111-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Mastic                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-34B, Gray HVAC Duct Mastic - HVAC Closet inside Classroom**

3

Lab ID-Version‡: 21841112-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Mastic                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-35A, Vibration Dampener - HVAC Closet inside Classroom 2**

Lab ID-Version‡: 21841113-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Black Wrap                             | ND               |
| <b>Composite Non-Asbestos Content:</b> | 40% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-35B, Vibration Dampener - HVAC Closet inside Classroom 3**

Lab ID-Version‡: 21841114-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Black Wrap                             | ND               |
| <b>Composite Non-Asbestos Content:</b> | 40% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-36A, Drywall with Joint Compound - Girl's Restroom adjacent  
to Classroom 4**

Lab ID-Version‡: 21841115-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Compound with Paint          | ND               |
| Cream Tape                             | ND               |
| Off-White Joint Compound               | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Moderate         |

**Location: ECG-25-7963-36B, Drywall with Joint Compound - Boy's Restroom adjacent  
to Classroom 4**

Lab ID-Version‡: 21841116-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Compound with Paint          | ND               |
| Cream Tape                             | ND               |
| Off-White Joint Compound               | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Moderate         |

**Location: ECG-25-7963-37A, Skim Coat - Girl's Restroom adjacent to Classroom 4**

Lab ID-Version‡: 21841117-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Off-White Skim Coat                  | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-37B, Skim Coat - Girl's Restroom adjacent to Classroom 4**

Lab ID-Version‡: 21841118-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Off-White Skim Coat                  | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-37C, Skim Coat - Boy's Restroom adjacent to Classroom 4**

Lab ID-Version‡: 21841119-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Off-White Skim Coat                  | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-38A, Drywall with Joint Compound - HVAC Closet inside  
Classroom 2**

Lab ID-Version‡: 21841120-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Compound                     | ND               |
| Cream Tape                             | ND               |
| Off-White Joint Compound               | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Comments:** No drywall present for analysis.**Location: ECG-25-7963-38B, Drywall with Joint Compound - HVAC Closet inside  
Classroom 3**

Lab ID-Version‡: 21841121-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Compound                     | ND               |
| Cream Tape                             | ND               |
| Off-White Joint Compound               | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-39A, Drywall with Joint Compound - Classroom 1**

Lab ID-Version‡: 21841122-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Compound                     | ND               |
| Cream Tape                             | ND               |
| Off-White Joint Compound               | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-39B, Drywall with Joint Compound - Classroom 3**

Lab ID-Version‡: 21841123-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Compound                     | ND               |
| Cream Tape                             | ND               |
| Off-White Joint Compound               | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-40A, Orange Peel Texture - Classroom 1**

Lab ID-Version‡: 21841124-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Off-White Texture                    | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-40B, Orange Peel Texture - Classroom 3**

Lab ID-Version‡: 21841125-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Off-White Texture                    | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-40C, Orange Peel Texture - Classroom 4**

Lab ID-Version‡: 21841126-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Off-White Texture                  | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-41A, Four inch Off-White Ceramic Wall Tile with Grout and Mortar - Girl's Restroom adjacent to Classroom 4**

Lab ID-Version‡: 21841127-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Off-White Ceramic Tile             | ND               |
| Brown Grout                        | ND               |
| White Mortar                       | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-41B, Four inch Off-White Ceramic Wall Tile with Grout and Mortar - Boy's Restroom adjacent to Classroom 4**

Lab ID-Version‡: 21841128-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Off-White Ceramic Tile             | ND               |
| Brown Grout                        | ND               |
| White Mortar                       | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-42A, Plaster - Janitor Closet between Classrooms 1 & 2**

Lab ID-Version‡: 21841129-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Gray Cementitious Material         | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025

Date of Receipt: 12-30-2025

Date of Report: 01-07-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-42B, Plaster - Janitor Closet between Classrooms 1 & 2**

Lab ID-Version‡: 21841130-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| White Plaster                             | ND               |
| Gray Cementitious Material                | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-42C, Plaster - Janitor Closet between Classrooms 1 & 2**

Lab ID-Version‡: 21841131-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| White Plaster                             | ND               |
| Gray Cementitious Material                | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-42D, Plaster - Janitor Closet between Boy's & Girl's Restrooms**

Lab ID-Version‡: 21841132-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Off-White Plaster                         | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-42E, Plaster - Janitor Closet between Boy's & Girl's Restrooms**

Lab ID-Version‡: 21841133-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Off-White Plaster                         | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025  
Date of Receipt: 12-30-2025  
Date of Report: 01-07-2026

**ASBESTOS PLM REPORT**

|                                    |     |
|------------------------------------|-----|
| <b>Total Samples Submitted:</b>    | 102 |
| <b>Total Samples Analyzed:</b>     | 100 |
| <b>Total Samples Not Analyzed:</b> | 2   |

**ECG-25-7963-12B, Four inch Hard Pack Pipe Run Insulation - Admin Bldg, Above Copy Room** Lab ID-Version‡: 21841059-0

|                     |                      |
|---------------------|----------------------|
| <b>NOT ANALYZED</b> | <b>POSITIVE STOP</b> |
|---------------------|----------------------|

**ECG-25-7963-12C, Four inch Hard Pack Pipe Run Insulation - Admin Bldg, Above Copy Room** Lab ID-Version‡: 21841060-0

|                     |                      |
|---------------------|----------------------|
| <b>NOT ANALYZED</b> | <b>POSITIVE STOP</b> |
|---------------------|----------------------|

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Sample results described as "Positive Stop" were not analyzed because the previous sample layer(s) contained asbestos >1%. Sample results described as "Sample Bag Empty" were not analyzed because while the sample bag was submitted it did not contain a discernible sample. Sample results described as "No Sample Submitted" were not analyzed because the sample bag was not submitted with the project. Sample results described as "Insufficient Sample" were not analyzed because while the sample was submitted for analysis, there was insufficient material present to analyze the sample confidently. Sample results described as "Per Client Request" were submitted to the laboratory but not analyzed because the laboratory was requested to hold the sample.

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630  
(833) 465-5857 [www.eurofinsus.com/Built](http://www.eurofinsus.com/Built)

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 11-26-2025  
Date of Receipt: 12-30-2025  
Date of Report: 01-07-2026

**ASBESTOS PLM REPORT**

**PROJECT ANALYST AND SIGNATORY REPORT**

---

**Project Analyst**



---

**Analyst:** Samantha Pierce

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

EMLab ID
4358740

REQUEST SERVICE
(Use checkboxes below)

Page 29 of 38

CONTACT INFORMATION

Table with 3 columns: Company, Contact, Phone. Includes address and special instructions.

PROJECT INFORMATION

TURN AROUND TIME CODES (TAT)

Table with 4 columns: Project ID, Project Description, Project Zip Code, PO Number. Includes sampling date and time, and TAT codes (STD, ND, SD, WH).

Table with 7 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains 12 rows of sample data.

Table with 10 columns for Asbestos PLM checkboxes.

Table with 4 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY, DATE & TIME. Includes signature and analyst name.



Table with weather conditions: Weather (None, Light, Moderate, Heavy), Level, Fog, Rain, Snow, Wind, Clear.

New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

CONTACT INFORMATION

Table with contact details: Company (Entek Consulting Group), Address (3435 American River Drive), Contact (Jose Hernandez, Mathew Watson), Phone (916-824-5580), and Special Instructions.

PROJECT INFORMATION

TURN AROUND TIME CODES (TAT)

Table with project details: Project ID (25-7963), Project Description (Sacramento City USD), Sampling Date & Time (11/26/2025 07:30 AM), PO Number (25-7963), and TAT codes (STD, ND, SD, WH).

Main table with 7 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, and Notes. Contains 12 rows of sample data.

EMLab ID
4358740

REQUEST SERVICE
(Use checkboxes below)

Table for Request Service with 10 columns and 10 rows of checkboxes for Asbestos PLM.

Table for Sample Type Codes, Relinquished By (Jose Hernandez), Date & Time (12/30/2025 7:56 AM), Received By (Samantha Pierce), and Date & Time (12/30/2025 8:45 AM).

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at:

https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

EMLab ID
4358740

REQUEST SERVICE
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697)
Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Mathew Watson
Special Instructions: Stop Analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION and TURN AROUND TIME CODES (TAT)
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Project Zip Code: 95820
Sampling Date & Time: 11/26/2025 07:30 AM
PO Number: 25-7963
Sampled By: Jose Hernandez
TAT codes: STD - Standard (DEFAULT), ND - Next Business Day, SD - Same Business Day Rush, WH - Weekend / Holiday

Table with 7 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains 14 rows of sample data including ECG-25-7963-10A through ECG-25-7963-14B.

Asbestos PLM table with 10 columns and 10 rows of checkboxes for sample analysis.

Table with 4 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY. Includes signature of Samantha Pierce, Analyst.



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

EMLab ID
4358740

REQUEST SERVICE
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697)
Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Mathew Watson
Special Instructions: Stop Analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION and TURN AROUND TIME CODES (TAT)
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Project Zip Code: 95820
Sampling Date & Time: 11/26/2025 07:30 AM
PO Number: 25-7963
Sampled By: Jose Hernandez
TAT codes: STD - Standard (DEFAULT), ND - Next Business Day, SD - Same Business Day Rush, WH - Weekend / Holiday

Table with 7 columns: Sample ID, Description, Sample Type (Below), TAT (Above), Volume / Area (as applicable), ISO Class (as applicable), Notes (Time of day, Temp, RH, etc.)
Rows include sample IDs ECG-25-7963-15A through ECG-25-7963-19C with descriptions of materials and locations.

Asbestos PLM table with 10 columns and 10 rows of checkboxes for sample analysis.

Table with 4 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY, DATE & TIME. Includes signature of Samantha Pierce.



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes Level (None, Light, Moderate, Heavy) and checkboxes for each condition.

EMLab ID
4358740

REQUEST SERVICE
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697)
Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Mathew Watson
Special Instructions: Stop Analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION and TURN AROUND TIME CODES (TAT)
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Project Zip Code: 95820
Sampling Date & Time: 11/26/2025 07:30 AM
PO Number: 25-7963
Sampled By: Jose Hernandez
TAT codes: STD - Standard (DEFAULT), ND - Next Business Day, SD - Same Business Day Rush, WH - Weekend / Holiday

Table with 7 columns: Sample ID, Description, Sample Type (Below), TAT (Above), Volume / Area (as applicable), ISO Class (as applicable), Notes (Time of day, Temp, RH, etc.)
Rows include sample IDs ECG-25-7963-19D through ECG-25-7963-23B with descriptions like Orange Peel Texture, Drywall with Joint Compound, Skim Coat, and Gray HVAC Duct Mastic.

Asbestos PLM table with 10 columns for different asbestos types and 10 rows of checkboxes.

Table with 4 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY, DATE & TIME. Includes signature of Samantha Pierce, Analyst.



Table with weather conditions: Weather (None, Light, Moderate, Heavy), Level, Fog, Rain, Snow, Wind, Clear.

New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

CONTACT INFORMATION

Table with contact details: Company (Entek Consulting Group), Address (3435 American River Drive), Contact (Jose Hernandez), Special Instructions.

PROJECT INFORMATION

TURN AROUND TIME CODES (TAT)

Table with project details: Project ID (25-7963), Project Description (Sacramento City USD), Sampling Date & Time (11/26/2025 07:30 AM), PO Number (25-7963), Sampled By (Jose Hernandez).

Main table with 8 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains 12 rows of sample data.

EMLab ID
4358740

REQUEST SERVICE
(Use checkboxes below)

Table for Asbestos PLM with checkboxes for various sample types.

Table for Sample Type Codes, Relinquished By (Jose Hernandez), Date & Time (12/30/2025 7:56 AM), Received By (Samantha Pierce), Date & Time (12/30/2025 8:45 AM).



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

EMLab ID
4358740

REQUEST SERVICE
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697)
Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Mathew Watson
Special Instructions: Stop Analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION and TURN AROUND TIME CODES (TAT)
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Sampling Date & Time: 11/26/2025 07:30 AM
PO Number: 25-7963
Sampled By: Jose Hernandez
TAT codes: STD - Standard (DEFAULT), ND - Next Business Day, SD - Same Business Day Rush, WH - Weekend / Holiday

Table with 7 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains 13 rows of sample data including Classroom 8, Classroom 3, Classroom 2, Classroom 4, and Classroom 1.

Asbestos PLM table with 10 columns and 10 rows of checkboxes for sample identification.

Table with 4 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY, DATE & TIME. Includes signature of Samantha Pierce.

**CHAIN OF CUSTODY**  
[www.eurofinsus.com/Built](http://www.eurofinsus.com/Built)



**New Jersey:** 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984  
**Phoenix, AZ:** 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802  
**Burlingame, CA:** 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

| Weather |          | Fog                                 | Rain                                | Snow                                | Wind                                | Clear                    |
|---------|----------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| Level   | None     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
|         | Light    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Moderate | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Heavy    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |

EMLab ID  
4358740

Page 36 of 38

**REQUESTING SERVICE**

(Use checkboxes below)

## CONTACT INFORMATION

|          |                               |                                                                                                                                                                                                                                                                |
|----------|-------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Company: | Entek Consulting Group (9697) | Address: 3435 American River Drive Suite C Sacramento, CA 95864<br><br>Special Instructions: Stop Analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series. |
| Contact: | Jose Hernandez, Mathew Watson |                                                                                                                                                                                                                                                                |
| Phone:   | 916-824-5580                  |                                                                                                                                                                                                                                                                |

## PROJECT INFORMATION

**TURN AROUND TIME CODES (TAT)**

|                      |                                                     |                            |                     |                                   |                                                                                                                                                           |
|----------------------|-----------------------------------------------------|----------------------------|---------------------|-----------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|
| Project ID:          | 25-7963                                             |                            |                     | <b>STD</b> – Standard (DEFAULT)   | <p>Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.</p> |
| Project Description: | Sacramento City USD - Earl Warren Elementary School |                            |                     | <b>ND</b> – Next Business Day     |                                                                                                                                                           |
| Project Zip Code:    | 95820                                               | Sampling Date & Time:      | 11/26/2025 07:30 AM | <b>SD</b> –Same Business Day Rush |                                                                                                                                                           |
| PO Number:           | 25-7963                                             | Sampled By: Jose Hernandez |                     | <b>WH</b> – Weekend / Holiday     |                                                                                                                                                           |

| Sample ID       | Description                                                           | Sample Type<br>(Below) | TAT<br>(Above) | Volume / Area<br>(as applicable) | ISO Class<br>(as applicable) | Notes (Time of day, Temp, RH, etc.) |
|-----------------|-----------------------------------------------------------------------|------------------------|----------------|----------------------------------|------------------------------|-------------------------------------|
| ECG-25-7963-33A | Tan-Beige Wall Paper with Glue - Classroom 3                          | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-33B | Tan-Beige Wall Paper with Glue - Classroom 1                          | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-34A | Gray HVAC Duct Mastic - HVAC Closet inside Classroom 2                | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-34B | Gray HVAC Duct Mastic - HVAC Closet inside Classroom 3                | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-35A | Vibration Dampener - HVAC Closet inside Classroom 2                   | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-35B | Vibration Dampener - HVAC Closet inside Classroom 3                   | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-36A | Drywall with Joint Compound - Girl's Restroom adjacent to Classroom 4 | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-36B | Drywall with Joint Compound - Boy's Restroom adjacent to Classroom 4  | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-37A | Skim Coat - Girl's Restroom adjacent to Classroom 4                   | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-37B | Skim Coat - Girl's Restroom adjacent to Classroom 4                   | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-37C | Skim Coat - Boy's Restroom adjacent to Classroom 4                    | B                      | 9              | N/A                              |                              |                                     |

Asbestos PLM

[illegible]

| SAMPLE TYPE CODES |  | RELINQUISHED BY | DATE & TIME        | RECEIVED BY                                                                                                       | DATE & TIME        |
|-------------------|--|-----------------|--------------------|-------------------------------------------------------------------------------------------------------------------|--------------------|
| B - Bulk sample   |  | Jose Hernandez  | 12/30/2025 7:56 AM | <br>Samantha Pierce, Analyst | 12/30/2025 8:45 AM |
|                   |  |                 |                    |                                                                                                                   |                    |
|                   |  |                 |                    |                                                                                                                   |                    |
|                   |  |                 |                    |                                                                                                                   |                    |

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at:

<https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/>

Copyright © 2024 Eurofins EPK Built Environment Testing, LLC

Doc. #1192, Rev 35, Revised 6/6/24, Page 1 of 1, QA

Page 8 of 10



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

EMLab ID
4358740

REQUEST SERVICE
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697)
Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Mathew Watson
Special Instructions: Stop Analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION and TURN AROUND TIME CODES (TAT)
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Project Zip Code: 95820
Sampling Date & Time: 11/26/2025 07:30 AM
PO Number: 25-7963
Sampled By: Jose Hernandez
TAT codes: STD - Standard (DEFAULT), ND - Next Business Day, SD - Same Business Day Rush, WH - Weekend / Holiday

Table with 7 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains 14 rows of sample data including ECG-25-7963-38A through ECG-25-7963-42B.

Asbestos PLM table with 10 columns and 10 rows of checkboxes for sample tracking.

Table with 4 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY, DATE & TIME. Includes signature of Samantha Pierce.



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

EMLab ID
4358740

REQUEST SERVICE
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697) Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Mathew Watson Special Instructions: Stop Analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Project Zip Code: 95820 Sampling Date & Time: 11/26/2025 07:30 AM
PO Number: 25-7963 Sampled By: Jose Hernandez

TURN AROUND TIME CODES (TAT)
STD - Standard (DEFAULT)
ND - Next Business Day
SD - Same Business Day Rush
WH - Weekend / Holiday

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Table with 7 columns: Sample ID, Description, Sample Type (Below), TAT (Above), Volume / Area (as applicable), ISO Class (as applicable), Notes (Time of day, Temp, RH, etc.)

Asbestos PLM
Grid of checkboxes for sample tracking.

SAMPLE TYPE CODES
B - Bulk sample

RELINQUISHED BY
Jose Hernandez

DATE & TIME
12/30/2025 7:56 AM

RECEIVED BY
Samantha Pierce, Analyst

DATE & TIME
12/30/2025 8:45 AM

Report for:

**Jose Hernandez, Khaianne Peters**  
**Entek Consulting Group**  
3435 American River Drive  
Suite C  
Sacramento, CA 95864

---

Regarding: Eurofins Built Environment Testing West, LLC  
Project: 25-7963; Sacramento City USD - Earl Warren Elementary School  
EML ID: 4360232

Approved by:

Dates of Analysis:  
Asbestos PLM: 01-06-2026 and 01-07-2026



Approved Signatory  
James Schatz

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)  
NVLAP Lab Code 600255-0

---

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Built Environment Testing West, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Total Samples Submitted:** 98**Total Samples Analyzed:** 98**Total Samples with Layer Asbestos Content > 1%:** 0**Location: ECG-25-7963-43A, 2'x4' Ceiling Panel - Classroom 1**

Lab ID-Version‡: 21848805-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Beige Ceiling Tile with White Surface  | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>20% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

**Location: ECG-25-7963-43B, 2'x4' Ceiling Panel - Classroom 2**

Lab ID-Version‡: 21848806-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Beige Ceiling Tile with White Surface  | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>20% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

**Location: ECG-25-7963-44A, Twelve inch Green Mottled Vinyl Floor Tile with Black  
Mastic - Classroom 10**

Lab ID-Version‡: 21848807-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Green Floor Tile                     | ND               |
| Black Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-44B, Twelve inch Green Mottled Vinyl Floor Tile with Black  
Mastic - Classroom 12**

Lab ID-Version‡: 21848808-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Green Floor Tile                     | ND               |
| Black Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-45A, Blue Carpet with Yellow Mastic - Classroom 10**

Lab ID-Version‡: 21848809-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-45B, Blue Carpet with Yellow Mastic - Classroom 12**

Lab ID-Version‡: 21848810-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-46A, Concrete Foundation - Classroom 10**

Lab ID-Version‡: 21848811-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Concrete                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-46B, Concrete Foundation - Classroom 10**

Lab ID-Version‡: 21848812-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Concrete                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-47A, Four inch Blue Vinyl Base Cove with Beige Mastic -  
Classroom 10**

Lab ID-Version‡: 21848813-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Blue Cove Base                            | ND               |
| Beige Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-47B, Four inch Blue Vinyl Base Cove with Beige Mastic -  
Classroom 12**

Lab ID-Version‡: 21848814-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Blue Cove Base                            | ND               |
| Beige Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-48A, Drywall with Joint Compound - Classroom 11**

Lab ID-Version‡: 21848815-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| White Compound with Paint                 | ND               |
| Cream Tape                                | ND               |
| White Joint Compound                      | ND               |
| White Drywall with Brown Paper            | ND               |
| <b>Composite Non-Asbestos Content:</b>    | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-48B, Drywall with Joint Compound - Classroom 12**

Lab ID-Version‡: 21848816-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Compound with Paint              | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-49A, Orange Peel Texture - Classroom 10**

Lab ID-Version‡: 21848817-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Texture                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-49B, Orange Peel Texture - Classroom 11**

Lab ID-Version‡: 21848818-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Texture                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-49C, Orange Peel Texture - Classroom 12**

Lab ID-Version‡: 21848819-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Texture                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-50A, Drywall with Joint Compound - HVAC Closet inside****Classroom 11**

Lab ID-Version‡: 21848820-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Compound with Paint              | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall                          | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-50B, Drywall with Joint Compound - HVAC Closet inside****Classroom 12**

Lab ID-Version‡: 21848821-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Compound with Paint              | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall                          | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-51A, Drywall with Joint Compound - Storage Room between****Boy's & Girl's Restrooms**

Lab ID-Version‡: 21848822-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Compound with Paint              | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall                          | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-51B, Drywall with Joint Compound - Girl's Restroom adjacent  
to Classroom 9**

Lab ID-Version‡: 21848823-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Compound with Paint              | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall                          | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-52A, Skim Coat - Girl's Restroom adjacent to Classroom 9**

Lab ID-Version‡: 21848824-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Plaster                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-52B, Skim Coat - Girl's Restroom adjacent to Classroom 9**

Lab ID-Version‡: 21848825-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Plaster                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-52C, Skim Coat - Boy's Restroom adjacent to Classroom 9**

Lab ID-Version‡: 21848826-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Plaster                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-53A, Two inch Beige Speckled Ceramic Floor Tile with Grout  
and Mortar - Boy's Restroom adjacent to Classroom 9**

Lab ID-Version‡: 21848827-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| White Ceramic Tile                        | ND               |
| Gray Grout                                | ND               |
| Light Gray Mortar                         | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-54A, Four inch Off-White Ceramic Wall Tile with Grout and  
Mortar - Girl's Restroom adjacent to Classroom 9**

Lab ID-Version‡: 21848828-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| White Ceramic Tile                        | ND               |
| Brown Grout                               | ND               |
| White Mortar                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-55A, Vibration Dampener - HVAC Closet inside Classroom 11**

Lab ID-Version‡: 21848829-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Black Wrap                                | ND               |
| <b>Composite Non-Asbestos Content:</b>    | 35% Glass Fibers |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-56A, 2'x4' Ceiling Panel - Classroom 10**

Lab ID-Version‡: 21848830-1

| Sample Layers                             | Asbestos Content                  |
|-------------------------------------------|-----------------------------------|
| Beige Ceiling Tile with White Surface     | ND                                |
| <b>Composite Non-Asbestos Content:</b>    | 30% Cellulose<br>20% Glass Fibers |
| <b>Sample Composite Homogeneity:</b> Good |                                   |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-57A, Tan-Beige Wall Paper with Glue - Classroom 11**

Lab ID-Version‡: 21848831-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Tan Wallpaper                          | ND               |
| Beige Glue                             | ND               |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-58A, 2'x2' Black Carpet Square with Clear and Yellow Mastic -  
Classroom 11**

Lab ID-Version‡: 21848832-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Black Carpet                           | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-58B, 2'x2' Black Carpet Square with Clear and Yellow Mastic -  
Classroom 11**

Lab ID-Version‡: 21848833-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Black Carpet                           | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-59A, Four inch Gray Vinyl Cove Base with Beige Mastic -  
Classroom 11**

Lab ID-Version‡: 21848834-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| Beige Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-59B, Four inch Gray Vinyl Cove Base with Beige Mastic -  
Classroom 11**

Lab ID-Version‡: 21848835-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Cove Base                     | ND               |
| Beige Mastic                       | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-60A, Gray Wood Pattern Vinyl Plank Flooring - Classroom 11**

Lab ID-Version‡: 21848836-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Sheet Flooring                | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-60B, Gray Wood Pattern Vinyl Plank Flooring - Classroom 11**

Lab ID-Version‡: 21848837-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Sheet Flooring                | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-61A, Twelve inch Green Vinyl Floor Tile with Yellow Mastic -  
Classroom 14**

Lab ID-Version‡: 21848838-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Green Floor Tile                   | ND               |
| Yellow Mastic                      | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-61B, Twelve inch Green Vinyl Floor Tile with Yellow Mastic -  
Classroom 15**

Lab ID-Version‡: 21848839-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Green Floor Tile                          | ND               |
| Yellow Mastic                             | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-62A, Four inch Blue Vinyl Base Cove with Beige Mastic -  
Classroom 14**

Lab ID-Version‡: 21848840-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Blue Cove Base                            | ND               |
| Beige Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-63A, Blue Multicolored Carpet with Yellow Mastic - Classroom  
14**

Lab ID-Version‡: 21848841-1

| Sample Layers                             | Asbestos Content     |
|-------------------------------------------|----------------------|
| Blue Carpet                               | ND                   |
| Yellow Mastic                             | ND                   |
| <b>Composite Non-Asbestos Content:</b>    | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b> Good |                      |

**Location: ECG-25-7963-64A, 2'x2' Black Carpet Tile with Yellow Mastic - Classroom 16**

Lab ID-Version‡: 21848842-1

| Sample Layers                             | Asbestos Content     |
|-------------------------------------------|----------------------|
| Black Carpet                              | ND                   |
| Yellow Mastic                             | ND                   |
| <b>Composite Non-Asbestos Content:</b>    | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b> Good |                      |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-64B, 2'x2' Black Carpet Tile with Yellow Mastic - Classroom 17**

Lab ID-Version‡: 21848843-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Black Carpet                           | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 50% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-65A, Gray Wood Pattern Vinyl Plank Flooring - Classroom 16**

Lab ID-Version‡: 21848844-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Sheet Flooring                  | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-65B, Gray Wood Pattern Vinyl Plank Flooring - Classroom 17**

Lab ID-Version‡: 21848845-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Sheet Flooring                  | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-66A, Four inch Light Gray Vinyl Base Cove with Beige Mastic - Classroom 17**

Lab ID-Version‡: 21848846-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| Beige Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-66B, Four inch Light Gray Vinyl Base Cove with Beige Mastic -  
Classroom 17**

Lab ID-Version‡: 21848847-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Cove Base                            | ND               |
| Beige Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-67A, Four inch Gray Vinyl Base Cove with Beige Mastic -  
Classroom 16**

Lab ID-Version‡: 21848848-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Cove Base                            | ND               |
| Beige Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-67B, Four inch Gray Vinyl Base Cove with Beige Mastic -  
Classroom 16**

Lab ID-Version‡: 21848849-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Cove Base                            | ND               |
| Beige Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-68A, Drywall with Joint Compound - Classroom 14**

Lab ID-Version‡: 21848850-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| White Compound with Paint                 | ND               |
| Cream Tape                                | ND               |
| White Joint Compound                      | ND               |
| White Drywall with Brown Paper            | ND               |
| <b>Composite Non-Asbestos Content:</b>    | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-68B, Drywall with Joint Compound - Classroom 16**

Lab ID-Version‡: 21848851-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Compound with Paint              | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-69A, Orange Peel Texture - Classroom 14**

Lab ID-Version‡: 21848852-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Texture                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-69B, Orange Peel Texture - Classroom 16**

Lab ID-Version‡: 21848853-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Texture                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-69C, Orange Peel Texture - Classroom 17**

Lab ID-Version‡: 21848854-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Texture                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-70A, Drywall with Joint Compound - HVAC Closet inside  
Classroom 14**

Lab ID-Version‡: 21848855-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Compound with Paint              | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-71A, Drywall with Joint Compound - Girl's Restroom adjacent  
to Classroom 17**

Lab ID-Version‡: 21848856-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Compound with Paint              | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-71B, Drywall with Joint Compound - Boy's Restroom adjacent  
to Classroom 17**

Lab ID-Version‡: 21848857-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Compound with Paint              | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-72A, Skim Coat - Girl's Restroom adjacent to Classroom 17**

Lab ID-Version‡: 21848858-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Skim Coat                    | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-72B, Skim Coat - Boy's Restroom adjacent to Classroom 17**

Lab ID-Version‡: 21848859-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Skim Coat                    | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-72C, Skim Coat - Boy's Restroom adjacent to Classroom 17**

Lab ID-Version‡: 21848860-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Skim Coat                    | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-73A, Plaster - Storage Room adjacent Boy's Restroom**

Lab ID-Version‡: 21848861-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-73B, Plaster - Storage Room adjacent Boy's Restroom**

Lab ID-Version‡: 21848862-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-73C, Plaster - Storage Room adjacent Boy's Restroom**

Lab ID-Version‡: 21848863-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-73D, Plaster - Storage Room adjacent Girl's Restroom**

Lab ID-Version‡: 21848864-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-73E, Plaster - Storage Room adjacent Girl's Restroom**

Lab ID-Version‡: 21848865-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-74A, Two inch Beige Speckled Ceramic Floor Tile with Grout  
and Mortar - Girl's Restroom adjacent Classroom 17**

Lab ID-Version‡: 21848866-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Beige Ceramic Tile                 | ND               |
| Gray Grout                         | ND               |
| Brown Mortar                       | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-75A, Four inch Off-White Ceramic Wall Tile with Grout and  
Mortar - Girl's Restroom adjacent Classroom 17**

Lab ID-Version‡: 21848867-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| White Ceramic Tile                        | ND               |
| Brown Grout                               | ND               |
| White Mortar                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-76A, Gray HVAC Duct Mastic - HVAC Closet inside Classroom  
14**

Lab ID-Version‡: 21848868-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Mastic                               | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-77A, 2'x4' Ceiling Panel - Classroom 14**

Lab ID-Version‡: 21848869-1

| Sample Layers                             | Asbestos Content                  |
|-------------------------------------------|-----------------------------------|
| Beige Ceiling Tile with White Surface     | ND                                |
| <b>Composite Non-Asbestos Content:</b>    | 30% Cellulose<br>20% Glass Fibers |
| <b>Sample Composite Homogeneity:</b> Good |                                   |

**Location: ECG-25-7963-78A, Twelve inch Green Mottled Vinyl Floor Tile with Yellow  
Mastic - MPR Building, Northeast Side of MPR**

Lab ID-Version‡: 21848870-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Green Floor Tile                          | ND               |
| Yellow Mastic                             | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-78B, Twelve inch Green Mottled Vinyl Floor Tile with Yellow  
Mastic - MPR Building, Kitchen Storage Room**

Lab ID-Version‡: 21848871-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Green Floor Tile                          | ND               |
| Yellow Mastic                             | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-79A, Twelve inch Tan Mottled Vinyl Floor Tile with Mastic -  
MPR Building, East Side of MPR**

Lab ID-Version‡: 21848872-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Tan Floor Tile                            | ND               |
| Black Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-79B, Twelve inch Tan Mottled Vinyl Floor Tile with Mastic -  
MPR Building, Northeast Side of MPR**

Lab ID-Version‡: 21848873-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Tan Floor Tile                            | ND               |
| Black Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-80A, Six inch Red Clay Floor Tile with Grout and Mortar -  
MPR Bldg, Kitchen Closet**

Lab ID-Version‡: 21848874-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Red Tile                                  | ND               |
| Gray Grout                                | ND               |
| Gray Mortar                               | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-80B, Six inch Red Clay Floor Tile with Grout and Mortar -  
MPR Bldg, Kitchen Closet**

Lab ID-Version‡: 21848875-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Red Tile                                  | ND               |
| Gray Grout                                | ND               |
| Gray Mortar                               | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-81A, Four inch Red Clay Wall Base Tile with Grout and Mortar -  
MPR Bldg, Kitchen Closet**

Lab ID-Version‡: 21848876-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Red Tile                                  | ND               |
| Gray Grout                                | ND               |
| Gray Mortar                               | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-81B, Four inch Red Clay Wall Base Tile with Grout and Mortar -  
MPR Bldg, Kitchen Closet**

Lab ID-Version‡: 21848877-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Red Tile                                  | ND               |
| Gray Grout                                | ND               |
| Gray Mortar                               | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-82A, Four inch Green Vinyl Base Cove with Tan Mastic - MPR  
Bldg, Janitor Closet**

Lab ID-Version‡: 21848878-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Green Floor Tile                   | ND               |
| Tan Mastic                         | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-82B, Four inch Green Vinyl Base Cove with Tan Mastic - MPR  
Bldg, Kitchen Storage**

Lab ID-Version‡: 21848879-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Green Floor Tile                   | ND               |
| Tan Mastic                         | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-83A, Concrete Foundation - MPR Bldg, Kitchen Storage**

Lab ID-Version‡: 21848880-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Concrete                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-83B, Concrete Foundation - MPR Bldg, Library**

Lab ID-Version‡: 21848881-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Concrete                      | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-84A, Plaster - MPR Bldg, Kitchen**

Lab ID-Version‡: 21848882-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-84B, Plaster - MPR Bldg, Kitchen Storage**

Lab ID-Version‡: 21848883-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-84C, Plaster - MPR Bldg, Kitchen Closet**

Lab ID-Version‡: 21848884-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-84D, Plaster - MPR Bldg, Janitor Closet**

Lab ID-Version‡: 21848885-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-84E, Plaster - MPR Bldg, Stage**

Lab ID-Version‡: 21848886-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-84F, Plaster - MPR Bldg, Speech Room**

Lab ID-Version‡: 21848887-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-84G, Plaster - MPR Bldg, Wheelchair Access Room**

Lab ID-Version‡: 21848888-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Plaster                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-85A, Drywall with Joint Compound - MPR Bldg, Southeast  
Entry Foyer**

Lab ID-Version‡: 21848889-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| White Compound with Paint                     | ND               |
| Cream Tape                                    | ND               |
| White Joint Compound                          | ND               |
| White Drywall with Brown Paper                | ND               |
| Composite Non-Asbestos Content: 15% Cellulose |                  |
| Sample Composite Homogeneity: Good            |                  |

**Location: ECG-25-7963-85B, Drywall with Joint Compound - MPR Bldg, Southeast  
Entry Foyer**

Lab ID-Version‡: 21848890-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| White Compound with Paint                     | ND               |
| Cream Tape                                    | ND               |
| White Joint Compound                          | ND               |
| White Drywall with Brown Paper                | ND               |
| Composite Non-Asbestos Content: 15% Cellulose |                  |
| Sample Composite Homogeneity: Good            |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-86A, Orange Peel Texture - MPR Bldg, South Wall of MPR at  
Stage**

Lab ID-Version‡: 21848891-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Texture                          | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-86B, Orange Peel Texture - MPR Bldg, South Wall of MPR at  
Stage**

Lab ID-Version‡: 21848892-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Texture                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-86C, Orange Peel Texture - MPR Bldg, South Wall of MPR at  
Stage**

Lab ID-Version‡: 21848893-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Texture                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-87A, Orange Peel Textured Plaster - MPR Bldg, West Wall of  
MPR**

Lab ID-Version‡: 21848894-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Plaster                          | ND               |
| Brown Fibrous Material                 | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-87B, Orange Peel Textured Plaster - MPR Bldg, East Wall of  
MPR**

Lab ID-Version‡: 21848895-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Plaster                          | ND               |
| Brown Fibrous Material                 | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-87C, Orange Peel Textured Plaster - MPR Bldg, North Wall of  
MPR**

Lab ID-Version‡: 21848896-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Plaster                          | ND               |
| Brown Fibrous Material                 | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-87D, Orange Peel Textured Plaster - MPR Bldg, West Wall of  
MPR**

Lab ID-Version‡: 21848897-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Plaster                          | ND               |
| Brown Fibrous Material                 | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-87E, Orange Peel Textured Plaster - MPR Bldg, East Wall of  
MPR**

Lab ID-Version‡: 21848898-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Plaster                          | ND               |
| Brown Fibrous Material                 | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Khaianne Peters

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-88A, Beige Fiberglass Reinforced Panel Adhesive - MPR Bldg,  
Kitchen**

Lab ID-Version‡: 21848899-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Beige Adhesive                     | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-88B, Beige Fiberglass Reinforced Panel Adhesive - MPR Bldg,  
Kitchen**

Lab ID-Version‡: 21848900-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Beige Adhesive                     | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-89A, Yellow Fiberglass Reinforced Panel Adhesive - MPR Bldg,  
Kitchen Freezer**

Lab ID-Version‡: 21848901-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Yellow Adhesive                    | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-89B, Yellow Fiberglass Reinforced Panel Adhesive - MPR Bldg,  
Kitchen Freezer**

Lab ID-Version‡: 21848902-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Yellow Adhesive                    | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630  
(833) 465-5857 [www.eurofinsus.com/Built](http://www.eurofinsus.com/Built)

Client: Entek Consulting Group  
C/O: Jose Hernandez, Khaianne Peters  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-11-2025

Date of Receipt: 12-31-2025

Date of Report: 01-08-2026

**ASBESTOS PLM REPORT**

**PROJECT ANALYST AND SIGNATORY REPORT**

---

**Project Analyst**



---

**Analyst:** Samantha Pierce

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

EMLab ID
4360232

REQUEST SERVICE
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697)
Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Khaianne Peters
Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION and TURN AROUND TIME CODES (TAT)
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Project Zip Code: 95820
Sampling Date & Time: 12/11/2025 02:30 PM
PO Number: 25-7963
Sampled By: Jose Hernandez
TAT codes: STD - Standard (DEFAULT), ND - Next Business Day, SD - Same Business Day Rush, WH - Weekend / Holiday

Table with 7 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains 14 rows of sample data including Classroom 1, Classroom 2, Classroom 10, Classroom 12, and Classroom 11.

Asbestos PLM table with 10 columns and 10 rows of checkboxes for sample analysis.

Table with 5 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY, DATE & TIME. Includes signature of Renee Reyes, Analyst.



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

EMLab ID
4360232

REQUEST SERVICE
(Use checkboxes below)

Page 29 of 36

CONTACT INFORMATION

Table with 3 columns: Company, Contact, Phone. Includes address and special instructions.

PROJECT INFORMATION

TURN AROUND TIME CODES (TAT)

Table with 4 columns: Project ID, Project Description, Project Zip Code, PO Number. Includes sampling date and time, and TAT codes (STD, ND, SD, WH).

Table with 7 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains multiple rows of sample data.

Table with 10 columns for Asbestos PLM checkboxes.

Table with 4 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY, DATE & TIME. Includes signature of Renee Reyes.

**CHAIN OF CUSTODY**  
[www.eurofinsus.com/Built](http://www.eurofinsus.com/Built)



**New Jersey:** 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984

**Phoenix, AZ:** 1501 West Knudsen Drive, Phoenix, AZ 85027 \* **(800) 651-4802**

**Burlingame, CA:** 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* **(833) 465-5857**

| Weather |          | Fog                                 | Rain                                | Snow                                | Wind                                | Clear                    |
|---------|----------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| Level   | None     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
|         | Light    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Moderate | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Heavy    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |

**EMLab ID**

4360232

Page 30 of 36

**REQUESTI  
SERVICE**

(Use checkboxes below)

## CONTACT INFORMATION

|          |                                 |                                                                                                                                                                                                                                                                |
|----------|---------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Company: | Entek Consulting Group (9697)   | Address: 3435 American River Drive Suite C Sacramento, CA 95864<br><br>Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series. |
| Contact: | Jose Hernandez, Khaianne Peters |                                                                                                                                                                                                                                                                |
| Phone:   | 916-824-5580                    |                                                                                                                                                                                                                                                                |

## PROJECT INFORMATION

### TURN AROUND TIME CODES (TAT)

|                      |                                                     |                            |                     |                                   |                                                                                                                                                    |
|----------------------|-----------------------------------------------------|----------------------------|---------------------|-----------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|
| Project ID:          | 25-7963                                             |                            |                     | <b>STD</b> – Standard (DEFAULT)   | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |
| Project Description: | Sacramento City USD - Earl Warren Elementary School |                            |                     | <b>ND</b> – Next Business Day     |                                                                                                                                                    |
| Project Zip Code:    | 95820                                               | Sampling Date & Time:      | 12/11/2025 02:30 PM | <b>SD</b> –Same Business Day Rush |                                                                                                                                                    |
| PO Number:           | 25-7963                                             | Sampled By: Jose Hernandez |                     | <b>WH</b> – Weekend / Holiday     |                                                                                                                                                    |

| Sample ID       | Description                                                                                               | Sample Type<br>(Below) | TAT<br>(Above) | Volume / Area<br>(as applicable) | ISO Class<br>(as applicable) | Notes (Time of day, Temp, RH, etc.) |
|-----------------|-----------------------------------------------------------------------------------------------------------|------------------------|----------------|----------------------------------|------------------------------|-------------------------------------|
| ECG-25-7963-53A | Two inch Beige Speckled Ceramic Floor Tile with Grout and Mortar - Boy's Restroom adjacent to Classroom 9 | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-54A | Four inch Off-White Ceramic Wall Tile with Grout and Mortar - Girl's Restroom adjacent to Classroom 9     | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-55A | Vibration Dampener - HVAC Closet inside Classroom 11                                                      | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-56A | 2'x4' Ceiling Panel - Classroom 10                                                                        | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-57A | Tan-Beige Wall Paper with Glue - Classroom 11                                                             | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-58A | 2'x2' Black Carpet Square with Clear and Yellow Mastic - Classroom 11                                     | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-58B | 2'x2' Black Carpet Square with Clear and Yellow Mastic - Classroom 11                                     | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-59A | Four inch Gray Vinyl Cove Base with Beige Mastic - Classroom 11                                           | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-59B | Four inch Gray Vinyl Cove Base with Beige Mastic - Classroom 11                                           | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-60A | Gray Wood Pattern Vinyl Plank Flooring - Classroom 11                                                     | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-60B | Gray Wood Pattern Vinyl Plank Flooring - Classroom 11                                                     | B                      | 9              | N/A                              |                              |                                     |

## Asbestos PLM

[illegible]

| SAMPLE TYPE CODES |  | RELINQUISHED BY | DATE & TIME        | RECEIVED BY                                                                                                | DATE & TIME        |
|-------------------|--|-----------------|--------------------|------------------------------------------------------------------------------------------------------------|--------------------|
| B - Bulk sample   |  | Jose Hernandez  | 12/31/2025 8:37 AM |  Renee Reyes, Analyst | 12/31/2025 3:04 PM |
|                   |  |                 |                    |                                                                                                            |                    |
|                   |  |                 |                    |                                                                                                            |                    |
|                   |  |                 |                    |                                                                                                            |                    |

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at:

<https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/>

Copyright © 2024 Eurofins EPK Built Environment Testing, LLC

Doc. #1192, Rev 35, Revised 6/6/24, Page 1 of 1, QA



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

EMLab ID
4360232

REQUEST SERVICE
(Use checkboxes below)

CONTACT INFORMATION table with fields for Company, Address, Contact, Special Instructions, and Phone.

PROJECT INFORMATION and TURN AROUND TIME CODES (TAT) section. Includes Project ID, Description, Sampling Date & Time, PO Number, and TAT codes (STD, ND, SD, WH).

Main table with columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains 13 rows of sample data.

Asbestos PLM table with 13 rows and 6 columns for tracking analysis results.

Table with 4 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY, DATE & TIME. Includes signature of Renee Reyes.



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

EMLab ID
4360232

REQUEST SERVICE
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697)
Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Khaianne Peters
Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION and TURN AROUND TIME CODES (TAT)
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Project Zip Code: 95820
Sampling Date & Time: 12/11/2025 02:30 PM
PO Number: 25-7963
Sampled By: Jose Hernandez
TAT codes: STD - Standard (DEFAULT), ND - Next Business Day, SD - Same Business Day Rush, WH - Weekend / Holiday

Table with 7 columns: Sample ID, Description, Sample Type (Below), TAT (Above), Volume / Area (as applicable), ISO Class (as applicable), Notes (Time of day, Temp, RH, etc.)
Rows include sample details for ECG-25-7963-67B through ECG-25-7963-72B.

Asbestos PLM table with 10 columns and 10 rows of checkboxes.

Table with 5 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY, DATE & TIME. Includes signature of Renee Reyes, Analyst.



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes Level (None, Light, Moderate, Heavy) and checkboxes for each condition.

EMLab ID
4360232

REQUEST SERVICE
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697)
Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Khaianne Peters
Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION and TURN AROUND TIME CODES (TAT)
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Sampling Date & Time: 12/11/2025 02:30 PM
PO Number: 25-7963
Sampled By: Jose Hernandez
TAT codes: STD - Standard (DEFAULT), ND - Next Business Day, SD - Same Business Day Rush, WH - Weekend / Holiday

Table with 7 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains 12 rows of sample data including ECG-25-7963-72C through ECG-25-7963-78A.

Asbestos PLM table with 12 columns for different asbestos types, each with a checkbox for detection.

Table with 4 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY. Includes signature of Renee Reyes, Analyst, dated 12/31/2025 3:04 PM.

**CHAIN OF CUSTODY**  
**[www.eurofinsus.com/Built](http://www.eurofinsus.com/Built)**



| Weather |          | Fog                                 | Rain                                | Snow                                | Wind                                | Clear                    |
|---------|----------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| Level   | None     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
|         | Light    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Moderate | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Heavy    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |

**New Jersey:** 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* **(866) 871-1984**

**Phoenix, AZ:** 1501 West Knudsen Drive, Phoenix, AZ 85027 \* **(800) 651-4802**

**Burlingame, CA:** 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

## CONTACT INFORMATION

|          |                                 |                                                                                                                                                                                                                                                                |
|----------|---------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Company: | Entek Consulting Group (9697)   | Address: 3435 American River Drive Suite C Sacramento, CA 95864<br><br>Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series. |
| Contact: | Jose Hernandez, Khaianne Peters |                                                                                                                                                                                                                                                                |
| Phone:   | 916-824-5580                    |                                                                                                                                                                                                                                                                |

## PROJECT INFORMATION

### TURN AROUND TIME CODES (TAT)

|                      |                                                     |                            |                     |                                   |                                                                                                                                                    |
|----------------------|-----------------------------------------------------|----------------------------|---------------------|-----------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|
| Project ID:          | 25-7963                                             |                            |                     | <b>STD</b> – Standard (DEFAULT)   | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |
| Project Description: | Sacramento City USD - Earl Warren Elementary School |                            |                     | <b>ND</b> – Next Business Day     |                                                                                                                                                    |
| Project Zip Code:    | 95820                                               | Sampling Date & Time:      | 12/11/2025 02:30 PM | <b>SD</b> –Same Business Day Rush |                                                                                                                                                    |
| PO Number:           | 25-7963                                             | Sampled By: Jose Hernandez |                     | <b>WH</b> – Weekend / Holiday     |                                                                                                                                                    |

| Sample ID       | Description                                                                                        | Sample Type<br>(Below) | TAT<br>(Above) | Volume / Area<br>(as applicable) | ISO Class<br>(as applicable) | Notes (Time of day, Temp, RH, etc.) |
|-----------------|----------------------------------------------------------------------------------------------------|------------------------|----------------|----------------------------------|------------------------------|-------------------------------------|
| ECG-25-7963-78B | Twelve inch Green Mottled Vinyl Floor Tile with Yellow Mastic - MPR Building, Kitchen Storage Room | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-79A | Twelve inch Tan Mottled Vinyl Floor Tile with Mastic - MPR Building, East Side of MPR              | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-79B | Twelve inch Tan Mottled Vinyl Floor Tile with Mastic - MPR Building, Northeast Side of MPR         | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-80A | Six inch Red Clay Floor Tile with Grout and Mortar - MPR Bldg, Kitchen Closet                      | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-80B | Six inch Red Clay Floor Tile with Grout and Mortar - MPR Bldg, Kitchen Closet                      | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-81A | Four inch Red Clay Wall Base Tile with Grout and Mortar - MPR Bldg, Kitchen Closet                 | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-81B | Four inch Red Clay Wall Base Tile with Grout and Mortar - MPR Bldg, Kitchen Closet                 | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-82A | Four inch Green Vinyl Base Cove with Tan Mastic - MPR Bldg, Janitor Closet                         | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-82B | Four inch Green Vinyl Base Cove with Tan Mastic - MPR Bldg, Kitchen Storage                        | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-83A | Concrete Foundation - MPR Bldg, Kitchen Storage                                                    | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-83B | Concrete Foundation - MPR Bldg, Library                                                            | B                      | 9              | N/A                              |                              |                                     |

|          |       |
|----------|-------|
| EMLab ID | of 36 |
| 4360232  |       |

**REQUESTI  
SERVICE**

(Use checkboxes  
below)

Page 34 of 36

[illegible]

| SAMPLE TYPE CODES |  | RELINQUISHED BY | DATE & TIME        | RECEIVED BY                                                                                                | DATE & TIME        |
|-------------------|--|-----------------|--------------------|------------------------------------------------------------------------------------------------------------|--------------------|
| B - Bulk sample   |  | Jose Hernandez  | 12/31/2025 8:37 AM |  Renee Reyes, Analyst | 12/31/2025 3:04 PM |
|                   |  |                 |                    |                                                                                                            |                    |
|                   |  |                 |                    |                                                                                                            |                    |
|                   |  |                 |                    |                                                                                                            |                    |

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at:

<https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/>

Copyright © 2024 Eurofins EPK Built Environment Testing, LLC

Doc. #1192, Rev 35, Revised 6/6/24, Page 1 of 1, QA

**CHAIN OF CUSTODY**  
**[www.eurofinsus.com/Built](http://www.eurofinsus.com/Built)**



**New Jersey:** 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984

**Phoenix, AZ:** 1501 West Knudsen Drive, Phoenix, AZ 85027 \* **(800) 651-4802**

**Burlingame, CA:** 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* **(833) 465-5857**

| Weather |          | Fog                                 | Rain                                | Snow                                | Wind                                | Clear                    |
|---------|----------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| Level   | None     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
|         | Light    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Moderate | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Heavy    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |

**EMLab ID**

4360232

Page 35 of 36

## REQUESTI SERVICE

(Use checkboxes below)

## CONTACT INFORMATION

|          |                                 |                                                                                                                                                                                                                                                                |
|----------|---------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Company: | Entek Consulting Group (9697)   | Address: 3435 American River Drive Suite C Sacramento, CA 95864<br><br>Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series. |
| Contact: | Jose Hernandez, Khaianne Peters |                                                                                                                                                                                                                                                                |
| Phone:   | 916-824-5580                    |                                                                                                                                                                                                                                                                |

## PROJECT INFORMATION

### TURN AROUND TIME CODES (TAT)

|                      |                                                     |                            |                     |                                   |                                                                                                                                                           |
|----------------------|-----------------------------------------------------|----------------------------|---------------------|-----------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|
| Project ID:          | 25-7963                                             |                            |                     | <b>STD</b> – Standard (DEFAULT)   | <p>Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.</p> |
| Project Description: | Sacramento City USD - Earl Warren Elementary School |                            |                     | <b>ND</b> – Next Business Day     |                                                                                                                                                           |
| Project Zip Code:    | 95820                                               | Sampling Date & Time:      | 12/11/2025 02:30 PM | <b>SD</b> –Same Business Day Rush |                                                                                                                                                           |
| PO Number:           | 25-7963                                             | Sampled By: Jose Hernandez |                     | <b>WH</b> – Weekend / Holiday     |                                                                                                                                                           |

| Sample ID       | Description                                                   | Sample Type<br>(Below) | TAT<br>(Above) | Volume / Area<br>(as applicable) | ISO Class<br>(as applicable) | Notes (Time of day, Temp, RH, etc.) |
|-----------------|---------------------------------------------------------------|------------------------|----------------|----------------------------------|------------------------------|-------------------------------------|
| ECG-25-7963-84A | Plaster - MPR Bldg, Kitchen                                   | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-84B | Plaster - MPR Bldg, Kitchen Storage                           | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-84C | Plaster - MPR Bldg, Kitchen Closet                            | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-84D | Plaster - MPR Bldg, Janitor Closet                            | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-84E | Plaster - MPR Bldg, Stage                                     | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-84F | Plaster - MPR Bldg, Speech Room                               | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-84G | Plaster - MPR Bldg, Wheelchair Access Room                    | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-85A | Drywall with Joint Compound - MPR Bldg, Southeast Entry Foyer | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-85B | Drywall with Joint Compound - MPR Bldg, Southeast Entry Foyer | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-86A | Orange Peel Texture - MPR Bldg, South Wall of MPR at Stage    | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-86B | Orange Peel Texture - MPR Bldg, South Wall of MPR at Stage    | B                      | 9              | N/A                              |                              |                                     |

Asbestos PLM

[illegible]

| SAMPLE TYPE CODES |  | RELINQUISHED BY | DATE & TIME        | RECEIVED BY                                                                                                | DATE & TIME        |
|-------------------|--|-----------------|--------------------|------------------------------------------------------------------------------------------------------------|--------------------|
| B - Bulk sample   |  | Jose Hernandez  | 12/31/2025 8:37 AM |  Renee Reyes, Analyst | 12/31/2025 3:04 PM |
|                   |  |                 |                    |                                                                                                            |                    |
|                   |  |                 |                    |                                                                                                            |                    |
|                   |  |                 |                    |                                                                                                            |                    |

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at:

<https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/>

Copyright © 2024 Eurofins EPK Built Environment Testing, LLC

Doc. #1192, Rev 35, Revised 6/6/24, Page 1 of 1, QA

Page 8 of 9



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

EMLab ID
4360232

REQUEST SERVICE
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697) Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Khaianne Peters Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Project Zip Code: 95820 Sampling Date & Time: 12/11/2025 02:30 PM
PO Number: 25-7963 Sampled By: Jose Hernandez

TURN AROUND TIME CODES (TAT)
STD - Standard (DEFAULT)
ND - Next Business Day
SD - Same Business Day Rush
WH - Weekend / Holiday

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Table with 7 columns: Sample ID, Description, Sample Type (Below), TAT (Above), Volume / Area (as applicable), ISO Class (as applicable), Notes (Time of day, Temp, RH, etc.)

Table for Asbestos PLM with 10 columns and 10 rows of checkboxes.

SAMPLE TYPE CODES
B - Bulk sample

RELINQUISHED BY
Jose Hernandez

DATE & TIME
12/31/2025 8:37 AM

RECEIVED BY
Renee Reyes, Analyst

DATE & TIME
12/31/2025 3:04 PM

Report for:

**Jose Hernandez, Mathew Watson**  
**Entek Consulting Group**  
3435 American River Drive  
Suite C  
Sacramento, CA 95864

---

Regarding: Eurofins Built Environment Testing West, LLC  
Project: 25-7963; Sacramento City USD - Earl Warren Elementary School  
EML ID: 4360804

Approved by:



Approved Signatory  
Amin Suliman

Dates of Analysis:  
Asbestos PLM: 01-08-2026

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)  
NVLAP Lab Code 200728-0

---

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Built Environment Testing West, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Total Samples Submitted:** 140

**Total Samples Analyzed:** 137

**Total Samples with Layer Asbestos Content > 1%:** 3

**Location: ECG-25-7963-90A, Gray Wood Pattern Vinyl Plank Flooring - MPR Bldg,  
Speech Room**

Lab ID-Version‡: 21851856-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Flooring                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-90B, Gray Wood Pattern Vinyl Plank Flooring - MPR Bldg,  
Speech Room**

Lab ID-Version‡: 21851857-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Flooring                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-91A, Four inch Gray Vinyl Base Cove with White Mastic - MPR  
Bldg, Speech Room**

Lab ID-Version‡: 21851858-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| Beige Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-91B, Four inch Gray Vinyl Base Cove with White Mastic - MPR  
Bldg, Speech Room**

Lab ID-Version‡: 21851859-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Cove Base                            | ND               |
| Beige Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-92A, Blue Carpet with Yellow Mastic - MPR Bldg, Wheel Chair  
Access Room**

Lab ID-Version‡: 21851860-1

| Sample Layers                             | Asbestos Content     |
|-------------------------------------------|----------------------|
| Blue Carpet                               | ND                   |
| Yellow Mastic                             | ND                   |
| <b>Composite Non-Asbestos Content:</b>    | 30% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b> Good |                      |

**Location: ECG-25-7963-93A, Four inch Blue Vinyl Base Cove with Beige Mastic - MPR  
Bldg, Wheel Chair Access Room**

Lab ID-Version‡: 21851861-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Blue Cove Base                            | ND               |
| Beige Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-94A, Two inch Beige Speckled Ceramic Floor with Grout and Mortar - MPR Bldg, Staff Restroom**

Lab ID-Version‡: 21851862-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| Beige Ceramic Tile            | ND               |
| Gray Grout                    | ND               |
| Beige Adhesive                | ND               |
| Gray Mortar                   | ND               |
| Sample Composite Homogeneity: | Good             |

**Location: ECG-25-7963-95A, Twelve inch Blue Mottled Vinyl Floor Tile with Black Mastic - MPR Bldg, Southeast Side of Library**

Lab ID-Version‡: 21851863-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| Blue Floor Tile               | ND               |
| Black Mastic                  | ND               |
| Sample Composite Homogeneity: | Good             |

**Location: ECG-25-7963-95B, Twelve inch Blue Mottled Vinyl Floor Tile with Black Mastic - MPR Bldg, Northeast Side of Library**

Lab ID-Version‡: 21851864-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| Blue Floor Tile               | ND               |
| Black Mastic                  | ND               |
| Sample Composite Homogeneity: | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
 C/O: Jose Hernandez, Mathew Watson  
 Re: 25-7963; Sacramento City USD - Earl Warren  
 Elementary School

Date of Sampling: 12-20-2025  
 Date of Receipt: 12-31-2025  
 Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-96A, Blue Multicolored Carpet with Yellow Mastic - MPR Bldg,  
 Psych Room**

Lab ID-Version‡: 21851865-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 70% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-96B, Blue Multicolored Carpet with Yellow Mastic - MPR Bldg,  
 Psych Room**

Lab ID-Version‡: 21851866-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 70% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-97A, Four inch Black Vinyl Base Cove with White Mastic - MPR  
 Bldg, Library**

Lab ID-Version‡: 21851867-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Black Cove Base                      | ND               |
| Cream Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-97B, Four inch Black Vinyl Base Cove with White Mastic - MPR  
 Bldg, Library**

Lab ID-Version‡: 21851868-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Black Cove Base                      | ND               |
| Cream Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
 C/O: Jose Hernandez, Mathew Watson  
 Re: 25-7963; Sacramento City USD - Earl Warren  
 Elementary School

Date of Sampling: 12-20-2025  
 Date of Receipt: 12-31-2025  
 Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-98A, Green Streaked Vinyl Floor Tile with Yellow Mastic - MPR  
 Bldg, Janitor & Storage Room**

Lab ID-Version‡: 21851869-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Green Floor Tile                          | ND               |
| Yellow Mastic                             | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-98B, Green Streaked Vinyl Floor Tile with Yellow Mastic - MPR  
 Bldg, Janitor & Storage Room**

Lab ID-Version‡: 21851870-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Green Floor Tile                          | ND               |
| Yellow Mastic                             | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-99A, Blue/Black Carpet with Paper Backing - MPR Bldg,  
 Janitor & Storage Room**

Lab ID-Version‡: 21851871-1

| Sample Layers                             | Asbestos Content                     |
|-------------------------------------------|--------------------------------------|
| Blue Carpet                               | ND                                   |
| Yellow Adhesive                           | ND                                   |
| White Paper                               | ND                                   |
| <b>Composite Non-Asbestos Content:</b>    | 60% Synthetic Fibers<br>5% Cellulose |
| <b>Sample Composite Homogeneity:</b> Good |                                      |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-99B, Blue/Black Carpet with Paper Backing - MPR Bldg,  
Janitor & Storage Room**

Lab ID-Version‡: 21851872-1

| Sample Layers                          | Asbestos Content                     |
|----------------------------------------|--------------------------------------|
| Blue Carpet                            | ND                                   |
| Yellow Adhesive                        | ND                                   |
| White Paper                            | ND                                   |
| <b>Composite Non-Asbestos Content:</b> | 60% Synthetic Fibers<br>5% Cellulose |
| <b>Sample Composite Homogeneity:</b>   | Good                                 |

**Location: ECG-25-7963-100A, Four inch Black Vinyl Base Cove with Beige Mastic -  
MPR Bldg, Janitor & Storage Room**

Lab ID-Version‡: 21851873-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Black Cove Base                      | ND               |
| Beige Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-100B, Four inch Black Vinyl Base Cove with Beige Mastic -  
MPR Bldg, Janitor & Storage Room**

Lab ID-Version‡: 21851874-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Black Cove Base                      | ND               |
| Beige Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-101A, Drywall with Joint Compound - MPR Bldg, Library**

Lab ID-Version‡: 21851875-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Texture                          | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-101B, Drywall with Joint Compound - MPR Bldg, Library**

Lab ID-Version‡: 21851876-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Texture                          | ND               |
| Cream Tape                             | ND               |
| White Joint Compound                   | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-102A, Orange Peel Texture - MPR Bldg, West Side of Library**

Lab ID-Version‡: 21851877-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Texture                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-102B, Orange Peel Texture - MPR Bldg, South Side of Library**

Lab ID-Version‡: 21851878-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Texture                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-102C, Orange Peel Texture - MPR Bldg, North Side of Library**

Lab ID-Version‡: 21851879-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Texture                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-102D, Orange Peel Texture - MPR Bldg, Southwest Side of Library**

Lab ID-Version‡: 21851880-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Texture                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-102E, Orange Peel Texture - MPR Bldg, Psych Room Ceiling**

Lab ID-Version‡: 21851881-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Texture                      | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-103A, Four inch Off-White Ceramic Wall Tile with Grout and Mortar - MPR Bldg, Staff Restroom**

Lab ID-Version‡: 21851882-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Off-White Ceramic Tile             | ND               |
| Gray Grout                         | ND               |
| Gray Mortar                        | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-104A, Gray HVAC Duct Mastic - MPR Bldg, HVAC Closet  
inside Library**

Lab ID-Version‡: 21851883-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Mastic                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-105A, 2'x4' Ceiling Panel - MPR Bldg, Library**

Lab ID-Version‡: 21851884-1

| Sample Layers                               | Asbestos Content                  |
|---------------------------------------------|-----------------------------------|
| Light Brown Ceiling Tile with White Surface | ND                                |
| <b>Composite Non-Asbestos Content:</b>      | 45% Cellulose<br>45% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>        | Good                              |

**Location: ECG-25-7963-105B, 2'x4' Ceiling Panel - MPR Bldg, Library**

Lab ID-Version‡: 21851885-1

| Sample Layers                               | Asbestos Content                  |
|---------------------------------------------|-----------------------------------|
| Light Brown Ceiling Tile with White Surface | ND                                |
| <b>Composite Non-Asbestos Content:</b>      | 45% Cellulose<br>45% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>        | Good                              |

**Location: ECG-25-7963-106A, Gray Window Caulking - MPR Bldg, Library at Windows**

Lab ID-Version‡: 21851886-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Caulk                           | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
 C/O: Jose Hernandez, Mathew Watson  
 Re: 25-7963; Sacramento City USD - Earl Warren  
 Elementary School

Date of Sampling: 12-20-2025  
 Date of Receipt: 12-31-2025  
 Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-106B, Gray Window Caulking - MPR Bldg, Library at Windows**

Lab ID-Version‡: 21851887-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Caulk                                | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-107A, Rough Textured Plaster - MPR Bldg, Janitor & Storage Room**

Lab ID-Version‡: 21851888-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Green Plaster                             | ND               |
| Gray Plaster                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-107B, Rough Textured Plaster - MPR Bldg, Janitor & Storage Room**

Lab ID-Version‡: 21851889-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Green Plaster                             | ND               |
| Gray Plaster                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-107C, Rough Textured Plaster - MPR Bldg, Janitor & Storage Room**

Lab ID-Version‡: 21851890-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Green Plaster                             | ND               |
| Gray Plaster                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-108A, Twelve inch Gray Streaked Vinyl Floor Tile with Black Mastic - Portable 20**

Lab ID-Version#: 21851891-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Floor Tile                           | ND               |
| Black Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-108B, Twelve inch Gray Streaked Vinyl Floor Tile with Black Mastic - Portable 25**

Lab ID-Version#: 21851892-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Floor Tile                           | ND               |
| Black Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-109A, Blue Multicolored Carpet with Yellow Mastic - Portable 20**

Lab ID-Version#: 21851893-1

| Sample Layers                                               | Asbestos Content |
|-------------------------------------------------------------|------------------|
| Multicolored Carpet                                         | ND               |
| Yellow Mastic                                               | ND               |
| <b>Composite Non-Asbestos Content:</b> 70% Synthetic Fibers |                  |
| <b>Sample Composite Homogeneity:</b> Good                   |                  |

**Location: ECG-25-7963-109B, Blue Multicolored Carpet with Yellow Mastic - Portable 21**

Lab ID-Version#: 21851894-1

| Sample Layers                                               | Asbestos Content |
|-------------------------------------------------------------|------------------|
| Multicolored Carpet                                         | ND               |
| Yellow Mastic                                               | ND               |
| <b>Composite Non-Asbestos Content:</b> 70% Synthetic Fibers |                  |
| <b>Sample Composite Homogeneity:</b> Good                   |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-110A, Twelve inch Light Blue Vinyl Floor Tile with Black  
Mastic - Portable 19**

Lab ID-Version‡: 21851895-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Floor Tile                           | ND               |
| Yellow Mastic                             | ND               |
| Black Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-110B, Twelve inch Light Blue Vinyl Floor Tile with Black Mastic  
- Portable 18**

Lab ID-Version‡: 21851896-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Floor Tile                           | ND               |
| Yellow Mastic                             | ND               |
| Black Mastic                              | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-111A, Multicolored Carpet Squares with Yellow Mastic -  
Portable 18**

Lab ID-Version‡: 21851897-1

| Sample Layers                             | Asbestos Content     |
|-------------------------------------------|----------------------|
| Multicolored Carpet                       | ND                   |
| Yellow Mastic                             | ND                   |
| <b>Composite Non-Asbestos Content:</b>    | 70% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b> Good |                      |

**Location: ECG-25-7963-111B, Multicolored Carpet Squares with Yellow Mastic -  
Portable 19**

Lab ID-Version‡: 21851898-1

| Sample Layers                             | Asbestos Content     |
|-------------------------------------------|----------------------|
| Multicolored Carpet                       | ND                   |
| Yellow Mastic                             | ND                   |
| <b>Composite Non-Asbestos Content:</b>    | 70% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b> Good |                      |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-112A, Blue Striped Carpet Squares with Blue Mastic - Portable**

**19**

Lab ID-Version‡: 21851899-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Blue-Green Mastic                      | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 70% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-112B, Blue Striped Carpet Squares with Blue Mastic - Portable**

**19**

Lab ID-Version‡: 21851900-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Blue-Green Mastic                      | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 70% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                 |

**Location: ECG-25-7963-113A, Four inch Gray Vinyl Base Cove with Cream Mastic - Portable 18**

Lab ID-Version‡: 21851901-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| Cream Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-113B, Four inch Gray Vinyl Base Cove with Cream Mastic - Portable 19**

Lab ID-Version‡: 21851902-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| Cream Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-114A, Drywall behind Tagboard - Portable 25**

Lab ID-Version‡: 21851903-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Drywall with Brown Paper     | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-114B, Drywall behind Tagboard - Portable 20**

Lab ID-Version‡: 21851904-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Drywall with Brown Paper     | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-115A, 2'x4' Ceiling Panel - Portable 25**

Lab ID-Version‡: 21851905-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Tan Ceiling Tile with White Surface    | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 60% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

**Location: ECG-25-7963-115B, 2'x4' Ceiling Panel - Portable 25**

Lab ID-Version‡: 21851906-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Tan Ceiling Tile with White Surface    | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 60% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

**Location: ECG-25-7963-116A, Expansion Joint Seam Caulking - Portable 25**

Lab ID-Version‡: 21851907-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Expansion Joint                  | ND               |
| Black Expansion Joint                  | ND               |
| <b>Composite Non-Asbestos Content:</b> | 5% Cellulose     |
| <b>Sample Composite Homogeneity:</b>   | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

### Location: ECG-25-7963-116B, Expansion Joint Seam Caulking - Portable 20

Lab ID-Version‡: 21851908-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| White Expansion Joint         | ND               |
| Sample Composite Homogeneity: | Good             |

### Location: ECG-25-7963-117A, Ramp Coating - Portable 25

Lab ID-Version‡: 21851909-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| Brown Coating                 | ND               |
| Sample Composite Homogeneity: | Good             |

### Location: ECG-25-7963-117B, Ramp Coating - Portable 25

Lab ID-Version‡: 21851910-1

| Sample Layers                 | Asbestos Content |
|-------------------------------|------------------|
| Brown Coating                 | ND               |
| Sample Composite Homogeneity: | Good             |

### Location: ECG-25-7963-118A, Drywall behind Tagboard - Portable 18

Lab ID-Version‡: 21851911-1

| Sample Layers                   | Asbestos Content |
|---------------------------------|------------------|
| White Drywall with Brown Paper  | ND               |
| Composite Non-Asbestos Content: | 10% Cellulose    |
| Sample Composite Homogeneity:   | Good             |

### Location: ECG-25-7963-118B, Drywall behind Tagboard - Portable 19

Lab ID-Version‡: 21851912-1

| Sample Layers                   | Asbestos Content |
|---------------------------------|------------------|
| White Drywall with Brown Paper  | ND               |
| Composite Non-Asbestos Content: | 10% Cellulose    |
| Sample Composite Homogeneity:   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
 C/O: Jose Hernandez, Mathew Watson  
 Re: 25-7963; Sacramento City USD - Earl Warren  
 Elementary School

Date of Sampling: 12-20-2025  
 Date of Receipt: 12-31-2025  
 Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

### Location: ECG-25-7963-119A, 2'x4' Ceiling Panel - Portable 18

Lab ID-Version‡: 21851913-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Tan Ceiling Tile with White Surface    | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 60% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

### Location: ECG-25-7963-119B, 2'x4' Ceiling Panel - Portable 19

Lab ID-Version‡: 21851914-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Tan Ceiling Tile with White Surface    | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 60% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

### Location: ECG-25-7963-120A, Black Metal Roof Mastic - Portable 25

Lab ID-Version‡: 21851915-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Brown/Black Mastic                     | ND               |
| <b>Composite Non-Asbestos Content:</b> | 5% Cellulose     |
| <b>Sample Composite Homogeneity:</b>   | Good             |

### Location: ECG-25-7963-120B, Black Metal Roof Mastic - Portable 20

Lab ID-Version‡: 21851916-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Brown/Black Mastic                     | ND               |
| <b>Composite Non-Asbestos Content:</b> | 5% Cellulose     |
| <b>Sample Composite Homogeneity:</b>   | Good             |

### Location: ECG-25-7963-121A, Gray Metal Roof Mastic - Portable 18

Lab ID-Version‡: 21851917-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Gray Mastic                            | 5% Chrysotile    |
| <b>Composite Non-Asbestos Content:</b> | 5% Cellulose     |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Comments:** ECG-25-7963-121B was not analyzed due to prior positive series.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-122A, Red Multicolored Carpet with Yellow Mastic - Portable**

22

Lab ID-Version‡: 21851919-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Red Carpet                             | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 70% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate             |

**Location: ECG-25-7963-122B, Red Multicolored Carpet with Yellow Mastic - Portable**

22

Lab ID-Version‡: 21851920-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Red Carpet                             | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 70% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate             |

**Location: ECG-25-7963-123A, Gray Streaked Vinyl Floor Tile with Black Mastic - Portable 22**

Lab ID-Version‡: 21851921-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Floor Tile                      | ND               |
| Black Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-123B, Gray Streaked Vinyl Floor Tile with Black Mastic - Portable 22**

Lab ID-Version‡: 21851922-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Floor Tile                      | ND               |
| Black Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-124A, Four inch Gray Vinyl Base Cove with White Mastic -  
Portable 22**

Lab ID-Version‡: 21851923-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| White Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-124B, Four inch Gray Vinyl Base Cove with White Mastic -  
Portable 22**

Lab ID-Version‡: 21851924-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| White Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-125A, Drywall behind Tagboard - Portable 22**

Lab ID-Version‡: 21851925-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-125B, Drywall behind Tagboard - Portable 22**

Lab ID-Version‡: 21851926-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-126A, Expansion Joint Seam Caulking - Portable 22**

Lab ID-Version‡: 21851927-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Expansion Joint                | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-126B, Expansion Joint Seam Caulking - Portable 22**

Lab ID-Version‡: 21851928-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Expansion Joint                | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-127A, Dark Gray Streaked Vinyl Floor Tile with Yellow Mastic - Portable 23**

Lab ID-Version‡: 21851929-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Dark Gray Floor Tile                   | ND               |
| Yellow Mastic                          | ND               |
| Gray Leveling Compound                 | ND               |
| Green Mastic                           | ND               |
| Tan Mastic                             | ND               |
| <b>Composite Non-Asbestos Content:</b> | 2% Cellulose     |
| <b>Sample Composite Homogeneity:</b>   | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-127B, Dark Gray Streaked Vinyl Floor Tile with Yellow Mastic - Portable 24**

Lab ID-Version‡: 21851930-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Dark Gray Floor Tile                   | ND               |
| Yellow Mastic                          | ND               |
| Gray Leveling Compound                 | ND               |
| Green Mastic                           | ND               |
| Tan Mastic                             | ND               |
| <b>Composite Non-Asbestos Content:</b> | 2% Cellulose     |
| <b>Sample Composite Homogeneity:</b>   | Moderate         |

**Location: ECG-25-7963-128A, Blue Multicolored Carpet with Yellow Mastic - Portable 24**

Lab ID-Version‡: 21851931-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 70% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate             |

**Location: ECG-25-7963-128B, Blue Multicolored Carpet with Yellow Mastic - Portable 23**

Lab ID-Version‡: 21851932-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 70% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate             |

**Location: ECG-25-7963-129A, Gray Vinyl Base Cove with White Mastic - Portable 24**

Lab ID-Version‡: 21851933-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| White Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
 C/O: Jose Hernandez, Mathew Watson  
 Re: 25-7963; Sacramento City USD - Earl Warren  
 Elementary School

Date of Sampling: 12-20-2025  
 Date of Receipt: 12-31-2025  
 Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-129B, Gray Vinyl Base Cove with White Mastic - Portable 23** Lab ID-Version‡: 21851934-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| White Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-130A, Drywall behind Tagboard - Portable 23** Lab ID-Version‡: 21851935-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-130B, Drywall behind Tagboard - Portable 24** Lab ID-Version‡: 21851936-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-131A, 2'x4' Ceiling Panel - Portable 23** Lab ID-Version‡: 21851937-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Tan Ceiling Tile with White Surface    | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 60% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

**Location: ECG-25-7963-131B, 2'x4' Ceiling Panel - Portable 23** Lab ID-Version‡: 21851938-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Tan Ceiling Tile with White Surface    | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 60% Cellulose<br>30% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

### Location: ECG-25-7963-132A, Expansion Joint Seam Caulking - Portable 23

Lab ID-Version‡: 21851939-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Expansion Joint              | ND               |
| Sample Composite Homogeneity: Good |                  |

### Location: ECG-25-7963-132B, Expansion Joint Seam Caulking - Portable 24

Lab ID-Version‡: 21851940-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| White Expansion Joint              | ND               |
| Sample Composite Homogeneity: Good |                  |

### Location: ECG-25-7963-133A, Ramp Coating - Portable 23

Lab ID-Version‡: 21851941-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Dark Gray Coating                  | ND               |
| Sample Composite Homogeneity: Good |                  |

### Location: ECG-25-7963-133B, Ramp Coating - Portable 24

Lab ID-Version‡: 21851942-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Dark Gray Coating                  | ND               |
| Sample Composite Homogeneity: Good |                  |

### Location: ECG-25-7963-134A, Off-White Vinyl Sheet Flooring with Mastic (Bottom Layer) - Janitor Closet between P1 and P2

Lab ID-Version‡: 21851943-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Off-White Sheet Flooring with Fibrous Backing | ND               |
| Brown/Beige Mastic                            | ND               |
| Composite Non-Asbestos Content: 20% Cellulose |                  |
| Sample Composite Homogeneity: Moderate        |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-134B, Off-White Vinyl Sheet Flooring with Mastic (Bottom Layer) - Boy's & Girl's Restroom between P1 and P2**

Lab ID-Version‡: 21851944-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Off-White Sheet Flooring with Fibrous Backing | ND               |
| Brown/Beige Mastic                            | ND               |
| <b>Composite Non-Asbestos Content:</b>        | 20% Cellulose    |
| <b>Sample Composite Homogeneity:</b>          | Moderate         |

**Location: ECG-25-7963-135A, Gray-Blue Vinyl Sheet Flooring with Mastic (Top Layer) - Boy's & Girl's Restroom between P1 and P2**

Lab ID-Version‡: 21851945-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Floor Tile                      | ND               |
| Tan Mastic                           | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-135B, Gray-Blue Vinyl Sheet Flooring with Mastic (Top Layer) - Boy's & Girl's Restroom between P1 and P2**

Lab ID-Version‡: 21851946-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Floor Tile                      | ND               |
| Tan Mastic                           | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-136A, Gray Vinyl Plank Flooring with Blue Mastic - P2**

Lab ID-Version‡: 21851947-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Flooring                        | ND               |
| Blue Mastic                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
 C/O: Jose Hernandez, Mathew Watson  
 Re: 25-7963; Sacramento City USD - Earl Warren  
 Elementary School

Date of Sampling: 12-20-2025  
 Date of Receipt: 12-31-2025  
 Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-136B, Gray Vinyl Plank Flooring with Blue Mastic - P1**

Lab ID-Version‡: 21851948-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Flooring                        | ND               |
| Blue Mastic                          | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-137A, Checkered Blue Carpet Squares with Gray and Yellow Mastic - P1**

Lab ID-Version‡: 21851949-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Brown/Beige Mastic                     | ND                   |
| Gray Leveling Compound                 | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 80% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate             |

**Location: ECG-25-7963-137B, Checkered Blue Carpet Squares with Gray and Yellow Mastic - P2**

Lab ID-Version‡: 21851950-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Brown/Beige Mastic                     | ND                   |
| Gray Leveling Compound                 | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 80% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-138A, Four inch Gray Vinyl Base Cove with Off-White Mastic - P2**

Lab ID-Version‡: 21851951-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| Off-White Mastic                     | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-138B, Four inch Gray Vinyl Base Cove with Off-White Mastic - P1**

Lab ID-Version‡: 21851952-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| Off-White Mastic                     | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-139A, Drywall behind Tagboard - Kitchen Space between P1 and P2**

Lab ID-Version‡: 21851953-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-139B, Drywall behind Tagboard - P1**

Lab ID-Version‡: 21851954-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-140A, Fiberglass Reinforced Panel with Glue - Staff Restroom  
between P1 and P2**

Lab ID-Version‡: 21851955-1

| Sample Layers                           | Asbestos Content |
|-----------------------------------------|------------------|
| Off-White Fiberglass Reinforced Plastic | ND               |
| Yellow Glue                             | ND               |
| <b>Sample Composite Homogeneity:</b>    | Moderate         |

**Location: ECG-25-7963-140B, Fiberglass Reinforced Panel with Glue - Staff Restroom  
between P1 and P2**

Lab ID-Version‡: 21851956-1

| Sample Layers                           | Asbestos Content |
|-----------------------------------------|------------------|
| Off-White Fiberglass Reinforced Plastic | ND               |
| Yellow Glue                             | ND               |
| <b>Sample Composite Homogeneity:</b>    | Moderate         |

**Location: ECG-25-7963-141A, Drywall Ceiling Panel - Staff Restroom between P1 and  
P2**

Lab ID-Version‡: 21851957-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| White Ceiling Tile (Drywall)           | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose<br>2% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

**Location: ECG-25-7963-141B, Drywall Ceiling Panel - Janitor Closet between P1 and P2**

Lab ID-Version‡: 21851958-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| White Ceiling Tile (Drywall)           | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose<br>2% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-142A, Expansion Joint Seam Caulking - P1**

Lab ID-Version‡: 21851959-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Expansion Joint                | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-142B, Expansion Joint Seam Caulking - P2**

Lab ID-Version‡: 21851960-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| White Expansion Joint                | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-143A, Gray Metal Roof Mastic - P1**

Lab ID-Version‡: 21851961-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Gray Mastic                            | ND               |
| <b>Composite Non-Asbestos Content:</b> | 3% Cellulose     |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-143B, Gray Metal Roof Mastic - P2**

Lab ID-Version‡: 21851962-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Gray Mastic                            | ND               |
| <b>Composite Non-Asbestos Content:</b> | 3% Cellulose     |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-144A, Blue Mottled Carpet with Yellow Mastic - Portable A2**

Lab ID-Version‡: 21851963-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 80% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-144B, Blue Mottled Carpet with Yellow Mastic - Portable A3**

Lab ID-Version‡: 21851964-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Blue Carpet                            | ND                   |
| Yellow Mastic                          | ND                   |
| <b>Composite Non-Asbestos Content:</b> | 80% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate             |

**Location: ECG-25-7963-145A, Gray Streaked Vinyl Floor Tile with Yellow Mastic - Portable A2**

Lab ID-Version‡: 21851965-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Floor Tile                      | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-145B, Gray Streaked Vinyl Floor Tile with Yellow Mastic - Portable A1**

Lab ID-Version‡: 21851966-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Floor Tile                      | ND               |
| Yellow Mastic                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-146A, Four inch Gray Vinyl Base Cove with White Mastic - Portable A1**

Lab ID-Version‡: 21851967-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| White Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
 C/O: Jose Hernandez, Mathew Watson  
 Re: 25-7963; Sacramento City USD - Earl Warren  
 Elementary School

Date of Sampling: 12-20-2025  
 Date of Receipt: 12-31-2025  
 Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-146B, Four inch Gray Vinyl Base Cove with White Mastic -  
 Portable A2**

Lab ID-Version‡: 21851968-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Cove Base                       | ND               |
| White Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

**Location: ECG-25-7963-147A, Drywall behind Tagboard - Portable A2**

Lab ID-Version‡: 21851969-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-147B, Drywall behind Tagboard - Portable A3**

Lab ID-Version‡: 21851970-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-148A, Concrete Ramp - West Side of Potable A1**

Lab ID-Version‡: 21851971-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Concrete                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-148B, Concrete Ramp - West Side of Potable A3**

Lab ID-Version‡: 21851972-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Concrete                        | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-149A, Asphalt Roof Shingle - Shed 1 adjacent to Portables A1-A3**

Lab ID-Version‡: 21851973-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Brown/Black Roofing Shingle            | ND               |
| <b>Composite Non-Asbestos Content:</b> | 20% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-149B, Asphalt Roof Shingle - Shed 1 adjacent to Portables A1-A3**

Lab ID-Version‡: 21851974-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Brown/Black Roofing Shingle            | ND               |
| <b>Composite Non-Asbestos Content:</b> | 20% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-150A, Asphalt Roofing - Shed 2 adjacent to Portables A1-A3**

Lab ID-Version‡: 21851975-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Black Roofing Shingle                  | ND                                |
| Black Roofing Tar and Felt             | ND                                |
| Black Roofing Tar and Felt             | ND                                |
| Black Roofing Tar and Felt             | ND                                |
| Black Roofing Tar                      | ND                                |
| Brown Wood                             | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 40% Cellulose<br>10% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate                          |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-150B, Asphalt Roofing - Shed 2 adjacent to Portables A1-A3**

Lab ID-Version‡: 21851976-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Black Roofing Shingle                  | ND                                |
| Black Roofing Tar and Felt             | ND                                |
| Black Roofing Tar and Felt             | ND                                |
| Black Roofing Tar and Felt             | ND                                |
| Black Roofing Tar                      | ND                                |
| Brown Wood                             | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 40% Cellulose<br>10% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate                          |

**Location: ECG-25-7963-151A, Brown/Orange Carpet with Yellow and Black Mastic - Portable A4**

Lab ID-Version‡: 21851977-1

| Sample Layers                          | Asbestos Content     |
|----------------------------------------|----------------------|
| Orange Carpet                          | ND                   |
| Yellow Mastic                          | ND                   |
| Black Mastic                           | 5% Chrysotile        |
| <b>Composite Non-Asbestos Content:</b> | 80% Synthetic Fibers |
| <b>Sample Composite Homogeneity:</b>   | Moderate             |

**Comments:** Sample ECG-25-7963-151B was not analyzed due to prior positive series. Some layers in the sample were inseparable without cross contamination.

**Location: ECG-25-7963-152A, Twelve inch Beige Vinyl Floor Tile with Black Mastic - Portable A4**

Lab ID-Version‡: 21851979-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Beige Floor Tile                     | ND               |
| Black Mastic                         | ND               |
| <b>Sample Composite Homogeneity:</b> | Moderate         |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-152B, Twelve inch Beige Vinyl Floor Tile with Black Mastic -  
Portable A4**

Lab ID-Version‡: 21851980-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Beige Floor Tile                              | ND               |
| Black Mastic                                  | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

**Location: ECG-25-7963-153A, Brown Resilient Sheet Flooring with Paper Backing and  
Mastic over Red Vinyl Floor Tile and Black Mastic - Portable A4**

Lab ID-Version‡: 21851981-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Brown Sheet Flooring with Fibrous Backing     | 20% Chrysotile   |
| Yellow Mastic                                 | ND               |
| Red Floor Tile                                | 5% Chrysotile    |
| Black Mastic                                  | 2% Chrysotile    |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

**Comments:** Sample ECG-25-7963-153B was not analyzed due to prior positive series. Some layers in the sample were inseparable without cross contamination.

**Location: ECG-25-7963-154A, Four inch Black Vinyl Base Cove with Black Mastic -  
Portable A4**

Lab ID-Version‡: 21851983-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Black Cove Base                               | ND               |
| Beige Mastic                                  | ND               |
| Brown/Black Mastic                            | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-154B, Four inch Black Vinyl Base Cove with Black Mastic -  
Portable A4**

Lab ID-Version‡: 21851984-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Black Cove Base                               | ND               |
| Beige Mastic                                  | ND               |
| Brown/Black Mastic                            | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

**Location: ECG-25-7963-155A, Site Concrete - West Side of Classrooms 14-17 Building**

Lab ID-Version‡: 21851985-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Concrete                             | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-155B, Site Concrete - West Side of Classrooms 5-8 Building**

Lab ID-Version‡: 21851986-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Concrete                             | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-156A, Asphalt - West Side of Classrooms 14-17 Building**

Lab ID-Version‡: 21851987-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Black Asphalt                             | ND               |
| <b>Composite Non-Asbestos Content:</b>    | 2% Cellulose     |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-156B, Asphalt - West Side of Classrooms 5-8 Building**

Lab ID-Version‡: 21851988-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Black Asphalt                          | ND               |
| <b>Composite Non-Asbestos Content:</b> | 2% Cellulose     |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-157A, Stucco - Northwest Corner of Classrooms 14-17 Building**

Lab ID-Version‡: 21851989-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Stucco with Paint               | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-157B, Stucco - Southeast Corner of Classrooms 9-12 Building**

Lab ID-Version‡: 21851990-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Stucco with Paint               | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-157C, Stucco - Southeast Corner of Admin Bldg. at Library**

Lab ID-Version‡: 21851991-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Stucco with Paint               | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-157D, Stucco - Northwest Corner of Classrooms 5-8 Building**

Lab ID-Version‡: 21851992-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Stucco with Paint               | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

**Location: ECG-25-7963-157E, Stucco - Northwest Corner of Classrooms 1-4 Building**

Lab ID-Version‡: 21851993-1

| Sample Layers                                 | Asbestos Content |
|-----------------------------------------------|------------------|
| Gray Stucco with Paint                        | ND               |
| Light Gray Stucco                             | ND               |
| <b>Sample Composite Homogeneity:</b> Moderate |                  |

**Location: ECG-25-7963-157F, Stucco - Southeast Corner of Classrooms 5-8 Building**

Lab ID-Version‡: 21851994-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Stucco with Paint                    | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

**Location: ECG-25-7963-157G, Stucco - Southeast Corner of Classrooms 1-4 Building**

Lab ID-Version‡: 21851995-1

| Sample Layers                             | Asbestos Content |
|-------------------------------------------|------------------|
| Gray Stucco with Paint                    | ND               |
| <b>Sample Composite Homogeneity:</b> Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## ASBESTOS PLM REPORT

|                                    |     |
|------------------------------------|-----|
| <b>Total Samples Submitted:</b>    | 140 |
| <b>Total Samples Analyzed:</b>     | 137 |
| <b>Total Samples Not Analyzed:</b> | 3   |

**ECG-25-7963-153B, Brown Resilient Sheet Flooring with Paper Backing and  
Mastic over Red Vinyl Floor Tile and Black Mastic - Portable A4** Lab ID-Version‡: 21851982-0

|              |               |
|--------------|---------------|
| NOT ANALYZED | POSITIVE STOP |
|--------------|---------------|

**ECG-25-7963-151B, Brown/Orange Carpet with Yellow and Black Mastic -  
Portable A4** Lab ID-Version‡: 21851978-0

|              |               |
|--------------|---------------|
| NOT ANALYZED | POSITIVE STOP |
|--------------|---------------|

**ECG-25-7963-121B, Gray Metal Roof Mastic - Portable 19** Lab ID-Version‡: 21851918-0

|              |               |
|--------------|---------------|
| NOT ANALYZED | POSITIVE STOP |
|--------------|---------------|

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Sample results described as "Positive Stop" were not analyzed because the previous sample layer(s) contained asbestos >1%. Sample results described as "Sample Bag Empty" were not analyzed because while the sample bag was submitted it did not contain a discernible sample. Sample results described as "No Sample Submitted" were not analyzed because the sample bag was not submitted with the project. Sample results described as "Insufficient Sample" were not analyzed because while the sample was submitted for analysis, there was insufficient material present to analyze the sample confidently. Sample results described as "Per Client Request" were submitted to the laboratory but not analyzed because the laboratory was requested to hold the sample.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**  
111 Anza Boulevard, Suite 122, Burlingame, CA 94010  
(833) 465-5857 [www.eurofinsus.com/Built](http://www.eurofinsus.com/Built)

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025  
Date of Receipt: 12-31-2025  
Date of Report: 01-08-2026

## **ASBESTOS PLM REPORT**

### **PROJECT ANALYSTS AND SIGNATORY REPORT**

---

#### **Project Analysts**



**Analyst:** Dimitri Arndt-Truong

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".



| Weather |          | Fog                                 | Rain                                | Snow                                | Wind                                | Clear                    |
|---------|----------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| Level   | None     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
|         | Light    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Moderate | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Heavy    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |

New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984  
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802  
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

| EMLab ID |
|----------|
| 4360804  |

| REQUESTED SERVICES<br>(Use checkboxes below) |                          |                          |                          |                          |                          |
|----------------------------------------------|--------------------------|--------------------------|--------------------------|--------------------------|--------------------------|
| Asbestos PLM                                 |                          |                          |                          |                          |                          |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |

| CONTACT INFORMATION  |                                                                                                   |                            |                                                                                                                                                                                         |                              |                                  |                                                                                                                                                    |                                     |  |  |
|----------------------|---------------------------------------------------------------------------------------------------|----------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------|----------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------|--|--|
| Company:             | Entek Consulting Group (9697)                                                                     |                            | Address: 3435 American River Drive Suite C Sacramento, CA 95864                                                                                                                         |                              |                                  |                                                                                                                                                    |                                     |  |  |
| Contact:             | Jose Hernandez, Mathew Watson                                                                     |                            | Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series. |                              |                                  |                                                                                                                                                    |                                     |  |  |
| Phone:               | 916-824-5580                                                                                      |                            |                                                                                                                                                                                         |                              |                                  |                                                                                                                                                    |                                     |  |  |
| PROJECT INFORMATION  |                                                                                                   |                            |                                                                                                                                                                                         | TURN AROUND TIME CODES (TAT) |                                  |                                                                                                                                                    |                                     |  |  |
| Project ID:          | 25-7963                                                                                           |                            |                                                                                                                                                                                         | STD – Standard (DEFAULT)     |                                  | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |                                     |  |  |
| Project Description: | Sacramento City USD - Earl Warren Elementary School                                               |                            |                                                                                                                                                                                         | ND – Next Business Day       |                                  |                                                                                                                                                    |                                     |  |  |
| Project Zip Code:    | 95820                                                                                             | Sampling Date & Time:      | 12/20/2025 07:00 AM                                                                                                                                                                     | SD – Same Business Day Rush  |                                  |                                                                                                                                                    |                                     |  |  |
| PO Number:           | 25-7963                                                                                           | Sampled By: Jose Hernandez |                                                                                                                                                                                         | WH – Weekend / Holiday       |                                  |                                                                                                                                                    |                                     |  |  |
| Sample ID            | Description                                                                                       |                            | Sample Type<br>(Below)                                                                                                                                                                  | TAT<br>(Above)               | Volume / Area<br>(as applicable) | ISO Class<br>(as applicable)                                                                                                                       | Notes (Time of day, Temp, RH, etc.) |  |  |
| ECG-25-7963-90A      | Gray Wood Pattern Vinyl Plank Flooring - MPR Bldg, Speech Room                                    |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-90B      | Gray Wood Pattern Vinyl Plank Flooring - MPR Bldg, Speech Room                                    |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-91A      | Four inch Gray Vinyl Base Cove with White Mastic - MPR Bldg, Speech Room                          |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-91B      | Four inch Gray Vinyl Base Cove with White Mastic - MPR Bldg, Speech Room                          |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-92A      | Blue Carpet with Yellow Mastic - MPR Bldg, Wheel Chair Access Room                                |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-93A      | Four inch Blue Vinyl Base Cove with Beige Mastic - MPR Bldg, Wheel Chair Access Room              |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-94A      | Two inch Beige Speckled Ceramic Floor with Grout and Mortar - MPR Bldg, Staff Restroom            |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-95A      | Twelve inch Blue Mottled Vinyl Floor Tile with Black Mastic - MPR Bldg, Southeast Side of Library |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-95B      | Twelve inch Blue Mottled Vinyl Floor Tile with Black Mastic - MPR Bldg, Northeast Side of Library |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-96A      | Blue Multicolored Carpet with Yellow Mastic - MPR Bldg, Psych Room                                |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-96B      | Blue Multicolored Carpet with Yellow Mastic - MPR Bldg, Psych Room                                |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |

| SAMPLE TYPE CODES |  | RELINQUISHED BY | DATE & TIME         | RECEIVED BY              | DATE & TIME        |
|-------------------|--|-----------------|---------------------|--------------------------|--------------------|
| B - Bulk sample   |  | Jose Hernandez  | 12/31/2025 12:38 PM | <br>Renee Reyes, Analyst | 12/31/2025 3:04 PM |
|                   |  |                 |                     |                          |                    |
|                   |  |                 |                     |                          |                    |



| Weather |          | Fog                                 | Rain                                | Snow                                | Wind                                | Clear                    |
|---------|----------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| Level   | None     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
|         | Light    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Moderate | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Heavy    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |

| EMLab ID |
|----------|
| 4360804  |

New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984  
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802  
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

CONTACT INFORMATION

|          |                               |                                                                                                                                                                                         |
|----------|-------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Company: | Entek Consulting Group (9697) | Address: 3435 American River Drive Suite C Sacramento, CA 95864                                                                                                                         |
| Contact: | Jose Hernandez, Mathew Watson | Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series. |
| Phone:   | 916-824-5580                  |                                                                                                                                                                                         |


PROJECT INFORMATION

TURN AROUND TIME CODES (TAT)

|                      |                                                     |                            |                     |                            |                                                                                                                                                    |
|----------------------|-----------------------------------------------------|----------------------------|---------------------|----------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|
| Project ID:          | 25-7963                                             |                            |                     | STD – Standard (DEFAULT)   | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |
| Project Description: | Sacramento City USD - Earl Warren Elementary School |                            |                     | ND – Next Business Day     |                                                                                                                                                    |
| Project Zip Code:    | 95820                                               | Sampling Date & Time:      | 12/20/2025 07:00 AM | SD –Same Business Day Rush |                                                                                                                                                    |
| PO Number:           | 25-7963                                             | Sampled By: Jose Hernandez |                     | WH – Weekend / Holiday     |                                                                                                                                                    |
|                      |                                                     |                            |                     |                            |                                                                                                                                                    |

| Sample ID        | Description                                                                           | Sample Type (Below) | TAT (Above) | Volume / Area (as applicable) | ISO Class (as applicable) | Notes (Time of day, Temp, RH, etc.) |
|------------------|---------------------------------------------------------------------------------------|---------------------|-------------|-------------------------------|---------------------------|-------------------------------------|
| ECG-25-7963-97A  | Four inch Black Vinyl Base Cove with White Mastic - MPR Bldg, Library                 | B                   | 9           | N/A                           |                           |                                     |
| ECG-25-7963-97B  | Four inch Black Vinyl Base Cove with White Mastic - MPR Bldg, Library                 | B                   | 9           | N/A                           |                           |                                     |
| ECG-25-7963-98A  | Green Streaked Vinyl Floor Tile with Yellow Mastic - MPR Bldg, Janitor & Storage Room | B                   | 9           | N/A                           |                           |                                     |
| ECG-25-7963-98B  | Green Streaked Vinyl Floor Tile with Yellow Mastic - MPR Bldg, Janitor & Storage Room | B                   | 9           | N/A                           |                           |                                     |
| ECG-25-7963-99A  | Blue/Black Carpet with Paper Backing - MPR Bldg, Janitor & Storage Room               | B                   | 9           | N/A                           |                           |                                     |
| ECG-25-7963-99B  | Blue/Black Carpet with Paper Backing - MPR Bldg, Janitor & Storage Room               | B                   | 9           | N/A                           |                           |                                     |
| ECG-25-7963-100A | Four inch Black Vinyl Base Cove with Beige Mastic - MPR Bldg, Janitor & Storage Room  | B                   | 9           | N/A                           |                           |                                     |
| ECG-25-7963-100B | Four inch Black Vinyl Base Cove with Beige Mastic - MPR Bldg, Janitor & Storage Room  | B                   | 9           | N/A                           |                           |                                     |
| ECG-25-7963-101A | Drywall with Joint Compound - MPR Bldg, Library                                       | B                   | 9           | N/A                           |                           |                                     |
| ECG-25-7963-101B | Drywall with Joint Compound - MPR Bldg, Library                                       | B                   | 9           | N/A                           |                           |                                     |
| ECG-25-7963-102A | Orange Peel Texture - MPR Bldg, West Side of Library                                  | B                   | 9           | N/A                           |                           |                                     |

| REQUESTED SERVICES<br>(Use checkboxes below) |                          |                          |                          |                          |                          |
|----------------------------------------------|--------------------------|--------------------------|--------------------------|--------------------------|--------------------------|
| Asbestos PLM                                 |                          |                          |                          |                          |                          |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
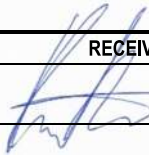
| SAMPLE TYPE CODES |  | RELINQUISHED BY | DATE & TIME         | RECEIVED BY                                                                                                   | DATE & TIME        |
|-------------------|--|-----------------|---------------------|---------------------------------------------------------------------------------------------------------------|--------------------|
| B - Bulk sample   |  | Jose Hernandez  | 12/31/2025 12:38 PM | <br>Renee Reyes, Analyst | 12/31/2025 3:04 PM |
|                   |  |                 |                     |                                                                                                               |                    |
|                   |  |                 |                     |                                                                                                               |                    |



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

Table with 1 column: EMLab ID. Value: 4360804

REQUESTED SERVICES (Use checkboxes below)
Asbestos PLM
Grid of checkboxes for various services.

CONTACT INFORMATION
PROJECT INFORMATION
TURN AROUND TIME CODES (TAT)
Table with 7 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains 12 rows of sample data.

SAMPLE TYPE CODES
RELINQUISHED BY
DATE & TIME
RECEIVED BY
DATE & TIME
Signature of Renee Reyes, Analyst



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

Table with 1 column: EMLab ID. Value: 4360804

REQUESTED SERVICES (Use checkboxes below)
Asbestos PLM
Grid of checkboxes for various services.

CONTACT INFORMATION
PROJECT INFORMATION
TURN AROUND TIME CODES (TAT)
Table with columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Includes a list of samples with descriptions and locations.

SAMPLE TYPE CODES
RELINQUISHED BY
DATE & TIME
RECEIVED BY
DATE & TIME
Signature of Renee Reyes, Analyst



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

Table with 1 column: EMLab ID. Value: 4360804

REQUESTED SERVICES
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697) Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Mathew Watson Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION TURN AROUND TIME CODES (TAT)
Project ID: 25-7963 STD - Standard (DEFAULT)
Project Description: Sacramento City USD - Earl Warren Elementary School ND - Next Business Day
Project Zip Code: 95820 Sampling Date & Time: 12/20/2025 07:00 AM SD - Same Business Day Rush
PO Number: 25-7963 Sampled By: Jose Hernandez WH - Weekend / Holiday

Table with 7 columns: Sample ID, Description, Sample Type (Below), TAT (Above), Volume / Area (as applicable), ISO Class (as applicable), Notes (Time of day, Temp, RH, etc.)
Rows include: ECG-25-7963-112B, ECG-25-7963-113A, ECG-25-7963-113B, ECG-25-7963-114A, ECG-25-7963-114B, ECG-25-7963-115A, ECG-25-7963-115B, ECG-25-7963-116A, ECG-25-7963-116B, ECG-25-7963-117A, ECG-25-7963-117B

Table for Asbestos PLM with 10 columns and 10 rows of checkboxes.

Table with 4 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY, DATE & TIME. Includes signature of Renee Reyes, Analyst.



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

Table with 1 column: EMLab ID. Value: 4360804

REQUESTED SERVICES
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697)
Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Mathew Watson
Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION and TURN AROUND TIME CODES (TAT)
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Project Zip Code: 95820
Sampling Date & Time: 12/20/2025 07:00 AM
PO Number: 25-7963
Sampled By: Jose Hernandez
TAT codes: STD - Standard (DEFAULT), ND - Next Business Day, SD - Same Business Day Rush, WH - Weekend / Holiday

Main table with 7 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains 13 rows of sample data.

Asbestos PLM table with 10 columns for different asbestos types, each with a checkbox.

Table with 4 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY. Includes signature of Renee Reyes, Analyst.



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984  
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802  
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

| Weather |          | Fog                                 | Rain                                | Snow                                | Wind                                | Clear                    |
|---------|----------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| Level   | None     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
|         | Light    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Moderate | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Heavy    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |

| EMLab ID |
|----------|
| 4360804  |

| REQUESTED SERVICES<br>(Use checkboxes below) |                          |                          |                          |                          |                          |
|----------------------------------------------|--------------------------|--------------------------|--------------------------|--------------------------|--------------------------|
| Asbestos PLM                                 |                          |                          |                          |                          |                          |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |

| CONTACT INFORMATION  |                                                                      |                            |                                                                                                                                                                                         |                              |                                  |                                                                                                                                                    |                                     |  |  |
|----------------------|----------------------------------------------------------------------|----------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------|----------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------|--|--|
| Company:             | Entek Consulting Group (9697)                                        |                            | Address: 3435 American River Drive Suite C Sacramento, CA 95864                                                                                                                         |                              |                                  |                                                                                                                                                    |                                     |  |  |
| Contact:             | Jose Hernandez, Mathew Watson                                        |                            | Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series. |                              |                                  |                                                                                                                                                    |                                     |  |  |
| Phone:               | 916-824-5580                                                         |                            |                                                                                                                                                                                         |                              |                                  |                                                                                                                                                    |                                     |  |  |
| PROJECT INFORMATION  |                                                                      |                            |                                                                                                                                                                                         | TURN AROUND TIME CODES (TAT) |                                  |                                                                                                                                                    |                                     |  |  |
| Project ID:          | 25-7963                                                              |                            |                                                                                                                                                                                         | STD – Standard (DEFAULT)     |                                  | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |                                     |  |  |
| Project Description: | Sacramento City USD - Earl Warren Elementary School                  |                            |                                                                                                                                                                                         | ND – Next Business Day       |                                  |                                                                                                                                                    |                                     |  |  |
| Project Zip Code:    | 95820                                                                | Sampling Date & Time:      | 12/20/2025 07:00 AM                                                                                                                                                                     | SD – Same Business Day Rush  |                                  |                                                                                                                                                    |                                     |  |  |
| PO Number:           | 25-7963                                                              | Sampled By: Jose Hernandez |                                                                                                                                                                                         | WH – Weekend / Holiday       |                                  |                                                                                                                                                    |                                     |  |  |
| Sample ID            | Description                                                          |                            | Sample Type<br>(Below)                                                                                                                                                                  | TAT<br>(Above)               | Volume / Area<br>(as applicable) | ISO Class<br>(as applicable)                                                                                                                       | Notes (Time of day, Temp, RH, etc.) |  |  |
| ECG-25-7963-123B     | Gray Streaked Vinyl Floor Tile with Black Mastic - Portable 22       |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-124A     | Four inch Gray Vinyl Base Cove with White Mastic - Portable 22       |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-124B     | Four inch Gray Vinyl Base Cove with White Mastic - Portable 22       |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-125A     | Drywall behind Tagboard - Portable 22                                |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-125B     | Drywall behind Tagboard - Portable 22                                |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-126A     | Expansion Joint Seam Caulking - Portable 22                          |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-126B     | Expansion Joint Seam Caulking - Portable 22                          |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-127A     | Dark Gray Streaked Vinyl Floor Tile with Yellow Mastic - Portable 23 |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-127B     | Dark Gray Streaked Vinyl Floor Tile with Yellow Mastic - Portable 24 |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-128A     | Blue Multicolored Carpet with Yellow Mastic - Portable 24            |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-128B     | Blue Multicolored Carpet with Yellow Mastic - Portable 23            |                            | B                                                                                                                                                                                       | 9                            | N/A                              |                                                                                                                                                    |                                     |  |  |

| SAMPLE TYPE CODES |  | RELINQUISHED BY | DATE & TIME         | RECEIVED BY              | DATE & TIME        |
|-------------------|--|-----------------|---------------------|--------------------------|--------------------|
| B - Bulk sample   |  | Jose Hernandez  | 12/31/2025 12:38 PM | <br>Renee Reyes, Analyst | 12/31/2025 3:04 PM |
|                   |  |                 |                     |                          |                    |
|                   |  |                 |                     |                          |                    |



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984  
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802  
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

| Weather |          | Fog                                 | Rain                                | Snow                                | Wind                                | Clear                    |
|---------|----------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| Level   | None     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
|         | Light    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Moderate | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Heavy    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |

| EMLab ID |
|----------|
| 4360804  |

| REQUESTED SERVICES<br>(Use checkboxes below) |                          |                          |                          |                          |                          |
|----------------------------------------------|--------------------------|--------------------------|--------------------------|--------------------------|--------------------------|
| Asbestos PLM                                 |                          |                          |                          |                          |                          |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |

| CONTACT INFORMATION  |                                                                                              |                            |                                                                                                                                                                                         |                              |                               |                                                                                                                                                    |                                     |  |  |
|----------------------|----------------------------------------------------------------------------------------------|----------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------|-------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------|--|--|
| Company:             | Entek Consulting Group (9697)                                                                |                            | Address: 3435 American River Drive Suite C Sacramento, CA 95864                                                                                                                         |                              |                               |                                                                                                                                                    |                                     |  |  |
| Contact:             | Jose Hernandez, Mathew Watson                                                                |                            | Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series. |                              |                               |                                                                                                                                                    |                                     |  |  |
| Phone:               | 916-824-5580                                                                                 |                            |                                                                                                                                                                                         |                              |                               |                                                                                                                                                    |                                     |  |  |
| PROJECT INFORMATION  |                                                                                              |                            |                                                                                                                                                                                         | TURN AROUND TIME CODES (TAT) |                               |                                                                                                                                                    |                                     |  |  |
| Project ID:          | 25-7963                                                                                      |                            |                                                                                                                                                                                         | STD – Standard (DEFAULT)     |                               | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |                                     |  |  |
| Project Description: | Sacramento City USD - Earl Warren Elementary School                                          |                            |                                                                                                                                                                                         | ND – Next Business Day       |                               |                                                                                                                                                    |                                     |  |  |
| Project Zip Code:    | 95820                                                                                        | Sampling Date & Time:      | 12/20/2025 07:00 AM                                                                                                                                                                     | SD – Same Business Day Rush  |                               |                                                                                                                                                    |                                     |  |  |
| PO Number:           | 25-7963                                                                                      | Sampled By: Jose Hernandez |                                                                                                                                                                                         | WH – Weekend / Holiday       |                               |                                                                                                                                                    |                                     |  |  |
| Sample ID            | Description                                                                                  |                            | Sample Type (Below)                                                                                                                                                                     | TAT (Above)                  | Volume / Area (as applicable) | ISO Class (as applicable)                                                                                                                          | Notes (Time of day, Temp, RH, etc.) |  |  |
| ECG-25-7963-129A     | Gray Vinyl Base Cove with White Mastic - Portable 24                                         |                            | B                                                                                                                                                                                       | 9                            | N/A                           |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-129B     | Gray Vinyl Base Cove with White Mastic - Portable 23                                         |                            | B                                                                                                                                                                                       | 9                            | N/A                           |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-130A     | Drywall behind Tagboard - Portable 23                                                        |                            | B                                                                                                                                                                                       | 9                            | N/A                           |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-130B     | Drywall behind Tagboard - Portable 24                                                        |                            | B                                                                                                                                                                                       | 9                            | N/A                           |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-131A     | 2'x4' Ceiling Panel - Portable 23                                                            |                            | B                                                                                                                                                                                       | 9                            | N/A                           |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-131B     | 2'x4' Ceiling Panel - Portable 23                                                            |                            | B                                                                                                                                                                                       | 9                            | N/A                           |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-132A     | Expansion Joint Seam Caulking - Portable 23                                                  |                            | B                                                                                                                                                                                       | 9                            | N/A                           |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-132B     | Expansion Joint Seam Caulking - Portable 24                                                  |                            | B                                                                                                                                                                                       | 9                            | N/A                           |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-133A     | Ramp Coating - Portable 23                                                                   |                            | B                                                                                                                                                                                       | 9                            | N/A                           |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-133B     | Ramp Coating - Portable 24                                                                   |                            | B                                                                                                                                                                                       | 9                            | N/A                           |                                                                                                                                                    |                                     |  |  |
| ECG-25-7963-134A     | Off-White Vinyl Sheet Flooring with Mastic (Bottom Layer) - Janitor Closet between P1 and P2 |                            | B                                                                                                                                                                                       | 9                            | N/A                           |                                                                                                                                                    |                                     |  |  |

| SAMPLE TYPE CODES |  | RELINQUISHED BY | DATE & TIME         | RECEIVED BY              | DATE & TIME        |
|-------------------|--|-----------------|---------------------|--------------------------|--------------------|
| B - Bulk sample   |  | Jose Hernandez  | 12/31/2025 12:38 PM | <br>Renee Reyes, Analyst | 12/31/2025 3:04 PM |
|                   |  |                 |                     |                          |                    |
|                   |  |                 |                     |                          |                    |



Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

Table with 1 column: EMLab ID. Value: 4360804

New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

CONTACT INFORMATION

Table with 3 columns: Company, Contact, Phone. Values include Entek Consulting Group (9697), Jose Hernandez, Mathew Watson, 916-824-5580, and address information.

PROJECT INFORMATION

TURN AROUND TIME CODES (TAT)

Table with 4 columns: Project ID, Project Description, Project Zip Code, PO Number. Includes sampling date and time (12/20/2025 07:00 AM) and sample type codes (STD, ND, SD, WH).

Main table with 7 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains 13 rows of sample data.

Table with 1 column: REQUESTED SERVICES (Use checkboxes below). Includes a vertical label 'Asbestos PLM' and a grid of checkboxes.

Table with 4 columns: SAMPLE TYPE CODES, RELINQUISHED BY, DATE & TIME, RECEIVED BY. Includes signature of Renee Reyes, Analyst.



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

Table with 1 column: EMLab ID. Value: 4360804

REQUESTED SERVICES (Use checkboxes below)
Asbestos PLM
Grid of checkboxes for various services.

CONTACT INFORMATION
PROJECT INFORMATION
TURN AROUND TIME CODES (TAT)
Table with 7 columns: Sample ID, Description, Sample Type, TAT, Volume / Area, ISO Class, Notes. Contains 15 rows of sample data.

SAMPLE TYPE CODES
RELINQUISHED BY
DATE & TIME
RECEIVED BY
DATE & TIME
Signature of Renee Reyes, Analyst



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984  
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802  
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

| Weather |          | Fog                                 | Rain                                | Snow                                | Wind                                | Clear                    |
|---------|----------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| Level   | None     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
|         | Light    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Moderate | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Heavy    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |

| EMLab ID |
|----------|
| 4360804  |

| REQUESTED SERVICES<br>(Use checkboxes below) |                          |                          |                          |                          |                          |
|----------------------------------------------|--------------------------|--------------------------|--------------------------|--------------------------|--------------------------|
| Asbestos PLM                                 |                          |                          |                          |                          |                          |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |

| CONTACT INFORMATION  |                                                              |                            |                                                                                                                                                                                         |                              |                |                                                                                                                                                    |                              |                                     |  |  |
|----------------------|--------------------------------------------------------------|----------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------|-------------------------------------|--|--|
| Company:             | Entek Consulting Group (9697)                                |                            | Address: 3435 American River Drive Suite C Sacramento, CA 95864                                                                                                                         |                              |                |                                                                                                                                                    |                              |                                     |  |  |
| Contact:             | Jose Hernandez, Mathew Watson                                |                            | Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series. |                              |                |                                                                                                                                                    |                              |                                     |  |  |
| Phone:               | 916-824-5580                                                 |                            |                                                                                                                                                                                         |                              |                |                                                                                                                                                    |                              |                                     |  |  |
| PROJECT INFORMATION  |                                                              |                            |                                                                                                                                                                                         | TURN AROUND TIME CODES (TAT) |                |                                                                                                                                                    |                              |                                     |  |  |
| Project ID:          | 25-7963                                                      |                            |                                                                                                                                                                                         | STD – Standard (DEFAULT)     |                | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |                              |                                     |  |  |
| Project Description: | Sacramento City USD - Earl Warren Elementary School          |                            |                                                                                                                                                                                         | ND – Next Business Day       |                |                                                                                                                                                    |                              |                                     |  |  |
| Project Zip Code:    | 95820                                                        | Sampling Date & Time:      | 12/20/2025 07:00 AM                                                                                                                                                                     | SD – Same Business Day Rush  |                |                                                                                                                                                    |                              |                                     |  |  |
| PO Number:           | 25-7963                                                      | Sampled By: Jose Hernandez |                                                                                                                                                                                         | WH – Weekend / Holiday       |                |                                                                                                                                                    |                              |                                     |  |  |
| Sample ID            | Description                                                  |                            |                                                                                                                                                                                         | Sample Type<br>(Below)       | TAT<br>(Above) | Volume / Area<br>(as applicable)                                                                                                                   | ISO Class<br>(as applicable) | Notes (Time of day, Temp, RH, etc.) |  |  |
| ECG-25-7963-145B     | Gray Streaked Vinyl Floor Tile with Yellow Mastic - Portable |                            |                                                                                                                                                                                         | A1 B                         | 9              | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-146A     | Four inch Gray Vinyl Base Cove with White Mastic - Portable  |                            |                                                                                                                                                                                         | A1 B                         | 9              | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-146B     | Four inch Gray Vinyl Base Cove with White Mastic - Portable  |                            |                                                                                                                                                                                         | A2 B                         | 9              | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-147A     | Drywall behind Tagboard - Portable A2                        |                            |                                                                                                                                                                                         | B                            | 9              | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-147B     | Drywall behind Tagboard - Portable A3                        |                            |                                                                                                                                                                                         | B                            | 9              | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-148A     | Concrete Ramp - West Side of Potable A1                      |                            |                                                                                                                                                                                         | B                            | 9              | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-148B     | Concrete Ramp - West Side of Potable A3                      |                            |                                                                                                                                                                                         | B                            | 9              | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-149A     | Asphalt Roof Shingle - Shed 1 adjacent to Portables A1-A3    |                            |                                                                                                                                                                                         | B                            | 9              | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-149B     | Asphalt Roof Shingle - Shed 1 adjacent to Portables A1-A3    |                            |                                                                                                                                                                                         | B                            | 9              | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-150A     | Asphalt Roofing - Shed 2 adjacent to Portables A1-A3         |                            |                                                                                                                                                                                         | B                            | 9              | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-150B     | Asphalt Roofing - Shed 2 adjacent to Portables A1-A3         |                            |                                                                                                                                                                                         | B                            | 9              | N/A                                                                                                                                                |                              |                                     |  |  |

| SAMPLE TYPE CODES |  | RELINQUISHED BY | DATE & TIME         | RECEIVED BY              | DATE & TIME        |
|-------------------|--|-----------------|---------------------|--------------------------|--------------------|
| B - Bulk sample   |  | Jose Hernandez  | 12/31/2025 12:38 PM | <br>Renee Reyes, Analyst | 12/31/2025 3:04 PM |
|                   |  |                 |                     |                          |                    |
|                   |  |                 |                     |                          |                    |

**CHAIN OF CUSTODY**  
[www.eurofinsus.com/Built](http://www.eurofinsus.com/Built)



**ENTEK**  
**CONSULTING GROUP, INC.**

| Weather |          | Fog                                 | Rain                                | Snow                                | Wind                                | Clear                    |
|---------|----------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| Level   | None     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
|         | Light    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Moderate | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Heavy    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |

**New Jersey:** 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984

**Phoenix, AZ:** 1501 West Knudsen Drive, Phoenix, AZ 85027 \* **(800) 651-4802**

**Burlingame, CA:** 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

## CONTACT INFORMATION

|          |                               |                                                                                                                                                                                                                                                                |
|----------|-------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Company: | Entek Consulting Group (9697) | Address: 3435 American River Drive Suite C Sacramento, CA 95864<br><br>Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series. |
| Contact: | Jose Hernandez, Mathew Watson |                                                                                                                                                                                                                                                                |
| Phone:   | 916-824-5580                  |                                                                                                                                                                                                                                                                |

## PROJECT INFORMATION

### TURN AROUND TIME CODES (TAT)

|                      |                                                     |                            |                     |                                   |                                                                                                                                                    |
|----------------------|-----------------------------------------------------|----------------------------|---------------------|-----------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|
| Project ID:          | 25-7963                                             |                            |                     | <b>STD</b> – Standard (DEFAULT)   | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |
| Project Description: | Sacramento City USD - Earl Warren Elementary School |                            |                     | <b>ND</b> – Next Business Day     |                                                                                                                                                    |
| Project Zip Code:    | 95820                                               | Sampling Date & Time:      | 12/20/2025 07:00 AM | <b>SD</b> –Same Business Day Rush |                                                                                                                                                    |
| PO Number:           | 25-7963                                             | Sampled By: Jose Hernandez |                     | <b>WH</b> – Weekend / Holiday     |                                                                                                                                                    |

| Sample ID        | Description                                                                                                           | Sample Type<br>(Below) | TAT<br>(Above) | Volume / Area<br>(as applicable) | ISO Class<br>(as applicable) | Notes (Time of day, Temp, RH, etc.) |
|------------------|-----------------------------------------------------------------------------------------------------------------------|------------------------|----------------|----------------------------------|------------------------------|-------------------------------------|
| ECG-25-7963-151A | Brown/Orange Carpet with Yellow and Black Mastic - Portable A4                                                        | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-151B | Brown/Orange Carpet with Yellow and Black Mastic - Portable A4                                                        | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-152A | Twelve inch Beige Vinyl Floor Tile with Black Mastic - Portable A4                                                    | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-152B | Twelve inch Beige Vinyl Floor Tile with Black Mastic - Portable A4                                                    | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-153A | Brown Resilient Sheet Flooring with Paper Backing and Mastic over Red Vinyl Floor Tile and Black Mastic - Portable A4 | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-153B | Brown Resilient Sheet Flooring with Paper Backing and Mastic over Red Vinyl Floor Tile and Black Mastic - Portable A4 | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-154A | Four inch Black Vinyl Base Cove with Black Mastic - Portable A4                                                       | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-154B | Four inch Black Vinyl Base Cove with Black Mastic - Portable A4                                                       | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-155A | Site Concrete - West Side of Classrooms 14-17 Building                                                                | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-155B | Site Concrete - West Side of Classrooms 5-8 Building                                                                  | B                      | 9              | N/A                              |                              |                                     |
| ECG-25-7963-156A | Asphalt - West Side of Classrooms 14-17 Building                                                                      | B                      | 9              | N/A                              |                              |                                     |

|          |
|----------|
| EMLab ID |
| 4360804  |

**REQUESTED  
SERVICES**

(Use checkboxes below)

[illegible]

| SAMPLE TYPE CODES |  | RELINQUISHED BY | DATE & TIME         | RECEIVED BY                                                                                                | DATE & TIME        |
|-------------------|--|-----------------|---------------------|------------------------------------------------------------------------------------------------------------|--------------------|
| B - Bulk sample   |  | Jose Hernandez  | 12/31/2025 12:38 PM |  Renee Reyes, Analyst | 12/31/2025 3:04 PM |
|                   |  |                 |                     |                                                                                                            |                    |
|                   |  |                 |                     |                                                                                                            |                    |
|                   |  |                 |                     |                                                                                                            |                    |

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at:

<https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/>

Copyright © 2024 Eurofins EPK Built Environment Testing, LLC

Doc. #1192, Rev 35, Revised 6/6/24, Page 1 of 1, QA



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

Table with 1 column: EMLab ID. Value: 4360804

REQUESTED SERVICES
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697) Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Mathew Watson Special Instructions: Stop analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Project Zip Code: 95820 Sampling Date & Time: 12/20/2025 07:00 AM
PO Number: 25-7963 Sampled By: Jose Hernandez

TURN AROUND TIME CODES (TAT)
STD - Standard (DEFAULT)
ND - Next Business Day
SD - Same Business Day Rush
WH - Weekend / Holiday
Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Table with 7 columns: Sample ID, Description, Sample Type (Below), TAT (Above), Volume / Area (as applicable), ISO Class (as applicable), Notes (Time of day, Temp, RH, etc.)

Table for Asbestos PLM with 10 columns and 10 rows of checkboxes.

SAMPLE TYPE CODES
B - Bulk sample

RELINQUISHED BY
Jose Hernandez

DATE & TIME
12/31/2025 12:38 PM

RECEIVED BY
Renee Reyes, Analyst

DATE & TIME
12/31/2025 3:04 PM



Built Environment Testing



ENTEK  
CONSULTING GROUP, INC.

Report for:

**Jose Hernandez, Mathew Watson**  
**Entek Consulting Group**  
3435 American River Drive  
Suite C  
Sacramento, CA 95864

---

Regarding: Eurofins Built Environment Testing West, LLC  
Project: 25-7963; Sacramento City USD - Earl Warren Elementary School  
EML ID: 4371623

Approved by:

Dates of Analysis:  
Asbestos PLM: 01-12-2026 and 01-13-2026

Approved Signatory  
James Schatz

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EB-AS-S-1267)  
NVLAP Lab Code 600255-0

---

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins Built Environment Testing West, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 01-11-2026

Date of Receipt: 01-12-2026

Date of Report: 01-15-2026

**ASBESTOS PLM REPORT****Total Samples Submitted:** 30**Total Samples Analyzed:** 29**Total Samples with Layer Asbestos Content > 1%:** 1**Location: ECG-25-7963-158A, White Asphalt Roofing - Building with Classrooms 14-17,  
Southeast Side**

Lab ID-Version#: 21907239-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| Black/White Roofing Material           | ND                               |
| White Compound                         | ND                               |
| Brown Fibrous Material                 | ND                               |
| Brown Wood                             | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 40% Cellulose<br>5% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

**Location: ECG-25-7963-158B, White Asphalt Roofing - Building with Classrooms 9-12,  
Northwest Side**

Lab ID-Version#: 21907240-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| Black/White Roofing Material           | ND                               |
| Brown Wood                             | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>5% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

**Location: ECG-25-7963-158C, White Asphalt Roofing - Building with Classrooms 5-8,  
North Side**

Lab ID-Version#: 21907241-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| Black/White Roofing Material           | ND                               |
| Brown Fibrous Material                 | ND                               |
| Brown Wood                             | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 40% Cellulose<br>5% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 01-11-2026

Date of Receipt: 01-12-2026

Date of Report: 01-15-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-158D, White Asphalt Roofing - Building with Classrooms 1-4,  
North Side**

Lab ID-Version‡: 21907242-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| Black/White Roofing Material           | ND                               |
| Brown Fibrous Material                 | ND                               |
| Brown Wood                             | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 40% Cellulose<br>5% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

**Location: ECG-25-7963-158E, White Asphalt Roofing - MPR Building, South Side**

Lab ID-Version‡: 21907243-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| Black/White Roofing Material           | ND                               |
| Brown Fibrous Material                 | ND                               |
| Brown Wood                             | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 40% Cellulose<br>5% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

**Location: ECG-25-7963-159A, White and Black Penetration Mastic - MPR Building,  
Southwest Side**

Lab ID-Version‡: 21907244-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Black/White Mastic                   | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-159B, White and Black Penetration Mastic - Building with  
Classrooms 5-8, West Side**

Lab ID-Version‡: 21907245-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Black/White Mastic                   | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 01-11-2026

Date of Receipt: 01-12-2026

Date of Report: 01-15-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-159C, White and Black Penetration Mastic - Building with  
Classrooms 1-4, Northeast Side**

Lab ID-Version‡: 21907246-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Black/White Mastic                 | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-159D, White and Black Penetration Mastic - Building with  
Classrooms 9-12, Near Center Side**

Lab ID-Version‡: 21907247-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Black/White Mastic                 | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-159E, White and Black Penetration Mastic - Building with  
Classrooms 14-17, Near Center Side**

Lab ID-Version‡: 21907248-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Black/White Mastic                 | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-160A, Gray Flashing Mastic - Southeast Side of Admin Bldg.**

Lab ID-Version‡: 21907249-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Mastic                        | ND               |
| Sample Composite Homogeneity: Good |                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 01-11-2026

Date of Receipt: 01-12-2026

Date of Report: 01-15-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-160B, Gray Flashing Mastic - Northeast Side of Building with  
Classrooms 14-17**

Lab ID-Version‡: 21907250-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray Mastic                        | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-161A, Gray-Red Coated Black Tar - Flashing Transition  
between Roof and Stucco Wall, East Side of Building with Classrooms 9-12**

Lab ID-Version‡: 21907251-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray/Black Tar                     | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-161B, Gray-Red Coated Black Tar - Flashing Transition  
between Roof and Stucco Wall, East Side of Building with Classrooms 9-12**

Lab ID-Version‡: 21907252-1

| Sample Layers                      | Asbestos Content |
|------------------------------------|------------------|
| Gray/Black Tar                     | ND               |
| Sample Composite Homogeneity: Good |                  |

**Location: ECG-25-7963-162A, White Single Ply Roofing - Northeast Side of Portable 22**

Lab ID-Version‡: 21907253-1

| Sample Layers                      | Asbestos Content                 |
|------------------------------------|----------------------------------|
| Gray Semi-Fibrous Material         | ND                               |
| White Drywall with Brown Paper     | ND                               |
| Composite Non-Asbestos Content:    | 15% Cellulose<br>5% Glass Fibers |
| Sample Composite Homogeneity: Good |                                  |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 01-11-2026

Date of Receipt: 01-12-2026

Date of Report: 01-15-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-162B, White Single Ply Roofing - Northwest Side of Portable 22**

Lab ID-Version‡: 21907254-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| Gray Semi-Fibrous Material             | ND                               |
| White Drywall with Brown Paper         | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose<br>5% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

**Location: ECG-25-7963-163A, White Single Ply Roofing - North Side of Portable 23**

Lab ID-Version‡: 21907255-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| Gray Semi-Fibrous Material             | ND                               |
| White Drywall with Brown Paper         | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 15% Cellulose<br>5% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

**Location: ECG-25-7963-163B, White Single Ply Roofing - North Side of Portable 24**

Lab ID-Version‡: 21907256-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| Gray Semi-Fibrous Material             | ND                               |
| White Drywall with Brown Paper         | ND                               |
| Brown Wood                             | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 25% Cellulose<br>5% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 01-11-2026

Date of Receipt: 01-12-2026

Date of Report: 01-15-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-164A, White Single Ply Roofing - West Side of Portables A1-A3**

Lab ID-Version‡: 21907257-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| Gray Semi-Fibrous Material             | ND                               |
| White Drywall with Brown Paper         | ND                               |
| Brown Wood                             | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 25% Cellulose<br>5% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

**Location: ECG-25-7963-164B, White Single Ply Roofing - West Side of Portables A1-A3**

Lab ID-Version‡: 21907258-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| Gray Semi-Fibrous Material             | ND                               |
| White Drywall with Brown Paper         | ND                               |
| Brown Wood                             | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 25% Cellulose<br>5% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

**Location: ECG-25-7963-165A, White Asphalt Roofing - South Side of Portable A4**

Lab ID-Version‡: 21907259-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| Black/White Roofing Material           | ND                               |
| Brown Fibrous Material                 | ND                               |
| Brown Wood                             | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 40% Cellulose<br>5% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 01-11-2026

Date of Receipt: 01-12-2026

Date of Report: 01-15-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-165B, White Asphalt Roofing - North Side of Portable A4**

Lab ID-Version‡: 21907260-1

| Sample Layers                          | Asbestos Content                 |
|----------------------------------------|----------------------------------|
| Black/White Roofing Material           | ND                               |
| Brown Fibrous Material                 | ND                               |
| Brown Wood                             | ND                               |
| <b>Composite Non-Asbestos Content:</b> | 40% Cellulose<br>5% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                             |

**Location: ECG-25-7963-166A, Penetration Mastic - Southwest Side of Portable A4**

Lab ID-Version‡: 21907261-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Black/White Mastic                   | 4% Chrysotile    |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Comments:** 166b was not analyzed due to prior positive series.**Location: ECG-25-7963-167A, Twelve inch Nailed-on Ceiling Tiles with Pinholes - South Side of Portable A4**

Lab ID-Version‡: 21907263-1

| Sample Layers                          | Asbestos Content                  |
|----------------------------------------|-----------------------------------|
| Beige Ceiling Tile with White Surface  | ND                                |
| <b>Composite Non-Asbestos Content:</b> | 30% Cellulose<br>20% Glass Fibers |
| <b>Sample Composite Homogeneity:</b>   | Good                              |

**Location: ECG-25-7963-167B, Twelve inch Nailed-on Ceiling Tiles with Pinholes - Southwest Side of Portable A4**

Lab ID-Version‡: 21907264-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Brown Ceiling Tile with White Surface  | ND               |
| <b>Composite Non-Asbestos Content:</b> | 75% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 01-11-2026

Date of Receipt: 01-12-2026

Date of Report: 01-15-2026

**ASBESTOS PLM REPORT****Location: ECG-25-7963-168A, Drywall with Joint Compound - HVAC Closet inside****Portable A4**

Lab ID-Version‡: 21907265-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Joint Compound               | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-168B, Drywall with Joint Compound - HVAC Closet inside****Portable A4**

Lab ID-Version‡: 21907266-1

| Sample Layers                          | Asbestos Content |
|----------------------------------------|------------------|
| Off-White Joint Compound               | ND               |
| White Drywall with Brown Paper         | ND               |
| <b>Composite Non-Asbestos Content:</b> | 10% Cellulose    |
| <b>Sample Composite Homogeneity:</b>   | Good             |

**Location: ECG-25-7963-169A, Gray Window Caulking - Northeast Side of Building with  
Classrooms 1-4**

Lab ID-Version‡: 21907267-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Caulk                           | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

**Location: ECG-25-7963-169B, Gray Window Caulking - Northeast Side of Building with  
Classrooms 5-8**

Lab ID-Version‡: 21907268-1

| Sample Layers                        | Asbestos Content |
|--------------------------------------|------------------|
| Gray Caulk                           | ND               |
| <b>Sample Composite Homogeneity:</b> | Good             |

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

All components not quantified as asbestos content and non-asbestos content are considered to be non-fibrous matrix components. Matrix components may include, but are not limited to, gypsum, paint, silicate minerals, vinyl, binder, calcium carbonate, tar, and foam.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 01-11-2026  
Date of Receipt: 01-12-2026  
Date of Report: 01-15-2026

**ASBESTOS PLM REPORT**

|                                    |    |
|------------------------------------|----|
| <b>Total Samples Submitted:</b>    | 30 |
| <b>Total Samples Analyzed:</b>     | 29 |
| <b>Total Samples Not Analyzed:</b> | 1  |

**ECG-25-7963-166B, Penetration Mastic - Northwest Side of Portable A4**      Lab ID-Version‡: 21907262-0

|                     |                      |
|---------------------|----------------------|
| <b>NOT ANALYZED</b> | <b>POSITIVE STOP</b> |
|---------------------|----------------------|

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Sample results described as "Positive Stop" were not analyzed because the previous sample layer(s) contained asbestos >1%. Sample results described as "Sample Bag Empty" were not analyzed because while the sample bag was submitted it did not contain a discernible sample. Sample results described as "No Sample Submitted" were not analyzed because the sample bag was not submitted with the project. Sample results described as "Insufficient Sample" were not analyzed because while the sample was submitted for analysis, there was insufficient material present to analyze the sample confidently. Sample results described as "Per Client Request" were submitted to the laboratory but not analyzed because the laboratory was requested to hold the sample.

**Eurofins Built Environment Testing West, LLC**

180 Blue Ravine Rd, Folsom, CA 95630  
(833) 465-5857 [www.eurofinsus.com/Built](http://www.eurofinsus.com/Built)

Client: Entek Consulting Group  
C/O: Jose Hernandez, Mathew Watson  
Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 01-11-2026

Date of Receipt: 01-12-2026

Date of Report: 01-15-2026

**ASBESTOS PLM REPORT**

**PROJECT ANALYST AND SIGNATORY REPORT**

---

**Project Analyst**



---

**Analyst:** Samantha Pierce

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".



| Weather |          | Fog                                 | Rain                                | Snow                                | Wind                                | Clear                    |
|---------|----------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| Level   | None     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
|         | Light    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Moderate | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Heavy    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |

**New Jersey:** 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984  
**Phoenix, AZ:** 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802  
**Burlingame, CA:** 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

| EMLab ID |
|----------|
| 4371623  |

| REQUESTED SERVICES<br>(Use checkboxes below) |                          |                          |                          |                          |                          |
|----------------------------------------------|--------------------------|--------------------------|--------------------------|--------------------------|--------------------------|
| Asbestos PLM                                 |                          |                          |                          |                          |                          |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |

| CONTACT INFORMATION  |                                                                                                                          |                            |                                                                                                                                                                                         |                              |                |                                                                                                                                                    |                              |                                     |  |  |
|----------------------|--------------------------------------------------------------------------------------------------------------------------|----------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------|-------------------------------------|--|--|
| Company:             | Entek Consulting Group (9697)                                                                                            |                            | Address: 3435 American River Drive Suite C Sacramento, CA 95864                                                                                                                         |                              |                |                                                                                                                                                    |                              |                                     |  |  |
| Contact:             | Jose Hernandez, Mathew Watson                                                                                            |                            | Special Instructions: Stop Analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series. |                              |                |                                                                                                                                                    |                              |                                     |  |  |
| Phone:               | 916-824-5580                                                                                                             |                            |                                                                                                                                                                                         |                              |                |                                                                                                                                                    |                              |                                     |  |  |
| PROJECT INFORMATION  |                                                                                                                          |                            |                                                                                                                                                                                         | TURN AROUND TIME CODES (TAT) |                |                                                                                                                                                    |                              |                                     |  |  |
| Project ID:          | 25-7963                                                                                                                  |                            |                                                                                                                                                                                         | STD – Standard (DEFAULT)     |                | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |                              |                                     |  |  |
| Project Description: | Sacramento City USD - Earl Warren Elementary School                                                                      |                            |                                                                                                                                                                                         | ND – Next Business Day       |                |                                                                                                                                                    |                              |                                     |  |  |
| Project Zip Code:    | 95820                                                                                                                    | Sampling Date & Time:      | 01/11/2026 11:00 AM                                                                                                                                                                     | SD – Same Business Day Rush  |                |                                                                                                                                                    |                              |                                     |  |  |
| PO Number:           | 25-7963                                                                                                                  | Sampled By: Jose Hernandez |                                                                                                                                                                                         | WH – Weekend / Holiday       |                |                                                                                                                                                    |                              |                                     |  |  |
| Sample ID            | Description                                                                                                              |                            |                                                                                                                                                                                         | Sample Type<br>(Below)       | TAT<br>(Above) | Volume / Area<br>(as applicable)                                                                                                                   | ISO Class<br>(as applicable) | Notes (Time of day, Temp, RH, etc.) |  |  |
| ECG-25-7963-160B     | Gray Flashing Mastic - Northeast Side of Building with Classrooms 1-17                                                   |                            |                                                                                                                                                                                         | B                            | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-161A     | Gray-Red Coated Black Tar - Flashing Transition between Roof and Stucco Wall, East Side of Building with Classrooms 9-12 |                            |                                                                                                                                                                                         | B                            | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-161B     | Gray-Red Coated Black Tar - Flashing Transition between Roof and Stucco Wall, East Side of Building with Classrooms 9-12 |                            |                                                                                                                                                                                         | B                            | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-162A     | White Single Ply Roofing - Northeast Side of Portable 22                                                                 |                            |                                                                                                                                                                                         | B                            | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-162B     | White Single Ply Roofing - Northwest Side of Portable 22                                                                 |                            |                                                                                                                                                                                         | B                            | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-163A     | White Single Ply Roofing - North Side of Portable 23                                                                     |                            |                                                                                                                                                                                         | B                            | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-163B     | White Single Ply Roofing - North Side of Portable 24                                                                     |                            |                                                                                                                                                                                         | B                            | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-164A     | White Single Ply Roofing - West Side of Portables A1-A3                                                                  |                            |                                                                                                                                                                                         | B                            | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-164B     | White Single Ply Roofing - West Side of Portables A1-A3                                                                  |                            |                                                                                                                                                                                         | B                            | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-165A     | White Asphalt Roofing - South Side of Portable A4                                                                        |                            |                                                                                                                                                                                         | B                            | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-165B     | White Asphalt Roofing - North Side of Portable A4                                                                        |                            |                                                                                                                                                                                         | B                            | STD            | N/A                                                                                                                                                |                              |                                     |  |  |

| SAMPLE TYPE CODES |  | RELINQUISHED BY | DATE & TIME        | RECEIVED BY              | DATE & TIME        |
|-------------------|--|-----------------|--------------------|--------------------------|--------------------|
| B - Bulk sample   |  | Jose Hernandez  | 1/12/2026 10:32 AM | <br>Renee Reyes, Analyst | 1/12/2026 10:39 AM |
|                   |  |                 |                    |                          |                    |
|                   |  |                 |                    |                          |                    |



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857

Table with 6 columns: Weather, Fog, Rain, Snow, Wind, Clear. Includes a Level section with options: None, Light, Moderate, Heavy.

Table with 2 columns: EMLab ID, 4371623

REQUESTED SERVICES
(Use checkboxes below)

CONTACT INFORMATION
Company: Entek Consulting Group (9697) Address: 3435 American River Drive Suite C Sacramento, CA 95864
Contact: Jose Hernandez, Mathew Watson Special Instructions: Stop Analysis upon first positive result (1%) for sample in a series. Also stop analysis upon first positive result (1%) in the joint compound for sample series.
Phone: 916-824-5580

PROJECT INFORMATION
Project ID: 25-7963
Project Description: Sacramento City USD - Earl Warren Elementary School
Project Zip Code: 95820 Sampling Date & Time: 01/11/2026 11:00 AM
PO Number: 25-7963 Sampled By: Jose Hernandez

TURN AROUND TIME CODES (TAT)
STD - Standard (DEFAULT)
ND - Next Business Day
SD - Same Business Day Rush
WH - Weekend / Holiday

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Table with 7 columns: Sample ID, Description, Sample Type (Below), TAT (Above), Volume / Area (as applicable), ISO Class (as applicable), Notes (Time of day, Temp, RH, etc.)

Table for Asbestos PLM with 6 columns and 12 rows of checkboxes.

SAMPLE TYPE CODES
B - Bulk sample

RELINQUISHED BY
Jose Hernandez


DATE & TIME
1/12/2026 10:32 AM

RECEIVED BY
Renee Reyes, Analyst

DATE & TIME
1/12/2026 10:39 AM



# Admin Building

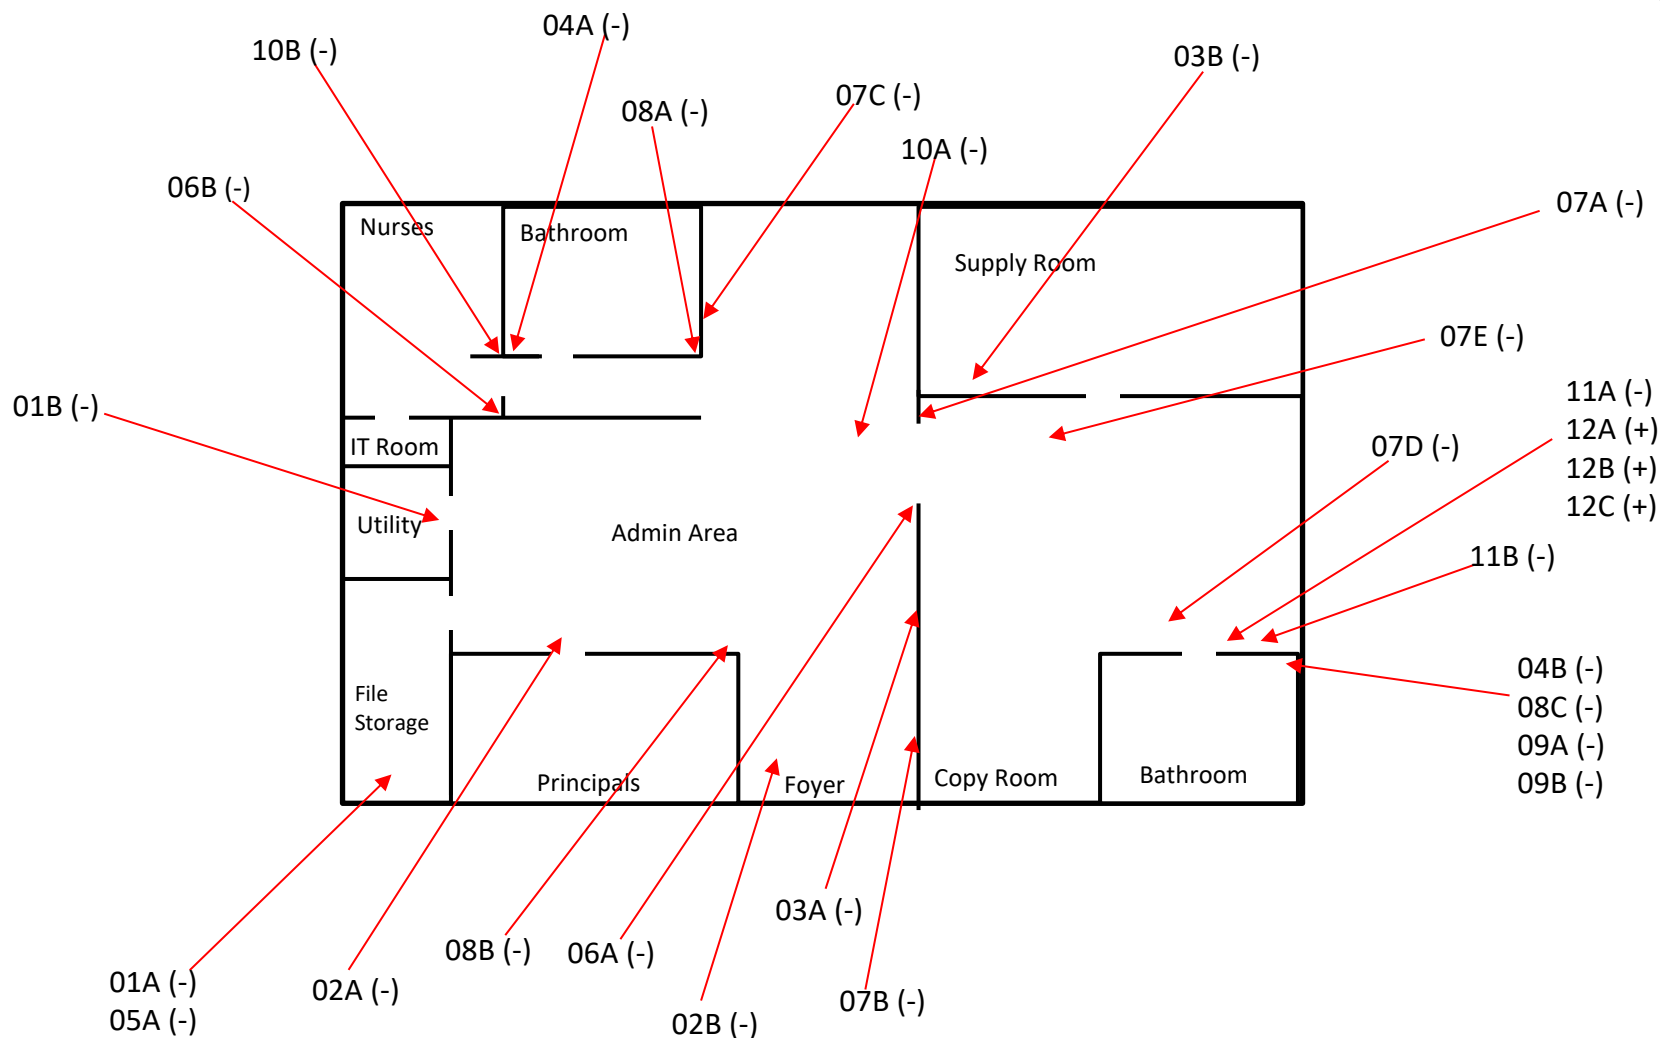


Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale

Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On November 26, 2025  
Project Number 25-7963



## Rooms 5-8

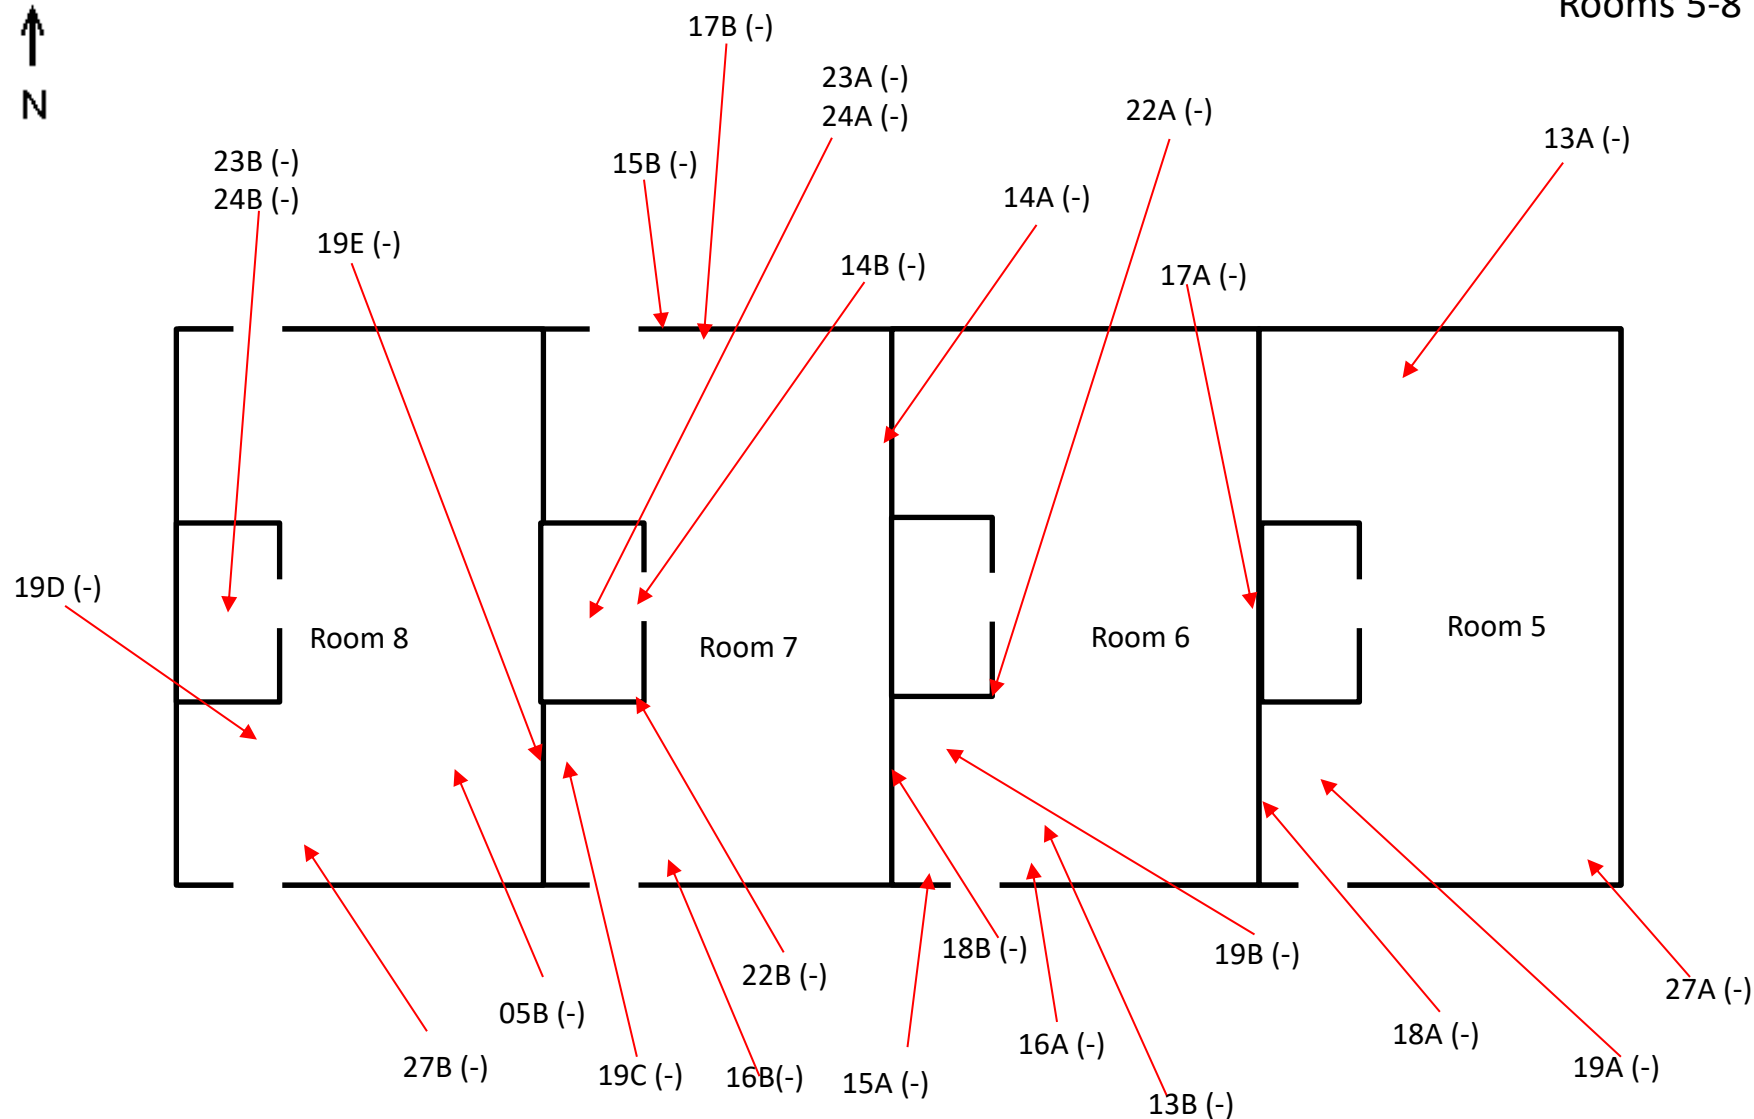


Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale

Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On November 26, 2025  
Project Number 25-7963

# Equipment Room and Restrooms

N →

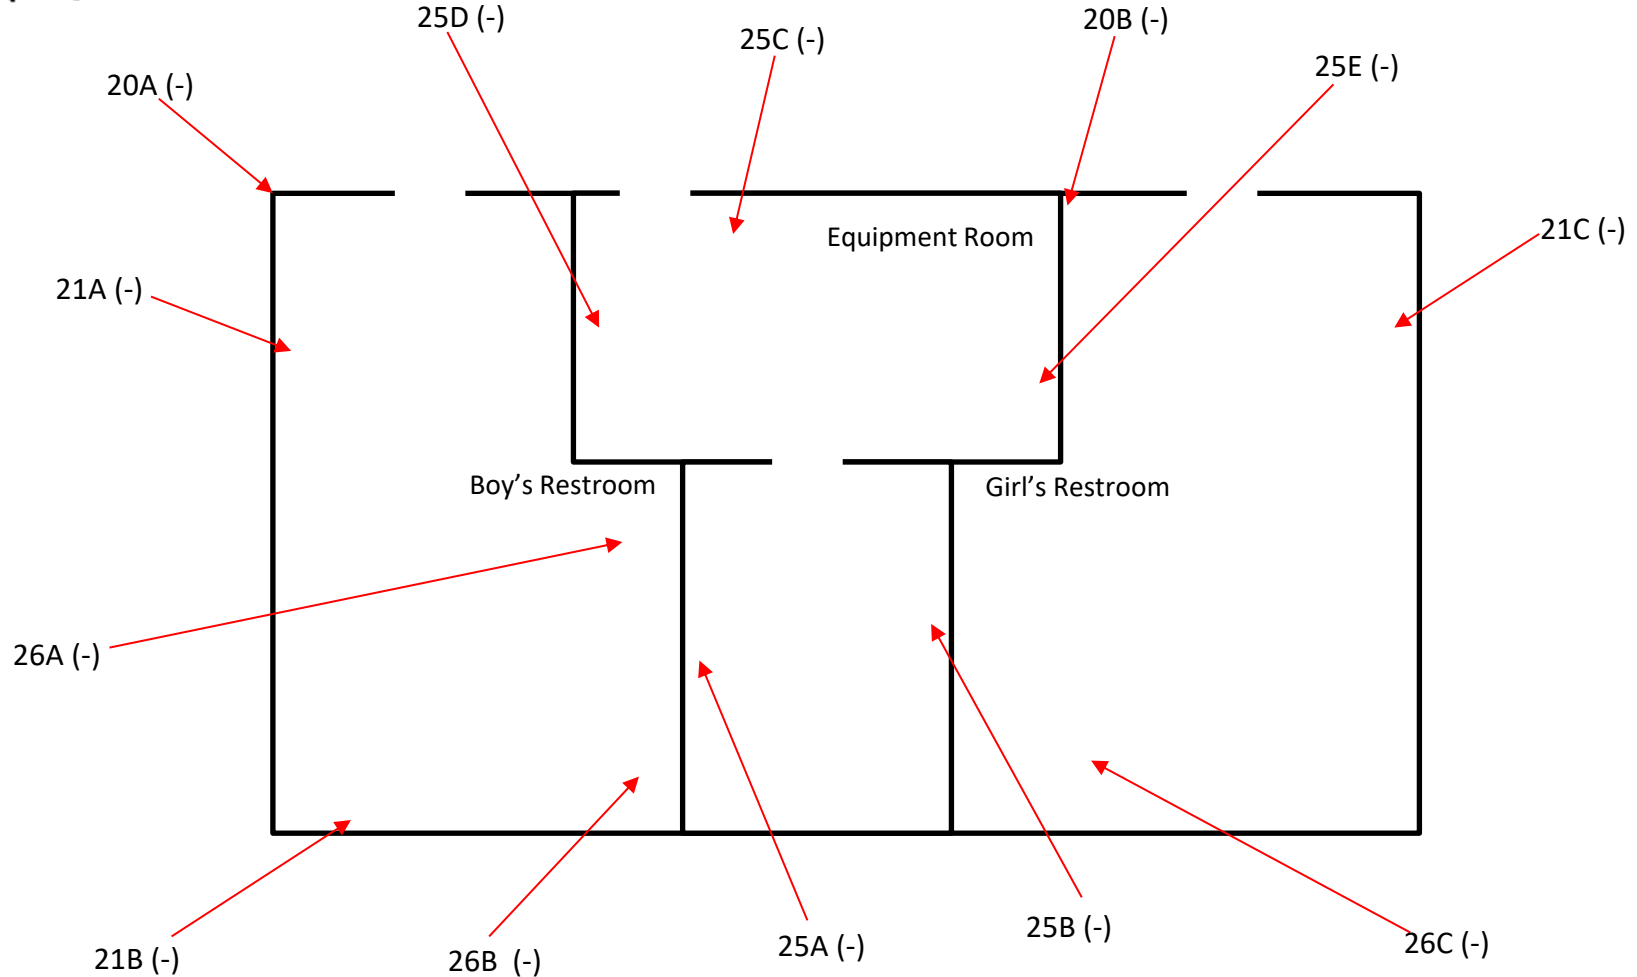


Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale

Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On November 26, 2025  
Project Number 25-7963




Rooms 1-4

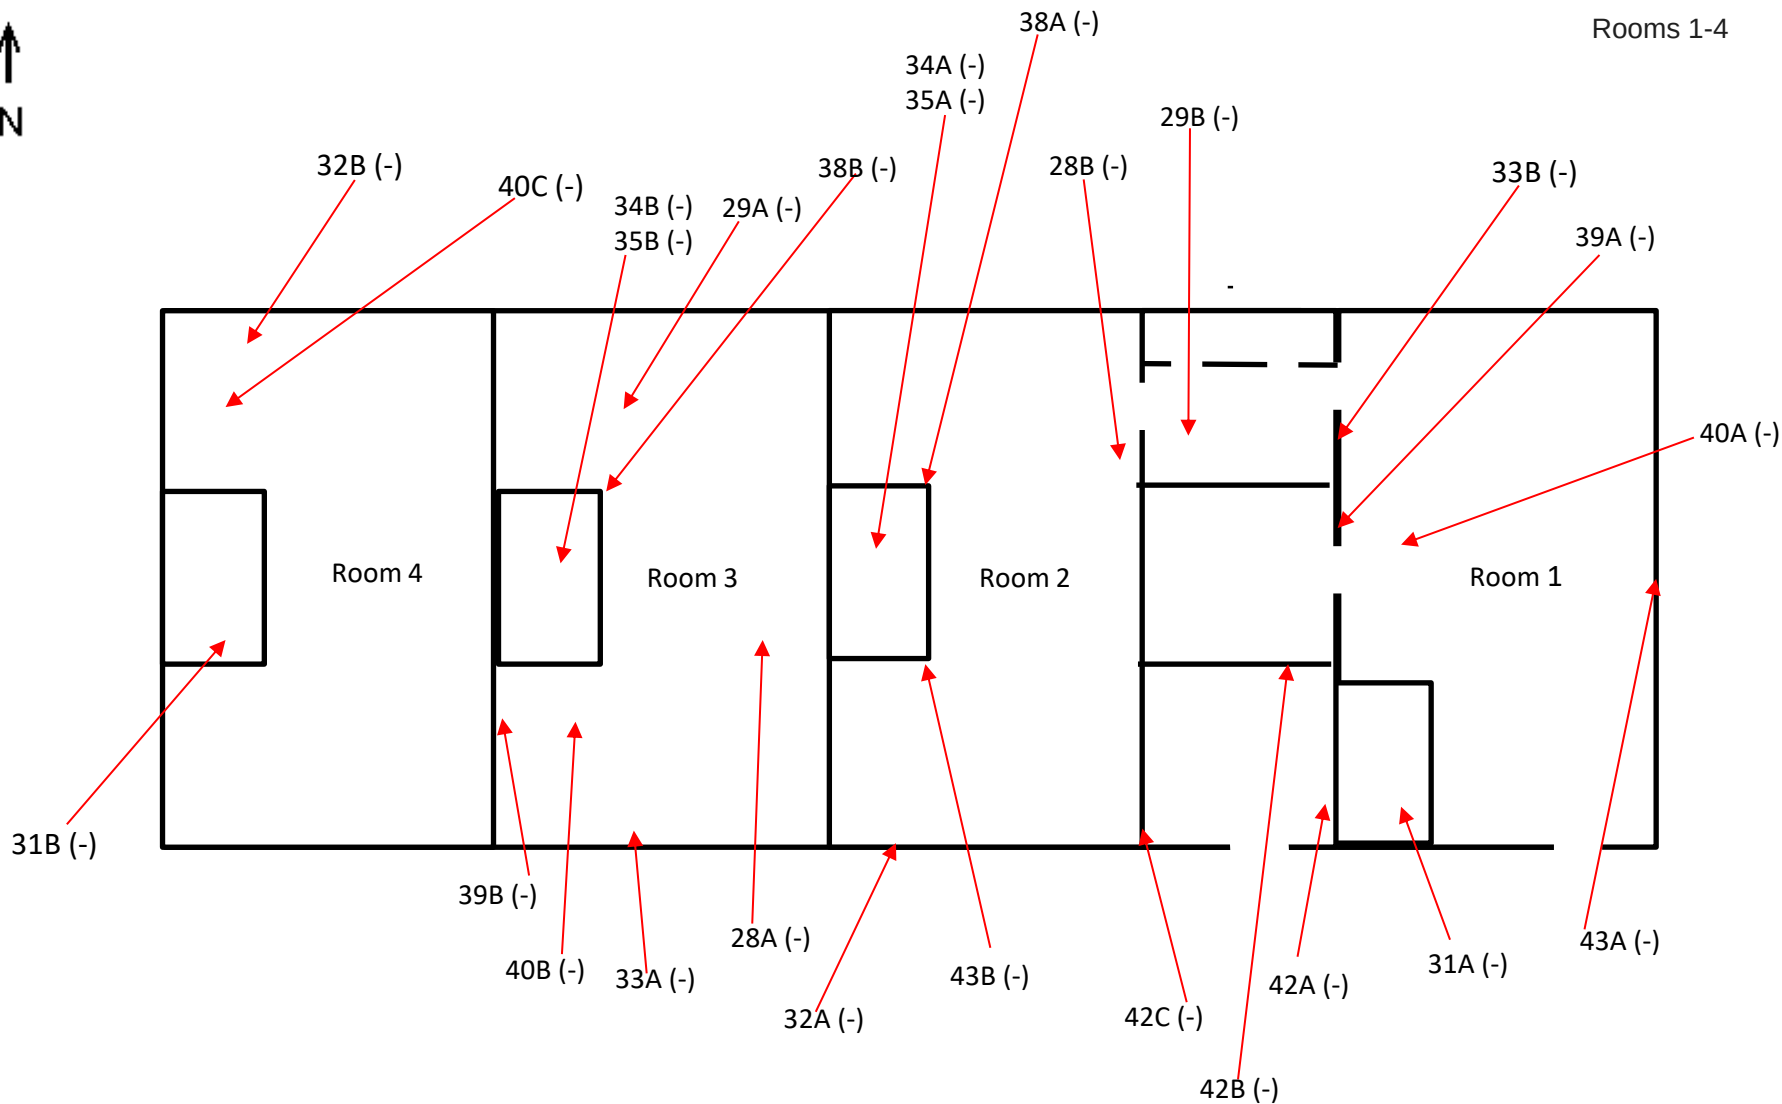

Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale


Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On November 26, 2025  
Project Number 25-7963

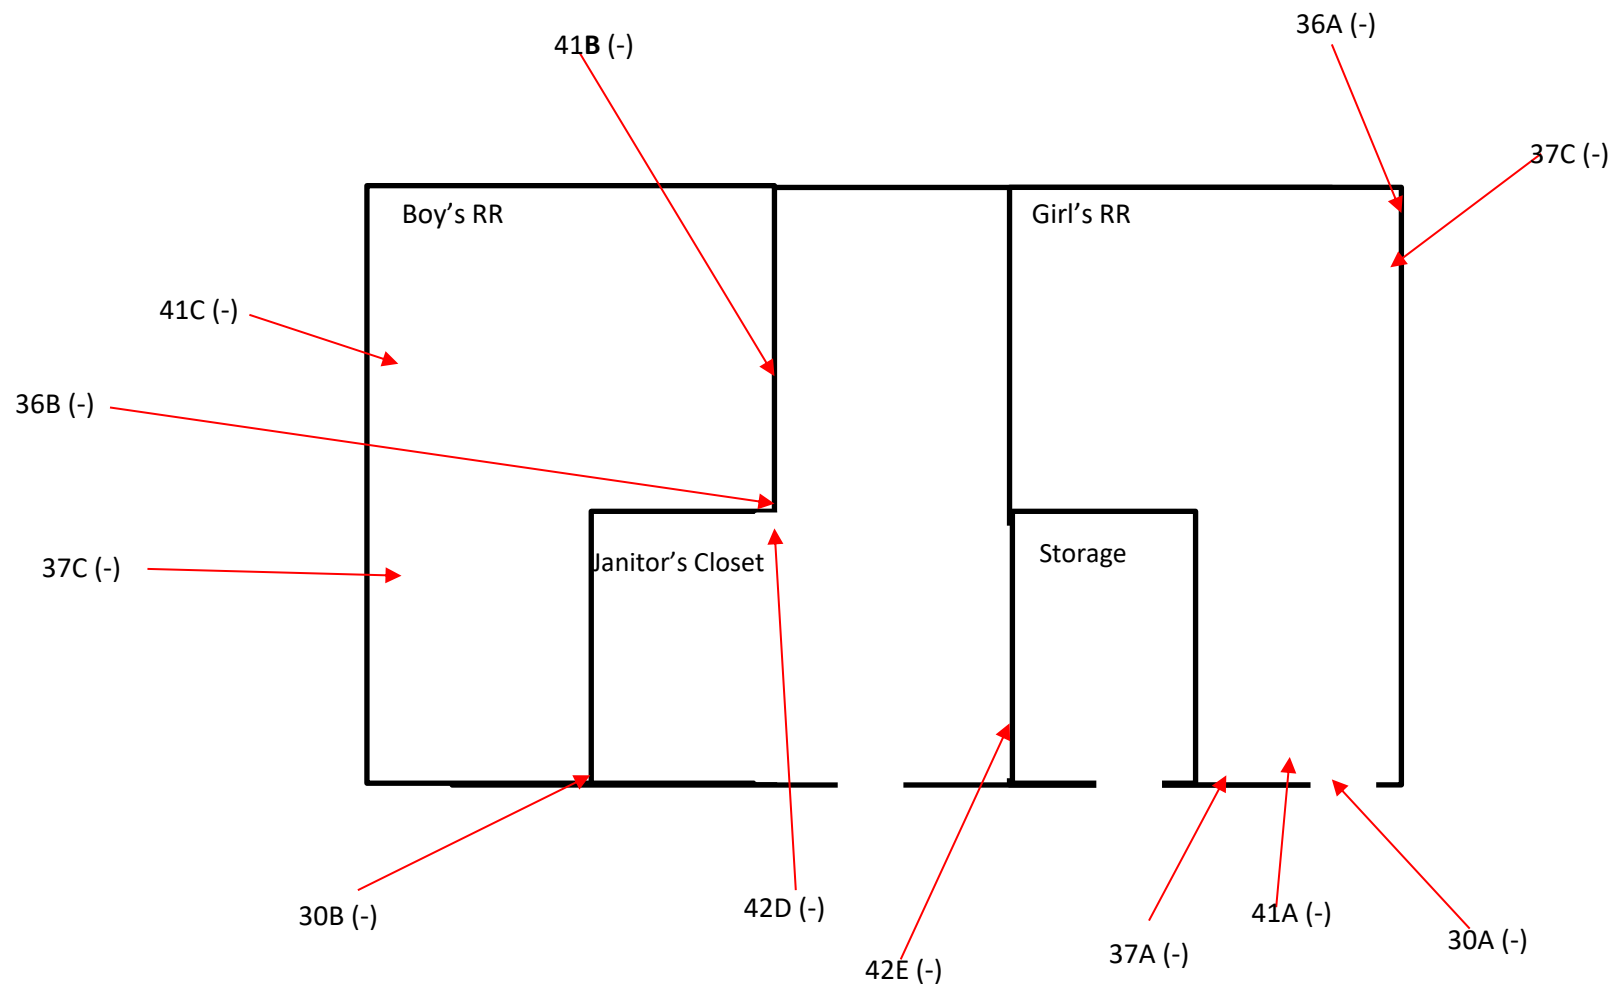


Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale

Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On November 26, 2025  
Project Number 25-7963

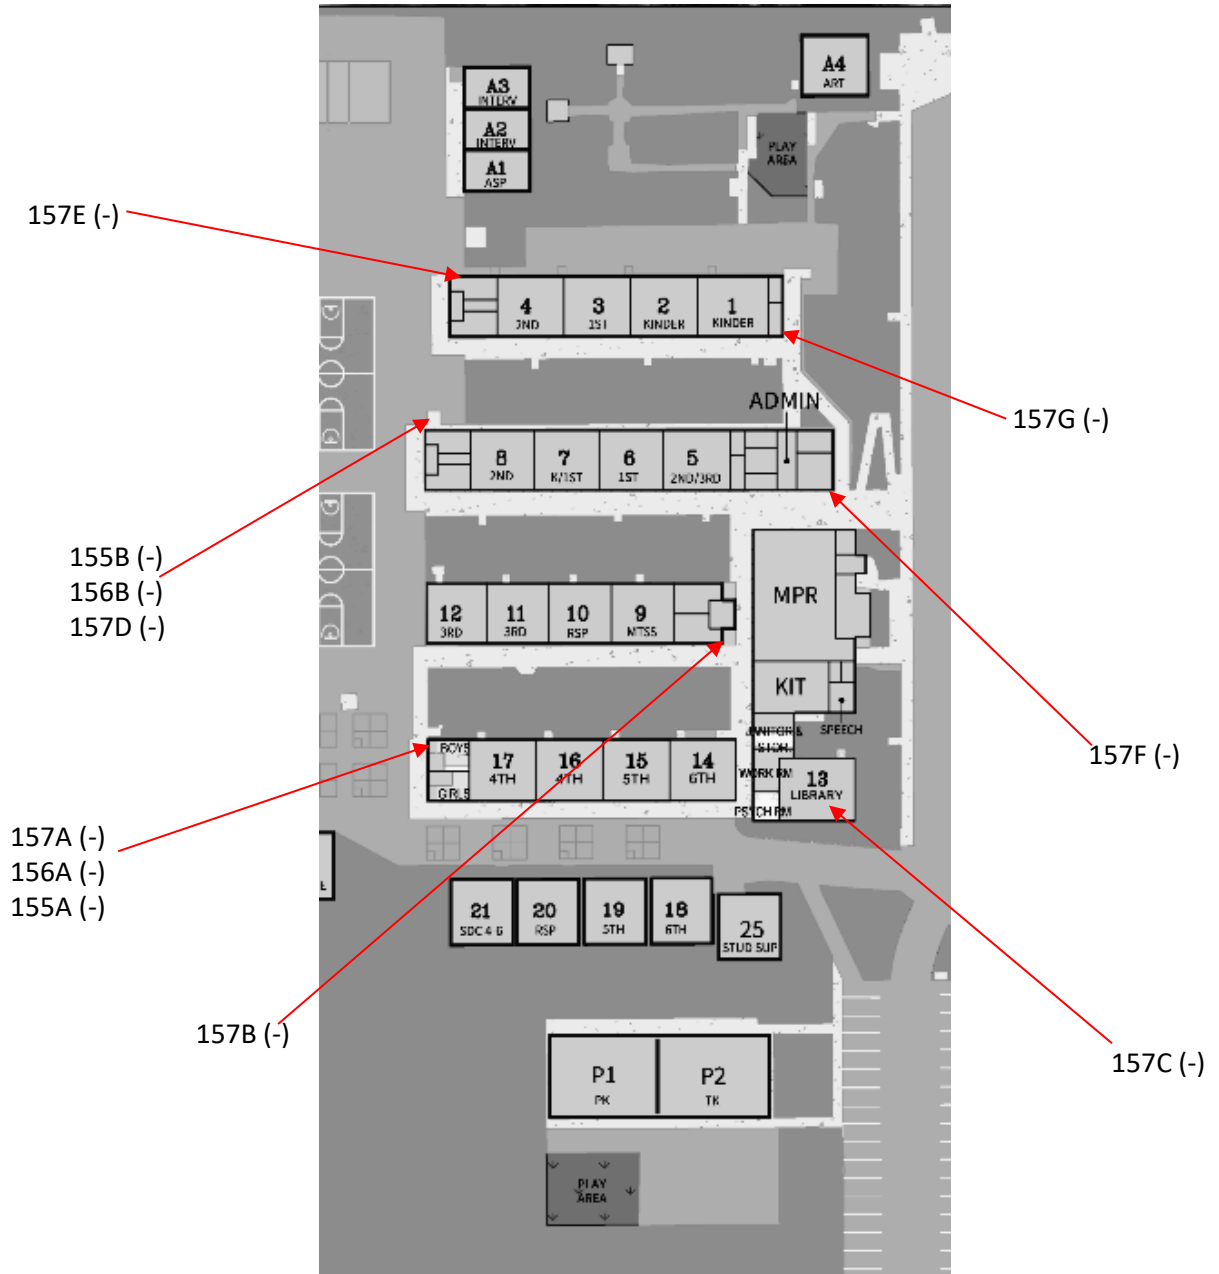

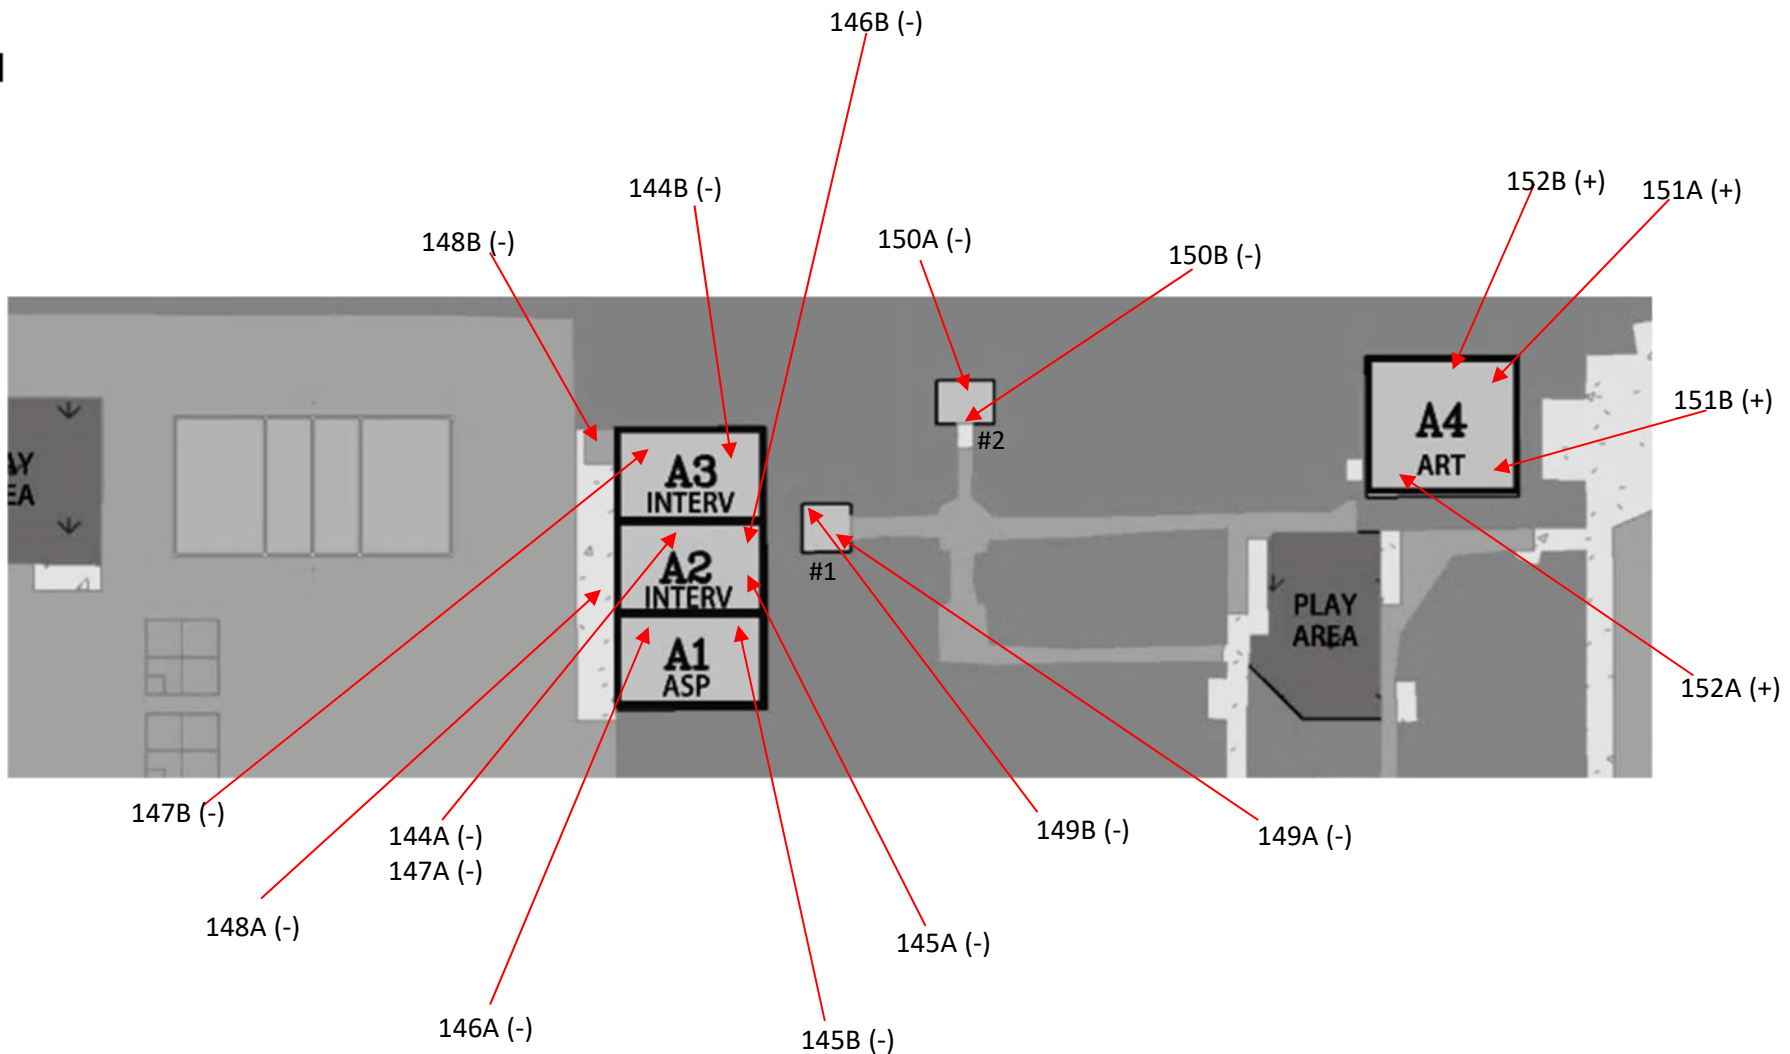


Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale

Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On December 20, 2025  
Project Number 25-7963



Rooms 9-12, Girls & Boys RR

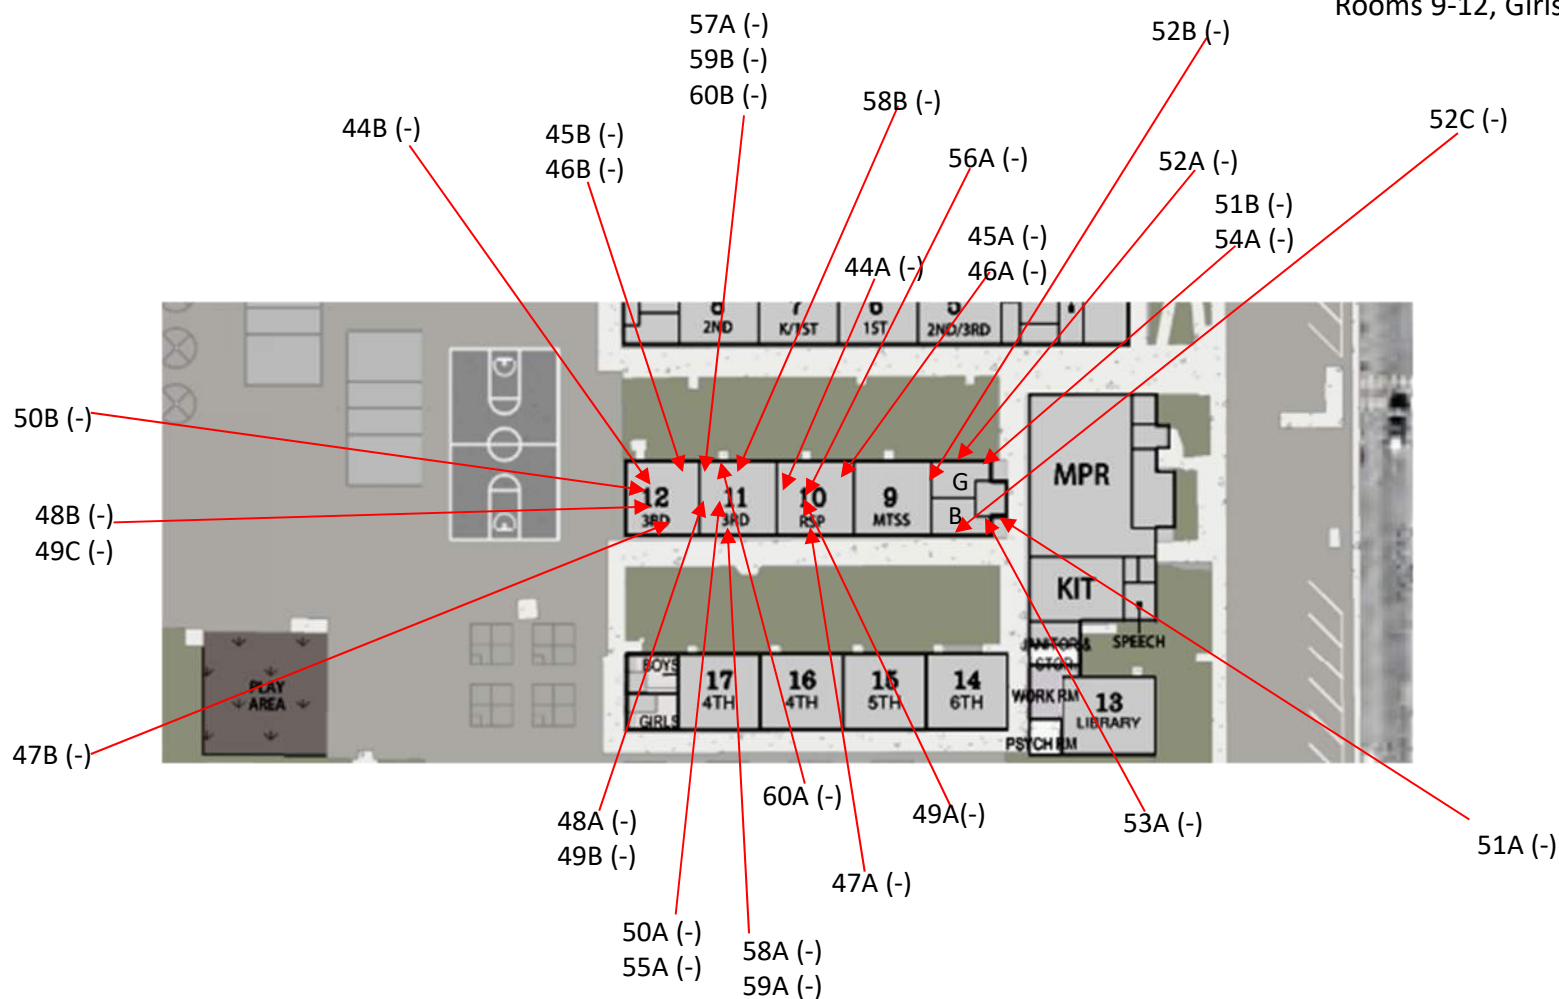


Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale

Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On December 20, 2025  
Project Number 25-7963



MPR, Kitchen, Janitors' Closet & Storage, Library, Work Room, Psych Room

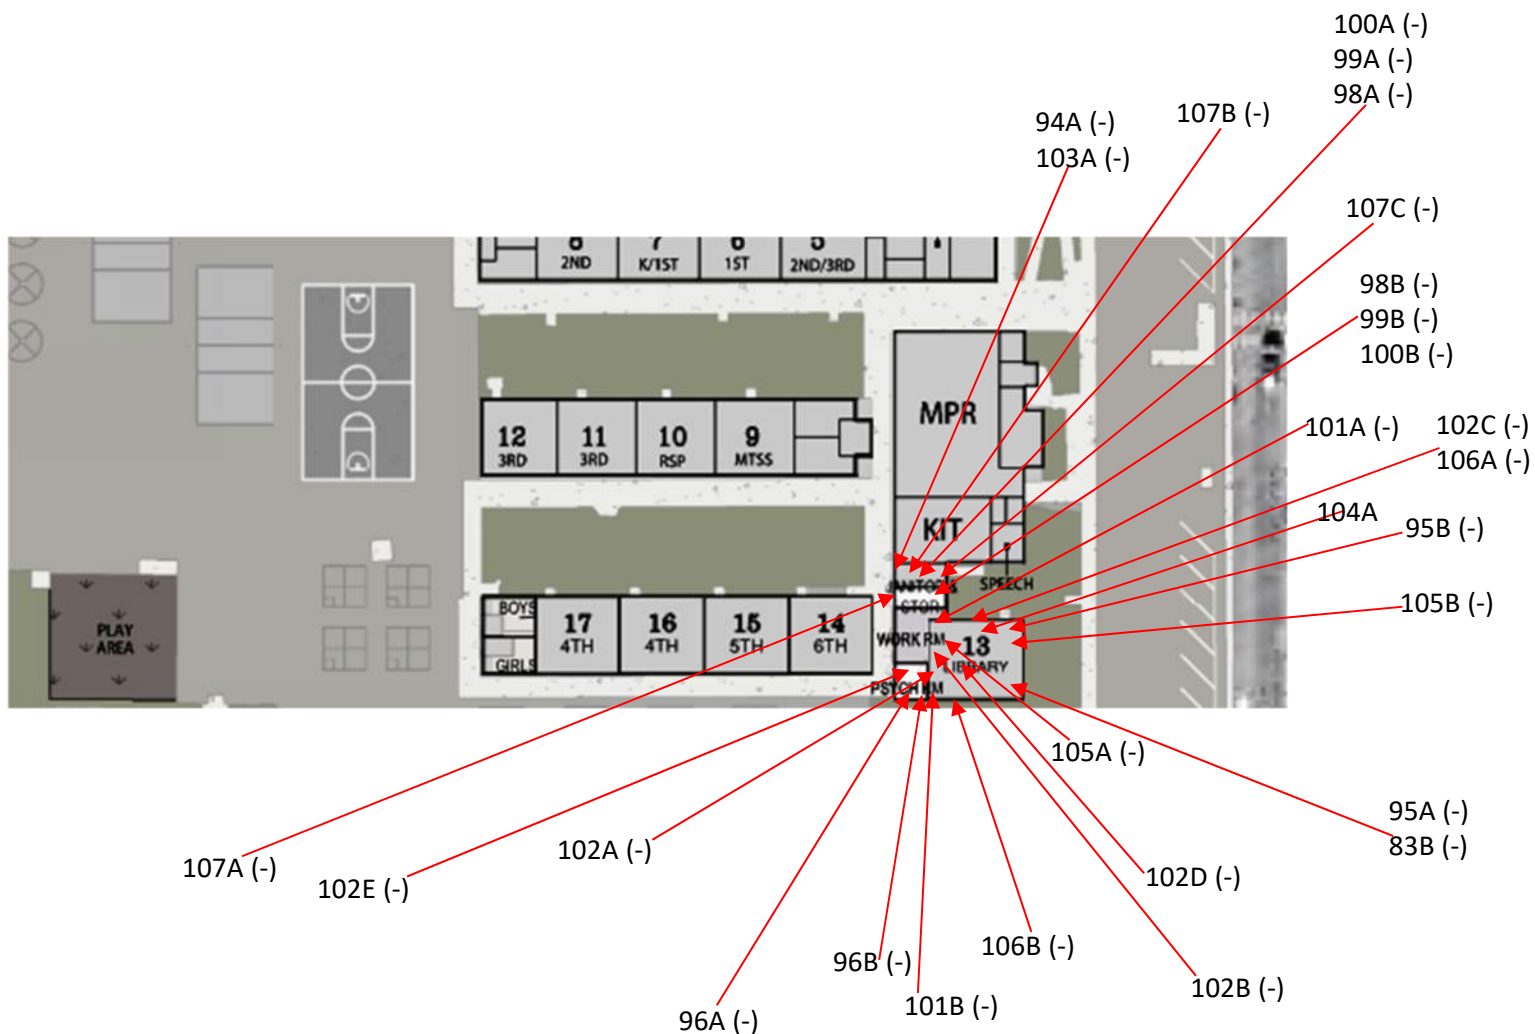


Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale

Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On December 20, 2025  
Project Number 25-7963




Rooms 14-17

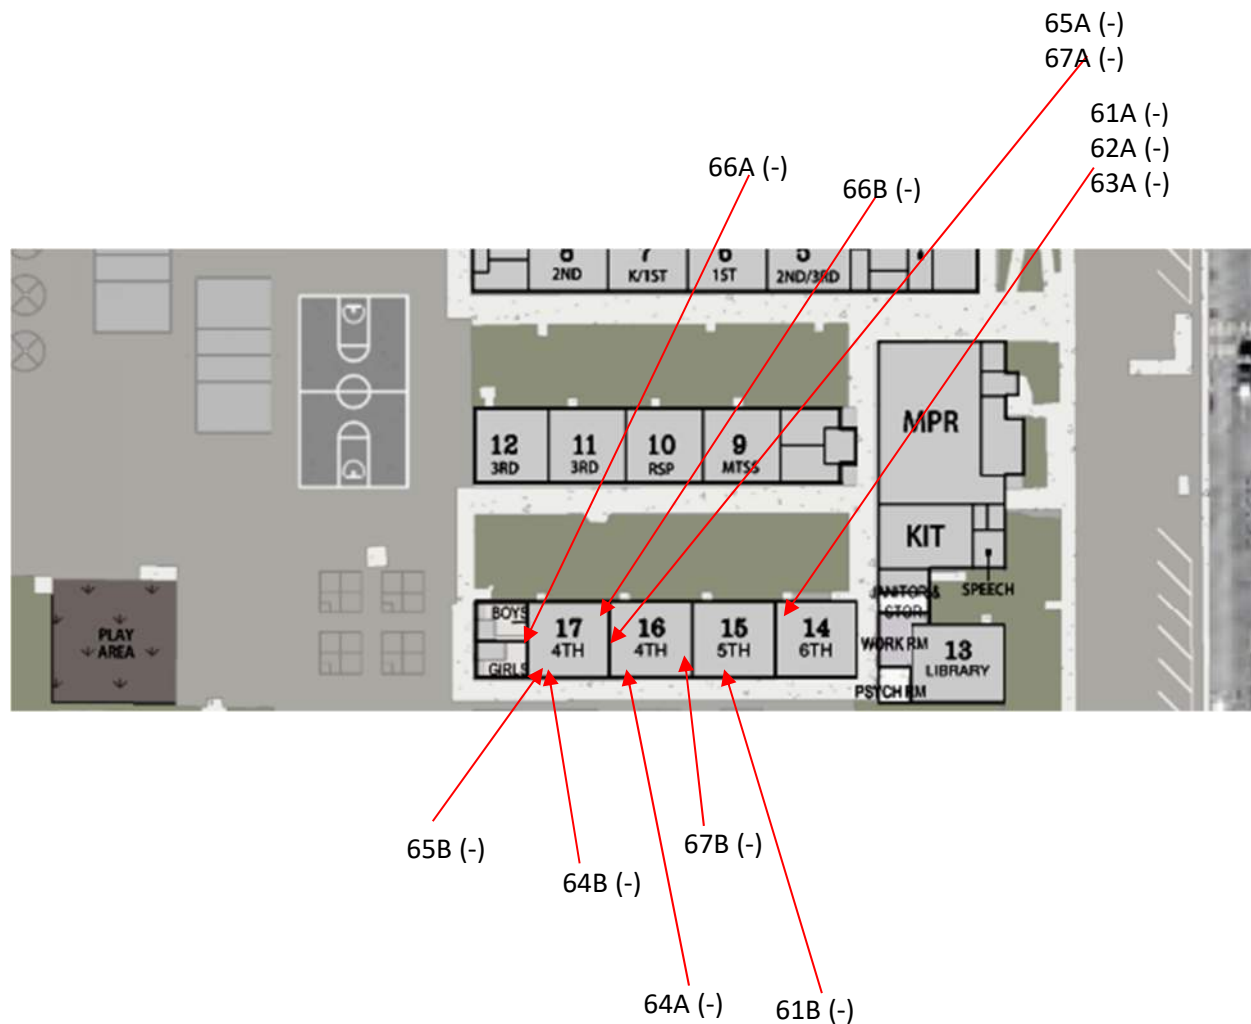

Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale


Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On December 20, 2025  
Project Number 25-7963

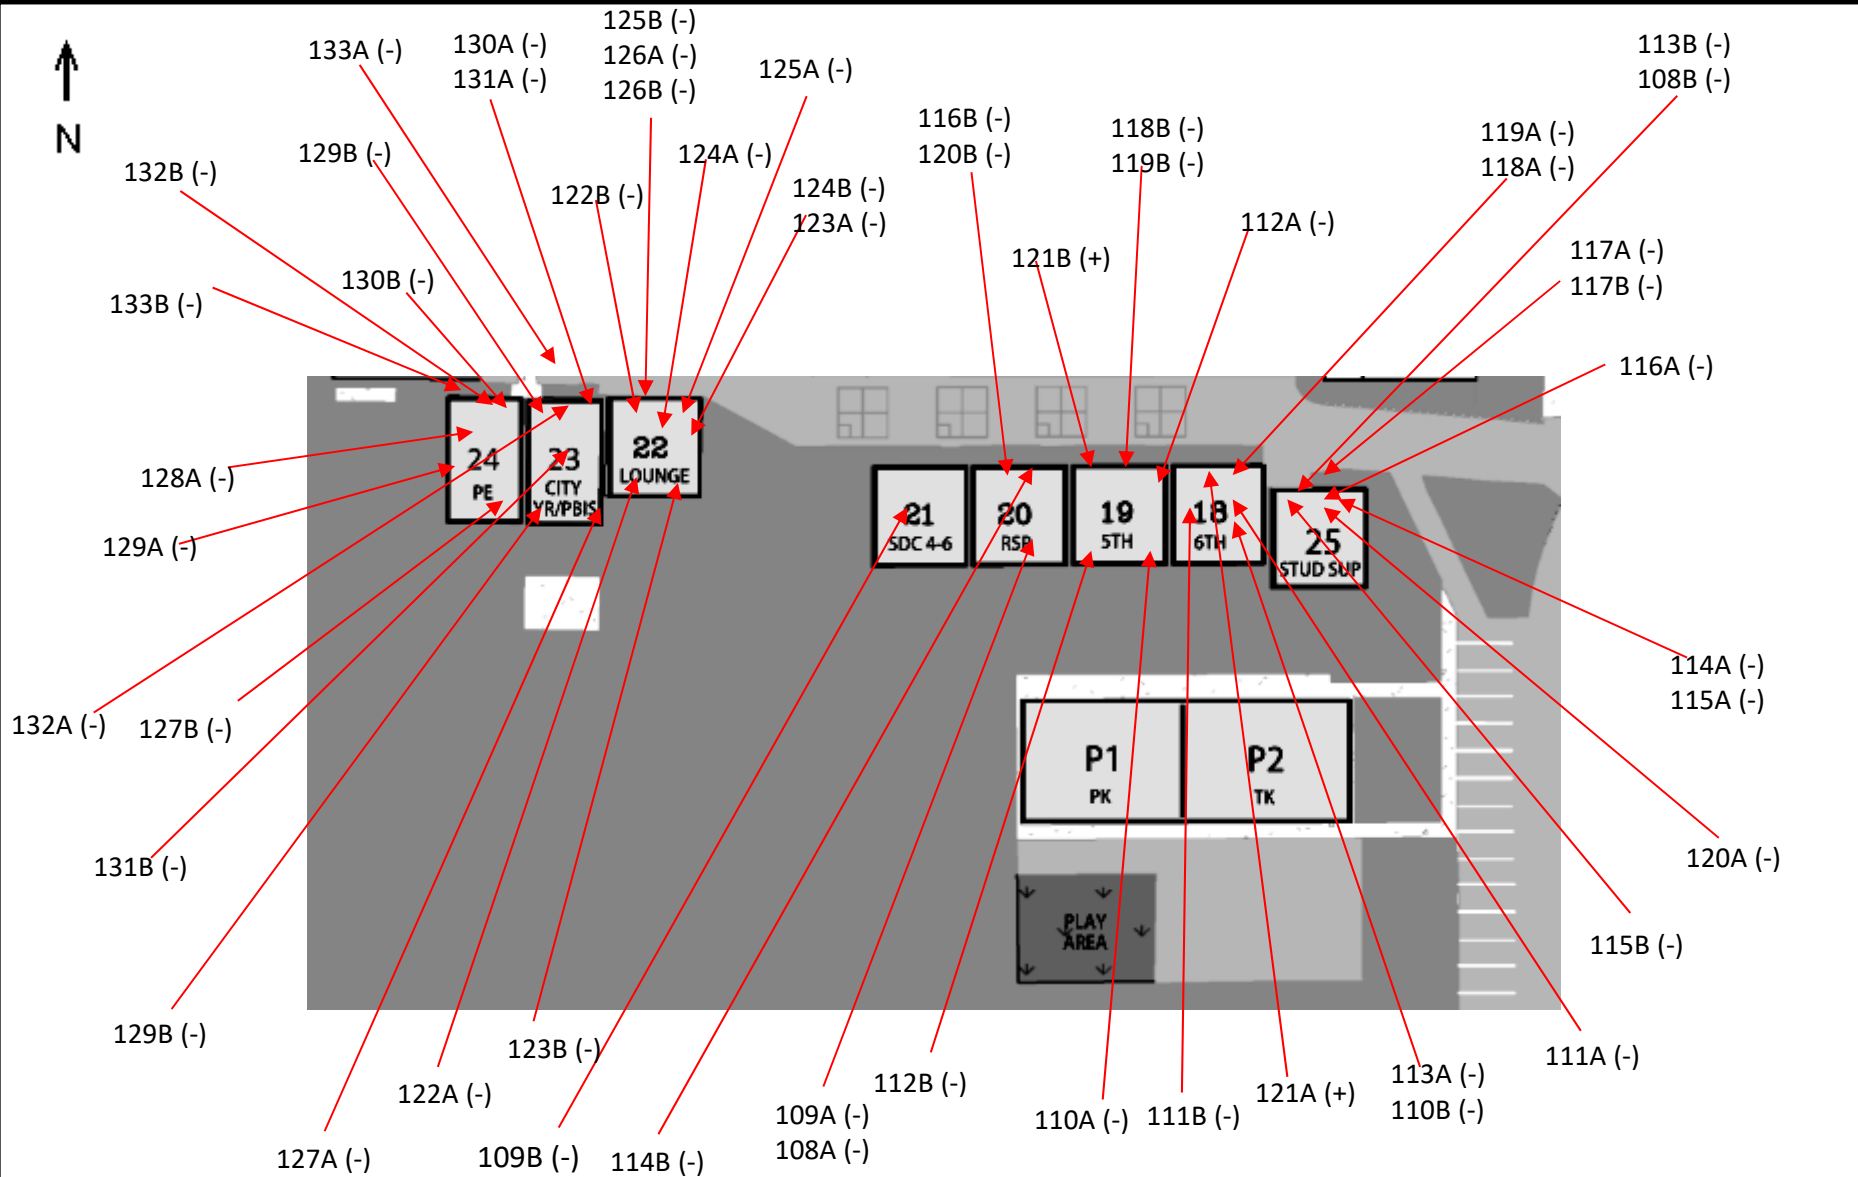

Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale


Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On November 26, 2025  
Project Number 25-7963

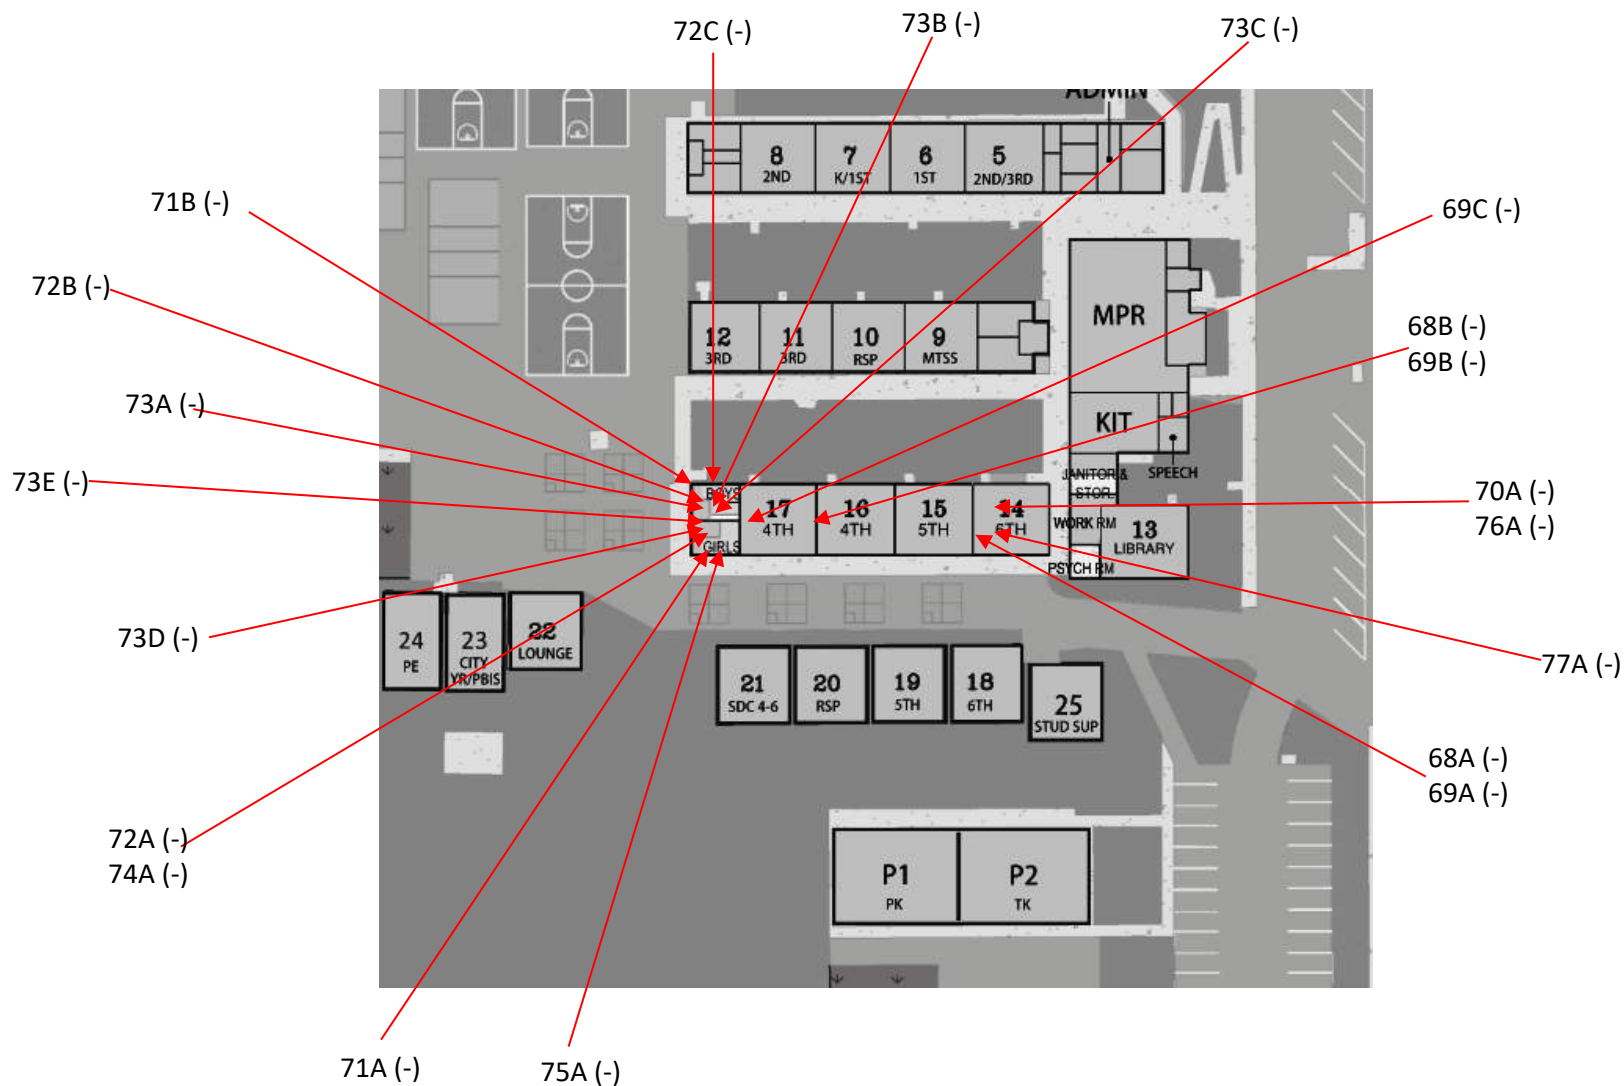

Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale


Asb Bulk Sample Locations  
Collected by Jose Hernandez  
On December 11, 2025  
Project Number 25-7963

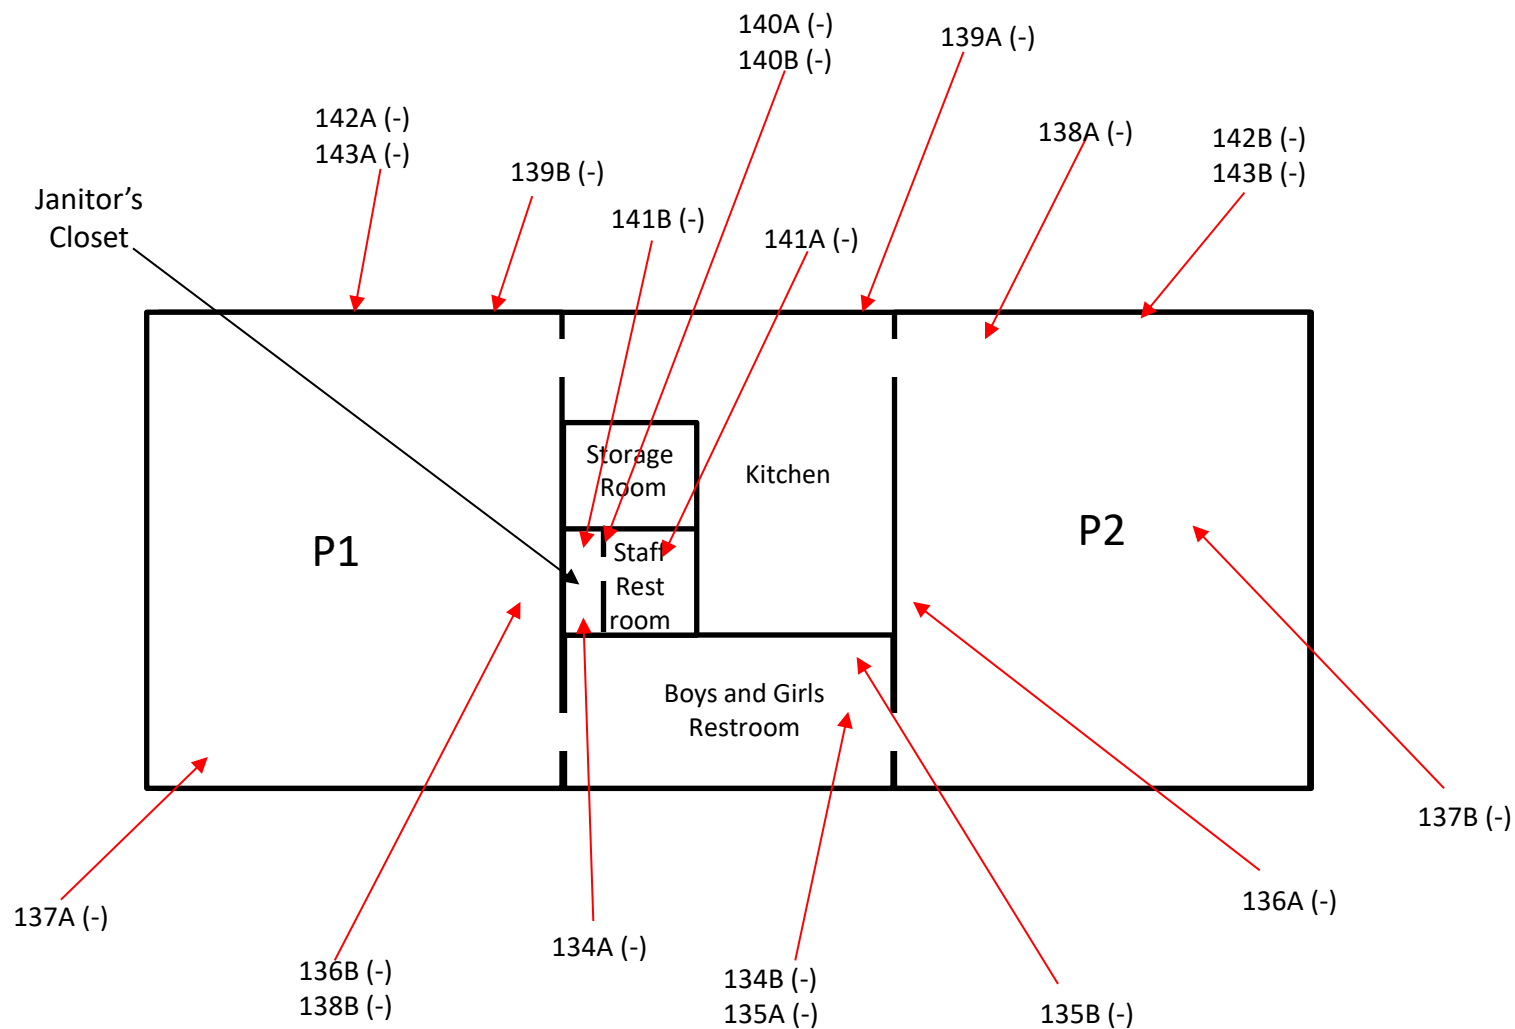

Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale


Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On December 20, 2025  
Project Number 25-7963

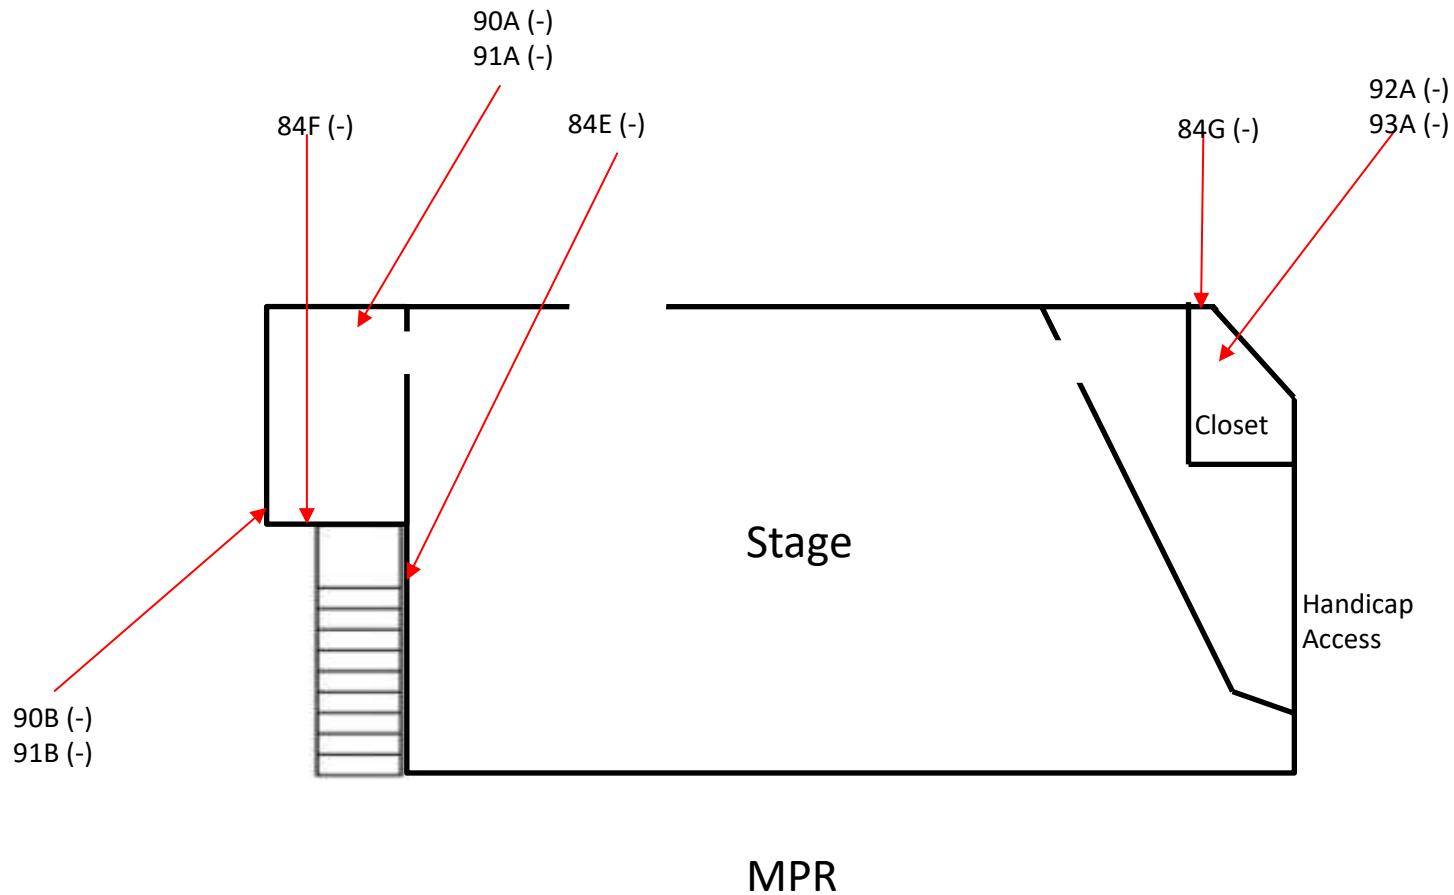

Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale


Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On December 20, 2025  
Project Number 25-7963

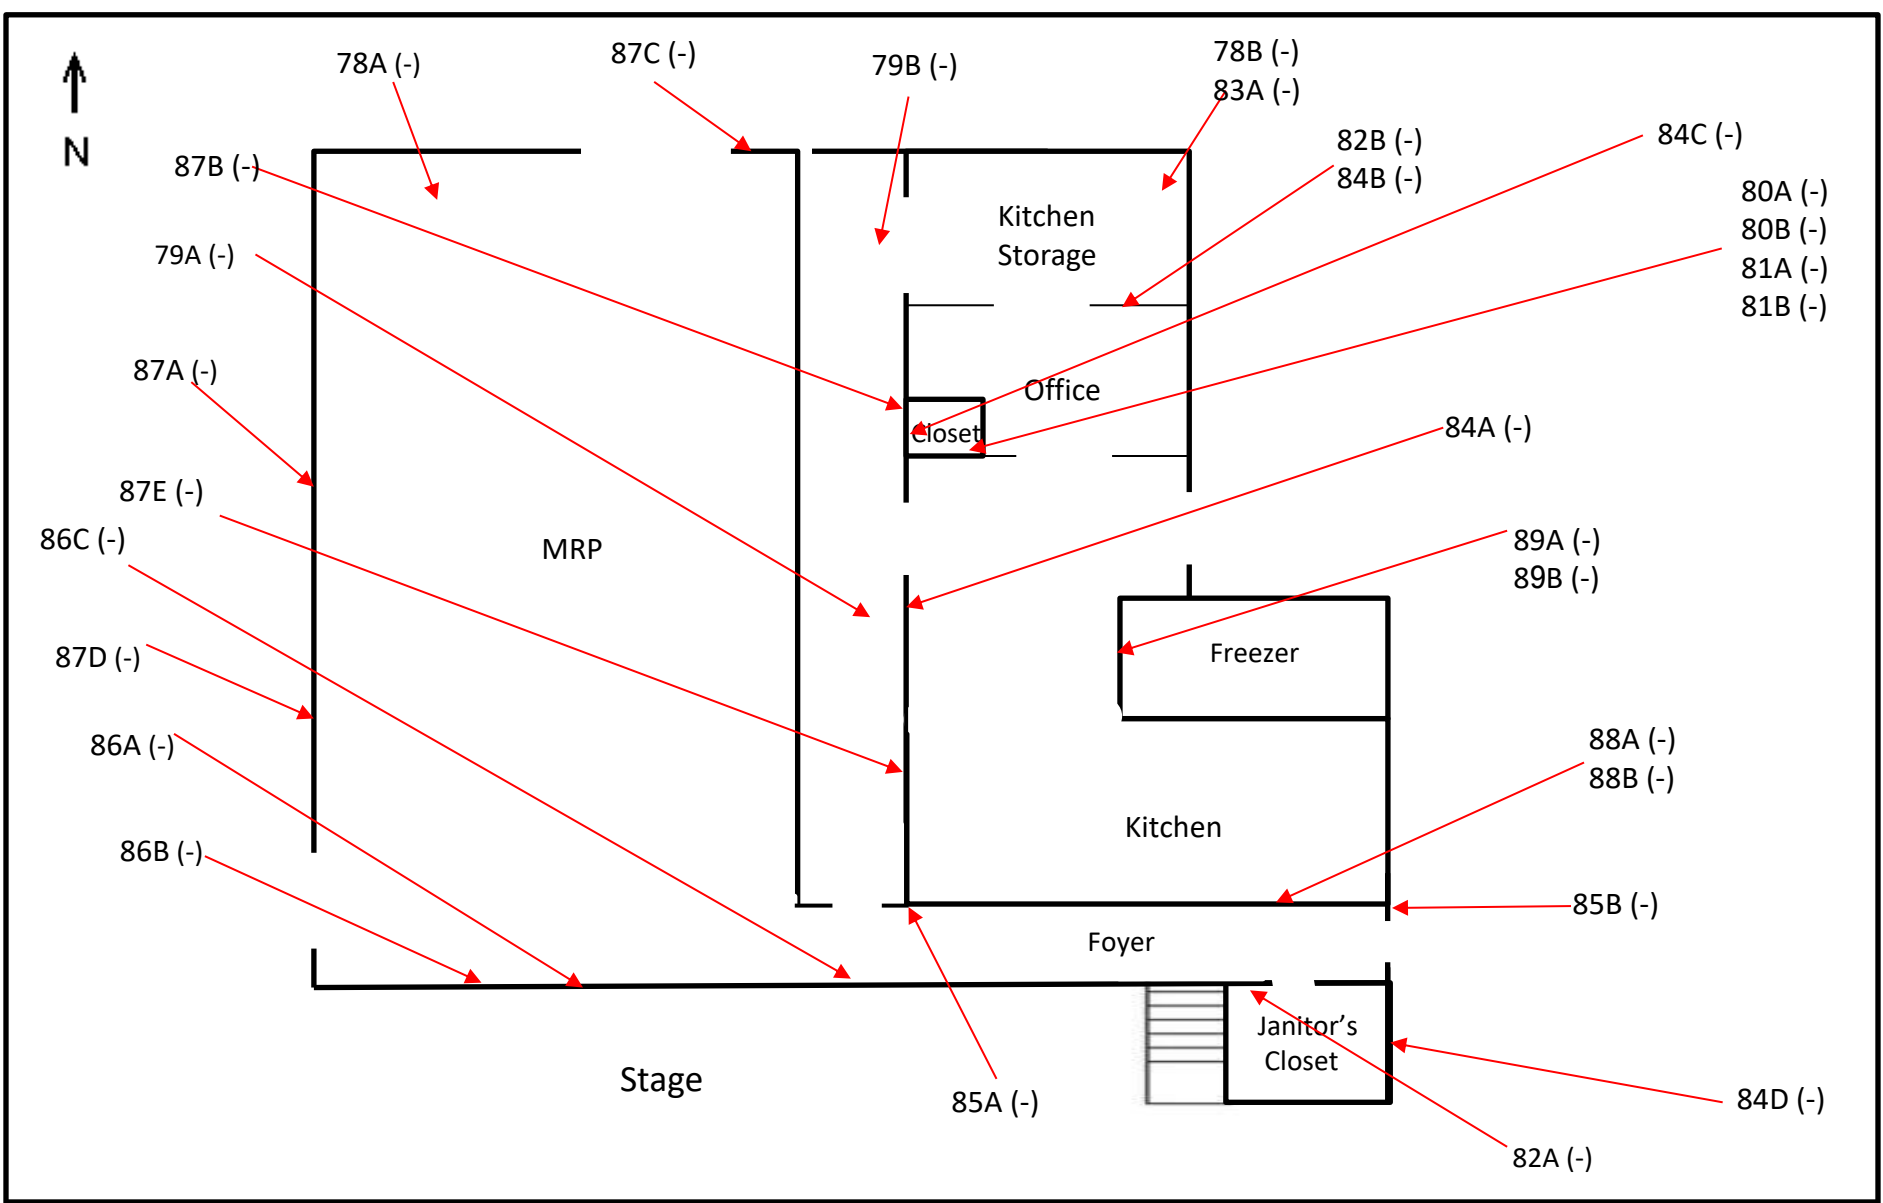

Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale

Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On December 11, 2025  
Project Number 25-7963

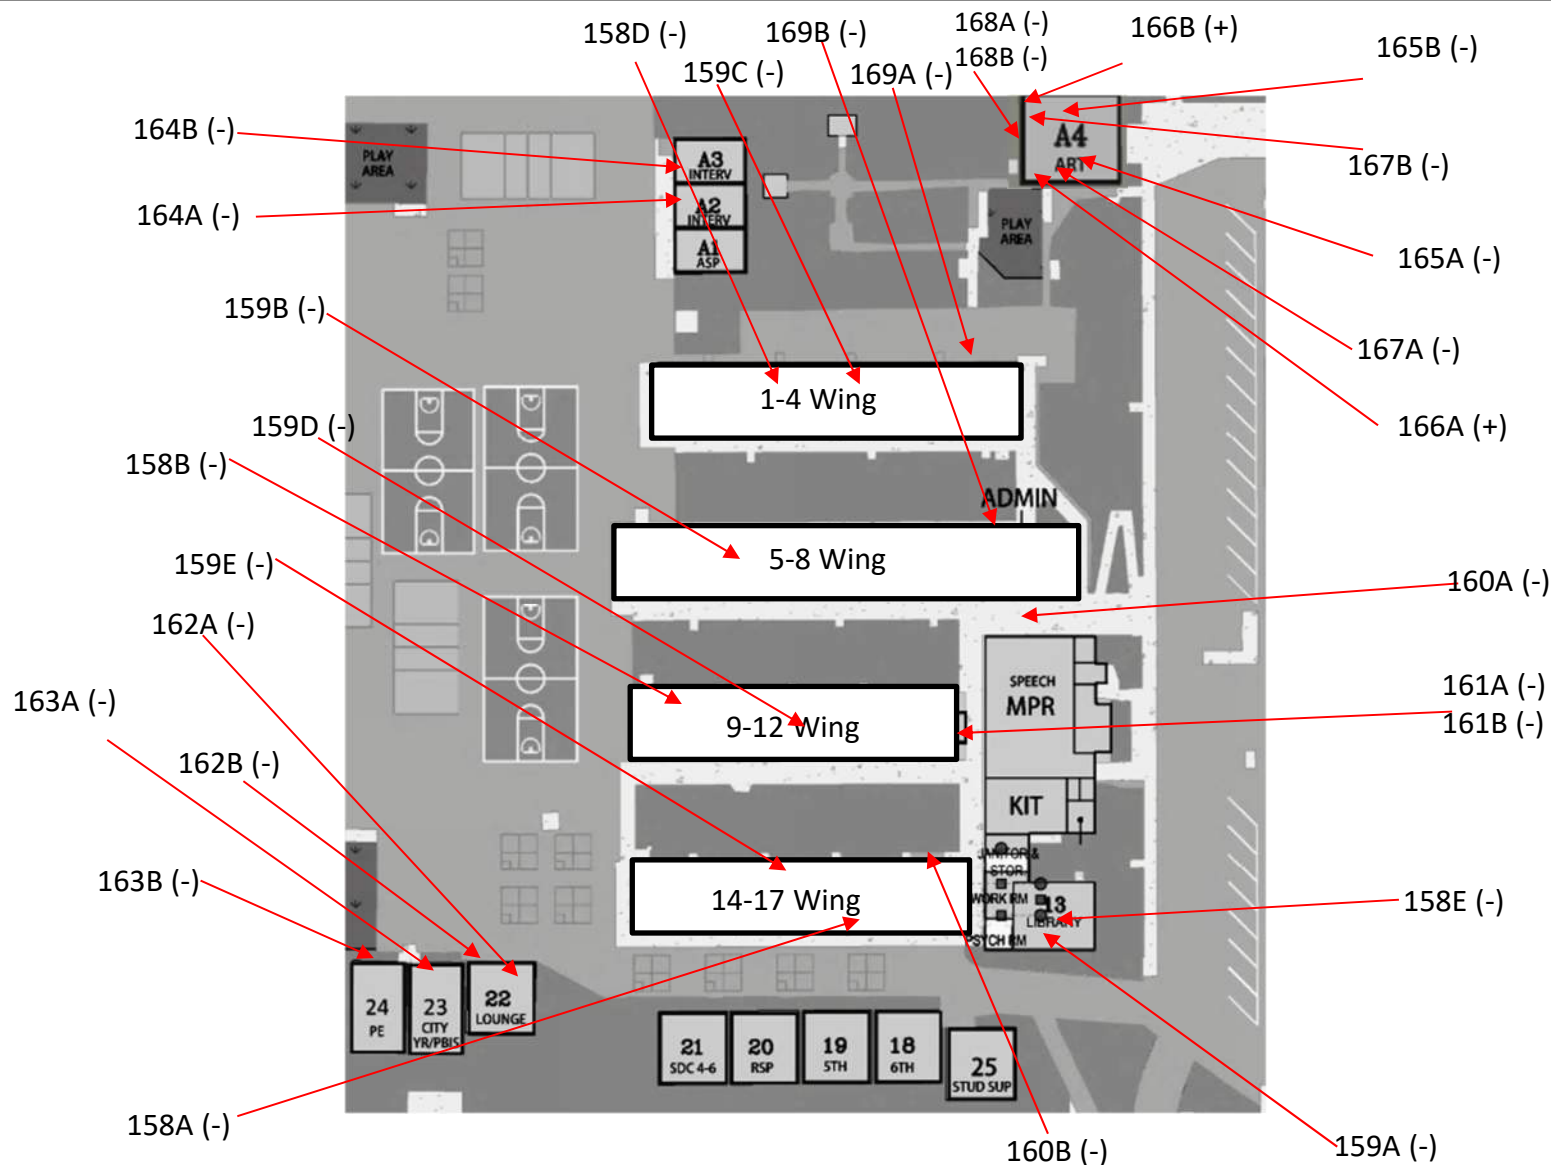

Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale

Asbestos Bulk Sample Locations  
Collected by Jose Hernandez  
On January 11, 2026  
Project Number 25-7963

# Asbestos Survey Form

(See Instructions)

777 12<sup>th</sup> Street, 3<sup>rd</sup> Floor  
Sacramento, CA 95814  
Office (916) 874-4800  
Fax (916) 874-4899  
Email:  
[asbestos@airquality.org](mailto:asbestos@airquality.org)

|                                                                                                                                             |            |                                                                                                  |                                                                                                                                                                |                                 |                                                                    |                                                                                                |
|---------------------------------------------------------------------------------------------------------------------------------------------|------------|--------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------|--------------------------------------------------------------------|------------------------------------------------------------------------------------------------|
| <b>1. Purpose of Survey</b>                                                                                                                 |            |                                                                                                  | <input checked="" type="checkbox"/> <b>Renovation</b>                                                                                                          |                                 | <input type="checkbox"/> <b>Demolition</b>                         |                                                                                                |
| <b>2. Facility Information</b>                                                                                                              |            |                                                                                                  |                                                                                                                                                                |                                 |                                                                    |                                                                                                |
| Project Area(s) Description Earl Warren Elementary School                                                                                   |            |                                                                                                  |                                                                                                                                                                |                                 |                                                                    |                                                                                                |
| Address 5420 Lowell Street                                                                                                                  |            |                                                                                                  | City Sacramento, CA 95820                                                                                                                                      |                                 | # of Structures 18                                                 |                                                                                                |
| <b>3. Owner Information</b>                                                                                                                 |            |                                                                                                  |                                                                                                                                                                |                                 |                                                                    |                                                                                                |
| Name Sacramento City Unified School District                                                                                                |            |                                                                                                  |                                                                                                                                                                |                                 |                                                                    |                                                                                                |
| Address 425 1st Avenue                                                                                                                      |            |                                                                                                  | City/State Sacramento, CA                                                                                                                                      |                                 | Zip 95818                                                          |                                                                                                |
| Contact Chris Ralston                                                                                                                       |            | Phone (916) 395-3970                                                                             |                                                                                                                                                                | Fax                             |                                                                    | Email (916) 395-3970                                                                           |
| <b>4. Consultant Information</b>                                                                                                            |            |                                                                                                  | Survey Date(s): 11/26/25, 12/11/25, 12/20/25 & 1/11/26                                                                                                         |                                 |                                                                    |                                                                                                |
| Company Name Entek Consulting Group, Inc.                                                                                                   |            |                                                                                                  |                                                                                                                                                                |                                 |                                                                    |                                                                                                |
| Name Jose Hernandez                                                                                                                         |            |                                                                                                  |                                                                                                                                                                |                                 | DOSH # 22-6995                                                     |                                                                                                |
| Address 3435 American River Drive, Suite C                                                                                                  |            |                                                                                                  | City/State Sacramento, California                                                                                                                              |                                 | Zip 95864                                                          |                                                                                                |
| Phone (916) 632-6800                                                                                                                        |            | Fax                                                                                              |                                                                                                                                                                | Email jhernandez@entekgroup.com |                                                                    | Signature  |
| <b>5. Client Information (If different than owner)</b>                                                                                      |            |                                                                                                  | <input type="checkbox"/> General Contractor                                                                                                                    |                                 | <input type="checkbox"/> Insurance Company                         |                                                                                                |
| <input type="checkbox"/> Architect                                                                                                          |            |                                                                                                  | <input type="checkbox"/> Property Manager                                                                                                                      |                                 | <input type="checkbox"/> Other _____                               |                                                                                                |
| Name                                                                                                                                        |            |                                                                                                  |                                                                                                                                                                |                                 |                                                                    |                                                                                                |
| Address                                                                                                                                     |            |                                                                                                  | City/State                                                                                                                                                     |                                 |                                                                    | Zip                                                                                            |
| Contact                                                                                                                                     |            | Phone                                                                                            |                                                                                                                                                                | Fax                             |                                                                    | Email                                                                                          |
| <b>6. Have all of the suspect materials that will be disturbed been sampled?</b>                                                            |            |                                                                                                  |                                                                                                                                                                |                                 |                                                                    | <input checked="" type="checkbox"/> Yes<br><input type="checkbox"/> No                         |
| If no, explain why:                                                                                                                         |            |                                                                                                  |                                                                                                                                                                |                                 |                                                                    |                                                                                                |
| <b>7. Summary of Total Asbestos Containing Material (ACM) Findings</b>                                                                      |            |                                                                                                  |                                                                                                                                                                |                                 |                                                                    |                                                                                                |
| <b>Regulated Asbestos Containing Material (RACM)</b><br>(Includes materials subject to known mechanical removal and fire damaged materials) |            |                                                                                                  | <b>Category II</b>                                                                                                                                             |                                 | <b>Category I</b>                                                  |                                                                                                |
| Square Ft.                                                                                                                                  | Linear Ft. | Cubic Ft.                                                                                        | Square Ft.                                                                                                                                                     | Linear Ft.                      | Square Ft.                                                         | Linear Ft.                                                                                     |
| 66                                                                                                                                          | 20         | 0                                                                                                | 104                                                                                                                                                            | 0                               | 956                                                                | 0                                                                                              |
| <b>To receive future SMAQMD Rule updates and changes affecting your industry (check one box):</b>                                           |            |                                                                                                  |                                                                                                                                                                |                                 |                                                                    |                                                                                                |
| <input type="checkbox"/> Please send e-mail notices to                                                                                      |            |                                                                                                  | <input type="checkbox"/> I will sign up myself at <a href="http://www.airquality.org/listserve/">www.airquality.org/listserve/</a> to receive emailed notices. |                                 |                                                                    |                                                                                                |
| <input checked="" type="checkbox"/> I am already subscribed.                                                                                |            | <input type="checkbox"/> I want the District to mail notices to the address on this application: |                                                                                                                                                                |                                 | <input type="checkbox"/> Owner <input type="checkbox"/> Consultant |                                                                                                |

# Asbestos Renovation/Demolition Notification Form

|                                                                                                                                                                                         |                                                                                                                                                                  |                                   |                                                                                                                                                                                                                                                                                        |                                  |                           |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------|---------------------------|
| <b>1</b>                                                                                                                                                                                | Building Department Permit Application # (if known) :<br>_____                                                                                                   |                                   | <input checked="" type="checkbox"/> Renovation (Do not complete Section 5)<br><input type="checkbox"/> Demolition (Complete all sections)<br><input type="checkbox"/> Ordered Demo - Attach ordered demo letter<br><input type="checkbox"/> Emergency Demo - SMAQMD Emergency #: _____ |                                  |                           |
|                                                                                                                                                                                         |                                                                                                                                                                  |                                   |                                                                                                                                                                                                                                                                                        |                                  |                           |
| <b>2</b>                                                                                                                                                                                | Contractor                                                                                                                                                       |                                   | Owner <b>Sacramento City USD-Chris Ralston</b>                                                                                                                                                                                                                                         |                                  |                           |
|                                                                                                                                                                                         | Address                                                                                                                                                          |                                   | Address <b>425 1st Avenue</b>                                                                                                                                                                                                                                                          |                                  |                           |
|                                                                                                                                                                                         | City, State / Zip                                                                                                                                                |                                   | City, State / Zip <b>Sacramento, CA 95818</b>                                                                                                                                                                                                                                          |                                  |                           |
|                                                                                                                                                                                         | Email                                                                                                                                                            |                                   | Email <b>Chris-ralston@scusd.edu</b>                                                                                                                                                                                                                                                   |                                  |                           |
|                                                                                                                                                                                         | Telephone                                                                                                                                                        |                                   | Telephone <b>(916) 395-3970</b>                                                                                                                                                                                                                                                        |                                  |                           |
| <b>3</b>                                                                                                                                                                                | Structure Name<br>Earl Warren Elementary School                                                                                                                  |                                   | Renovation Area<br>Earl Warren Elementary School                                                                                                                                                                                                                                       |                                  | # of Floors <b>18</b>     |
|                                                                                                                                                                                         | Project Address<br>5420 Lowell Street                                                                                                                            |                                   | City / Zip <b>Sacramento, CA 95820</b>                                                                                                                                                                                                                                                 |                                  | Year Built <b>Unknown</b> |
| <b>4</b>                                                                                                                                                                                | Preference for return of form                                                                                                                                    | <input type="checkbox"/> E-mail : |                                                                                                                                                                                                                                                                                        | <input type="checkbox"/> Other : |                           |
| <b>DEMOLITION ONLY – Start date must be at least <u>10 working days</u> from the day of your postmark or hand delivery of this form.</b>                                                |                                                                                                                                                                  |                                   |                                                                                                                                                                                                                                                                                        |                                  |                           |
| <b>5</b>                                                                                                                                                                                | Start Date _____                                                                                                                                                 |                                   | Revision # <u>1</u> <u>2</u> <u>3</u> <u>4</u> <u>5</u> <u>6</u> <u>7</u> <u>8</u> <u>9</u> (circle)                                                                                                                                                                                   |                                  |                           |
|                                                                                                                                                                                         | Completion Date _____                                                                                                                                            |                                   | New Start Date _____                                                                                                                                                                                                                                                                   |                                  |                           |
|                                                                                                                                                                                         |                                                                                                                                                                  |                                   | New Completion Date _____                                                                                                                                                                                                                                                              |                                  |                           |
|                                                                                                                                                                                         | Method of Demo (Check Applicable): <input type="checkbox"/> Manual/Hand Tools <input type="checkbox"/> Mechanical/Heavy Equipment <input type="checkbox"/> Other |                                   |                                                                                                                                                                                                                                                                                        |                                  |                           |
| Procedure to be followed if RACM is found or Category II material becomes friable:                                                                                                      |                                                                                                                                                                  |                                   |                                                                                                                                                                                                                                                                                        |                                  |                           |
| <b>I have read and understand the directions. The information on this form is true and accurate.<br/>I certify that the asbestos survey conducted represents the facility as built.</b> |                                                                                                                                                                  |                                   |                                                                                                                                                                                                                                                                                        |                                  |                           |
| <b>6</b>                                                                                                                                                                                | Applicant Name (Print)                                                                                                                                           |                                   | <input type="checkbox"/> Owner                                                                                                                                                                                                                                                         |                                  | Permit may be issued on:  |
|                                                                                                                                                                                         | Phone Number                                                                                                                                                     |                                   | <input type="checkbox"/> Rep / Agent                                                                                                                                                                                                                                                   |                                  |                           |
|                                                                                                                                                                                         | Applicant's Signature                                                                                                                                            |                                   | <input type="checkbox"/> Contractor                                                                                                                                                                                                                                                    |                                  |                           |
|                                                                                                                                                                                         |                                                                                                                                                                  | Date                              |                                                                                                                                                                                                                                                                                        |                                  |                           |

**Have DOSH Consultant complete and sign below OR attach completed Asbestos Survey Form and Consultant's report.**

|                            |                                                                                                |                       |                                                                                                                                          |                                                            |
|----------------------------|------------------------------------------------------------------------------------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------|
| <b>CONSULTANT USE ONLY</b> | Company Name <b>Entek Consulting Group, Inc.</b>                                               |                       | Telephone <b>(916) 632-6800</b>                                                                                                          |                                                            |
|                            | Surveyor Name <b>Jose Hernandez</b>                                                            |                       | DOSH # <b>22-6995</b>                                                                                                                    | Survey Date <b>11/26/25, 12/11/25, 12/20/25 &amp; 1/15</b> |
|                            | Analytical Method <b>PLM by Dispersion Staining</b>                                            |                       | Pt Count Materials <10%? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Declined by Client |                                                            |
|                            | Amount of RACM                                                                                 | Square Feet <b>66</b> | Linear Feet <b>20</b>                                                                                                                    | Cubic Feet <b>0</b>                                        |
|                            | Amount of Category I <b>956</b>                                                                |                       | Amount of Category II <b>104</b>                                                                                                         |                                                            |
|                            | Project Address <b>5420 Lowell Street</b>                                                      |                       | City <b>Sacramento</b>                                                                                                                   | Zip <b>95820</b>                                           |
|                            | Suspect Materials Present? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No |                       | Consultant's Signature                                                                                                                   |                                                            |

**SMAQMD USE ONLY**

Date Received / Date Postmarked \_\_\_\_\_ Date Approved & Returned \_\_\_\_\_  
Project # \_\_\_\_\_ Check # \_\_\_\_\_ Receipt # \_\_\_\_\_ Amount Paid \_\_\_\_\_ Staff \_\_\_\_\_

## **APPENDIX B**

### **LEAD RELATED DOCUMENTS**

- Lead in Paint Samples Analysis Report From MicroTest
- Bulk Lead Material Analysis Request Form for Entek
- Lead Bulk Sample Location Drawings
- Lead Hazard Evaluation Report (CDPH 8552)

Report for:

**Jose Hernandez, Mathew Watson**  
**Entek Consulting Group**  
3435 American River Drive  
Suite C  
Sacramento, CA 95864

---

Regarding: Eurofins Built Environment Testing West, LLC  
Project: 25-7963; Sacramento City USD - Earl Warren Elementary School  
EML ID: 4360977

Approved by:

Dates of Analysis:  
Lead - Flame AA: 01-03-2026



Approved Signatory  
Philip Newton

Service SOPs: Lead - Flame AA (EB-BC-S-8443)  
AIHA LAP, LLC accredited service, Lab ID #178697

---

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. Due to the nature of the analyses performed, field blank correction of results is not applied. The results relate only to the samples as received and tested. Sample size, as it relates to Wipe samples only, is supplied by the client.

Eurofins Built Environment Testing West, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins Built Environment Testing West, LLC's LabServe® reporting system includes automated fail-safes to ensure that all AIHA LAP, LLC quality requirements are met and notifications are added to reports when any quality steps remain pending.

**Eurofins Built Environment Testing West, LLC**

2841 Dow Avenue, Suite 300, Tustin, CA 92780

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025

Date of Receipt: 01-02-2026

Date of Report: 01-08-2026

**LEAD: FLAME ATOMIC ABSORPTION SPECTROMETRY**

|                          |                                                                                                   |                                                                                                   |                                                                                                    |
|--------------------------|---------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------|
| Location:                | ECG-25-7963-01Pb:<br>White Paint on Interior<br>Drywall Wall System -<br>West Side of Classroom 5 | ECG-25-7963-02Pb:<br>Beige Paint on Interior<br>Textured Plaster - MPR<br>Bldg., West Wall of MPR | ECG-25-7963-03Pb:<br>Off-White Paint on<br>Interior Plaster Wall<br>System - MPR Bldg.,<br>Kitchen |
| Comments (see below)     | None                                                                                              | None                                                                                              | None                                                                                               |
| Lab ID-Version‡:         | 21853106-1                                                                                        | 21853107-1                                                                                        | 21853108-1                                                                                         |
| Analysis Date:           | 01/03/2026                                                                                        | 01/03/2026                                                                                        | 01/03/2026                                                                                         |
| Sample type              | Paint Chip sample                                                                                 | Paint Chip sample                                                                                 | Paint Chip sample                                                                                  |
| Method*                  | NIOSH 7082 & EPA 7000B<br>modified                                                                | NIOSH 7082 & EPA 7000B<br>modified                                                                | NIOSH 7082 & EPA 7000B<br>modified                                                                 |
| † Method Reporting Limit | 39 ppm                                                                                            | 39 ppm                                                                                            | 39 ppm                                                                                             |
| Sample size              | 0.2546 grams                                                                                      | 0.2569 grams                                                                                      | 0.2548 grams                                                                                       |
| § Total Lead Result      | < 39 ppm                                                                                          | < 39 ppm                                                                                          | 1100 ppm                                                                                           |

**Comments:**

Sample results have not been corrected for blank values.

Bulk samples are not covered under the AIHA LAP, LLC service accreditation.

Wipe samples must meet ASTM E1792 criteria. Method Reporting Limits may not be valid for non-ASTM E1792 wipe samples.

Estimated accuracy is solely based on recovery data from internal laboratory control samples at the 95% confidence interval ( $k \sim 2$ ) of the level of concern, derived from a 1,000-ppm certified lead reference.

\*Sample preparation and analytical methods are based upon NIOSH 7082 and EPA 7000B.

† The Method Reporting Limit is the minimum concentration of Lead that the laboratory can confidently detect in the sample.

§ Total Lead Result has been rounded to two significant figures to reflect analytical precision.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

2841 Dow Avenue, Suite 300, Tustin, CA 92780

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025

Date of Receipt: 01-02-2026

Date of Report: 01-08-2026

**LEAD: FLAME ATOMIC ABSORPTION SPECTROMETRY**

|                          |                                                                                      |                                                                                                           |                                                                        |
|--------------------------|--------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------|
| Location:                | ECG-25-7963-04Pb:<br>Varnish on Interior Wood<br>Stage Floor - MPR Bldg.<br>at Stage | ECG-25-7963-05Pb:<br>White Paint on Interior<br>Plaster Wall System -<br>MPR Bldg., West Side of<br>Stage | ECG-25-7963-06Pb:<br>Blue Paint on Exterior<br>Wood Trim - Portable 20 |
| Comments (see below)     | None                                                                                 | None                                                                                                      | None                                                                   |
| Lab ID-Version‡:         | 21853109-1                                                                           | 21853110-1                                                                                                | 21853111-1                                                             |
| Analysis Date:           | 01/03/2026                                                                           | 01/03/2026                                                                                                | 01/03/2026                                                             |
| Sample type              | Paint Chip sample                                                                    | Paint Chip sample                                                                                         | Paint Chip sample                                                      |
| Method*                  | NIOSH 7082 & EPA 7000B<br>modified                                                   | NIOSH 7082 & EPA 7000B<br>modified                                                                        | NIOSH 7082 & EPA 7000B<br>modified                                     |
| † Method Reporting Limit | 40 ppm                                                                               | 39 ppm                                                                                                    | 39 ppm                                                                 |
| Sample size              | 0.2527 grams                                                                         | 0.2572 grams                                                                                              | 0.2537 grams                                                           |
| § Total Lead Result      | < 40 ppm                                                                             | 120 ppm                                                                                                   | < 39 ppm                                                               |

**Comments:**

Sample results have not been corrected for blank values.

Bulk samples are not covered under the AIHA LAP, LLC service accreditation.

Wipe samples must meet ASTM E1792 criteria. Method Reporting Limits may not be valid for non-ASTM E1792 wipe samples.

Estimated accuracy is solely based on recovery data from internal laboratory control samples at the 95% confidence interval ( $k \sim 2$ ) of the level of concern, derived from a 1,000-ppm certified lead reference.

\*Sample preparation and analytical methods are based upon NIOSH 7082 and EPA 7000B.

† The Method Reporting Limit is the minimum concentration of Lead that the laboratory can confidently detect in the sample.

§ Total Lead Result has been rounded to two significant figures to reflect analytical precision.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

2841 Dow Avenue, Suite 300, Tustin, CA 92780

(833) 465-5857 www.eurofinsus.com/Built

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025

Date of Receipt: 01-02-2026

Date of Report: 01-08-2026

**LEAD: FLAME ATOMIC ABSORPTION SPECTROMETRY**

|                          |                                                                                                                |                                                                                                                          |                                                                            |
|--------------------------|----------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------|
| Location:                | ECG-25-7963-07Pb:<br>Pink/Blue/Green/Yellow/<br>Orange Paint on Exterior<br>Wood Siding - Portables<br>P1 & P2 | ECG-25-7963-08Pb:<br>Red Paint on Exterior<br>Striping on Concrete<br>Sidewalk - Exterior North<br>Sidewalk of MPR Bldg. | ECG-25-7963-09Pb:<br>Off-White on Exterior<br>Wood Siding - Portable<br>18 |
| Comments (see below)     | None                                                                                                           | None                                                                                                                     | None                                                                       |
| Lab ID-Version‡:         | 21853112-1                                                                                                     | 21853113-1                                                                                                               | 21853114-1                                                                 |
| Analysis Date:           | 01/03/2026                                                                                                     | 01/03/2026                                                                                                               | 01/03/2026                                                                 |
| Sample type              | Paint Chip sample                                                                                              | Paint Chip sample                                                                                                        | Paint Chip sample                                                          |
| Method*                  | NIOSH 7082 & EPA 7000B<br>modified                                                                             | NIOSH 7082 & EPA 7000B<br>modified                                                                                       | NIOSH 7082 & EPA 7000B<br>modified                                         |
| † Method Reporting Limit | 39 ppm                                                                                                         | 51 ppm                                                                                                                   | 40 ppm                                                                     |
| Sample size              | 0.2534 grams                                                                                                   | 0.1961 grams                                                                                                             | 0.2511 grams                                                               |
| § Total Lead Result      | < 39 ppm                                                                                                       | < 51 ppm                                                                                                                 | < 40 ppm                                                                   |

**Comments:**

Sample results have not been corrected for blank values.

Bulk samples are not covered under the AIHA LAP, LLC service accreditation.

Wipe samples must meet ASTM E1792 criteria. Method Reporting Limits may not be valid for non-ASTM E1792 wipe samples.

Estimated accuracy is solely based on recovery data from internal laboratory control samples at the 95% confidence interval ( $k \sim 2$ ) of the level of concern, derived from a 1,000-ppm certified lead reference.

\*Sample preparation and analytical methods are based upon NIOSH 7082 and EPA 7000B.

† The Method Reporting Limit is the minimum concentration of Lead that the laboratory can confidently detect in the sample.

§ Total Lead Result has been rounded to two significant figures to reflect analytical precision.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

**Eurofins Built Environment Testing West, LLC**

2841 Dow Avenue, Suite 300, Tustin, CA 92780

(833) 465-5857 [www.eurofinsus.com/Built](http://www.eurofinsus.com/Built)

Client: Entek Consulting Group

C/O: Jose Hernandez, Mathew Watson

Re: 25-7963; Sacramento City USD - Earl Warren  
Elementary School

Date of Sampling: 12-20-2025

Date of Receipt: 01-02-2026

Date of Report: 01-08-2026

**LEAD: FLAME ATOMIC ABSORPTION SPECTROMETRY**

**PROJECT ANALYST AND SIGNATORY REPORT**

**Project Analyst**



**Analyst:** Jennifer Grenier

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by AIHA LAP, LLC, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".




New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 \* (866) 871-1984  
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 \* (800) 651-4802  
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 \* (833) 465-5857


| Weather |          | Fog                                 | Rain                                | Snow                                | Wind                                | Clear                    |
|---------|----------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| Level   | None     | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
|         | Light    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Moderate | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |
|         | Heavy    | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            | <input type="checkbox"/>            |                          |

|          |
|----------|
| EMLab ID |
| 4360977  |

| REQUESTED SERVICES<br>(Use checkboxes below) |                          |                          |                          |                          |                          |
|----------------------------------------------|--------------------------|--------------------------|--------------------------|--------------------------|--------------------------|
| Lead                                         | Flame                    | AA                       |                          |                          |                          |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/>          | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>                     | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/>                     | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |

| CONTACT INFORMATION  |                                                                                            |                            |                     |                                                                 |                |                                                                                                                                                    |                              |                                     |  |  |
|----------------------|--------------------------------------------------------------------------------------------|----------------------------|---------------------|-----------------------------------------------------------------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------|-------------------------------------|--|--|
| Company:             | Entek Consulting Group (9697)                                                              |                            |                     | Address: 3435 American River Drive Suite C Sacramento, CA 95864 |                |                                                                                                                                                    |                              |                                     |  |  |
| Contact:             | Jose Hernandez, Mathew Watson                                                              |                            |                     | Special Instructions:                                           |                |                                                                                                                                                    |                              |                                     |  |  |
| Phone:               | 916-824-5580                                                                               |                            |                     |                                                                 |                |                                                                                                                                                    |                              |                                     |  |  |
| PROJECT INFORMATION  |                                                                                            |                            |                     | TURN AROUND TIME CODES (TAT)                                    |                |                                                                                                                                                    |                              |                                     |  |  |
| Project ID:          | 25-7963                                                                                    |                            |                     | STD – Standard (DEFAULT)                                        |                | Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs. |                              |                                     |  |  |
| Project Description: | Sacramento City USD - Earl Warren Elementary School                                        |                            |                     | ND – Next Business Day                                          |                |                                                                                                                                                    |                              |                                     |  |  |
| Project Zip Code:    | 95820                                                                                      | Sampling Date & Time:      | 12/20/2025 07:00 AM | SD – Same Business Day Rush                                     |                |                                                                                                                                                    |                              |                                     |  |  |
| PO Number:           | 25-7963                                                                                    | Sampled By: Jose Hernandez |                     | WH – Weekend / Holiday                                          |                |                                                                                                                                                    |                              |                                     |  |  |
| Sample ID            | Description                                                                                |                            |                     | Sample Type<br>(Below)                                          | TAT<br>(Above) | Volume / Area<br>(as applicable)                                                                                                                   | ISO Class<br>(as applicable) | Notes (Time of day, Temp, RH, etc.) |  |  |
| ECG-25-7963-01Pb     | White Paint on Interior Drywall Wall System - West Side of Classroom 5                     |                            |                     | P                                                               | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-02Pb     | Beige Paint on Interior Textured Plaster - MPR Bldg., West Wall of MPR                     |                            |                     | P                                                               | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-03Pb     | Off-White Paint on Interior Plaster Wall System - MPR Bldg., Kitchen                       |                            |                     | P                                                               | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-04Pb     | Varnish on Interior Wood Stage Floor - MPR Bldg. at Stage                                  |                            |                     | P                                                               | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-05Pb     | White Paint on Interior Plaster Wall System - MPR Bldg., West Side of Stage                |                            |                     | P                                                               | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-06Pb     | Blue Paint on Exterior Wood Trim - Portable 20                                             |                            |                     | P                                                               | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-07Pb     | Pink/Blue/Green/Yellow/Orange Paint on Exterior Wood Siding - Portables P1 & P2            |                            |                     | P                                                               | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-08Pb     | Red Paint on Exterior Striping on Concrete Sidewalk - Exterior North Sidewalk of MPR Bldg. |                            |                     | P                                                               | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
| ECG-25-7963-09Pb     | Off-White on Exterior Wood Siding - Portable 18                                            |                            |                     | P                                                               | STD            | N/A                                                                                                                                                |                              |                                     |  |  |
|                      |                                                                                            |                            |                     |                                                                 |                |                                                                                                                                                    |                              |                                     |  |  |
|                      |                                                                                            |                            |                     |                                                                 |                |                                                                                                                                                    |                              |                                     |  |  |

| SAMPLE TYPE CODES     |  | RELINQUISHED BY | DATE & TIME        | RECEIVED BY                                                                                                       | DATE & TIME      |
|-----------------------|--|-----------------|--------------------|-------------------------------------------------------------------------------------------------------------------|------------------|
| P - Paint Chip sample |  | Jose Hernandez  | 12/31/2025 2:30 PM | <br>Steven Castillo, Analyst | 1/2/2026 9:35 AM |
|                       |  |                 |                    |                                                                                                                   |                  |
|                       |  |                 |                    |                                                                                                                   |                  |

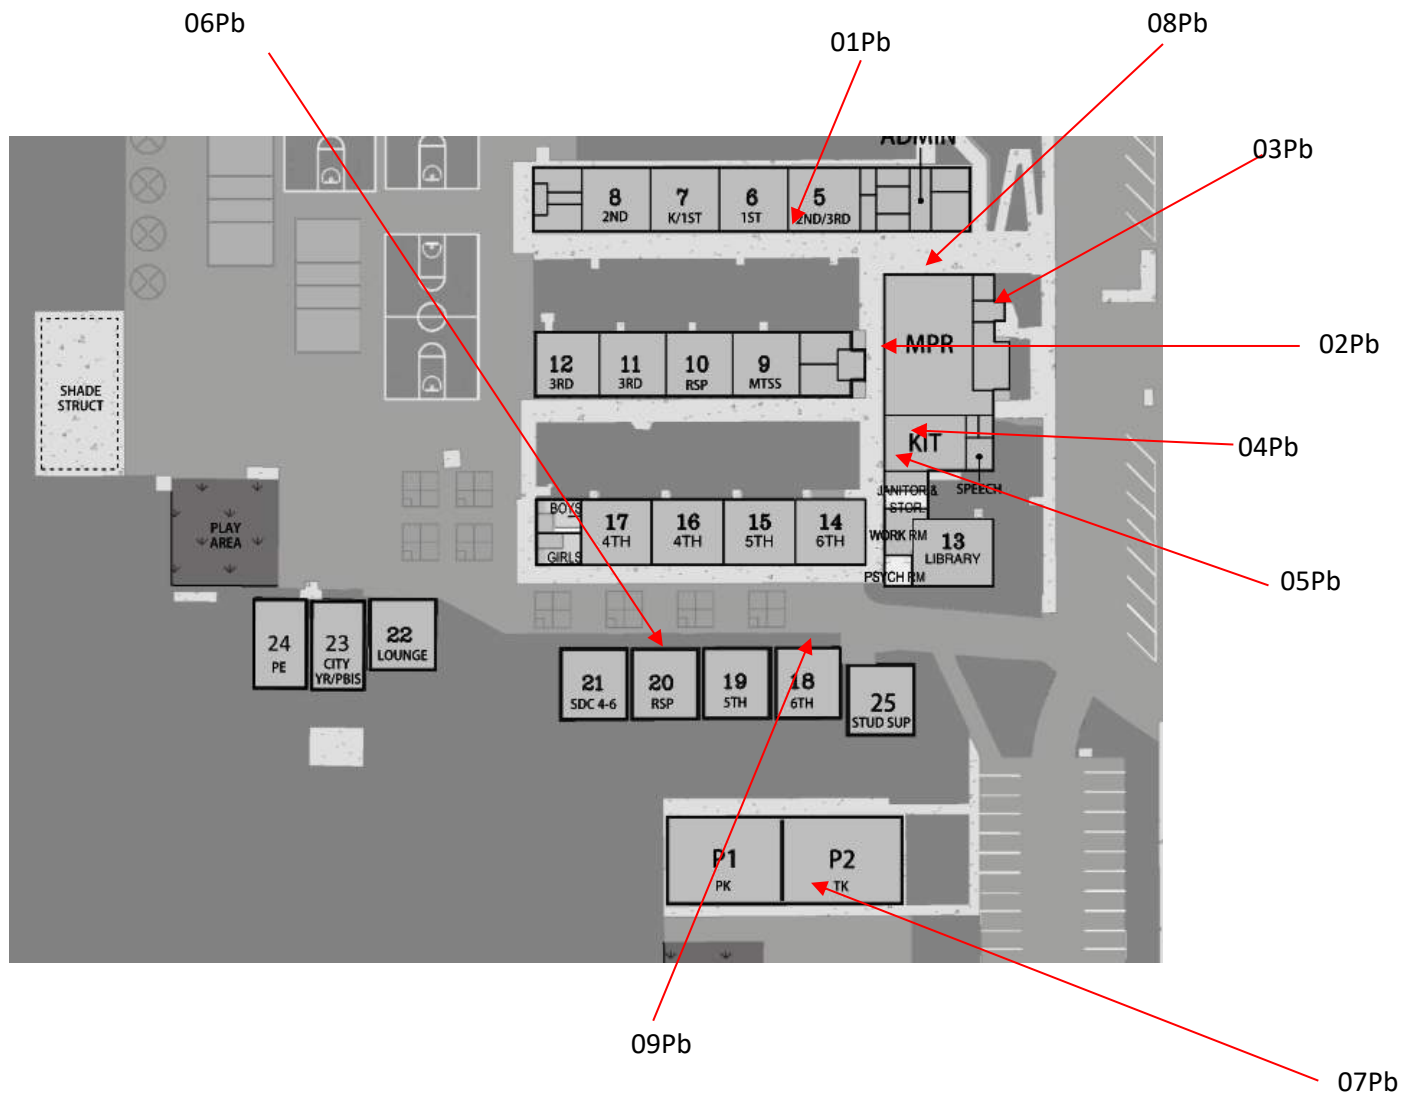

Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale

Lead Bulk Sample Locations  
Collected by Jose Hernandez  
On December 20, 2025  
Project Number 25-7963

| Date             | Test # | Serial #   | Pass/Fail | Unit type | Calibration Pb | Pb +/- | Pb P/F       | Description                                                                                                                             |
|------------------|--------|------------|-----------|-----------|----------------|--------|--------------|-----------------------------------------------------------------------------------------------------------------------------------------|
| 12/20/2025 16:29 | 161    | X550-0240  | Pass      | mg/cm2    | PCS Cal        | 1      | 0.1 Positive |                                                                                                                                         |
| 12/20/2025 16:29 | 162    | X550-0240  | Pass      | mg/cm2    | PCS Cal        | 1      | 0.1 Positive |                                                                                                                                         |
| 12/20/2025 16:29 | 163    | X550-0240  | Pass      | mg/cm2    | PCS Cal        | 1      | 0.1 Positive |                                                                                                                                         |
| 12/20/2025 16:29 | 164    | X550-0240  | Pass      | mg/cm2    | PCS Cal        | 1      | 0.1 Positive |                                                                                                                                         |
| 12/20/2025 16:31 | 165    | X550-02401 |           | mg/cm2    | LeadPaint      | 0.2    | 0.2          | White interior plaster/drywall - Throughout Admin Office Building                                                                       |
| 12/20/2025 16:38 | 169    | X550-02401 |           | ppm       | Soil           | 706    | 0.01         | Beige interior wood doors/door frames - Throughout Admin Office Building                                                                |
| 12/20/2025 16:42 | 171    | X550-02401 |           | ppm       | Soil           | 342    | 0.01         | Blue interior wood doors/door frames/trim - Throughout permanent buildings                                                              |
| 12/20/2025 16:44 | 172    | X550-02401 |           | ppm       | Soil           | 214    | 0.01         | Ceramic glazing on 4" Off-White wall tile - Throughout restrooms inside the permanent buildings                                         |
| 12/20/2025 16:54 | 174    | X550-02401 |           | ppm       | Soil           | 5,800  | 0.01         | White interior wooden vertical columns - Throughout permanent buildings                                                                 |
| 12/20/2025 17:00 | 175    | X550-02401 |           | ppm       | Soil           | 2,629  | 0.01         | Beige interior plaster/wooden components - Throughout restrooms inside permanent buildings                                              |
| 12/20/2025 17:04 | 176    | X550-02401 |           | ppm       | Soil           | 12,221 | 0.02         | White interior smooth plaster/drywall walls/ceiling - Throughout the janitor's closets and storage rooms inside the permanent buildings |
| 12/20/2025 17:12 | 177    | X550-02401 |           | ppm       | Soil           | 113    | 0.01         | Off-White exterior stucco - Throughout permanent buildings                                                                              |
| 12/20/2025 17:14 | 178    | X550-02401 |           | ppm       | Soil           | 1,126  | 0.01         | Blue exterior wood components/trim - Throughout permanent buildings                                                                     |
| 12/20/2025 17:19 | 181    | X550-02401 |           | ppm       | Soil           | 172    | 0.01         | Light Brown interior wood paneling - Throughout MPR building                                                                            |
| 12/20/2025 17:23 | 183    | X550-02401 |           | ppm       | Soil           | 168    | 0.01         | Dark Brown interior wood trim - Throughout MPR building                                                                                 |
| 12/20/2025 17:26 | 185    | X550-02401 |           | ppm       | Soil           | 240    | 0.01         | Tan interior plaster - Throughout MPR building                                                                                          |
| 12/20/2025 17:28 | 186    | X550-02401 |           | ppm       | Soil           | 600    | 0.01         | White interior wood doors/door frames/trim - Throughout MPR building                                                                    |
| 12/20/2025 17:40 | 191    | X550-02401 |           | ppm       | Soil           | 468    | 0.01         | White interior wood panels - Throughout stage inside MPR building                                                                       |
| 12/20/2025 17:45 | 192    | X550-02401 |           | ppm       | Soil           | 15,074 | 0.02         | White interior wood panels - Throughout Psych Room inside MPR building                                                                  |
| 12/20/2025 17:48 | 193    | X550-02401 |           | ppm       | Soil           | 597    | 0.01         | Blue exterior wood doors/door frames - Throughout permanent buildings                                                                   |
| 12/20/2025 17:52 | 194    | X550-02401 |           | ppm       | Soil           | 75,666 | 0.16         | Blue exterior metal round support columns - Throughout covered walkways                                                                 |
| 12/20/2025 17:55 | 195    | X550-02401 |           | ppm       | Soil           | 10,477 | 0.01         | Off-White exterior wooden structural components - Throughout permanent buildings/covered walkways                                       |
| 12/20/2025 18:00 | 197    | X550-02401 |           | ppm       | Soil           | 65     | 0.01         | Blue exterior metal doors/door frames/trim - Throughout portable buildings                                                              |
| 12/20/2025 18:10 | 200    | X550-02401 |           | ppm       | Soil           | 86     | 0.01         | Blue exterior metal hand rails - Throughout portable buildings                                                                          |
| 12/20/2025 18:34 | 203    | X550-02401 |           | ppm       | Soil           | 105    | 0.01         | Off-White exterior metal gutters/down spouts - Throughout portable buildings                                                            |
| 12/20/2025 18:38 | 204    | X550-02401 |           | ppm       | Soil           | 11,128 | 0.02         | Off-White/Gray exterior metal down spouts - Throughout permanent buildings                                                              |
| 12/20/2025 18:43 | 207    | X550-02401 |           | ppm       | Soil           | 1,539  | 0.01         | Blue exterior metal down spouts - Throughout permanent buildings                                                                        |
| 12/20/2025 18:45 | 208    | X550-02401 |           | ppm       | Soil           | 73     | 0.01         | Blue exterior metal gutters - Throughout permanent buildings                                                                            |
| 12/20/2025 18:53 | 209    | X550-02401 |           | ppm       | Soil           | 97     | 0.01         | Blue exterior metal roof edge trim - Throughout permanent building/covered walkways                                                     |

**LEAD HAZARD EVALUATION REPORT****Section 1 — Date of Lead Hazard Evaluation** 12/20/2025**Section 2 — Type of Lead Hazard Evaluation (Check one box only)**☒ Lead Inspection ☐ Risk assessment ☐ Clearance Inspection ☐ Other (specify) \_\_\_\_\_**Section 3 — Structure Where Lead Hazard Evaluation Was Conducted**

|                                                     |                                                                                                                                                                                            |            |                                                                                                            |          |
|-----------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------------------------------------------------------------------------------------------------|----------|
| Address [number, street, apartment (if applicable)] |                                                                                                                                                                                            | City       | County                                                                                                     | Zip Code |
| 5420 Lowell Street                                  |                                                                                                                                                                                            | Sacramento | Sacramento                                                                                                 | 95820    |
| Construction date (year) of structure               | Type of structure                                                                                                                                                                          |            | Children living in structure?                                                                              |          |
| Unknown                                             | <input type="checkbox"/> Multi-unit building <input checked="" type="checkbox"/> School or daycare<br><input type="checkbox"/> Single family dwelling <input type="checkbox"/> Other _____ |            | <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No<br><input type="checkbox"/> Don't Know |          |

**Section 4 — Owner of Structure (if business/agency, list contact person)**

|                                                         |  |                  |            |
|---------------------------------------------------------|--|------------------|------------|
| Name                                                    |  | Telephone number |            |
| Sacramento City Unified School District (Chris Ralston) |  | (916) 395-3970   |            |
| Address [number, street, apartment (if applicable)]     |  | City             | State      |
| 425 1st Avenue                                          |  | Sacramento       | California |
|                                                         |  |                  | Zip Code   |
|                                                         |  |                  | 95818      |

**Section 5 — Results of Lead Hazard Evaluation (check all that apply)**

☐ No lead-based paint detected ☒ Intact lead-based paint detected ☐ Deteriorated lead-based paint detected  
☐ No lead hazards detected ☐ Lead-contaminated dust found ☐ Lead-contaminated soil found ☒ Other: intact lead containing paint detected

**Section 6 — Individual Conducting Lead Hazard Evaluation**

|                                                     |                                                                                      |                  |           |
|-----------------------------------------------------|--------------------------------------------------------------------------------------|------------------|-----------|
| Name                                                |                                                                                      | Telephone number |           |
| Entek Consulting Group, Inc. - Jose Hernandez       |                                                                                      | (916) 632-6800   |           |
| Address [number, street, apartment (if applicable)] |                                                                                      | City             | State     |
| 3435 American River Drive, Suite C                  |                                                                                      | Sacramento       | CA        |
|                                                     |                                                                                      |                  | Zip Code  |
|                                                     |                                                                                      |                  | 95864     |
| CDPH certification number                           | Signature                                                                            |                  | Date      |
| 10754                                               |  |                  | 1/15/2026 |

Name and CDPH certification number of any other individuals conducting sampling or testing (if applicable)

N/A

**Section 7 — Attachments**

- A. A foundation diagram or sketch of the structure indicating the specific locations of each lead hazard or presence of lead-based paint;
- B. Each testing method, device, and sampling procedure used;
- C. All data collected, including quality control data, laboratory results, including laboratory name, address, and phone number.

First copy and attachments retained by inspector

Second copy and attachments retained by owner

Third copy only (no attachments) mailed or faxed to:

California Department of Public Health  
Childhood Lead Poisoning Prevention Branch Reports  
850 Marina Bay Parkway, Building P, Third Floor  
Richmond, CA 94804-6403  
Fax: (510) 620-5656

## **APPENDIX C**

### **BACK UP DOCUMENTS**

- Site Map
- Inspector Accreditations and Certifications
- Laboratory Accreditations for Asbestos and Lead Analysis



Sacramento City Unified School District  
Earl Warren Elementary School  
5420 Lowell Street  
Sacramento, CA 95820

Entek Consulting Group, Inc.  
3435 American River Dr, Ste C  
Sacramento, CA 95864  
Map Not to Scale

Site Map  
Project Number 25-7963

State of California  
Division of Occupational Safety and Health  
**Certified Asbestos Consultant**  
**Jose A Hernandez**




Name

Certification No. **22-6995**

Expires on **1/21/2026**

This certification was issued by the Division of Occupational Safety and Health as authorized by Sections 7180 et seq of the Business and Professions Code.

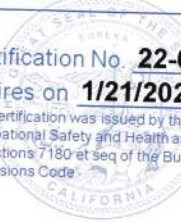



STATE OF CALIFORNIA  
DEPARTMENT OF PUBLIC HEALTH



## LEAD-RELATED CONSTRUCTION CERTIFICATE

INDIVIDUAL:



**Jose Hernandez**

CERTIFICATE TYPE:

Lead Inspector/Assessor

NUMBER:

LRC-00010754

EXPIRATION DATE:

1/9/2026

Disclaimer: This document alone should not be relied upon to confirm certification status. Compare the individual's photo and name to another valid form of government issued photo identification. Verify the individual's certification status by searching for Lead-Related Construction Professionals at [www.cdph.ca.gov/programs/clppb](http://www.cdph.ca.gov/programs/clppb) or calling (800) 597-LEAD

State of California  
Division of Occupational Safety and Health  
**Certified Site Surveillance Technician**

**Mathew K Watson**



Name

Certification No. **24-7753**

Expires on **09/20/2026**

This certification was issued by the Division of Occupational Safety and Health as authorized by Sections 7180 et seq of the Business and Professions Code



STATE OF CALIFORNIA  
DEPARTMENT OF PUBLIC HEALTH



## LEAD-RELATED CONSTRUCTION CERTIFICATE

**INDIVIDUAL:**



**Mathew Watson**

**CERTIFICATE TYPE:**

Lead Inspector/Assessor

Lead Sampling Technician

**NUMBER:**

LRC-00014775

LRC-00012700

**EXPIRATION DATE:**

10/9/2026

4/26/2026

Disclaimer: This document alone should not be relied upon to confirm certification status. Compare the individual's photo and name to another valid form of government issued photo identification. Verify the individual's certification status by searching for Lead-Related Construction Professionals at [www.cdph.ca.gov/programs/clpph](http://www.cdph.ca.gov/programs/clpph) or calling (800) 597-LEAD

State of California  
Division of Occupational Safety and Health  
**Certified Site Surveillance Technician**  
**Khaiianne R. Peters**



Name

Certification No. **23-7401**

Expires on **07/21/2026**

This certification was issued by the Division of Occupational Safety and Health as authorized by Sections 7180 et seq of the Business and Professions Code.





STATE OF CALIFORNIA  
DEPARTMENT OF PUBLIC HEALTH



# LEAD-RELATED CONSTRUCTION CERTIFICATE

INDIVIDUAL:



**Khaianne Peters**

CERTIFICATE TYPE:

Lead Sampling Technician

NUMBER:

LRC-00010496

EXPIRATION DATE:

10/12/2026



Disclaimer: This document alone should not be relied upon to confirm certification status. Compare the individual's photo and name to another valid form of government issued photo identification. Verify the individual's certification status by searching for Lead-Related Construction Professionals at [www.cdph.ca.gov/programs/clppb](http://www.cdph.ca.gov/programs/clppb) or calling (800) 597-LEAD

United States Department of Commerce  
National Institute of Standards and Technology



---

## Certificate of Accreditation to ISO/IEC 17025:2017

---

NVLAP LAB CODE: 600397-0

**Eurofins Built Environment Testing West- Sacramento, CA**  
Folsom, CA

*is accredited by the National Voluntary Laboratory Accreditation Program for specific services,  
listed on the Scope of Accreditation, for:*

### **Asbestos Fiber Analysis**

*This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2017.  
This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality  
management system (refer to joint ISO-ILAC-IAF Communiqué on ISO/IEC 17025).*

---

2025-10-01 through 2026-09-30

*Effective Dates*



A handwritten signature in blue ink, appearing to read "R. K. Knech".

---

*For the National Voluntary Laboratory Accreditation Program*

**SCOPE OF ACCREDITATION TO ISO/IEC 17025:2017**

**Eurofins Built Environment Testing West- Sacramento, CA**

180 Blue Ravine Road

Folsom, CA 95630

Kuan W. Chen

Phone: 415-377-0751

Email: [kuan.chen@et.eurofinsus.com](mailto:kuan.chen@et.eurofinsus.com)

<http://www.emlab.com>

**ASBESTOS FIBER ANALYSIS**

**NVLAP LAB CODE 600397-0**

**Bulk Asbestos Analysis**

**Code**


**Description**

18/A01

EPA -- 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples

18/A03

EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials

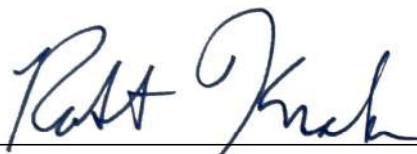

*For the National Voluntary Laboratory Accreditation Program*

United States Department of Commerce  
National Institute of Standards and Technology



---

## Certificate of Accreditation to ISO/IEC 17025:2017

---

NVLAP LAB CODE: 200728-0

**Eurofins Built Environment Testing West- San Francisco, CA**  
Burlingame, CA

*is accredited by the National Voluntary Laboratory Accreditation Program for specific services,  
listed on the Scope of Accreditation, for:*

### **Asbestos Fiber Analysis**

*This laboratory is accredited in accordance with the recognized International Standard ISO/IEC 17025:2017.  
This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory quality  
management system (refer to joint ISO-ILAC-IAF Communiqué on ISO/IEC 17025).*

---

2025-07-01 through 2026-06-30

*Effective Dates*



A handwritten signature in blue ink, appearing to read "R. K. Knech".

---

*For the National Voluntary Laboratory Accreditation Program*

**SCOPE OF ACCREDITATION TO ISO/IEC 17025:2017**

**Eurofins Built Environment Testing West- San Francisco, CA**

111 Anza Boulevard

Suite 122

Burlingame, CA 94010

Kuan W. Chen

Phone: 415-377-0751

Email: kuan.chen@et.eurofinsus.com

<https://www.eurofinsus.com/environment-testing/built-environment>

**ASBESTOS FIBER ANALYSIS**

**NVLAP LAB CODE 200728-0**

**Bulk Asbestos Analysis**

**Code**


**Description**

18/A01

EPA -- 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples

18/A03

EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials

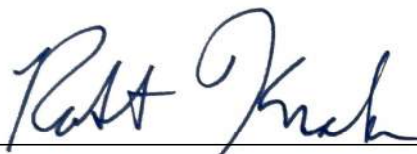

*For the National Voluntary Laboratory Accreditation Program*



**AIHA Laboratory Accreditation Programs, LLC**  
*acknowledges that*  
**Eurofins Built Environment Testing West- Tustin, CA**  
**Eurofins Built Environment Testing West, LLC**  
**2841 Dow Ave Suite 300 Tustin, CA 92780**  
**Laboratory ID: LAP-178697**

along with all premises from which key activities are performed, as listed above, has fulfilled the requirements of the AIHA Laboratory Accreditation Programs, LLC (AIHA LAP) accreditation to the ISO/IEC 17025:2017 international standard, General Requirements for the Competence of Testing and Calibration Laboratories in the following:

**LABORATORY ACCREDITATION PROGRAMS**

|                                     |                                   |                                          |
|-------------------------------------|-----------------------------------|------------------------------------------|
| <input checked="" type="checkbox"/> | <b>INDUSTRIAL HYGIENE</b>         | Accreditation Expires: February 01, 2026 |
| <input checked="" type="checkbox"/> | <b>ENVIRONMENTAL LEAD</b>         | Accreditation Expires: February 01, 2026 |
| <input checked="" type="checkbox"/> | <b>ENVIRONMENTAL MICROBIOLOGY</b> | Accreditation Expires: February 01, 2026 |
| <input type="checkbox"/>            | <b>FOOD</b>                       | Accreditation Expires:                   |
| <input type="checkbox"/>            | <b>UNIQUE SCOPES</b>              | Accreditation Expires:                   |
| <input type="checkbox"/>            | <b>BE FIELD/MOBILE</b>            | Accreditation Expires:                   |

Specific Field(s) of Testing/Method(s) within each Accreditation Program for which the above named laboratory maintains accreditation is outlined on the attached Scope of Accreditation. Continued accreditation is contingent upon successful on-going compliance with ISO/IEC 17025:2017 and AIHA LAP requirements. This certificate is not valid without the attached Scope of Accreditation. Please review the AIHA LAP website ([www.aihaaccreditedlabs.org](http://www.aihaaccreditedlabs.org)) for the most current Scope.

A handwritten signature in black ink that reads 'Cheryl O. Morton'.

Cheryl O Morton  
Executive Director, AIHA Laboratory Accreditation Programs, LLC



## AIHA Laboratory Accreditation Programs, LLC

### SCOPE OF ACCREDITATION

**Eurofins Built Environment Testing**  
**West- Tustin, CA**  
**Eurofins Built Environment Testing**  
**West, LLC**  
2841 Dow Ave Suite 300 Tustin, CA 92780

Laboratory ID: LAP-178697

Issue Date: 01/07/2025

Expire Date: 02/01/2026

The laboratory is approved for those specific field(s) of testing/methods listed in the table below. Clients are urged to verify the laboratory's current accreditation status for the particular field(s) of testing/Methods, since these can change due to proficiency status, suspension and/or withdrawal of accreditation.

The EPA recognizes the AIHA LAP, LLC ELLAP program as meeting the requirements of the National Lead Laboratory Accreditation Program (NLLAP) established under Title X of the Residential Lead-Based Paint Hazard Reduction Act of 1992 and includes paint, soil and dust wipe analysis. Air and composited wipes analyses are not included as part of the NLLAP.

### Environmental Lead Laboratory Accreditation Program (ELLAP)

**Initial Accreditation Date: 03/01/2017**

| Component, parameter, characteristic, material, or product tested | Technology sub-type/Detector | Method                    | Method Description<br>(for internal methods only) |
|-------------------------------------------------------------------|------------------------------|---------------------------|---------------------------------------------------|
| Paint                                                             | AA                           | EPA SW-846 7000B Modified | N/A                                               |
|                                                                   |                              | NIOSH 7082                | N/A                                               |
| Settled Dust by Wipe                                              | AA                           | EPA SW-846 7000B Modified | N/A                                               |
|                                                                   |                              | NIOSH 7082                | N/A                                               |

A complete listing of currently accredited ELLAP laboratories is available on the AIHA LAP, LLC website at:  
<http://www.aihaaccreditedlabs.org>